



CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

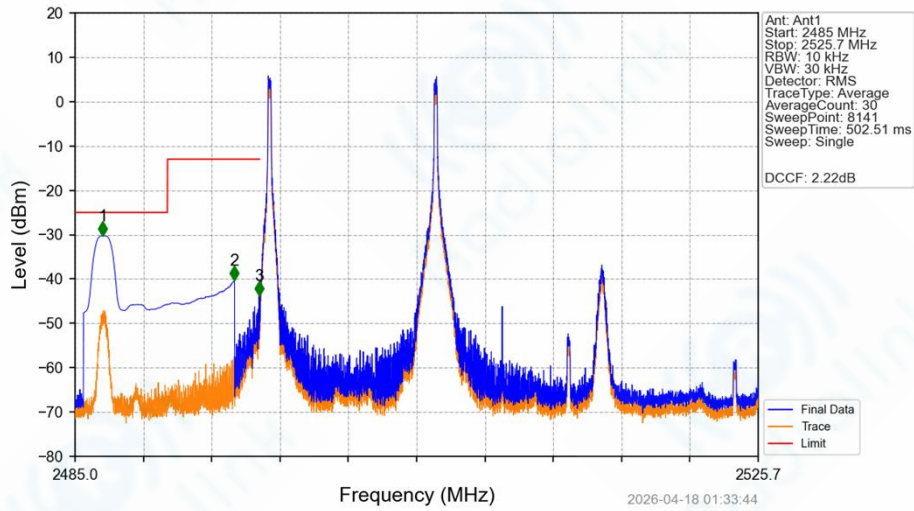

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

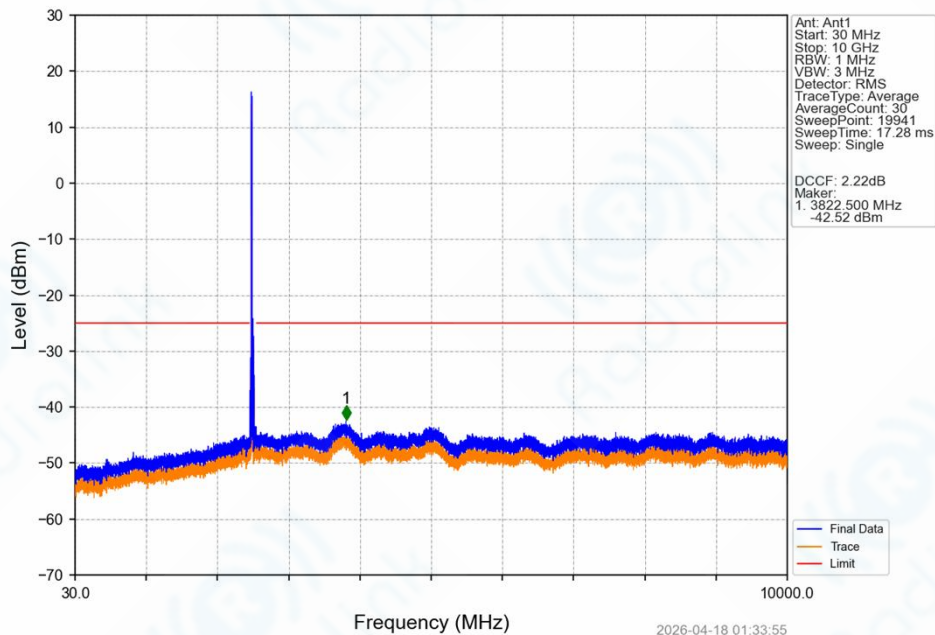


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

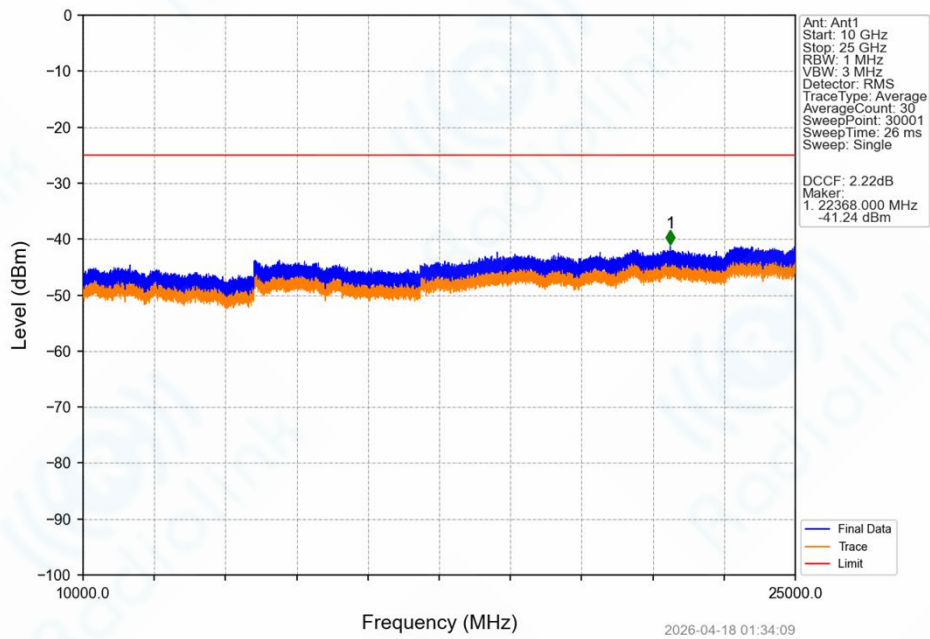

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 1@0 CC2: 1@0

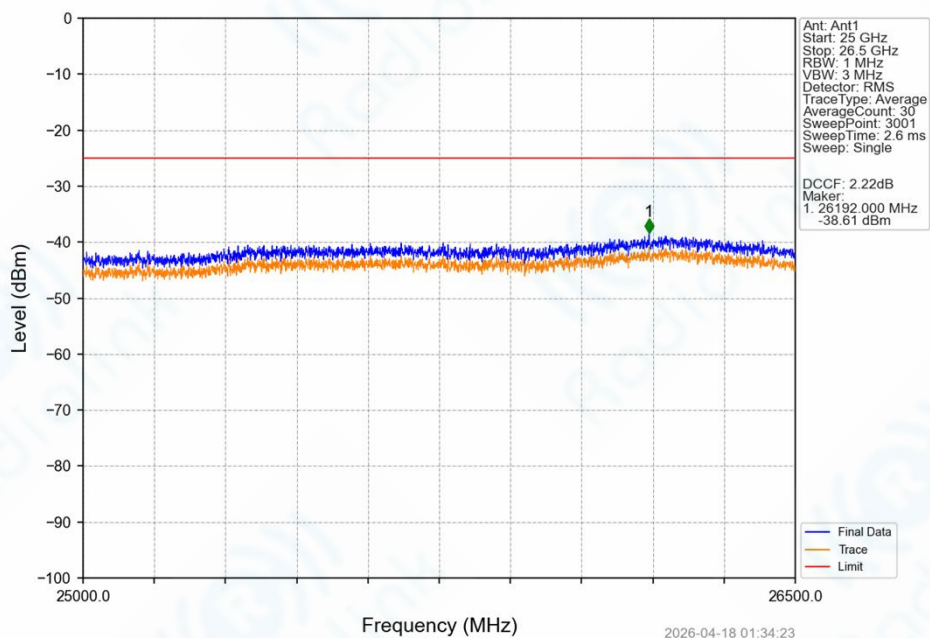


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

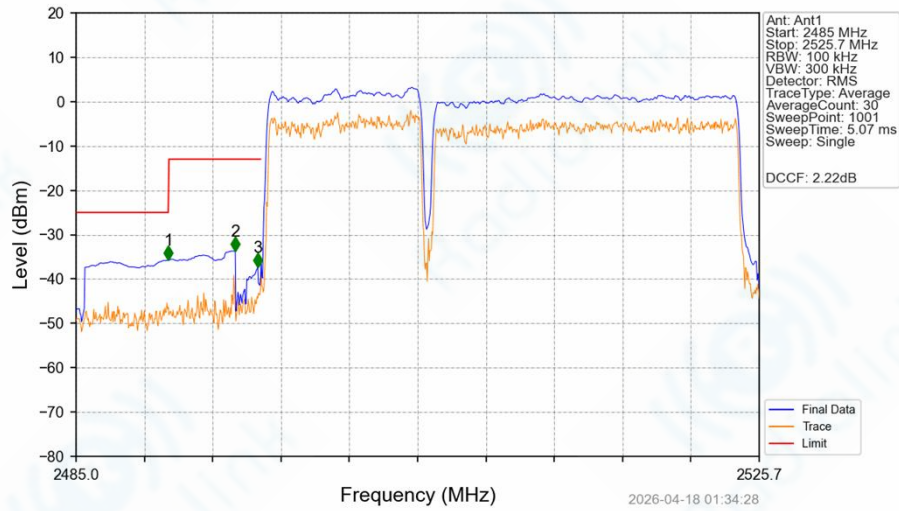

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2485	2490.5	1	CHP	1	2490.494	-35.76	-25	Pass
2490.5	2495	1	CHP	2	2494.483	-33.63	-13	Pass
2495	2496	0.292	CHP	3	2495.826	-37.38	-13	Pass
2496	2525.7	0.292	CHP	/	/	/	/	/


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

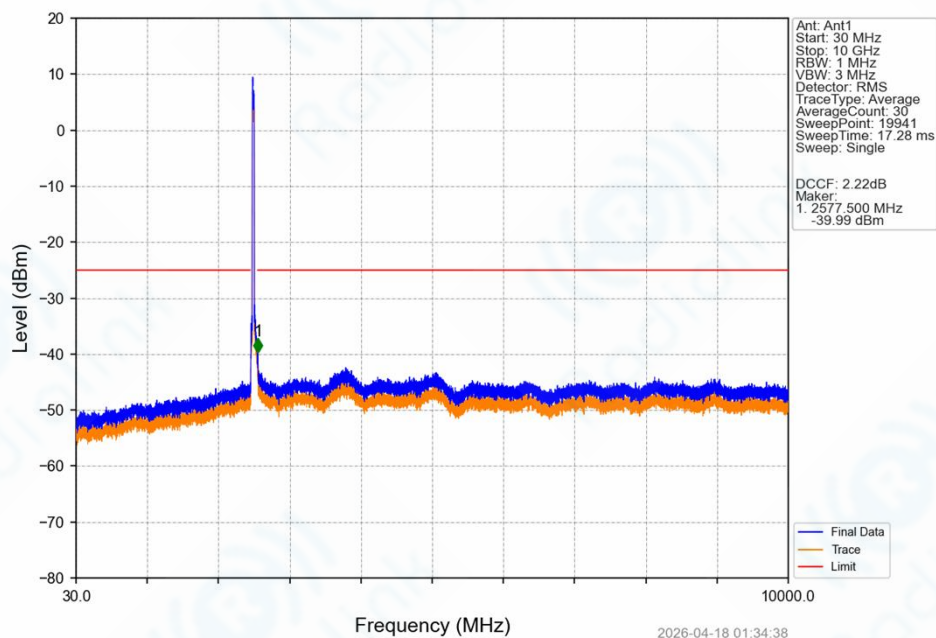


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

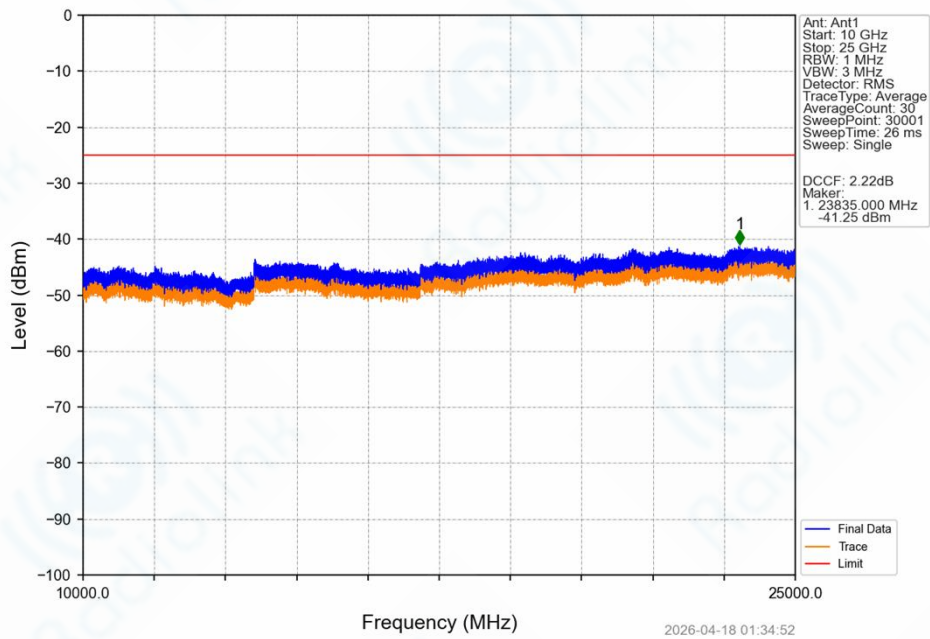

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2501 CC2:2515.4MHz_CC1: 50@0 CC2: 100@0

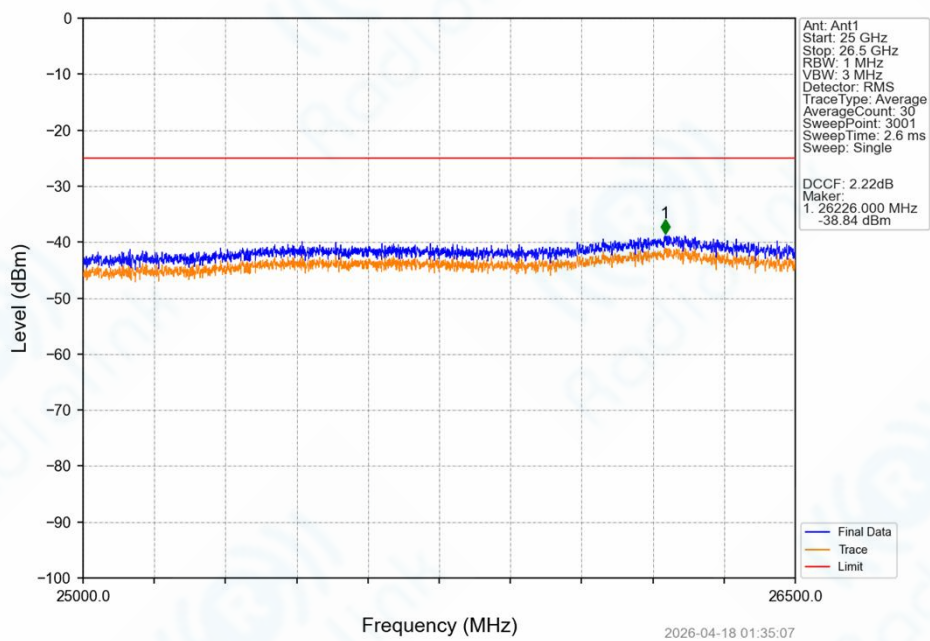


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2:
1@0

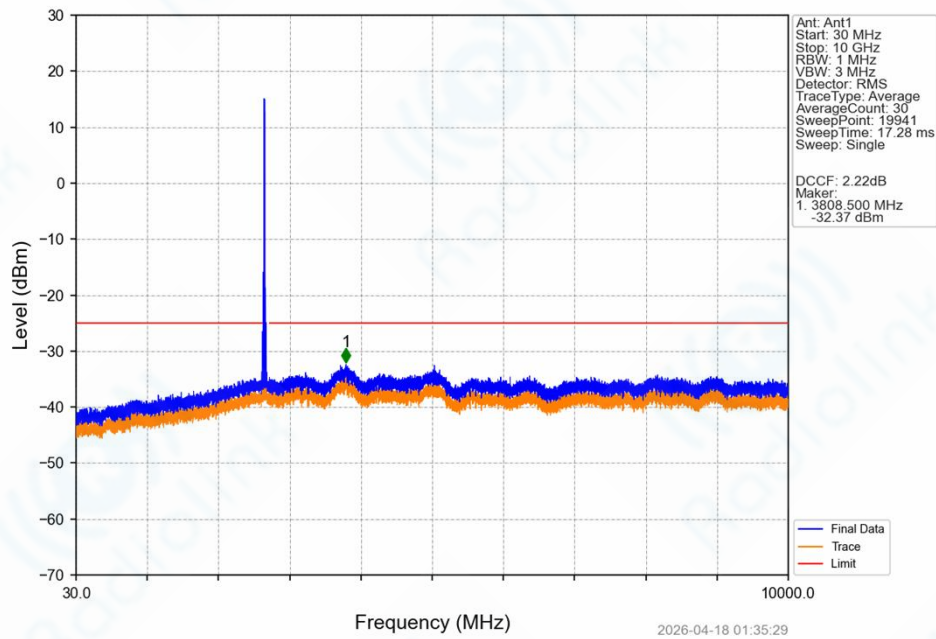


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2:
1@0

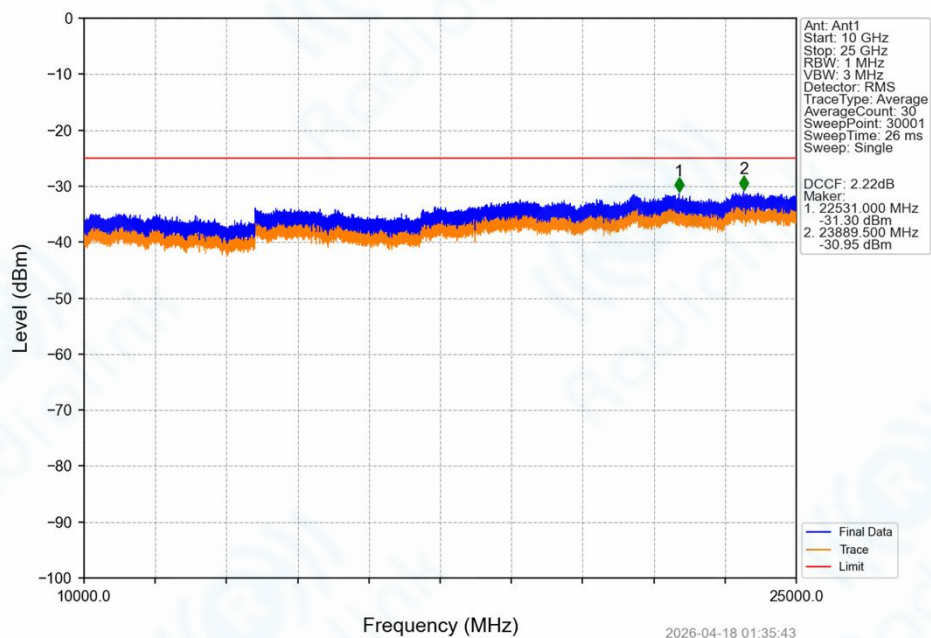

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@0 CC2: 1@0

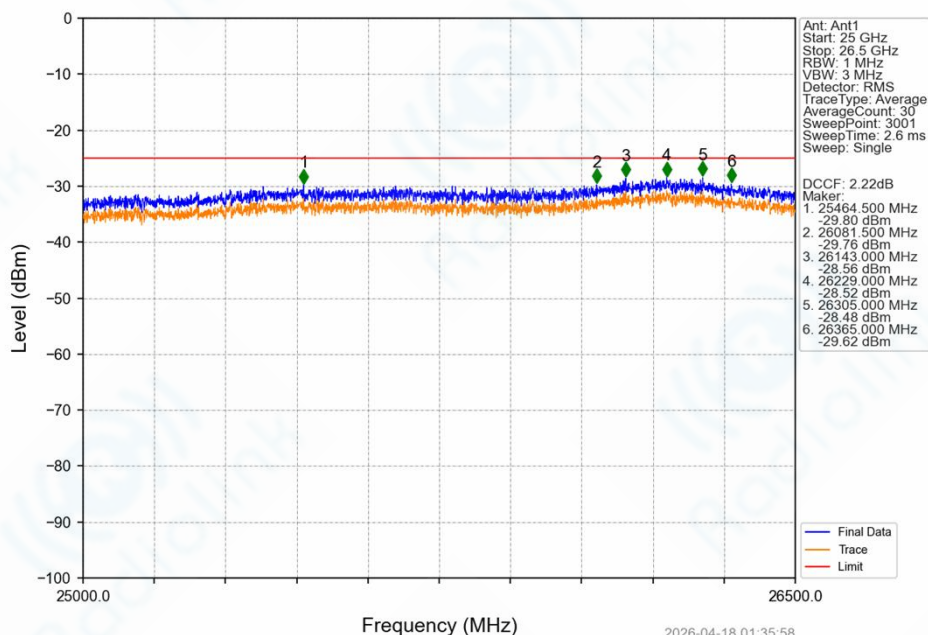

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 1@49 CC2: 1@99

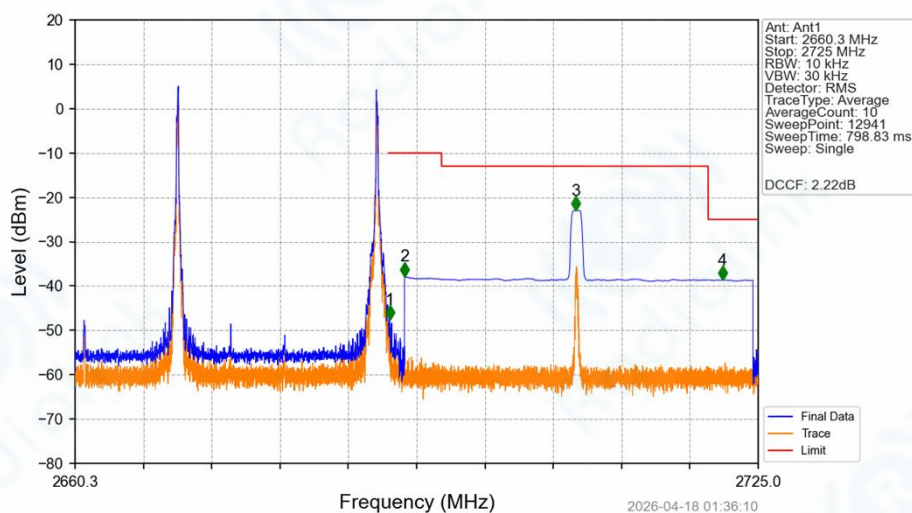


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2660.3	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.095	-47.57	-10	Pass
2691	2695	1	CHP	2	2691.500	-37.78	-10	Pass
2695	2720.256	1	CHP	3	2707.720	-22.96	-13	Pass
2720.256	2725	1	CHP	4	2721.600	-38.58	-25	Pass


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

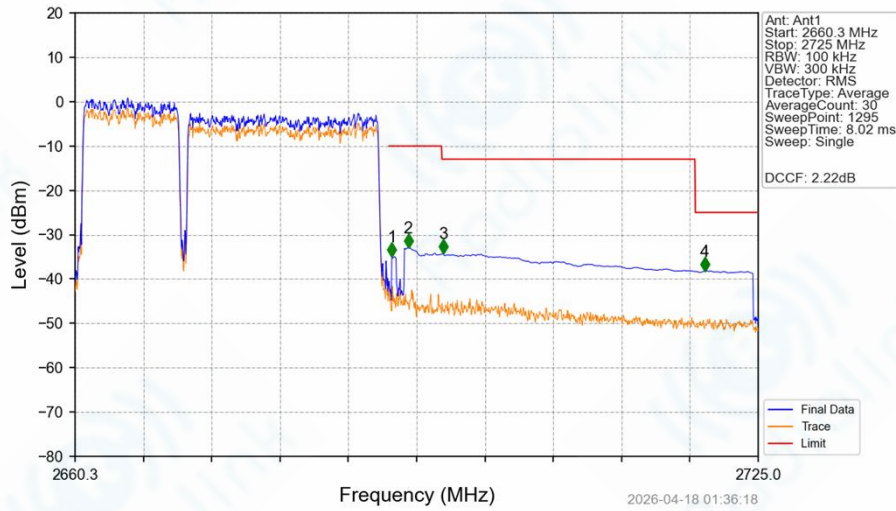

CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2: 100@0

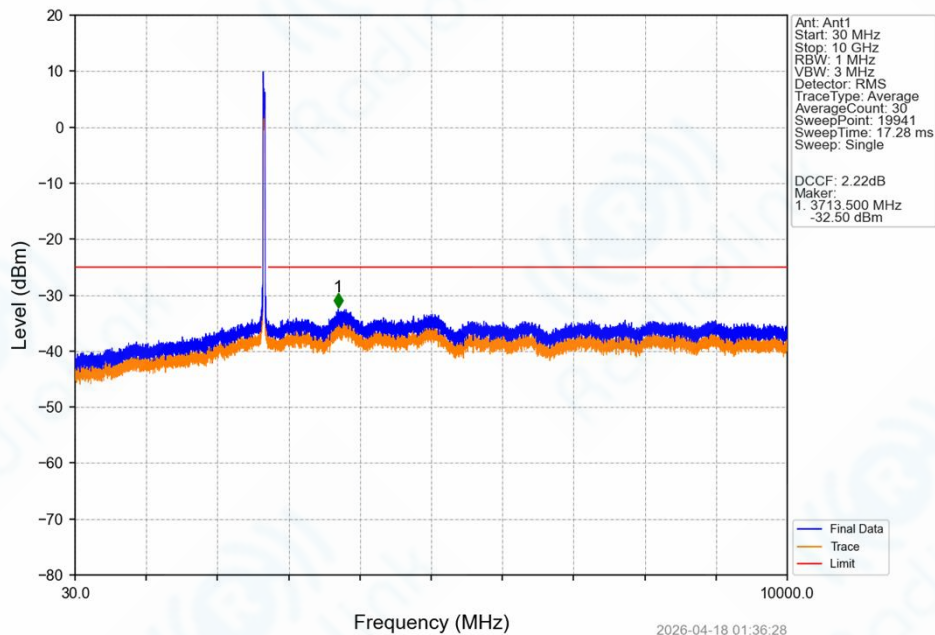


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2:
100@0

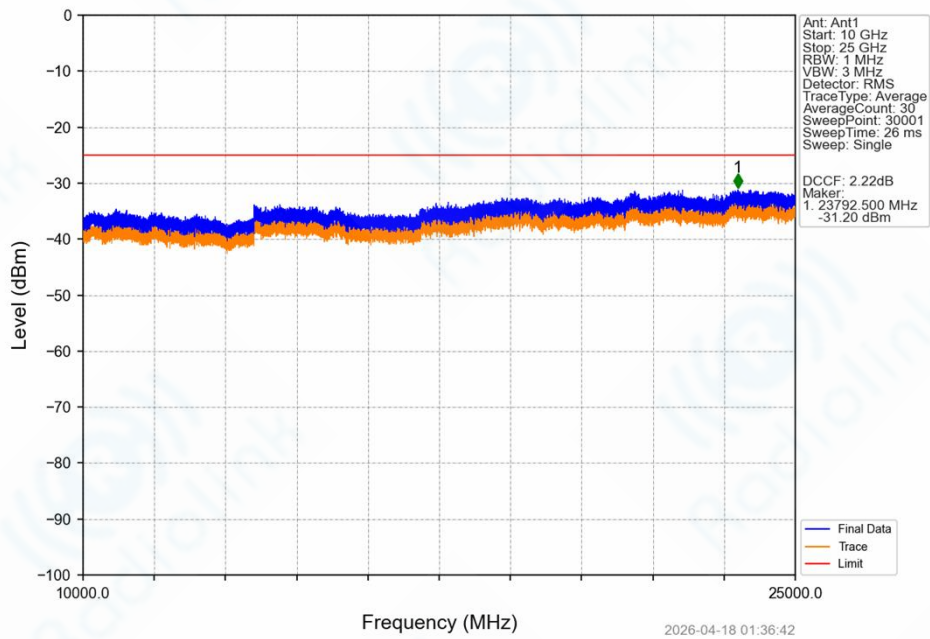


CA_41C_SISO_NTNV_CC1:10 CC2:20MHz_CC1:64QAM CC2:64QAM_CC1:2665.6 CC2:2680MHz_CC1: 50@0 CC2:
100@0

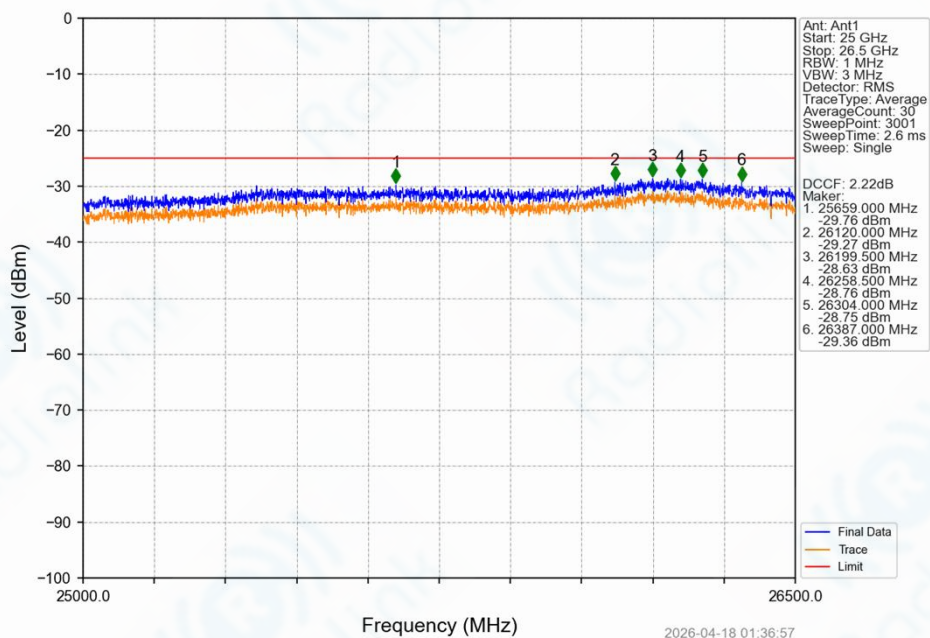

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

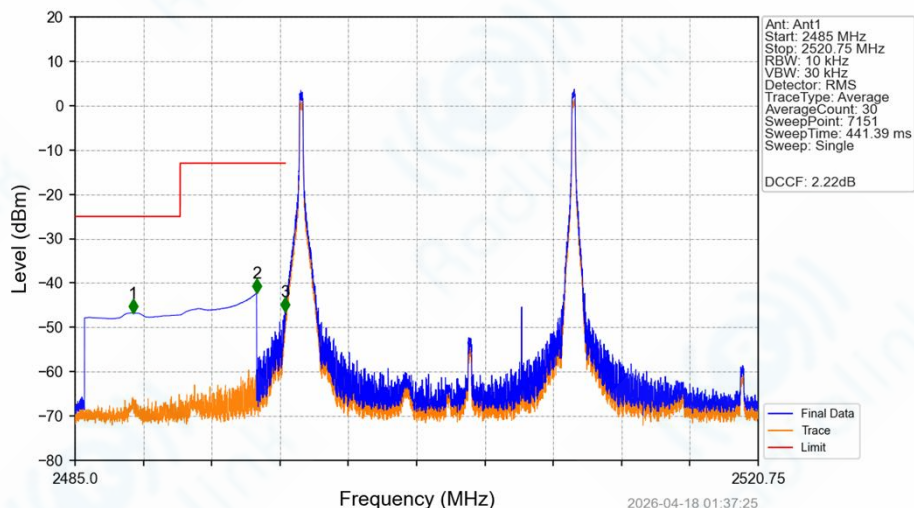


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

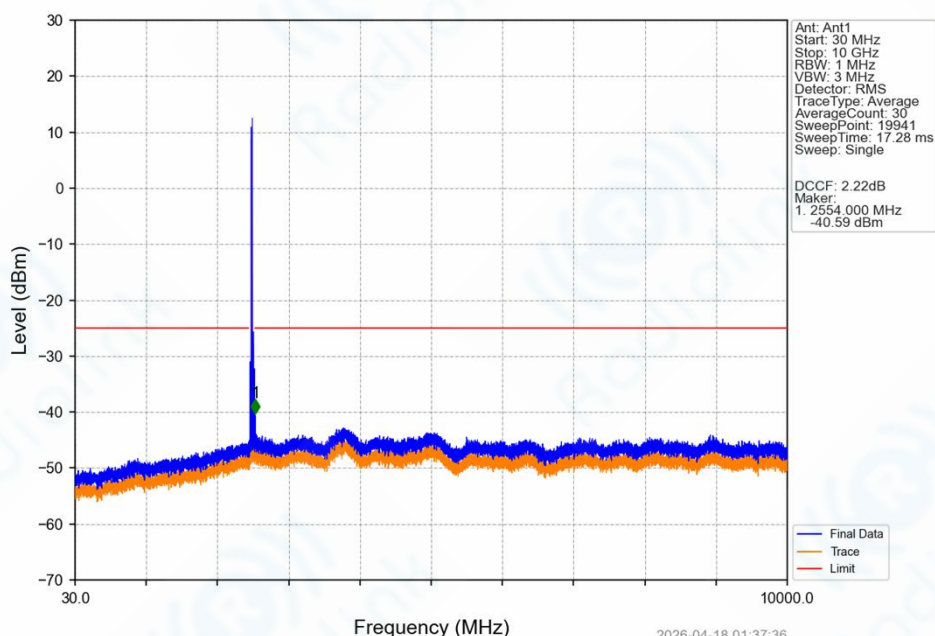


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

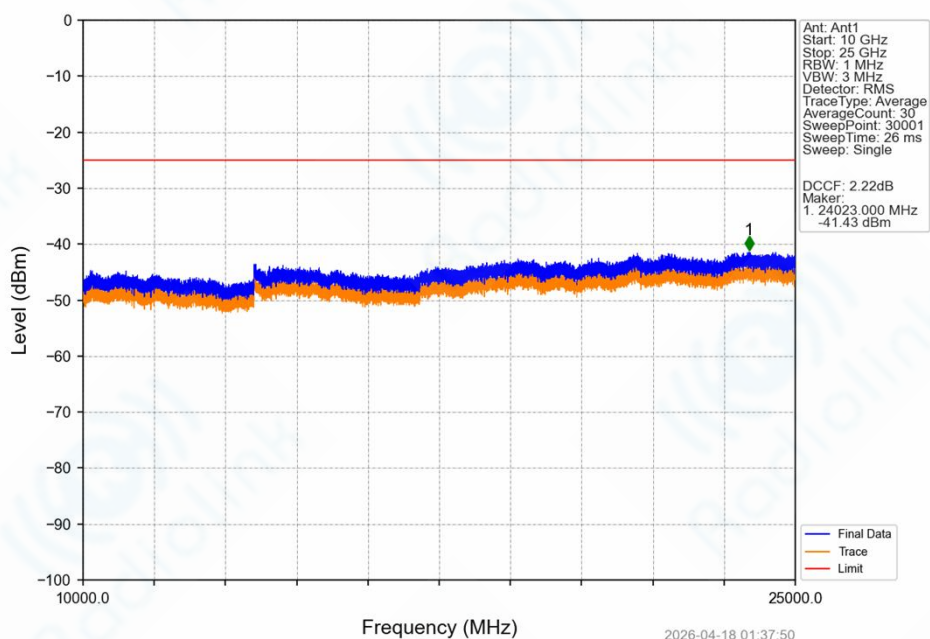


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

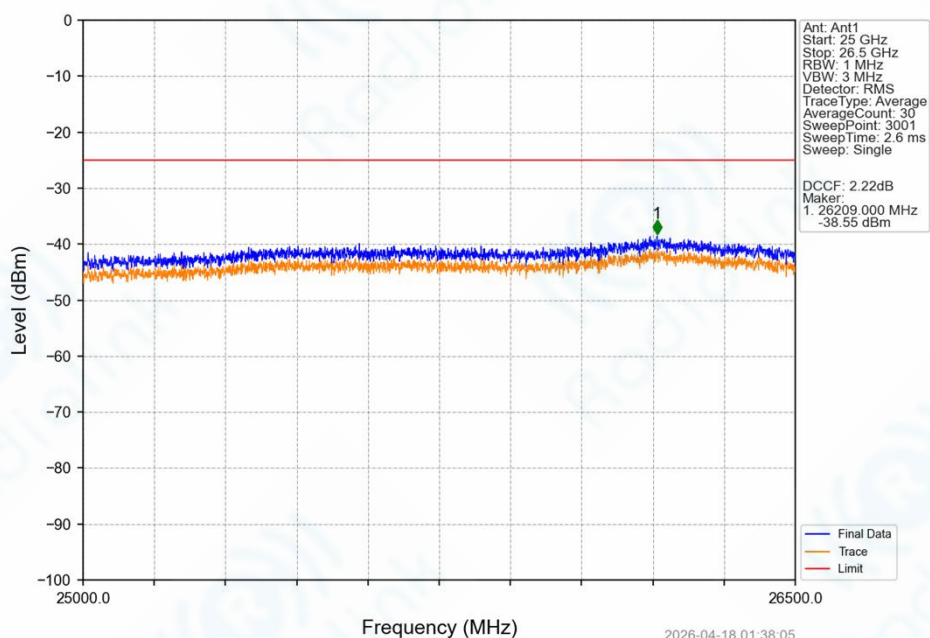


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

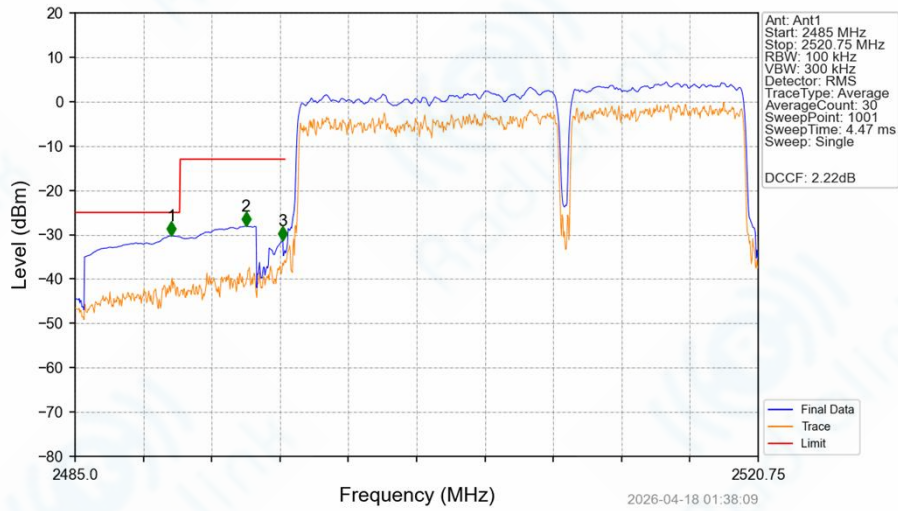


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

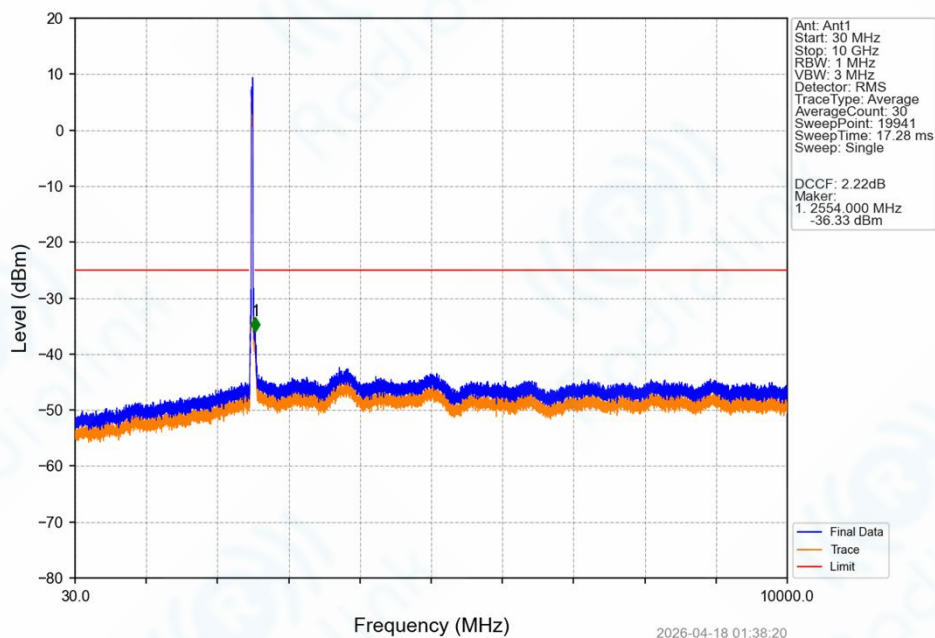


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

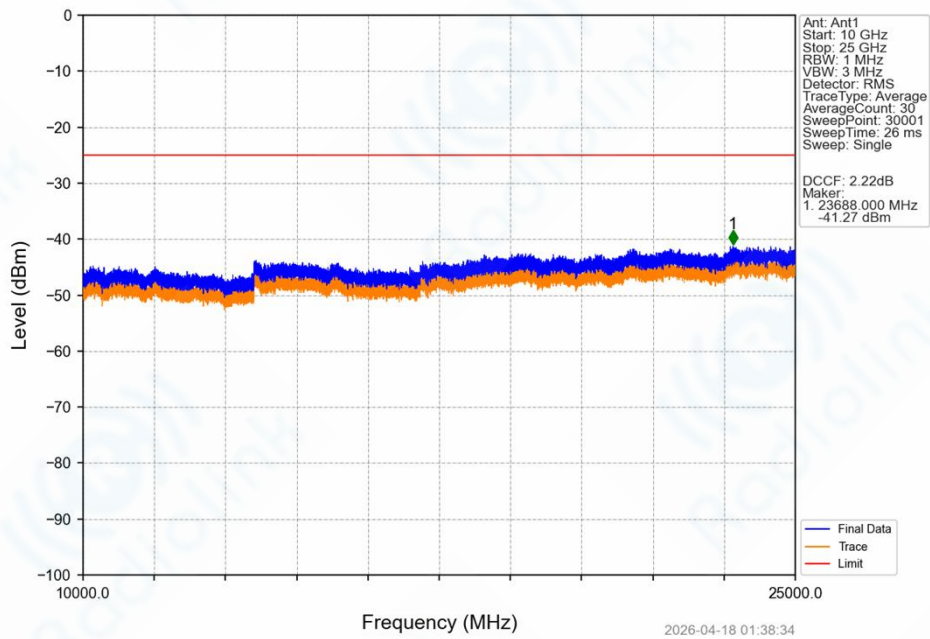


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

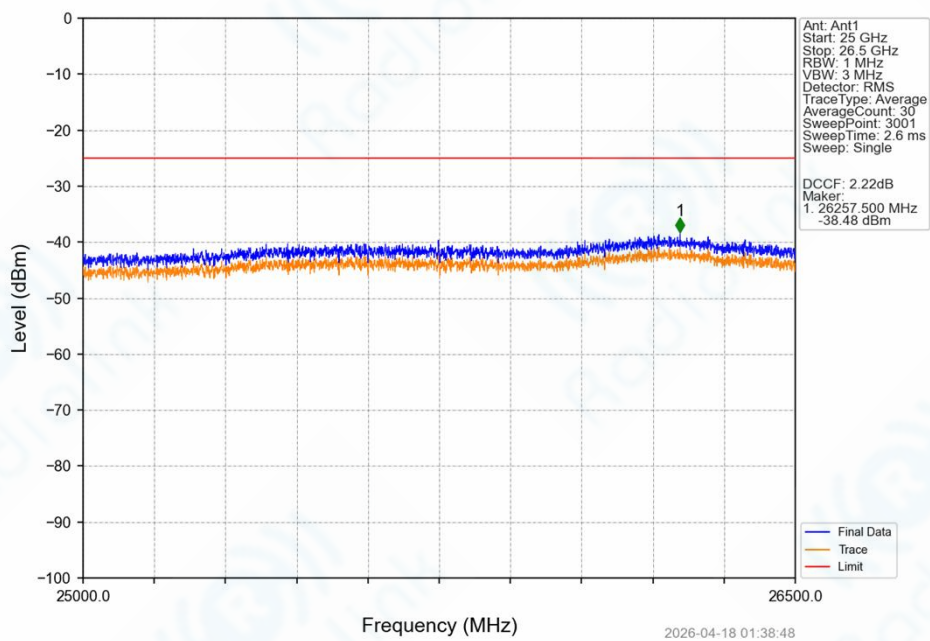


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 1@0 CC2: 1@0

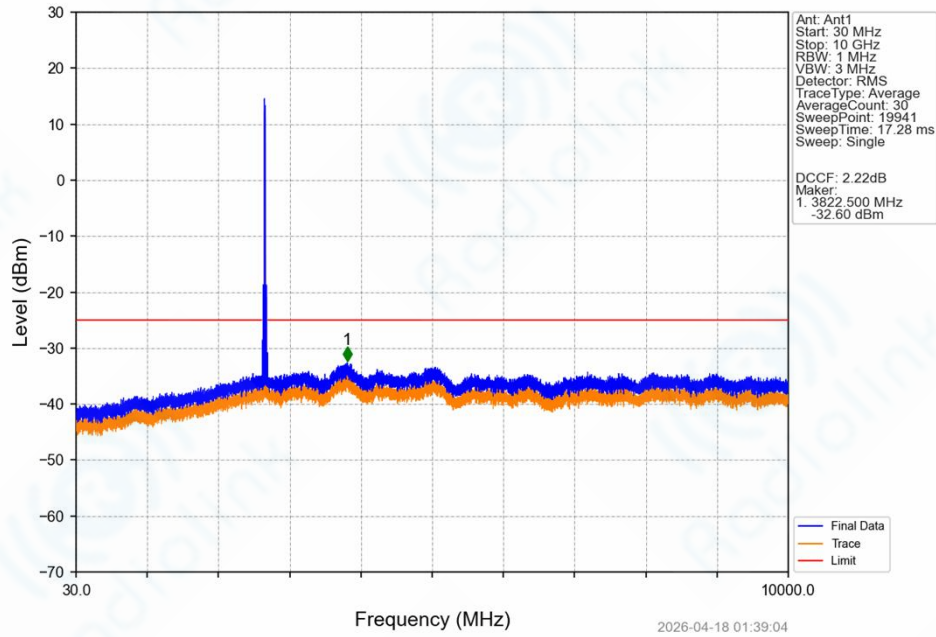

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 1@0 CC2: 1@0

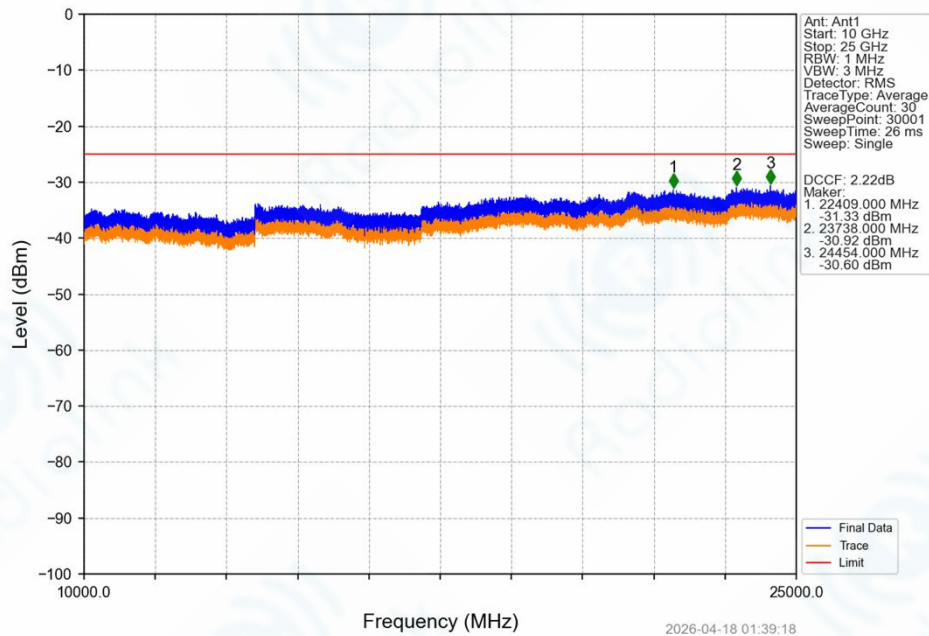


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 1@0_CC2: 1@0

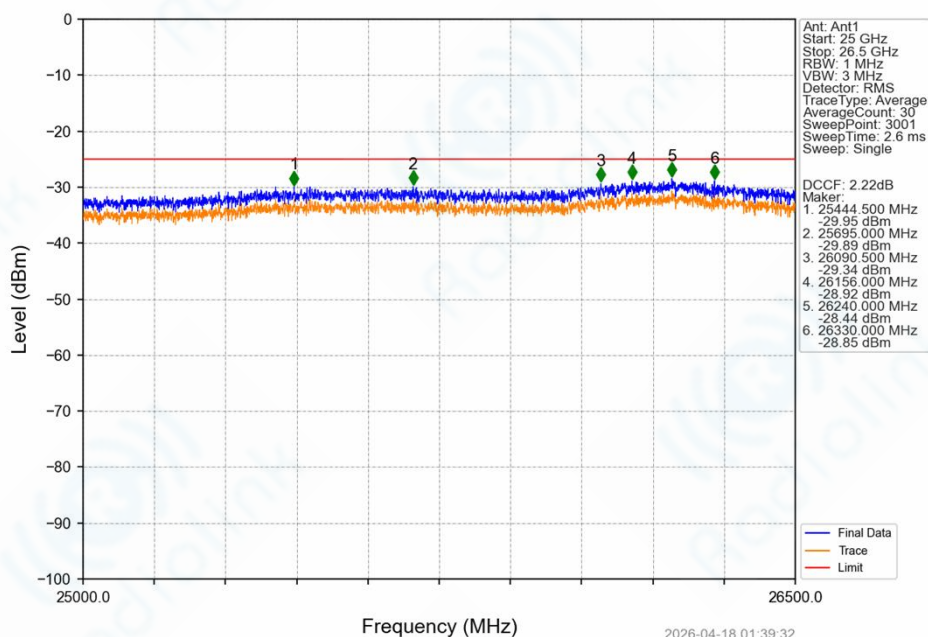

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 1@74_CC2: 1@49

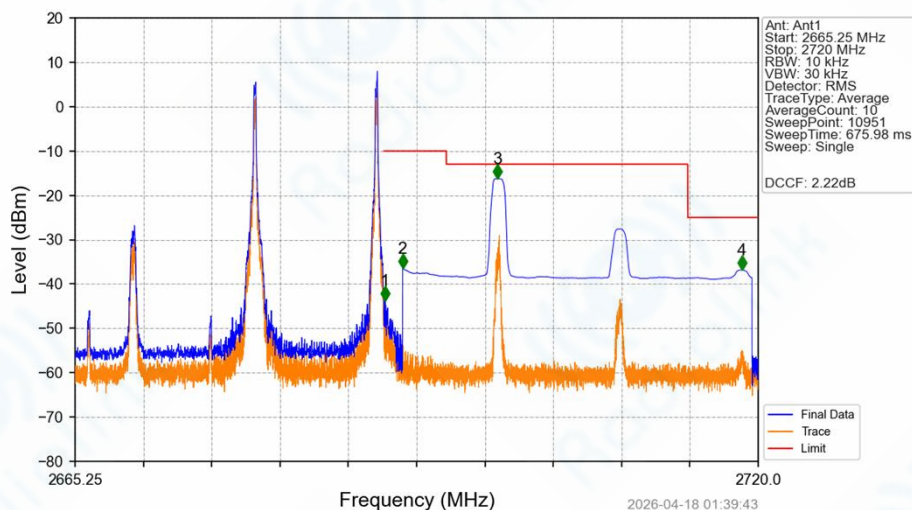


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.095	-43.71	-10	Pass
2691	2695	1	CHP	2	2691.500	-36.40	-10	Pass
2695	2714.353	1	CHP	3	2699.115	-16.26	-13	Pass
2714.353	2720	1	CHP	4	2718.705	-36.81	-25	Pass

Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

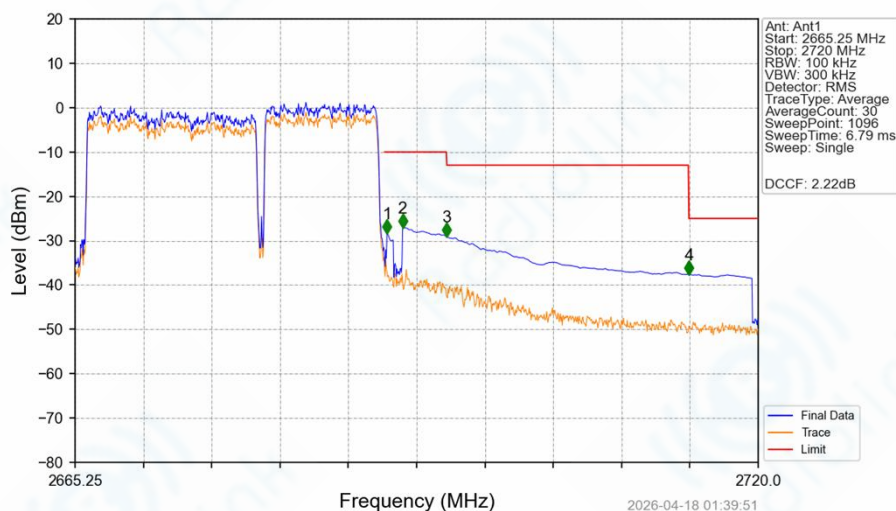

Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.1	/	/	/	/	/	/
2690	2691	0.489	CHP	1	2690.250	-28.37	-10	Pass
2691	2695	1	CHP	2	2691.500	-27.07	-10	Pass
2695	2714.428	1	CHP	3	2695.050	-29.17	-13	Pass
2714.428	2720	1	CHP	4	2714.450	-37.61	-25	Pass


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:QPSK CC2:QPSK_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

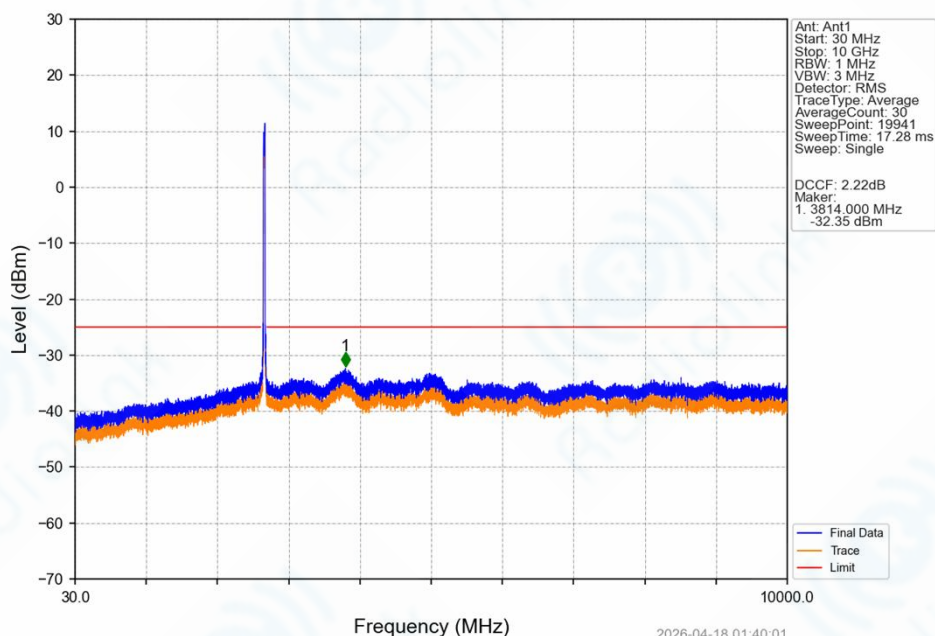


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 75@0_CC2: 50@0

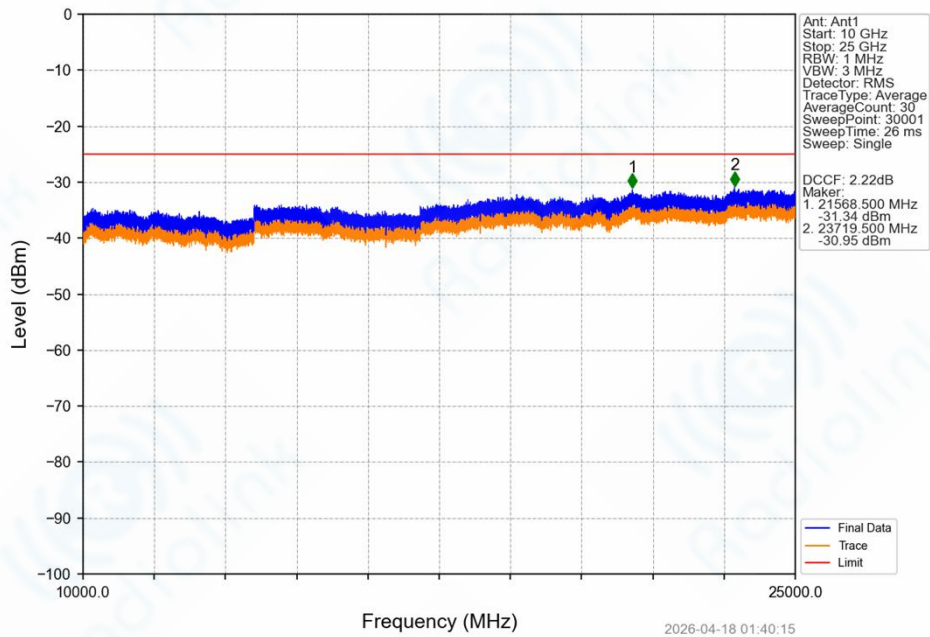


CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:QPSK_CC2:QPSK_CC1:2673_CC2:2685MHz_CC1: 75@0_CC2: 50@0

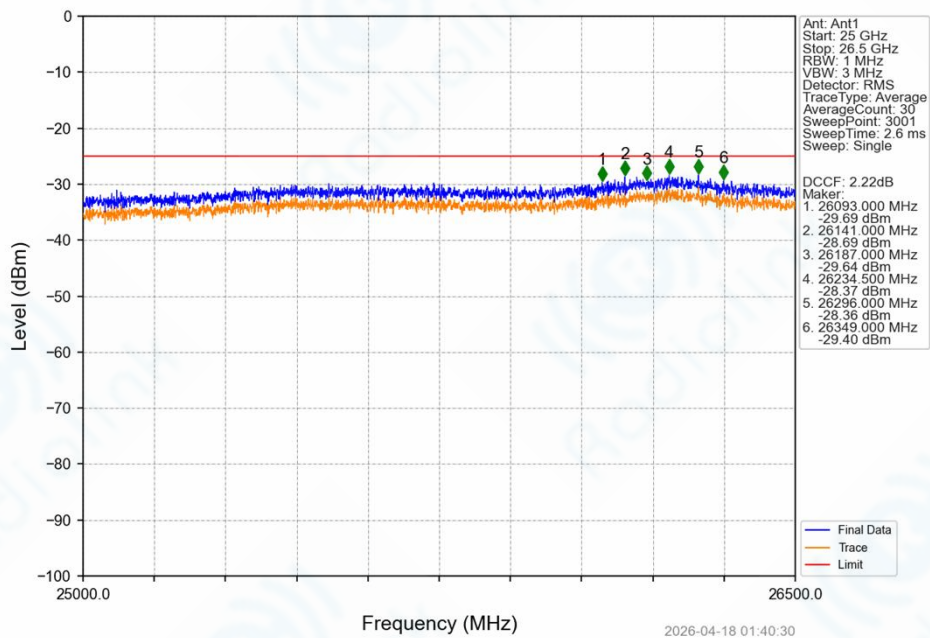


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

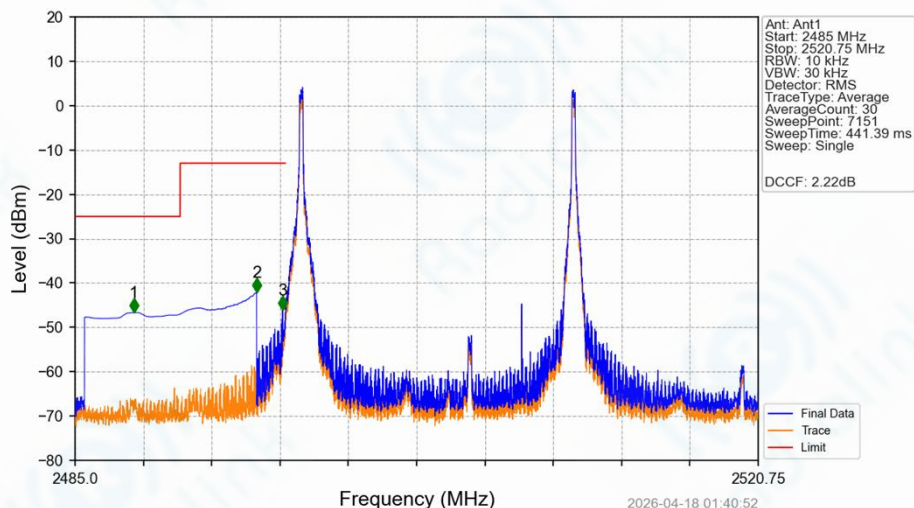


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

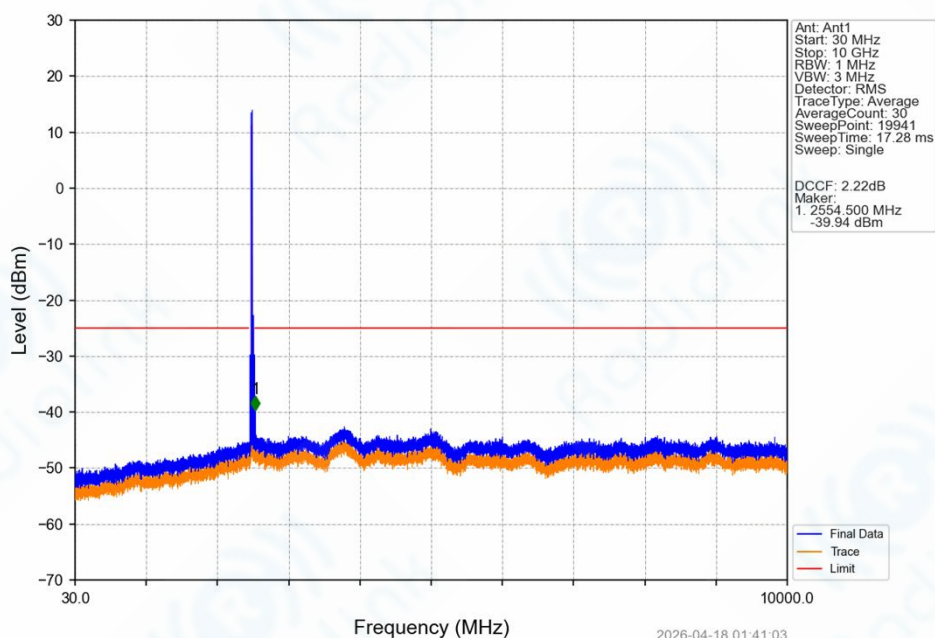


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

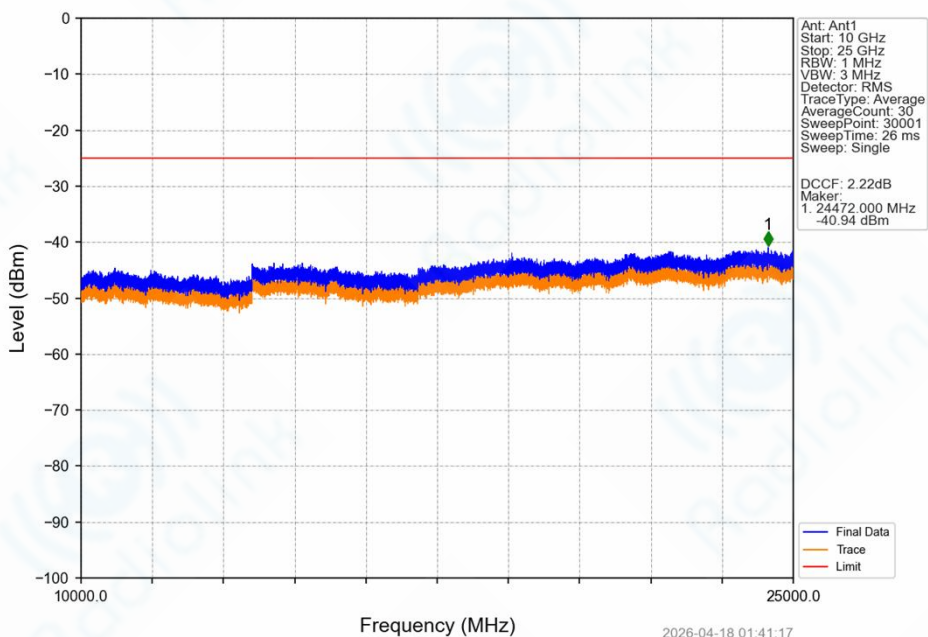


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

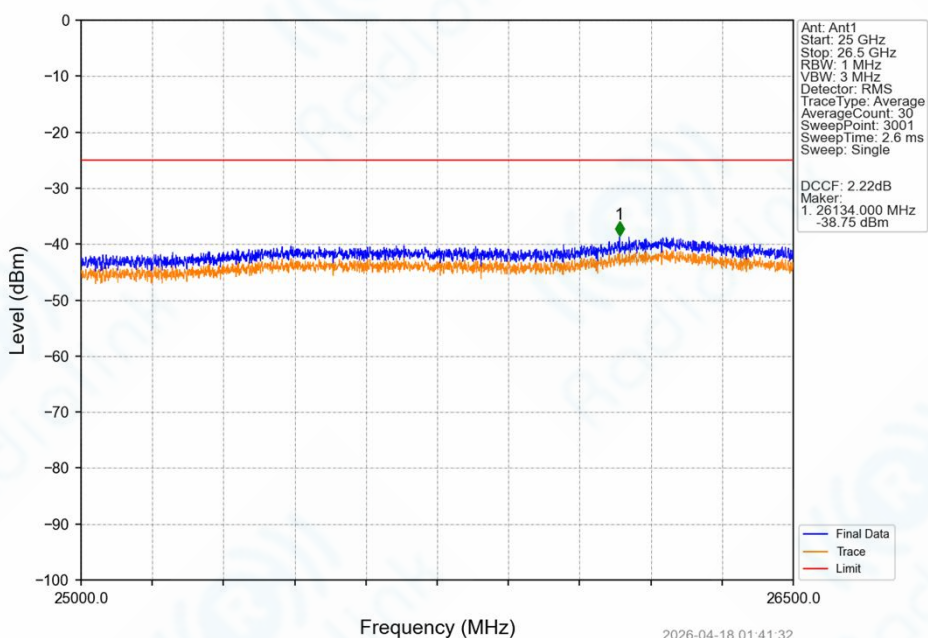


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

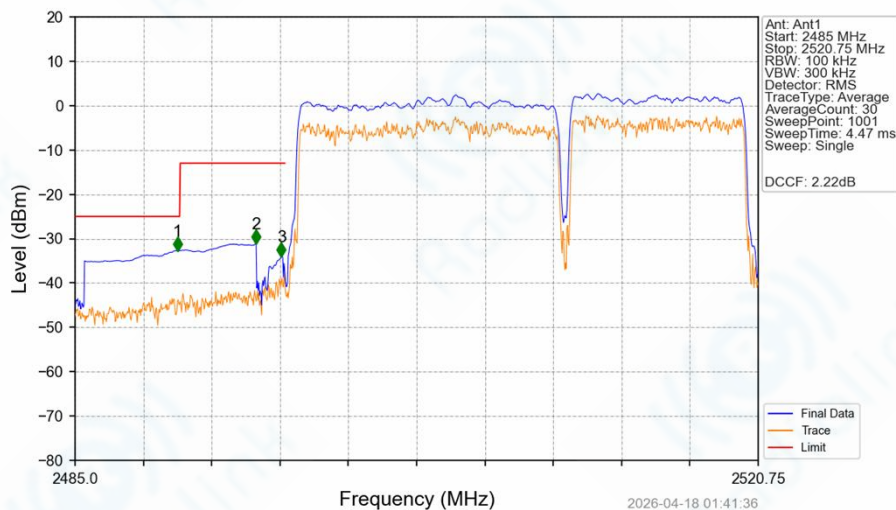


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

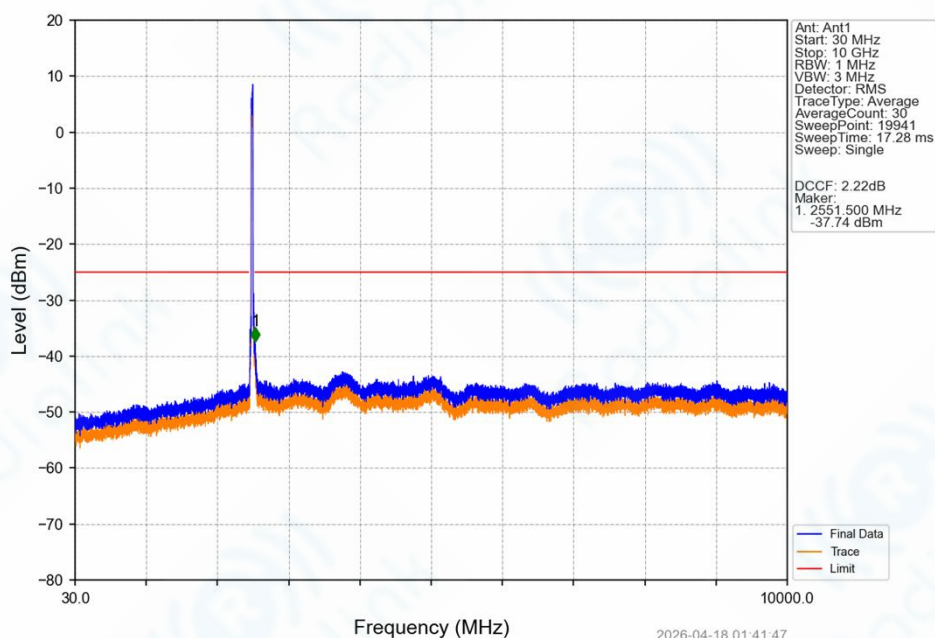


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2:
50@0

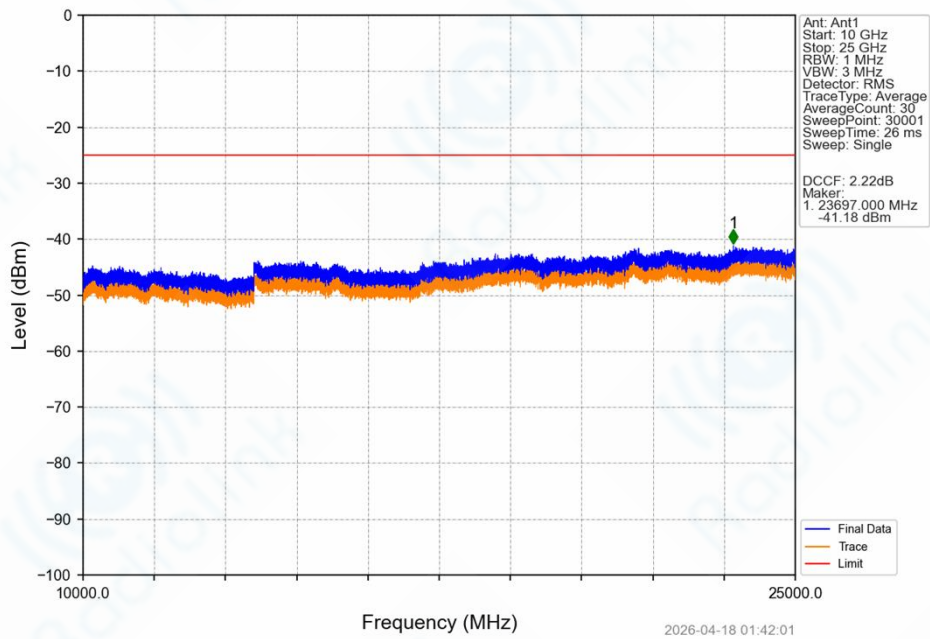


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2:
50@0

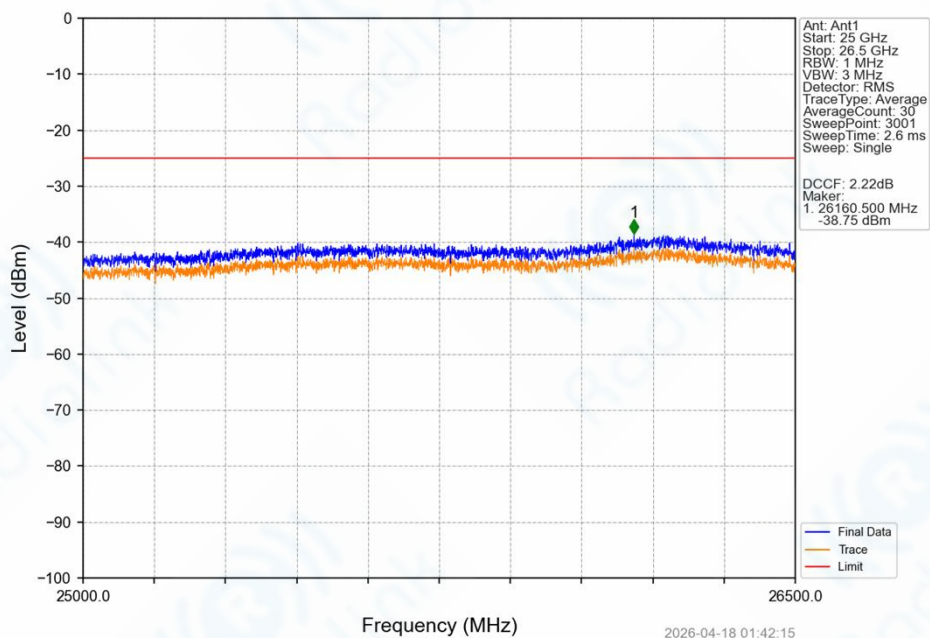

CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:16QAM_CC2:16QAM_CC1:2673_CC2:2685MHz_CC1: 1@0_CC2: 1@0

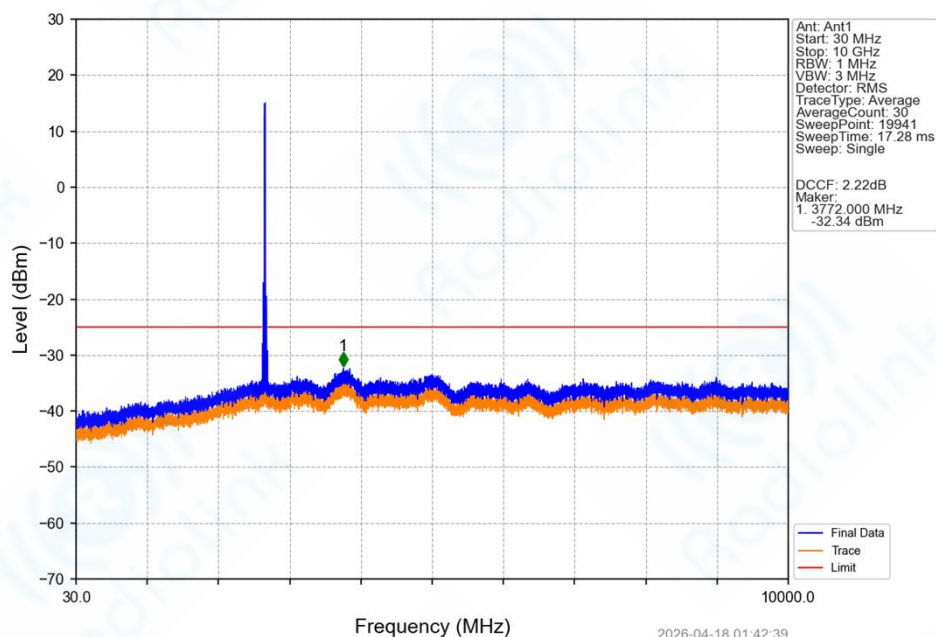


CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:16QAM_CC2:16QAM_CC1:2673_CC2:2685MHz_CC1: 1@0_CC2: 1@0

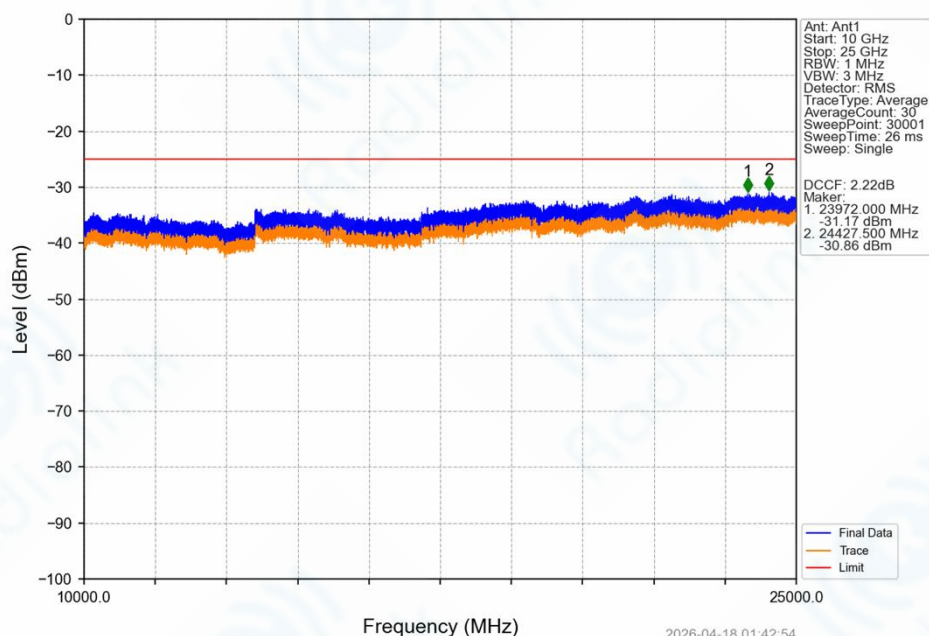

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 1@0 CC2: 1@0

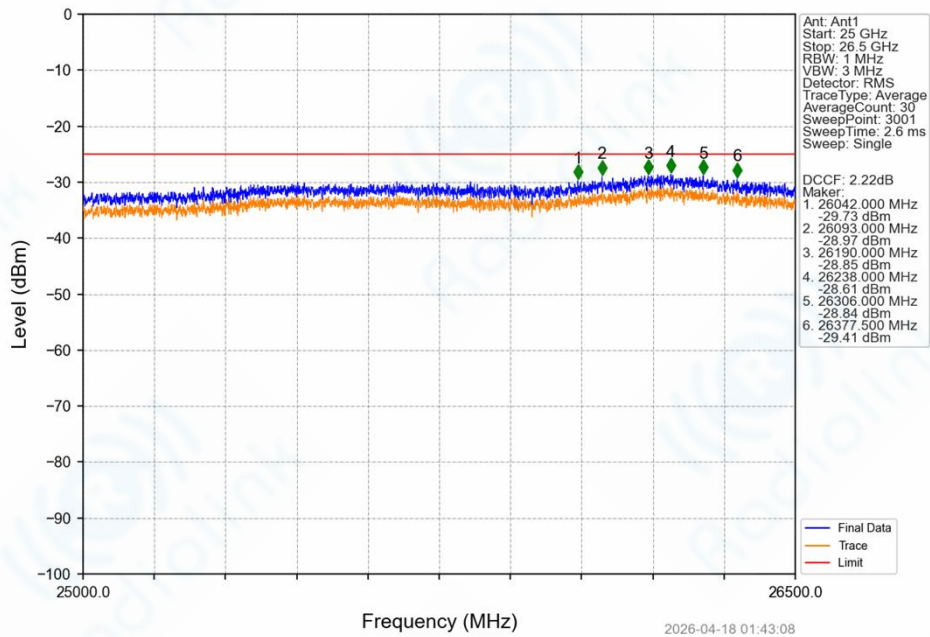

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 1@74 CC2: 1@49

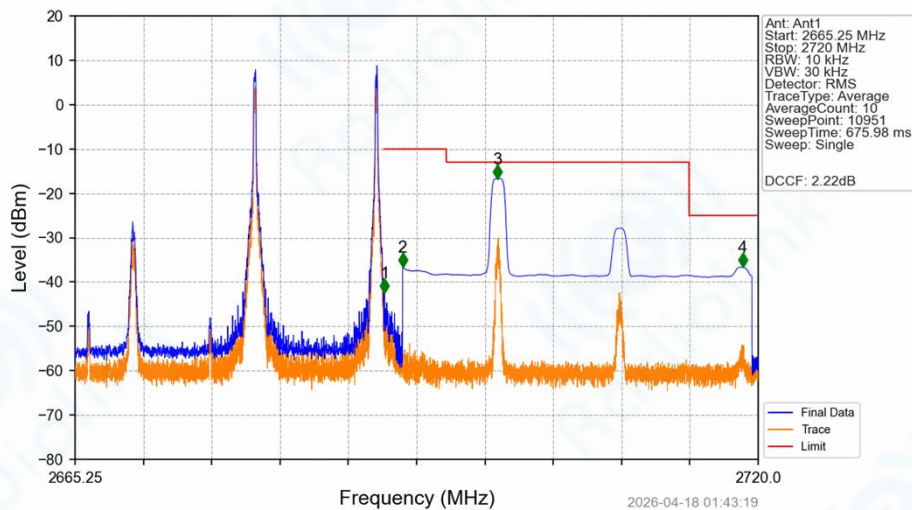


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.045	-42.42	-10	Pass
2691	2695	1	CHP	2	2691.500	-36.63	-10	Pass
2695	2714.458	1	CHP	3	2699.085	-16.70	-13	Pass
2714.458	2720	1	CHP	4	2718.740	-36.66	-25	Pass


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

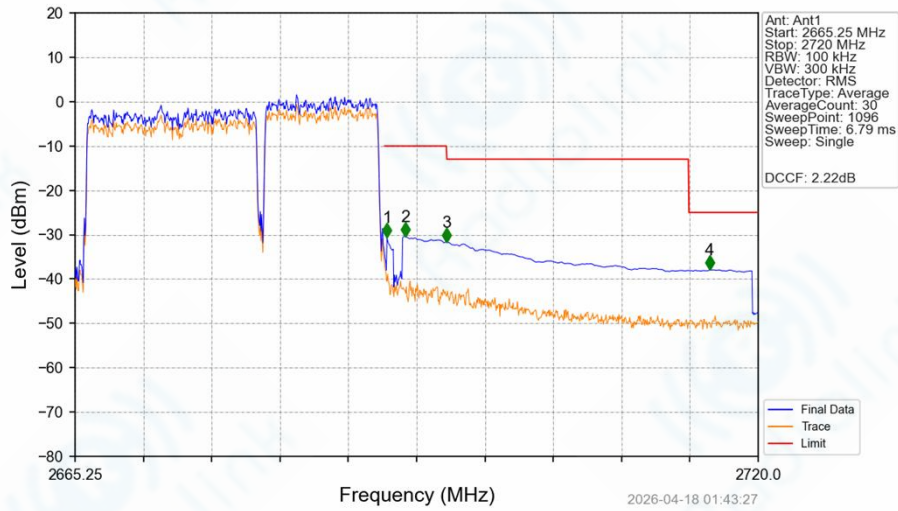


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

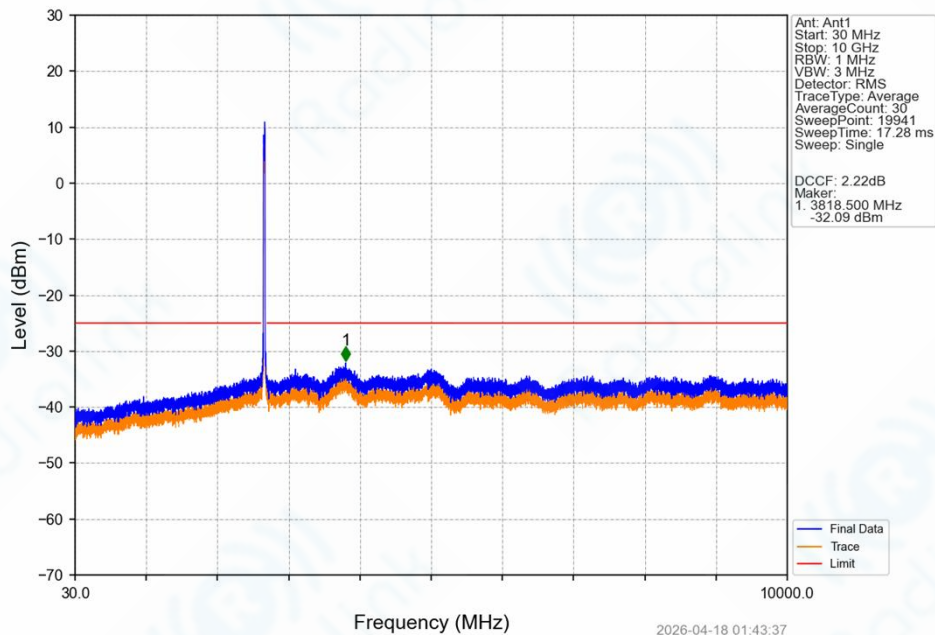


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2:
50@0

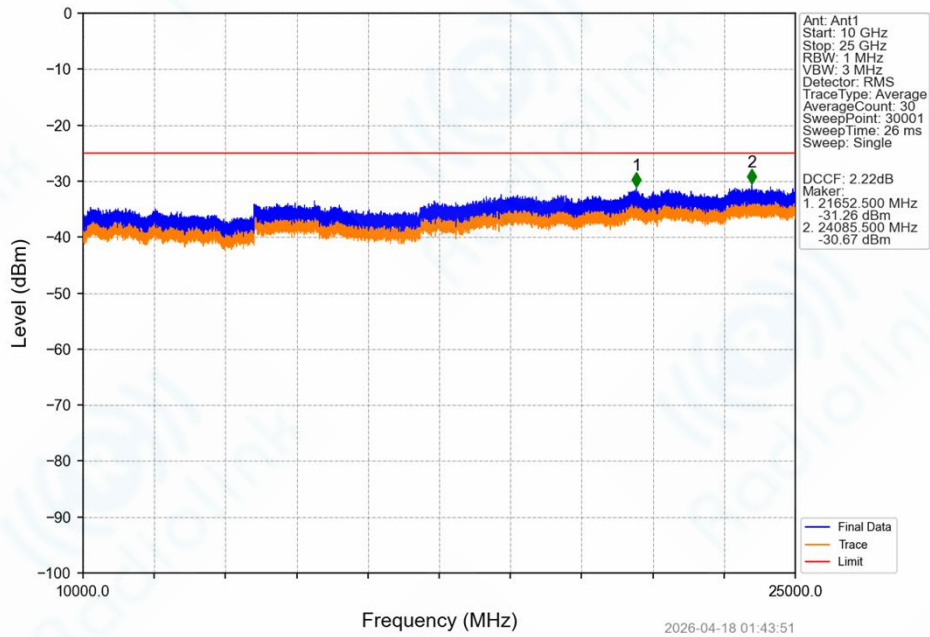


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:16QAM CC2:16QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2:
50@0

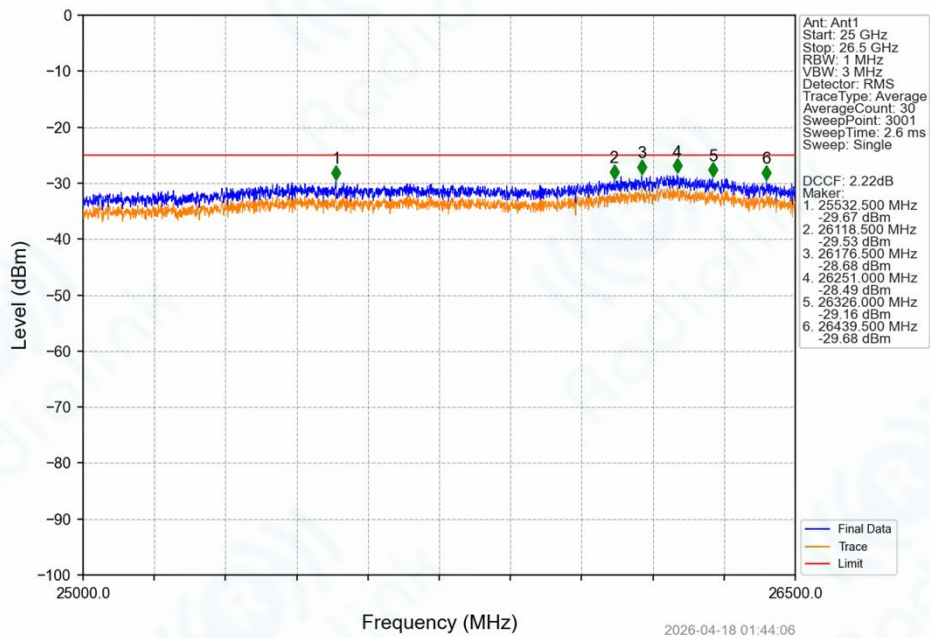


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

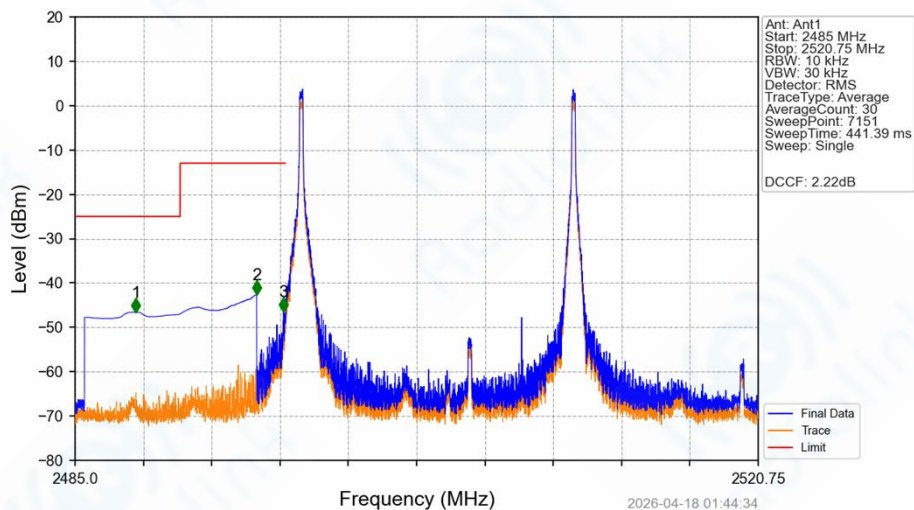


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2: 1@0

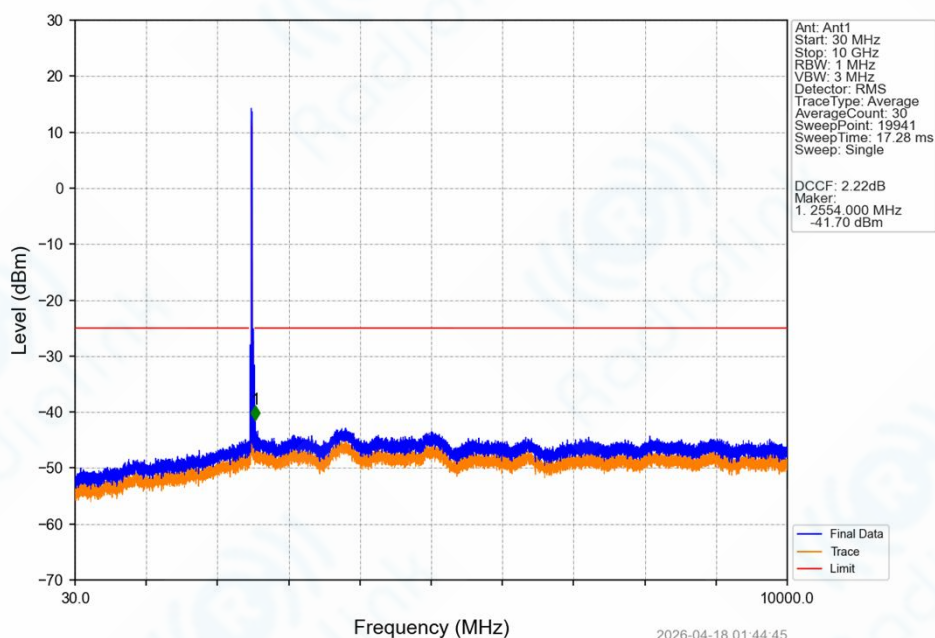


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

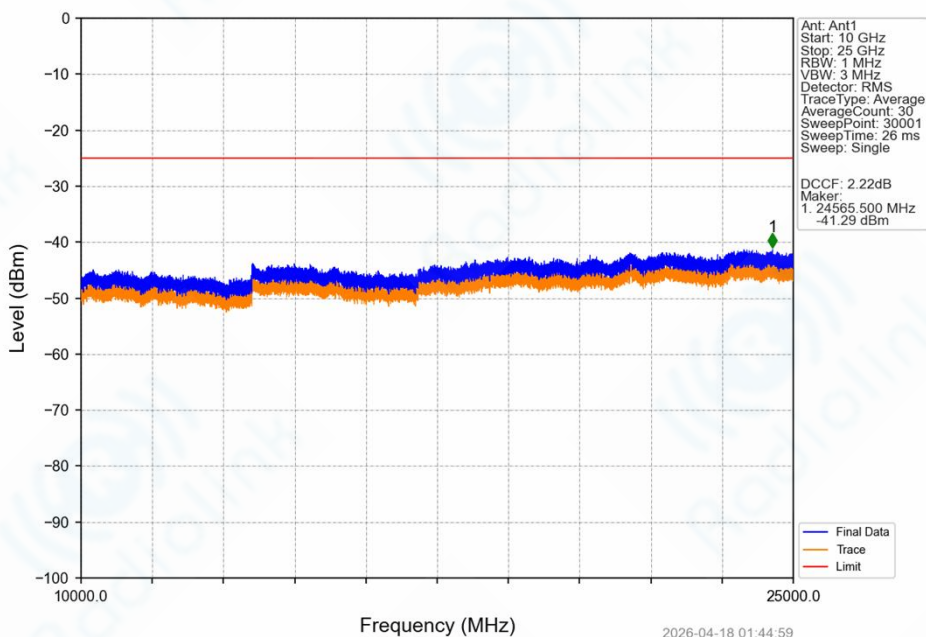


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 1@0 CC2:
1@0

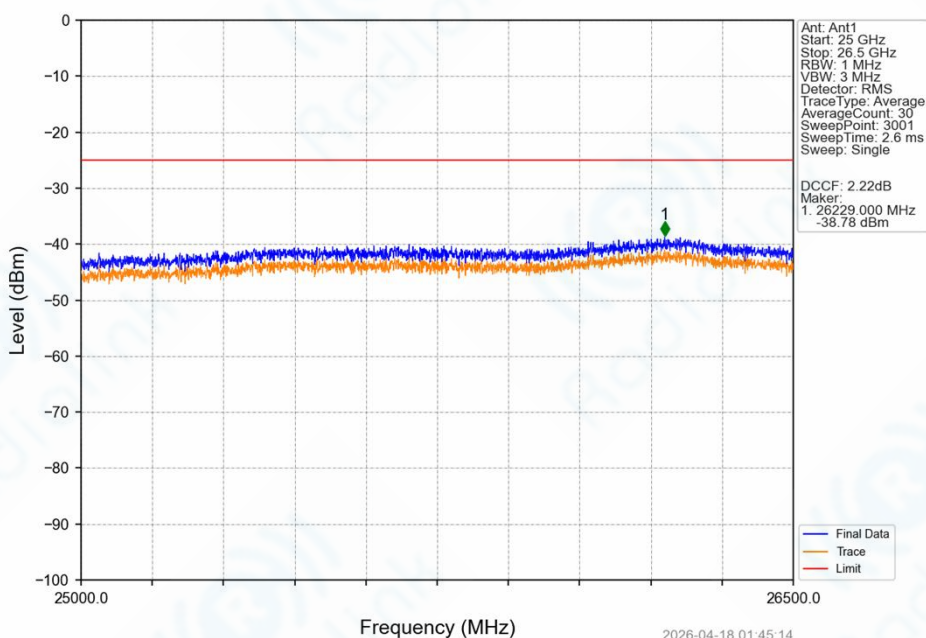

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

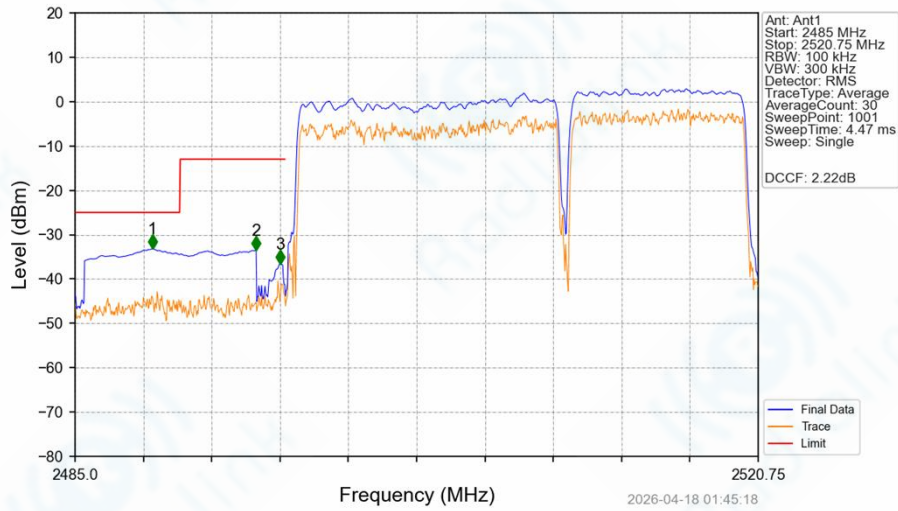


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

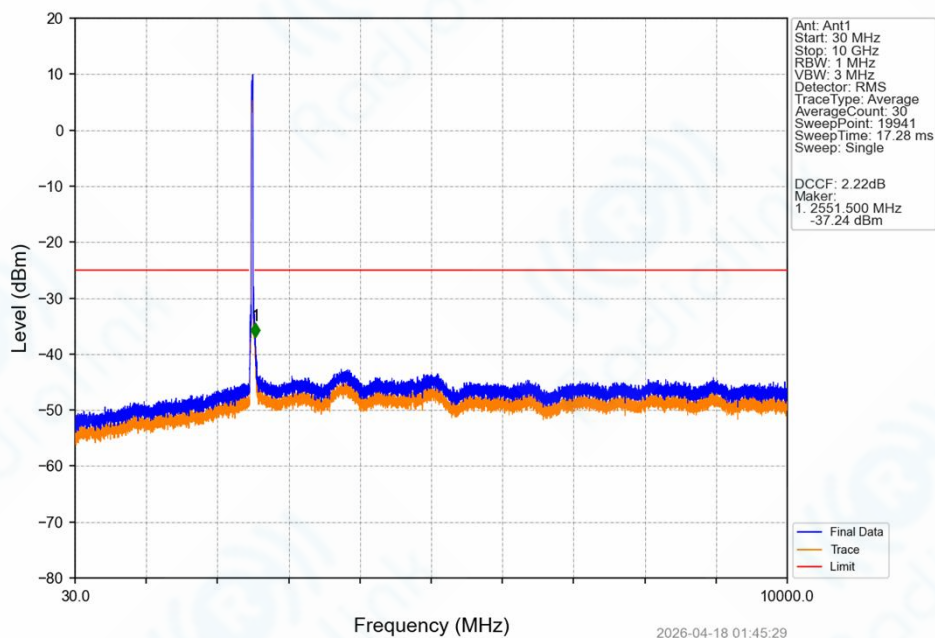


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

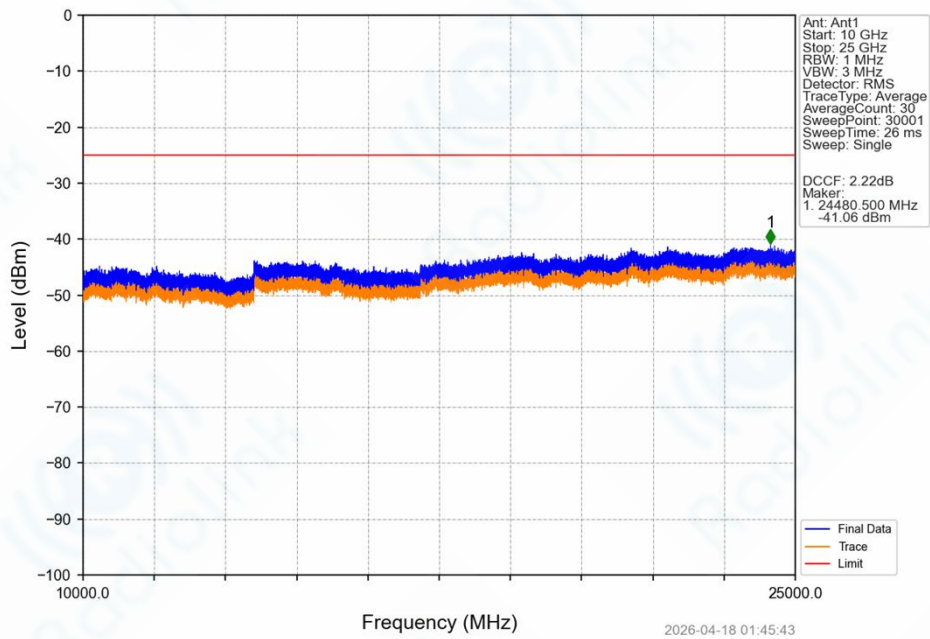

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2503.5 CC2:2515.5MHz_CC1: 75@0 CC2: 50@0

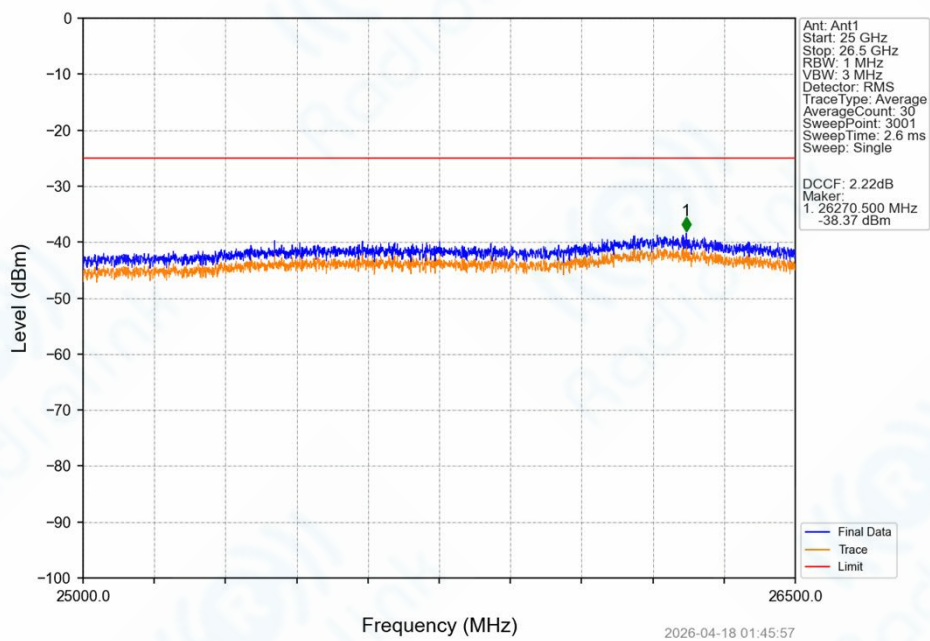


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:64QAM_CC2:64QAM_CC1:2673_CC2:2685MHz_CC1: 1@0_CC2: 1@0

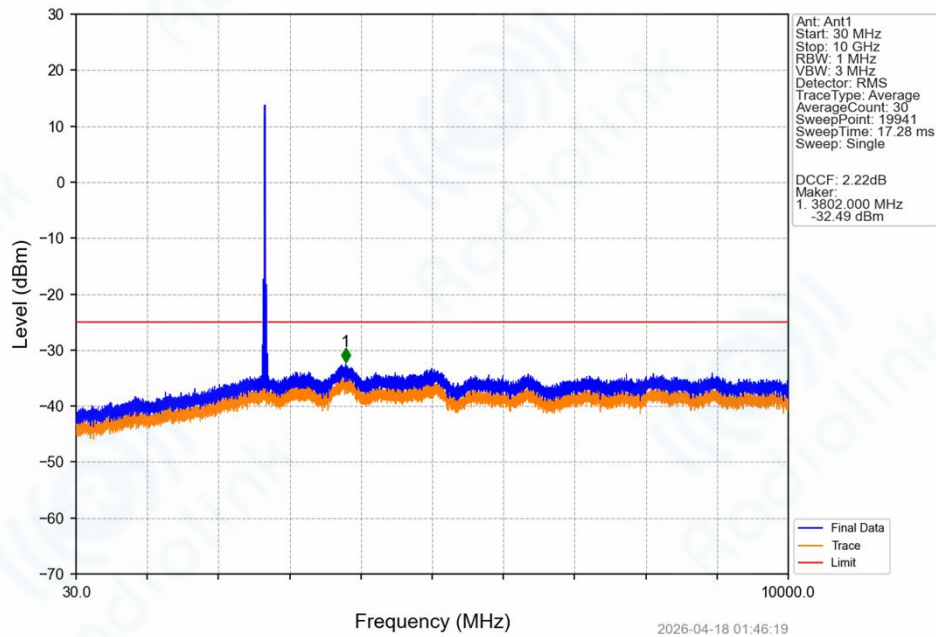


CA_41C_SISO_NTNV_CC1:15_CC2:10MHz_CC1:64QAM_CC2:64QAM_CC1:2673_CC2:2685MHz_CC1: 1@0_CC2: 1@0

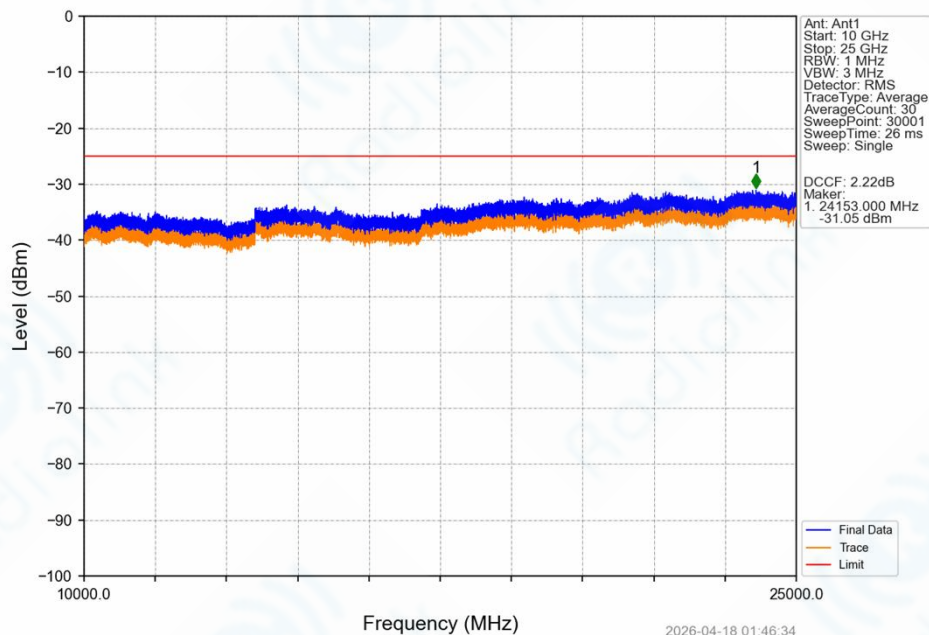

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 1@0 CC2: 1@0

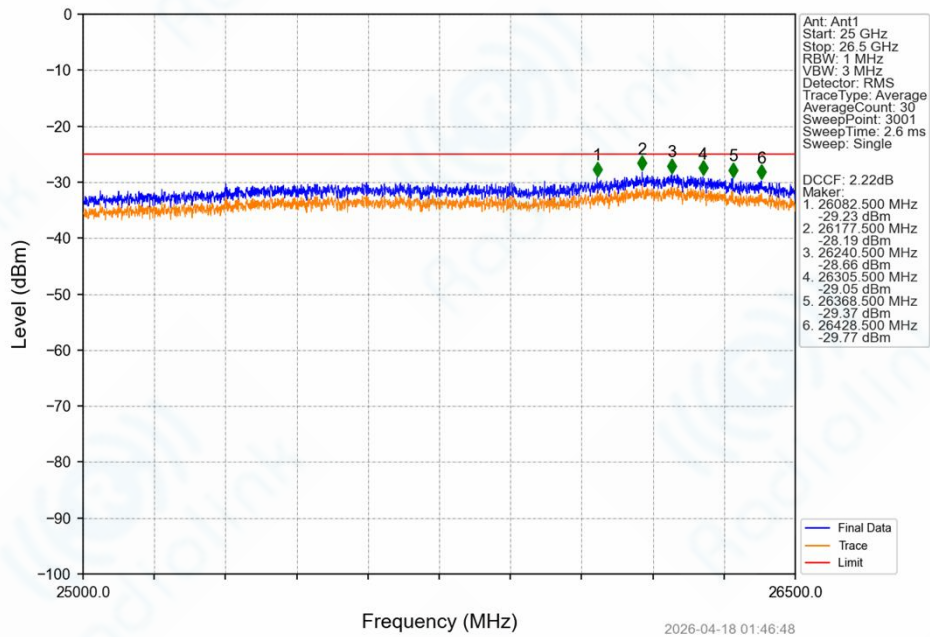

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 1@74 CC2: 1@49

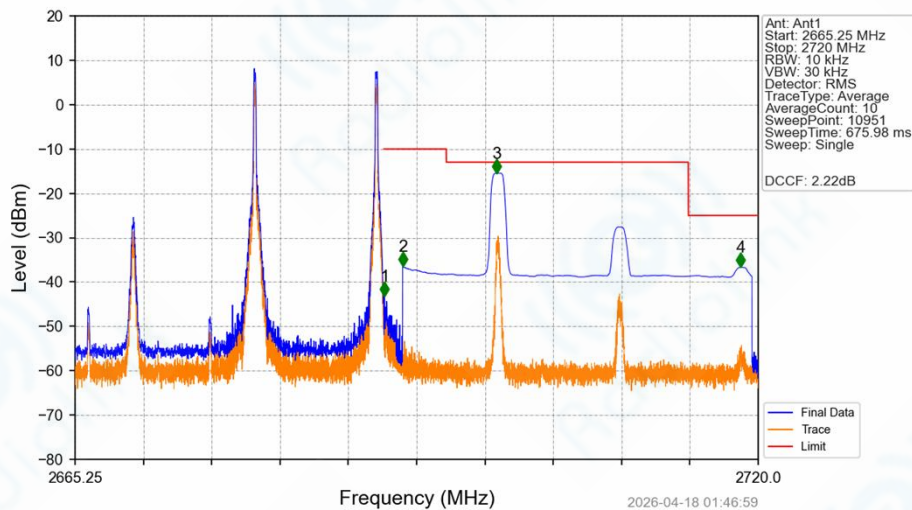


Start (MHz)	Stop (MHz)	RBW (MHz)	Method	Marker No.	Freq (MHz)	Level (dBm)	Limit (dBm)	Result
2665.25	2690	0.02	CHP	/	/	/	/	/
2690	2691	0.02	CHP	1	2690.055	-43.19	-10	Pass
2691	2695	1	CHP	2	2691.505	-36.36	-10	Pass
2695	2714.398	1	CHP	3	2699.005	-15.47	-13	Pass
2714.398	2720	1	CHP	4	2718.595	-36.67	-25	Pass


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

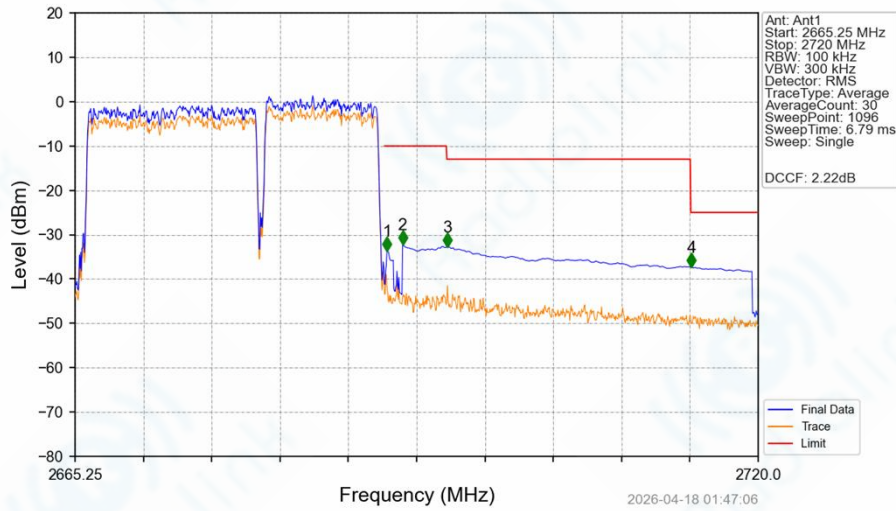


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

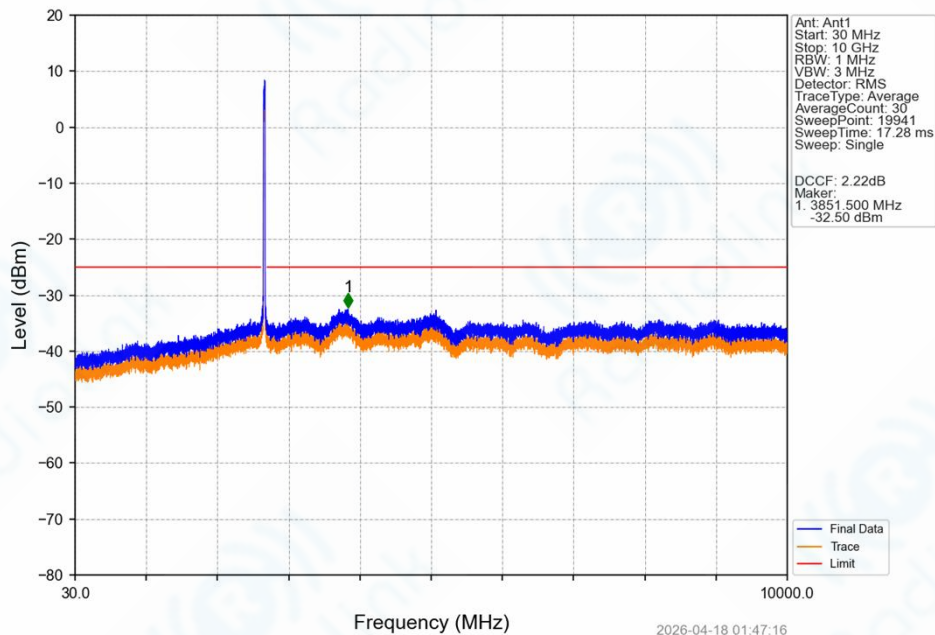


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

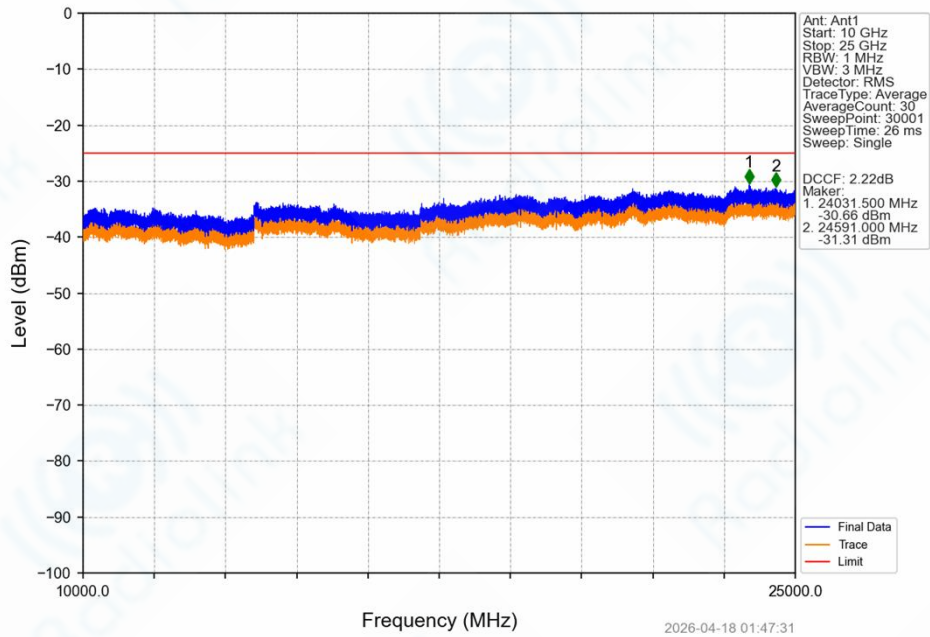


CA_41C_SISO_NTNV_CC1:15 CC2:10MHz_CC1:64QAM CC2:64QAM_CC1:2673 CC2:2685MHz_CC1: 75@0 CC2: 50@0

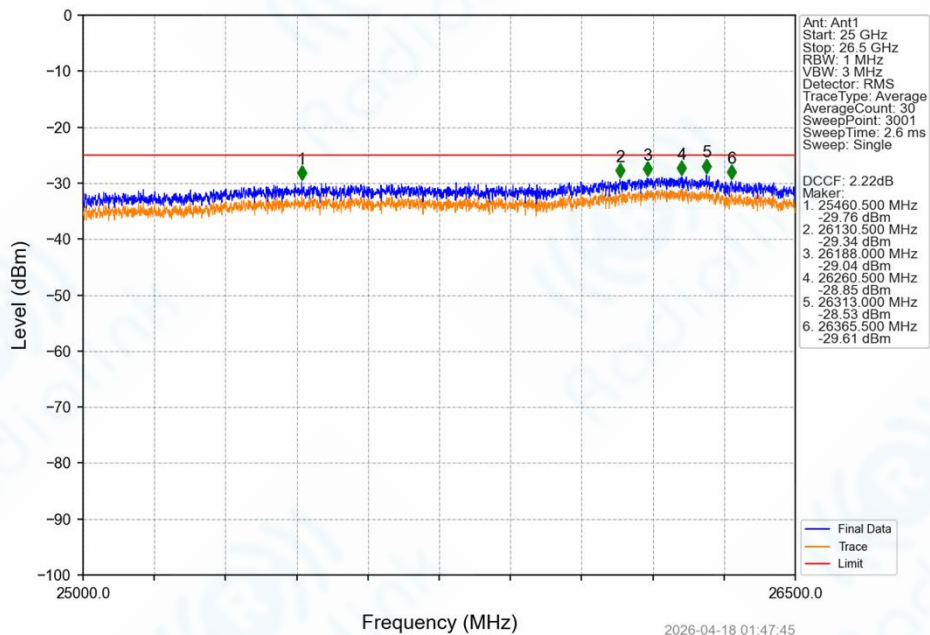

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 1@0 CC2: 1@0

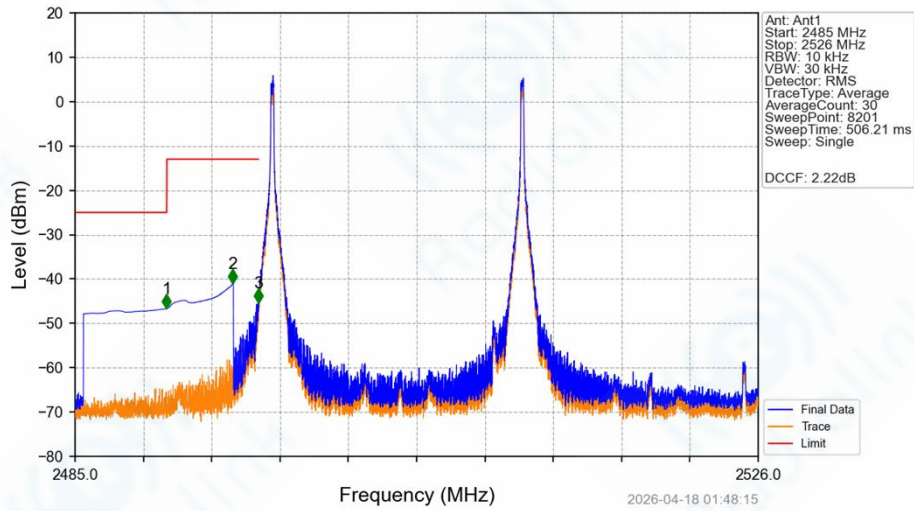

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 1@0 CC2: 1@0

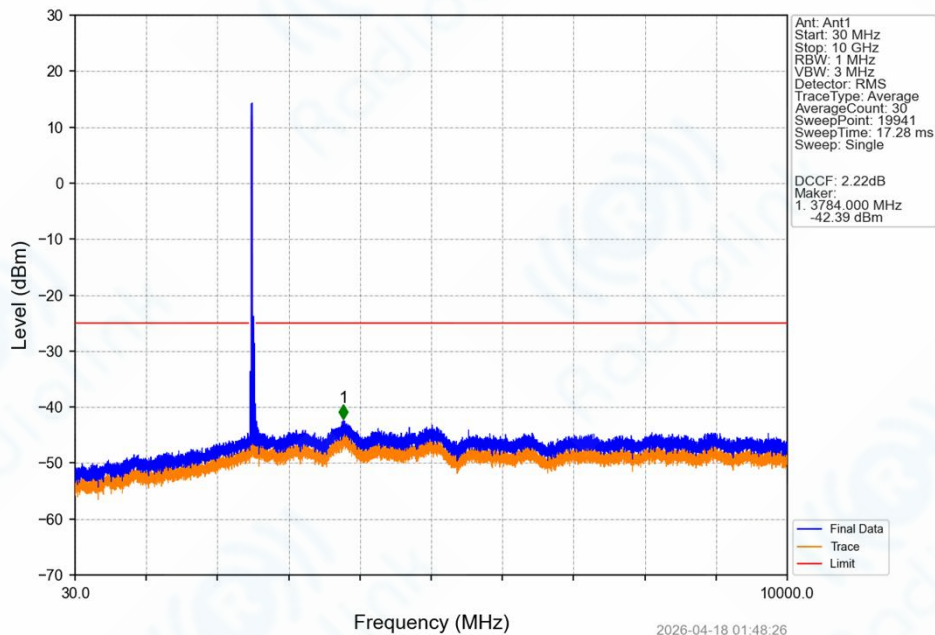


Radiolink Testing (Shenzhen) Co., Ltd.


Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District, Shenzhen, Guangdong Province, China

Tel: +86 0755 23080694

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 1@0 CC2:
1@0

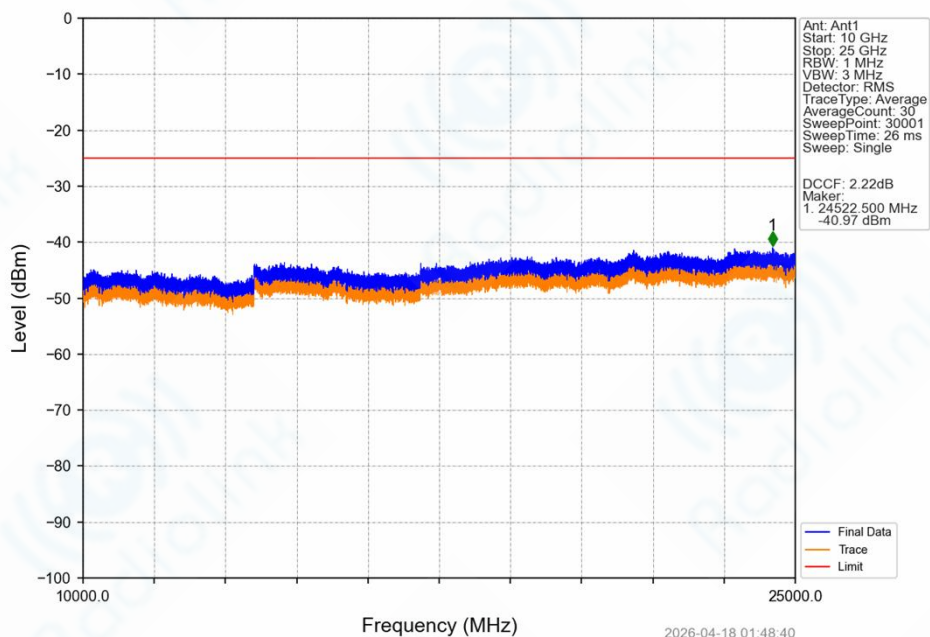

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 1@0 CC2:
1@0

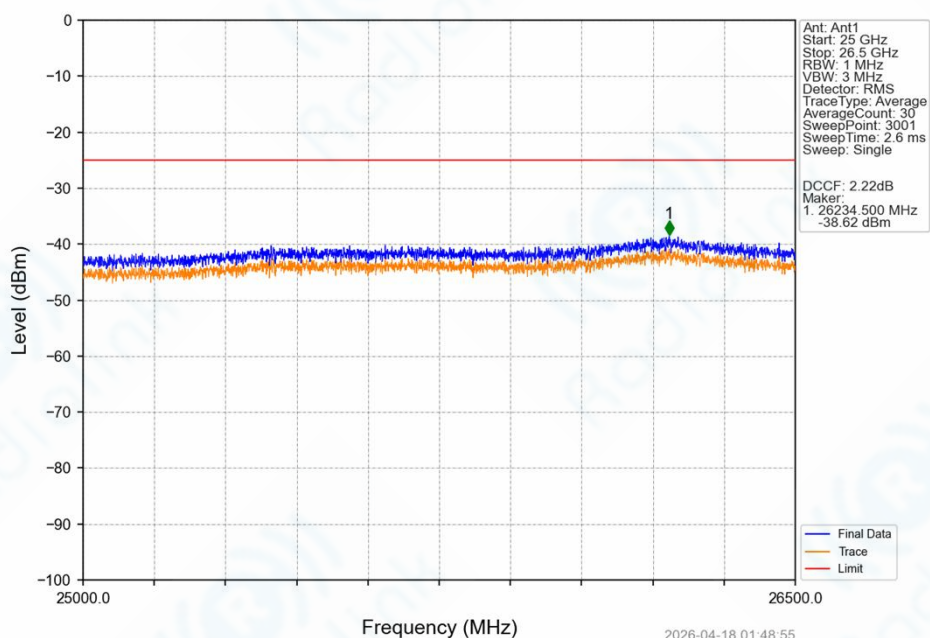


Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694


CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 75@0 CC2:

75@0

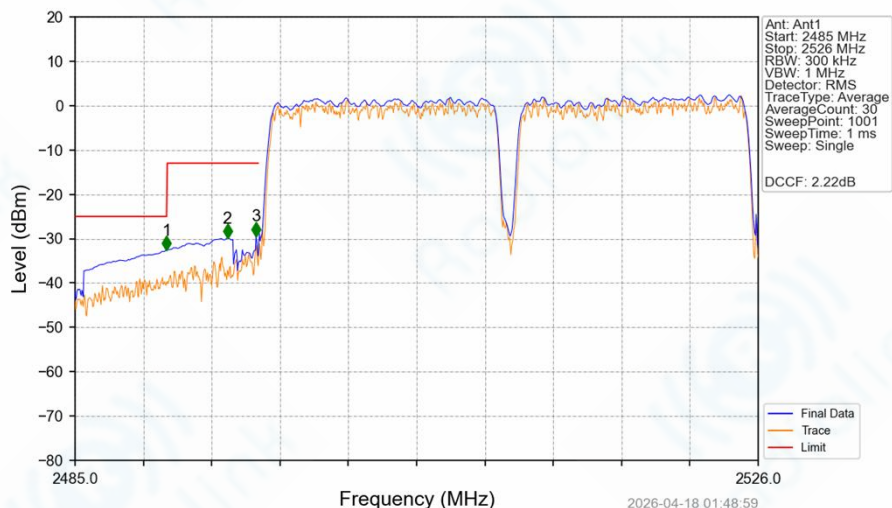


CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 75@0 CC2:


75@0

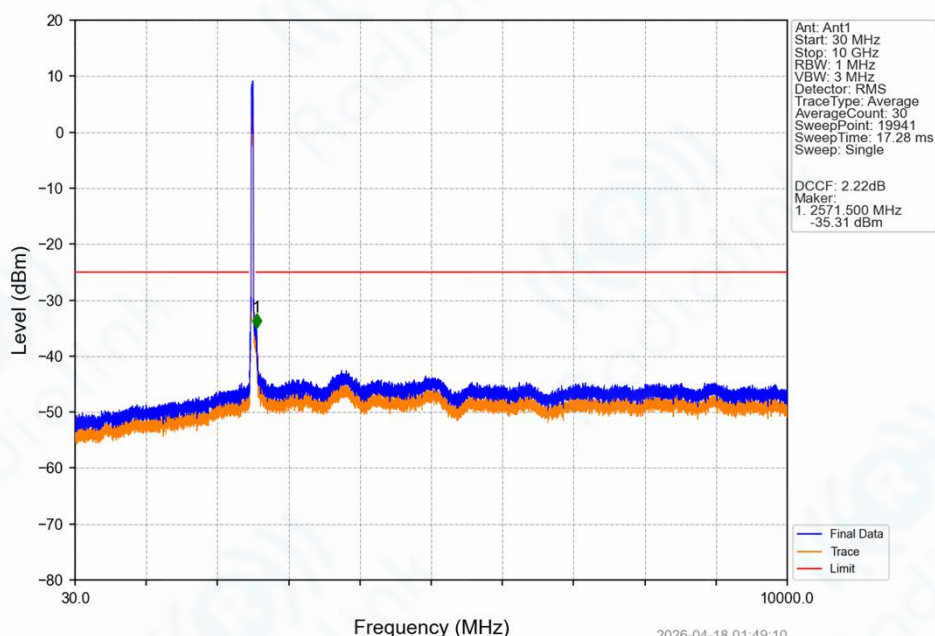

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 75@0 CC2: 75@0

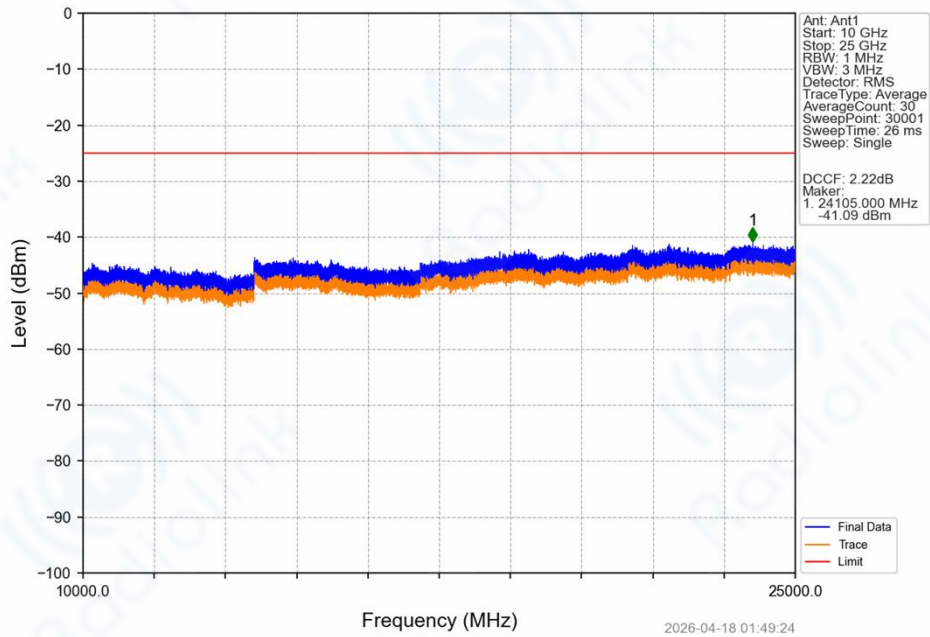

CA_41C_SISO_NTNV_CC1:15 CC2:15MHz_CC1:QPSK CC2:QPSK_CC1:2503.5 CC2:2518.5MHz_CC1: 75@0 CC2: 75@0

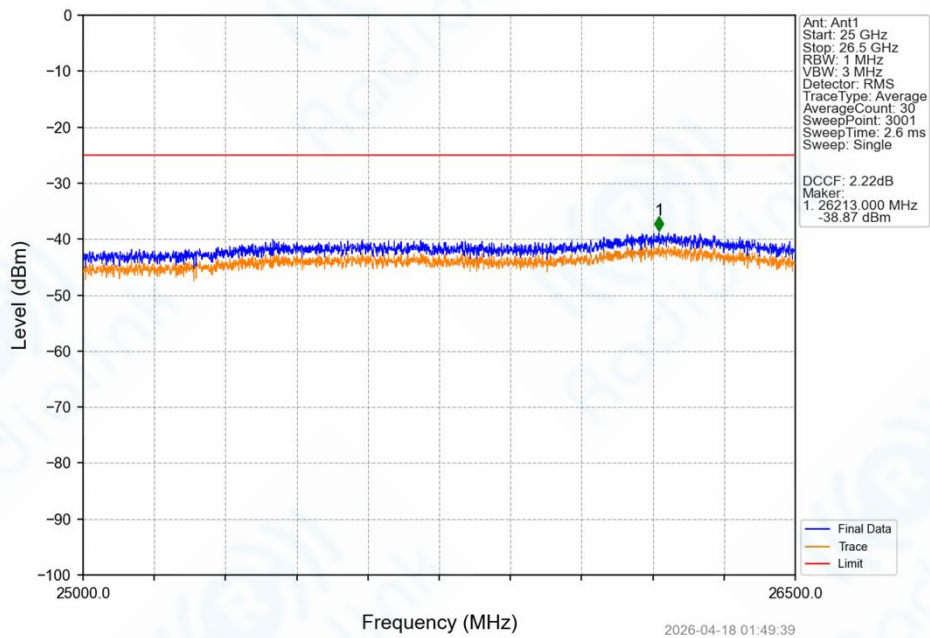

Radiolink Testing (Shenzhen) Co., Ltd.

Room 103, Building B, Jinghang Industrial Park, Area 71, Xingdong Community, Xin'an Subdistrict, Bao'an District,
Shenzhen, Guangdong Province, China
Tel: +86 0755 23080694