





Restrict Band NVNT n20 5180MHz Ant1 Peak

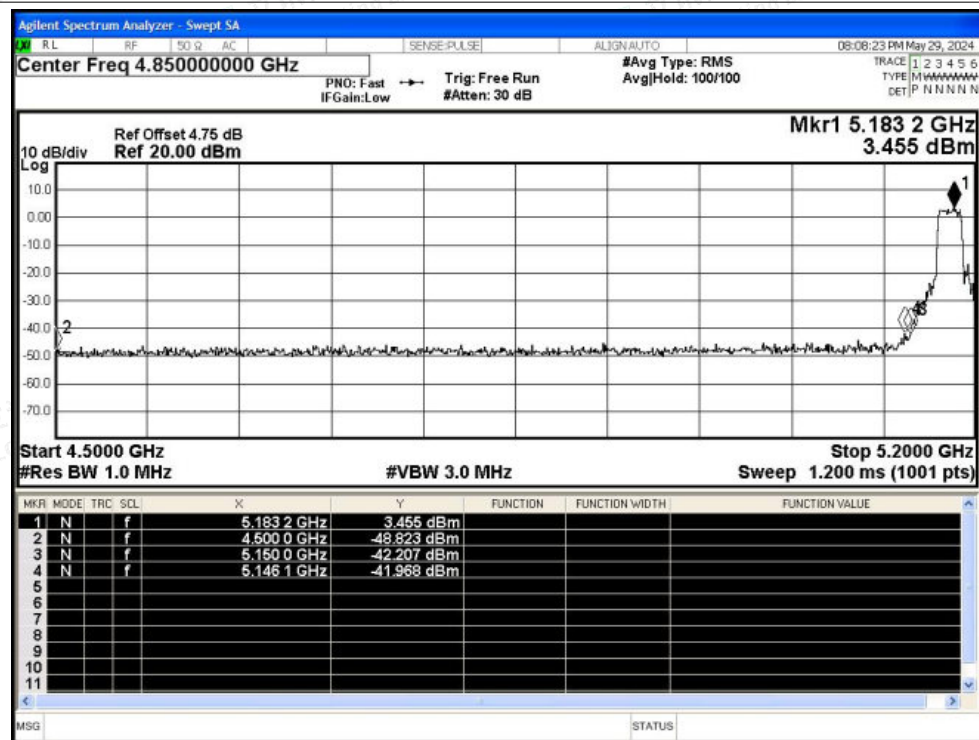

Restrict Band NVNT n20 5180MHz Ant1 Average

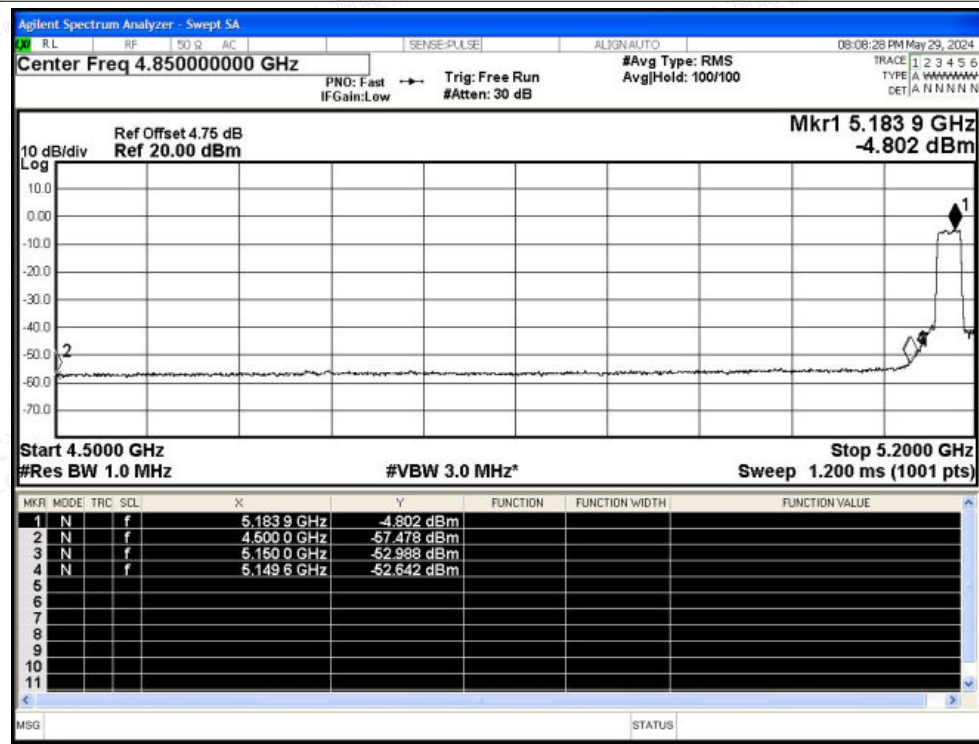

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

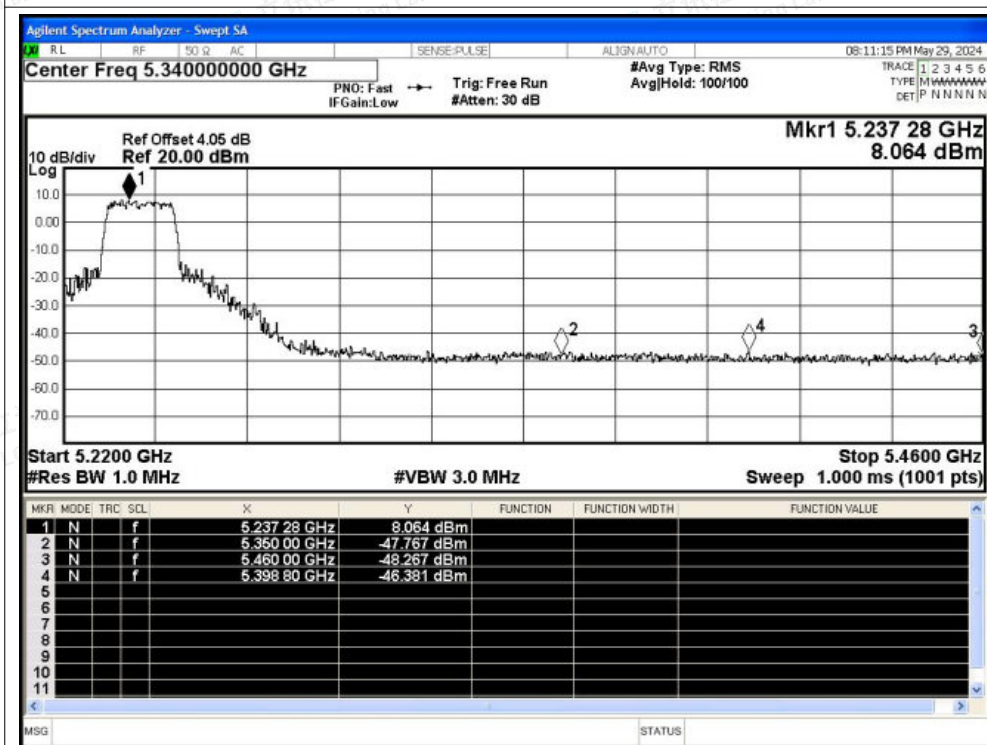

Restrict Band NVNT n20 5240MHz Ant1 Average

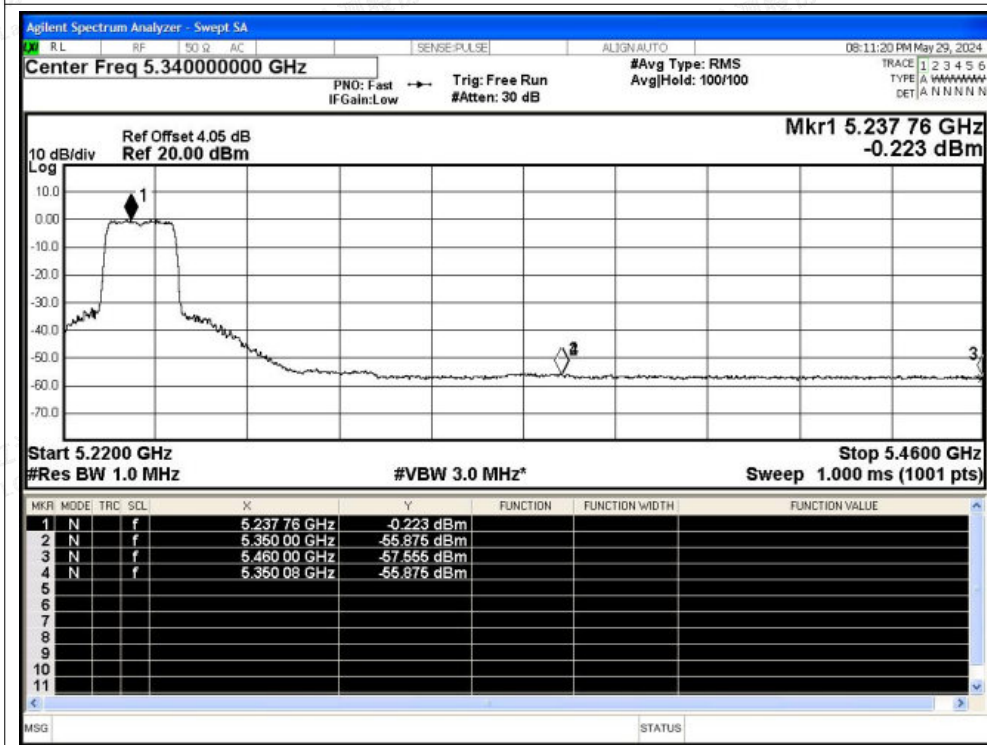

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

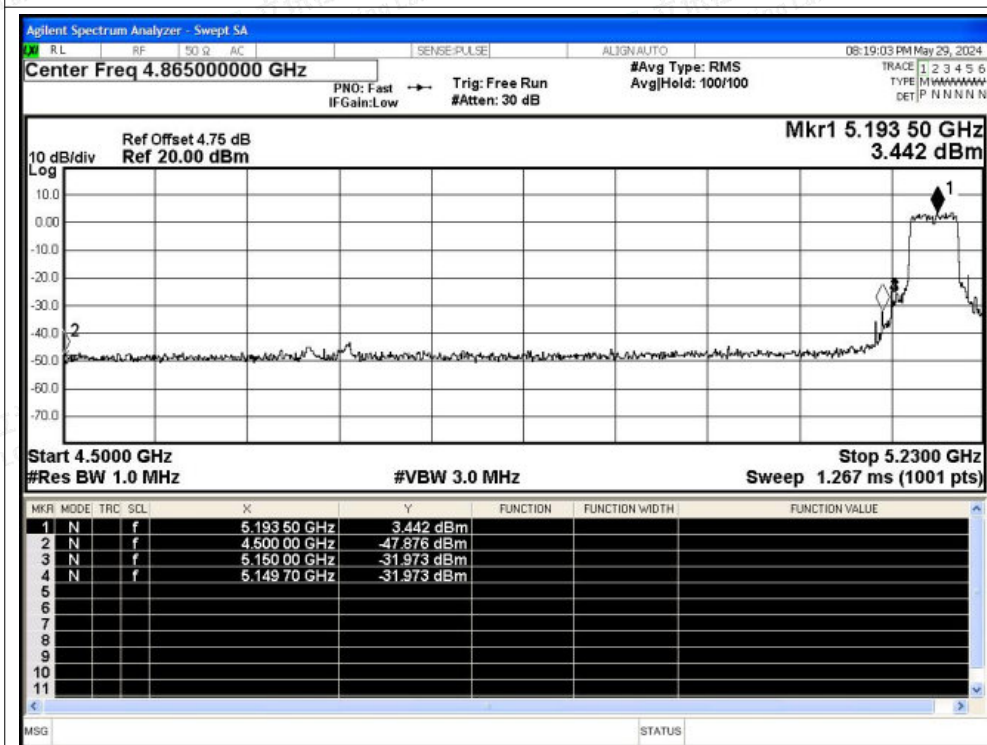

Restrict Band NVNT n40 5190MHz Ant1 Average

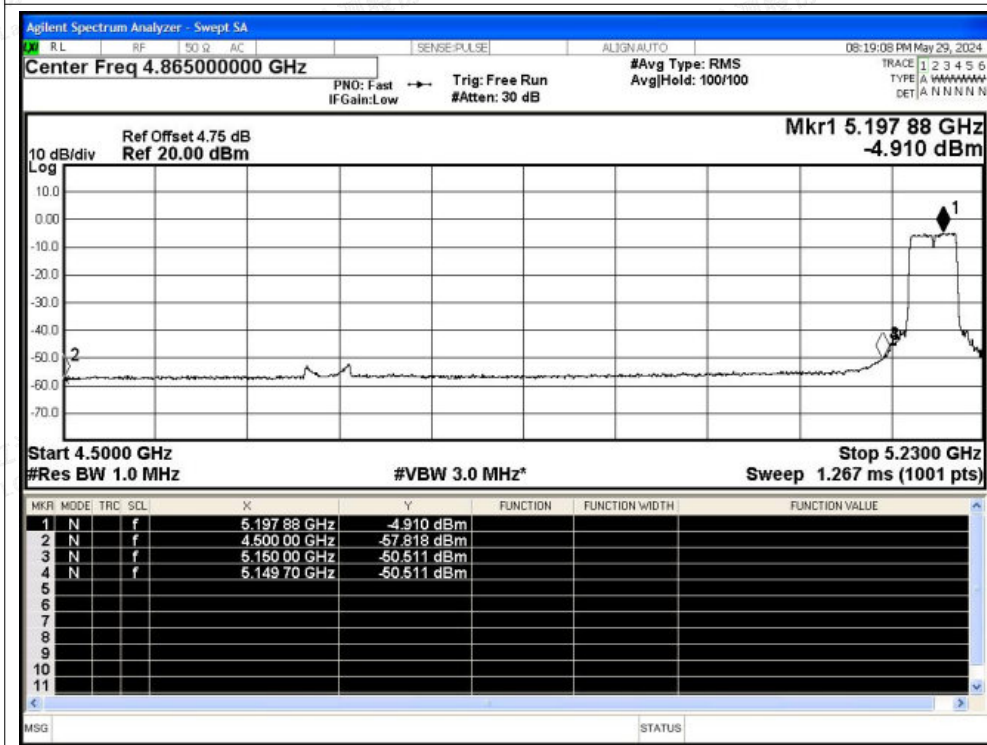

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

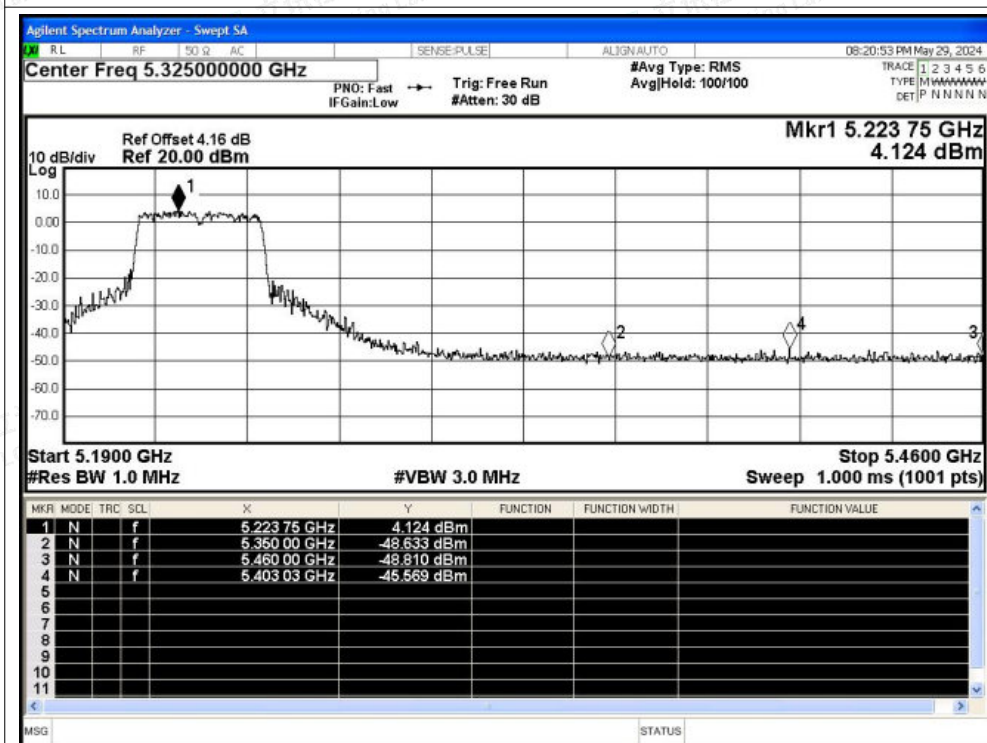

Restrict Band NVNT n40 5230MHz Ant1 Average

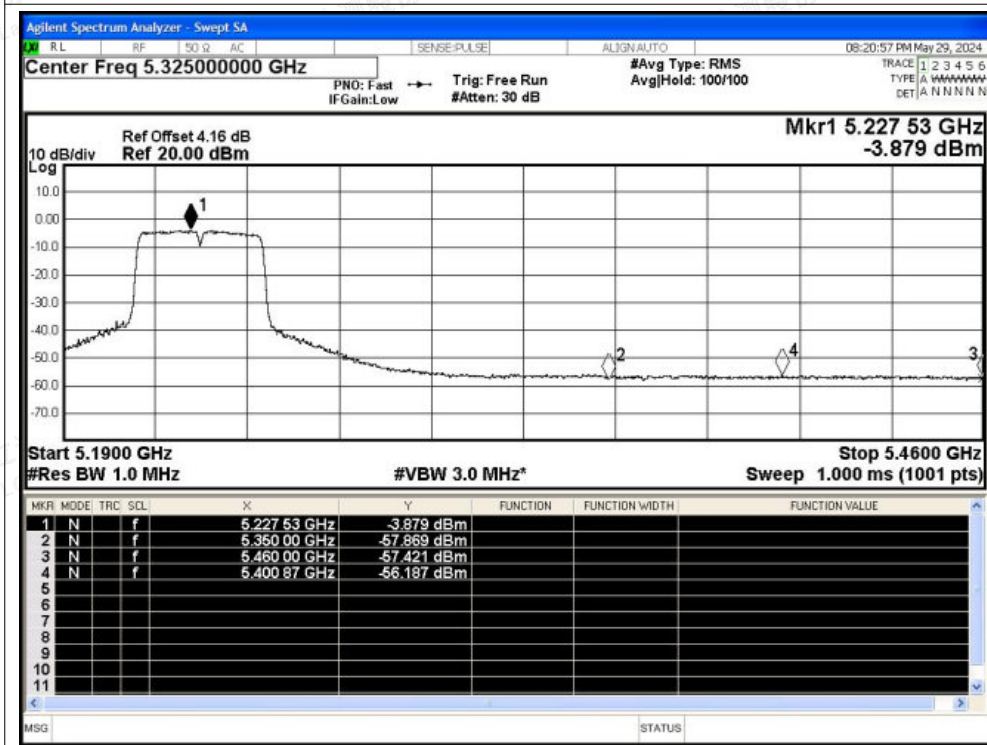

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

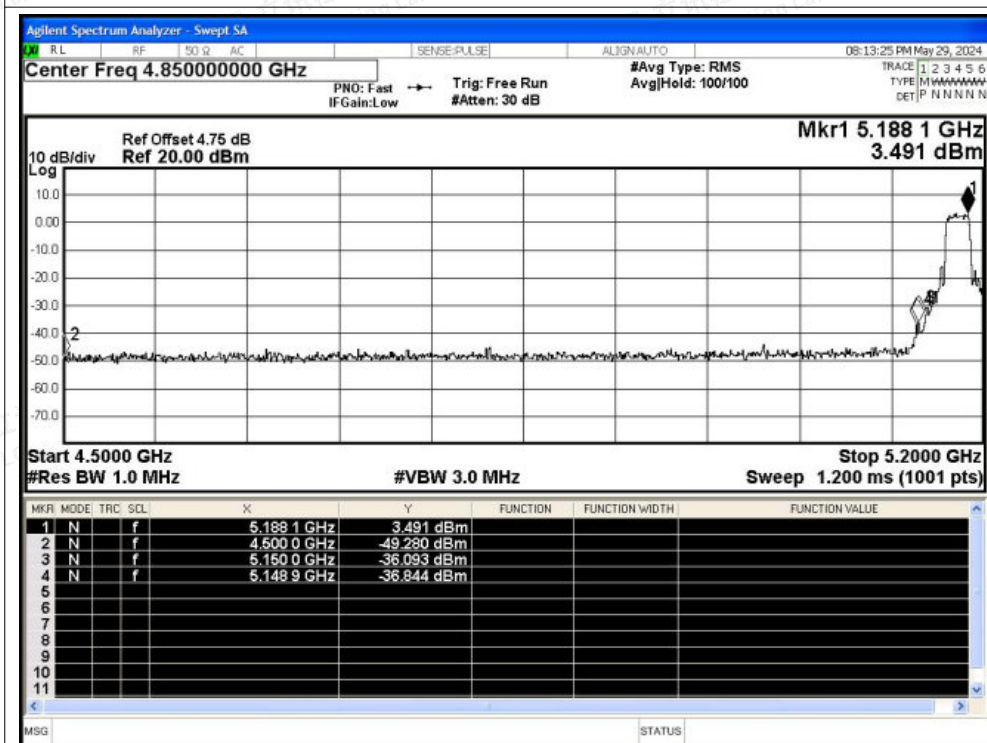

Restrict Band NVNT ac20 5180MHz Ant1 Average

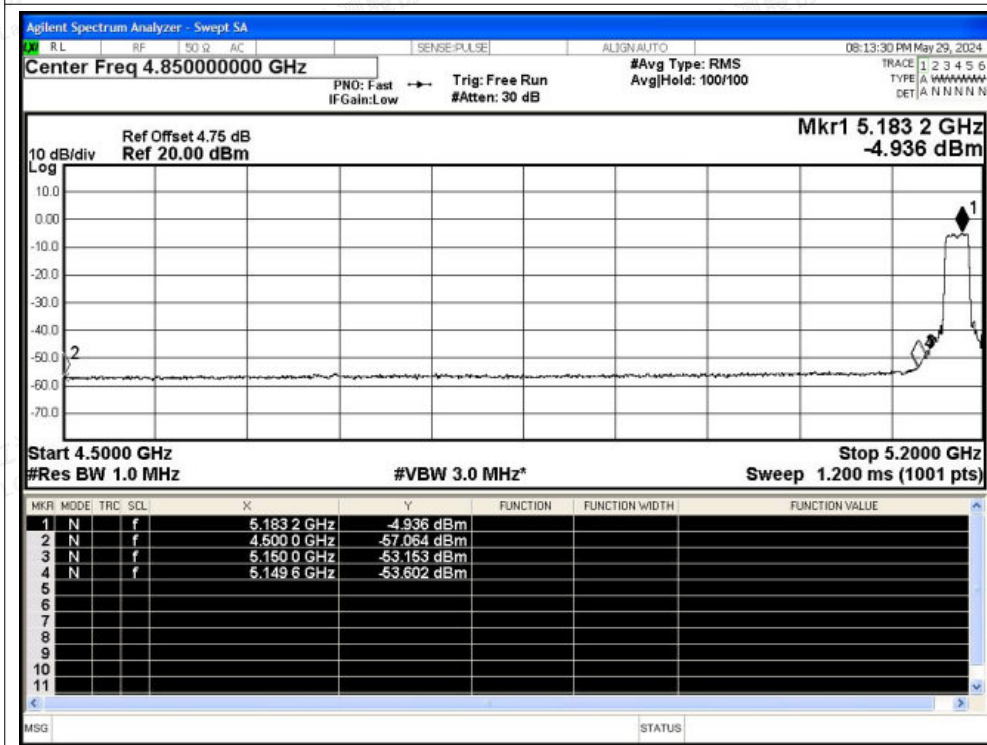

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

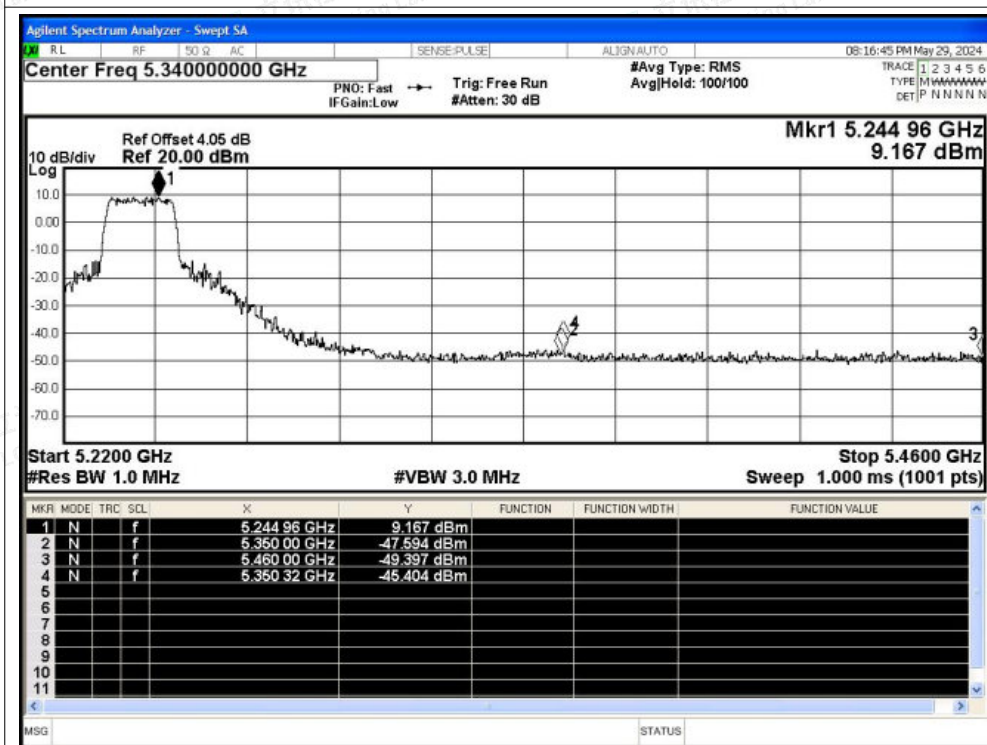

Restrict Band NVNT ac20 5240MHz Ant1 Average

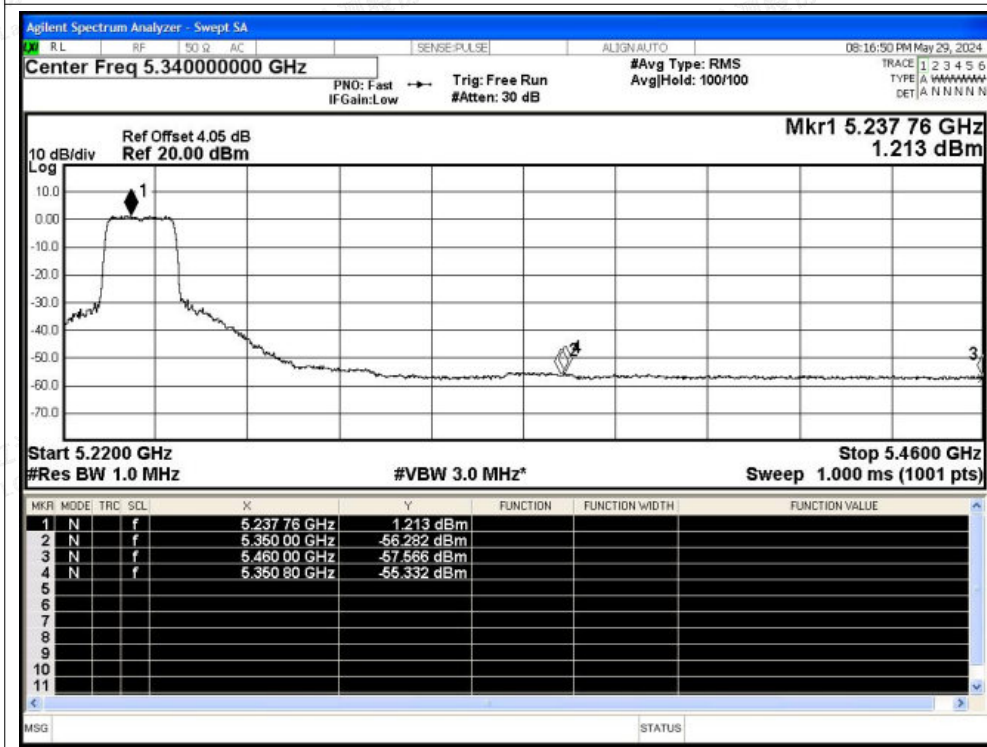

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

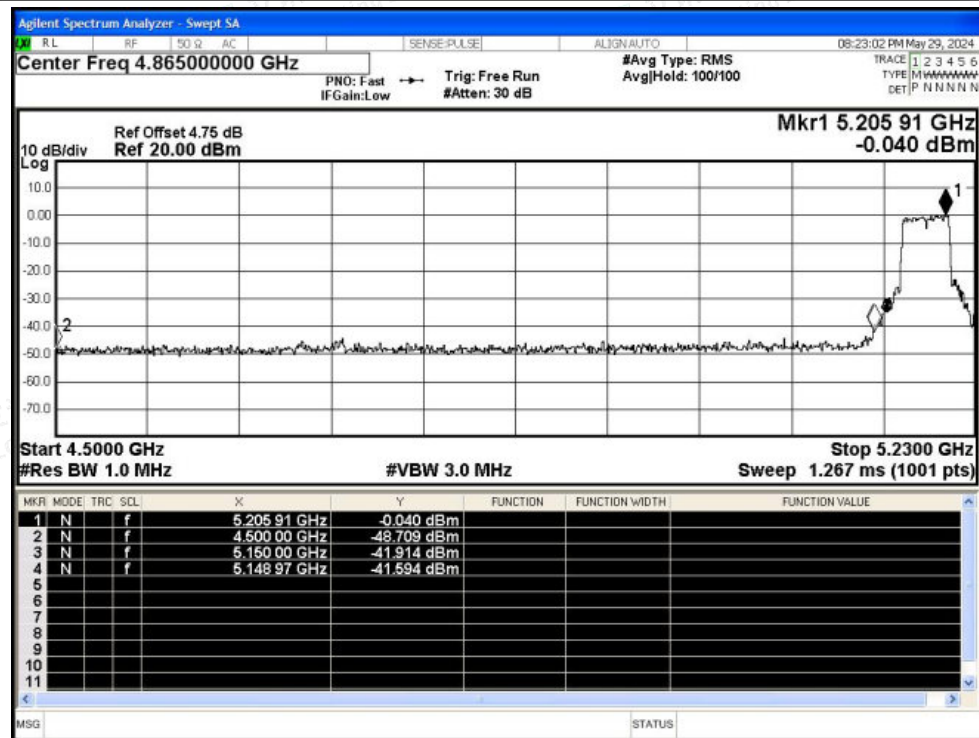


Restrict Band NVNT ac40 5190MHz Ant1 Average

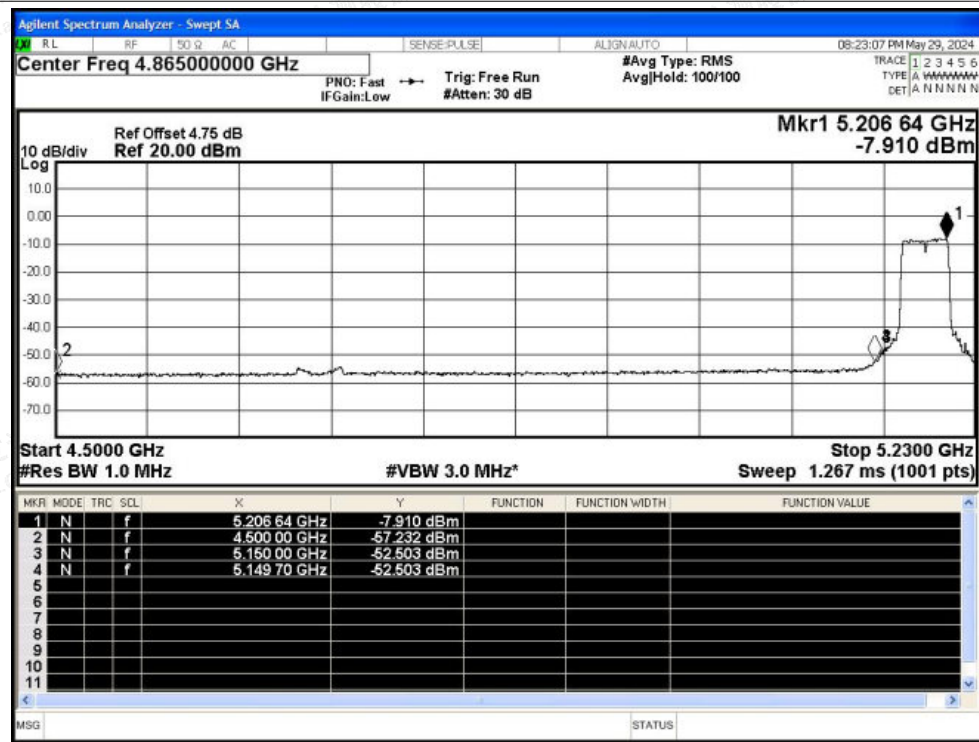




Restrict Band NVNT ac40 5230MHz Ant1 Peak

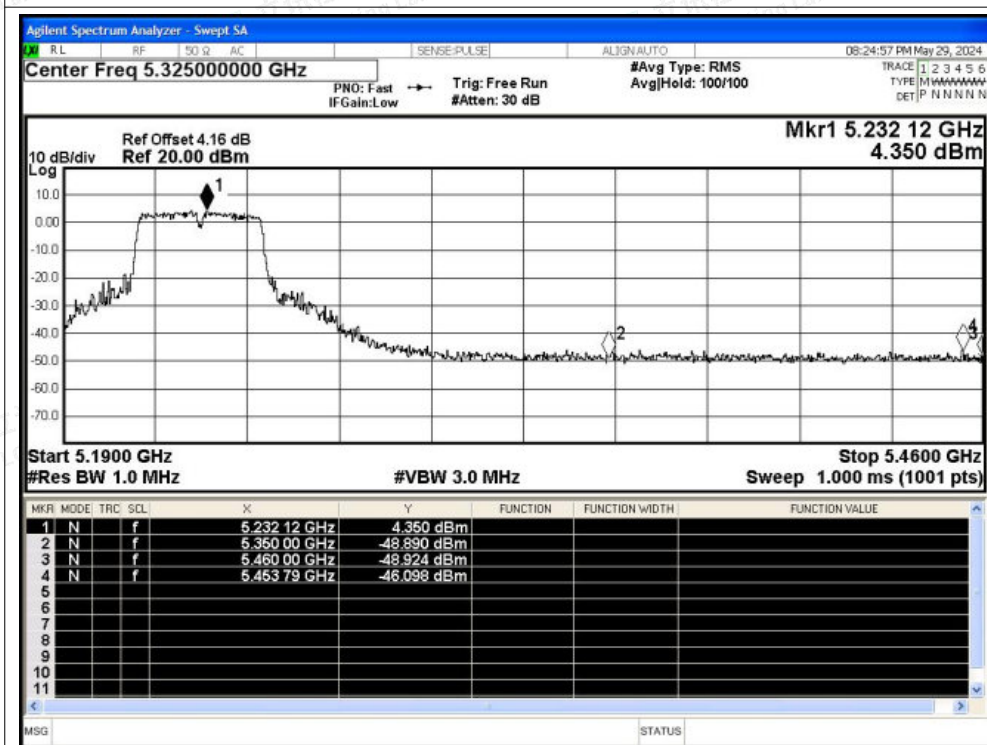

Restrict Band NVNT ac40 5230MHz Ant1 Average

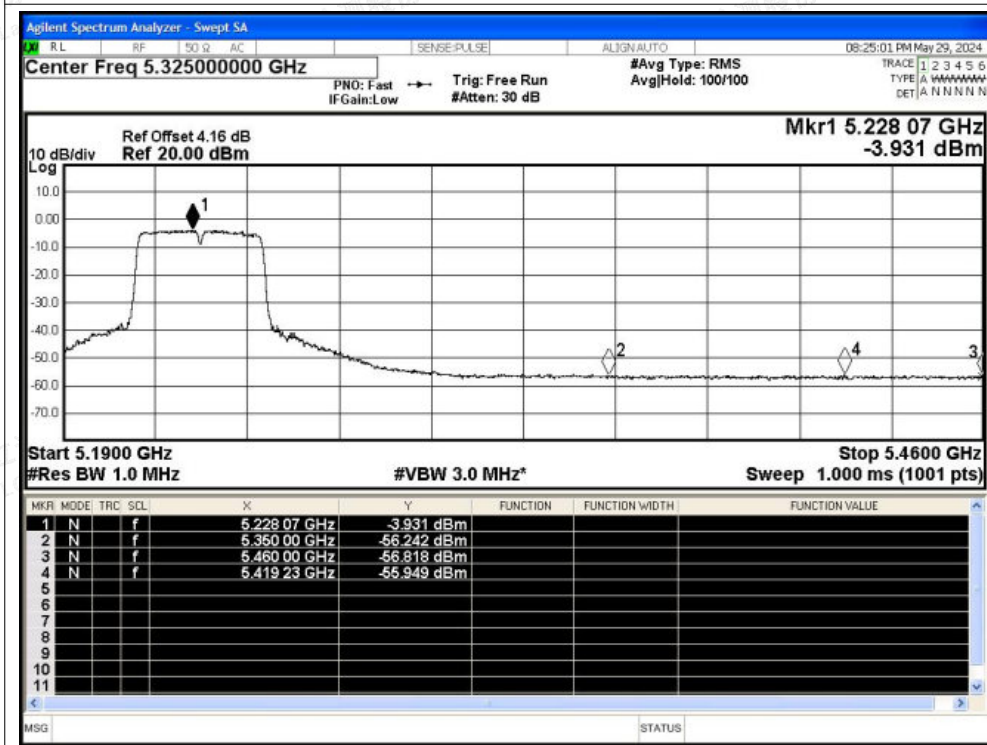

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

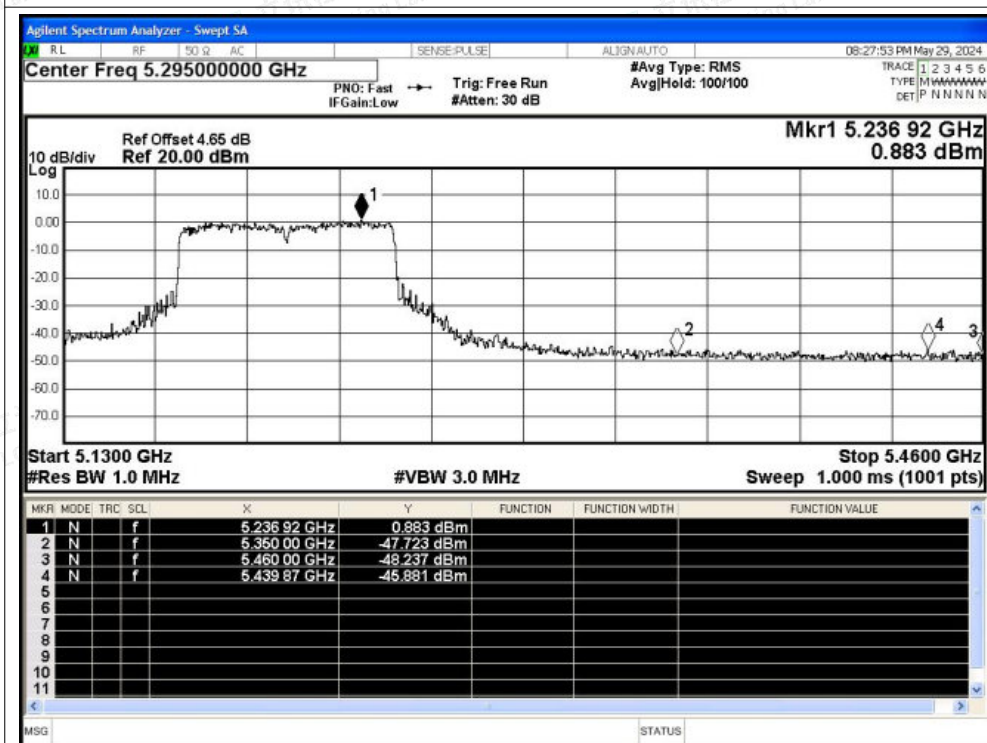

Restrict Band NVNT ac80 5210MHz Ant1 Average

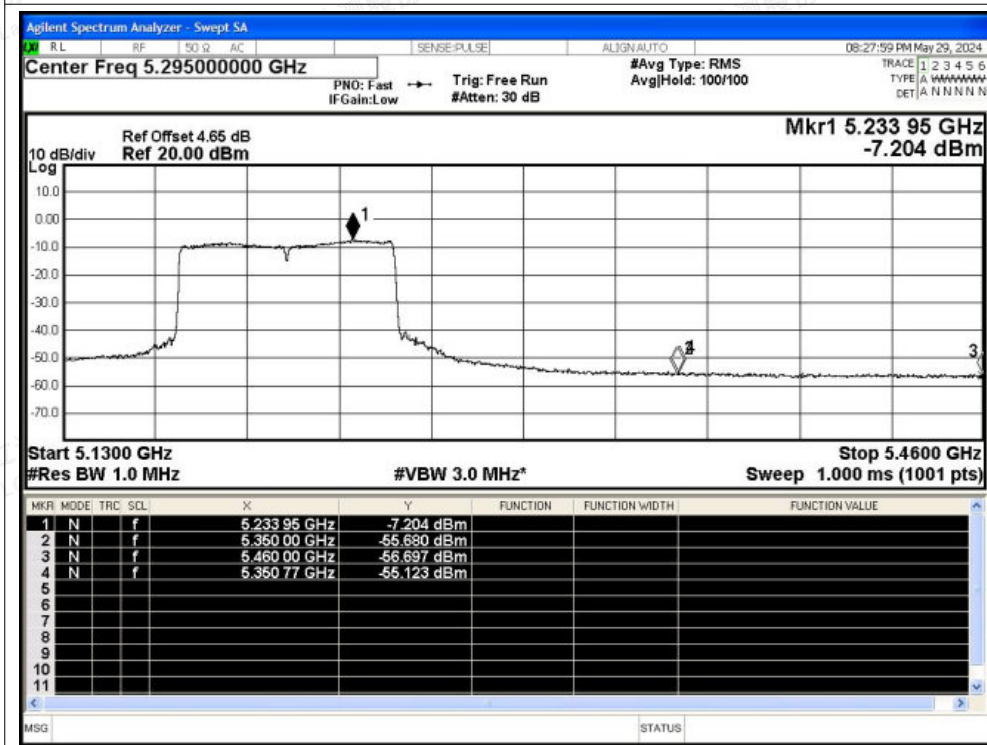

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

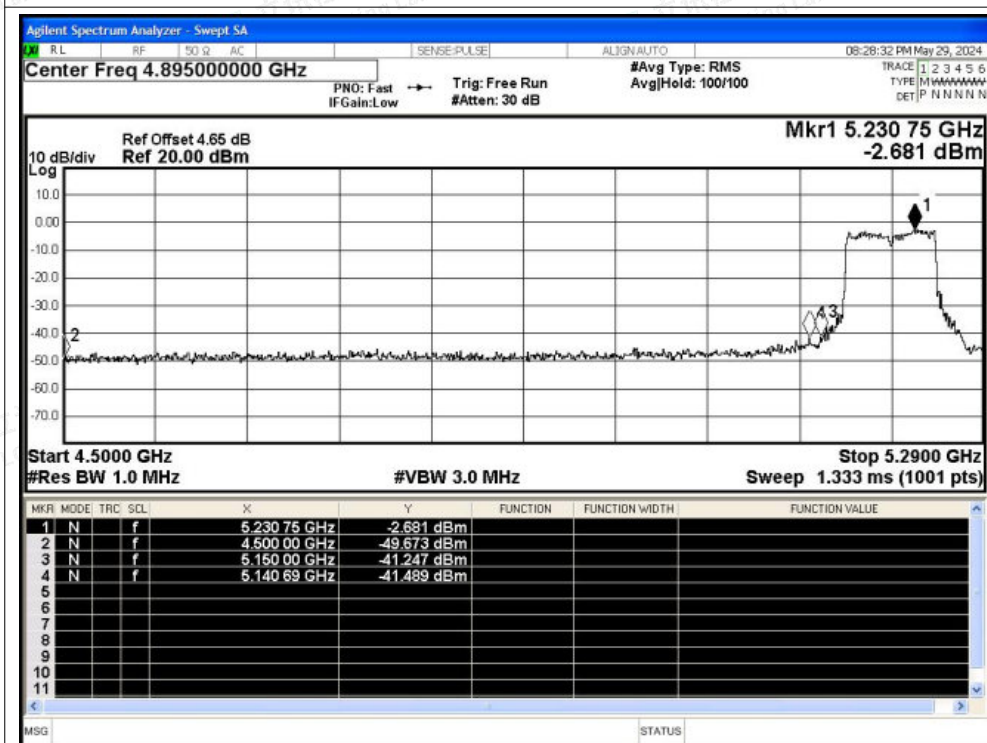

Restrict Band NVNT ac80 5210MHz Ant1 Average

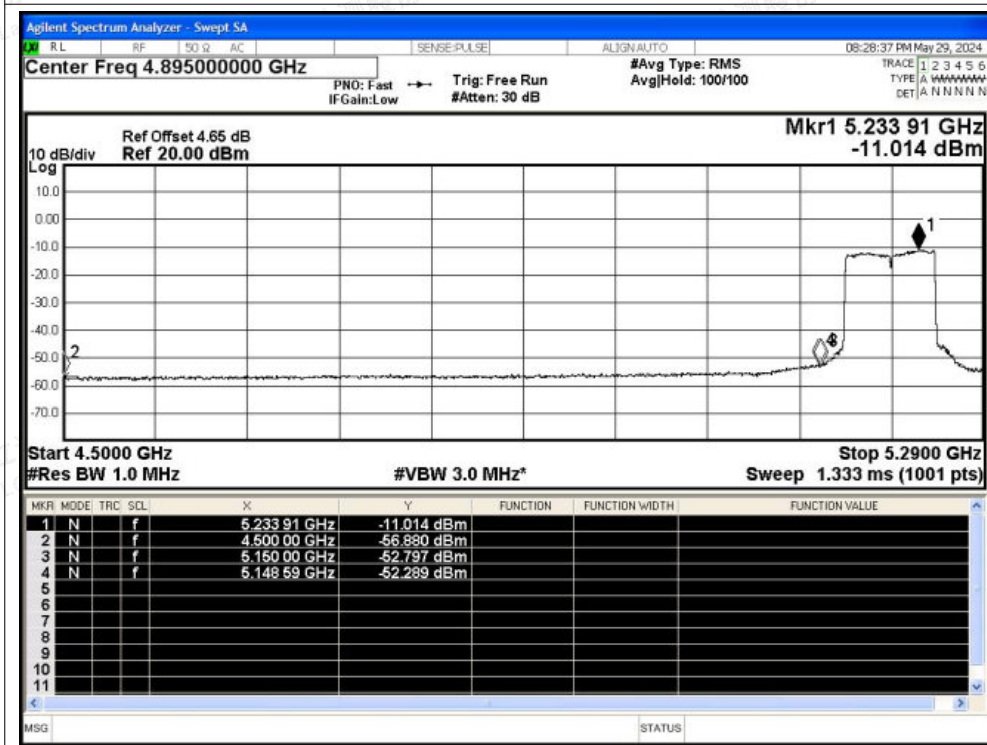

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-48.34	2	-	48.92	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-57.32	2	0.27	40.21	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-43.68	2	-	53.58	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-54.71	2	0.27	42.82	Average	54	Pass
NVNT	a	5180	Ant2	5150	-47.6	2	-	49.66	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-54.7	2	0.27	42.83	Average	54	Pass
NVNT	a	5240	Ant2	5350	-49.38	2	-	47.88	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.19	2	0.27	40.34	Average	54	Pass
NVNT	a	5240	Ant2	5436	-46.03	2	-	51.23	Peak	68.2	Pass
NVNT	a	5240	Ant2	5362.8	-56.45	2	0.27	41.08	Average	54	Pass
NVNT	a	5240	Ant2	5460	-48.16	2	-	49.1	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-56.81	2	0.27	40.72	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-47.87	2	-	49.39	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-57.63	2	0.32	39.95	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-41	2	-	56.26	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-53.51	2	0.32	44.07	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-39.9	2	-	57.36	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-52.47	2	0.32	45.11	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-47.27	2	-	49.99	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.37	2	0.32	40.21	Average	54	Pass
NVNT	n20	5240	Ant2	5383.2	-46.05	2	-	51.21	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5379.36	-56.52	2	0.32	41.06	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-48.67	2	-	48.59	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.51	2	0.32	40.07	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-48.02	2	-	49.24	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-57.33	2	0.33	40.26	Average	54	Pass
NVNT	n40	5190	Ant2	5147.51	-39.67	2	-	57.59	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-53.55	2	0.33	44.04	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-42.97	2	-	54.29	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-53.55	2	0.33	44.04	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-48.83	2	-	48.43	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.41	2	0.33	40.18	Average	54	Pass
NVNT	n40	5230	Ant2	5391.15	-46.18	2	-	51.08	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5451.9	-56.25	2	0.33	41.34	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-49.87	2	-	47.39	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-56.71	2	0.33	40.88	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-48.91	2	-	48.35	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-57	2	0.31	40.57	Average	54	Pass






NVNT	ac20	5180	Ant2	5147.5	-41.81	2	-	55.45	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-54.87	2	0.31	42.7	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-43.57	2	-	53.69	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-54.05	2	0.31	43.52	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-48.13	2	-	49.13	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.57	2	0.31	40	Average	54	Pass
NVNT	ac20	5240	Ant2	5366.4	-46.08	2	-	51.18	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5449.68	-56.3	2	0.31	41.27	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-47.69	2	-	49.57	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.05	2	0.31	40.52	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-48.75	2	-	48.51	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.03	2	0.33	40.56	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.97	-40.72	2	-	56.54	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-53.07	2	0.33	44.52	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-42.88	2	-	54.38	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-53.07	2	0.33	44.52	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-48.83	2	-	48.43	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.02	2	0.33	40.57	Average	54	Pass
NVNT	ac40	5230	Ant2	5377.11	-46.49	2	-	50.77	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5392.77	-56.05	2	0.33	41.54	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.49	2	-	47.77	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.41	2	0.33	40.18	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.43	2	-	48.83	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-55.58	2	0.25	41.93	Average	54	Pass
NVNT	ac80	5210	Ant2	5356.38	-44.81	2	-	52.45	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350.11	-55.58	2	0.25	41.93	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.19	2	-	48.07	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.13	2	0.25	41.38	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-48.35	2	-	48.91	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-57.32	2	0.25	40.19	Average	54	Pass
NVNT	ac80	5210	Ant2	5131.21	-38.69	2	-	58.57	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5144.64	-50.05	2	0.25	47.46	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.69	2	-	54.57	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-50.92	2	0.25	46.59	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

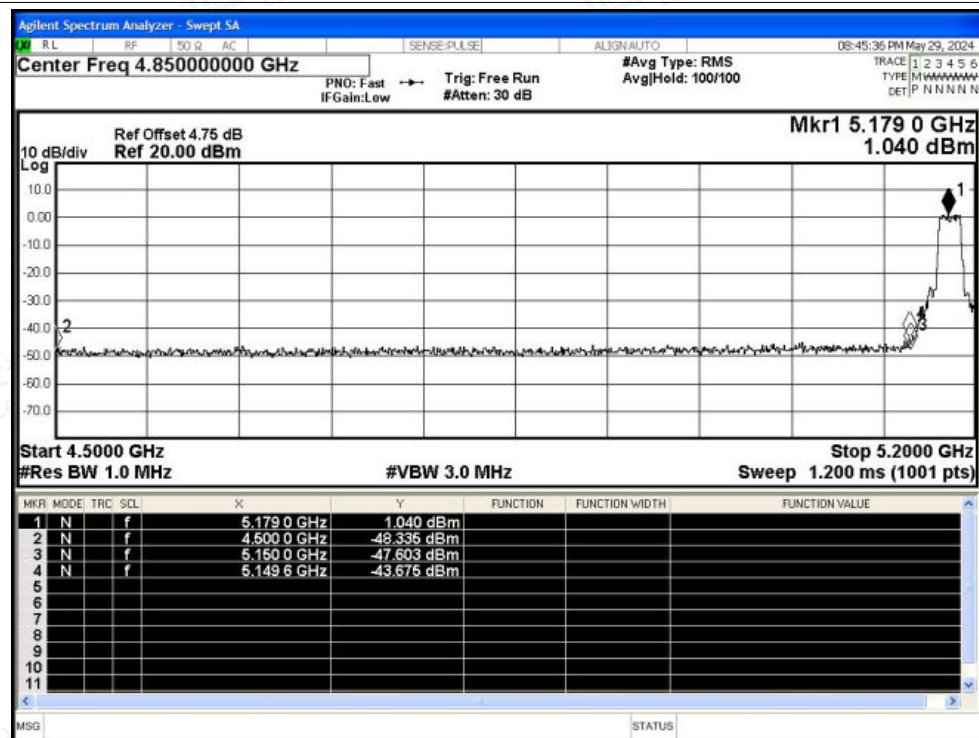

Restrict Band NVNT a 5180MHz Ant2 Average

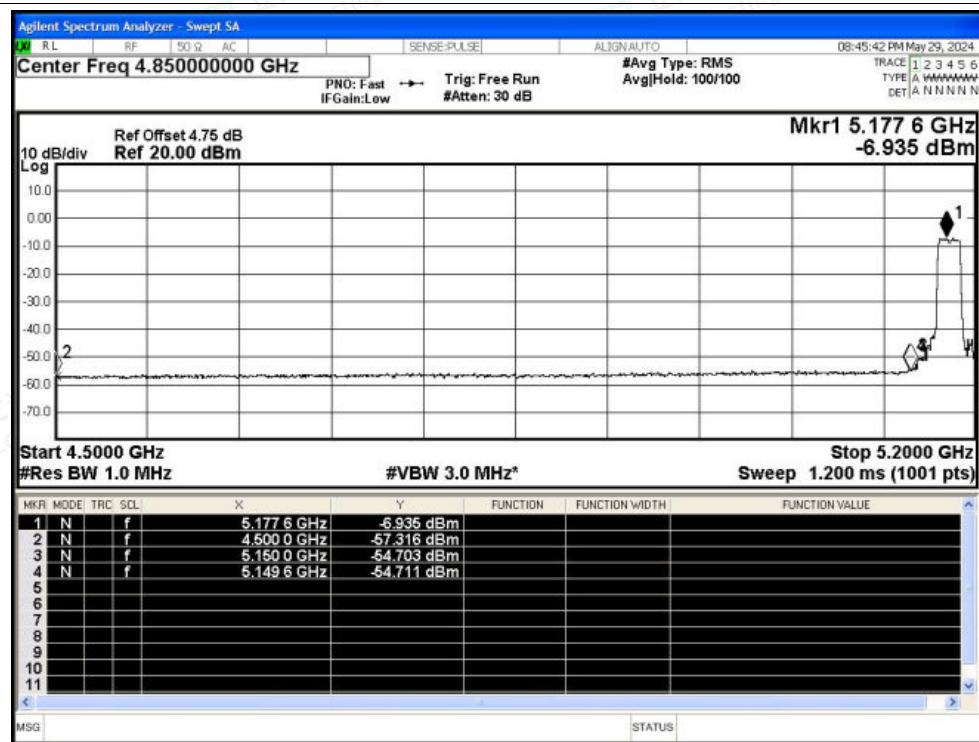

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

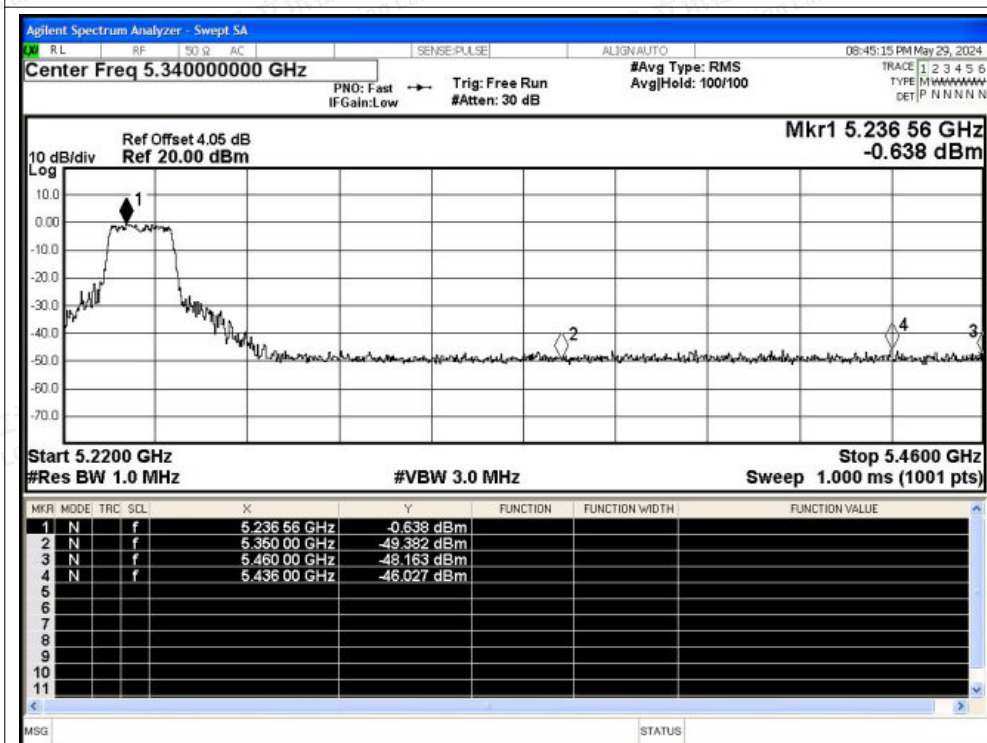

Restrict Band NVNT a 5240MHz Ant2 Average

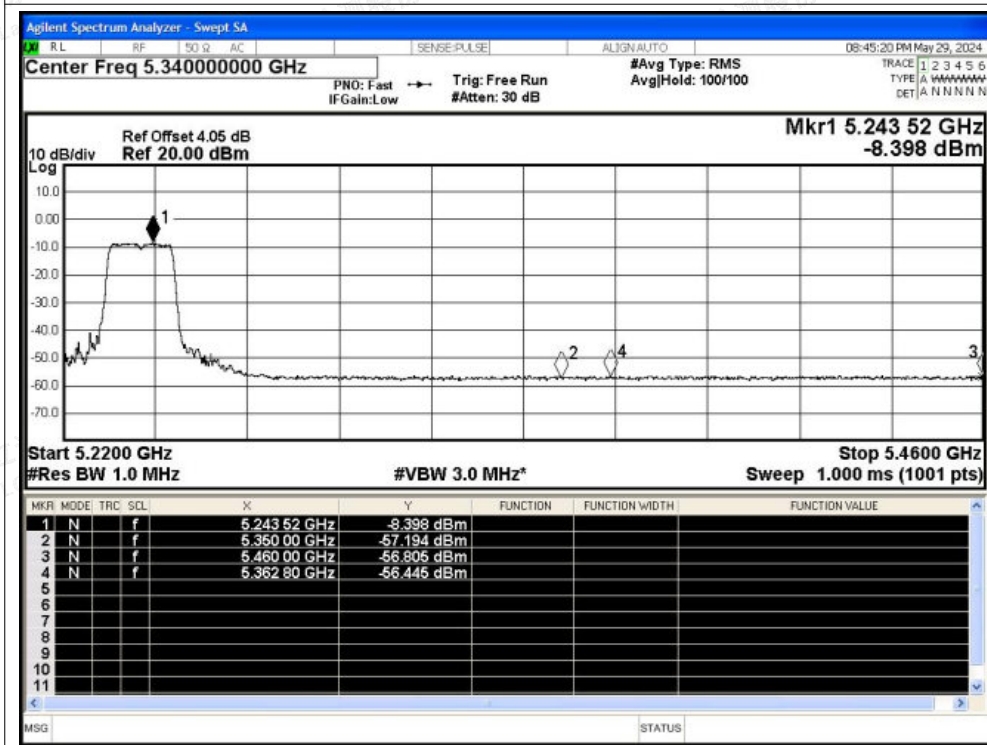

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

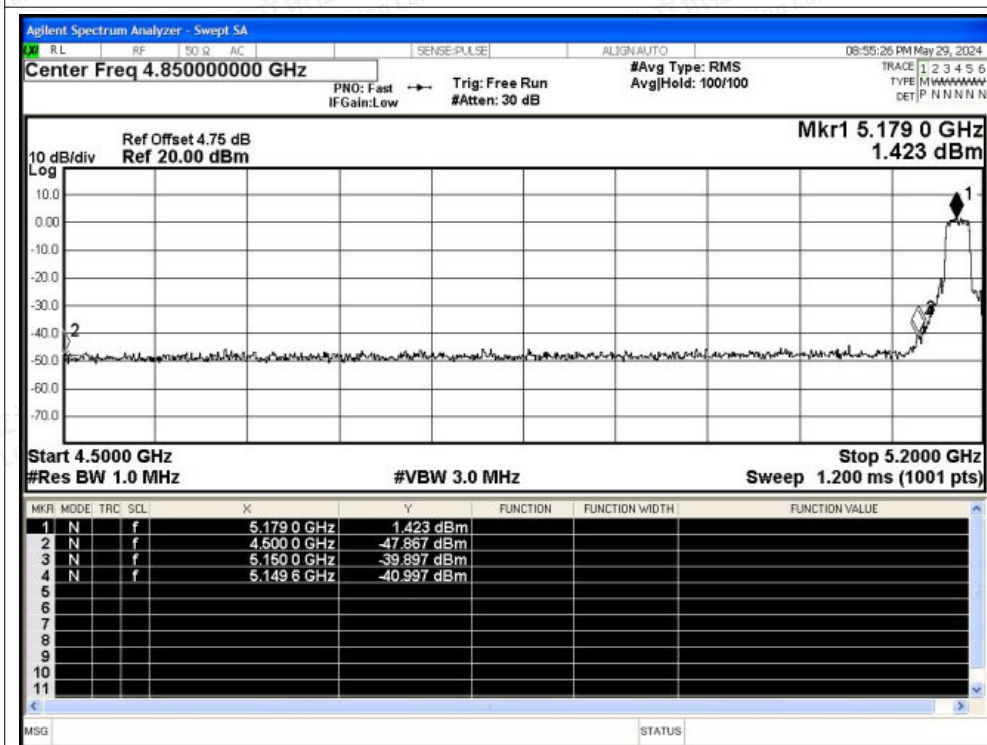

Restrict Band NVNT n20 5180MHz Ant2 Average

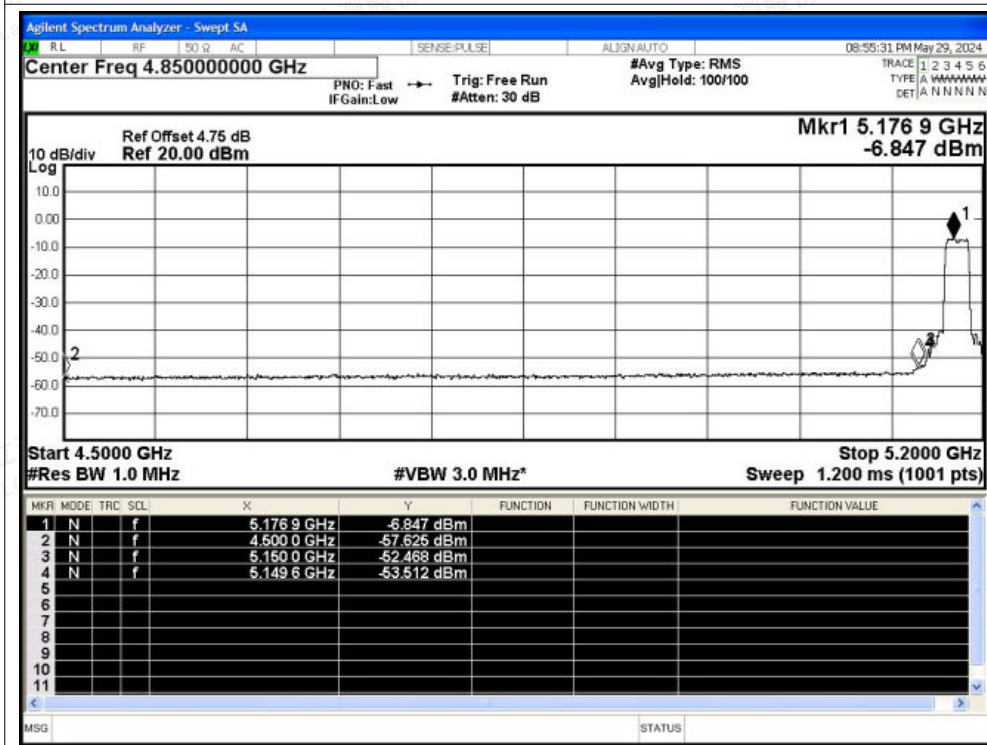

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

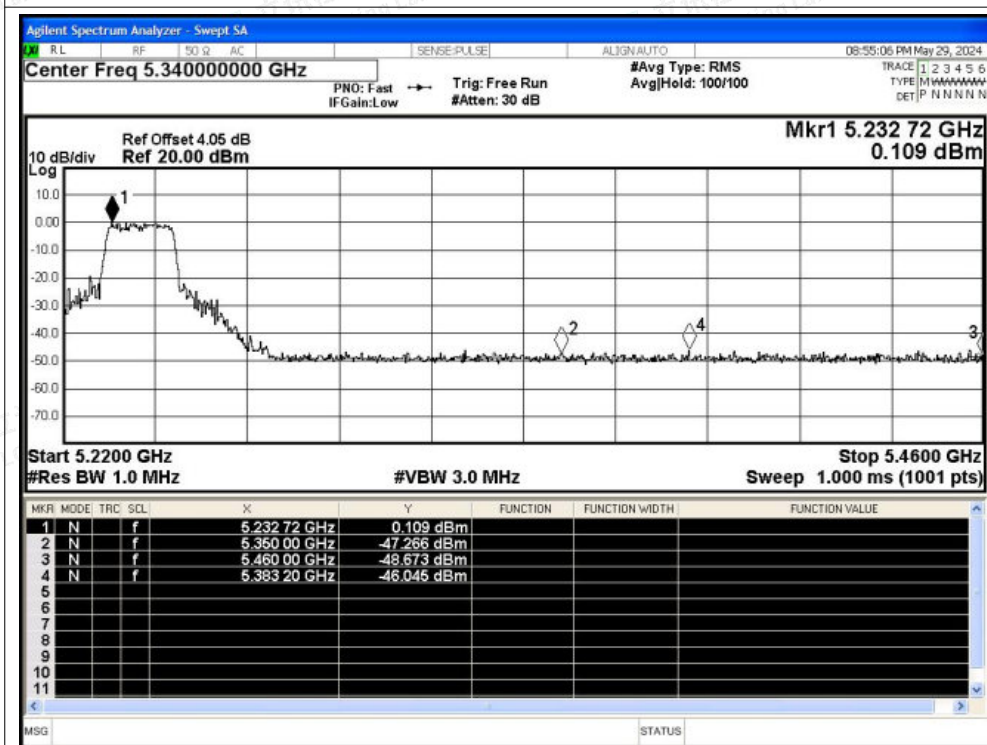


Restrict Band NVNT n20 5240MHz Ant2 Average

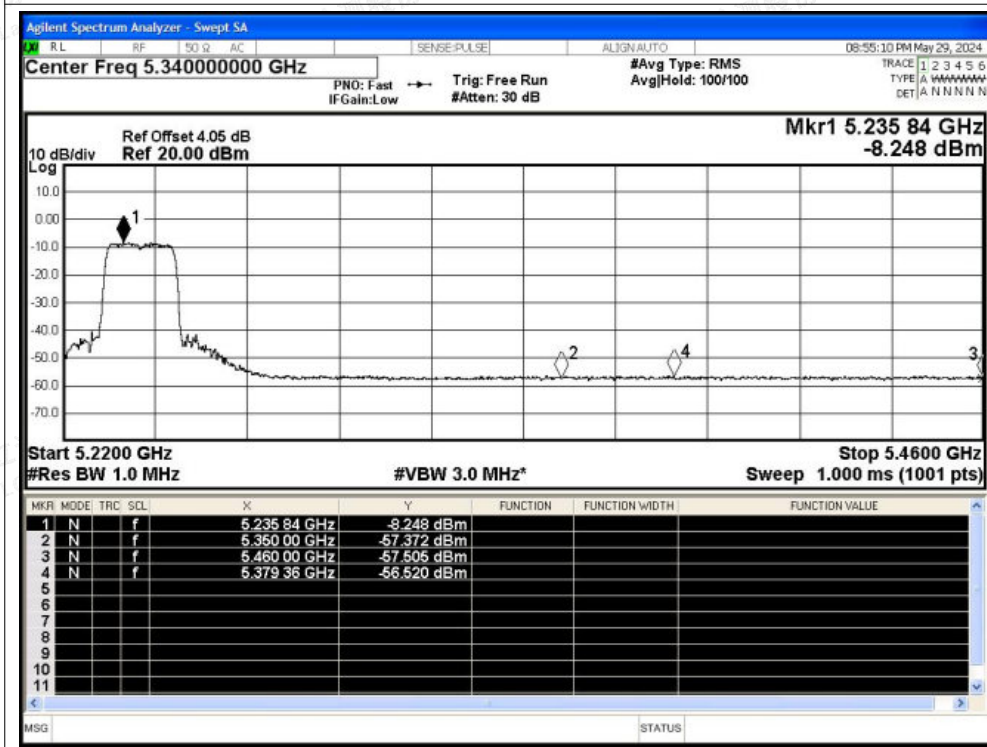




Restrict Band NVNT n40 5190MHz Ant2 Peak

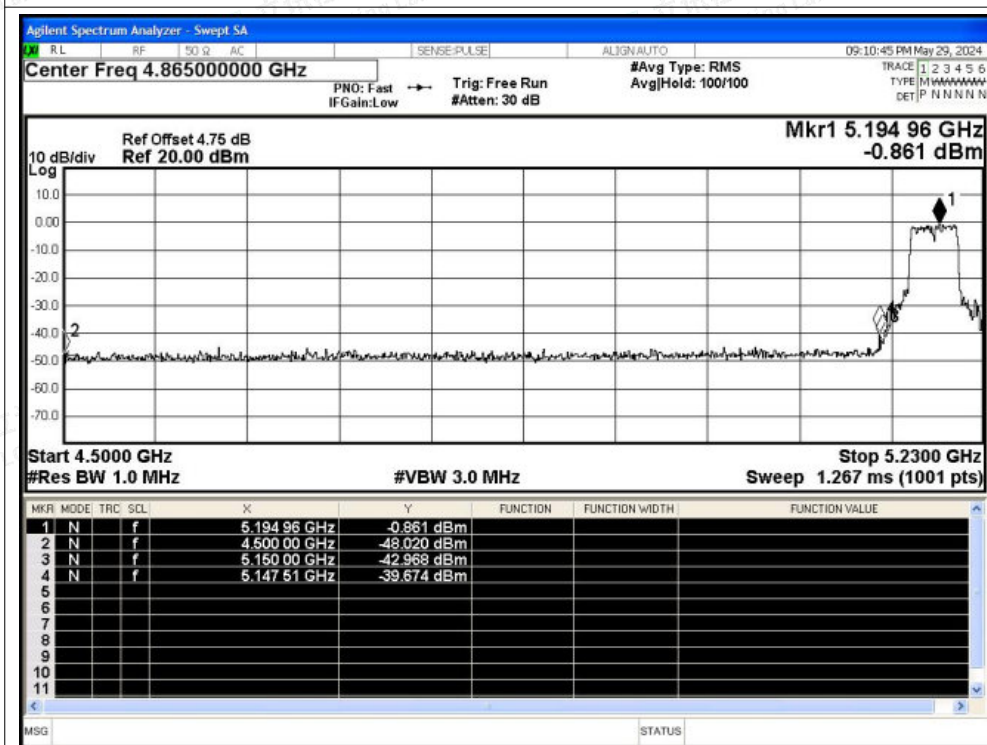

Restrict Band NVNT n40 5190MHz Ant2 Average

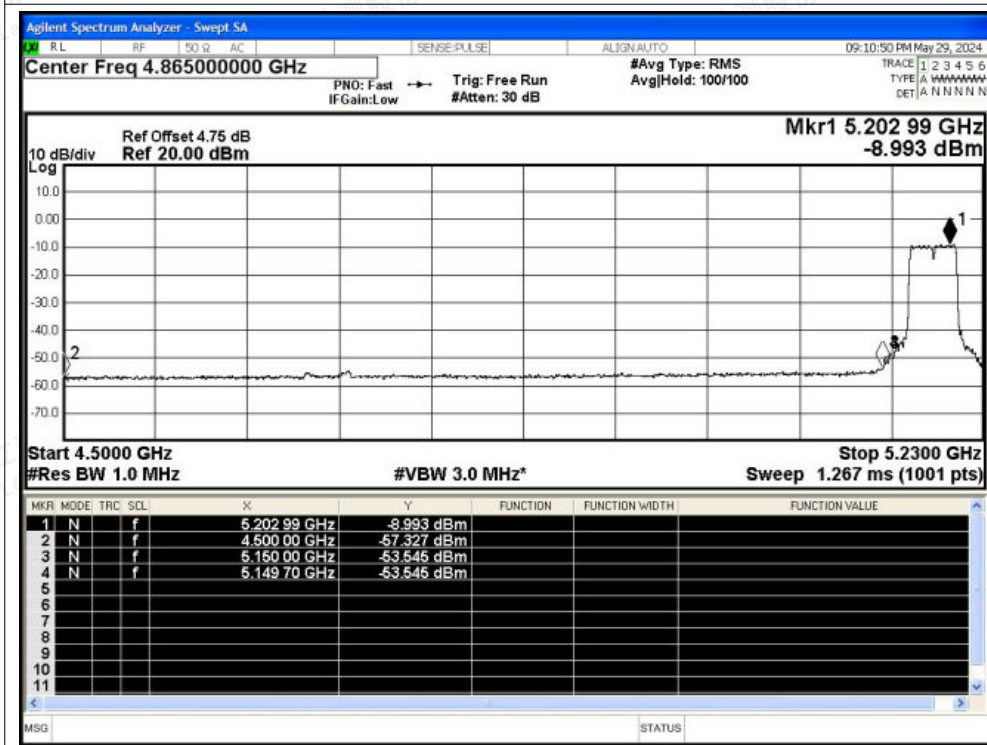

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

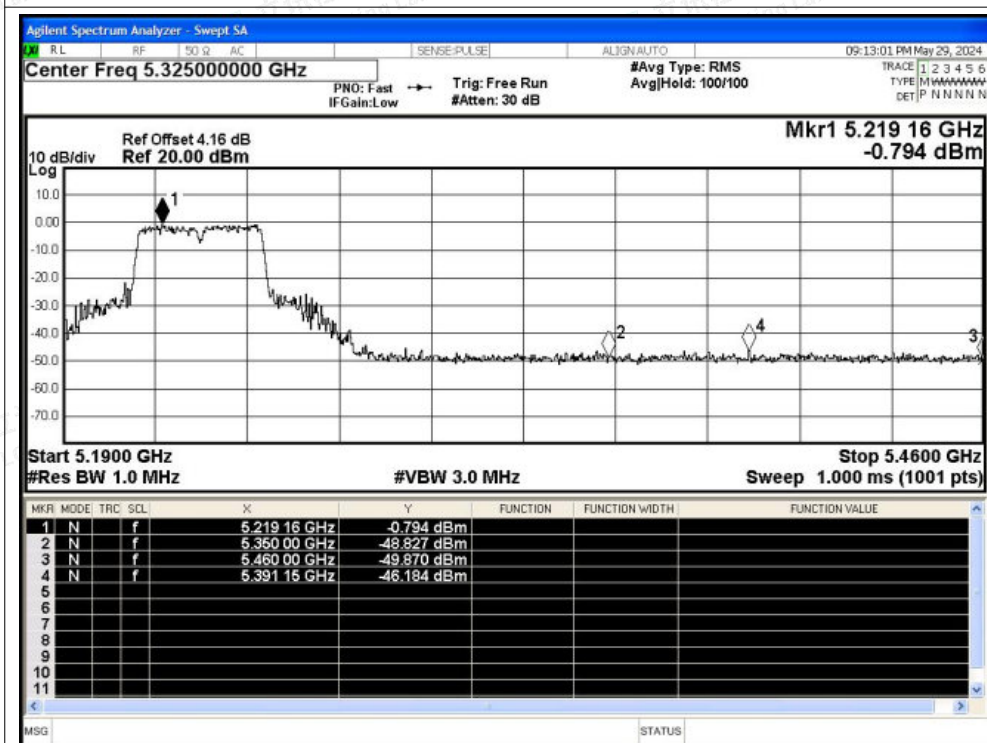

Restrict Band NVNT n40 5230MHz Ant2 Average

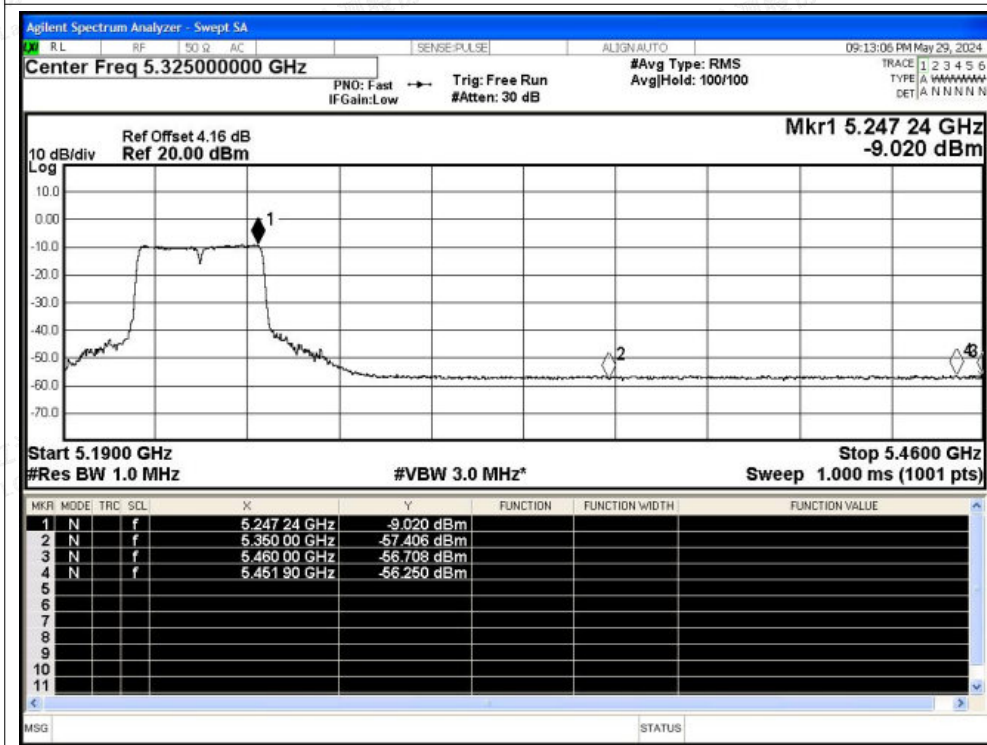

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

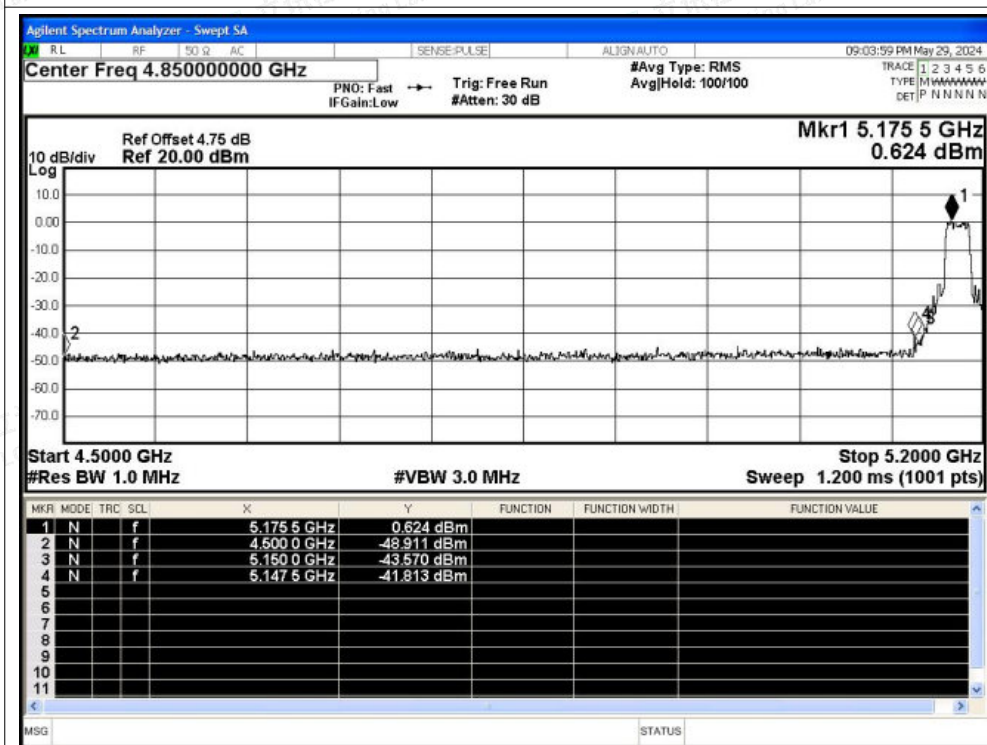

Restrict Band NVNT ac20 5180MHz Ant2 Average

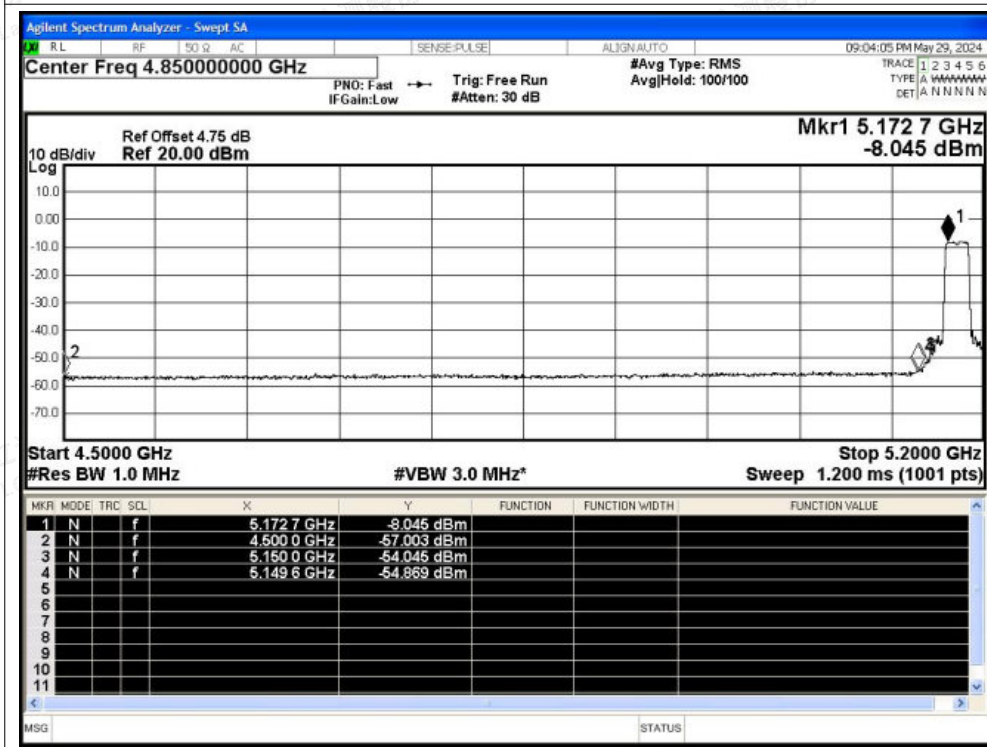

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

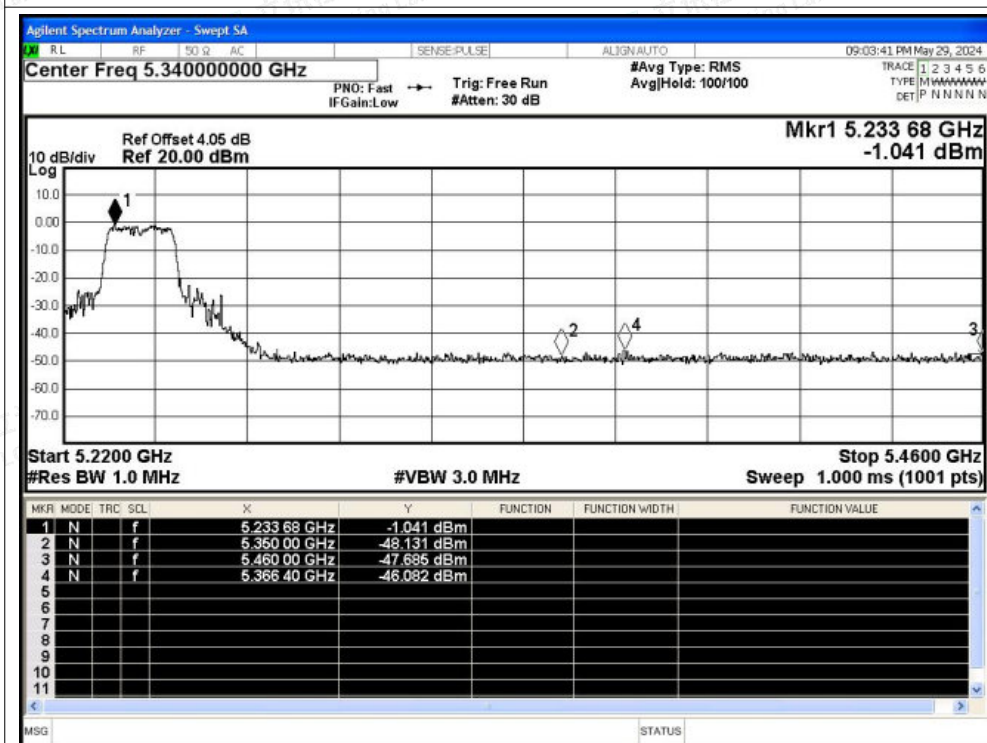

Restrict Band NVNT ac20 5240MHz Ant2 Average

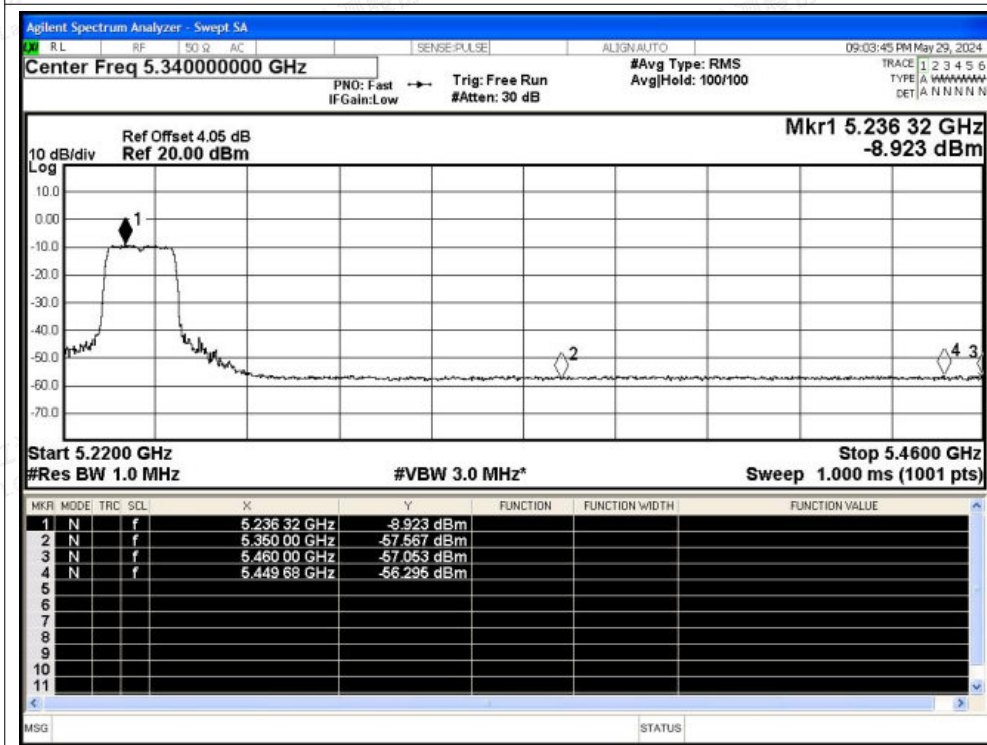

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity