





Restrict Band NVNT n40 5230MHz Ant1 Peak

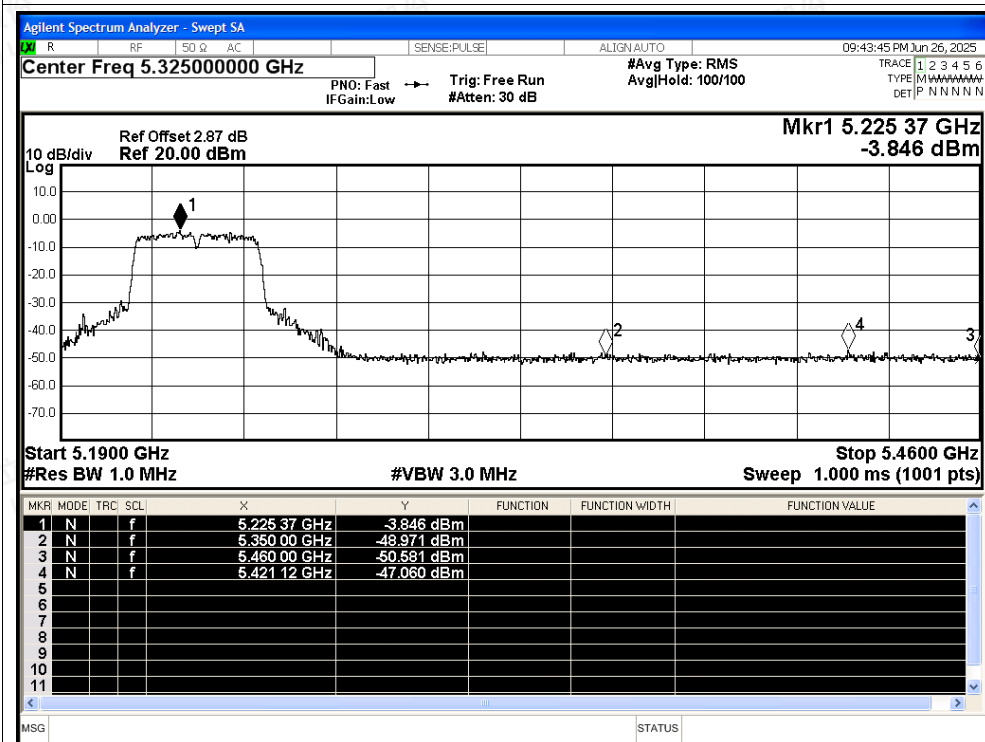

Restrict Band NVNT n40 5230MHz Ant1 Average

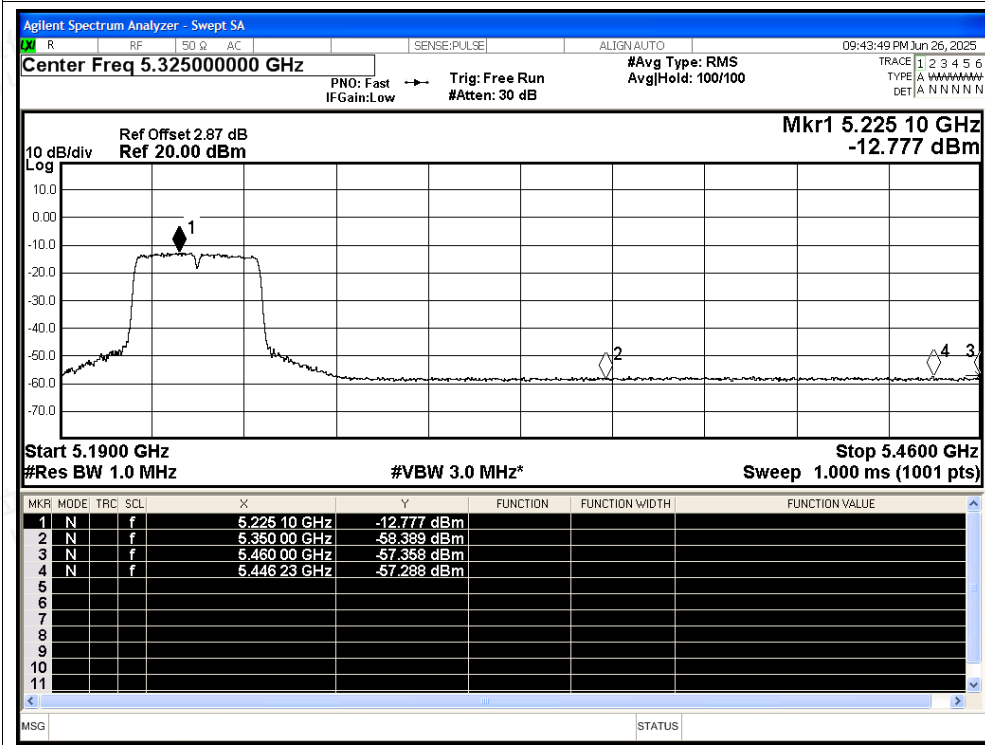

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

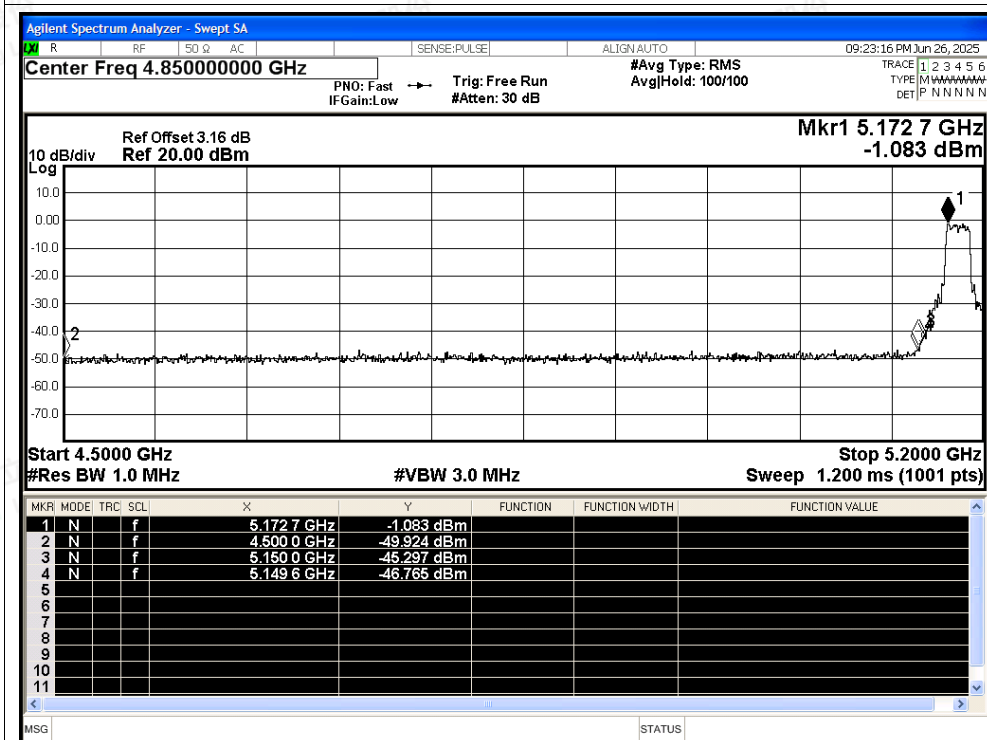

Restrict Band NVNT ac20 5180MHz Ant1 Average

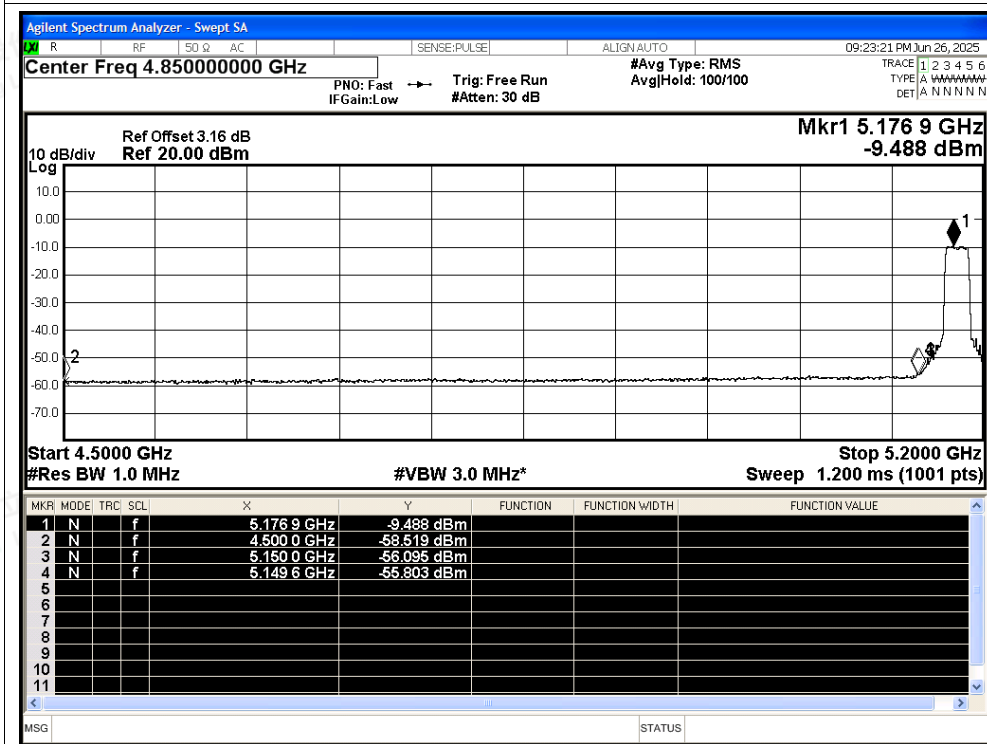

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

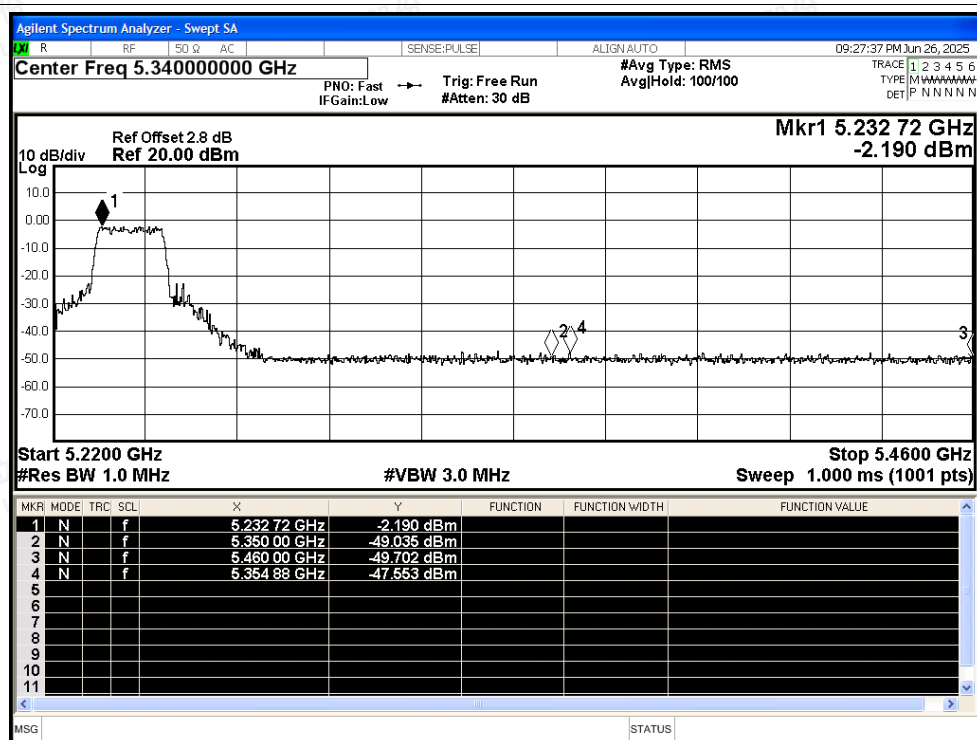

Restrict Band NVNT ac20 5240MHz Ant1 Average

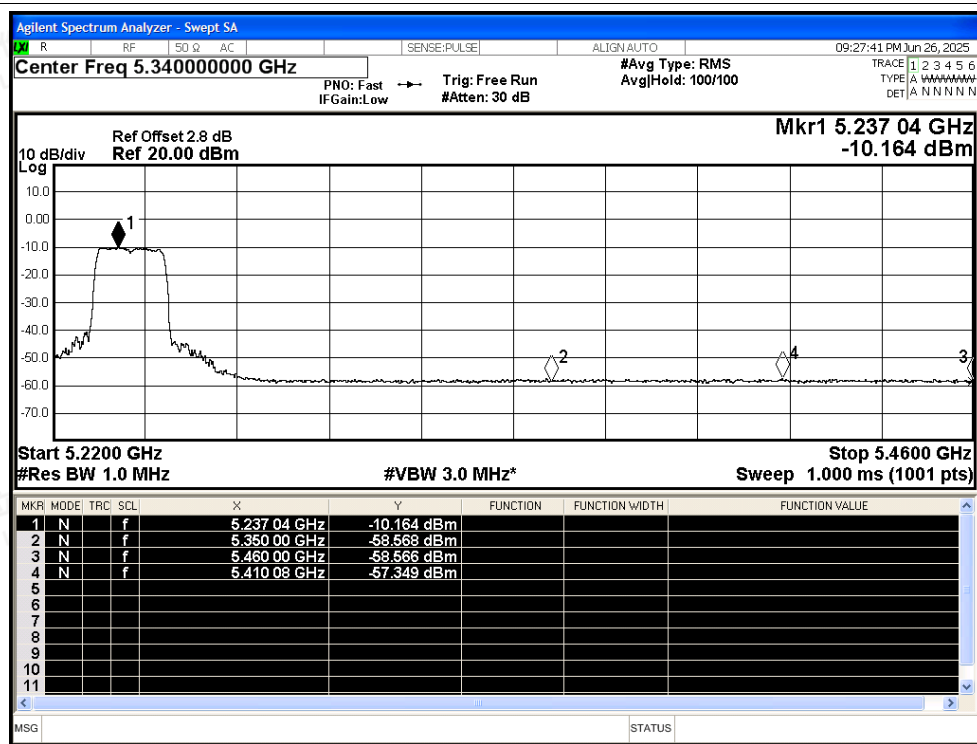

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

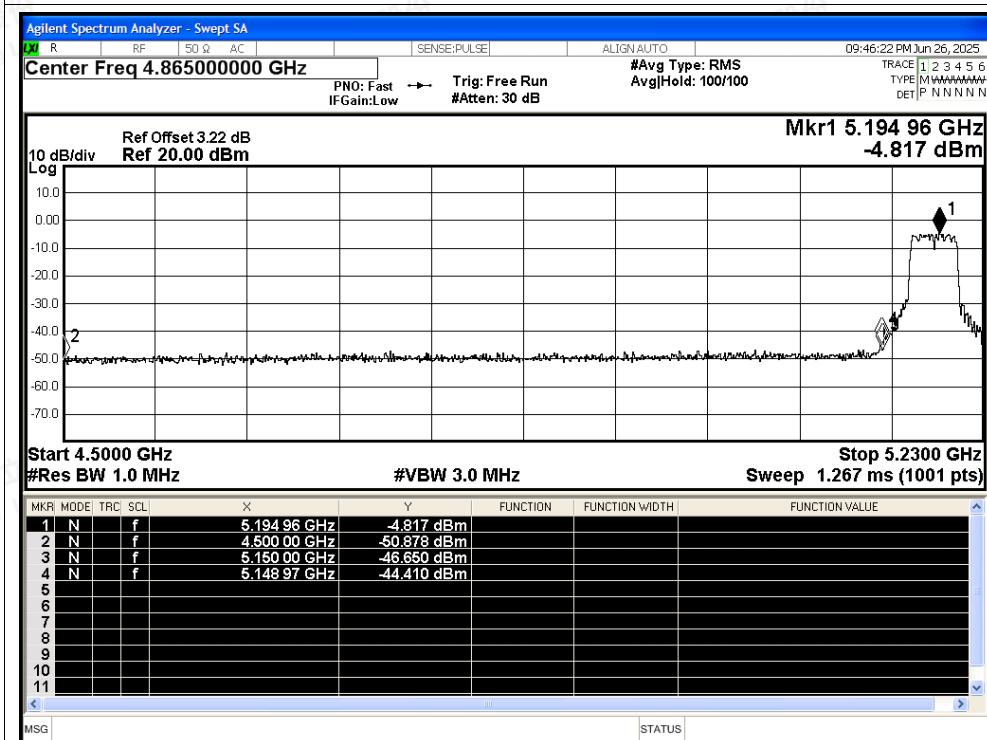

Restrict Band NVNT ac40 5190MHz Ant1 Average

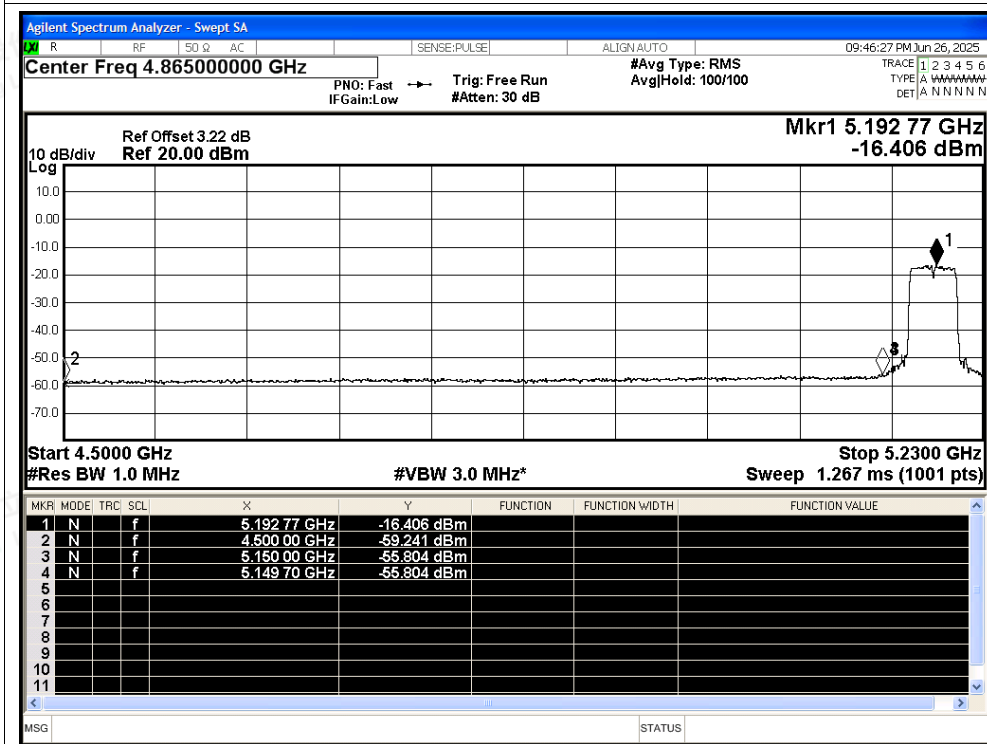

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

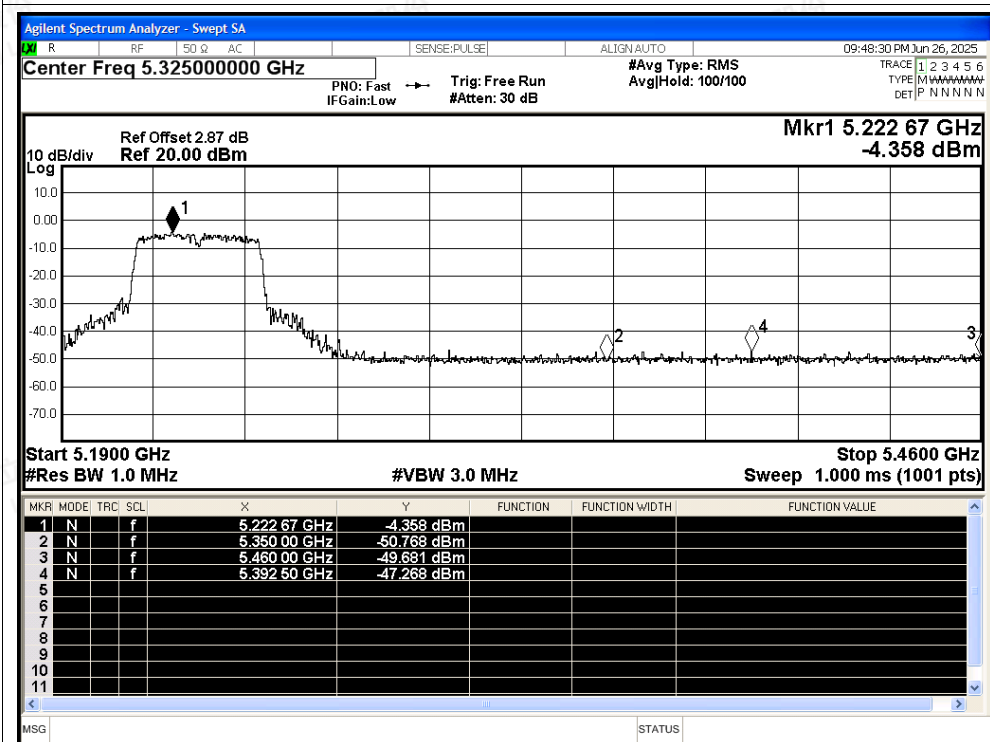

Restrict Band NVNT ac40 5230MHz Ant1 Average

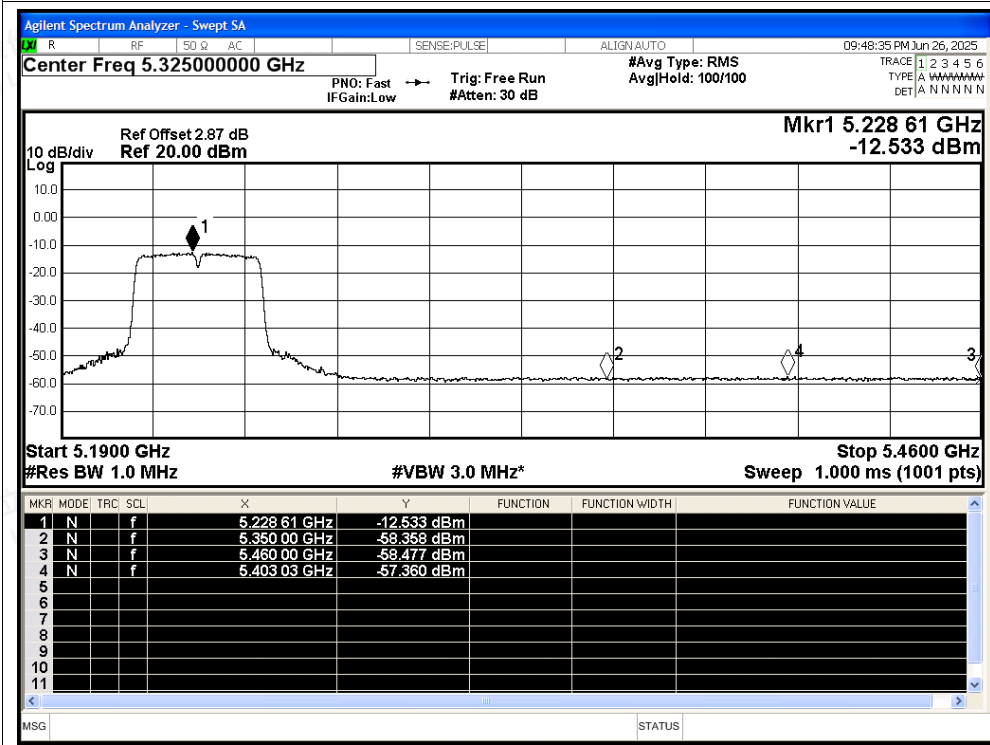

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

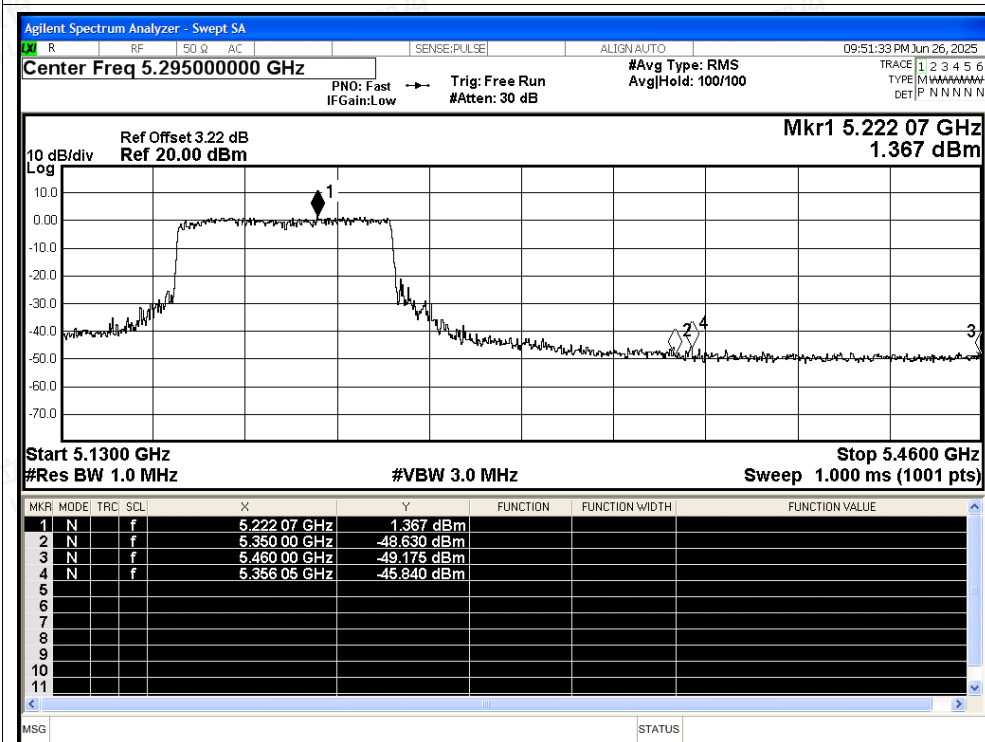

Restrict Band NVNT ac80 5210MHz Ant1 Average

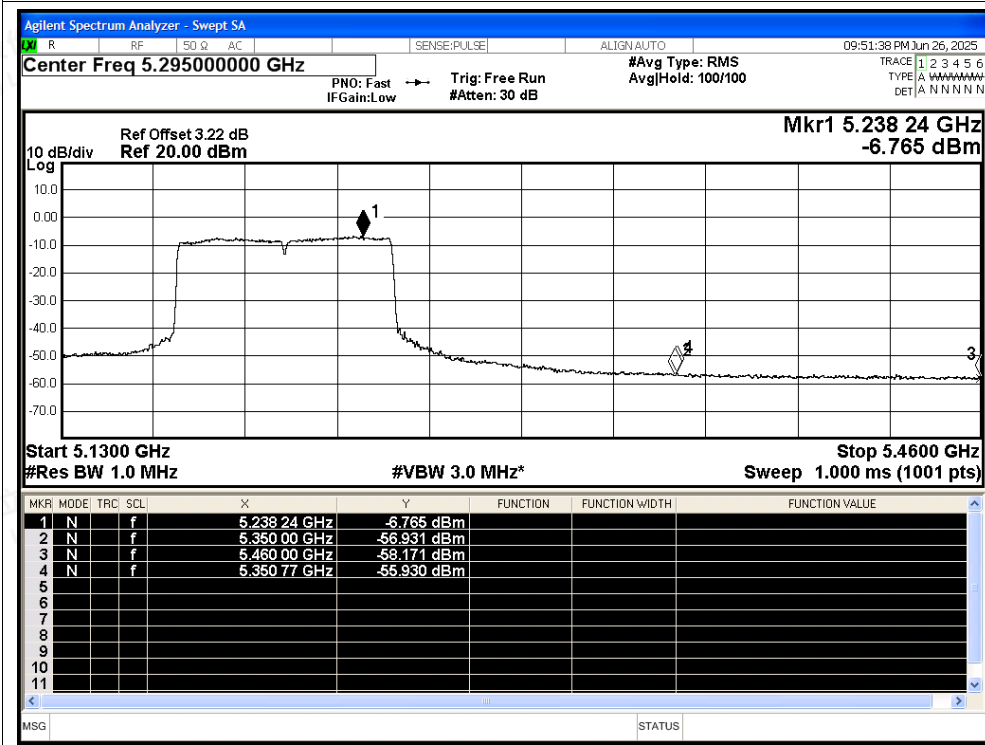

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

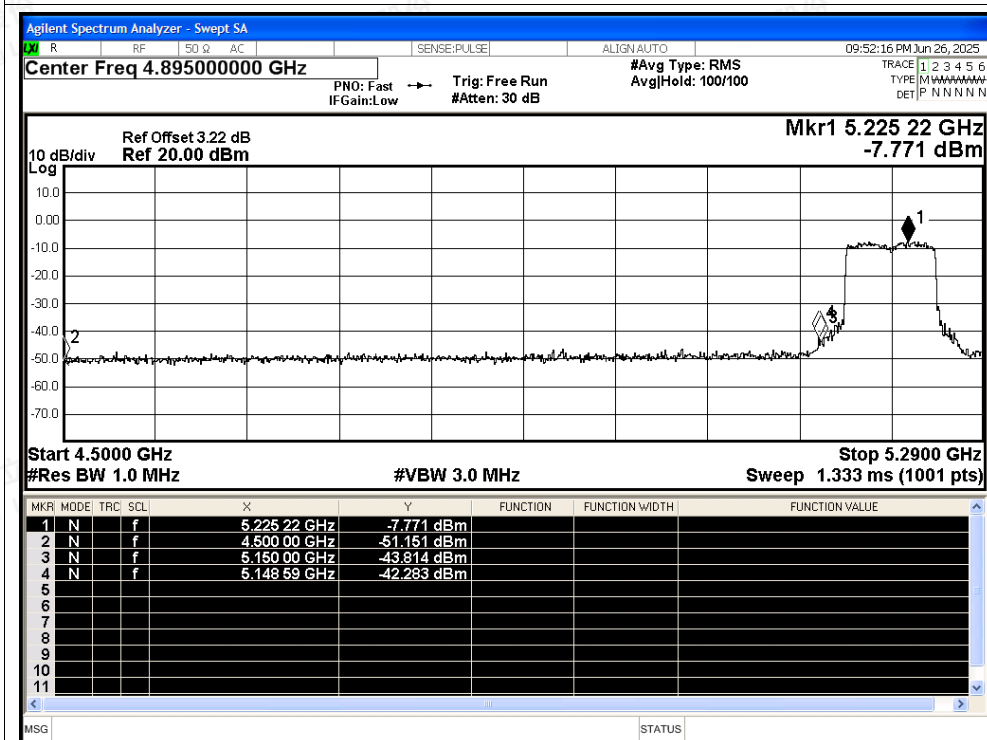

Restrict Band NVNT ac80 5210MHz Ant1 Average

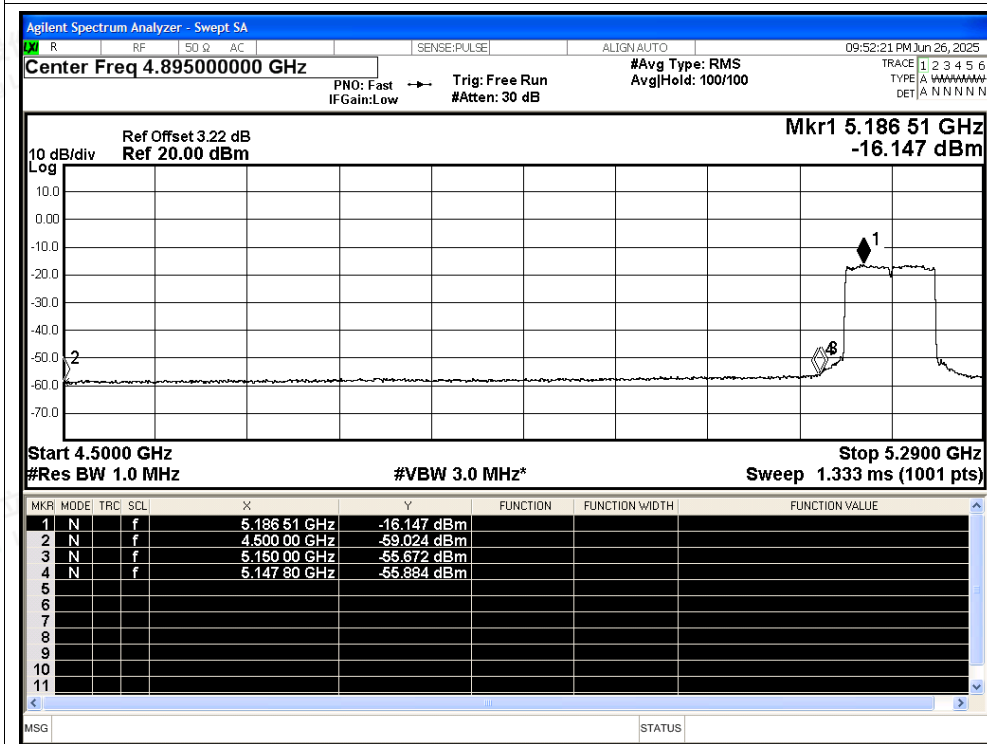

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.64	2.57	-	47.16	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.77	2.57	0.24	39.27	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-45.89	2.57	-	51.91	Peak	68.2	Pass
NVNT	a	5180	Ant2	5134.2	-56.21	2.57	0.24	41.83	Average	54	Pass
NVNT	a	5180	Ant2	5150	-48.78	2.57	-	49.02	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-56.74	2.57	0.24	41.30	Average	54	Pass
NVNT	a	5240	Ant2	5350	-49.29	2.57	-	48.51	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-58.36	2.57	0.24	39.68	Average	54	Pass
NVNT	a	5240	Ant2	5375.52	-46.85	2.57	-	50.95	Peak	68.2	Pass
NVNT	a	5240	Ant2	5367.84	-57.22	2.57	0.24	40.82	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.61	2.57	-	48.19	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-58.25	2.57	0.24	39.79	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-51.2	2.57	-	46.60	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.54	2.57	0.12	39.38	Average	54	Pass
NVNT	n20	5180	Ant2	5136.3	-46.54	2.57	-	51.26	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-56.07	2.57	0.12	41.85	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-45.59	2.57	-	52.21	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-56.55	2.57	0.12	41.37	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-50.2	2.57	-	47.60	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-58.39	2.57	0.12	39.53	Average	54	Pass
NVNT	n20	5240	Ant2	5385.36	-47.07	2.57	-	50.73	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5368.8	-57.33	2.57	0.12	40.59	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-48.94	2.57	-	48.86	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-58.12	2.57	0.12	39.80	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-51.27	2.57	-	46.53	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.87	2.57	0.24	39.17	Average	54	Pass
NVNT	n40	5190	Ant2	5148.97	-43.88	2.57	-	53.92	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5146.78	-55.35	2.57	0.24	42.69	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-45.68	2.57	-	52.12	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-56.3	2.57	0.24	41.74	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-48.42	2.57	-	49.38	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-58.06	2.57	0.24	39.98	Average	54	Pass
NVNT	n40	5230	Ant2	5391.42	-47.29	2.57	-	50.51	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5377.11	-57.3	2.57	0.24	40.74	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-48.51	2.57	-	49.29	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.38	2.57	0.24	39.66	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-50.85	2.57	-	46.95	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-58.42	2.57	0.12	39.50	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-42.97	2.57	-	54.83	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5148.9	-56	2.57	0.12	41.92	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-44.83	2.57	-	52.97	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-55.52	2.57	0.12	42.40	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-48.94	2.57	-	48.86	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.89	2.57	0.12	40.03	Average	54	Pass
NVNT	ac20	5240	Ant2	5360.88	-47.58	2.57	-	50.22	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5447.28	-57.39	2.57	0.12	40.53	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.7	2.57	-	47.10	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.25	2.57	0.12	39.67	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.65	2.57	-	47.15	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-59.13	2.57	0.24	38.91	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-44.06	2.57	-	53.74	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.24	-55.49	2.57	0.24	42.55	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-44.06	2.57	-	53.74	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-55.69	2.57	0.24	42.35	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-51.23	2.57	-	46.57	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-58.3	2.57	0.24	39.74	Average	54	Pass
NVNT	ac40	5230	Ant2	5381.7	-46.88	2.57	-	50.92	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5444.34	-57.27	2.57	0.24	40.77	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.41	2.57	-	48.39	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.03	2.57	0.24	40.01	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.39	2.57	-	49.41	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.6	2.57	0.47	41.67	Average	54	Pass
NVNT	ac80	5210	Ant2	5425.35	-46.21	2.57	-	51.59	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5360.34	-56.34	2.57	0.47	41.93	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.03	2.57	-	48.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-58.03	2.57	0.47	40.24	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-50.55	2.57	-	47.25	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-59.17	2.57	0.47	39.10	Average	54	Pass
NVNT	ac80	5210	Ant2	5147.01	-45.03	2.57	-	52.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-55.46	2.57	0.47	42.81	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-46.82	2.57	-	50.98	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-55.71	2.57	0.47	42.56	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

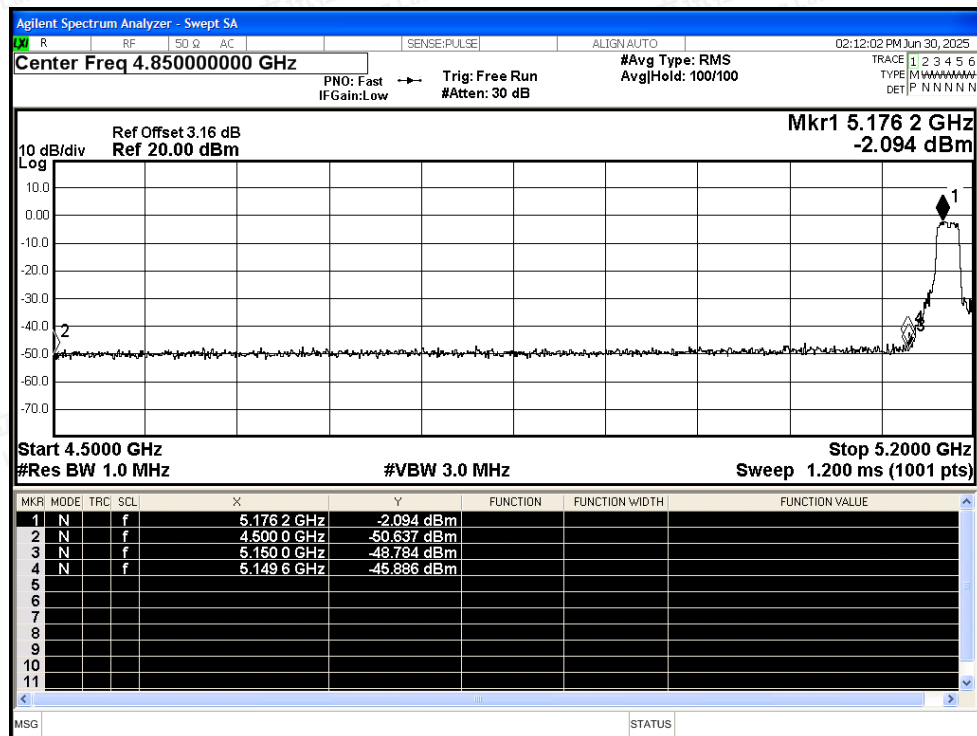

Restrict Band NVNT a 5180MHz Ant2 Average

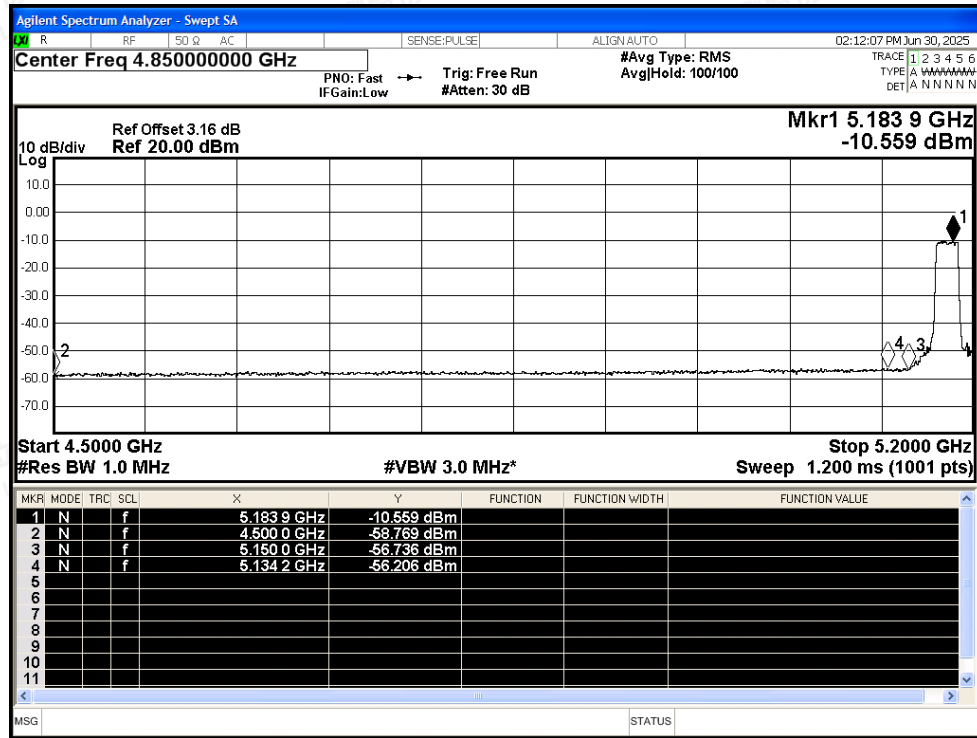

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

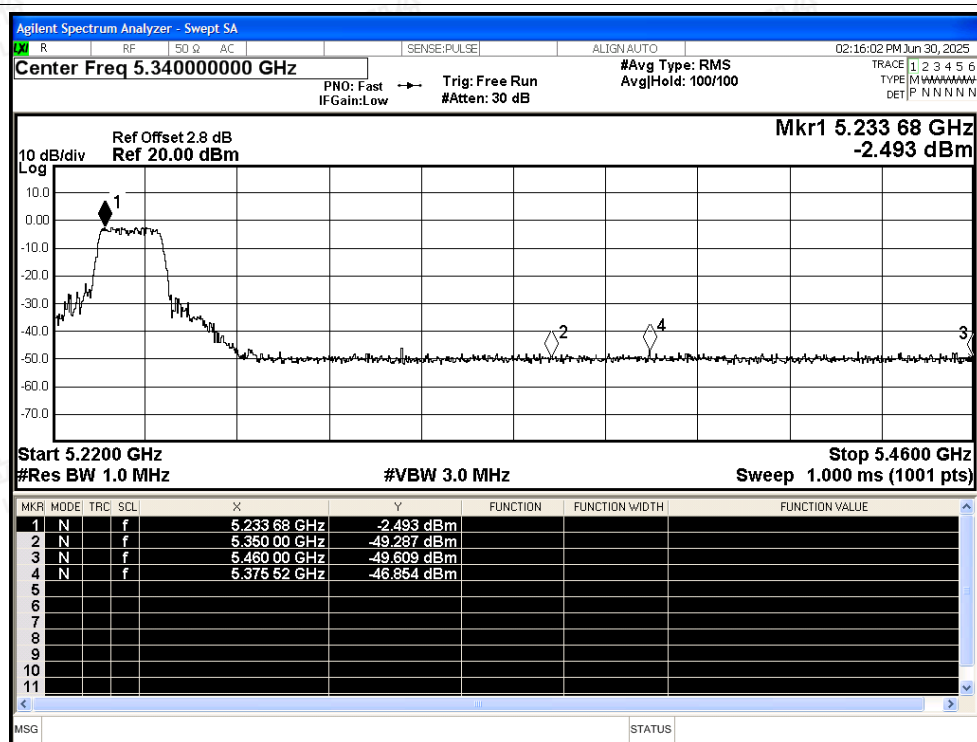

Restrict Band NVNT a 5240MHz Ant2 Average

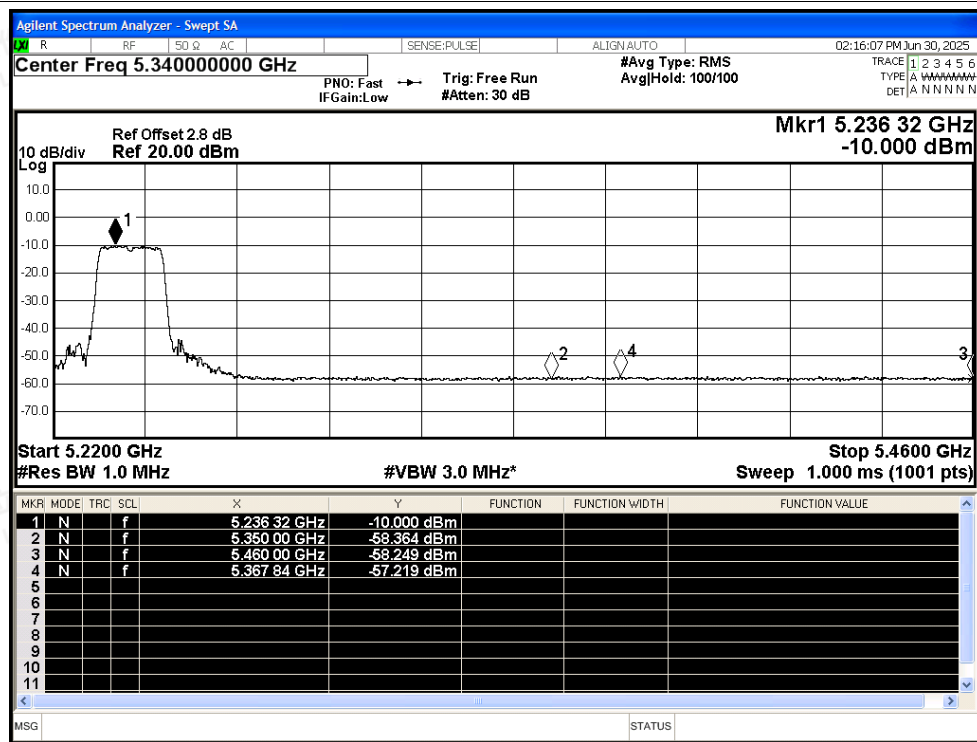

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

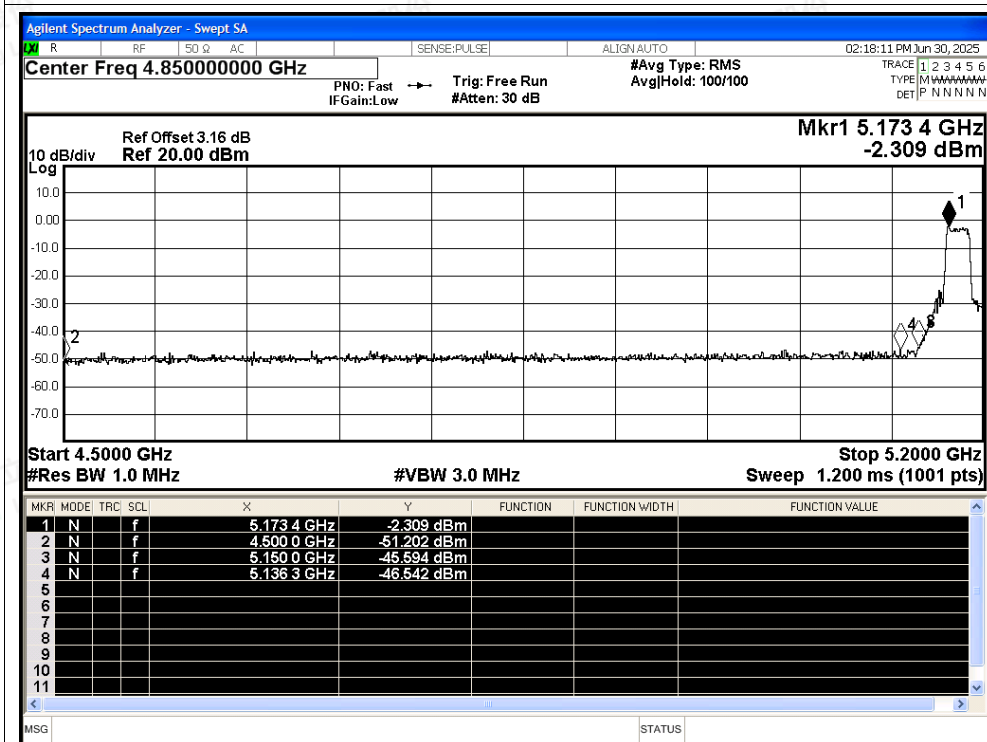

Restrict Band NVNT n20 5180MHz Ant2 Average

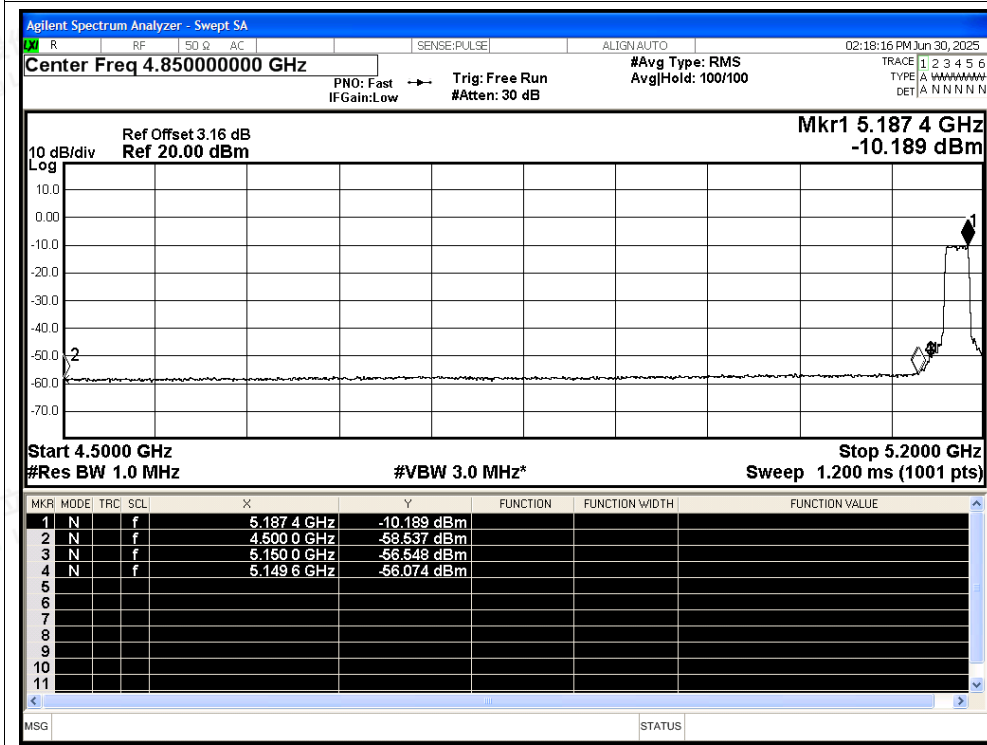

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

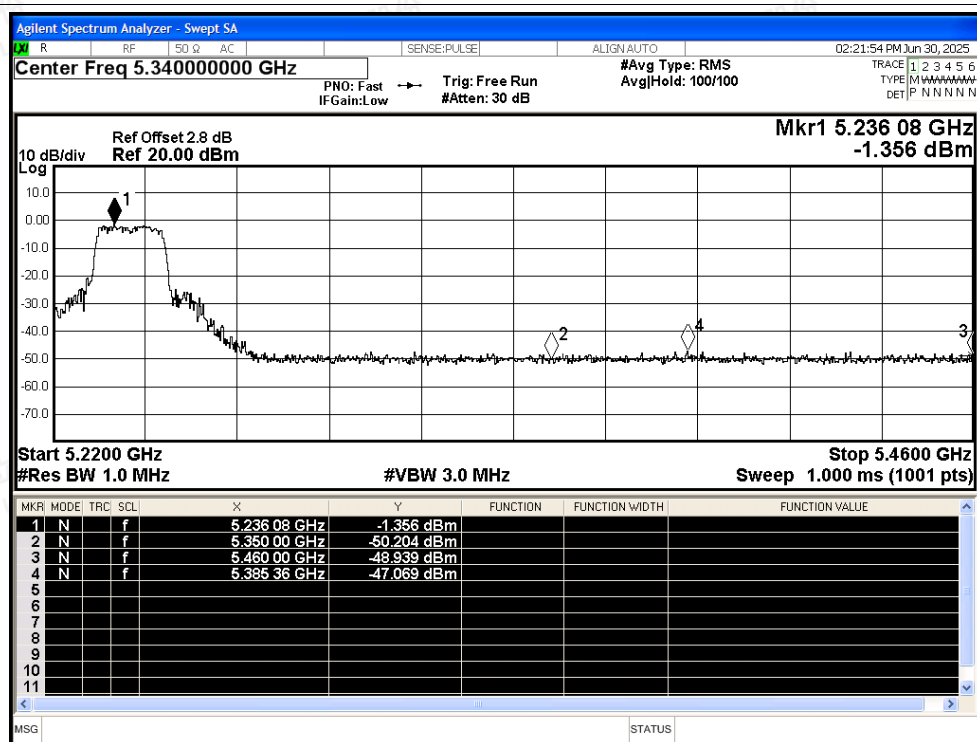

Restrict Band NVNT n20 5240MHz Ant2 Average

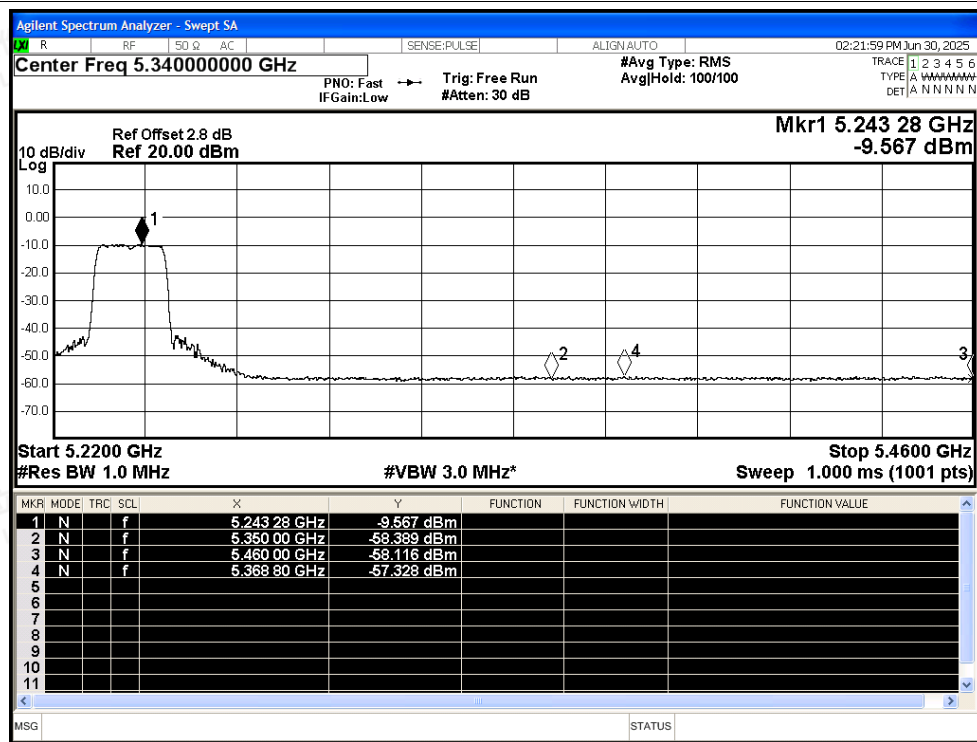

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

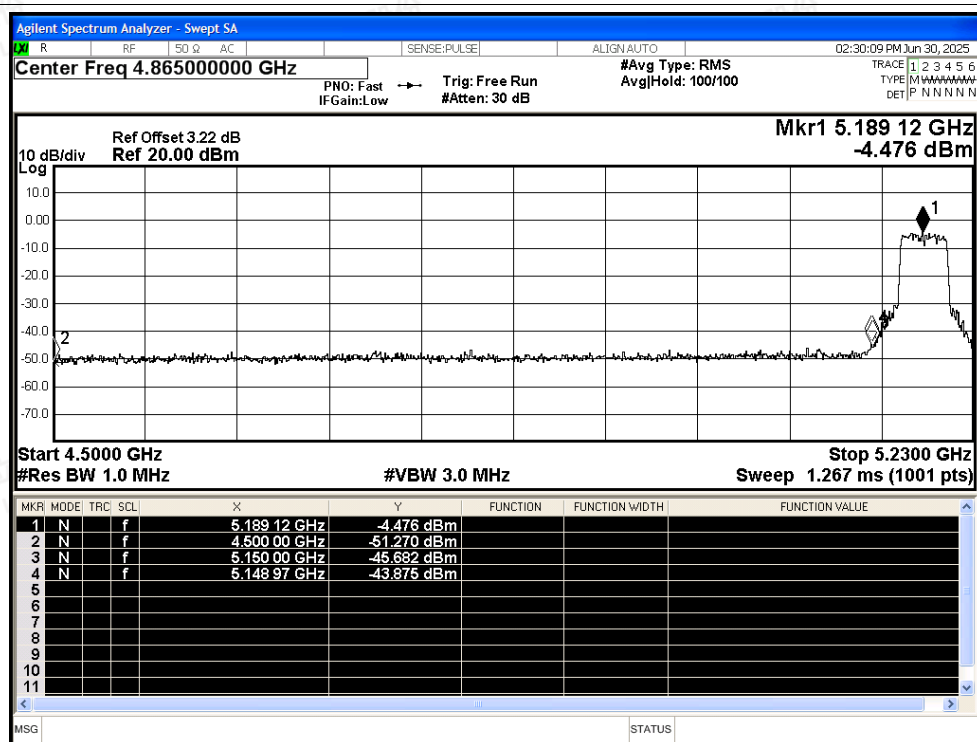

Restrict Band NVNT n40 5190MHz Ant2 Average

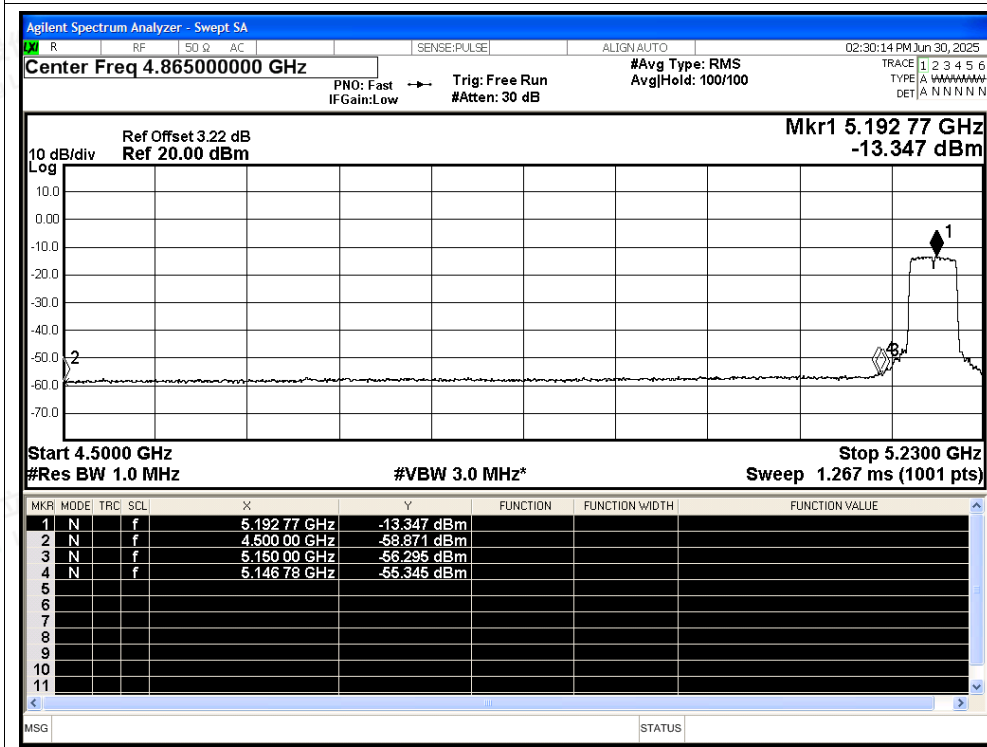

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

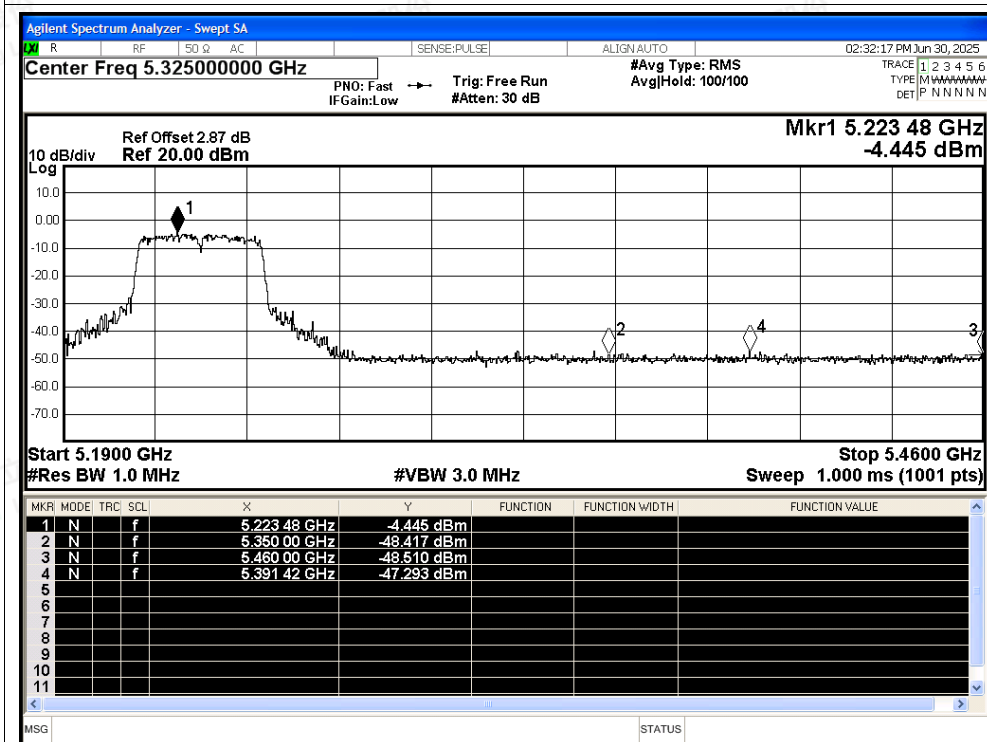

Restrict Band NVNT n40 5230MHz Ant2 Average

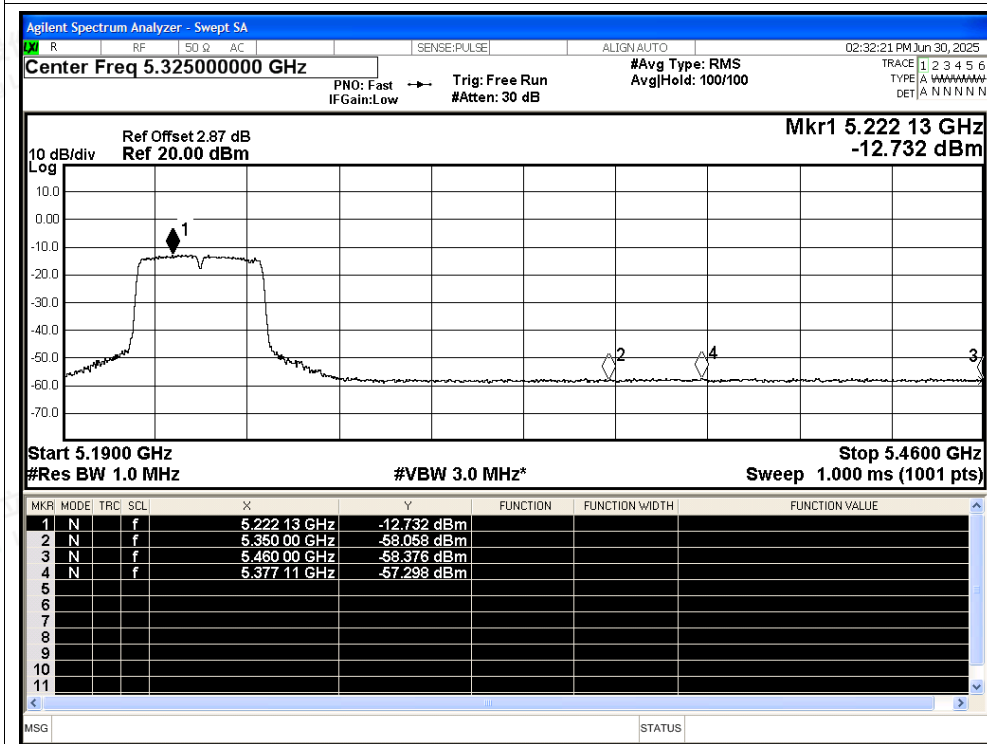

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

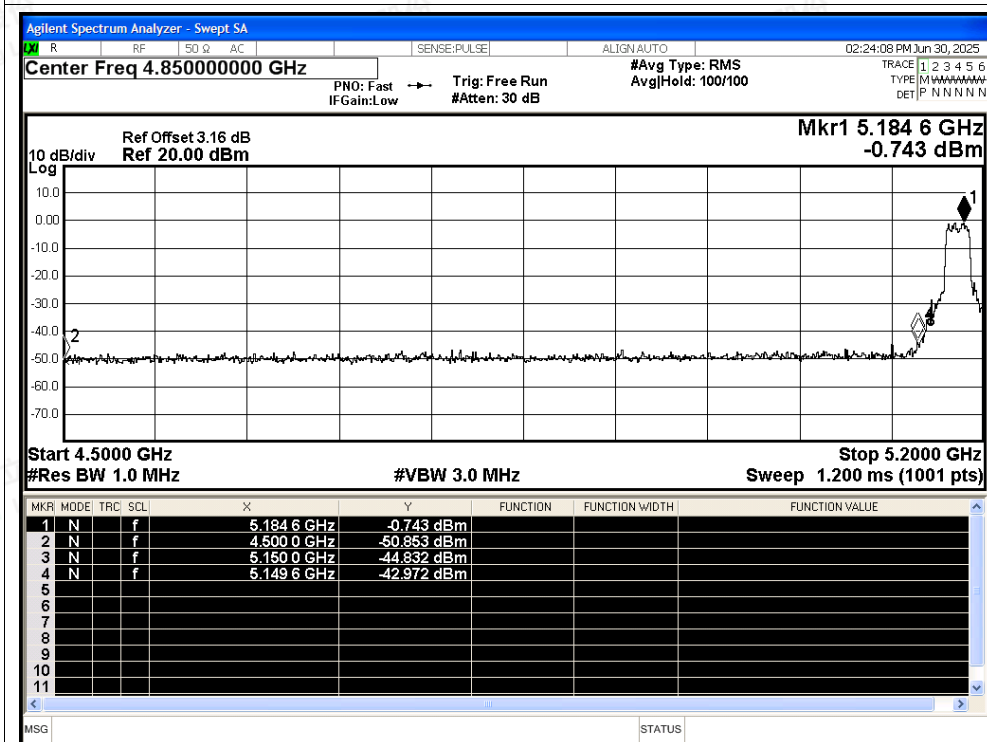

Restrict Band NVNT ac20 5180MHz Ant2 Average

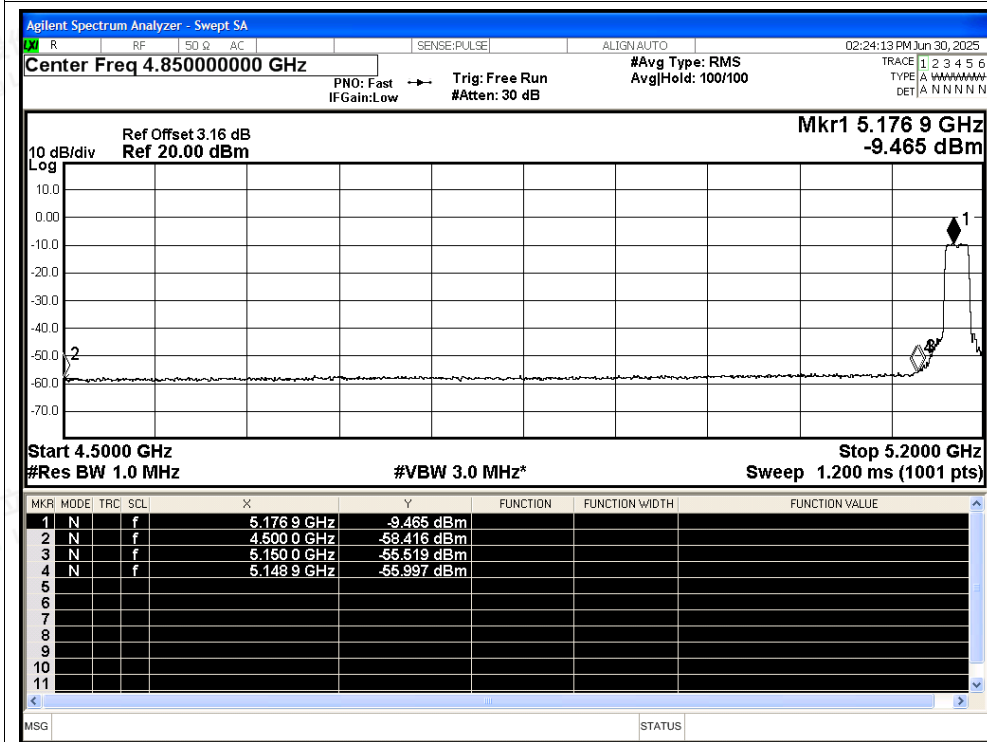

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

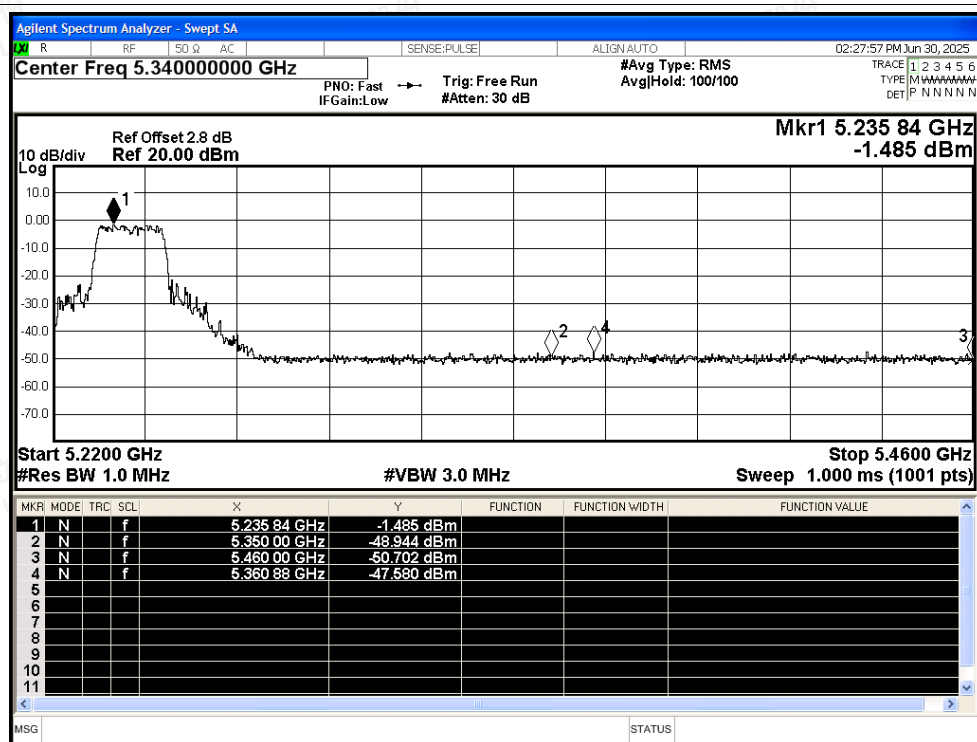

Restrict Band NVNT ac20 5240MHz Ant2 Average

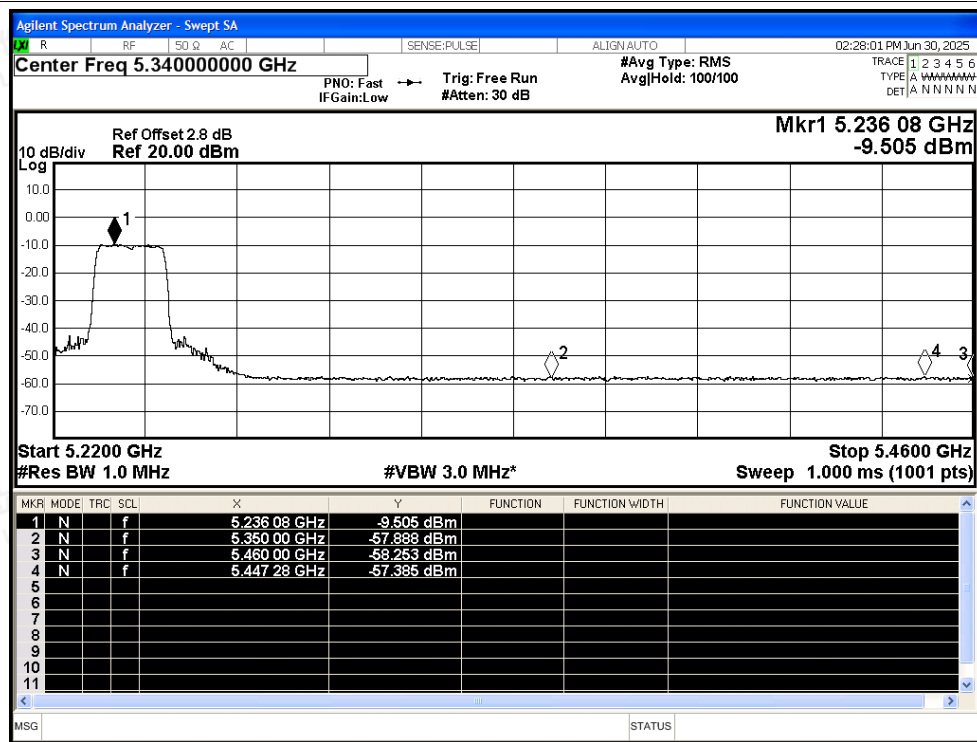

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

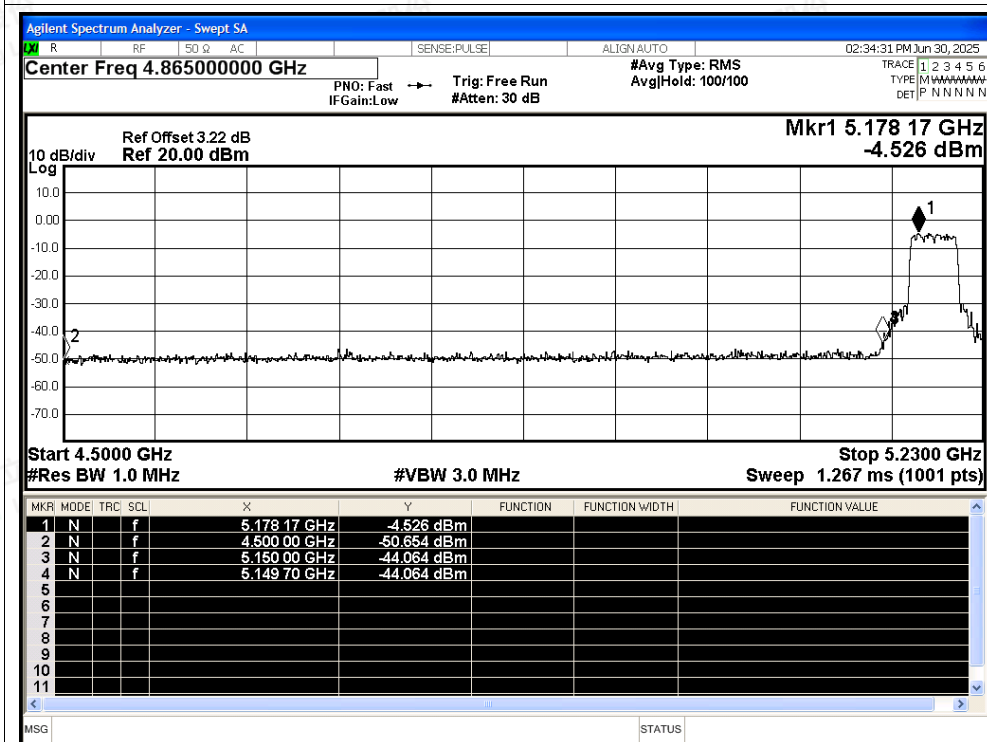

Restrict Band NVNT ac40 5190MHz Ant2 Average

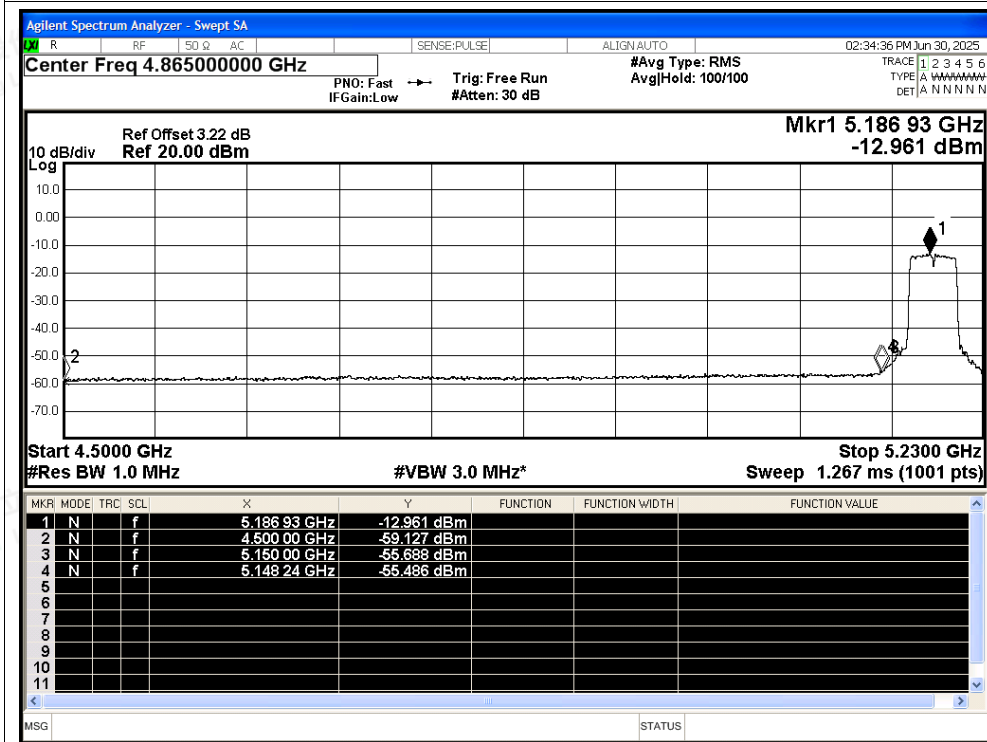

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

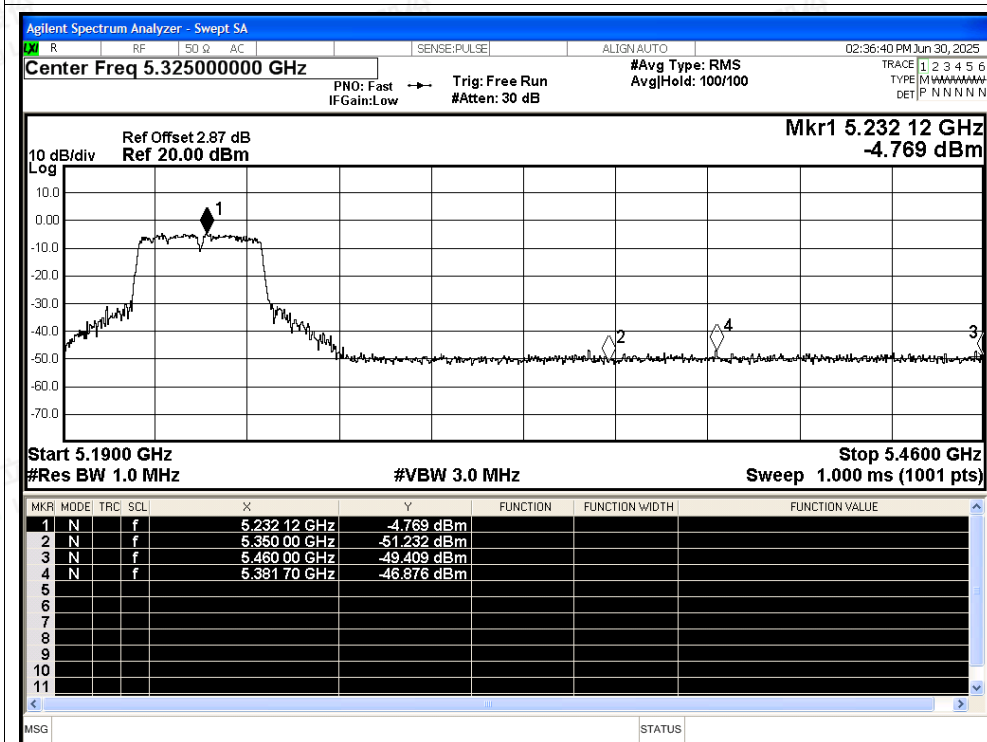

Restrict Band NVNT ac40 5230MHz Ant2 Average

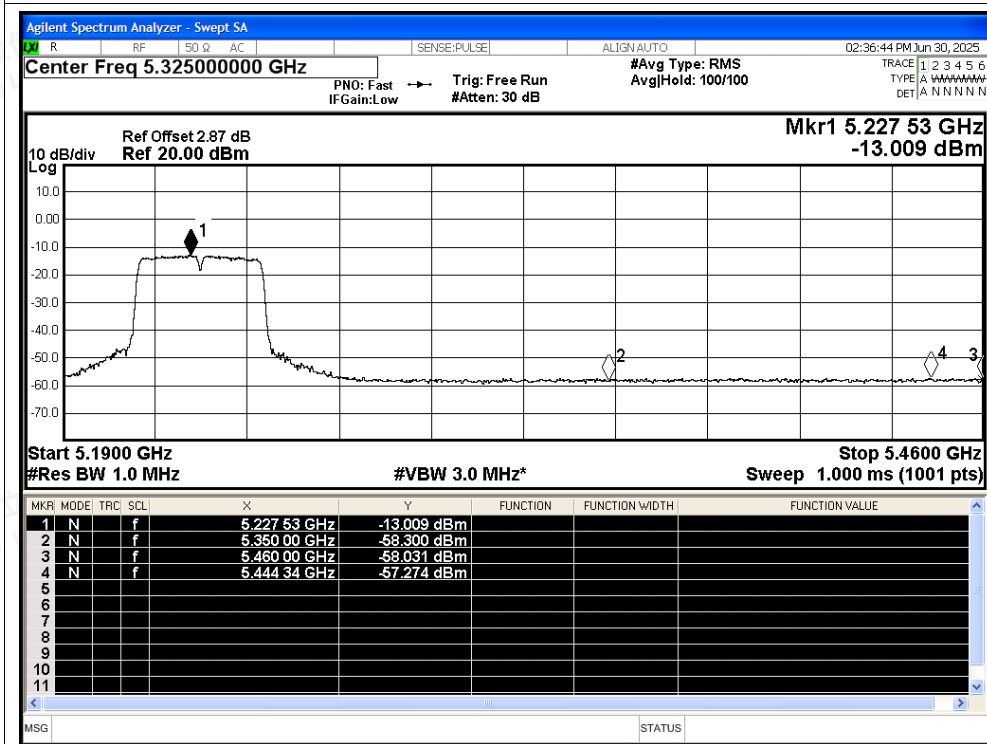

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

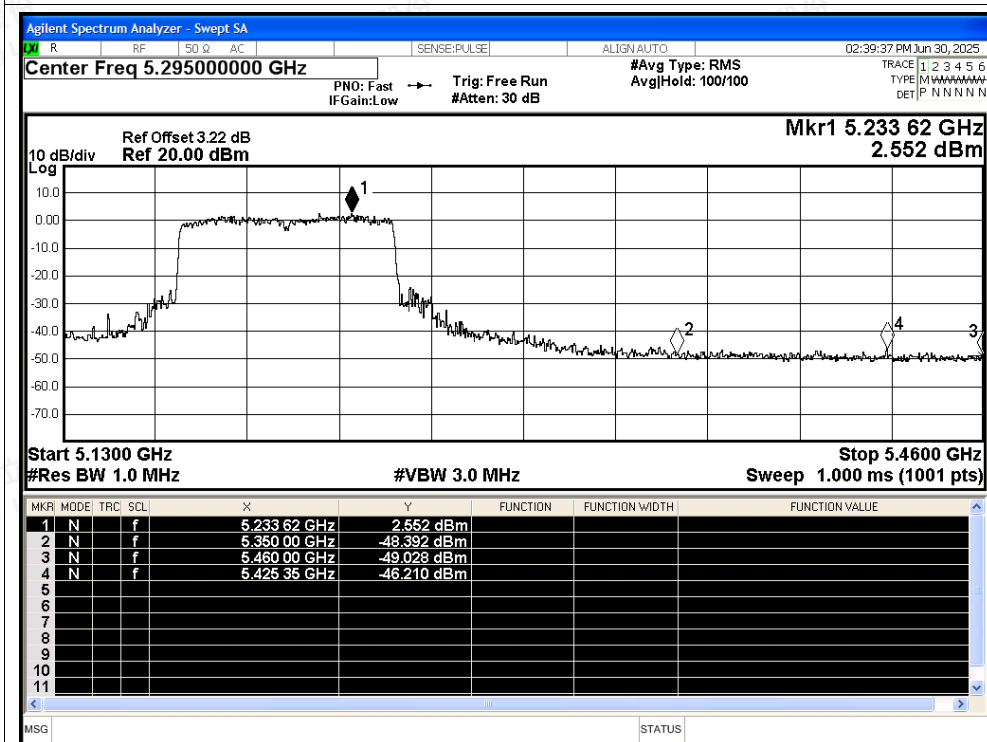

Restrict Band NVNT ac80 5210MHz Ant2 Average

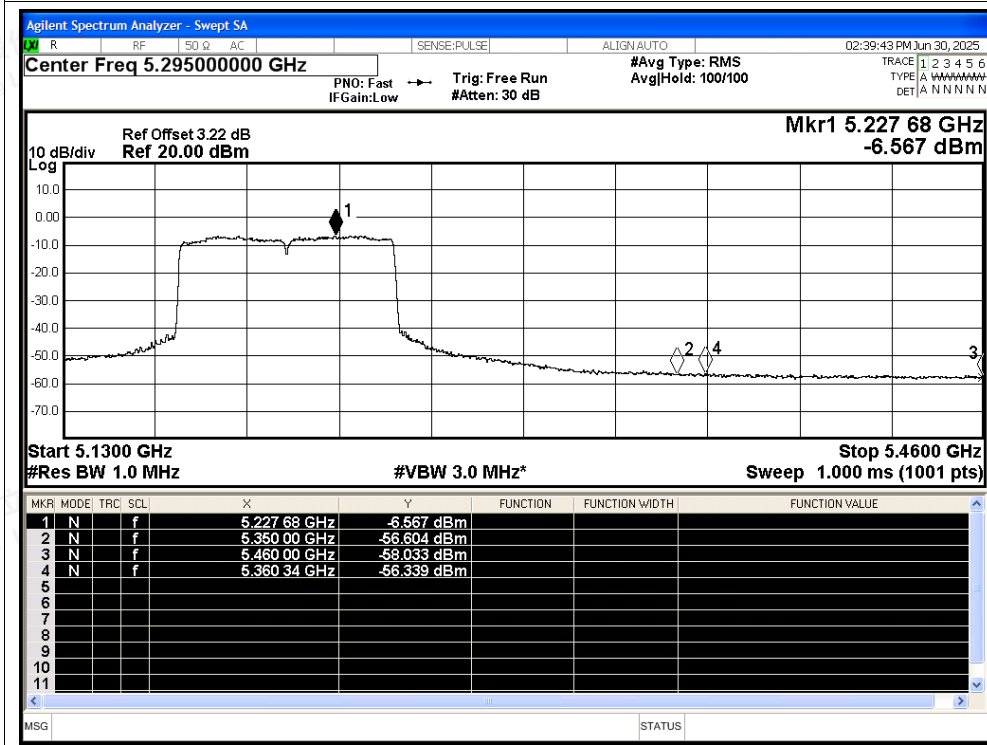

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

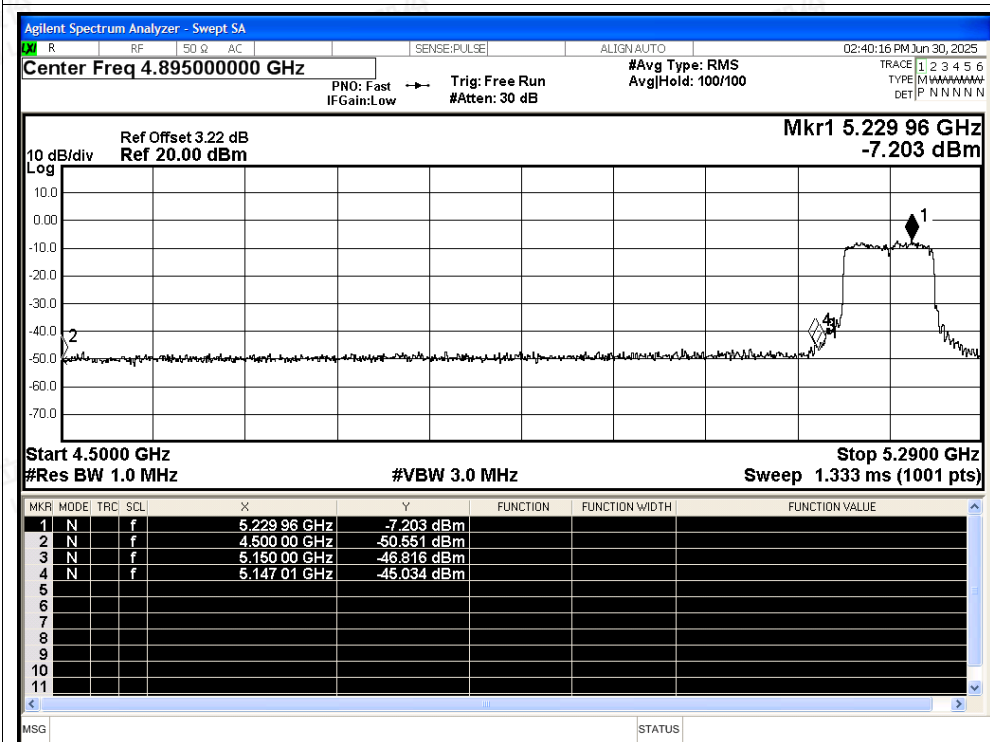

Restrict Band NVNT ac80 5210MHz Ant2 Average

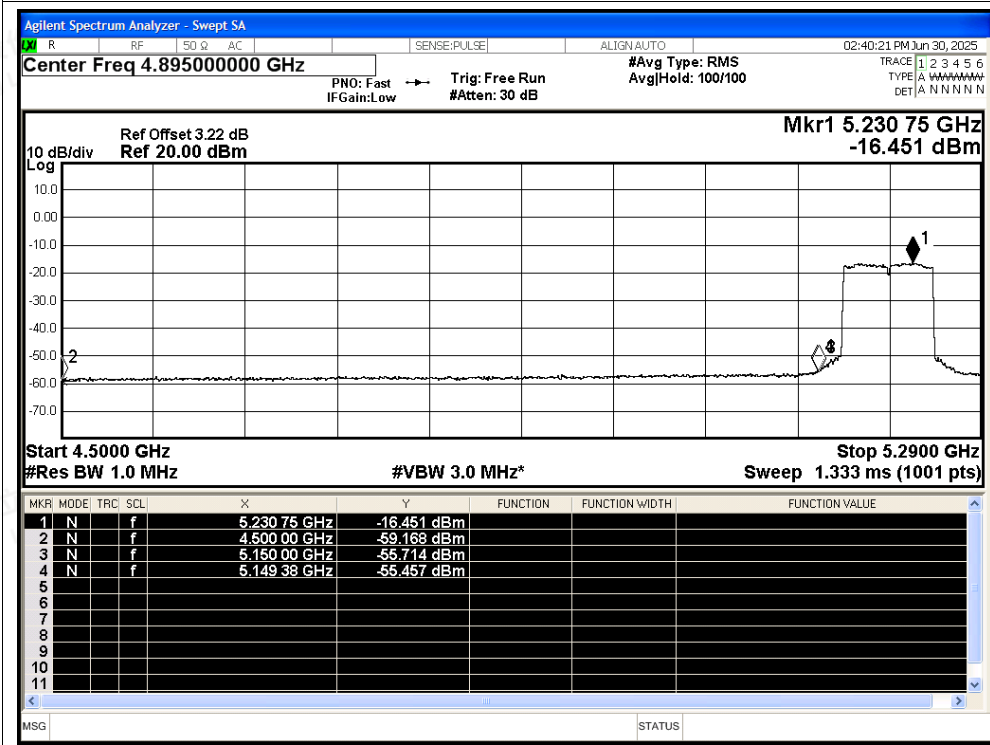

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-51.07	-51.2	5.58	52.68	Peak	68.2	PASS
NVNT	n20	5180	-58.55	-58.54	5.58	45.27	Average	54	PASS
NVNT	n20	5180	-46.03	-46.54	5.58	57.54	Peak	68.2	PASS
NVNT	n20	5180	-55.99	-56.07	5.58	47.79	Average	54	PASS
NVNT	n20	5180	-47.83	-45.59	5.58	57.25	Peak	68.2	PASS
NVNT	n20	5180	-55.5	-56.55	5.58	47.82	Average	54	PASS
NVNT	n20	5240	-51.48	-50.2	5.58	53.02	Peak	68.2	PASS
NVNT	n20	5240	-58.36	-58.39	5.58	45.44	Average	54	PASS
NVNT	n20	5240	-47.47	-47.07	5.58	56.55	Peak	68.2	PASS
NVNT	n20	5240	-57.49	-57.33	5.58	46.41	Average	54	PASS
NVNT	n20	5240	-49.33	-48.94	5.58	54.69	Peak	68.2	PASS
NVNT	n20	5240	-58.03	-58.12	5.58	45.74	Average	54	PASS
NVNT	n40	5190	-49.67	-51.27	5.58	53.42	Peak	68.2	PASS
NVNT	n40	5190	-58.97	-58.87	5.58	44.90	Average	54	PASS
NVNT	n40	5190	-42.93	-43.88	5.58	60.44	Peak	68.2	PASS
NVNT	n40	5190	-56.61	-55.35	5.58	47.88	Average	54	PASS
NVNT	n40	5190	-46.98	-45.68	5.58	57.54	Peak	68.2	PASS
NVNT	n40	5190	-57.07	-56.3	5.58	47.15	Average	54	PASS
NVNT	n40	5230	-48.97	-48.42	5.58	55.13	Peak	68.2	PASS
NVNT	n40	5230	-58.39	-58.06	5.58	45.60	Average	54	PASS
NVNT	n40	5230	-47.06	-47.29	5.58	56.64	Peak	68.2	PASS
NVNT	n40	5230	-57.29	-57.3	5.58	46.52	Average	54	PASS
NVNT	n40	5230	-50.58	-48.51	5.58	54.40	Peak	68.2	PASS
NVNT	n40	5230	-57.36	-58.38	5.58	45.98	Average	54	PASS
NVNT	ac20	5180	-49.92	-50.85	5.58	53.46	Peak	68.2	PASS
NVNT	ac20	5180	-58.52	-58.42	5.58	45.35	Average	54	PASS
NVNT	ac20	5180	-46.77	-42.97	5.58	59.35	Peak	68.2	PASS
NVNT	ac20	5180	-55.8	-56	5.58	47.92	Average	54	PASS
NVNT	ac20	5180	-45.3	-44.83	5.58	58.76	Peak	68.2	PASS
NVNT	ac20	5180	-56.1	-55.52	5.58	48.02	Average	54	PASS
NVNT	ac20	5240	-49.04	-48.94	5.58	54.83	Peak	68.2	PASS
NVNT	ac20	5240	-58.57	-57.89	5.58	45.60	Average	54	PASS
NVNT	ac20	5240	-47.55	-47.58	5.58	56.25	Peak	68.2	PASS
NVNT	ac20	5240	-57.35	-57.39	5.58	46.45	Average	54	PASS
NVNT	ac20	5240	-49.7	-50.7	5.58	53.65	Peak	68.2	PASS
NVNT	ac20	5240	-58.57	-58.25	5.58	45.41	Average	54	PASS
NVNT	ac40	5190	-50.88	-50.65	5.58	53.05	Peak	68.2	PASS
NVNT	ac40	5190	-59.24	-59.13	5.58	44.63	Average	54	PASS
NVNT	ac40	5190	-44.41	-44.06	5.58	59.59	Peak	68.2	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-55.8	-55.49	5.58	48.18	Average	54	PASS
NVNT	ac40	5190	-46.65	-44.06	5.58	58.65	Peak	68.2	PASS
NVNT	ac40	5190	-55.8	-55.69	5.58	48.07	Average	54	PASS
NVNT	ac40	5230	-50.77	-51.23	5.58	52.82	Peak	68.2	PASS
NVNT	ac40	5230	-58.36	-58.3	5.58	45.49	Average	54	PASS
NVNT	ac40	5230	-47.27	-46.88	5.58	56.75	Peak	68.2	PASS
NVNT	ac40	5230	-57.36	-57.27	5.58	46.50	Average	54	PASS
NVNT	ac40	5230	-49.68	-49.41	5.58	54.27	Peak	68.2	PASS
NVNT	ac40	5230	-58.48	-58.03	5.58	45.57	Average	54	PASS
NVNT	ac80	5210	-48.63	-48.39	5.58	55.31	Peak	68.2	PASS
NVNT	ac80	5210	-56.93	-56.6	5.58	47.06	Average	54	PASS
NVNT	ac80	5210	-45.84	-46.21	5.58	57.80	Peak	68.2	PASS
NVNT	ac80	5210	-55.93	-56.34	5.58	47.69	Average	54	PASS
NVNT	ac80	5210	-49.18	-49.03	5.58	54.71	Peak	68.2	PASS
NVNT	ac80	5210	-58.17	-58.03	5.58	45.72	Average	54	PASS
NVNT	ac80	5210	-51.15	-50.55	5.58	52.98	Peak	68.2	PASS
NVNT	ac80	5210	-59.02	-59.17	5.58	44.72	Average	54	PASS
NVNT	ac80	5210	-42.28	-45.03	5.58	60.38	Peak	68.2	PASS
NVNT	ac80	5210	-55.88	-55.46	5.58	48.15	Average	54	PASS
NVNT	ac80	5210	-43.81	-46.82	5.58	58.76	Peak	68.2	PASS
NVNT	ac80	5210	-55.67	-55.71	5.58	48.13	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-50.09	5.1	-	50.24	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-58.6	5.1	0.24	41.97	Average	54	Pass
NVNT	a	5180	Ant3	5144	-45.74	5.1	-	54.59	Peak	68.2	Pass
NVNT	a	5180	Ant3	5138.4	-56.32	5.1	0.24	44.25	Average	54	Pass
NVNT	a	5180	Ant3	5150	-47.5	5.1	-	52.83	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-56.26	5.1	0.24	44.31	Average	54	Pass
NVNT	a	5240	Ant3	5350	-50.04	5.1	-	50.29	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-58.72	5.1	0.24	41.85	Average	54	Pass
NVNT	a	5240	Ant3	5401.92	-47.68	5.1	-	52.65	Peak	68.2	Pass
NVNT	a	5240	Ant3	5386.56	-57.37	5.1	0.24	43.20	Average	54	Pass
NVNT	a	5240	Ant3	5460	-49.66	5.1	-	50.67	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-58.44	5.1	0.24	42.13	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-50.69	5.1	-	49.64	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-58.98	5.1	0.12	41.47	Average	54	Pass
NVNT	n20	5180	Ant3	5149.6	-44.23	5.1	-	56.10	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5148.9	-55.99	5.1	0.12	44.46	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-44.63	5.1	-	55.70	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-56.03	5.1	0.12	44.42	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-51.41	5.1	-	48.92	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-58.03	5.1	0.12	42.42	Average	54	Pass
NVNT	n20	5240	Ant3	5398.56	-47.18	5.1	-	53.15	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5396.4	-57.44	5.1	0.12	43.01	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-49.32	5.1	-	51.01	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-58.4	5.1	0.12	42.05	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-49.68	5.1	-	50.65	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-58.96	5.1	0.23	41.60	Average	54	Pass
NVNT	n40	5190	Ant3	5147.51	-43.79	5.1	-	56.54	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5148.97	-55.51	5.1	0.23	45.05	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-47.09	5.1	-	53.24	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-55.57	5.1	0.23	44.99	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-49.45	5.1	-	50.88	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-58.67	5.1	0.24	41.90	Average	54	Pass
NVNT	n40	5230	Ant3	5424.63	-47.93	5.1	-	52.40	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5421.93	-57.39	5.1	0.24	43.18	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-50.54	5.1	-	49.79	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-58.38	5.1	0.24	42.19	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-50.43	5.1	-	49.90	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	4500	-58.47	5.1	0.12	41.98	Average	54	Pass
NVNT	ac20	5180	Ant3	5148.9	-44.29	5.1	-	56.04	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	5148.9	-55.52	5.1	0.12	44.93	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-47.24	5.1	-	53.09	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-55.72	5.1	0.12	44.73	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-50.87	5.1	-	49.46	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-58.12	5.1	0.12	42.33	Average	54	Pass
NVNT	ac20	5240	Ant3	5391.36	-46.79	5.1	-	53.54	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5417.76	-57.48	5.1	0.12	42.97	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-50.56	5.1	-	49.77	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-58.03	5.1	0.12	42.42	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-49.12	5.1	-	51.21	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-57.86	5.1	0.24	42.71	Average	54	Pass
NVNT	ac40	5190	Ant3	5147.51	-45.78	5.1	-	54.55	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5149.7	-55.54	5.1	0.24	45.03	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-46.12	5.1	-	54.21	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-55.54	5.1	0.24	45.03	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-49.43	5.1	-	50.90	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-58	5.1	0.23	42.56	Average	54	Pass
NVNT	ac40	5230	Ant3	5433.81	-47.2	5.1	-	53.13	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5393.04	-57.38	5.1	0.23	43.18	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-50.07	5.1	-	50.26	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-58.29	5.1	0.23	42.27	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-48.85	5.1	-	51.48	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-57.04	5.1	0.47	43.76	Average	54	Pass
NVNT	ac80	5210	Ant3	5355.72	-46.9	5.1	-	53.43	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5361	-56.63	5.1	0.47	44.17	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-49.95	5.1	-	50.38	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-57.5	5.1	0.47	43.30	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-50.79	5.1	-	49.54	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-58.69	5.1	0.47	42.11	Average	54	Pass
NVNT	ac80	5210	Ant3	5147.8	-43.77	5.1	-	56.56	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5147.01	-55.61	5.1	0.47	45.19	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-41.24	5.1	-	59.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-55.23	5.1	0.47	45.57	Average	54	Pass
NVNT	ax20	5180	Ant3	4500	-51.16	5.1	-	49.17	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	4500	-59.24	5.1	0.12	41.21	Average	54	Pass
NVNT	ax20	5180	Ant3	5148.9	-42.95	5.1	-	57.38	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5148.9	-55.86	5.1	0.12	44.59	Average	54	Pass
NVNT	ax20	5180	Ant3	5150	-47.85	5.1	-	52.48	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5150	-55.51	5.1	0.12	44.94	Average	54	Pass
NVNT	ax20	5240	Ant3	5350	-50.91	5.1	-	49.42	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5350	-58.17	5.1	0.12	42.28	Average	54	Pass
NVNT	ax20	5240	Ant3	5423.52	-47.54	5.1	-	52.79	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5380.8	-57.46	5.1	0.12	42.99	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant3	5460	-49.76	5.1	-	50.57	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5460	-58.39	5.1	0.12	42.06	Average	54	Pass
NVNT	ax40	5190	Ant3	4500	-50.41	5.1	-	49.92	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	4500	-59.34	5.1	0.24	41.23	Average	54	Pass
NVNT	ax40	5190	Ant3	5013.19	-46.15	5.1	-	54.18	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5148.24	-55.88	5.1	0.24	44.69	Average	54	Pass
NVNT	ax40	5190	Ant3	5150	-46.43	5.1	-	53.90	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5150	-55.94	5.1	0.24	44.63	Average	54	Pass
NVNT	ax40	5230	Ant3	5350	-49.57	5.1	-	50.76	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350	-58.14	5.1	0.24	42.43	Average	54	Pass
NVNT	ax40	5230	Ant3	5431.92	-46.76	5.1	-	53.57	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5442.99	-57.25	5.1	0.24	43.32	Average	54	Pass
NVNT	ax40	5230	Ant3	5460	-50.48	5.1	-	49.85	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5460	-58.19	5.1	0.24	42.38	Average	54	Pass
NVNT	ax80	5210	Ant3	5350	-50.58	5.1	-	49.75	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350	-56.83	5.1	0.47	43.97	Average	54	Pass
NVNT	ax80	5210	Ant3	5350.77	-44.96	5.1	-	55.37	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5353.08	-56.28	5.1	0.47	44.52	Average	54	Pass
NVNT	ax80	5210	Ant3	5460	-49.84	5.1	-	50.49	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5460	-57.96	5.1	0.47	42.84	Average	54	Pass
NVNT	ax80	5210	Ant3	4500	-51.46	5.1	-	48.87	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	4500	-58.73	5.1	0.47	42.07	Average	54	Pass
NVNT	ax80	5210	Ant3	5148.59	-43.8	5.1	-	56.53	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5149.38	-55.58	5.1	0.47	45.22	Average	54	Pass
NVNT	ax80	5210	Ant3	5150	-45.25	5.1	-	55.08	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5150	-55.45	5.1	0.47	45.35	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant3 Peak

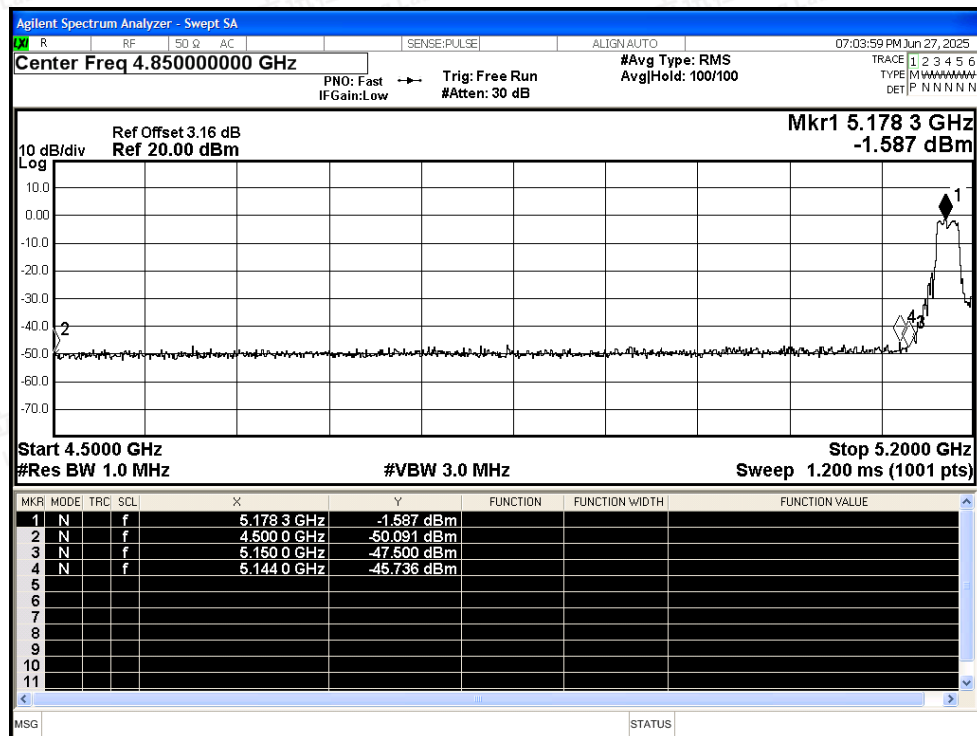

Restrict Band NVNT a 5180MHz Ant3 Average

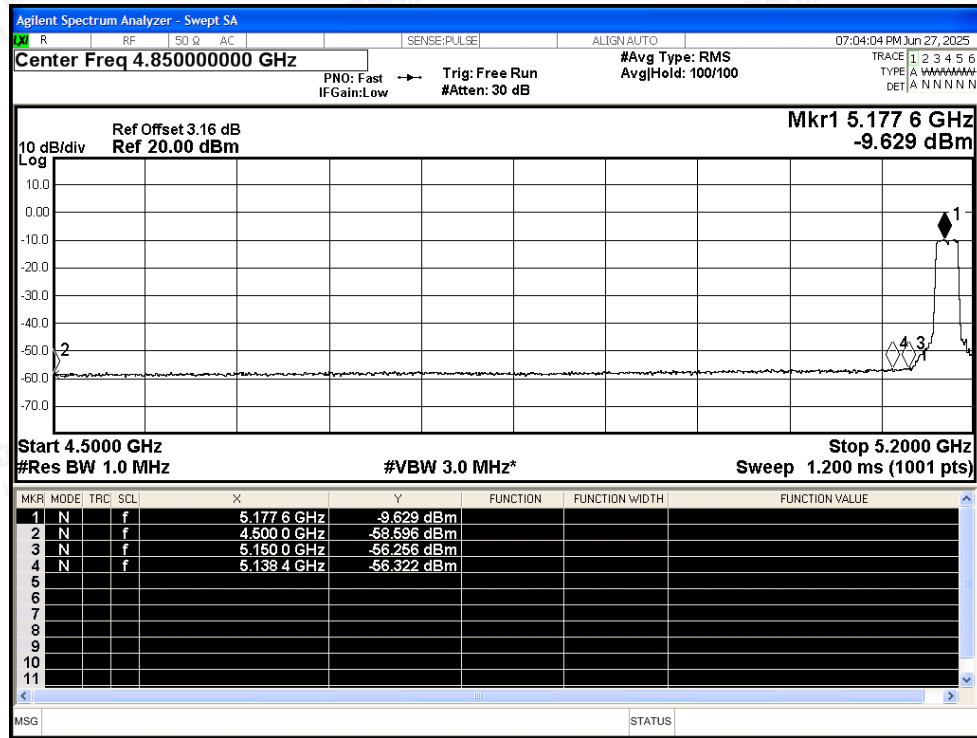

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

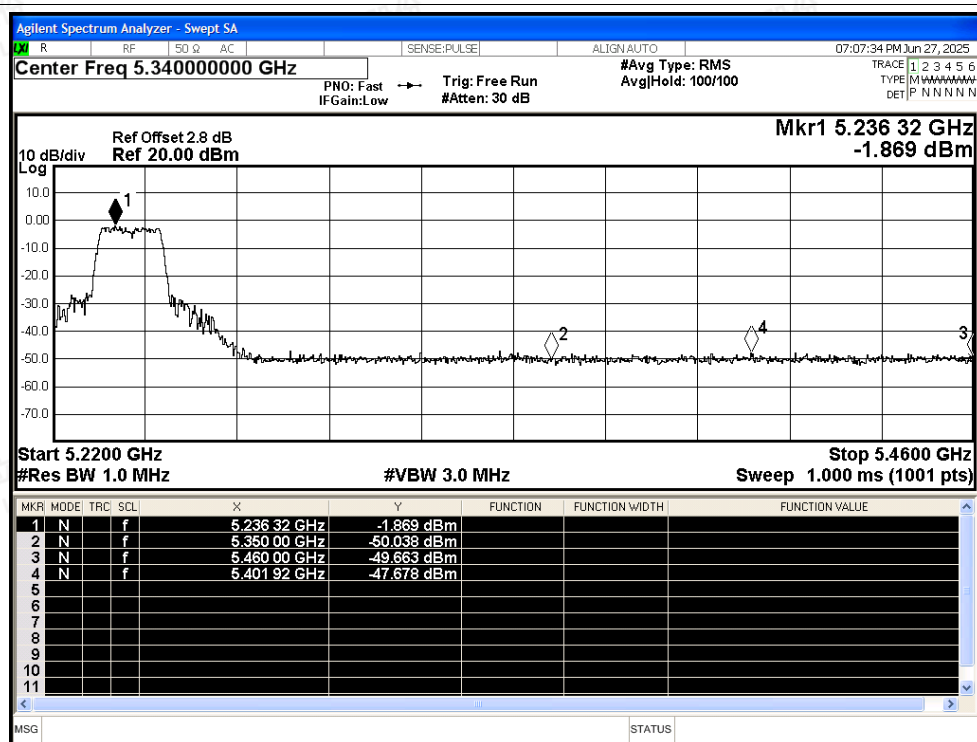

Restrict Band NVNT a 5240MHz Ant3 Average

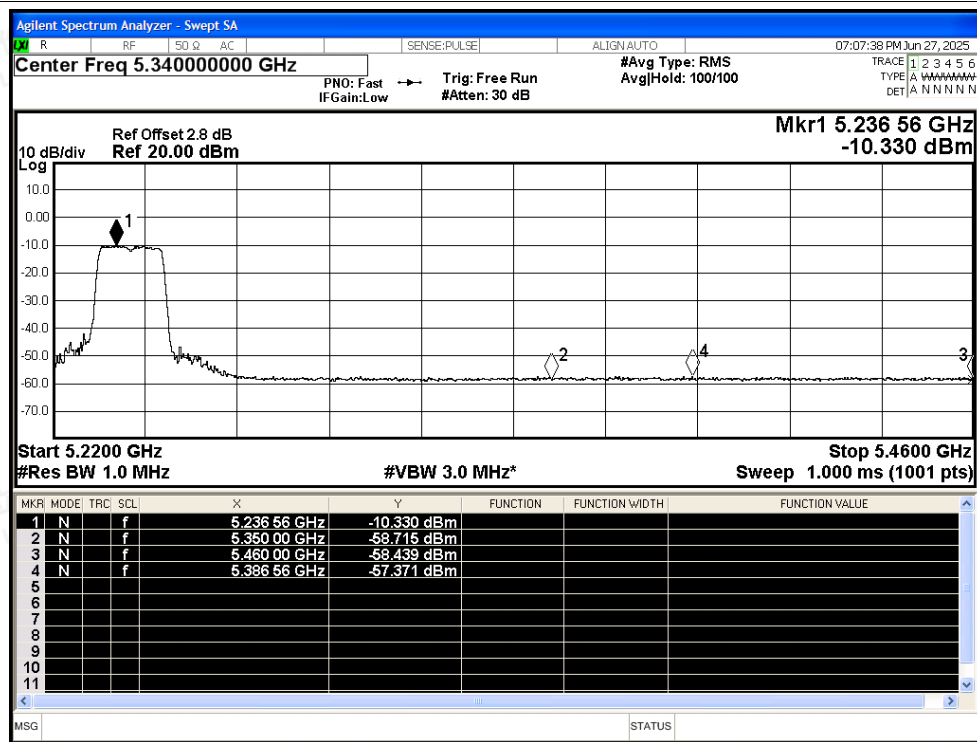

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant3 Peak

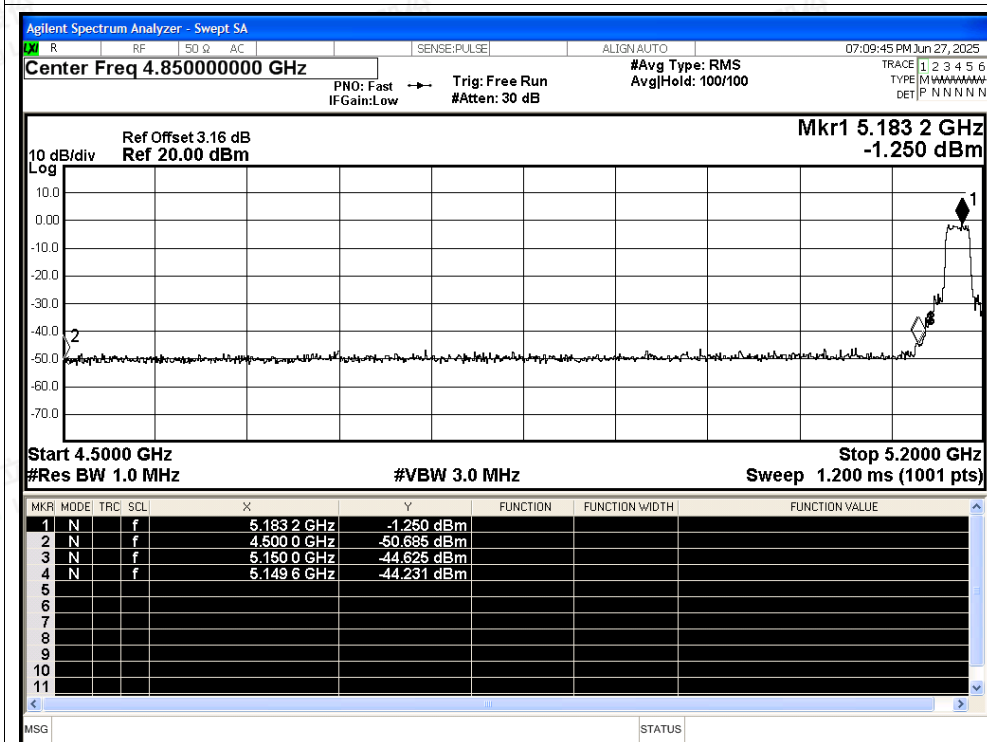

Restrict Band NVNT n20 5180MHz Ant3 Average

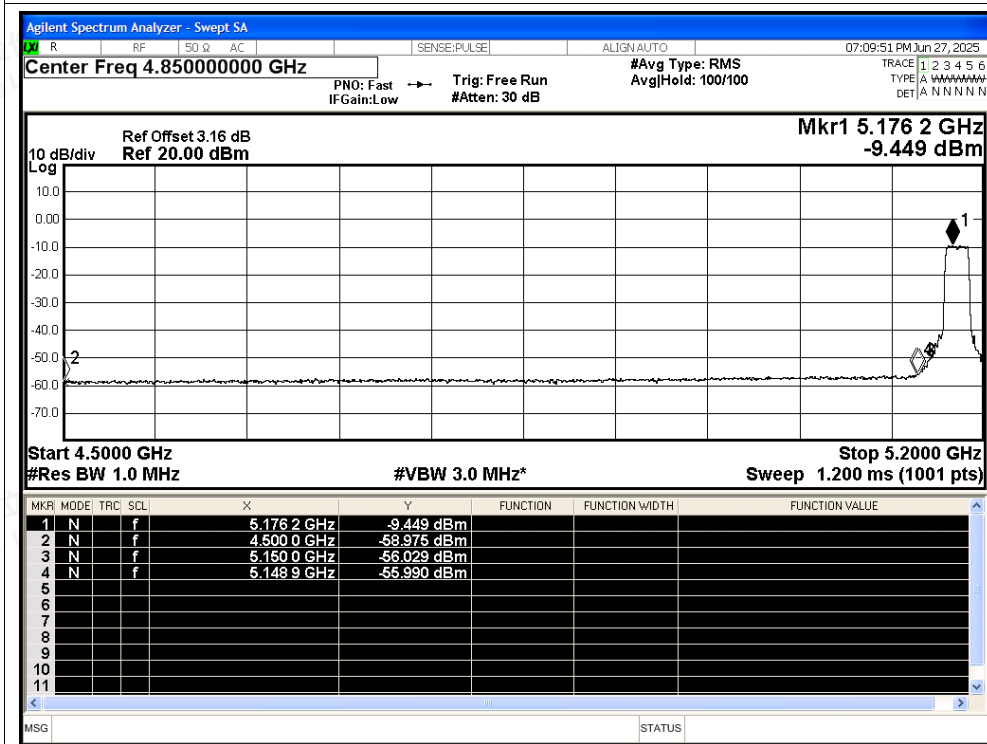

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant3 Peak

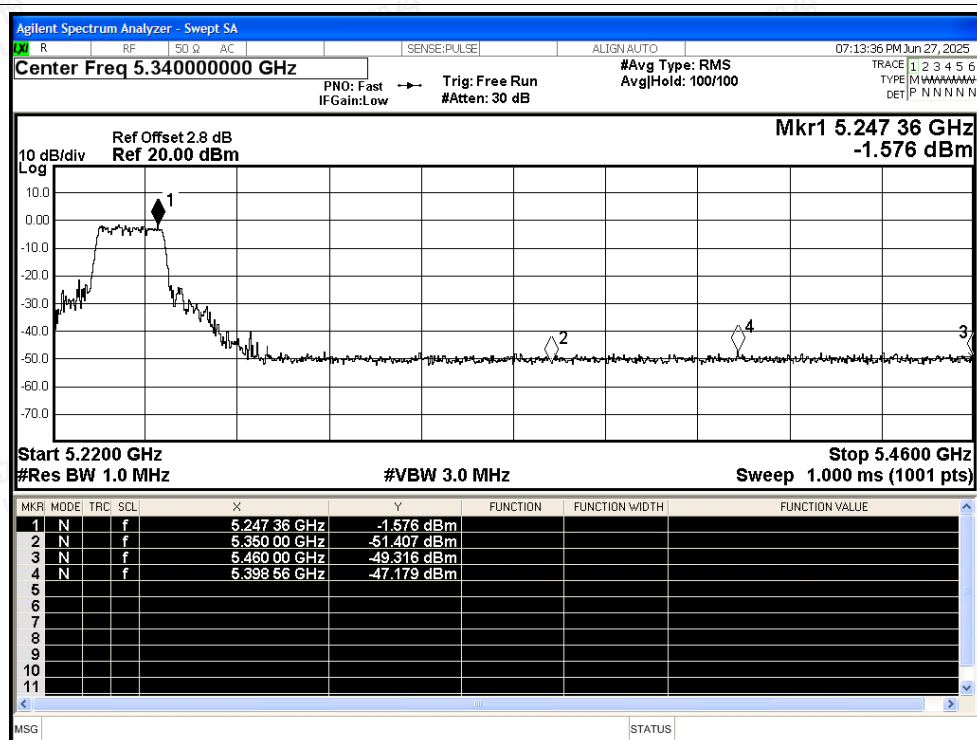

Restrict Band NVNT n20 5240MHz Ant3 Average

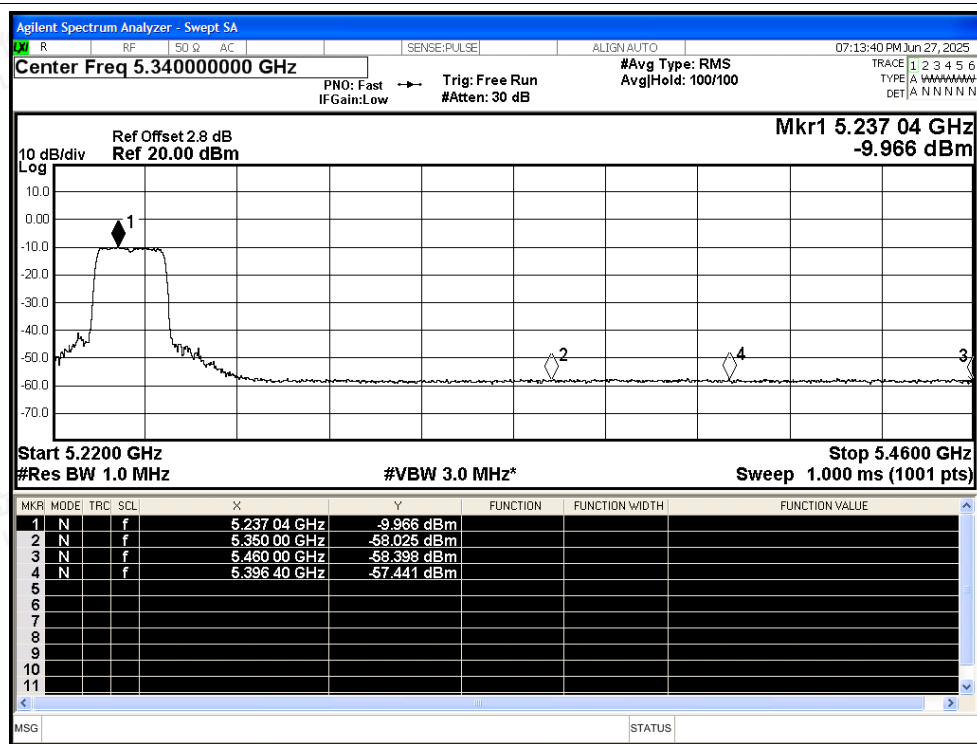

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

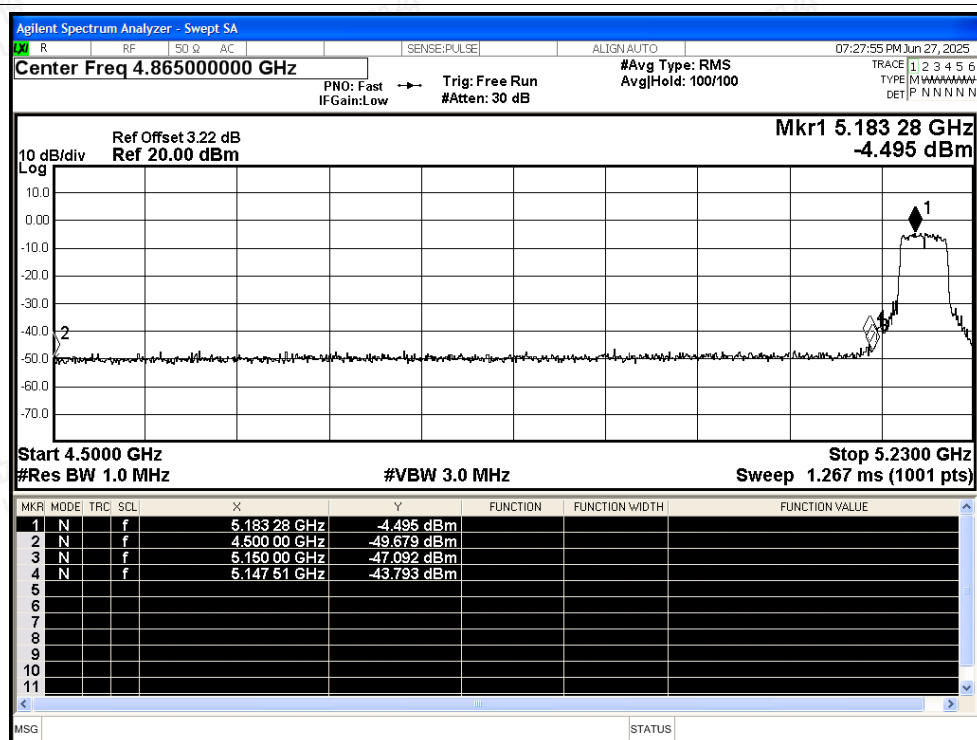

Restrict Band NVNT n40 5190MHz Ant3 Average

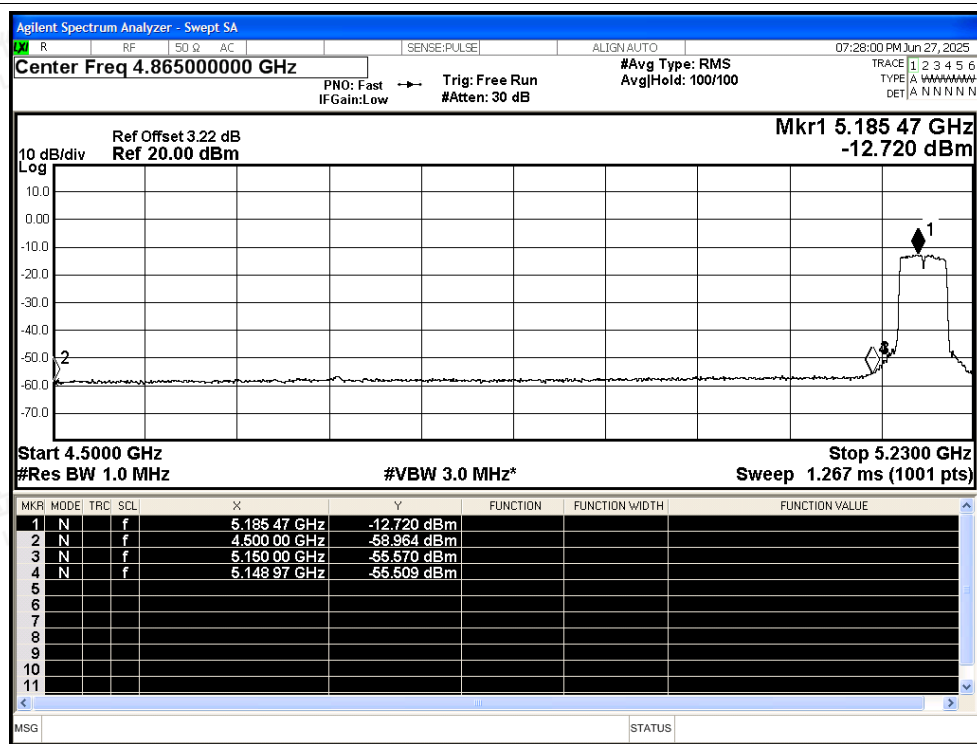

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

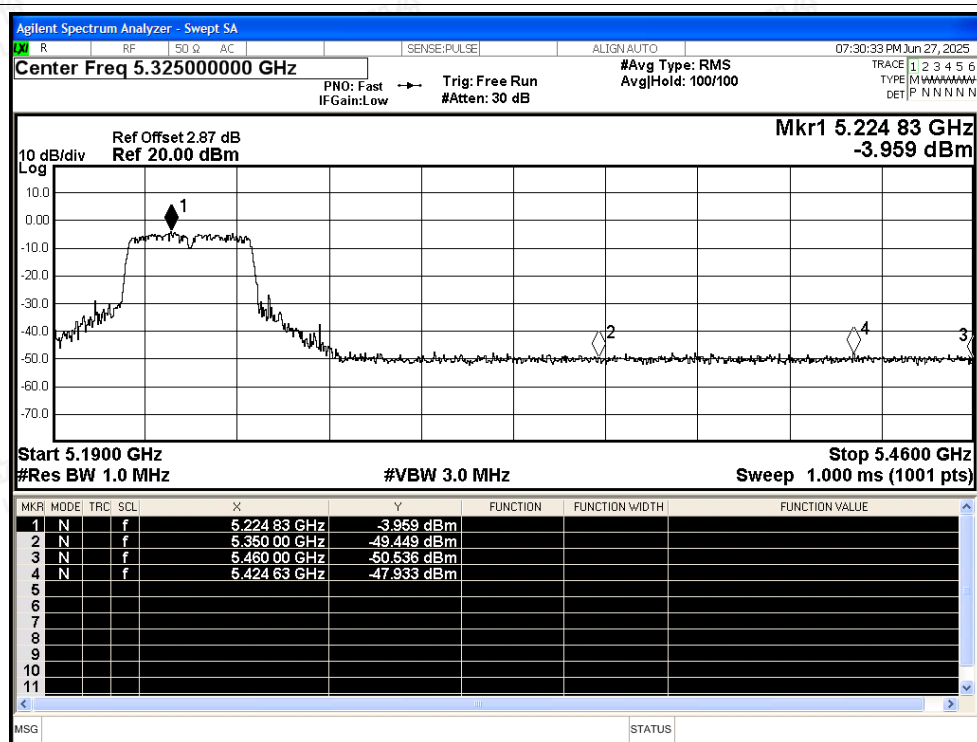

Restrict Band NVNT n40 5230MHz Ant3 Average

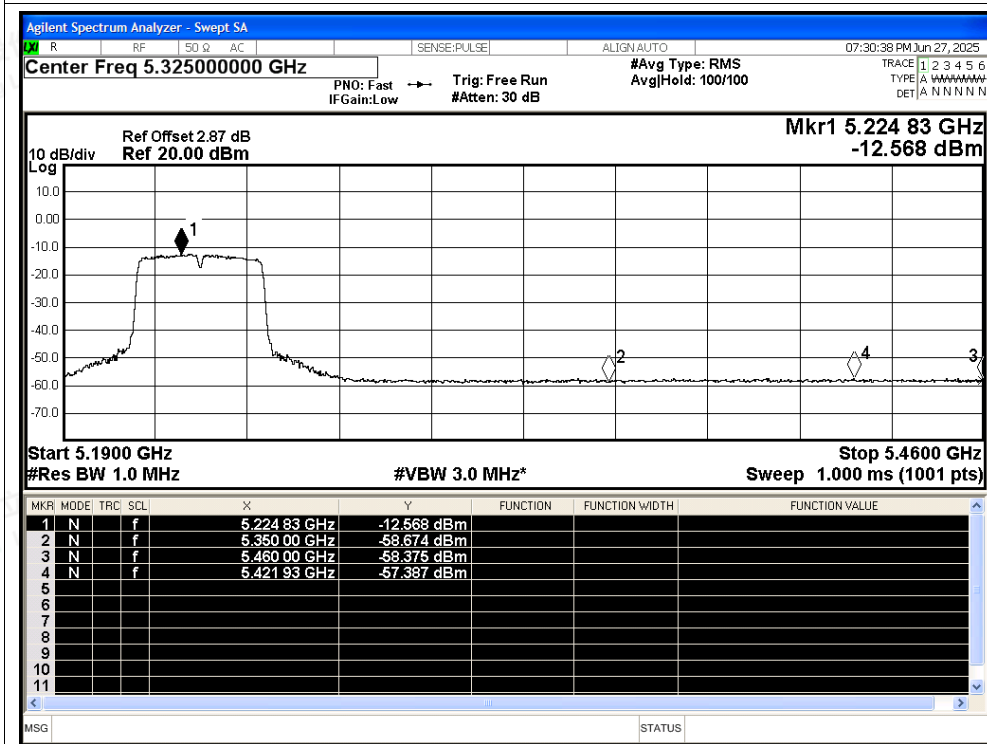

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

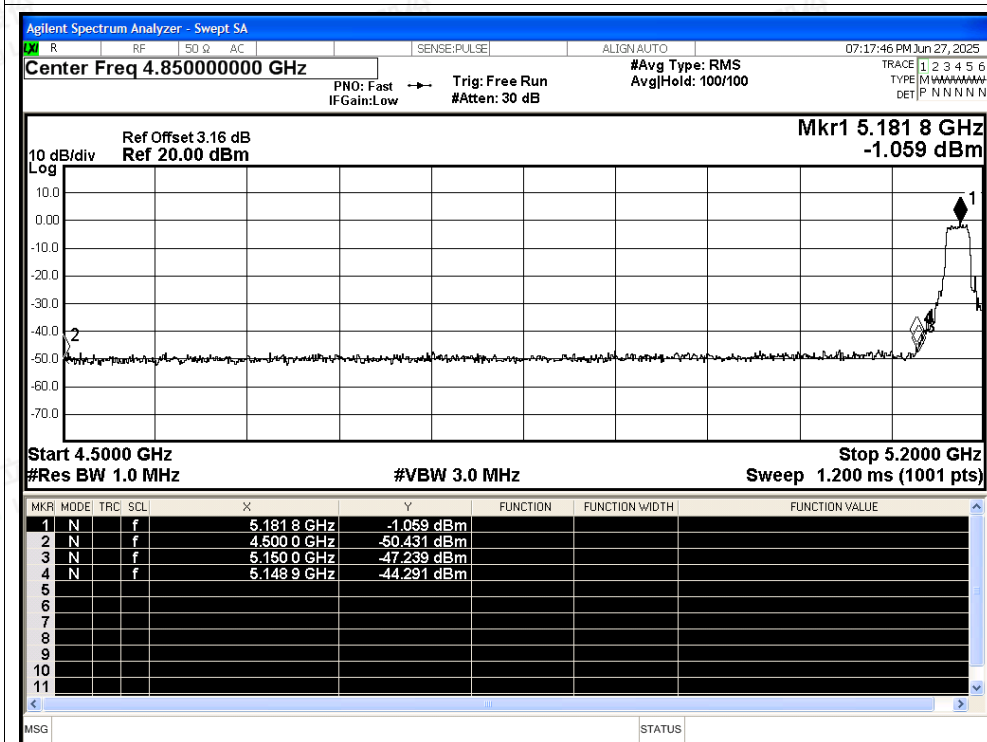

Restrict Band NVNT ac20 5180MHz Ant3 Average

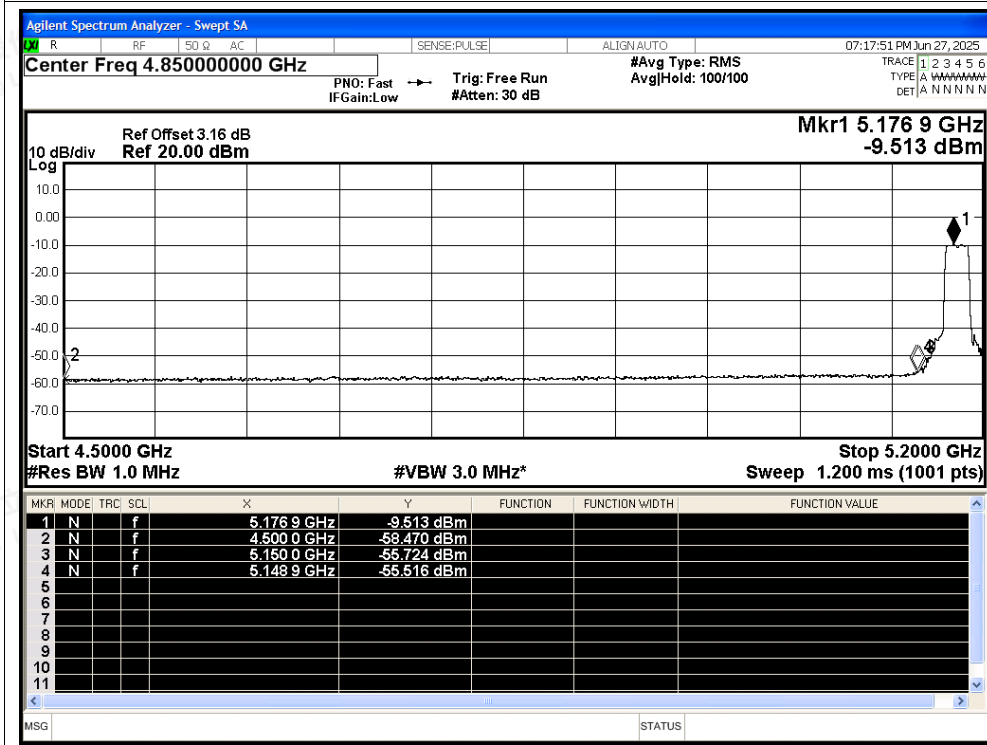

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

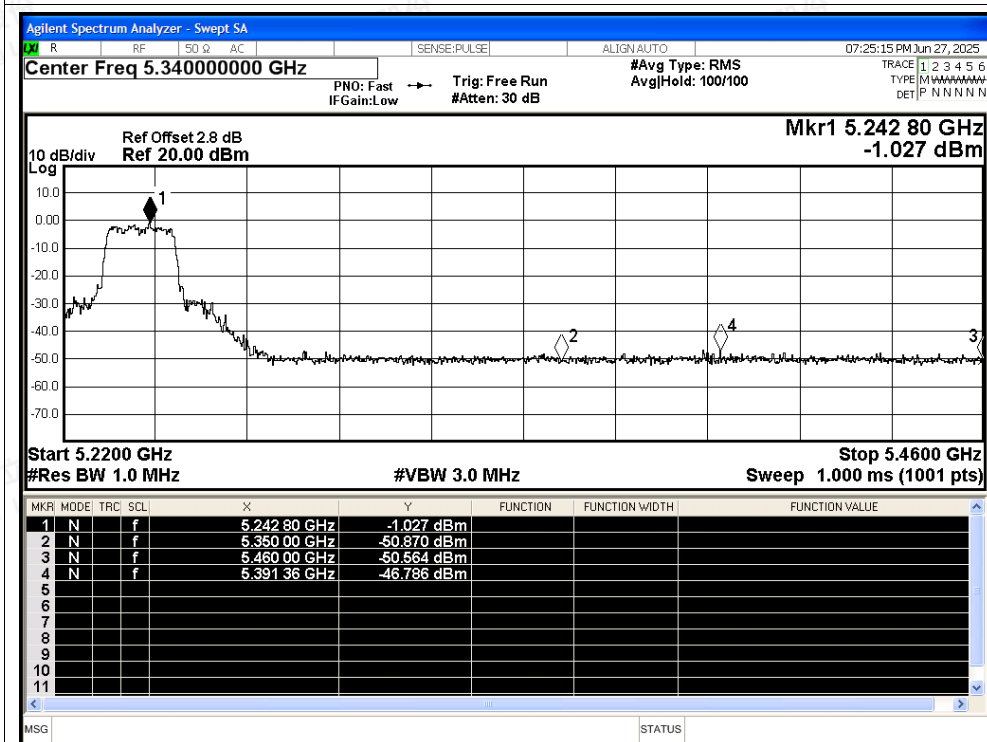

Restrict Band NVNT ac20 5240MHz Ant3 Average

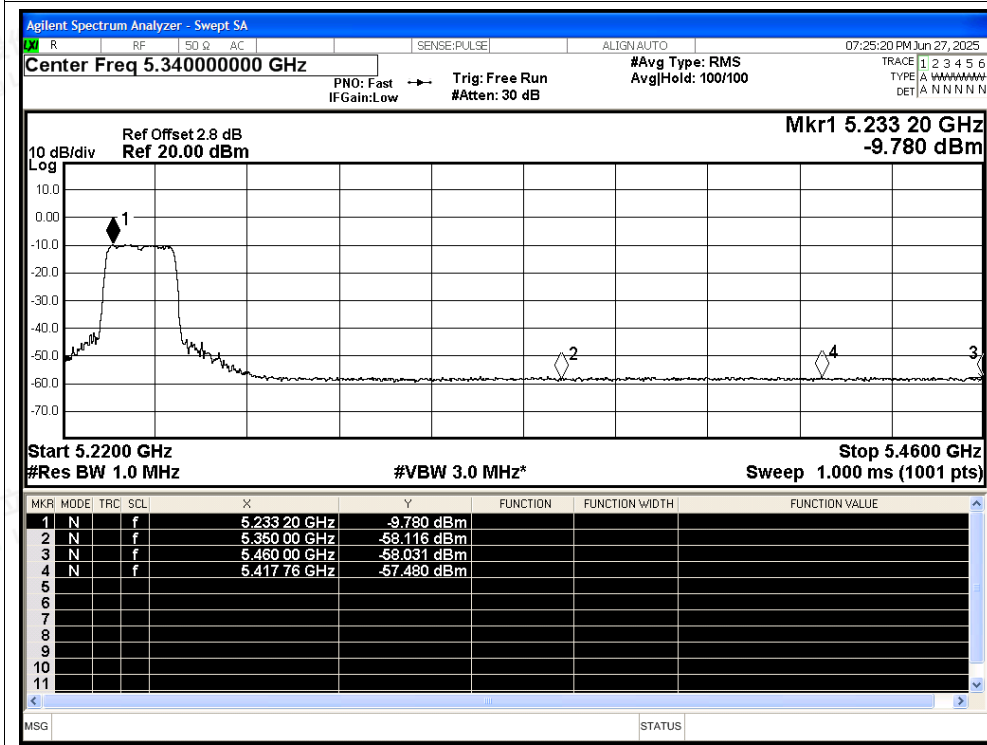

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

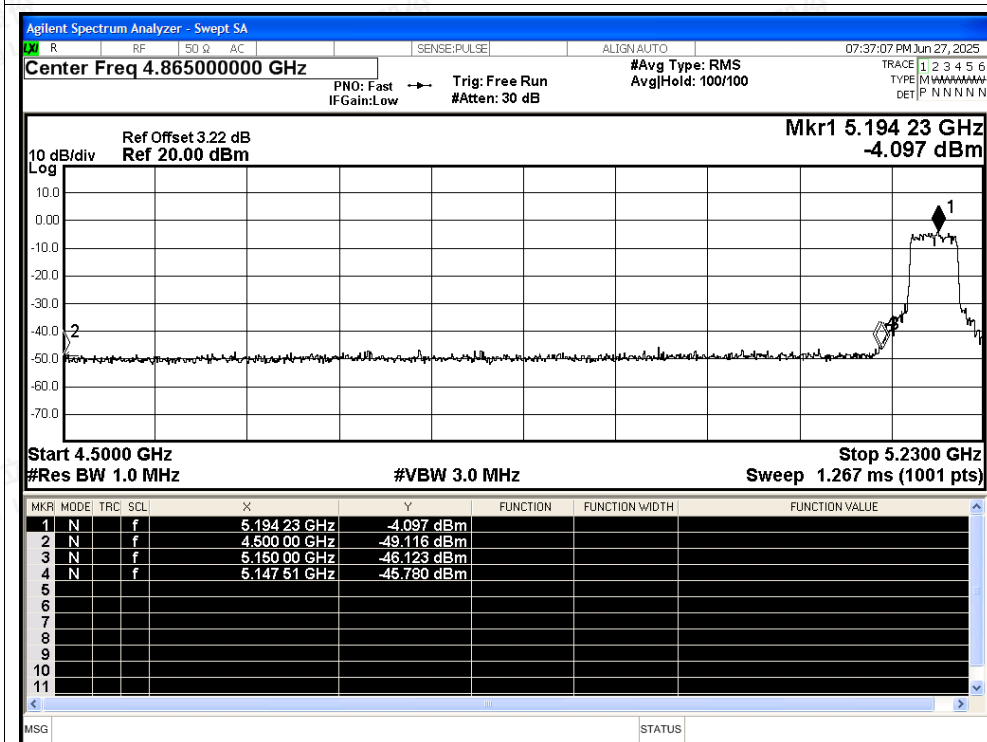

Restrict Band NVNT ac40 5190MHz Ant3 Average

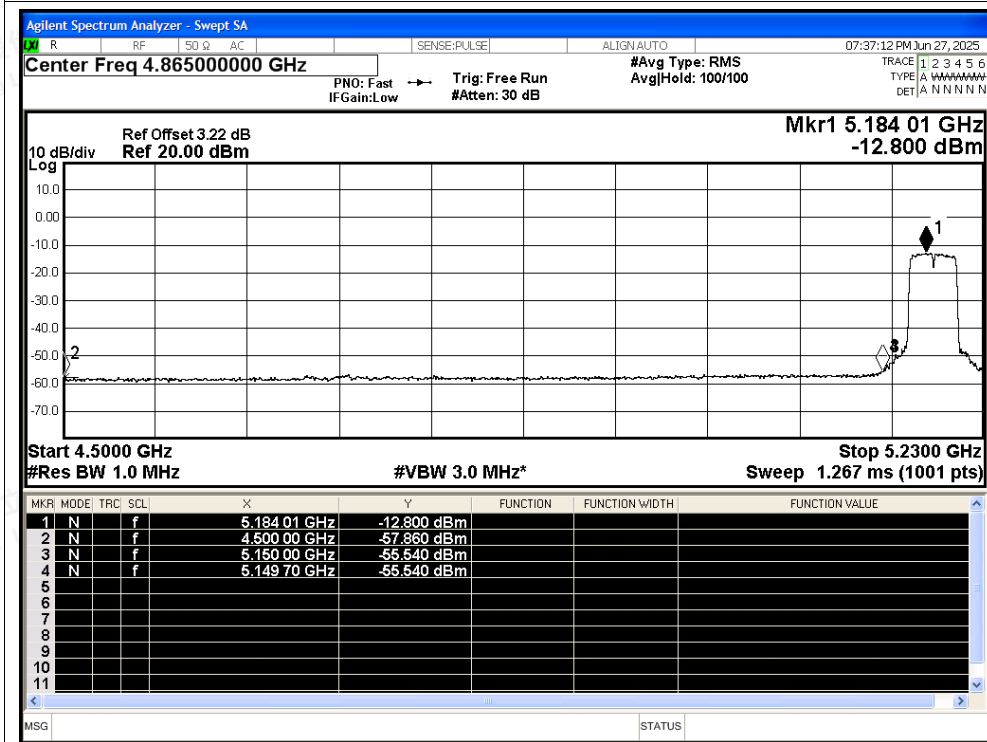

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

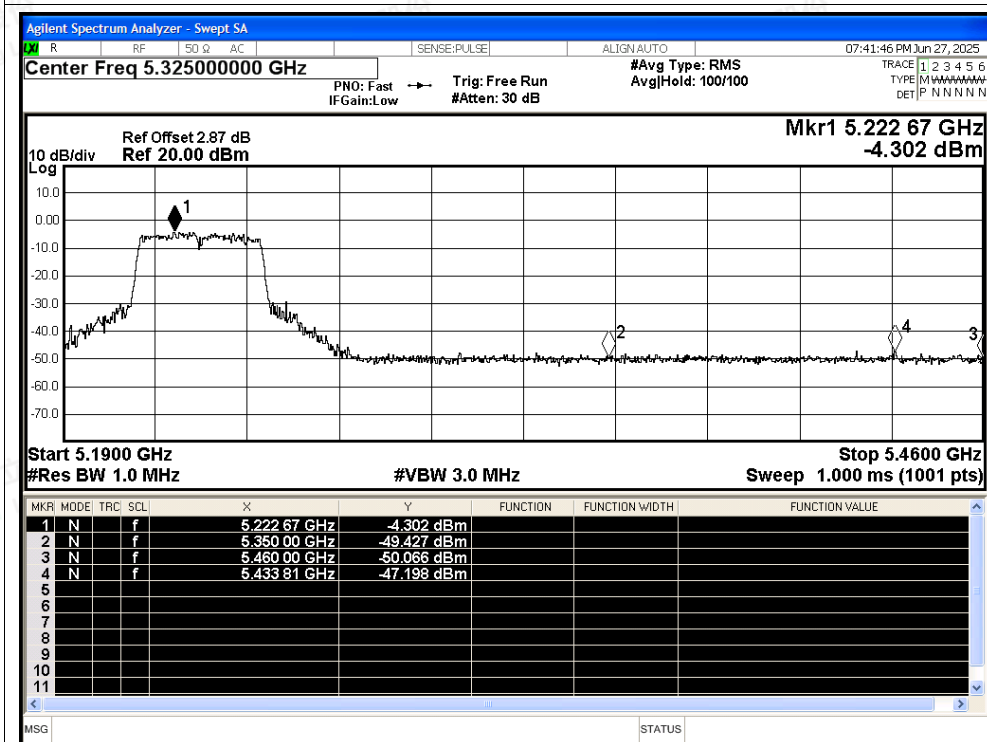

Restrict Band NVNT ac40 5230MHz Ant3 Average

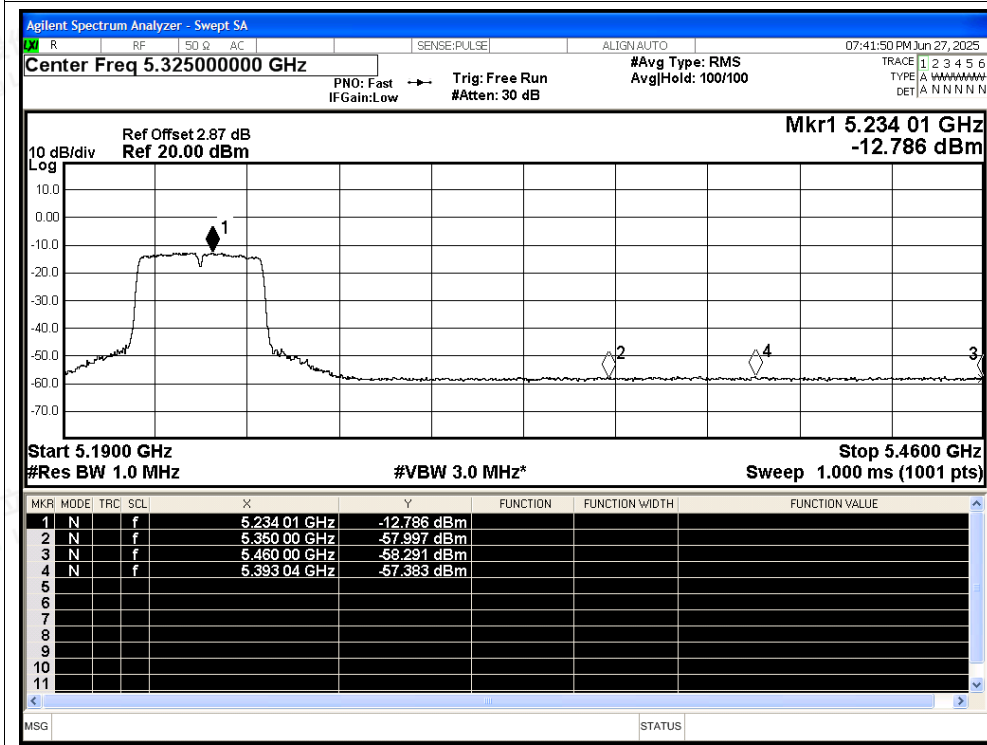

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

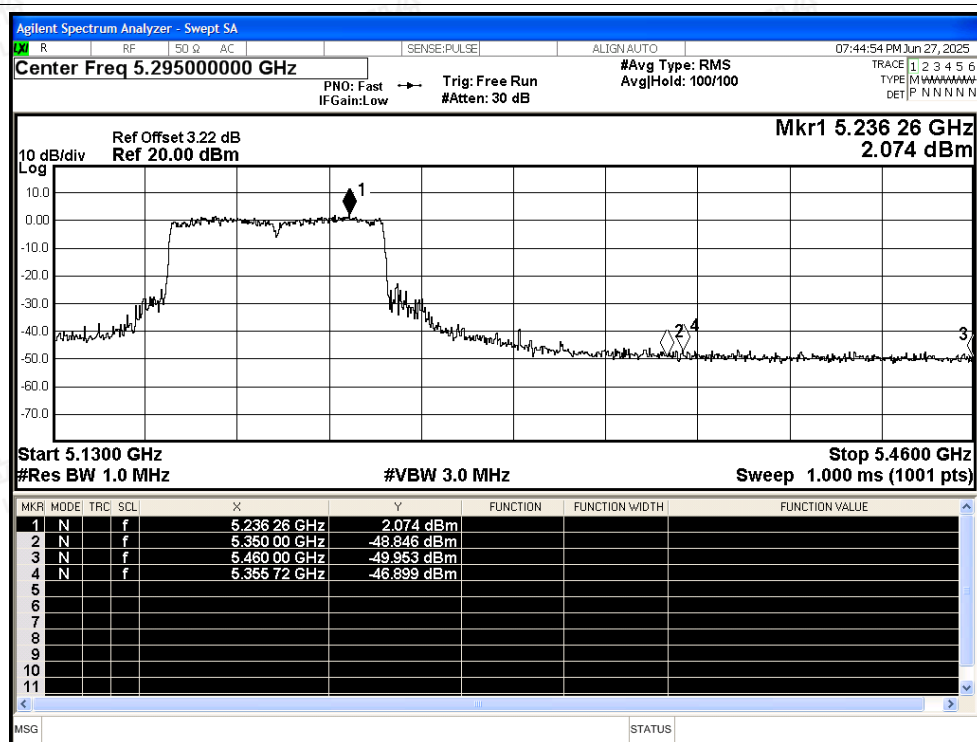

Restrict Band NVNT ac80 5210MHz Ant3 Average

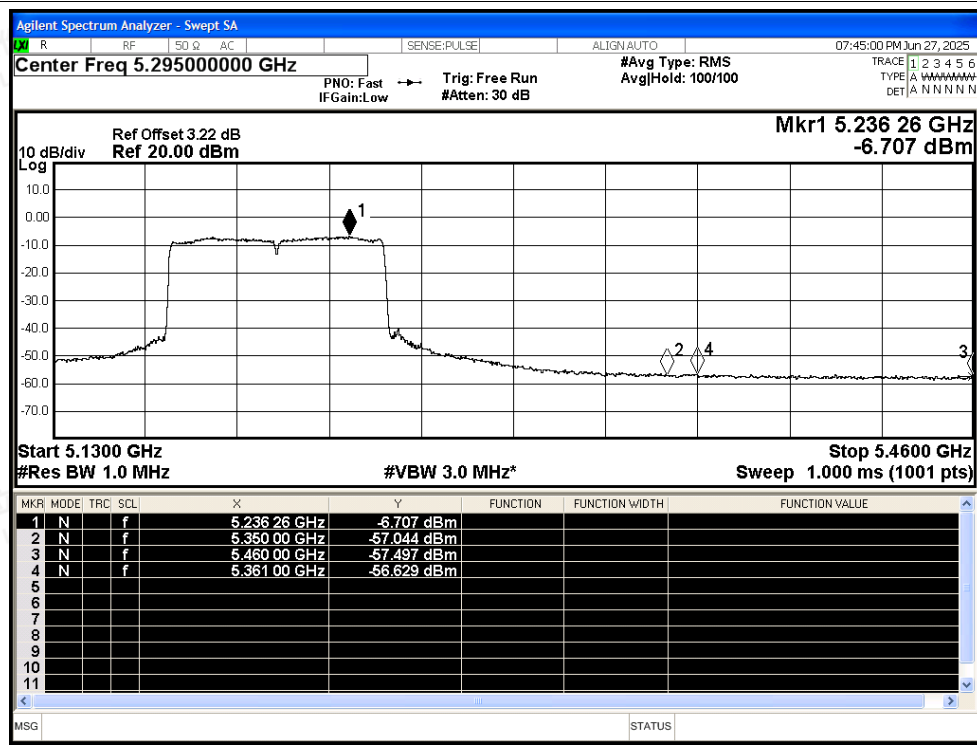

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

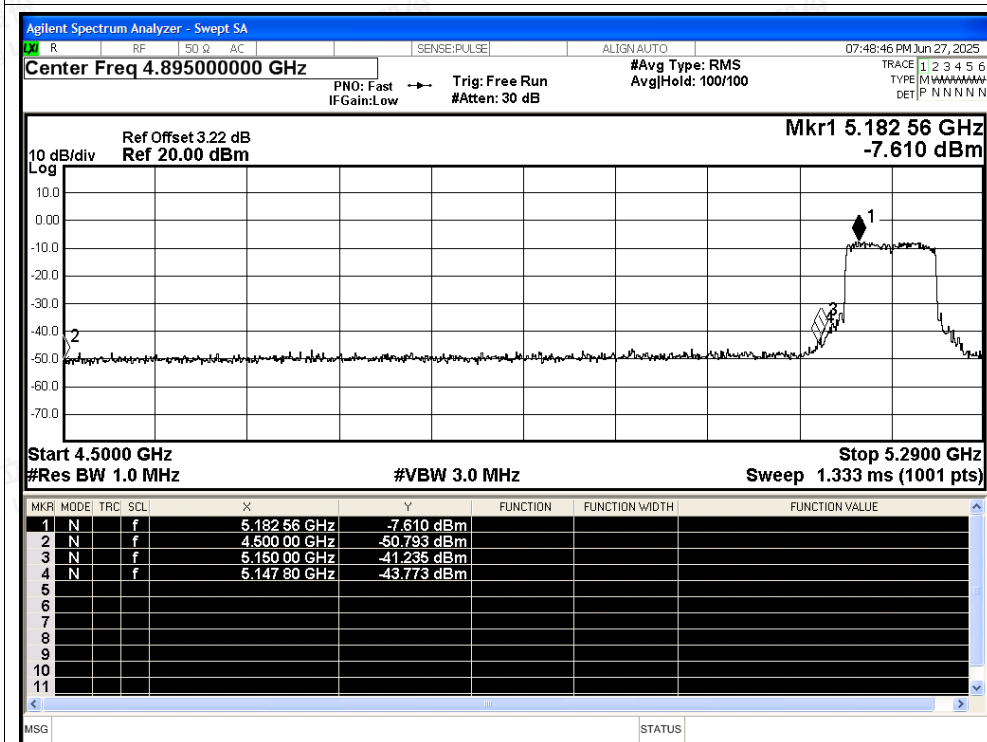

Restrict Band NVNT ac80 5210MHz Ant3 Average

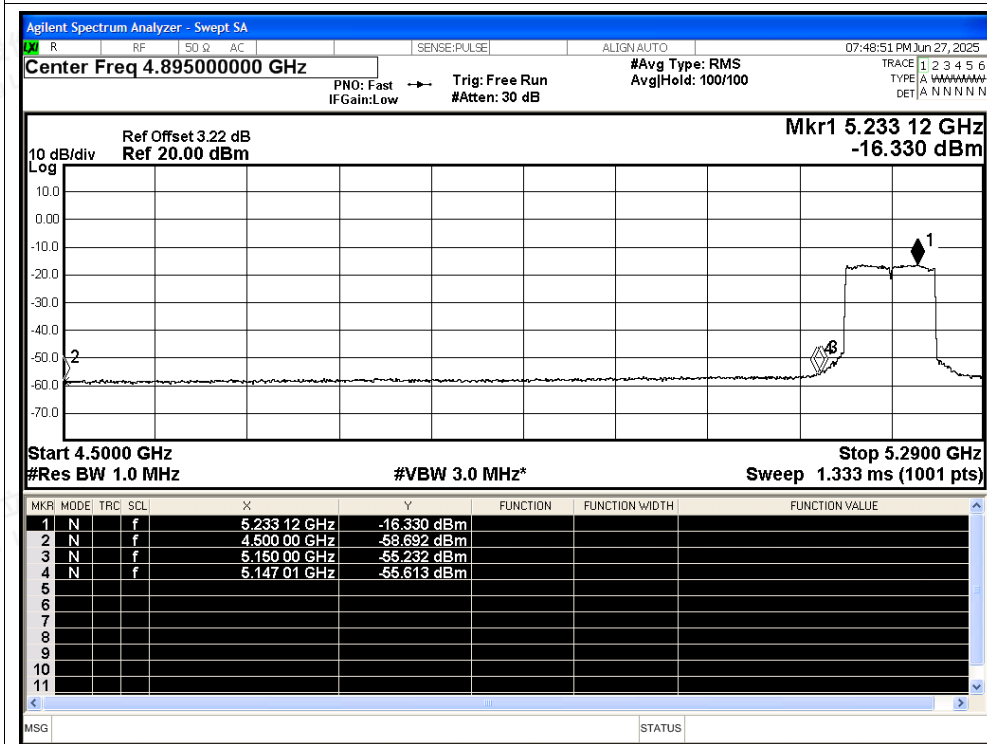

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant3 Peak

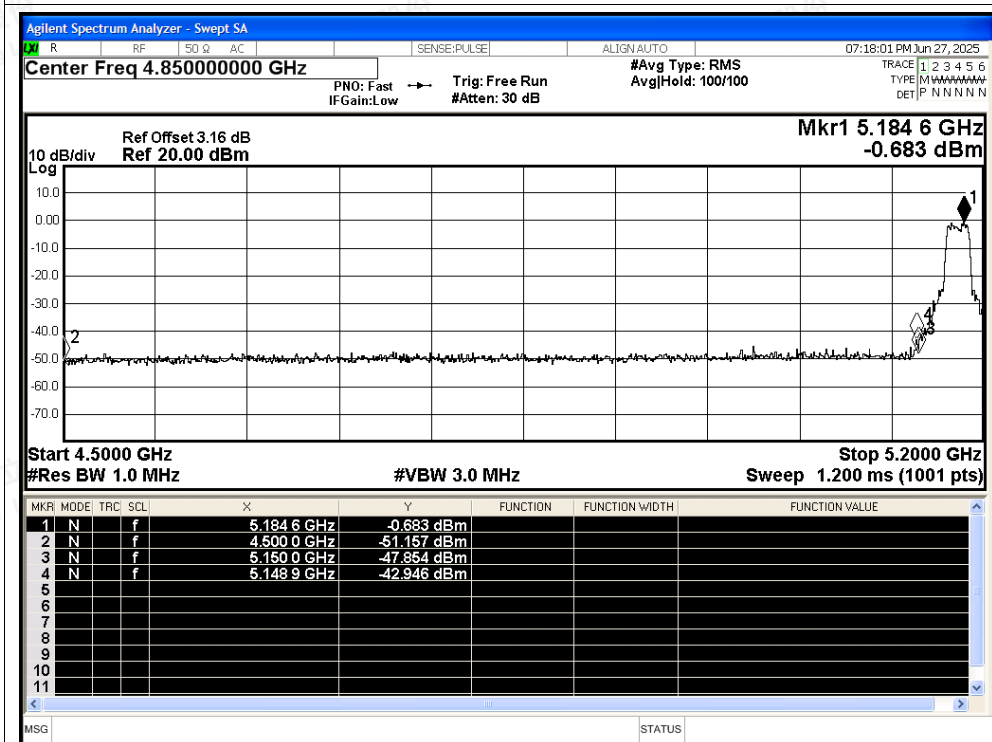

Restrict Band NVNT ax20 5180MHz Ant3 Average

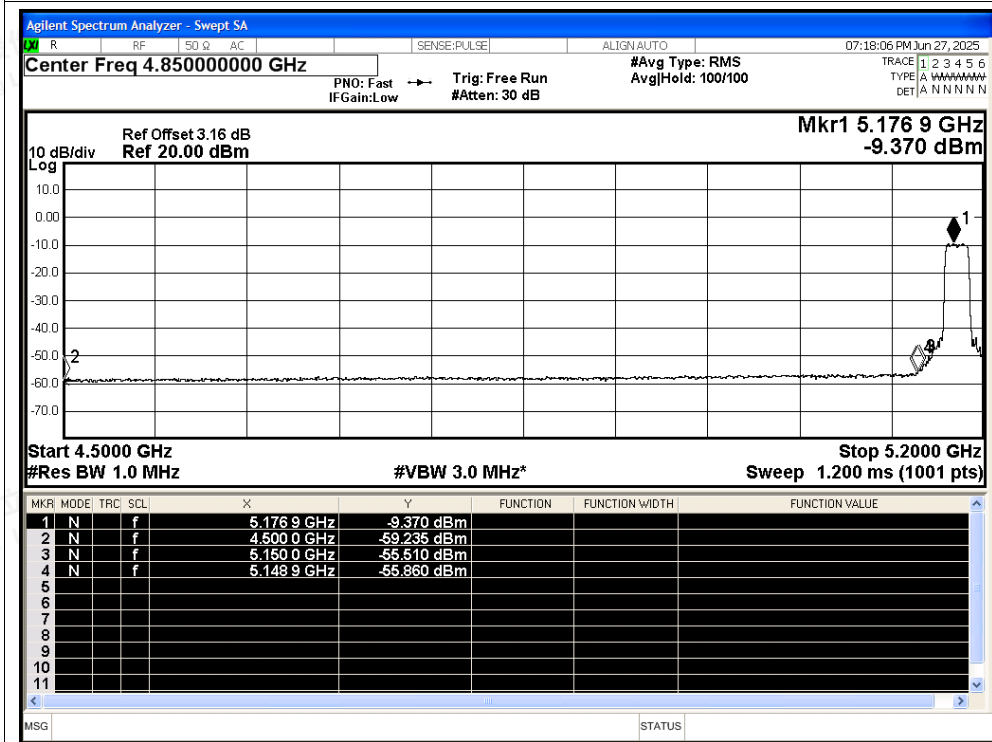

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant3 Peak

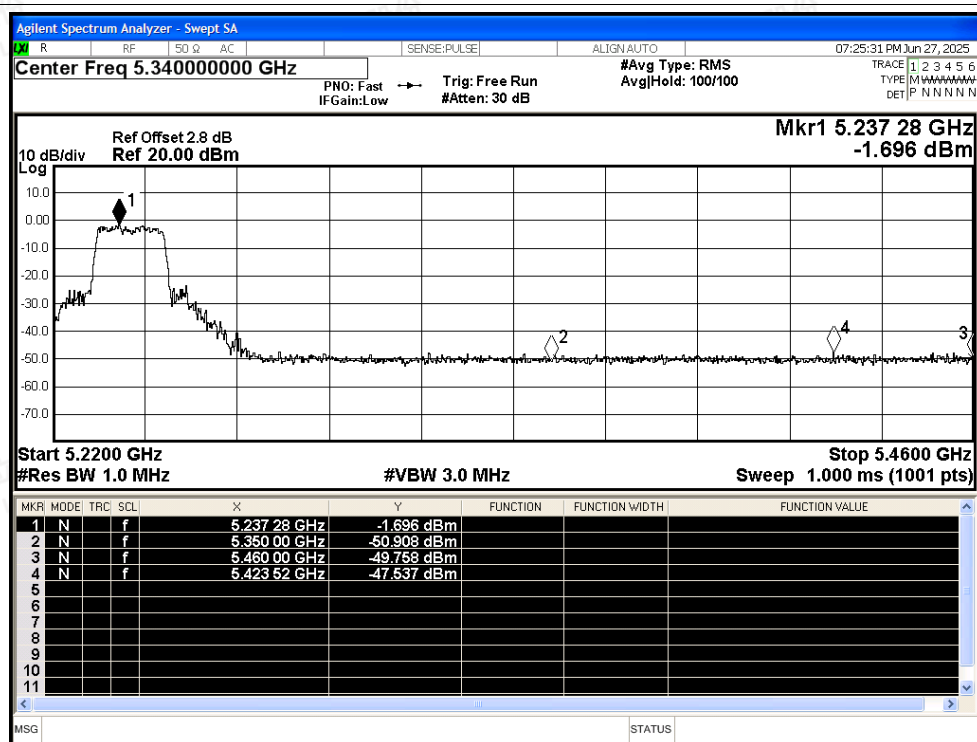

Restrict Band NVNT ax20 5240MHz Ant3 Average

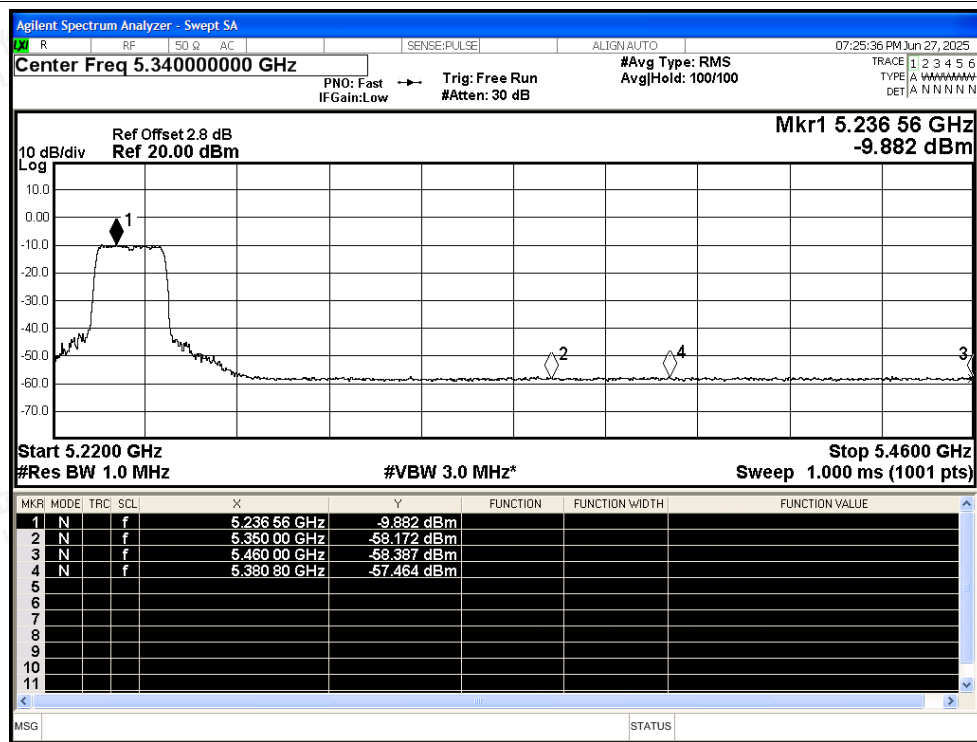

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant3 Peak

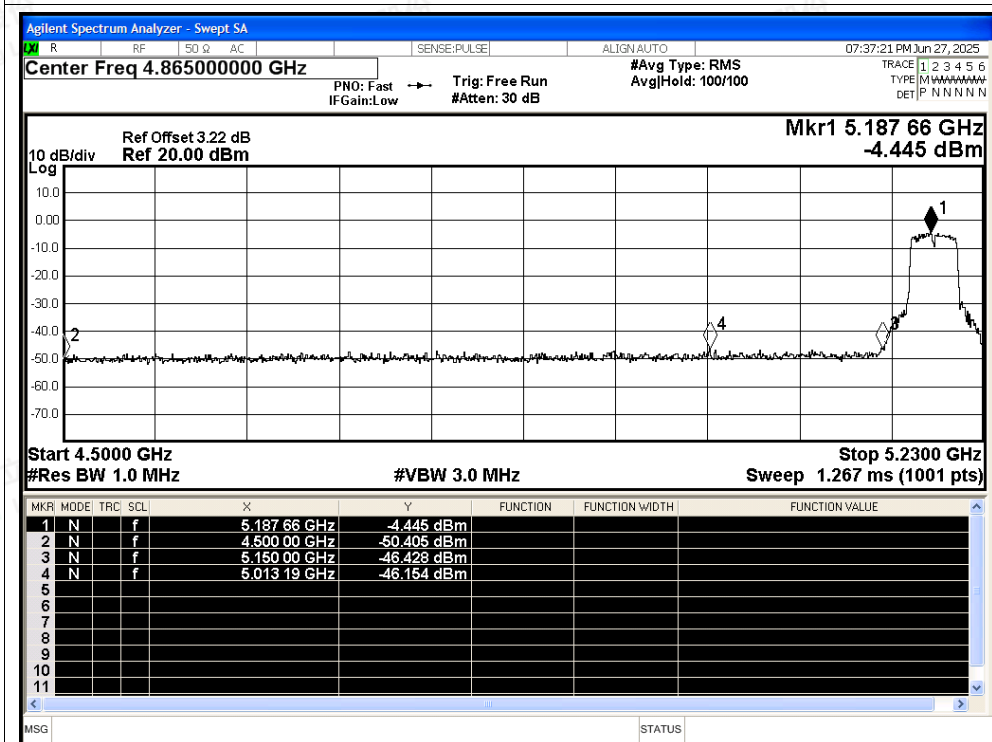

Restrict Band NVNT ax40 5190MHz Ant3 Average

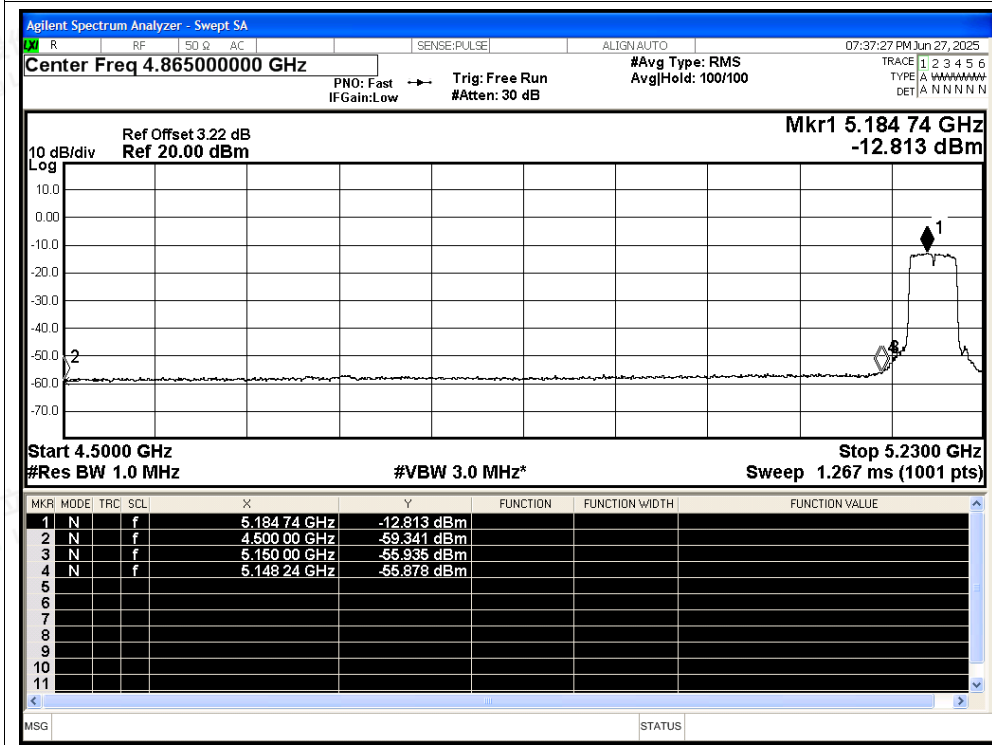

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant3 Peak

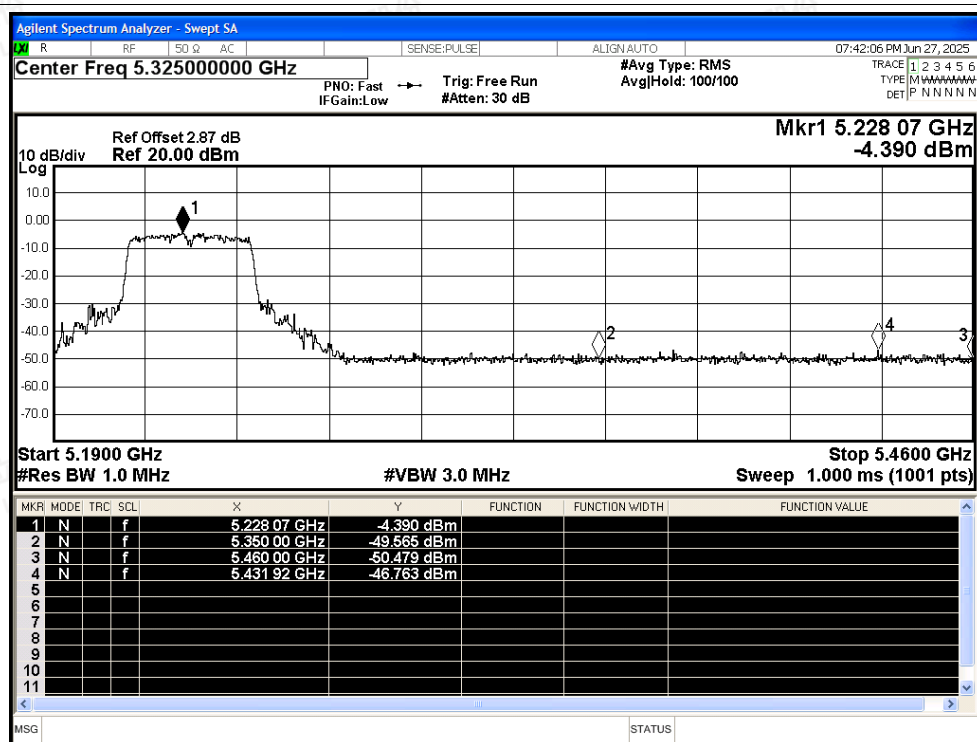

Restrict Band NVNT ax40 5230MHz Ant3 Average

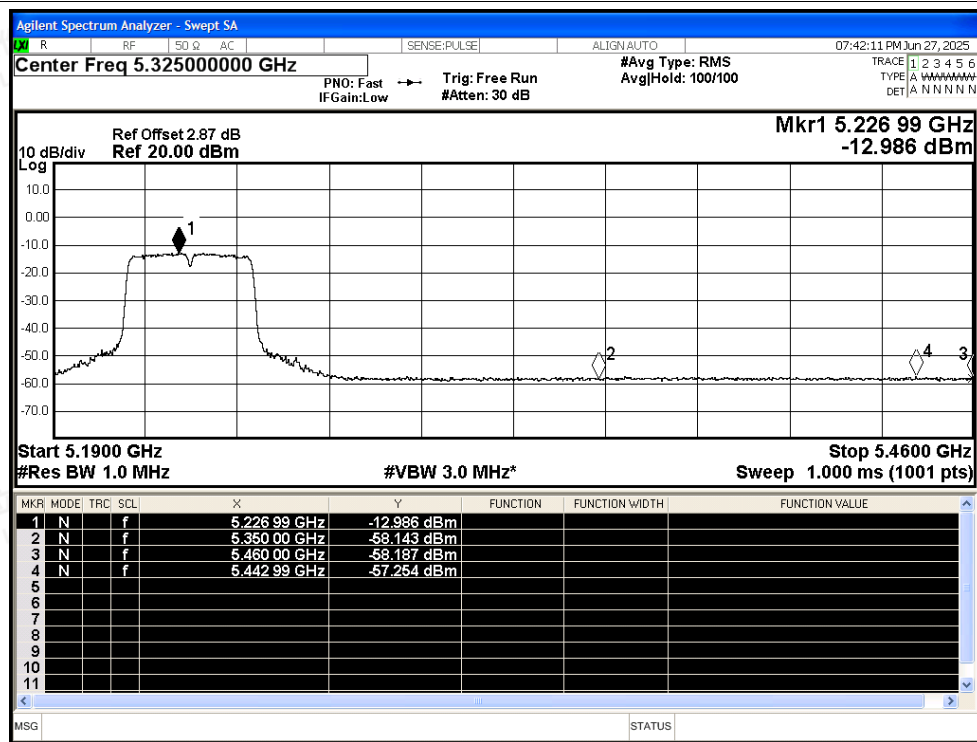

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

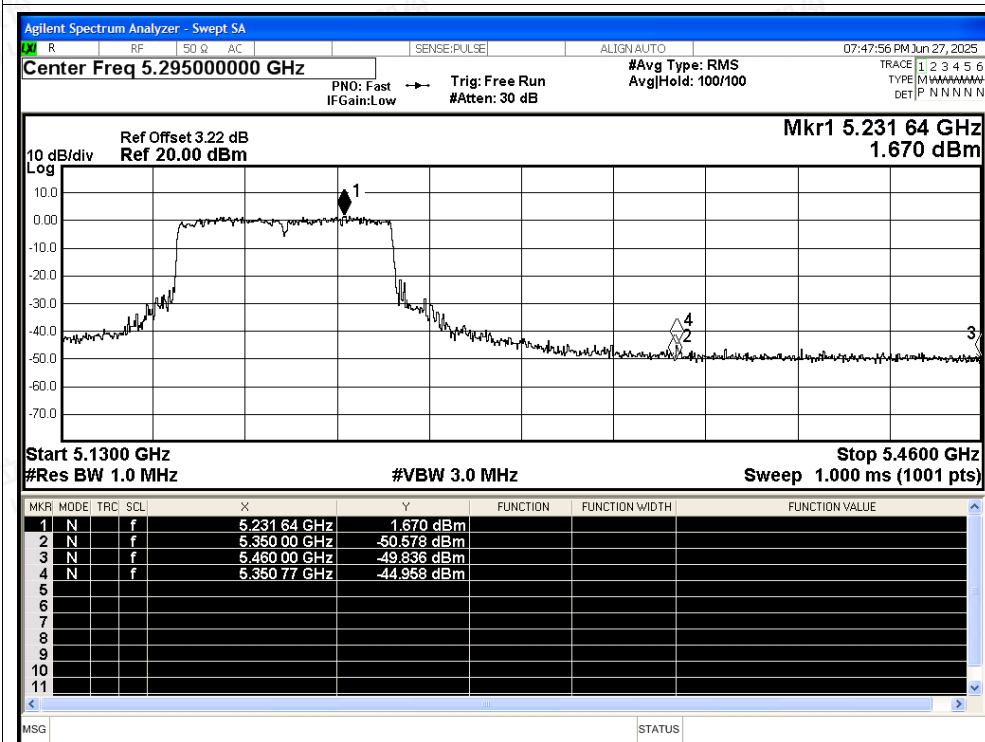

Restrict Band NVNT ax80 5210MHz Ant3 Average

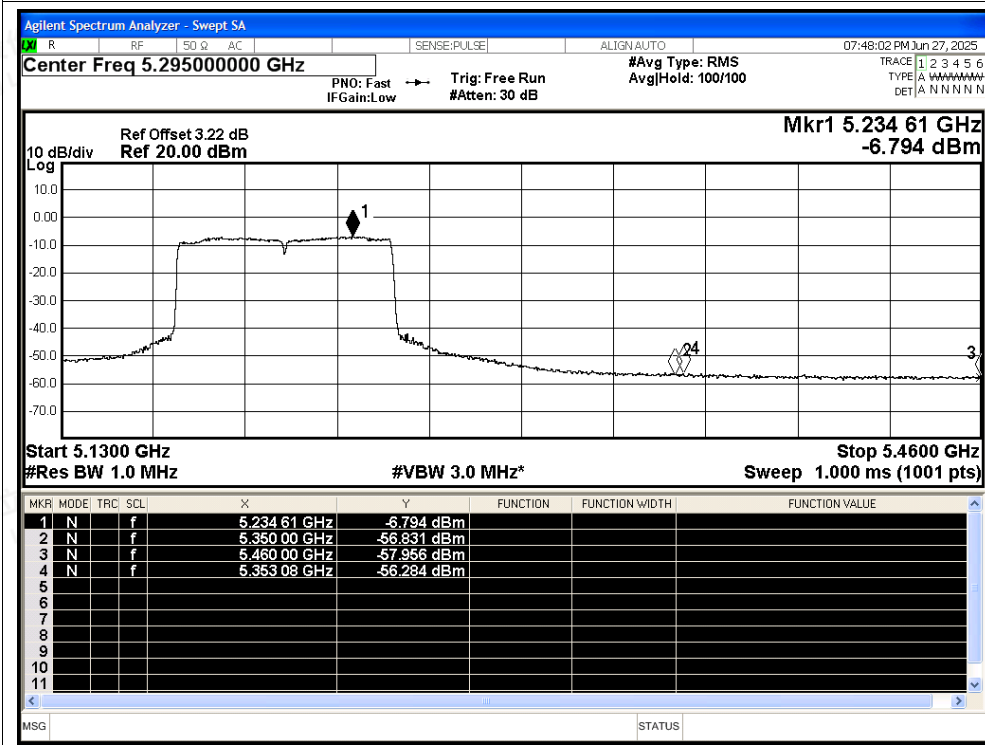

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

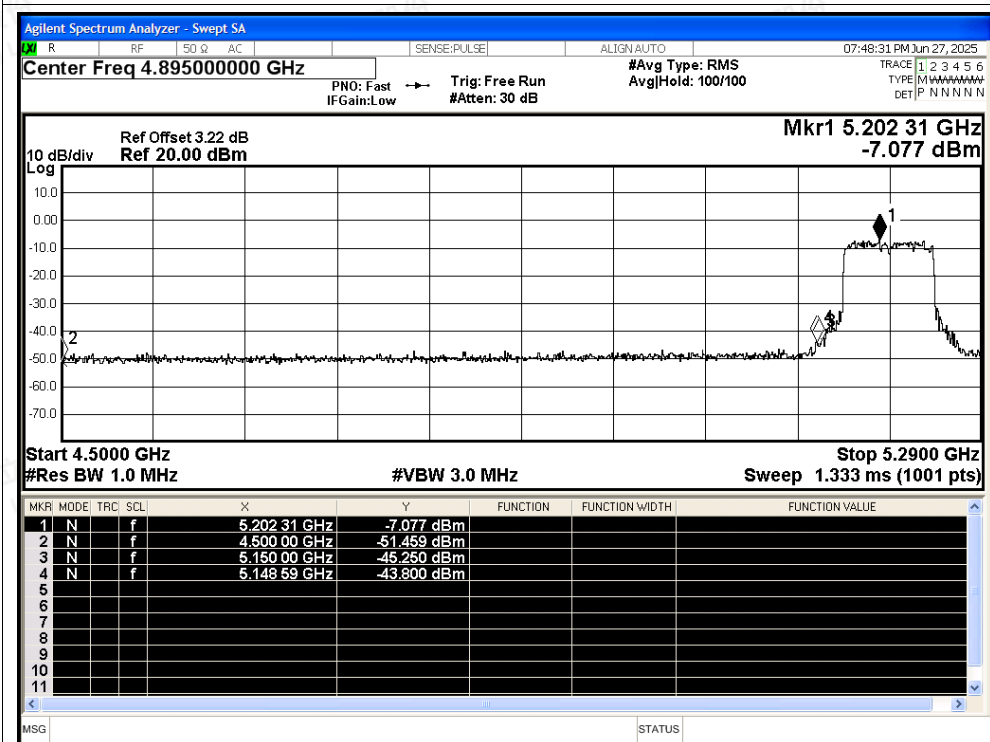

Restrict Band NVNT ax80 5210MHz Ant3 Average

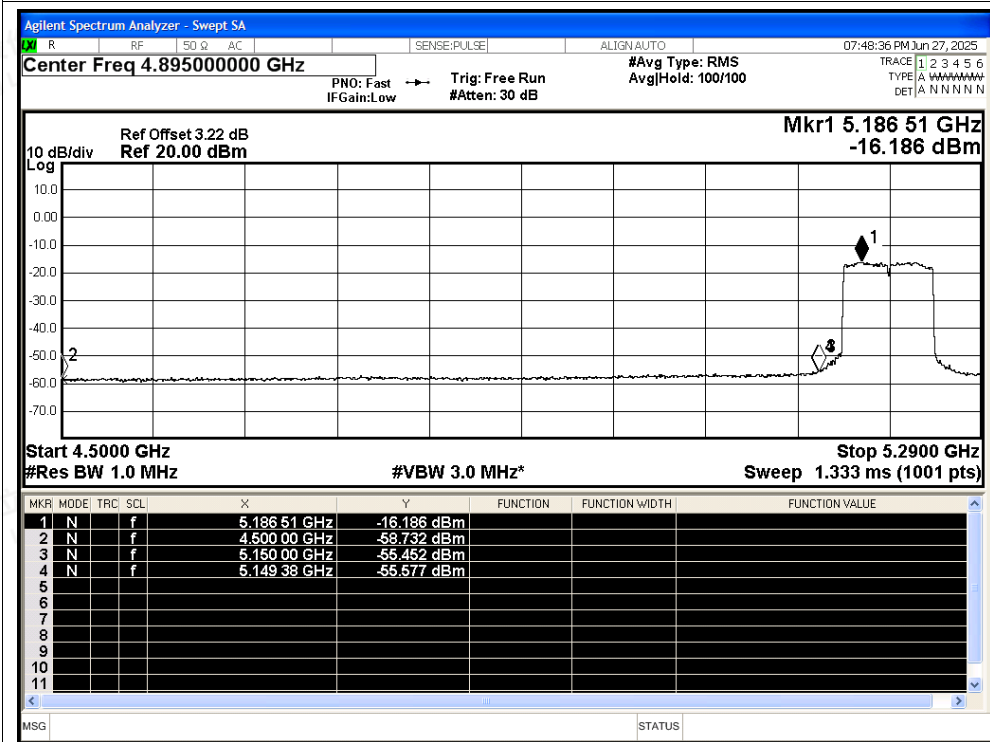

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant4	4500	-49.46	5.1	-	50.87	Peak	68.2	Pass
NVNT	a	5180	Ant4	4500	-58.75	5.1	0.24	41.82	Average	54	Pass
NVNT	a	5180	Ant4	4835.3	-46.83	5.1	-	53.50	Peak	68.2	Pass
NVNT	a	5180	Ant4	5125.8	-56.32	5.1	0.24	44.25	Average	54	Pass
NVNT	a	5180	Ant4	5150	-47.82	5.1	-	52.51	Peak	68.2	Pass
NVNT	a	5180	Ant4	5150	-56.79	5.1	0.24	43.78	Average	54	Pass
NVNT	a	5240	Ant4	5350	-50.61	5.1	-	49.72	Peak	68.2	Pass
NVNT	a	5240	Ant4	5350	-58.4	5.1	0.24	42.17	Average	54	Pass
NVNT	a	5240	Ant4	5384.64	-47.74	5.1	-	52.59	Peak	68.2	Pass
NVNT	a	5240	Ant4	5389.68	-57.28	5.1	0.24	43.29	Average	54	Pass
NVNT	a	5240	Ant4	5460	-49.68	5.1	-	50.65	Peak	68.2	Pass
NVNT	a	5240	Ant4	5460	-58.41	5.1	0.24	42.16	Average	54	Pass
NVNT	n20	5180	Ant4	4500	-51.41	5.1	-	48.92	Peak	68.2	Pass
NVNT	n20	5180	Ant4	4500	-58.52	5.1	0.12	41.93	Average	54	Pass
NVNT	n20	5180	Ant4	5144	-45.71	5.1	-	54.62	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5148.2	-55.76	5.1	0.12	44.69	Average	54	Pass
NVNT	n20	5180	Ant4	5150	-46.94	5.1	-	53.39	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5150	-56.11	5.1	0.12	44.34	Average	54	Pass
NVNT	n20	5240	Ant4	5350	-50.82	5.1	-	49.51	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5350	-58.05	5.1	0.12	42.40	Average	54	Pass
NVNT	n20	5240	Ant4	5409.36	-46.37	5.1	-	53.96	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5367.36	-57.43	5.1	0.12	43.02	Average	54	Pass
NVNT	n20	5240	Ant4	5460	-51.46	5.1	-	48.87	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5460	-58.63	5.1	0.12	41.82	Average	54	Pass
NVNT	n40	5190	Ant4	4500	-49.47	5.1	-	50.86	Peak	68.2	Pass
NVNT	n40	5190	Ant4	4500	-58.54	5.1	0.24	42.03	Average	54	Pass
NVNT	n40	5190	Ant4	5148.97	-41.1	5.1	-	59.23	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5149.7	-55.53	5.1	0.24	45.04	Average	54	Pass
NVNT	n40	5190	Ant4	5150	-45.87	5.1	-	54.46	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5150	-55.53	5.1	0.24	45.04	Average	54	Pass
NVNT	n40	5230	Ant4	5350	-50.23	5.1	-	50.10	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350	-58.29	5.1	0.24	42.28	Average	54	Pass
NVNT	n40	5230	Ant4	5359.29	-47	5.1	-	53.33	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5394.12	-57.26	5.1	0.24	43.31	Average	54	Pass
NVNT	n40	5230	Ant4	5460	-50.86	5.1	-	49.47	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5460	-58.82	5.1	0.24	41.75	Average	54	Pass
NVNT	ac20	5180	Ant4	4500	-50.3	5.1	-	50.03	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	4500	-59.26	5.1	0.12	41.19	Average	54	Pass
NVNT	ac20	5180	Ant4	5149.6	-43.78	5.1	-	56.55	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant4	5149.6	-55.78	5.1	0.12	44.67	Average	54	Pass
NVNT	ac20	5180	Ant4	5150	-41.88	5.1	-	58.45	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5150	-55.31	5.1	0.12	45.14	Average	54	Pass
NVNT	ac20	5240	Ant4	5350	-50.69	5.1	-	49.64	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350	-58.7	5.1	0.12	41.75	Average	54	Pass
NVNT	ac20	5240	Ant4	5354.64	-47.24	5.1	-	53.09	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5438.88	-57.38	5.1	0.12	43.07	Average	54	Pass
NVNT	ac20	5240	Ant4	5460	-50.8	5.1	-	49.53	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5460	-58.18	5.1	0.12	42.27	Average	54	Pass
NVNT	ac40	5190	Ant4	4500	-50.4	5.1	-	49.93	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	4500	-59.03	5.1	0.24	41.54	Average	54	Pass
NVNT	ac40	5190	Ant4	5148.24	-44.89	5.1	-	55.44	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5149.7	-55.42	5.1	0.24	45.15	Average	54	Pass
NVNT	ac40	5190	Ant4	5150	-47.67	5.1	-	52.66	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5150	-55.42	5.1	0.24	45.15	Average	54	Pass
NVNT	ac40	5230	Ant4	5350	-49.06	5.1	-	51.27	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5350	-58.11	5.1	0.24	42.46	Average	54	Pass
NVNT	ac40	5230	Ant4	5451.36	-47.57	5.1	-	52.76	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5386.56	-57.37	5.1	0.24	43.20	Average	54	Pass
NVNT	ac40	5230	Ant4	5460	-51.01	5.1	-	49.32	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5460	-58.63	5.1	0.24	41.94	Average	54	Pass
NVNT	ac80	5210	Ant4	5350	-48.27	5.1	-	52.06	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5350	-56.6	5.1	0.47	44.20	Average	54	Pass
NVNT	ac80	5210	Ant4	5350.77	-46.15	5.1	-	54.18	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5351.76	-56.41	5.1	0.47	44.39	Average	54	Pass
NVNT	ac80	5210	Ant4	5460	-50.11	5.1	-	50.22	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5460	-57.97	5.1	0.47	42.83	Average	54	Pass
NVNT	ac80	5210	Ant4	4500	-50.54	5.1	-	49.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	4500	-58.49	5.1	0.47	42.31	Average	54	Pass
NVNT	ac80	5210	Ant4	5147.8	-44.42	5.1	-	55.91	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5147.01	-55.58	5.1	0.47	45.22	Average	54	Pass
NVNT	ac80	5210	Ant4	5150	-45.21	5.1	-	55.12	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5150	-55.36	5.1	0.47	45.44	Average	54	Pass
NVNT	ax20	5180	Ant4	4500	-51.46	5.1	-	48.87	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	4500	-59.1	5.1	0.12	41.35	Average	54	Pass
NVNT	ax20	5180	Ant4	5127.9	-46.42	5.1	-	53.91	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5149.6	-56.01	5.1	0.12	44.44	Average	54	Pass
NVNT	ax20	5180	Ant4	5150	-45.01	5.1	-	55.32	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5150	-56.09	5.1	0.12	44.36	Average	54	Pass
NVNT	ax20	5240	Ant4	5350	-50.73	5.1	-	49.60	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5350	-57.99	5.1	0.12	42.46	Average	54	Pass
NVNT	ax20	5240	Ant4	5449.2	-47.21	5.1	-	53.12	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5439.12	-57.37	5.1	0.12	43.08	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant4	5460	-49.44	5.1	-	50.89	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5460	-58.33	5.1	0.12	42.12	Average	54	Pass
NVNT	ax40	5190	Ant4	4500	-49.9	5.1	-	50.43	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	4500	-58.49	5.1	0.24	42.08	Average	54	Pass
NVNT	ax40	5190	Ant4	5149.7	-44.83	5.1	-	55.50	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5149.7	-55.27	5.1	0.24	45.30	Average	54	Pass
NVNT	ax40	5190	Ant4	5150	-44.83	5.1	-	55.50	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5150	-55.27	5.1	0.24	45.30	Average	54	Pass
NVNT	ax40	5230	Ant4	5350	-50.81	5.1	-	49.52	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5350	-58.3	5.1	0.24	42.27	Average	54	Pass
NVNT	ax40	5230	Ant4	5434.08	-47.51	5.1	-	52.82	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5352.81	-57.36	5.1	0.24	43.21	Average	54	Pass
NVNT	ax40	5230	Ant4	5460	-50.29	5.1	-	50.04	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5460	-57.94	5.1	0.24	42.63	Average	54	Pass
NVNT	ax80	5210	Ant4	5350	-48.71	5.1	-	51.62	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5350	-57.03	5.1	0.47	43.77	Average	54	Pass
NVNT	ax80	5210	Ant4	5373.21	-46.62	5.1	-	53.71	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5359.35	-56.29	5.1	0.47	44.51	Average	54	Pass
NVNT	ax80	5210	Ant4	5460	-48.56	5.1	-	51.77	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5460	-57.42	5.1	0.47	43.38	Average	54	Pass
NVNT	ax80	5210	Ant4	4500	-49.55	5.1	-	50.78	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	4500	-58.95	5.1	0.47	41.85	Average	54	Pass
NVNT	ax80	5210	Ant4	5149.38	-43.21	5.1	-	57.12	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5148.59	-55.57	5.1	0.47	45.23	Average	54	Pass
NVNT	ax80	5210	Ant4	5150	-46.88	5.1	-	53.45	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5150	-55.81	5.1	0.47	44.99	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant4 Peak

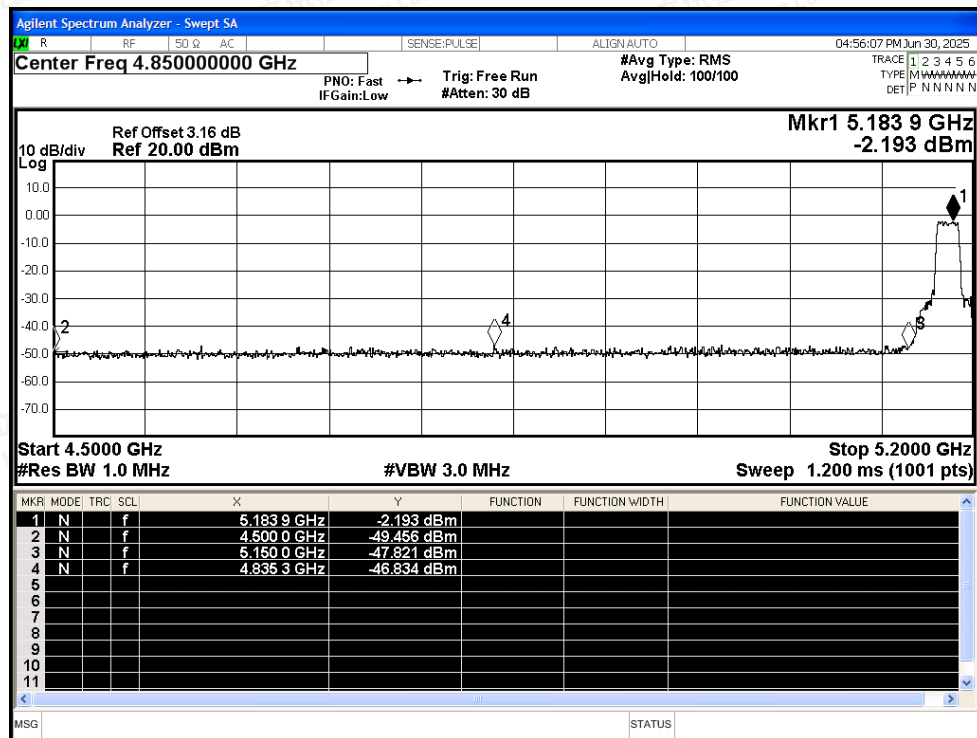

Restrict Band NVNT a 5180MHz Ant4 Average

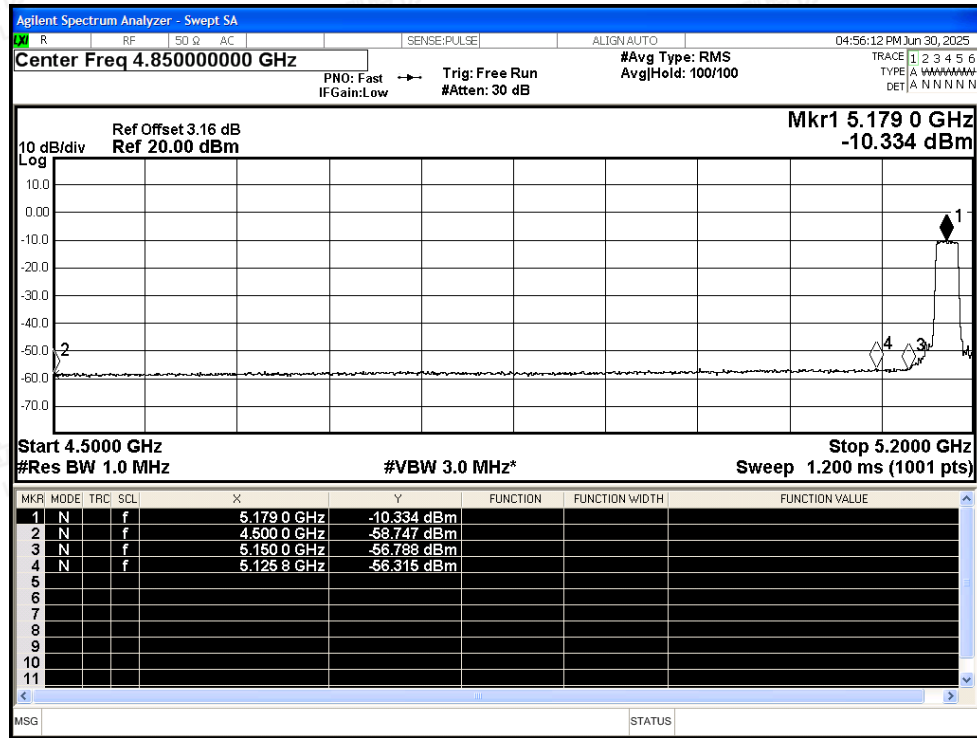

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant4 Peak

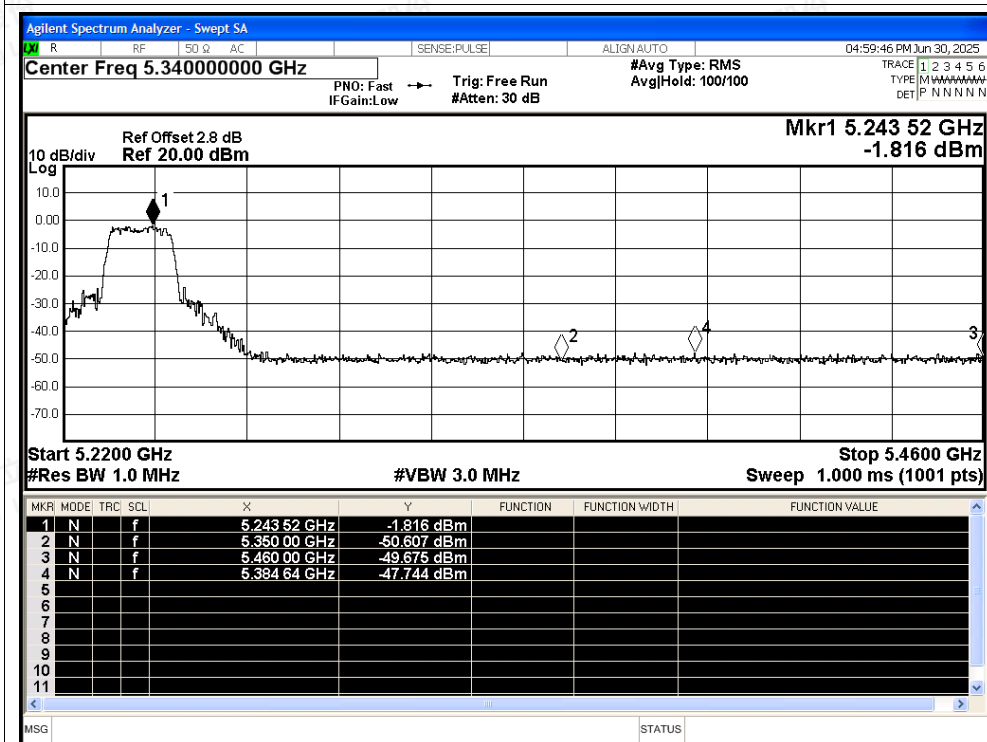

Restrict Band NVNT a 5240MHz Ant4 Average

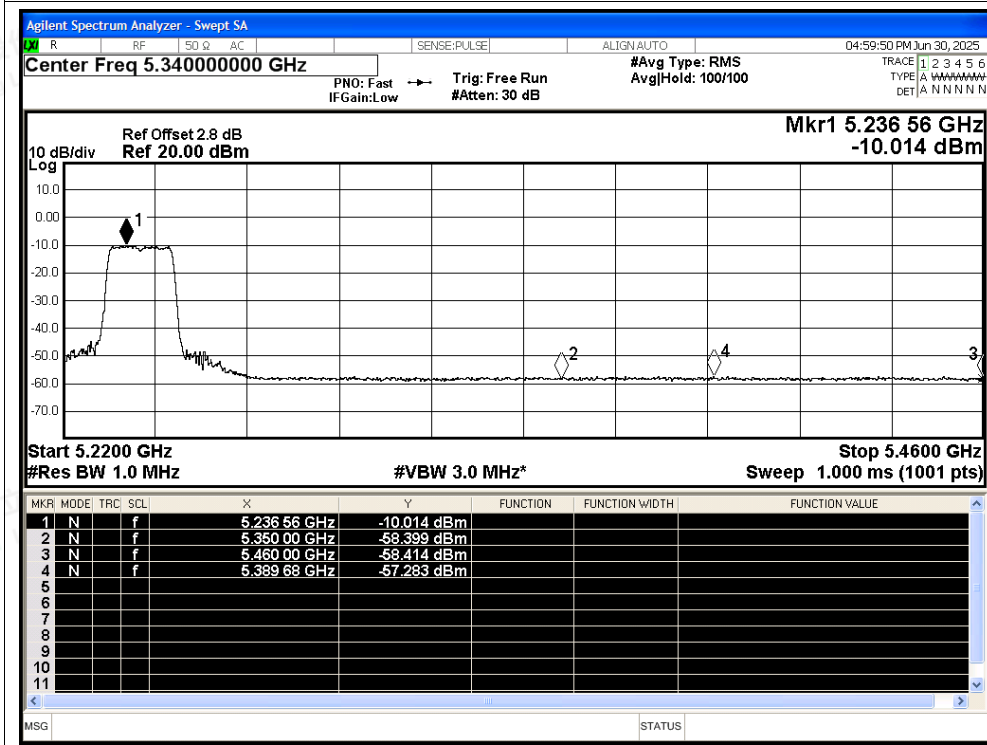

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant4 Peak

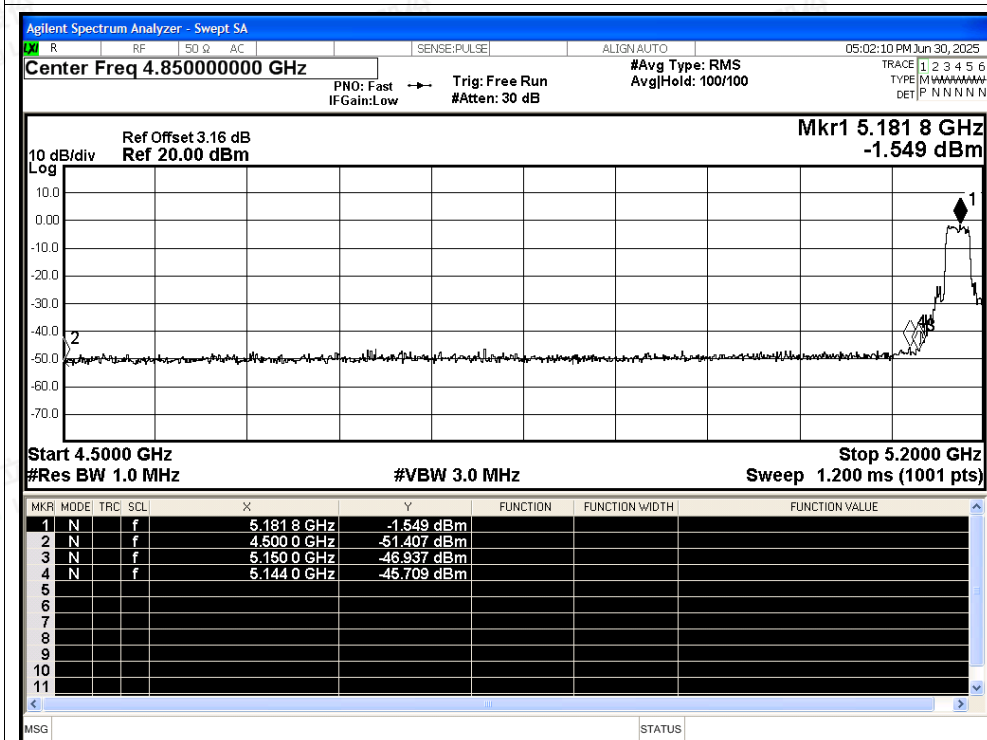

Restrict Band NVNT n20 5180MHz Ant4 Average

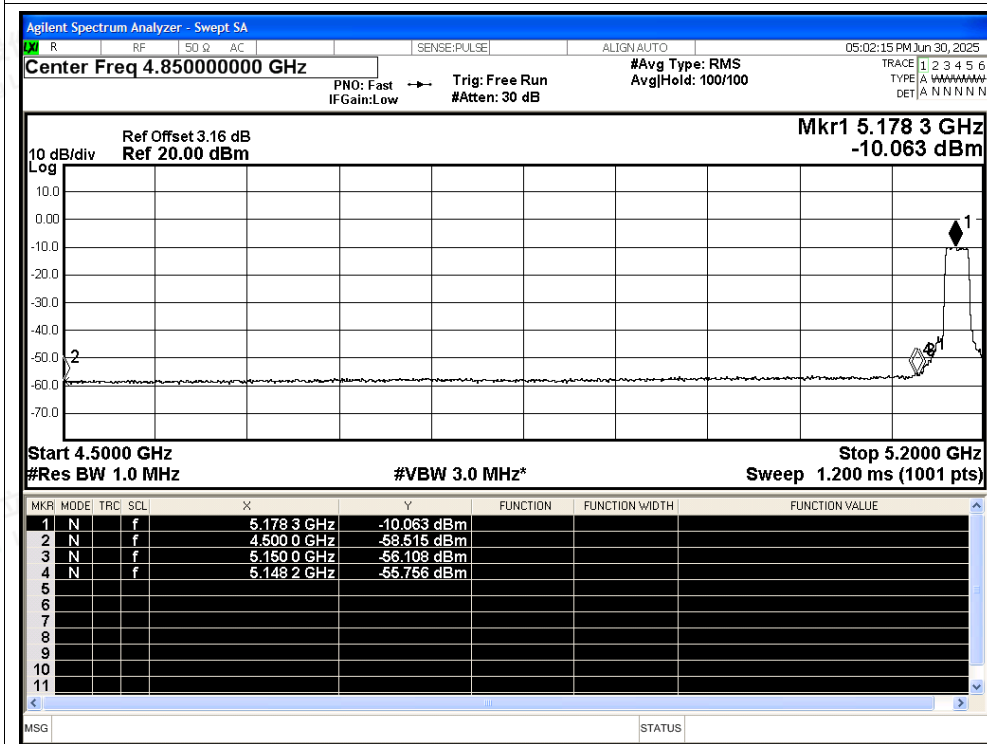

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant4 Peak

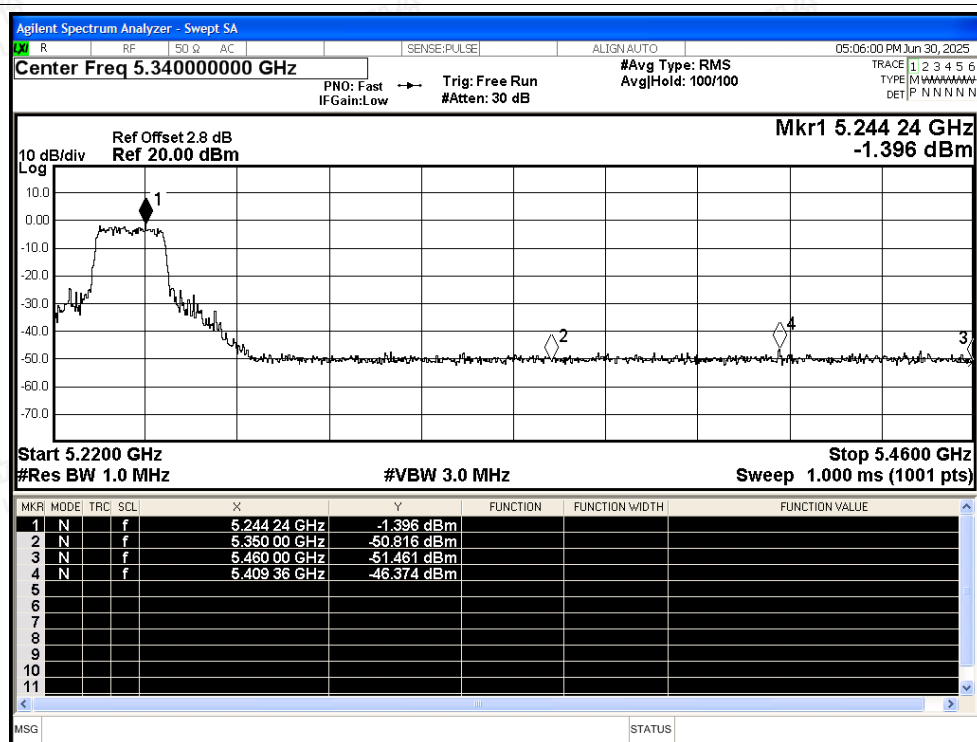

Restrict Band NVNT n20 5240MHz Ant4 Average

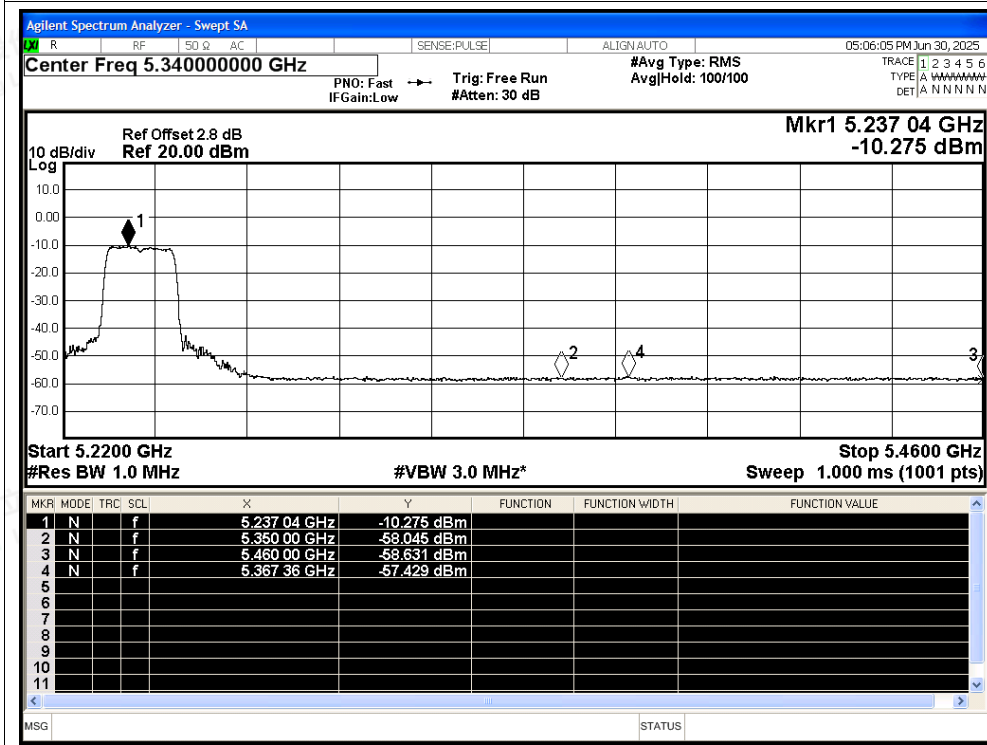

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant4 Peak

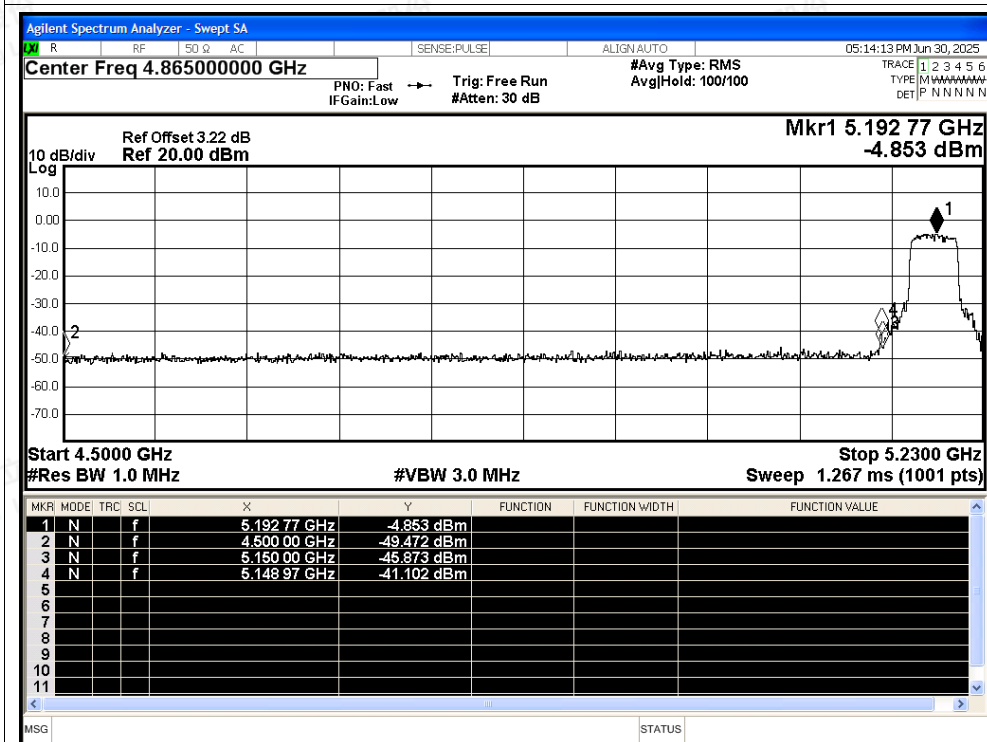

Restrict Band NVNT n40 5190MHz Ant4 Average

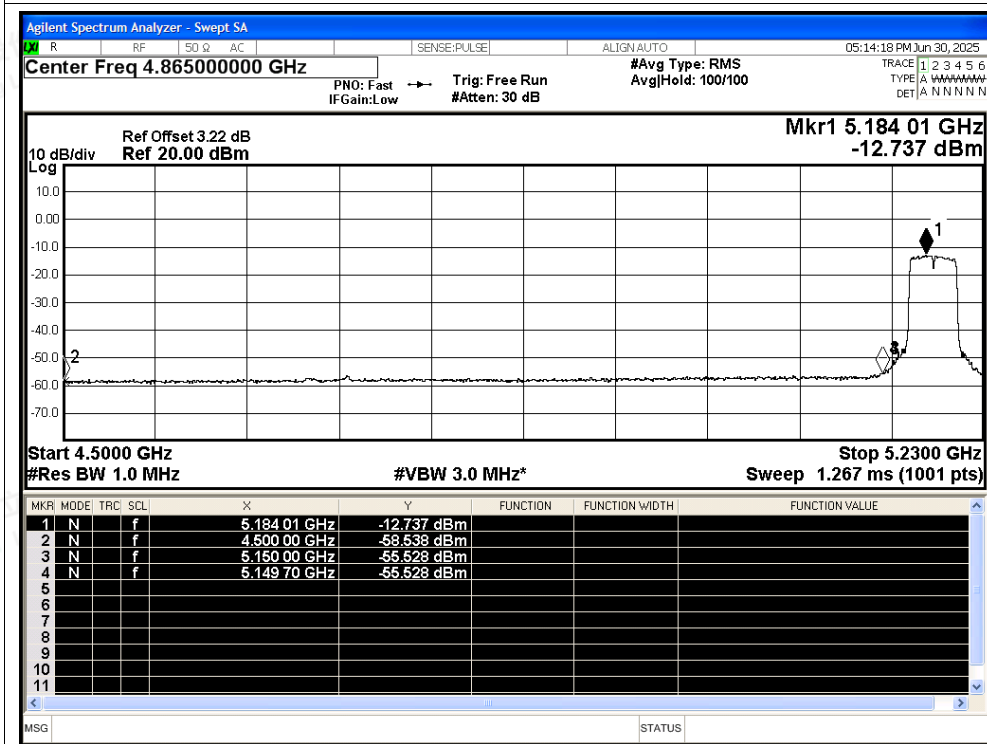

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant4 Peak

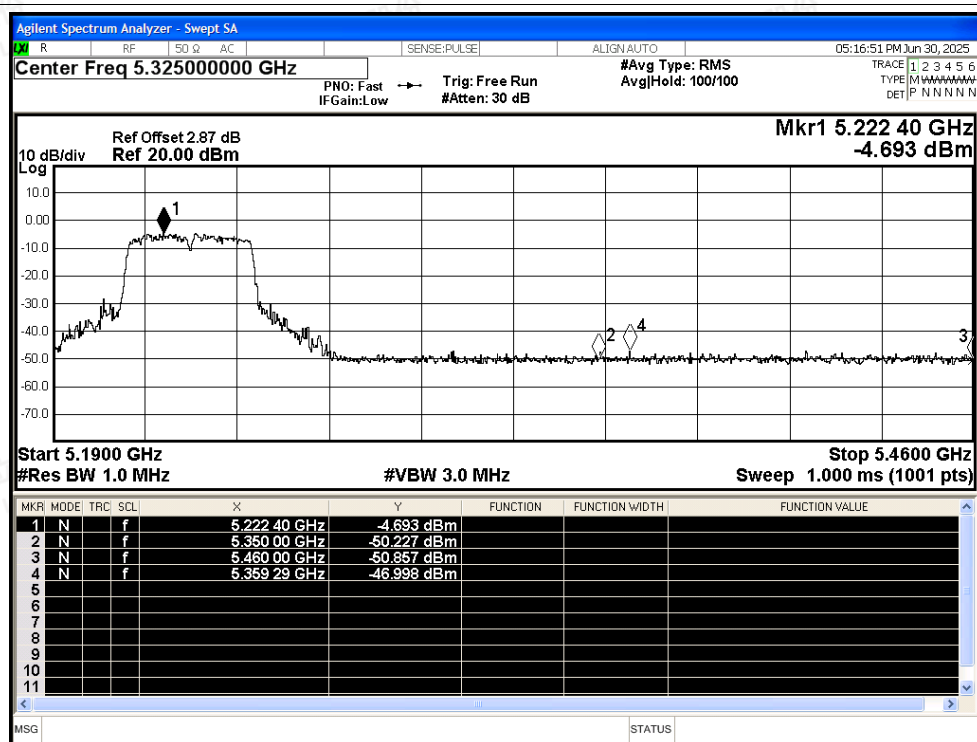

Restrict Band NVNT n40 5230MHz Ant4 Average

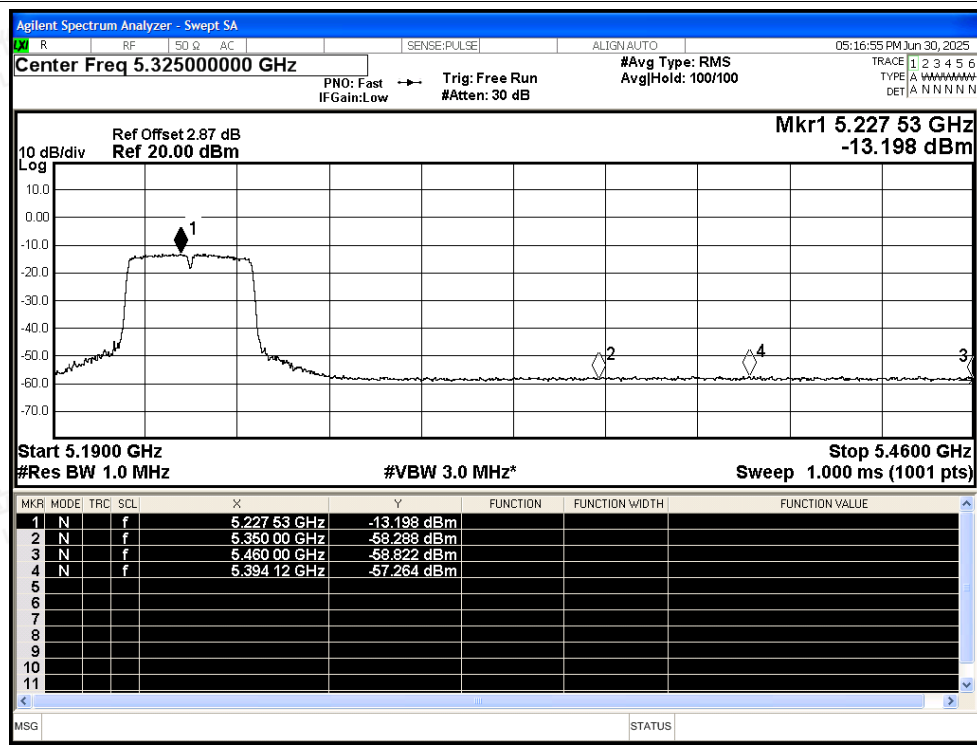

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant4 Peak

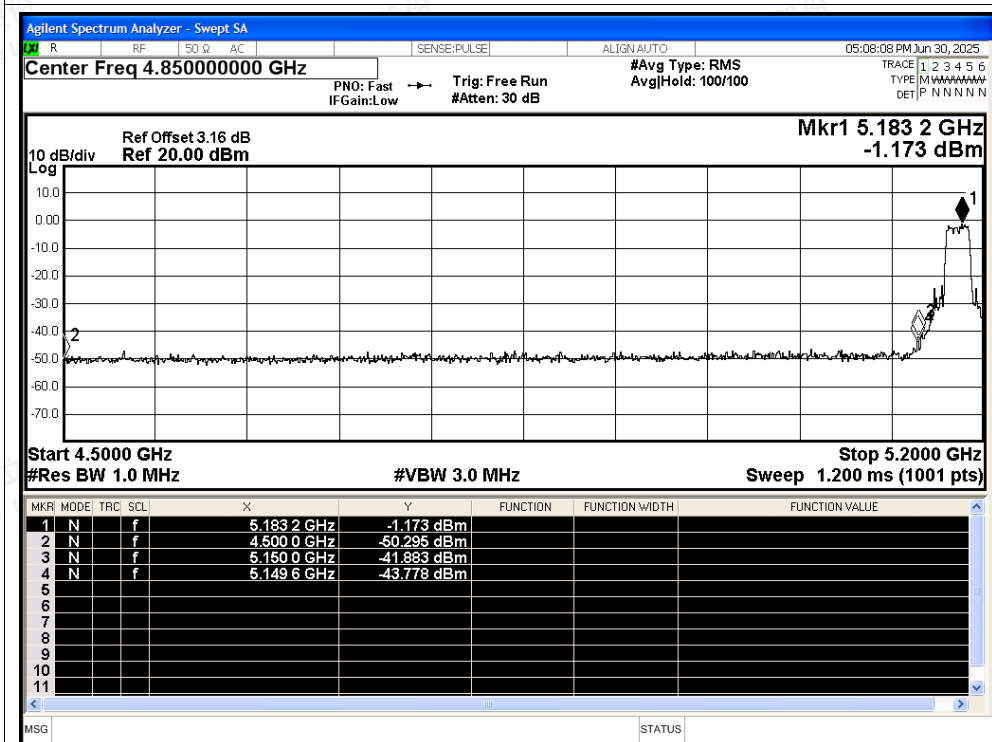

Restrict Band NVNT ac20 5180MHz Ant4 Average

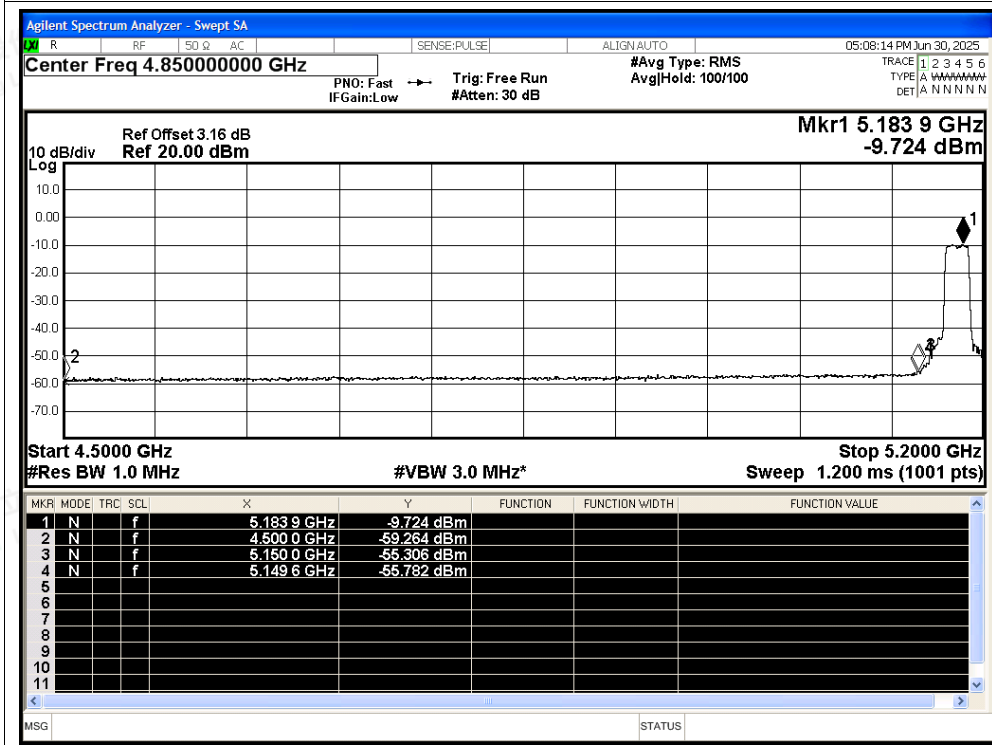

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant4 Peak

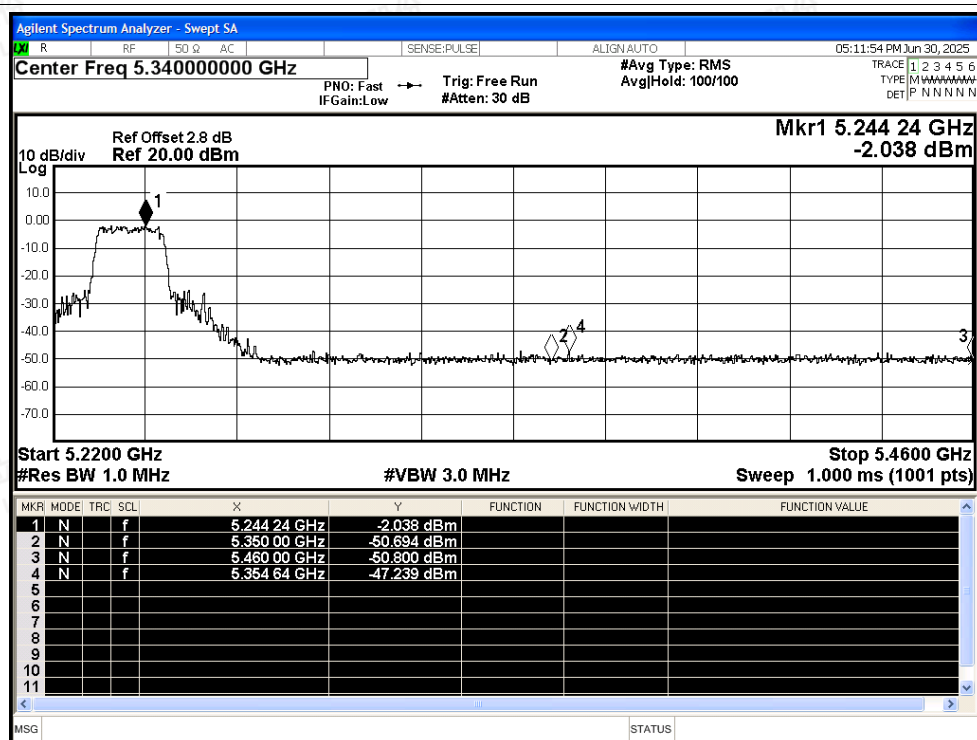

Restrict Band NVNT ac20 5240MHz Ant4 Average

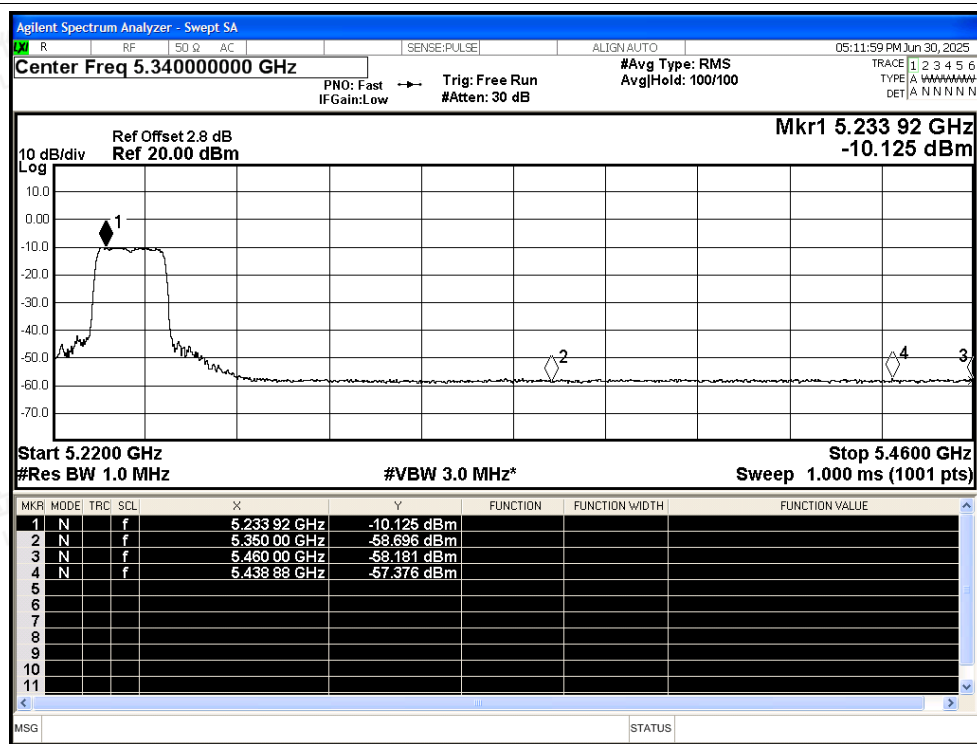

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant4 Peak

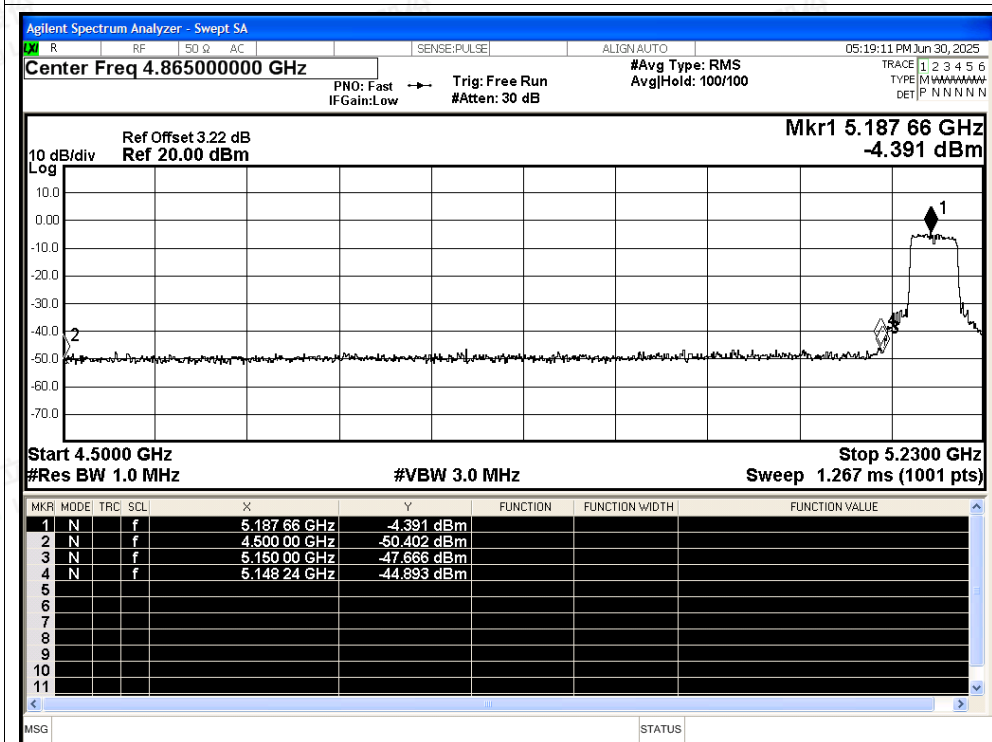

Restrict Band NVNT ac40 5190MHz Ant4 Average

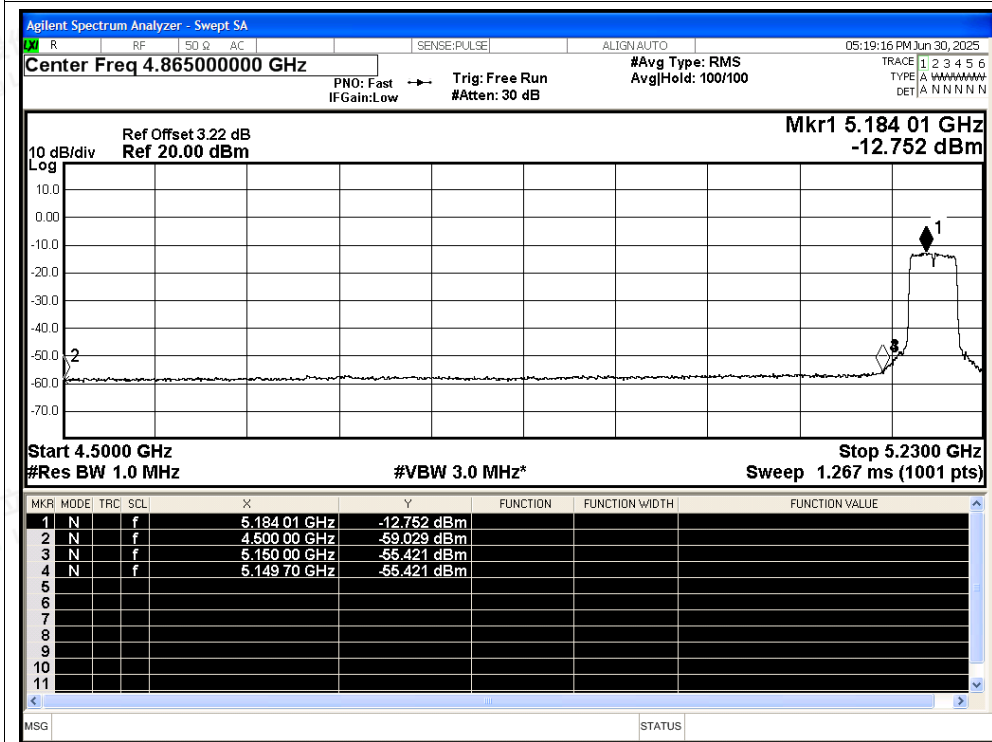

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant4 Peak

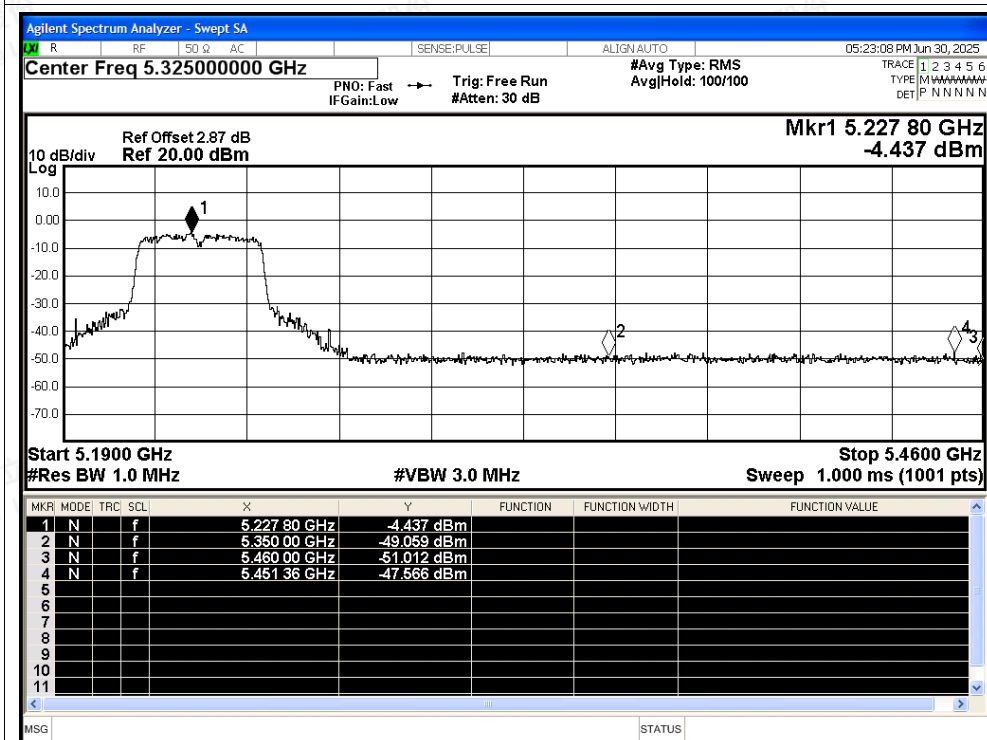

Restrict Band NVNT ac40 5230MHz Ant4 Average

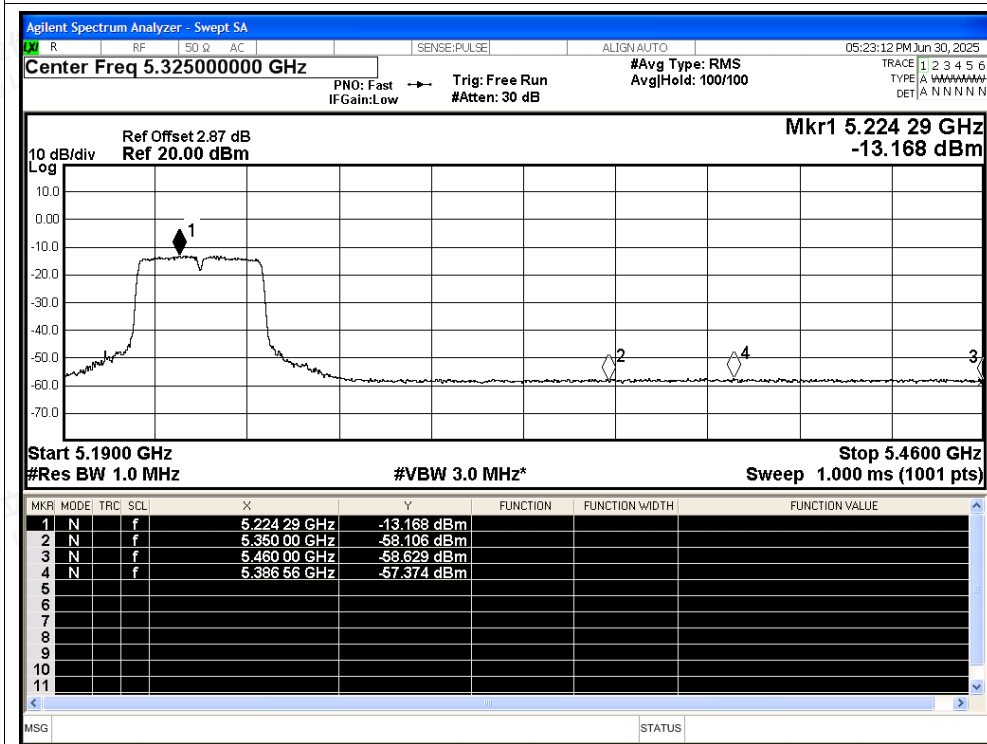

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant4 Peak

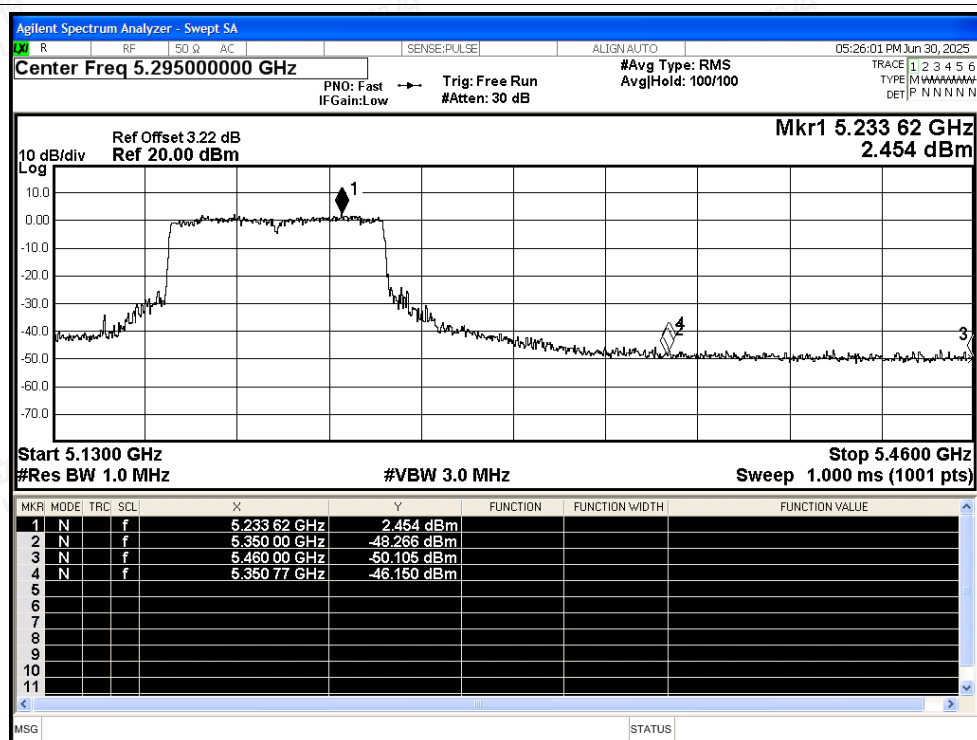

Restrict Band NVNT ac80 5210MHz Ant4 Average

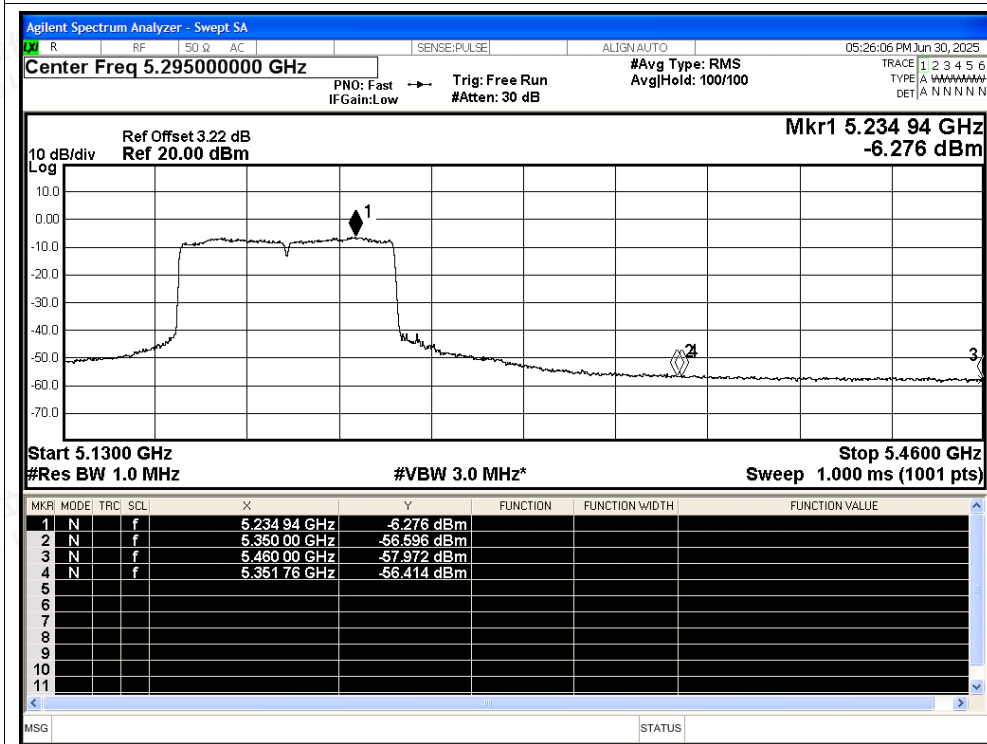

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant4 Peak

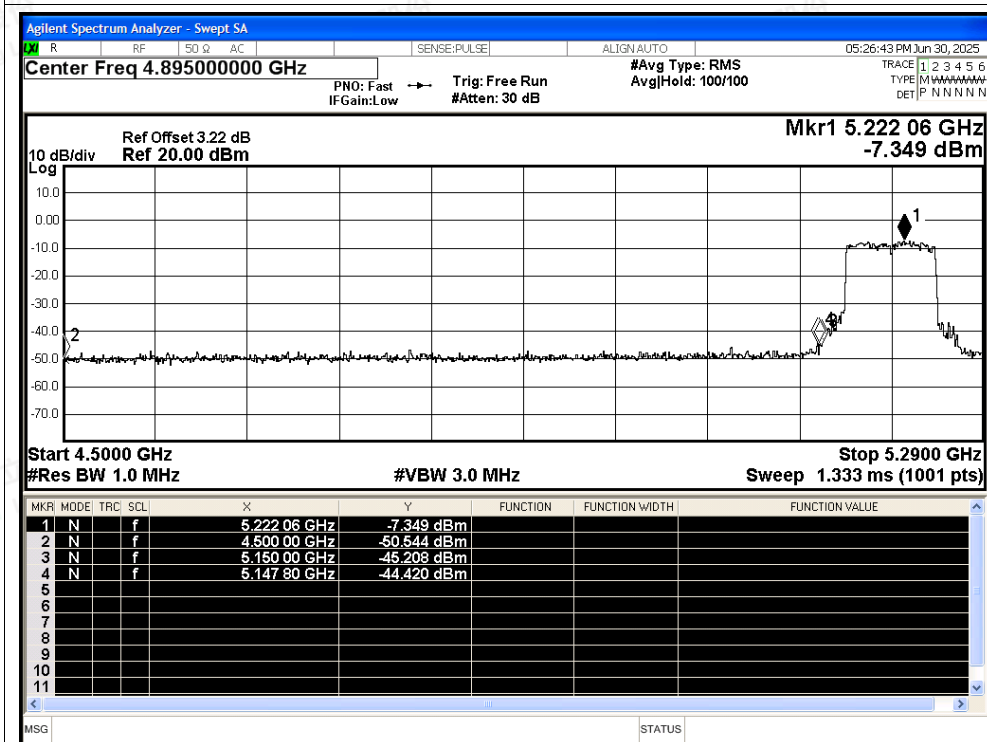

Restrict Band NVNT ac80 5210MHz Ant4 Average

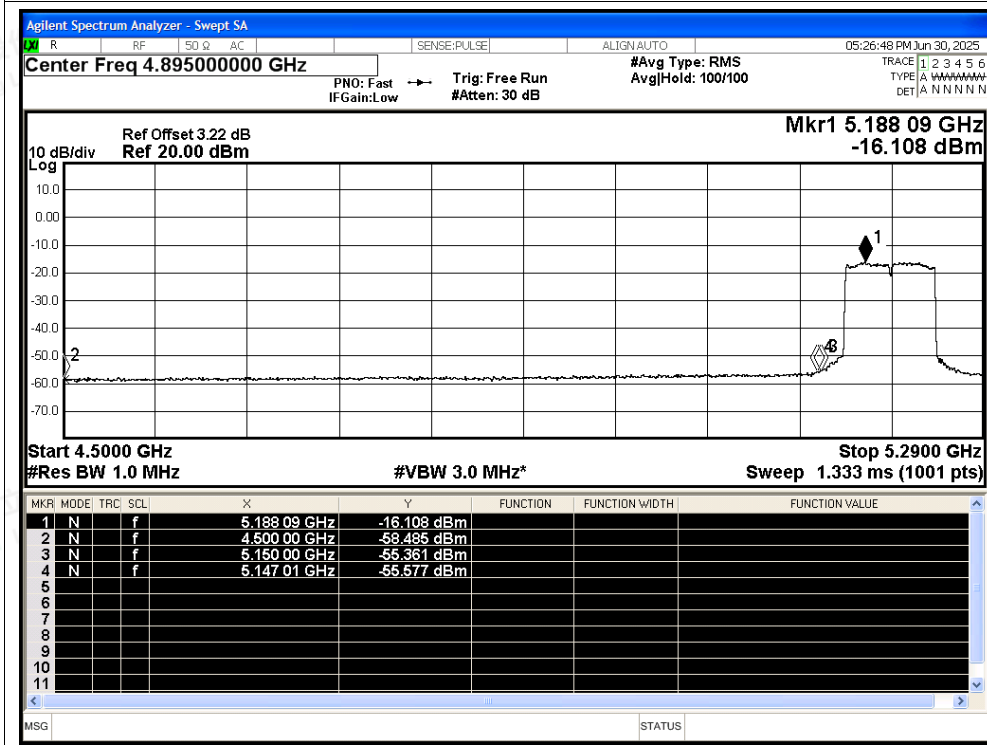

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant4 Peak

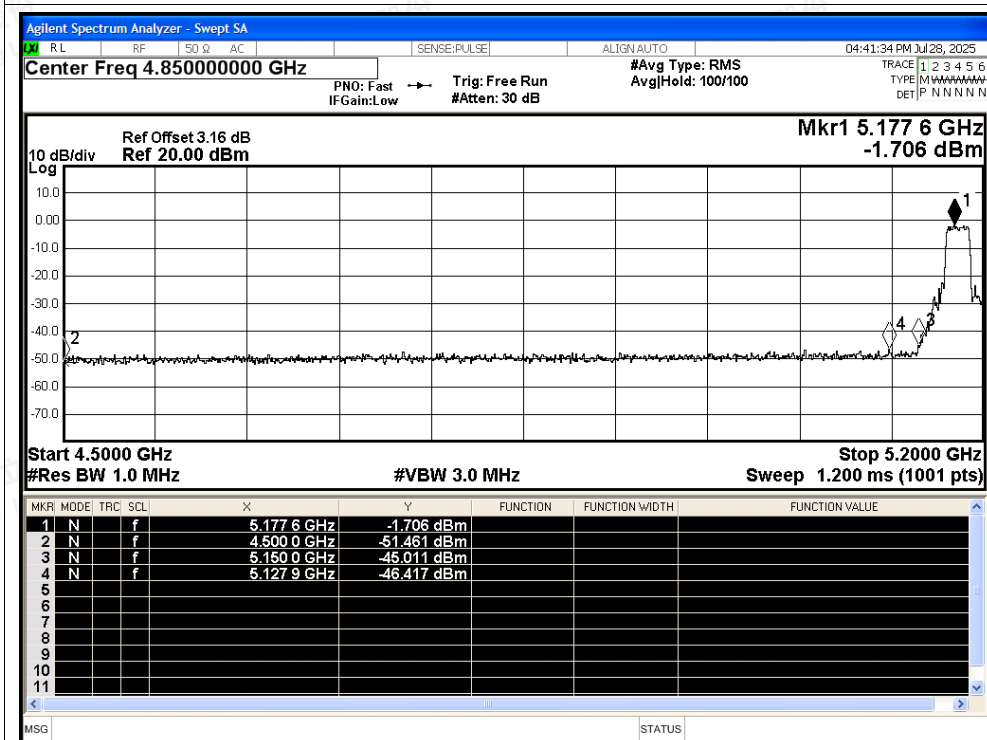

Restrict Band NVNT ax20 5180MHz Ant4 Average

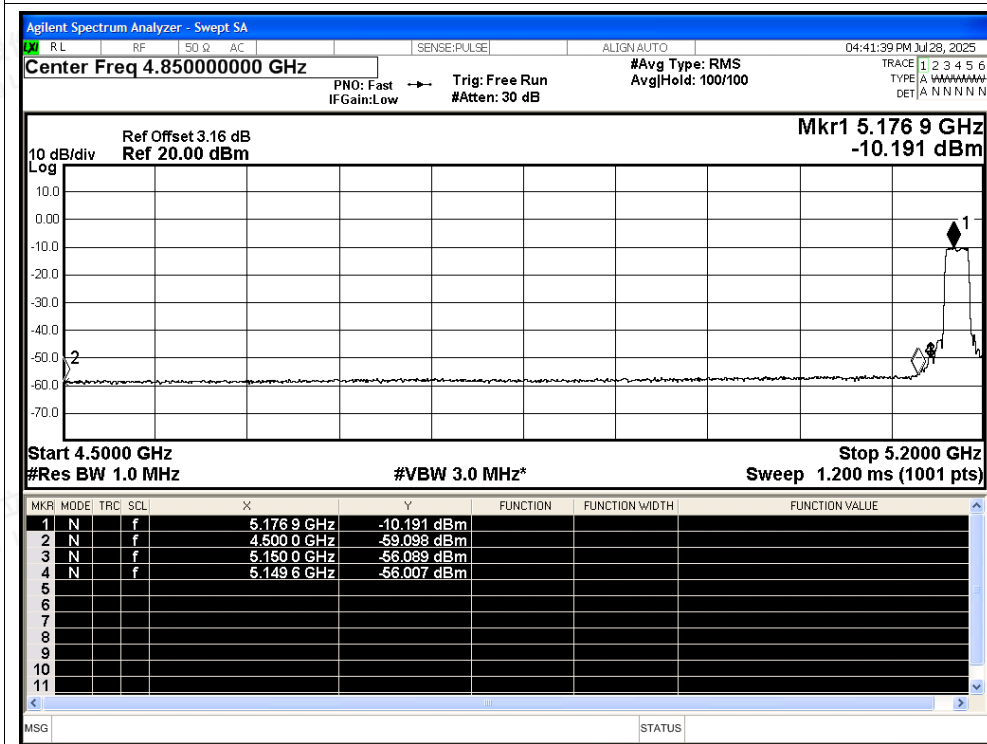

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant4 Peak

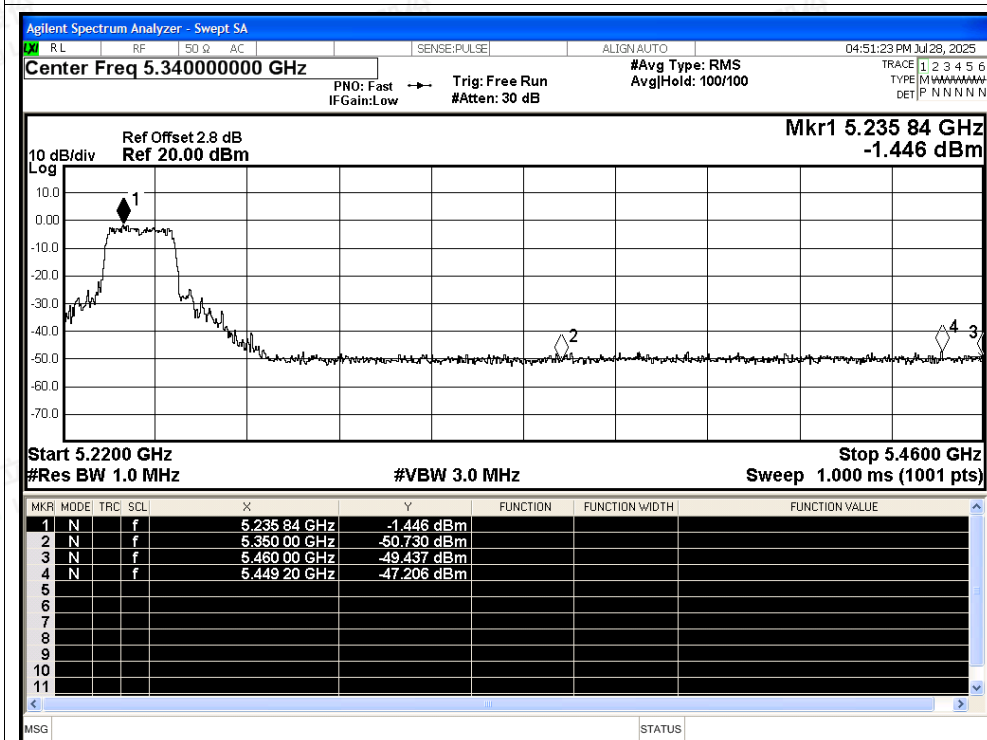

Restrict Band NVNT ax20 5240MHz Ant4 Average

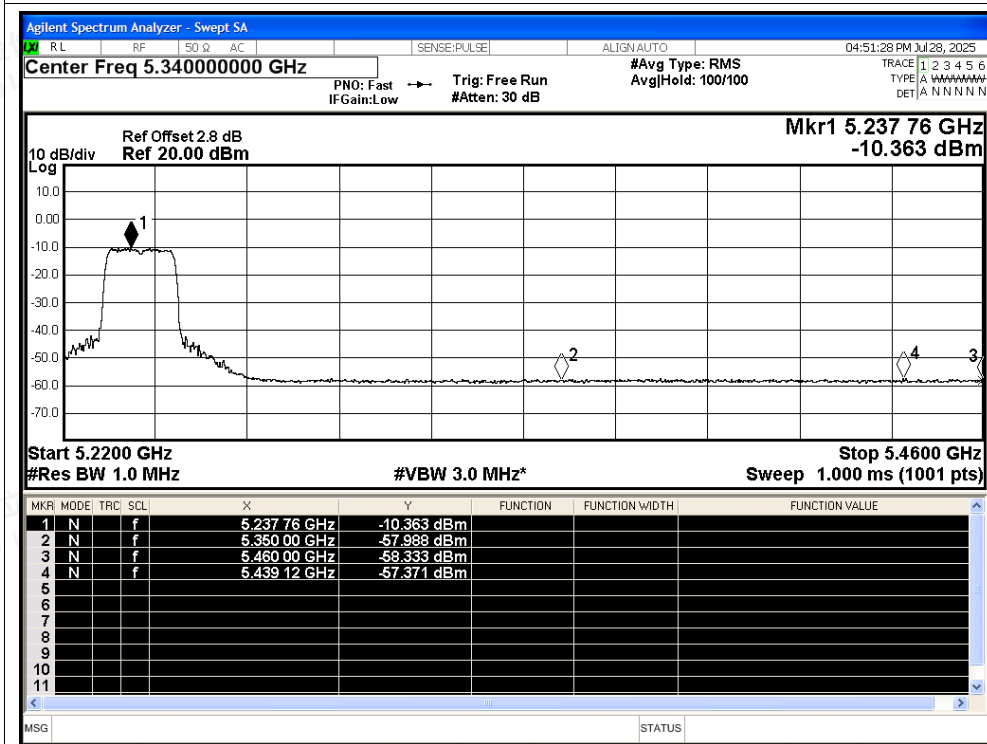

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant4 Peak

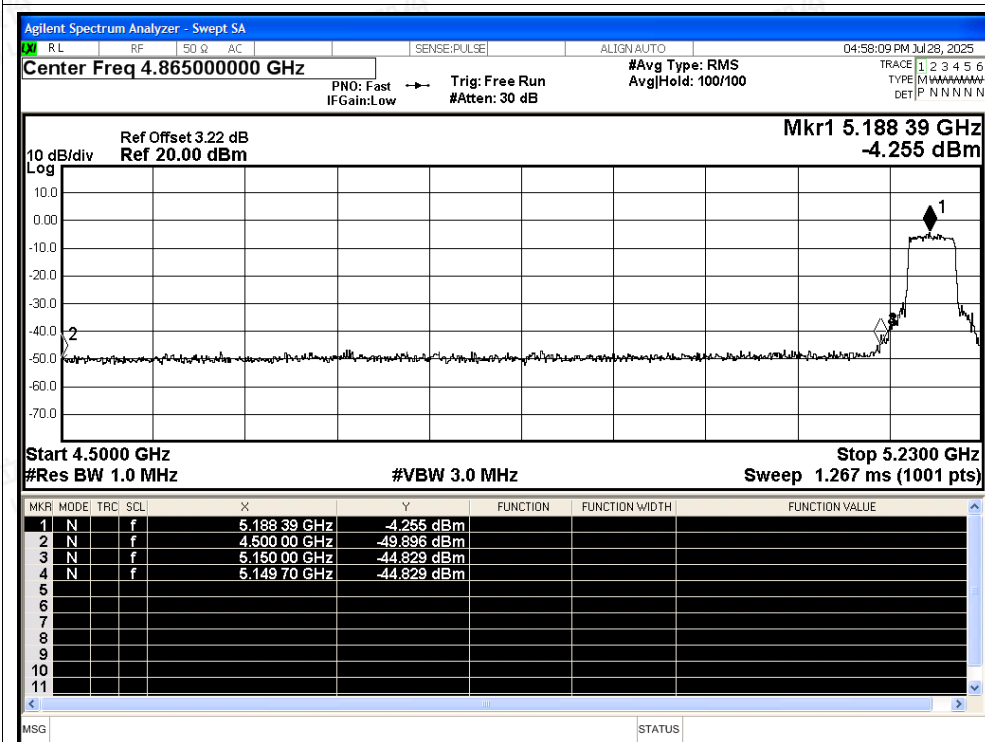

Restrict Band NVNT ax40 5190MHz Ant4 Average

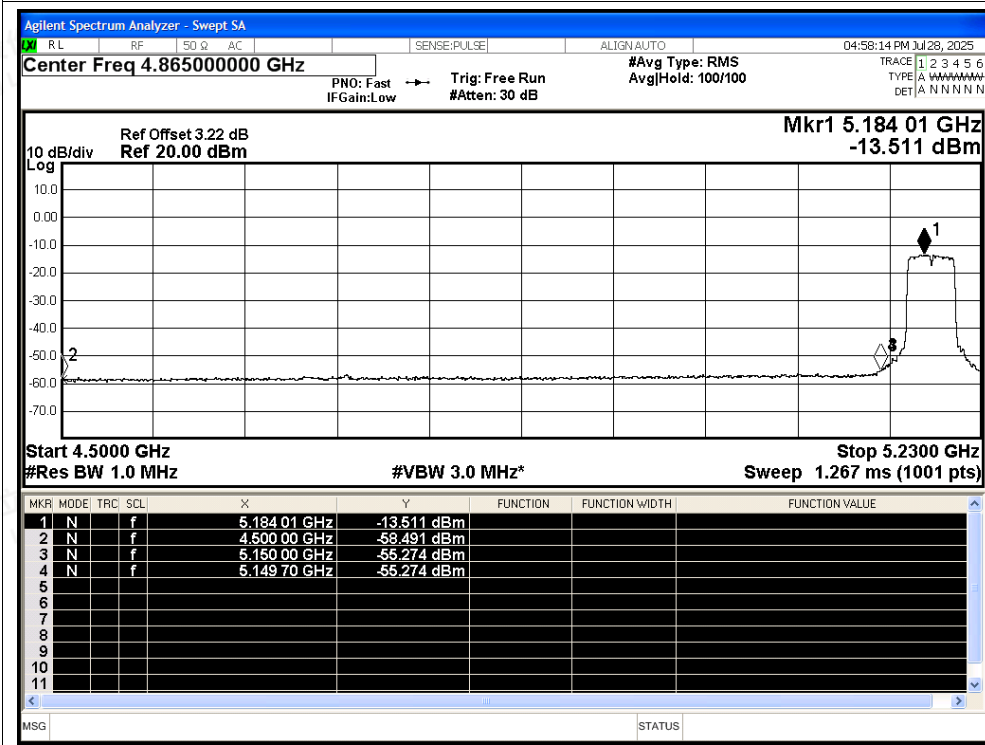

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant4 Peak

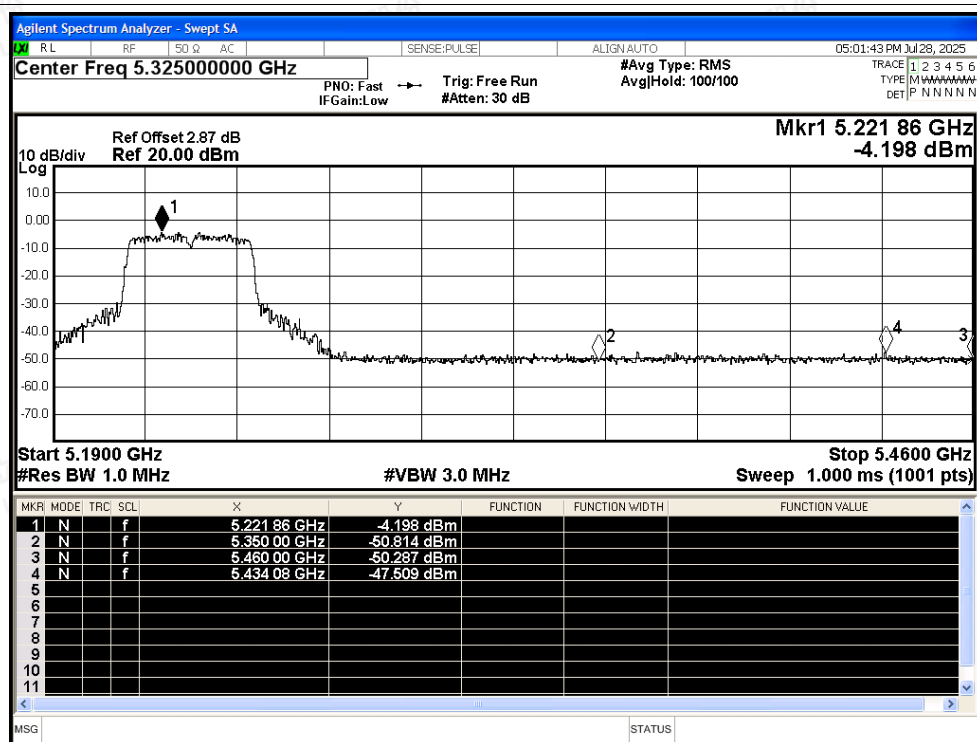

Restrict Band NVNT ax40 5230MHz Ant4 Average

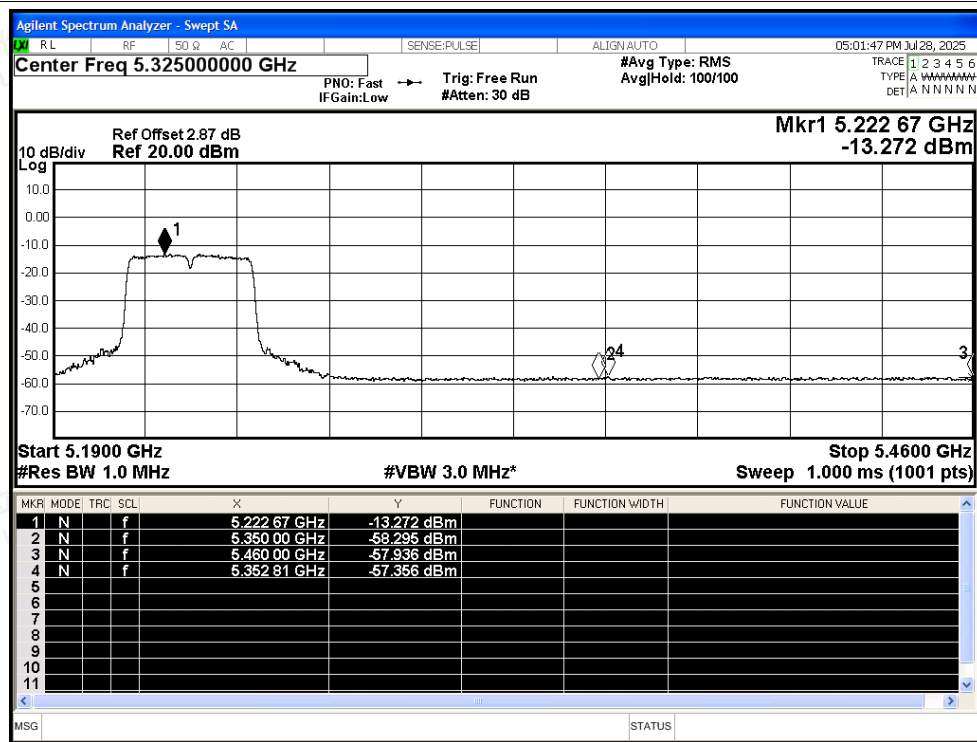

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant4 Peak

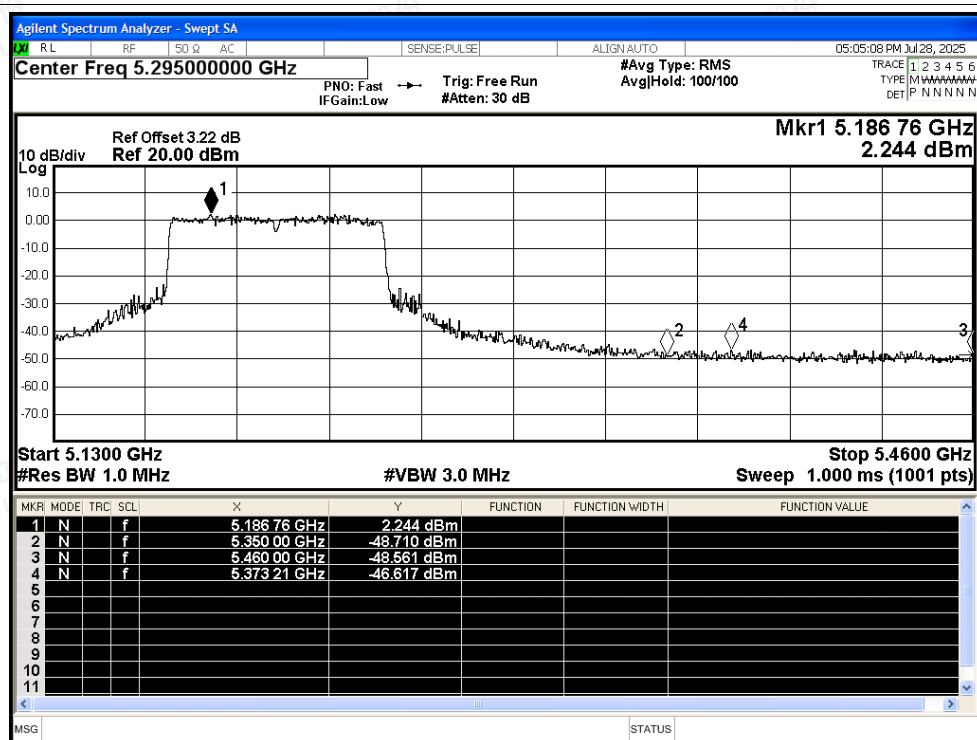

Restrict Band NVNT ax80 5210MHz Ant4 Average

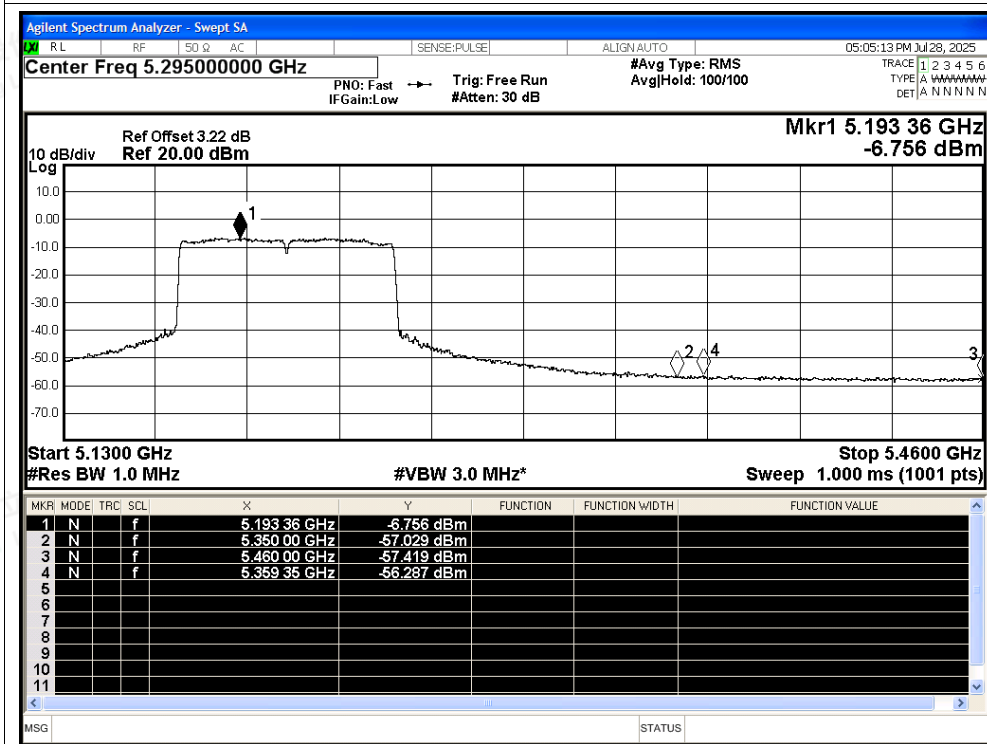

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant4 Peak

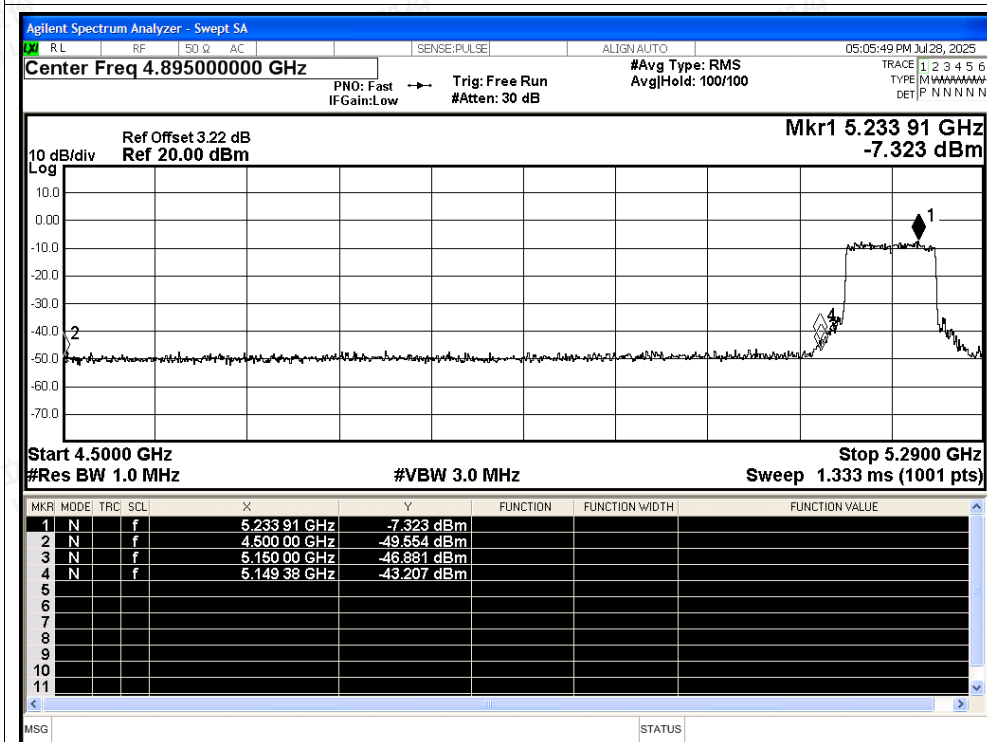

Restrict Band NVNT ax80 5210MHz Ant4 Average

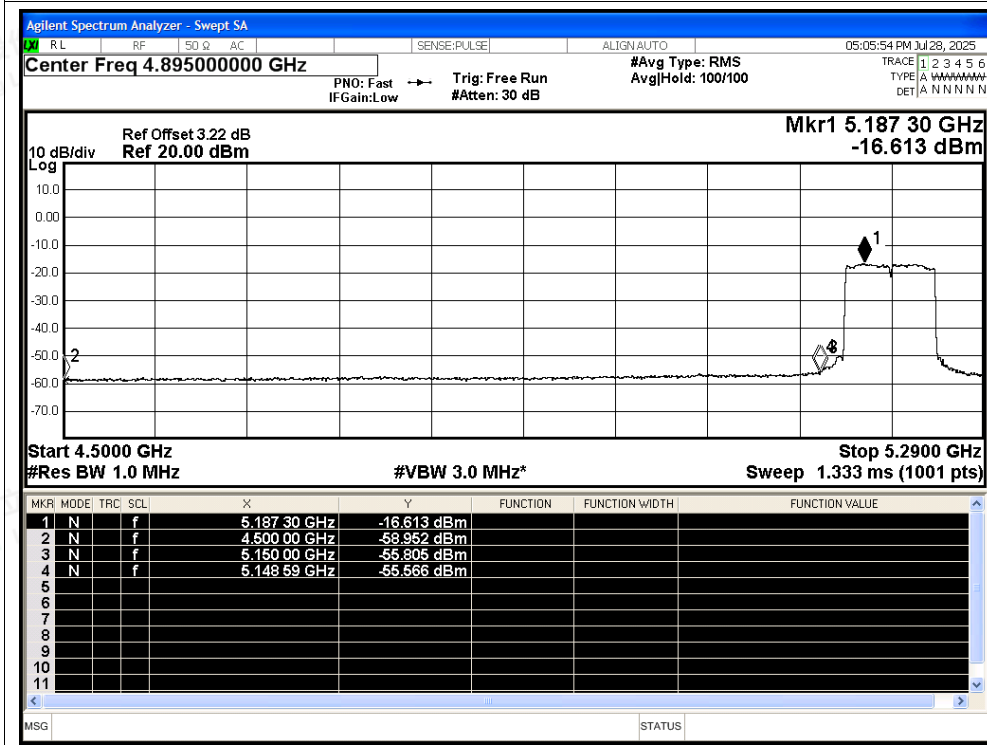

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-50.69	-51.41	8.11	55.31	Peak	68.2	PASS
NVNT	n20	5180	-58.98	-58.52	8.11	47.60	Average	54	PASS
NVNT	n20	5180	-44.23	-45.71	8.11	61.44	Peak	68.2	PASS
NVNT	n20	5180	-55.99	-55.76	8.11	50.47	Average	54	PASS
NVNT	n20	5180	-44.63	-46.94	8.11	60.71	Peak	68.2	PASS
NVNT	n20	5180	-56.03	-56.11	8.11	50.28	Average	54	PASS
NVNT	n20	5240	-51.41	-50.82	8.11	55.24	Peak	68.2	PASS
NVNT	n20	5240	-58.03	-58.05	8.11	48.31	Average	54	PASS
NVNT	n20	5240	-47.18	-46.37	8.11	59.59	Peak	68.2	PASS
NVNT	n20	5240	-57.44	-57.43	8.11	48.91	Average	54	PASS
NVNT	n20	5240	-49.32	-51.46	8.11	56.09	Peak	68.2	PASS
NVNT	n20	5240	-58.4	-58.63	8.11	47.83	Average	54	PASS
NVNT	n40	5190	-49.68	-49.47	8.11	56.77	Peak	68.2	PASS
NVNT	n40	5190	-58.96	-58.54	8.11	47.60	Average	54	PASS
NVNT	n40	5190	-43.79	-41.1	8.11	64.11	Peak	68.2	PASS
NVNT	n40	5190	-55.51	-55.53	8.11	50.83	Average	54	PASS
NVNT	n40	5190	-47.09	-45.87	8.11	59.91	Peak	68.2	PASS
NVNT	n40	5190	-55.57	-55.53	8.11	50.80	Average	54	PASS
NVNT	n40	5230	-49.45	-50.23	8.11	56.53	Peak	68.2	PASS
NVNT	n40	5230	-58.67	-58.29	8.11	47.87	Average	54	PASS
NVNT	n40	5230	-47.93	-47	8.11	58.91	Peak	68.2	PASS
NVNT	n40	5230	-57.39	-57.26	8.11	49.02	Average	54	PASS
NVNT	n40	5230	-50.54	-50.86	8.11	55.65	Peak	68.2	PASS
NVNT	n40	5230	-58.38	-58.82	8.11	47.75	Average	54	PASS
NVNT	ac20	5180	-50.43	-50.3	8.11	55.98	Peak	68.2	PASS
NVNT	ac20	5180	-58.47	-59.26	8.11	47.50	Average	54	PASS
NVNT	ac20	5180	-44.29	-43.78	8.11	62.32	Peak	68.2	PASS
NVNT	ac20	5180	-55.52	-55.78	8.11	50.70	Average	54	PASS
NVNT	ac20	5180	-47.24	-41.88	8.11	62.57	Peak	68.2	PASS
NVNT	ac20	5180	-55.72	-55.31	8.11	50.84	Average	54	PASS
NVNT	ac20	5240	-50.87	-50.69	8.11	55.57	Peak	68.2	PASS
NVNT	ac20	5240	-58.12	-58.7	8.11	47.95	Average	54	PASS
NVNT	ac20	5240	-46.79	-47.24	8.11	59.34	Peak	68.2	PASS
NVNT	ac20	5240	-57.48	-57.38	8.11	48.92	Average	54	PASS
NVNT	ac20	5240	-50.56	-50.8	8.11	55.67	Peak	68.2	PASS
NVNT	ac20	5240	-58.03	-58.18	8.11	48.24	Average	54	PASS
NVNT	ac40	5190	-49.12	-50.4	8.11	56.63	Peak	68.2	PASS
NVNT	ac40	5190	-57.86	-59.03	8.11	47.94	Average	54	PASS
NVNT	ac40	5190	-45.78	-44.89	8.11	61.04	Peak	68.2	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-55.54	-55.42	8.11	50.87	Average	54	PASS
NVNT	ac40	5190	-46.12	-47.67	8.11	59.52	Peak	68.2	PASS
NVNT	ac40	5190	-55.54	-55.42	8.11	50.87	Average	54	PASS
NVNT	ac40	5230	-49.43	-49.06	8.11	57.11	Peak	68.2	PASS
NVNT	ac40	5230	-58	-58.11	8.11	48.29	Average	54	PASS
NVNT	ac40	5230	-47.2	-47.57	8.11	58.97	Peak	68.2	PASS
NVNT	ac40	5230	-57.38	-57.37	8.11	48.97	Average	54	PASS
NVNT	ac40	5230	-50.07	-51.01	8.11	55.83	Peak	68.2	PASS
NVNT	ac40	5230	-58.29	-58.63	8.11	47.89	Average	54	PASS
NVNT	ac80	5210	-48.85	-48.27	8.11	57.80	Peak	68.2	PASS
NVNT	ac80	5210	-57.04	-56.6	8.11	49.53	Average	54	PASS
NVNT	ac80	5210	-46.9	-46.15	8.11	59.84	Peak	68.2	PASS
NVNT	ac80	5210	-56.63	-56.41	8.11	49.83	Average	54	PASS
NVNT	ac80	5210	-49.95	-50.11	8.11	56.32	Peak	68.2	PASS
NVNT	ac80	5210	-57.5	-57.97	8.11	48.62	Average	54	PASS
NVNT	ac80	5210	-50.79	-50.54	8.11	55.68	Peak	68.2	PASS
NVNT	ac80	5210	-58.69	-58.49	8.11	47.76	Average	54	PASS
NVNT	ac80	5210	-43.77	-44.42	8.11	62.27	Peak	68.2	PASS
NVNT	ac80	5210	-55.61	-55.58	8.11	50.75	Average	54	PASS
NVNT	ac80	5210	-41.24	-45.21	8.11	63.56	Peak	68.2	PASS
NVNT	ac80	5210	-55.23	-55.36	8.11	51.05	Average	54	PASS
NVNT	ax20	5180	-51.16	-51.46	8.11	55.04	Peak	68.2	PASS
NVNT	ax20	5180	-59.24	-59.1	8.11	47.18	Average	54	PASS
NVNT	ax20	5180	-42.95	-46.42	8.11	62.00	Peak	68.2	PASS
NVNT	ax20	5180	-55.86	-56.01	8.11	50.41	Average	54	PASS
NVNT	ax20	5180	-47.85	-45.01	8.11	60.15	Peak	68.2	PASS
NVNT	ax20	5180	-55.51	-56.09	8.11	50.56	Average	54	PASS
NVNT	ax20	5240	-50.91	-50.73	8.11	55.53	Peak	68.2	PASS
NVNT	ax20	5240	-58.17	-57.99	8.11	48.27	Average	54	PASS
NVNT	ax20	5240	-47.54	-47.21	8.11	58.98	Peak	68.2	PASS
NVNT	ax20	5240	-57.46	-57.37	8.11	48.93	Average	54	PASS
NVNT	ax20	5240	-49.76	-49.44	8.11	56.75	Peak	68.2	PASS
NVNT	ax20	5240	-58.39	-58.33	8.11	47.99	Average	54	PASS
NVNT	ax40	5190	-50.41	-49.9	8.11	56.20	Peak	68.2	PASS
NVNT	ax40	5190	-59.34	-58.49	8.11	47.45	Average	54	PASS
NVNT	ax40	5190	-46.15	-44.83	8.11	60.91	Peak	68.2	PASS
NVNT	ax40	5190	-55.88	-55.27	8.11	50.78	Average	54	PASS
NVNT	ax40	5190	-46.43	-44.83	8.11	60.79	Peak	68.2	PASS
NVNT	ax40	5190	-55.94	-55.27	8.11	50.76	Average	54	PASS
NVNT	ax40	5230	-49.57	-50.81	8.11	56.20	Peak	68.2	PASS
NVNT	ax40	5230	-58.14	-58.3	8.11	48.13	Average	54	PASS
NVNT	ax40	5230	-46.76	-47.51	8.11	59.23	Peak	68.2	PASS
NVNT	ax40	5230	-57.25	-57.36	8.11	49.04	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	-50.48	-50.29	8.11	55.96	Peak	68.2	PASS
NVNT	ax40	5230	-58.19	-57.94	8.11	48.28	Average	54	PASS
NVNT	ax80	5210	-50.58	-48.71	8.11	56.80	Peak	68.2	PASS
NVNT	ax80	5210	-56.83	-57.03	8.11	49.42	Average	54	PASS
NVNT	ax80	5210	-44.96	-46.62	8.11	60.64	Peak	68.2	PASS
NVNT	ax80	5210	-56.28	-56.29	8.11	50.06	Average	54	PASS
NVNT	ax80	5210	-49.84	-48.56	8.11	57.19	Peak	68.2	PASS
NVNT	ax80	5210	-57.96	-57.42	8.11	48.67	Average	54	PASS
NVNT	ax80	5210	-51.46	-49.55	8.11	55.95	Peak	68.2	PASS
NVNT	ax80	5210	-58.73	-58.95	8.11	47.51	Average	54	PASS
NVNT	ax80	5210	-43.8	-43.21	8.11	62.85	Peak	68.2	PASS
NVNT	ax80	5210	-55.58	-55.57	8.11	50.77	Average	54	PASS
NVNT	ax80	5210	-45.25	-46.88	8.11	60.36	Peak	68.2	PASS
NVNT	ax80	5210	-55.45	-55.81	8.11	50.72	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Model: E1M-L159Y

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	An1	4500	-47.3	5.1	-	53.03	Peak	68.2	Pass
NVNT	a	5180	An1	4500	-57.41	5.1	0.24	43.16	Average	54	Pass
NVNT	a	5180	An1	5131.4	-45.35	5.1	-	54.98	Peak	68.2	Pass
NVNT	a	5180	An1	5148.9	-55.25	5.1	0.24	45.32	Average	54	Pass
NVNT	a	5180	An1	5150	-47.29	5.1	-	53.04	Peak	68.2	Pass
NVNT	a	5180	An1	5150	-55.48	5.1	0.24	45.09	Average	54	Pass
NVNT	a	5240	An1	5350	-50.2	5.1	-	50.13	Peak	68.2	Pass
NVNT	a	5240	An1	5350	-56.94	5.1	0.24	43.63	Average	54	Pass
NVNT	a	5240	An1	5422.08	-46.19	5.1	-	54.14	Peak	68.2	Pass
NVNT	a	5240	An1	5402.64	-56.43	5.1	0.24	44.14	Average	54	Pass
NVNT	a	5240	An1	5460	-48.78	5.1	-	51.55	Peak	68.2	Pass
NVNT	a	5240	An1	5460	-57.39	5.1	0.24	43.18	Average	54	Pass
NVNT	n20	5180	An1	4500	-49.74	5.1	-	50.59	Peak	68.2	Pass
NVNT	n20	5180	An1	4500	-57.19	5.1	0.12	43.26	Average	54	Pass
NVNT	n20	5180	An1	5149.6	-41.67	5.1	-	58.66	Peak	68.2	Pass
NVNT	n20	5180	An1	5149.6	-54.43	5.1	0.12	46.02	Average	54	Pass
NVNT	n20	5180	An1	5150	-44.89	5.1	-	55.44	Peak	68.2	Pass
NVNT	n20	5180	An1	5150	-54.78	5.1	0.12	45.67	Average	54	Pass
NVNT	n20	5240	An1	5350	-49.37	5.1	-	50.96	Peak	68.2	Pass
NVNT	n20	5240	An1	5350	-56.69	5.1	0.12	43.76	Average	54	Pass
NVNT	n20	5240	An1	5361.12	-45.5	5.1	-	54.83	Peak	68.2	Pass
NVNT	n20	5240	An1	5445.36	-56.32	5.1	0.12	44.13	Average	54	Pass
NVNT	n20	5240	An1	5460	-49.17	5.1	-	51.16	Peak	68.2	Pass
NVNT	n20	5240	An1	5460	-57.06	5.1	0.12	43.39	Average	54	Pass
NVNT	n40	5190	An1	4500	-47.26	5.1	-	53.07	Peak	68.2	Pass
NVNT	n40	5190	An1	4500	-57.66	5.1	0.24	42.91	Average	54	Pass
NVNT	n40	5190	An1	5148.24	-41.19	5.1	-	59.14	Peak	68.2	Pass
NVNT	n40	5190	An1	5148.97	-54.54	5.1	0.24	46.03	Average	54	Pass
NVNT	n40	5190	An1	5150	-46.34	5.1	-	53.99	Peak	68.2	Pass
NVNT	n40	5190	An1	5150	-54.96	5.1	0.24	45.61	Average	54	Pass
NVNT	n40	5230	An1	5350	-50.03	5.1	-	50.30	Peak	68.2	Pass
NVNT	n40	5230	An1	5350	-57.09	5.1	0.24	43.48	Average	54	Pass
NVNT	n40	5230	An1	5365.23	-45.98	5.1	-	54.35	Peak	68.2	Pass
NVNT	n40	5230	An1	5363.34	-56.39	5.1	0.24	44.18	Average	54	Pass
NVNT	n40	5230	An1	5460	-48.03	5.1	-	52.30	Peak	68.2	Pass
NVNT	n40	5230	An1	5460	-57.16	5.1	0.24	43.41	Average	54	Pass
NVNT	ac20	5180	An1	4500	-49.22	5.1	-	51.11	Peak	68.2	Pass
NVNT	ac20	5180	An1	4500	-57.5	5.1	0.12	42.95	Average	54	Pass
NVNT	ac20	5180	An1	5149.6	-44.37	5.1	-	55.96	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	An1	5140.5	-55.27	5.1	0.12	45.18	Average	54	Pass
NVNT	ac20	5180	An1	5150	-43.89	5.1	-	56.44	Peak	68.2	Pass
NVNT	ac20	5180	An1	5150	-54.85	5.1	0.12	45.60	Average	54	Pass
NVNT	ac20	5240	An1	5350	-49.25	5.1	-	51.08	Peak	68.2	Pass
NVNT	ac20	5240	An1	5350	-56.76	5.1	0.12	43.69	Average	54	Pass
NVNT	ac20	5240	An1	5445.36	-46.05	5.1	-	54.28	Peak	68.2	Pass
NVNT	ac20	5240	An1	5379.84	-56.39	5.1	0.12	44.06	Average	54	Pass
NVNT	ac20	5240	An1	5460	-48.82	5.1	-	51.51	Peak	68.2	Pass
NVNT	ac20	5240	An1	5460	-57.04	5.1	0.12	43.41	Average	54	Pass
NVNT	ac40	5190	An1	4500	-49.06	5.1	-	51.27	Peak	68.2	Pass
NVNT	ac40	5190	An1	4500	-57.29	5.1	0.24	43.28	Average	54	Pass
NVNT	ac40	5190	An1	5148.24	-43.81	5.1	-	56.52	Peak	68.2	Pass
NVNT	ac40	5190	An1	5148.24	-54.29	5.1	0.24	46.28	Average	54	Pass
NVNT	ac40	5190	An1	5150	-45.77	5.1	-	54.56	Peak	68.2	Pass
NVNT	ac40	5190	An1	5150	-55.17	5.1	0.24	45.40	Average	54	Pass
NVNT	ac40	5230	An1	5350	-49.04	5.1	-	51.29	Peak	68.2	Pass
NVNT	ac40	5230	An1	5350	-57.1	5.1	0.24	43.47	Average	54	Pass
NVNT	ac40	5230	An1	5457.84	-46.36	5.1	-	53.97	Peak	68.2	Pass
NVNT	ac40	5230	An1	5353.89	-56.33	5.1	0.24	44.24	Average	54	Pass
NVNT	ac40	5230	An1	5460	-48.56	5.1	-	51.77	Peak	68.2	Pass
NVNT	ac40	5230	An1	5460	-56.92	5.1	0.24	43.65	Average	54	Pass
NVNT	ac80	5210	An1	5350	-49.13	5.1	-	51.20	Peak	68.2	Pass
NVNT	ac80	5210	An1	5350	-56.07	5.1	0.47	44.73	Average	54	Pass
NVNT	ac80	5210	An1	5370.9	-45.12	5.1	-	55.21	Peak	68.2	Pass
NVNT	ac80	5210	An1	5359.02	-55.41	5.1	0.47	45.39	Average	54	Pass
NVNT	ac80	5210	An1	5460	-49.13	5.1	-	51.20	Peak	68.2	Pass
NVNT	ac80	5210	An1	5460	-56.77	5.1	0.47	44.03	Average	54	Pass
NVNT	ac80	5210	An1	4500	-48.47	5.1	-	51.86	Peak	68.2	Pass
NVNT	ac80	5210	An1	4500	-57.75	5.1	0.47	43.05	Average	54	Pass
NVNT	ac80	5210	An1	5146.22	-43.15	5.1	-	57.18	Peak	68.2	Pass
NVNT	ac80	5210	An1	5147.8	-54.35	5.1	0.47	46.45	Average	54	Pass
NVNT	ac80	5210	An1	5150	-47.1	5.1	-	53.23	Peak	68.2	Pass
NVNT	ac80	5210	An1	5150	-54.56	5.1	0.47	46.24	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz An1 Peak

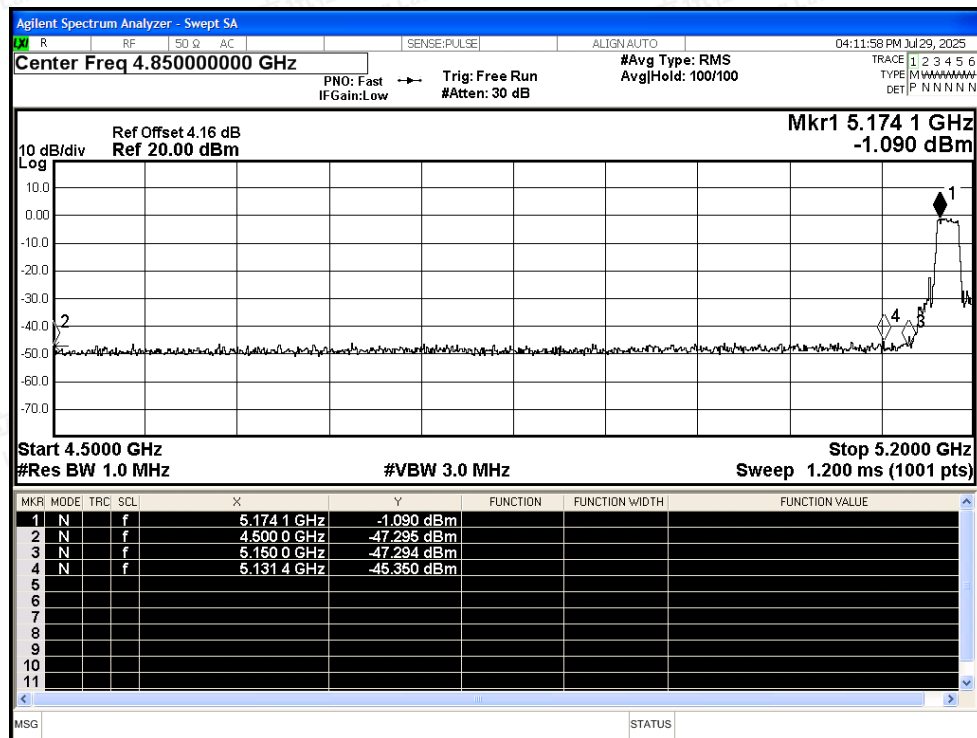

Restrict Band NVNT a 5180MHz An1 Average

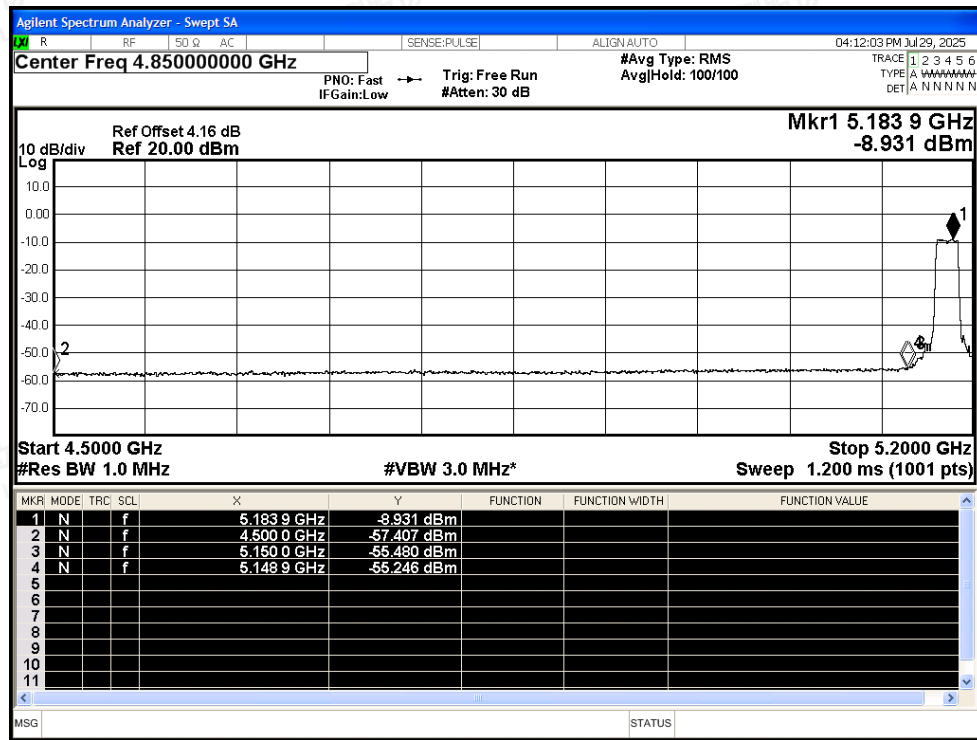

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz An1 Peak

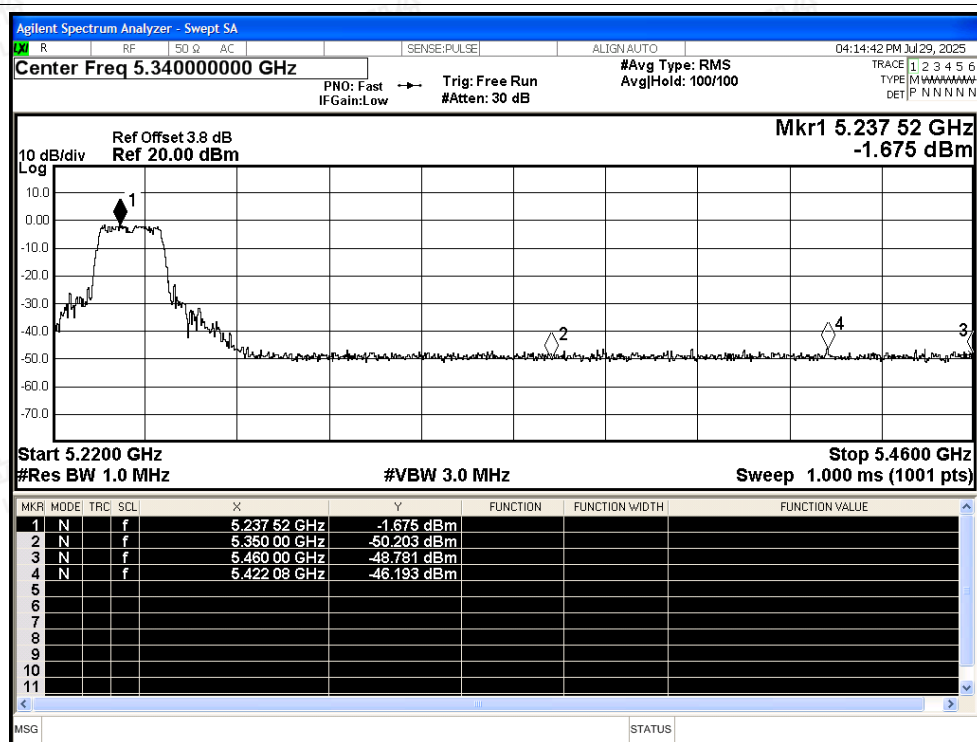

Restrict Band NVNT a 5240MHz An1 Average

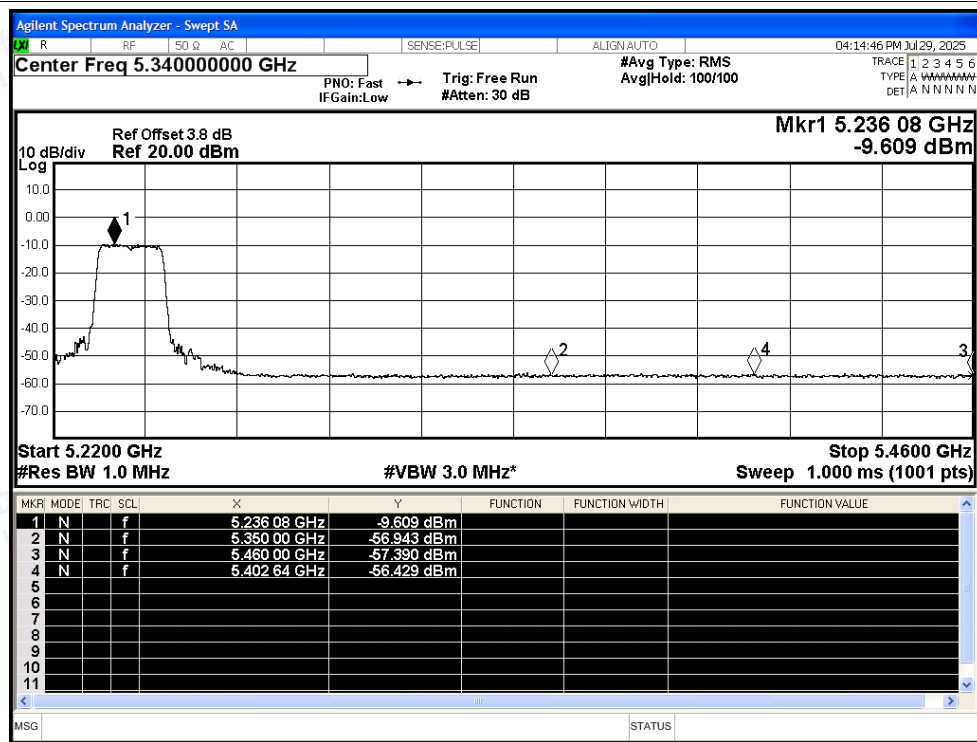

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz An1 Peak

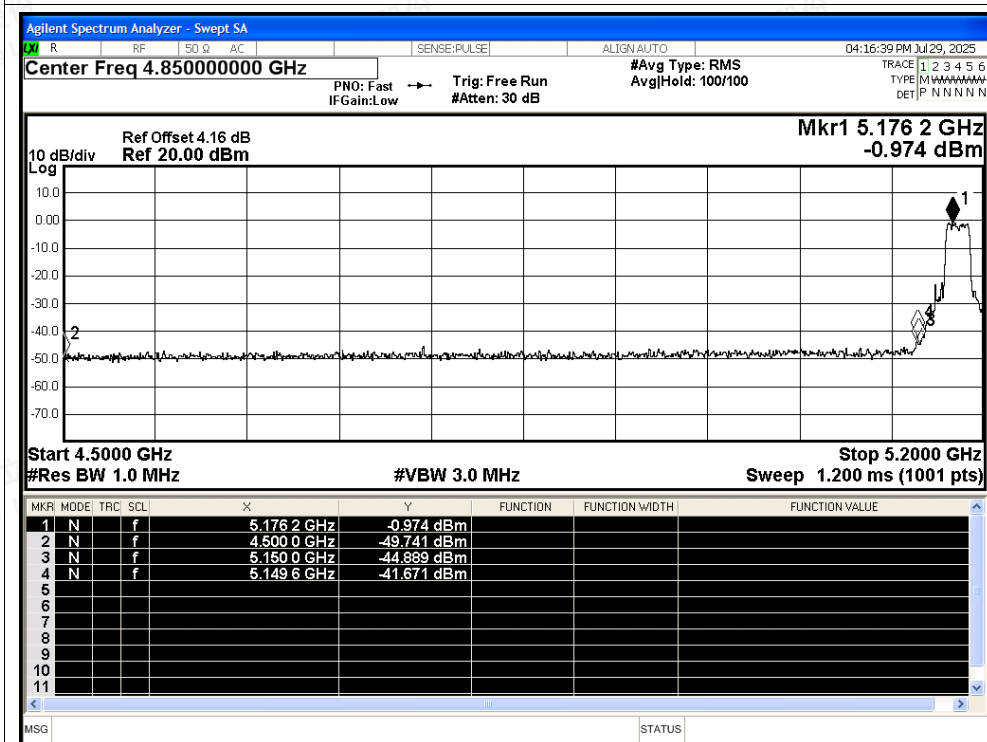

Restrict Band NVNT n20 5180MHz An1 Average

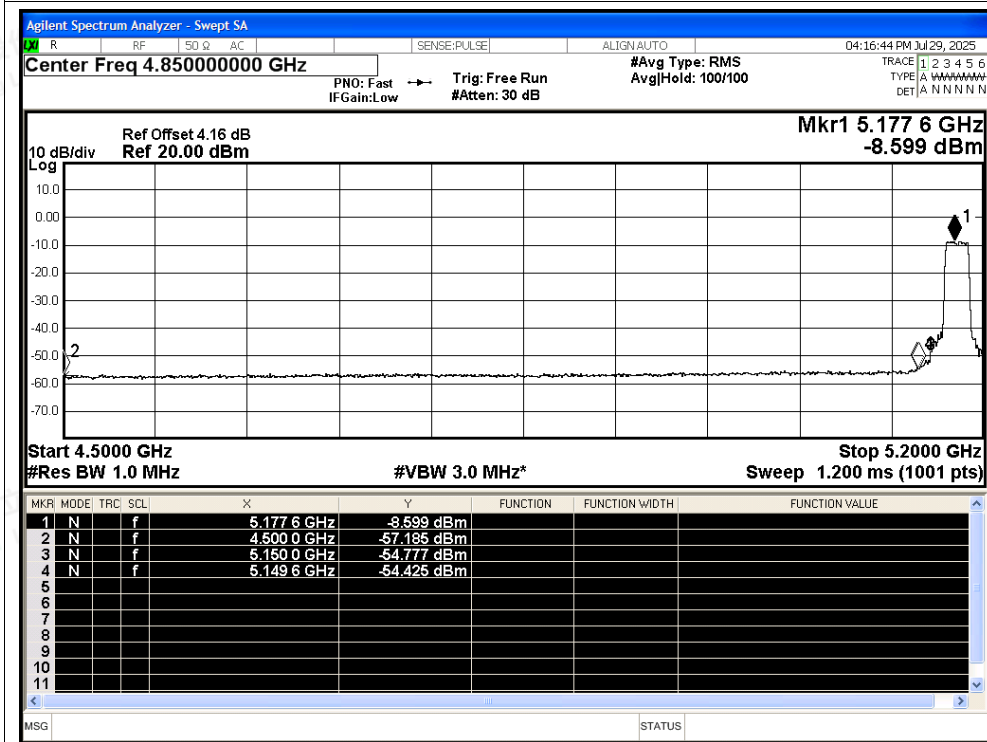

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz An1 Peak

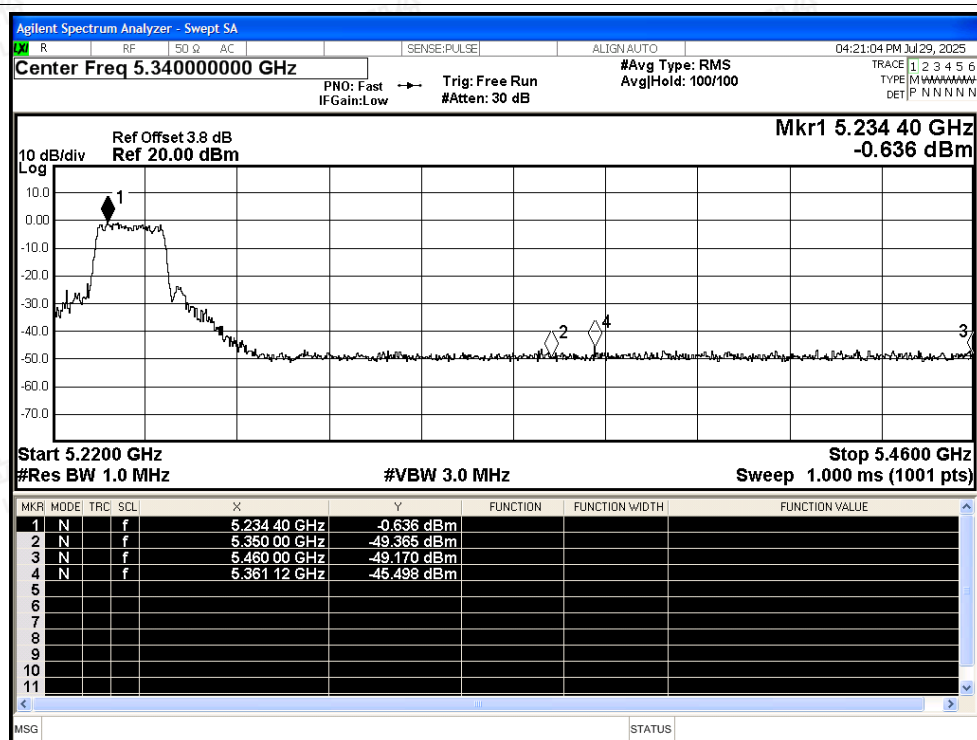

Restrict Band NVNT n20 5240MHz An1 Average

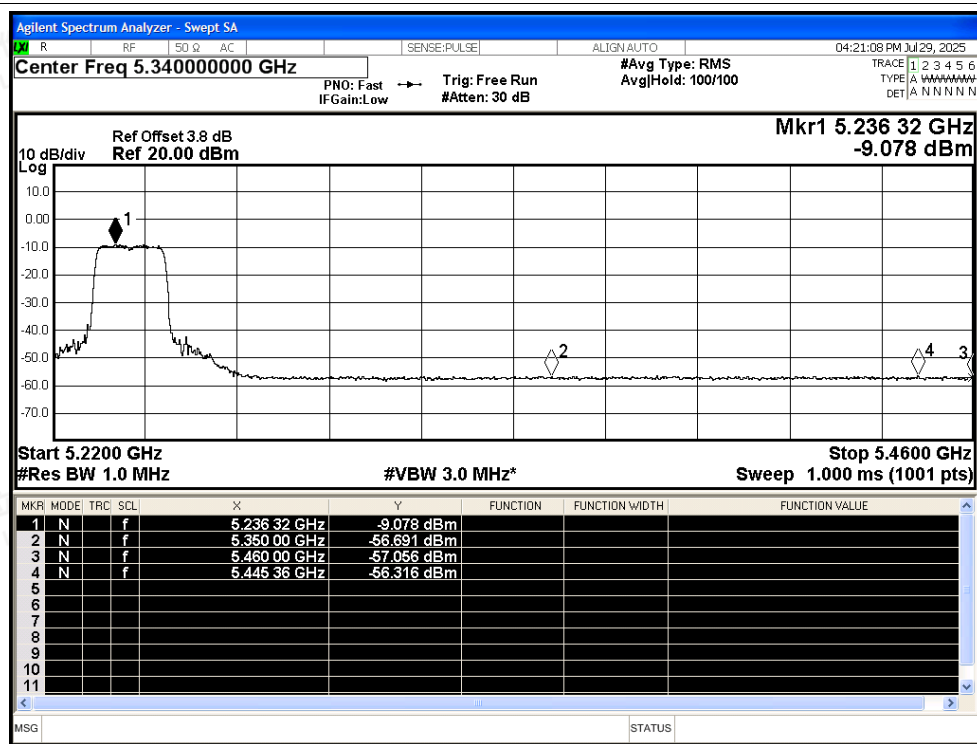

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz An1 Peak

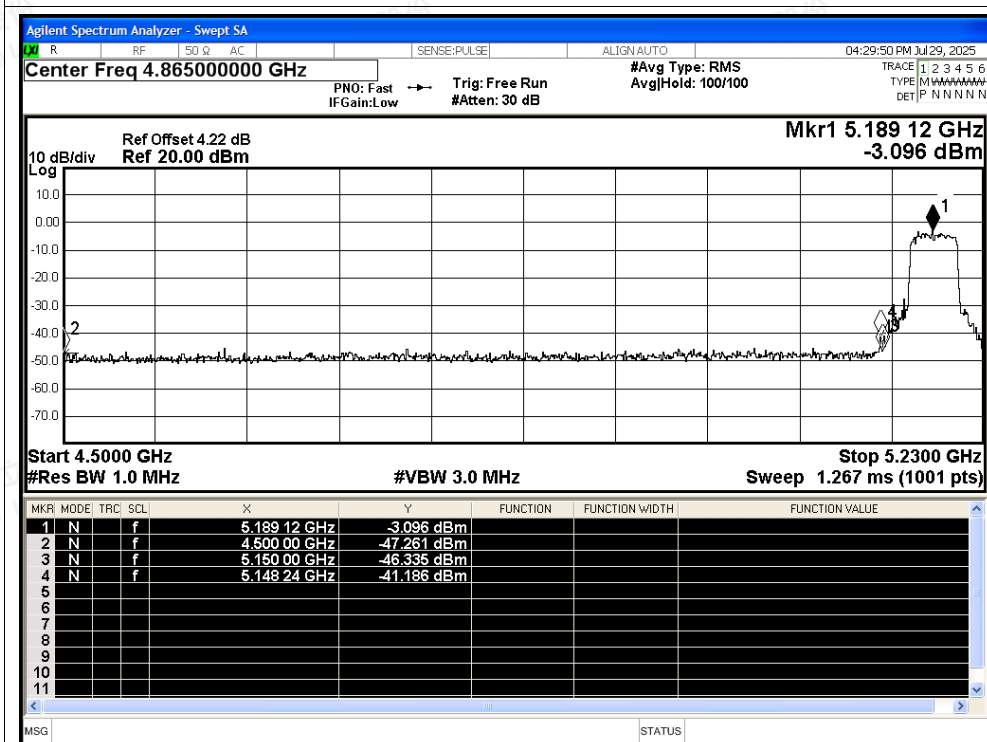

Restrict Band NVNT n40 5190MHz An1 Average

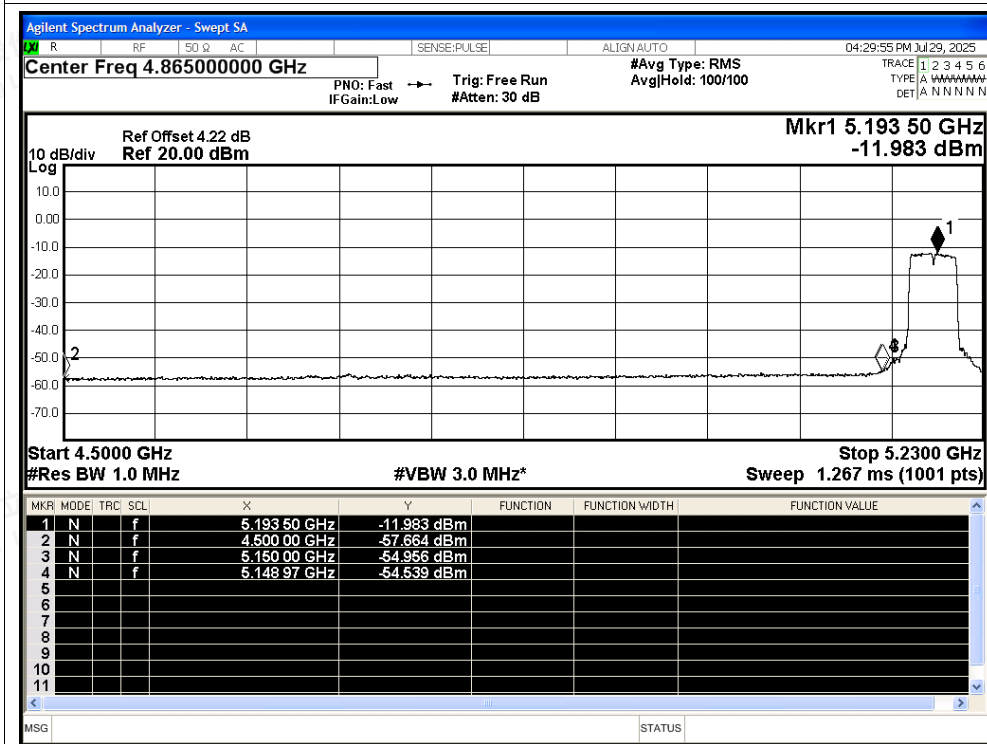

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz An1 Peak

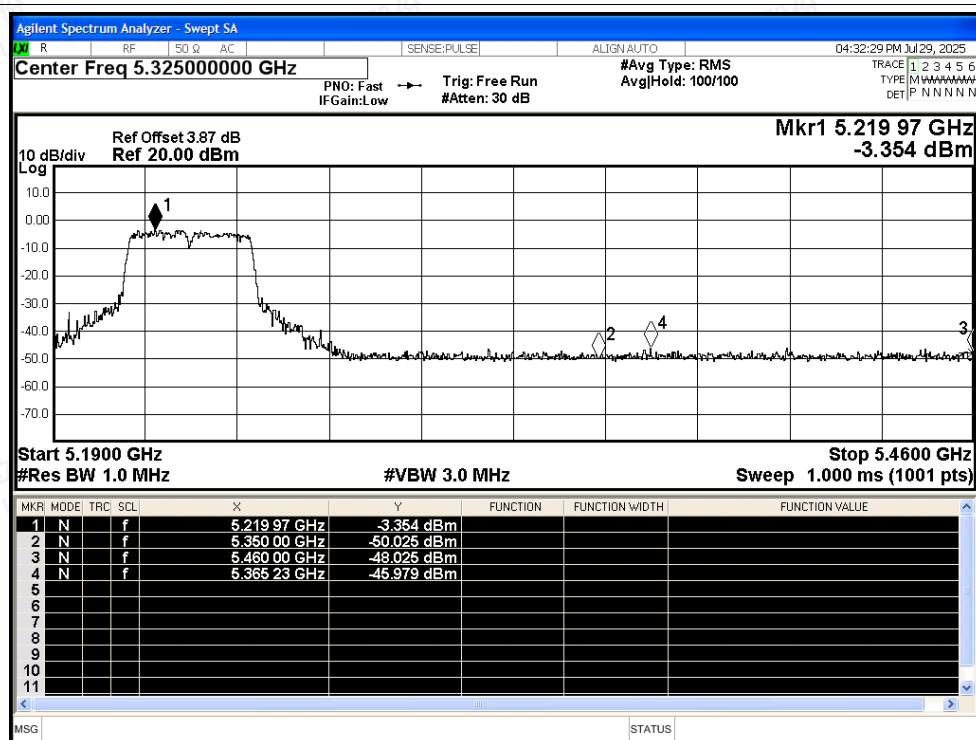

Restrict Band NVNT n40 5230MHz An1 Average

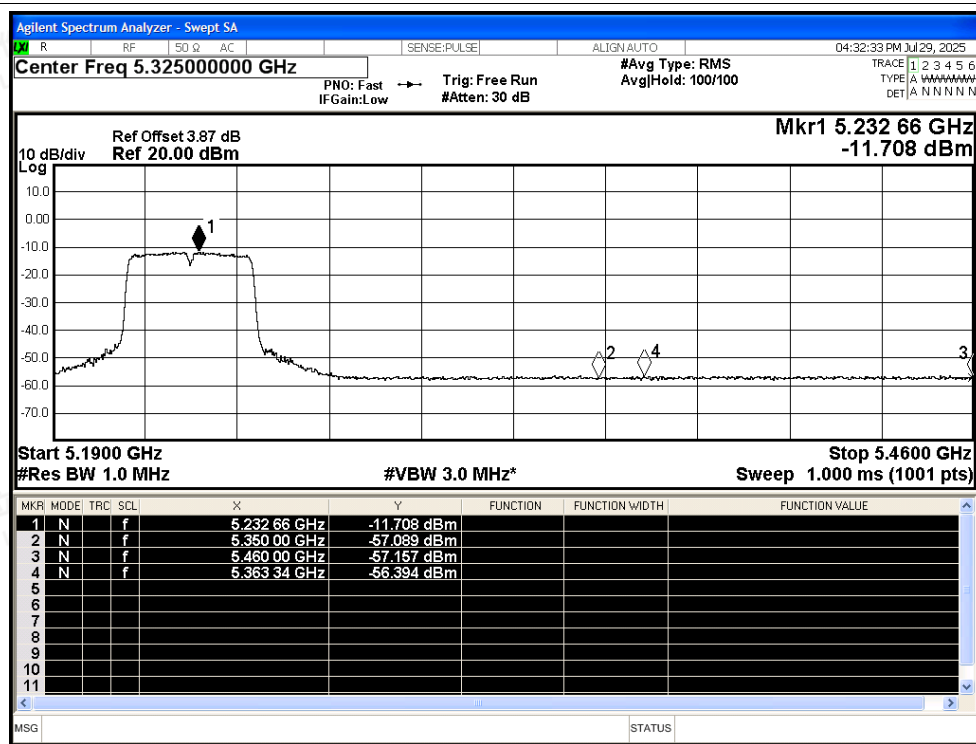

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz An1 Peak

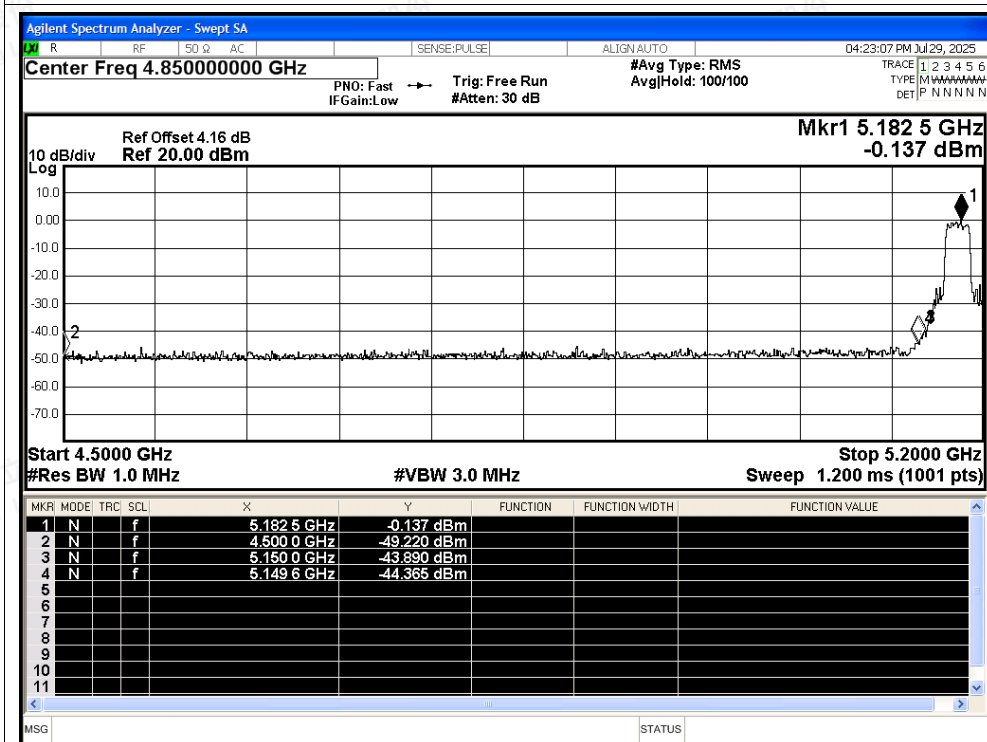

Restrict Band NVNT ac20 5180MHz An1 Average

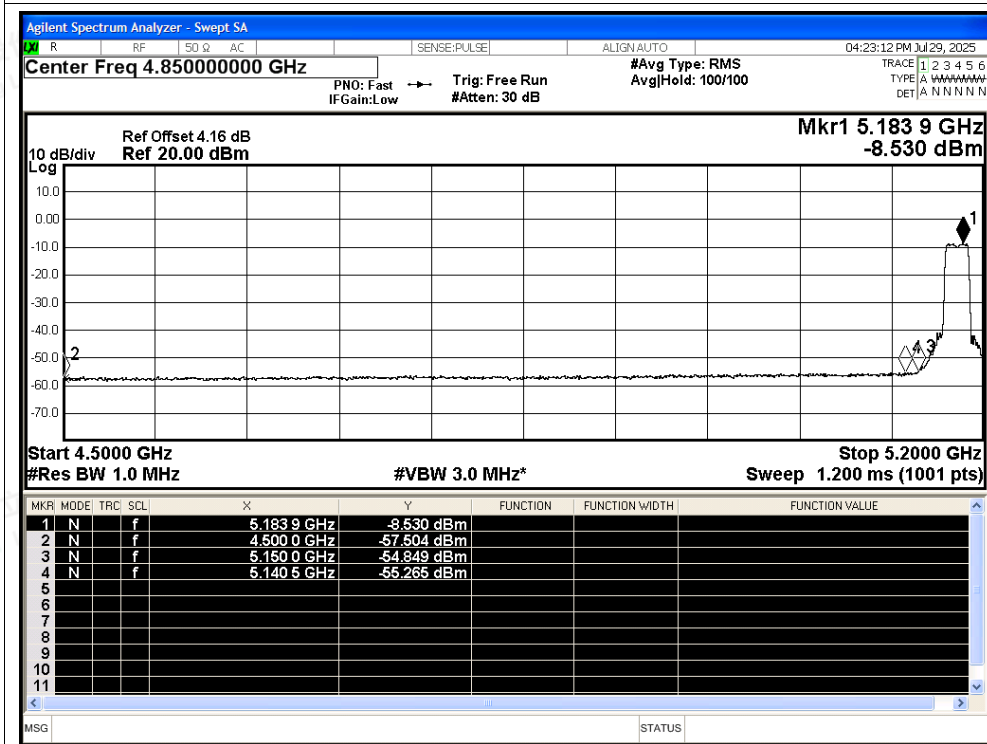

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz An1 Peak

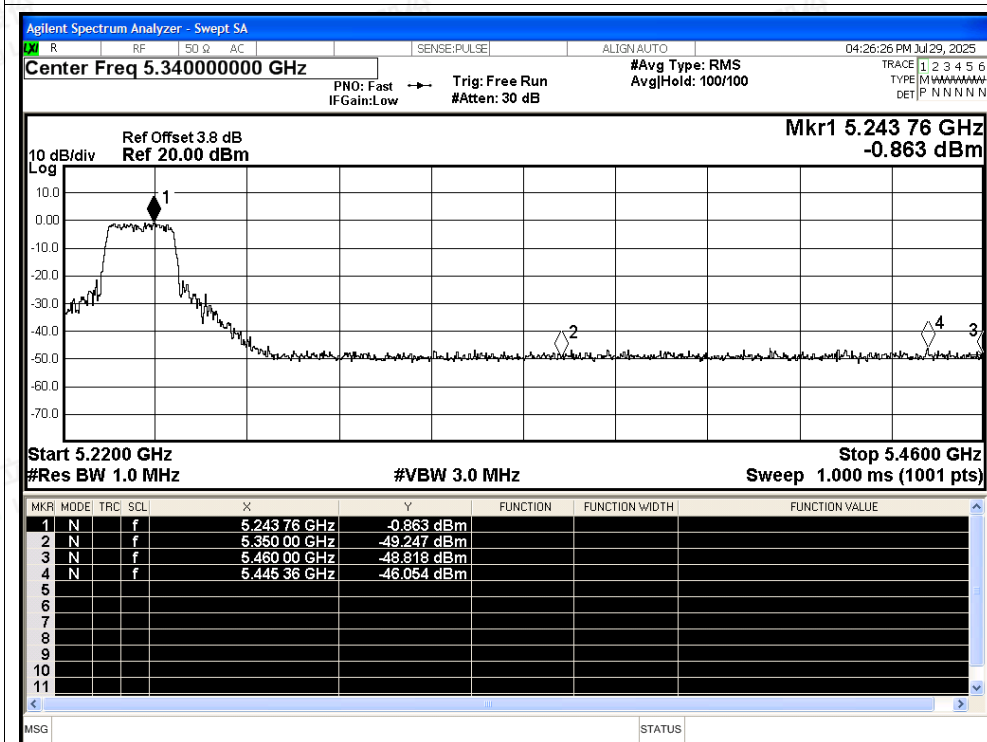

Restrict Band NVNT ac20 5240MHz An1 Average

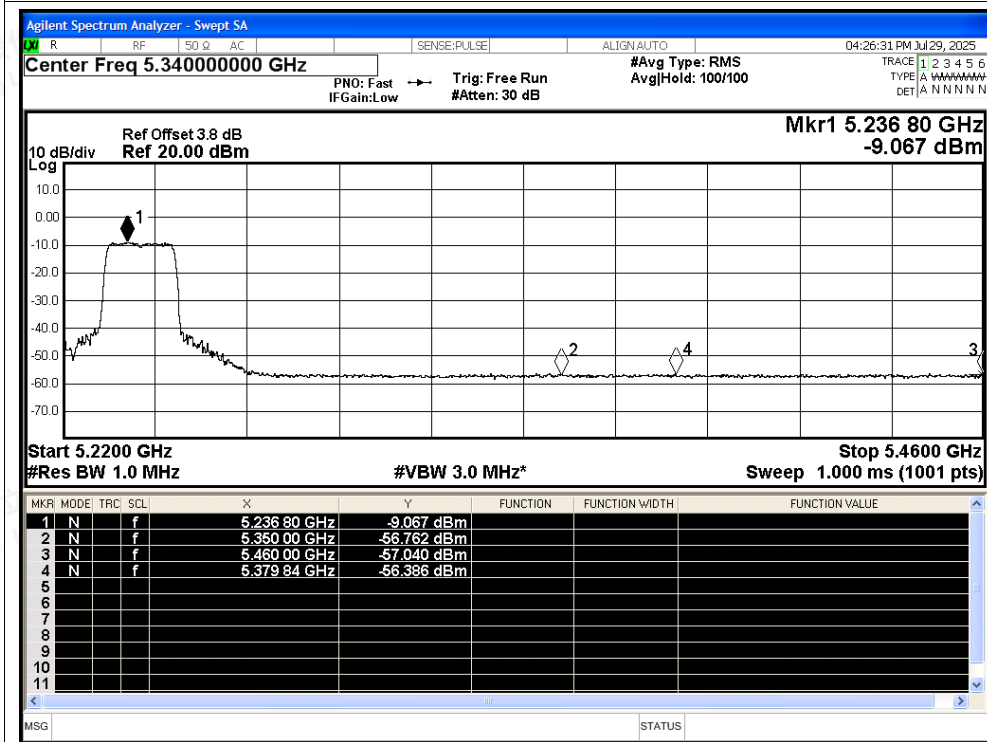

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz An1 Peak

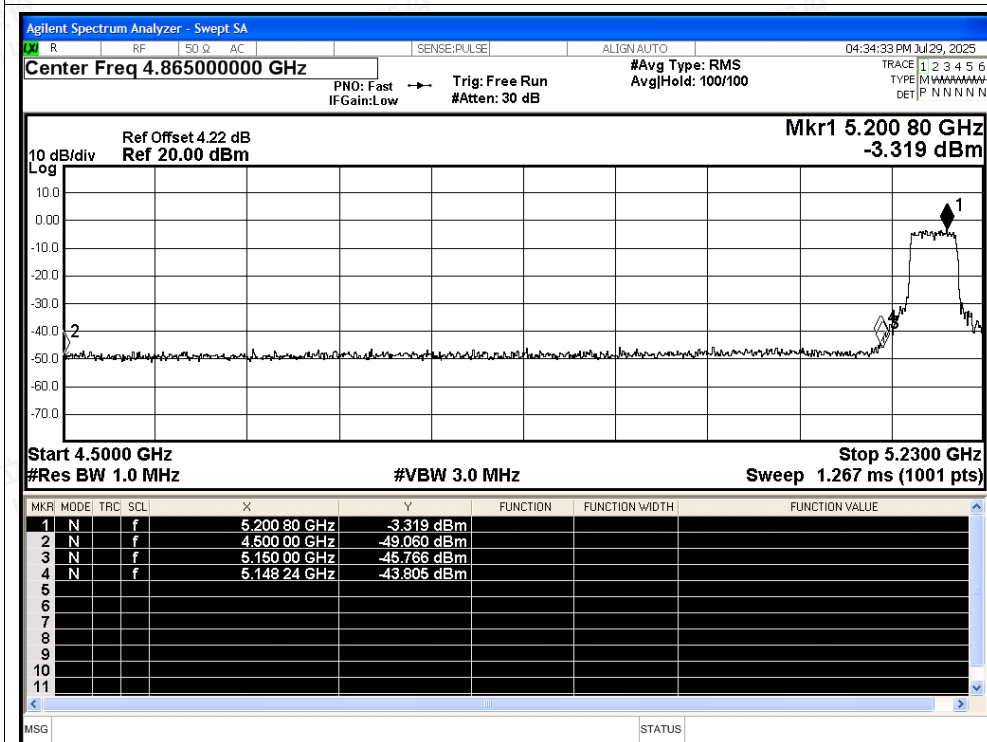

Restrict Band NVNT ac40 5190MHz An1 Average

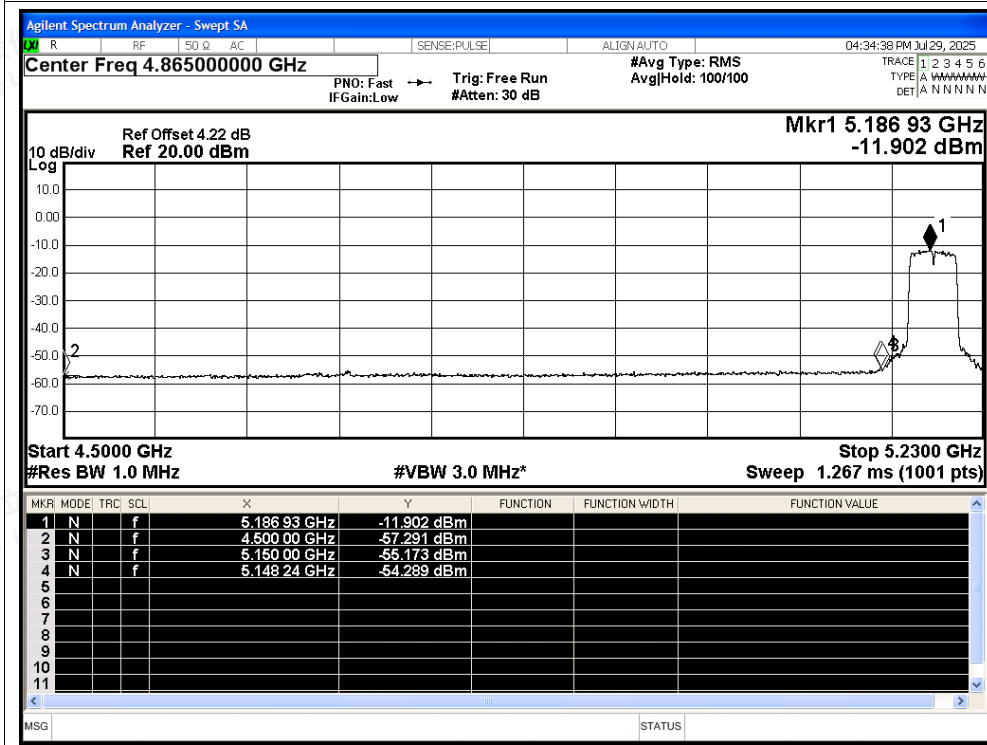

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz An1 Peak

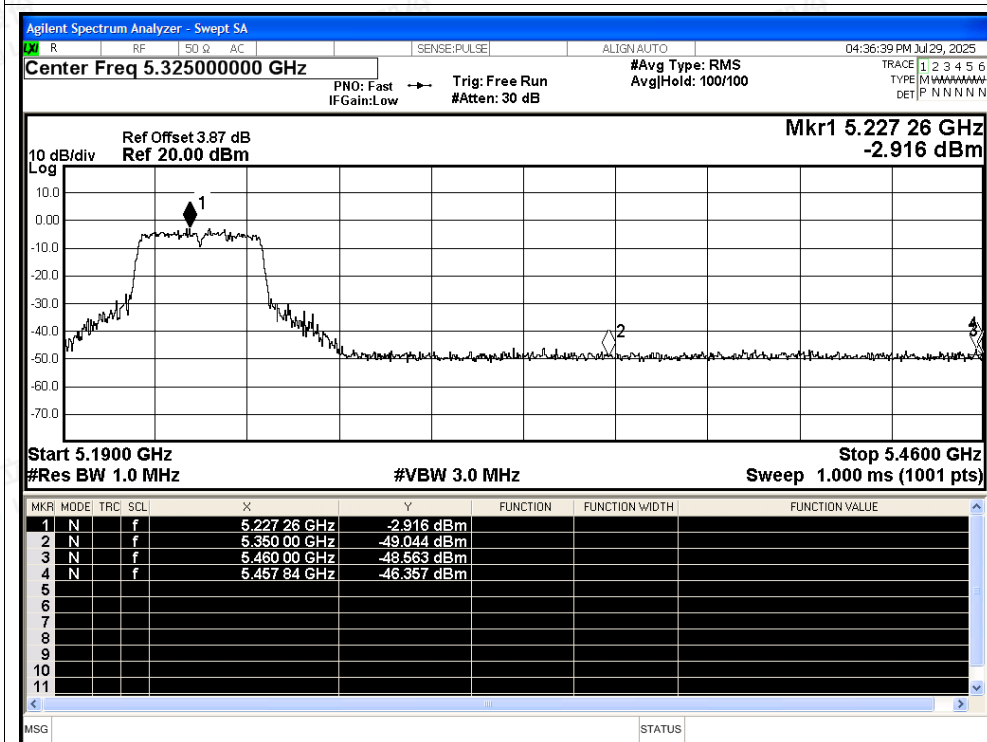

Restrict Band NVNT ac40 5230MHz An1 Average

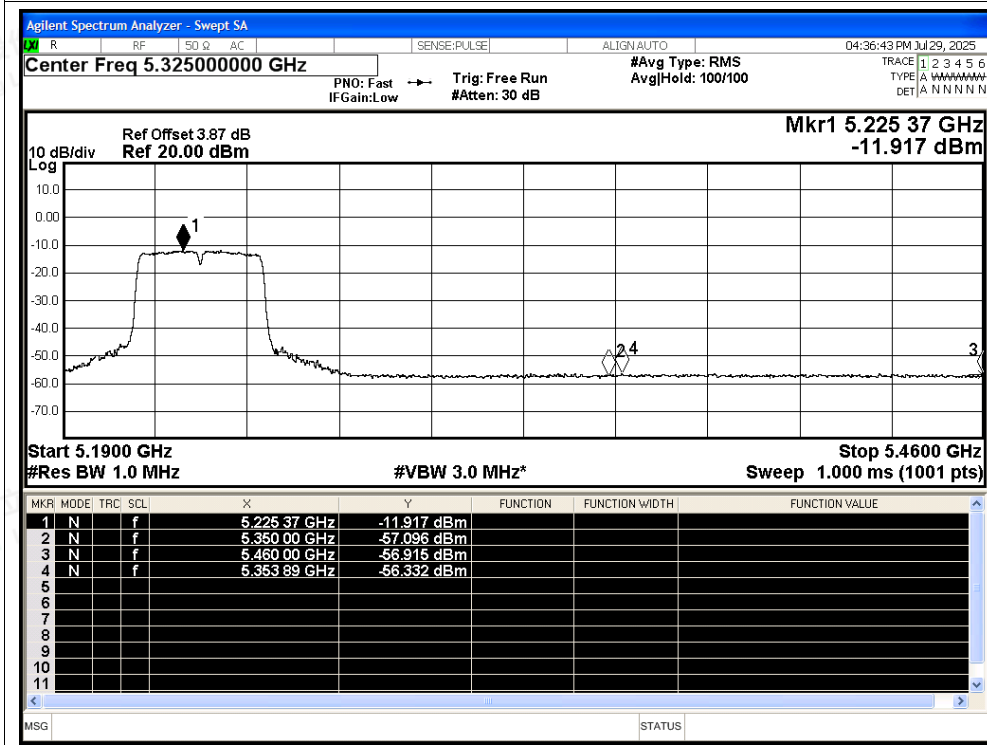

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity