





Restrict Band NVNT ax20 5700MHz Ant4 Peak

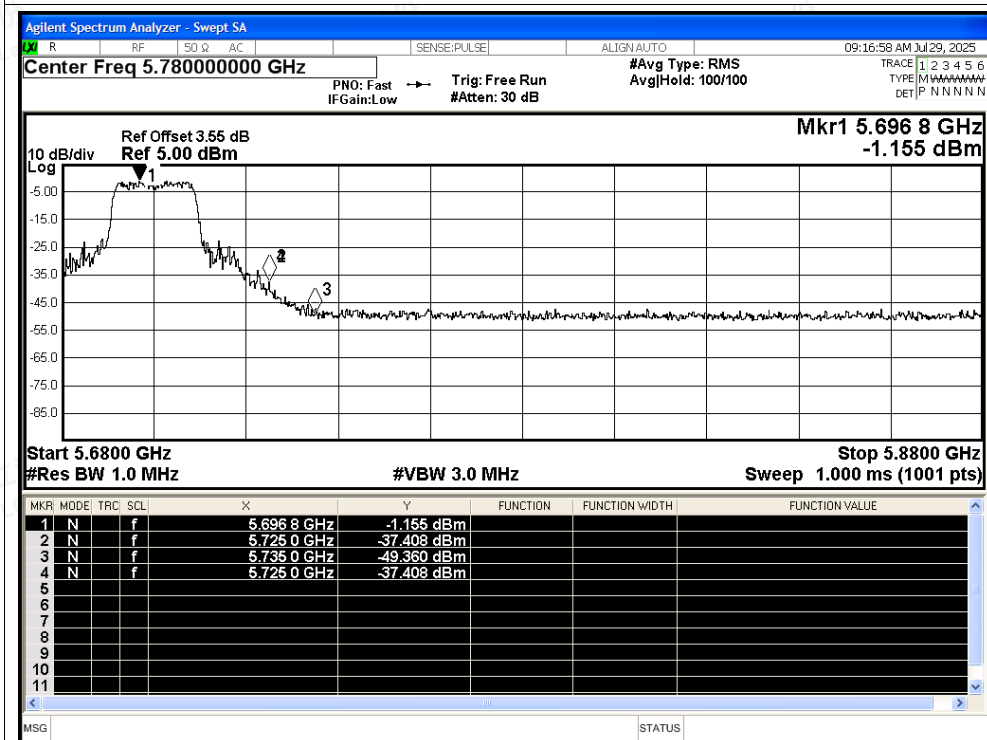

Restrict Band NVNT ax20 5700MHz Ant4 Average

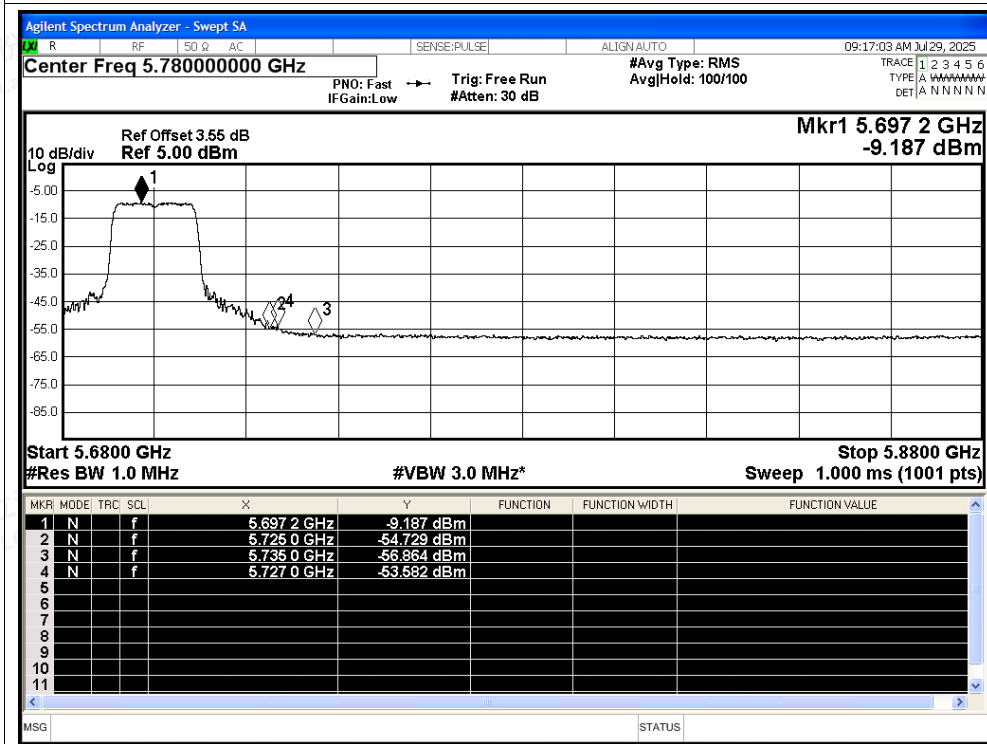

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant4 Peak

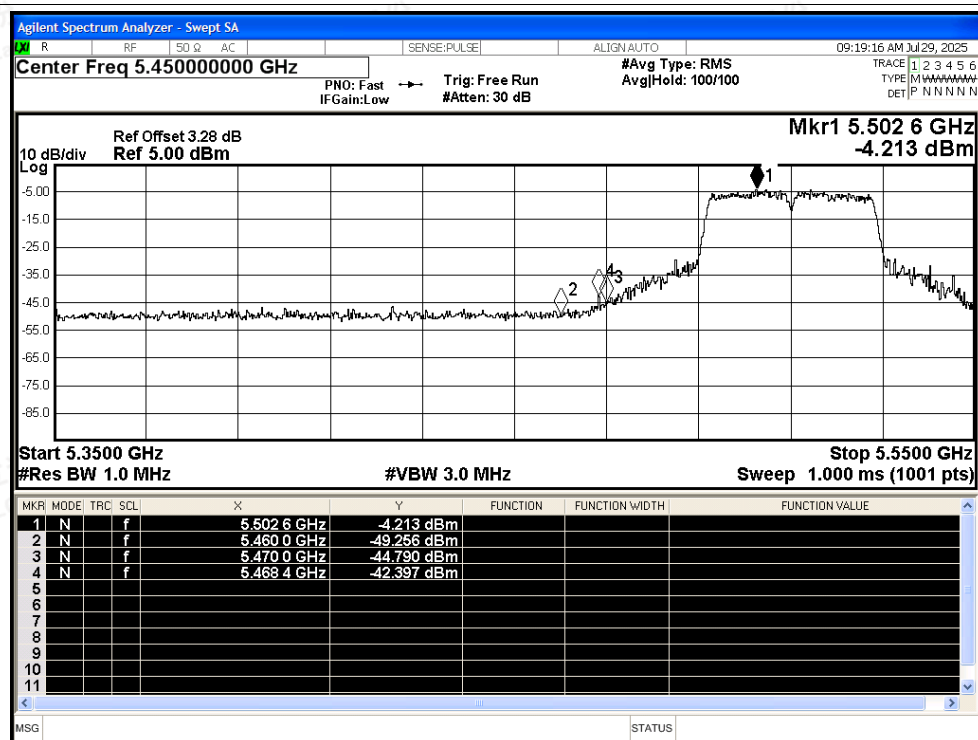

Restrict Band NVNT ax40 5510MHz Ant4 Average

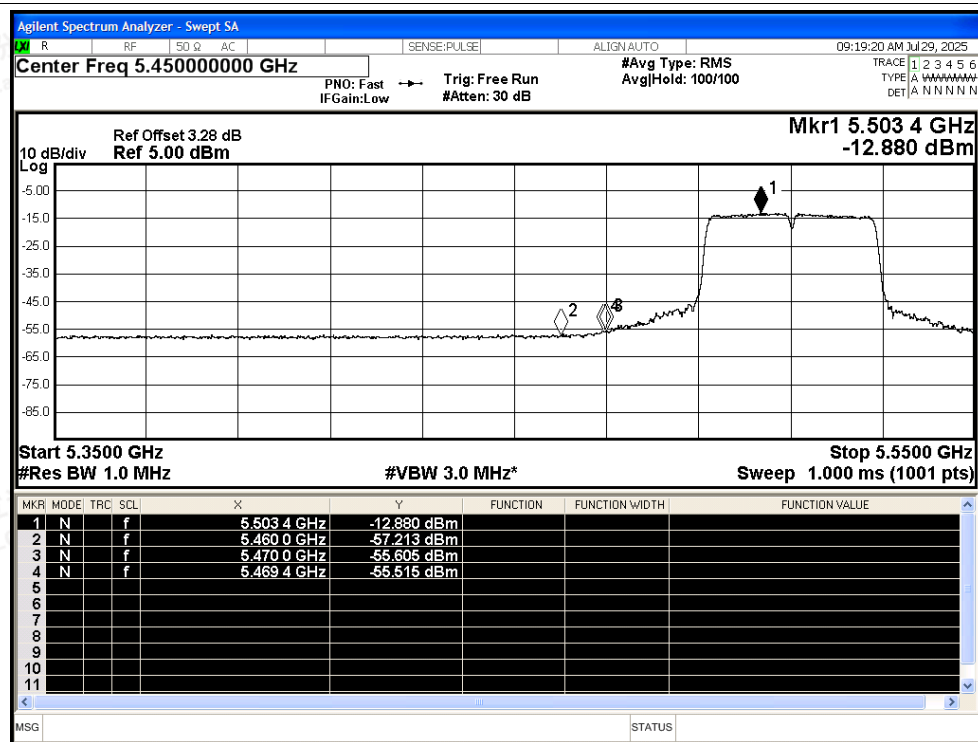

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant4 Peak

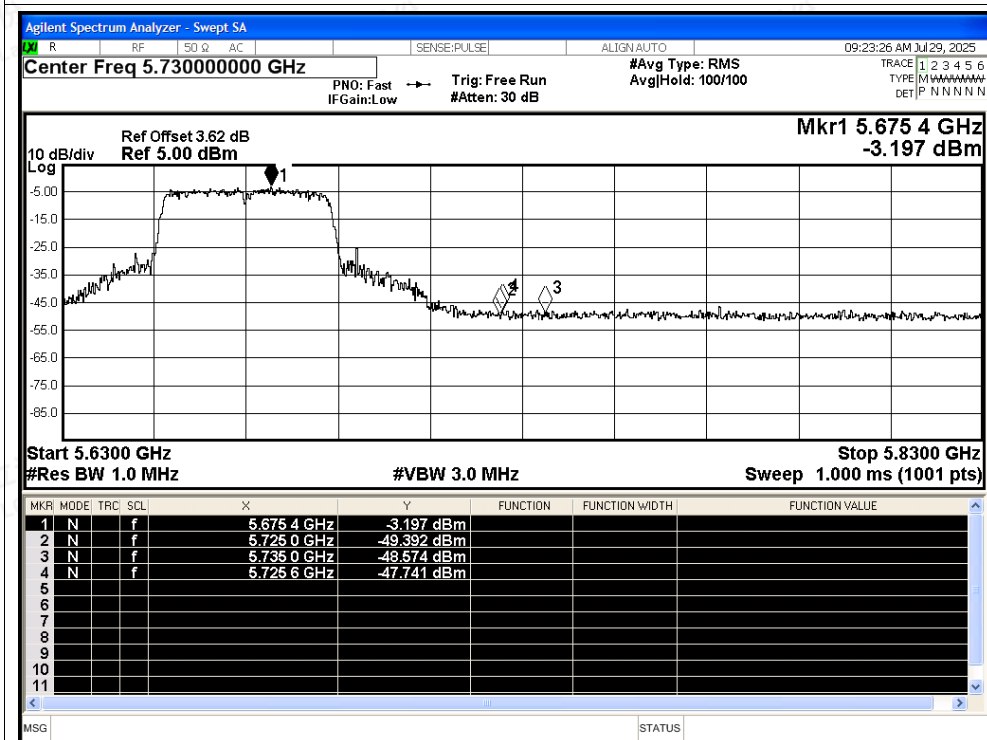

Restrict Band NVNT ax40 5670MHz Ant4 Average

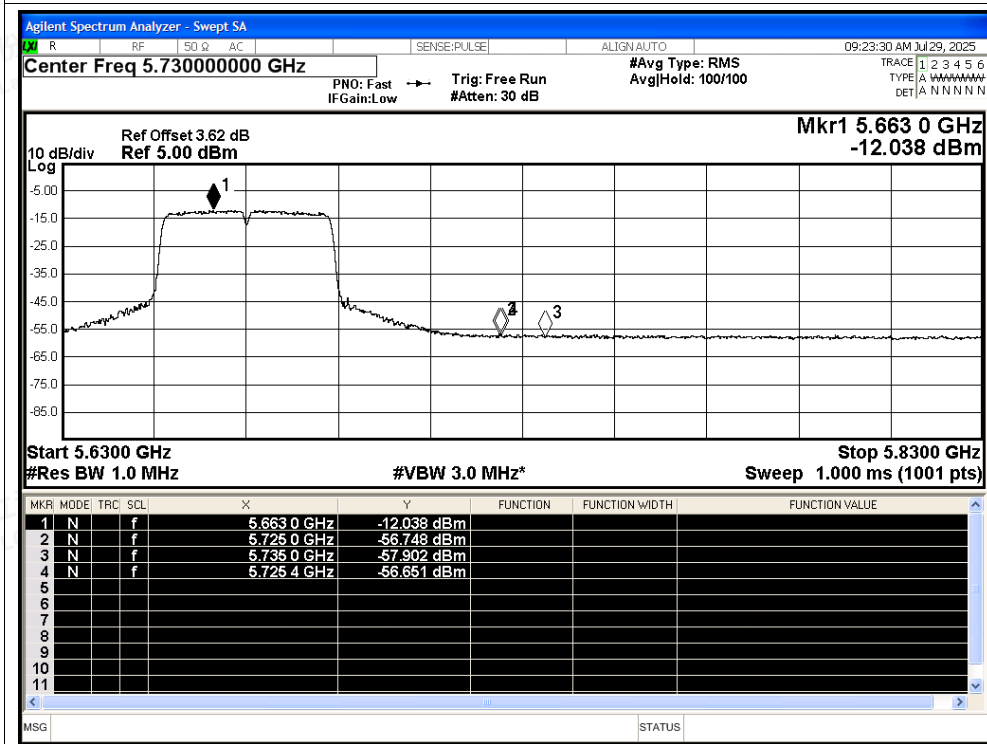

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz Ant4 Peak

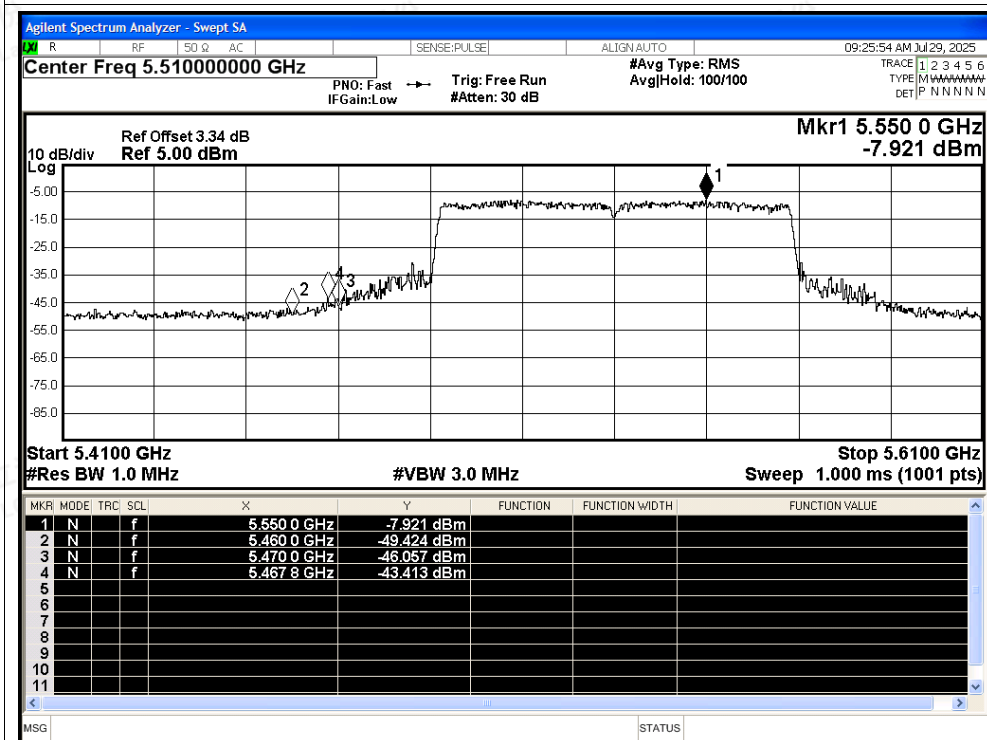

Restrict Band NVNT ax80 5530MHz Ant4 Average

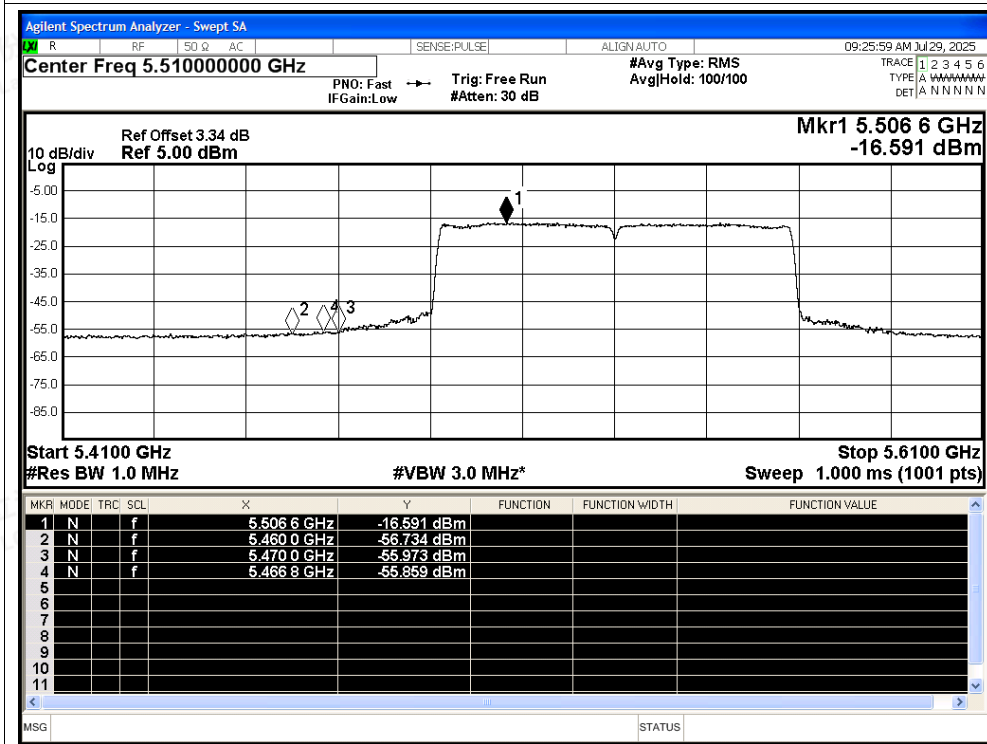

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz Ant4 Peak

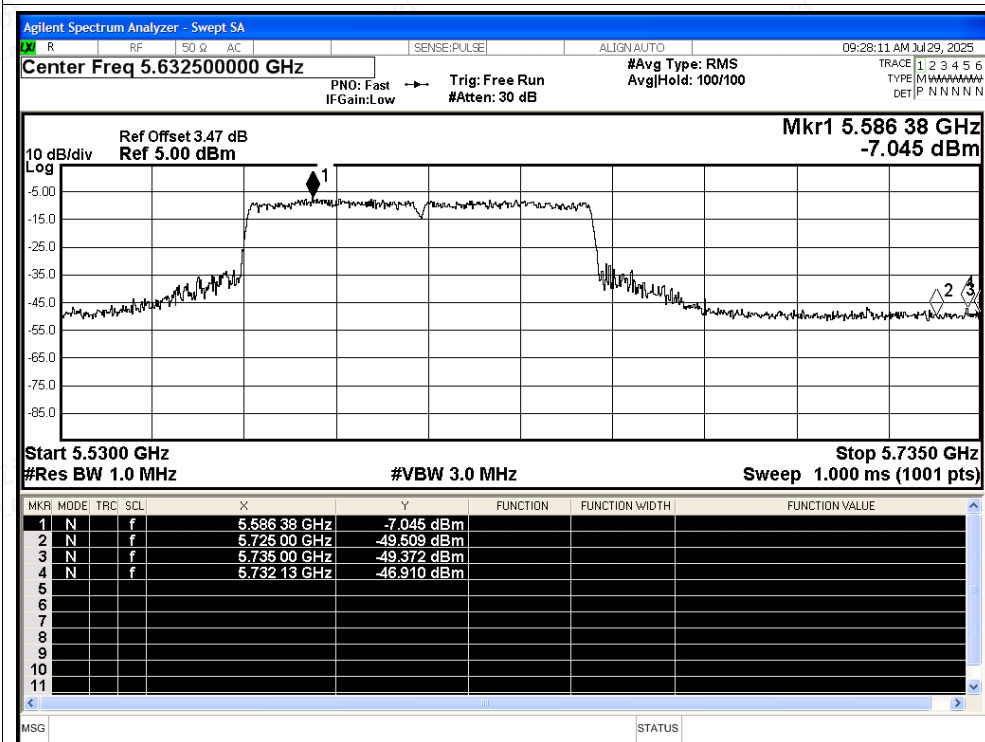

Restrict Band NVNT ax80 5610MHz Ant4 Average

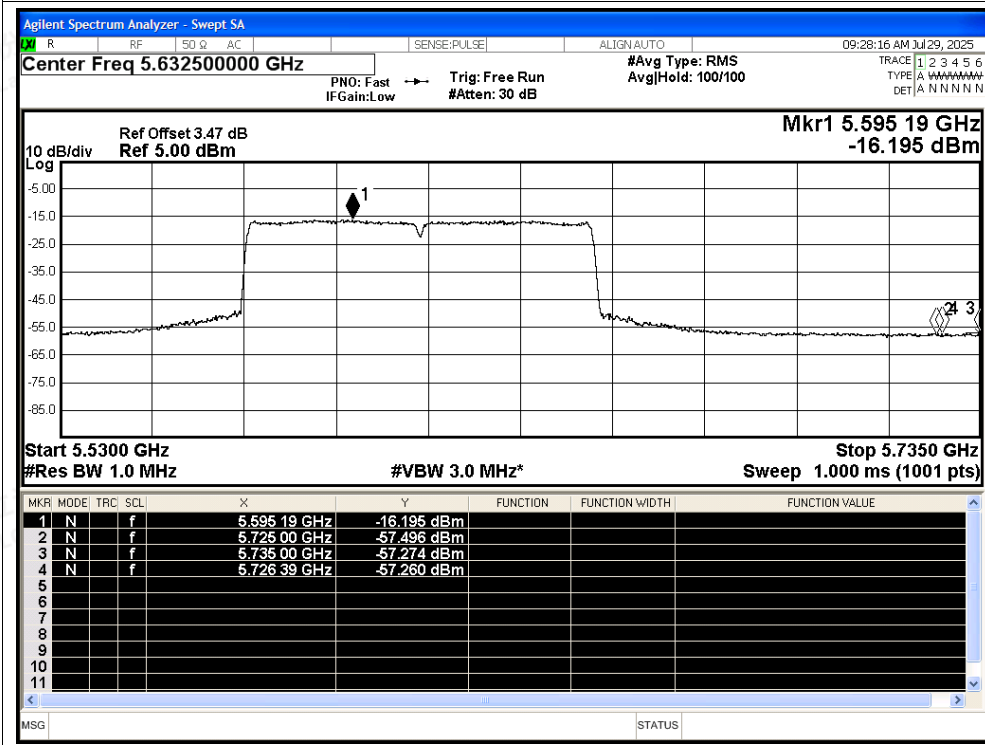

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT3 Power (dBm)	ANT4 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-48.87	-49.76	8.11	57.06	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.66	-57.51	8.11	48.76	Average	54	Pass
NVNT	n20	5500	5470	-46.08	-44.26	8.11	61.27	Peak	68.2	Pass
NVNT	n20	5500	5467.8	-55.94	-55.97	8.11	50.39	Average	54	Pass
NVNT	n20	5500	5470	-46.2	-44.31	8.11	61.19	Peak	68.2	Pass
NVNT	n20	5500	5470	-56.78	-56.08	8.11	49.93	Average	54	Pass
NVNT	n20	5700	5725	-41.67	-39.44	8.11	65.93	Peak	68.2	Pass
NVNT	n20	5700	5725	-53.02	-54.66	8.11	52.58	Average	54	Pass
NVNT	n20	5700	5729.2	-39.26	-38.21	8.11	67.64	Peak	68.2	Pass
NVNT	n20	5700	5725.4	-53.02	-53.02	8.11	53.33	Average	54	Pass
NVNT	n20	5700	5735	-49.48	-49.25	8.11	56.98	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.3	-57.5	8.11	48.95	Average	54	Pass
NVNT	n40	5510	5460	-47.42	-48.57	8.11	58.39	Peak	68.2	Pass
NVNT	n40	5510	5460	-57.54	-58.11	8.11	48.53	Average	54	Pass
NVNT	n40	5510	5468.8	-44.17	-40.3	8.11	64.53	Peak	68.2	Pass
NVNT	n40	5510	5469.6	-55.76	-55.88	8.11	50.53	Average	54	Pass
NVNT	n40	5510	5470	-45.24	-41.53	8.11	63.35	Peak	68.2	Pass
NVNT	n40	5510	5470	-55.76	-56.11	8.11	50.42	Average	54	Pass
NVNT	n40	5670	5725	-49.32	-48.86	8.11	57.26	Peak	68.2	Pass
NVNT	n40	5670	5725	-57.14	-57.79	8.11	48.90	Average	54	Pass
NVNT	n40	5670	5730.4	-47.03	-48.11	8.11	58.81	Peak	68.2	Pass
NVNT	n40	5670	5727.8	-57.02	-56.92	8.11	49.38	Average	54	Pass
NVNT	n40	5670	5735	-49.92	-49.94	8.11	56.42	Peak	68.2	Pass
NVNT	n40	5670	5735	-57.58	-57.01	8.11	49.06	Average	54	Pass
NVNT	ac20	5500	5460	-49.37	-49.54	8.11	56.89	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.76	-57.3	8.11	48.82	Average	54	Pass
NVNT	ac20	5500	5469.6	-45.08	-45.55	8.11	61.04	Peak	68.2	Pass
NVNT	ac20	5500	5469	-56.43	-56.05	8.11	50.11	Average	54	Pass
NVNT	ac20	5500	5470	-47.26	-47.7	8.11	58.87	Peak	68.2	Pass
NVNT	ac20	5500	5470	-56.59	-57	8.11	49.56	Average	54	Pass
NVNT	ac20	5700	5725	-41.2	-40.89	8.11	65.31	Peak	68.2	Pass
NVNT	ac20	5700	5725	-54.19	-53.55	8.11	52.49	Average	54	Pass
NVNT	ac20	5700	5727	-38.74	-38.65	8.11	67.65	Peak	68.2	Pass
NVNT	ac20	5700	5726	-53.79	-53.08	8.11	52.93	Average	54	Pass
NVNT	ac20	5700	5735	-47.16	-47.74	8.11	58.91	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.37	-56.37	8.11	49.51	Average	54	Pass
NVNT	ac40	5510	5460	-49.4	-50.14	8.11	56.59	Peak	68.2	Pass
NVNT	ac40	5510	5460	-57.47	-57.76	8.11	48.74	Average	54	Pass
NVNT	ac40	5510	5469.6	-42	-43.02	8.11	63.87	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5469.6	-55.95	-55.81	8.11	50.47	Average	54	Pass
NVNT	ac40	5510	5470	-42	-46.03	8.11	62.78	Peak	68.2	Pass
NVNT	ac40	5510	5470	-56.33	-55.81	8.11	50.29	Average	54	Pass
NVNT	ac40	5670	5725	-48.45	-47.93	8.11	58.17	Peak	68.2	Pass
NVNT	ac40	5670	5725	-57.55	-57.45	8.11	48.85	Average	54	Pass
NVNT	ac40	5670	5730.6	-47.42	-47.17	8.11	59.05	Peak	68.2	Pass
NVNT	ac40	5670	5725.2	-56.98	-57.03	8.11	49.34	Average	54	Pass
NVNT	ac40	5670	5735	-49.04	-48.79	8.11	57.43	Peak	68.2	Pass
NVNT	ac40	5670	5735	-57.15	-57.97	8.11	48.81	Average	54	Pass
NVNT	ac80	5530	5460	-48.63	-47.3	8.11	58.43	Peak	68.2	Pass
NVNT	ac80	5530	5460	-57.13	-57.55	8.11	49.01	Average	54	Pass
NVNT	ac80	5530	5467.4	-42.75	-43.24	8.11	63.36	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.27	-55.67	8.11	50.88	Average	54	Pass
NVNT	ac80	5530	5470	-46.4	-44.85	8.11	60.79	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.27	-56.65	8.11	50.44	Average	54	Pass
NVNT	ac80	5610	5725	-51.21	-50.41	8.11	55.56	Peak	68.2	Pass
NVNT	ac80	5610	5725	-57.56	-58.16	8.11	48.50	Average	54	Pass
NVNT	ac80	5610	5725.16	-48.25	-47.72	8.11	58.37	Peak	68.2	Pass
NVNT	ac80	5610	5729.875	-57.31	-57.07	8.11	49.16	Average	54	Pass
NVNT	ac80	5610	5735	-48.96	-49.82	8.11	56.98	Peak	68.2	Pass
NVNT	ac80	5610	5735	-57.61	-57.66	8.11	48.71	Average	54	Pass
NVNT	ax20	5500	5460	-49.35	-48.41	8.11	57.49	Peak	68.2	Pass
NVNT	ax20	5500	5460	-57.26	-57.26	8.11	49.09	Average	54	Pass
NVNT	ax20	5500	5468.6	-43.44	-44.34	8.11	62.48	Peak	68.2	Pass
NVNT	ax20	5500	5469.6	-56	-55.51	8.11	50.60	Average	54	Pass
NVNT	ax20	5500	5470	-45.81	-47.65	8.11	59.71	Peak	68.2	Pass
NVNT	ax20	5500	5470	-56	-56.37	8.11	50.17	Average	54	Pass
NVNT	ax20	5700	5725	-37.27	-37.41	8.11	66.47	Peak	68.2	Pass
NVNT	ax20	5700	5725	-54.94	-54.73	8.11	51.51	Average	54	Pass
NVNT	ax20	5700	5726	-37.27	-37.41	8.11	66.47	Peak	68.2	Pass
NVNT	ax20	5700	5725.8	-53.35	-53.58	8.11	52.88	Average	54	Pass
NVNT	ax20	5700	5735	-47.13	-49.36	8.11	58.24	Peak	68.2	Pass
NVNT	ax20	5700	5735	-56.97	-56.86	8.11	49.43	Average	54	Pass
NVNT	ax40	5510	5460	-50.73	-49.26	8.11	56.41	Peak	68.2	Pass
NVNT	ax40	5510	5460	-57.03	-57.21	8.11	49.23	Average	54	Pass
NVNT	ax40	5510	5468.4	-41.56	-42.4	8.11	64.39	Peak	68.2	Pass
NVNT	ax40	5510	5469.6	-56.18	-55.52	8.11	50.51	Average	54	Pass
NVNT	ax40	5510	5470	-41.56	-44.79	8.11	63.47	Peak	68.2	Pass
NVNT	ax40	5510	5470	-56.62	-55.61	8.11	50.26	Average	54	Pass
NVNT	ax40	5670	5725	-48.48	-49.39	8.11	57.44	Peak	68.2	Pass
NVNT	ax40	5670	5725	-57.94	-56.75	8.11	49.04	Average	54	Pass
NVNT	ax40	5670	5726.2	-47.39	-47.74	8.11	58.79	Peak	68.2	Pass
NVNT	ax40	5670	5725.6	-56.71	-56.65	8.11	49.67	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	5735	-48.28	-48.57	8.11	57.93	Peak	68.2	Pass
NVNT	ax40	5670	5735	-57.68	-57.9	8.11	48.56	Average	54	Pass
NVNT	ax80	5530	5460	-49.01	-49.42	8.11	57.14	Peak	68.2	Pass
NVNT	ax80	5530	5460	-57.18	-56.73	8.11	49.40	Average	54	Pass
NVNT	ax80	5530	5468.8	-42.61	-43.41	8.11	63.36	Peak	68.2	Pass
NVNT	ax80	5530	5469.4	-55.73	-55.86	8.11	50.55	Average	54	Pass
NVNT	ax80	5530	5470	-43.31	-46.06	8.11	61.88	Peak	68.2	Pass
NVNT	ax80	5530	5470	-55.99	-55.97	8.11	50.37	Average	54	Pass
NVNT	ax80	5610	5725	-49.68	-49.51	8.11	56.75	Peak	68.2	Pass
NVNT	ax80	5610	5725	-58.06	-57.5	8.11	48.58	Average	54	Pass
NVNT	ax80	5610	5725.57	-47.16	-46.91	8.11	59.31	Peak	68.2	Pass
NVNT	ax80	5610	5727.005	-57.33	-57.26	8.11	49.05	Average	54	Pass
NVNT	ax80	5610	5735	-49.75	-49.37	8.11	56.79	Peak	68.2	Pass
NVNT	ax80	5610	5735	-57.67	-57.27	8.11	48.88	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Model: E1M-L159Y

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	An1	5460	-50.25	5.1	-	50.08	Peak	68.2	Pass
NVNT	a	5500	An1	5460	-57.74	5.1	0.24	42.83	Average	54	Pass
NVNT	a	5500	An1	5470	-45.39	5.1	-	54.94	Peak	68.2	Pass
NVNT	a	5500	An1	5470	-56.86	5.1	0.24	43.71	Average	54	Pass
NVNT	a	5500	An1	5470	-45.39	5.1	-	54.94	Peak	68.2	Pass
NVNT	a	5500	An1	5470	-56.86	5.1	0.24	43.71	Average	54	Pass
NVNT	a	5700	An1	5725	-45.11	5.1	-	55.22	Peak	68.2	Pass
NVNT	a	5700	An1	5725	-56.08	5.1	0.24	44.49	Average	54	Pass
NVNT	a	5700	An1	5726	-41.17	5.1	-	59.16	Peak	68.2	Pass
NVNT	a	5700	An1	5725.4	-55.37	5.1	0.24	45.20	Average	54	Pass
NVNT	a	5700	An1	5735	-49.63	5.1	-	50.70	Peak	68.2	Pass
NVNT	a	5700	An1	5735	-57.61	5.1	0.24	42.96	Average	54	Pass
NVNT	n20	5500	An1	5460	-48.37	5.1	-	51.96	Peak	68.2	Pass
NVNT	n20	5500	An1	5460	-57.54	5.1	0.12	42.91	Average	54	Pass
NVNT	n20	5500	An1	5470	-44.14	5.1	-	56.19	Peak	68.2	Pass
NVNT	n20	5500	An1	5469.6	-56.69	5.1	0.12	43.76	Average	54	Pass
NVNT	n20	5500	An1	5470	-44.14	5.1	-	56.19	Peak	68.2	Pass
NVNT	n20	5500	An1	5470	-57.11	5.1	0.12	43.34	Average	54	Pass
NVNT	n20	5700	An1	5725	-41.23	5.1	-	59.10	Peak	68.2	Pass
NVNT	n20	5700	An1	5725	-55.02	5.1	0.12	45.43	Average	54	Pass
NVNT	n20	5700	An1	5726.2	-39.97	5.1	-	60.36	Peak	68.2	Pass
NVNT	n20	5700	An1	5725.6	-54.45	5.1	0.12	46.00	Average	54	Pass
NVNT	n20	5700	An1	5735	-47.26	5.1	-	53.07	Peak	68.2	Pass
NVNT	n20	5700	An1	5735	-57.89	5.1	0.12	42.56	Average	54	Pass
NVNT	n40	5510	An1	5460	-49.29	5.1	-	51.04	Peak	68.2	Pass
NVNT	n40	5510	An1	5460	-58.22	5.1	0.23	42.34	Average	54	Pass
NVNT	n40	5510	An1	5468.8	-44.25	5.1	-	56.08	Peak	68.2	Pass
NVNT	n40	5510	An1	5467.6	-56.49	5.1	0.23	44.07	Average	54	Pass
NVNT	n40	5510	An1	5470	-47.47	5.1	-	52.86	Peak	68.2	Pass
NVNT	n40	5510	An1	5470	-56.62	5.1	0.23	43.94	Average	54	Pass
NVNT	n40	5670	An1	5725	-49.83	5.1	-	50.50	Peak	68.2	Pass
NVNT	n40	5670	An1	5725	-58.1	5.1	0.24	42.47	Average	54	Pass
NVNT	n40	5670	An1	5732	-46.66	5.1	-	53.67	Peak	68.2	Pass
NVNT	n40	5670	An1	5725.8	-57.29	5.1	0.24	43.28	Average	54	Pass
NVNT	n40	5670	An1	5735	-50.48	5.1	-	49.85	Peak	68.2	Pass
NVNT	n40	5670	An1	5735	-58.29	5.1	0.24	42.28	Average	54	Pass
NVNT	ac20	5500	An1	5460	-49.96	5.1	-	50.37	Peak	68.2	Pass
NVNT	ac20	5500	An1	5460	-58.69	5.1	0.12	41.76	Average	54	Pass
NVNT	ac20	5500	An1	5469.2	-45.41	5.1	-	54.92	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	An1	5469.6	-56.4	5.1	0.12	44.05	Average	54	Pass
NVNT	ac20	5500	An1	5470	-48.15	5.1	-	52.18	Peak	68.2	Pass
NVNT	ac20	5500	An1	5470	-57.1	5.1	0.12	43.35	Average	54	Pass
NVNT	ac20	5700	An1	5725	-37.26	5.1	-	63.07	Peak	68.2	Pass
NVNT	ac20	5700	An1	5725	-53.77	5.1	0.12	46.68	Average	54	Pass
NVNT	ac20	5700	An1	5735	-48.95	5.1	-	51.38	Peak	68.2	Pass
NVNT	ac20	5700	An1	5735	-57.65	5.1	0.12	42.80	Average	54	Pass
NVNT	ac20	5700	An1	5735	-48.95	5.1	-	51.38	Peak	68.2	Pass
NVNT	ac20	5700	An1	5735	-57.65	5.1	0.12	42.80	Average	54	Pass
NVNT	ac40	5510	An1	5460	-49.69	5.1	-	50.64	Peak	68.2	Pass
NVNT	ac40	5510	An1	5460	-58.59	5.1	0.23	41.97	Average	54	Pass
NVNT	ac40	5510	An1	5469.8	-45.57	5.1	-	54.76	Peak	68.2	Pass
NVNT	ac40	5510	An1	5470	-56.59	5.1	0.23	43.97	Average	54	Pass
NVNT	ac40	5510	An1	5470	-45.94	5.1	-	54.39	Peak	68.2	Pass
NVNT	ac40	5510	An1	5470	-56.59	5.1	0.23	43.97	Average	54	Pass
NVNT	ac40	5670	An1	5725	-47.6	5.1	-	52.73	Peak	68.2	Pass
NVNT	ac40	5670	An1	5725	-58.58	5.1	0.23	41.98	Average	54	Pass
NVNT	ac40	5670	An1	5727	-47.21	5.1	-	53.12	Peak	68.2	Pass
NVNT	ac40	5670	An1	5731	-57.65	5.1	0.23	42.91	Average	54	Pass
NVNT	ac40	5670	An1	5735	-48.27	5.1	-	52.06	Peak	68.2	Pass
NVNT	ac40	5670	An1	5735	-58.33	5.1	0.23	42.23	Average	54	Pass
NVNT	ac80	5530	An1	5460	-48.35	5.1	-	51.98	Peak	68.2	Pass
NVNT	ac80	5530	An1	5460	-57.52	5.1	0.47	43.28	Average	54	Pass
NVNT	ac80	5530	An1	5469.8	-44.39	5.1	-	55.94	Peak	68.2	Pass
NVNT	ac80	5530	An1	5469.4	-56	5.1	0.47	44.80	Average	54	Pass
NVNT	ac80	5530	An1	5470	-45.15	5.1	-	55.18	Peak	68.2	Pass
NVNT	ac80	5530	An1	5470	-56.41	5.1	0.47	44.39	Average	54	Pass
NVNT	ac80	5610	An1	5725	-48.4	5.1	-	51.93	Peak	68.2	Pass
NVNT	ac80	5610	An1	5725	-58.34	5.1	0.47	42.46	Average	54	Pass
NVNT	ac80	5610	An1	5725.16	-48.14	5.1	-	52.19	Peak	68.2	Pass
NVNT	ac80	5610	An1	5725.57	-57.9	5.1	0.47	42.90	Average	54	Pass
NVNT	ac80	5610	An1	5735	-50.07	5.1	-	50.26	Peak	68.2	Pass
NVNT	ac80	5610	An1	5735	-58.68	5.1	0.47	42.12	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz An1 Peak

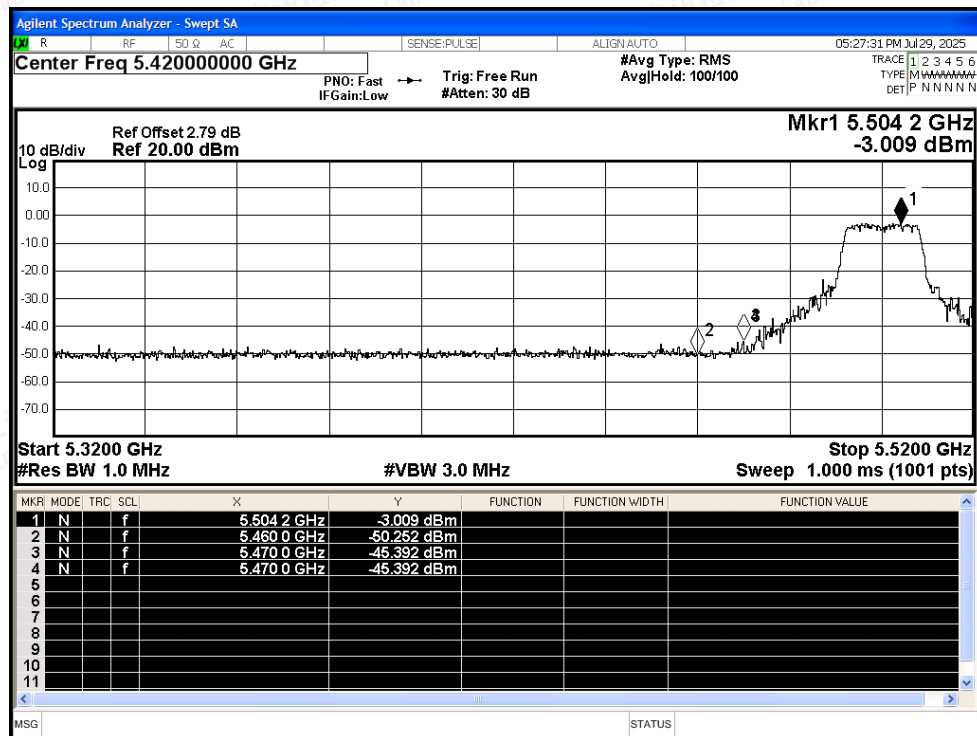

Restrict Band NVNT a 5500MHz An1 Average

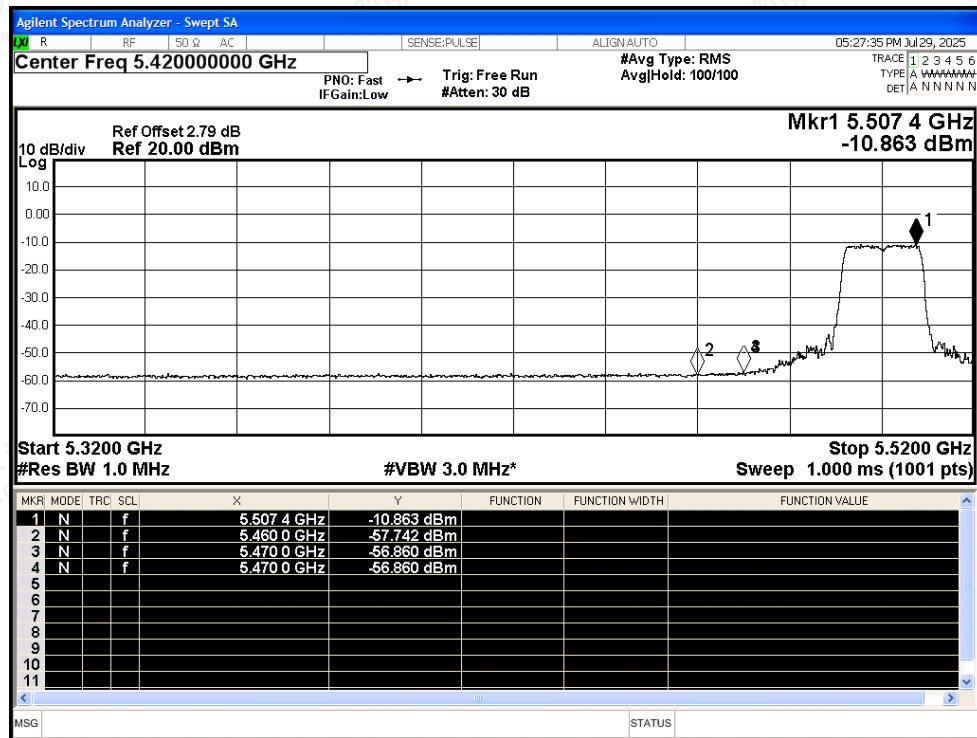

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz An1 Peak

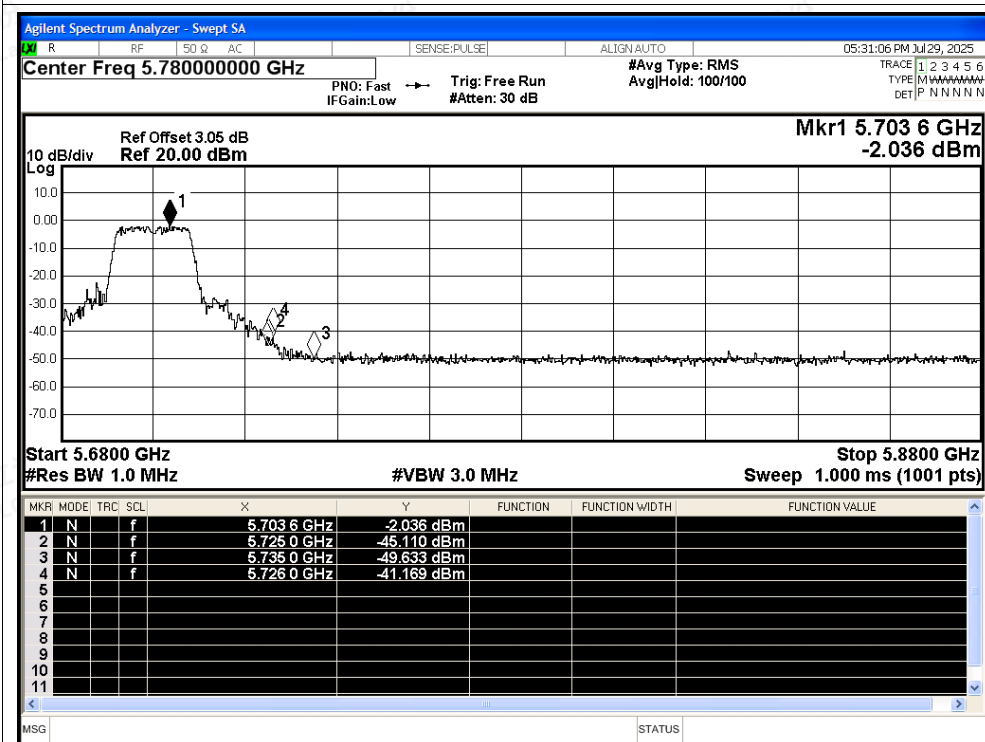

Restrict Band NVNT a 5700MHz An1 Average

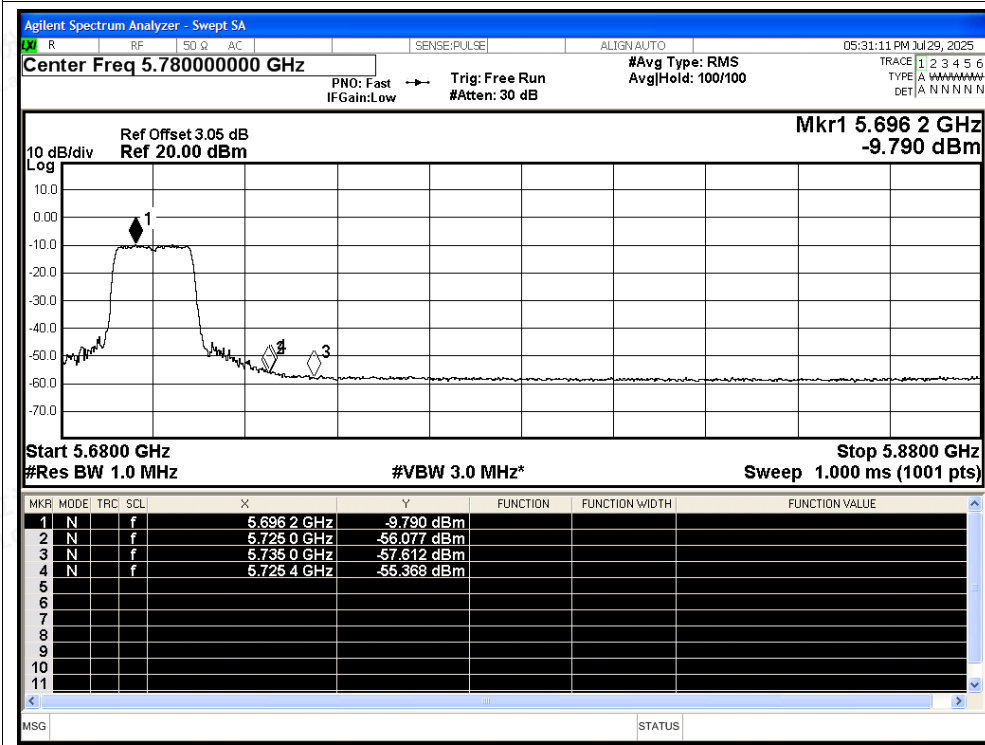

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz An1 Peak

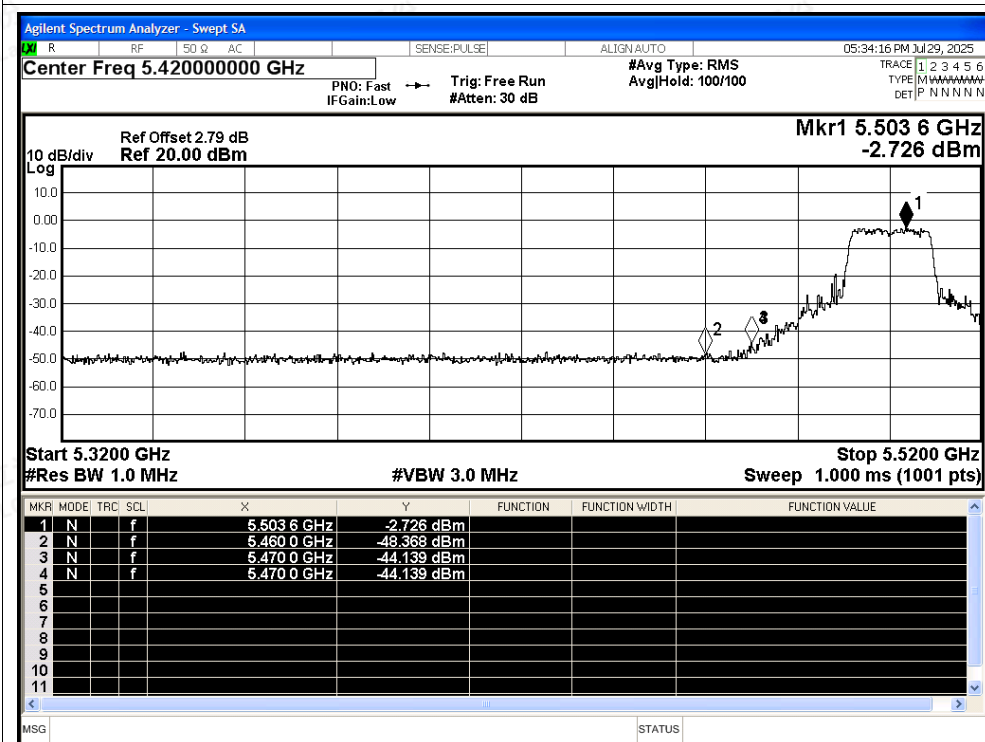

Restrict Band NVNT n20 5500MHz An1 Average

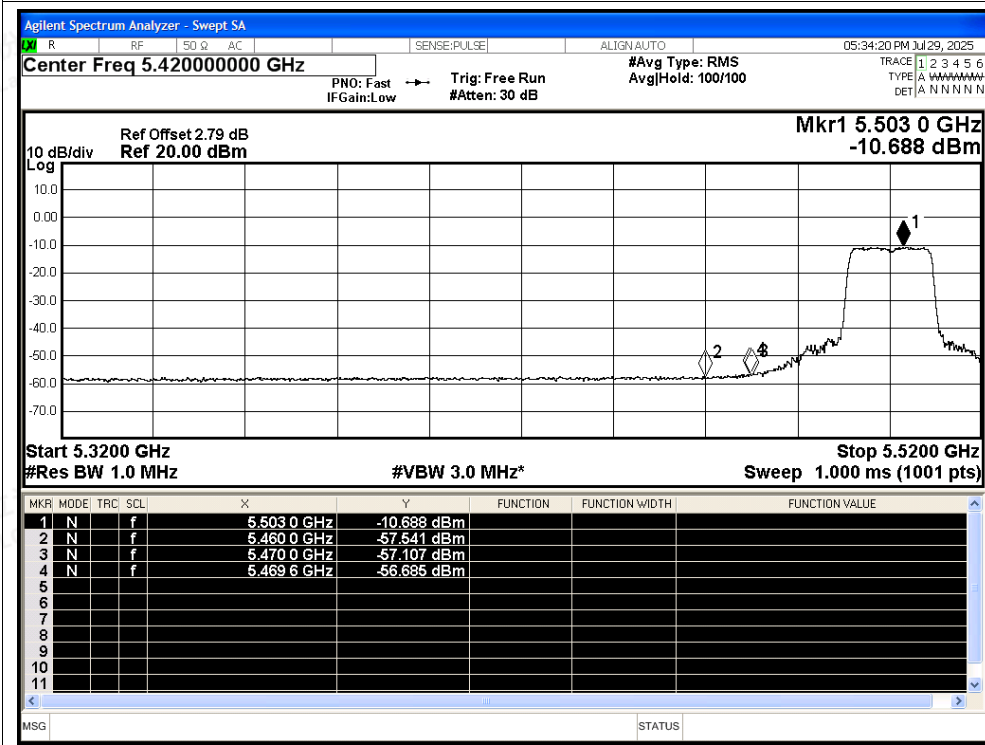

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz An1 Peak

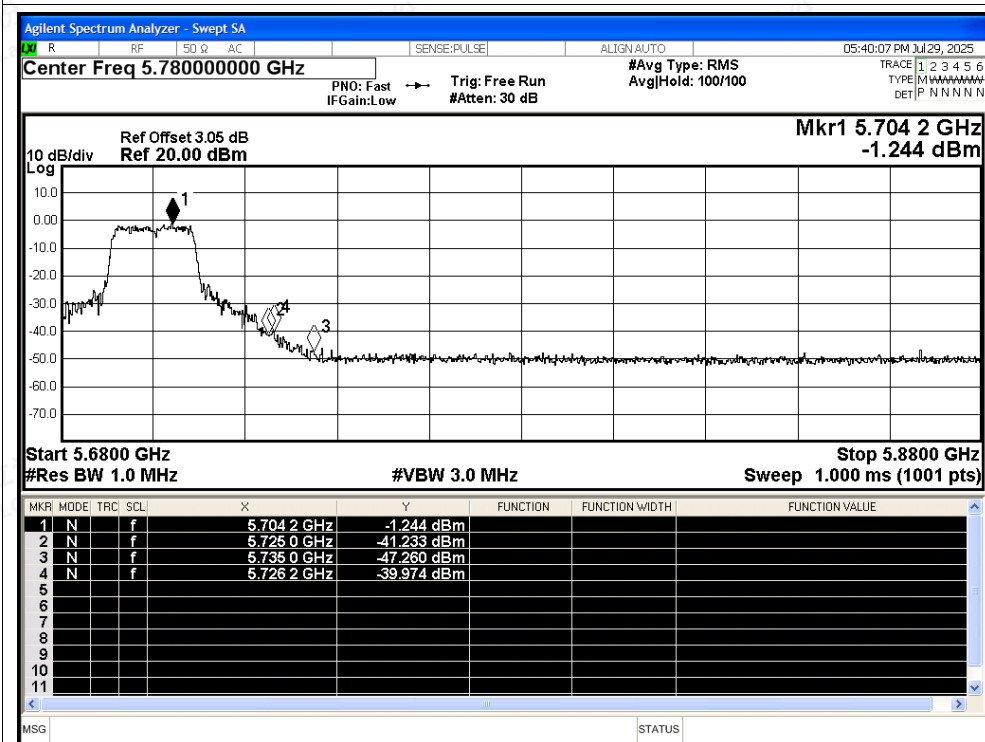

Restrict Band NVNT n20 5700MHz An1 Average

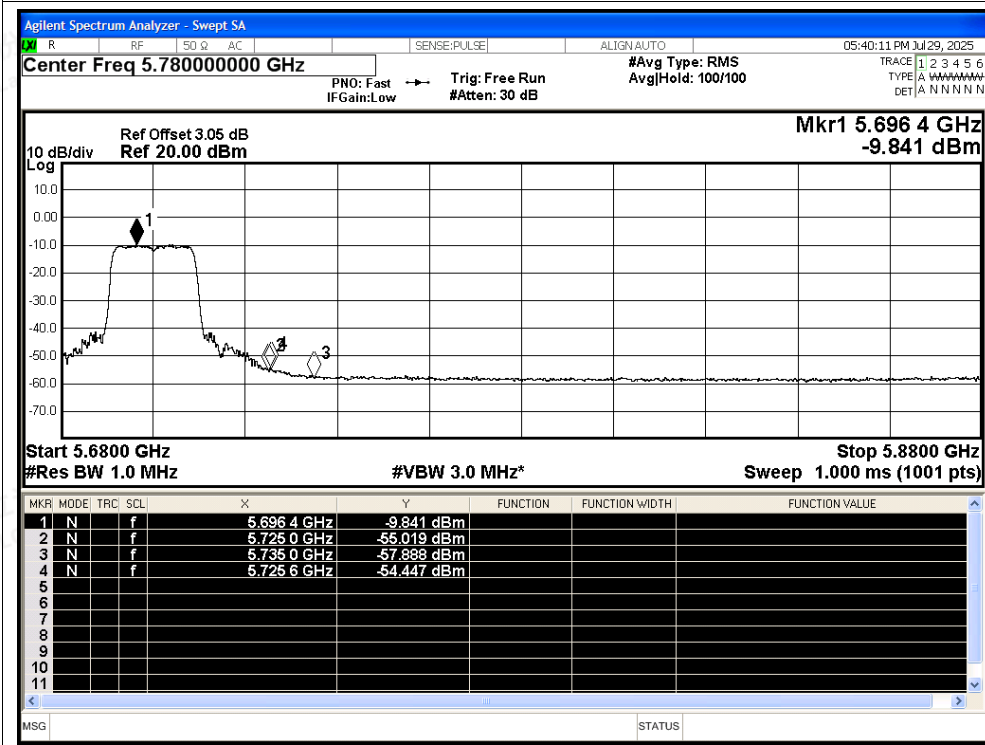

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz An1 Peak

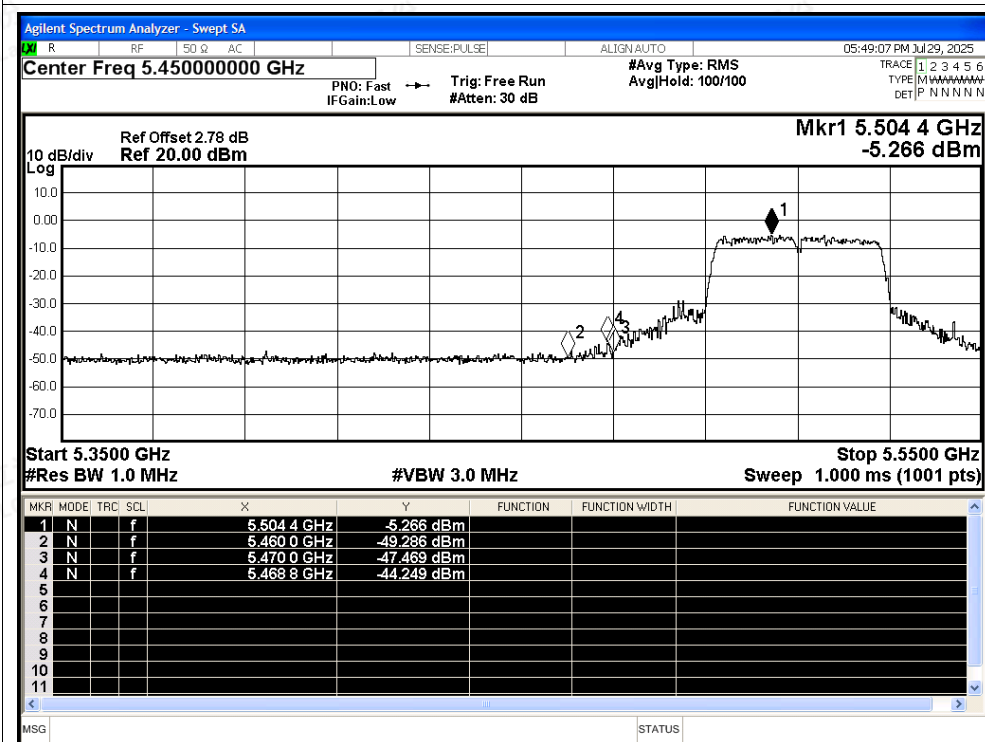

Restrict Band NVNT n40 5510MHz An1 Average

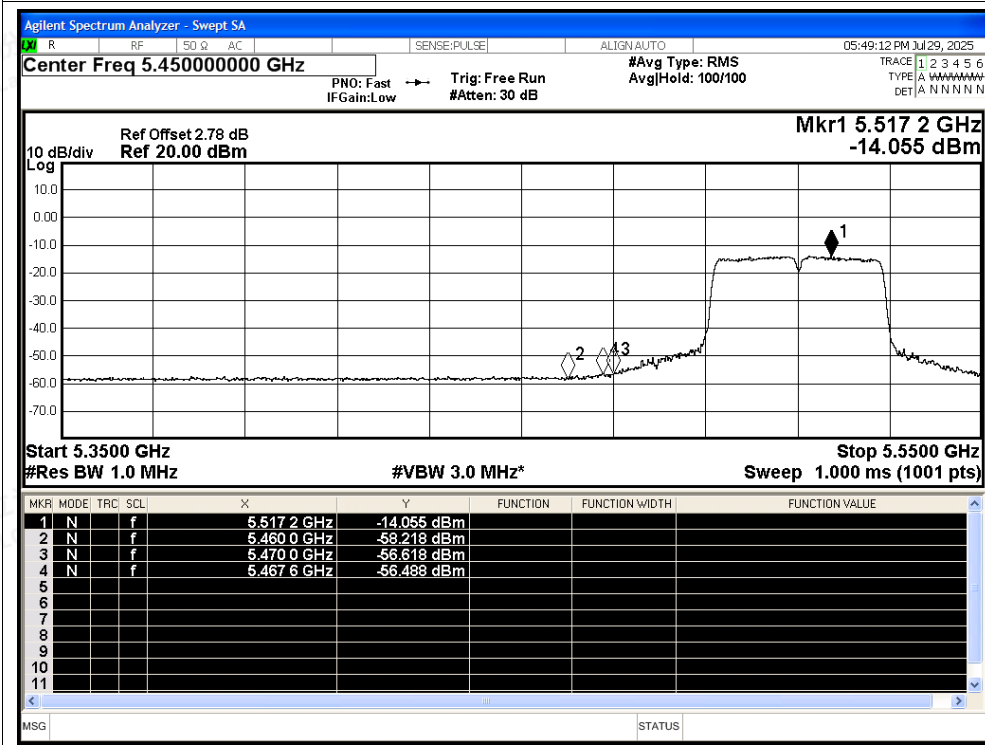

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz An1 Peak

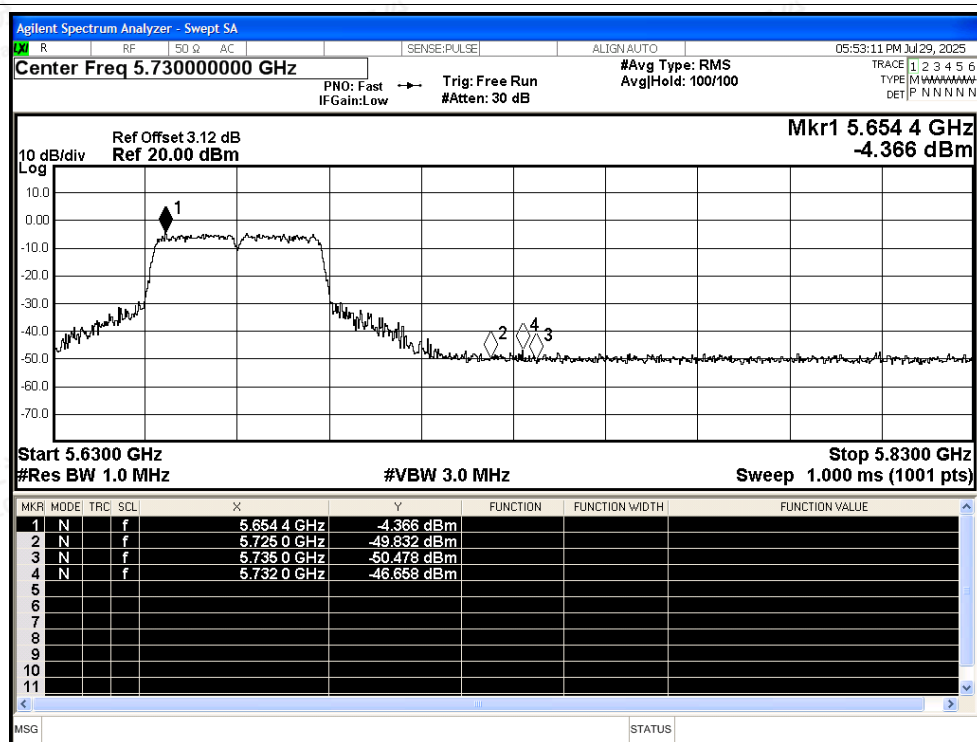

Restrict Band NVNT n40 5670MHz An1 Average

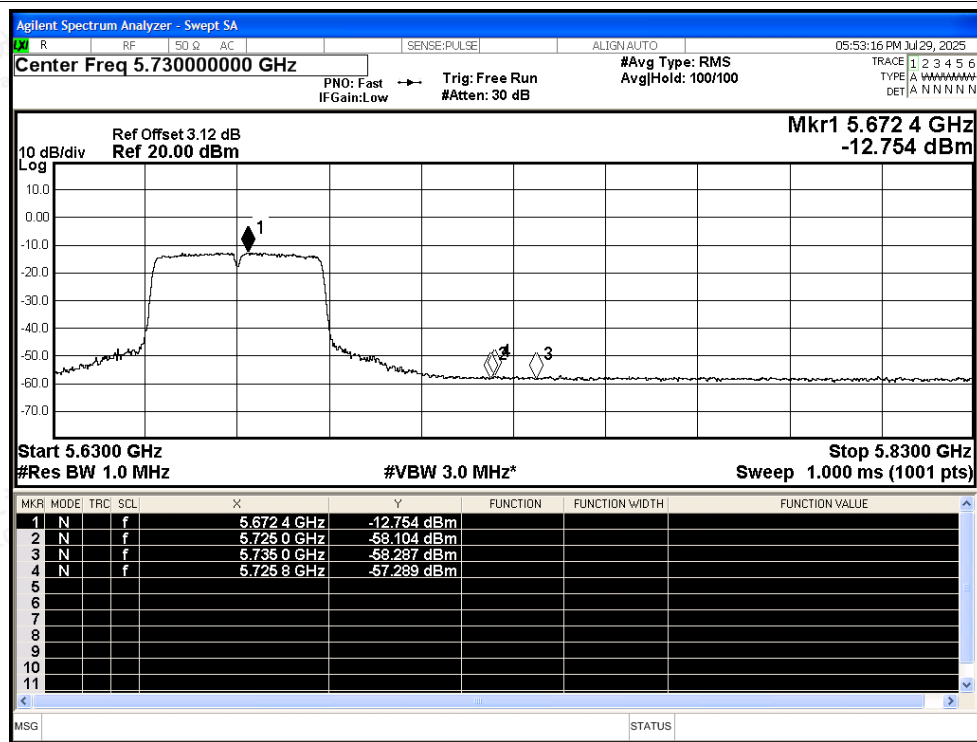

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz An1 Peak

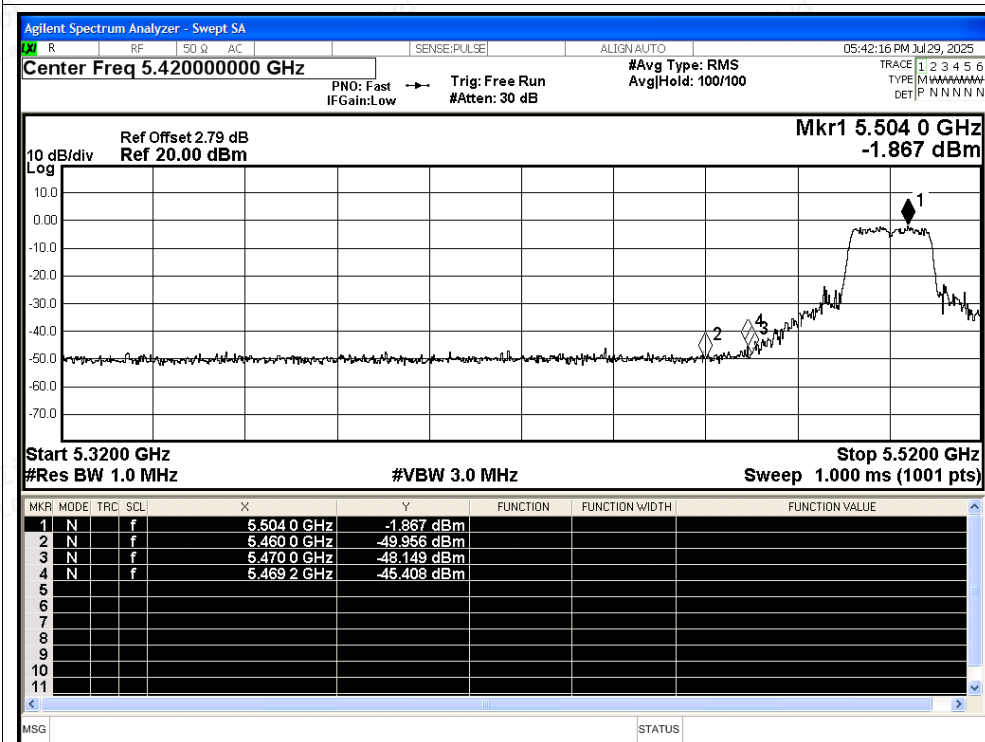

Restrict Band NVNT ac20 5500MHz An1 Average

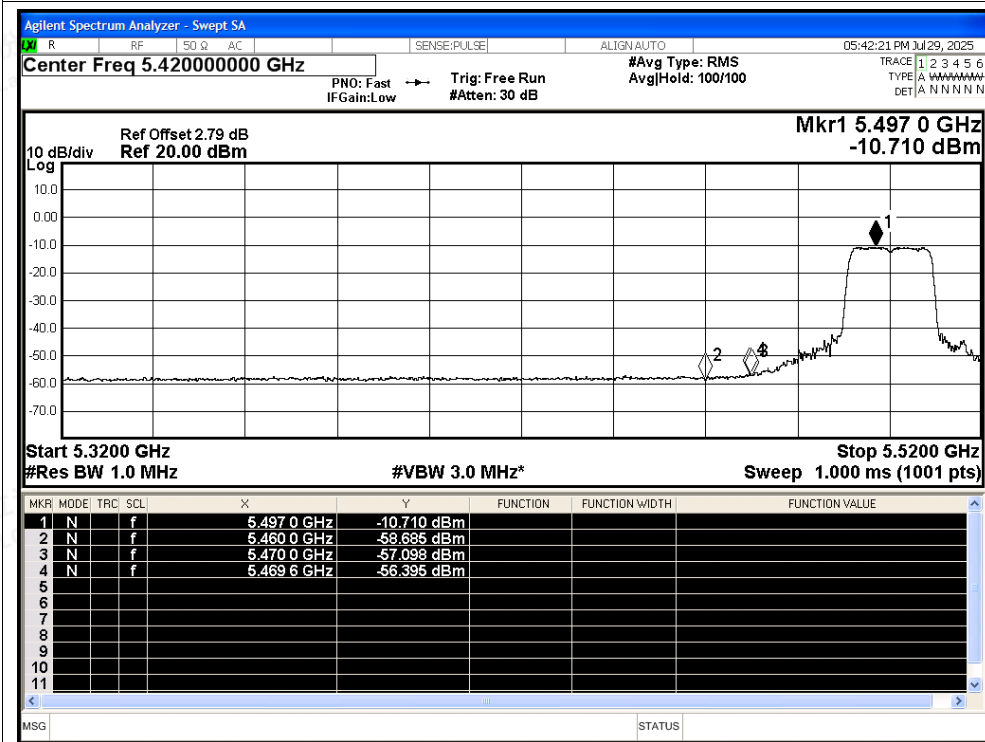

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz An1 Peak

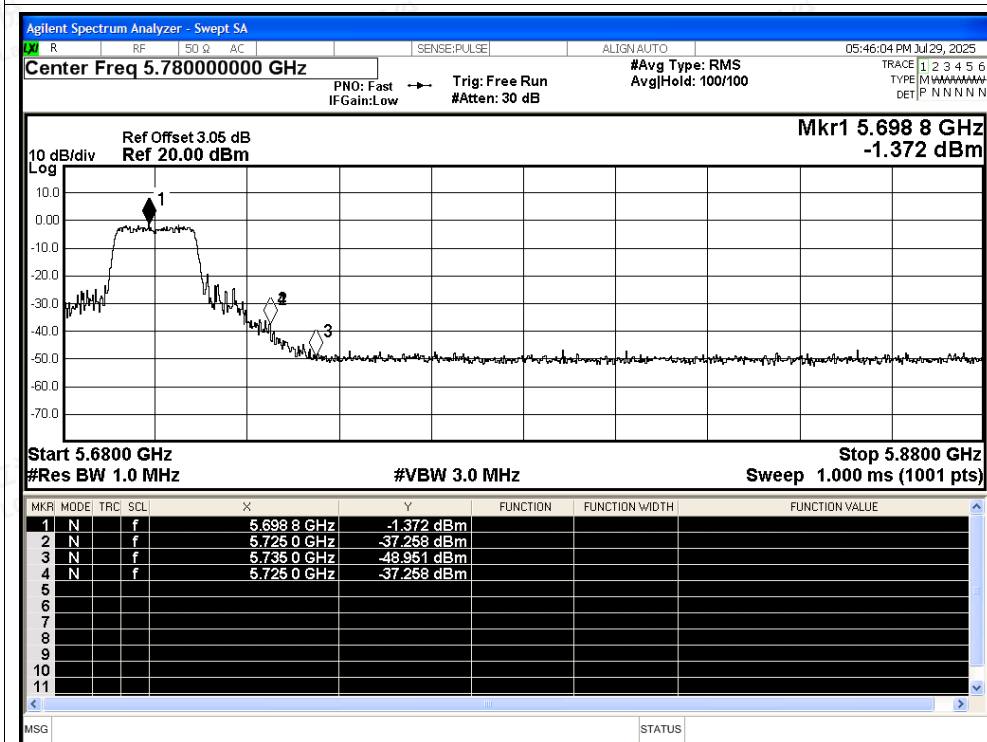

Restrict Band NVNT ac20 5700MHz An1 Average

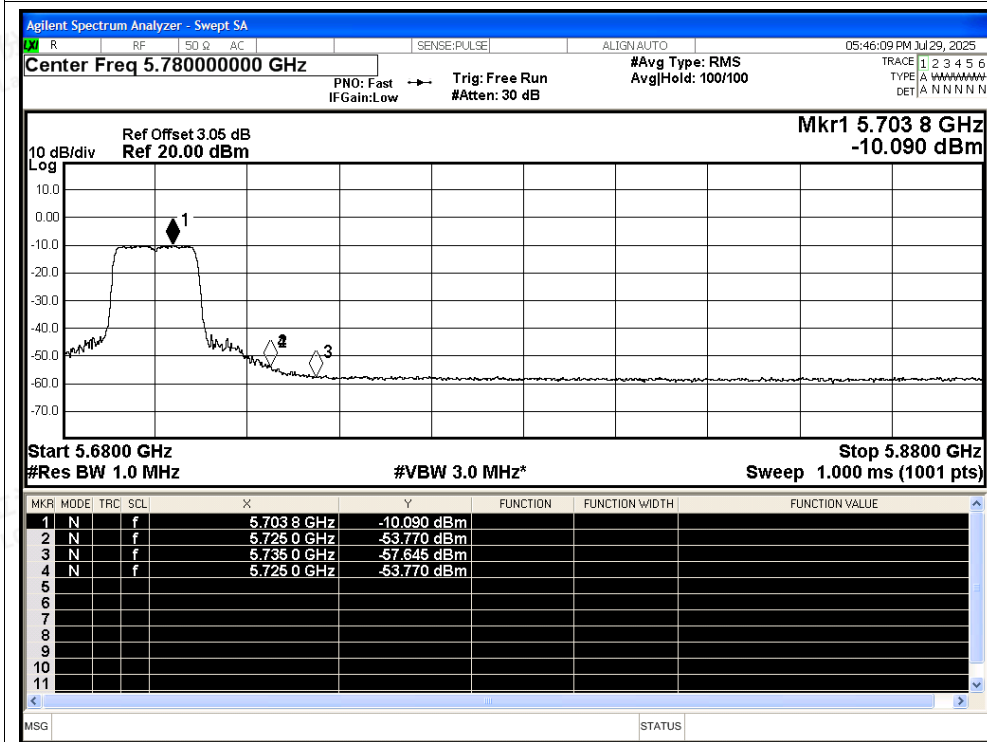

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz An1 Peak

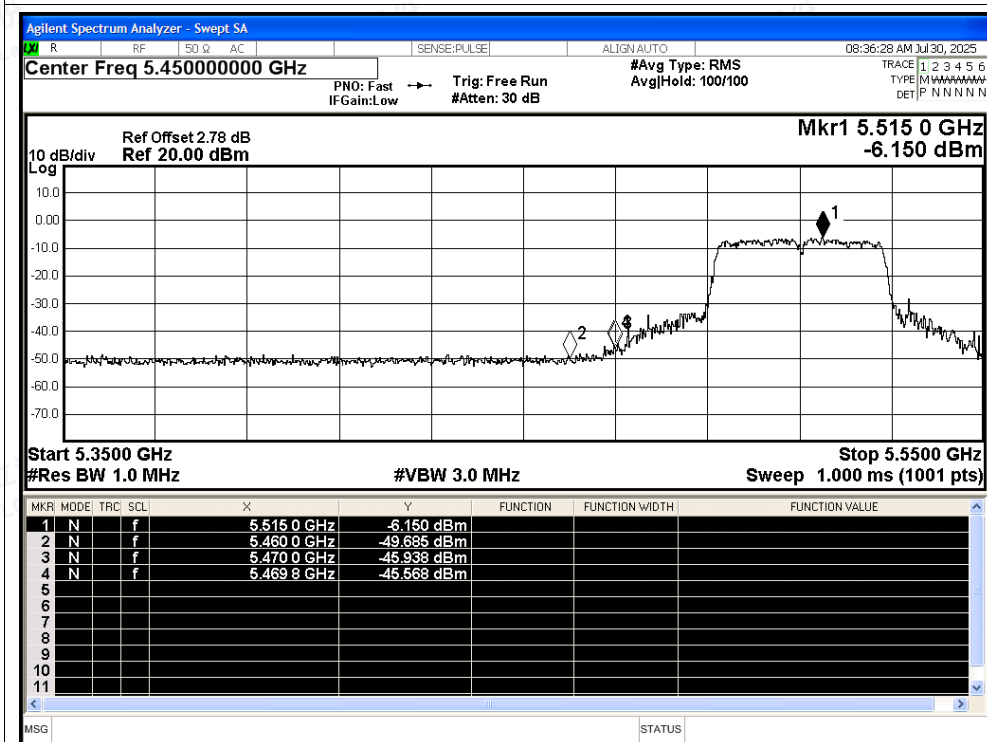

Restrict Band NVNT ac40 5510MHz An1 Average

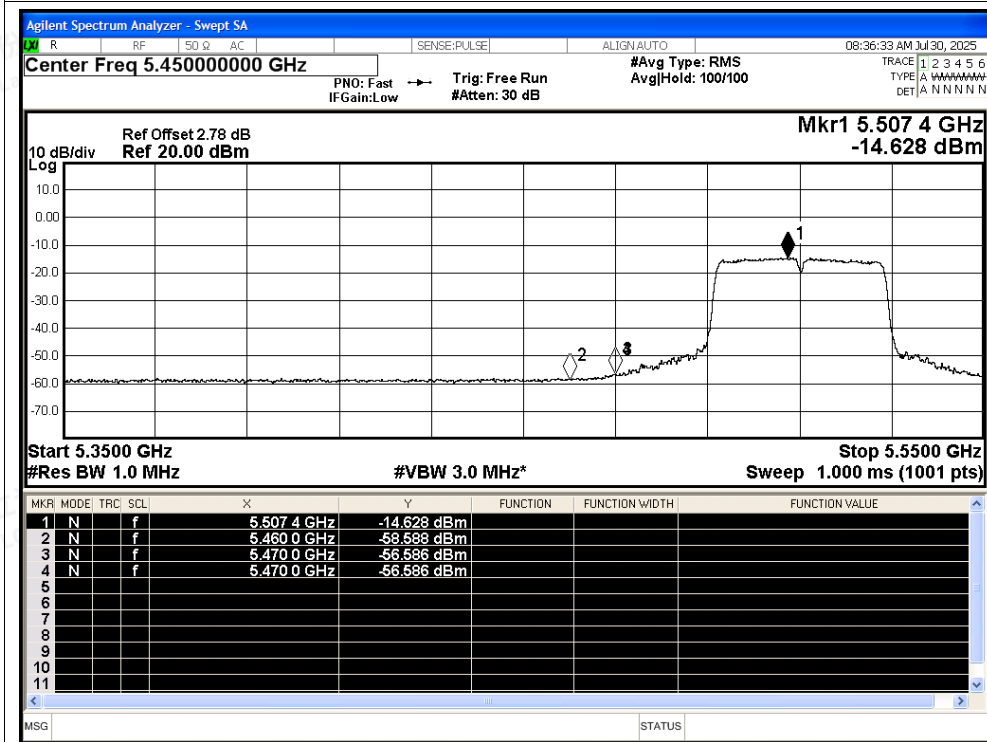

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz An1 Peak

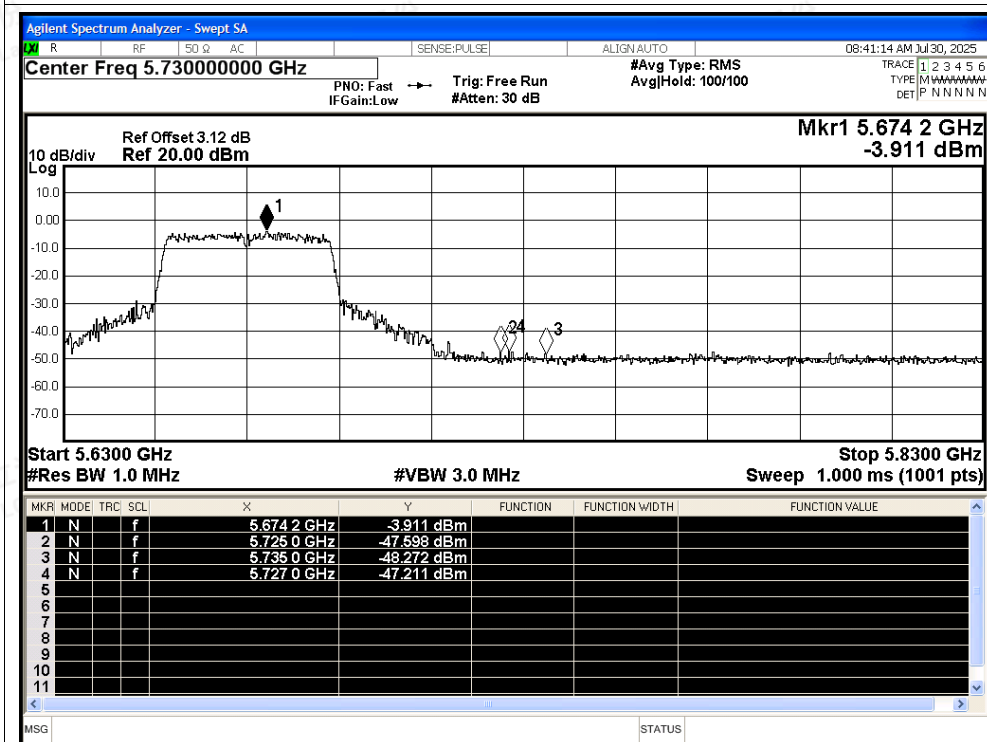

Restrict Band NVNT ac40 5670MHz An1 Average

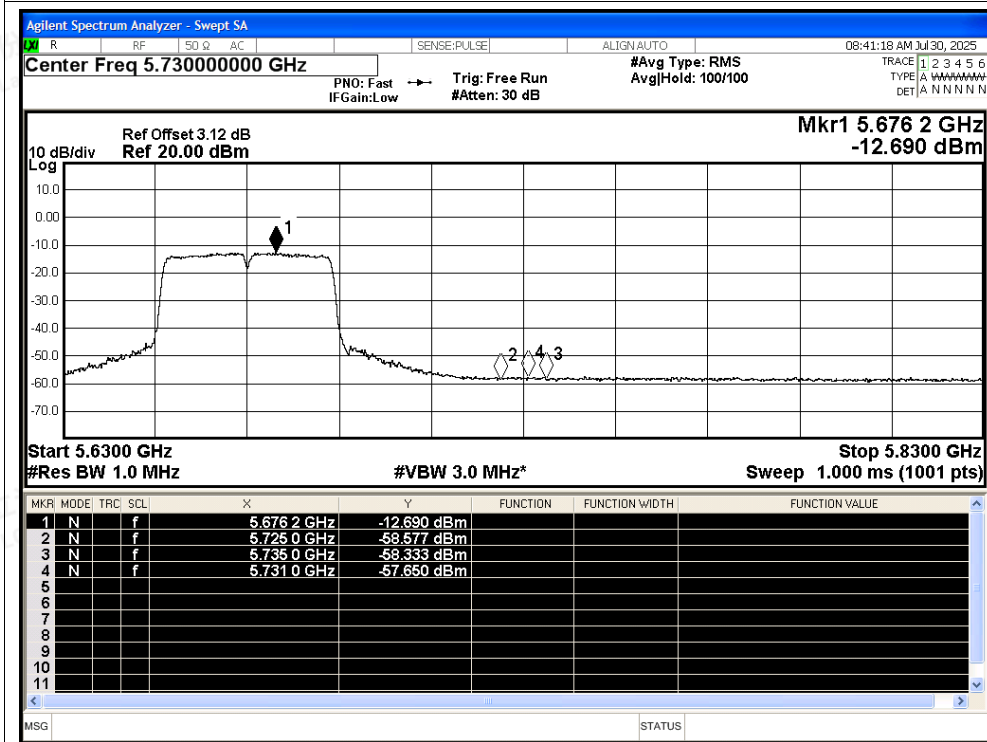

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz An1 Peak

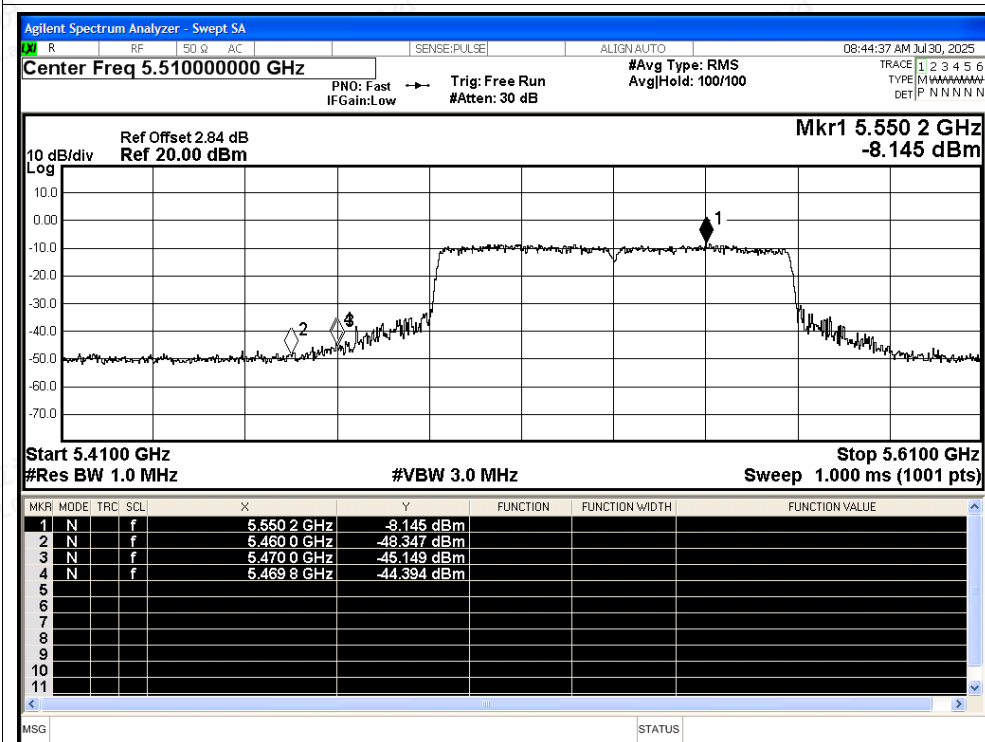

Restrict Band NVNT ac80 5530MHz An1 Average

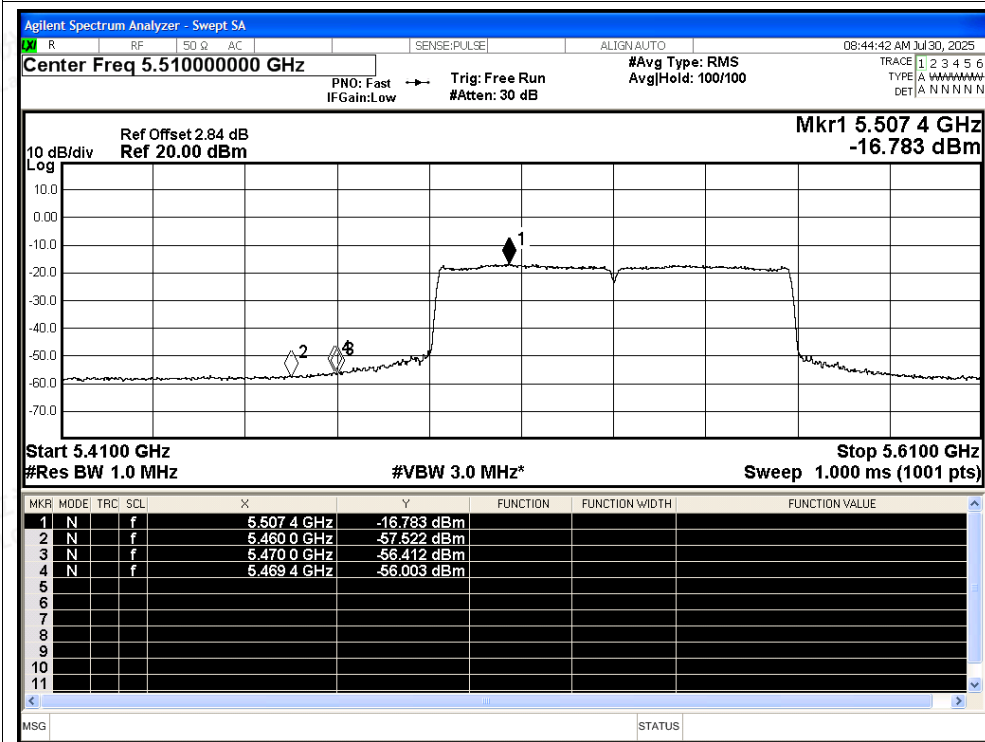

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz An1 Peak

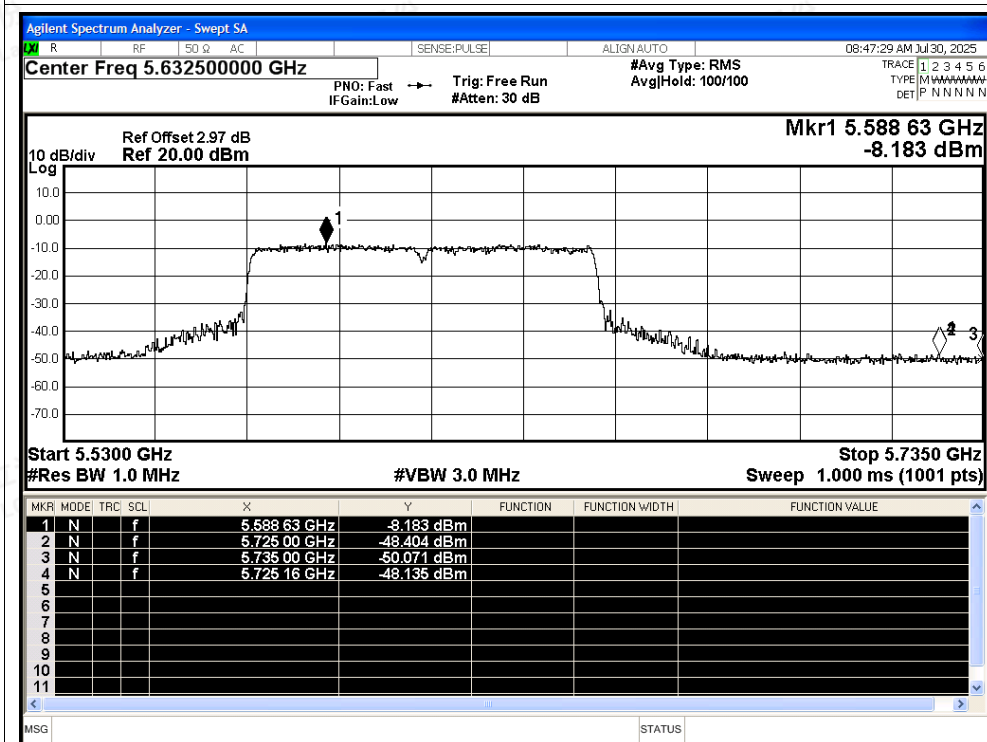

Restrict Band NVNT ac80 5610MHz An1 Average

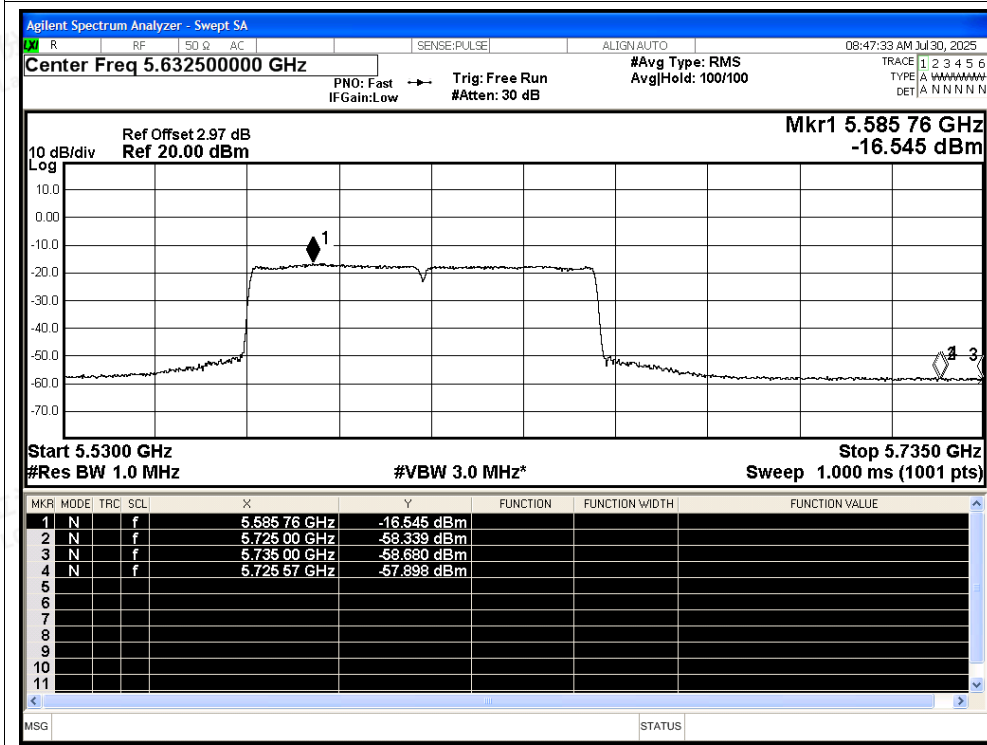

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	An2	5460	-48.07	5.1	-	52.26	Peak	68.2	Pass
NVNT	a	5500	An2	5460	-58.1	5.1	0.24	42.47	Average	54	Pass
NVNT	a	5500	An2	5465.8	-46.69	5.1	-	53.64	Peak	68.2	Pass
NVNT	a	5500	An2	5470	-56.48	5.1	0.24	44.09	Average	54	Pass
NVNT	a	5500	An2	5470	-48.29	5.1	-	52.04	Peak	68.2	Pass
NVNT	a	5500	An2	5470	-56.48	5.1	0.24	44.09	Average	54	Pass
NVNT	a	5700	An2	5725	-44.94	5.1	-	55.39	Peak	68.2	Pass
NVNT	a	5700	An2	5725	-56.27	5.1	0.24	44.30	Average	54	Pass
NVNT	a	5700	An2	5726.2	-40.59	5.1	-	59.74	Peak	68.2	Pass
NVNT	a	5700	An2	5725.4	-55.88	5.1	0.24	44.69	Average	54	Pass
NVNT	a	5700	An2	5735	-45.61	5.1	-	54.72	Peak	68.2	Pass
NVNT	a	5700	An2	5735	-57.48	5.1	0.24	43.09	Average	54	Pass
NVNT	n20	5500	An2	5460	-50	5.1	-	50.33	Peak	68.2	Pass
NVNT	n20	5500	An2	5460	-57.82	5.1	0.12	42.63	Average	54	Pass
NVNT	n20	5500	An2	5469.8	-42.37	5.1	-	57.96	Peak	68.2	Pass
NVNT	n20	5500	An2	5469.4	-56.24	5.1	0.12	44.21	Average	54	Pass
NVNT	n20	5500	An2	5470	-42.68	5.1	-	57.65	Peak	68.2	Pass
NVNT	n20	5500	An2	5470	-56.65	5.1	0.12	43.80	Average	54	Pass
NVNT	n20	5700	An2	5725	-42.18	5.1	-	58.15	Peak	68.2	Pass
NVNT	n20	5700	An2	5725	-54.87	5.1	0.12	45.58	Average	54	Pass
NVNT	n20	5700	An2	5725.4	-37.61	5.1	-	62.72	Peak	68.2	Pass
NVNT	n20	5700	An2	5726.4	-54.47	5.1	0.12	45.98	Average	54	Pass
NVNT	n20	5700	An2	5735	-50.96	5.1	-	49.37	Peak	68.2	Pass
NVNT	n20	5700	An2	5735	-57.73	5.1	0.12	42.72	Average	54	Pass
NVNT	n40	5510	An2	5460	-48.04	5.1	-	52.29	Peak	68.2	Pass
NVNT	n40	5510	An2	5460	-58.23	5.1	0.24	42.34	Average	54	Pass
NVNT	n40	5510	An2	5469.8	-40.08	5.1	-	60.25	Peak	68.2	Pass
NVNT	n40	5510	An2	5470	-55.98	5.1	0.24	44.59	Average	54	Pass
NVNT	n40	5510	An2	5470	-40.7	5.1	-	59.63	Peak	68.2	Pass
NVNT	n40	5510	An2	5470	-55.98	5.1	0.24	44.59	Average	54	Pass
NVNT	n40	5670	An2	5725	-48.42	5.1	-	51.91	Peak	68.2	Pass
NVNT	n40	5670	An2	5725	-58.29	5.1	0.24	42.28	Average	54	Pass
NVNT	n40	5670	An2	5726.4	-47.55	5.1	-	52.78	Peak	68.2	Pass
NVNT	n40	5670	An2	5726.8	-57.47	5.1	0.24	43.10	Average	54	Pass
NVNT	n40	5670	An2	5735	-48.16	5.1	-	52.17	Peak	68.2	Pass
NVNT	n40	5670	An2	5735	-58.3	5.1	0.24	42.27	Average	54	Pass
NVNT	ac20	5500	An2	5460	-50.05	5.1	-	50.28	Peak	68.2	Pass
NVNT	ac20	5500	An2	5460	-58.13	5.1	0.12	42.32	Average	54	Pass
NVNT	ac20	5500	An2	5469.4	-46.36	5.1	-	53.97	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	An2	5469	-56.17	5.1	0.12	44.28	Average	54	Pass
NVNT	ac20	5500	An2	5470	-47.07	5.1	-	53.26	Peak	68.2	Pass
NVNT	ac20	5500	An2	5470	-56.49	5.1	0.12	43.96	Average	54	Pass
NVNT	ac20	5700	An2	5725	-40.74	5.1	-	59.59	Peak	68.2	Pass
NVNT	ac20	5700	An2	5725	-53.94	5.1	0.12	46.51	Average	54	Pass
NVNT	ac20	5700	An2	5726.2	-39.71	5.1	-	60.62	Peak	68.2	Pass
NVNT	ac20	5700	An2	5725	-53.94	5.1	0.12	46.51	Average	54	Pass
NVNT	ac20	5700	An2	5735	-49.44	5.1	-	50.89	Peak	68.2	Pass
NVNT	ac20	5700	An2	5735	-57.5	5.1	0.12	42.95	Average	54	Pass
NVNT	ac40	5510	An2	5460	-50.24	5.1	-	50.09	Peak	68.2	Pass
NVNT	ac40	5510	An2	5460	-58.36	5.1	0.24	42.21	Average	54	Pass
NVNT	ac40	5510	An2	5468	-41.05	5.1	-	59.28	Peak	68.2	Pass
NVNT	ac40	5510	An2	5469.4	-56.36	5.1	0.24	44.21	Average	54	Pass
NVNT	ac40	5510	An2	5470	-46.66	5.1	-	53.67	Peak	68.2	Pass
NVNT	ac40	5510	An2	5470	-56.95	5.1	0.24	43.62	Average	54	Pass
NVNT	ac40	5670	An2	5725	-50.42	5.1	-	49.91	Peak	68.2	Pass
NVNT	ac40	5670	An2	5725	-57.74	5.1	0.24	42.83	Average	54	Pass
NVNT	ac40	5670	An2	5726.6	-46.79	5.1	-	53.54	Peak	68.2	Pass
NVNT	ac40	5670	An2	5726	-57.35	5.1	0.24	43.22	Average	54	Pass
NVNT	ac40	5670	An2	5735	-50.05	5.1	-	50.28	Peak	68.2	Pass
NVNT	ac40	5670	An2	5735	-58.01	5.1	0.24	42.56	Average	54	Pass
NVNT	ac80	5530	An2	5460	-49.59	5.1	-	50.74	Peak	68.2	Pass
NVNT	ac80	5530	An2	5460	-57.19	5.1	0.47	43.61	Average	54	Pass
NVNT	ac80	5530	An2	5466	-44.8	5.1	-	55.53	Peak	68.2	Pass
NVNT	ac80	5530	An2	5468.8	-56.17	5.1	0.47	44.63	Average	54	Pass
NVNT	ac80	5530	An2	5470	-46.63	5.1	-	53.70	Peak	68.2	Pass
NVNT	ac80	5530	An2	5470	-56.24	5.1	0.47	44.56	Average	54	Pass
NVNT	ac80	5610	An2	5725	-50.03	5.1	-	50.30	Peak	68.2	Pass
NVNT	ac80	5610	An2	5725	-57.64	5.1	0.47	43.16	Average	54	Pass
NVNT	ac80	5610	An2	5732.13	-47.83	5.1	-	52.50	Peak	68.2	Pass
NVNT	ac80	5610	An2	5727.825	-57.59	5.1	0.47	43.21	Average	54	Pass
NVNT	ac80	5610	An2	5735	-49.85	5.1	-	50.48	Peak	68.2	Pass
NVNT	ac80	5610	An2	5735	-58.09	5.1	0.47	42.71	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz An2 Peak

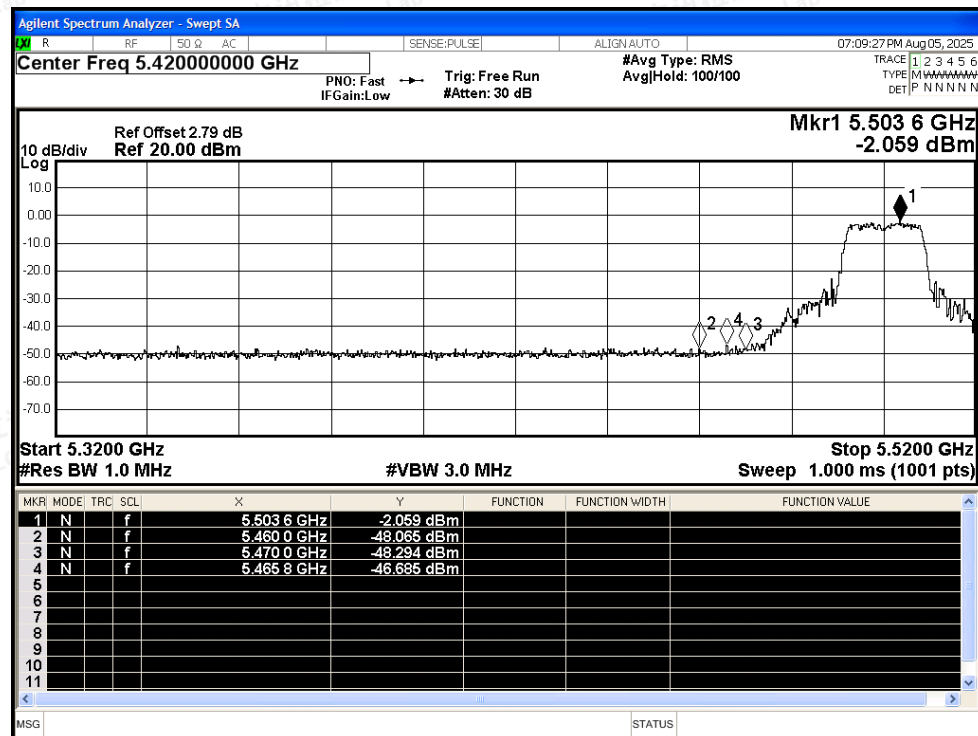

Restrict Band NVNT a 5500MHz An2 Average

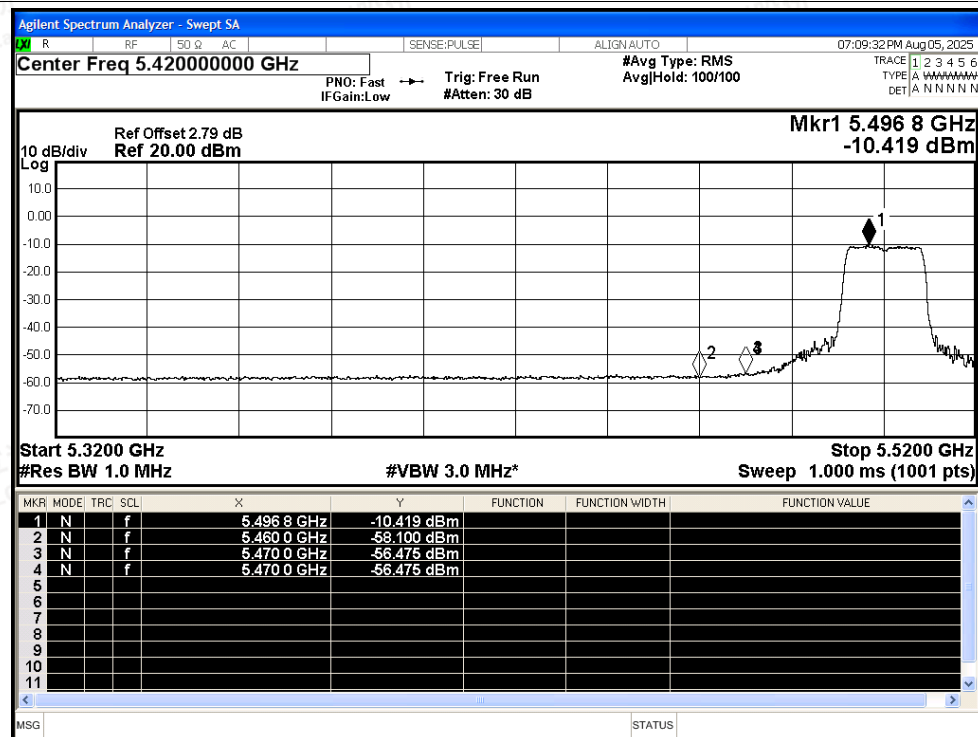

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz An2 Peak

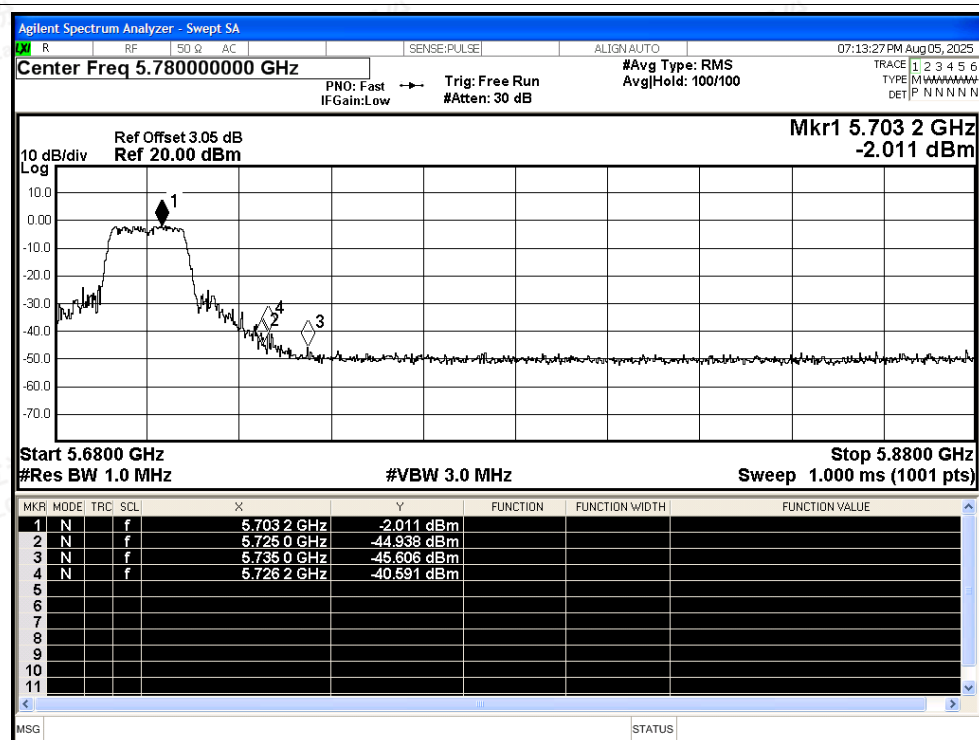

Restrict Band NVNT a 5700MHz An2 Average

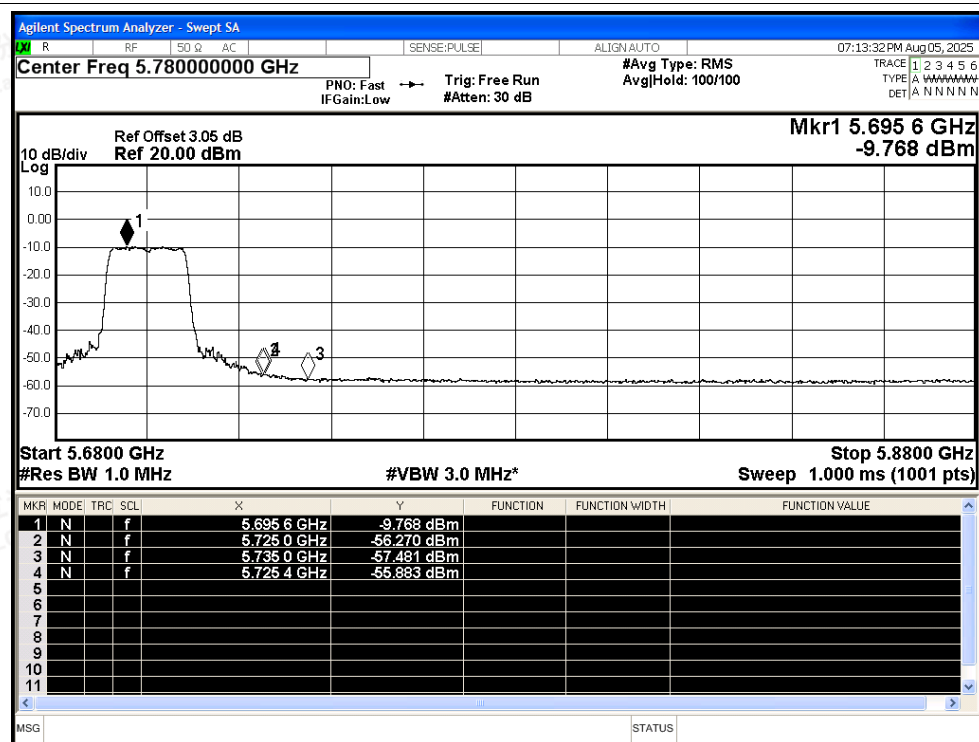

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz An2 Peak

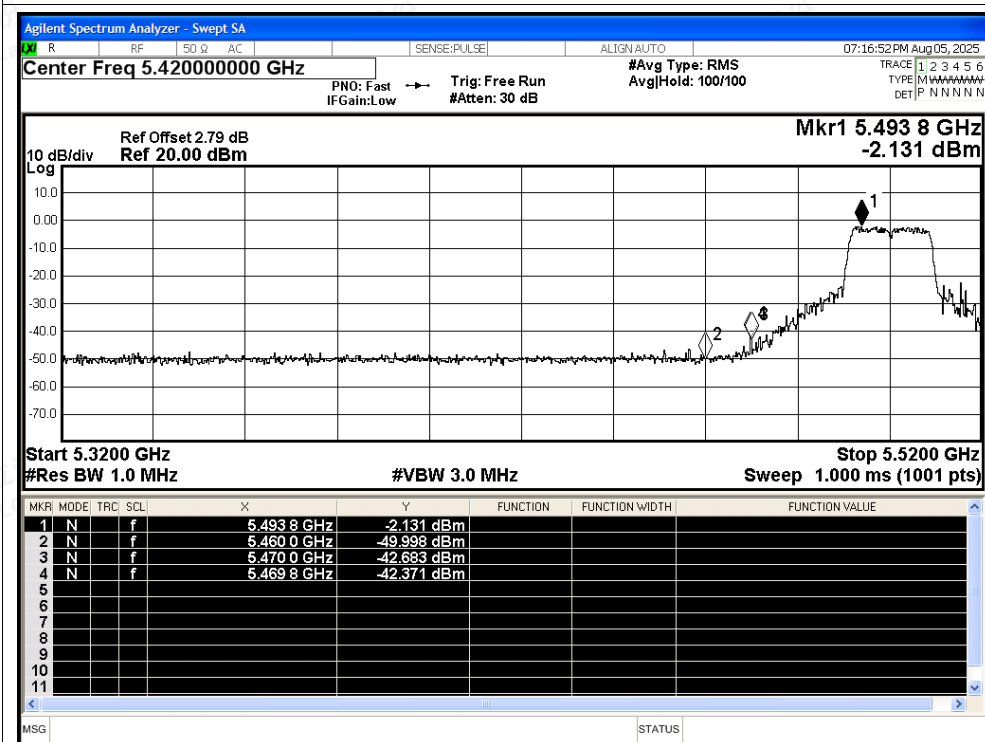

Restrict Band NVNT n20 5500MHz An2 Average

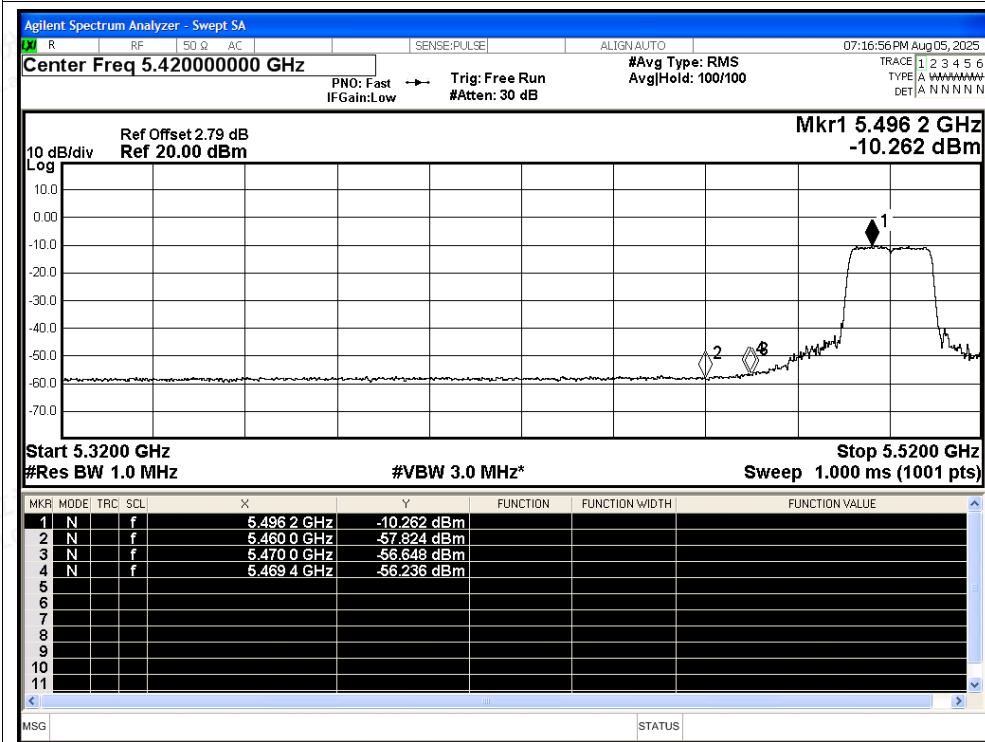

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz An2 Peak

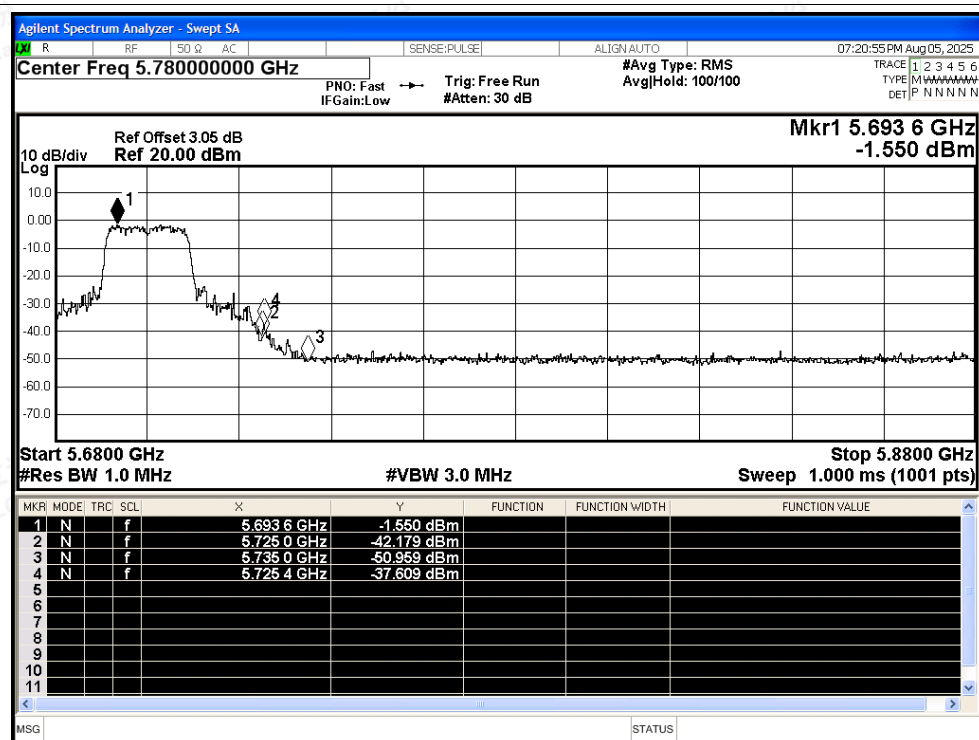

Restrict Band NVNT n20 5700MHz An2 Average

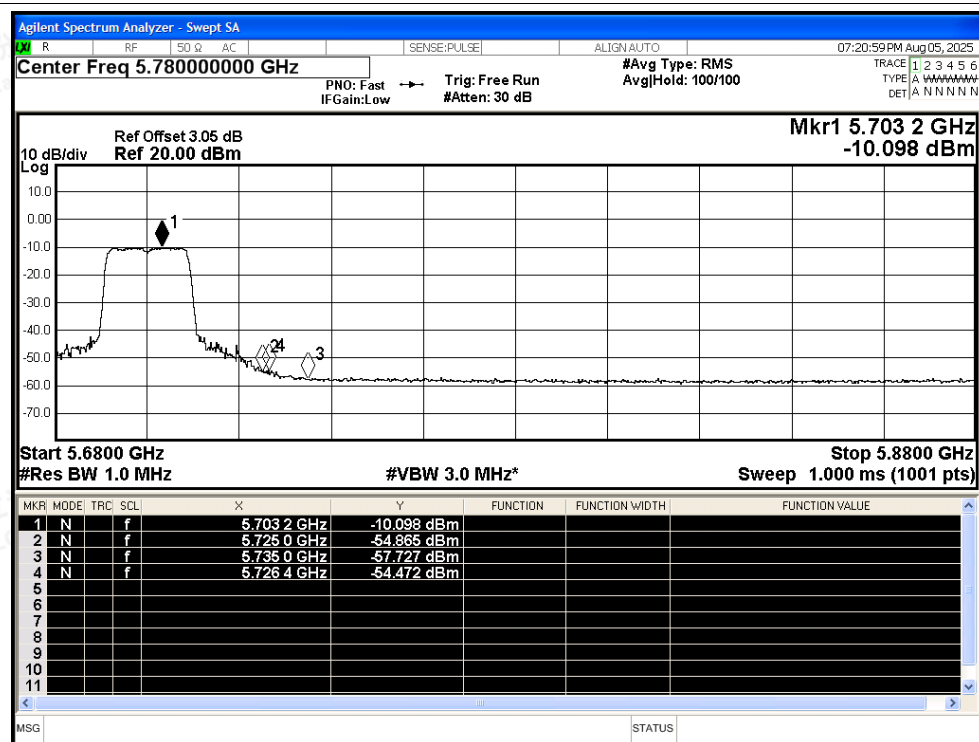

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz An2 Peak

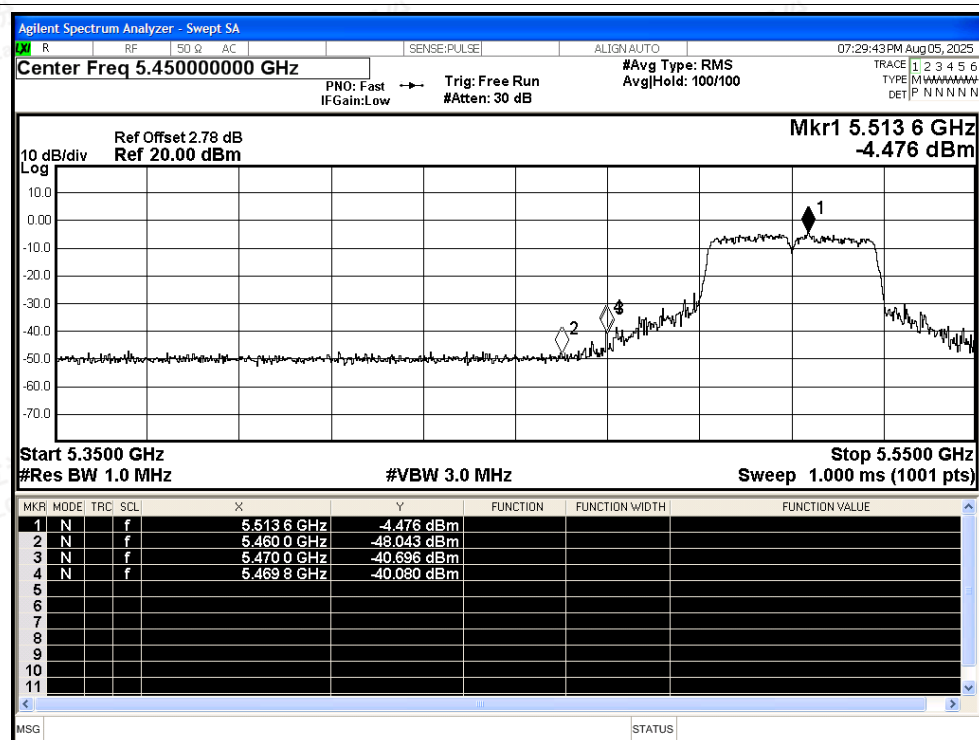

Restrict Band NVNT n40 5510MHz An2 Average

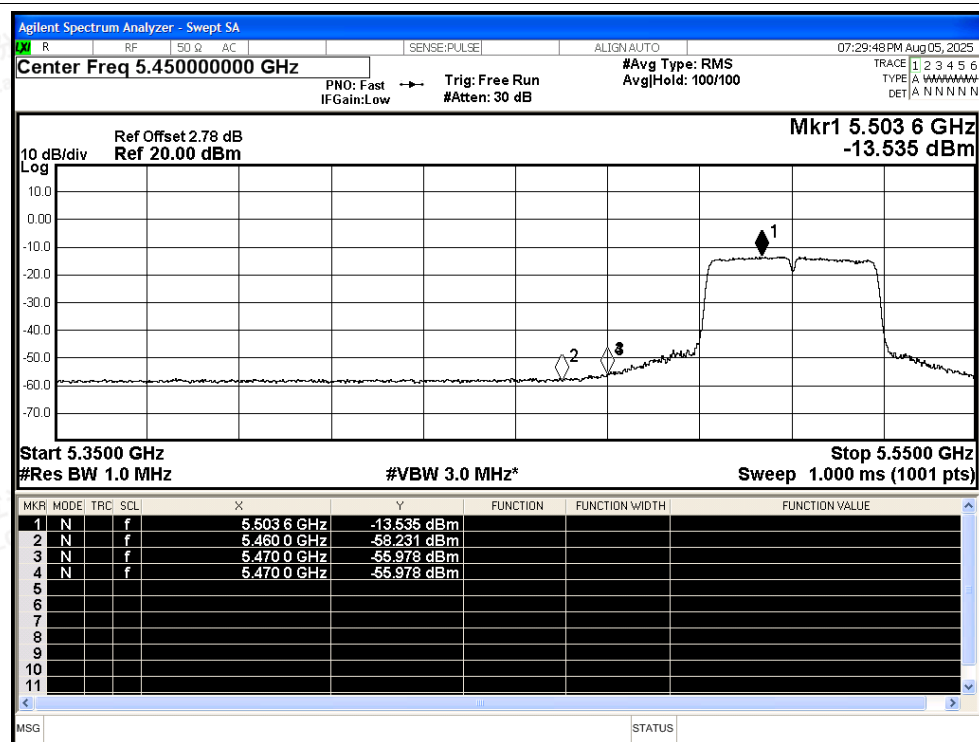

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz An2 Peak

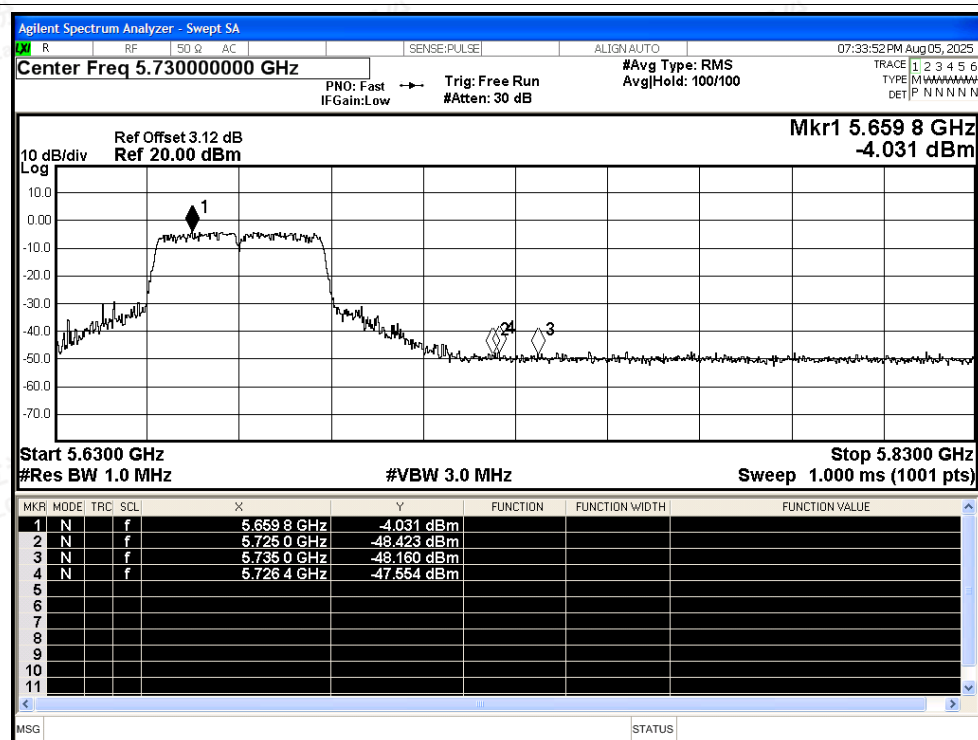

Restrict Band NVNT n40 5670MHz An2 Average

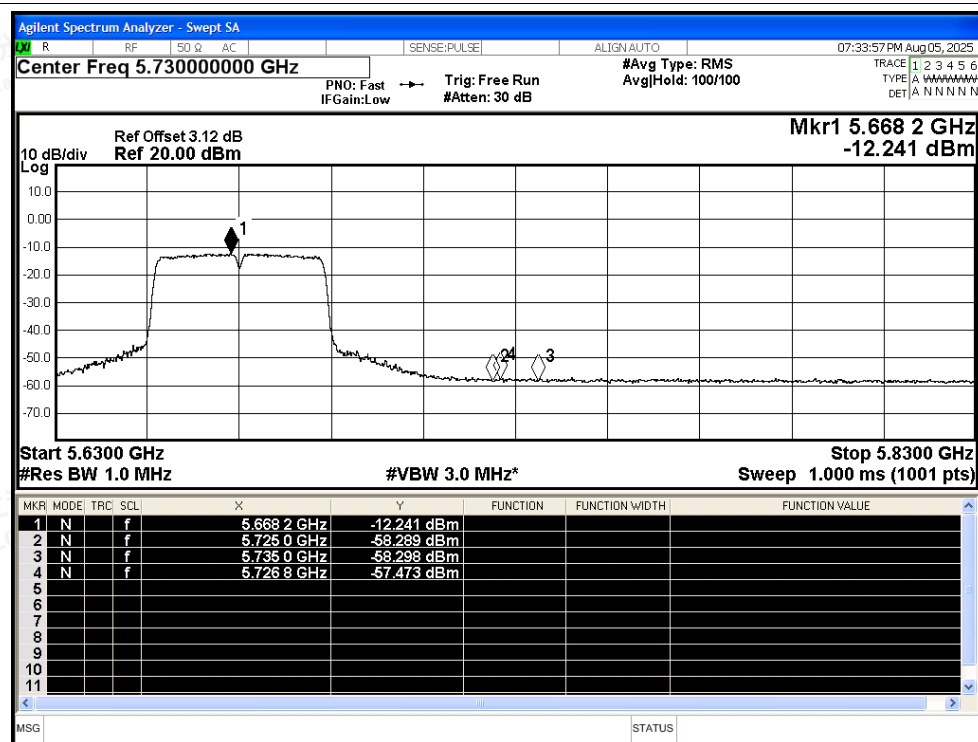

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz An2 Peak

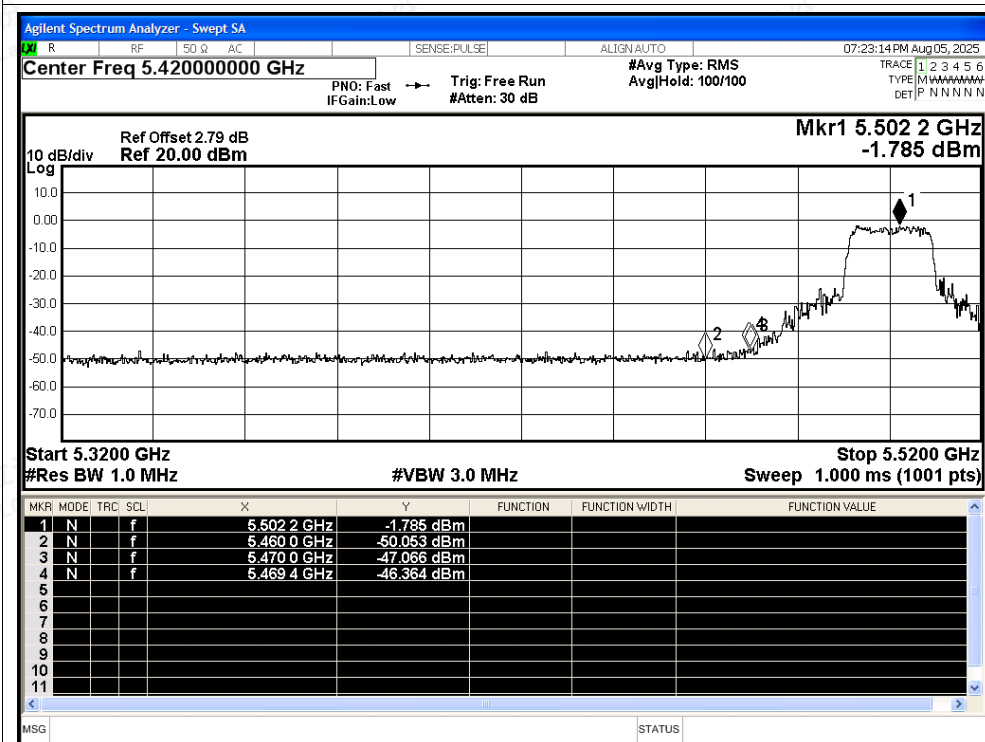

Restrict Band NVNT ac20 5500MHz An2 Average

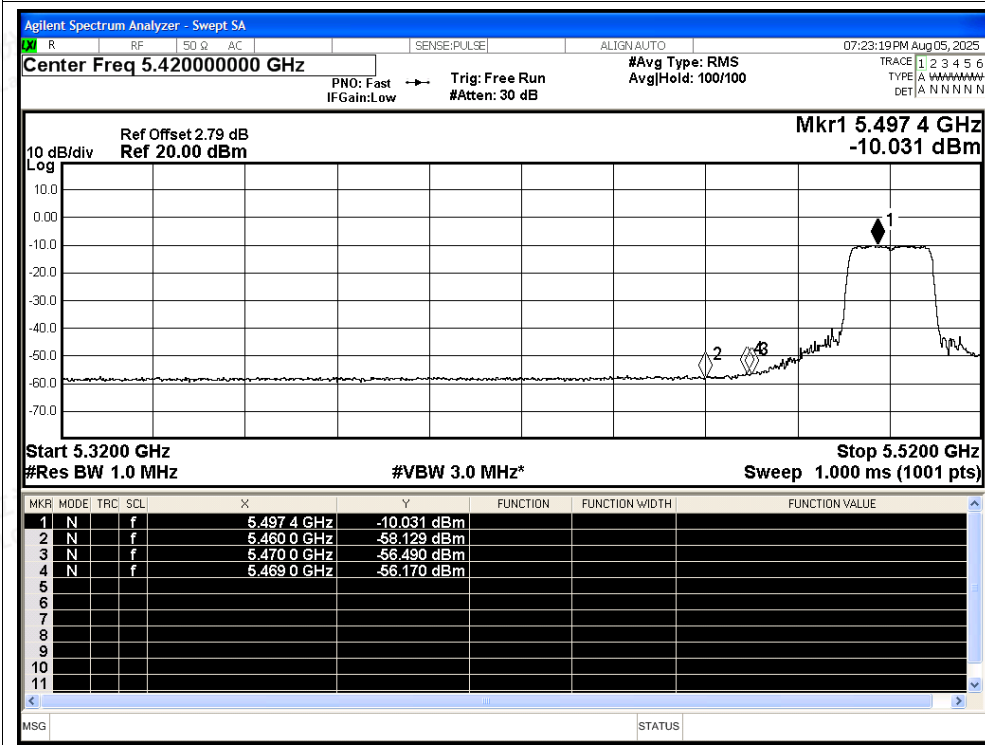

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz An2 Peak

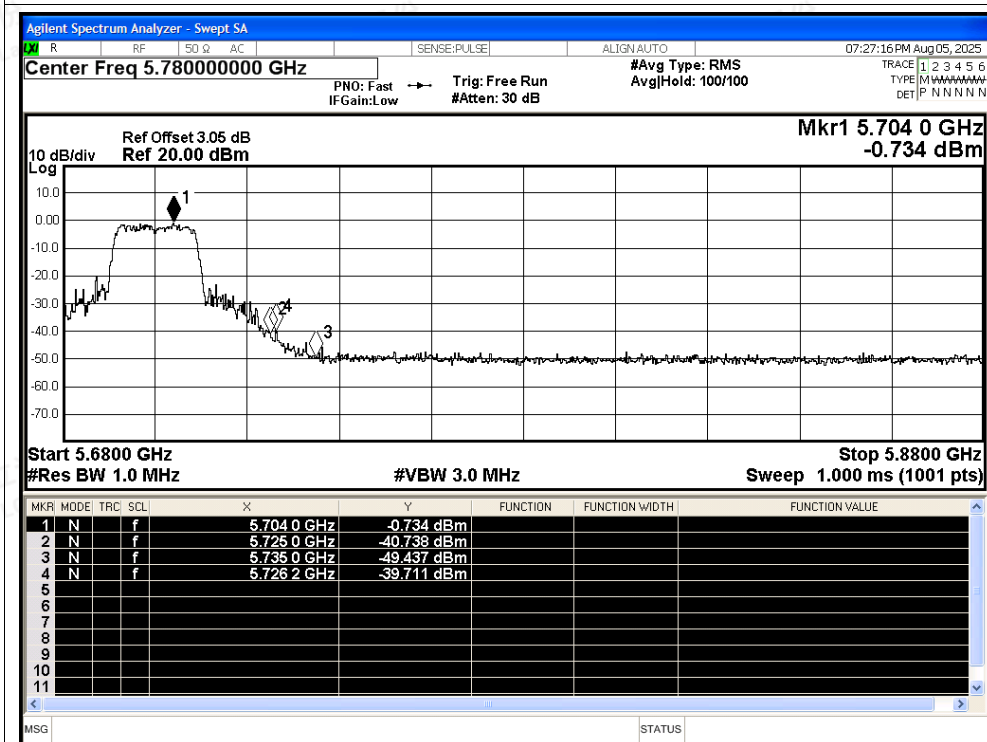

Restrict Band NVNT ac20 5700MHz An2 Average

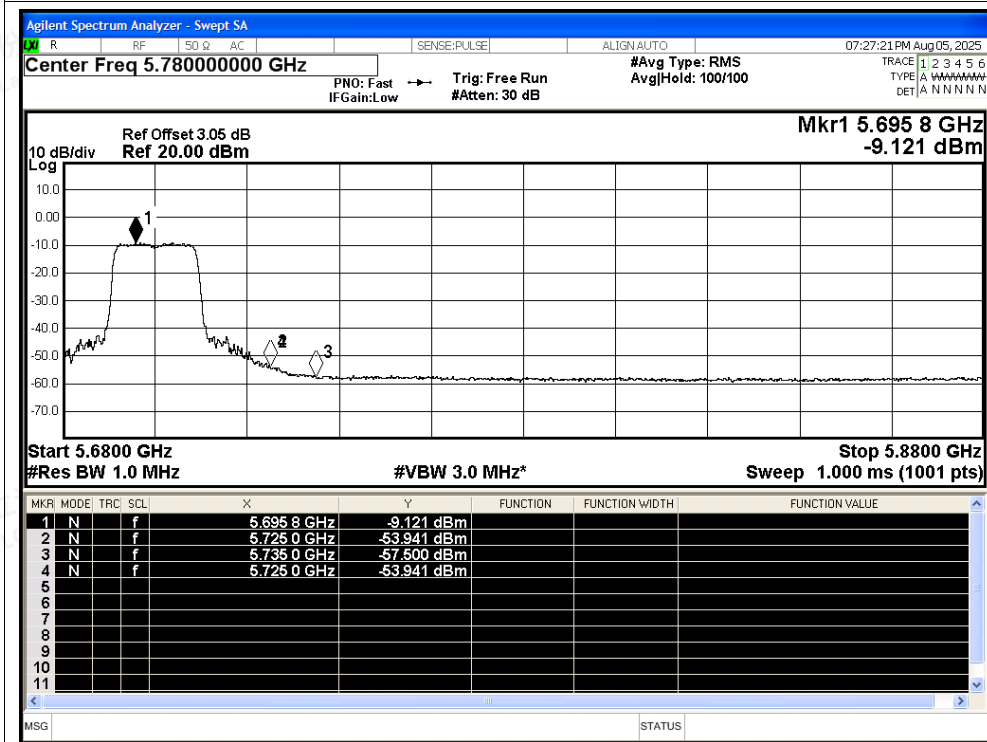


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

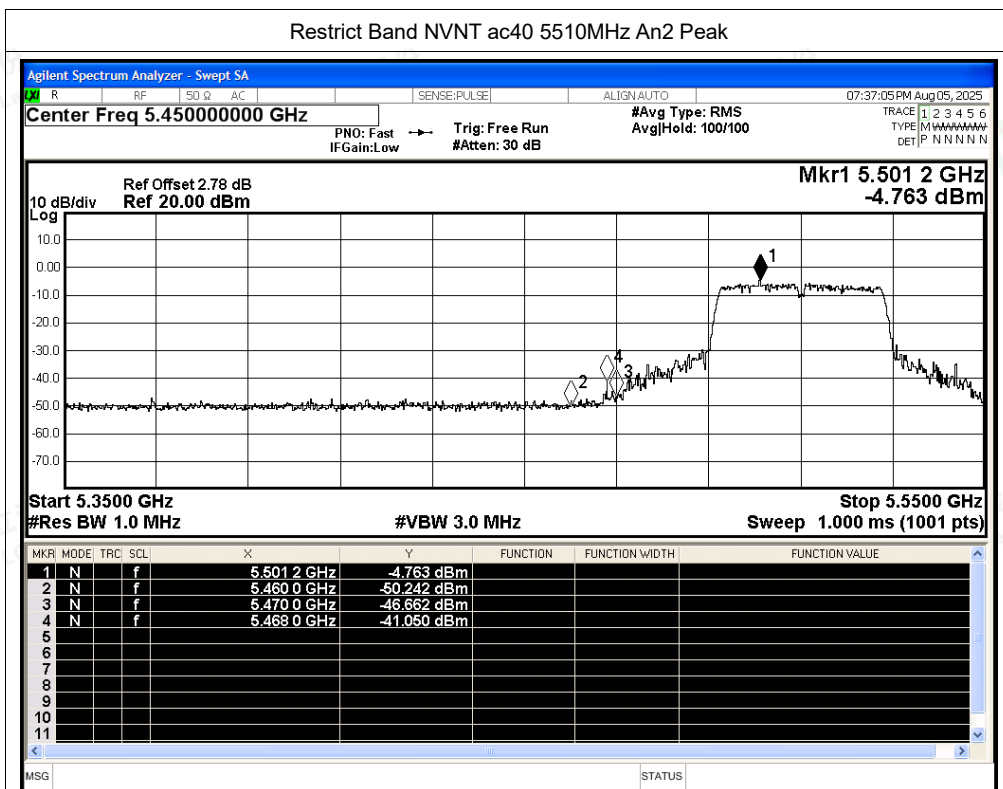

Restrict Band NVNT ac40 5510MHz An2 Average

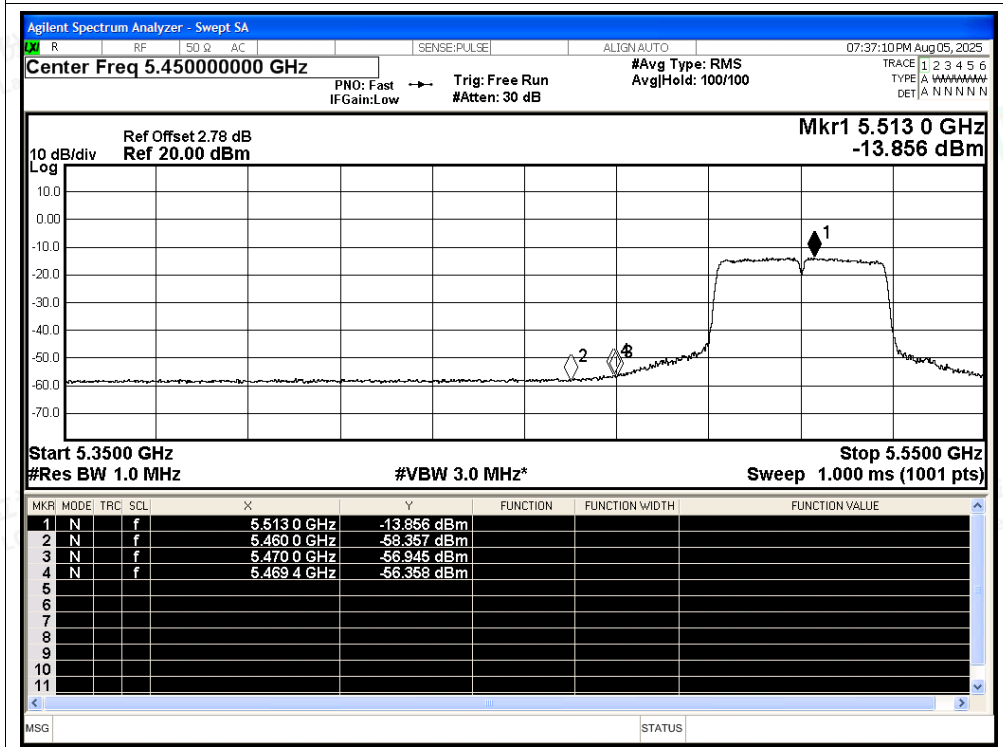

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz An2 Peak

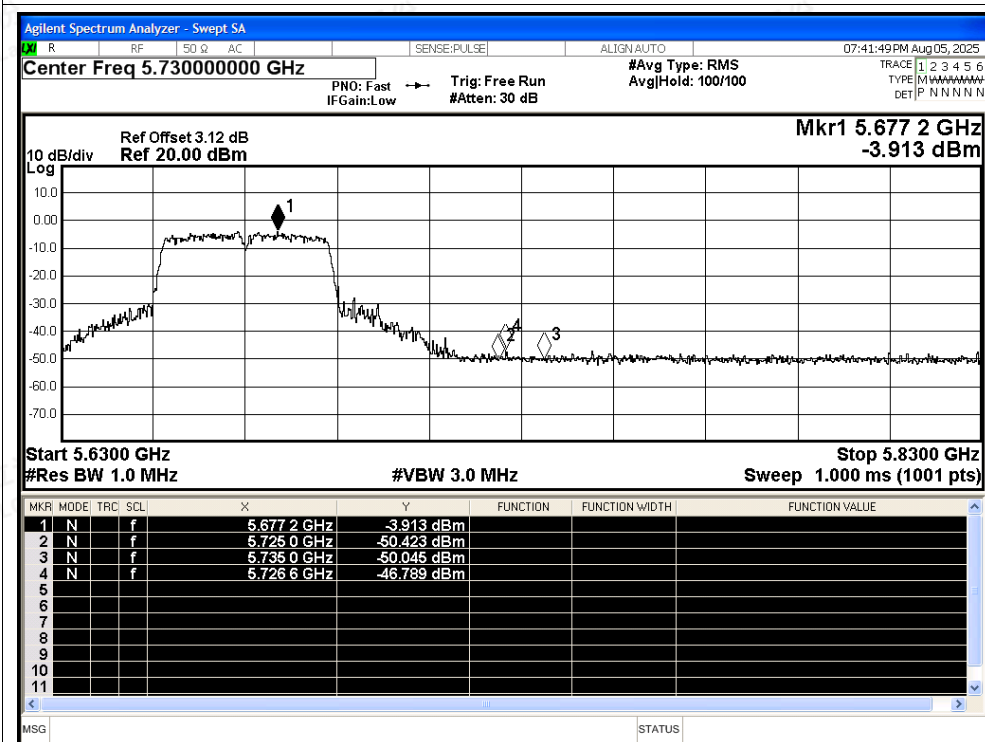

Restrict Band NVNT ac40 5670MHz An2 Average

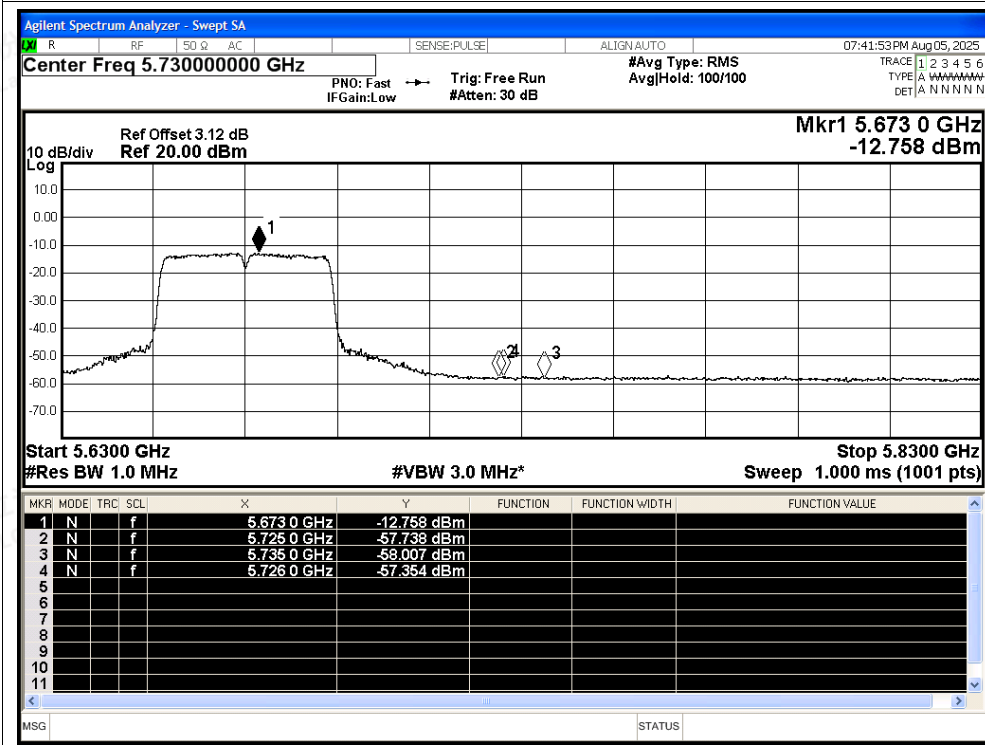

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz An2 Peak

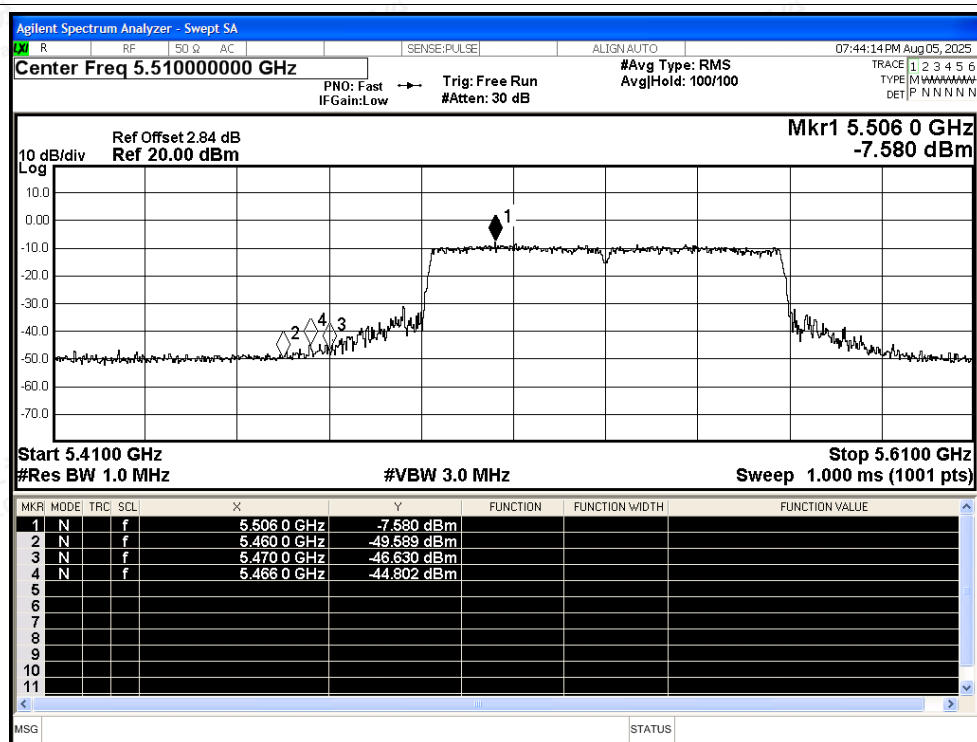

Restrict Band NVNT ac80 5530MHz An2 Average

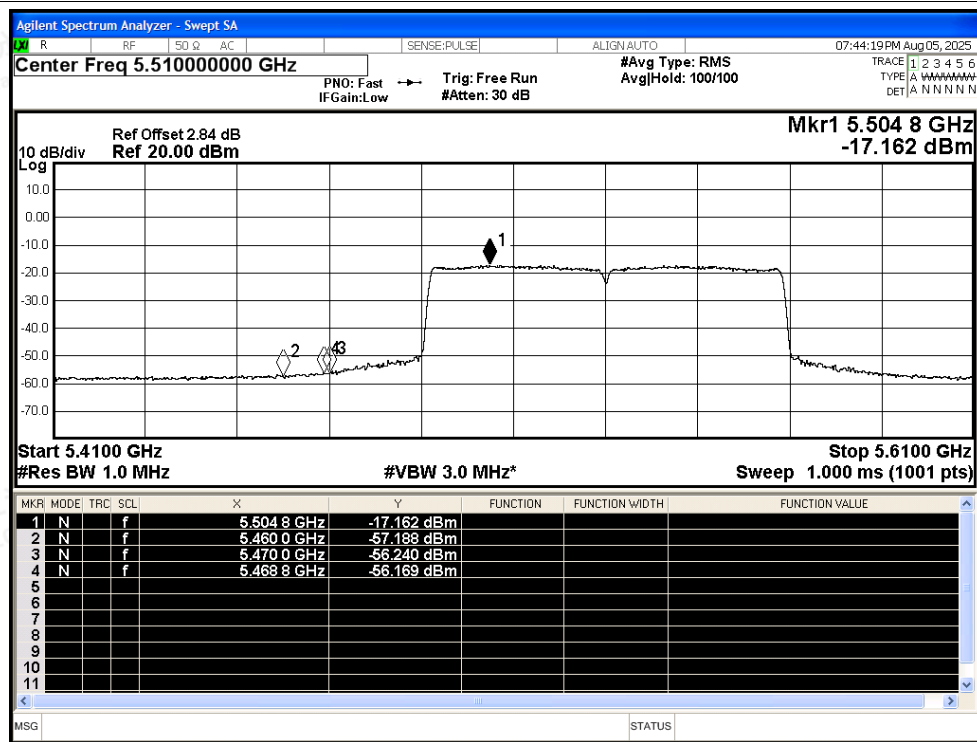

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz An2 Peak

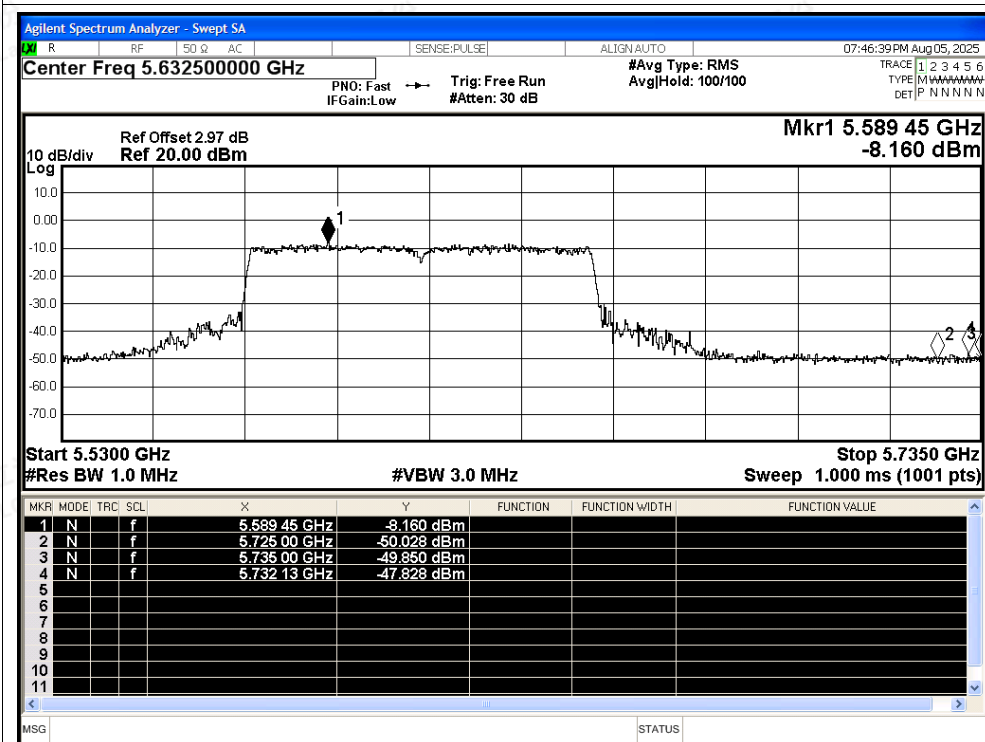

Restrict Band NVNT ac80 5610MHz An2 Average

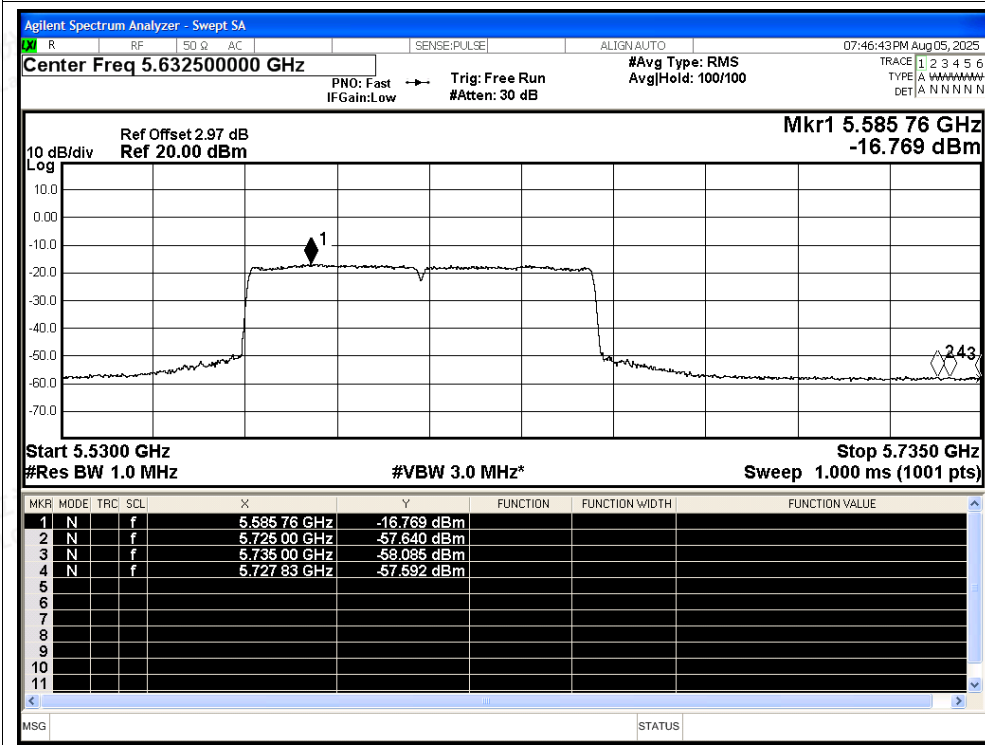

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	AN1 Power (dBm)	AN2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-48.37	-50	8.11	57.24	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.54	-57.82	8.11	48.67	Average	54	Pass
NVNT	n20	5500	5470	-44.14	-42.37	8.11	63.18	Peak	68.2	Pass
NVNT	n20	5500	5467.8	-56.69	-56.24	8.11	49.89	Average	54	Pass
NVNT	n20	5500	5470	-44.14	-42.68	8.11	63.00	Peak	68.2	Pass
NVNT	n20	5500	5470	-57.11	-56.65	8.11	49.47	Average	54	Pass
NVNT	n20	5700	5725	-41.23	-42.18	8.11	64.67	Peak	68.2	Pass
NVNT	n20	5700	5725	-55.02	-54.87	8.11	51.40	Average	54	Pass
NVNT	n20	5700	5729.2	-39.97	-37.61	8.11	67.72	Peak	68.2	Pass
NVNT	n20	5700	5725.4	-54.45	-54.47	8.11	51.89	Average	54	Pass
NVNT	n20	5700	5735	-47.26	-50.96	8.11	57.62	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.89	-57.73	8.11	48.54	Average	54	Pass
NVNT	n40	5510	5460	-49.29	-48.04	8.11	57.73	Peak	68.2	Pass
NVNT	n40	5510	5460	-58.22	-58.23	8.11	48.12	Average	54	Pass
NVNT	n40	5510	5468.8	-44.25	-40.08	8.11	64.67	Peak	68.2	Pass
NVNT	n40	5510	5469.6	-56.49	-55.98	8.11	50.12	Average	54	Pass
NVNT	n40	5510	5470	-47.47	-40.7	8.11	63.47	Peak	68.2	Pass
NVNT	n40	5510	5470	-56.62	-55.98	8.11	50.06	Average	54	Pass
NVNT	n40	5670	5725	-49.83	-48.42	8.11	57.28	Peak	68.2	Pass
NVNT	n40	5670	5725	-58.1	-58.29	8.11	48.15	Average	54	Pass
NVNT	n40	5670	5730.4	-46.66	-47.55	8.11	59.27	Peak	68.2	Pass
NVNT	n40	5670	5727.8	-57.29	-57.47	8.11	48.97	Average	54	Pass
NVNT	n40	5670	5735	-50.48	-48.16	8.11	57.18	Peak	68.2	Pass
NVNT	n40	5670	5735	-58.29	-58.3	8.11	48.05	Average	54	Pass
NVNT	ac20	5500	5460	-49.96	-50.05	8.11	56.34	Peak	68.2	Pass
NVNT	ac20	5500	5460	-58.69	-58.13	8.11	47.95	Average	54	Pass
NVNT	ac20	5500	5469.6	-45.41	-46.36	8.11	60.49	Peak	68.2	Pass
NVNT	ac20	5500	5469	-56.4	-56.17	8.11	50.06	Average	54	Pass
NVNT	ac20	5500	5470	-48.15	-47.07	8.11	58.77	Peak	68.2	Pass
NVNT	ac20	5500	5470	-57.1	-56.49	8.11	49.56	Average	54	Pass
NVNT	ac20	5700	5725	-37.26	-40.74	8.11	67.69	Peak	68.2	Pass
NVNT	ac20	5700	5725	-53.77	-53.94	8.11	52.49	Average	54	Pass
NVNT	ac20	5700	5727	-48.95	-39.71	8.11	64.12	Peak	68.2	Pass
NVNT	ac20	5700	5726	-57.65	-53.94	8.11	50.94	Average	54	Pass
NVNT	ac20	5700	5735	-48.95	-49.44	8.11	57.16	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.65	-57.5	8.11	48.77	Average	54	Pass
NVNT	ac40	5510	5460	-49.69	-50.24	8.11	56.39	Peak	68.2	Pass
NVNT	ac40	5510	5460	-58.59	-58.36	8.11	47.87	Average	54	Pass
NVNT	ac40	5510	5469.6	-45.57	-41.05	8.11	63.60	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5469.6	-56.59	-56.36	8.11	49.87	Average	54	Pass
NVNT	ac40	5510	5470	-45.94	-46.66	8.11	60.06	Peak	68.2	Pass
NVNT	ac40	5510	5470	-56.59	-56.95	8.11	49.58	Average	54	Pass
NVNT	ac40	5670	5725	-47.6	-50.42	8.11	57.56	Peak	68.2	Pass
NVNT	ac40	5670	5725	-58.58	-57.74	8.11	48.21	Average	54	Pass
NVNT	ac40	5670	5730.6	-47.21	-46.79	8.11	59.35	Peak	68.2	Pass
NVNT	ac40	5670	5725.2	-57.65	-57.35	8.11	48.85	Average	54	Pass
NVNT	ac40	5670	5735	-48.27	-50.05	8.11	57.28	Peak	68.2	Pass
NVNT	ac40	5670	5735	-58.33	-58.01	8.11	48.18	Average	54	Pass
NVNT	ac80	5530	5460	-48.35	-49.59	8.11	57.42	Peak	68.2	Pass
NVNT	ac80	5530	5460	-57.52	-57.19	8.11	49.00	Average	54	Pass
NVNT	ac80	5530	5467.4	-44.39	-44.8	8.11	61.76	Peak	68.2	Pass
NVNT	ac80	5530	5470	-56	-56.17	8.11	50.26	Average	54	Pass
NVNT	ac80	5530	5470	-45.15	-46.63	8.11	60.52	Peak	68.2	Pass
NVNT	ac80	5530	5470	-56.41	-56.24	8.11	50.02	Average	54	Pass
NVNT	ac80	5610	5725	-48.4	-50.03	8.11	57.21	Peak	68.2	Pass
NVNT	ac80	5610	5725	-58.34	-57.64	8.11	48.37	Average	54	Pass
NVNT	ac80	5610	5725.16	-48.14	-47.83	8.11	58.37	Peak	68.2	Pass
NVNT	ac80	5610	5729.875	-57.9	-57.59	8.11	48.61	Average	54	Pass
NVNT	ac80	5610	5735	-50.07	-49.85	8.11	56.39	Peak	68.2	Pass
NVNT	ac80	5610	5735	-58.68	-58.09	8.11	47.97	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	An3	5460	-49.47	5.1	-	50.86	Peak	68.2	Pass
NVNT	a	5500	An3	5460	-56.94	5.1	0.24	43.63	Average	54	Pass
NVNT	a	5500	An3	5467	-45.91	5.1	-	54.42	Peak	68.2	Pass
NVNT	a	5500	An3	5460.2	-56.77	5.1	0.24	43.80	Average	54	Pass
NVNT	a	5500	An3	5470	-47.83	5.1	-	52.50	Peak	68.2	Pass
NVNT	a	5500	An3	5470	-57.21	5.1	0.24	43.36	Average	54	Pass
NVNT	a	5700	An3	5725	-44.49	5.1	-	55.84	Peak	68.2	Pass
NVNT	a	5700	An3	5725	-56.26	5.1	0.24	44.31	Average	54	Pass
NVNT	a	5700	An3	5725.8	-40.76	5.1	-	59.57	Peak	68.2	Pass
NVNT	a	5700	An3	5725.6	-55.44	5.1	0.24	45.13	Average	54	Pass
NVNT	a	5700	An3	5735	-48.96	5.1	-	51.37	Peak	68.2	Pass
NVNT	a	5700	An3	5735	-57.1	5.1	0.24	43.47	Average	54	Pass
NVNT	n20	5500	An3	5460	-49.77	5.1	-	50.56	Peak	68.2	Pass
NVNT	n20	5500	An3	5460	-57.9	5.1	0.12	42.55	Average	54	Pass
NVNT	n20	5500	An3	5470	-44.25	5.1	-	56.08	Peak	68.2	Pass
NVNT	n20	5500	An3	5469.8	-56.07	5.1	0.12	44.38	Average	54	Pass
NVNT	n20	5500	An3	5470	-44.25	5.1	-	56.08	Peak	68.2	Pass
NVNT	n20	5500	An3	5470	-56.37	5.1	0.12	44.08	Average	54	Pass
NVNT	n20	5700	An3	5725	-41.11	5.1	-	59.22	Peak	68.2	Pass
NVNT	n20	5700	An3	5725	-54.68	5.1	0.12	45.77	Average	54	Pass
NVNT	n20	5700	An3	5725.6	-37.87	5.1	-	62.46	Peak	68.2	Pass
NVNT	n20	5700	An3	5725.2	-54.37	5.1	0.12	46.08	Average	54	Pass
NVNT	n20	5700	An3	5735	-47.47	5.1	-	52.86	Peak	68.2	Pass
NVNT	n20	5700	An3	5735	-57.12	5.1	0.12	43.33	Average	54	Pass
NVNT	n40	5510	An3	5460	-48.4	5.1	-	51.93	Peak	68.2	Pass
NVNT	n40	5510	An3	5460	-57.32	5.1	0.23	43.24	Average	54	Pass
NVNT	n40	5510	An3	5465.8	-45.64	5.1	-	54.69	Peak	68.2	Pass
NVNT	n40	5510	An3	5470	-55.46	5.1	0.23	45.10	Average	54	Pass
NVNT	n40	5510	An3	5470	-48.09	5.1	-	52.24	Peak	68.2	Pass
NVNT	n40	5510	An3	5470	-55.46	5.1	0.23	45.10	Average	54	Pass
NVNT	n40	5670	An3	5725	-49.42	5.1	-	50.91	Peak	68.2	Pass
NVNT	n40	5670	An3	5725	-57.27	5.1	0.24	43.30	Average	54	Pass
NVNT	n40	5670	An3	5728.4	-47.42	5.1	-	52.91	Peak	68.2	Pass
NVNT	n40	5670	An3	5729.8	-56.98	5.1	0.24	43.59	Average	54	Pass
NVNT	n40	5670	An3	5735	-48.83	5.1	-	51.50	Peak	68.2	Pass
NVNT	n40	5670	An3	5735	-57.8	5.1	0.24	42.77	Average	54	Pass
NVNT	ac20	5500	An3	5460	-51.25	5.1	-	49.08	Peak	68.2	Pass
NVNT	ac20	5500	An3	5460	-57.96	5.1	0.12	42.49	Average	54	Pass
NVNT	ac20	5500	An3	5469	-45.28	5.1	-	55.05	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	An3	5469.8	-56.22	5.1	0.12	44.23	Average	54	Pass
NVNT	ac20	5500	An3	5470	-47.05	5.1	-	53.28	Peak	68.2	Pass
NVNT	ac20	5500	An3	5470	-57.03	5.1	0.12	43.42	Average	54	Pass
NVNT	ac20	5700	An3	5725	-41.08	5.1	-	59.25	Peak	68.2	Pass
NVNT	ac20	5700	An3	5725	-54.01	5.1	0.12	46.44	Average	54	Pass
NVNT	ac20	5700	An3	5725	-41.08	5.1	-	59.25	Peak	68.2	Pass
NVNT	ac20	5700	An3	5725.6	-53.83	5.1	0.12	46.62	Average	54	Pass
NVNT	ac20	5700	An3	5735	-49.16	5.1	-	51.17	Peak	68.2	Pass
NVNT	ac20	5700	An3	5735	-57.54	5.1	0.12	42.91	Average	54	Pass
NVNT	ac40	5510	An3	5460	-49.44	5.1	-	50.89	Peak	68.2	Pass
NVNT	ac40	5510	An3	5460	-57.27	5.1	0.24	43.30	Average	54	Pass
NVNT	ac40	5510	An3	5469.8	-38.64	5.1	-	61.69	Peak	68.2	Pass
NVNT	ac40	5510	An3	5469.8	-55.52	5.1	0.24	45.05	Average	54	Pass
NVNT	ac40	5510	An3	5470	-45.77	5.1	-	54.56	Peak	68.2	Pass
NVNT	ac40	5510	An3	5470	-56.11	5.1	0.24	44.46	Average	54	Pass
NVNT	ac40	5670	An3	5725	-50.67	5.1	-	49.66	Peak	68.2	Pass
NVNT	ac40	5670	An3	5725	-57.12	5.1	0.24	43.45	Average	54	Pass
NVNT	ac40	5670	An3	5733.8	-47.62	5.1	-	52.71	Peak	68.2	Pass
NVNT	ac40	5670	An3	5729.2	-57.01	5.1	0.24	43.56	Average	54	Pass
NVNT	ac40	5670	An3	5735	-49.93	5.1	-	50.40	Peak	68.2	Pass
NVNT	ac40	5670	An3	5735	-57.54	5.1	0.24	43.03	Average	54	Pass
NVNT	ac80	5530	An3	5460	-49.29	5.1	-	51.04	Peak	68.2	Pass
NVNT	ac80	5530	An3	5460	-57.22	5.1	0.47	43.58	Average	54	Pass
NVNT	ac80	5530	An3	5466.8	-43.61	5.1	-	56.72	Peak	68.2	Pass
NVNT	ac80	5530	An3	5467.8	-55.63	5.1	0.47	45.17	Average	54	Pass
NVNT	ac80	5530	An3	5470	-45.22	5.1	-	55.11	Peak	68.2	Pass
NVNT	ac80	5530	An3	5470	-56.14	5.1	0.47	44.66	Average	54	Pass
NVNT	ac80	5610	An3	5725	-49.5	5.1	-	50.83	Peak	68.2	Pass
NVNT	ac80	5610	An3	5725	-57.29	5.1	0.47	43.51	Average	54	Pass
NVNT	ac80	5610	An3	5725.16	-48.2	5.1	-	52.13	Peak	68.2	Pass
NVNT	ac80	5610	An3	5725.365	-57.06	5.1	0.47	43.74	Average	54	Pass
NVNT	ac80	5610	An3	5735	-48.8	5.1	-	51.53	Peak	68.2	Pass
NVNT	ac80	5610	An3	5735	-57.56	5.1	0.47	43.24	Average	54	Pass
NVNT	ax20	5500	An3	5460	-49.04	5.1	-	51.29	Peak	68.2	Pass
NVNT	ax20	5500	An3	5460	-57.3	5.1	0.12	43.15	Average	54	Pass
NVNT	ax20	5500	An3	5467.6	-45.54	5.1	-	54.79	Peak	68.2	Pass
NVNT	ax20	5500	An3	5468.2	-56.21	5.1	0.12	44.24	Average	54	Pass
NVNT	ax20	5500	An3	5470	-46.16	5.1	-	54.17	Peak	68.2	Pass
NVNT	ax20	5500	An3	5470	-56.67	5.1	0.12	43.78	Average	54	Pass
NVNT	ax20	5700	An3	5725	-41.31	5.1	-	59.02	Peak	68.2	Pass
NVNT	ax20	5700	An3	5725	-54.54	5.1	0.12	45.91	Average	54	Pass
NVNT	ax20	5700	An3	5725.4	-40.56	5.1	-	59.77	Peak	68.2	Pass
NVNT	ax20	5700	An3	5725	-54.54	5.1	0.12	45.91	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	An3	5735	-48.36	5.1	-	51.97	Peak	68.2	Pass
NVNT	ax20	5700	An3	5735	-57.18	5.1	0.12	43.27	Average	54	Pass
NVNT	ax40	5510	An3	5460	-49.17	5.1	-	51.16	Peak	68.2	Pass
NVNT	ax40	5510	An3	5460	-57.77	5.1	0.24	42.80	Average	54	Pass
NVNT	ax40	5510	An3	5468.2	-43.85	5.1	-	56.48	Peak	68.2	Pass
NVNT	ax40	5510	An3	5469.8	-55.47	5.1	0.24	45.10	Average	54	Pass
NVNT	ax40	5510	An3	5470	-47.14	5.1	-	53.19	Peak	68.2	Pass
NVNT	ax40	5510	An3	5470	-56.26	5.1	0.24	44.31	Average	54	Pass
NVNT	ax40	5670	An3	5725	-49.71	5.1	-	50.62	Peak	68.2	Pass
NVNT	ax40	5670	An3	5725	-57.47	5.1	0.24	43.10	Average	54	Pass
NVNT	ax40	5670	An3	5732	-47.94	5.1	-	52.39	Peak	68.2	Pass
NVNT	ax40	5670	An3	5726.4	-56.35	5.1	0.24	44.22	Average	54	Pass
NVNT	ax40	5670	An3	5735	-48.33	5.1	-	52.00	Peak	68.2	Pass
NVNT	ax40	5670	An3	5735	-57.49	5.1	0.24	43.08	Average	54	Pass
NVNT	ax80	5530	An3	5460	-49.52	5.1	-	50.81	Peak	68.2	Pass
NVNT	ax80	5530	An3	5460	-56.94	5.1	0.47	43.86	Average	54	Pass
NVNT	ax80	5530	An3	5469.8	-43.61	5.1	-	56.72	Peak	68.2	Pass
NVNT	ax80	5530	An3	5469.6	-55.4	5.1	0.47	45.40	Average	54	Pass
NVNT	ax80	5530	An3	5470	-47.65	5.1	-	52.68	Peak	68.2	Pass
NVNT	ax80	5530	An3	5470	-56.39	5.1	0.47	44.41	Average	54	Pass
NVNT	ax80	5610	An3	5725	-48.84	5.1	-	51.49	Peak	68.2	Pass
NVNT	ax80	5610	An3	5725	-57.37	5.1	0.47	43.43	Average	54	Pass
NVNT	ax80	5610	An3	5732.95	-47.52	5.1	-	52.81	Peak	68.2	Pass
NVNT	ax80	5610	An3	5733.77	-57.04	5.1	0.47	43.76	Average	54	Pass
NVNT	ax80	5610	An3	5735	-50.18	5.1	-	50.15	Peak	68.2	Pass
NVNT	ax80	5610	An3	5735	-57.57	5.1	0.47	43.23	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz An3 Peak

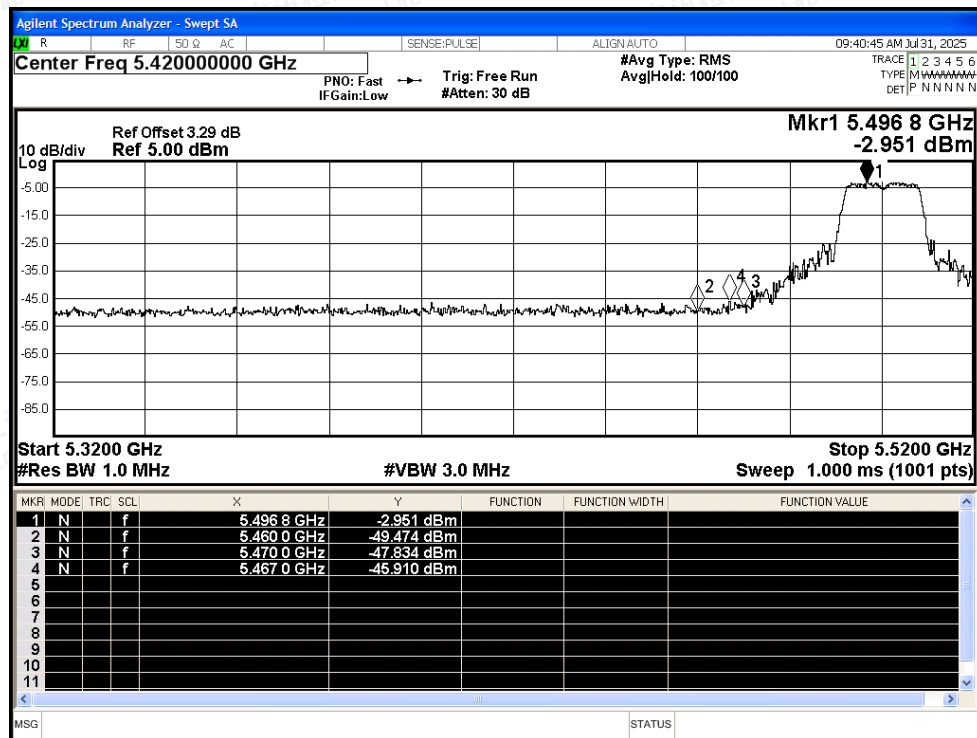

Restrict Band NVNT a 5500MHz An3 Average

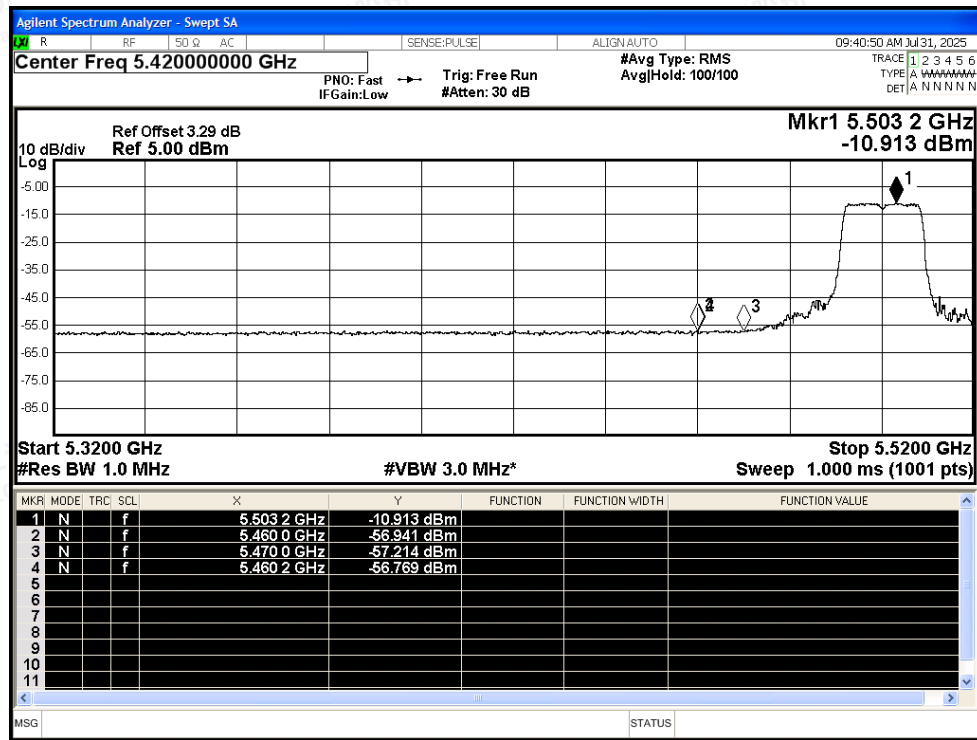

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz An3 Peak

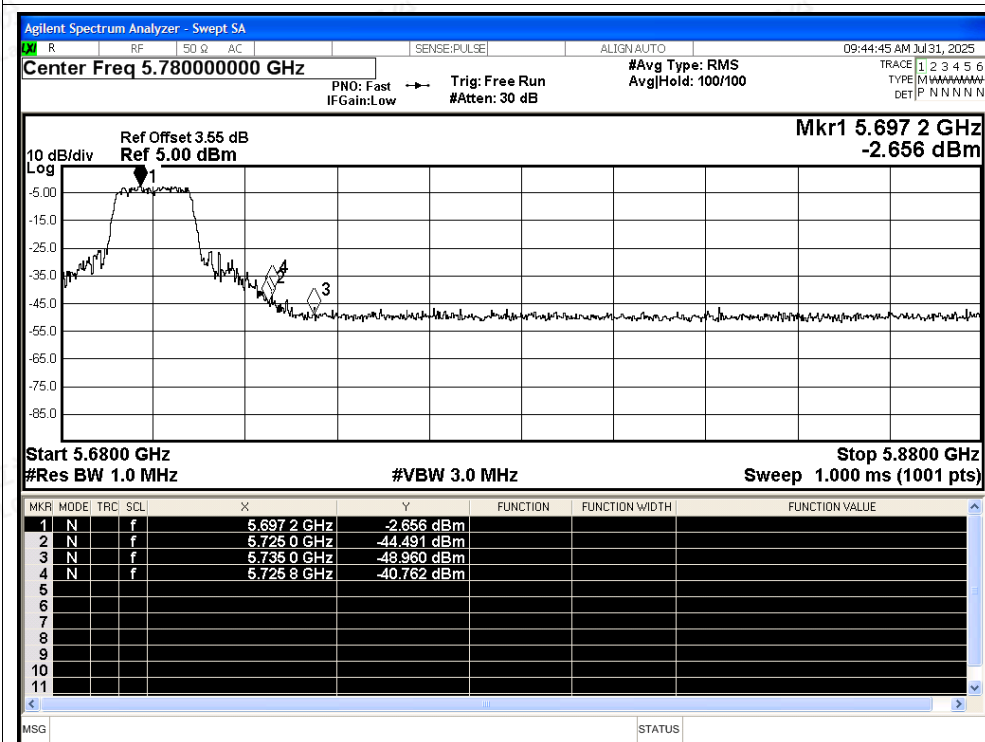

Restrict Band NVNT a 5700MHz An3 Average

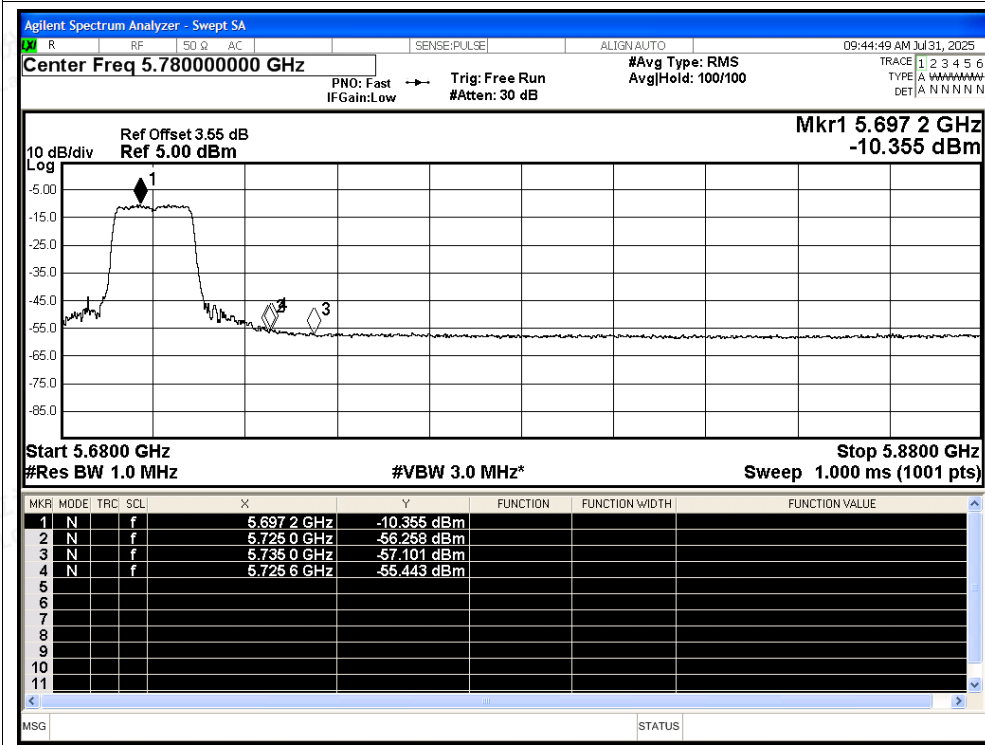

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz An3 Peak

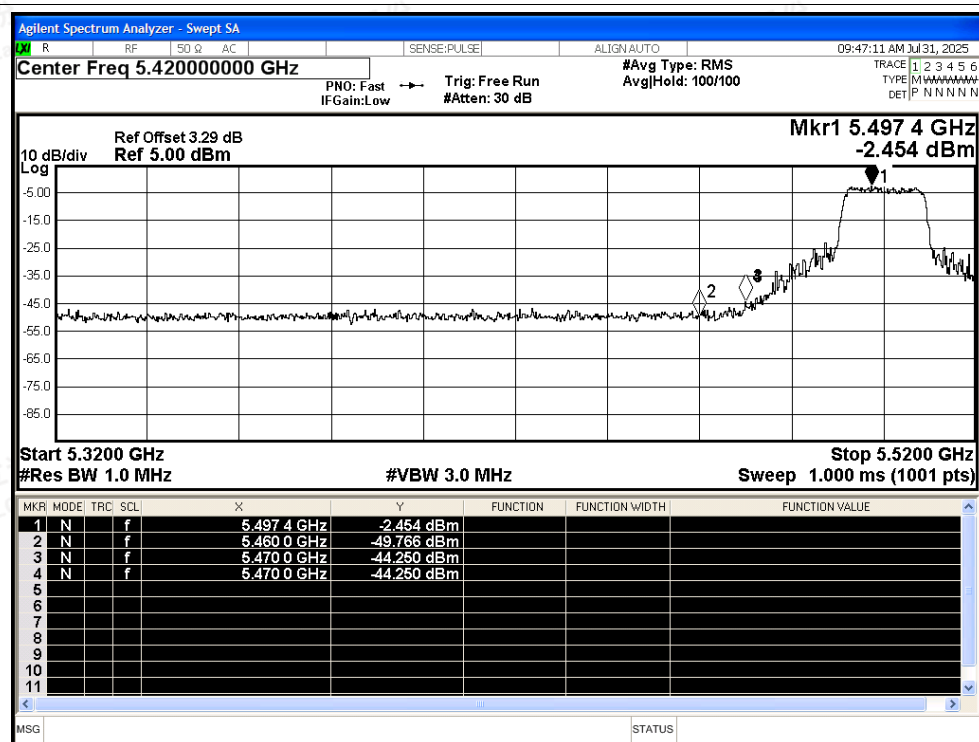

Restrict Band NVNT n20 5500MHz An3 Average

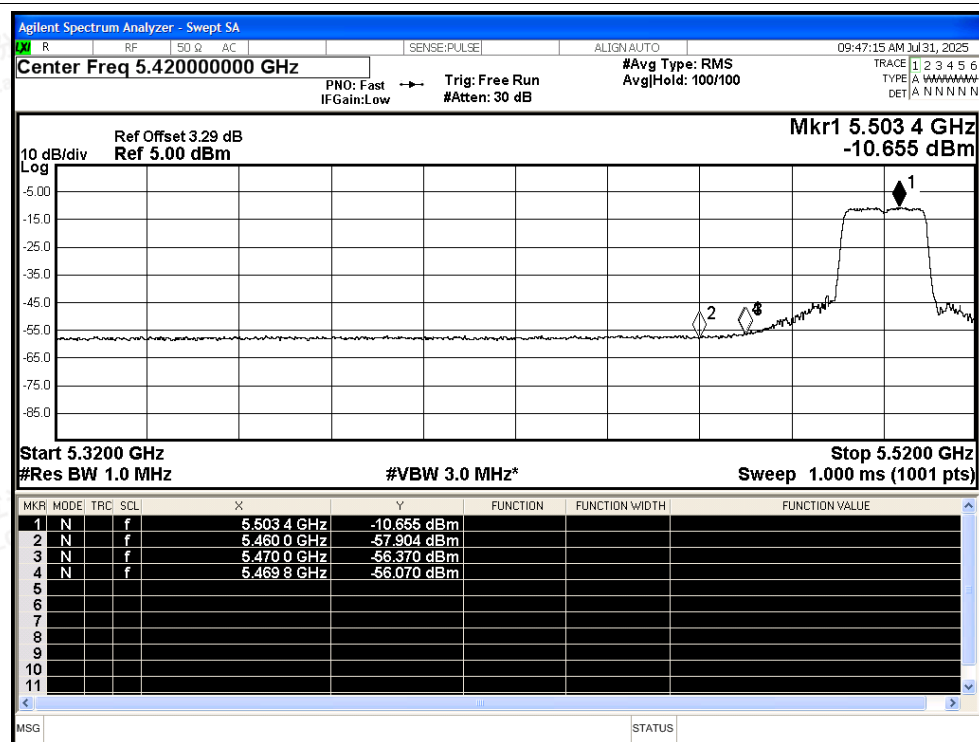

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz An3 Peak

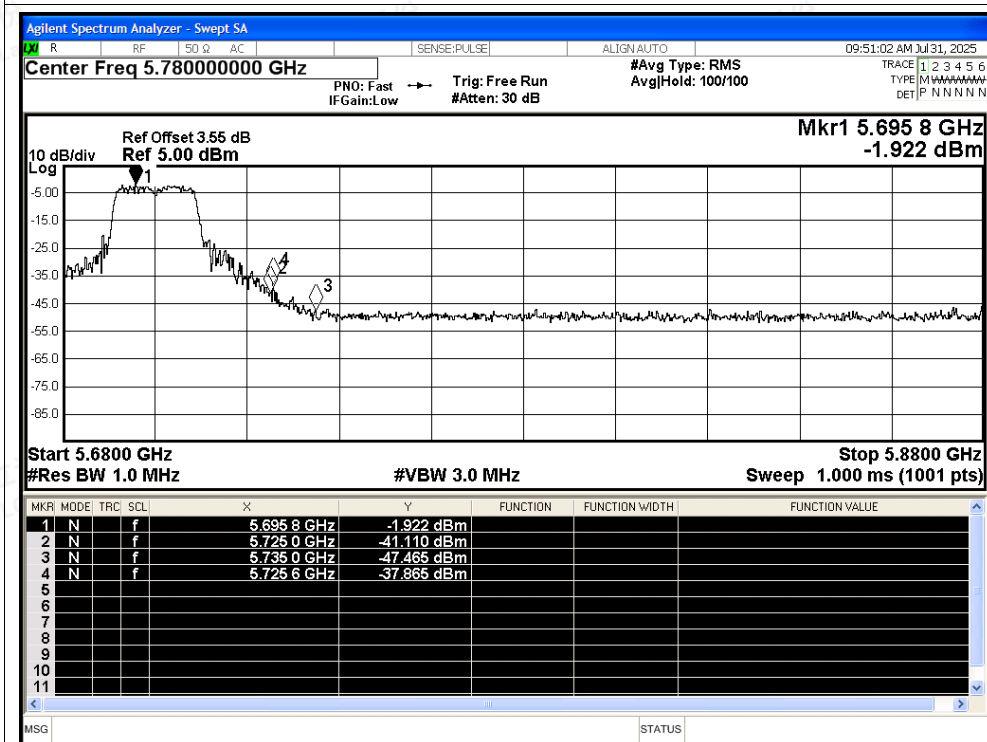

Restrict Band NVNT n20 5700MHz An3 Average

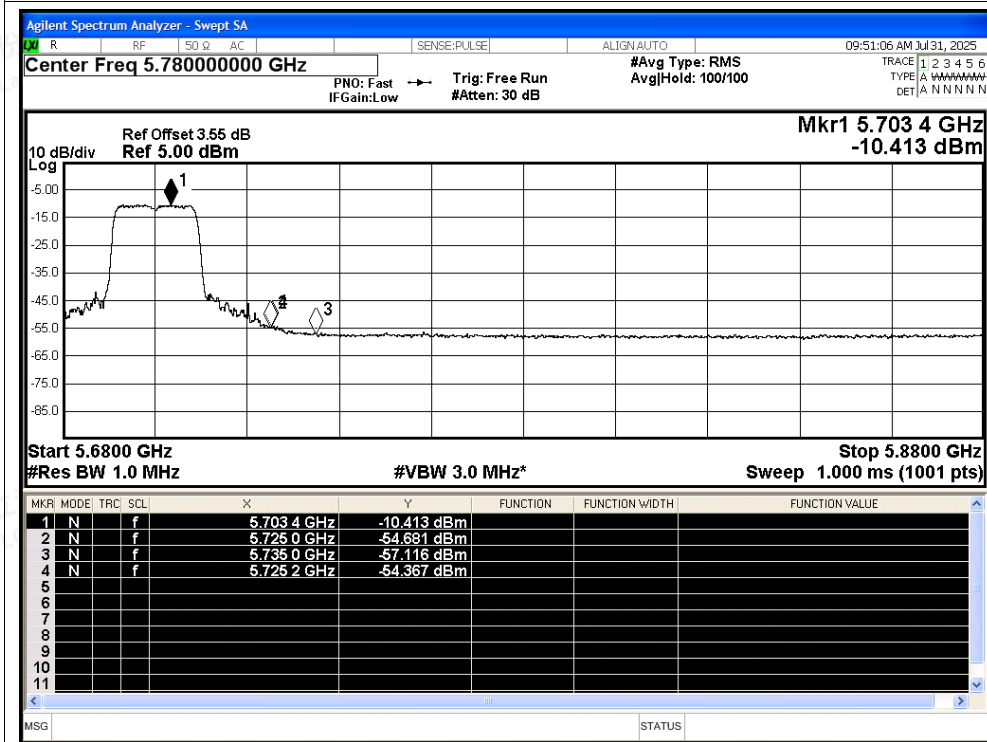

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz An3 Peak

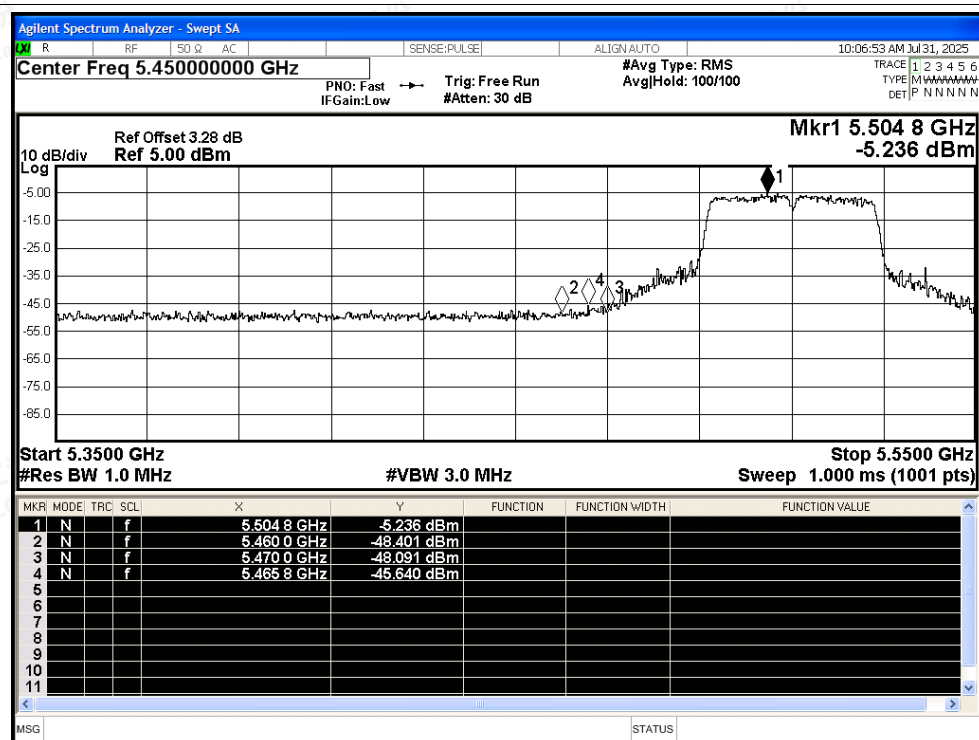

Restrict Band NVNT n40 5510MHz An3 Average

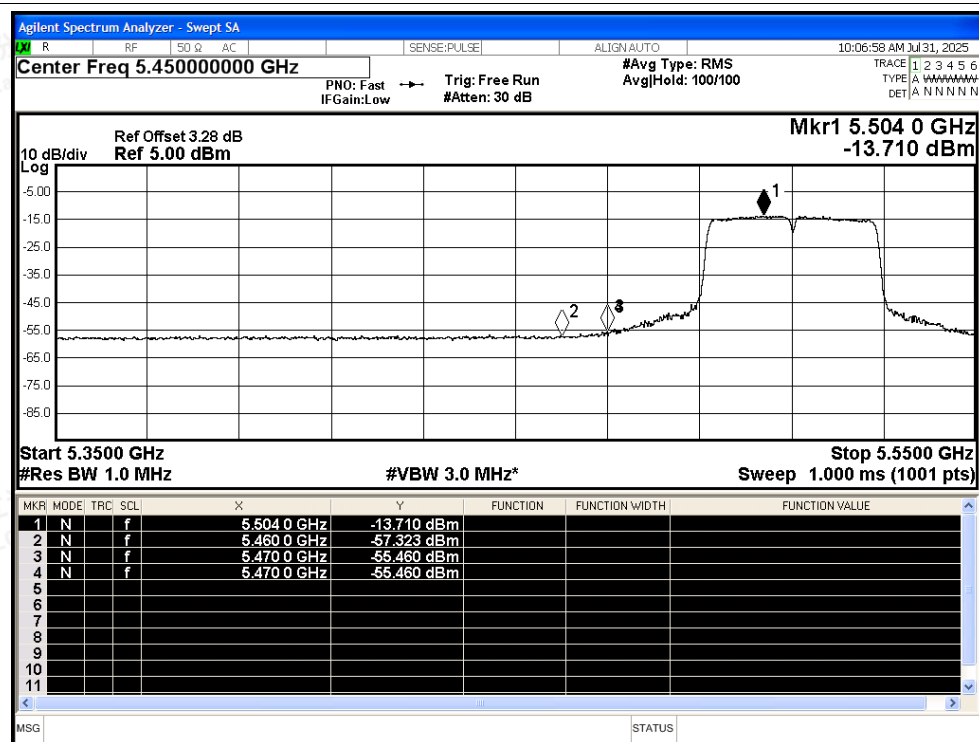

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz An3 Peak

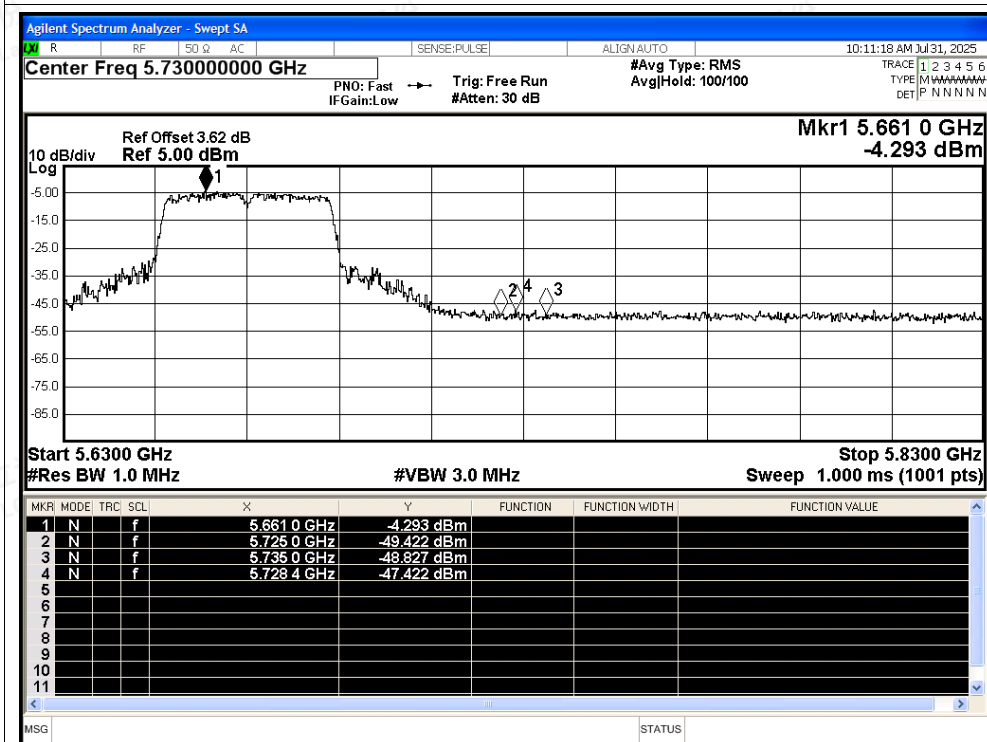

Restrict Band NVNT n40 5670MHz An3 Average

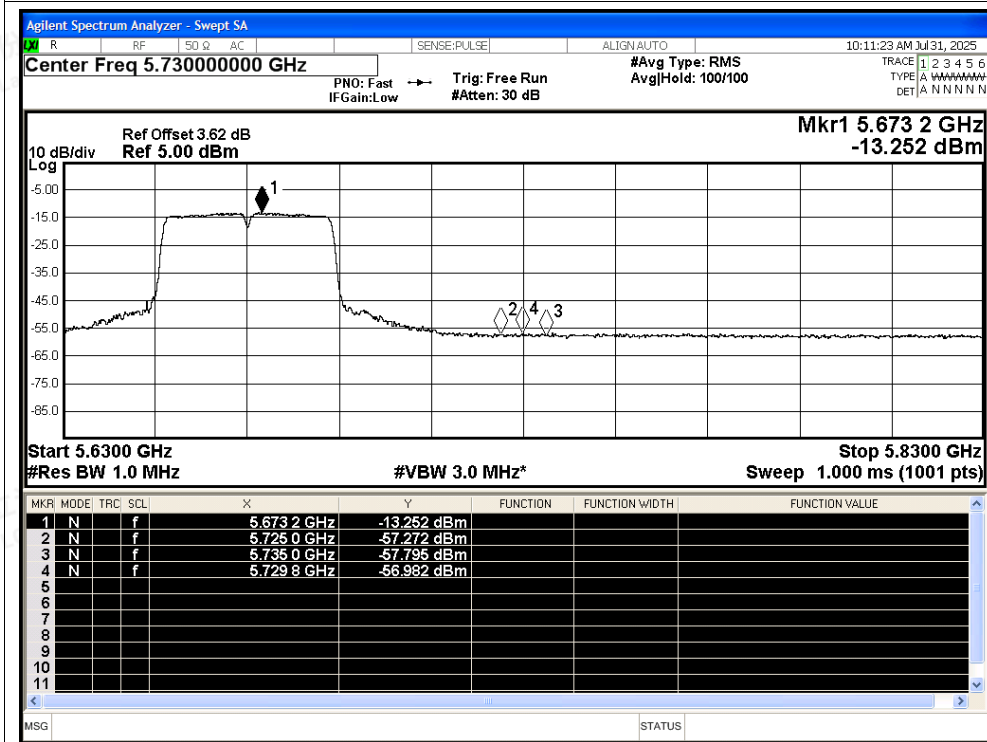

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz An3 Peak

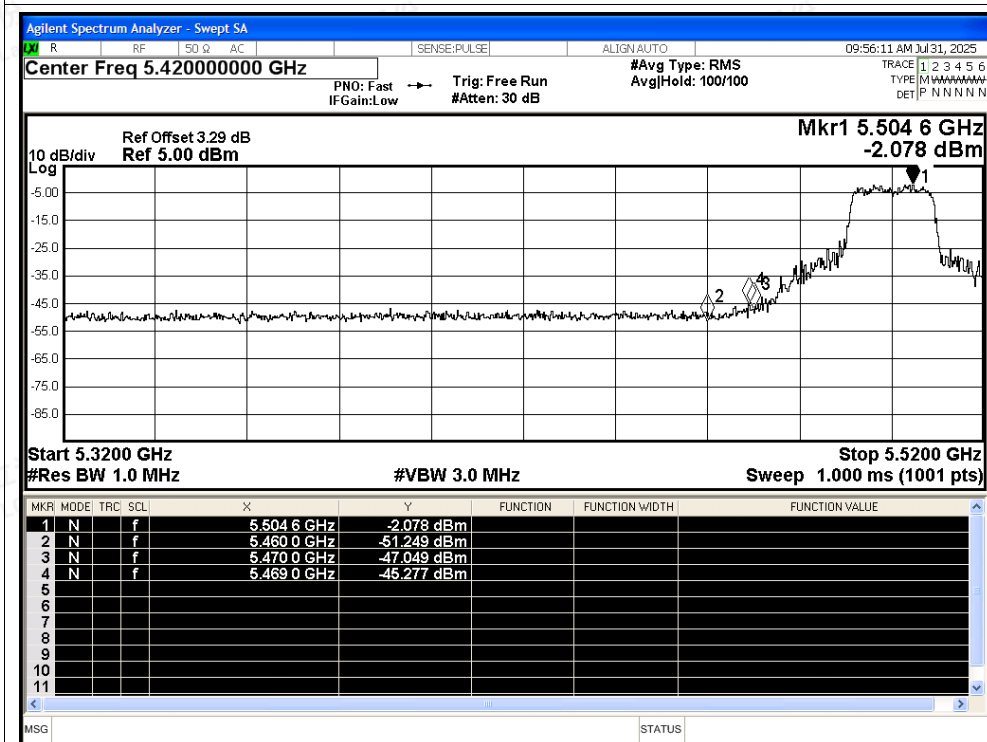

Restrict Band NVNT ac20 5500MHz An3 Average

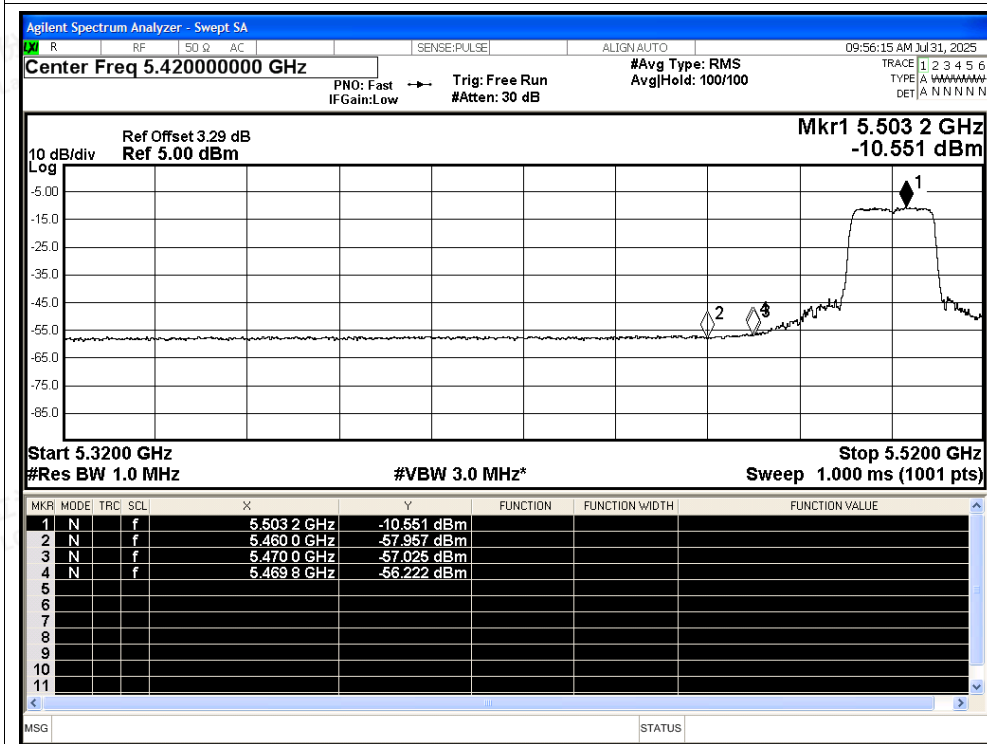

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz An3 Peak

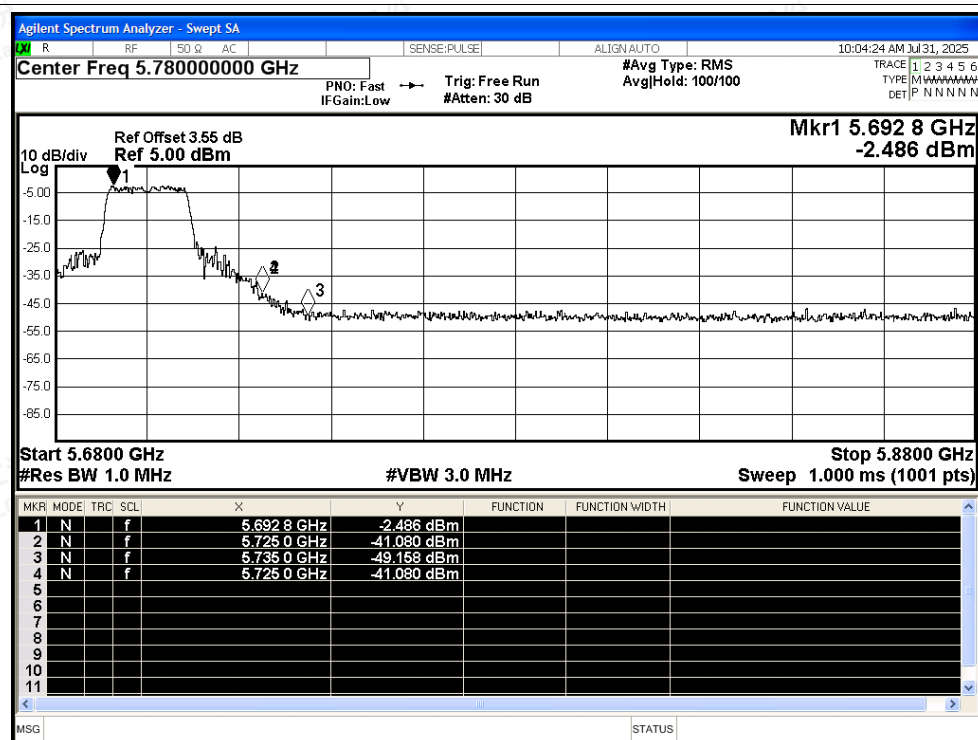

Restrict Band NVNT ac20 5700MHz An3 Average

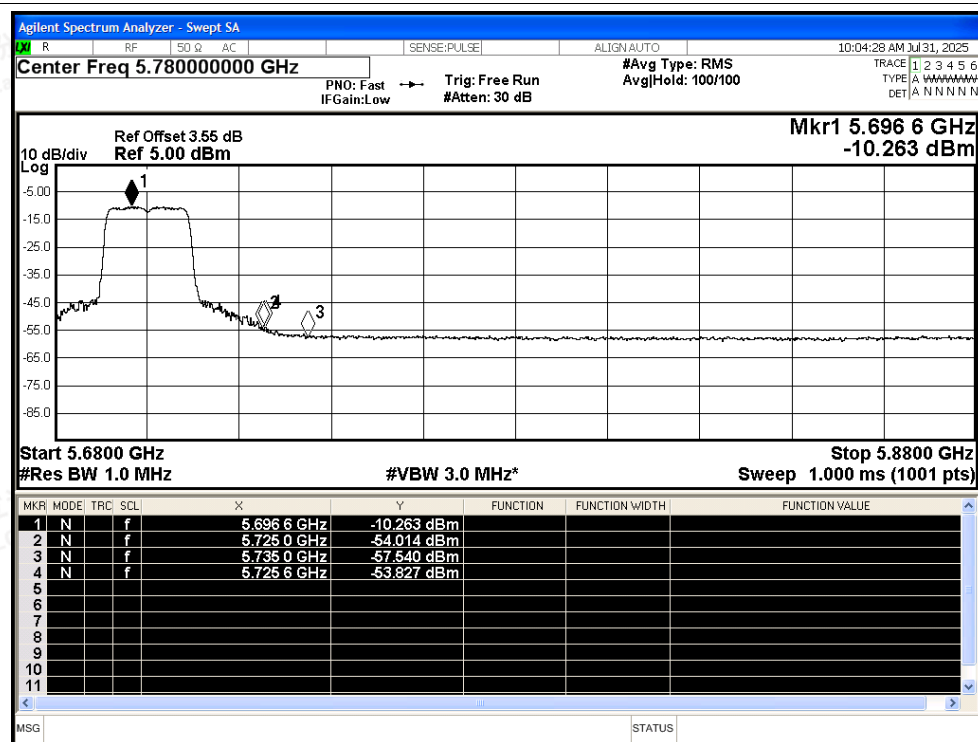

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz An3 Peak

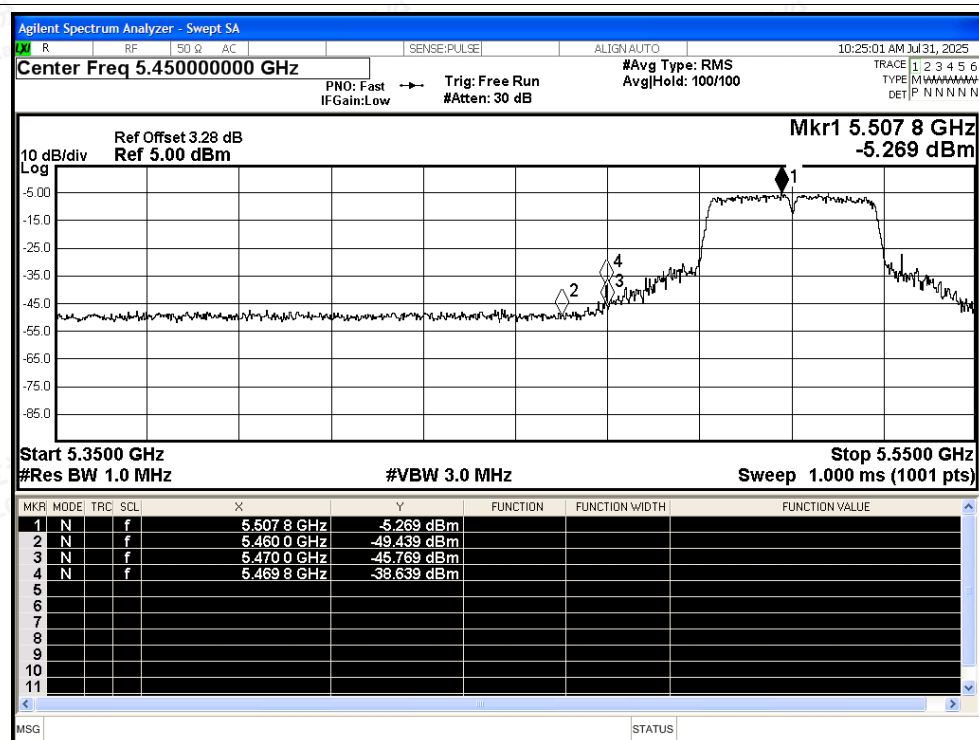

Restrict Band NVNT ac40 5510MHz An3 Average

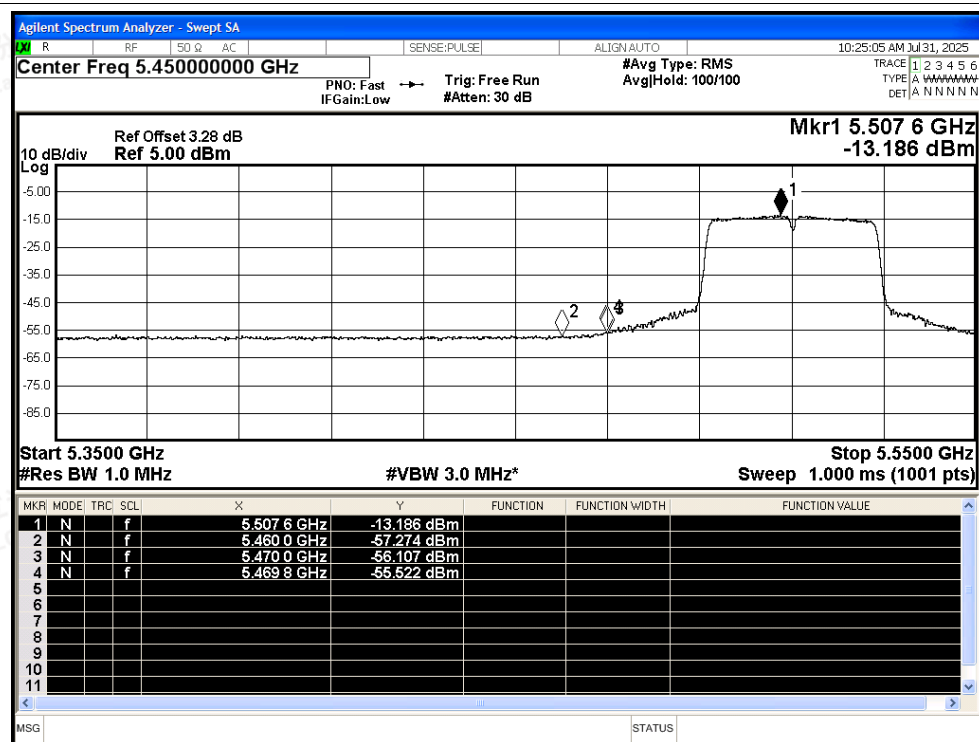

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz An3 Peak

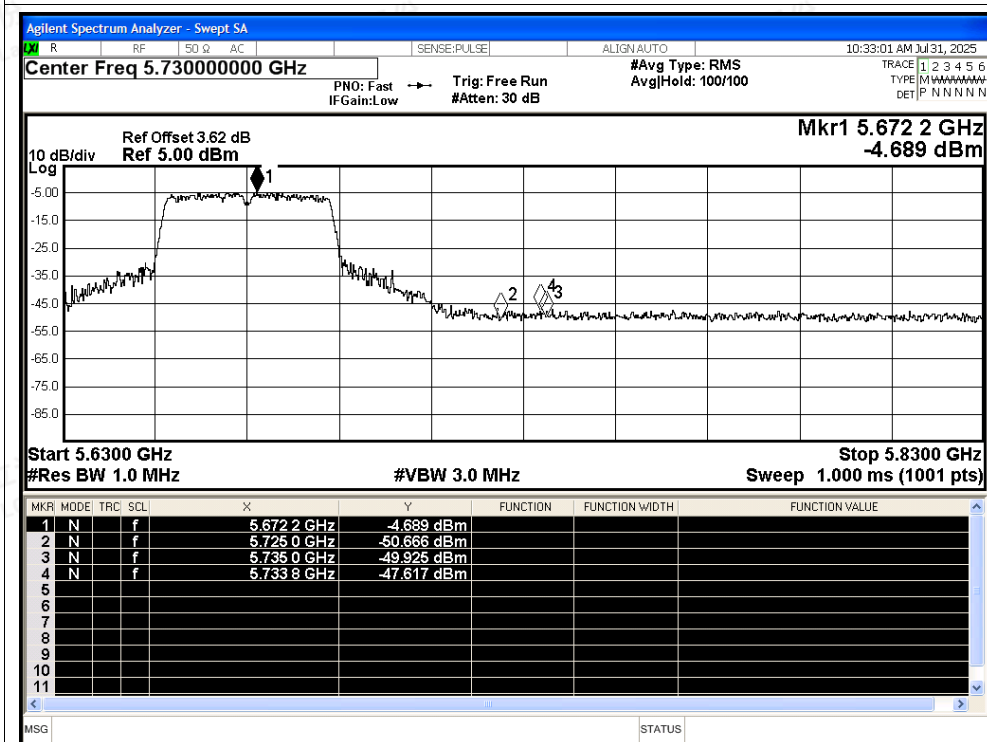

Restrict Band NVNT ac40 5670MHz An3 Average

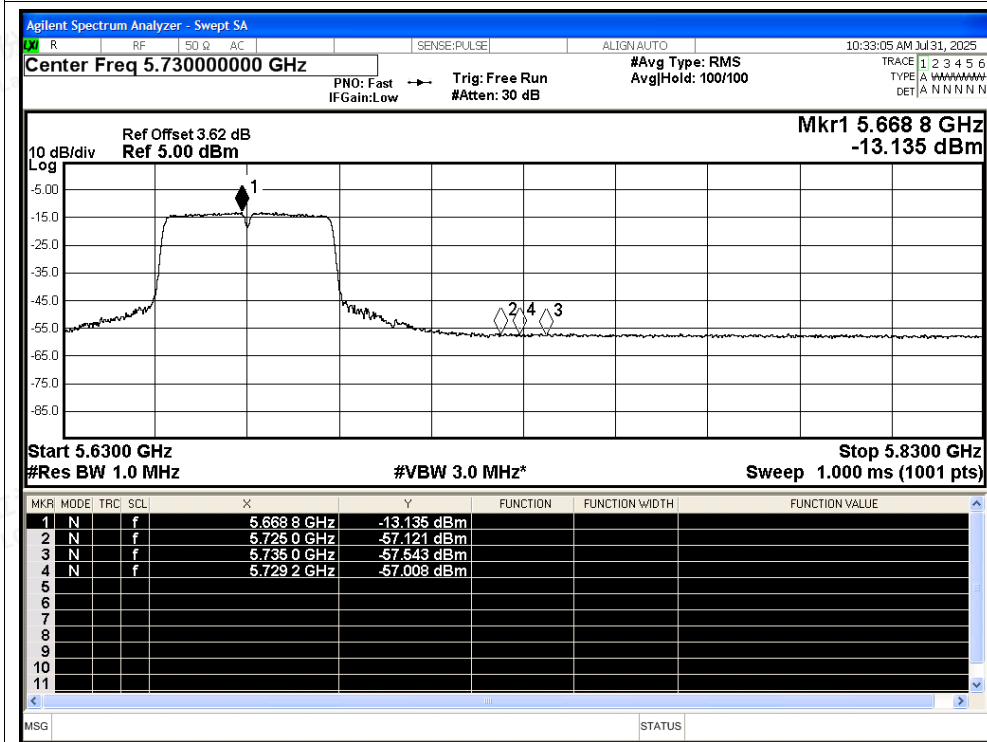

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz An3 Peak

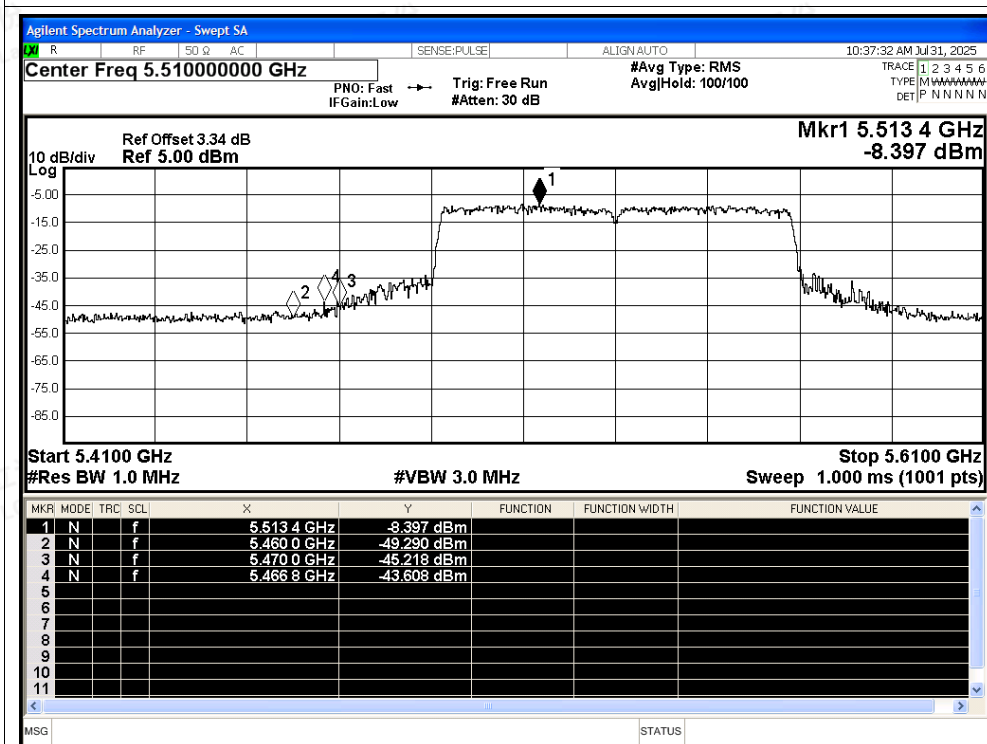

Restrict Band NVNT ac80 5530MHz An3 Average

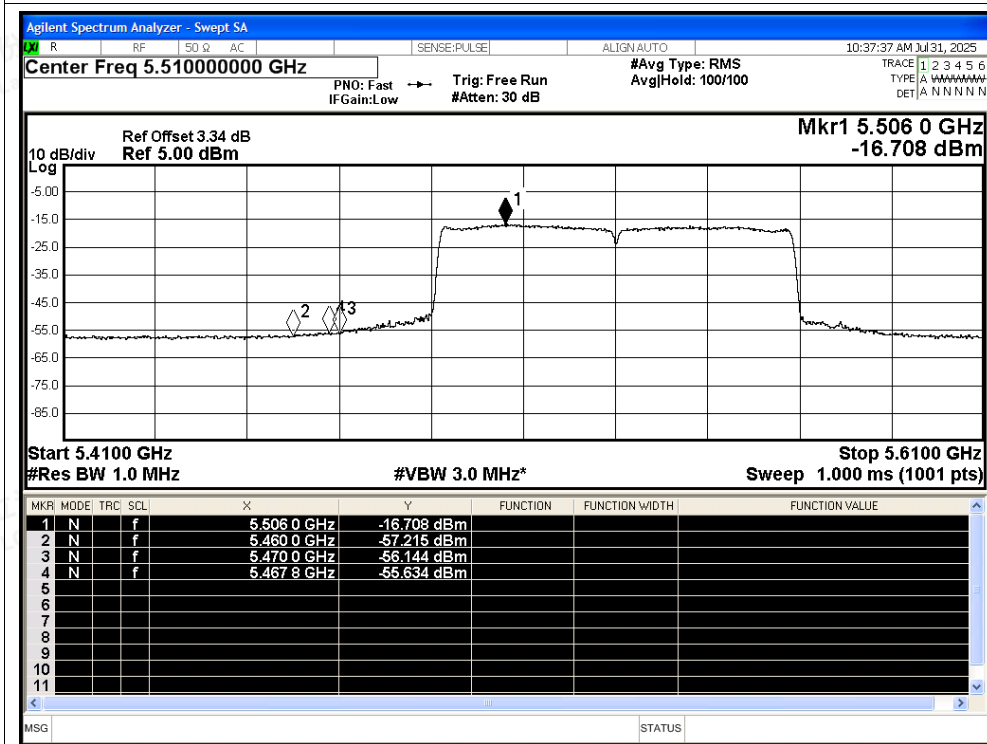

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz An3 Peak

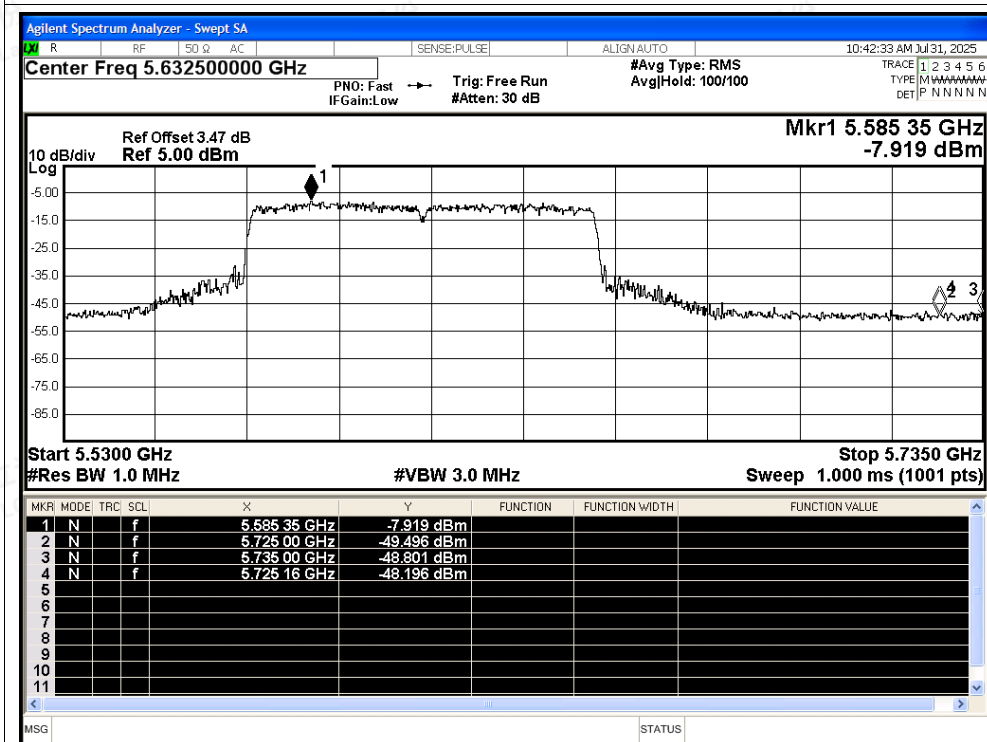

Restrict Band NVNT ac80 5610MHz An3 Average

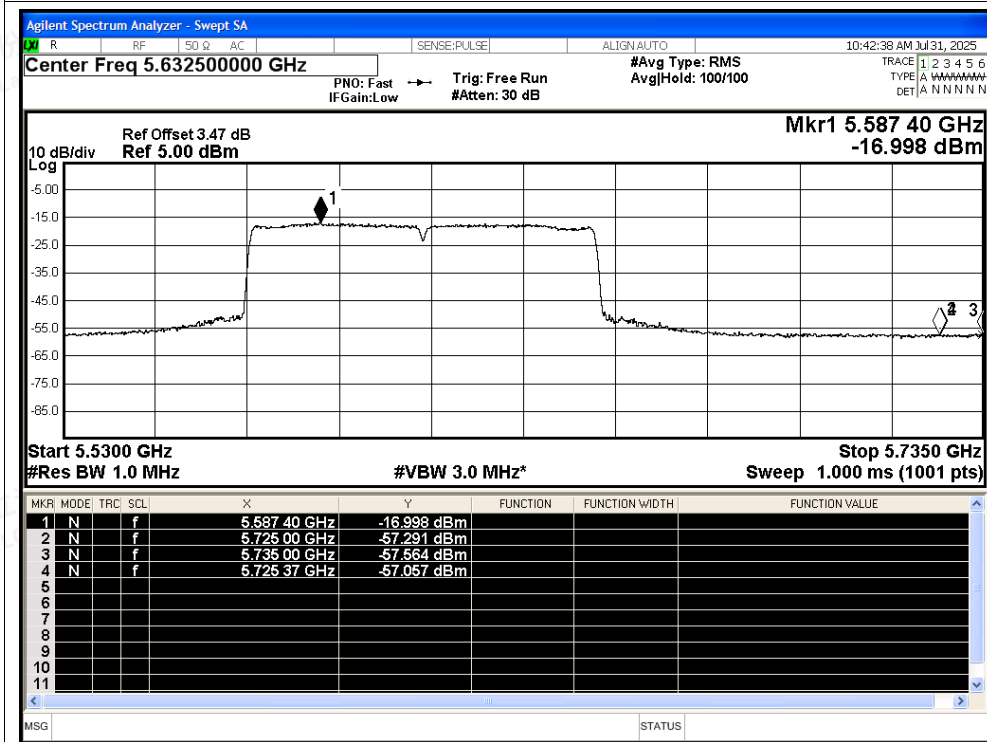

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz An3 Peak

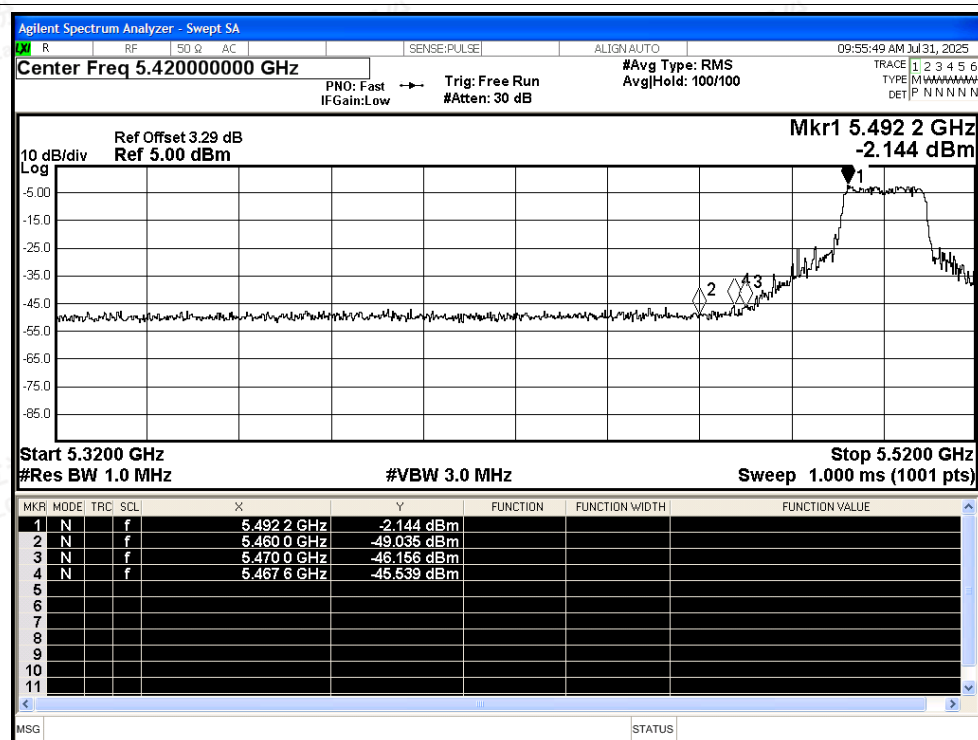

Restrict Band NVNT ax20 5500MHz An3 Average

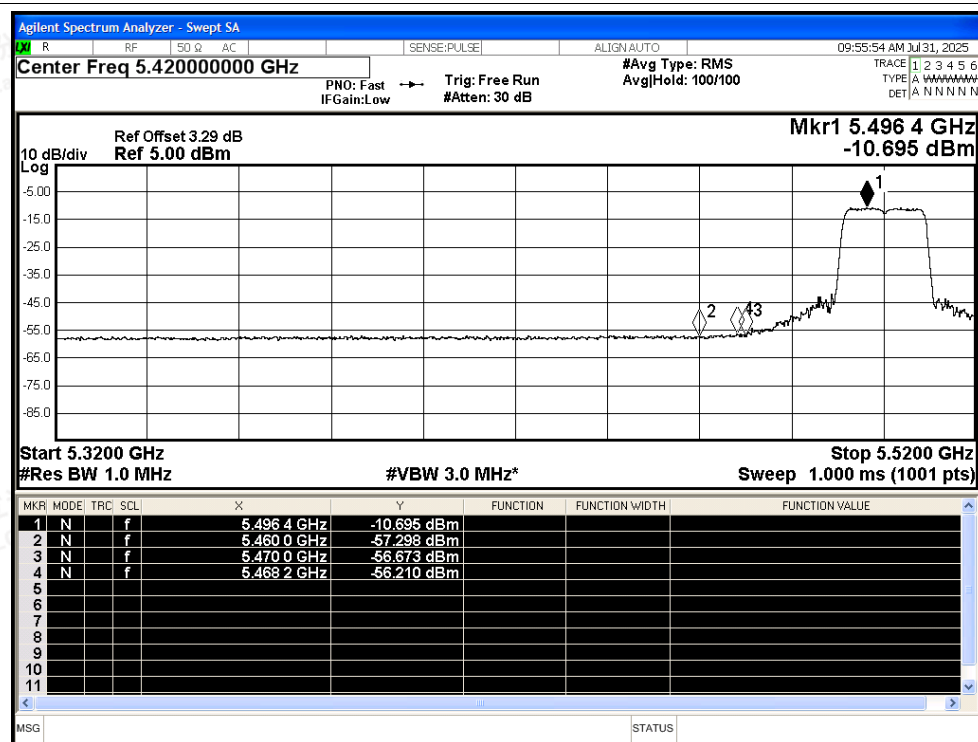

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz An3 Peak

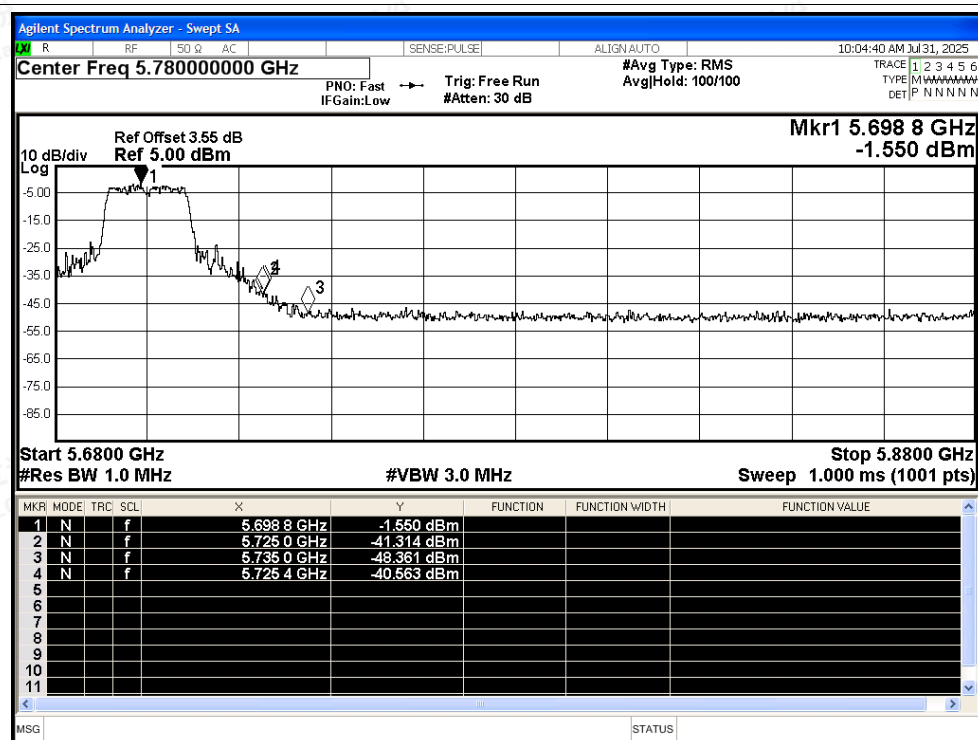

Restrict Band NVNT ax20 5700MHz An3 Average

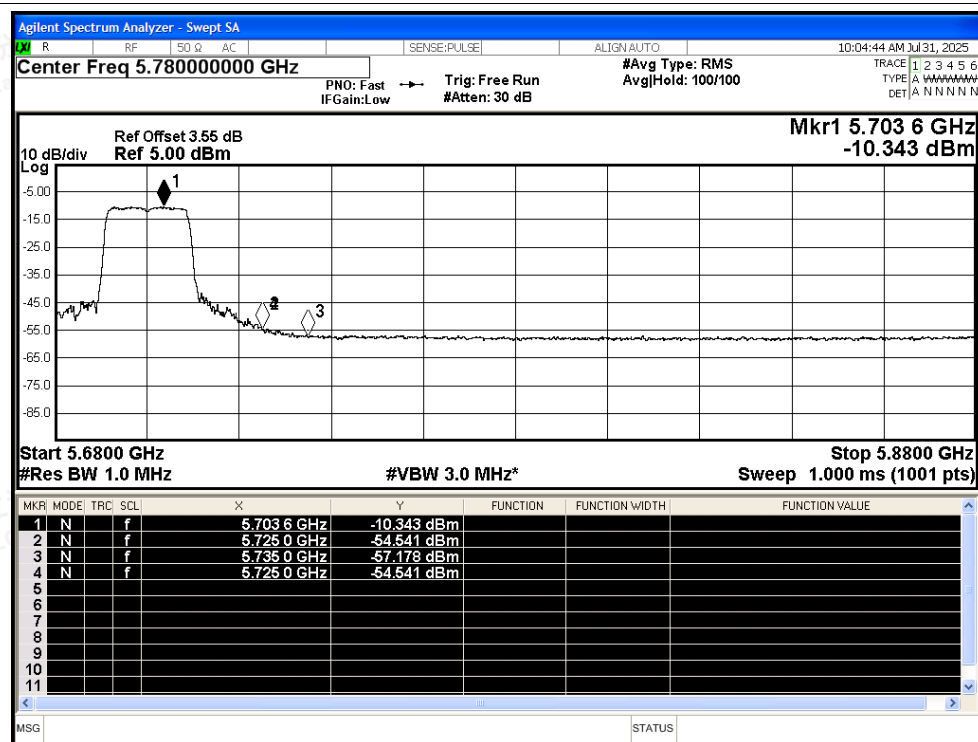

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz An3 Peak

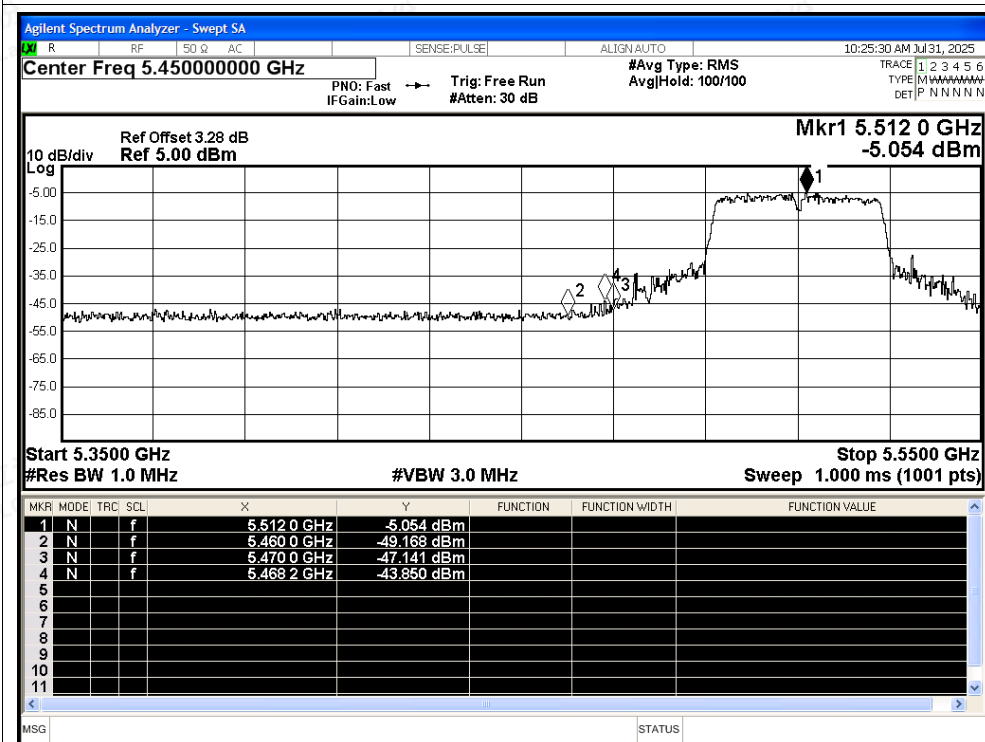

Restrict Band NVNT ax40 5510MHz An3 Average

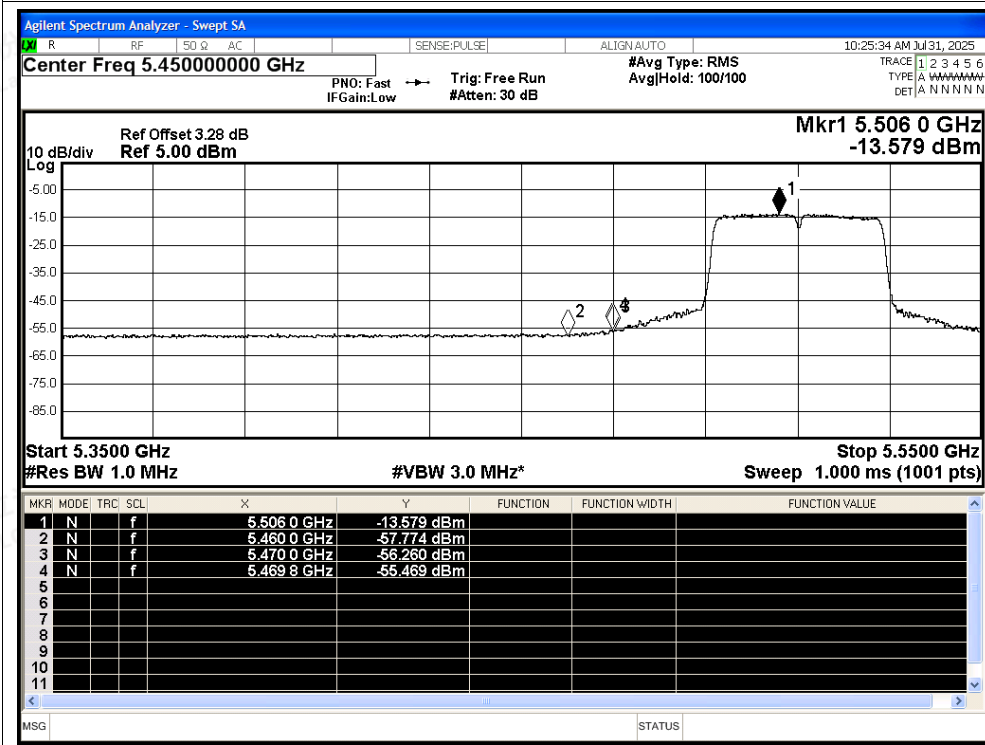

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz An3 Peak

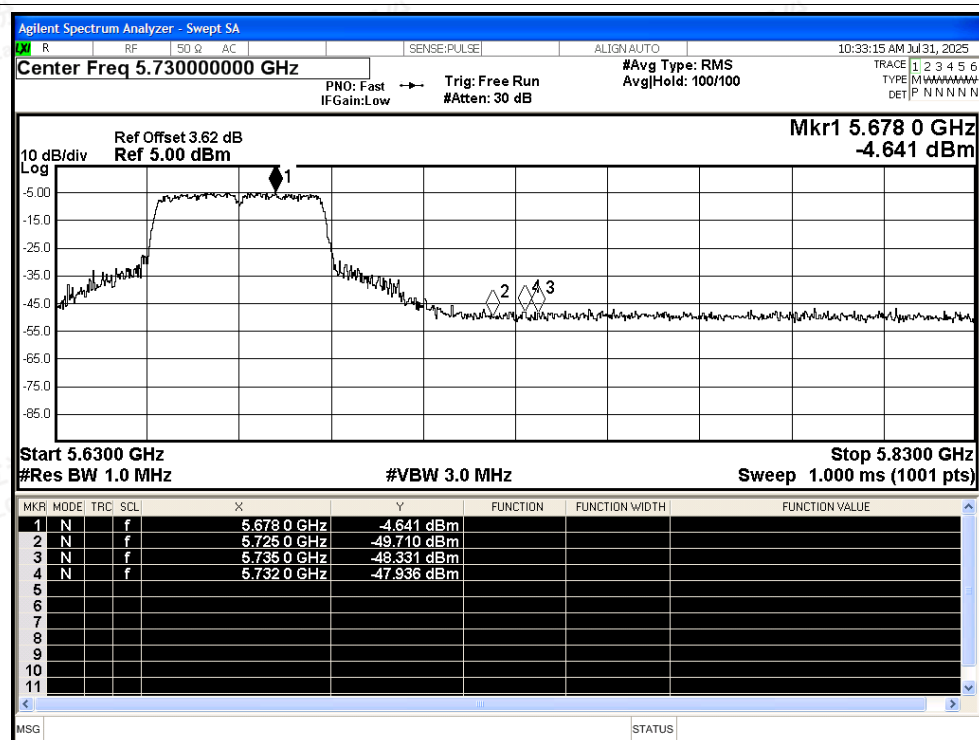

Restrict Band NVNT ax40 5670MHz An3 Average

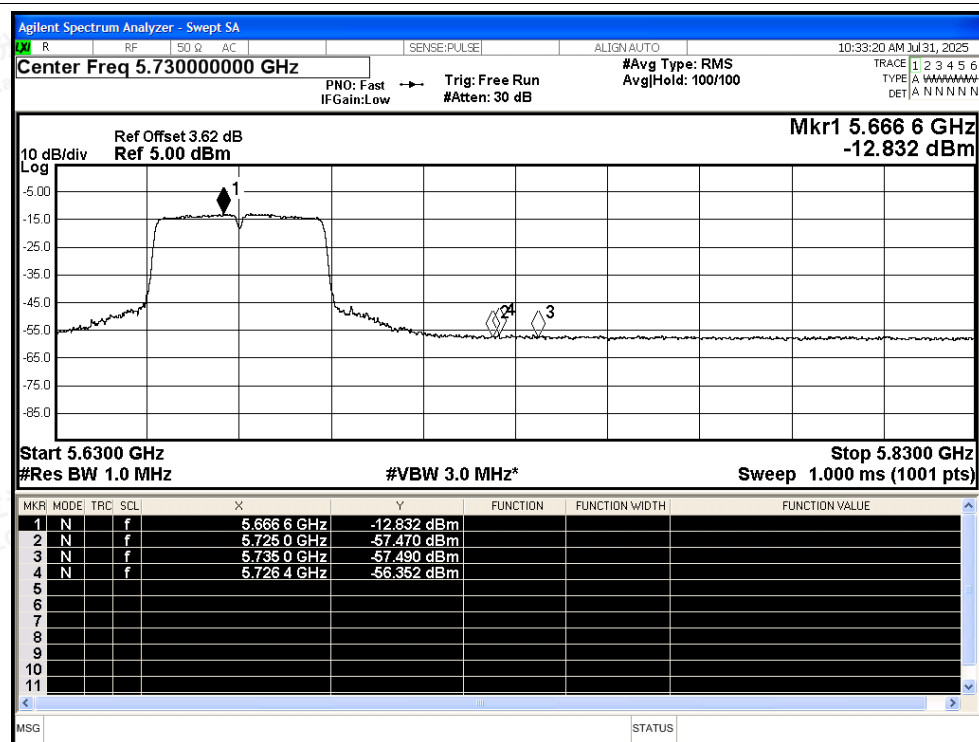

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz An3 Peak

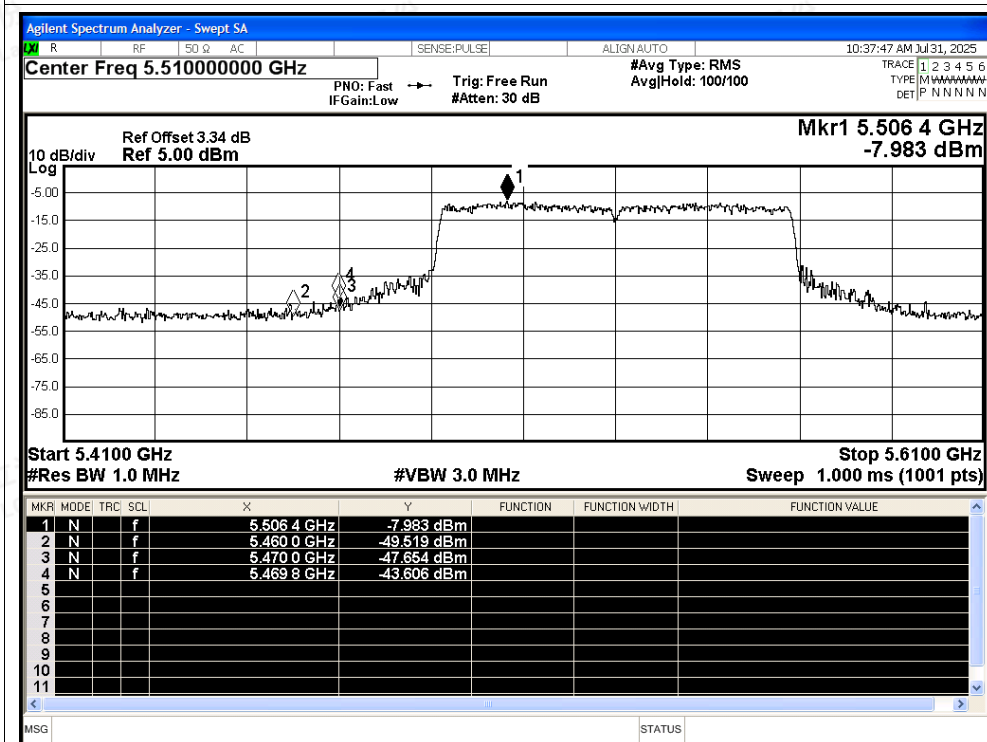

Restrict Band NVNT ax80 5530MHz An3 Average

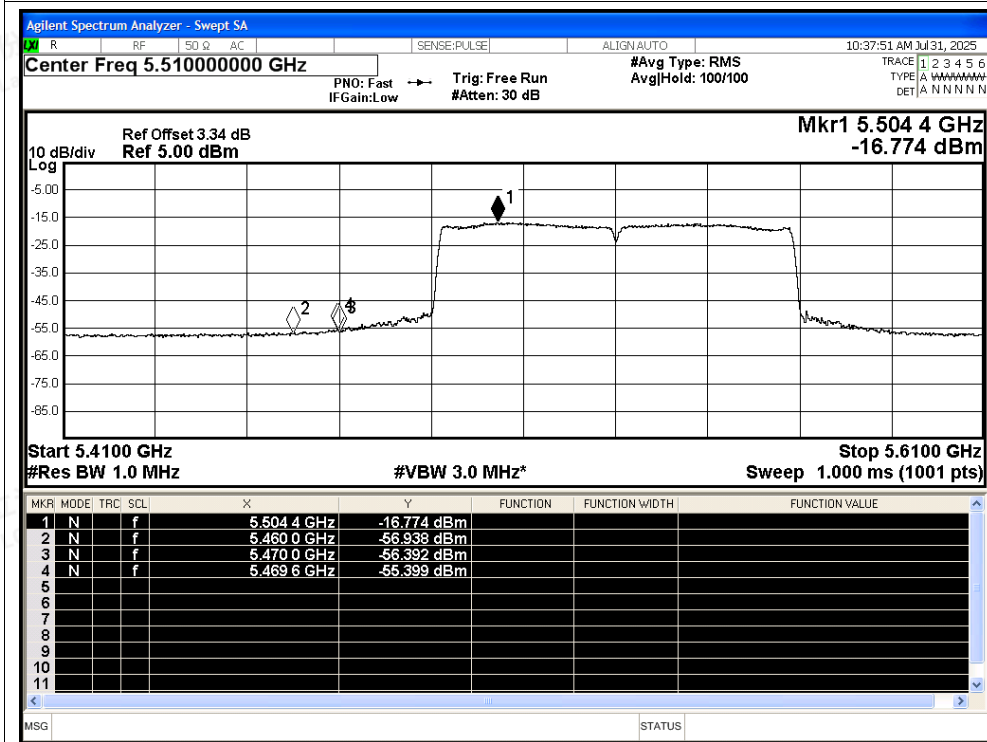

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz An3 Peak

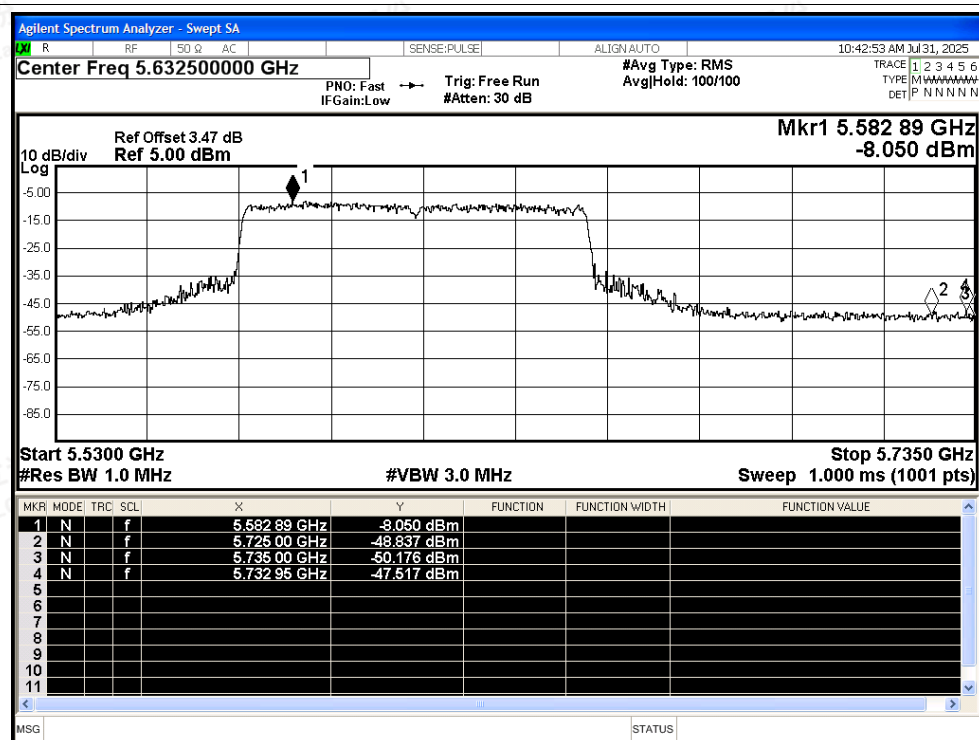

Restrict Band NVNT ax80 5610MHz An3 Average

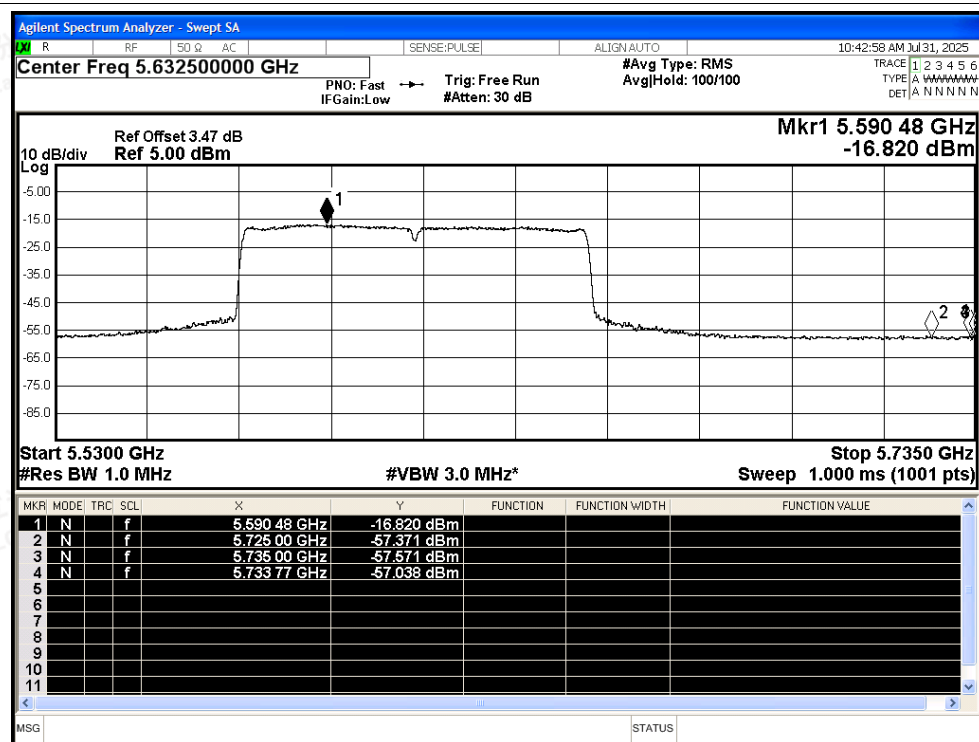

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	An4	5460	-49.7	5.1	-	50.63	Peak	68.2	Pass
NVNT	a	5500	An4	5460	-57.51	5.1	0.24	43.06	Average	54	Pass
NVNT	a	5500	An4	5463.8	-46.41	5.1	-	53.92	Peak	68.2	Pass
NVNT	a	5500	An4	5469	-56.38	5.1	0.24	44.19	Average	54	Pass
NVNT	a	5500	An4	5470	-48.16	5.1	-	52.17	Peak	68.2	Pass
NVNT	a	5500	An4	5470	-56.38	5.1	0.24	44.19	Average	54	Pass
NVNT	a	5700	An4	5725	-41.86	5.1	-	58.47	Peak	68.2	Pass
NVNT	a	5700	An4	5725	-55.15	5.1	0.24	45.42	Average	54	Pass
NVNT	a	5700	An4	5726.6	-38.43	5.1	-	61.90	Peak	68.2	Pass
NVNT	a	5700	An4	5725.8	-54.52	5.1	0.24	46.05	Average	54	Pass
NVNT	a	5700	An4	5735	-48.5	5.1	-	51.83	Peak	68.2	Pass
NVNT	a	5700	An4	5735	-57.4	5.1	0.24	43.17	Average	54	Pass
NVNT	n20	5500	An4	5460	-49.43	5.1	-	50.90	Peak	68.2	Pass
NVNT	n20	5500	An4	5460	-57.19	5.1	0.12	43.26	Average	54	Pass
NVNT	n20	5500	An4	5469.2	-42.84	5.1	-	57.49	Peak	68.2	Pass
NVNT	n20	5500	An4	5469.4	-56.01	5.1	0.12	44.44	Average	54	Pass
NVNT	n20	5500	An4	5470	-45.55	5.1	-	54.78	Peak	68.2	Pass
NVNT	n20	5500	An4	5470	-56.2	5.1	0.12	44.25	Average	54	Pass
NVNT	n20	5700	An4	5725	-41.33	5.1	-	59.00	Peak	68.2	Pass
NVNT	n20	5700	An4	5725	-54.35	5.1	0.12	46.10	Average	54	Pass
NVNT	n20	5700	An4	5725.4	-40.39	5.1	-	59.94	Peak	68.2	Pass
NVNT	n20	5700	An4	5725.2	-53.73	5.1	0.12	46.72	Average	54	Pass
NVNT	n20	5700	An4	5735	-47.78	5.1	-	52.55	Peak	68.2	Pass
NVNT	n20	5700	An4	5735	-57.21	5.1	0.12	43.24	Average	54	Pass
NVNT	n40	5510	An4	5460	-49.41	5.1	-	50.92	Peak	68.2	Pass
NVNT	n40	5510	An4	5460	-57.75	5.1	0.23	42.81	Average	54	Pass
NVNT	n40	5510	An4	5469.6	-41.01	5.1	-	59.32	Peak	68.2	Pass
NVNT	n40	5510	An4	5468.6	-55.08	5.1	0.23	45.48	Average	54	Pass
NVNT	n40	5510	An4	5470	-46.06	5.1	-	54.27	Peak	68.2	Pass
NVNT	n40	5510	An4	5470	-55.74	5.1	0.23	44.82	Average	54	Pass
NVNT	n40	5670	An4	5725	-49.73	5.1	-	50.60	Peak	68.2	Pass
NVNT	n40	5670	An4	5725	-57.59	5.1	0.24	42.98	Average	54	Pass
NVNT	n40	5670	An4	5733.6	-47.75	5.1	-	52.58	Peak	68.2	Pass
NVNT	n40	5670	An4	5725.6	-56.93	5.1	0.24	43.64	Average	54	Pass
NVNT	n40	5670	An4	5735	-49.2	5.1	-	51.13	Peak	68.2	Pass
NVNT	n40	5670	An4	5735	-57.42	5.1	0.24	43.15	Average	54	Pass
NVNT	ac20	5500	An4	5460	-49.95	5.1	-	50.38	Peak	68.2	Pass
NVNT	ac20	5500	An4	5460	-56.71	5.1	0.12	43.74	Average	54	Pass
NVNT	ac20	5500	An4	5468.8	-43.05	5.1	-	57.28	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	An4	5469.6	-55.82	5.1	0.12	44.63	Average	54	Pass
NVNT	ac20	5500	An4	5470	-44.88	5.1	-	55.45	Peak	68.2	Pass
NVNT	ac20	5500	An4	5470	-56.45	5.1	0.12	44.00	Average	54	Pass
NVNT	ac20	5700	An4	5725	-39.95	5.1	-	60.38	Peak	68.2	Pass
NVNT	ac20	5700	An4	5725	-53.63	5.1	0.12	46.82	Average	54	Pass
NVNT	ac20	5700	An4	5725.4	-38.3	5.1	-	62.03	Peak	68.2	Pass
NVNT	ac20	5700	An4	5725.2	-53.23	5.1	0.12	47.22	Average	54	Pass
NVNT	ac20	5700	An4	5735	-49.51	5.1	-	50.82	Peak	68.2	Pass
NVNT	ac20	5700	An4	5735	-56.7	5.1	0.12	43.75	Average	54	Pass
NVNT	ac40	5510	An4	5460	-49.95	5.1	-	50.38	Peak	68.2	Pass
NVNT	ac40	5510	An4	5460	-57.89	5.1	0.24	42.68	Average	54	Pass
NVNT	ac40	5510	An4	5469	-42.98	5.1	-	57.35	Peak	68.2	Pass
NVNT	ac40	5510	An4	5469	-55.93	5.1	0.24	44.64	Average	54	Pass
NVNT	ac40	5510	An4	5470	-46.11	5.1	-	54.22	Peak	68.2	Pass
NVNT	ac40	5510	An4	5470	-56.13	5.1	0.24	44.44	Average	54	Pass
NVNT	ac40	5670	An4	5725	-49.97	5.1	-	50.36	Peak	68.2	Pass
NVNT	ac40	5670	An4	5725	-57.77	5.1	0.24	42.80	Average	54	Pass
NVNT	ac40	5670	An4	5729.4	-47.04	5.1	-	53.29	Peak	68.2	Pass
NVNT	ac40	5670	An4	5728.8	-56.91	5.1	0.24	43.66	Average	54	Pass
NVNT	ac40	5670	An4	5735	-48.92	5.1	-	51.41	Peak	68.2	Pass
NVNT	ac40	5670	An4	5735	-57.58	5.1	0.24	42.99	Average	54	Pass
NVNT	ac80	5530	An4	5460	-49.01	5.1	-	51.32	Peak	68.2	Pass
NVNT	ac80	5530	An4	5460	-56.74	5.1	0.47	44.06	Average	54	Pass
NVNT	ac80	5530	An4	5470	-44.43	5.1	-	55.90	Peak	68.2	Pass
NVNT	ac80	5530	An4	5467.8	-54.9	5.1	0.47	45.90	Average	54	Pass
NVNT	ac80	5530	An4	5470	-44.43	5.1	-	55.90	Peak	68.2	Pass
NVNT	ac80	5530	An4	5470	-55.81	5.1	0.47	44.99	Average	54	Pass
NVNT	ac80	5610	An4	5725	-50.58	5.1	-	49.75	Peak	68.2	Pass
NVNT	ac80	5610	An4	5725	-57.95	5.1	0.47	42.85	Average	54	Pass
NVNT	ac80	5610	An4	5728.235	-47.7	5.1	-	52.63	Peak	68.2	Pass
NVNT	ac80	5610	An4	5732.335	-57.18	5.1	0.47	43.62	Average	54	Pass
NVNT	ac80	5610	An4	5735	-49.63	5.1	-	50.70	Peak	68.2	Pass
NVNT	ac80	5610	An4	5735	-57.77	5.1	0.47	43.03	Average	54	Pass
NVNT	ax20	5500	An4	5460	-49.88	5.1	-	50.45	Peak	68.2	Pass
NVNT	ax20	5500	An4	5460	-57.92	5.1	0.12	42.53	Average	54	Pass
NVNT	ax20	5500	An4	5469.4	-42.77	5.1	-	57.56	Peak	68.2	Pass
NVNT	ax20	5500	An4	5469.6	-56.06	5.1	0.12	44.39	Average	54	Pass
NVNT	ax20	5500	An4	5470	-43.79	5.1	-	56.54	Peak	68.2	Pass
NVNT	ax20	5500	An4	5470	-56.5	5.1	0.12	43.95	Average	54	Pass
NVNT	ax20	5700	An4	5725	-36.35	5.1	-	63.98	Peak	68.2	Pass
NVNT	ax20	5700	An4	5725	-53.72	5.1	0.12	46.73	Average	54	Pass
NVNT	ax20	5700	An4	5725	-36.35	5.1	-	63.98	Peak	68.2	Pass
NVNT	ax20	5700	An4	5725.2	-53.36	5.1	0.12	47.09	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	An4	5735	-50.45	5.1	-	49.88	Peak	68.2	Pass
NVNT	ax20	5700	An4	5735	-57	5.1	0.12	43.45	Average	54	Pass
NVNT	ax40	5510	An4	5460	-50.19	5.1	-	50.14	Peak	68.2	Pass
NVNT	ax40	5510	An4	5460	-57.69	5.1	0.24	42.88	Average	54	Pass
NVNT	ax40	5510	An4	5469	-43.24	5.1	-	57.09	Peak	68.2	Pass
NVNT	ax40	5510	An4	5469.4	-55.19	5.1	0.24	45.38	Average	54	Pass
NVNT	ax40	5510	An4	5470	-46.11	5.1	-	54.22	Peak	68.2	Pass
NVNT	ax40	5510	An4	5470	-55.73	5.1	0.24	44.84	Average	54	Pass
NVNT	ax40	5670	An4	5725	-48.77	5.1	-	51.56	Peak	68.2	Pass
NVNT	ax40	5670	An4	5725	-57.48	5.1	0.24	43.09	Average	54	Pass
NVNT	ax40	5670	An4	5731.4	-47.7	5.1	-	52.63	Peak	68.2	Pass
NVNT	ax40	5670	An4	5727.2	-56.92	5.1	0.24	43.65	Average	54	Pass
NVNT	ax40	5670	An4	5735	-49.11	5.1	-	51.22	Peak	68.2	Pass
NVNT	ax40	5670	An4	5735	-57.42	5.1	0.24	43.15	Average	54	Pass
NVNT	ax80	5530	An4	5460	-47.03	5.1	-	53.30	Peak	68.2	Pass
NVNT	ax80	5530	An4	5460	-57	5.1	0.47	43.80	Average	54	Pass
NVNT	ax80	5530	An4	5467.2	-43.75	5.1	-	56.58	Peak	68.2	Pass
NVNT	ax80	5530	An4	5469.6	-55.29	5.1	0.47	45.51	Average	54	Pass
NVNT	ax80	5530	An4	5470	-45.34	5.1	-	54.99	Peak	68.2	Pass
NVNT	ax80	5530	An4	5470	-55.53	5.1	0.47	45.27	Average	54	Pass
NVNT	ax80	5610	An4	5725	-49.83	5.1	-	50.50	Peak	68.2	Pass
NVNT	ax80	5610	An4	5725	-57.53	5.1	0.47	43.27	Average	54	Pass
NVNT	ax80	5610	An4	5726.185	-48.03	5.1	-	52.30	Peak	68.2	Pass
NVNT	ax80	5610	An4	5727.415	-57.3	5.1	0.47	43.50	Average	54	Pass
NVNT	ax80	5610	An4	5735	-48.75	5.1	-	51.58	Peak	68.2	Pass
NVNT	ax80	5610	An4	5735	-57.93	5.1	0.47	42.87	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz An4 Peak

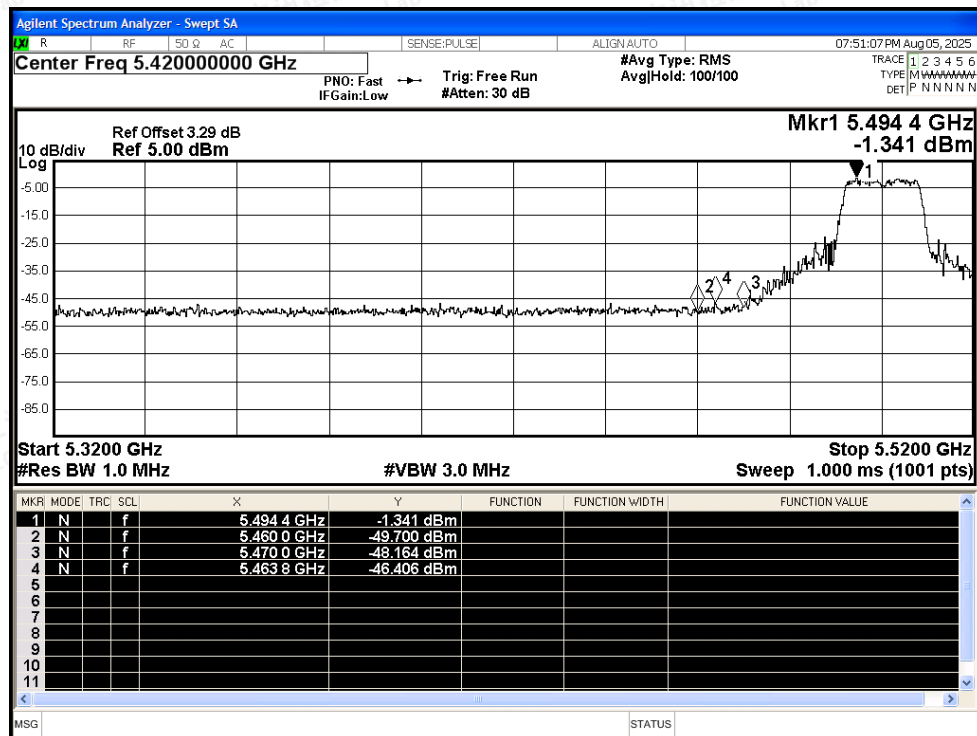

Restrict Band NVNT a 5500MHz An4 Average

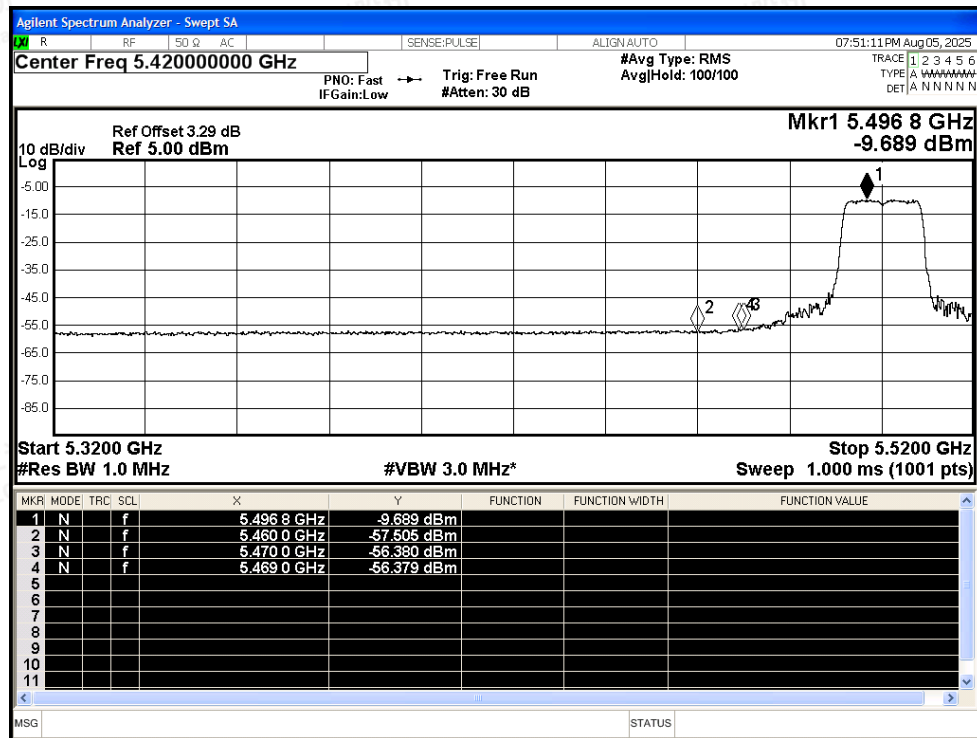

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5700MHz An4 Peak

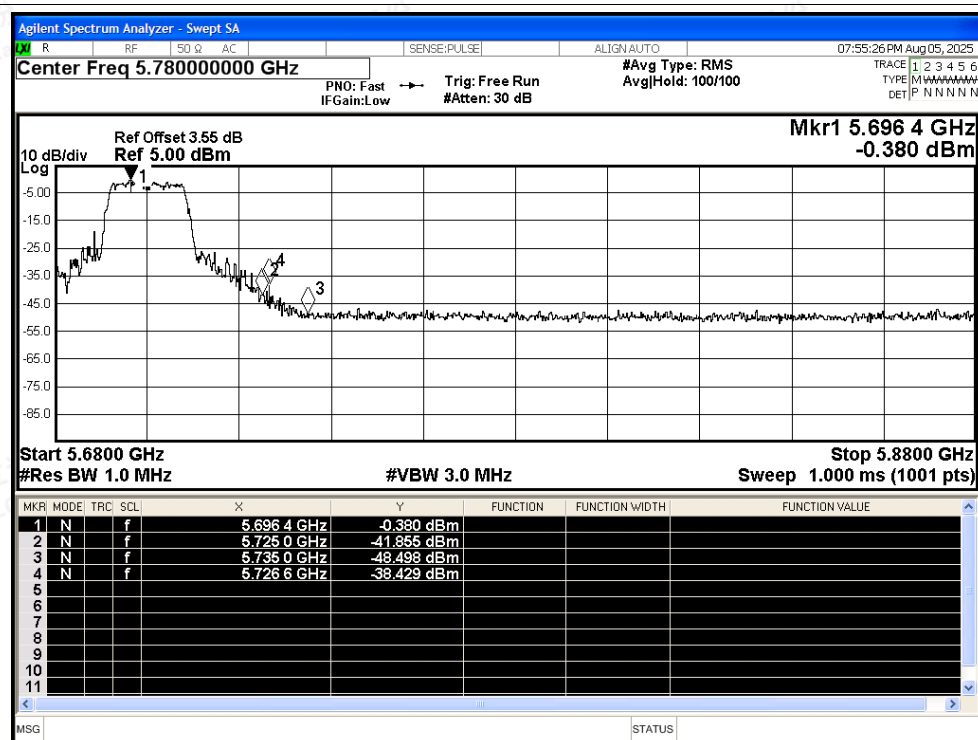

Restrict Band NVNT a 5700MHz An4 Average

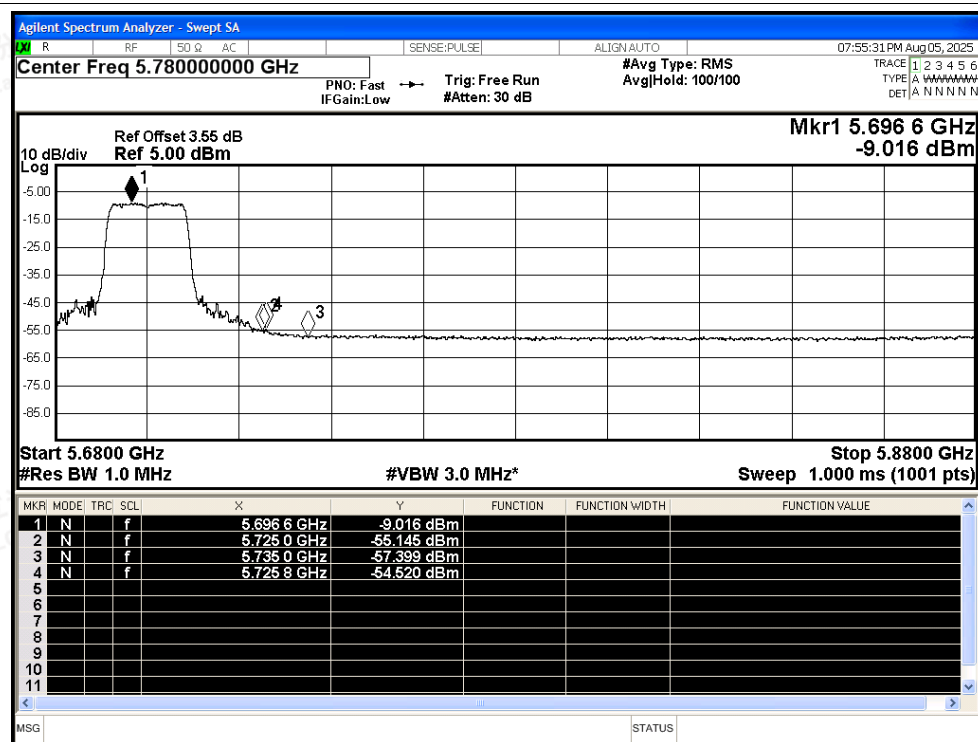

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5500MHz An4 Peak

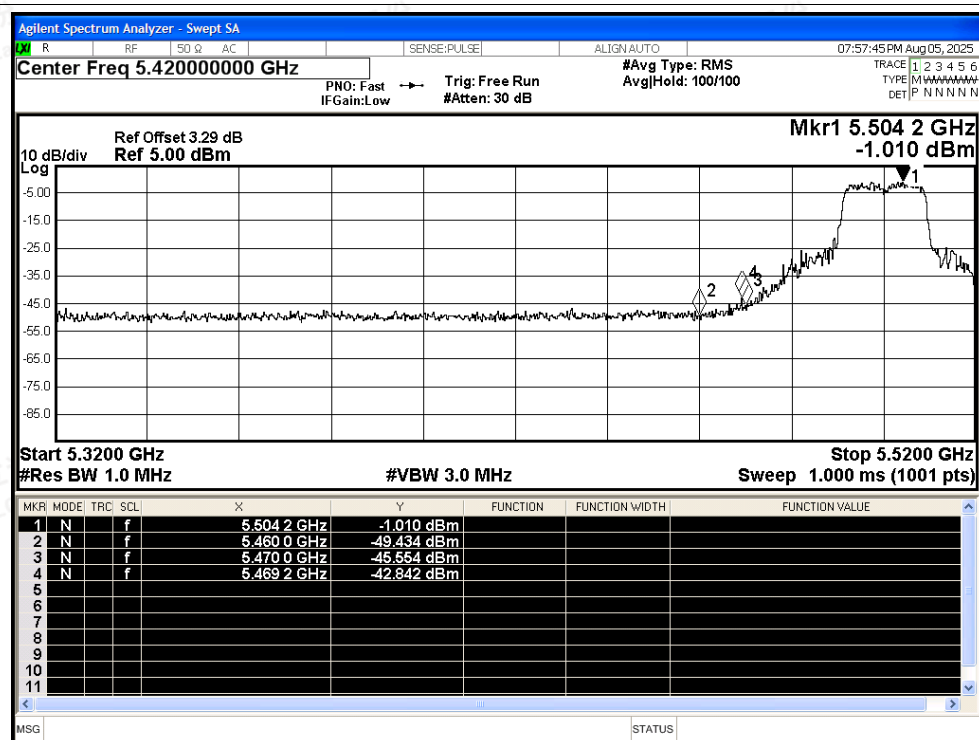

Restrict Band NVNT n20 5500MHz An4 Average

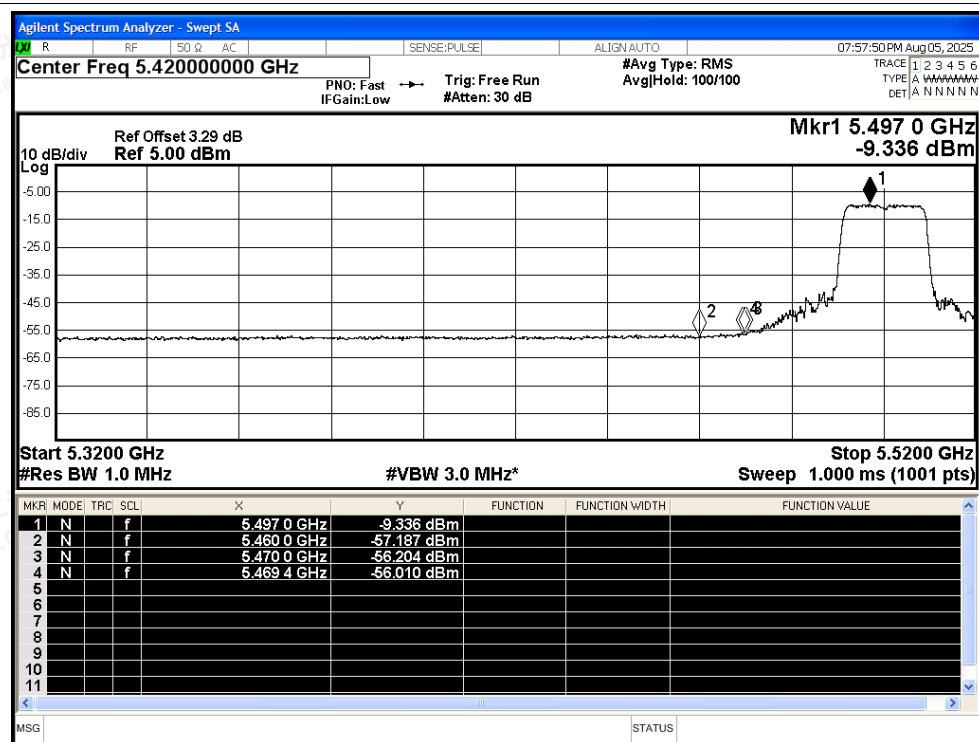

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5700MHz An4 Peak

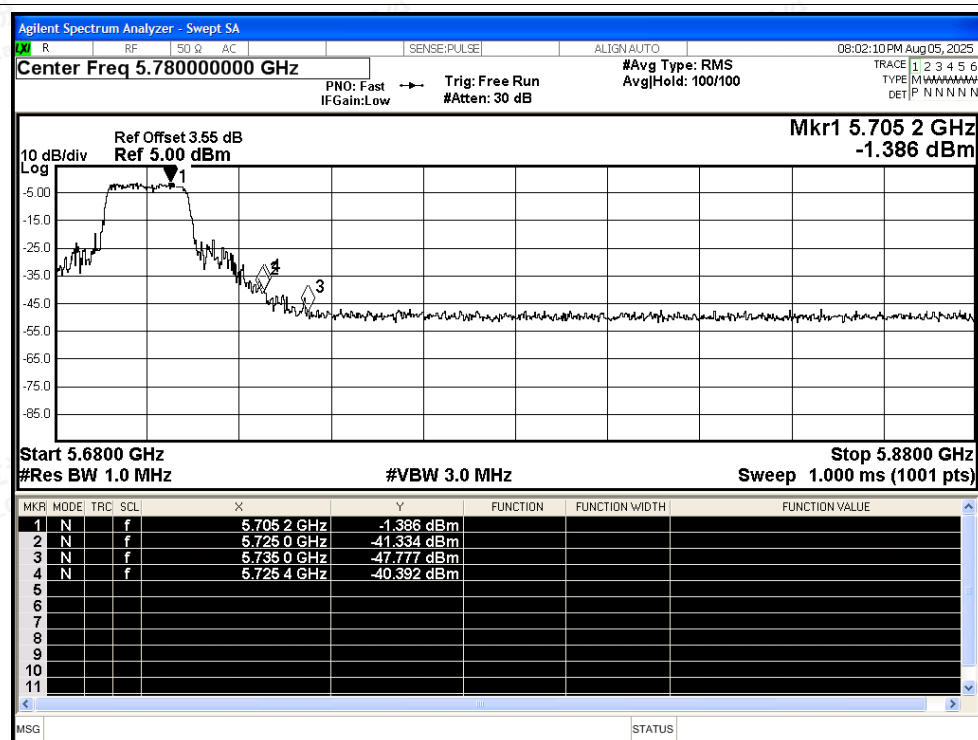

Restrict Band NVNT n20 5700MHz An4 Average

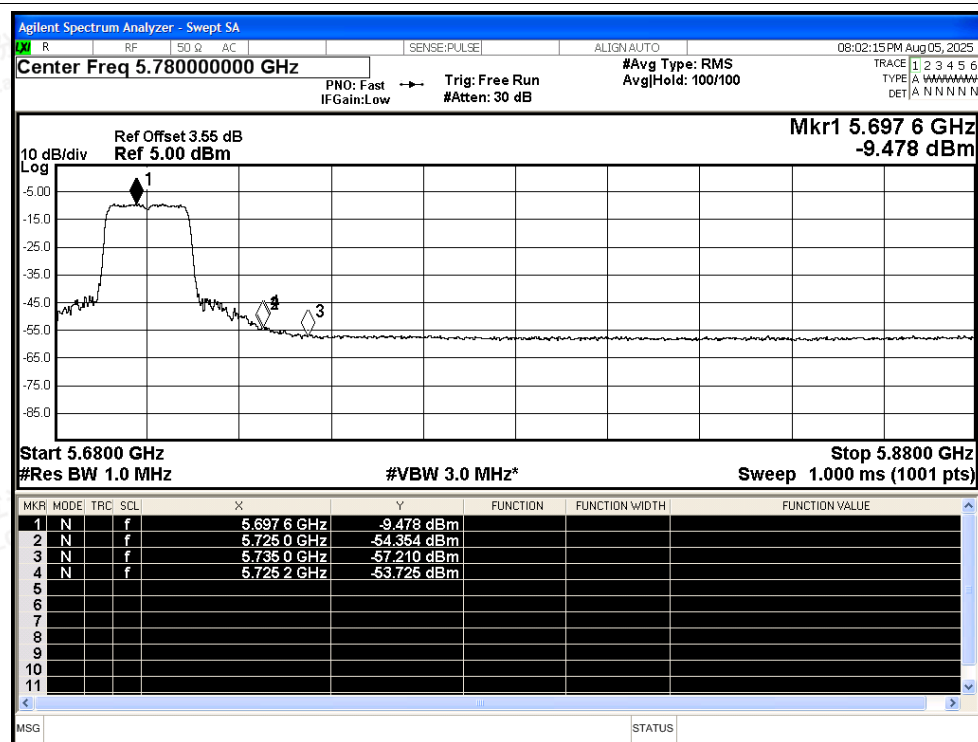

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5510MHz An4 Peak

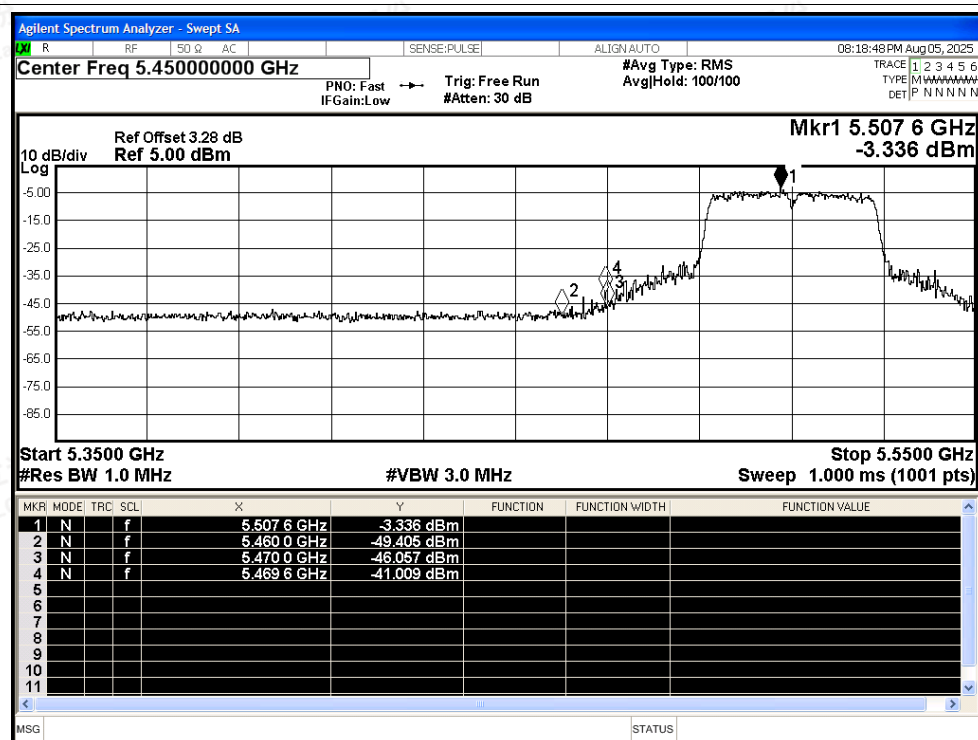

Restrict Band NVNT n40 5510MHz An4 Average

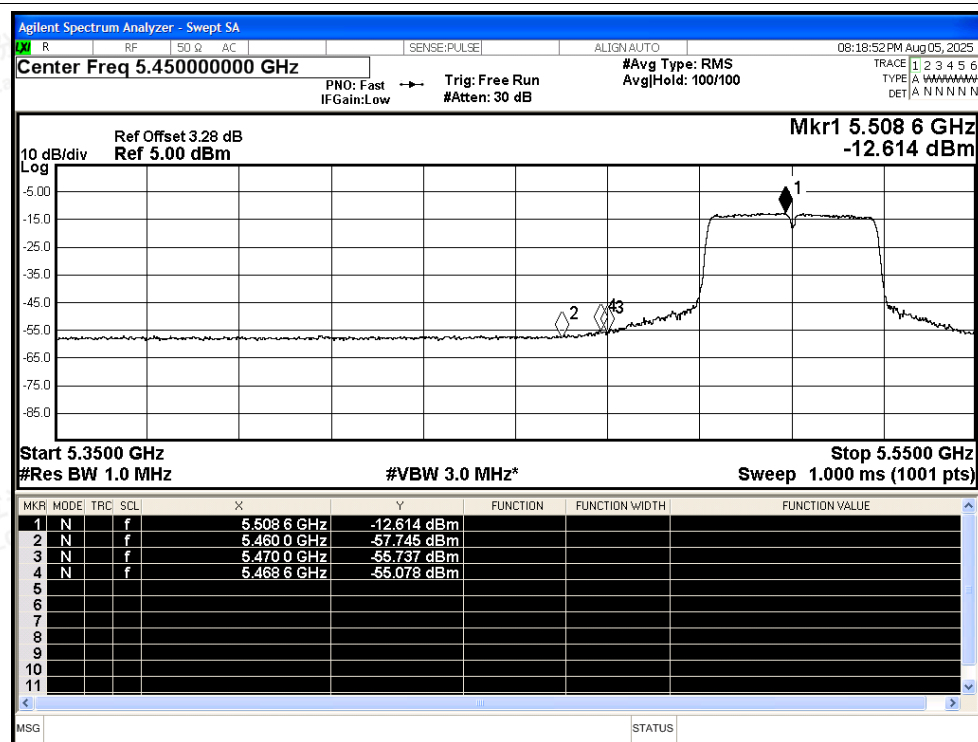

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5670MHz An4 Peak

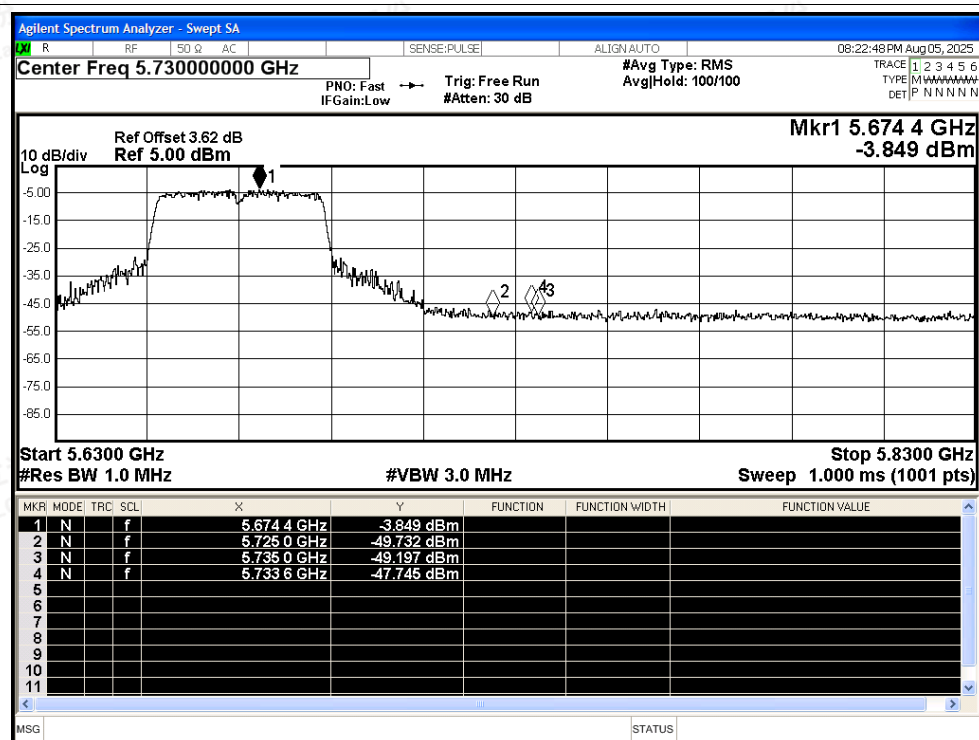

Restrict Band NVNT n40 5670MHz An4 Average

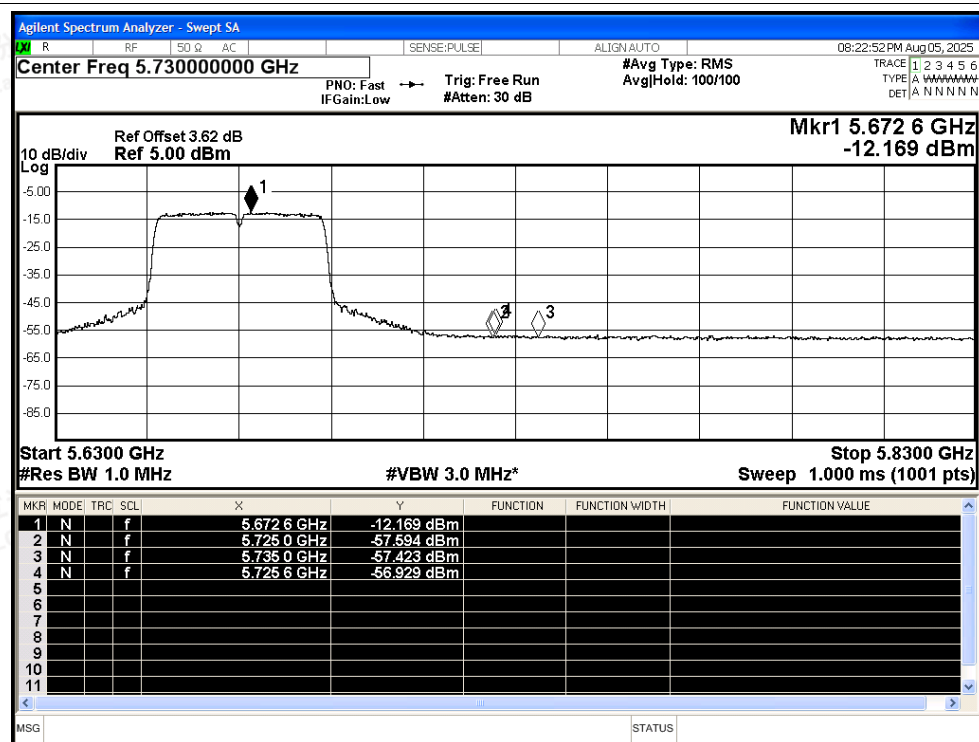

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5500MHz An4 Peak

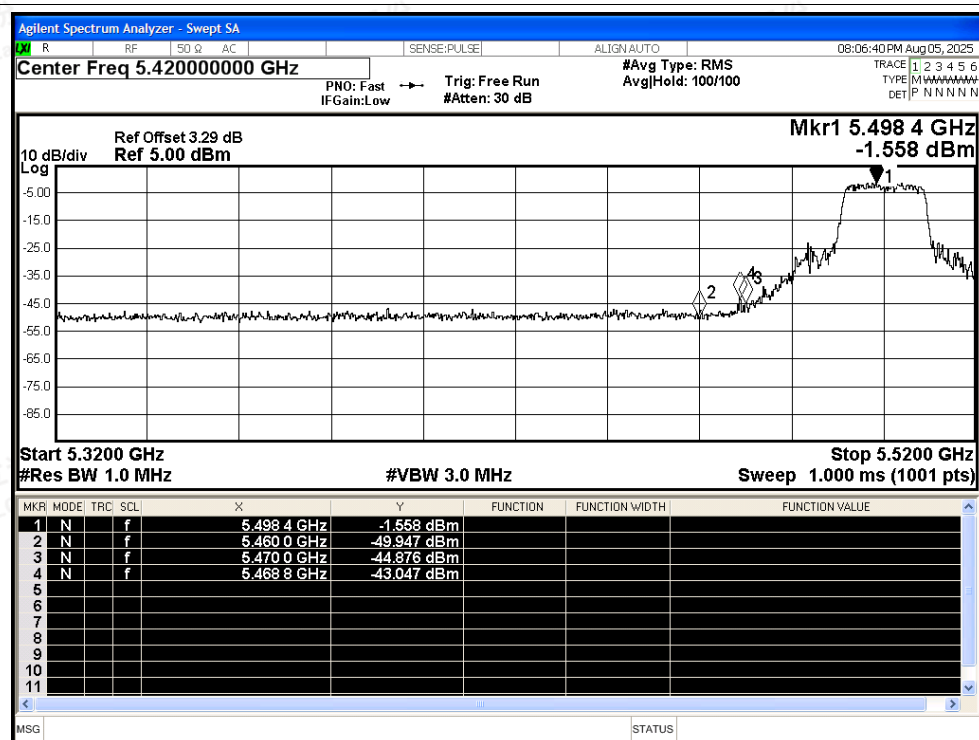

Restrict Band NVNT ac20 5500MHz An4 Average

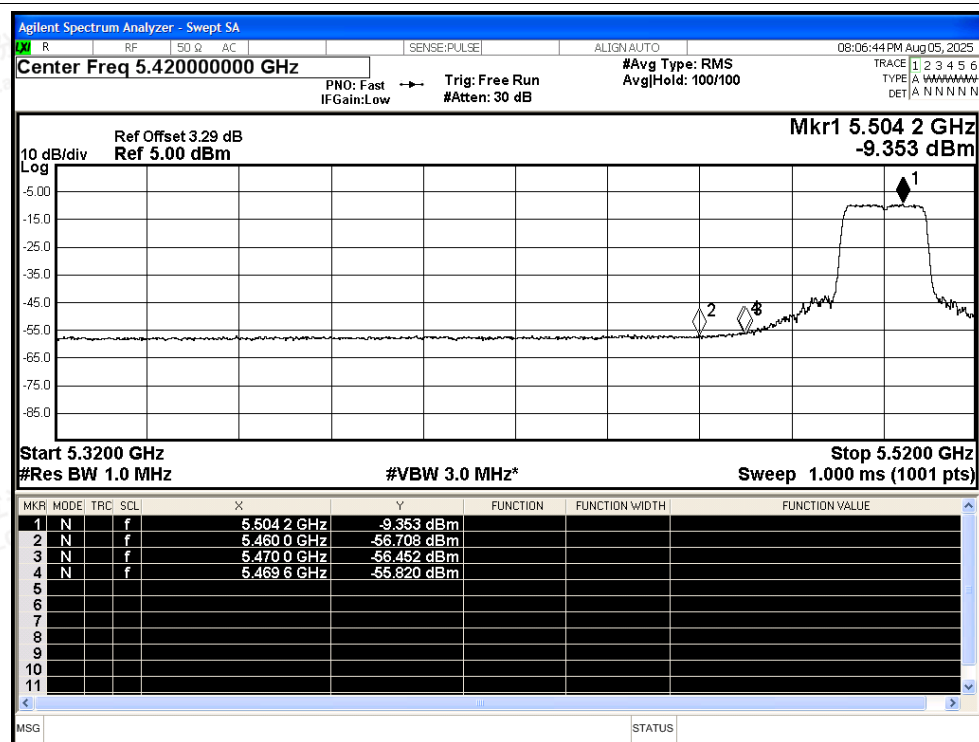

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz An4 Peak

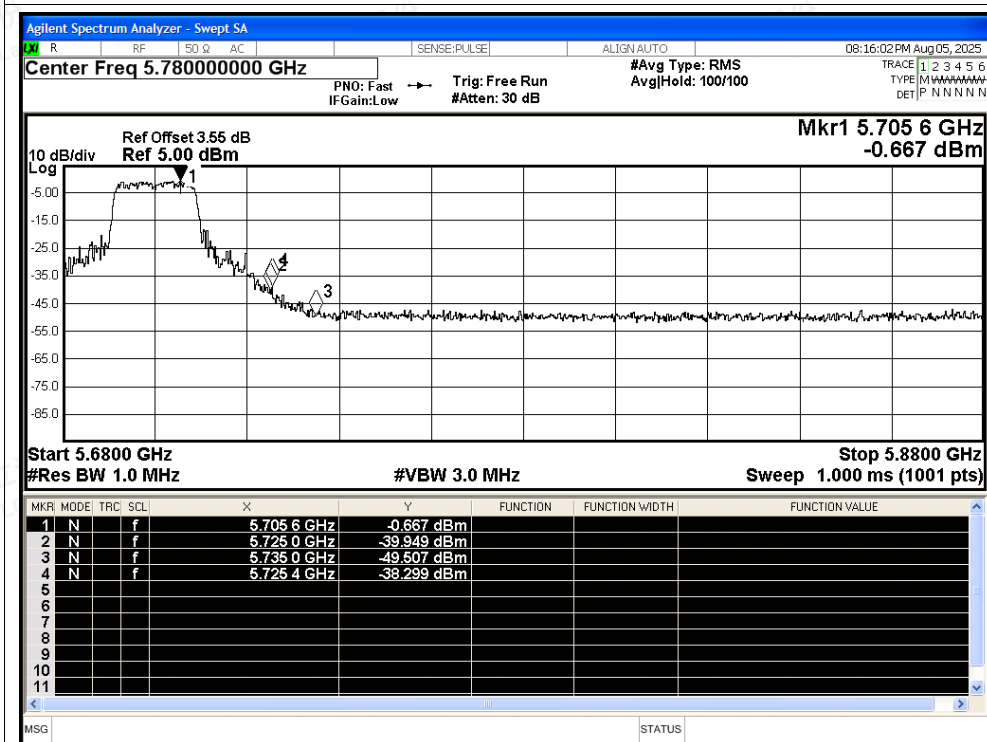

Restrict Band NVNT ac20 5700MHz An4 Average

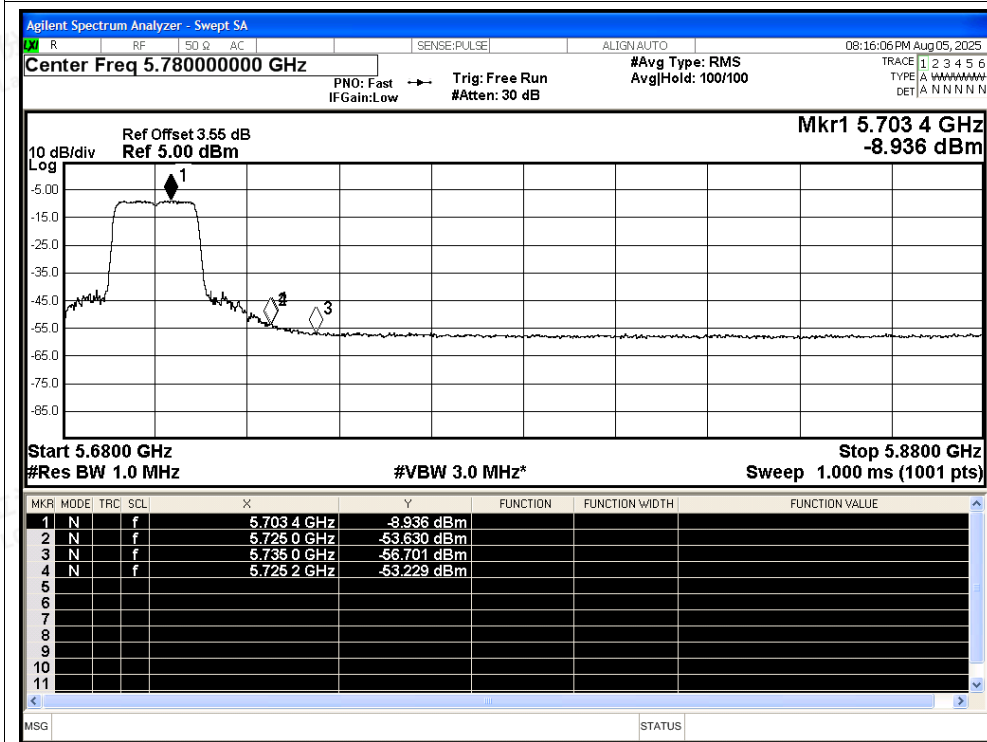

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz An4 Peak

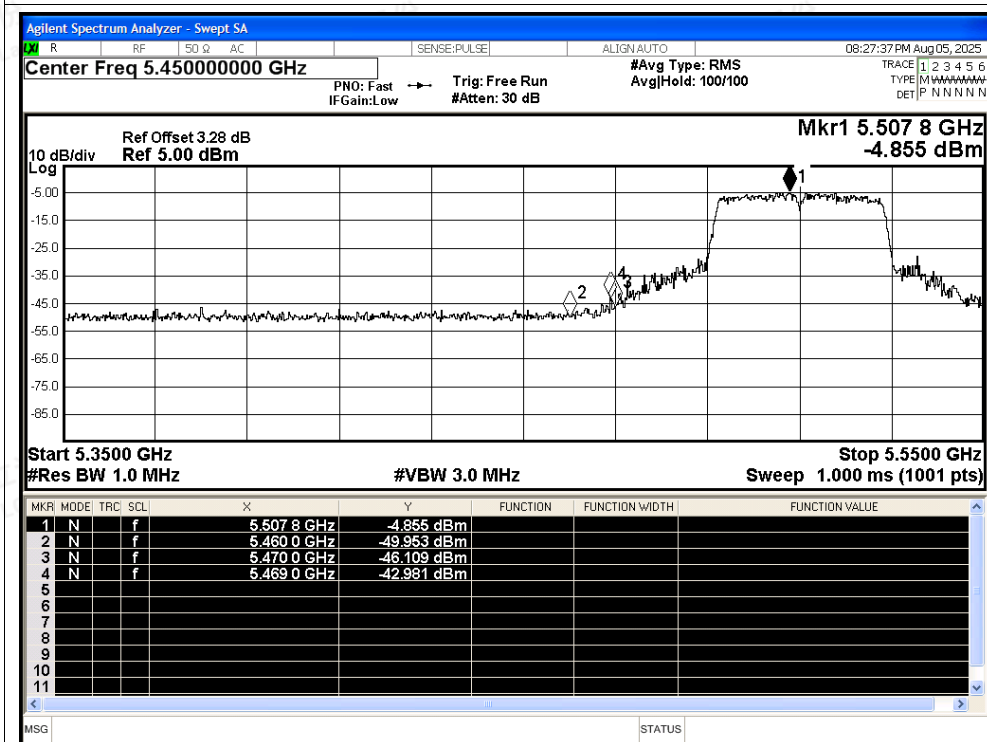

Restrict Band NVNT ac40 5510MHz An4 Average

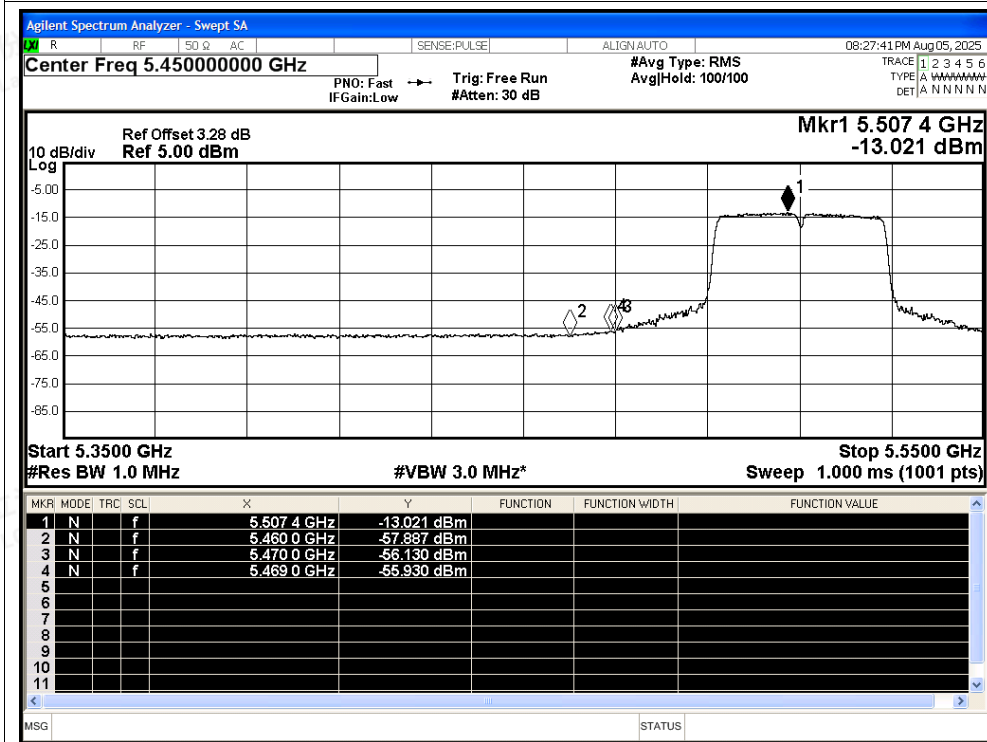

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz An4 Peak

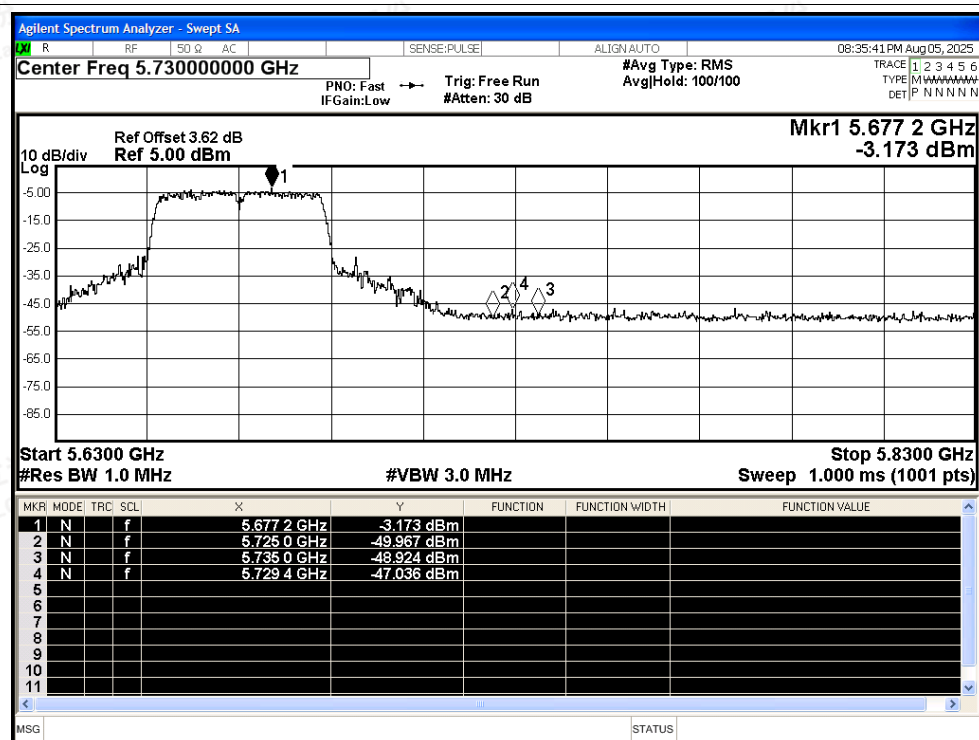

Restrict Band NVNT ac40 5670MHz An4 Average

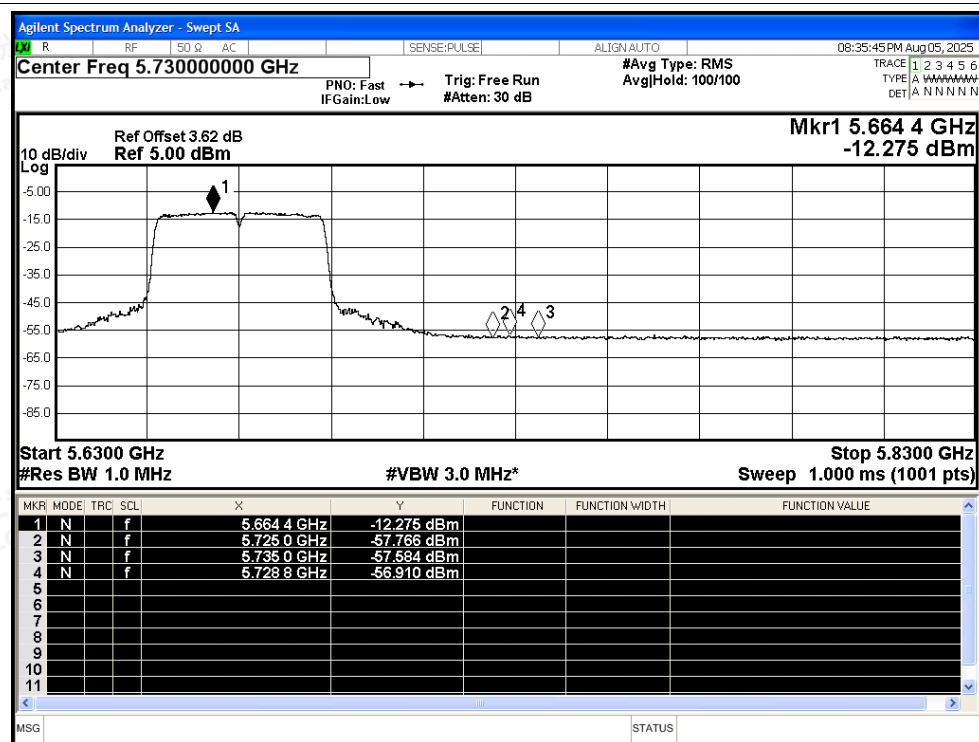

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz An4 Peak

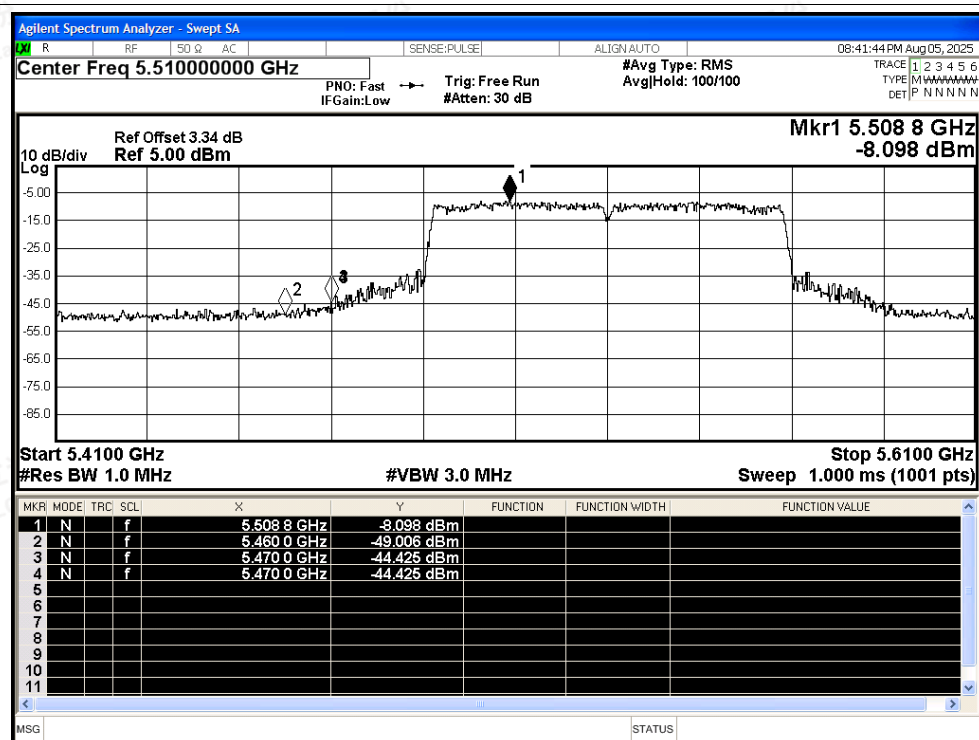

Restrict Band NVNT ac80 5530MHz An4 Average

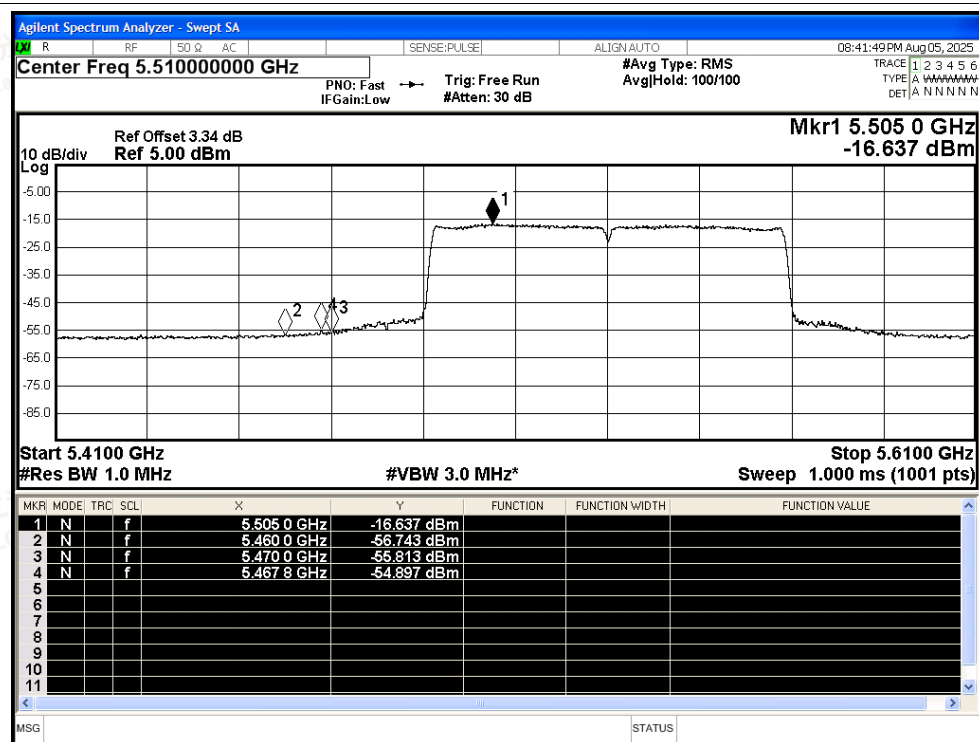

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz An4 Peak

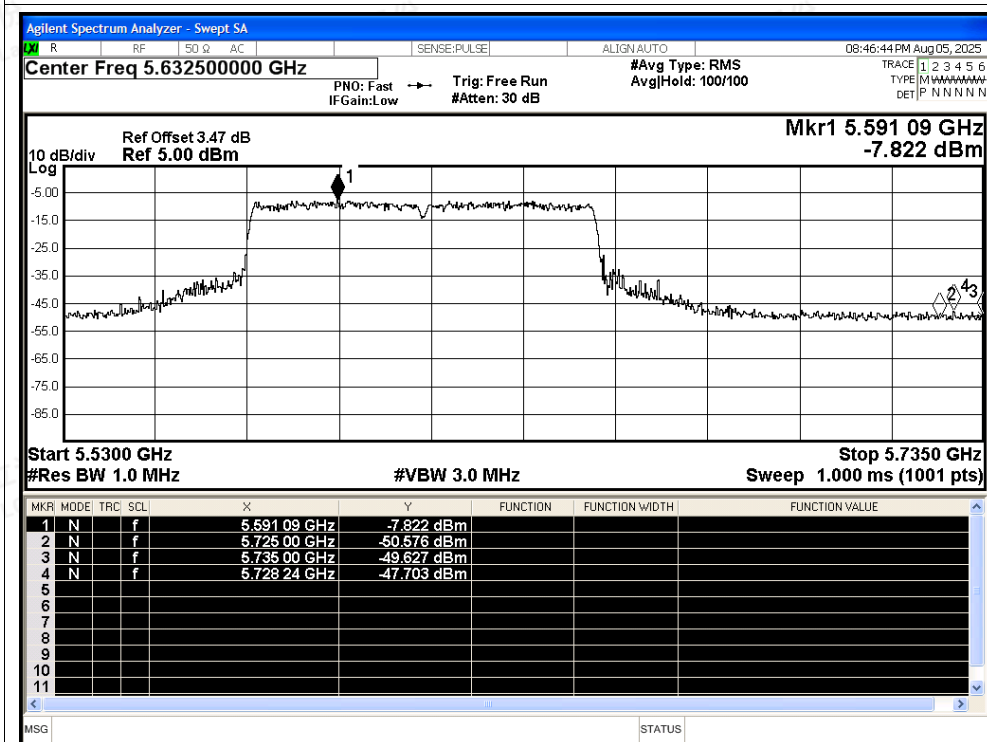

Restrict Band NVNT ac80 5610MHz An4 Average

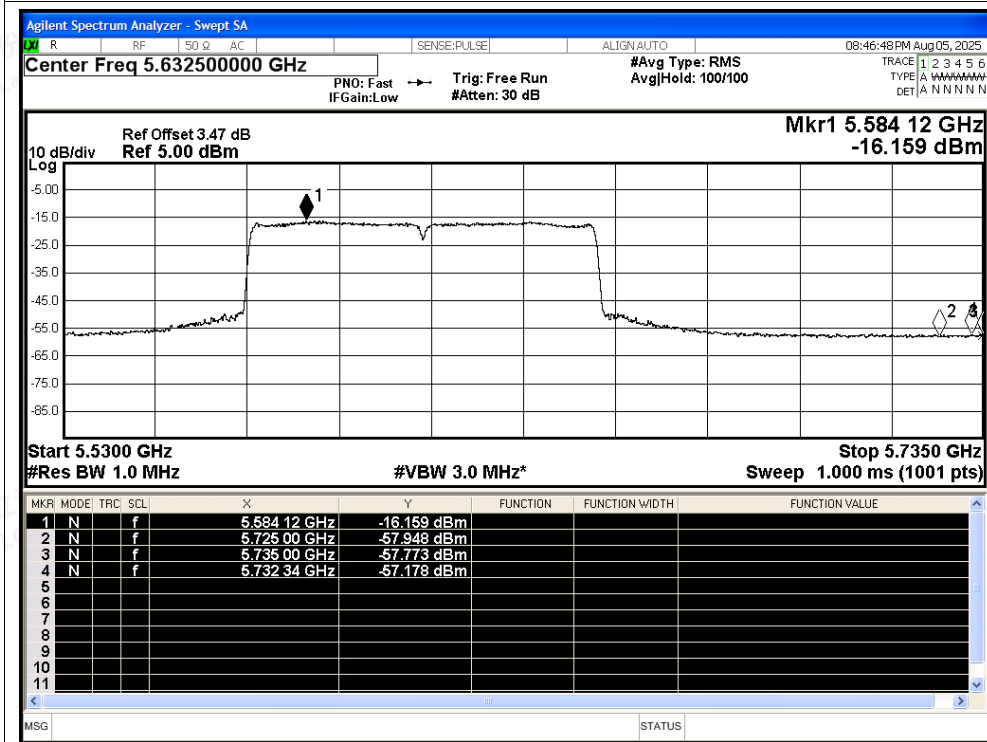

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz An4 Peak

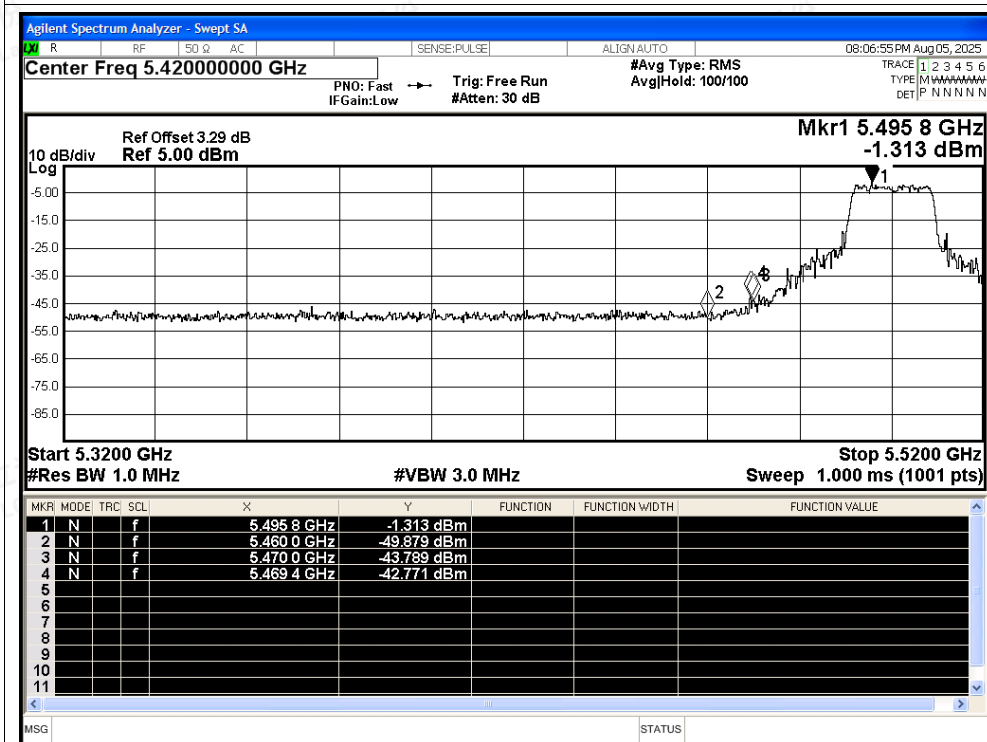

Restrict Band NVNT ax20 5500MHz An4 Average

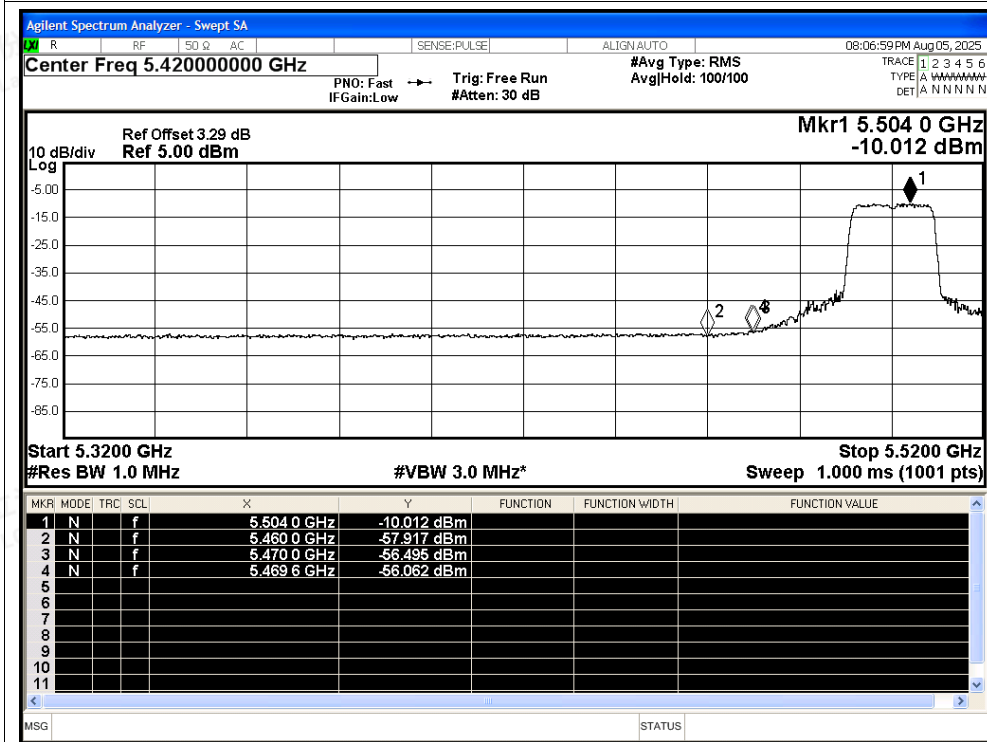

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz An4 Peak

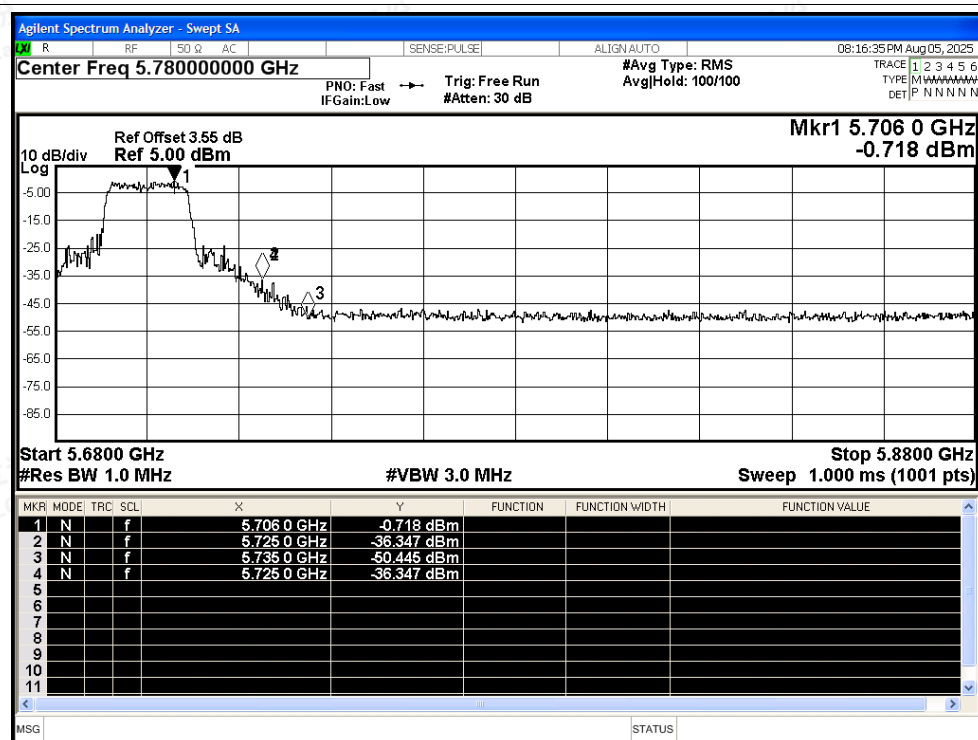

Restrict Band NVNT ax20 5700MHz An4 Average

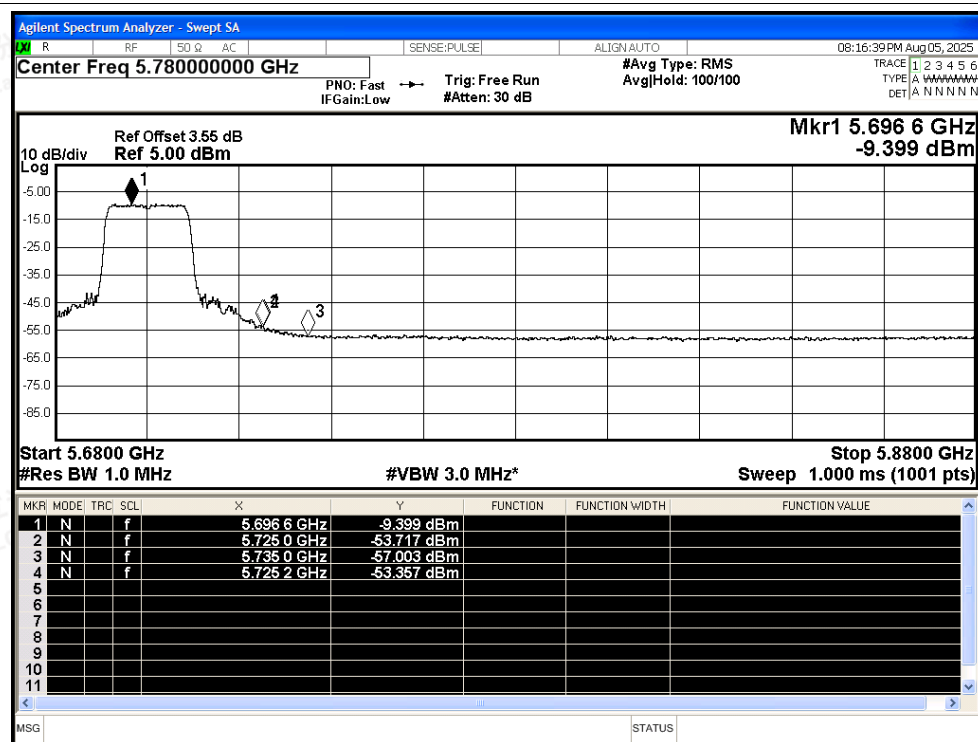

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz An4 Peak

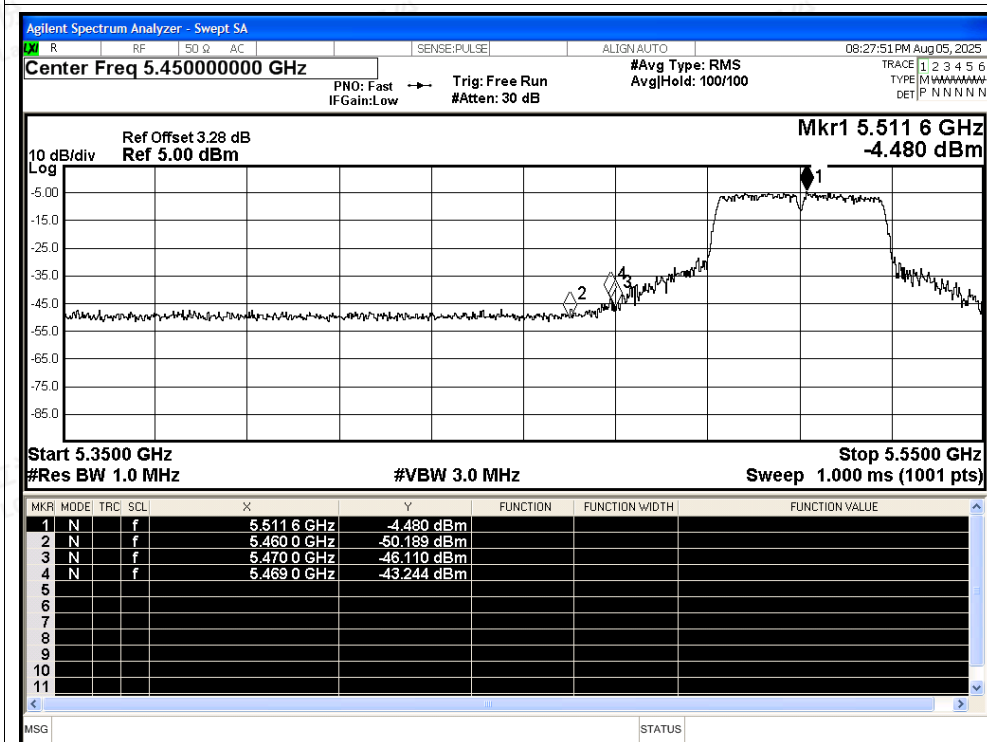

Restrict Band NVNT ax40 5510MHz An4 Average

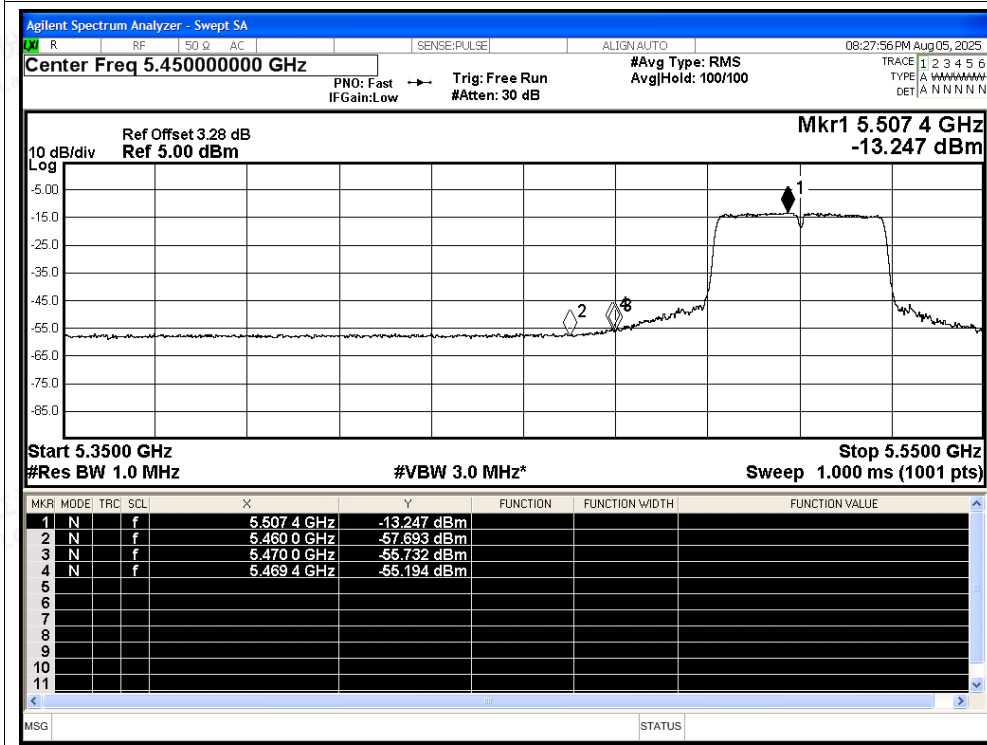

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz An4 Peak

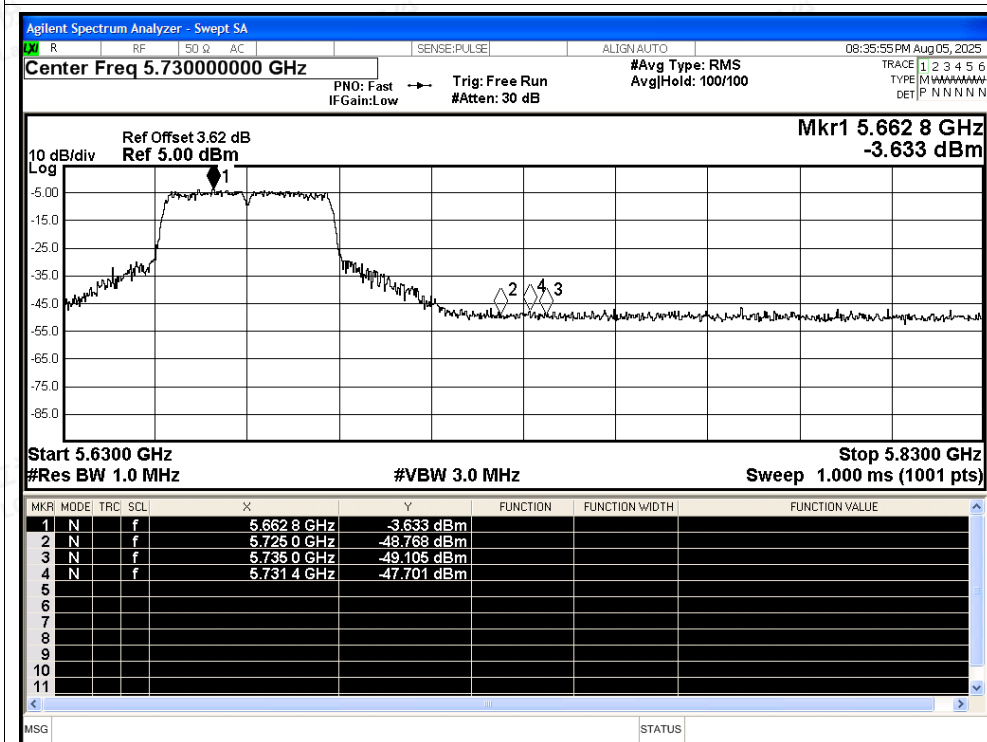

Restrict Band NVNT ax40 5670MHz An4 Average

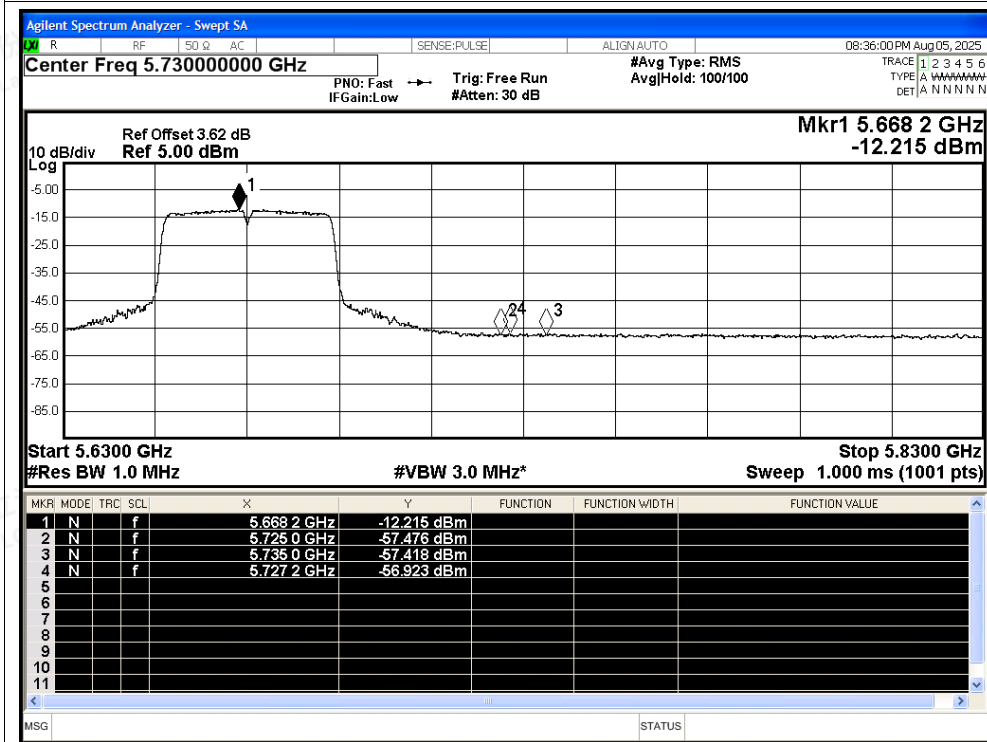

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz An4 Peak

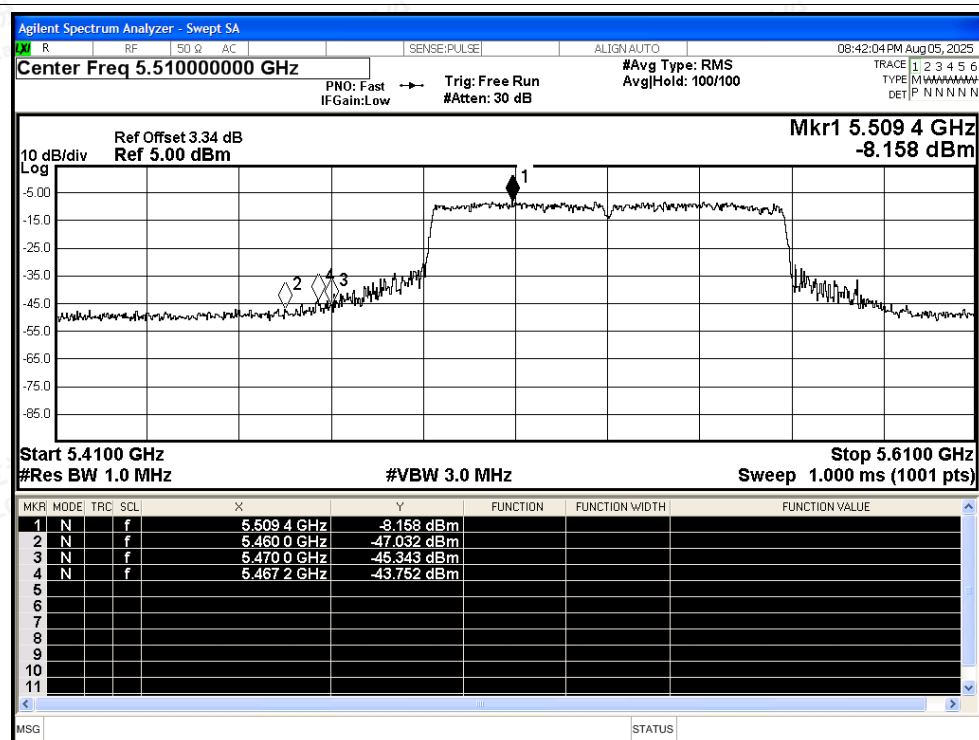

Restrict Band NVNT ax80 5530MHz An4 Average

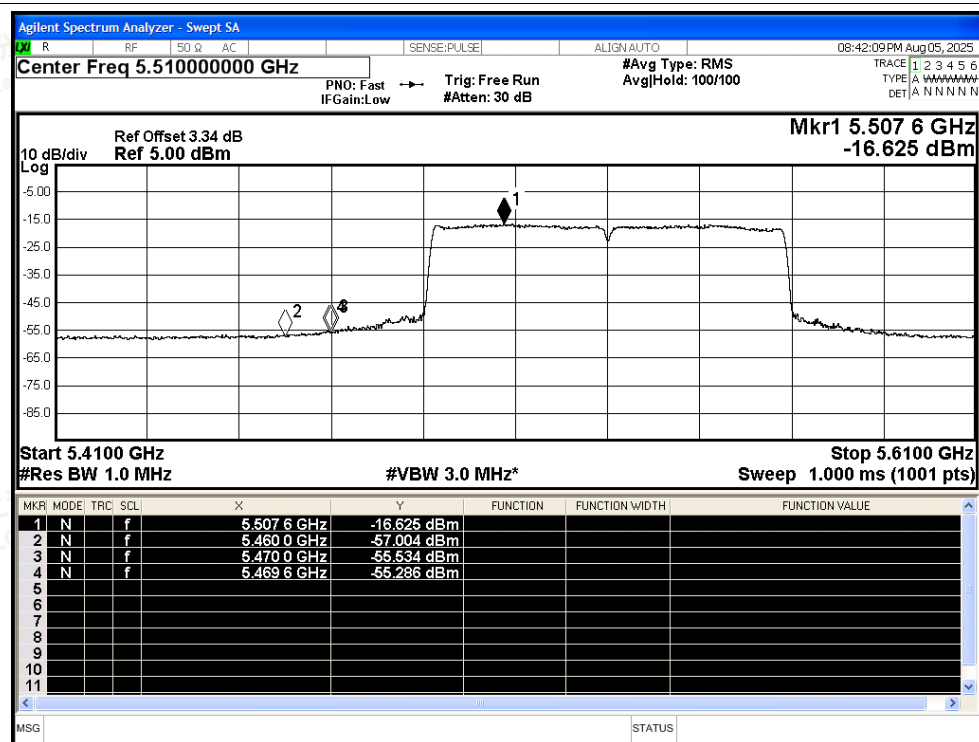

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz An4 Peak

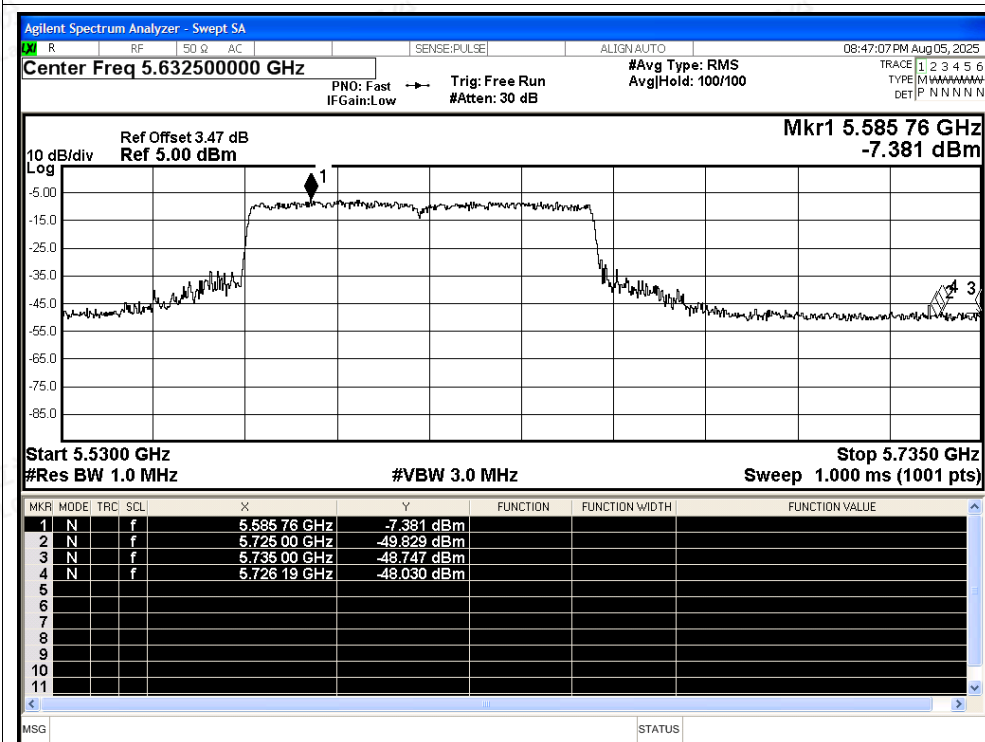

Restrict Band NVNT ax80 5610MHz An4 Average

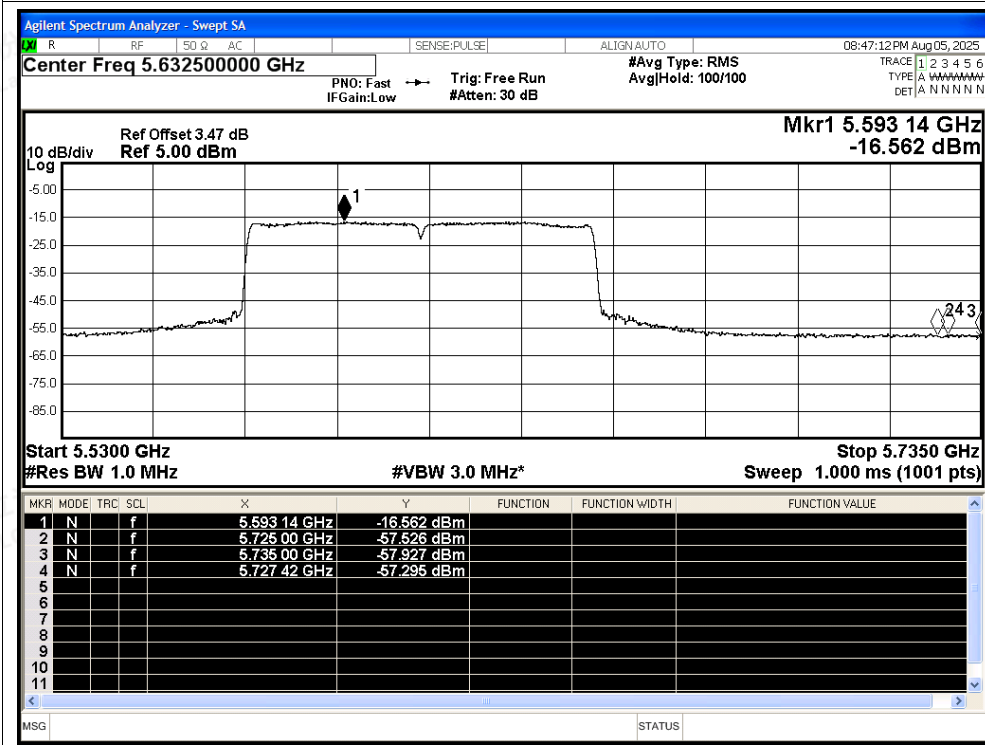

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity