
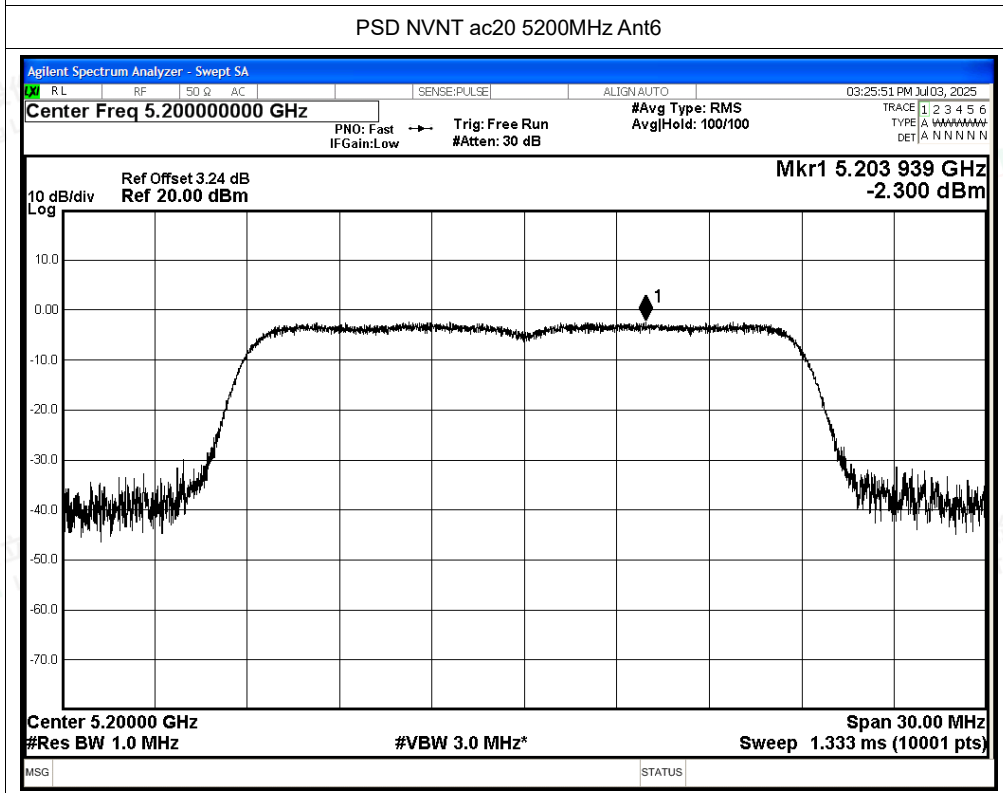



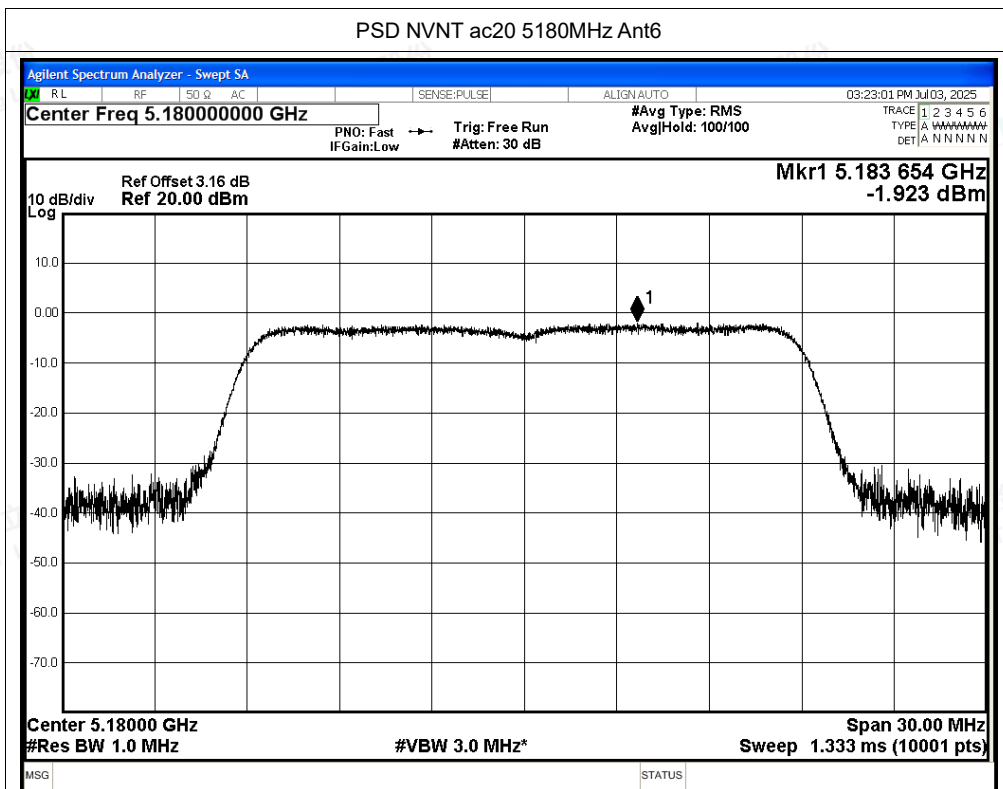


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

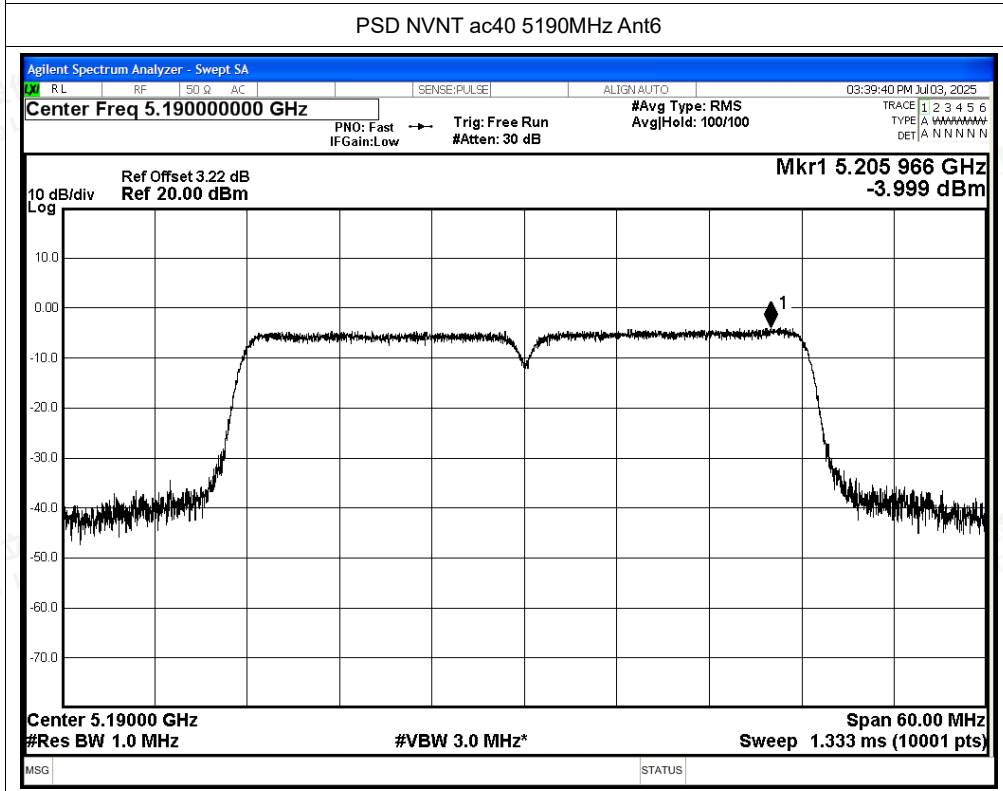
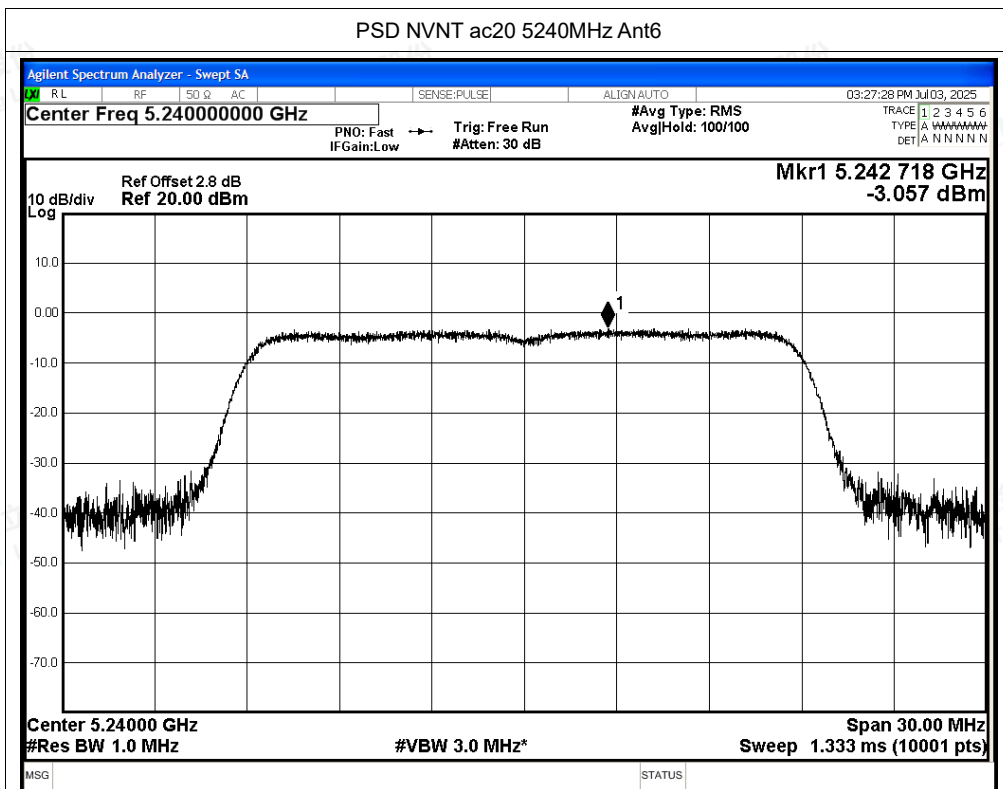


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

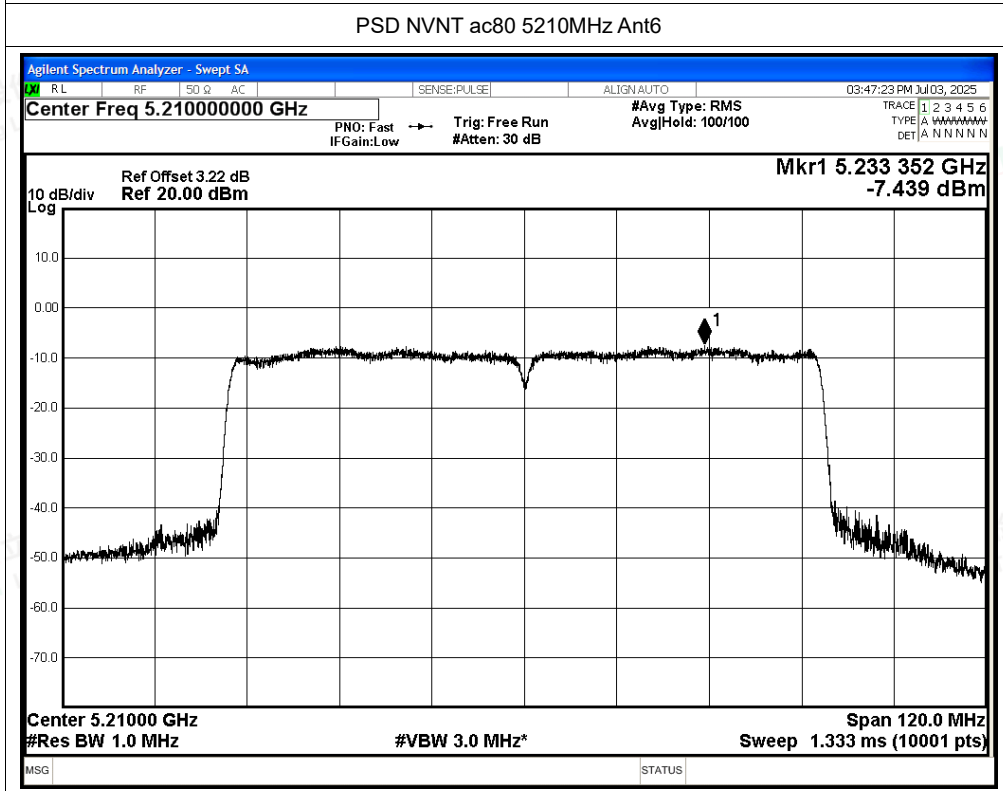
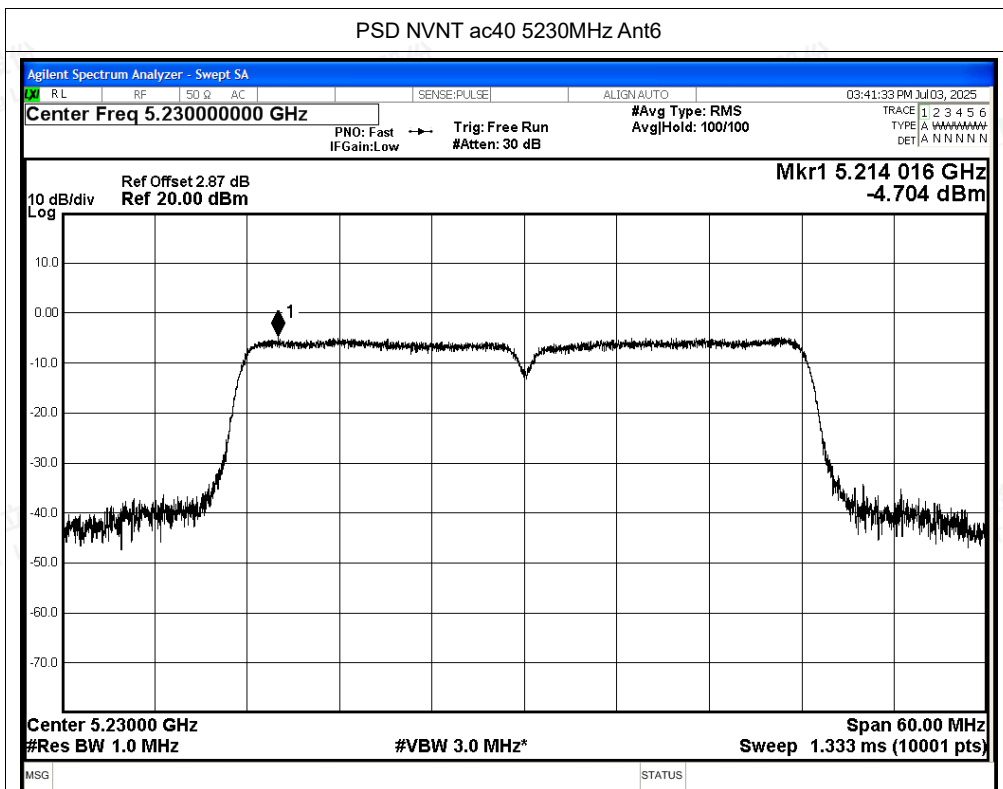


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

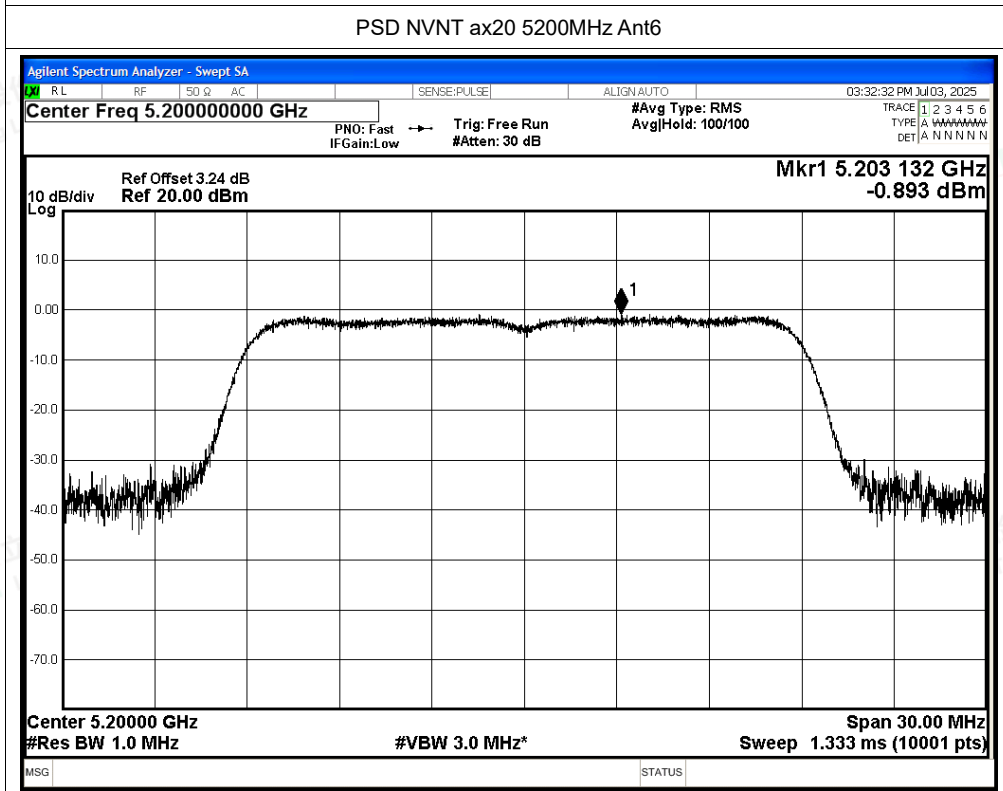
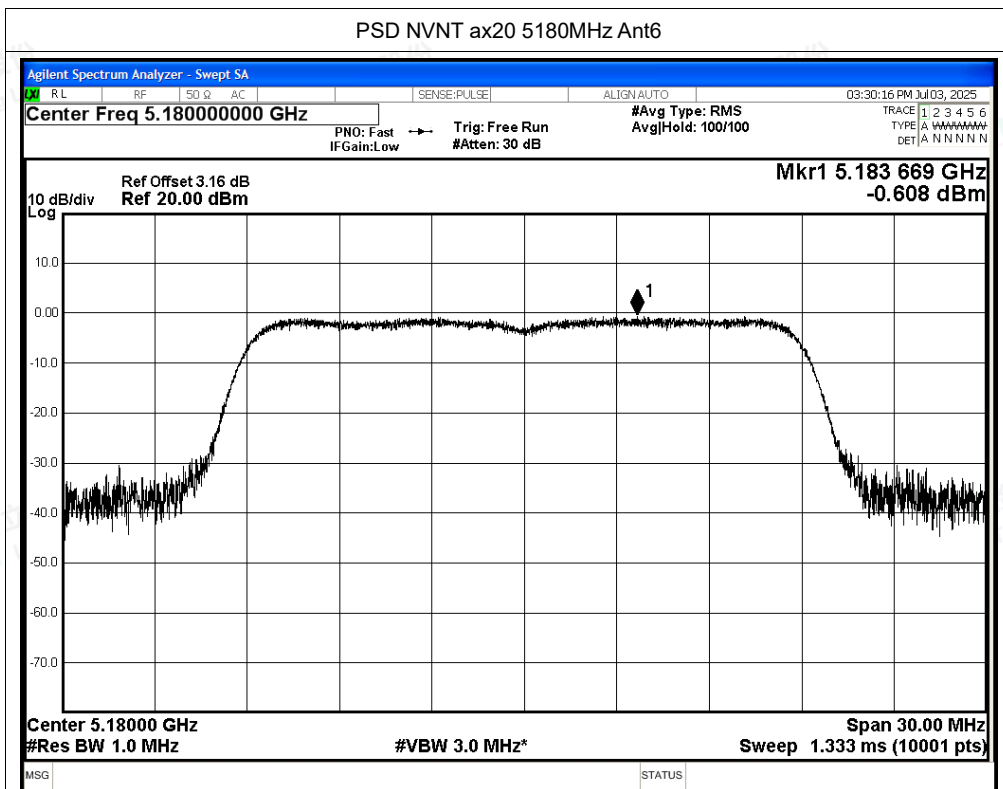


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

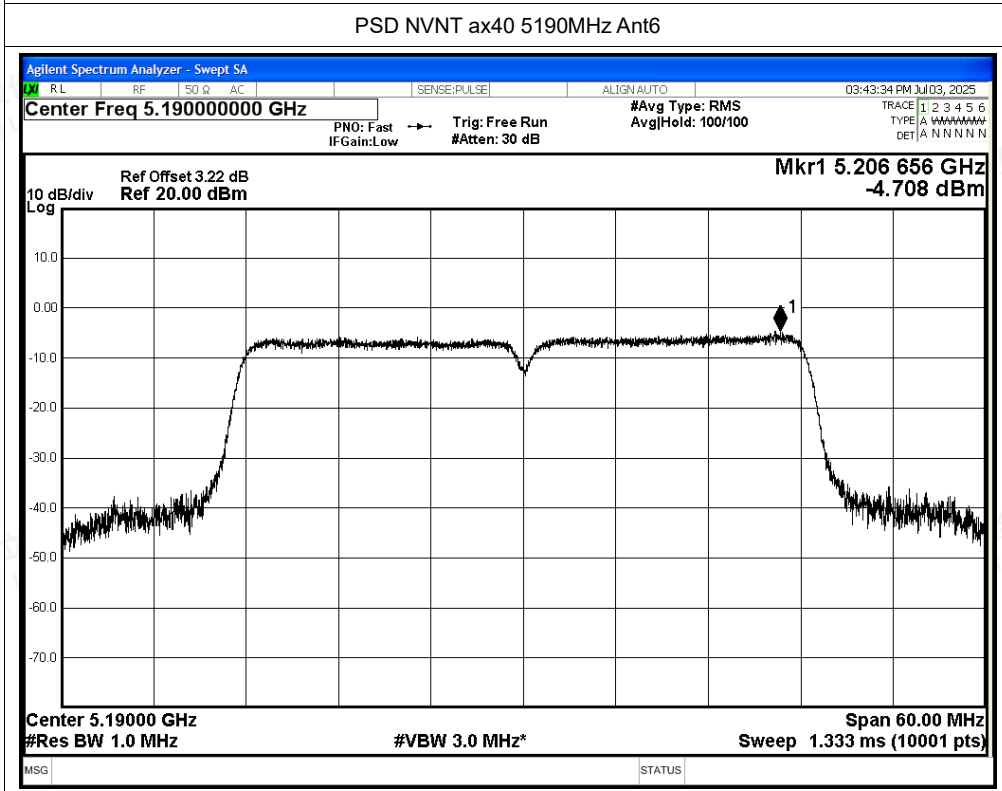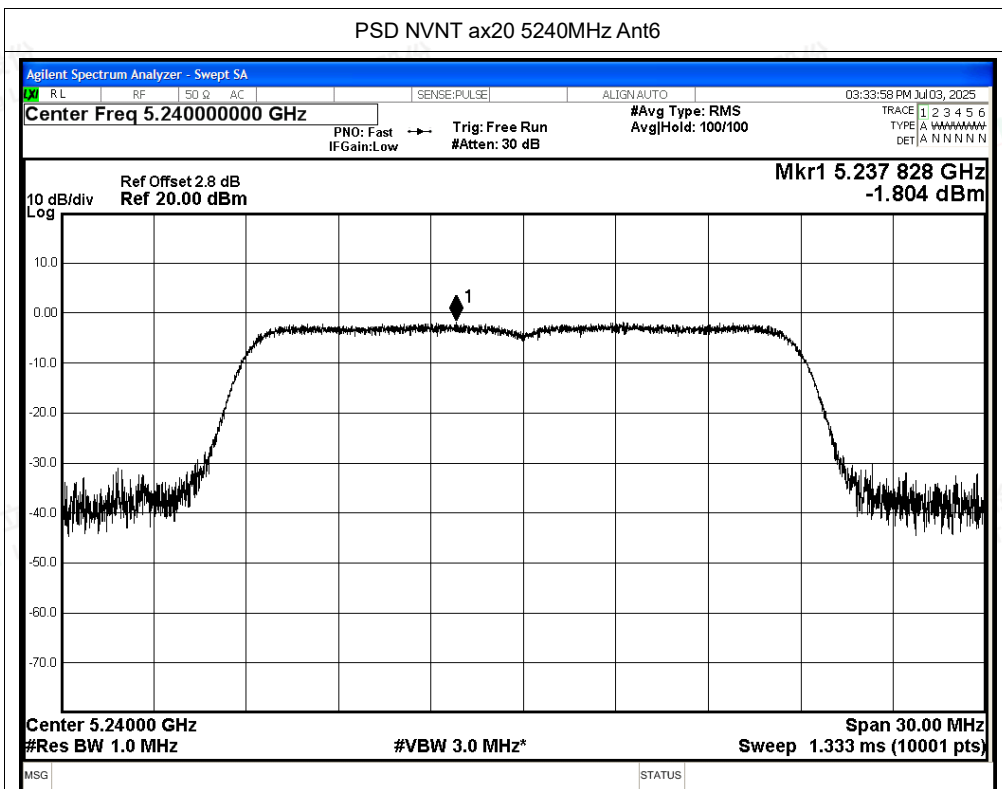

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant6

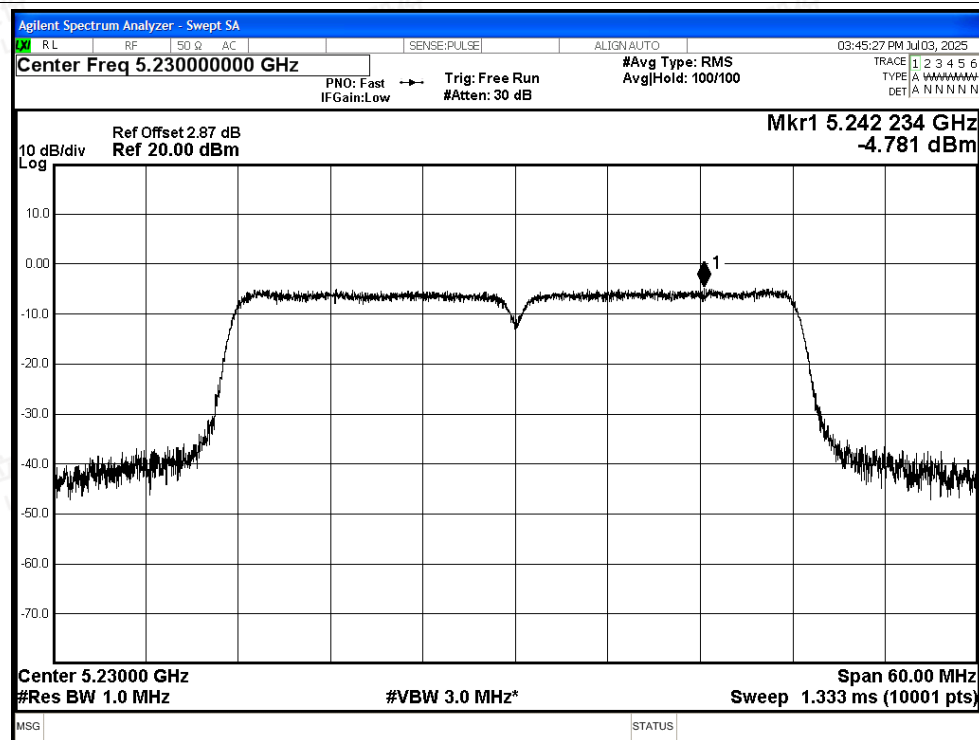

PSD NVNT ax80 5210MHz Ant6

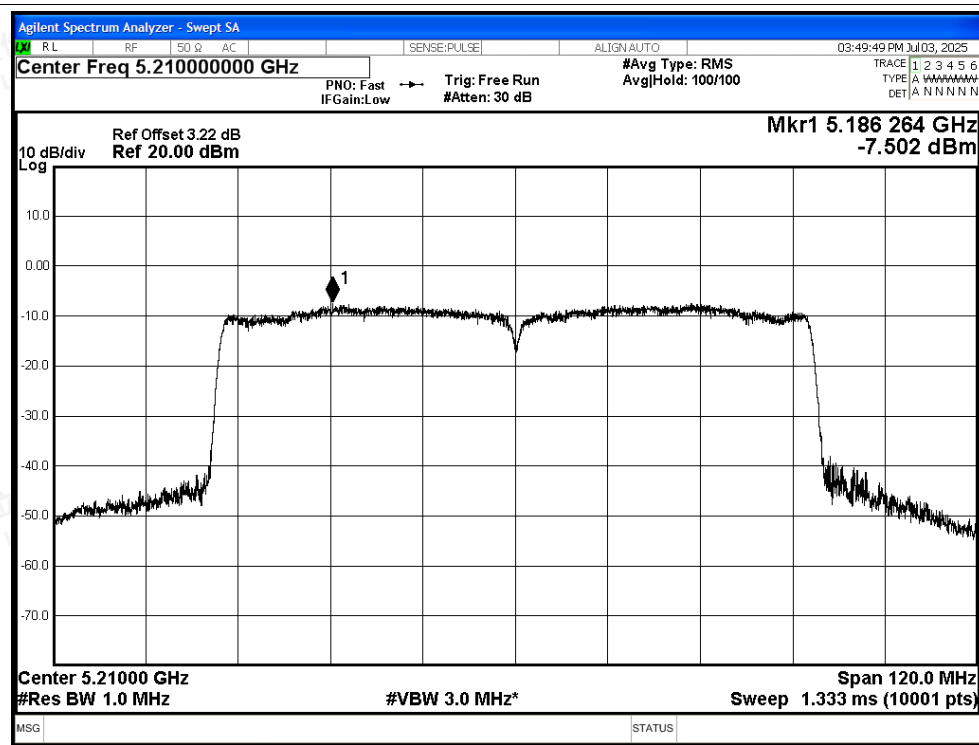

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-49.11	3.39	-	49.39	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-59.08	3.39	0.28	39.70	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-43.32	3.39	-	55.18	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-53.78	3.39	0.28	45.00	Average	54	Pass
NVNT	a	5180	Ant2	5150	-39.66	3.39	-	58.84	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-53.57	3.39	0.28	45.21	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.08	3.39	-	48.42	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.39	3.39	0.24	41.35	Average	54	Pass
NVNT	a	5240	Ant2	5421.12	-46.02	3.39	-	52.48	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.32	-57.27	3.39	0.24	41.47	Average	54	Pass
NVNT	a	5240	Ant2	5460	-51.26	3.39	-	47.24	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-58.26	3.39	0.24	40.48	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-52.06	3.39	-	46.44	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.59	3.39	0.28	40.19	Average	54	Pass
NVNT	n20	5180	Ant2	5146.8	-36.89	3.39	-	61.61	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-50.44	3.39	0.28	48.34	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-40.49	3.39	-	58.01	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-51	3.39	0.28	47.78	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-49.53	3.39	-	48.97	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-58.3	3.39	0.28	40.48	Average	54	Pass
NVNT	n20	5240	Ant2	5412.24	-47.43	3.39	-	51.07	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5369.04	-57.41	3.39	0.28	41.37	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-50.98	3.39	-	47.52	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-58.51	3.39	0.28	40.27	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-49.82	3.39	-	48.68	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.45	3.39	0.54	40.59	Average	54	Pass
NVNT	n40	5190	Ant2	5149.7	-36.34	3.39	-	62.16	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-52.62	3.39	0.54	46.42	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-36.34	3.39	-	62.16	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-52.62	3.39	0.54	46.42	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-49.37	3.39	-	49.13	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.86	3.39	0.53	41.17	Average	54	Pass
NVNT	n40	5230	Ant2	5431.65	-47.32	3.39	-	51.18	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5397.63	-57.52	3.39	0.53	41.51	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-50.59	3.39	-	47.91	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.41	3.39	0.53	40.62	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-50.1	3.39	-	48.40	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-58.5	3.39	0.28	40.28	Average	54	Pass
NVNT	ac20	5180	Ant2	5148.2	-39.17	3.39	-	59.33	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-52.51	3.39	0.28	46.27	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-37.83	3.39	-	60.67	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-51.35	3.39	0.28	47.43	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-50.05	3.39	-	48.45	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.68	3.39	0.28	41.10	Average	54	Pass
NVNT	ac20	5240	Ant2	5369.76	-47.27	3.39	-	51.23	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5352.48	-57.25	3.39	0.28	41.53	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.81	3.39	-	48.69	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.08	3.39	0.28	40.70	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.65	3.39	-	47.85	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-59.08	3.39	0.55	39.97	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-39.1	3.39	-	59.40	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-52.34	3.39	0.55	46.71	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-39.1	3.39	-	59.4	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-52.53	3.39	0.55	46.52	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-49.51	3.39	-	48.99	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.96	3.39	0.55	41.09	Average	54	Pass
NVNT	ac40	5230	Ant2	5371.71	-47.48	3.39	-	51.02	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5402.49	-57.37	3.39	0.55	41.68	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-50.05	3.39	-	48.45	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.15	3.39	0.55	40.90	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.4	3.39	-	50.10	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-57.61	3.39	0.99	41.88	Average	54	Pass
NVNT	ac80	5210	Ant2	5430.96	-47.23	3.39	-	51.27	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5364.96	-56.97	3.39	0.99	42.52	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-50.81	3.39	-	47.69	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-58.02	3.39	0.99	41.47	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.15	3.39	-	47.35	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-59.52	3.39	0.99	39.97	Average	54	Pass
NVNT	ac80	5210	Ant2	5146.22	-40.07	3.39	-	58.43	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.01	-52.01	3.39	0.99	47.48	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.04	3.39	-	56.46	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-52.12	3.39	0.99	47.37	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-50.75	3.39	-	47.75	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.77	3.39	0.28	40.01	Average	54	Pass
NVNT	ax20	5180	Ant2	5149.6	-40.62	3.39	-	57.88	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5148.2	-52.49	3.39	0.28	46.29	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-42.38	3.39	-	56.12	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5180	Ant2	5150	-52.65	3.39	0.28	46.13	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-49.8	3.39	-	48.70	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-58.17	3.39	0.28	40.61	Average	54	Pass
NVNT	ax20	5240	Ant2	5406	-47.64	3.39	-	50.86	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5352	-57.22	3.39	0.28	41.56	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-50.01	3.39	-	48.49	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-58.56	3.39	0.28	40.22	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-50.53	3.39	-	47.97	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-59.18	3.39	0.53	39.85	Average	54	Pass
NVNT	ax40	5190	Ant2	5148.24	-36.55	3.39	-	61.95	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-52.47	3.39	0.53	46.56	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-40.83	3.39	-	57.67	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-52.47	3.39	0.53	46.56	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-50.86	3.39	-	47.64	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-58.73	3.39	0.54	40.31	Average	54	Pass
NVNT	ax40	5230	Ant2	5386.29	-46.45	3.39	-	52.05	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5352.27	-57.46	3.39	0.54	41.58	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-50.47	3.39	-	48.03	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-57.81	3.39	0.54	41.23	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-50.03	3.39	-	48.47	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-57.67	3.39	0.99	41.82	Average	54	Pass
NVNT	ax80	5210	Ant2	5411.16	-46.66	3.39	-	51.84	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5369.91	-57.06	3.39	0.99	42.43	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-51.47	3.39	-	47.03	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-58.37	3.39	0.99	41.12	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-50.77	3.39	-	47.73	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.63	3.39	0.99	40.86	Average	54	Pass
NVNT	ax80	5210	Ant2	5149.38	-38.05	3.39	-	60.45	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-53	3.39	0.99	46.49	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-44.34	3.39	-	54.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-52.88	3.39	0.99	46.61	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

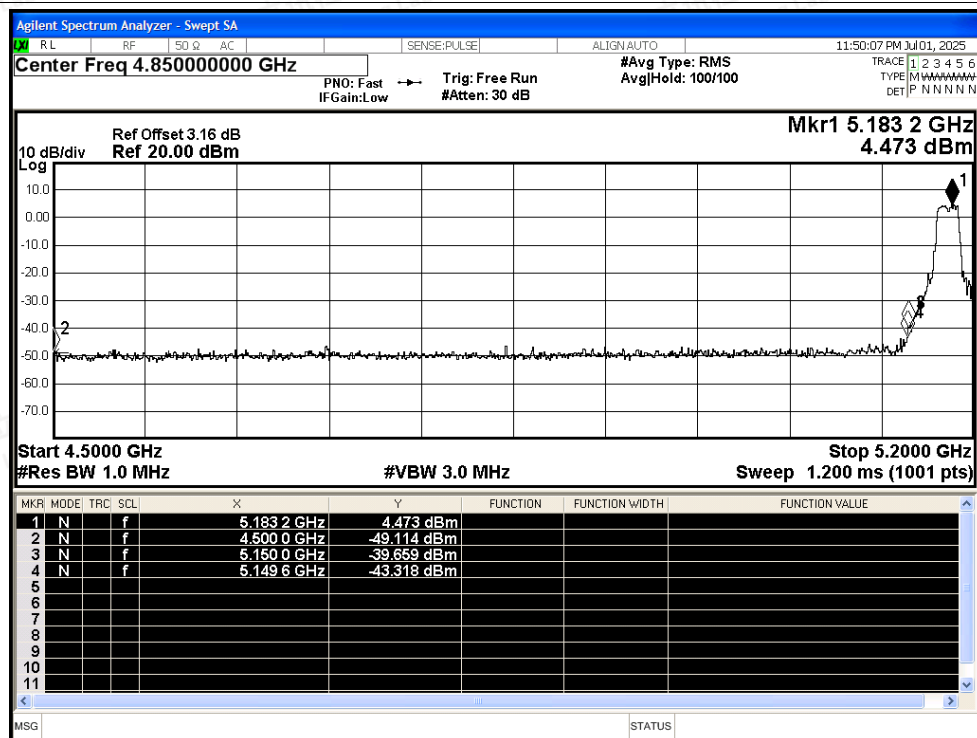

Restrict Band NVNT a 5180MHz Ant2 Average

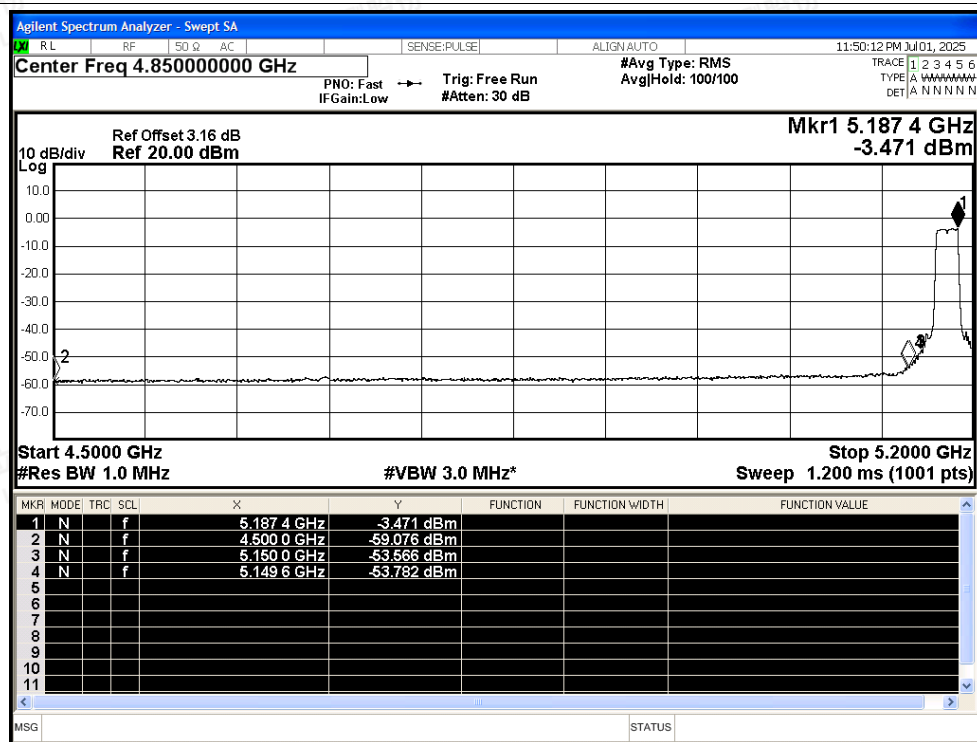

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

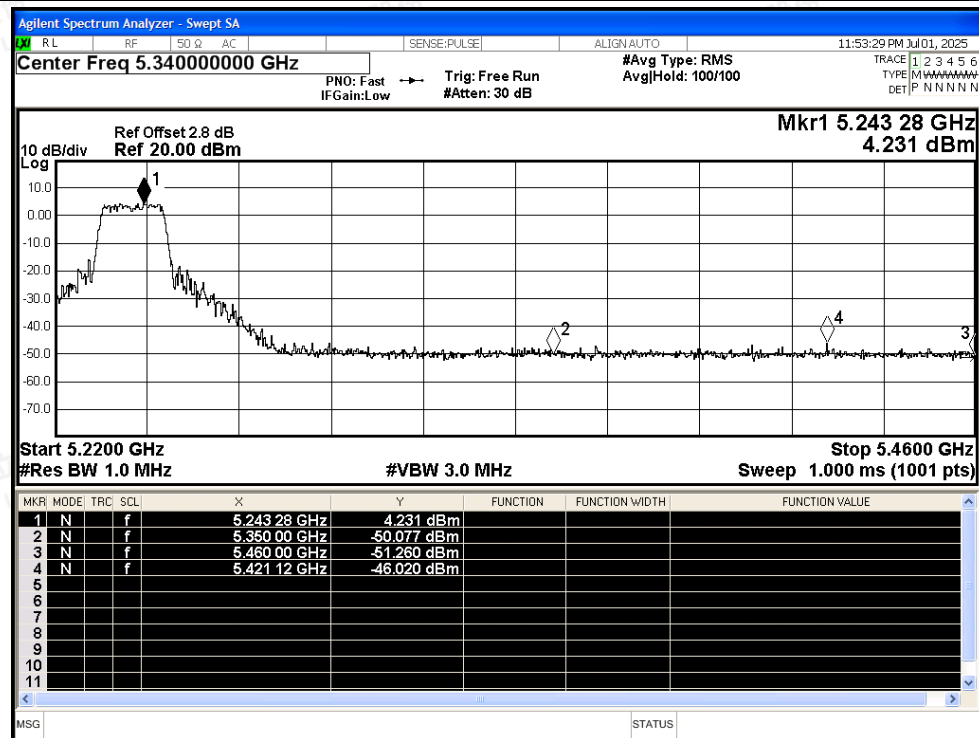

Restrict Band NVNT a 5240MHz Ant2 Average

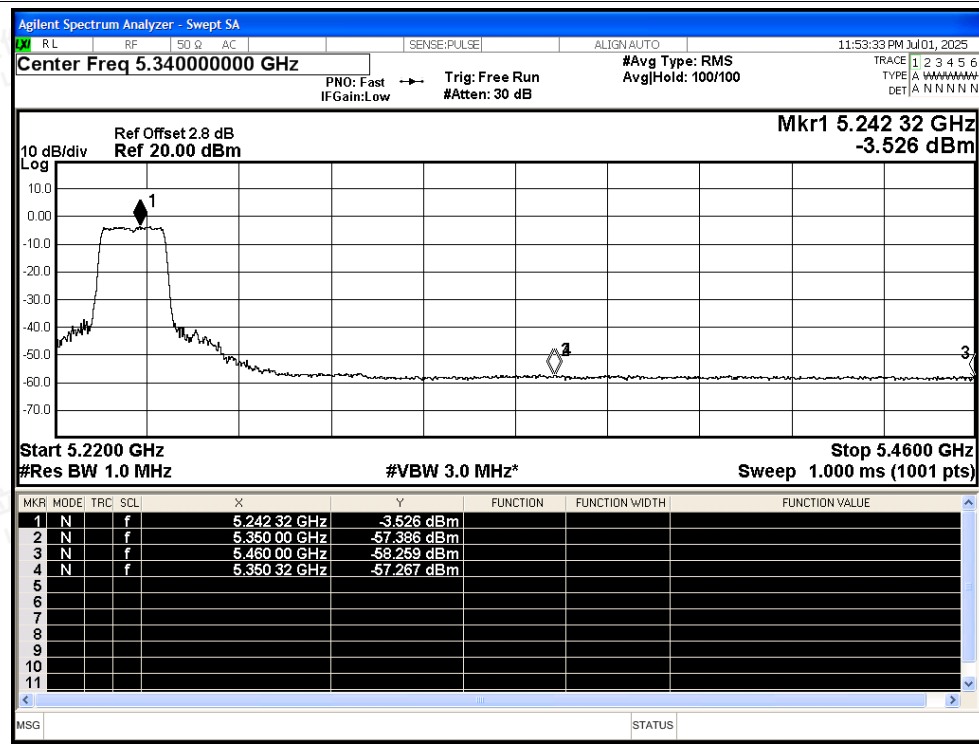

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

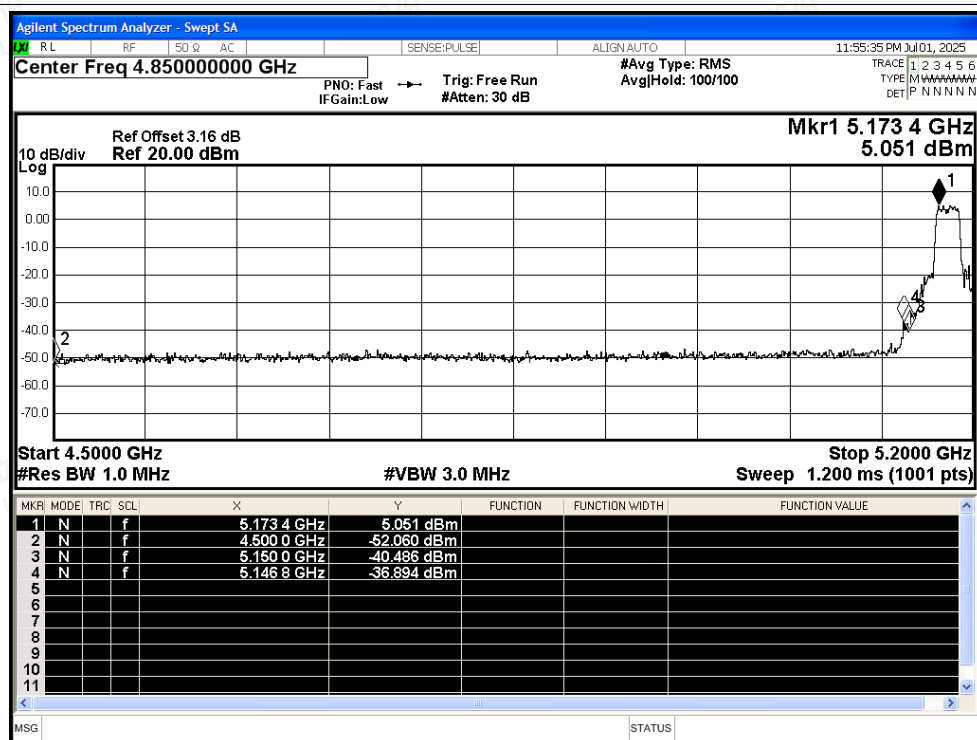

Restrict Band NVNT n20 5180MHz Ant2 Average

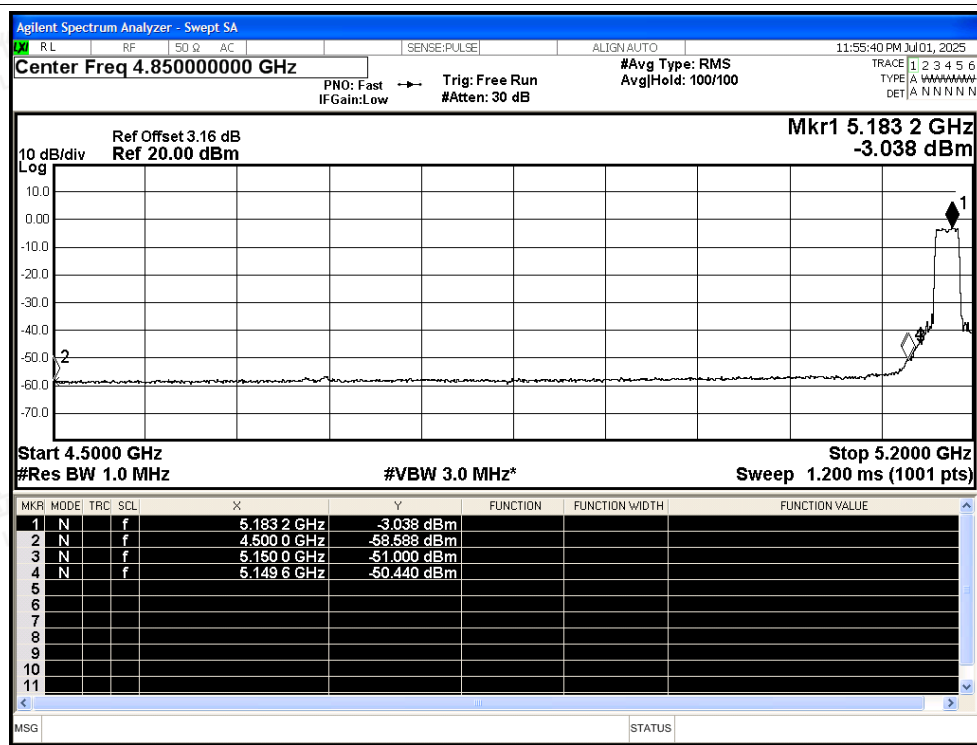

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

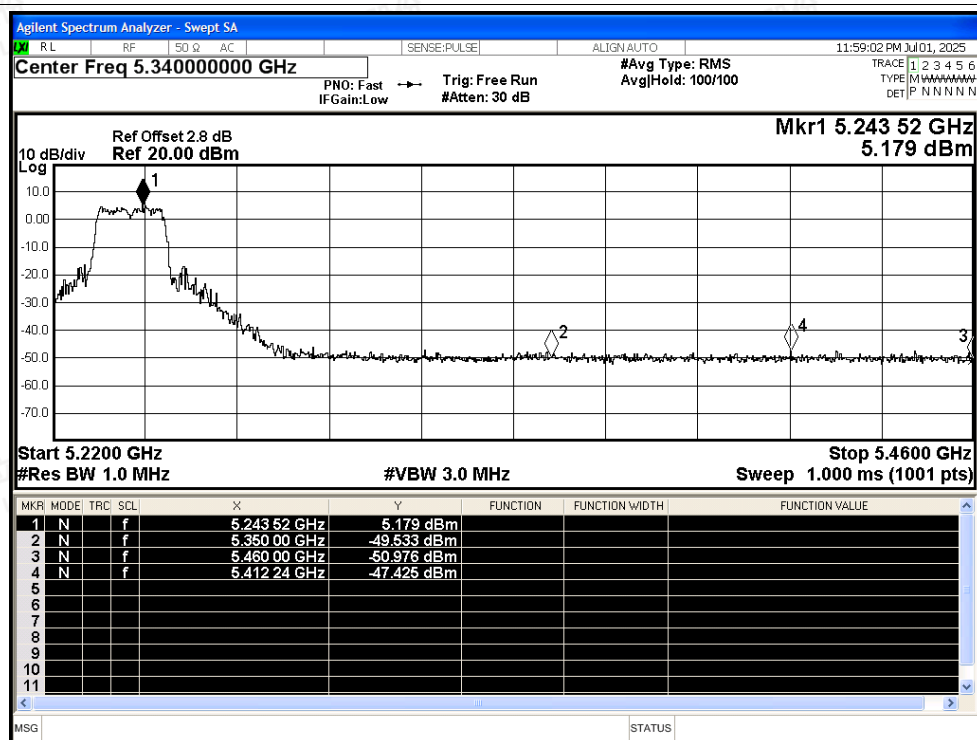

Restrict Band NVNT n20 5240MHz Ant2 Average

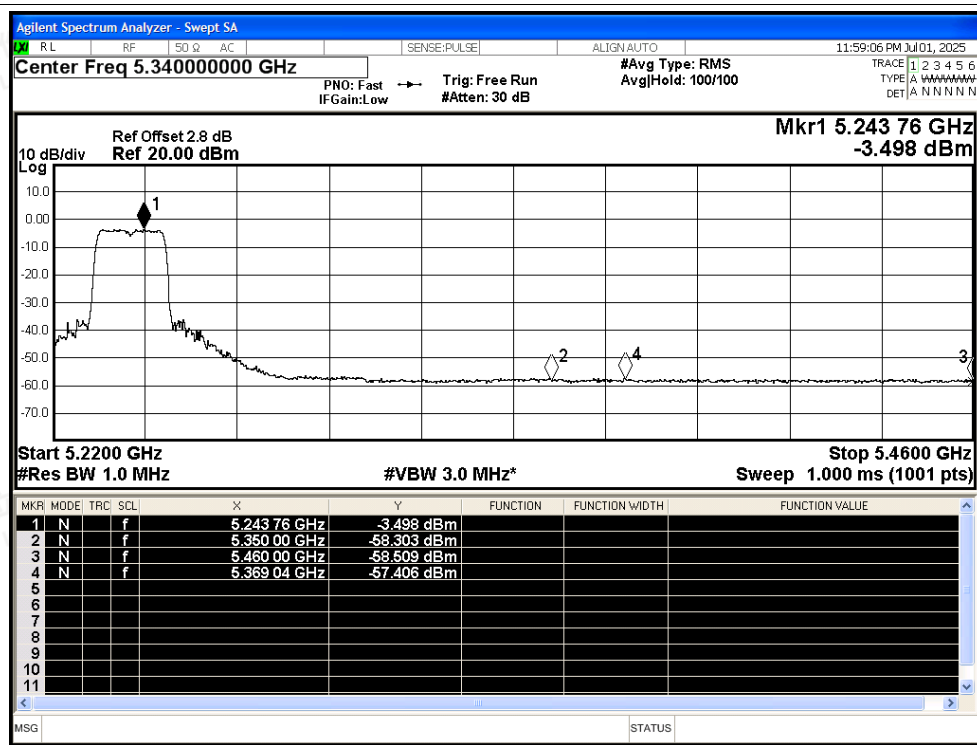

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

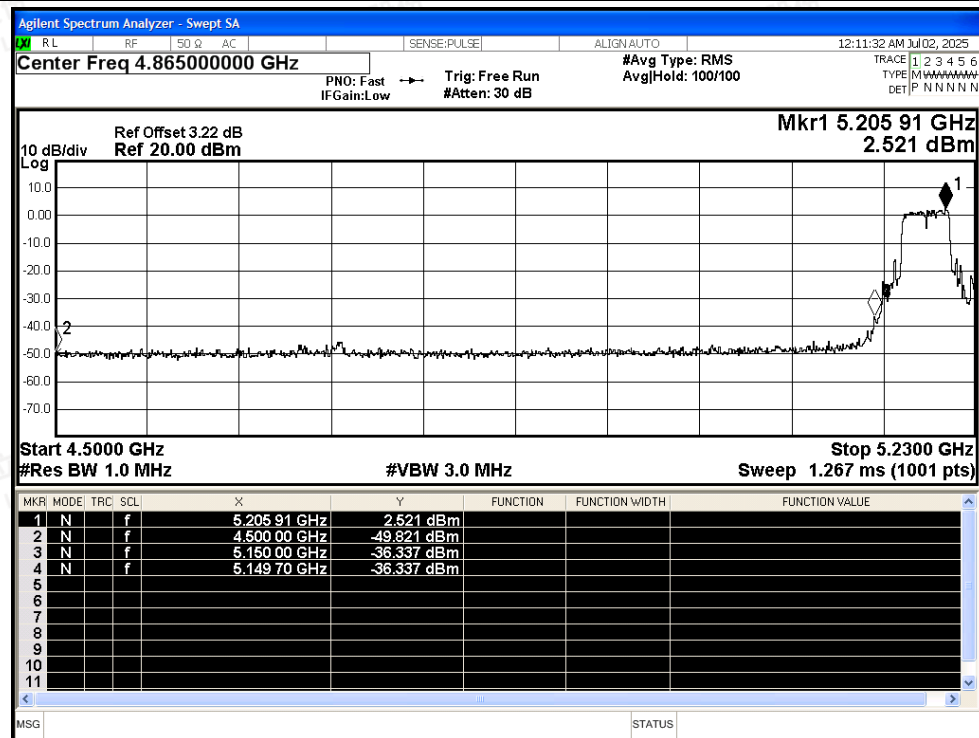

Restrict Band NVNT n40 5190MHz Ant2 Average

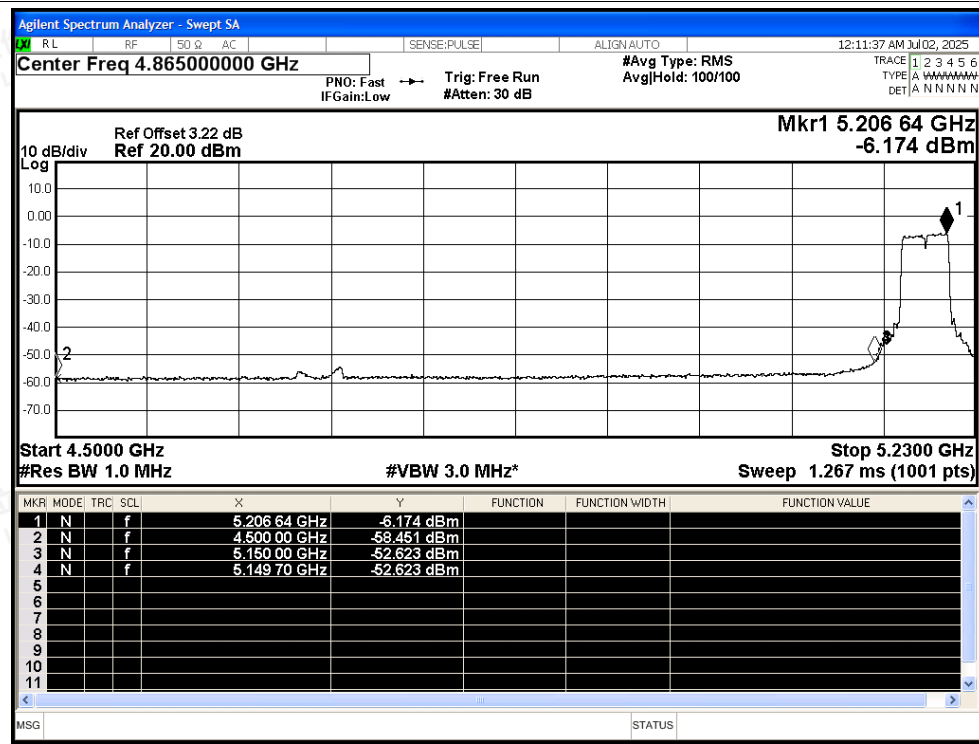

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

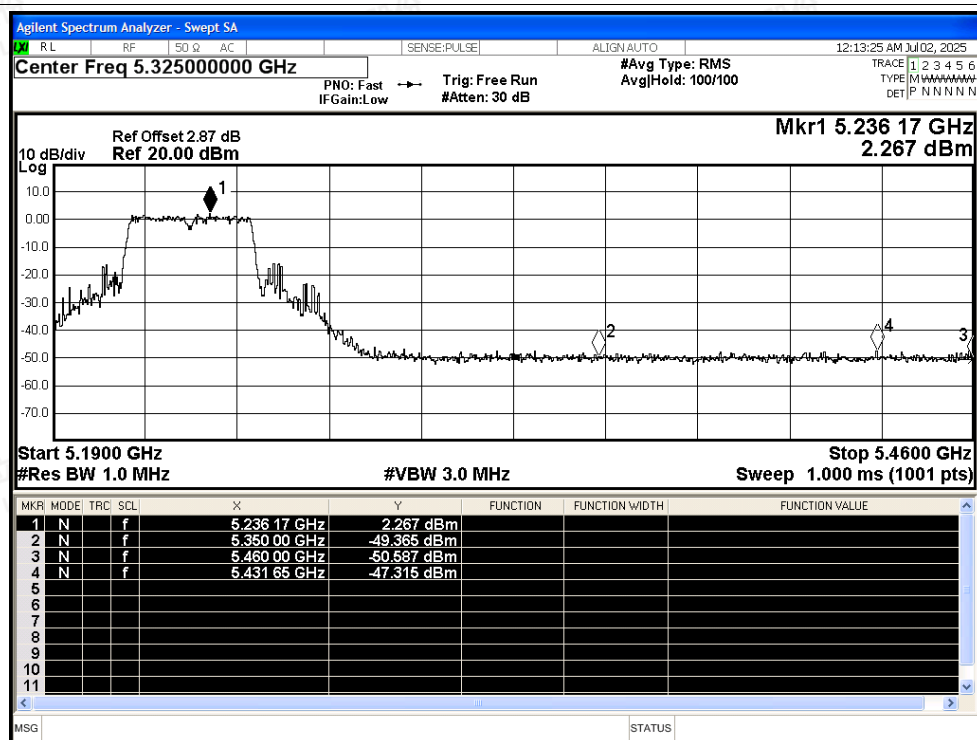

Restrict Band NVNT n40 5230MHz Ant2 Average

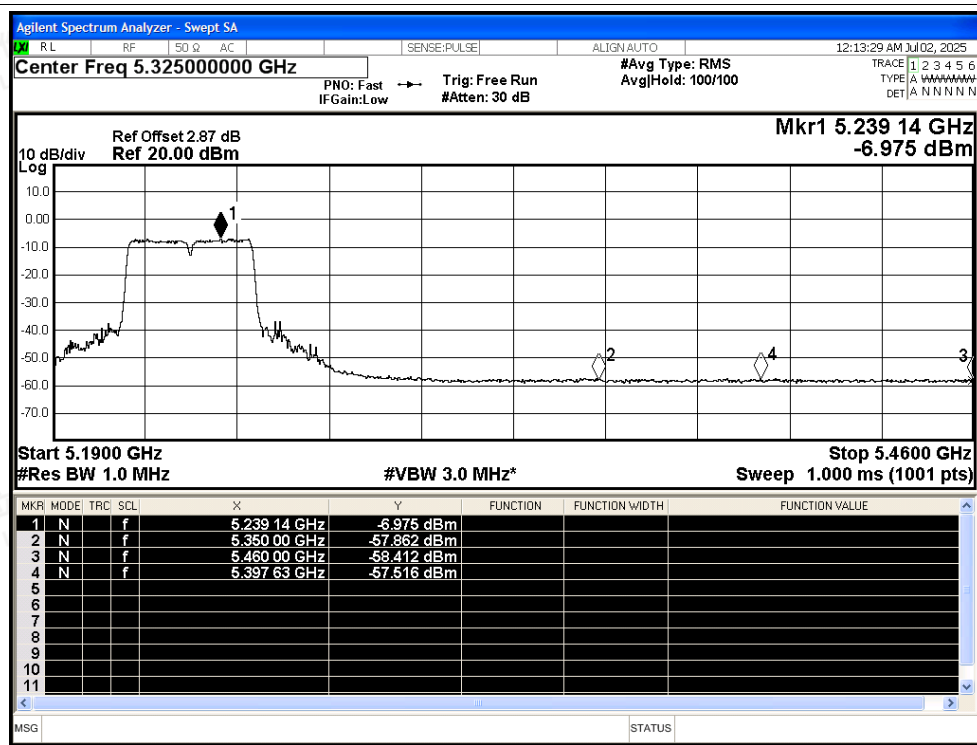

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

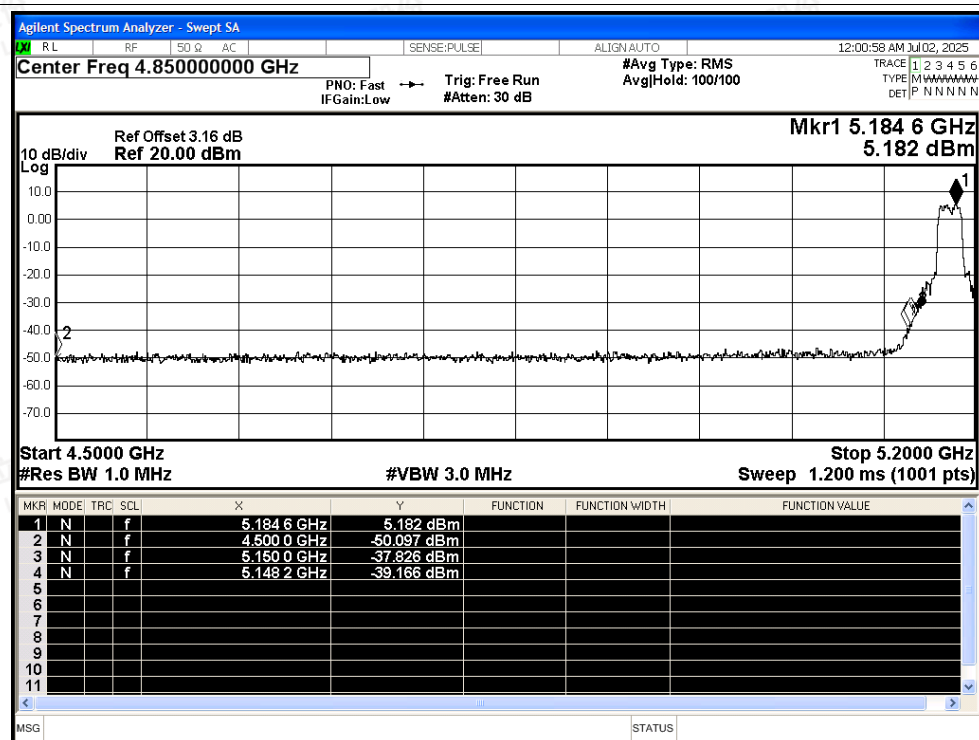

Restrict Band NVNT ac20 5180MHz Ant2 Average

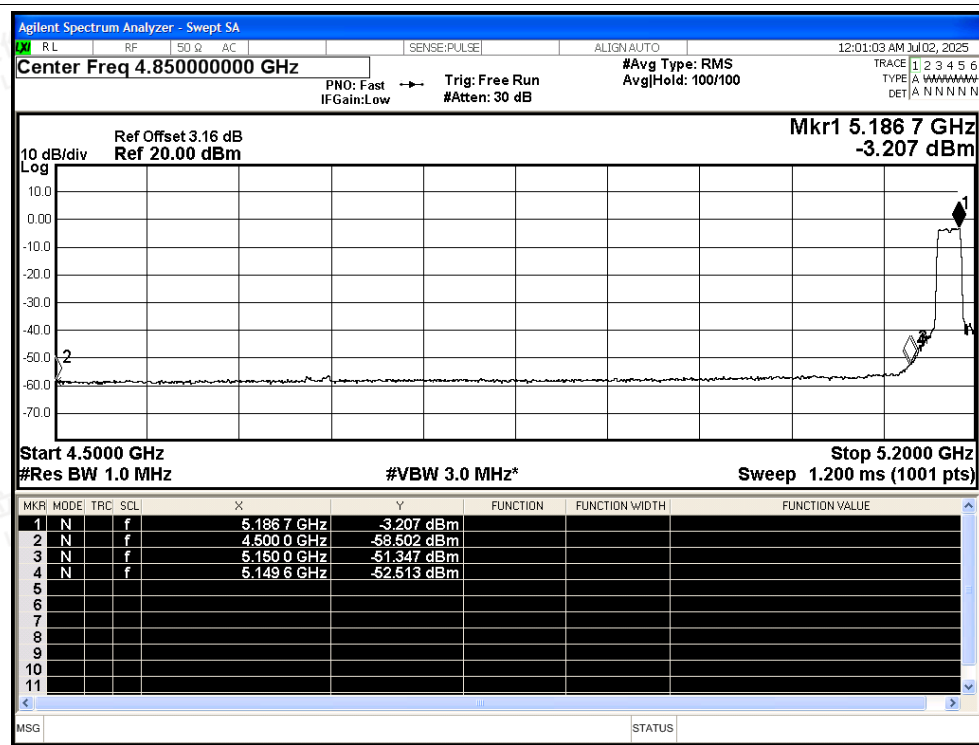

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

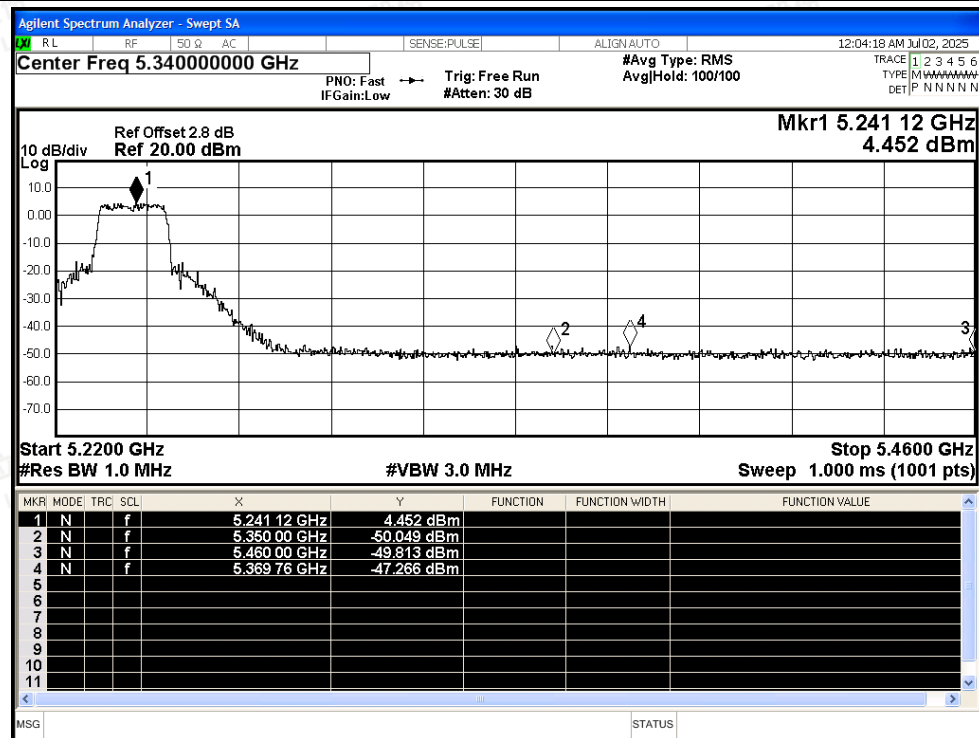

Restrict Band NVNT ac20 5240MHz Ant2 Average

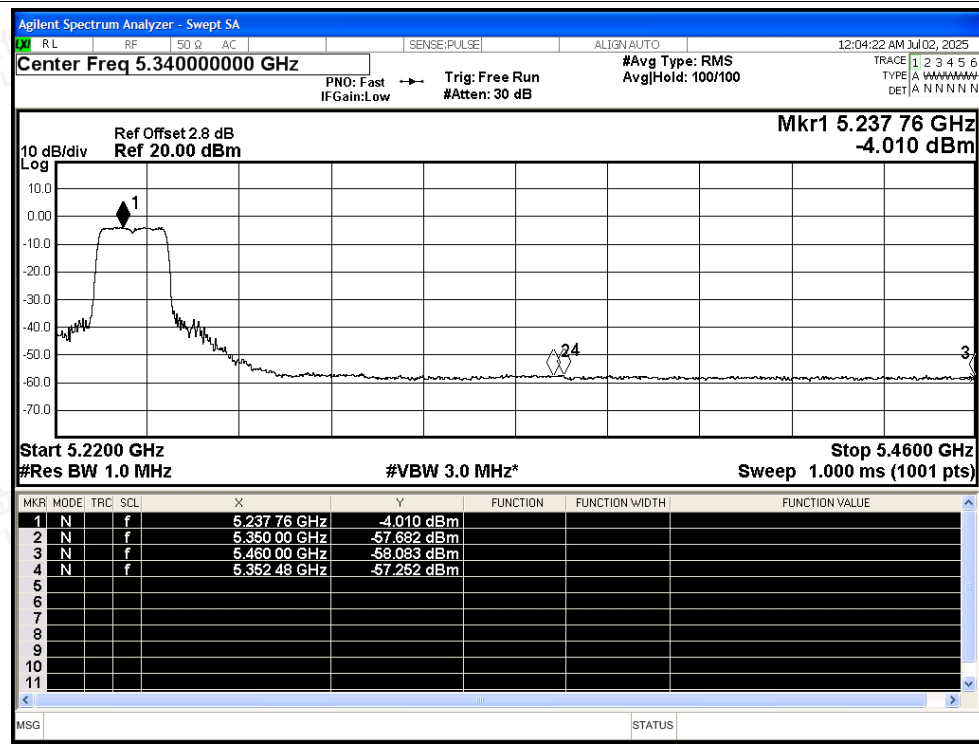

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

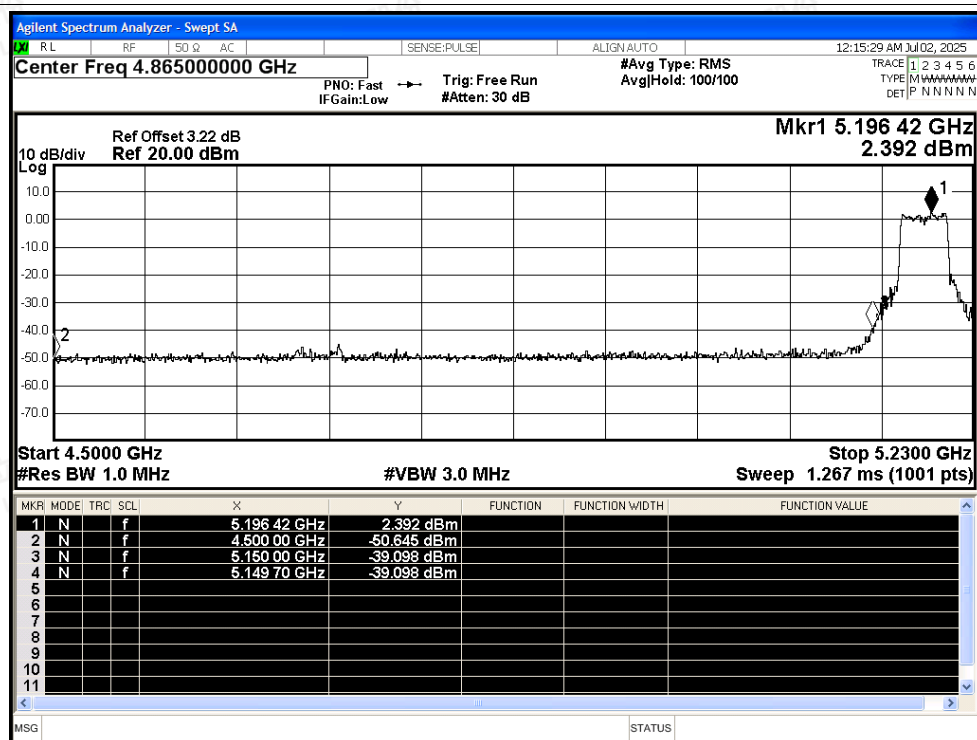

Restrict Band NVNT ac40 5190MHz Ant2 Average

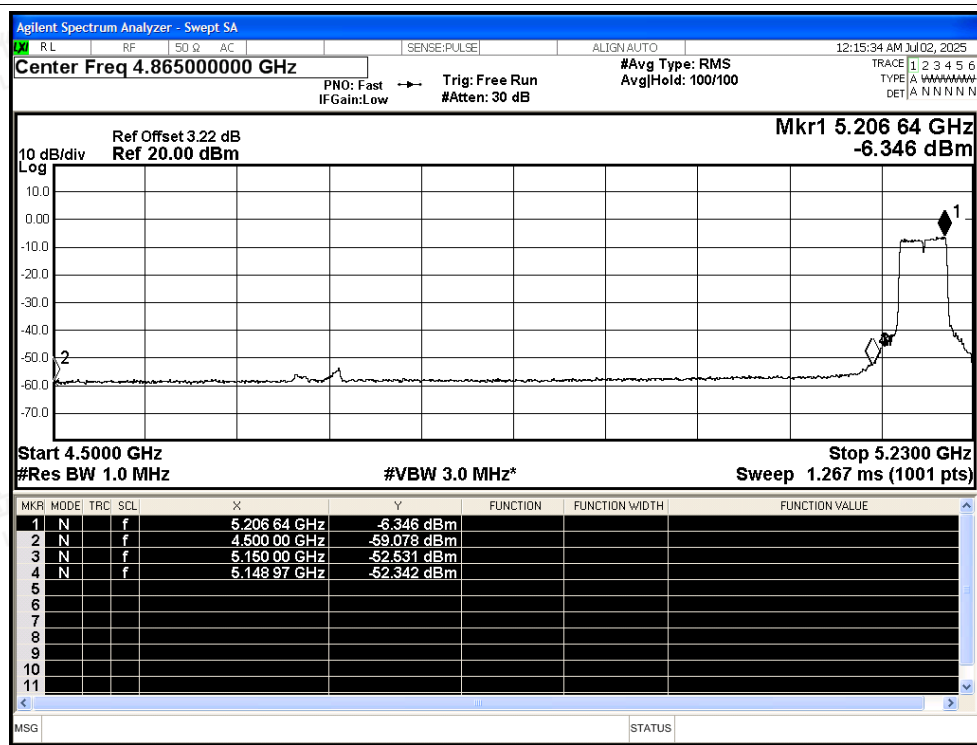

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

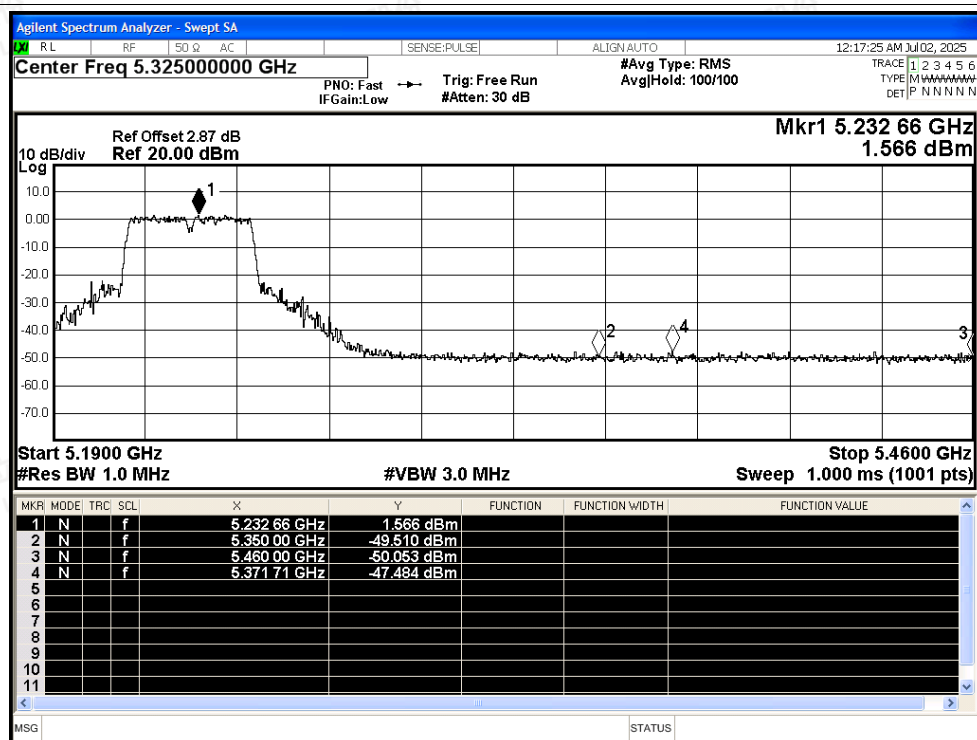

Restrict Band NVNT ac40 5230MHz Ant2 Average

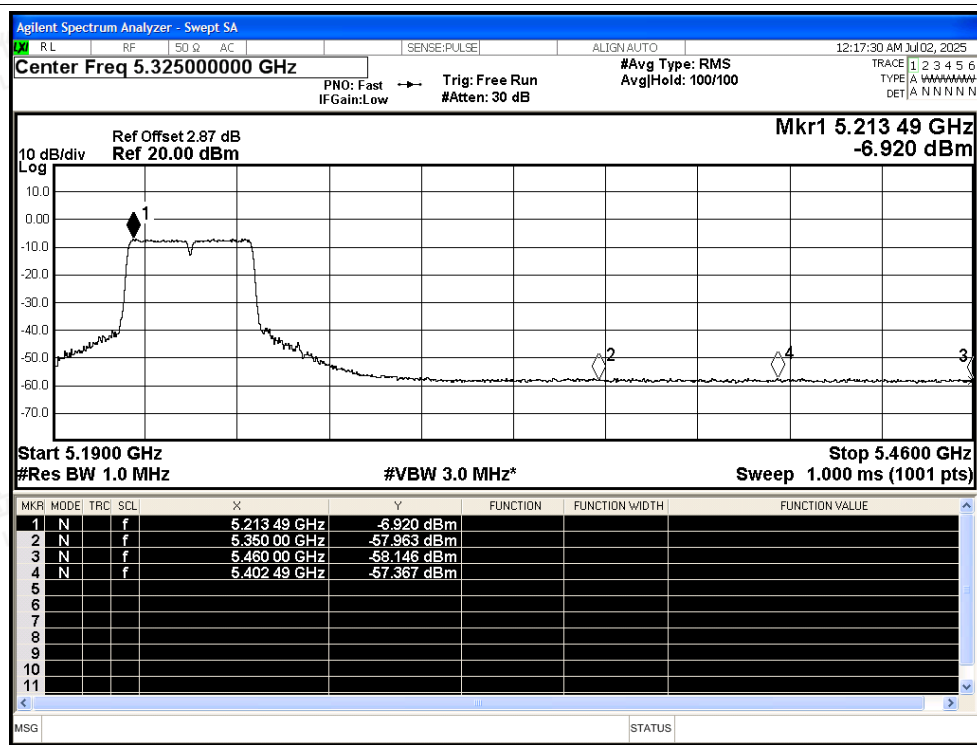

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

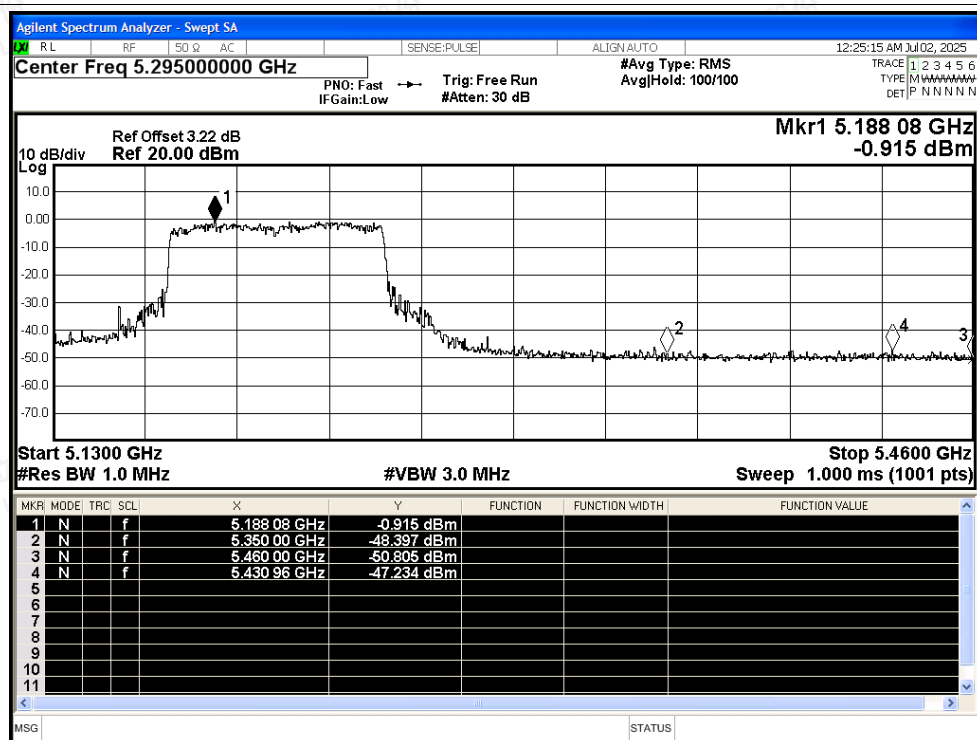

Restrict Band NVNT ac80 5210MHz Ant2 Average

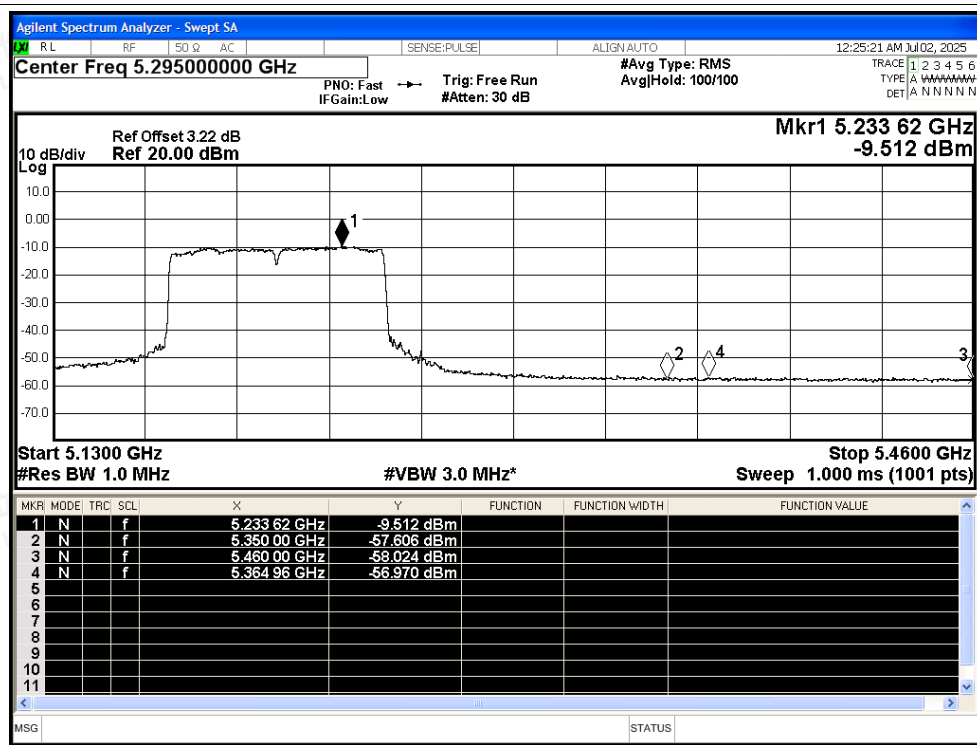

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

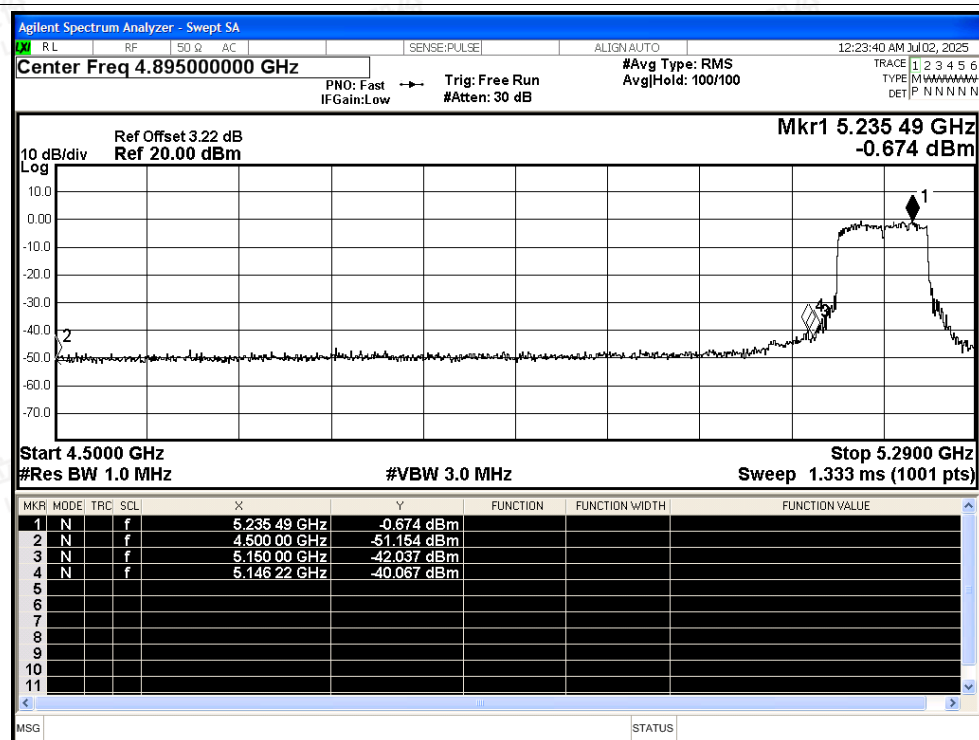

Restrict Band NVNT ac80 5210MHz Ant2 Average

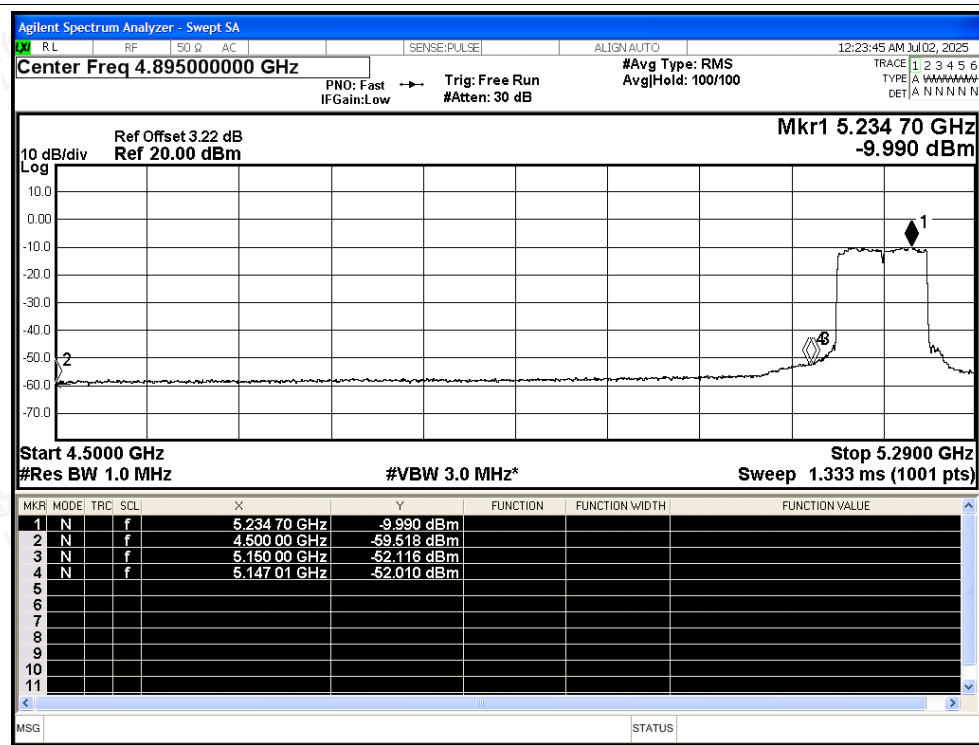

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

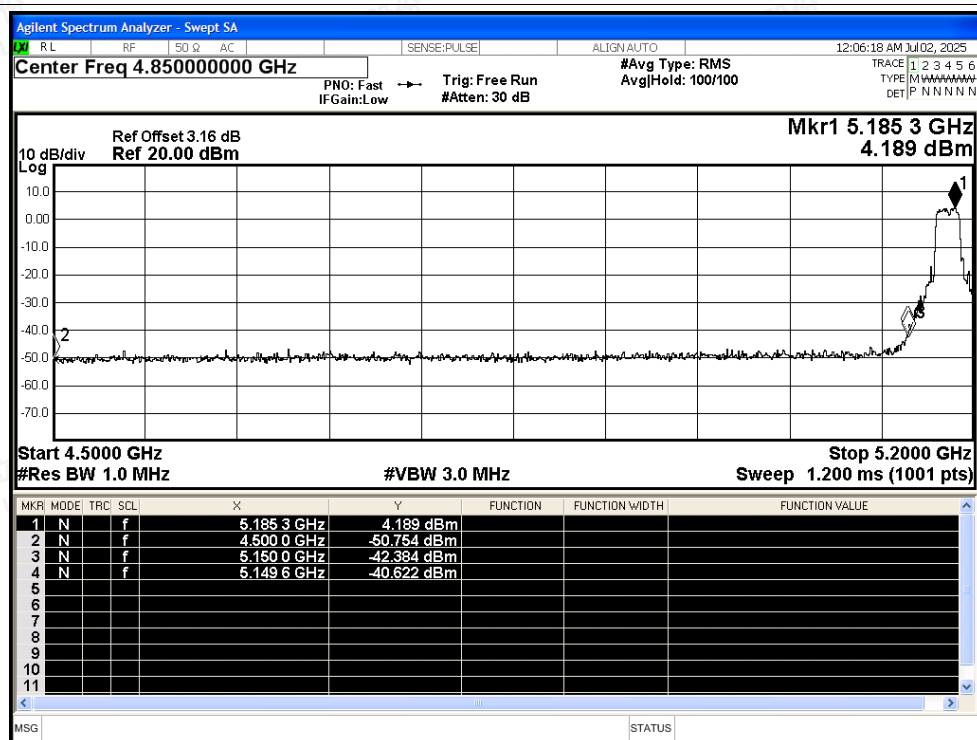

Restrict Band NVNT ax20 5180MHz Ant2 Average

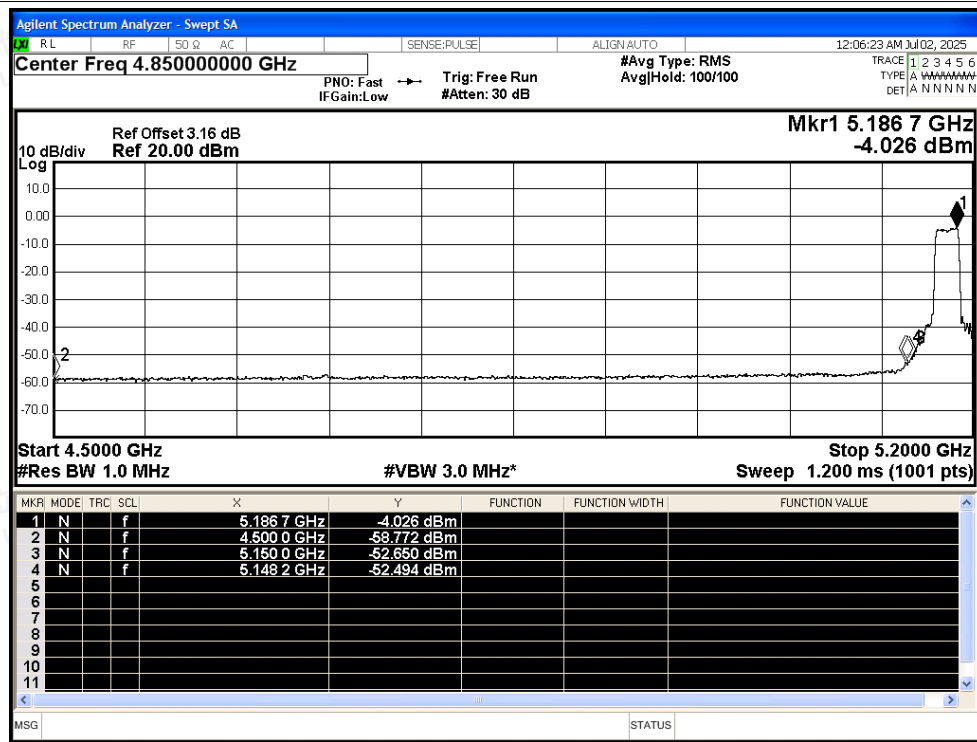

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

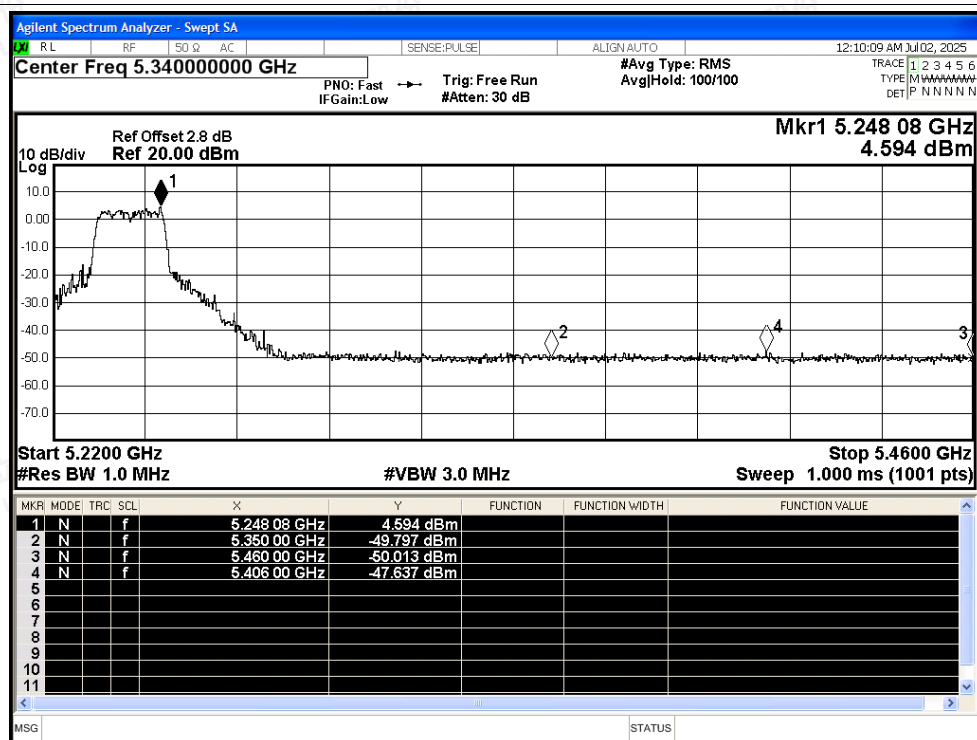

Restrict Band NVNT ax20 5240MHz Ant2 Average

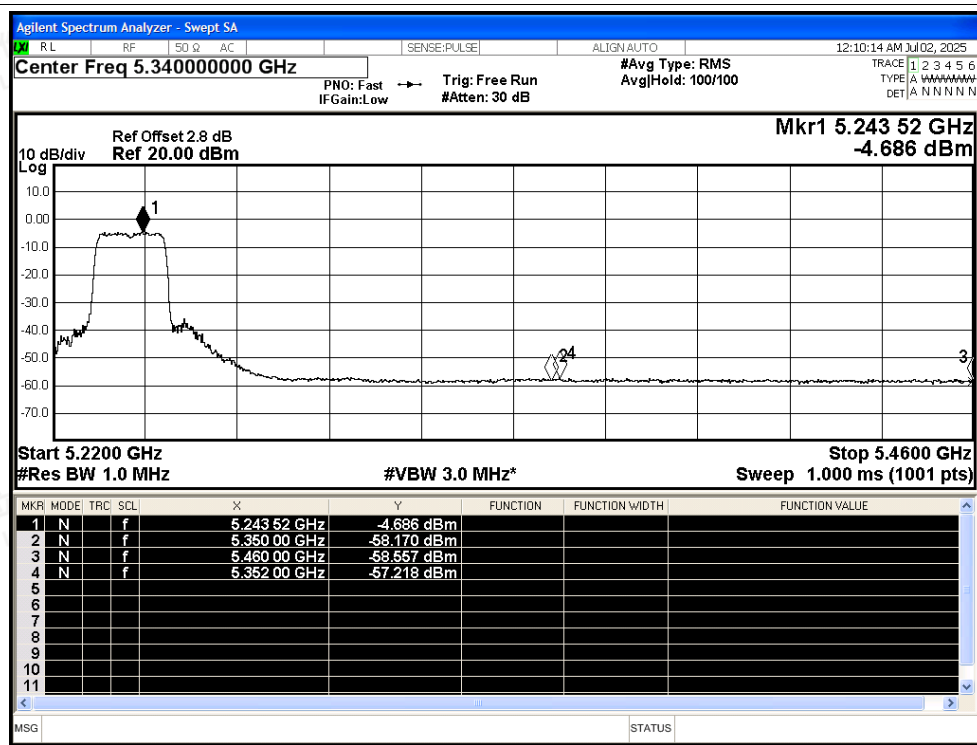

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

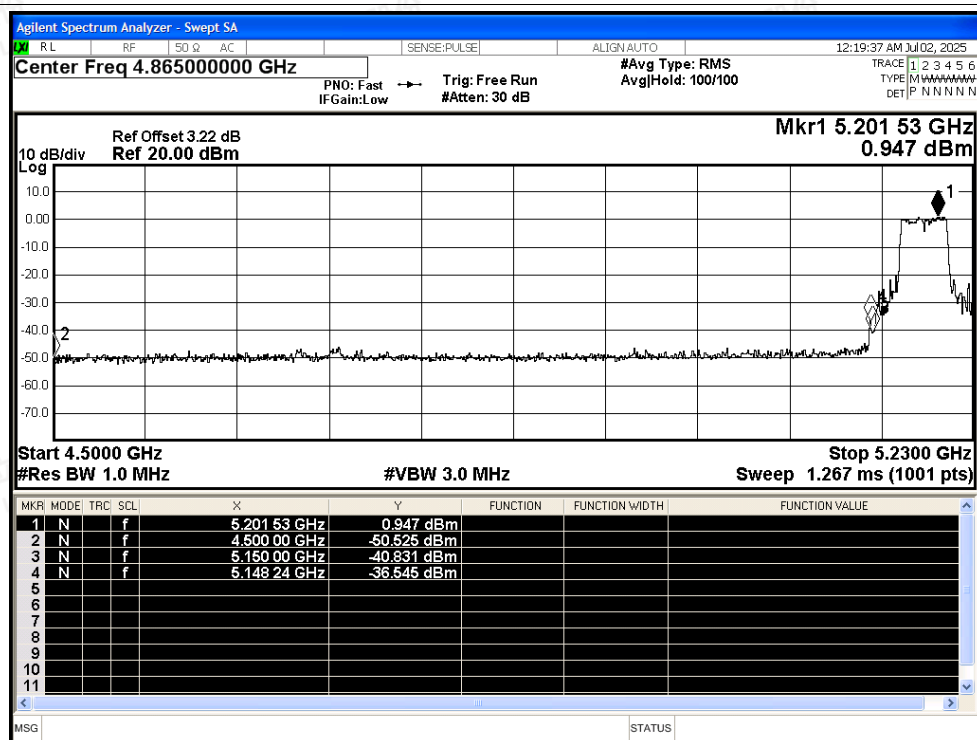

Restrict Band NVNT ax40 5190MHz Ant2 Average

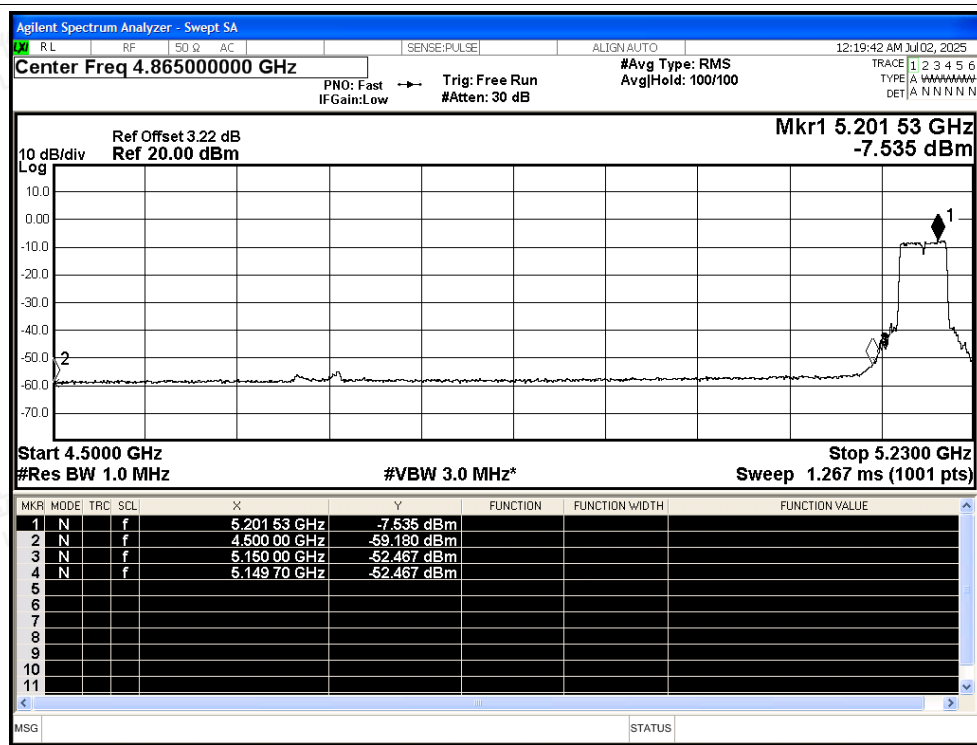

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

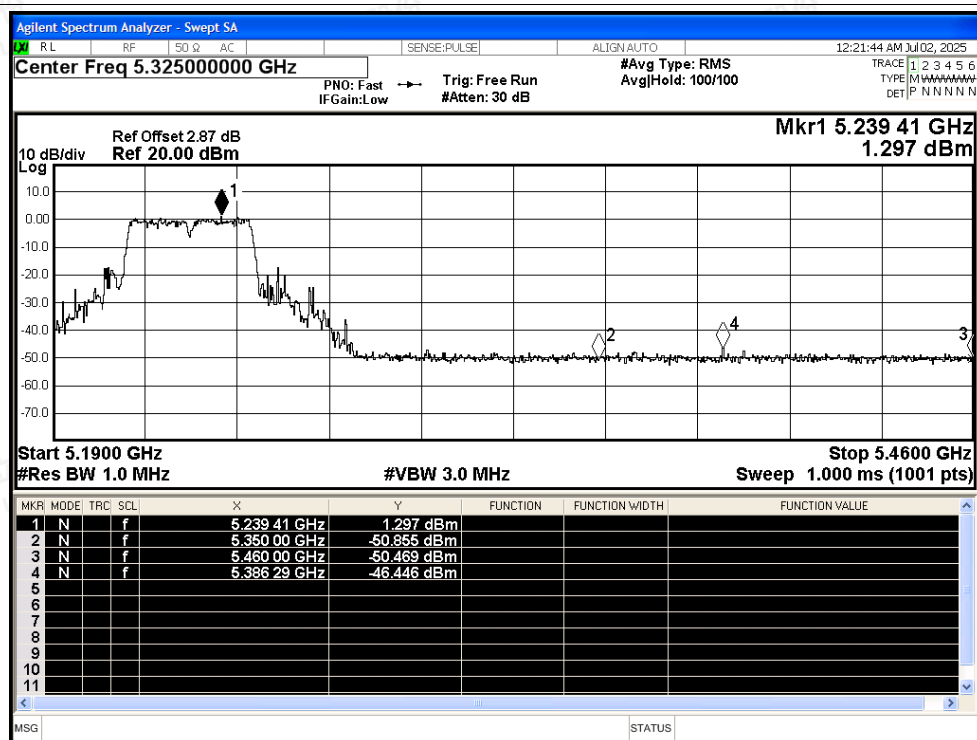

Restrict Band NVNT ax40 5230MHz Ant2 Average

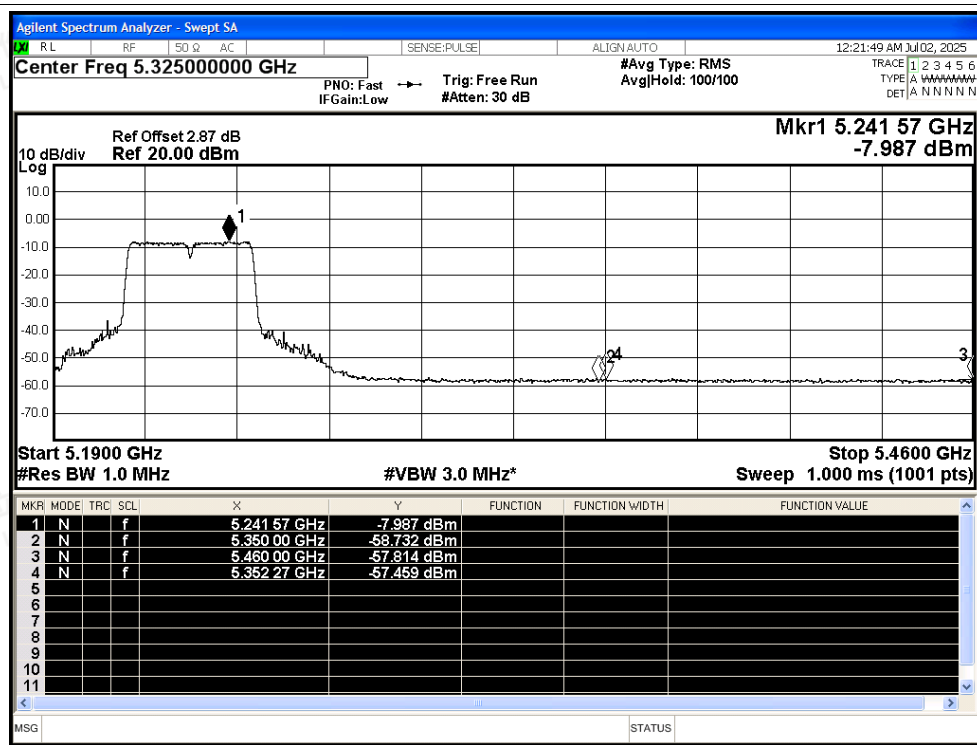

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

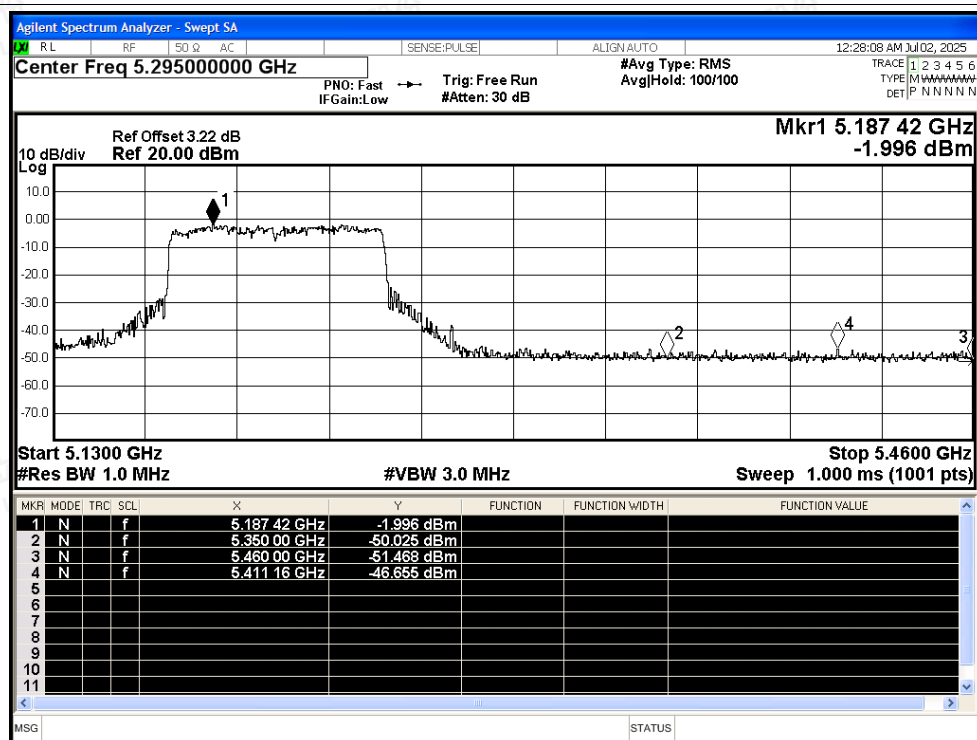

Restrict Band NVNT ax80 5210MHz Ant2 Average

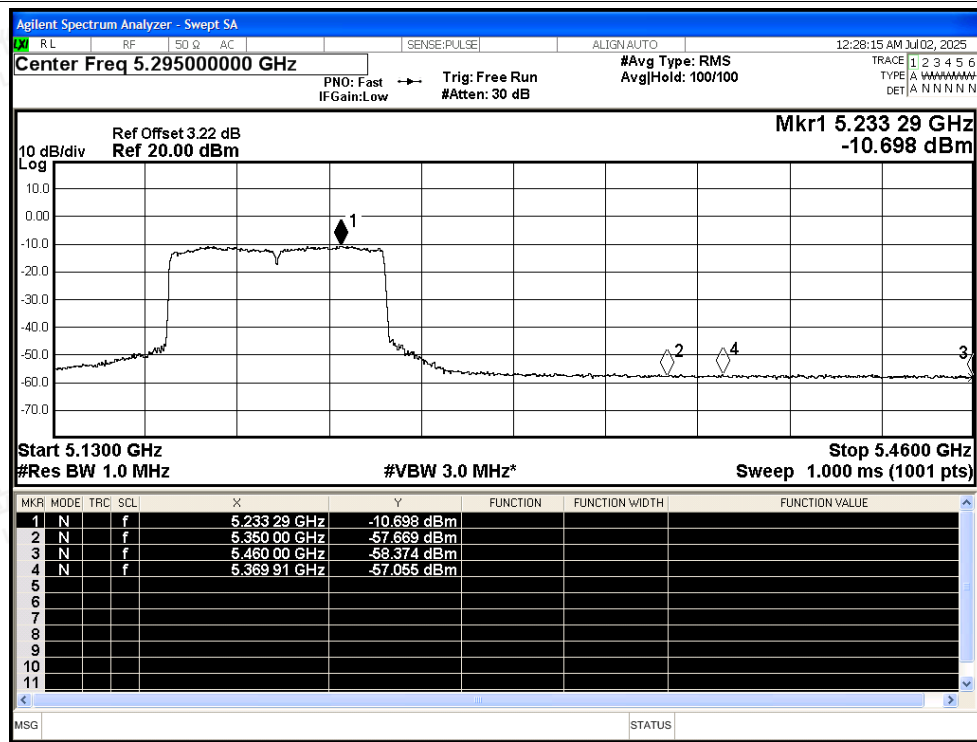

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

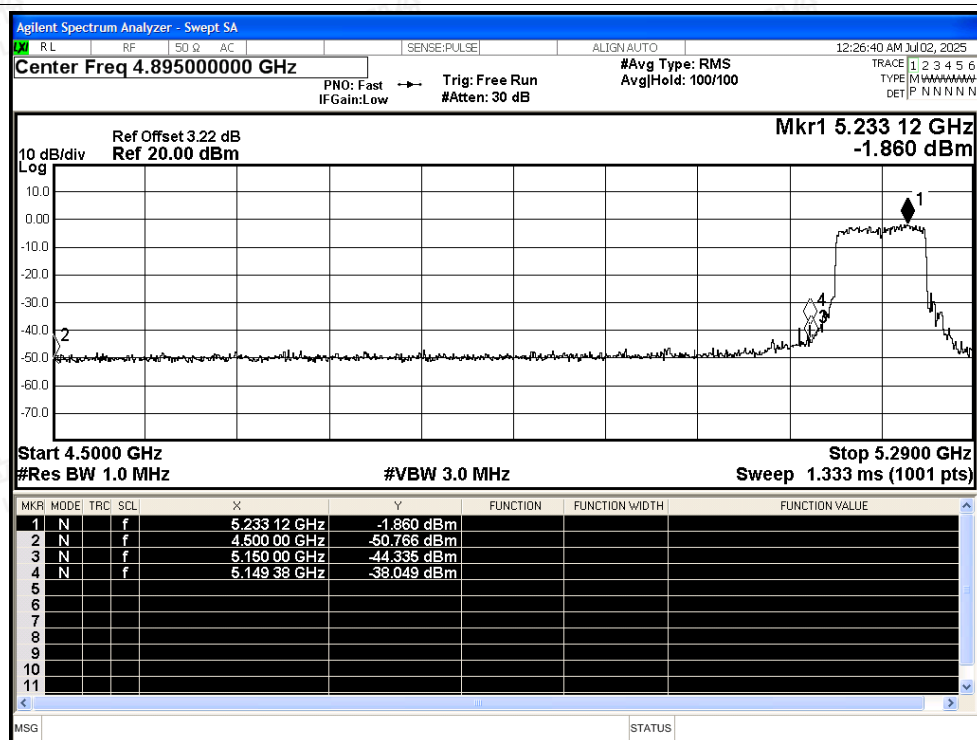

Restrict Band NVNT ax80 5210MHz Ant2 Average

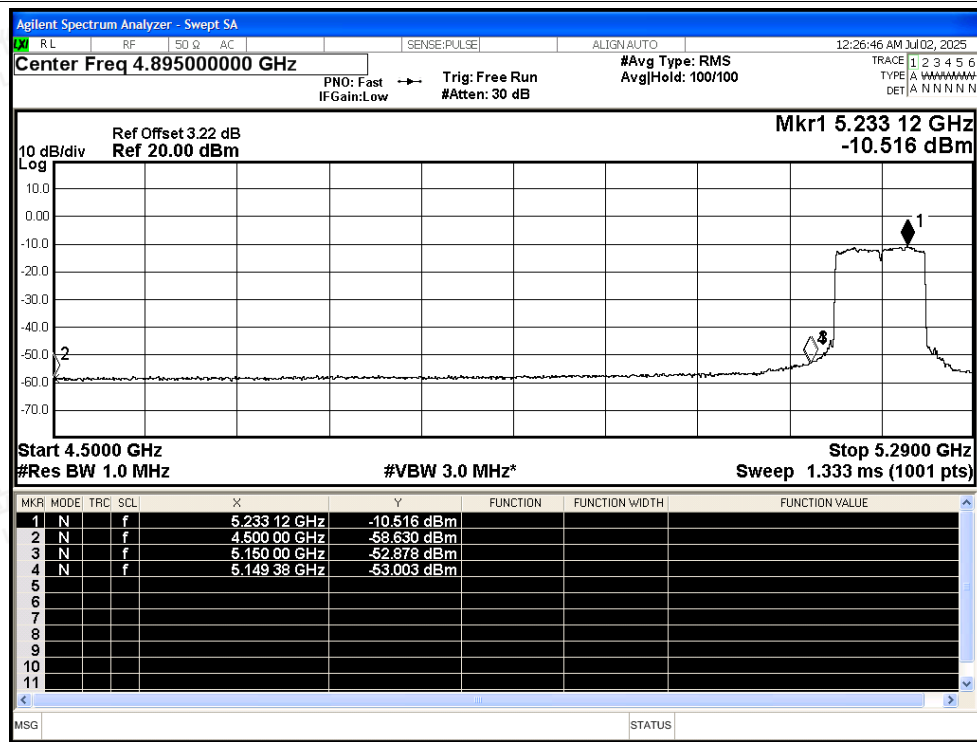

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-50.47	3.39	-	48.15	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-58.64	3.39	0.28	40.26	Average	54	Pass
NVNT	a	5180	Ant3	5148.9	-43.98	3.39	-	54.64	Peak	68.2	Pass
NVNT	a	5180	Ant3	5148.9	-54.13	3.39	0.28	44.77	Average	54	Pass
NVNT	a	5180	Ant3	5150	-44.6	3.39	-	54.02	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-54.33	3.39	0.28	44.57	Average	54	Pass
NVNT	a	5240	Ant3	5350	-48.58	3.39	-	50.04	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-57.99	3.39	0.24	40.87	Average	54	Pass
NVNT	a	5240	Ant3	5375.52	-47.16	3.39	-	51.46	Peak	68.2	Pass
NVNT	a	5240	Ant3	5367.6	-57.37	3.39	0.24	41.49	Average	54	Pass
NVNT	a	5240	Ant3	5460	-48.88	3.39	-	49.74	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-58.74	3.39	0.24	40.12	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-51.53	3.39	-	47.09	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-59.54	3.39	0.28	39.36	Average	54	Pass
NVNT	n20	5180	Ant3	5149.6	-43.2	3.39	-	55.42	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5149.6	-53.31	3.39	0.28	45.59	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-44.12	3.39	-	54.50	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-53.3	3.39	0.28	45.60	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-50.1	3.39	-	48.52	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-57.8	3.39	0.28	41.10	Average	54	Pass
NVNT	n20	5240	Ant3	5430.24	-47.26	3.39	-	51.36	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5368.32	-57.53	3.39	0.28	41.37	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-50.41	3.39	-	48.21	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-58.47	3.39	0.28	40.43	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-50.43	3.39	-	48.19	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-58.67	3.39	0.54	40.49	Average	54	Pass
NVNT	n40	5190	Ant3	5149.7	-37.99	3.39	-	60.63	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5148.97	-51.96	3.39	0.54	47.20	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-37.99	3.39	-	60.63	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-52.44	3.39	0.54	46.72	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-51.7	3.39	-	46.92	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-58.42	3.39	0.55	40.75	Average	54	Pass
NVNT	n40	5230	Ant3	5390.07	-46.87	3.39	-	51.75	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5382.24	-57.34	3.39	0.55	41.83	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-50.43	3.39	-	48.19	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-58.41	3.39	0.55	40.76	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	4500	-51.48	3.39	-	47.14	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	4500	-58.5	3.39	0.28	40.4	Average	54	Pass
NVNT	ac20	5180	Ant3	5149.6	-38.66	3.39	-	59.96	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5148.9	-51.43	3.39	0.28	47.47	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-36.14	3.39	-	62.48	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-52.25	3.39	0.28	46.65	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-49.88	3.39	-	48.74	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-57.69	3.39	0.28	41.21	Average	54	Pass
NVNT	ac20	5240	Ant3	5351.04	-47.48	3.39	-	51.14	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5352.24	-57.14	3.39	0.28	41.76	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-50.06	3.39	-	48.56	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-58.44	3.39	0.28	40.46	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-51.07	3.39	-	47.55	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-59.06	3.39	0.53	40.09	Average	54	Pass
NVNT	ac40	5190	Ant3	5149.7	-40.42	3.39	-	58.2	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5148.97	-52.02	3.39	0.53	47.13	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-40.42	3.39	-	58.2	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-52.74	3.39	0.53	46.41	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-50.6	3.39	-	48.02	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-57.79	3.39	0.53	41.36	Average	54	Pass
NVNT	ac40	5230	Ant3	5365.77	-47.18	3.39	-	51.44	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5373.33	-57.32	3.39	0.53	41.83	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-49.66	3.39	-	48.96	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-58.37	3.39	0.53	40.78	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-49.85	3.39	-	48.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-57.17	3.39	1.01	42.46	Average	54	Pass
NVNT	ac80	5210	Ant3	5378.16	-46.73	3.39	-	51.89	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5368.59	-57.07	3.39	1.01	42.56	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-50.39	3.39	-	48.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-58.1	3.39	1.01	41.53	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-50.94	3.39	-	47.68	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-59.03	3.39	1.01	40.6	Average	54	Pass
NVNT	ac80	5210	Ant3	5045.89	-45.92	3.39	-	52.7	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5079.07	-56.55	3.39	1.01	43.08	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-49.13	3.39	-	49.49	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-57.37	3.39	1.01	42.26	Average	54	Pass
NVNT	ax20	5180	Ant3	4500	-51.76	3.39	-	46.86	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	4500	-58.63	3.39	0.28	40.27	Average	54	Pass
NVNT	ax20	5180	Ant3	5149.6	-41.21	3.39	-	57.41	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5149.6	-53.76	3.39	0.28	45.14	Average	54	Pass
NVNT	ax20	5180	Ant3	5150	-40.87	3.39	-	57.75	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5180	Ant3	5150	-54.13	3.39	0.28	44.77	Average	54	Pass
NVNT	ax20	5240	Ant3	5350	-50.74	3.39	-	47.88	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5350	-58.45	3.39	0.28	40.45	Average	54	Pass
NVNT	ax20	5240	Ant3	5443.2	-47.43	3.39	-	51.19	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5358.96	-57.43	3.39	0.28	41.47	Average	54	Pass
NVNT	ax20	5240	Ant3	5460	-50.36	3.39	-	48.26	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5460	-57.83	3.39	0.28	41.07	Average	54	Pass
NVNT	ax40	5190	Ant3	4500	-51.63	3.39	-	46.99	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	4500	-59.04	3.39	0.53	40.11	Average	54	Pass
NVNT	ax40	5190	Ant3	5146.78	-39.41	3.39	-	59.21	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5149.7	-51.77	3.39	0.53	47.38	Average	54	Pass
NVNT	ax40	5190	Ant3	5150	-39.96	3.39	-	58.66	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5150	-51.77	3.39	0.53	47.38	Average	54	Pass
NVNT	ax40	5230	Ant3	5350	-48.94	3.39	-	49.68	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350	-57.65	3.39	0.53	41.5	Average	54	Pass
NVNT	ax40	5230	Ant3	5379.27	-47.17	3.39	-	51.45	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5431.92	-57.47	3.39	0.53	41.68	Average	54	Pass
NVNT	ax40	5230	Ant3	5460	-50.71	3.39	-	47.91	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5460	-58.42	3.39	0.53	40.73	Average	54	Pass
NVNT	ax80	5210	Ant3	5350	-50.14	3.39	-	48.48	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350	-57.27	3.39	0.99	42.34	Average	54	Pass
NVNT	ax80	5210	Ant3	5365.62	-47.14	3.39	-	51.48	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5381.46	-56.76	3.39	0.99	42.85	Average	54	Pass
NVNT	ax80	5210	Ant3	5460	-49.64	3.39	-	48.98	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5460	-57.98	3.39	0.99	41.63	Average	54	Pass
NVNT	ax80	5210	Ant3	4500	-50.95	3.39	-	47.67	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	4500	-59.2	3.39	0.99	40.41	Average	54	Pass
NVNT	ax80	5210	Ant3	5144.64	-41.79	3.39	-	56.83	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5143.06	-51.94	3.39	0.99	47.67	Average	54	Pass
NVNT	ax80	5210	Ant3	5150	-41.32	3.39	-	57.30	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5150	-52.43	3.39	0.99	47.18	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant3 Peak

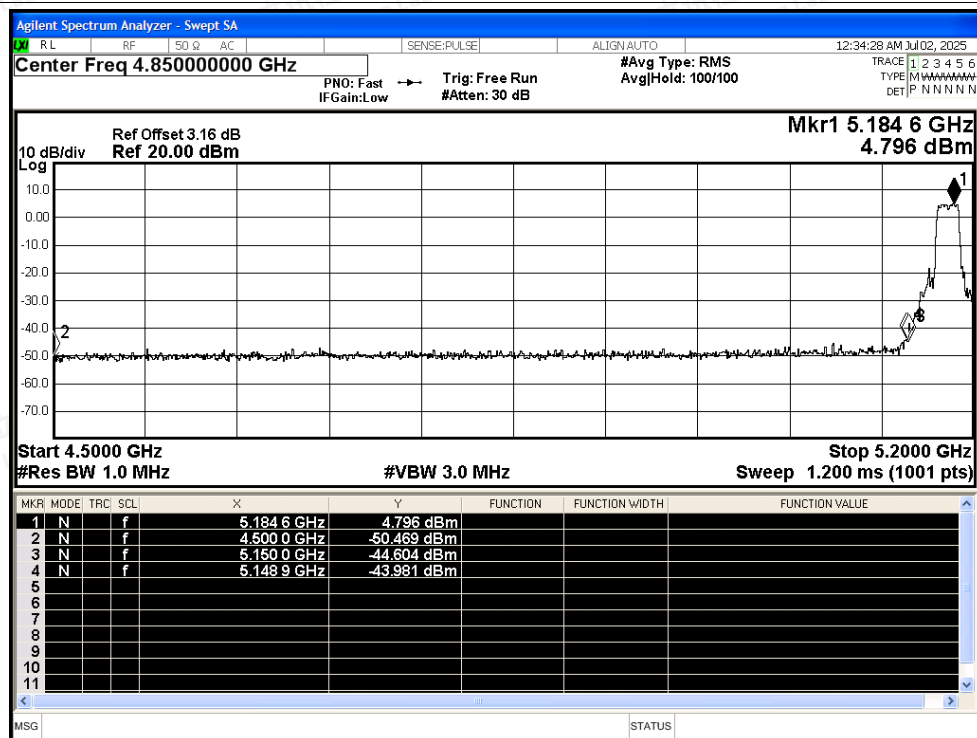

Restrict Band NVNT a 5180MHz Ant3 Average

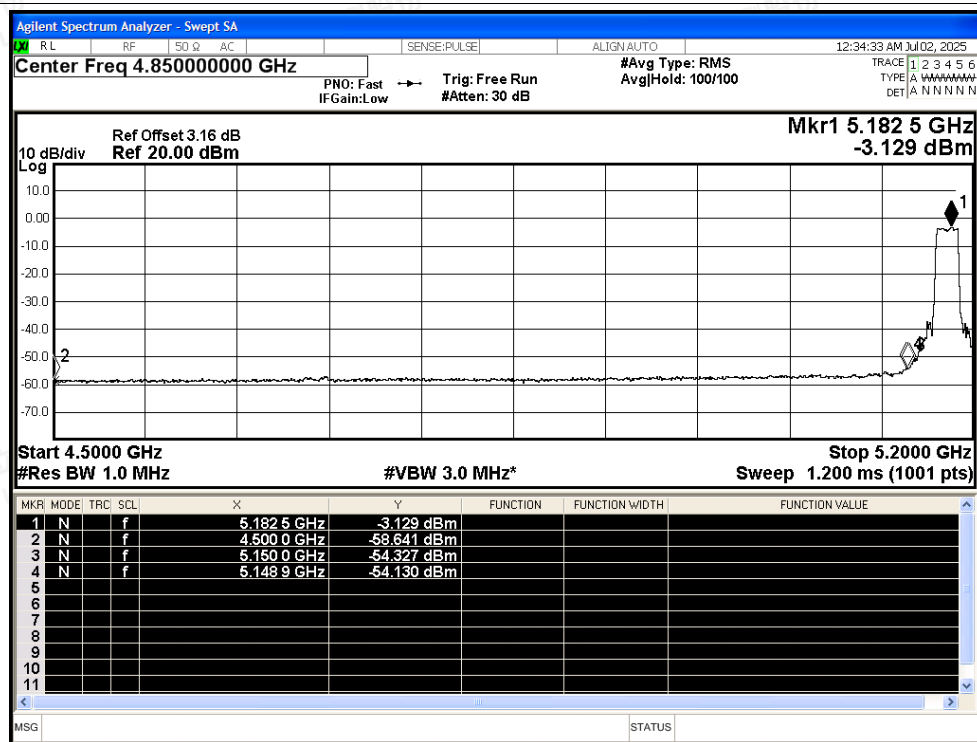

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

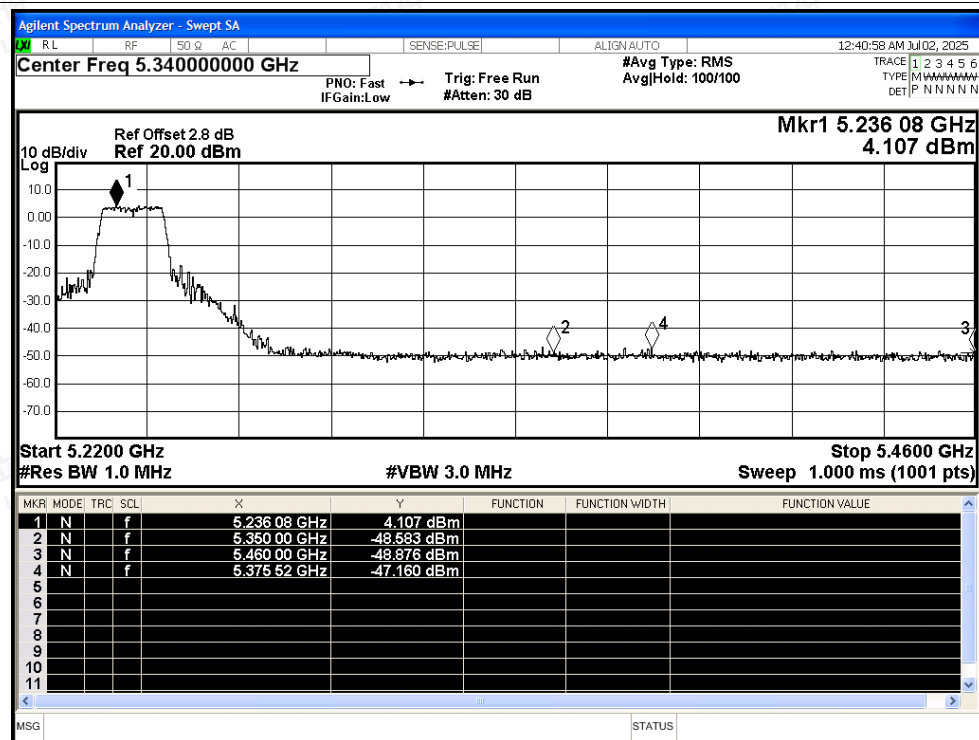


Restrict Band NVNT a 5240MHz Ant3 Average

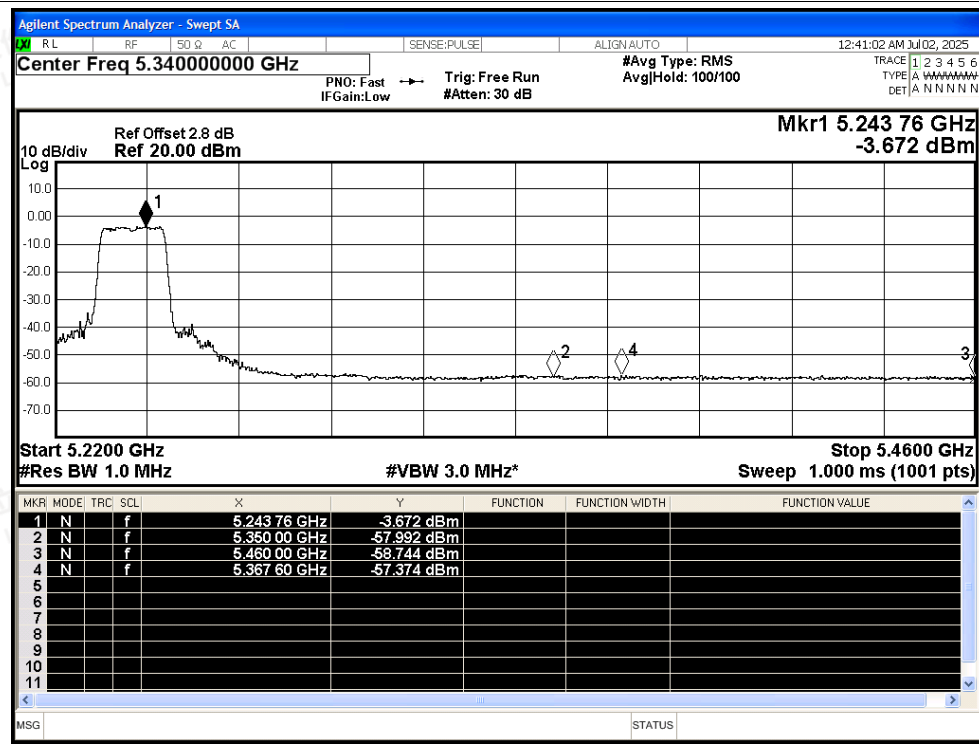




Restrict Band NVNT n20 5180MHz Ant3 Peak

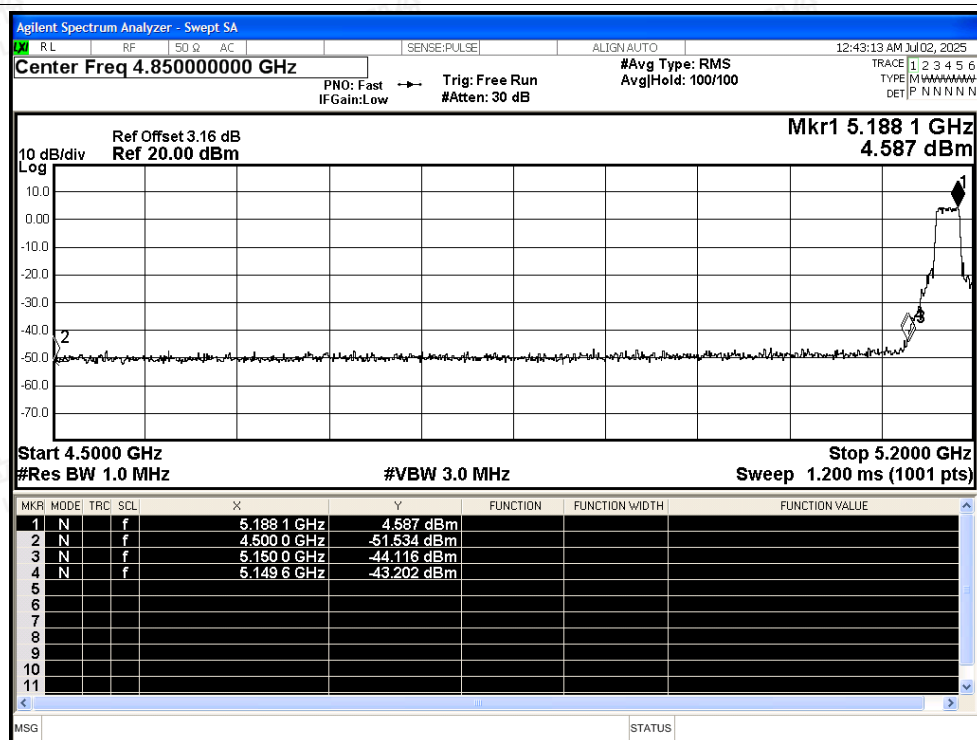

Restrict Band NVNT n20 5180MHz Ant3 Average

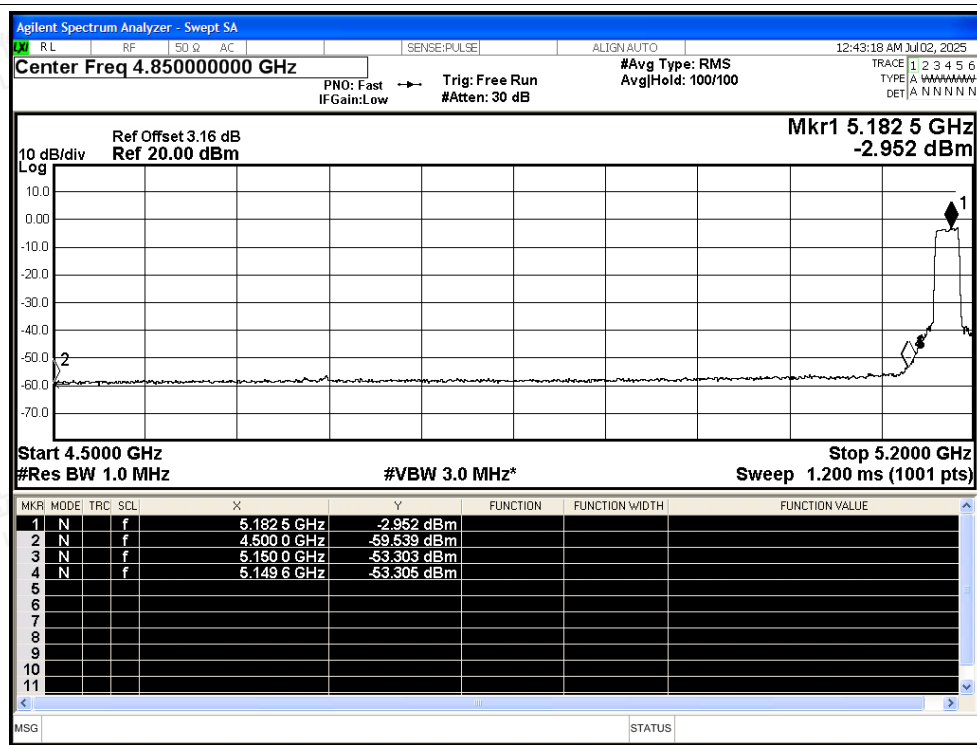

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant3 Peak

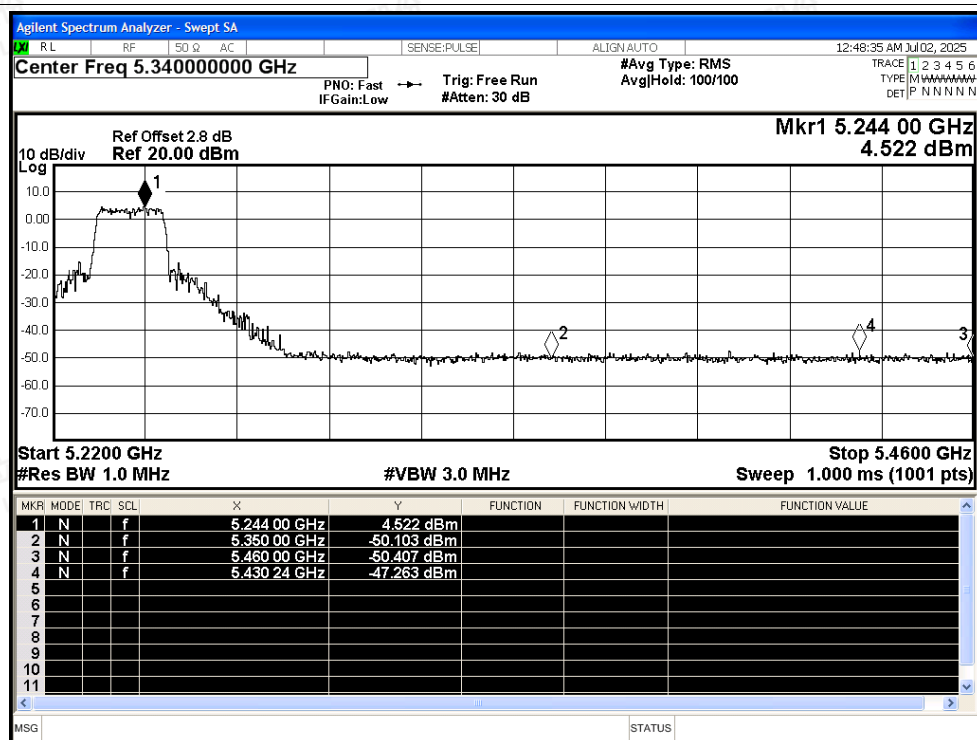

Restrict Band NVNT n20 5240MHz Ant3 Average

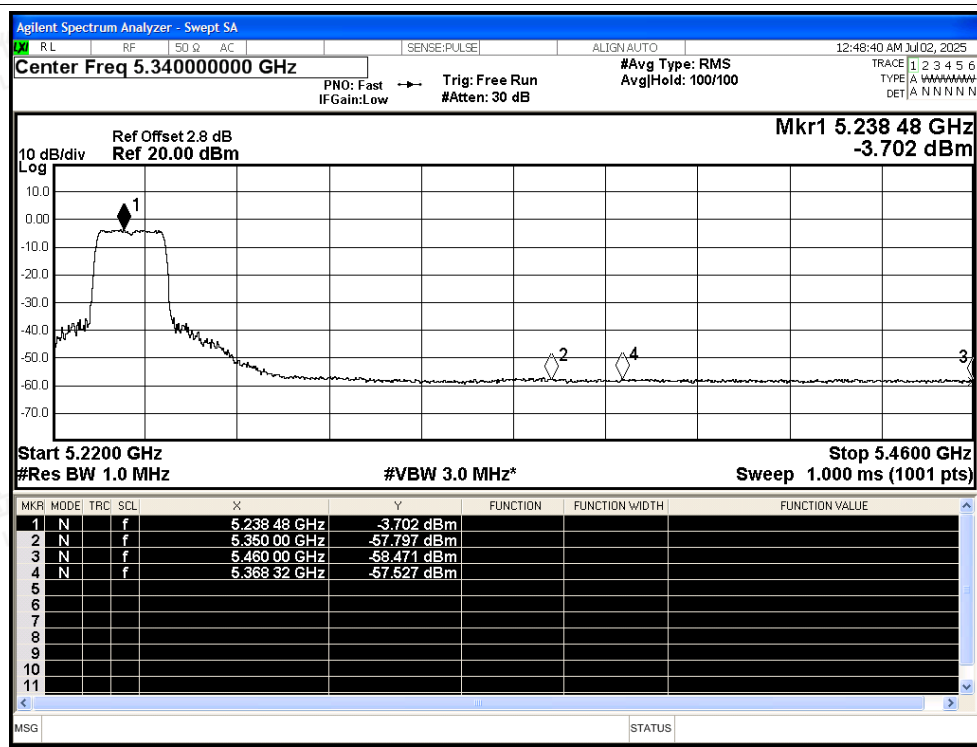

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

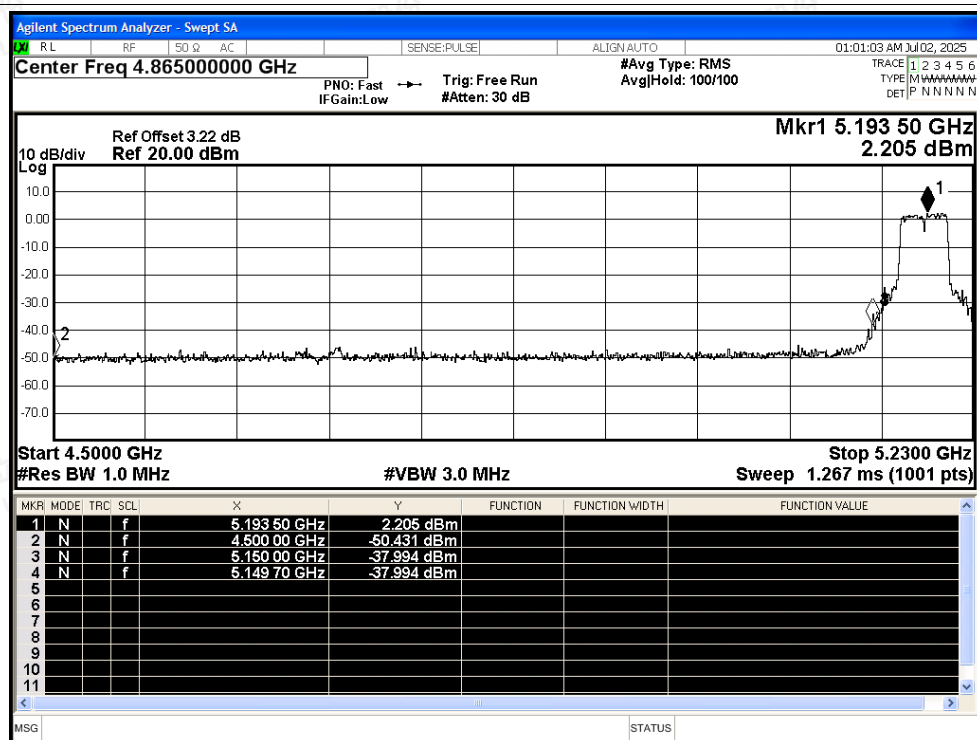

Restrict Band NVNT n40 5190MHz Ant3 Average

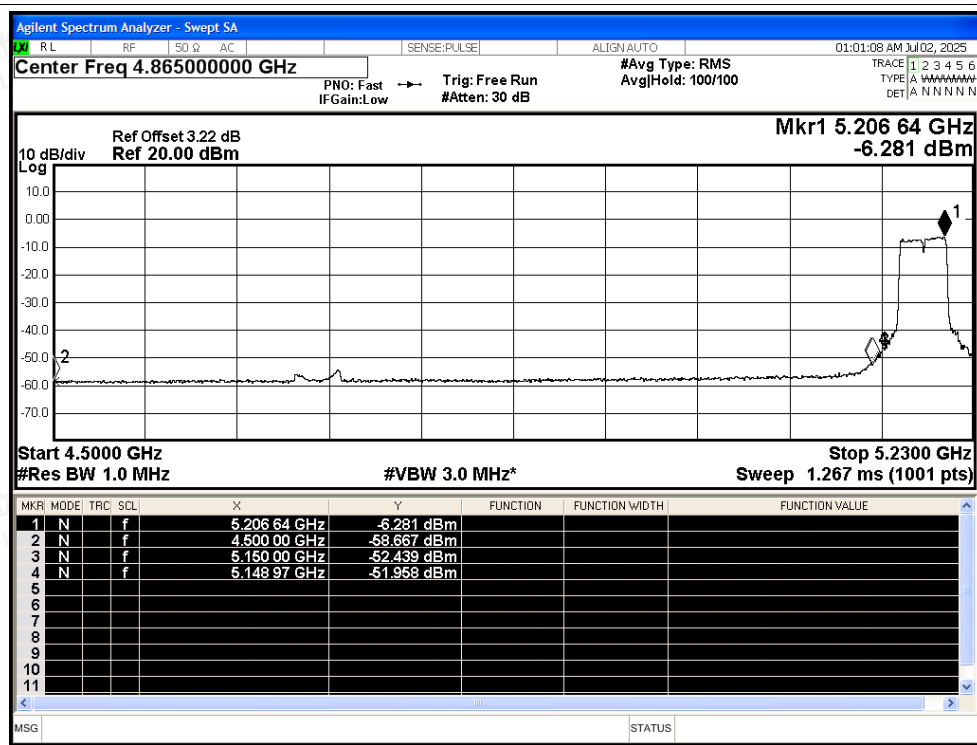

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

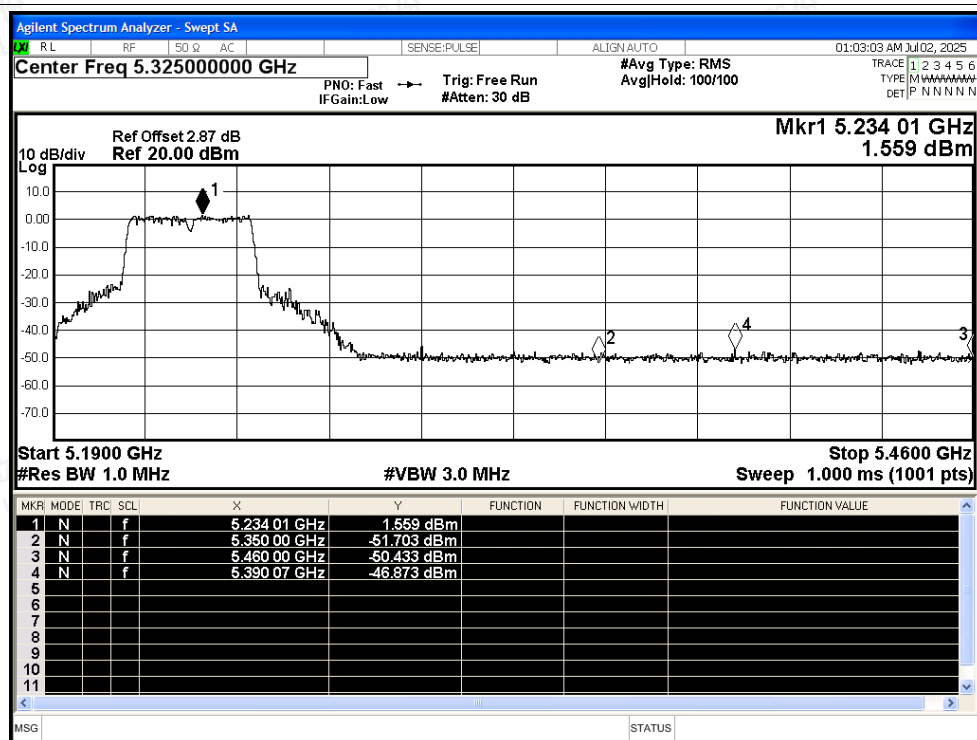

Restrict Band NVNT n40 5230MHz Ant3 Average

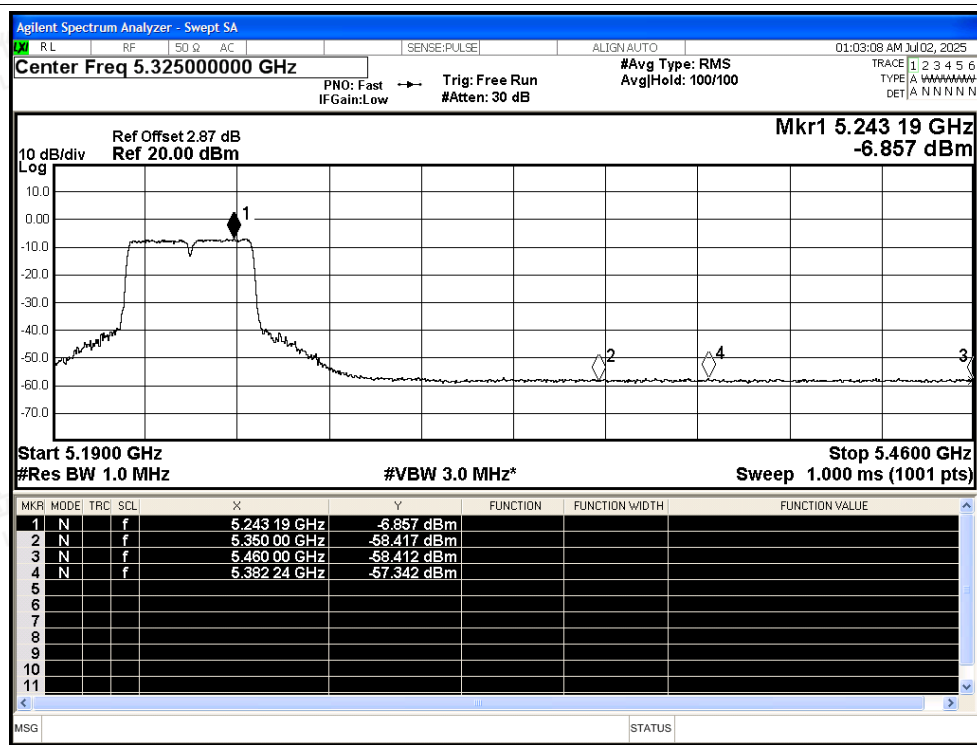

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

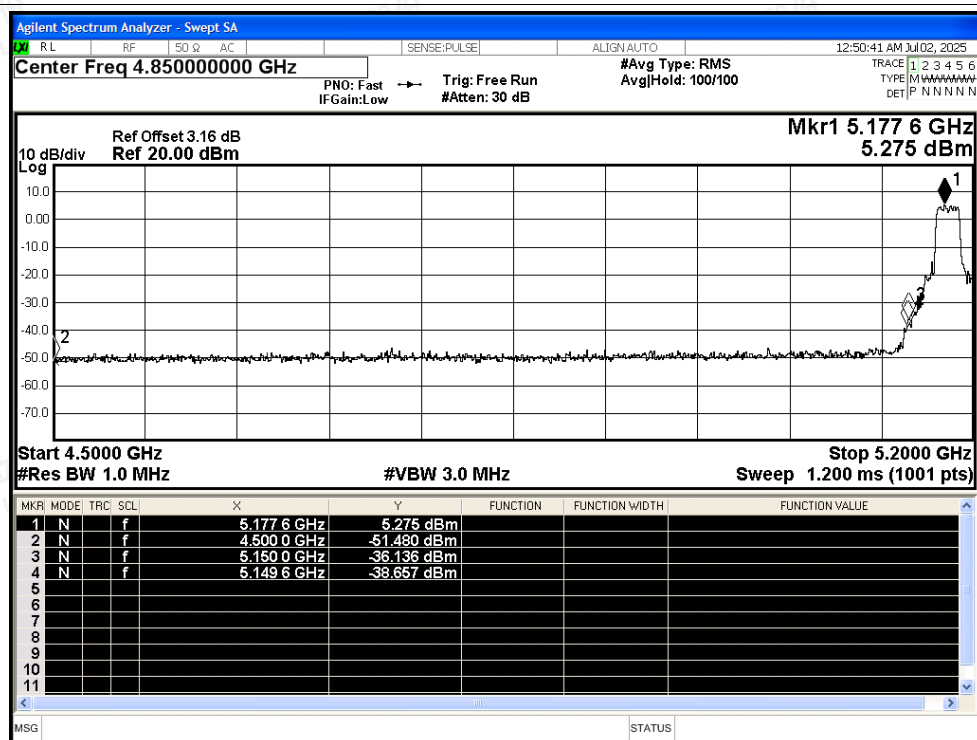

Restrict Band NVNT ac20 5180MHz Ant3 Average

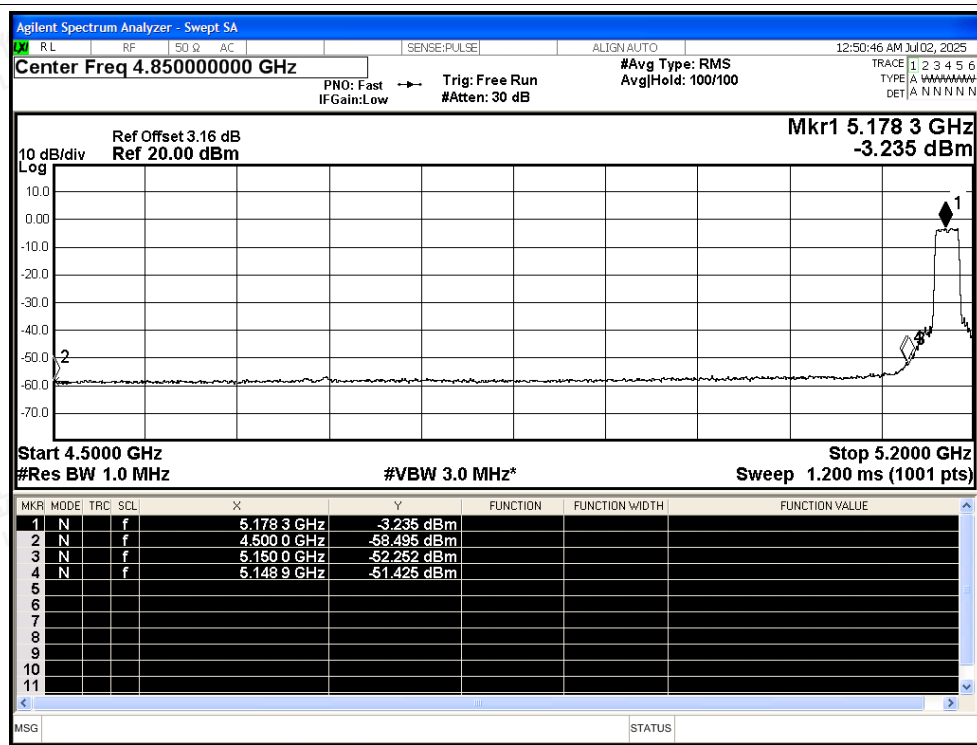

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

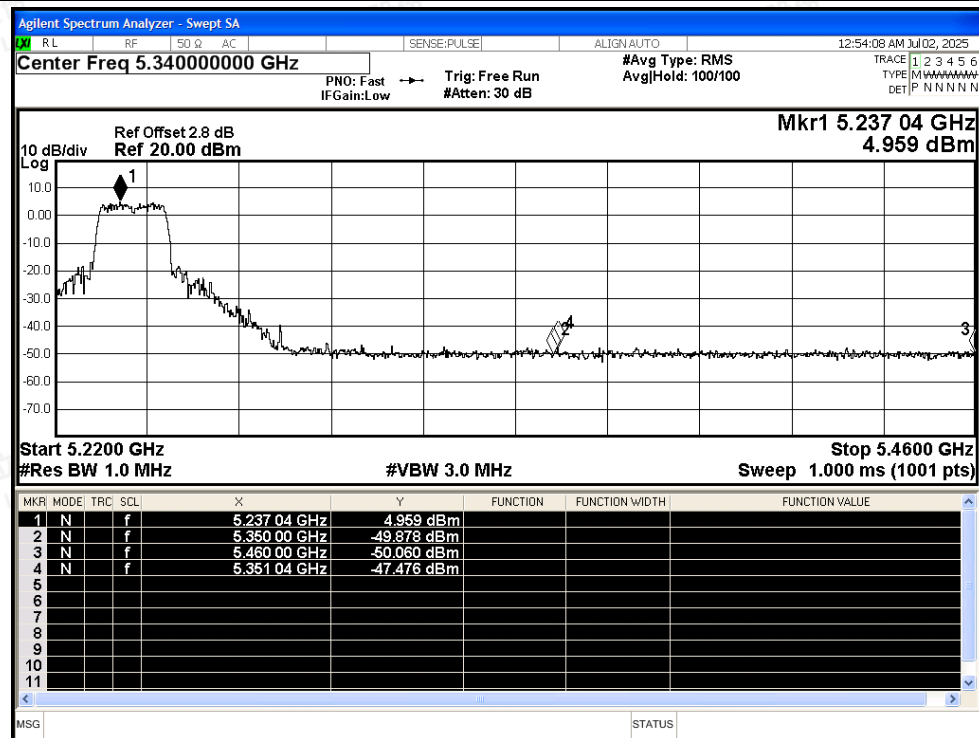

Restrict Band NVNT ac20 5240MHz Ant3 Average

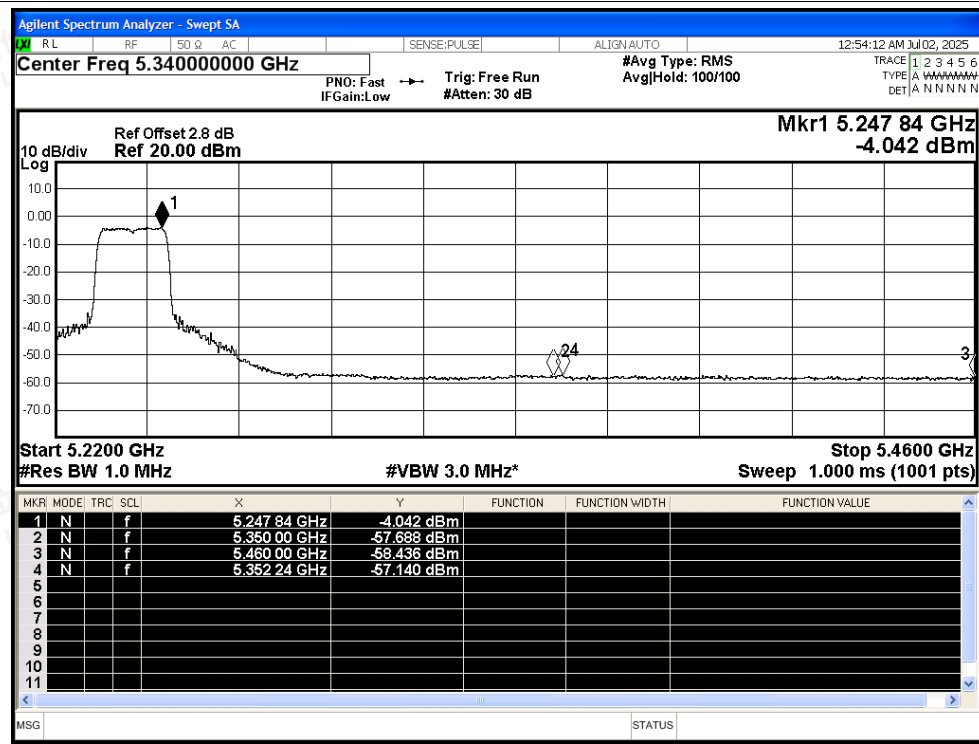

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

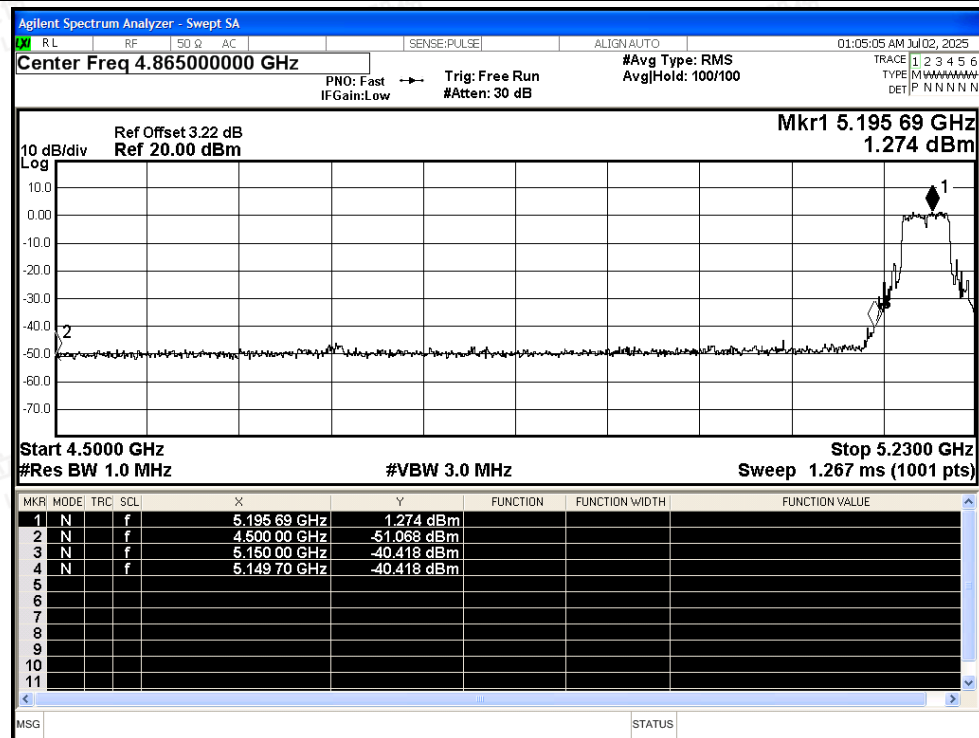

Restrict Band NVNT ac40 5190MHz Ant3 Average

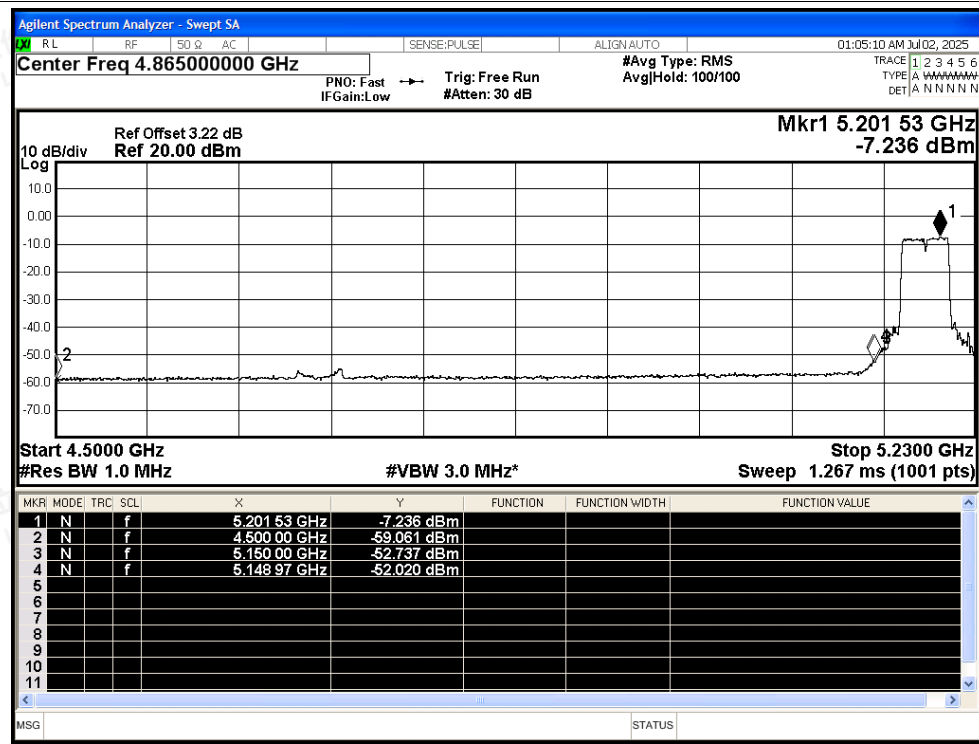

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

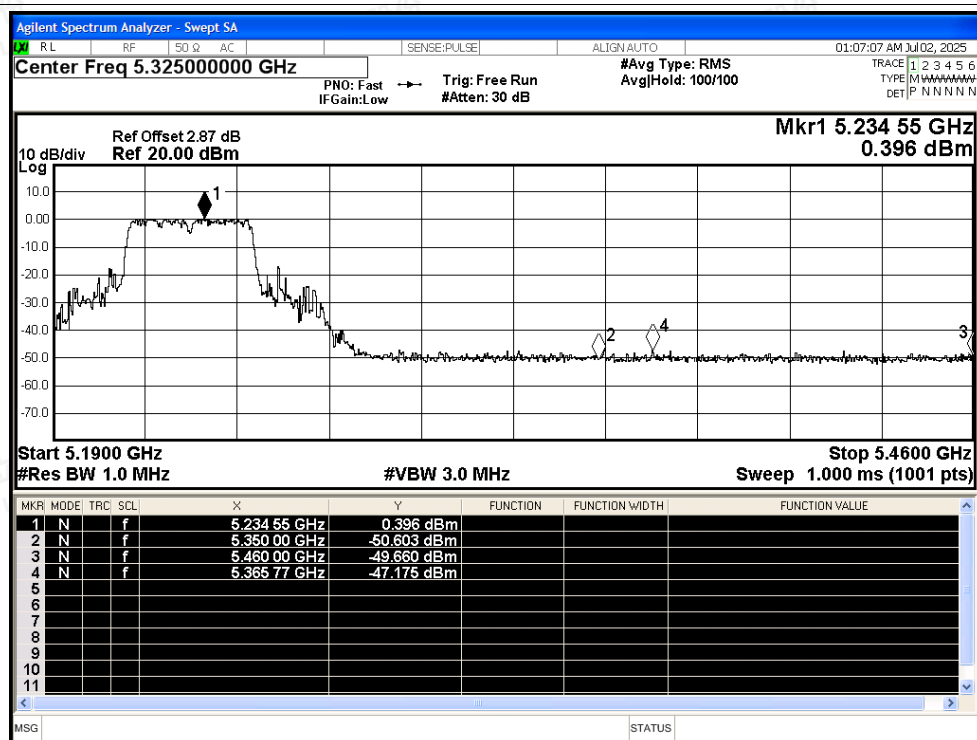

Restrict Band NVNT ac40 5230MHz Ant3 Average

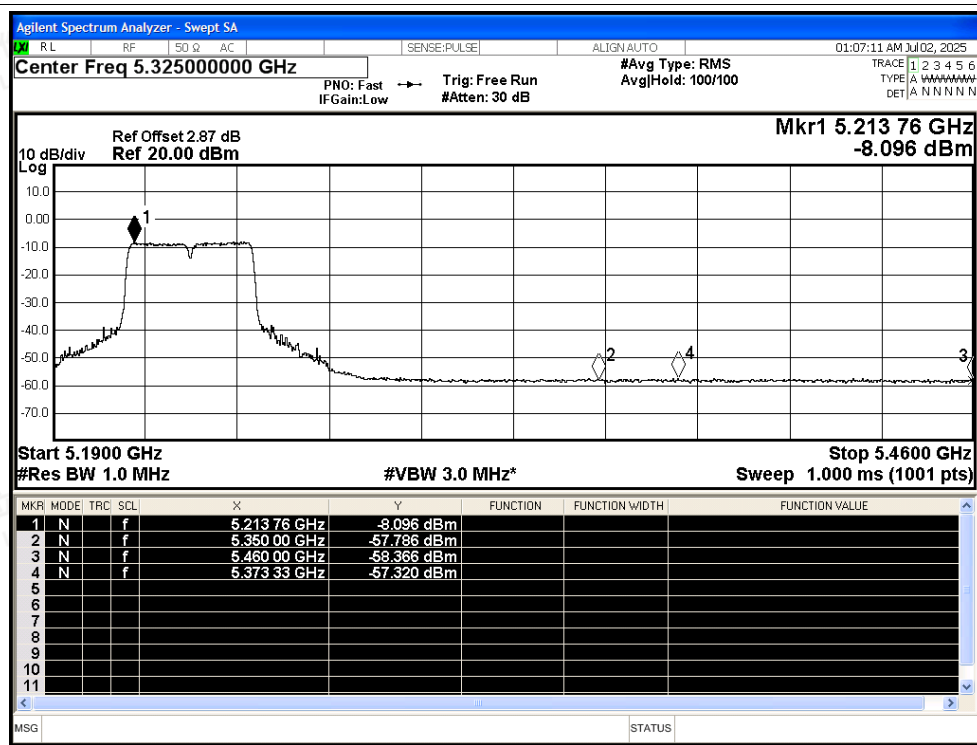

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

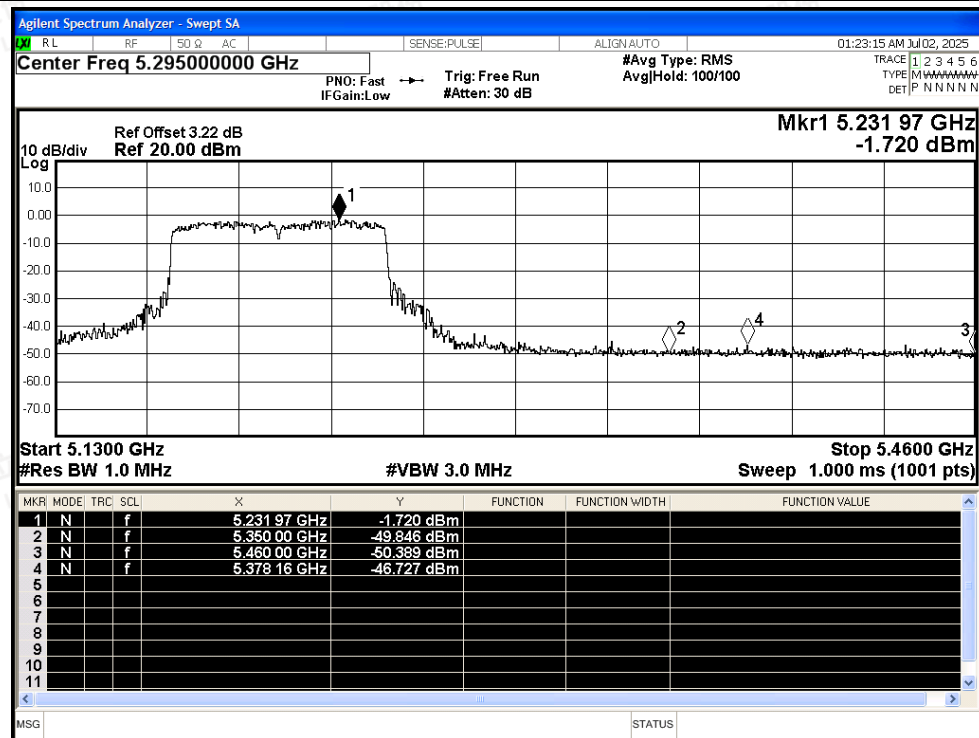

Restrict Band NVNT ac80 5210MHz Ant3 Average

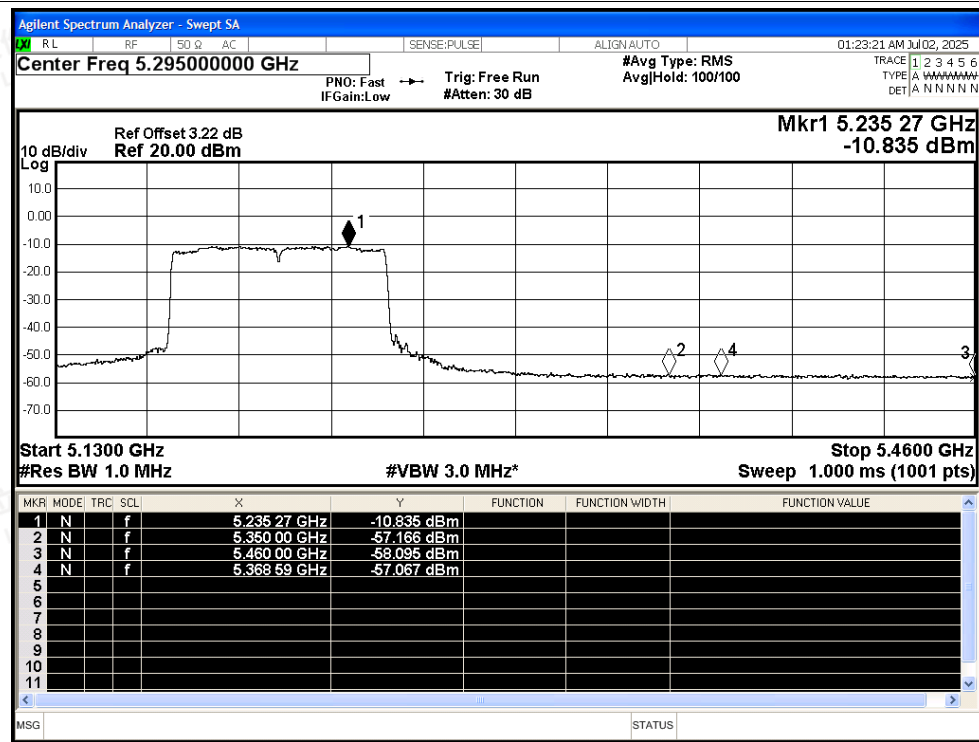

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

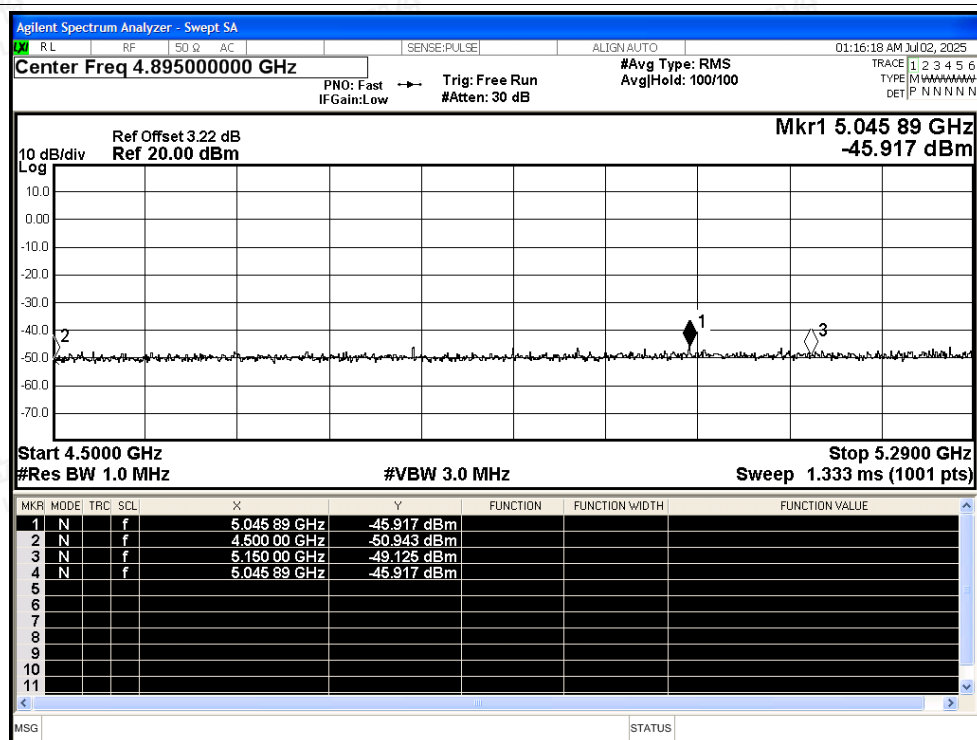

Restrict Band NVNT ac80 5210MHz Ant3 Average

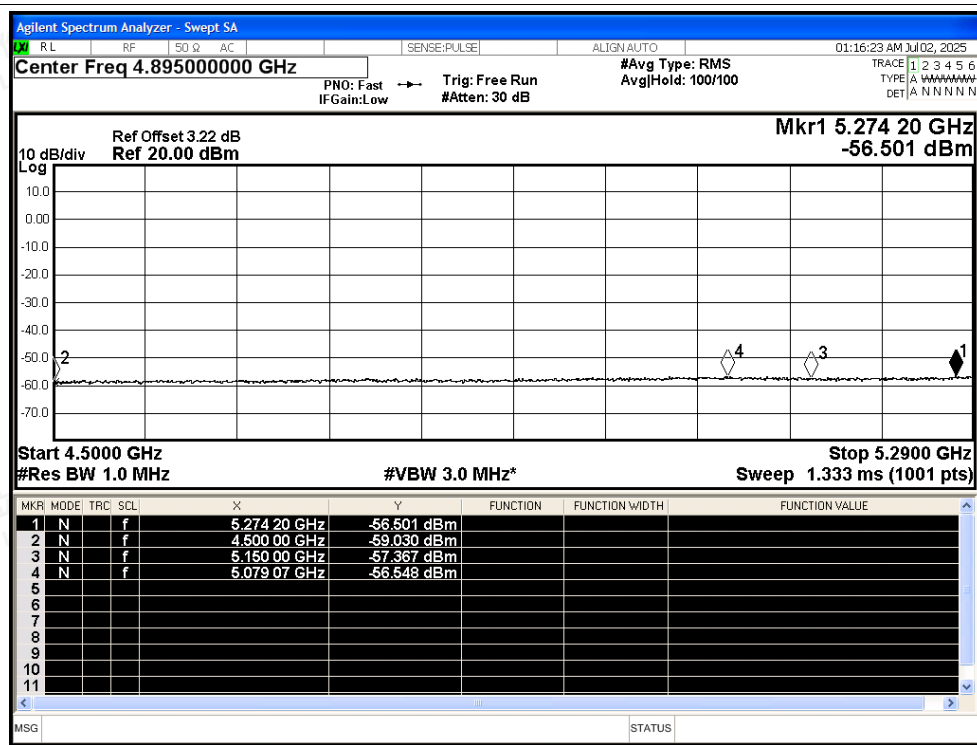

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant3 Peak

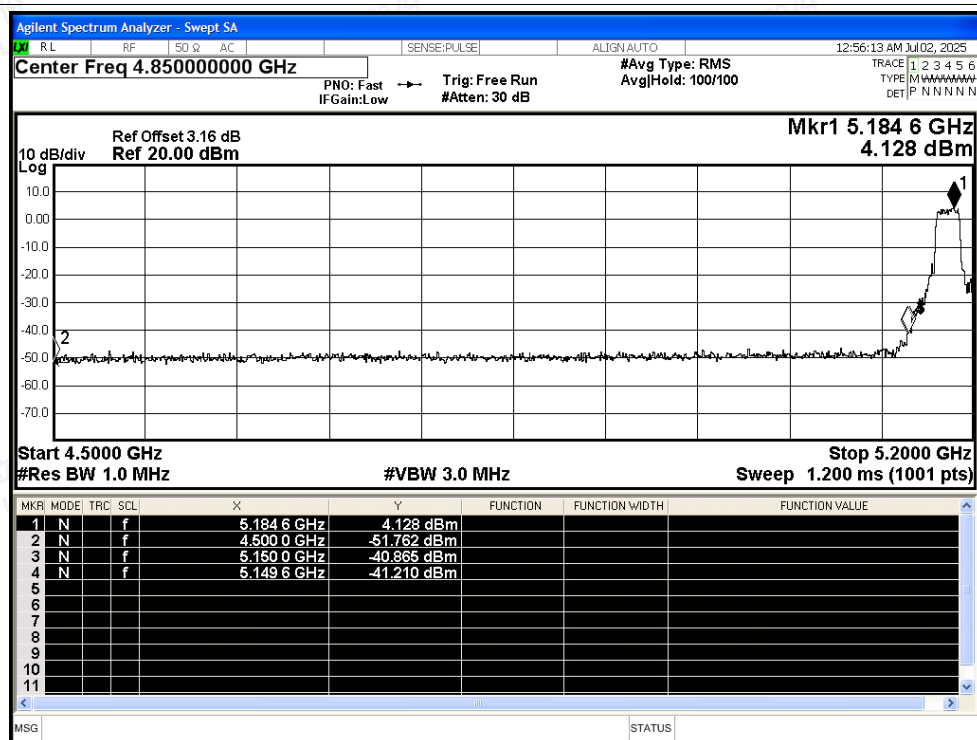

Restrict Band NVNT ax20 5180MHz Ant3 Average

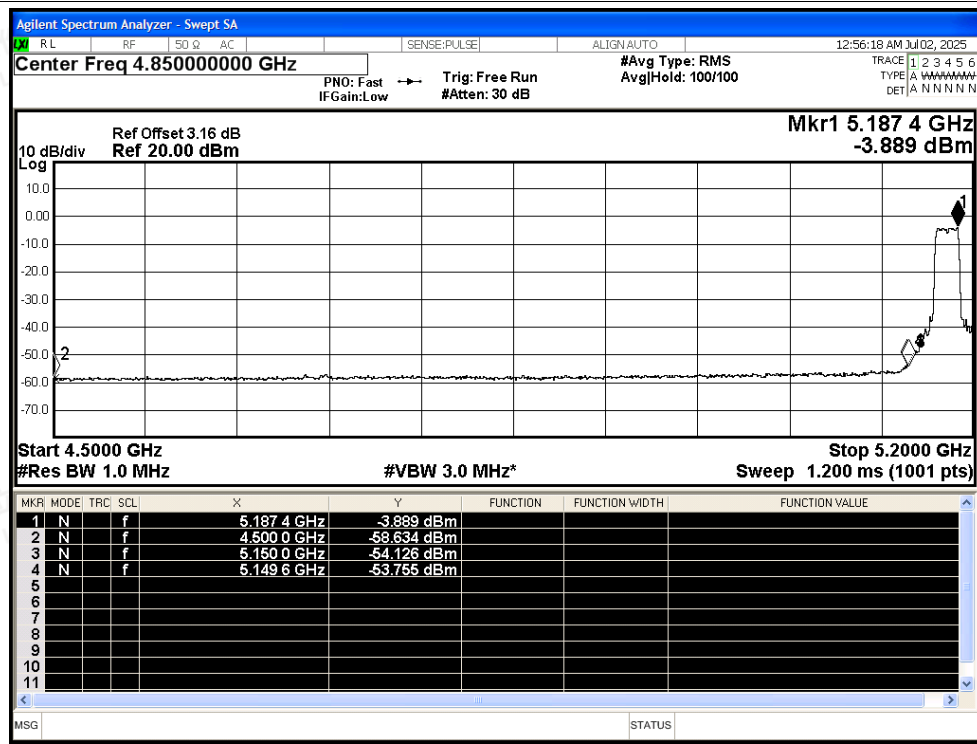

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant3 Peak

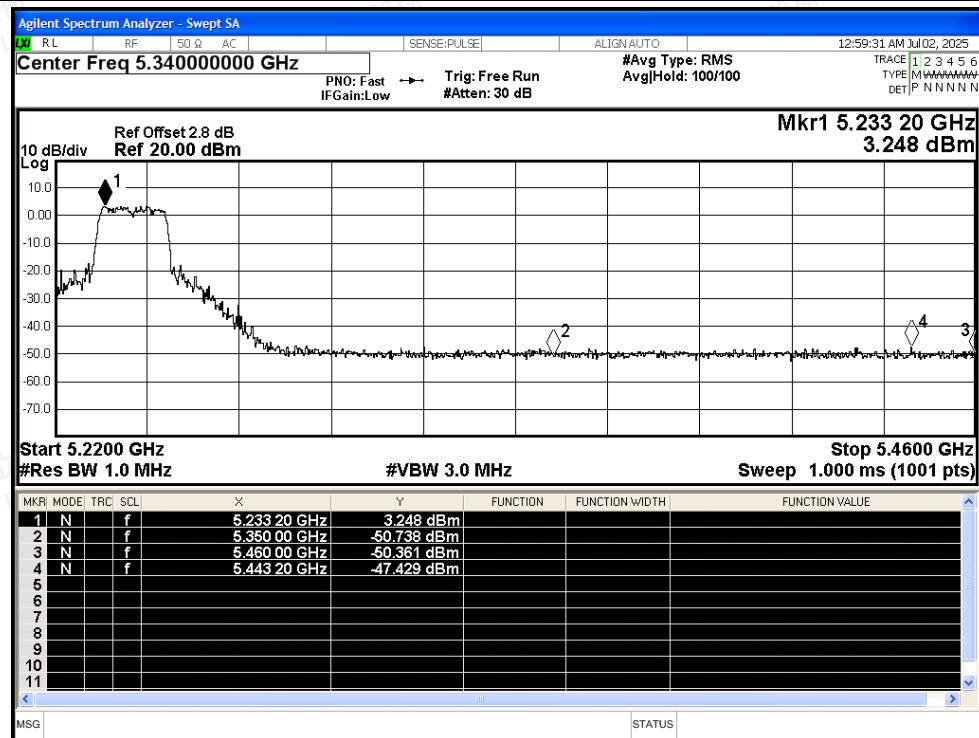

Restrict Band NVNT ax20 5240MHz Ant3 Average

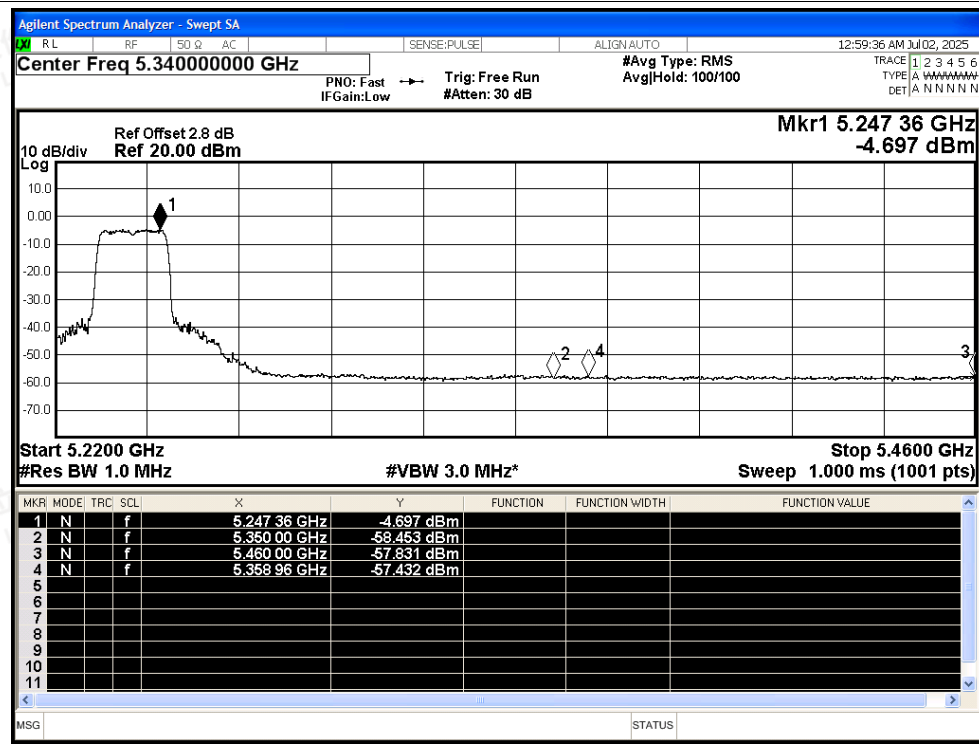

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant3 Peak

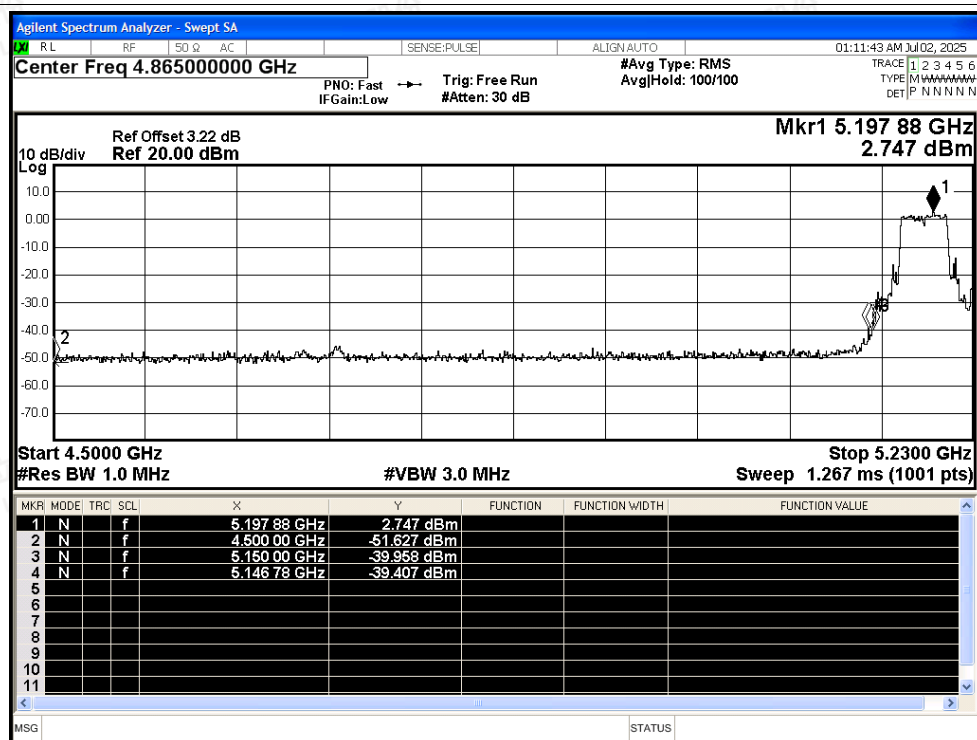

Restrict Band NVNT ax40 5190MHz Ant3 Average

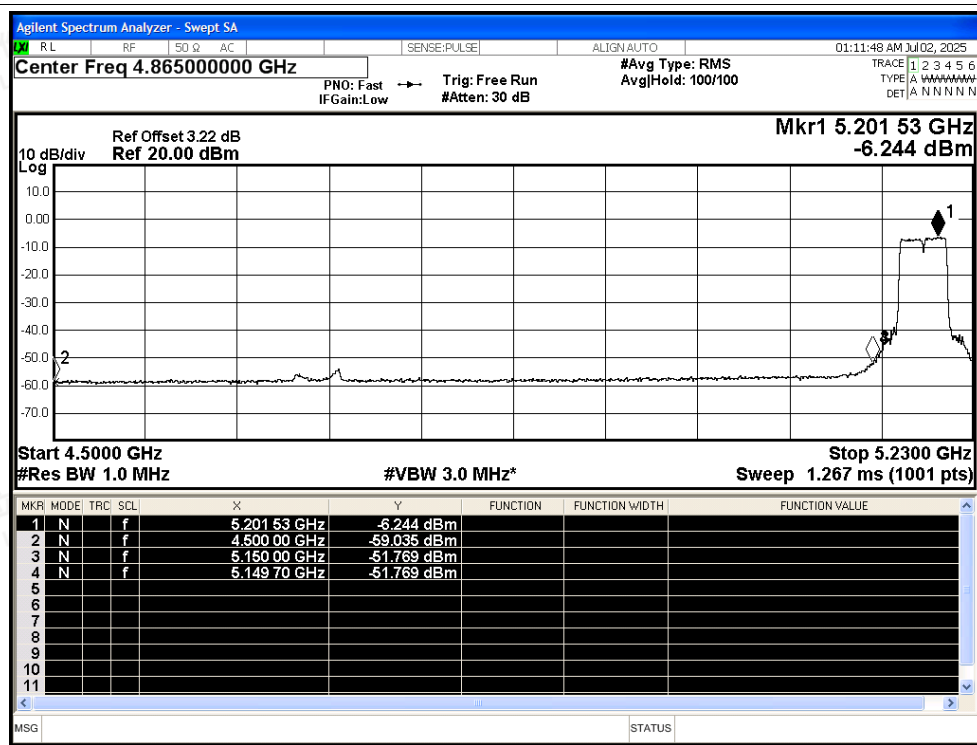

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant3 Peak

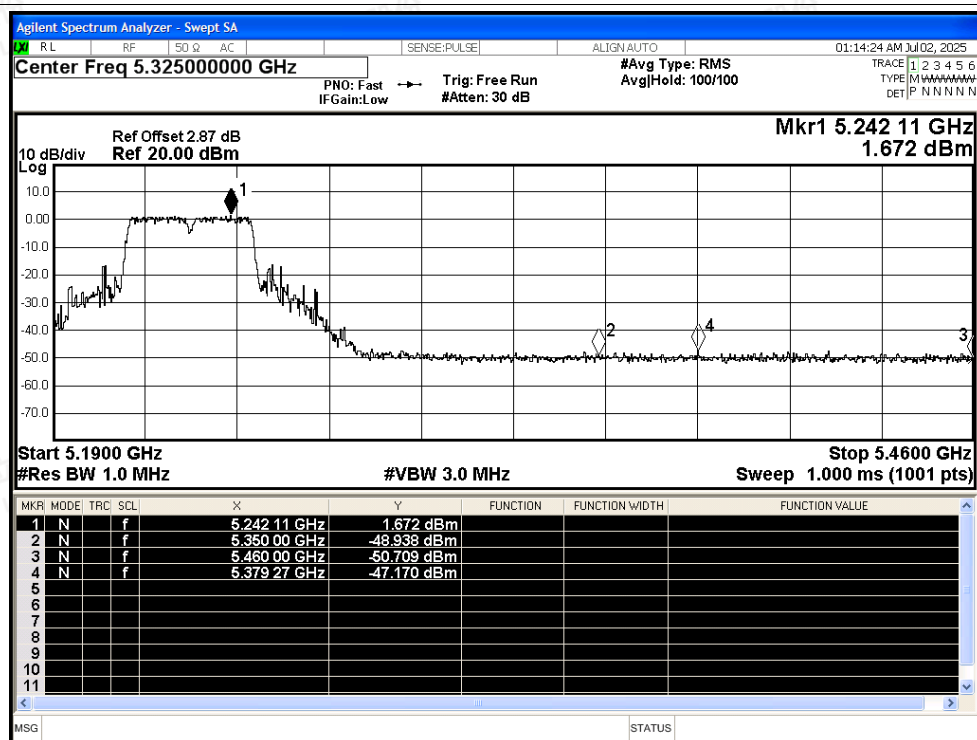

Restrict Band NVNT ax40 5230MHz Ant3 Average

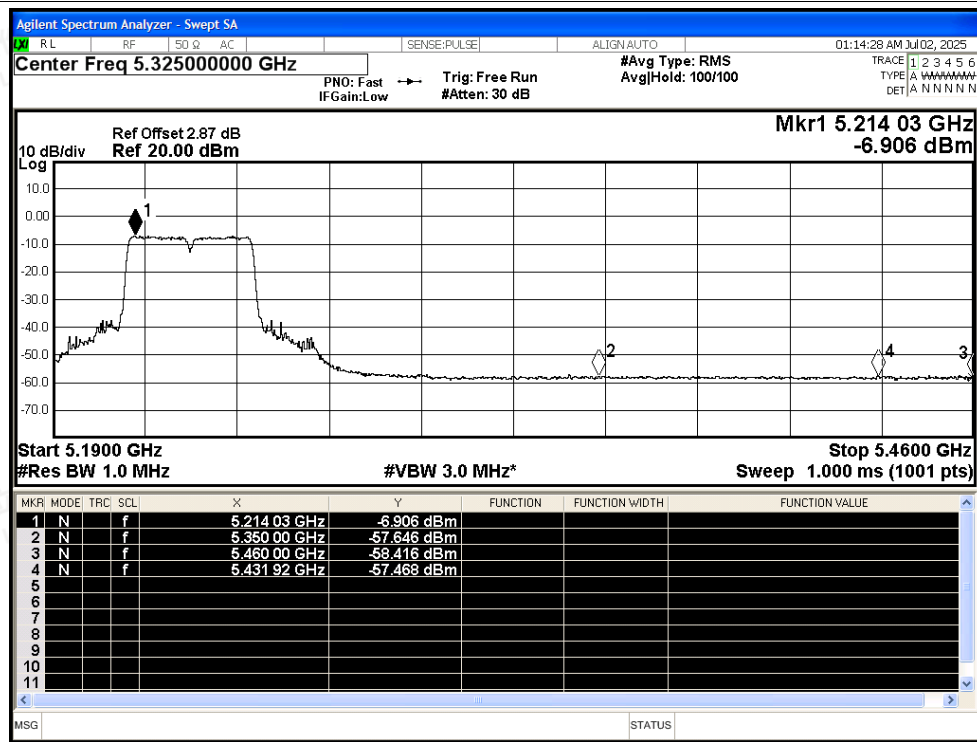

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

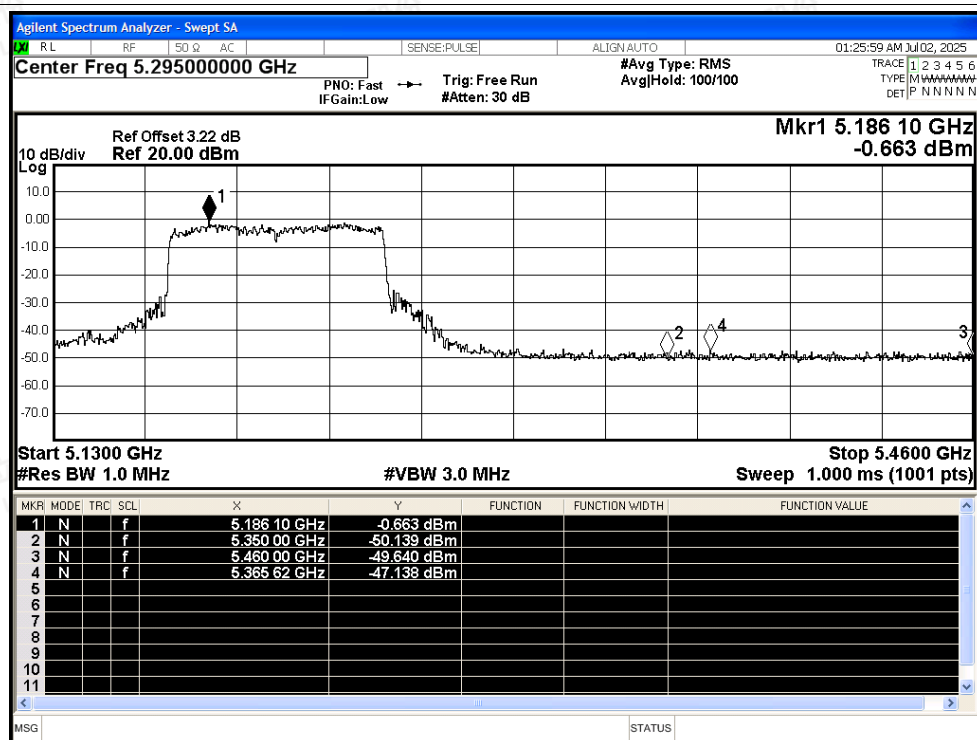

Restrict Band NVNT ax80 5210MHz Ant3 Average

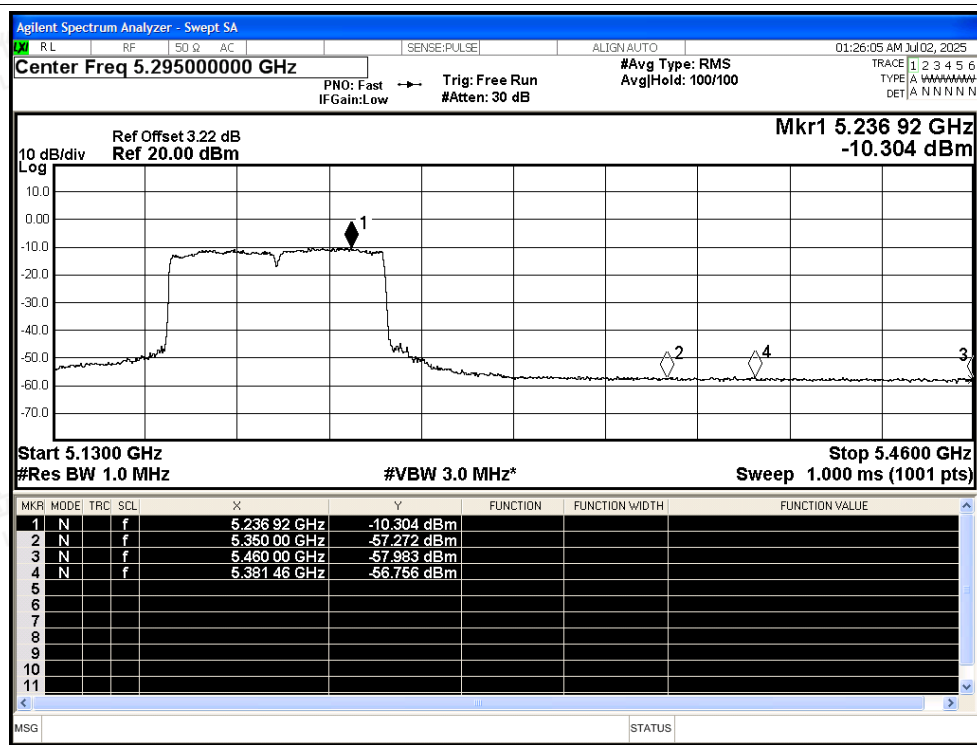

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

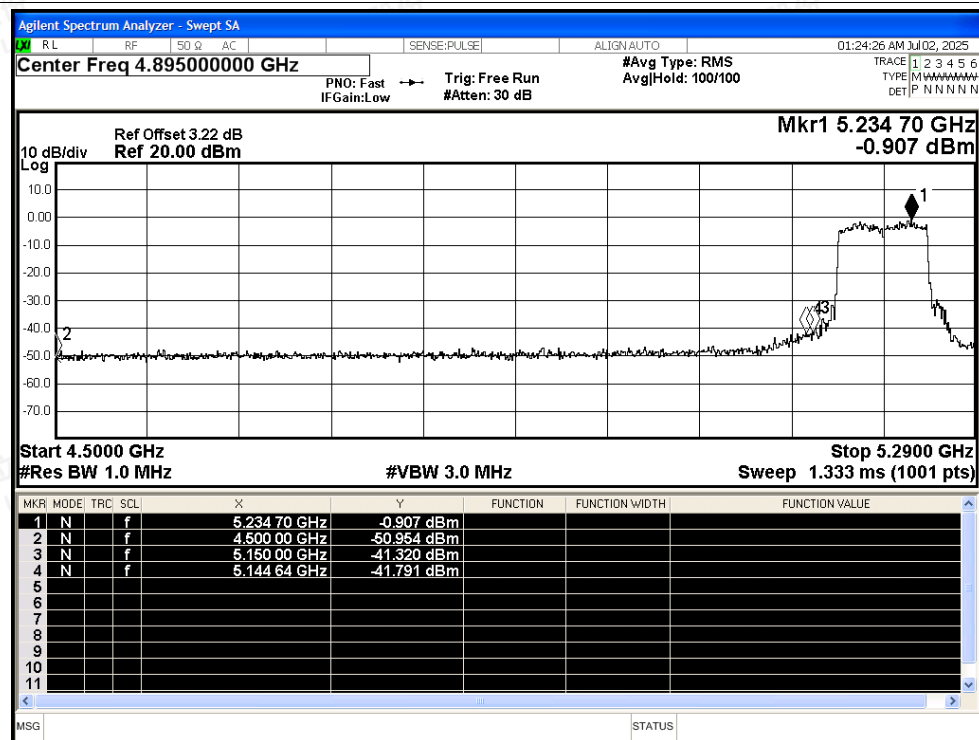

Restrict Band NVNT ax80 5210MHz Ant3 Average

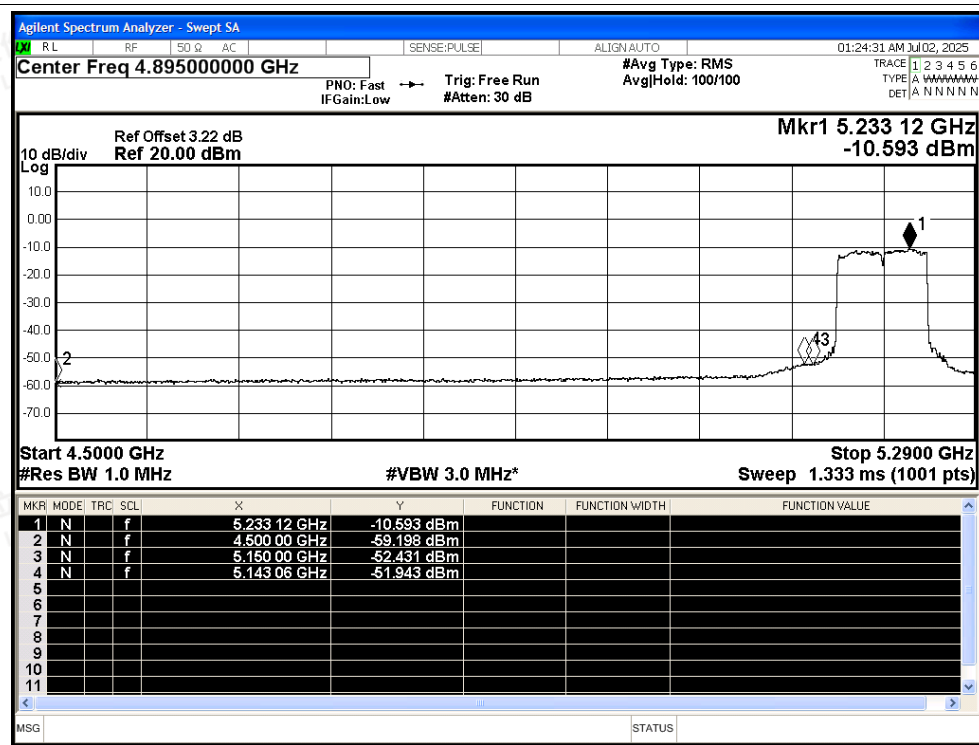

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant5	4500	-50.23	3.93	-	48.93	Peak	68.2	Pass
NVNT	a	5180	Ant5	4500	-58.77	3.93	0.19	40.58	Average	54	Pass
NVNT	a	5180	Ant5	5148.9	-40.44	3.93	-	58.72	Peak	68.2	Pass
NVNT	a	5180	Ant5	5149.6	-51.6	3.93	0.19	47.75	Average	54	Pass
NVNT	a	5180	Ant5	5150	-40.18	3.93	-	58.98	Peak	68.2	Pass
NVNT	a	5180	Ant5	5150	-52.39	3.93	0.19	46.96	Average	54	Pass
NVNT	a	5240	Ant5	5350	-49.51	3.93	-	49.65	Peak	68.2	Pass
NVNT	a	5240	Ant5	5350	-57.19	3.93	0.19	42.16	Average	54	Pass
NVNT	a	5240	Ant5	5357.76	-47.48	3.93	-	51.68	Peak	68.2	Pass
NVNT	a	5240	Ant5	5350.08	-57.19	3.93	0.19	42.16	Average	54	Pass
NVNT	a	5240	Ant5	5460	-50.36	3.93	-	48.80	Peak	68.2	Pass
NVNT	a	5240	Ant5	5460	-58.32	3.93	0.19	41.03	Average	54	Pass
NVNT	n20	5180	Ant5	4500	-50.86	3.93	-	48.30	Peak	68.2	Pass
NVNT	n20	5180	Ant5	4500	-58.74	3.93	0.23	40.65	Average	54	Pass
NVNT	n20	5180	Ant5	5148.9	-38.89	3.93	-	60.27	Peak	68.2	Pass
NVNT	n20	5180	Ant5	5148.9	-51.48	3.93	0.23	47.91	Average	54	Pass
NVNT	n20	5180	Ant5	5150	-38.26	3.93	-	60.90	Peak	68.2	Pass
NVNT	n20	5180	Ant5	5150	-51.45	3.93	0.23	47.94	Average	54	Pass
NVNT	n20	5240	Ant5	5350	-49.52	3.93	-	49.64	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5350	-57.43	3.93	0.23	41.96	Average	54	Pass
NVNT	n20	5240	Ant5	5426.88	-46.65	3.93	-	52.51	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5350.8	-57.18	3.93	0.23	42.21	Average	54	Pass
NVNT	n20	5240	Ant5	5460	-49.32	3.93	-	49.84	Peak	68.2	Pass
NVNT	n20	5240	Ant5	5460	-58.5	3.93	0.23	40.89	Average	54	Pass
NVNT	n40	5190	Ant5	4500	-51.57	3.93	-	47.59	Peak	68.2	Pass
NVNT	n40	5190	Ant5	4500	-58.25	3.93	0.44	41.35	Average	54	Pass
NVNT	n40	5190	Ant5	5149.7	-39.92	3.93	-	59.24	Peak	68.2	Pass
NVNT	n40	5190	Ant5	5149.7	-52.66	3.93	0.44	46.94	Average	54	Pass
NVNT	n40	5190	Ant5	5150	-39.92	3.93	-	59.24	Peak	68.2	Pass
NVNT	n40	5190	Ant5	5150	-52.66	3.93	0.44	46.94	Average	54	Pass
NVNT	n40	5230	Ant5	5350	-50.06	3.93	-	49.10	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5350	-58.27	3.93	0.44	41.33	Average	54	Pass
NVNT	n40	5230	Ant5	5423.82	-47.16	3.93	-	52.00	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5375.76	-57.18	3.93	0.44	42.42	Average	54	Pass
NVNT	n40	5230	Ant5	5460	-51.03	3.93	-	48.13	Peak	68.2	Pass
NVNT	n40	5230	Ant5	5460	-58.47	3.93	0.44	41.13	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant5	4500	-50.6	3.93	-	48.56	Peak	68.2	Pass
NVNT	ac20	5180	Ant5	4500	-58.79	3.93	0.22	40.59	Average	54	Pass
NVNT	ac20	5180	Ant5	5147.5	-36.37	3.93	-	62.79	Peak	68.2	Pass
NVNT	ac20	5180	Ant5	5149.6	-51.13	3.93	0.22	48.25	Average	54	Pass
NVNT	ac20	5180	Ant5	5150	-39.72	3.93	-	59.44	Peak	68.2	Pass
NVNT	ac20	5180	Ant5	5150	-49.98	3.93	0.22	49.40	Average	54	Pass
NVNT	ac20	5240	Ant5	5350	-49.09	3.93	-	50.07	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5350	-57.74	3.93	0.22	41.64	Average	54	Pass
NVNT	ac20	5240	Ant5	5448	-46.8	3.93	-	52.36	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5352	-57.07	3.93	0.22	42.31	Average	54	Pass
NVNT	ac20	5240	Ant5	5460	-50.54	3.93	-	48.62	Peak	68.2	Pass
NVNT	ac20	5240	Ant5	5460	-58.19	3.93	0.22	41.19	Average	54	Pass
NVNT	ac40	5190	Ant5	4500	-50.31	3.93	-	48.85	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	4500	-58.63	3.93	0.43	40.96	Average	54	Pass
NVNT	ac40	5190	Ant5	5149.7	-39.94	3.93	-	59.22	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	5149.7	-51.38	3.93	0.43	48.21	Average	54	Pass
NVNT	ac40	5190	Ant5	5150	-39.94	3.93	-	59.22	Peak	68.2	Pass
NVNT	ac40	5190	Ant5	5150	-51.38	3.93	0.43	48.21	Average	54	Pass
NVNT	ac40	5230	Ant5	5350	-49.31	3.93	-	49.85	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5350	-57.89	3.93	0.43	41.70	Average	54	Pass
NVNT	ac40	5230	Ant5	5381.16	-47.3	3.93	-	51.86	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5454.33	-57.19	3.93	0.43	42.40	Average	54	Pass
NVNT	ac40	5230	Ant5	5460	-49.41	3.93	-	49.75	Peak	68.2	Pass
NVNT	ac40	5230	Ant5	5460	-58.42	3.93	0.43	41.17	Average	54	Pass
NVNT	ac80	5210	Ant5	5350	-48.95	3.93	-	50.21	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5350	-56.88	3.93	0.83	43.11	Average	54	Pass
NVNT	ac80	5210	Ant5	5401.26	-46.63	3.93	-	52.53	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5350.11	-56.88	3.93	0.83	43.11	Average	54	Pass
NVNT	ac80	5210	Ant5	5460	-50.59	3.93	-	48.57	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5460	-58.46	3.93	0.83	41.53	Average	54	Pass
NVNT	ac80	5210	Ant5	4500	-50.54	3.93	-	48.62	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	4500	-59.56	3.93	0.83	40.43	Average	54	Pass
NVNT	ac80	5210	Ant5	5147.01	-41.13	3.93	-	58.03	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5146.22	-52.24	3.93	0.83	47.75	Average	54	Pass
NVNT	ac80	5210	Ant5	5150	-43.52	3.93	-	55.64	Peak	68.2	Pass
NVNT	ac80	5210	Ant5	5150	-52.09	3.93	0.83	47.90	Average	54	Pass
NVNT	ax20	5180	Ant5	4500	-49.8	3.93	-	49.36	Peak	68.2	Pass
NVNT	ax20	5180	Ant5	4500	-58.9	3.93	0.22	40.48	Average	54	Pass
NVNT	ax20	5180	Ant5	5149.6	-38.21	3.93	-	60.95	Peak	68.2	Pass
NVNT	ax20	5180	Ant5	5149.6	-51.37	3.93	0.22	48.01	Average	54	Pass
NVNT	ax20	5180	Ant5	5150	-40.17	3.93	-	58.99	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5180	Ant5	5150	-51.33	3.93	0.22	48.05	Average	54	Pass
NVNT	ax20	5240	Ant5	5350	-49.25	3.93	-	49.91	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5350	-58.26	3.93	0.22	41.12	Average	54	Pass
NVNT	ax20	5240	Ant5	5440.08	-47.48	3.93	-	51.68	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5351.52	-57.22	3.93	0.22	42.16	Average	54	Pass
NVNT	ax20	5240	Ant5	5460	-50.31	3.93	-	48.85	Peak	68.2	Pass
NVNT	ax20	5240	Ant5	5460	-58.29	3.93	0.22	41.09	Average	54	Pass
NVNT	ax40	5190	Ant5	4500	-50.03	3.93	-	49.13	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	4500	-58.66	3.93	0.43	40.93	Average	54	Pass
NVNT	ax40	5190	Ant5	5149.7	-38.65	3.93	-	60.51	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	5149.7	-52.16	3.93	0.43	47.43	Average	54	Pass
NVNT	ax40	5190	Ant5	5150	-38.65	3.93	-	60.51	Peak	68.2	Pass
NVNT	ax40	5190	Ant5	5150	-52.16	3.93	0.43	47.43	Average	54	Pass
NVNT	ax40	5230	Ant5	5350	-48.61	3.93	-	50.55	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5350	-57.96	3.93	0.44	41.64	Average	54	Pass
NVNT	ax40	5230	Ant5	5353.08	-47.43	3.93	-	51.73	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5373.6	-57.29	3.93	0.44	42.31	Average	54	Pass
NVNT	ax40	5230	Ant5	5460	-50.94	3.93	-	48.22	Peak	68.2	Pass
NVNT	ax40	5230	Ant5	5460	-58.09	3.93	0.44	41.51	Average	54	Pass
NVNT	ax80	5210	Ant5	5350	-50.38	3.93	-	48.78	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5350	-57.65	3.93	0.83	42.34	Average	54	Pass
NVNT	ax80	5210	Ant5	5391.69	-46.96	3.93	-	52.20	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5357.37	-56.79	3.93	0.83	43.20	Average	54	Pass
NVNT	ax80	5210	Ant5	5460	-50.22	3.93	-	48.94	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5460	-58.02	3.93	0.83	41.97	Average	54	Pass
NVNT	ax80	5210	Ant5	4500	-49.61	3.93	-	49.55	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	4500	-58.66	3.93	0.83	41.33	Average	54	Pass
NVNT	ax80	5210	Ant5	5147.01	-37.9	3.93	-	61.26	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5137.53	-51.96	3.93	0.83	48.03	Average	54	Pass
NVNT	ax80	5210	Ant5	5150	-43.11	3.93	-	56.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant5	5150	-52.33	3.93	0.83	47.66	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant5 Peak

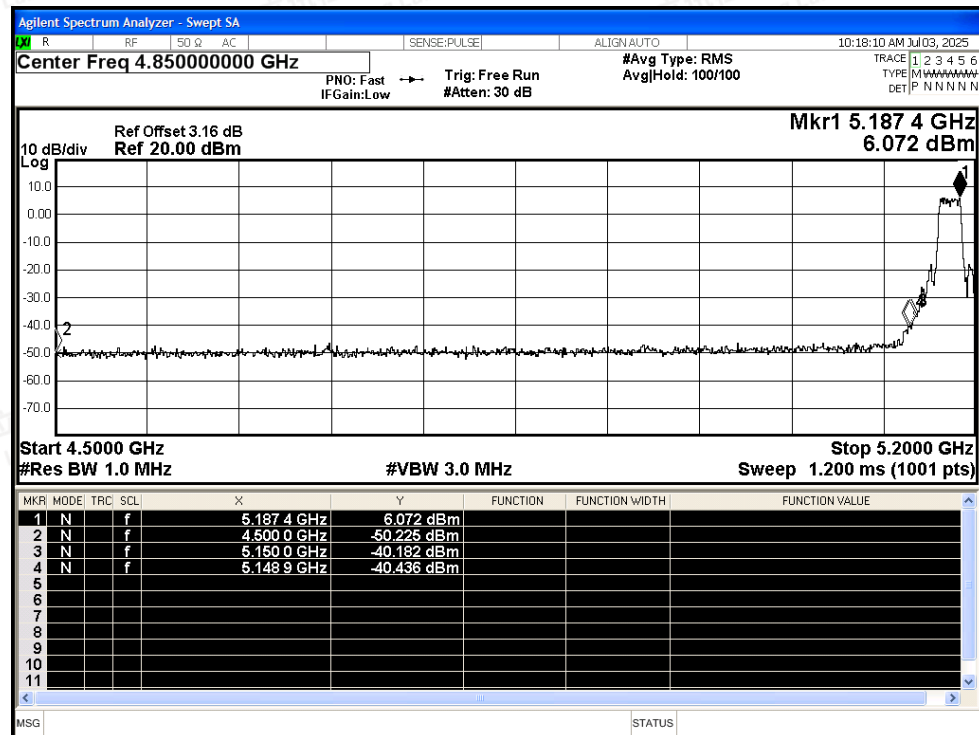

Restrict Band NVNT a 5180MHz Ant5 Average

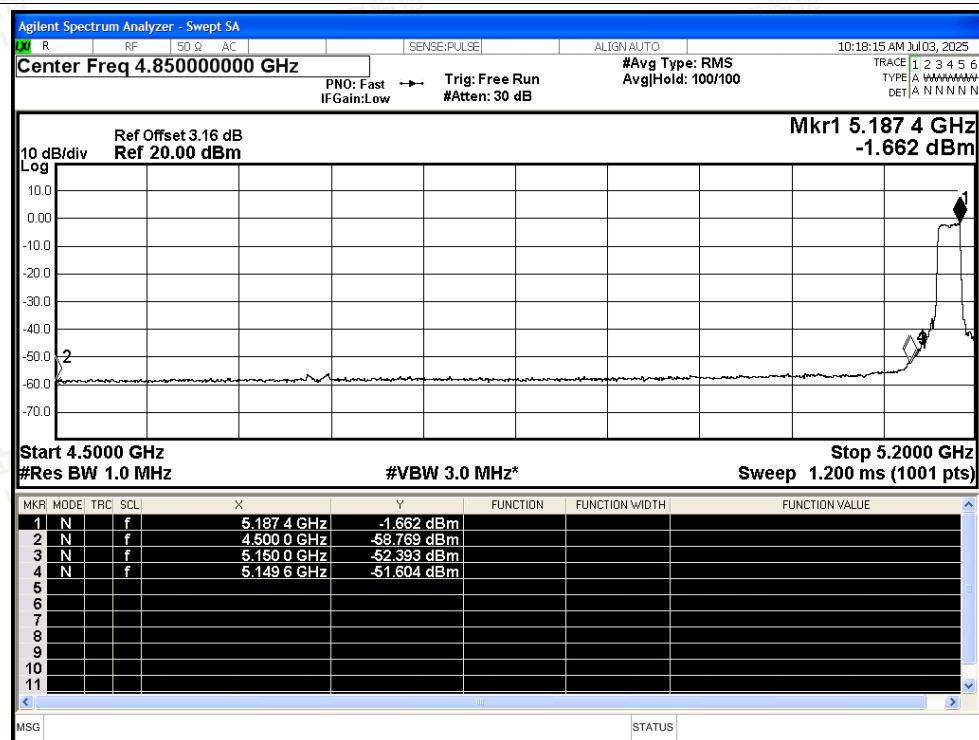

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant5 Peak

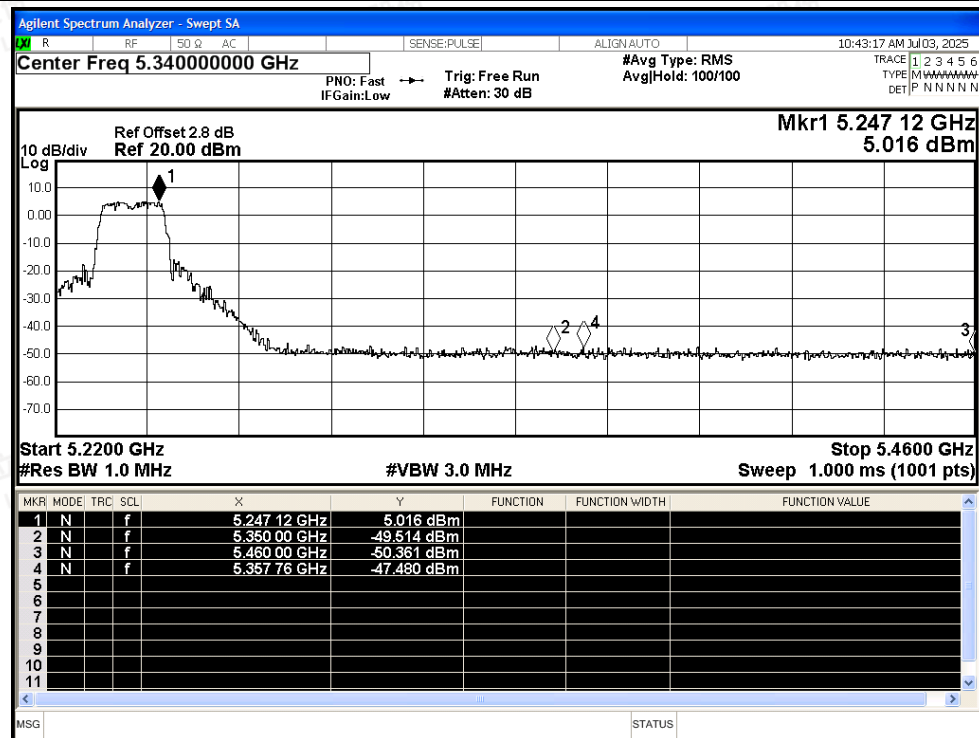

Restrict Band NVNT a 5240MHz Ant5 Average

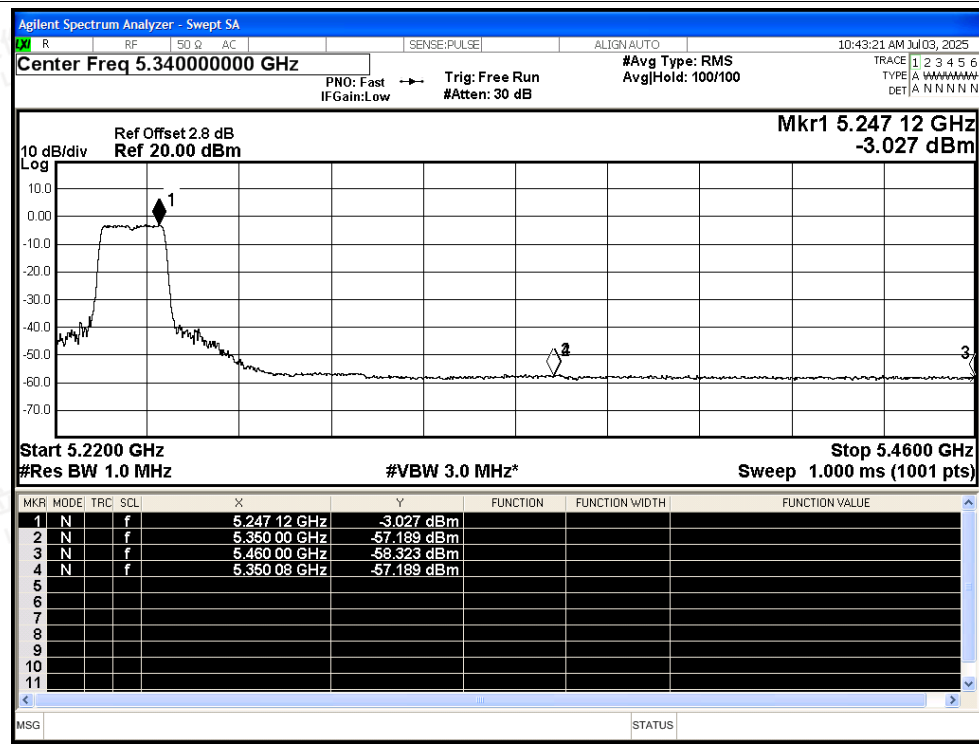

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant5 Peak

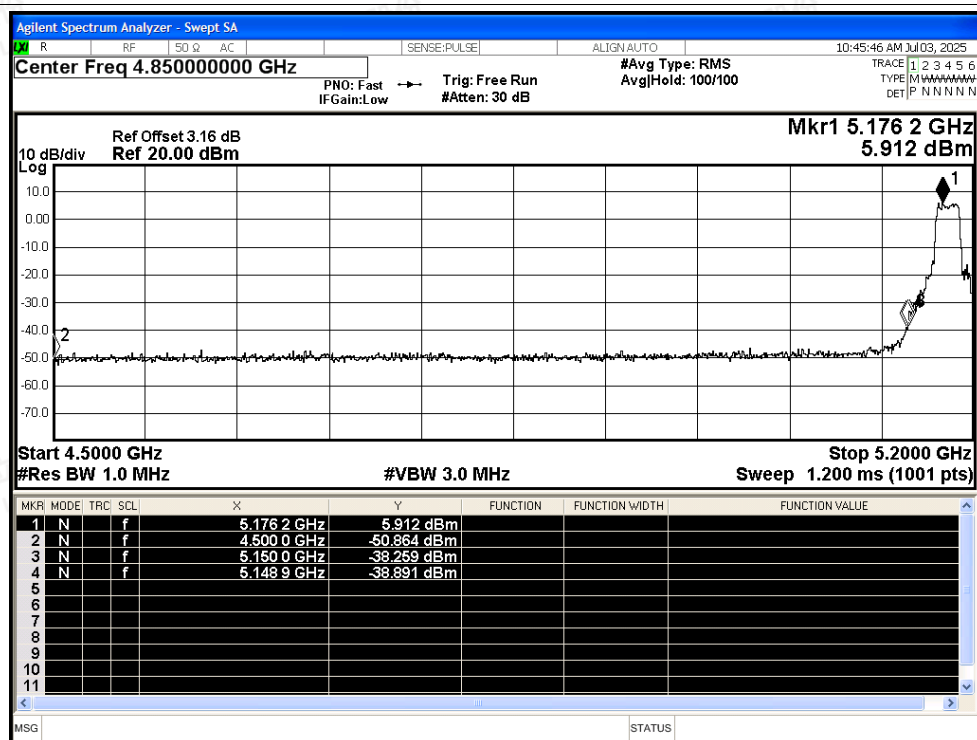

Restrict Band NVNT n20 5180MHz Ant5 Average

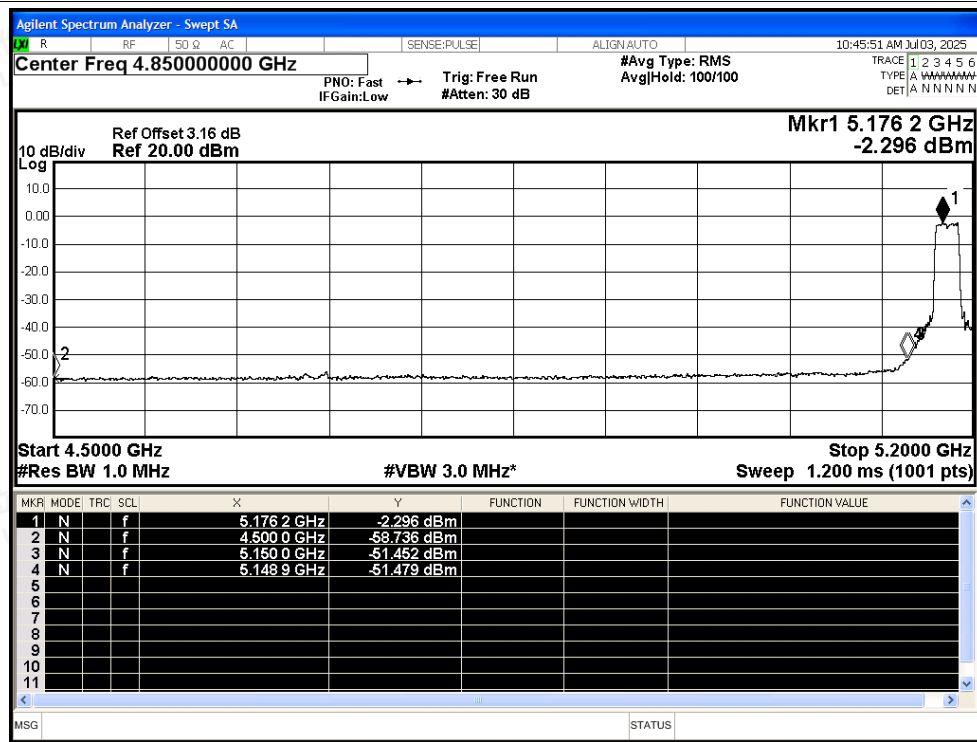

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant5 Peak

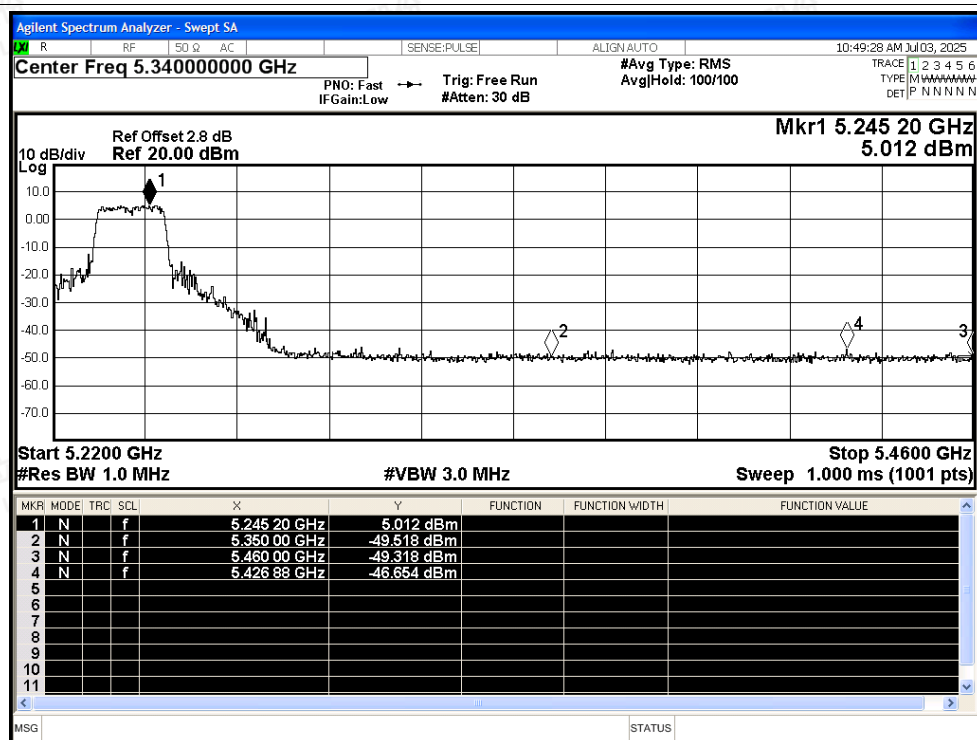

Restrict Band NVNT n20 5240MHz Ant5 Average

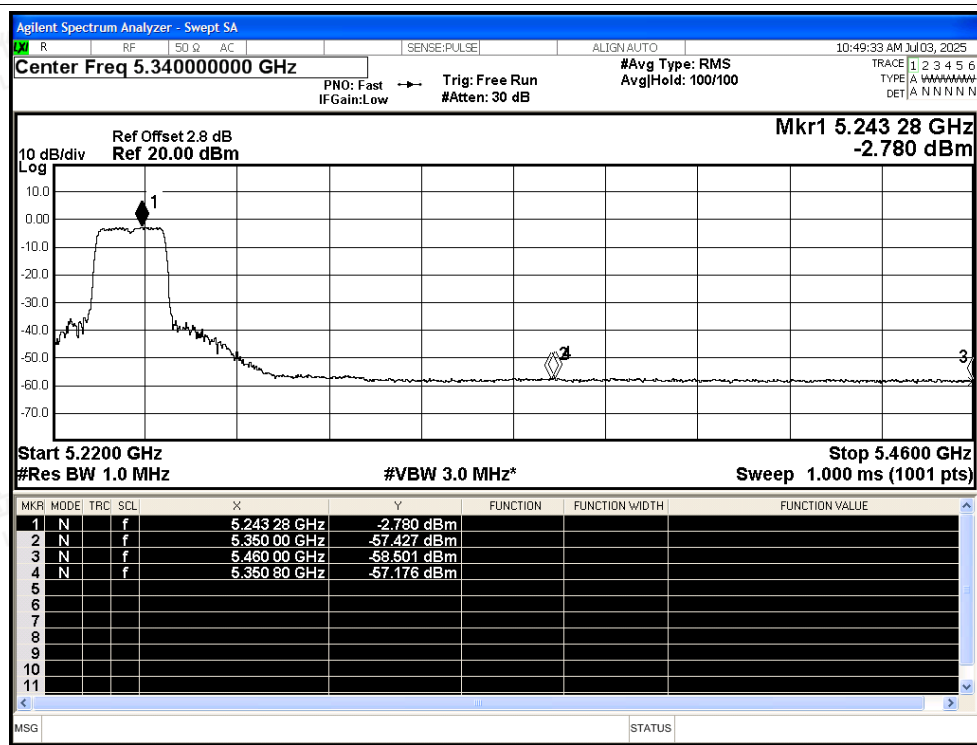

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant5 Peak

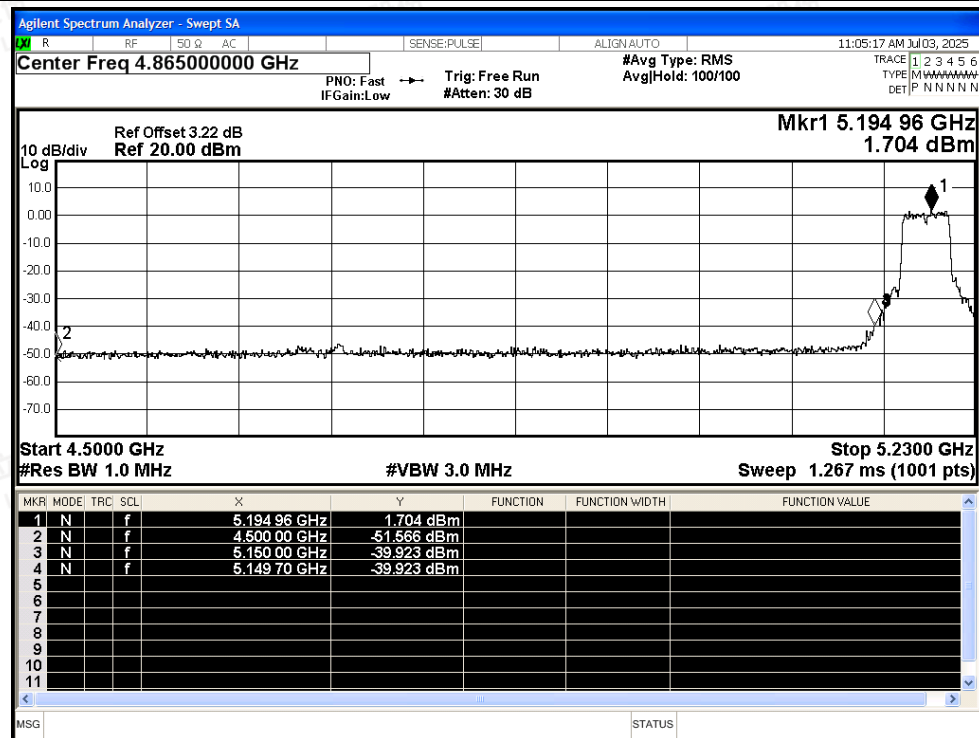

Restrict Band NVNT n40 5190MHz Ant5 Average

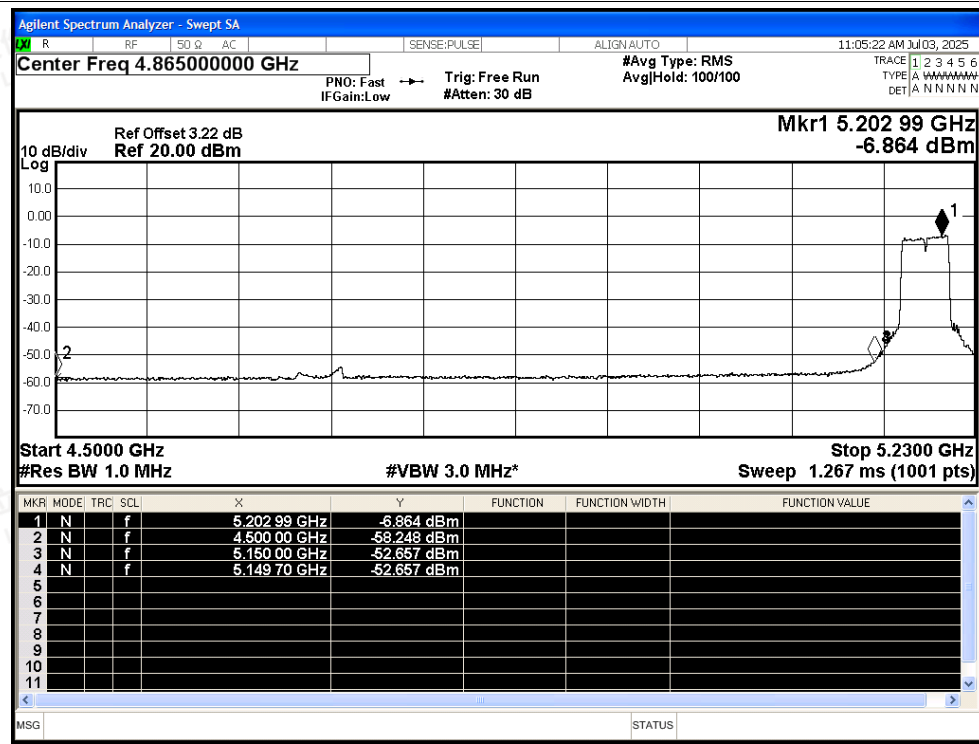

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant5 Peak

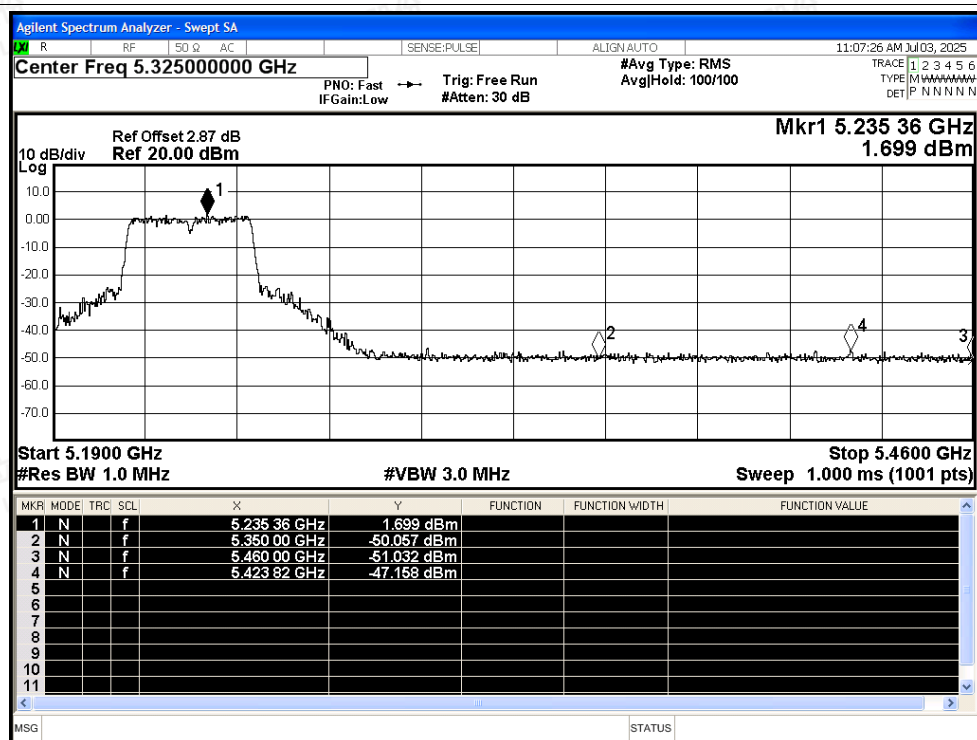

Restrict Band NVNT n40 5230MHz Ant5 Average

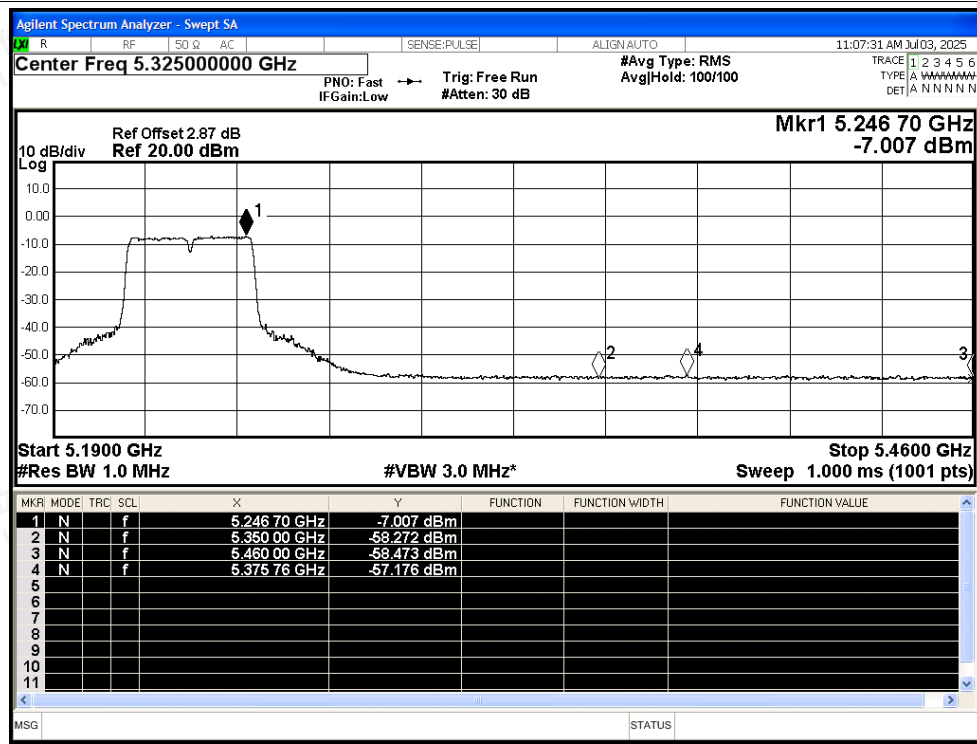

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant5 Peak

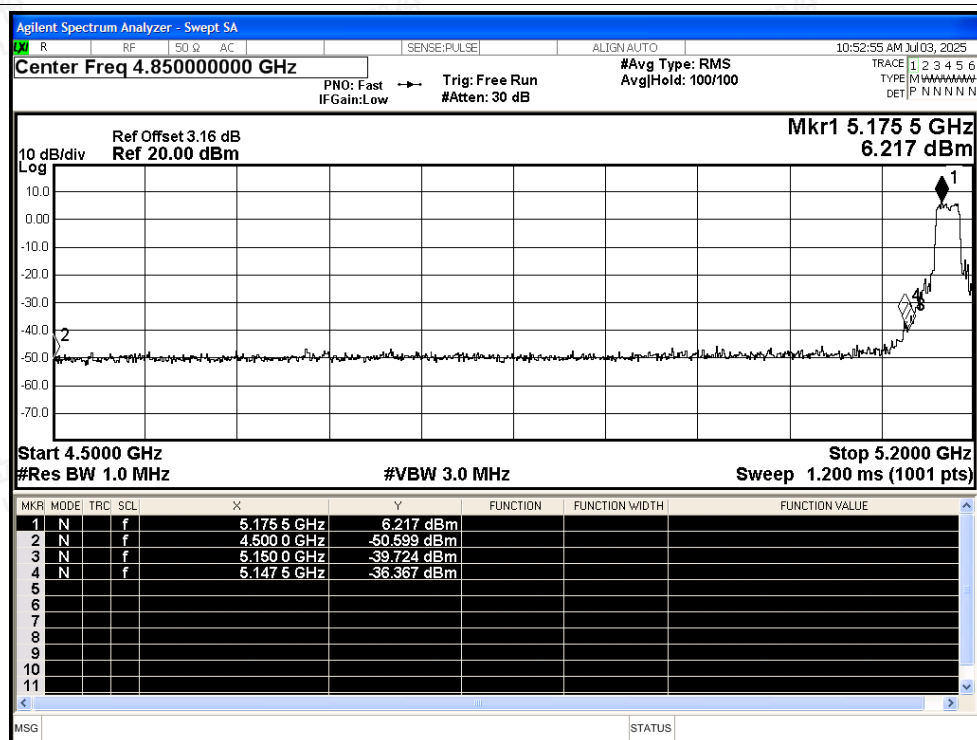

Restrict Band NVNT ac20 5180MHz Ant5 Average

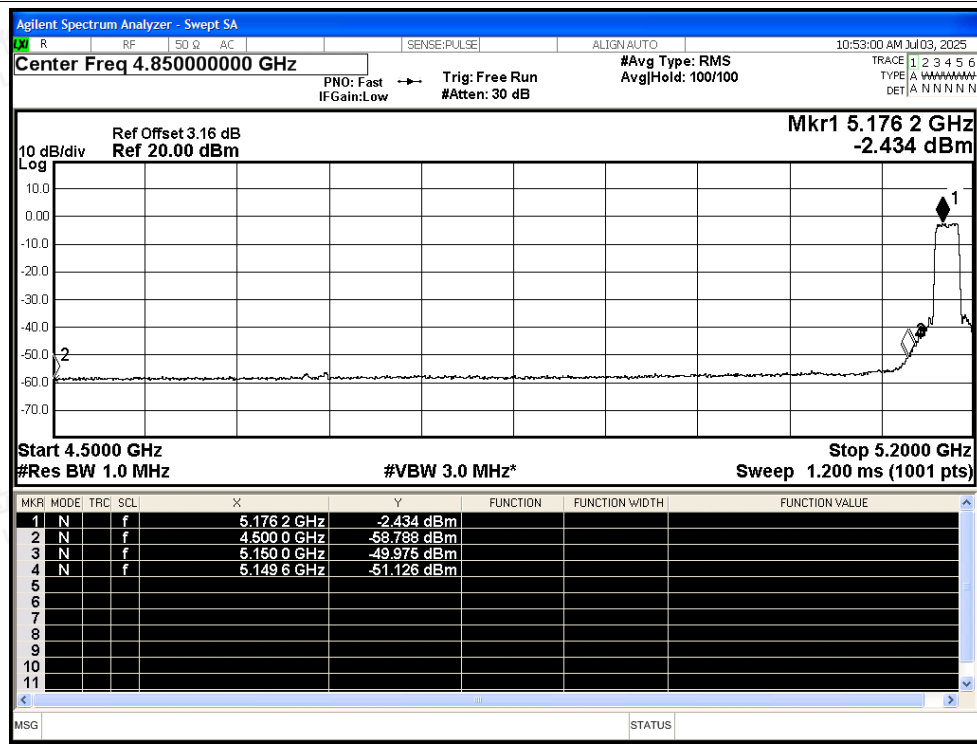

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant5 Peak

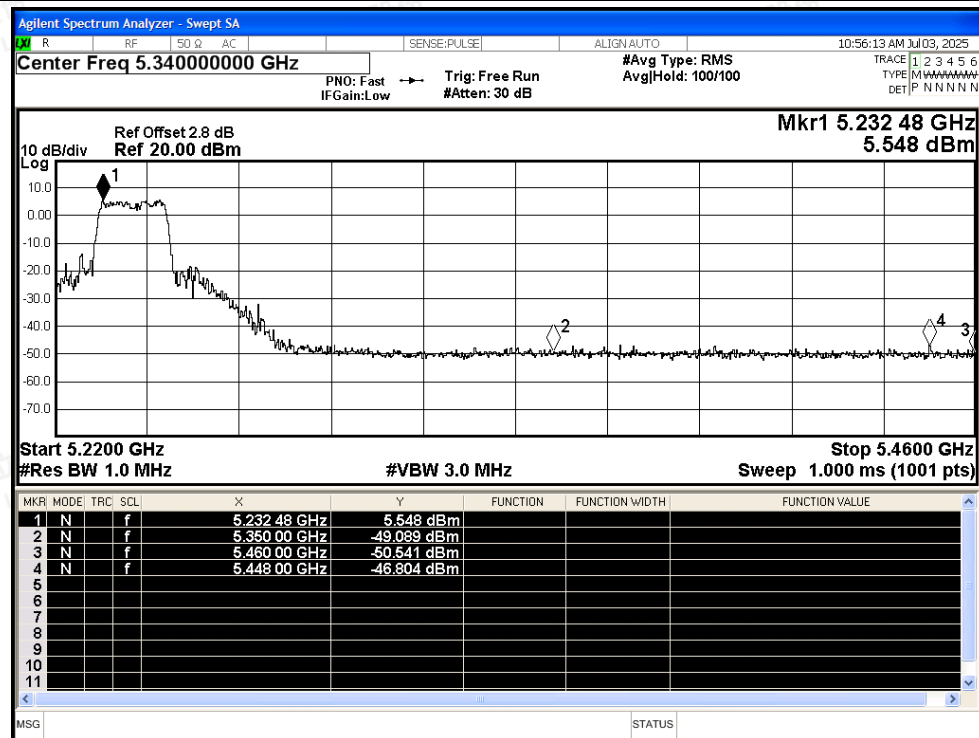

Restrict Band NVNT ac20 5240MHz Ant5 Average

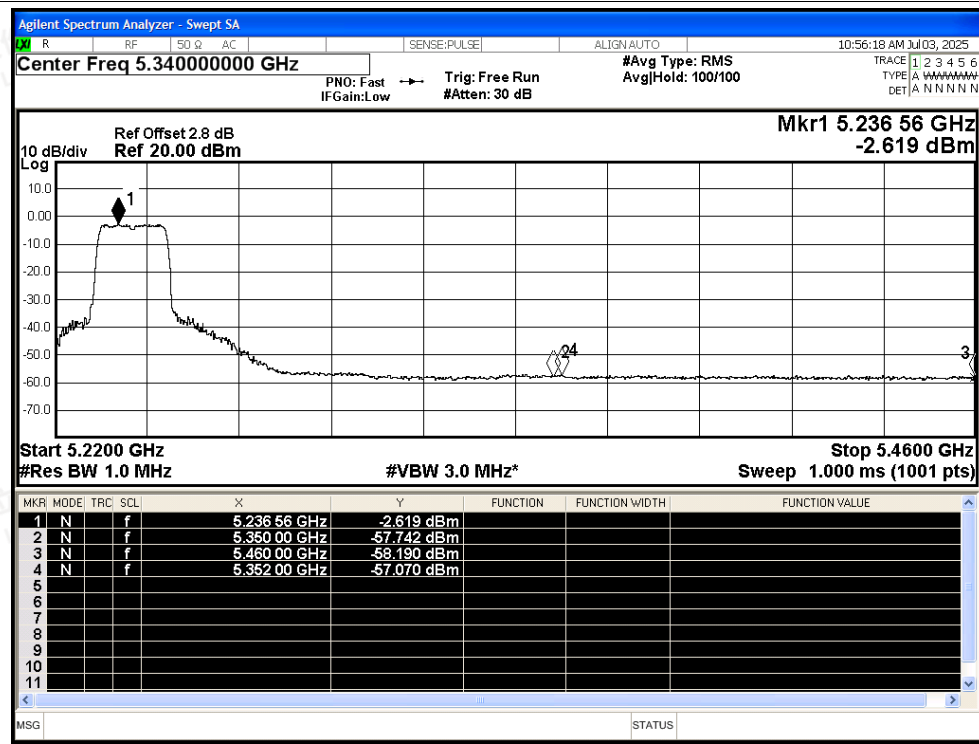

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant5 Peak

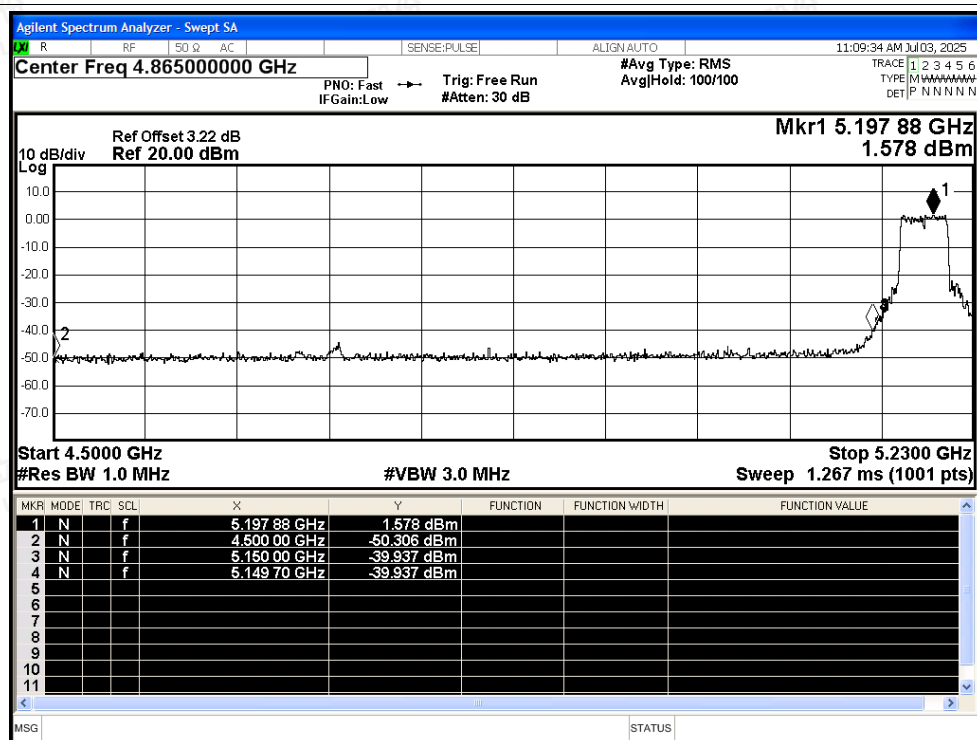

Restrict Band NVNT ac40 5190MHz Ant5 Average

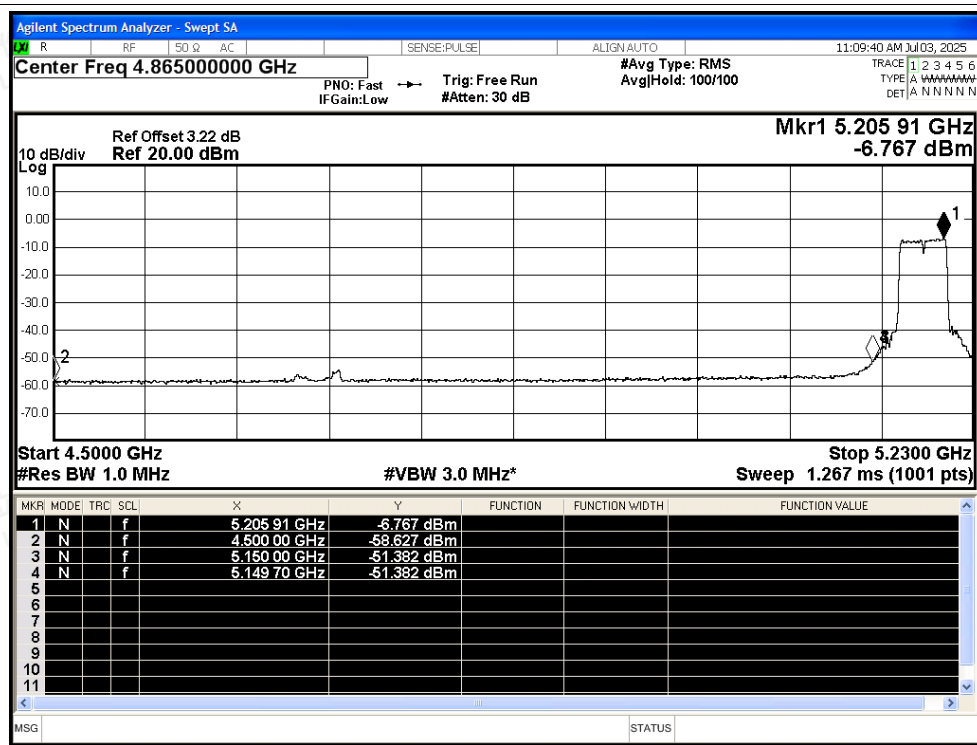

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant5 Peak

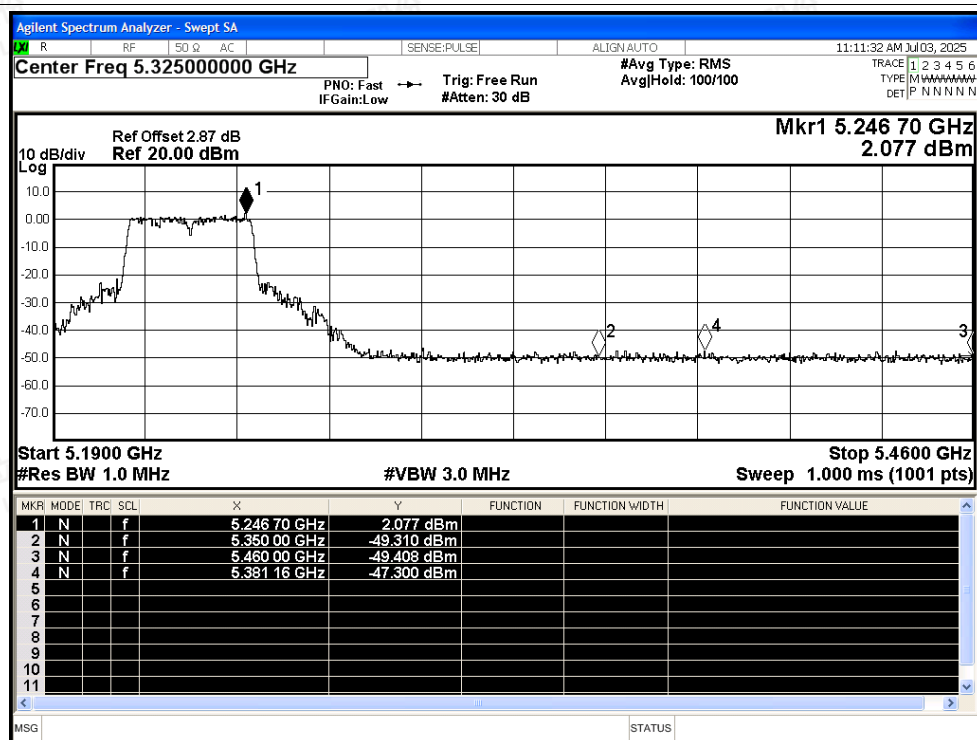

Restrict Band NVNT ac40 5230MHz Ant5 Average

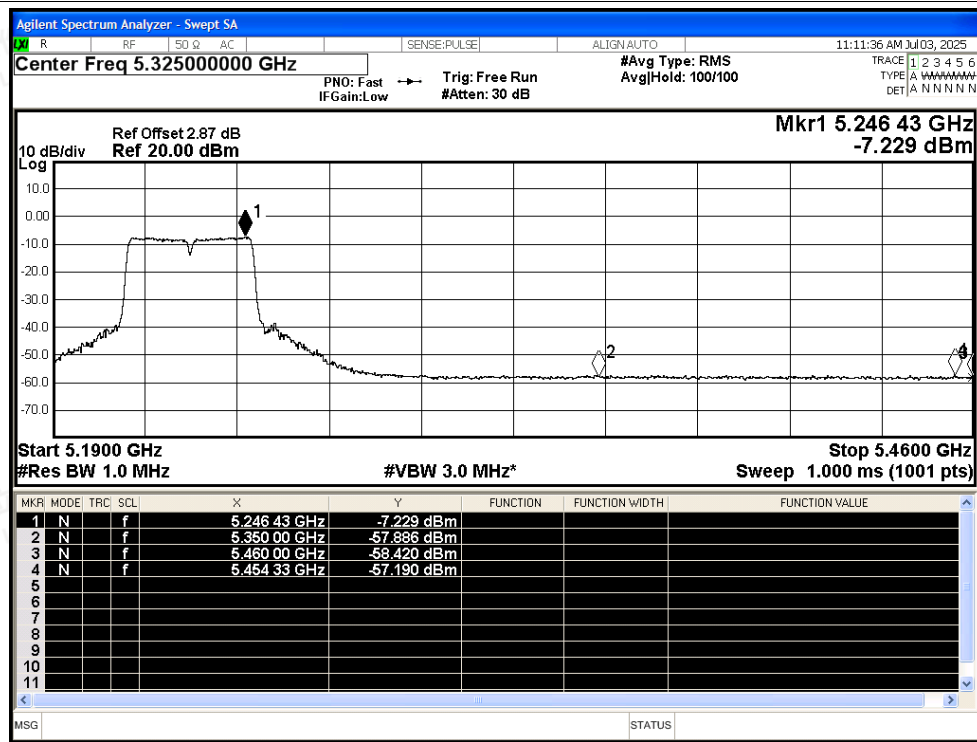

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant5 Peak

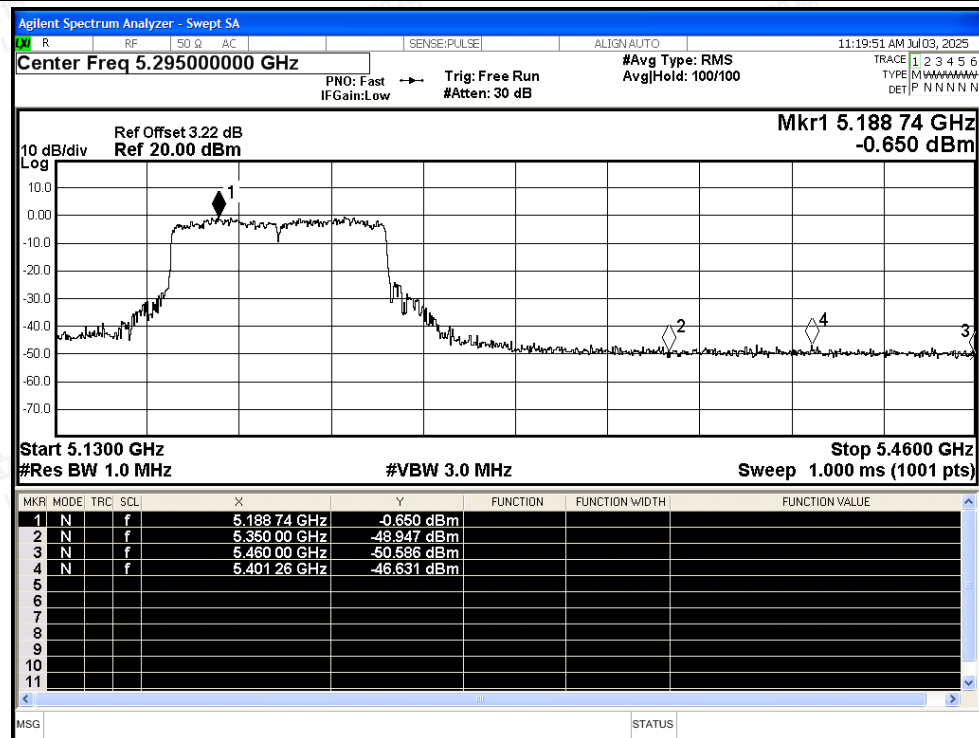

Restrict Band NVNT ac80 5210MHz Ant5 Average

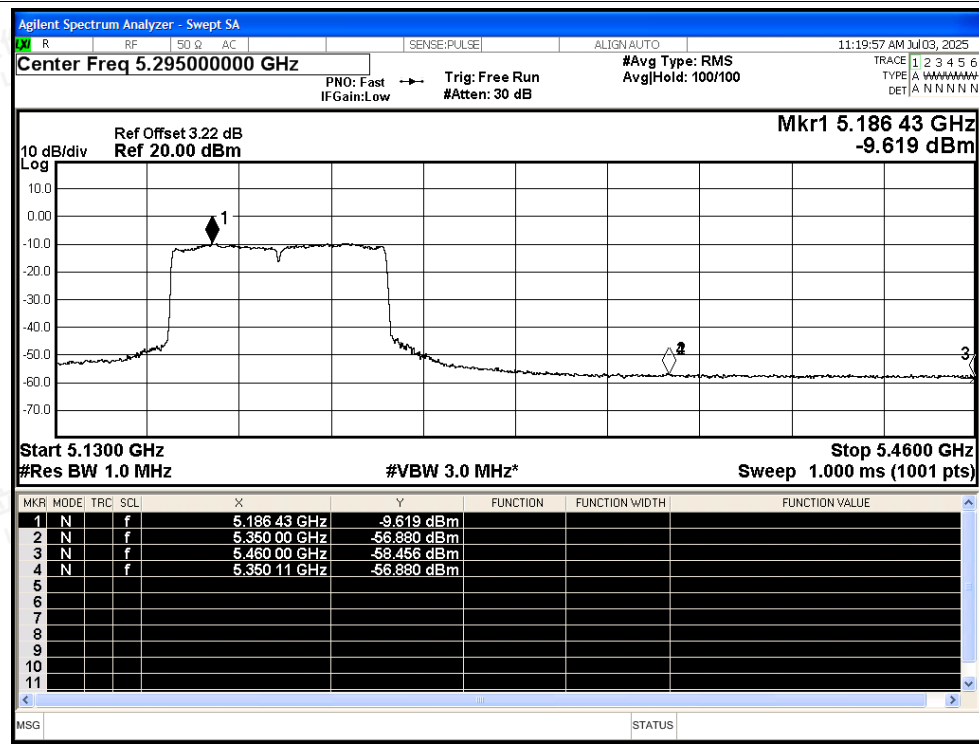

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant5 Peak

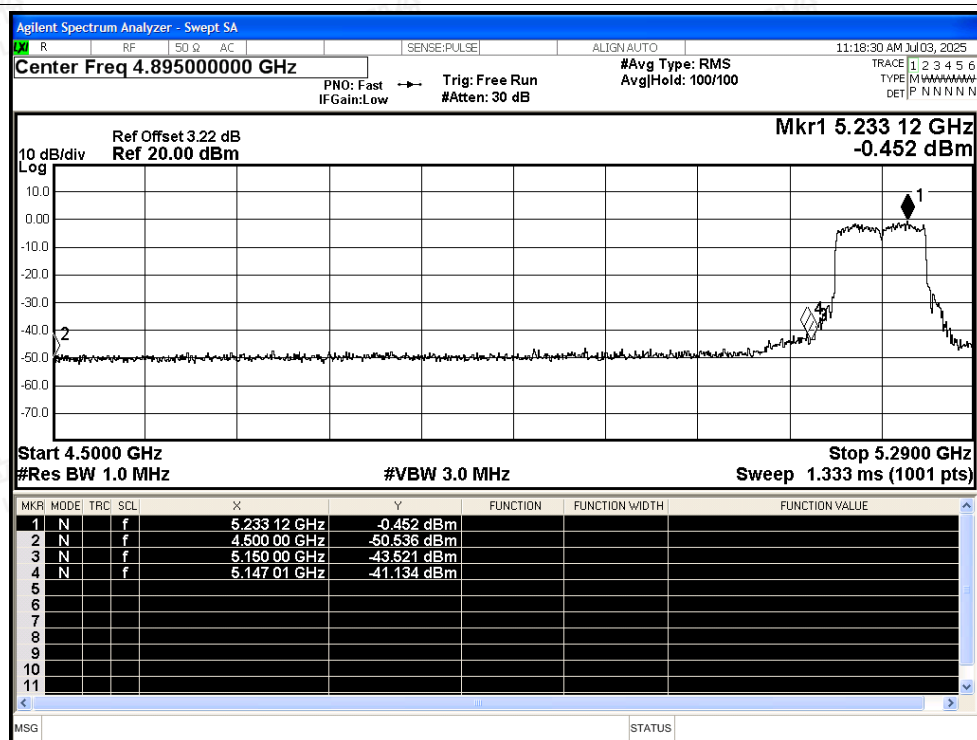

Restrict Band NVNT ac80 5210MHz Ant5 Average

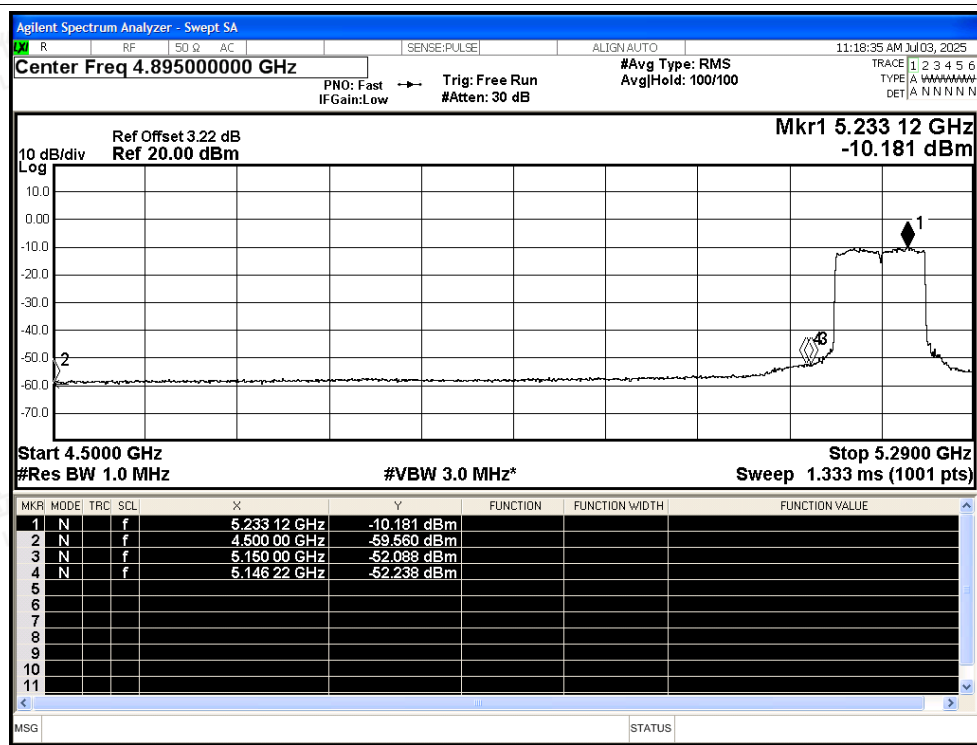

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant5 Peak

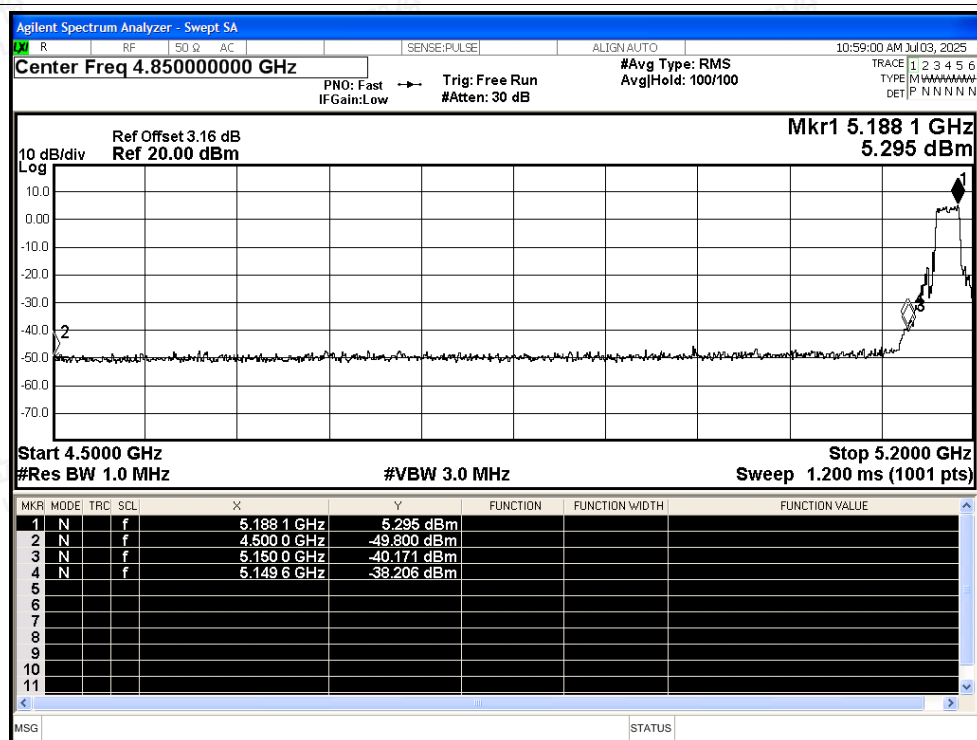

Restrict Band NVNT ax20 5180MHz Ant5 Average

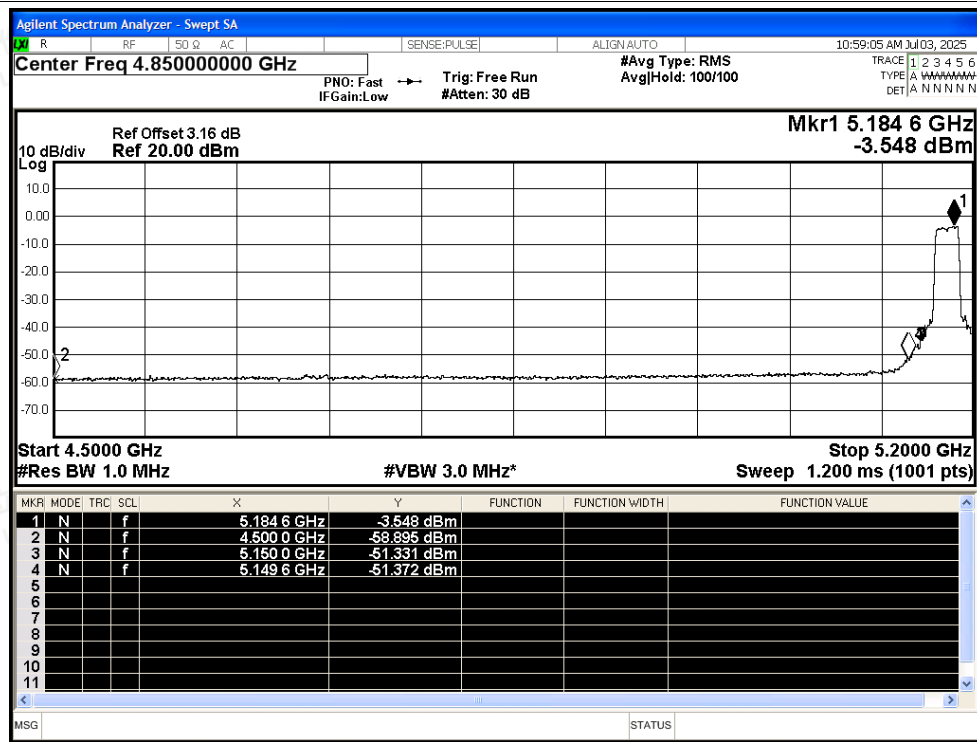

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant5 Peak

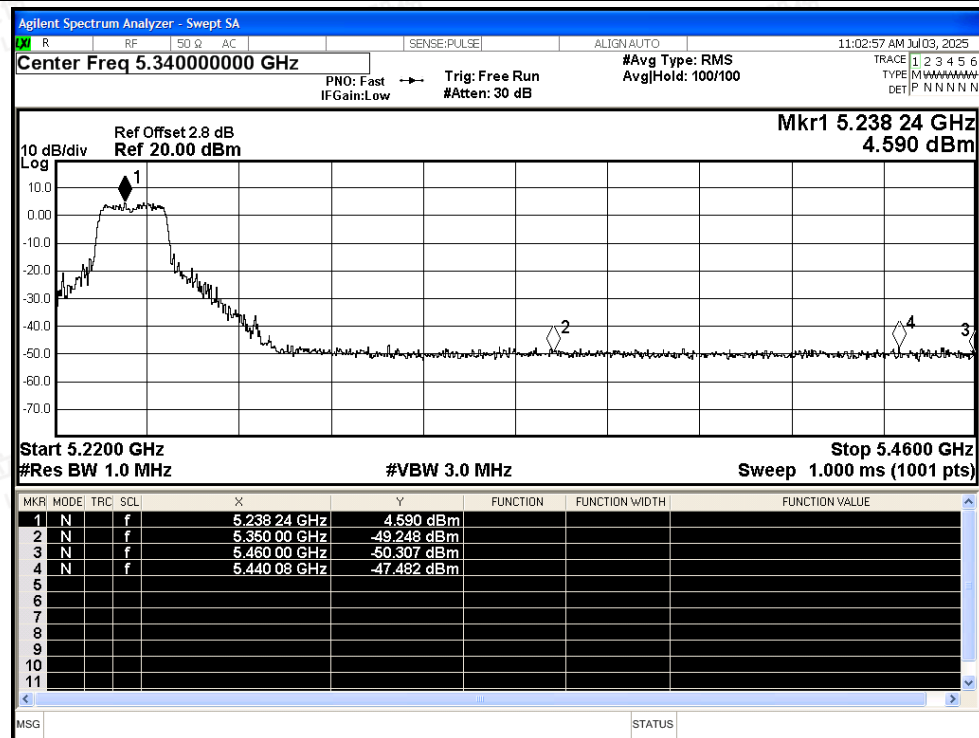

Restrict Band NVNT ax20 5240MHz Ant5 Average

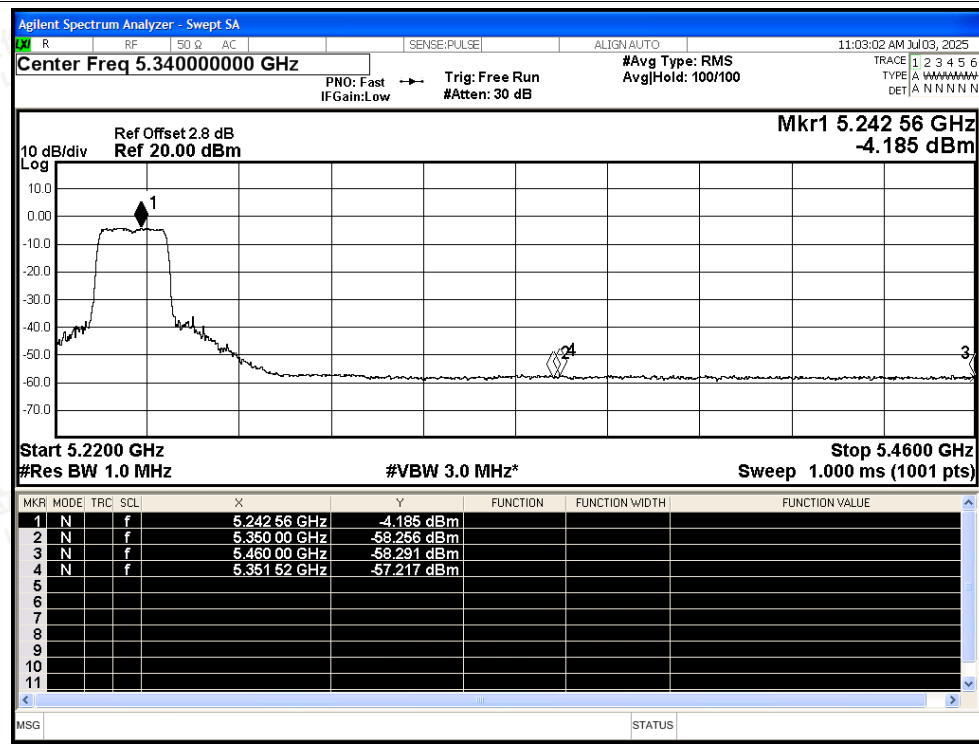

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant5 Peak

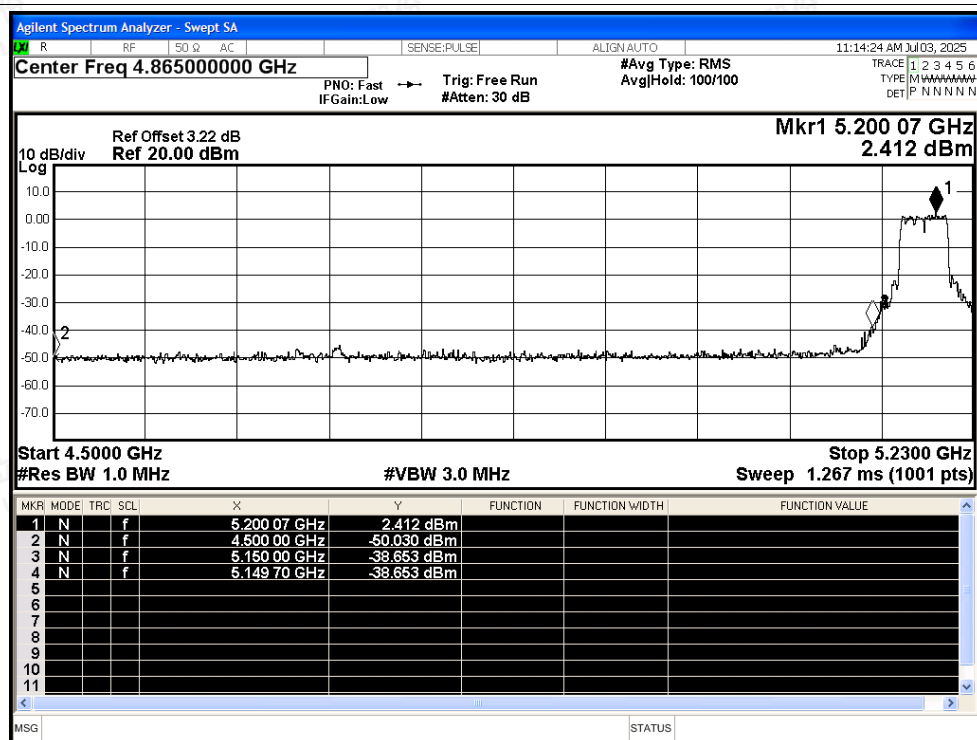

Restrict Band NVNT ax40 5190MHz Ant5 Average

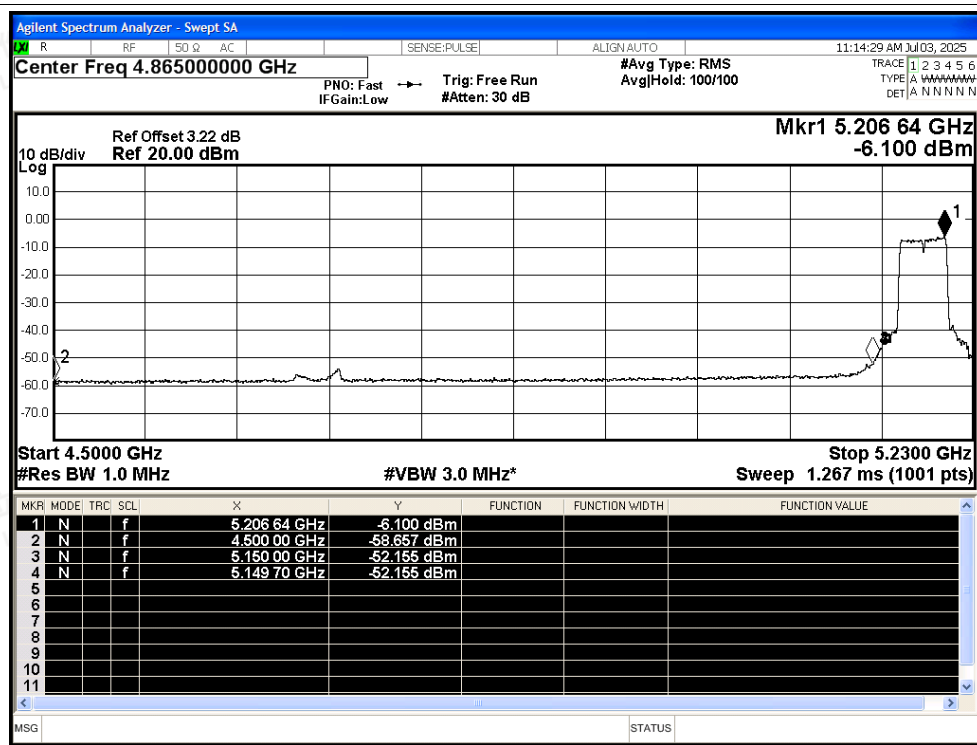

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant5 Peak

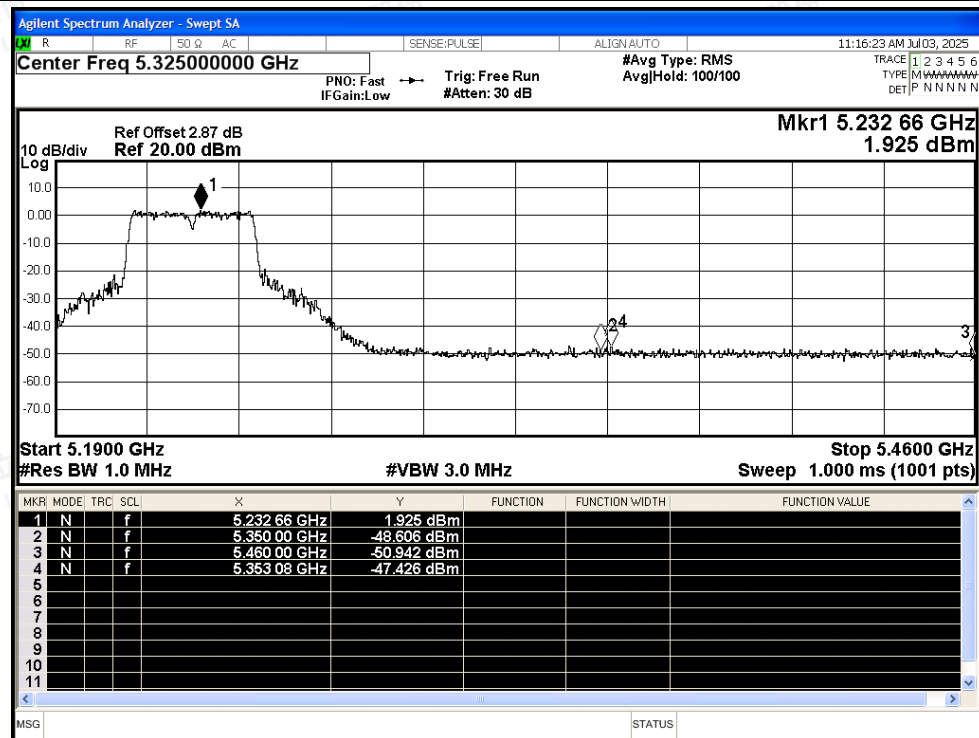

Restrict Band NVNT ax40 5230MHz Ant5 Average

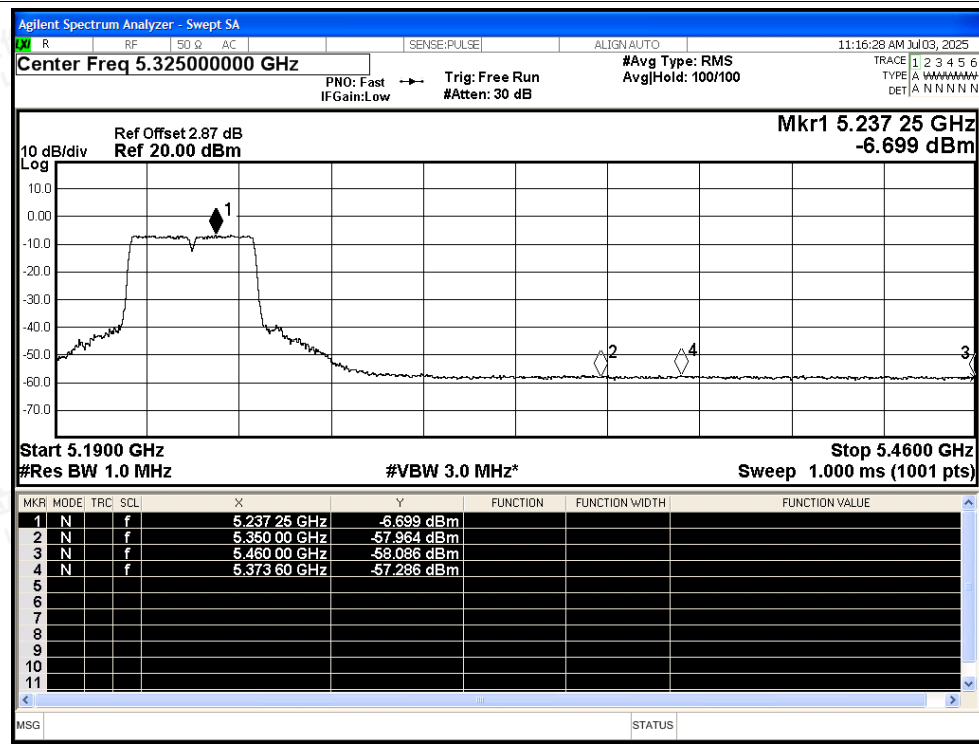

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant5 Peak

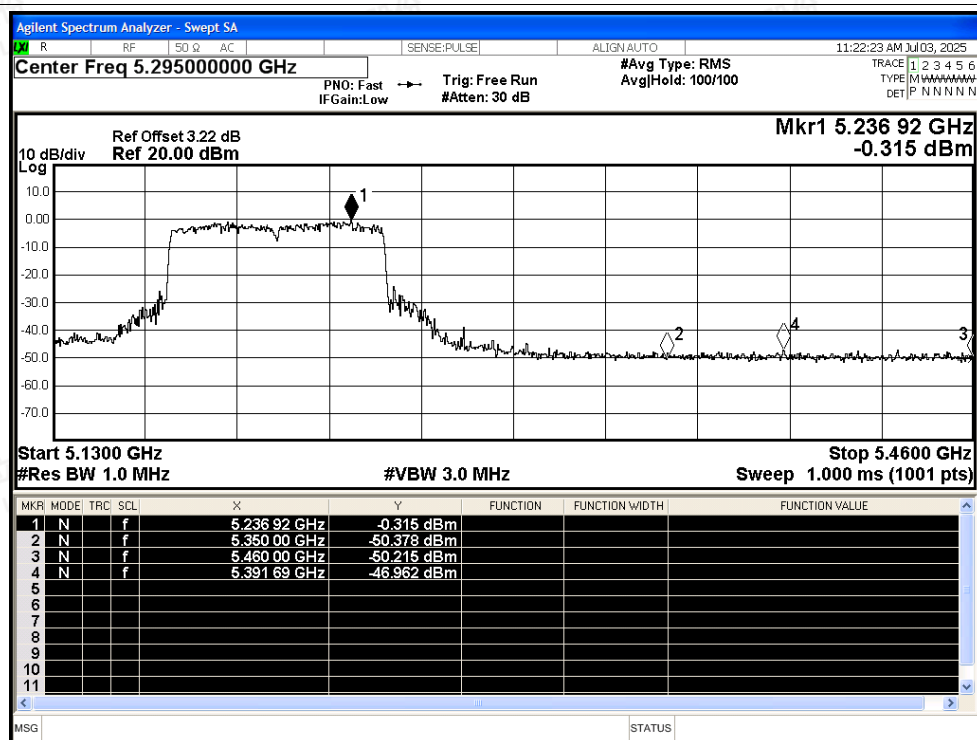

Restrict Band NVNT ax80 5210MHz Ant5 Average

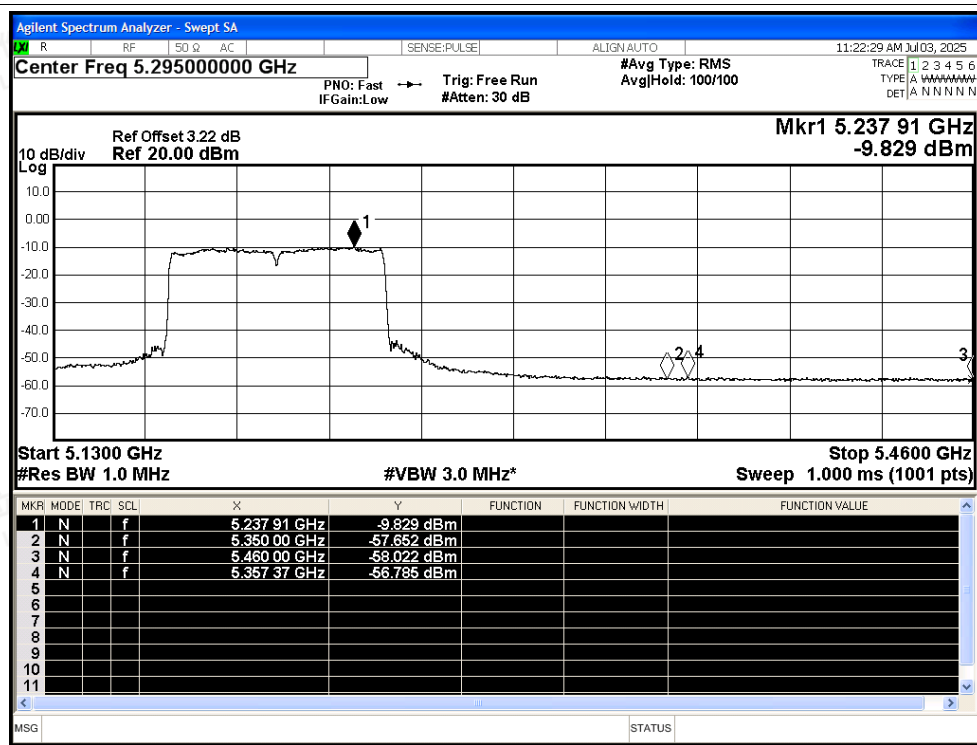

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant5 Peak

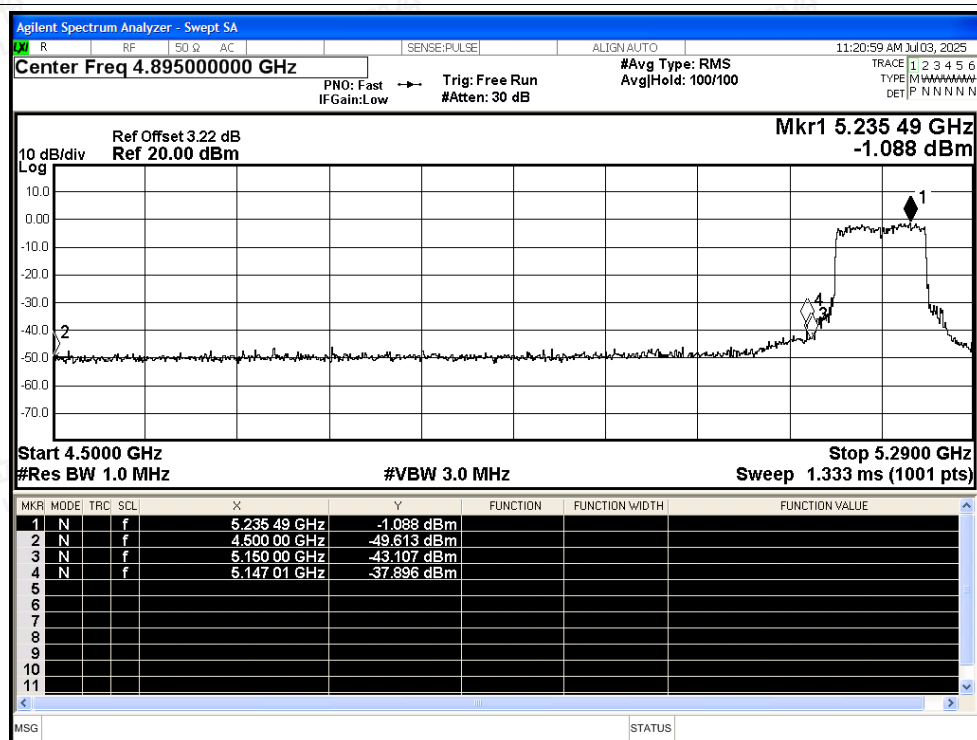

Restrict Band NVNT ax80 5210MHz Ant5 Average

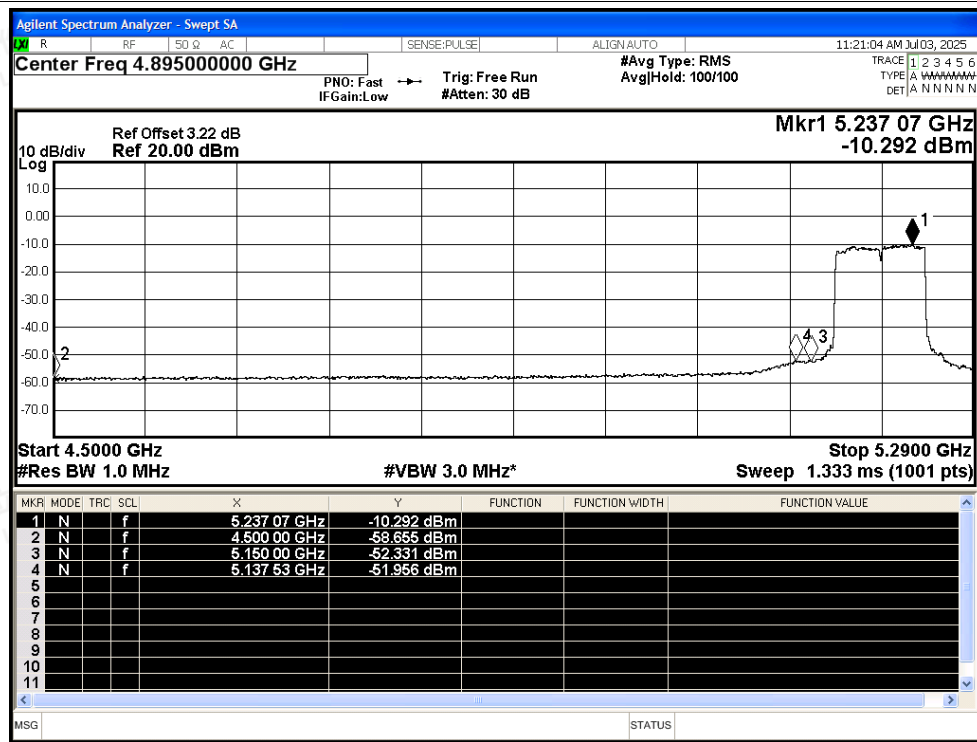

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant6	4500	-50.3	3.87	-	48.80	Peak	68.2	Pass
NVNT	a	5180	Ant6	4500	-58.77	3.87	0.19	40.52	Average	54	Pass
NVNT	a	5180	Ant6	5148.9	-39.85	3.87	-	59.25	Peak	68.2	Pass
NVNT	a	5180	Ant6	5148.9	-53.6	3.87	0.19	45.69	Average	54	Pass
NVNT	a	5180	Ant6	5150	-42.78	3.87	-	56.32	Peak	68.2	Pass
NVNT	a	5180	Ant6	5150	-53.13	3.87	0.19	46.16	Average	54	Pass
NVNT	a	5240	Ant6	5350	-50.59	3.87	-	48.51	Peak	68.2	Pass
NVNT	a	5240	Ant6	5350	-57.89	3.87	0.19	41.40	Average	54	Pass
NVNT	a	5240	Ant6	5398.56	-47.5	3.87	-	51.60	Peak	68.2	Pass
NVNT	a	5240	Ant6	5352	-57.47	3.87	0.19	41.82	Average	54	Pass
NVNT	a	5240	Ant6	5460	-50.04	3.87	-	49.06	Peak	68.2	Pass
NVNT	a	5240	Ant6	5460	-58.32	3.87	0.19	40.97	Average	54	Pass
NVNT	n20	5180	Ant6	4500	-50.41	3.87	-	48.69	Peak	68.2	Pass
NVNT	n20	5180	Ant6	4500	-58.05	3.87	0.23	41.28	Average	54	Pass
NVNT	n20	5180	Ant6	5148.9	-35.74	3.87	-	63.36	Peak	68.2	Pass
NVNT	n20	5180	Ant6	5149.6	-52.34	3.87	0.23	46.99	Average	54	Pass
NVNT	n20	5180	Ant6	5150	-39.65	3.87	-	59.45	Peak	68.2	Pass
NVNT	n20	5180	Ant6	5150	-52.89	3.87	0.23	46.44	Average	54	Pass
NVNT	n20	5240	Ant6	5350	-49.93	3.87	-	49.17	Peak	68.2	Pass
NVNT	n20	5240	Ant6	5350	-57.79	3.87	0.23	41.54	Average	54	Pass
NVNT	n20	5240	Ant6	5359.44	-47.35	3.87	-	51.75	Peak	68.2	Pass
NVNT	n20	5240	Ant6	5350.56	-57.3	3.87	0.23	42.03	Average	54	Pass
NVNT	n20	5240	Ant6	5460	-50.78	3.87	-	48.32	Peak	68.2	Pass
NVNT	n20	5240	Ant6	5460	-58.48	3.87	0.23	40.85	Average	54	Pass
NVNT	n40	5190	Ant6	4500	-50.85	3.87	-	48.25	Peak	68.2	Pass
NVNT	n40	5190	Ant6	4500	-59.06	3.87	0.44	40.48	Average	54	Pass
NVNT	n40	5190	Ant6	5149.7	-38.19	3.87	-	60.91	Peak	68.2	Pass
NVNT	n40	5190	Ant6	5149.7	-50.05	3.87	0.44	49.49	Average	54	Pass
NVNT	n40	5190	Ant6	5150	-38.19	3.87	-	60.91	Peak	68.2	Pass
NVNT	n40	5190	Ant6	5150	-50.05	3.87	0.44	49.49	Average	54	Pass
NVNT	n40	5230	Ant6	5350	-49.61	3.87	-	49.49	Peak	68.2	Pass
NVNT	n40	5230	Ant6	5350	-58.13	3.87	0.43	41.40	Average	54	Pass
NVNT	n40	5230	Ant6	5370.63	-46.86	3.87	-	52.24	Peak	68.2	Pass
NVNT	n40	5230	Ant6	5455.14	-57.4	3.87	0.43	42.13	Average	54	Pass
NVNT	n40	5230	Ant6	5460	-50.92	3.87	-	48.18	Peak	68.2	Pass
NVNT	n40	5230	Ant6	5460	-58.14	3.87	0.43	41.39	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant6	4500	-49.85	3.87	-	49.25	Peak	68.2	Pass
NVNT	ac20	5180	Ant6	4500	-58.66	3.87	0.22	40.66	Average	54	Pass
NVNT	ac20	5180	Ant6	5148.9	-37.35	3.87	-	61.75	Peak	68.2	Pass
NVNT	ac20	5180	Ant6	5148.9	-52.92	3.87	0.22	46.40	Average	54	Pass
NVNT	ac20	5180	Ant6	5150	-36.47	3.87	-	62.63	Peak	68.2	Pass
NVNT	ac20	5180	Ant6	5150	-51.72	3.87	0.22	47.60	Average	54	Pass
NVNT	ac20	5240	Ant6	5350	-49.5	3.87	-	49.60	Peak	68.2	Pass
NVNT	ac20	5240	Ant6	5350	-58.16	3.87	0.22	41.16	Average	54	Pass
NVNT	ac20	5240	Ant6	5369.52	-46.94	3.87	-	52.16	Peak	68.2	Pass
NVNT	ac20	5240	Ant6	5367.36	-57.28	3.87	0.22	42.04	Average	54	Pass
NVNT	ac20	5240	Ant6	5460	-50.07	3.87	-	49.03	Peak	68.2	Pass
NVNT	ac20	5240	Ant6	5460	-58.52	3.87	0.22	40.80	Average	54	Pass
NVNT	ac40	5190	Ant6	4500	-51.09	3.87	-	48.01	Peak	68.2	Pass
NVNT	ac40	5190	Ant6	4500	-59.09	3.87	0.44	40.45	Average	54	Pass
NVNT	ac40	5190	Ant6	5149.7	-35.04	3.87	-	64.06	Peak	68.2	Pass
NVNT	ac40	5190	Ant6	5149.7	-49.9	3.87	0.44	49.64	Average	54	Pass
NVNT	ac40	5190	Ant6	5150	-35.04	3.87	-	64.06	Peak	68.2	Pass
NVNT	ac40	5190	Ant6	5150	-49.9	3.87	0.44	49.64	Average	54	Pass
NVNT	ac40	5230	Ant6	5350	-49.7	3.87	-	49.40	Peak	68.2	Pass
NVNT	ac40	5230	Ant6	5350	-58.12	3.87	0.43	41.41	Average	54	Pass
NVNT	ac40	5230	Ant6	5455.68	-46.9	3.87	-	52.20	Peak	68.2	Pass
NVNT	ac40	5230	Ant6	5354.7	-57.32	3.87	0.43	42.21	Average	54	Pass
NVNT	ac40	5230	Ant6	5460	-51.44	3.87	-	47.66	Peak	68.2	Pass
NVNT	ac40	5230	Ant6	5460	-58.84	3.87	0.43	40.69	Average	54	Pass
NVNT	ac80	5210	Ant6	5350	-49.9	3.87	-	49.20	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	5350	-57.59	3.87	0.83	42.34	Average	54	Pass
NVNT	ac80	5210	Ant6	5351.1	-46.97	3.87	-	52.13	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	5352.75	-56.55	3.87	0.83	43.38	Average	54	Pass
NVNT	ac80	5210	Ant6	5460	-50.33	3.87	-	48.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	5460	-58.44	3.87	0.83	41.49	Average	54	Pass
NVNT	ac80	5210	Ant6	4500	-51.13	3.87	-	47.97	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	4500	-58.89	3.87	0.83	41.04	Average	54	Pass
NVNT	ac80	5210	Ant6	5147.8	-37.2	3.87	-	61.90	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	5145.43	-50.01	3.87	0.83	49.92	Average	54	Pass
NVNT	ac80	5210	Ant6	5150	-41.87	3.87	-	57.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant6	5150	-50.09	3.87	0.83	49.84	Average	54	Pass
NVNT	ax20	5180	Ant6	4500	-50.97	3.87	-	48.13	Peak	68.2	Pass
NVNT	ax20	5180	Ant6	4500	-59.15	3.87	0.22	40.17	Average	54	Pass
NVNT	ax20	5180	Ant6	5149.6	-35.11	3.87	-	63.99	Peak	68.2	Pass
NVNT	ax20	5180	Ant6	5149.6	-49.93	3.87	0.22	49.39	Average	54	Pass
NVNT	ax20	5180	Ant6	5150	-39.93	3.87	-	59.17	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5180	Ant6	5150	-50.53	3.87	0.22	48.79	Average	54	Pass
NVNT	ax20	5240	Ant6	5350	-48.94	3.87	-	50.16	Peak	68.2	Pass
NVNT	ax20	5240	Ant6	5350	-57.56	3.87	0.22	41.76	Average	54	Pass
NVNT	ax20	5240	Ant6	5431.2	-47.07	3.87	-	52.03	Peak	68.2	Pass
NVNT	ax20	5240	Ant6	5363.04	-57.21	3.87	0.22	42.11	Average	54	Pass
NVNT	ax20	5240	Ant6	5460	-49.9	3.87	-	49.20	Peak	68.2	Pass
NVNT	ax20	5240	Ant6	5460	-58.25	3.87	0.22	41.07	Average	54	Pass
NVNT	ax40	5190	Ant6	4500	-52.25	3.87	-	46.85	Peak	68.2	Pass
NVNT	ax40	5190	Ant6	4500	-58.65	3.87	0.43	40.88	Average	54	Pass
NVNT	ax40	5190	Ant6	5148.97	-36.18	3.87	-	62.92	Peak	68.2	Pass
NVNT	ax40	5190	Ant6	5149.7	-51.67	3.87	0.43	47.86	Average	54	Pass
NVNT	ax40	5190	Ant6	5150	-43.05	3.87	-	56.05	Peak	68.2	Pass
NVNT	ax40	5190	Ant6	5150	-51.67	3.87	0.43	47.86	Average	54	Pass
NVNT	ax40	5230	Ant6	5350	-49.8	3.87	-	49.30	Peak	68.2	Pass
NVNT	ax40	5230	Ant6	5350	-57.43	3.87	0.44	42.11	Average	54	Pass
NVNT	ax40	5230	Ant6	5380.89	-47.69	3.87	-	51.41	Peak	68.2	Pass
NVNT	ax40	5230	Ant6	5374.41	-57.23	3.87	0.44	42.31	Average	54	Pass
NVNT	ax40	5230	Ant6	5460	-51.11	3.87	-	47.99	Peak	68.2	Pass
NVNT	ax40	5230	Ant6	5460	-58.29	3.87	0.44	41.25	Average	54	Pass
NVNT	ax80	5210	Ant6	5350	-49.68	3.87	-	49.42	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	5350	-57.05	3.87	0.83	42.88	Average	54	Pass
NVNT	ax80	5210	Ant6	5356.38	-46.61	3.87	-	52.49	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	5361.66	-56.14	3.87	0.83	43.79	Average	54	Pass
NVNT	ax80	5210	Ant6	5460	-50.71	3.87	-	48.39	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	5460	-57.76	3.87	0.83	42.17	Average	54	Pass
NVNT	ax80	5210	Ant6	4500	-50.04	3.87	-	49.06	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	4500	-58.88	3.87	0.83	41.05	Average	54	Pass
NVNT	ax80	5210	Ant6	5142.27	-39.88	3.87	-	59.22	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	5145.43	-49.88	3.87	0.83	50.05	Average	54	Pass
NVNT	ax80	5210	Ant6	5150	-35.68	3.87	-	63.42	Peak	68.2	Pass
NVNT	ax80	5210	Ant6	5150	-51.15	3.87	0.83	48.78	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant6 Peak

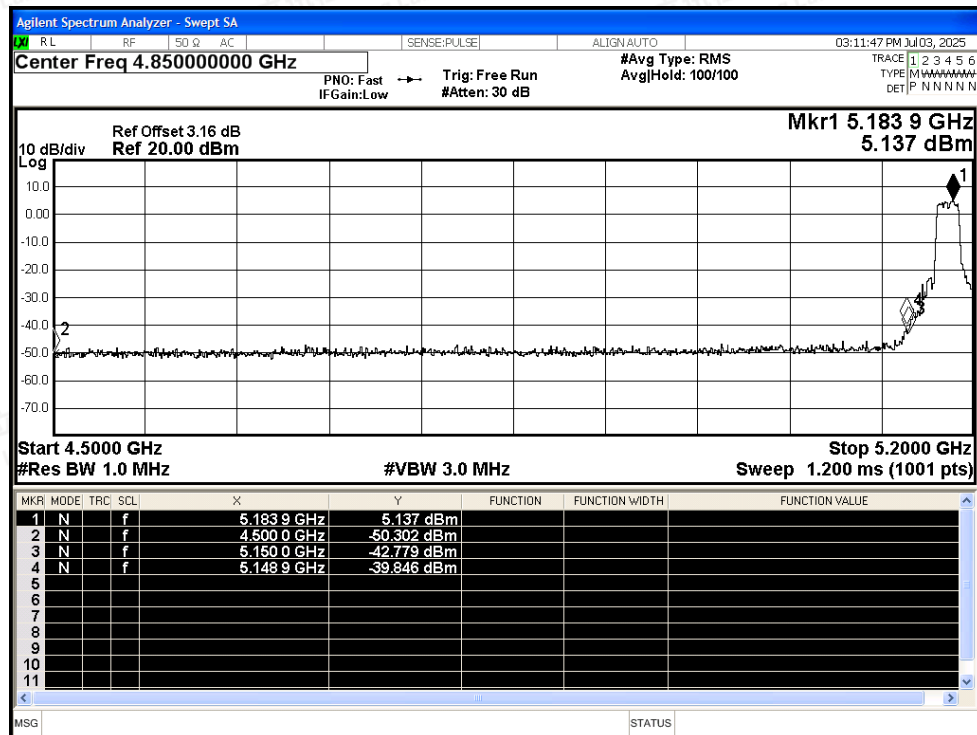

Restrict Band NVNT a 5180MHz Ant6 Average

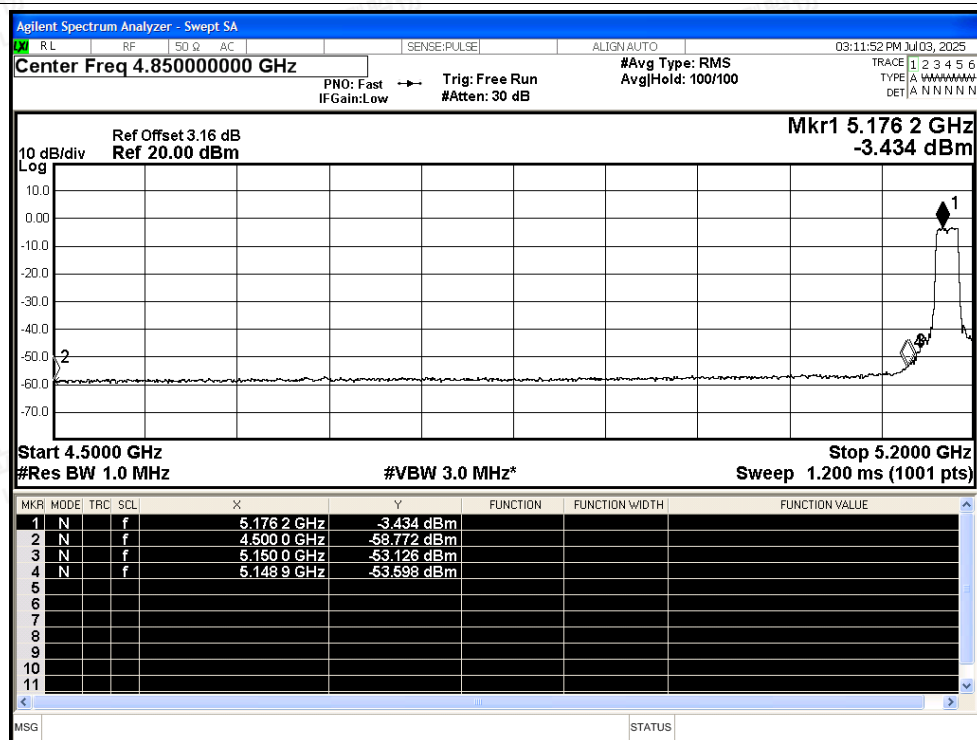

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant6 Peak

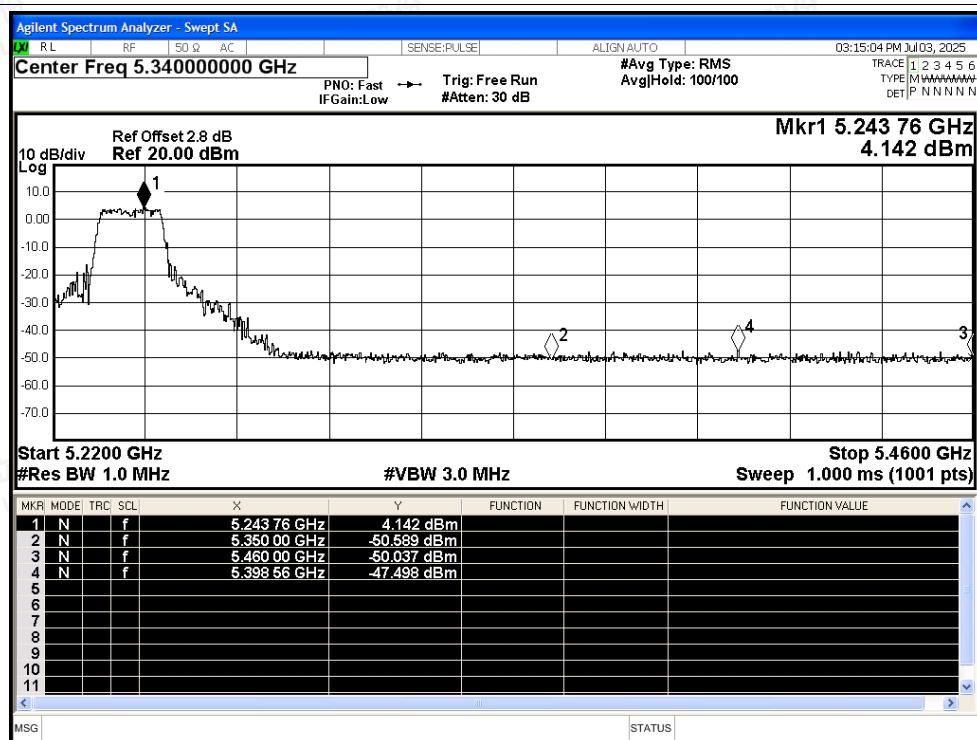

Restrict Band NVNT a 5240MHz Ant6 Average

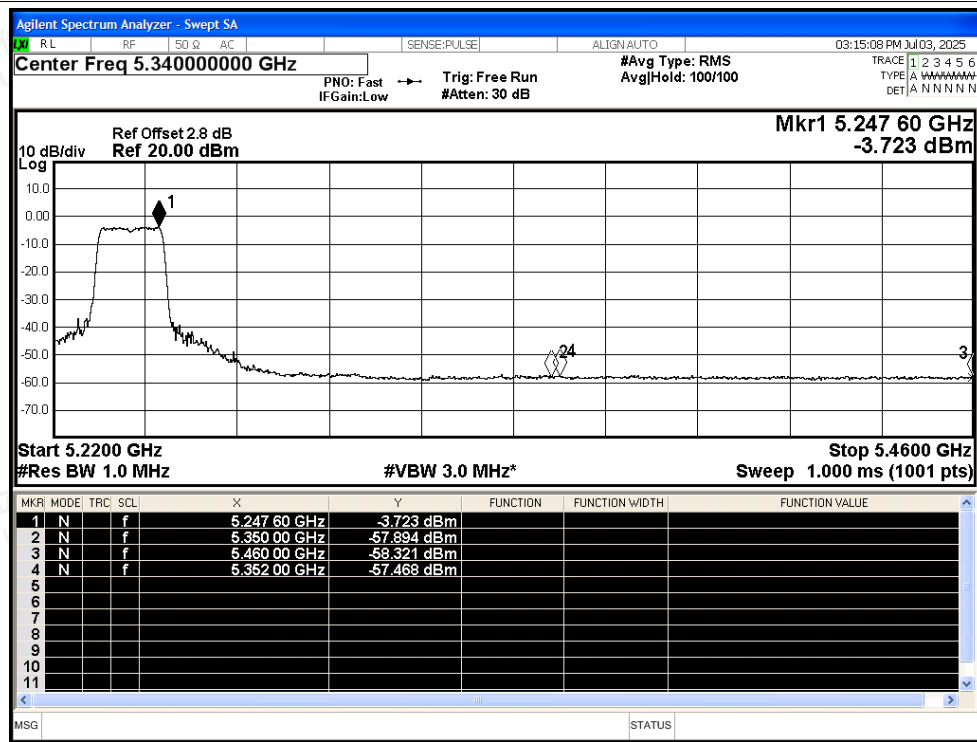

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant6 Peak

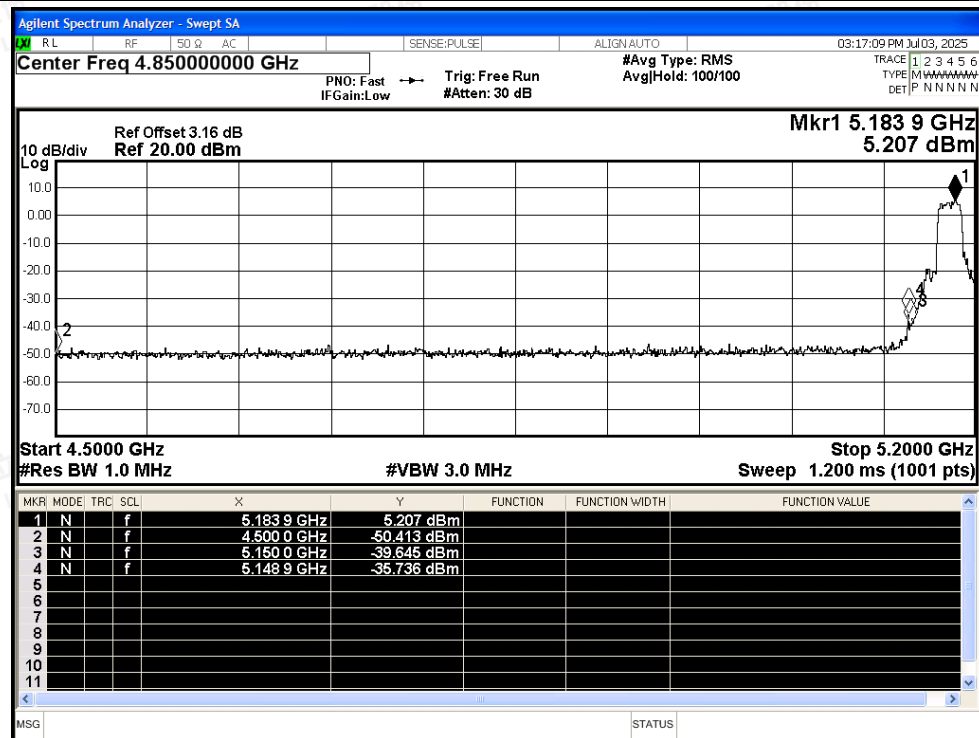

Restrict Band NVNT n20 5180MHz Ant6 Average

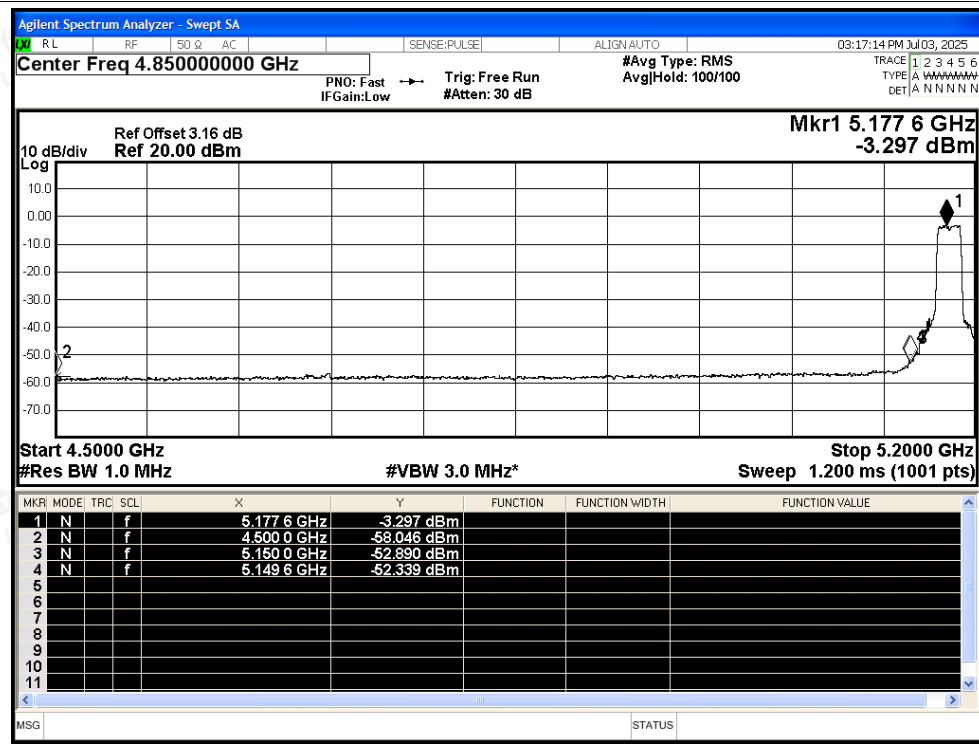

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant6 Peak

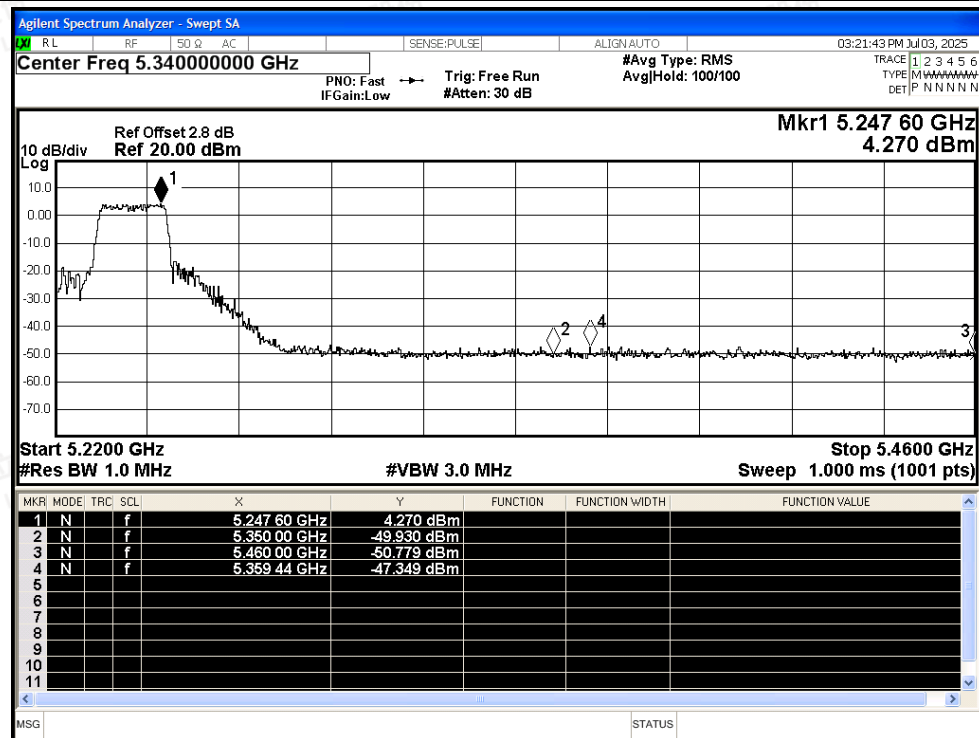

Restrict Band NVNT n20 5240MHz Ant6 Average

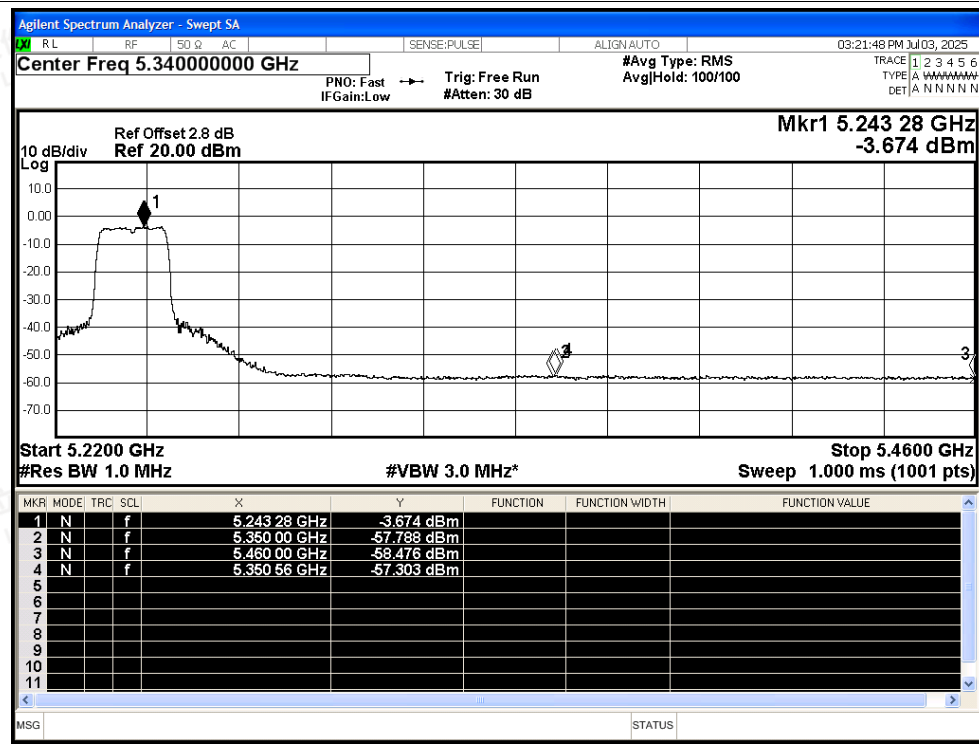

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant6 Peak

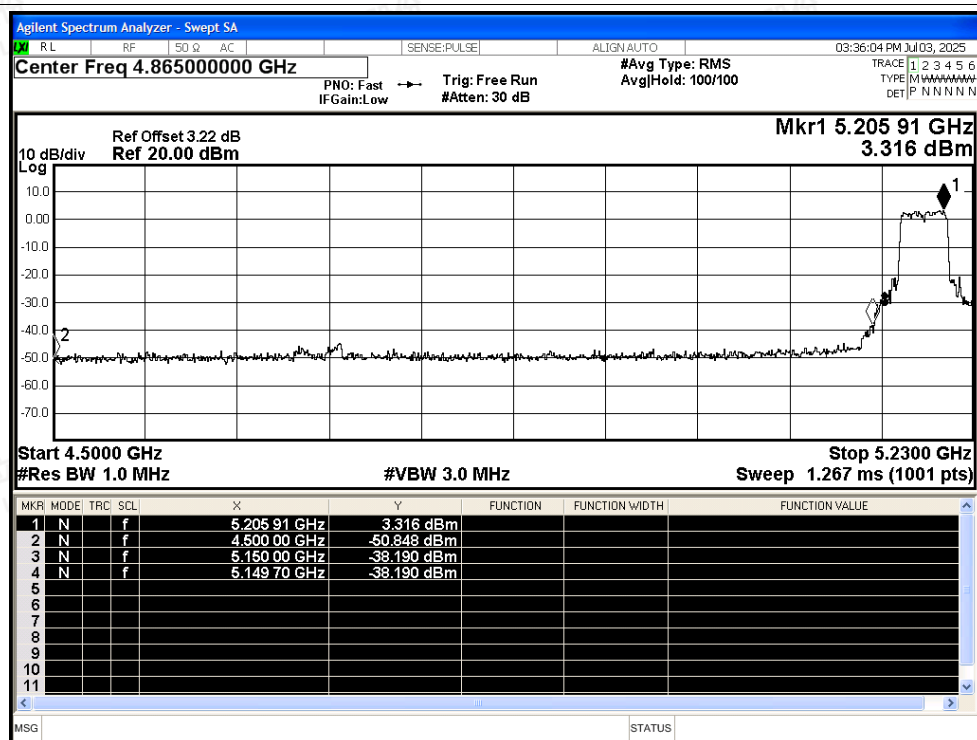

Restrict Band NVNT n40 5190MHz Ant6 Average

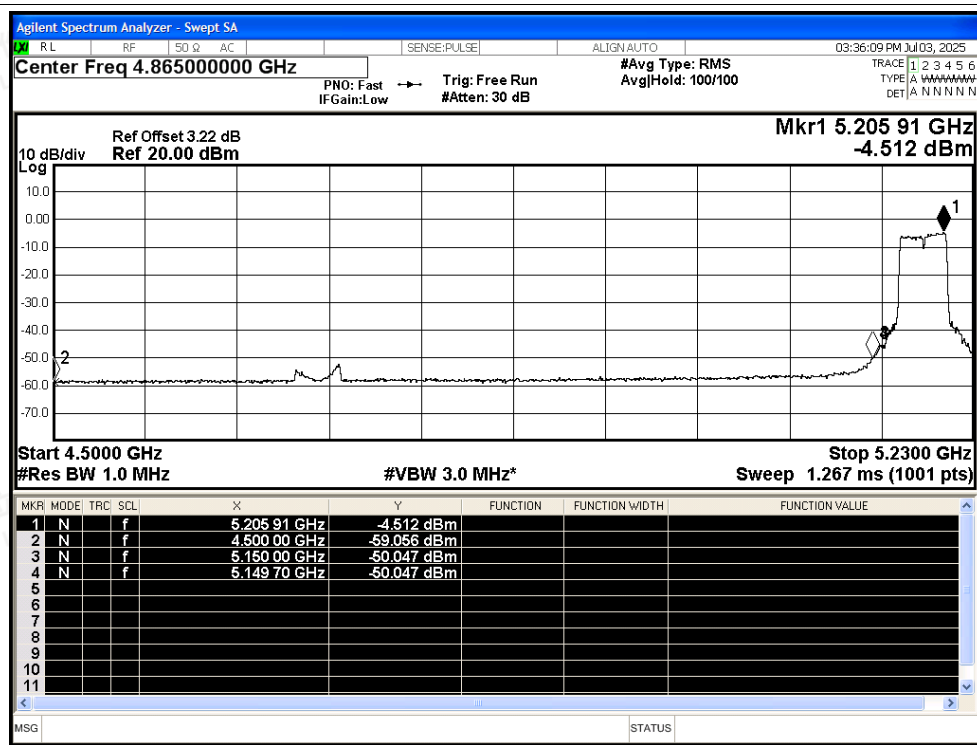

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant6 Peak

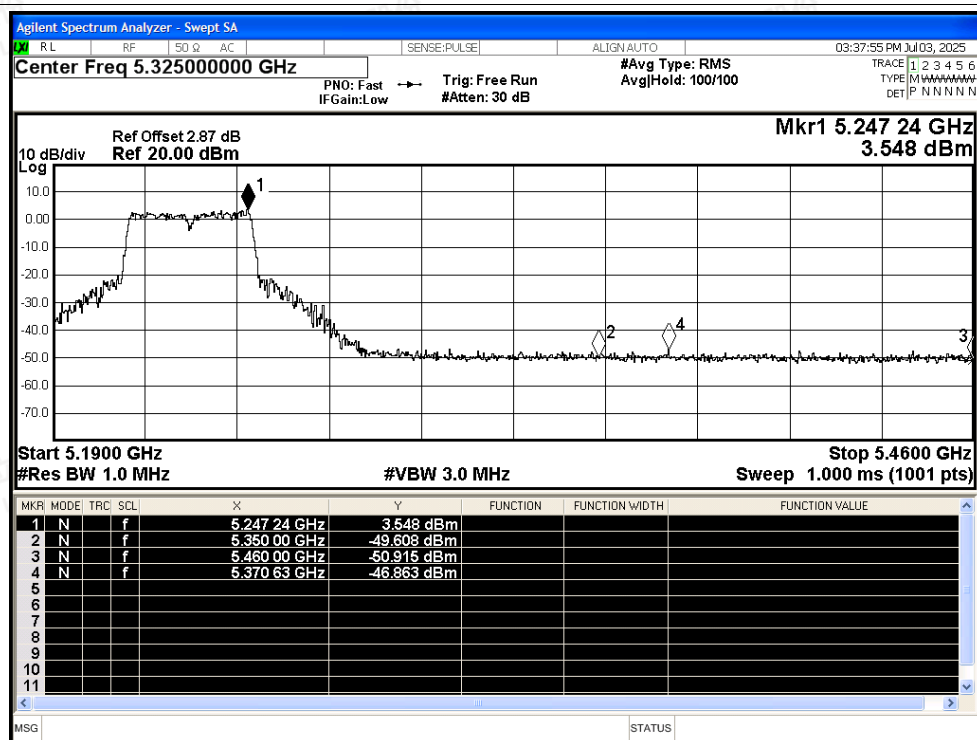

Restrict Band NVNT n40 5230MHz Ant6 Average

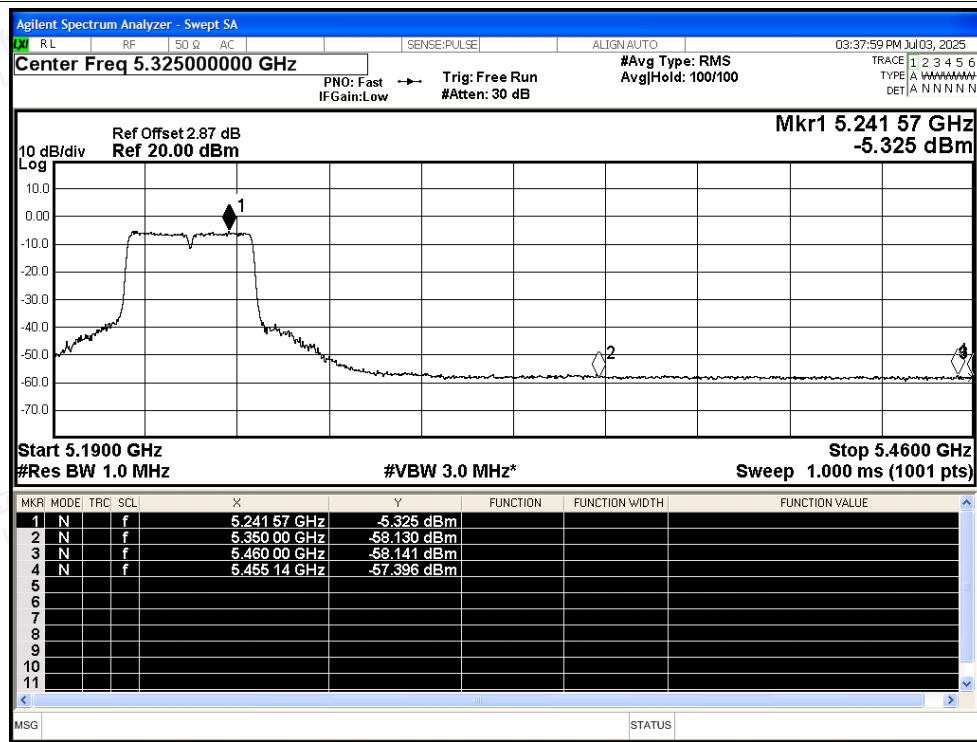

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant6 Peak

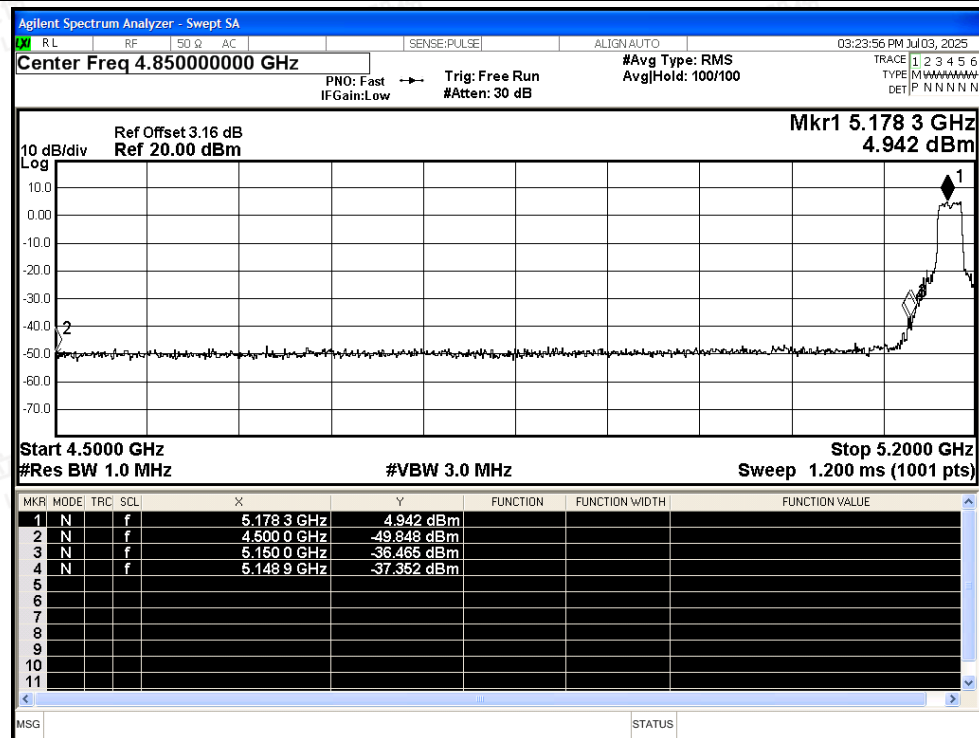

Restrict Band NVNT ac20 5180MHz Ant6 Average

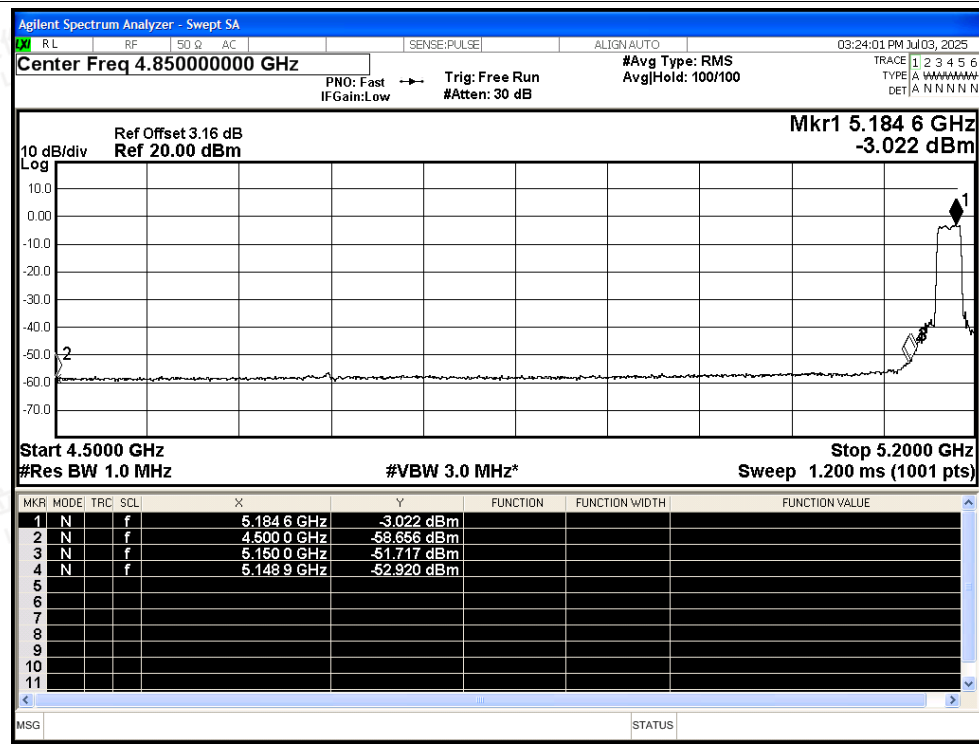

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant6 Peak

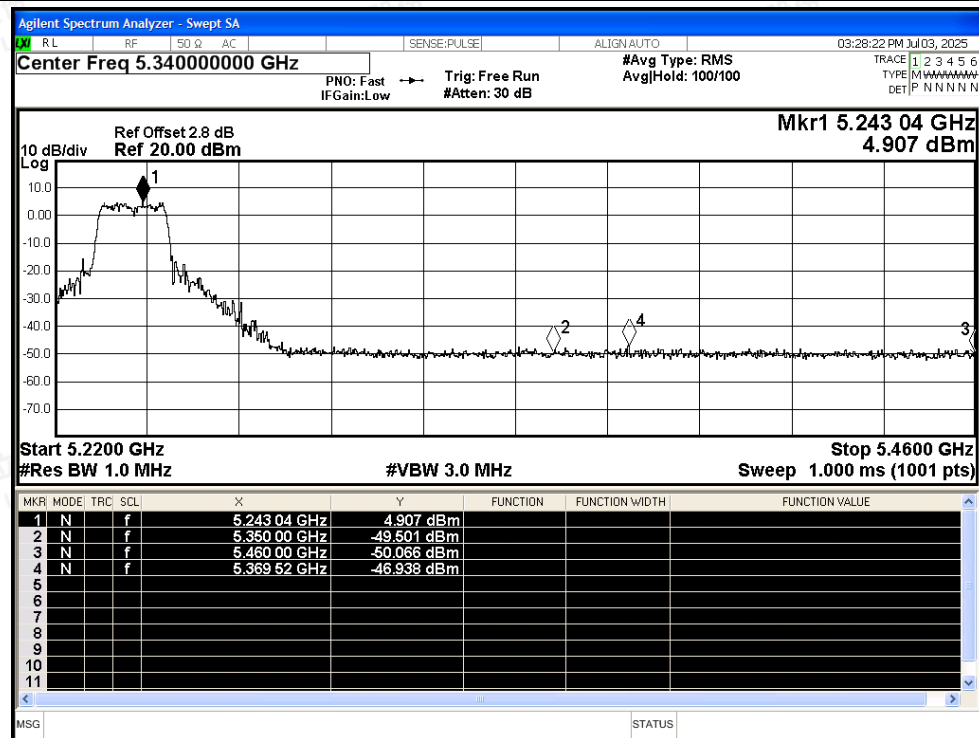

Restrict Band NVNT ac20 5240MHz Ant6 Average

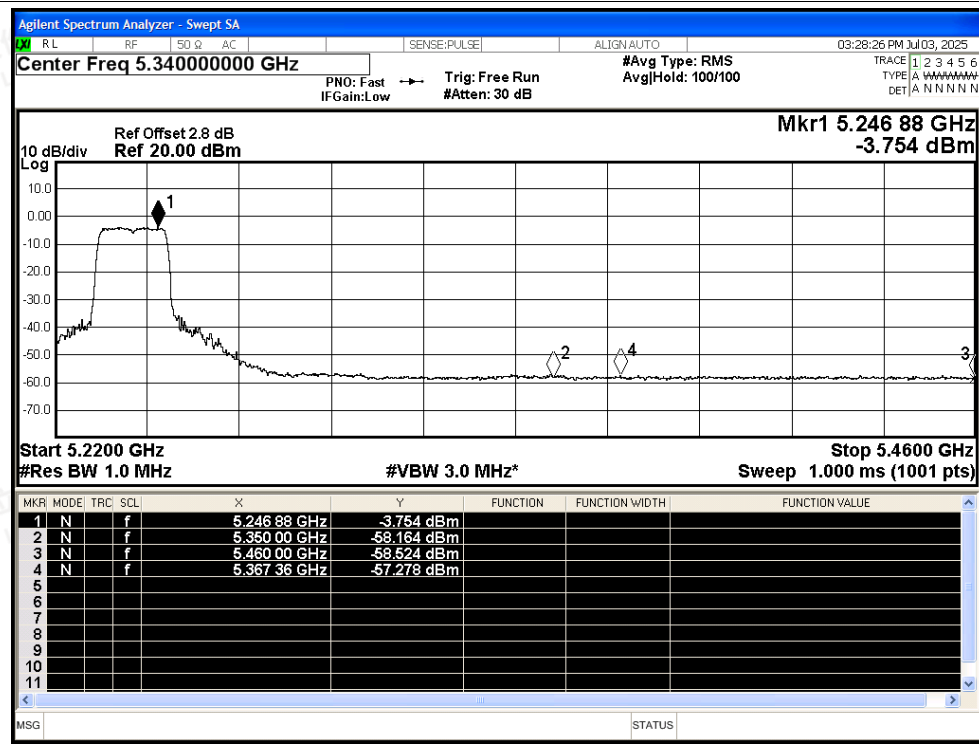

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity