





Restrict Band NVNT ac40 5190MHz Ant6 Peak

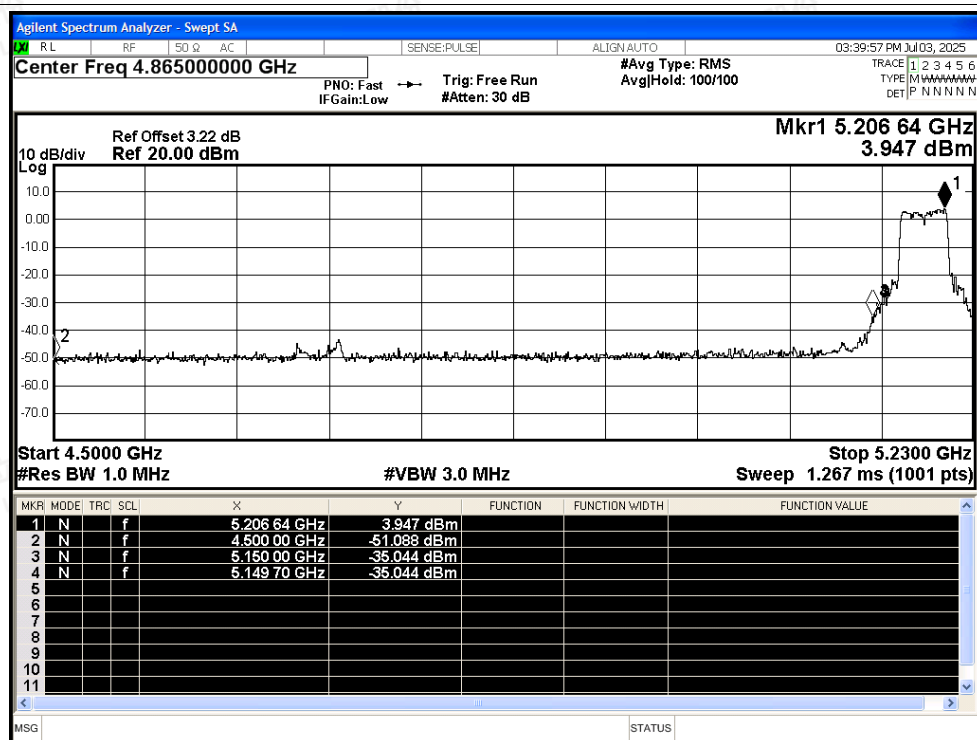

Restrict Band NVNT ac40 5190MHz Ant6 Average

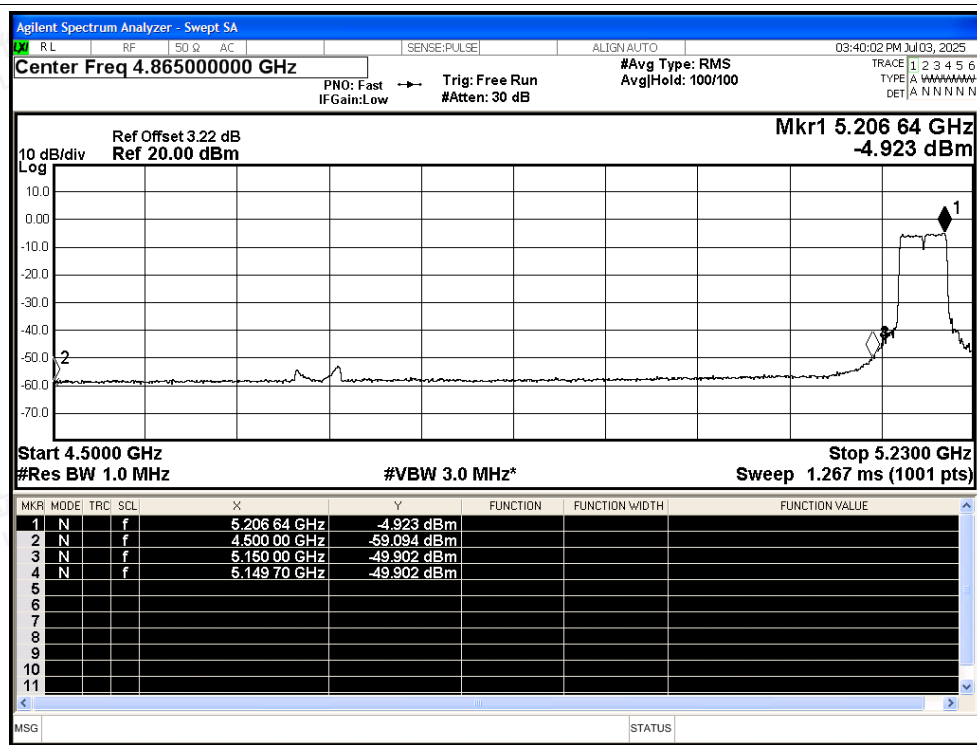

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant6 Peak

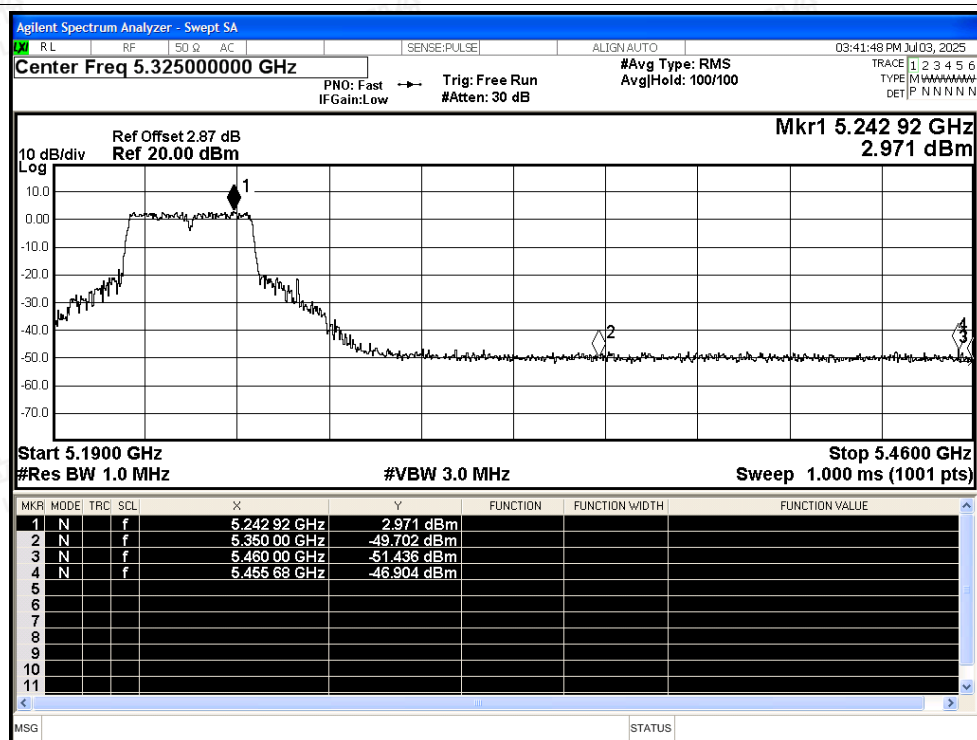

Restrict Band NVNT ac40 5230MHz Ant6 Average

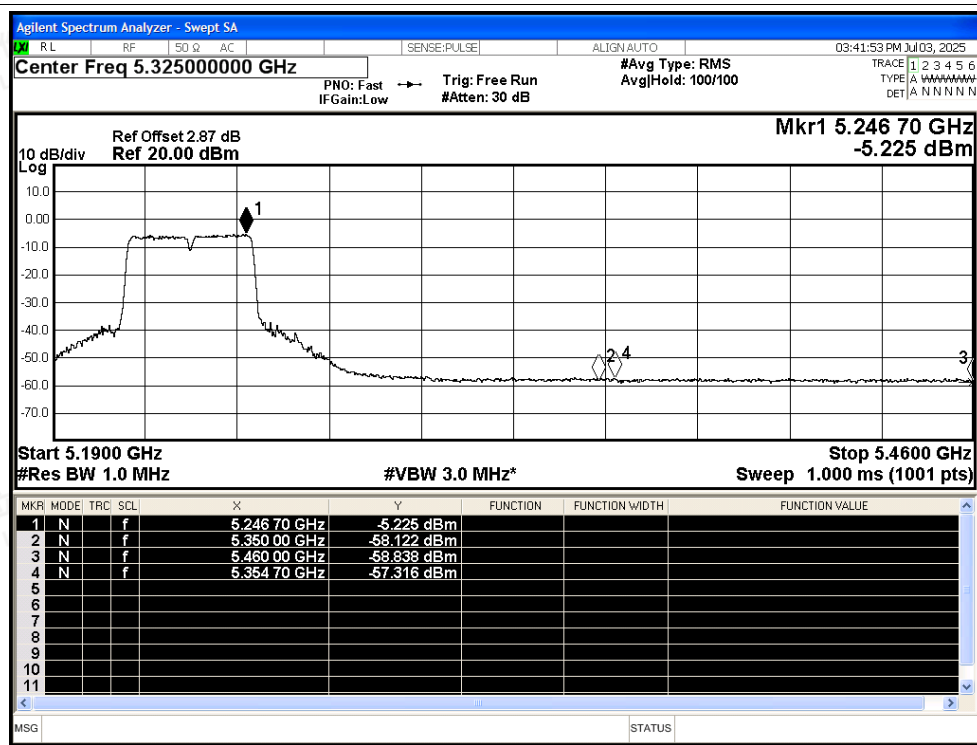

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant6 Peak

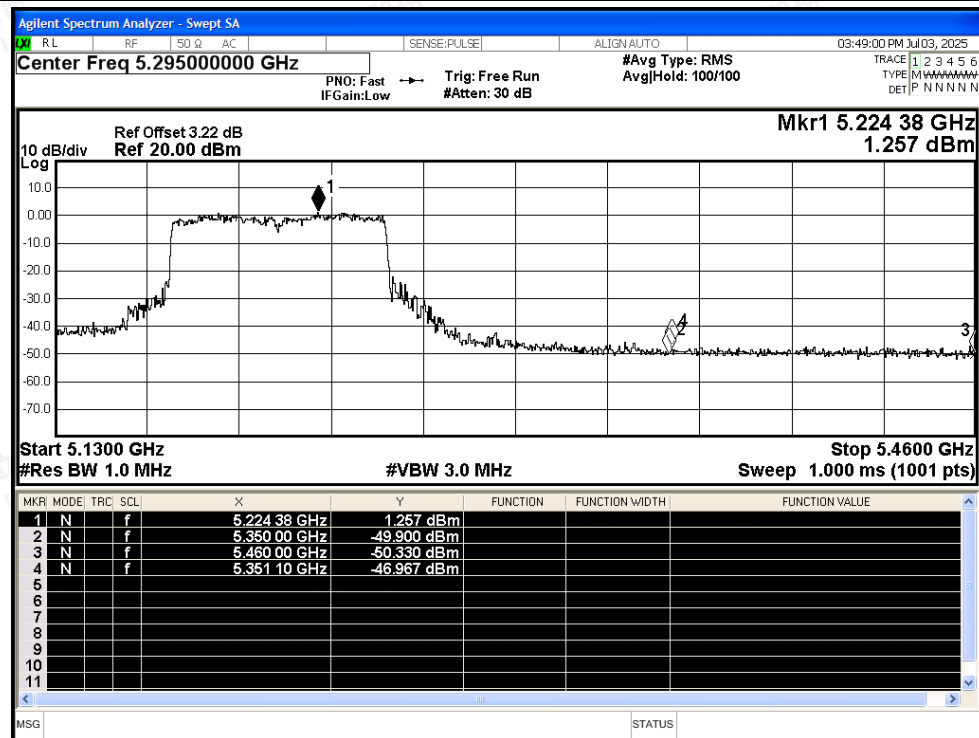

Restrict Band NVNT ac80 5210MHz Ant6 Average

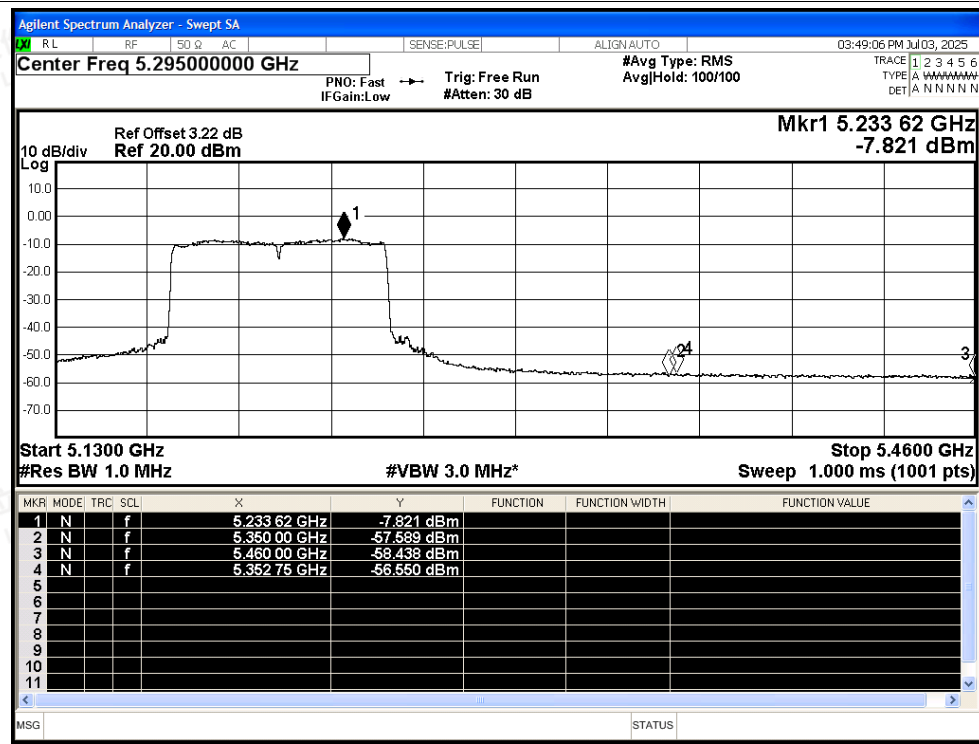

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant6 Peak

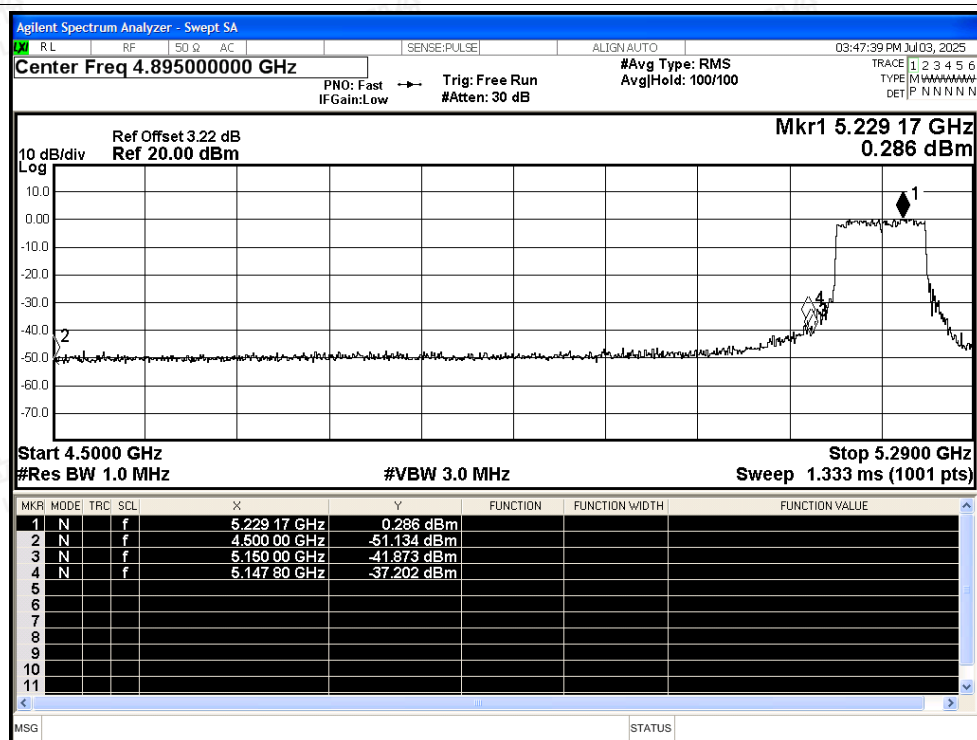

Restrict Band NVNT ac80 5210MHz Ant6 Average

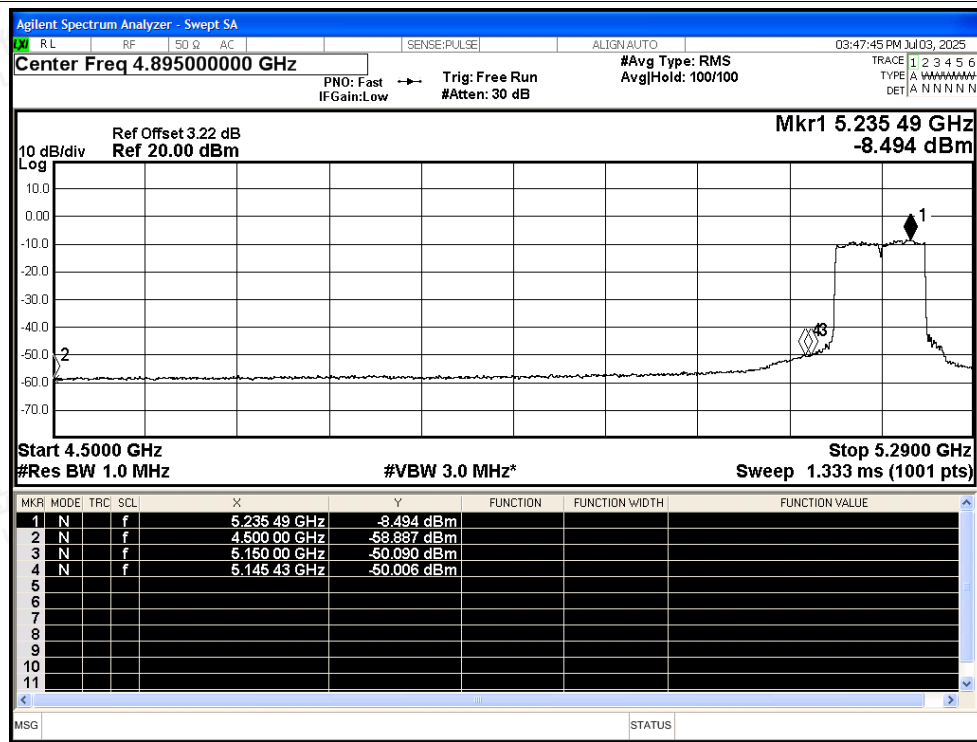

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant6 Peak

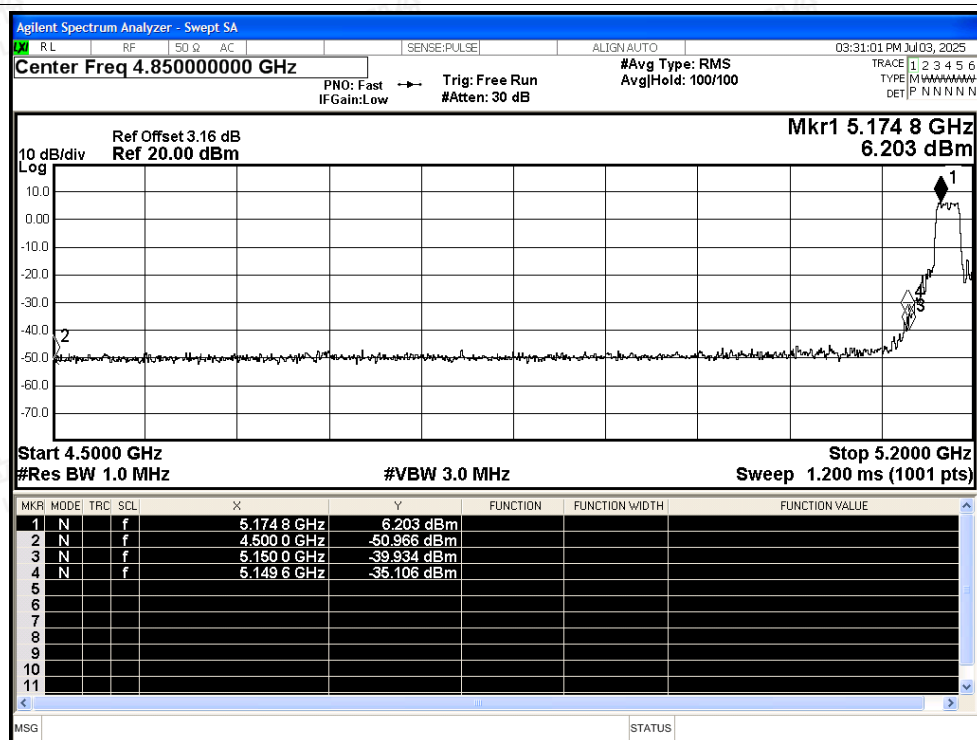

Restrict Band NVNT ax20 5180MHz Ant6 Average

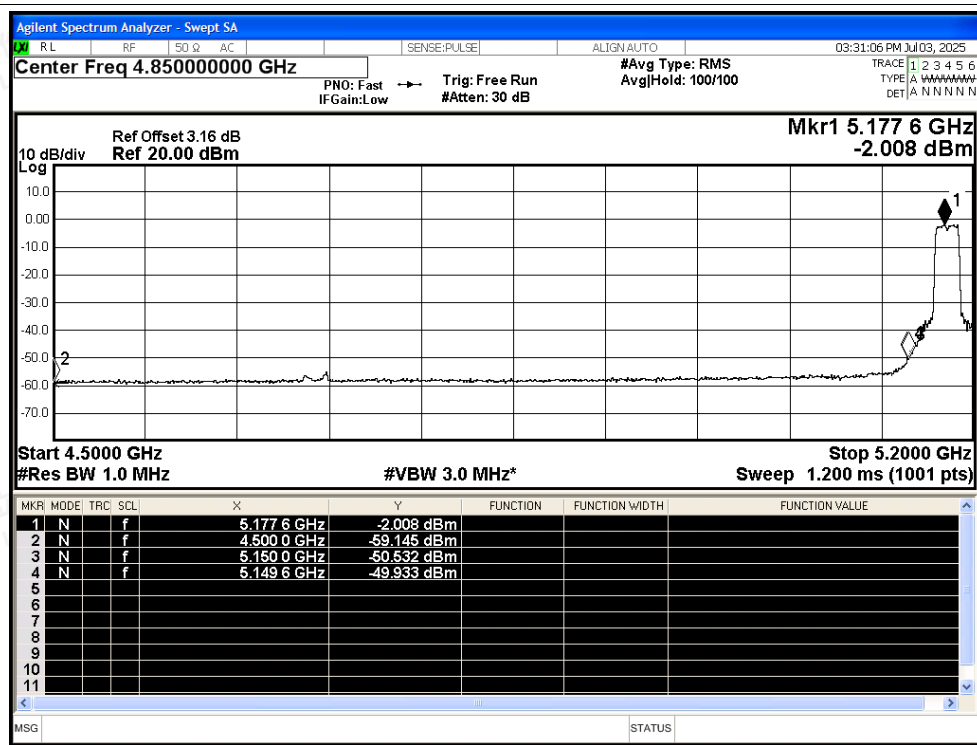

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant6 Peak

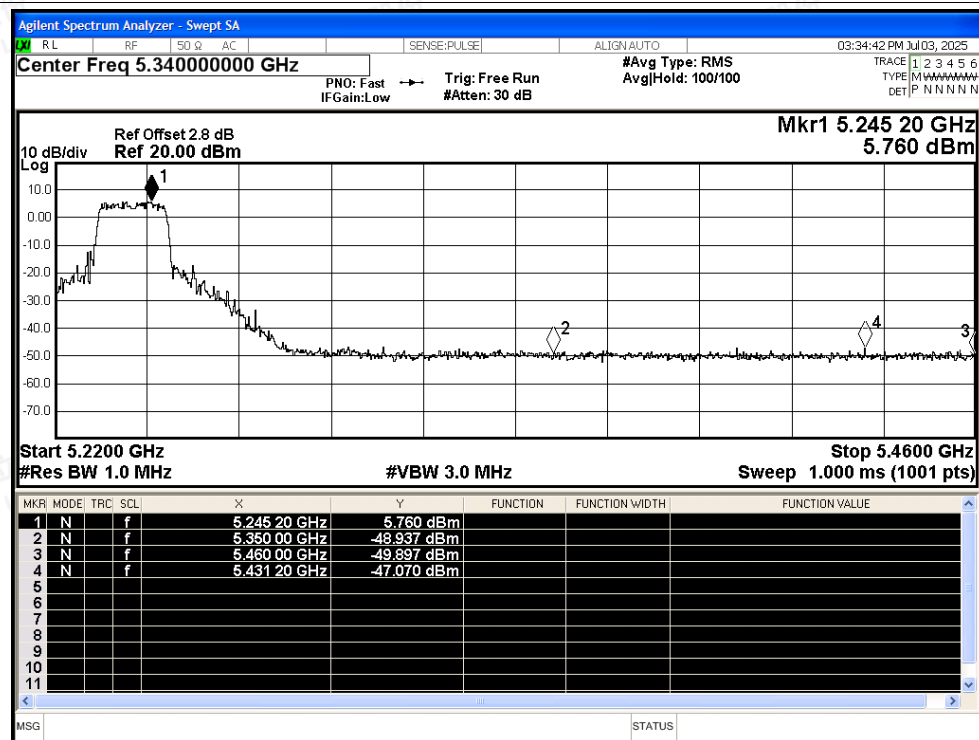


Restrict Band NVNT ax20 5240MHz Ant6 Average

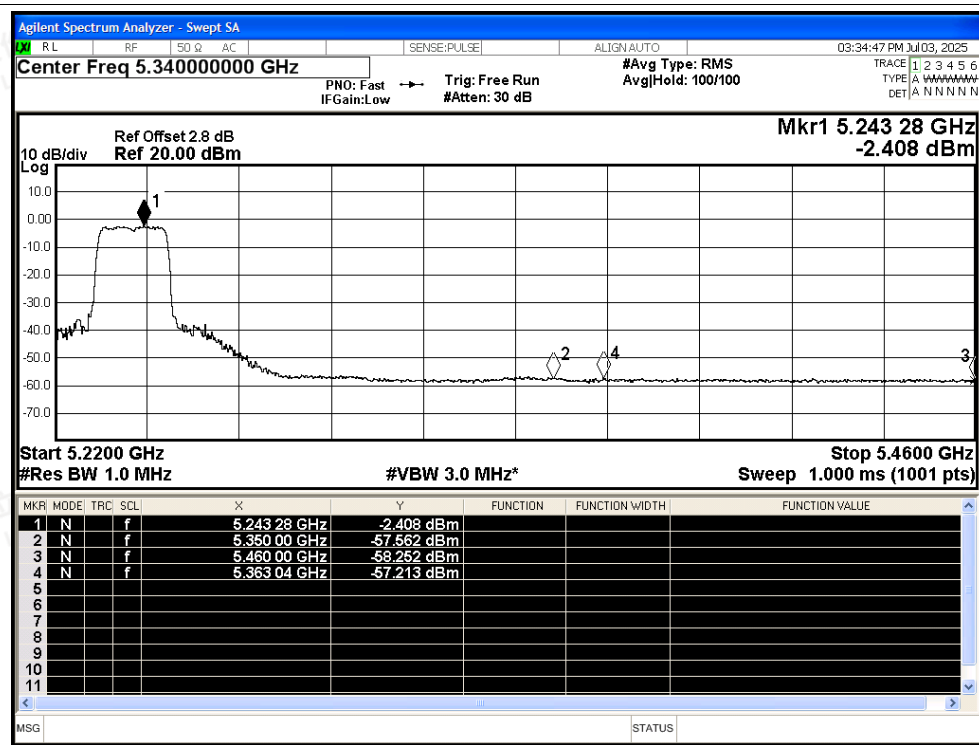




Restrict Band NVNT ax40 5190MHz Ant6 Peak

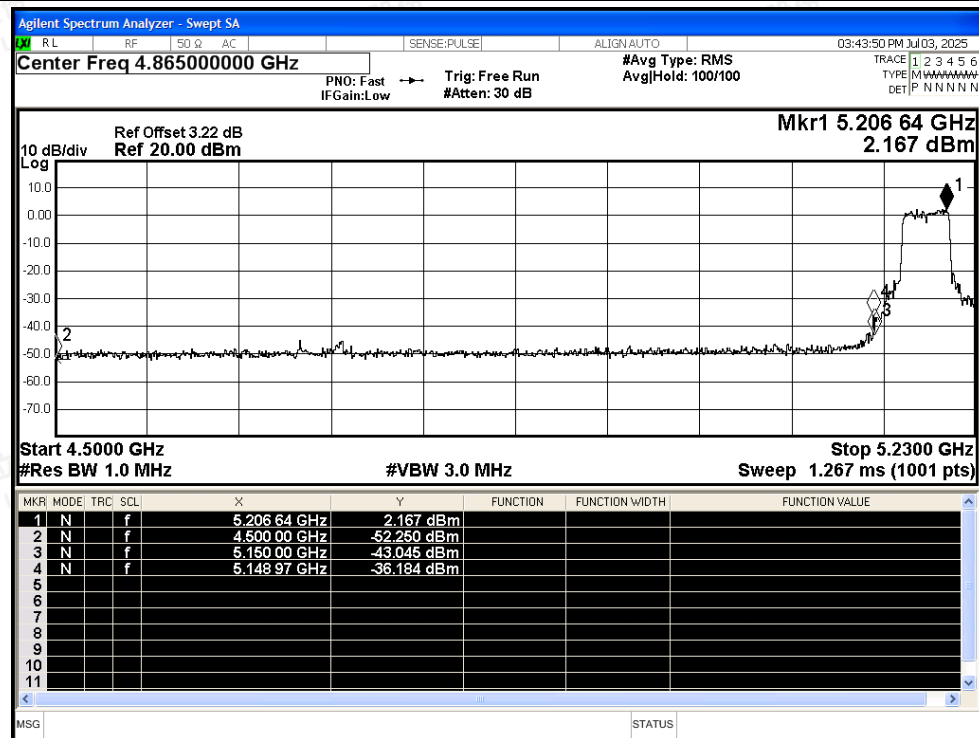

Restrict Band NVNT ax40 5190MHz Ant6 Average

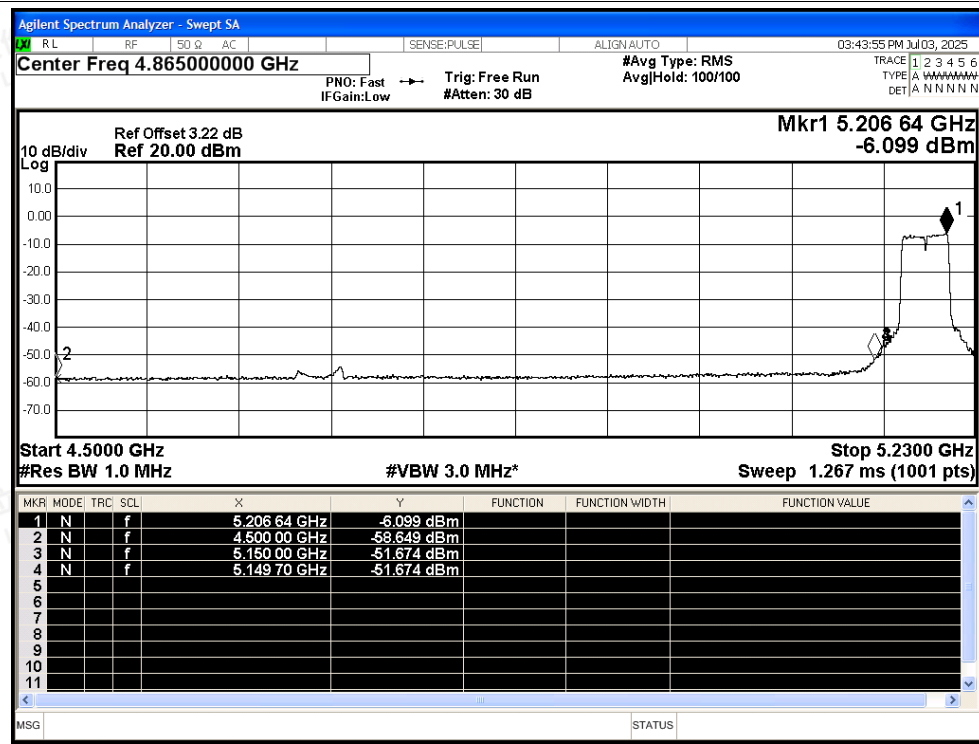

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant6 Peak

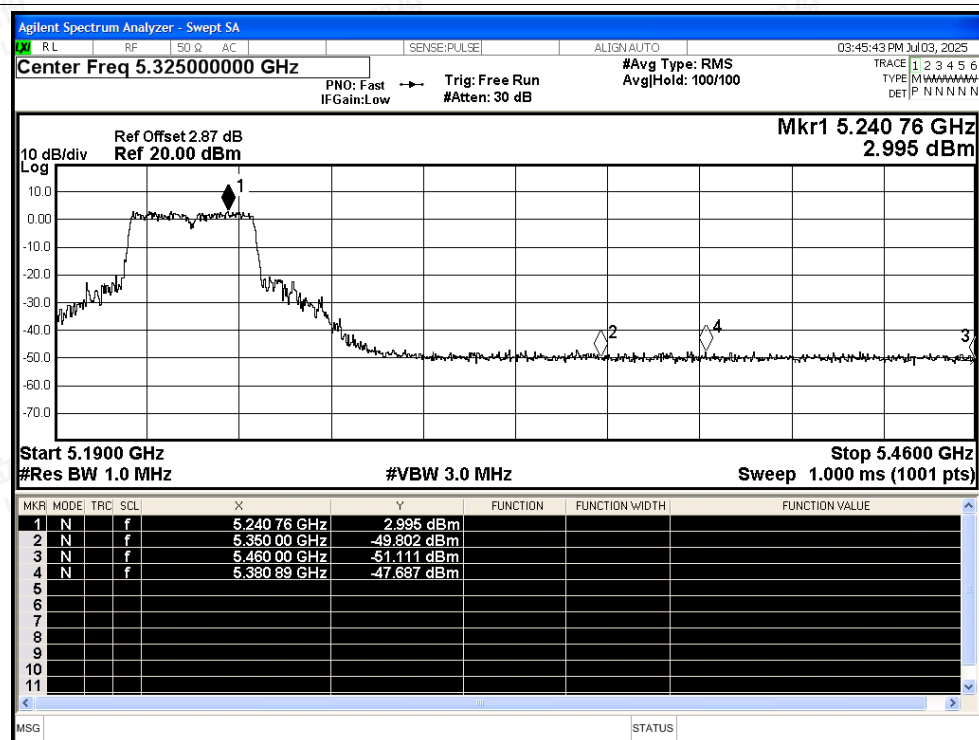

Restrict Band NVNT ax40 5230MHz Ant6 Average

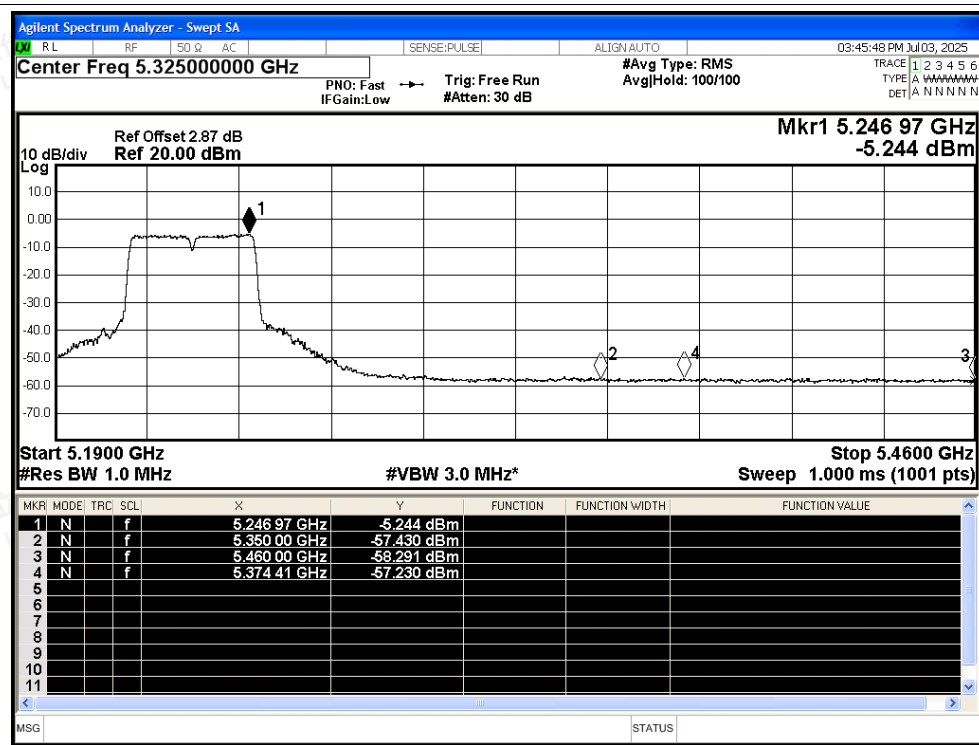

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant6 Peak

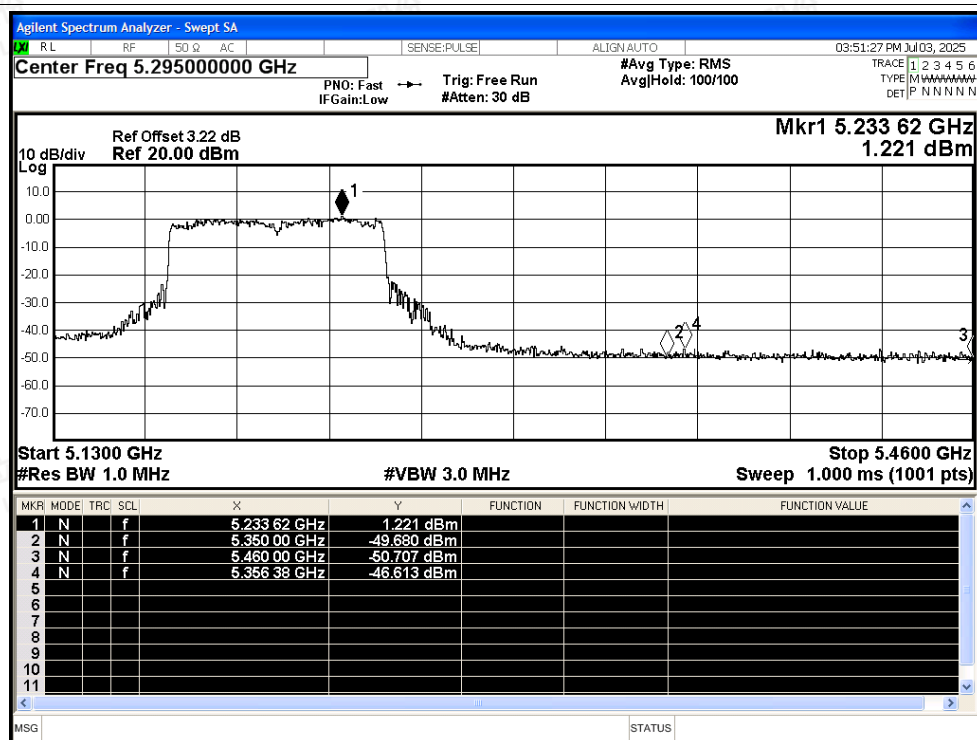

Restrict Band NVNT ax80 5210MHz Ant6 Average

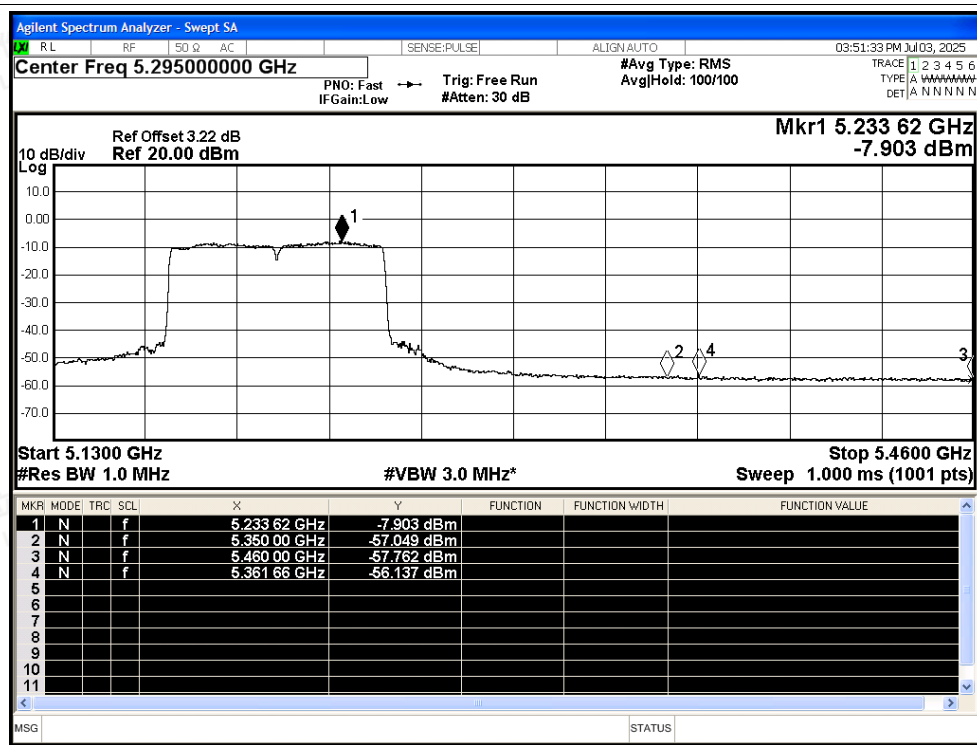

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant6 Peak

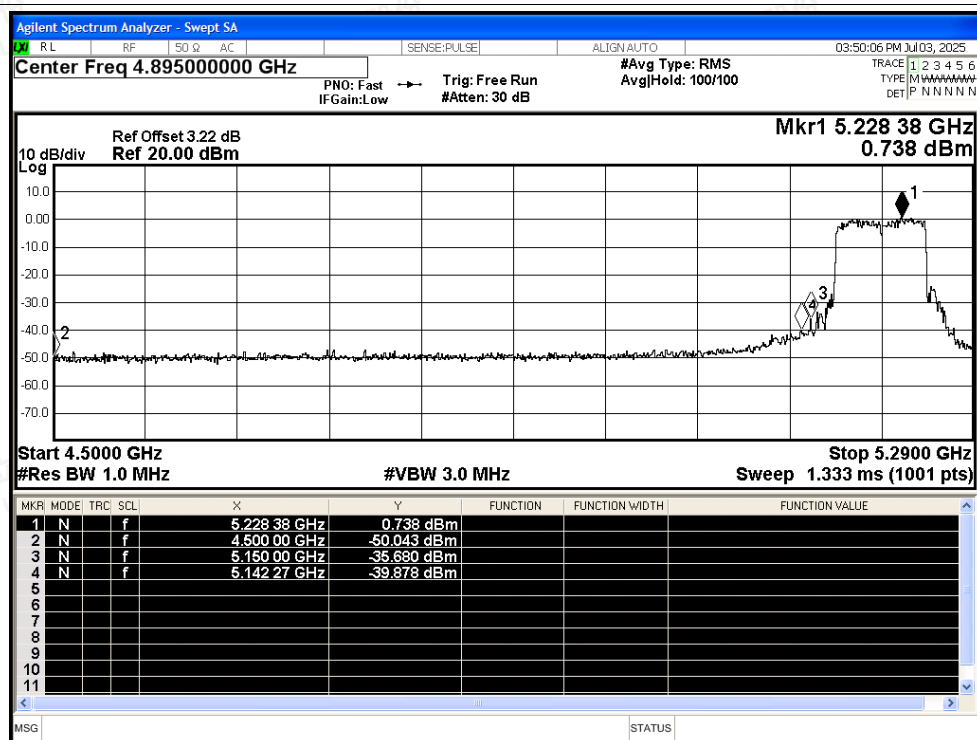

Restrict Band NVNT ax80 5210MHz Ant6 Average

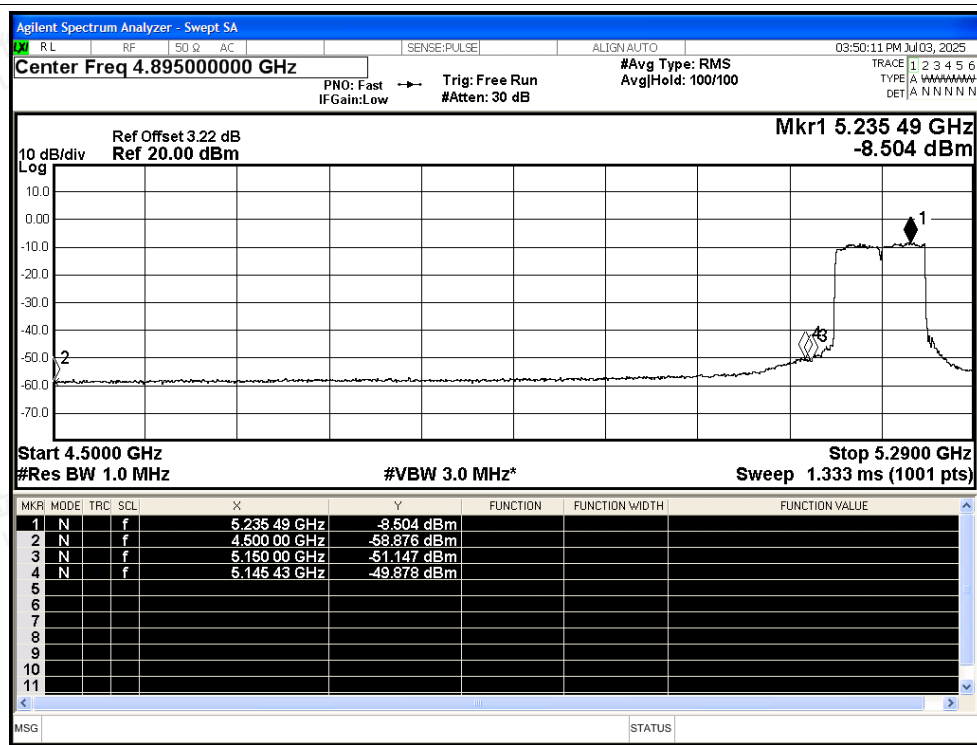

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant2 Power (dBm)	Ant3 Power (dBm)	Sum (Ant2+Ant3)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-52.06	-51.53	-48.78	6.40	52.79	Peak	68.2	PASS
NVNT	n20	5180	-58.59	-59.54	-56.03	6.40	45.54	Average	54	PASS
NVNT	n20	5180	-36.89	-43.2	-35.98	6.40	65.59	Peak	68.2	PASS
NVNT	n20	5180	-50.44	-53.31	-48.63	6.40	52.94	Average	54	PASS
NVNT	n20	5180	-40.49	-44.12	-38.93	6.40	62.64	Peak	68.2	PASS
NVNT	n20	5180	-51	-53.3	-48.99	6.40	52.58	Average	54	PASS
NVNT	n20	5240	-49.53	-50.1	-46.80	6.40	54.77	Peak	68.2	PASS
NVNT	n20	5240	-58.3	-57.8	-55.03	6.40	46.54	Average	54	PASS
NVNT	n20	5240	-47.43	-47.26	-44.33	6.40	57.23	Peak	68.2	PASS
NVNT	n20	5240	-57.41	-57.53	-54.46	6.40	47.11	Average	54	PASS
NVNT	n20	5240	-50.98	-50.41	-47.68	6.40	53.89	Peak	68.2	PASS
NVNT	n20	5240	-58.51	-58.47	-55.48	6.40	46.09	Average	54	PASS
NVNT	n40	5190	-49.82	-50.43	-47.10	6.40	54.46	Peak	68.2	PASS
NVNT	n40	5190	-58.45	-58.67	-55.55	6.40	46.02	Average	54	PASS
NVNT	n40	5190	-36.34	-37.99	-34.08	6.40	67.49	Peak	68.2	PASS
NVNT	n40	5190	-52.62	-51.96	-49.27	6.40	52.3	Average	54	PASS
NVNT	n40	5190	-36.34	-37.99	-34.08	6.40	67.49	Peak	68.2	PASS
NVNT	n40	5190	-52.62	-52.44	-49.52	6.40	52.05	Average	54	PASS
NVNT	n40	5230	-49.37	-51.7	-47.37	6.40	54.2	Peak	68.2	PASS
NVNT	n40	5230	-57.86	-58.42	-55.12	6.40	46.45	Average	54	PASS
NVNT	n40	5230	-47.32	-46.87	-44.08	6.40	57.49	Peak	68.2	PASS
NVNT	n40	5230	-57.52	-57.34	-54.42	6.40	47.15	Average	54	PASS
NVNT	n40	5230	-50.59	-50.43	-47.50	6.40	54.07	Peak	68.2	PASS
NVNT	n40	5230	-58.41	-58.41	-55.40	6.40	46.17	Average	54	PASS
NVNT	ac20	5180	-50.1	-51.48	-47.73	6.40	53.84	Peak	68.2	PASS
NVNT	ac20	5180	-58.5	-58.5	-55.49	6.40	46.08	Average	54	PASS
NVNT	ac20	5180	-39.17	-38.66	-35.90	6.40	65.67	Peak	68.2	PASS
NVNT	ac20	5180	-52.51	-51.43	-48.93	6.40	52.64	Average	54	PASS
NVNT	ac20	5180	-37.83	-36.14	-33.89	6.40	67.67	Peak	68.2	PASS
NVNT	ac20	5180	-51.35	-52.25	-48.77	6.40	52.8	Average	54	PASS
NVNT	ac20	5240	-50.05	-49.88	-46.95	6.40	54.61	Peak	68.2	PASS
NVNT	ac20	5240	-57.68	-57.69	-54.67	6.40	46.89	Average	54	PASS
NVNT	ac20	5240	-47.27	-47.48	-44.36	6.40	57.20	Peak	68.2	PASS
NVNT	ac20	5240	-57.25	-57.14	-54.18	6.40	47.38	Average	54	PASS
NVNT	ac20	5240	-49.81	-50.06	-46.92	6.40	54.64	Peak	68.2	PASS
NVNT	ac20	5240	-58.08	-58.44	-55.25	6.40	46.32	Average	54	PASS
NVNT	ac40	5190	-50.65	-51.07	-47.84	6.40	53.72	Peak	68.2	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-59.08	-59.06	-56.06	6.40	45.51	Average	54	PASS
NVNT	ac40	5190	-39.1	-40.42	-36.70	6.40	64.87	Peak	68.2	PASS
NVNT	ac40	5190	-52.34	-52.02	-49.17	6.40	52.40	Average	54	PASS
NVNT	ac40	5190	-39.1	-40.42	-36.70	6.40	64.87	Peak	68.2	PASS
NVNT	ac40	5190	-52.53	-52.74	-49.62	6.40	51.94	Average	54	PASS
NVNT	ac40	5230	-49.51	-50.6	-47.01	6.40	54.56	Peak	68.2	PASS
NVNT	ac40	5230	-57.96	-57.79	-54.86	6.40	46.70	Average	54	PASS
NVNT	ac40	5230	-47.48	-47.18	-44.32	6.40	57.25	Peak	68.2	PASS
NVNT	ac40	5230	-57.37	-57.32	-54.33	6.40	47.23	Average	54	PASS
NVNT	ac40	5230	-50.05	-49.66	-46.84	6.40	54.73	Peak	68.2	PASS
NVNT	ac40	5230	-58.15	-58.37	-55.25	6.40	46.32	Average	54	PASS
NVNT	ac80	5210	-48.4	-49.85	-46.05	6.40	55.51	Peak	68.2	PASS
NVNT	ac80	5210	-57.61	-57.17	-54.37	6.40	47.19	Average	54	PASS
NVNT	ac80	5210	-47.23	-46.73	-43.96	6.40	57.61	Peak	68.2	PASS
NVNT	ac80	5210	-56.97	-57.07	-54.01	6.40	47.56	Average	54	PASS
NVNT	ac80	5210	-50.81	-50.39	-47.58	6.40	53.98	Peak	68.2	PASS
NVNT	ac80	5210	-58.02	-58.1	-55.05	6.40	46.52	Average	54	PASS
NVNT	ac80	5210	-51.15	-50.94	-48.03	6.40	53.53	Peak	68.2	PASS
NVNT	ac80	5210	-59.52	-59.03	-56.26	6.40	45.31	Average	54	PASS
NVNT	ac80	5210	-40.07	-45.92	-39.07	6.40	62.50	Peak	68.2	PASS
NVNT	ac80	5210	-52.01	-56.55	-50.70	6.40	50.87	Average	54	PASS
NVNT	ac80	5210	-42.04	-49.13	-41.26	6.40	60.30	Peak	68.2	PASS
NVNT	ac80	5210	-52.12	-57.37	-50.99	6.40	50.58	Average	54	PASS
NVNT	ax20	5180	-50.75	-51.76	-48.22	6.40	53.35	Peak	68.2	PASS
NVNT	ax20	5180	-58.77	-58.63	-55.69	6.40	45.88	Average	54	PASS
NVNT	ax20	5180	-40.62	-41.21	-37.89	6.40	63.67	Peak	68.2	PASS
NVNT	ax20	5180	-52.49	-53.76	-50.07	6.40	51.5	Average	54	PASS
NVNT	ax20	5180	-42.38	-40.87	-38.55	6.40	63.02	Peak	68.2	PASS
NVNT	ax20	5180	-52.65	-54.13	-50.32	6.40	51.25	Average	54	PASS
NVNT	ax20	5240	-49.8	-50.74	-47.23	6.40	54.33	Peak	68.2	PASS
NVNT	ax20	5240	-58.17	-58.45	-55.30	6.40	46.27	Average	54	PASS
NVNT	ax20	5240	-47.64	-47.43	-44.52	6.40	57.04	Peak	68.2	PASS
NVNT	ax20	5240	-57.22	-57.43	-54.31	6.40	47.25	Average	54	PASS
NVNT	ax20	5240	-50.01	-50.36	-47.17	6.40	54.40	Peak	68.2	PASS
NVNT	ax20	5240	-58.56	-57.83	-55.17	6.40	46.40	Average	54	PASS
NVNT	ax40	5190	-50.53	-51.63	-48.03	6.40	53.53	Peak	68.2	PASS
NVNT	ax40	5190	-59.18	-59.04	-56.10	6.40	45.47	Average	54	PASS
NVNT	ax40	5190	-36.55	-39.41	-34.74	6.40	66.83	Peak	68.2	PASS
NVNT	ax40	5190	-52.47	-51.77	-49.10	6.40	52.47	Average	54	PASS
NVNT	ax40	5190	-40.83	-39.96	-37.36	6.40	64.20	Peak	68.2	PASS
NVNT	ax40	5190	-52.47	-51.77	-49.10	6.40	52.47	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	-50.86	-48.94	-46.78	6.40	54.78	Peak	68.2	PASS
NVNT	ax40	5230	-58.73	-57.65	-55.15	6.40	46.42	Average	54	PASS
NVNT	ax40	5230	-46.45	-47.17	-43.78	6.40	57.78	Peak	68.2	PASS
NVNT	ax40	5230	-57.46	-57.47	-54.45	6.40	47.11	Average	54	PASS
NVNT	ax40	5230	-50.47	-50.71	-47.58	6.40	53.99	Peak	68.2	PASS
NVNT	ax40	5230	-57.81	-58.42	-55.09	6.40	46.47	Average	54	PASS
NVNT	ax80	5210	-50.03	-50.14	-47.07	6.40	54.49	Peak	68.2	PASS
NVNT	ax80	5210	-57.67	-57.27	-54.46	6.40	47.11	Average	54	PASS
NVNT	ax80	5210	-46.66	-47.14	-43.88	6.40	57.68	Peak	68.2	PASS
NVNT	ax80	5210	-57.06	-56.76	-53.90	6.40	47.67	Average	54	PASS
NVNT	ax80	5210	-51.47	-49.64	-47.45	6.40	54.12	Peak	68.2	PASS
NVNT	ax80	5210	-58.37	-57.98	-55.16	6.40	46.41	Average	54	PASS
NVNT	ax80	5210	-50.77	-50.95	-47.85	6.40	53.72	Peak	68.2	PASS
NVNT	ax80	5210	-58.63	-59.2	-55.90	6.40	45.67	Average	54	PASS
NVNT	ax80	5210	-38.05	-41.79	-36.52	6.40	65.05	Peak	68.2	PASS
NVNT	ax80	5210	-53	-51.94	-49.43	6.40	52.14	Average	54	PASS
NVNT	ax80	5210	-44.34	-41.32	-39.56	6.40	62.01	Peak	68.2	PASS
NVNT	ax80	5210	-52.88	-52.43	-49.64	6.40	51.93	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant5 Power (dBm)	Ant6 Power (dBm)	Sum (Ant5+Ant6)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-50.23	-50.3	-47.25	6.94	54.91	Peak	68.2	PASS
NVNT	n20	5180	-58.77	-58.77	-55.76	6.94	46.41	Average	54	PASS
NVNT	n20	5180	-40.44	-39.85	-37.12	6.94	65.04	Peak	68.2	PASS
NVNT	n20	5180	-51.6	-53.6	-49.48	6.94	52.69	Average	54	PASS
NVNT	n20	5180	-40.18	-42.78	-38.28	6.94	63.89	Peak	68.2	PASS
NVNT	n20	5180	-52.39	-53.13	-49.73	6.94	52.43	Average	54	PASS
NVNT	n20	5240	-49.51	-50.59	-47.01	6.94	55.16	Peak	68.2	PASS
NVNT	n20	5240	-57.19	-57.89	-54.52	6.94	47.65	Average	54	PASS
NVNT	n20	5240	-47.48	-47.5	-44.48	6.94	57.69	Peak	68.2	PASS
NVNT	n20	5240	-57.19	-57.47	-54.32	6.94	47.85	Average	54	PASS
NVNT	n20	5240	-50.36	-50.04	-47.19	6.94	54.98	Peak	68.2	PASS
NVNT	n20	5240	-58.32	-58.32	-55.31	6.94	46.86	Average	54	PASS
NVNT	n40	5190	-50.86	-50.41	-47.62	6.94	54.55	Peak	68.2	PASS
NVNT	n40	5190	-58.74	-58.05	-55.37	6.94	46.80	Average	54	PASS
NVNT	n40	5190	-38.89	-35.74	-34.03	6.94	68.14	Peak	68.2	PASS
NVNT	n40	5190	-51.48	-52.34	-48.88	6.94	53.29	Average	54	PASS
NVNT	n40	5190	-38.26	-39.65	-35.89	6.94	66.28	Peak	68.2	PASS
NVNT	n40	5190	-51.45	-52.89	-49.10	6.94	53.07	Average	54	PASS
NVNT	n40	5230	-49.52	-49.93	-46.71	6.94	55.46	Peak	68.2	PASS
NVNT	n40	5230	-57.43	-57.79	-54.60	6.94	47.57	Average	54	PASS
NVNT	n40	5230	-46.65	-47.35	-43.98	6.94	58.19	Peak	68.2	PASS
NVNT	n40	5230	-57.18	-57.3	-54.23	6.94	47.94	Average	54	PASS
NVNT	n40	5230	-49.32	-50.78	-46.98	6.94	55.19	Peak	68.2	PASS
NVNT	n40	5230	-58.5	-58.48	-55.48	6.94	46.69	Average	54	PASS
NVNT	ac20	5180	-51.57	-50.85	-48.18	6.94	53.98	Peak	68.2	PASS
NVNT	ac20	5180	-58.25	-59.06	-55.63	6.94	46.54	Average	54	PASS
NVNT	ac20	5180	-39.92	-38.19	-35.96	6.94	66.21	Peak	68.2	PASS
NVNT	ac20	5180	-52.66	-53.05	-49.84	6.94	52.33	Average	54	PASS
NVNT	ac20	5180	-39.92	-38.19	-35.96	6.94	66.21	Peak	68.2	PASS
NVNT	ac20	5180	-52.66	-53.05	-49.84	6.94	52.33	Average	54	PASS
NVNT	ac20	5240	-50.06	-49.61	-46.82	6.94	55.35	Peak	68.2	PASS
NVNT	ac20	5240	-58.27	-58.13	-55.19	6.94	46.98	Average	54	PASS
NVNT	ac20	5240	-47.16	-46.86	-44.00	6.94	58.17	Peak	68.2	PASS
NVNT	ac20	5240	-57.18	-57.4	-54.28	6.94	47.89	Average	54	PASS
NVNT	ac20	5240	-51.03	-50.92	-47.96	6.94	54.20	Peak	68.2	PASS
NVNT	ac20	5240	-58.47	-58.14	-55.29	6.94	46.88	Average	54	PASS
NVNT	ac40	5190	-50.6	-49.85	-47.20	6.94	54.97	Peak	68.2	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-58.79	-58.66	-55.71	6.94	46.45	Average	54	PASS
NVNT	ac40	5190	-38.37	-37.35	-34.82	6.94	67.35	Peak	68.2	PASS
NVNT	ac40	5190	-51.13	-52.92	-48.92	6.94	53.24	Average	54	PASS
NVNT	ac40	5190	-39.72	-36.47	-34.79	6.94	67.38	Peak	68.2	PASS
NVNT	ac40	5190	-53.98	-51.72	-49.69	6.94	52.47	Average	54	PASS
NVNT	ac40	5230	-49.09	-49.5	-46.28	6.94	55.89	Peak	68.2	PASS
NVNT	ac40	5230	-57.74	-58.16	-54.93	6.94	47.23	Average	54	PASS
NVNT	ac40	5230	-46.8	-46.94	-43.86	6.94	58.31	Peak	68.2	PASS
NVNT	ac40	5230	-57.07	-57.28	-54.16	6.94	48.00	Average	54	PASS
NVNT	ac40	5230	-50.54	-50.07	-47.29	6.94	54.88	Peak	68.2	PASS
NVNT	ac40	5230	-58.19	-58.52	-55.34	6.94	46.83	Average	54	PASS
NVNT	ac80	5210	-50.31	-51.09	-47.67	6.94	54.50	Peak	68.2	PASS
NVNT	ac80	5210	-58.63	-59.09	-55.84	6.94	46.32	Average	54	PASS
NVNT	ac80	5210	-39.94	-36.04	-34.56	6.94	67.61	Peak	68.2	PASS
NVNT	ac80	5210	-51.38	-54.9	-49.78	6.94	52.39	Average	54	PASS
NVNT	ac80	5210	-39.94	-38.04	-35.88	6.94	66.29	Peak	68.2	PASS
NVNT	ac80	5210	-51.38	-52.9	-49.06	6.94	53.10	Average	54	PASS
NVNT	ac80	5210	-49.31	-49.7	-46.49	6.94	55.68	Peak	68.2	PASS
NVNT	ac80	5210	-57.89	-58.12	-54.99	6.94	47.17	Average	54	PASS
NVNT	ac80	5210	-47.3	-46.9	-44.09	6.94	58.08	Peak	68.2	PASS
NVNT	ac80	5210	-57.19	-57.32	-54.24	6.94	47.92	Average	54	PASS
NVNT	ac80	5210	-49.41	-51.44	-47.30	6.94	54.87	Peak	68.2	PASS
NVNT	ac80	5210	-58.42	-58.84	-55.61	6.94	46.55	Average	54	PASS
NVNT	ax20	5180	-48.95	-49.9	-46.39	6.94	55.78	Peak	68.2	PASS
NVNT	ax20	5180	-56.88	-57.59	-54.21	6.94	47.96	Average	54	PASS
NVNT	ax20	5180	-46.63	-46.97	-43.79	6.94	58.38	Peak	68.2	PASS
NVNT	ax20	5180	-56.88	-56.55	-53.70	6.94	48.47	Average	54	PASS
NVNT	ax20	5180	-50.59	-50.33	-47.45	6.94	54.72	Peak	68.2	PASS
NVNT	ax20	5180	-58.46	-58.44	-55.44	6.94	46.73	Average	54	PASS
NVNT	ax20	5240	-50.54	-51.13	-47.81	6.94	54.35	Peak	68.2	PASS
NVNT	ax20	5240	-59.56	-58.89	-56.20	6.94	45.97	Average	54	PASS
NVNT	ax20	5240	-41.13	-37.2	-35.72	6.94	66.44	Peak	68.2	PASS
NVNT	ax20	5240	-52.24	-53.01	-49.60	6.94	52.57	Average	54	PASS
NVNT	ax20	5240	-43.52	-41.87	-39.61	6.94	62.56	Peak	68.2	PASS
NVNT	ax20	5240	-52.09	-52.09	-49.08	6.94	53.09	Average	54	PASS
NVNT	ax40	5190	-49.8	-50.97	-47.34	6.94	54.83	Peak	68.2	PASS
NVNT	ax40	5190	-58.9	-59.15	-56.01	6.94	46.15	Average	54	PASS
NVNT	ax40	5190	-38.21	-37.11	-34.61	6.94	67.55	Peak	68.2	PASS
NVNT	ax40	5190	-51.37	-55.93	-50.07	6.94	52.10	Average	54	PASS
NVNT	ax40	5190	-40.17	-39.93	-37.04	6.94	65.13	Peak	68.2	PASS
NVNT	ax40	5190	-51.33	-54.53	-49.63	6.94	52.54	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	-49.25	-48.94	-46.08	6.94	56.09	Peak	68.2	PASS
NVNT	ax40	5230	-58.26	-57.56	-54.89	6.94	47.28	Average	54	PASS
NVNT	ax40	5230	-47.48	-47.07	-44.26	6.94	57.91	Peak	68.2	PASS
NVNT	ax40	5230	-57.22	-57.21	-54.20	6.94	47.96	Average	54	PASS
NVNT	ax40	5230	-50.31	-49.9	-47.09	6.94	55.08	Peak	68.2	PASS
NVNT	ax40	5230	-58.29	-58.25	-55.26	6.94	46.91	Average	54	PASS
NVNT	ax80	5210	-50.03	-52.25	-47.99	6.94	54.18	Peak	68.2	PASS
NVNT	ax80	5210	-58.66	-58.65	-55.64	6.94	46.52	Average	54	PASS
NVNT	ax80	5210	-38.65	-36.18	-34.23	6.94	67.94	Peak	68.2	PASS
NVNT	ax80	5210	-52.16	-51.67	-48.90	6.94	53.27	Average	54	PASS
NVNT	ax80	5210	-38.65	-43.05	-37.30	6.94	64.86	Peak	68.2	PASS
NVNT	ax80	5210	-52.16	-51.67	-48.90	6.94	53.27	Average	54	PASS
NVNT	ax80	5210	-48.61	-49.8	-46.15	6.94	56.01	Peak	68.2	PASS
NVNT	ax80	5210	-57.96	-57.43	-54.68	6.94	47.49	Average	54	PASS
NVNT	ax80	5210	-47.43	-47.69	-44.55	6.94	57.62	Peak	68.2	PASS
NVNT	ax80	5210	-57.29	-57.23	-54.25	6.94	47.92	Average	54	PASS
NVNT	ax80	5210	-50.94	-51.11	-48.01	6.94	54.15	Peak	68.2	PASS
NVNT	ax80	5210	-58.09	-58.29	-55.18	6.94	46.99	Average	54	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180.02	20000	3.86	25	Pass
NVNT	a	5200	Ant2	5200	0	0	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5180	0	0	25	Pass
NVNT	n20	5200	Ant2	5200.02	20000	3.85	25	Pass
NVNT	n20	5240	Ant2	5240	0	0	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5180	0	0	25	Pass
NVNT	ac20	5200	Ant2	5200	0	0	25	Pass
NVNT	ac20	5240	Ant2	5240	0	0	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5180	0	0	25	Pass
NVNT	ax20	5200	Ant2	5200	0	0	25	Pass
NVNT	ax20	5240	Ant2	5240	0	0	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

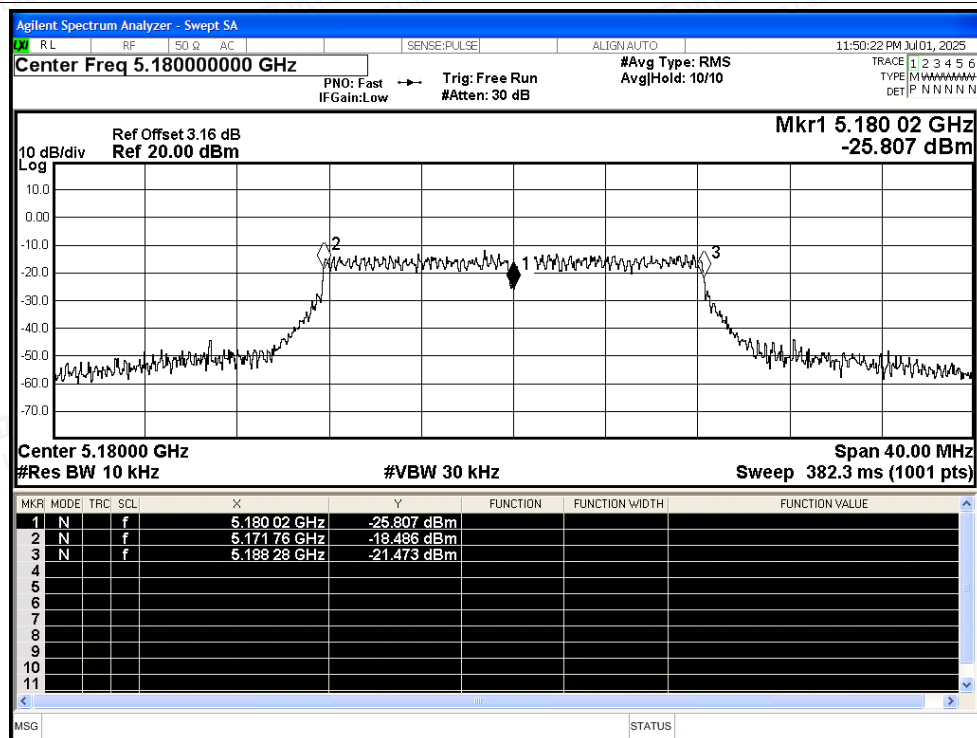

Freq. Stability NVNT a 5200MHz Ant2

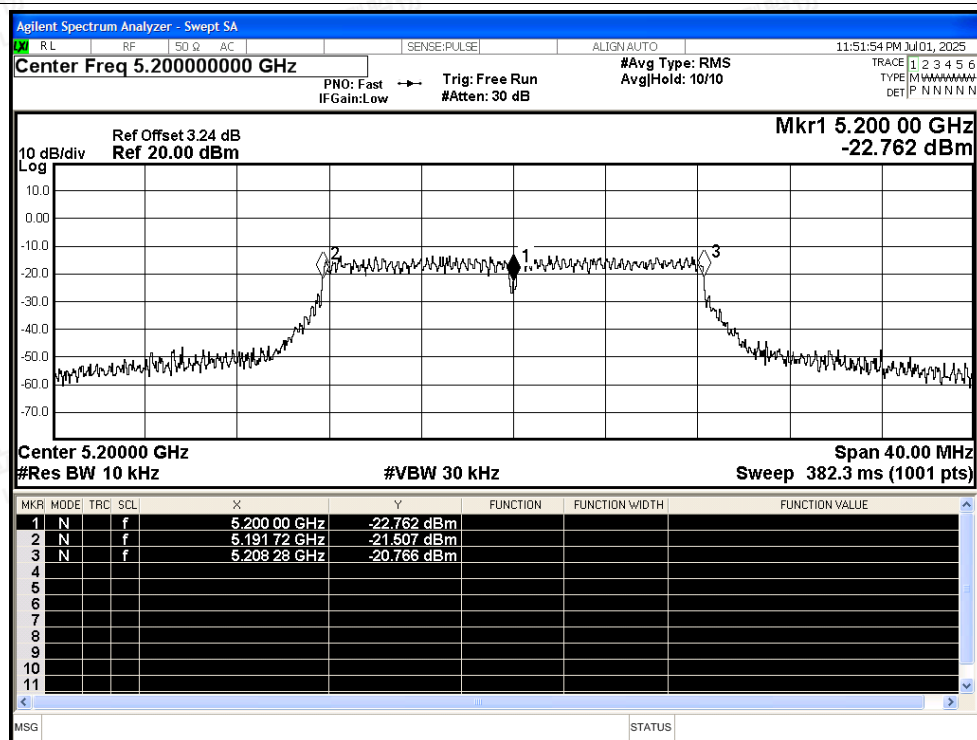

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

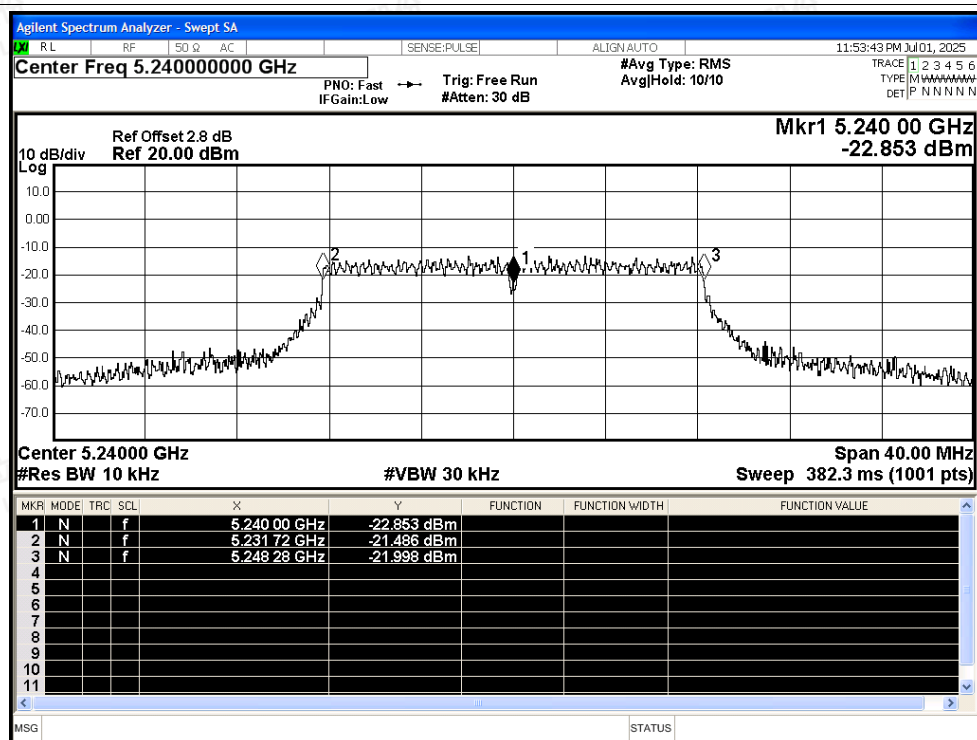

Freq. Stability NVNT n20 5180MHz Ant2

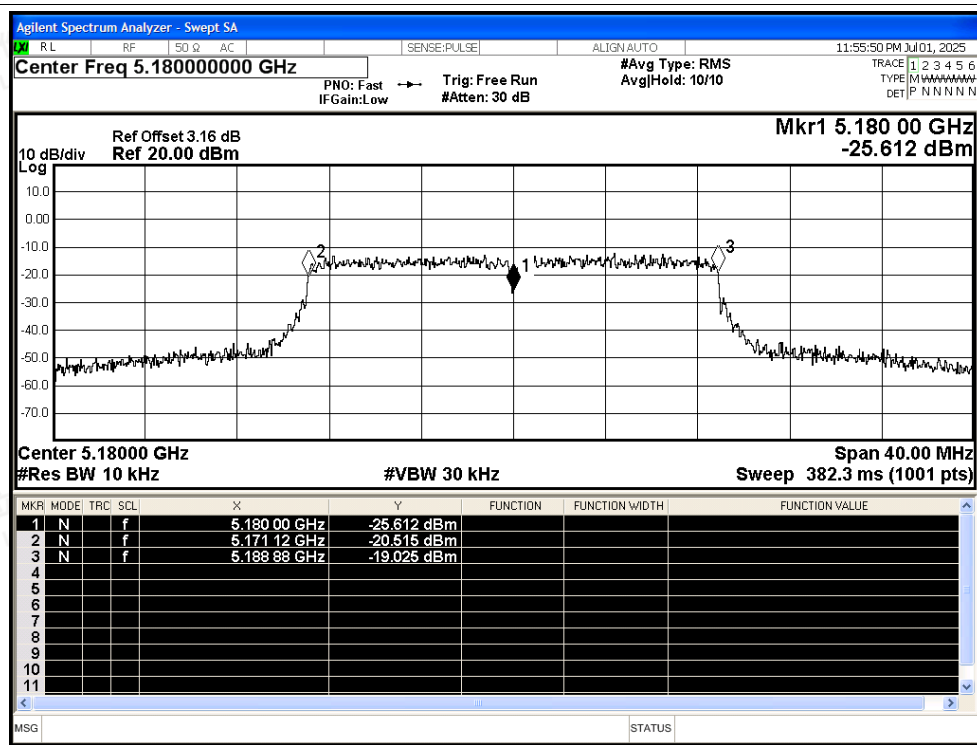

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

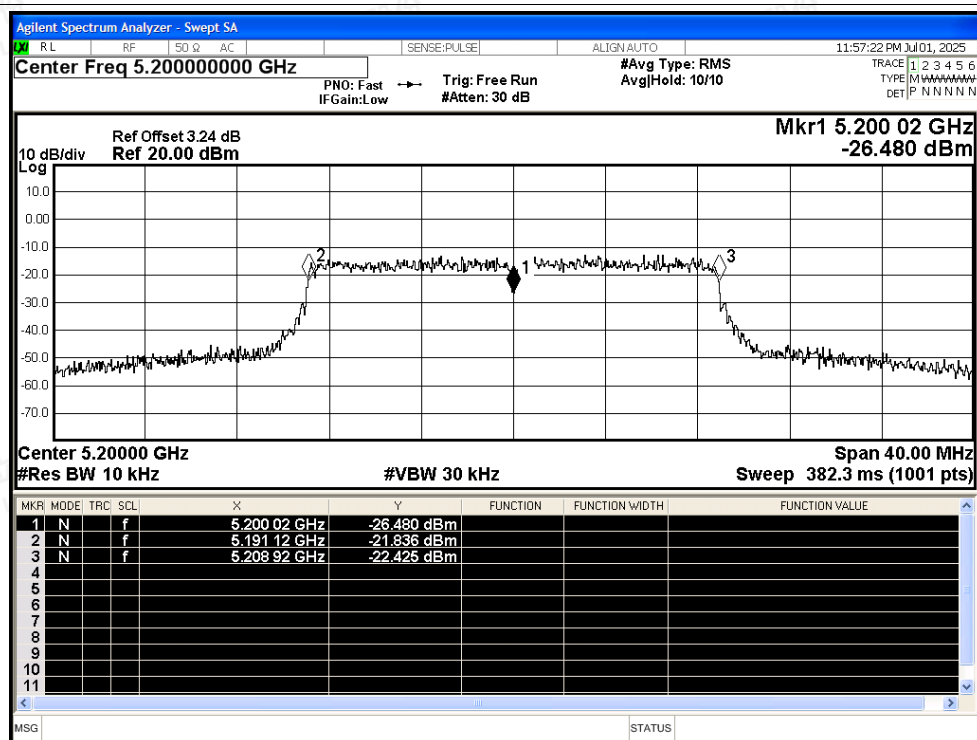

Freq. Stability NVNT n20 5240MHz Ant2

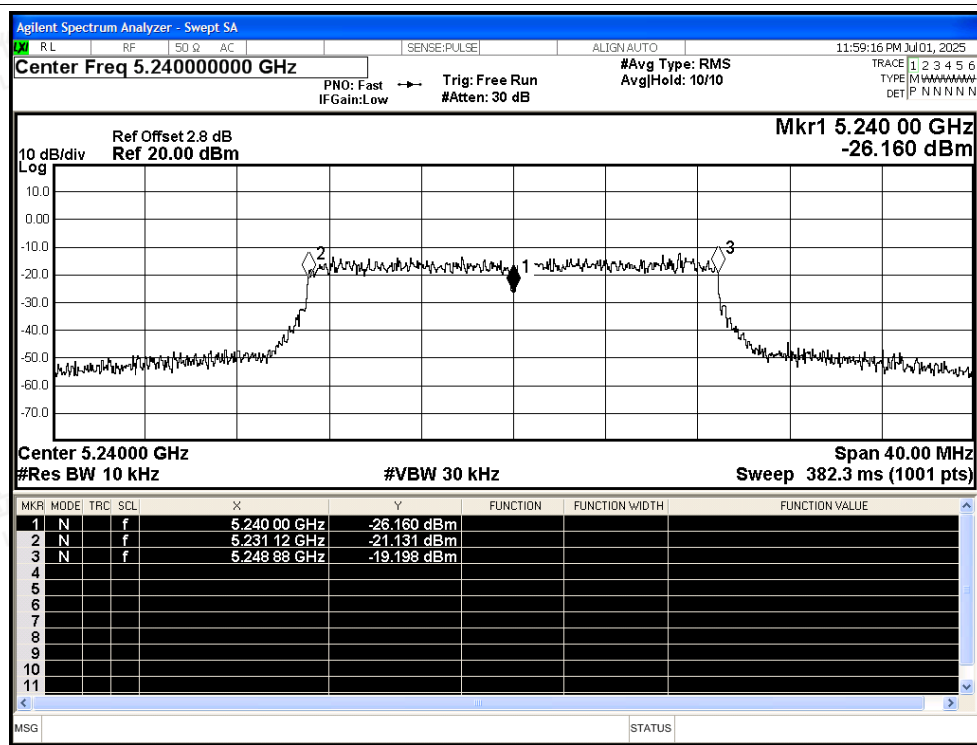

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant2

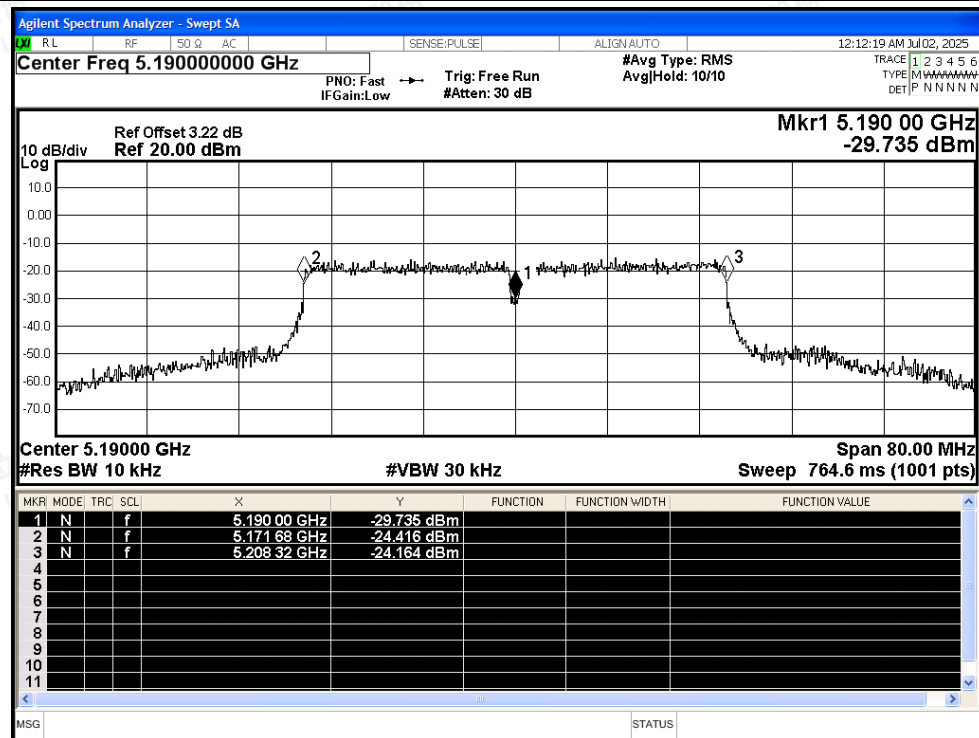

Freq. Stability NVNT n40 5230MHz Ant2

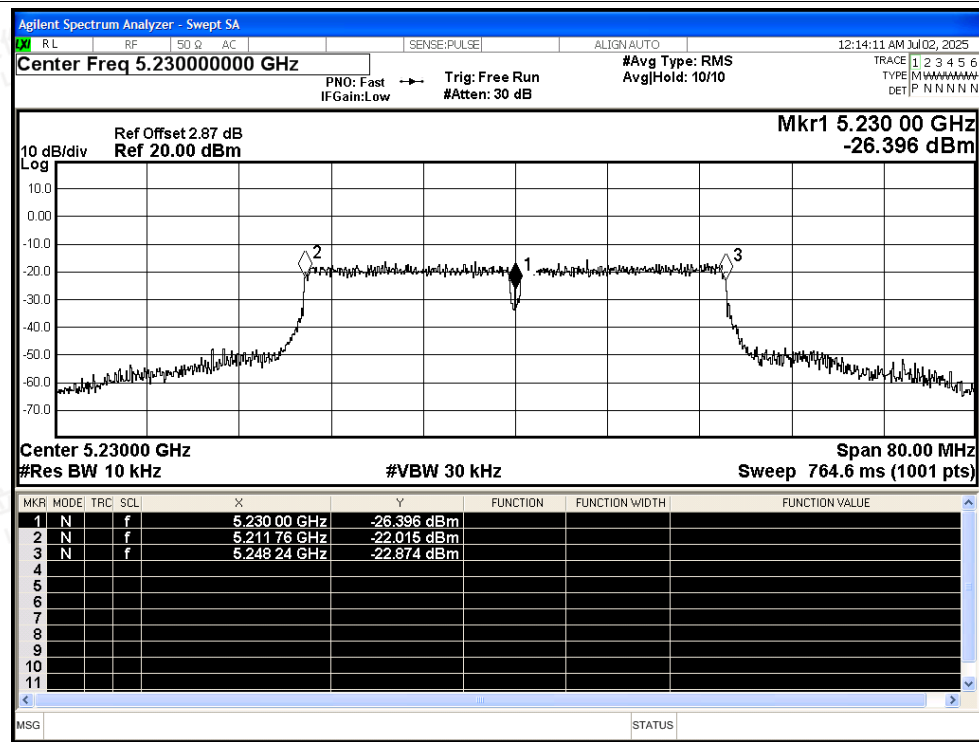

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant2

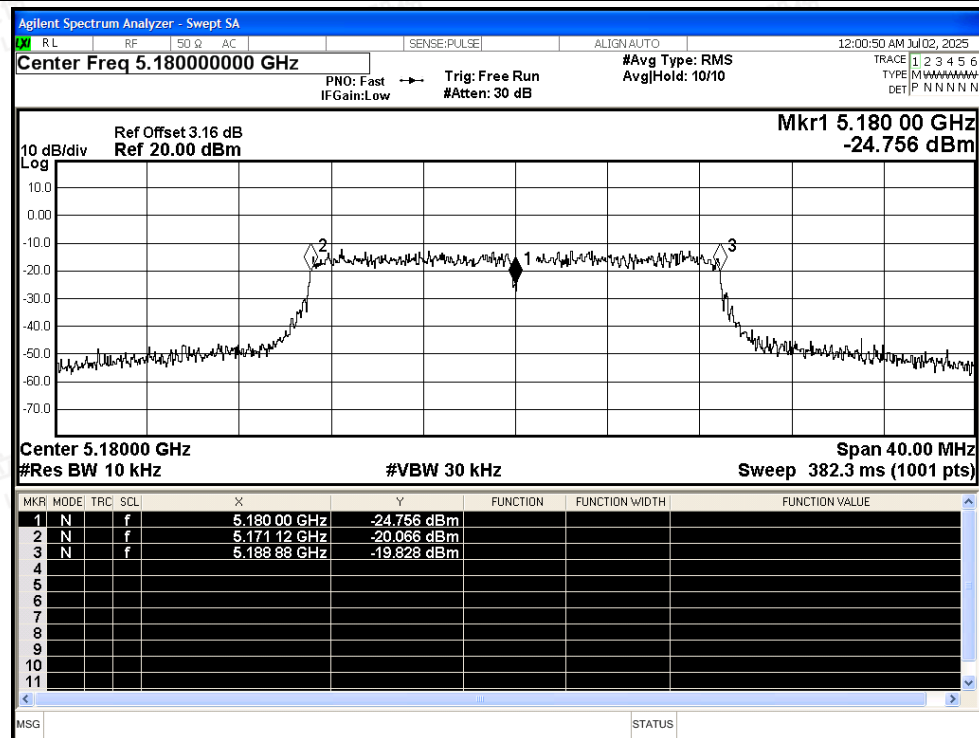

Freq. Stability NVNT ac20 5200MHz Ant2

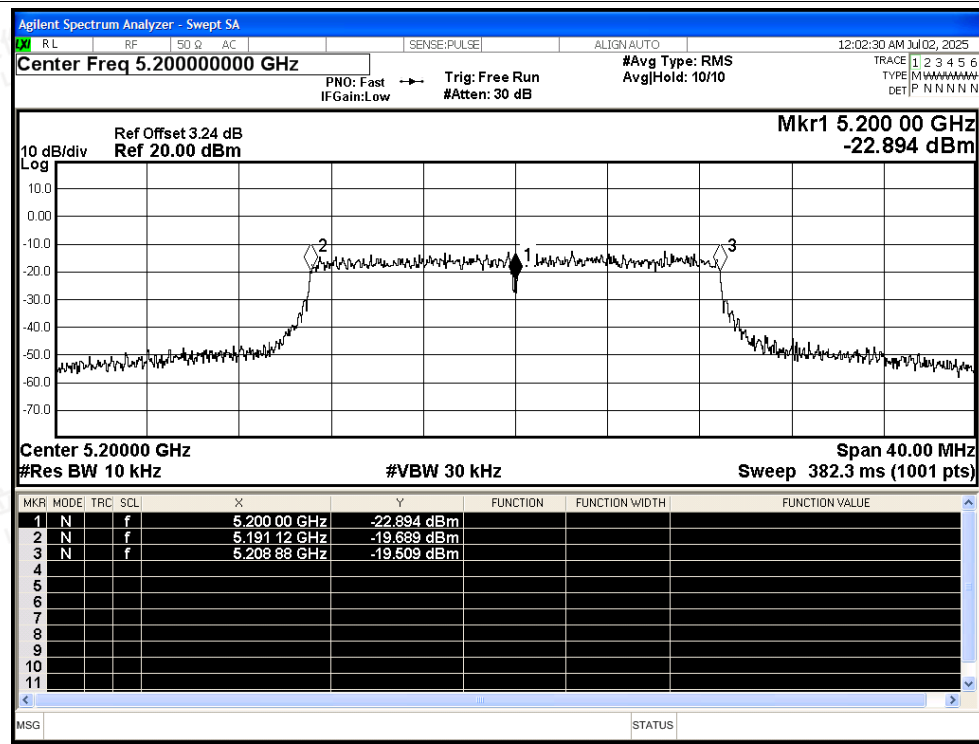

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant2

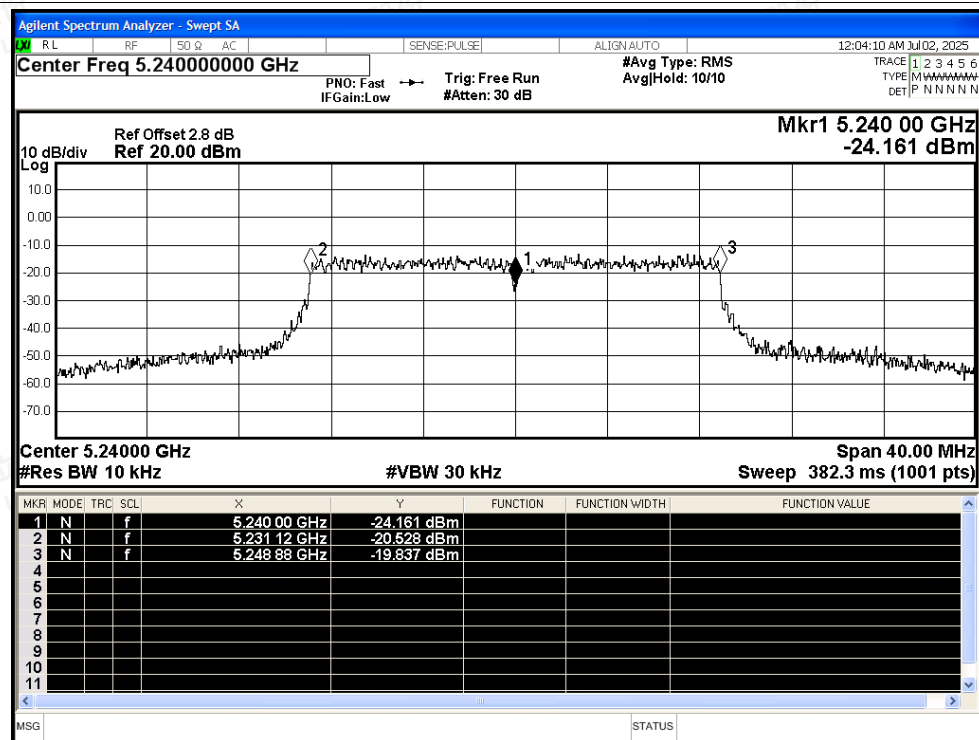

Freq. Stability NVNT ac40 5190MHz Ant2

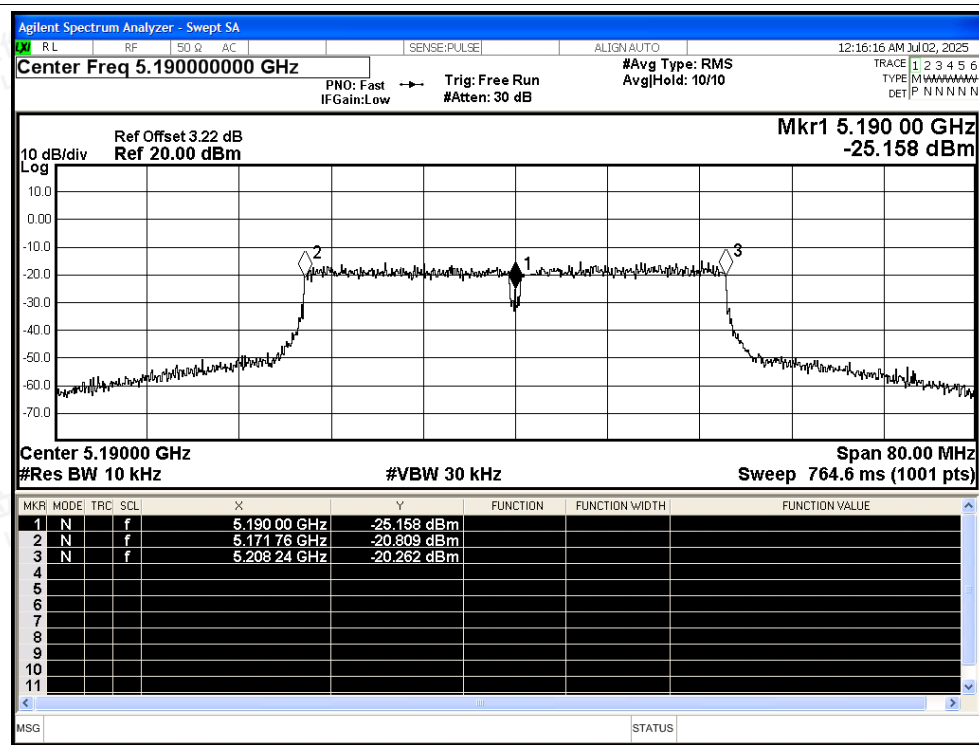

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant2

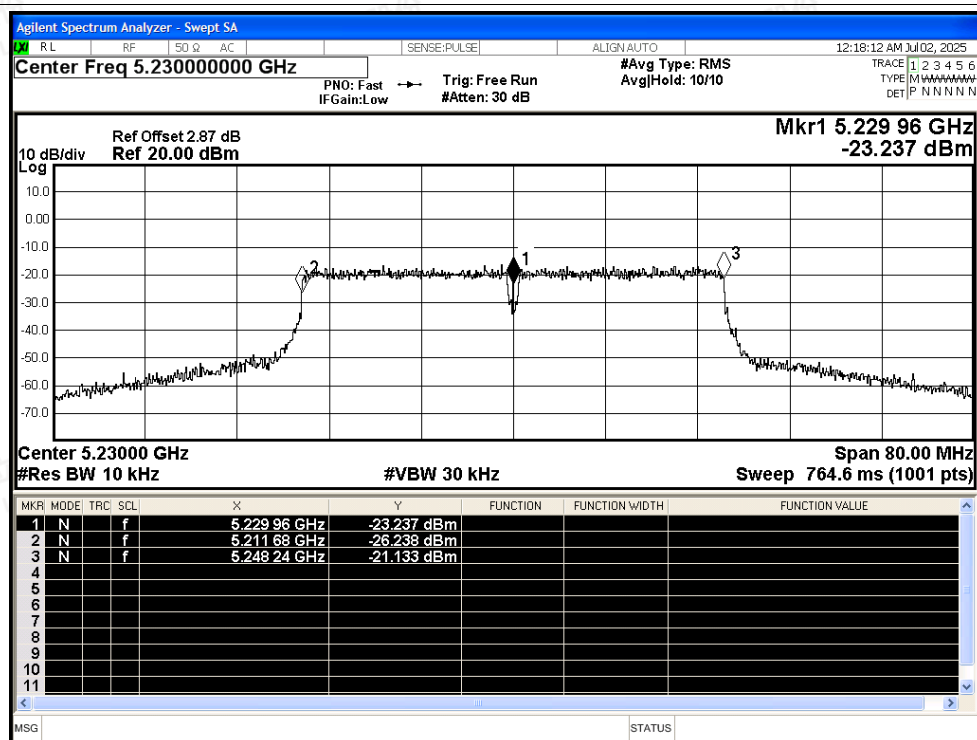

Freq. Stability NVNT ac80 5210MHz Ant2

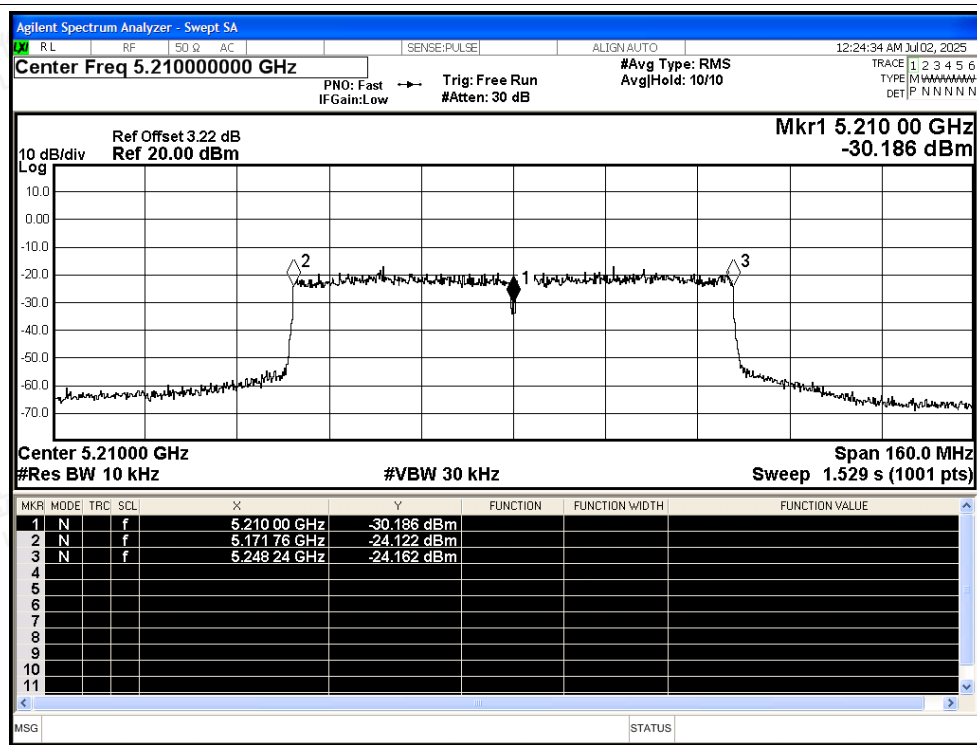

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant2

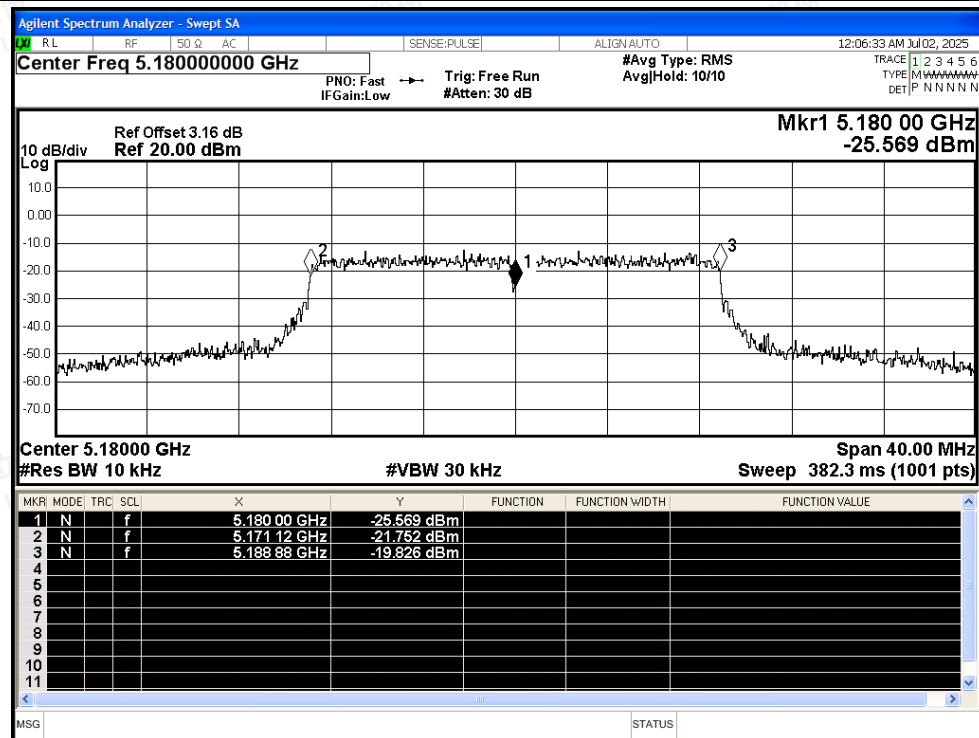

Freq. Stability NVNT ax20 5200MHz Ant2

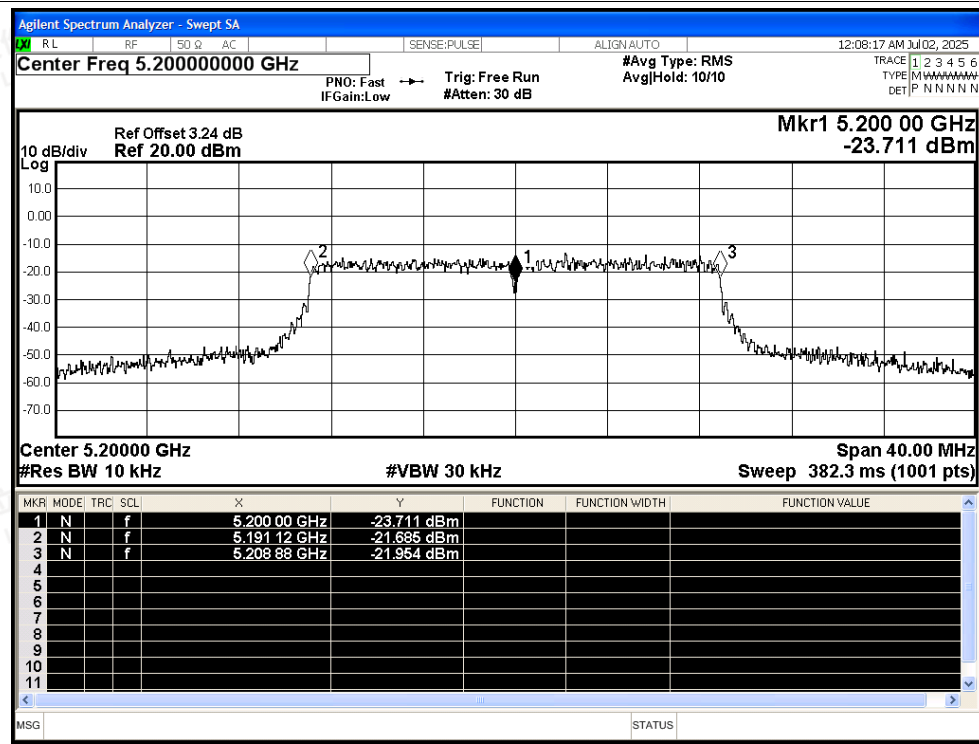

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant2

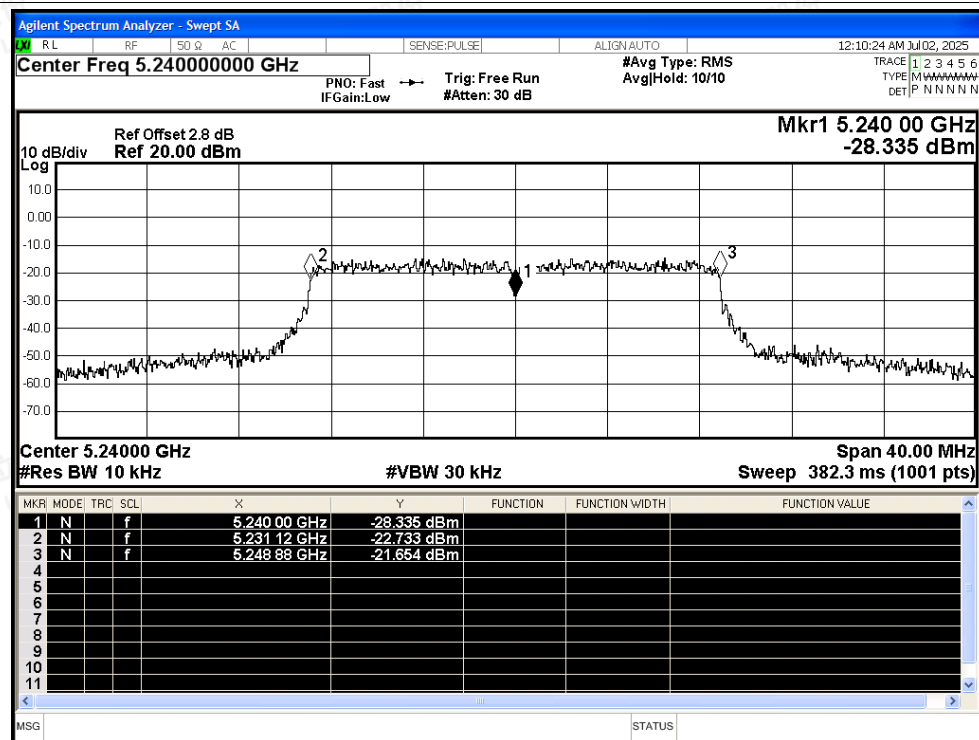

Freq. Stability NVNT ax40 5190MHz Ant2

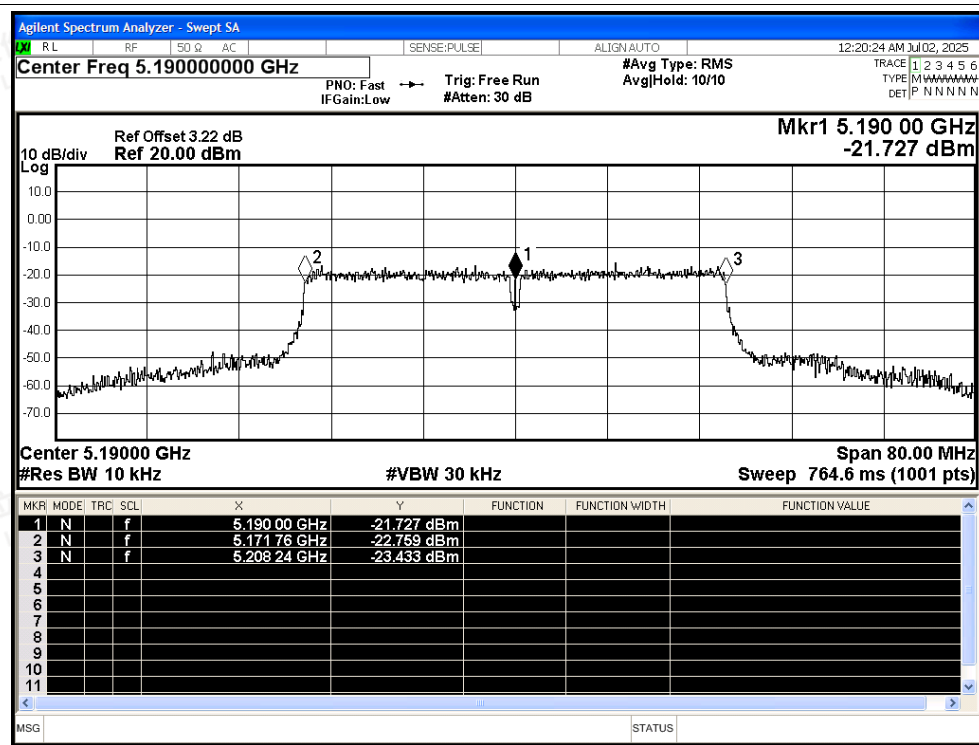

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant2

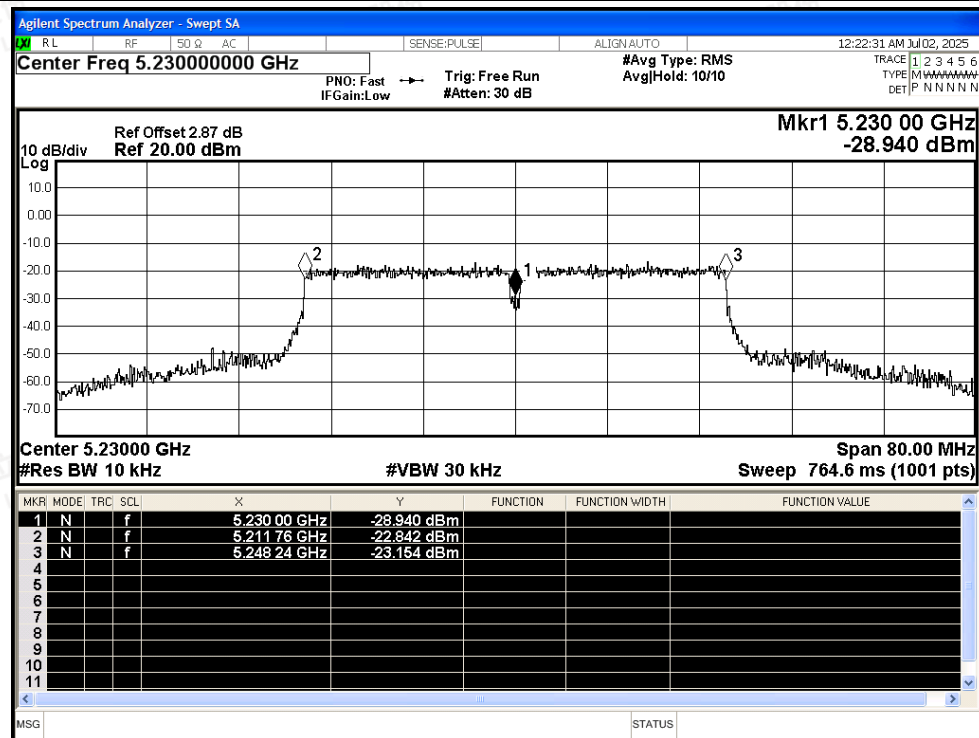

Freq. Stability NVNT ax80 5210MHz Ant2

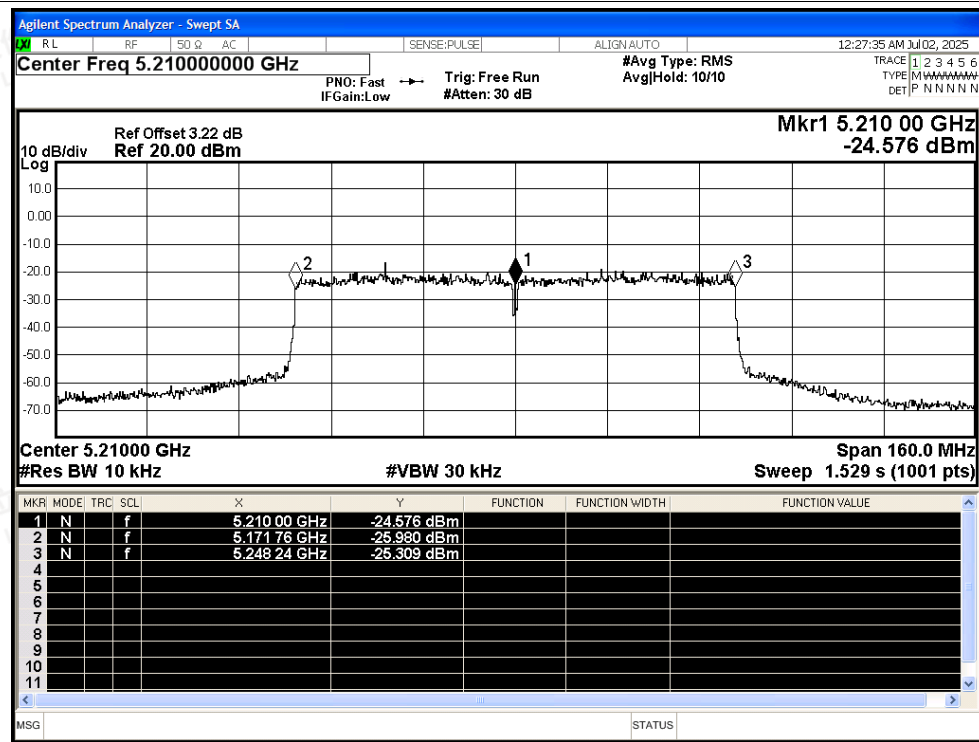

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5180	0	0	25	Pass
NVNT	a	5200	Ant3	5200	0	0	25	Pass
NVNT	a	5240	Ant3	5240	0	0	25	Pass
NVNT	n20	5180	Ant3	5180	0	0	25	Pass
NVNT	n20	5200	Ant3	5200	0	0	25	Pass
NVNT	n20	5240	Ant3	5240	0	0	25	Pass
NVNT	n40	5190	Ant3	5190	0	0	25	Pass
NVNT	n40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant3	5200	0	0	25	Pass
NVNT	ac20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant3	5190	0	0	25	Pass
NVNT	ac40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass
NVNT	ax20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant3	5240.02	20000	3.82	25	Pass
NVNT	ax40	5190	Ant3	5190	0	0	25	Pass
NVNT	ax40	5230	Ant3	5230	0	0	25	Pass
NVNT	ax80	5210	Ant3	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

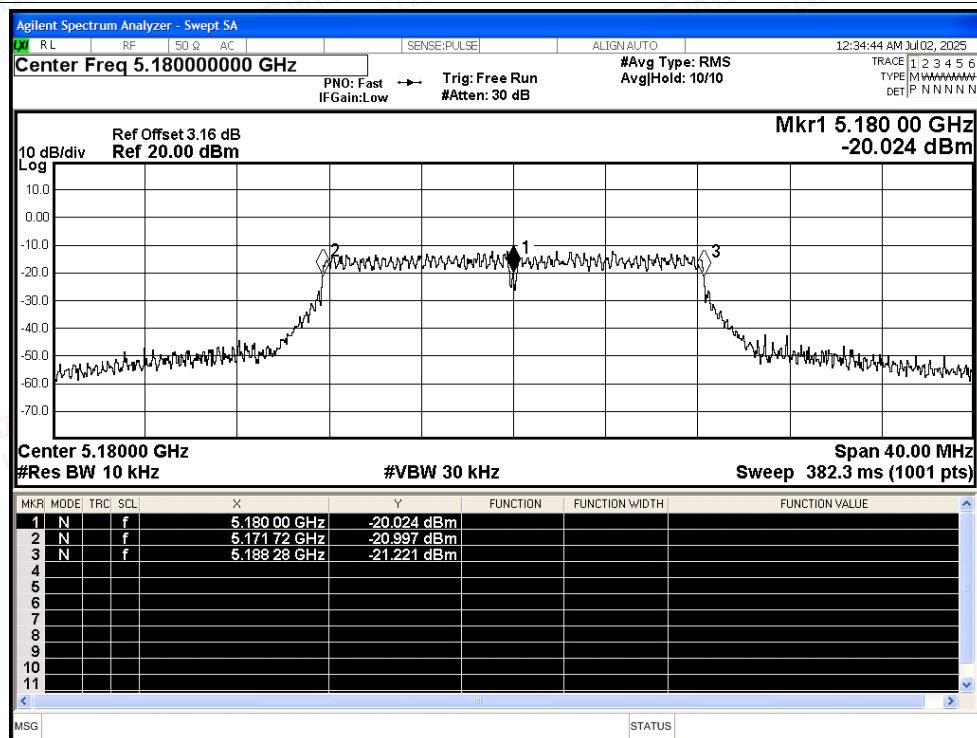

Freq. Stability NVNT a 5200MHz Ant3

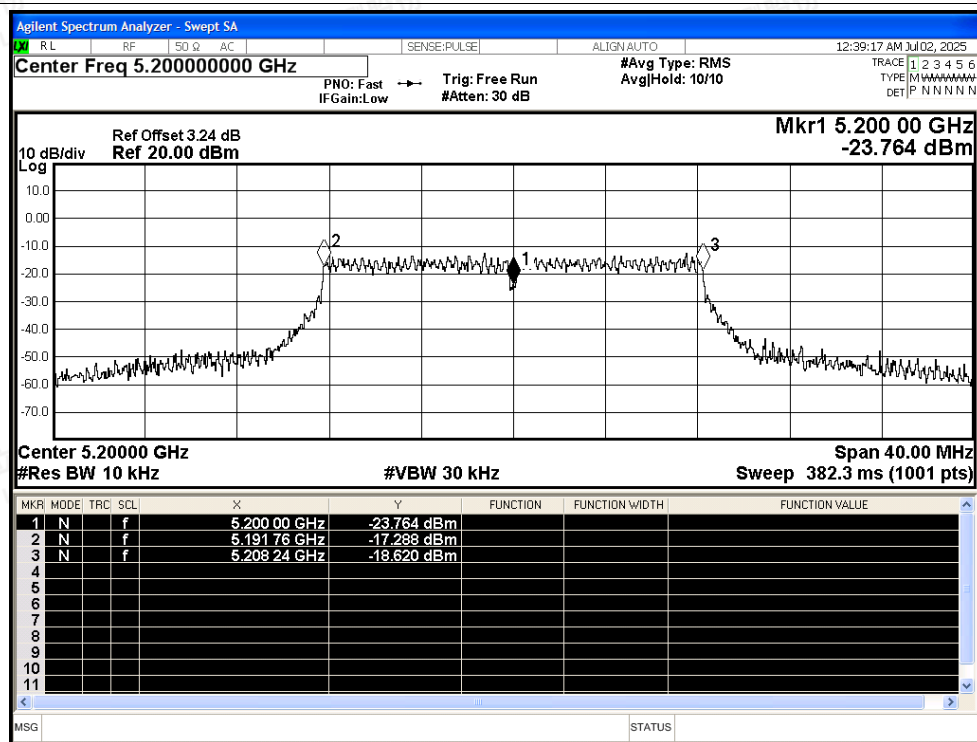

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant3

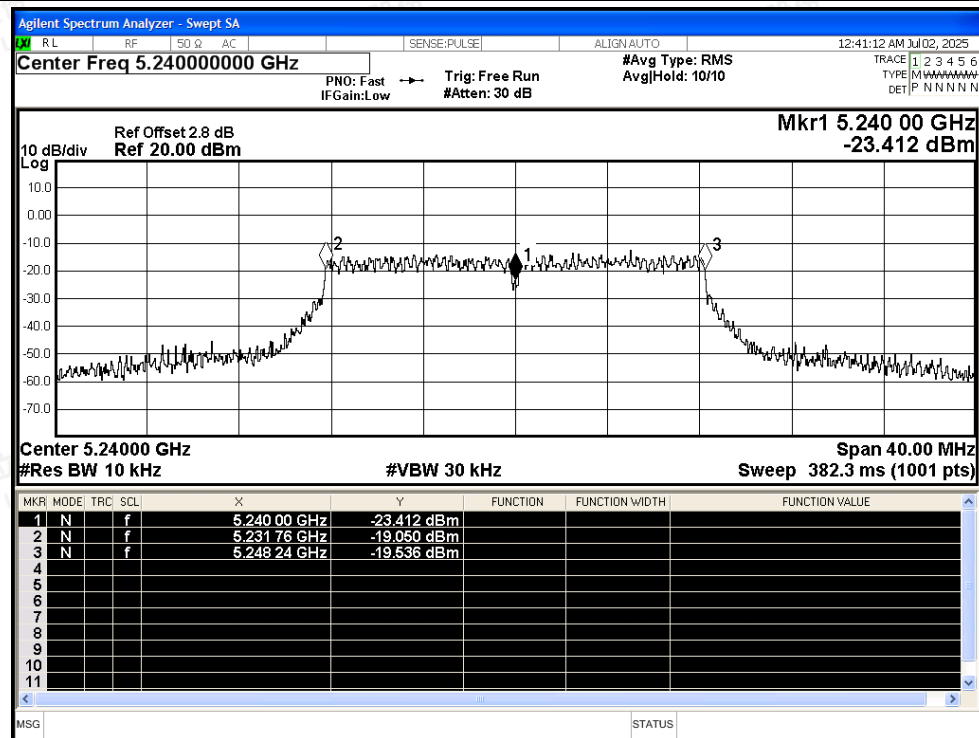

Freq. Stability NVNT n20 5180MHz Ant3

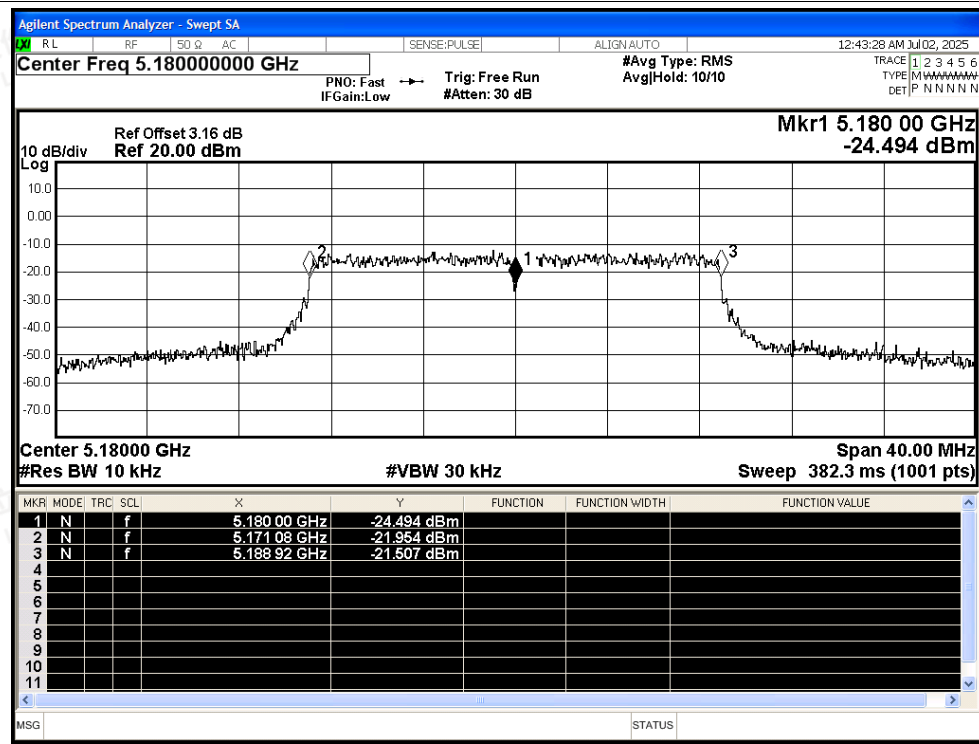

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant3

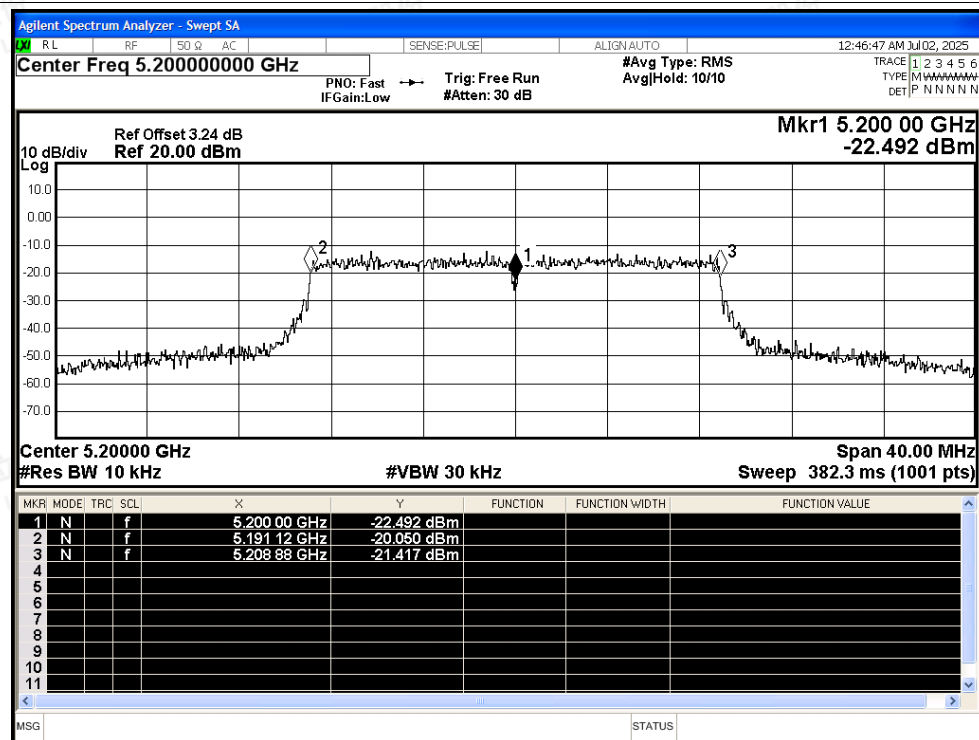

Freq. Stability NVNT n20 5240MHz Ant3

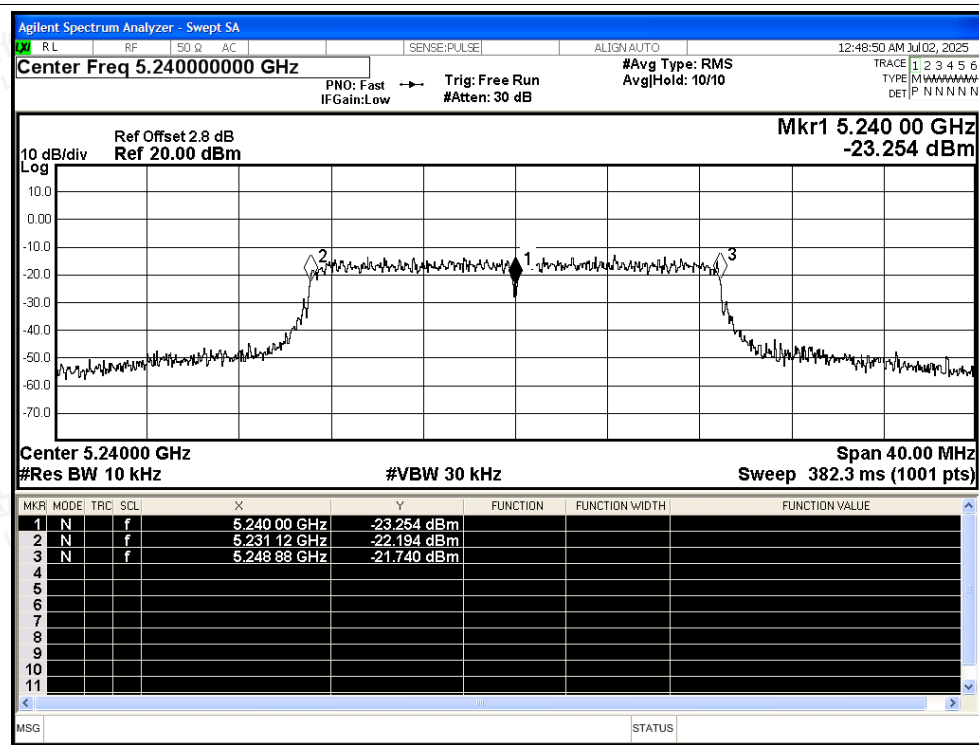

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant3

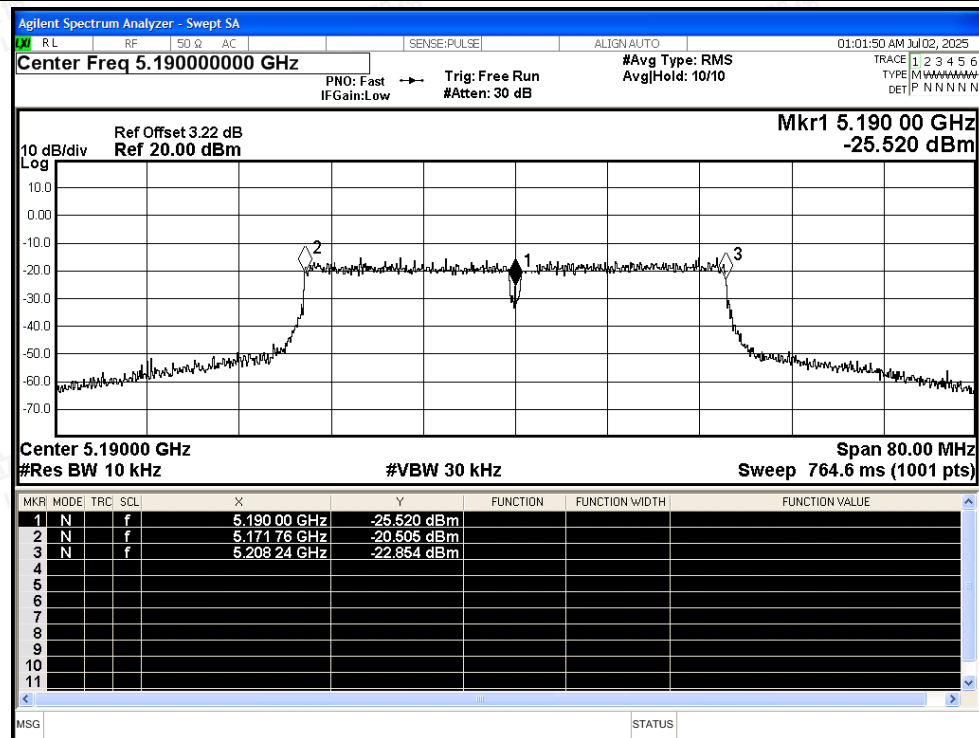

Freq. Stability NVNT n40 5230MHz Ant3

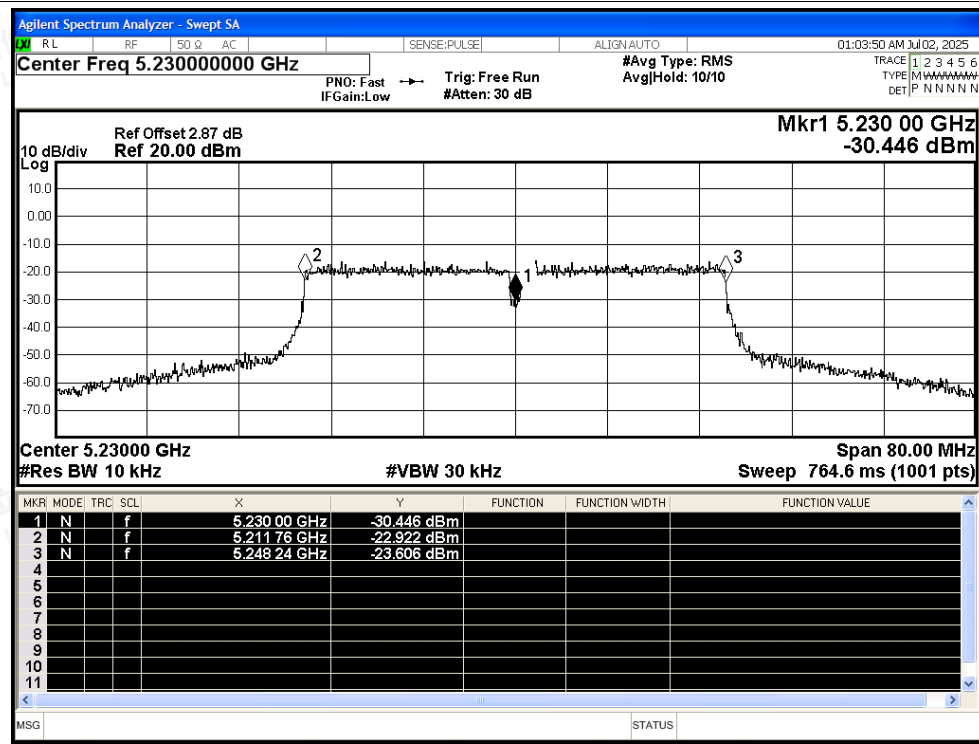

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant3

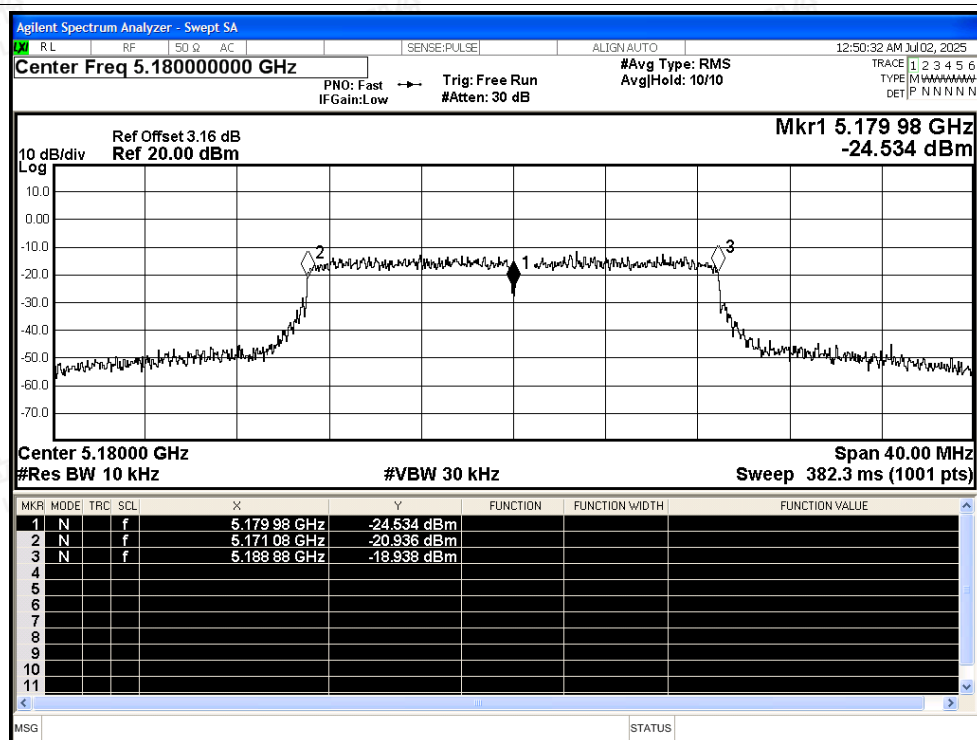

Freq. Stability NVNT ac20 5200MHz Ant3

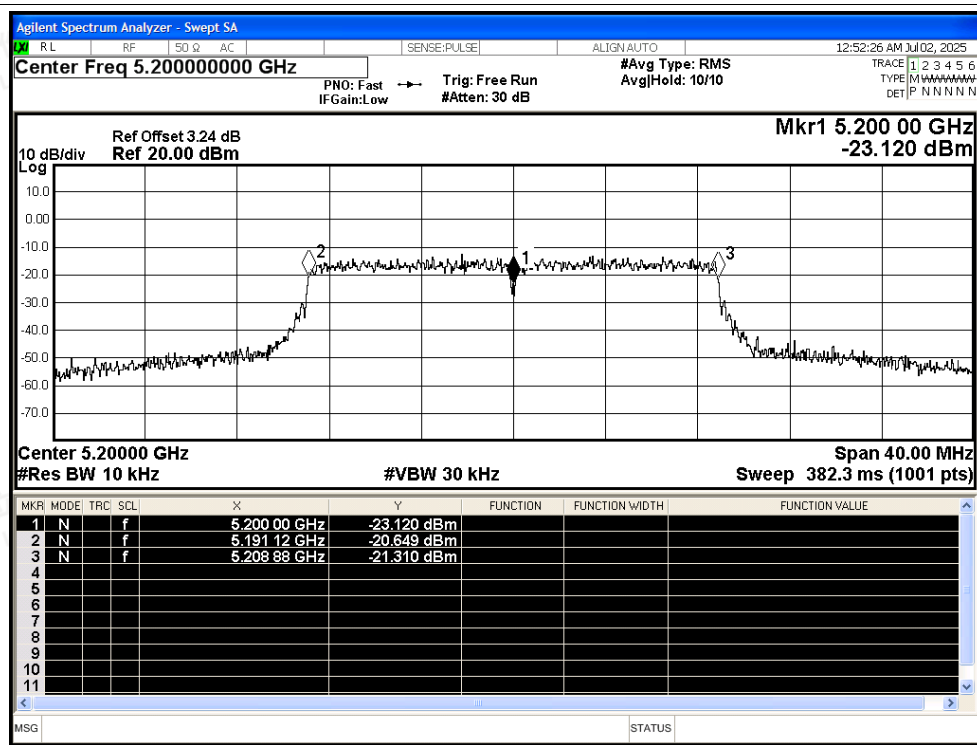

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant3

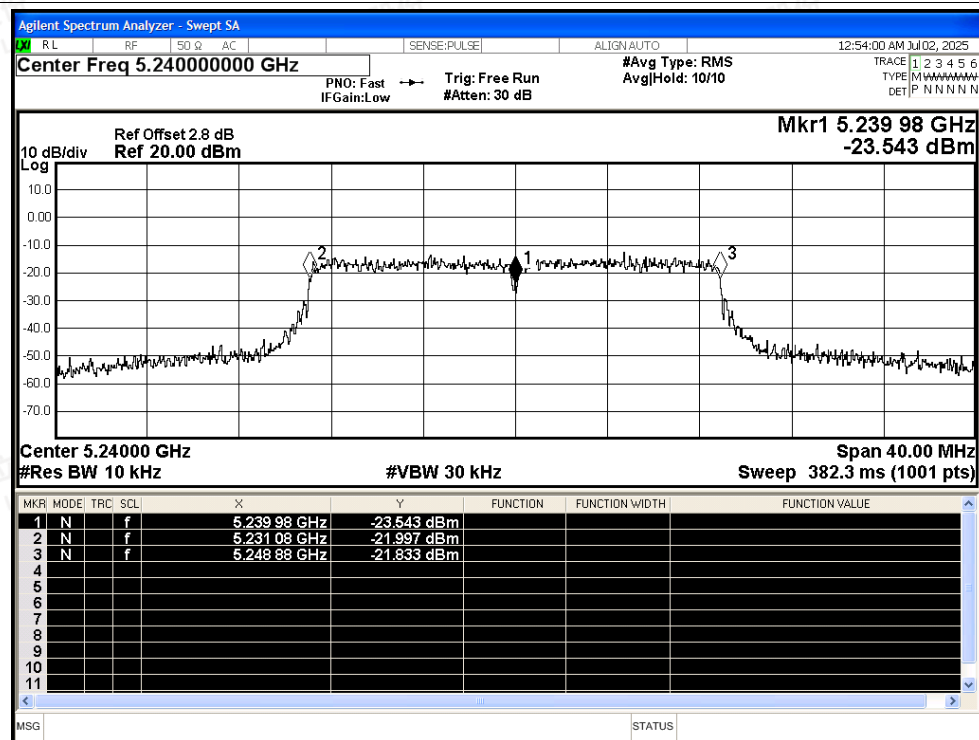

Freq. Stability NVNT ac40 5190MHz Ant3

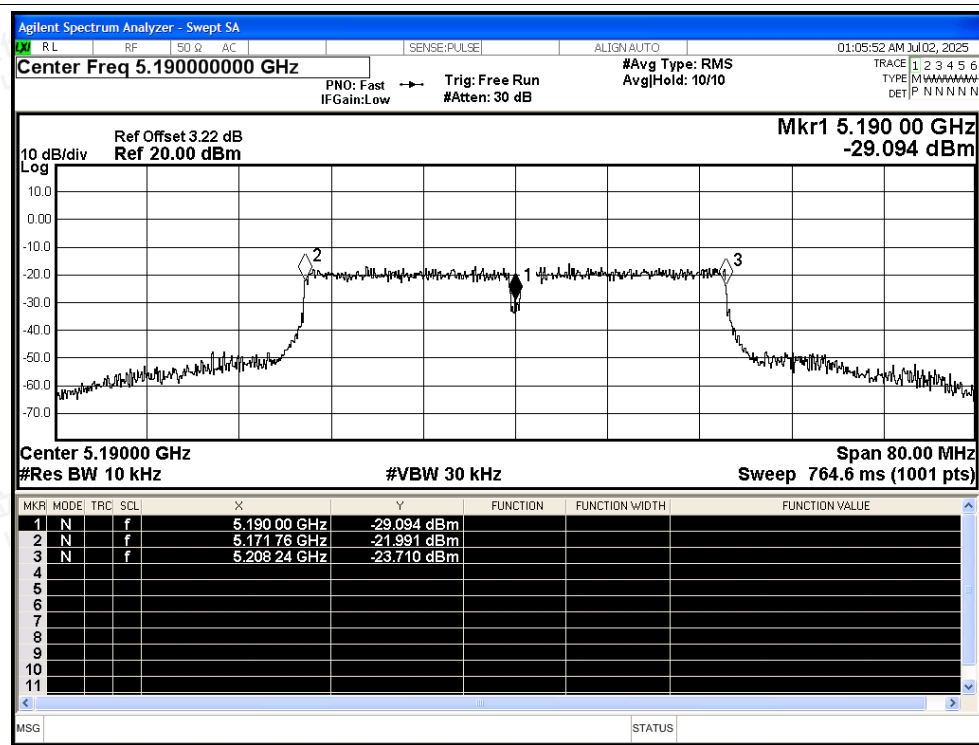

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant3

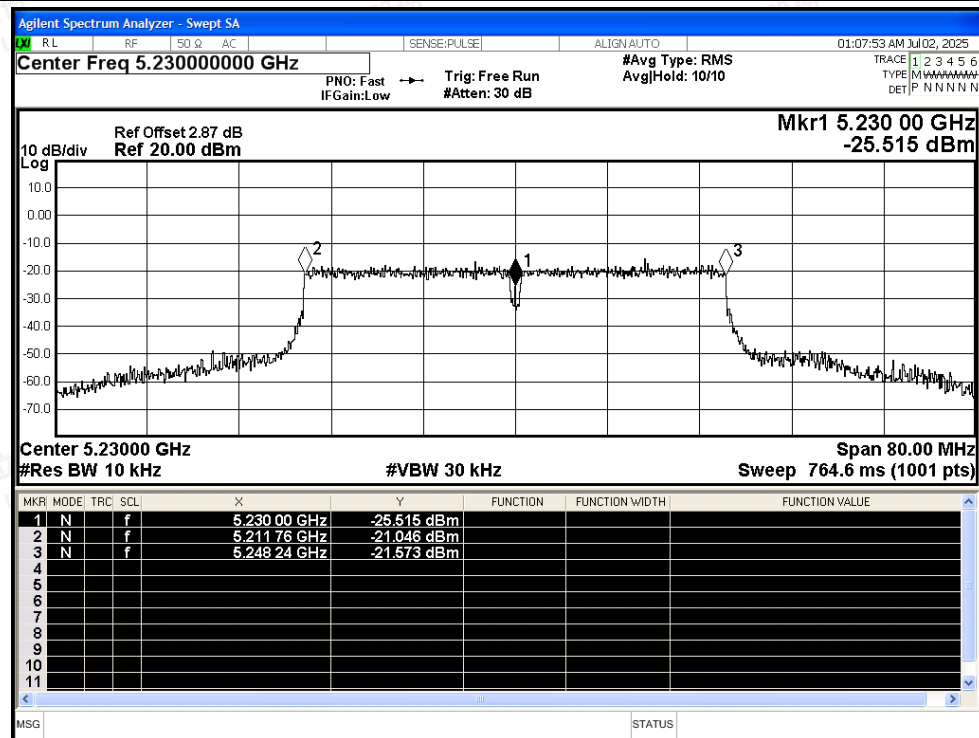

Freq. Stability NVNT ac80 5210MHz Ant3

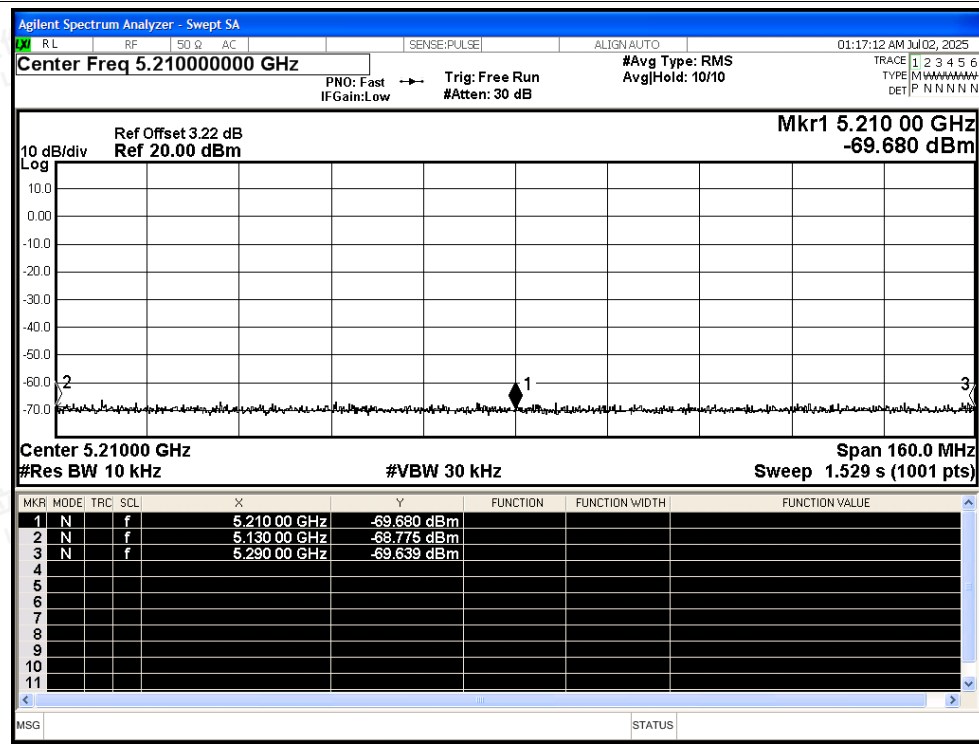

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant3

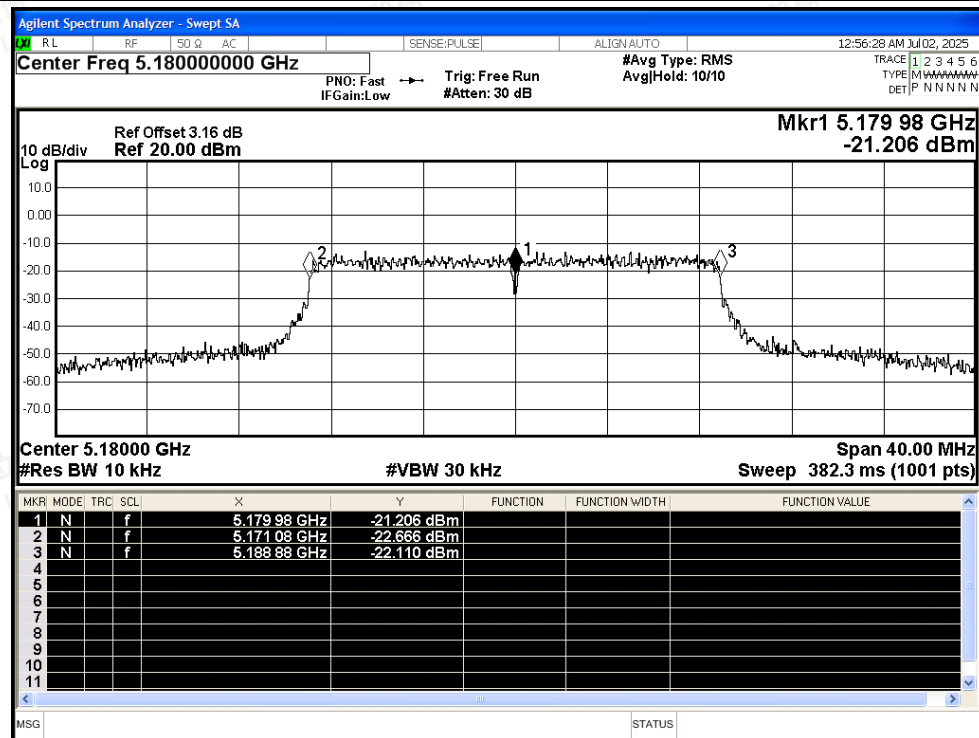

Freq. Stability NVNT ax20 5200MHz Ant3

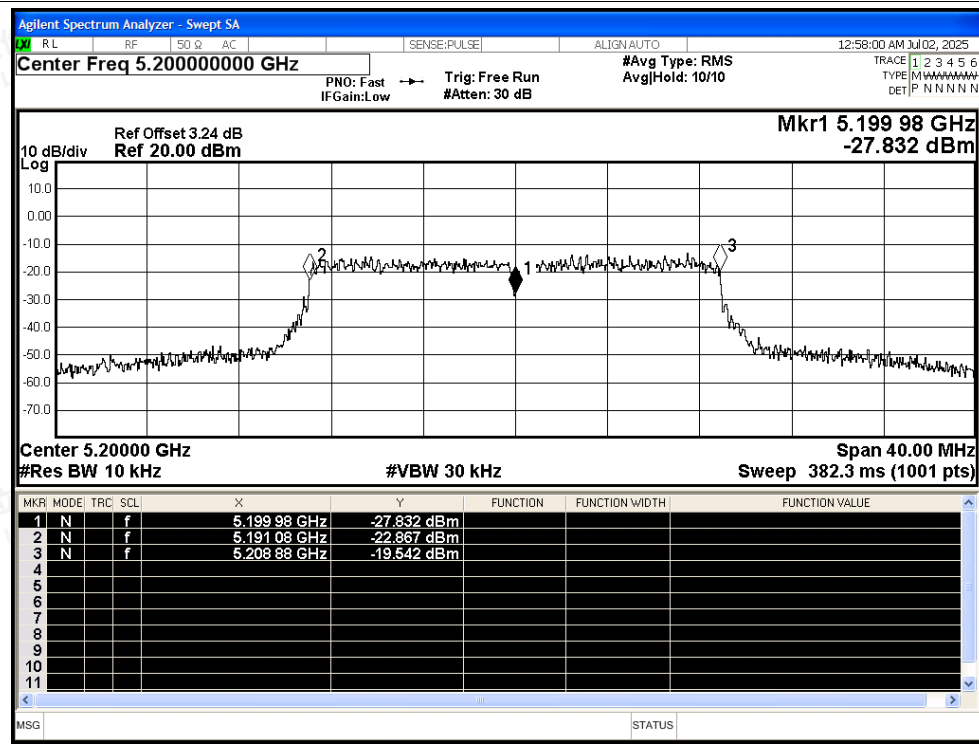

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant3

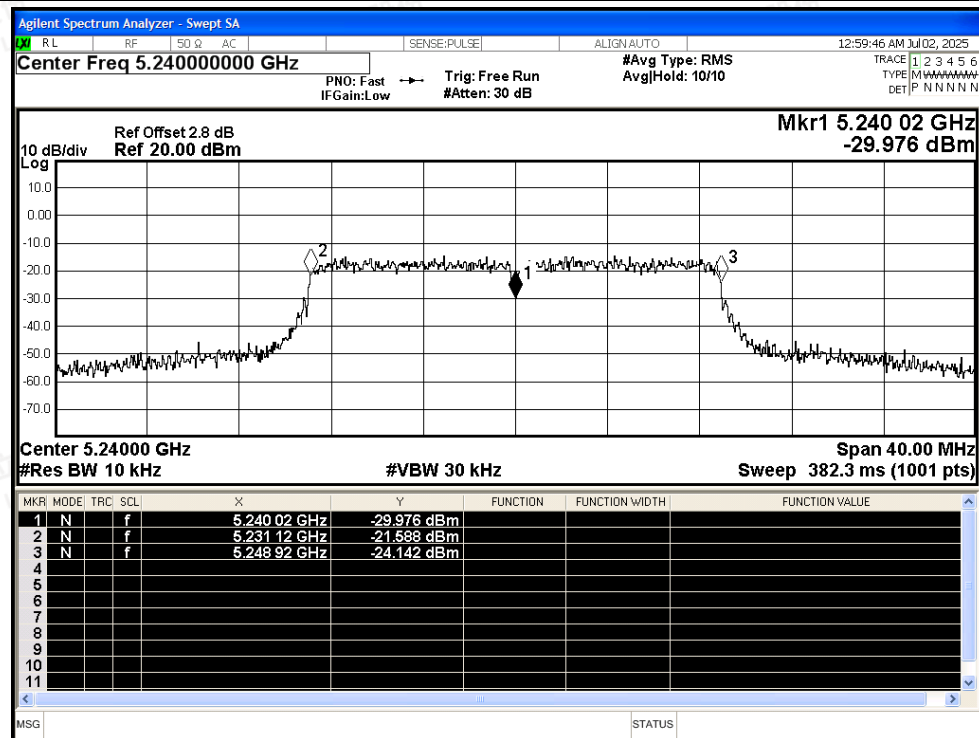

Freq. Stability NVNT ax40 5190MHz Ant3

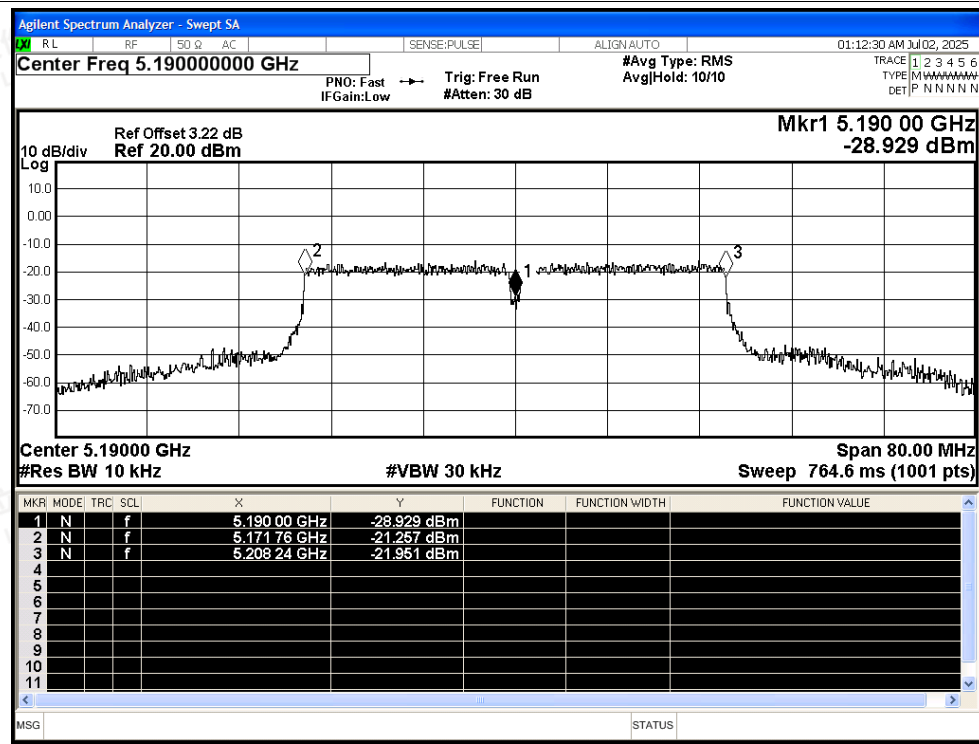

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant3

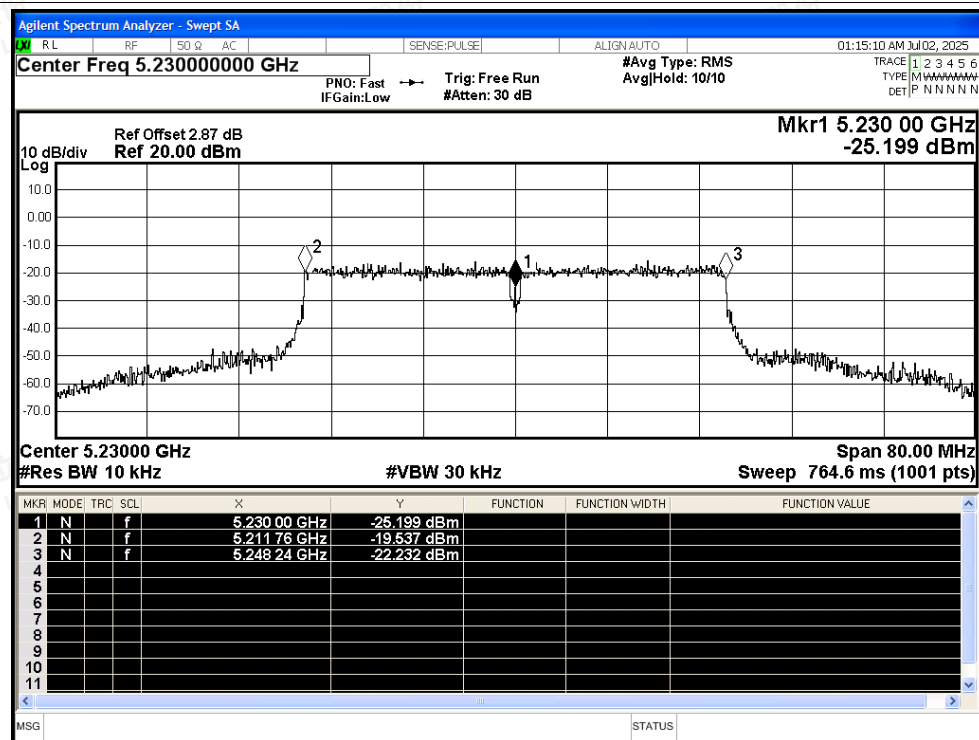

Freq. Stability NVNT ax80 5210MHz Ant3

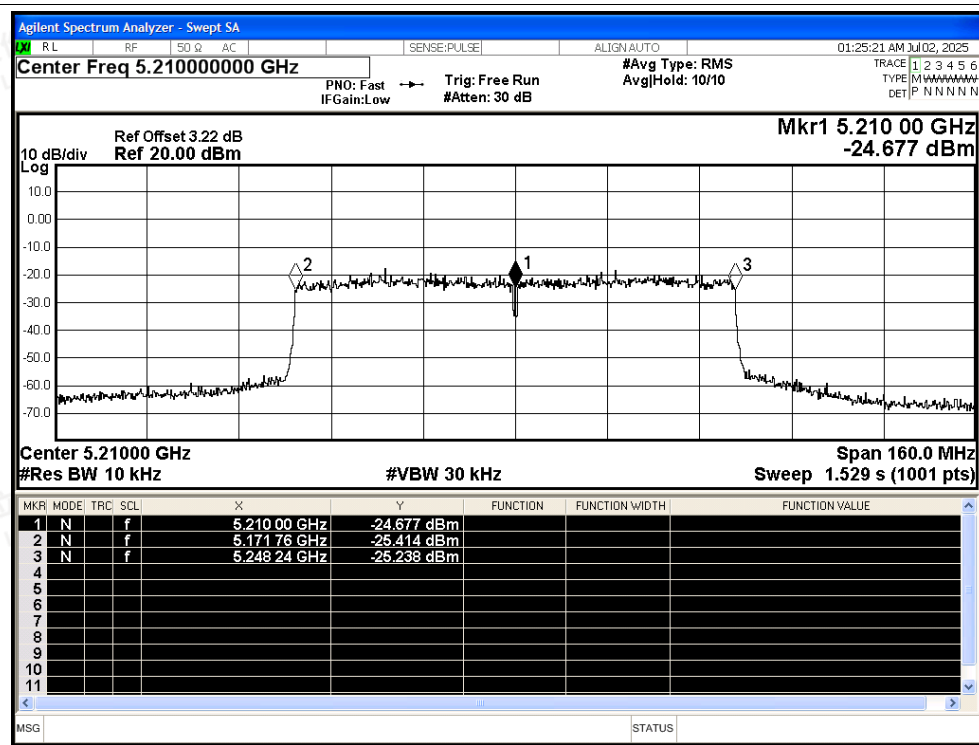

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant5	5180	0	0	25	Pass
NVNT	a	5200	Ant5	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant5	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant5	5180	0	0	25	Pass
NVNT	n20	5200	Ant5	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant5	5239.96	-40000	-7.63	25	Pass
NVNT	n40	5190	Ant5	5190	0	0	25	Pass
NVNT	n40	5230	Ant5	5230	0	0	25	Pass
NVNT	ac20	5180	Ant5	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant5	5200	0	0	25	Pass
NVNT	ac20	5240	Ant5	5240	0	0	25	Pass
NVNT	ac40	5190	Ant5	5190	0	0	25	Pass
NVNT	ac40	5230	Ant5	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant5	5210	0	0	25	Pass
NVNT	ax20	5180	Ant5	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant5	5200	0	0	25	Pass
NVNT	ax20	5240	Ant5	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant5	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant5	5230	0	0	25	Pass
NVNT	ax80	5210	Ant5	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant5

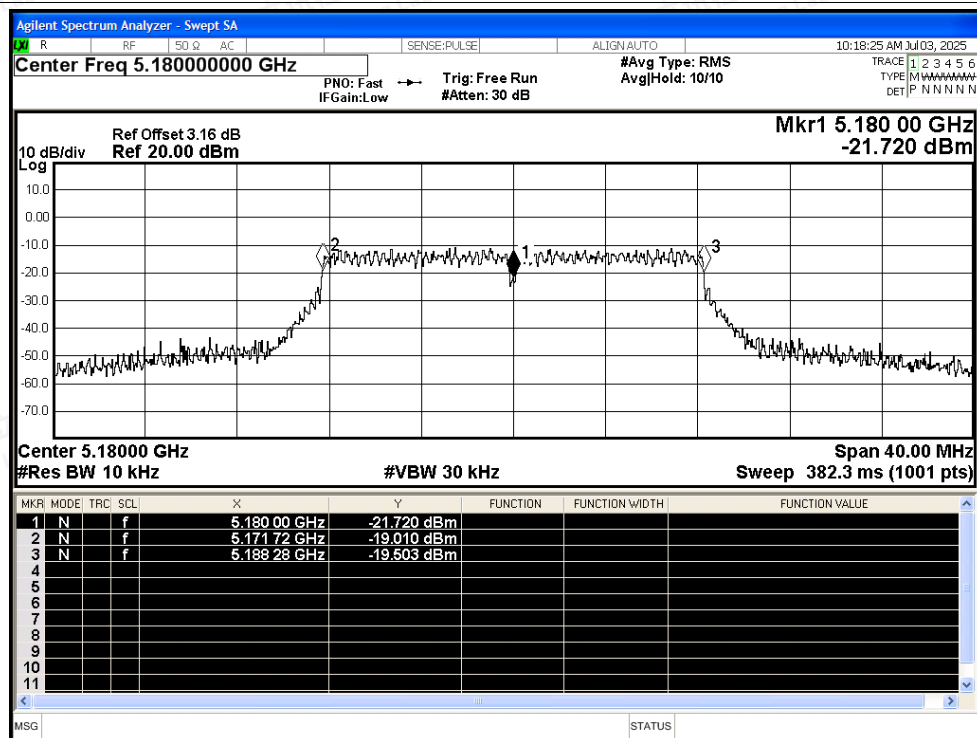

Freq. Stability NVNT a 5200MHz Ant5

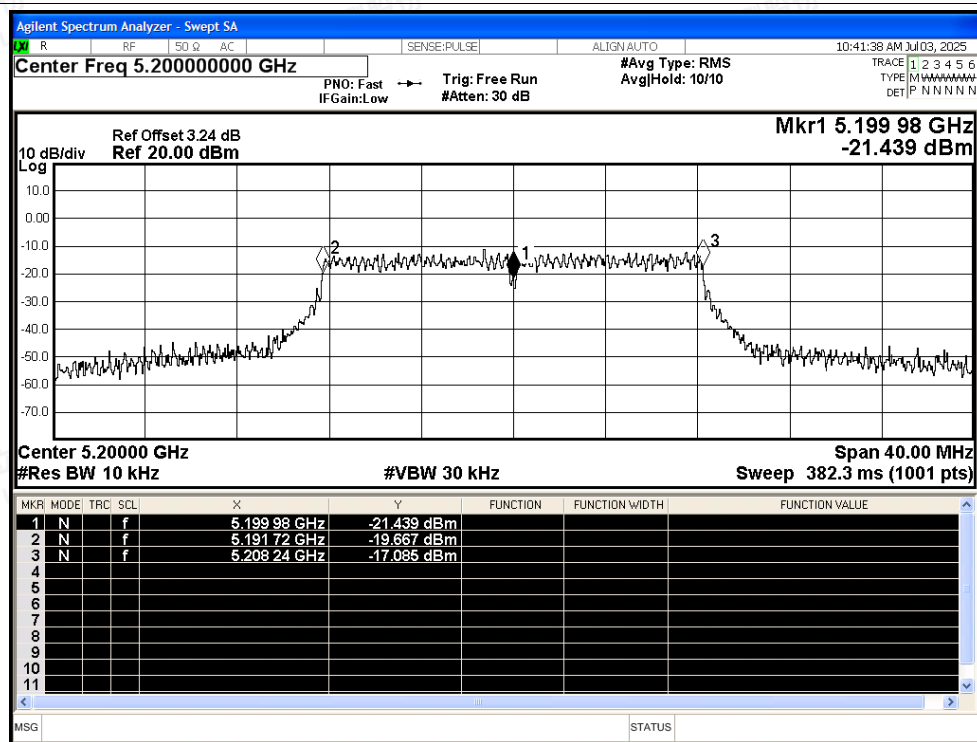

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant5

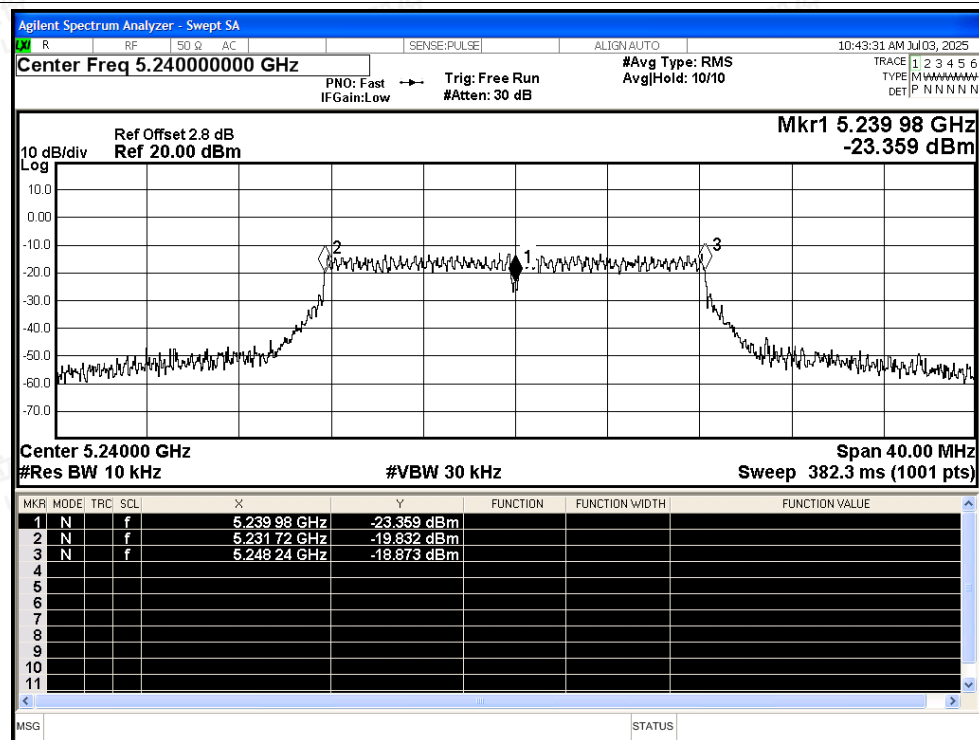

Freq. Stability NVNT n20 5180MHz Ant5


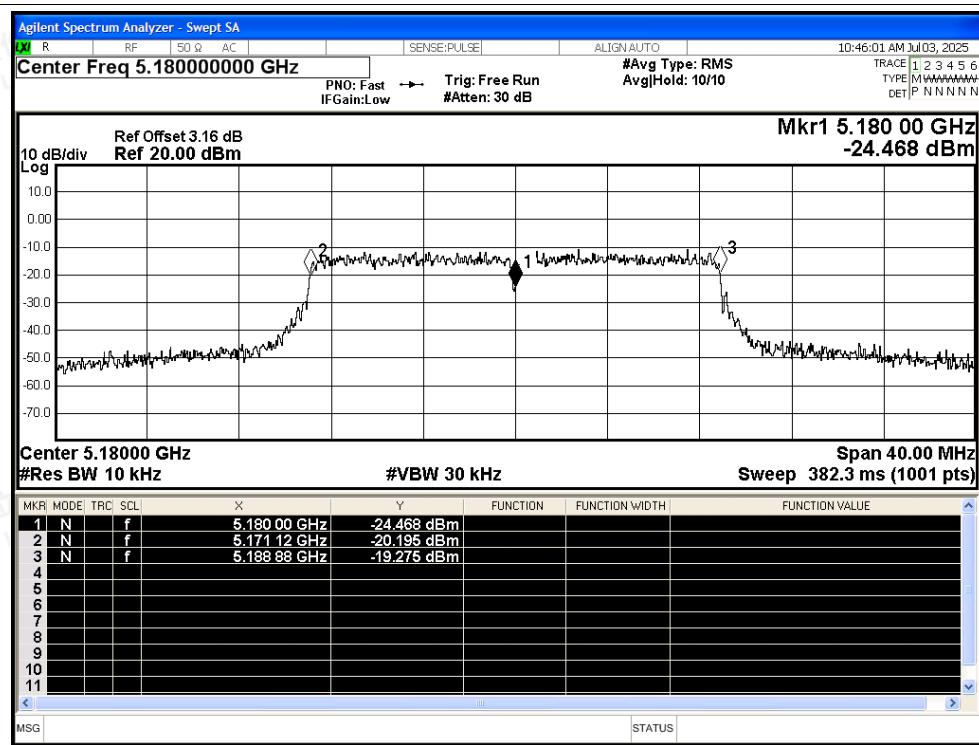


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

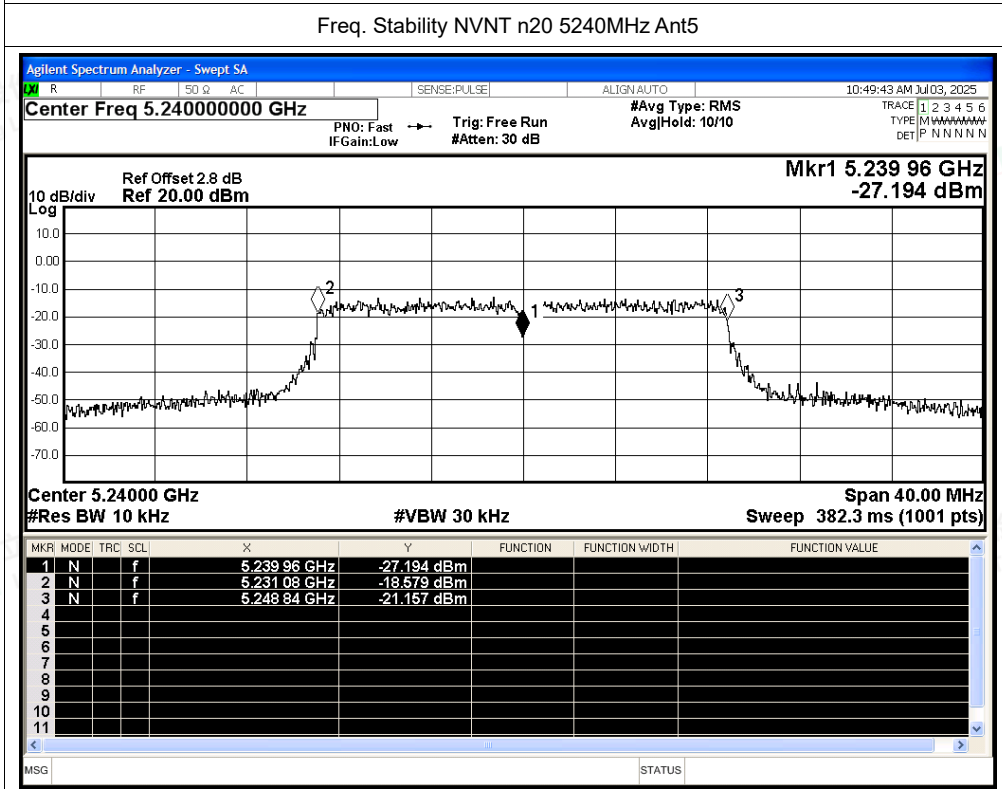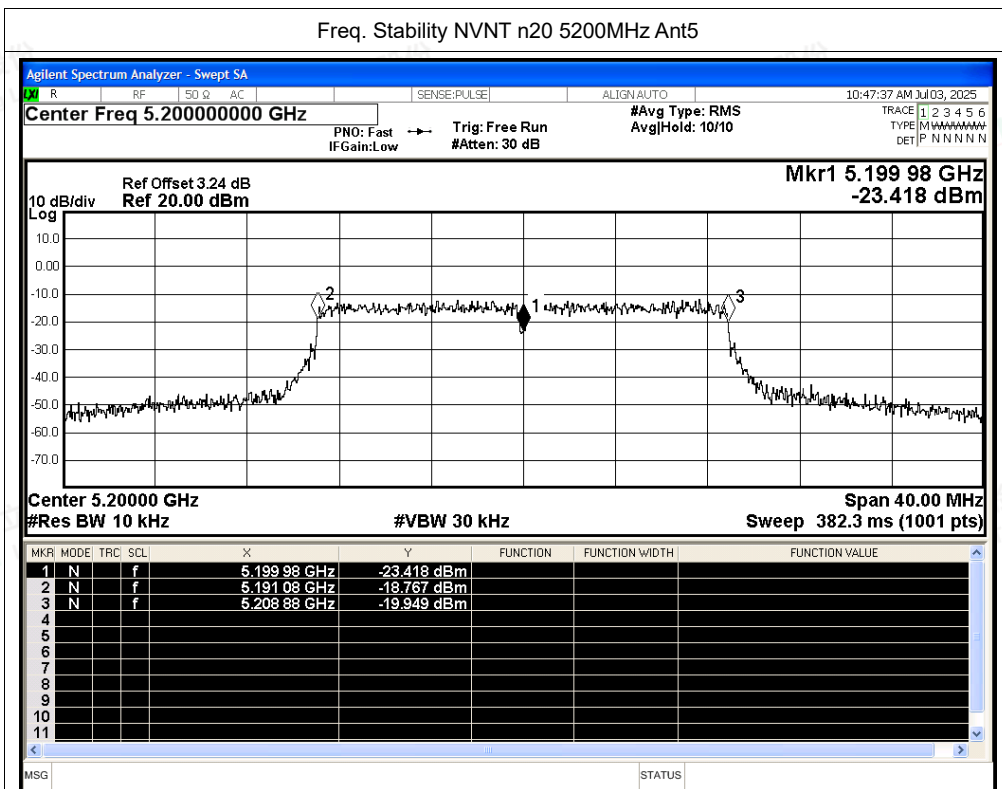

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant5

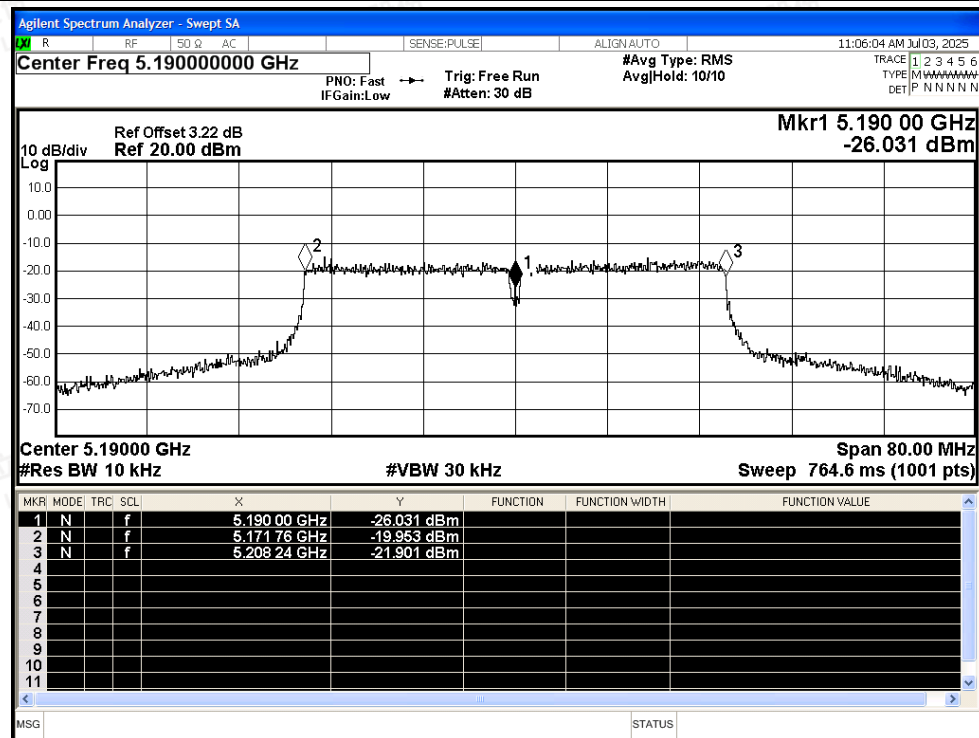

Freq. Stability NVNT n40 5230MHz Ant5

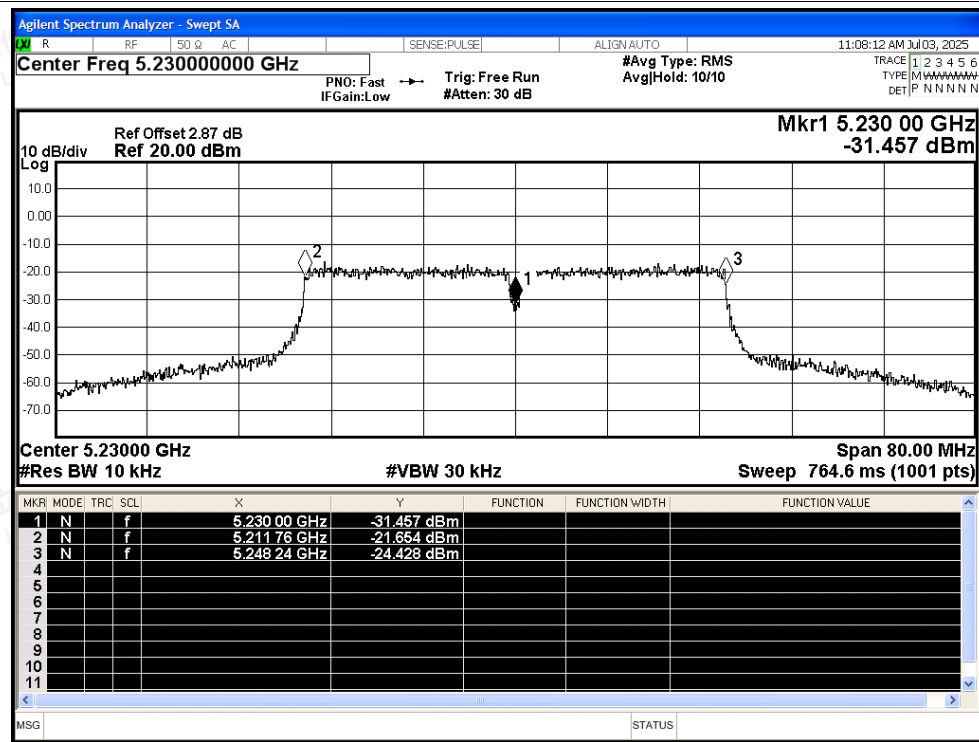

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant5

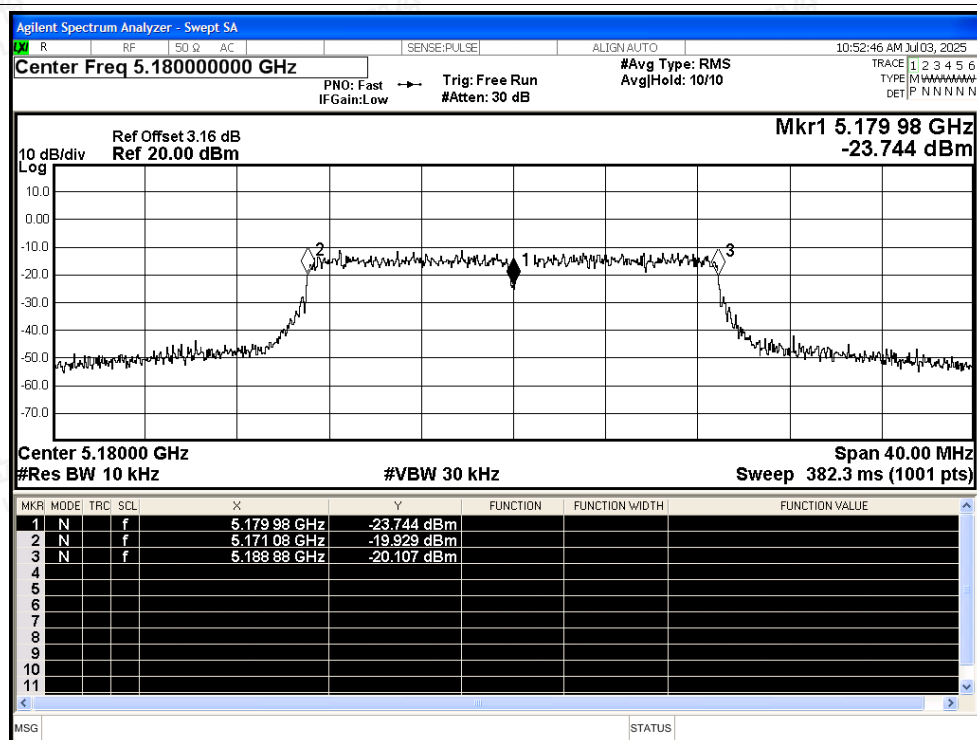

Freq. Stability NVNT ac20 5200MHz Ant5

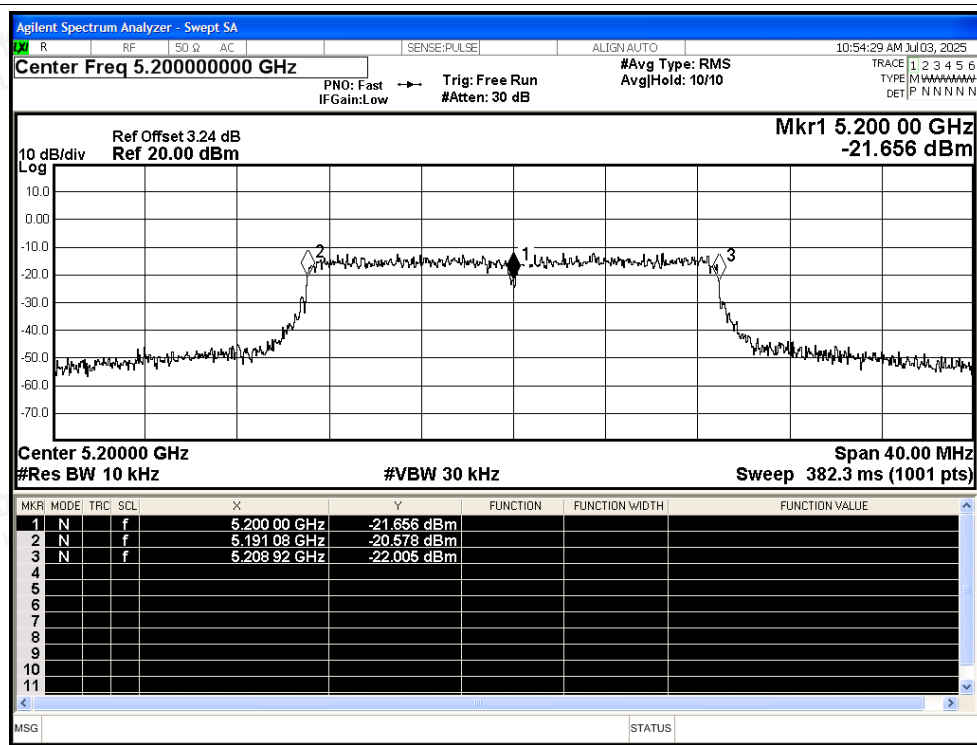

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant5

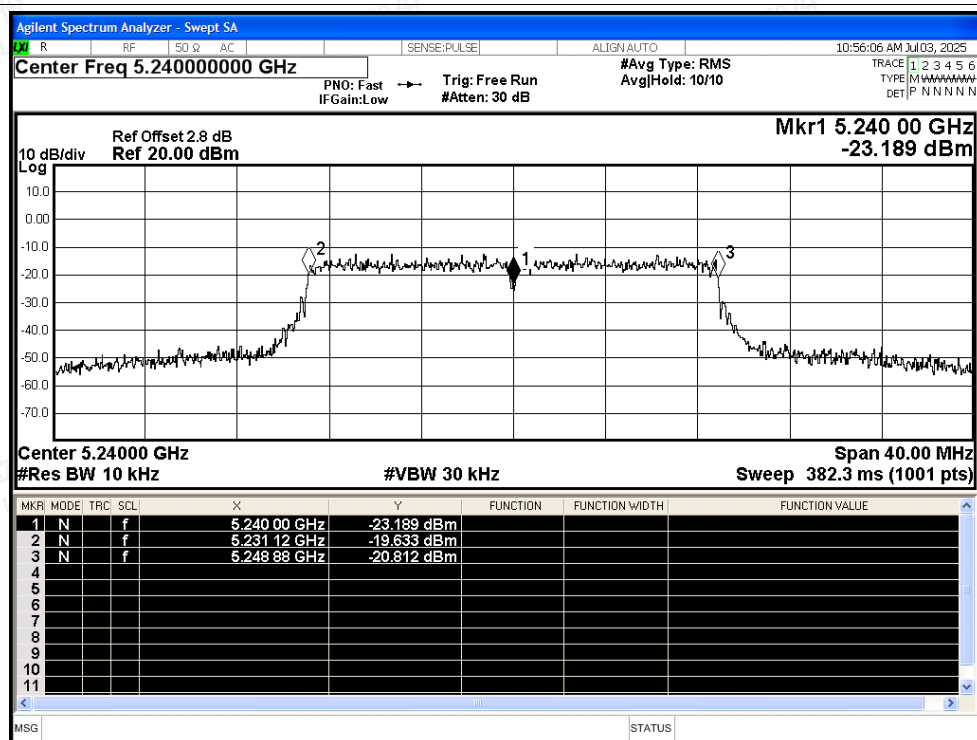

Freq. Stability NVNT ac40 5190MHz Ant5

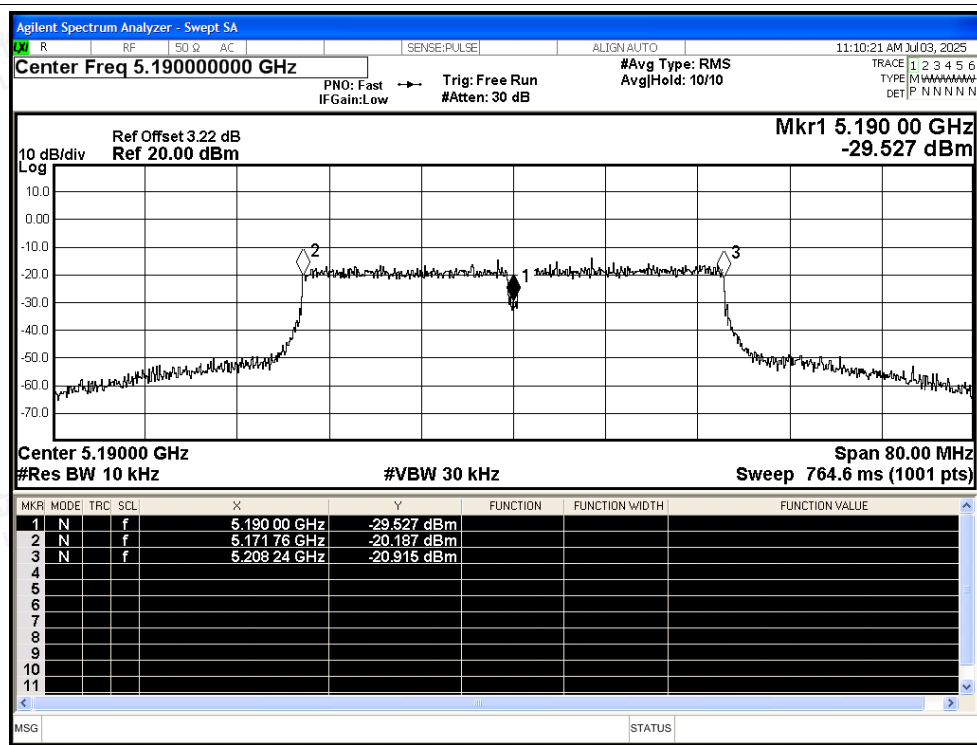

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant5

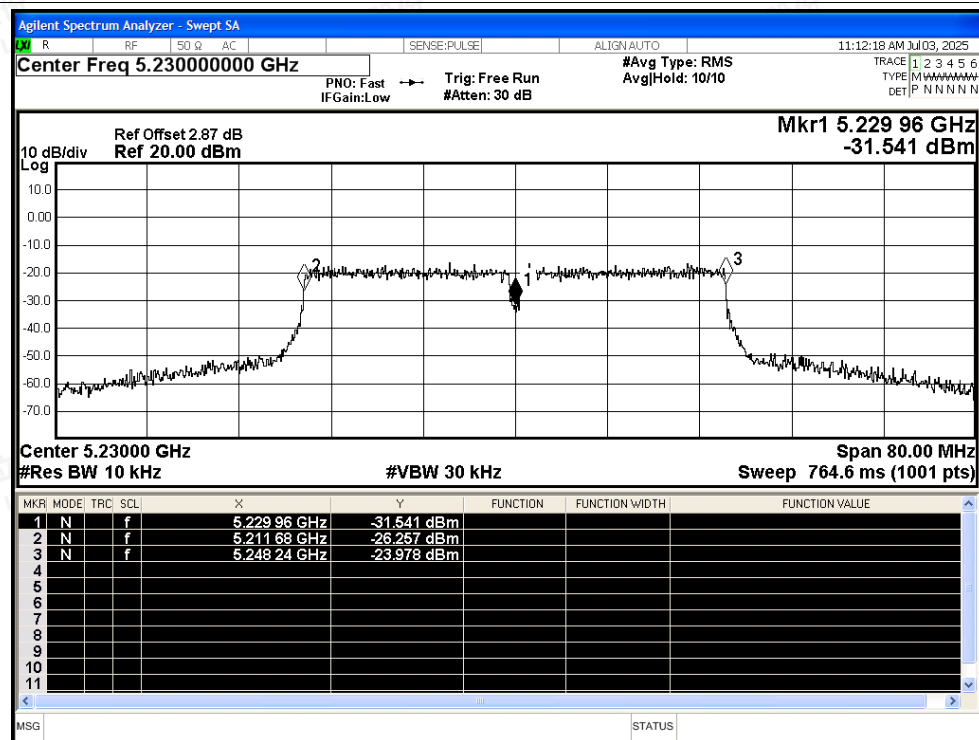

Freq. Stability NVNT ac80 5210MHz Ant5

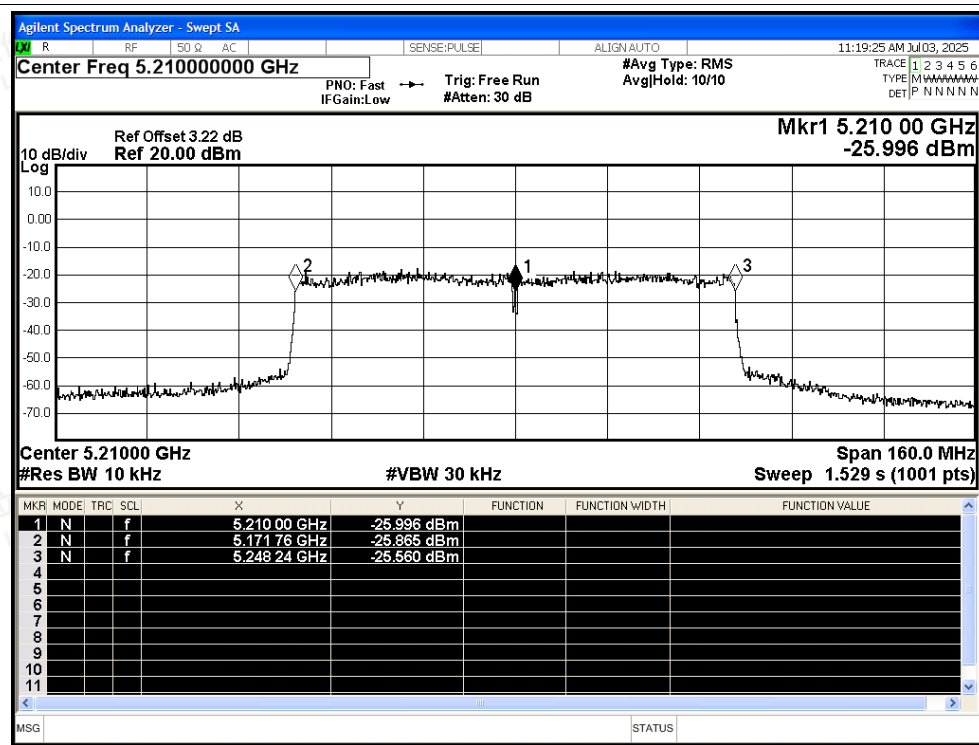

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant5

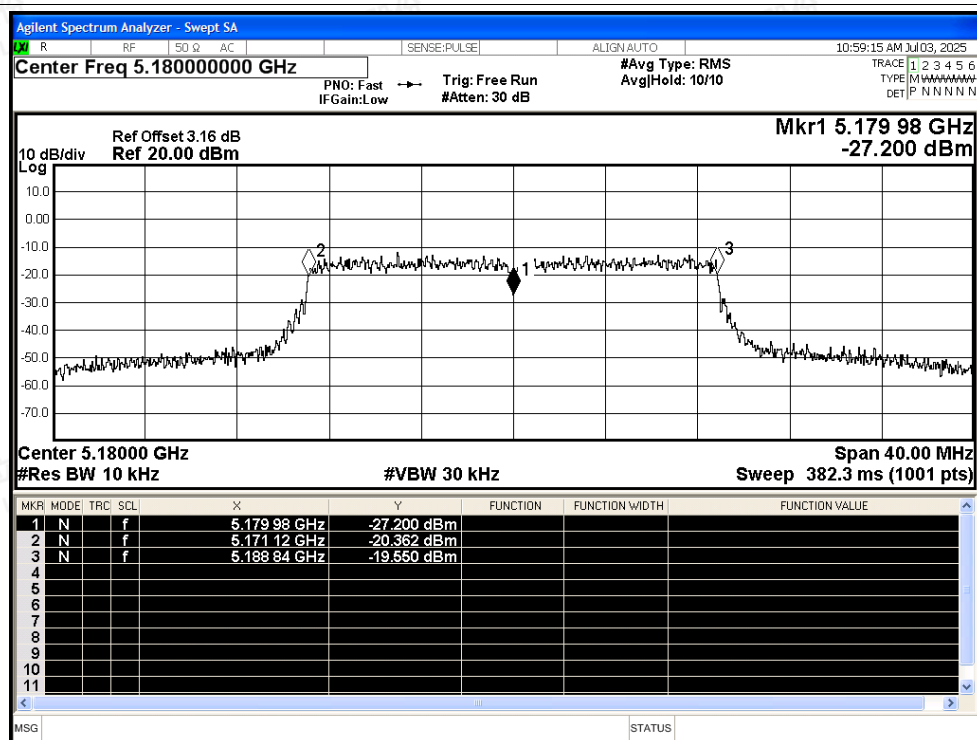

Freq. Stability NVNT ax20 5200MHz Ant5

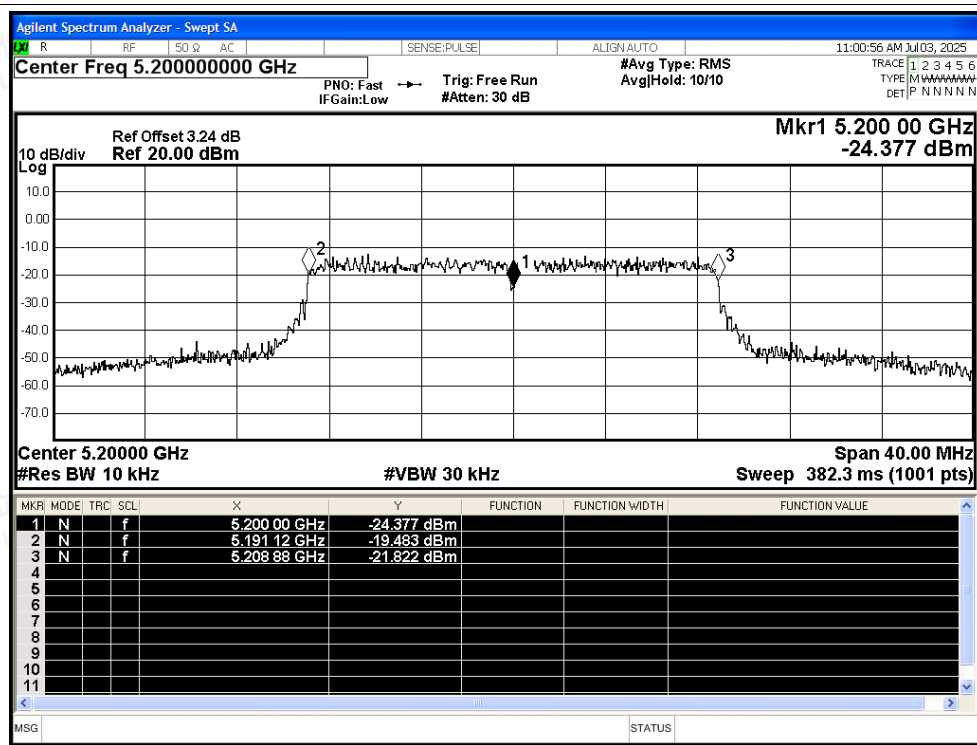

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant5

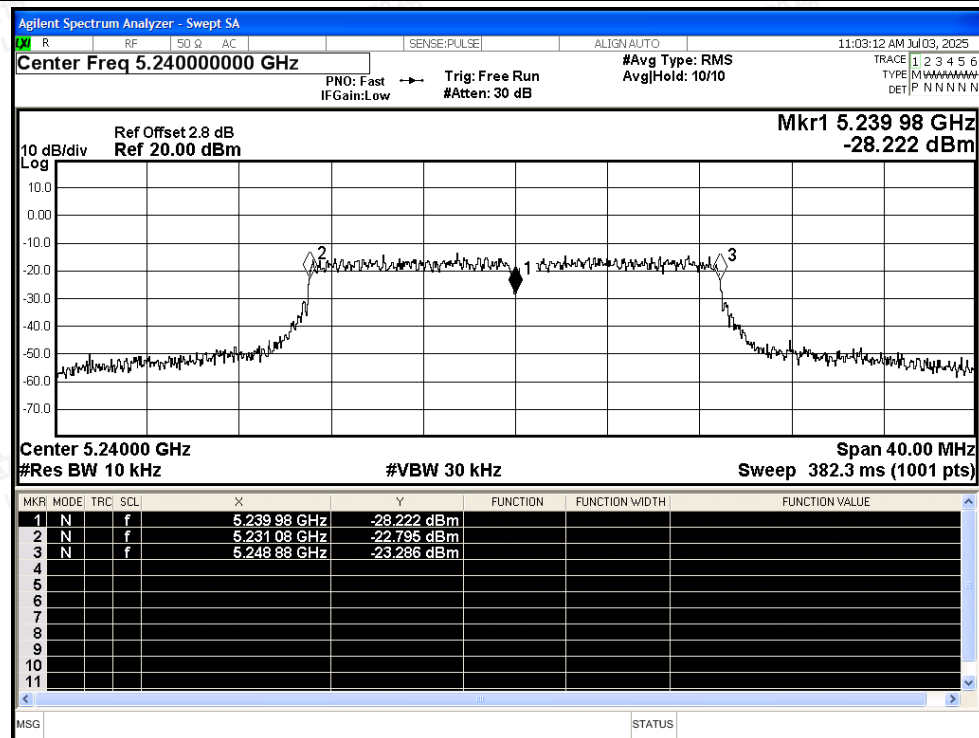

Freq. Stability NVNT ax40 5190MHz Ant5

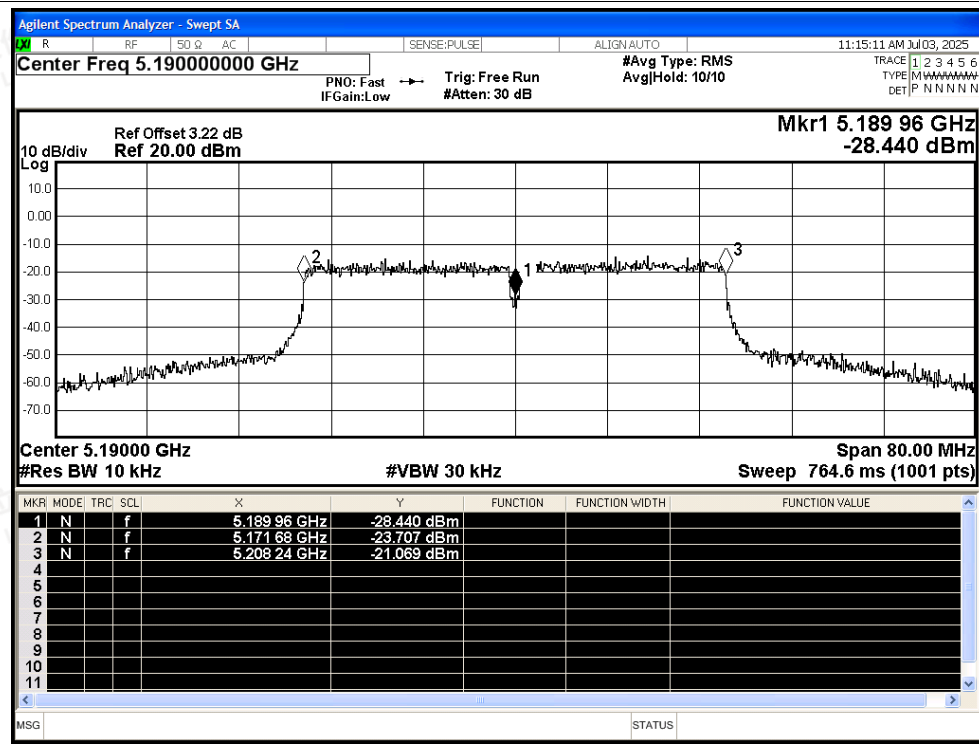

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant5

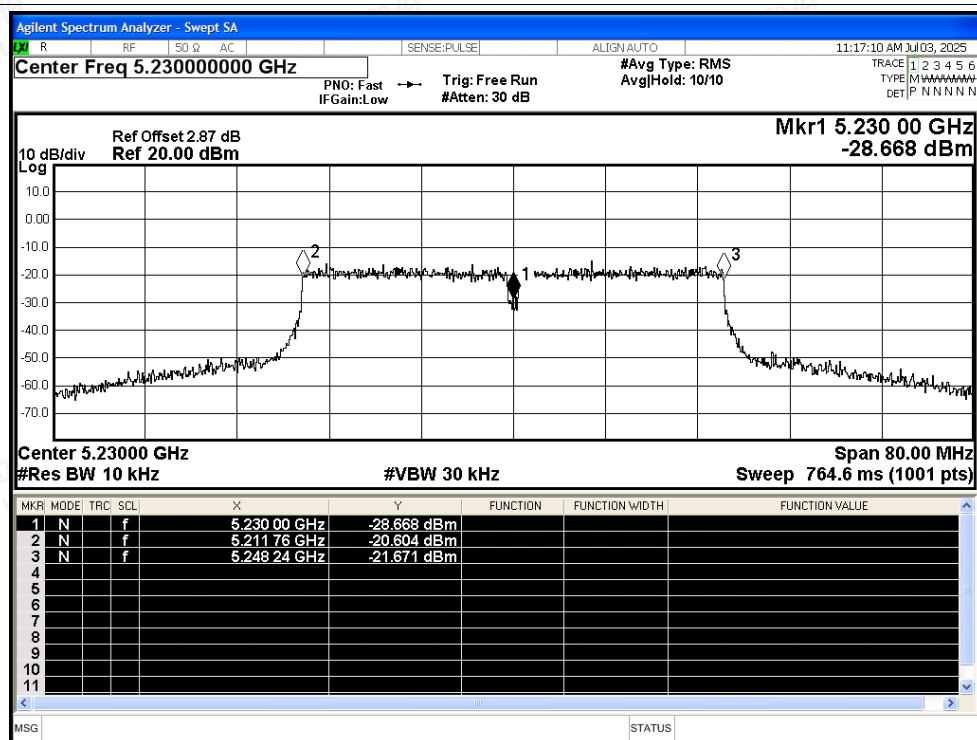

Freq. Stability NVNT ax80 5210MHz Ant5

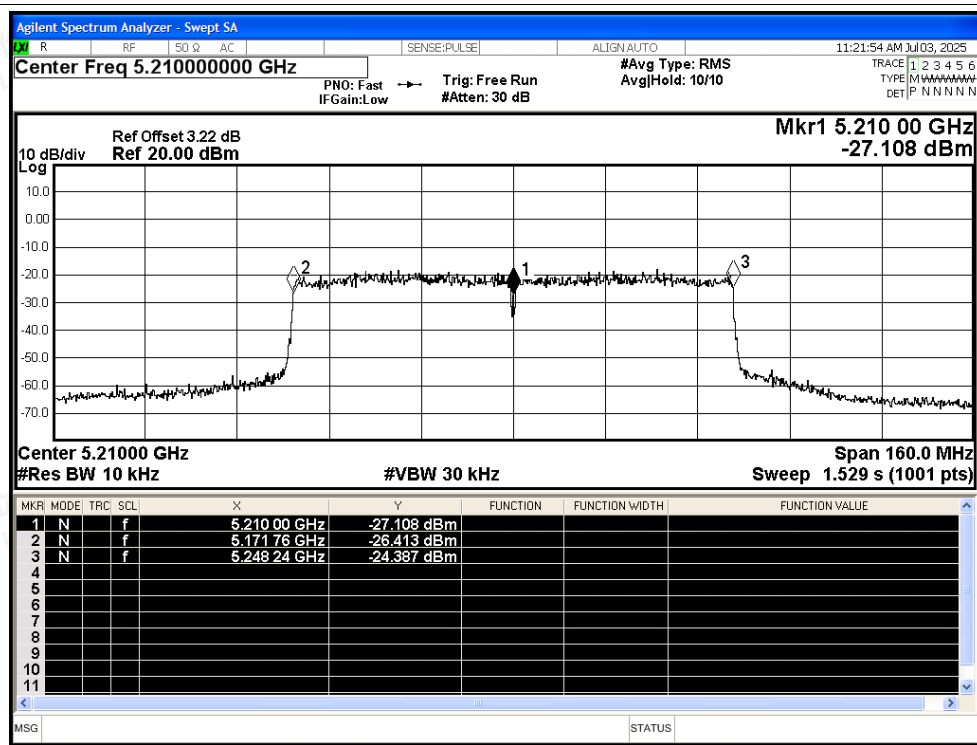

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant6	5180	0	0	25	Pass
NVNT	a	5200	Ant6	5200	0	0	25	Pass
NVNT	a	5240	Ant6	5240	0	0	25	Pass
NVNT	n20	5180	Ant6	5180	0	0	25	Pass
NVNT	n20	5200	Ant6	5200	0	0	25	Pass
NVNT	n20	5240	Ant6	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant6	5190	0	0	25	Pass
NVNT	n40	5230	Ant6	5230	0	0	25	Pass
NVNT	ac20	5180	Ant6	5180	0	0	25	Pass
NVNT	ac20	5200	Ant6	5200	0	0	25	Pass
NVNT	ac20	5240	Ant6	5240	0	0	25	Pass
NVNT	ac40	5190	Ant6	5190	0	0	25	Pass
NVNT	ac40	5230	Ant6	5230	0	0	25	Pass
NVNT	ac80	5210	Ant6	5210	0	0	25	Pass
NVNT	ax20	5180	Ant6	5180	0	0	25	Pass
NVNT	ax20	5200	Ant6	5200	0	0	25	Pass
NVNT	ax20	5240	Ant6	5240	0	0	25	Pass
NVNT	ax40	5190	Ant6	5190	0	0	25	Pass
NVNT	ax40	5230	Ant6	5230	0	0	25	Pass
NVNT	ax80	5210	Ant6	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant6

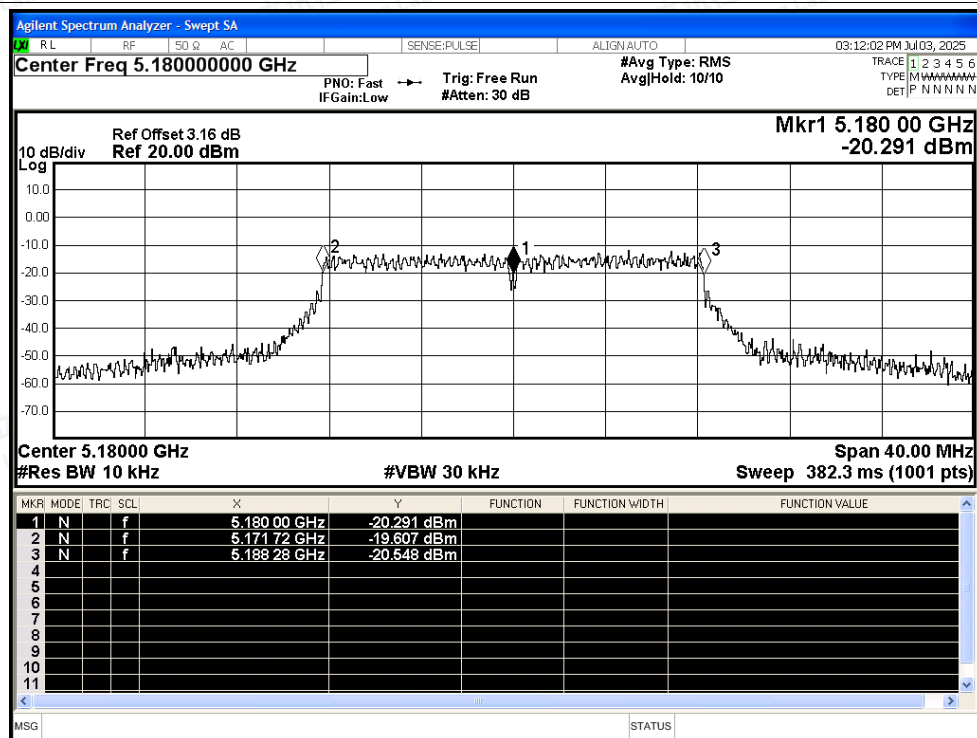

Freq. Stability NVNT a 5200MHz Ant6

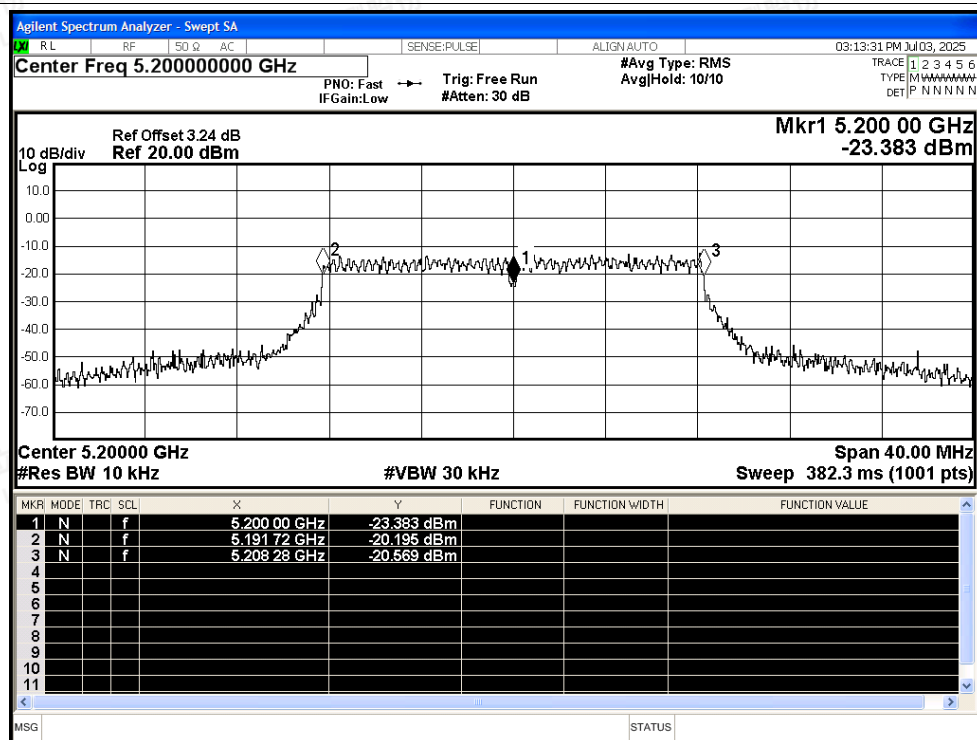

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant6

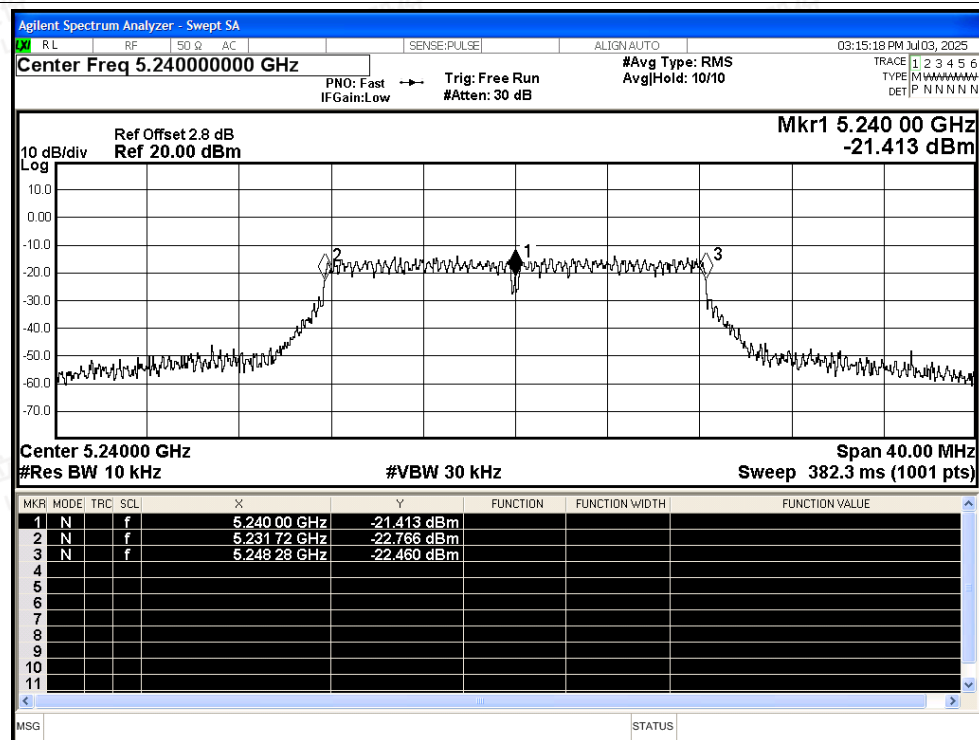

Freq. Stability NVNT n20 5180MHz Ant6

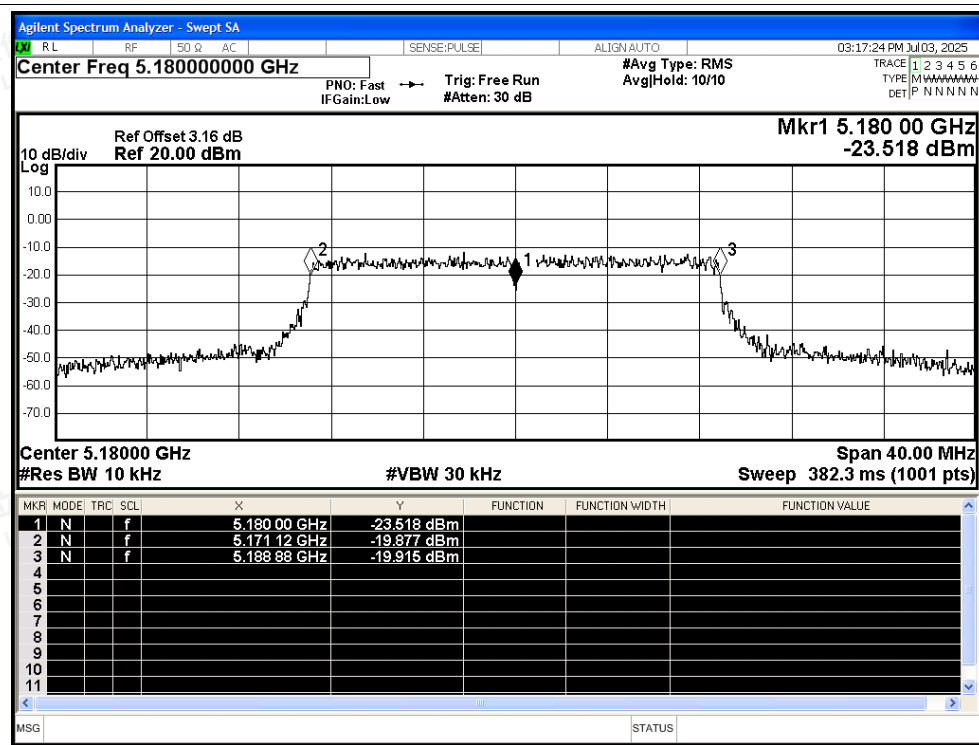

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant6

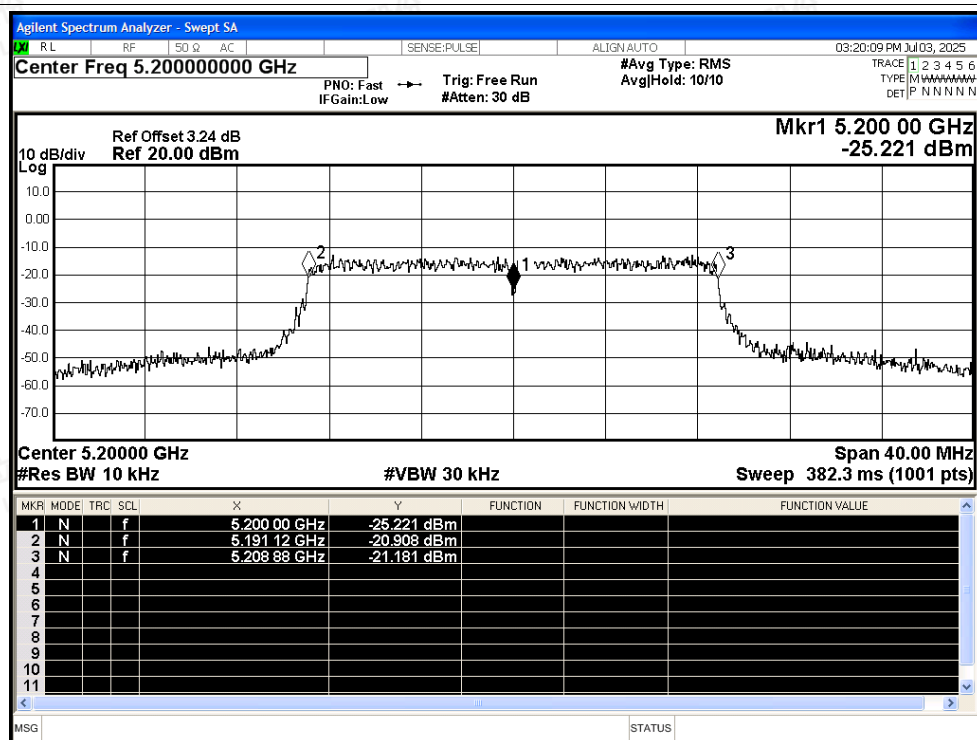

Freq. Stability NVNT n20 5240MHz Ant6

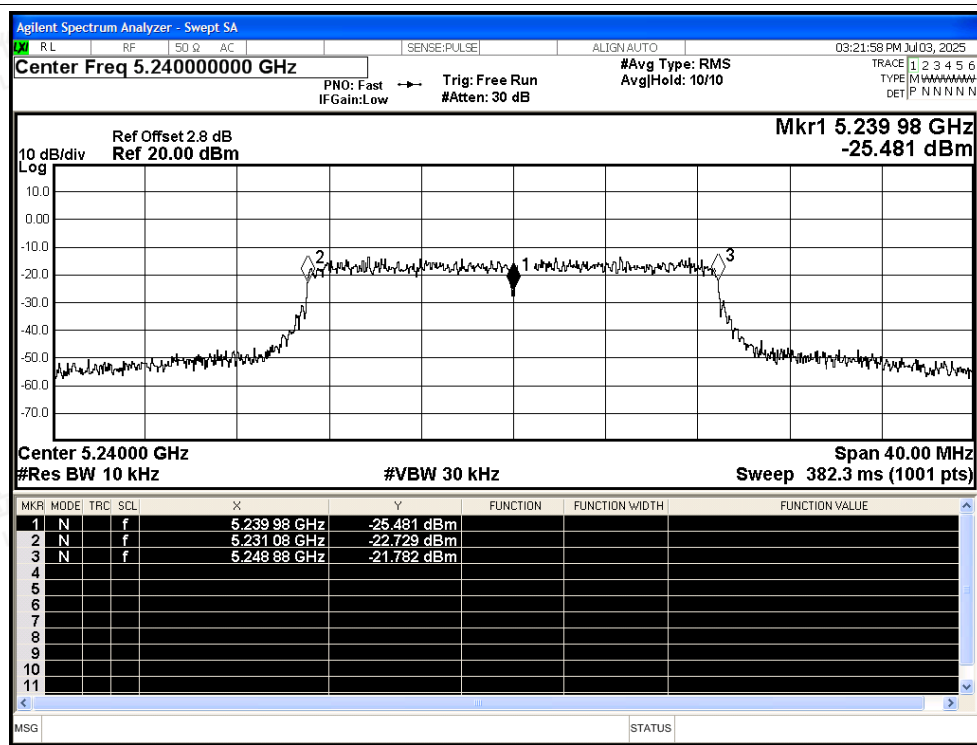

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant6

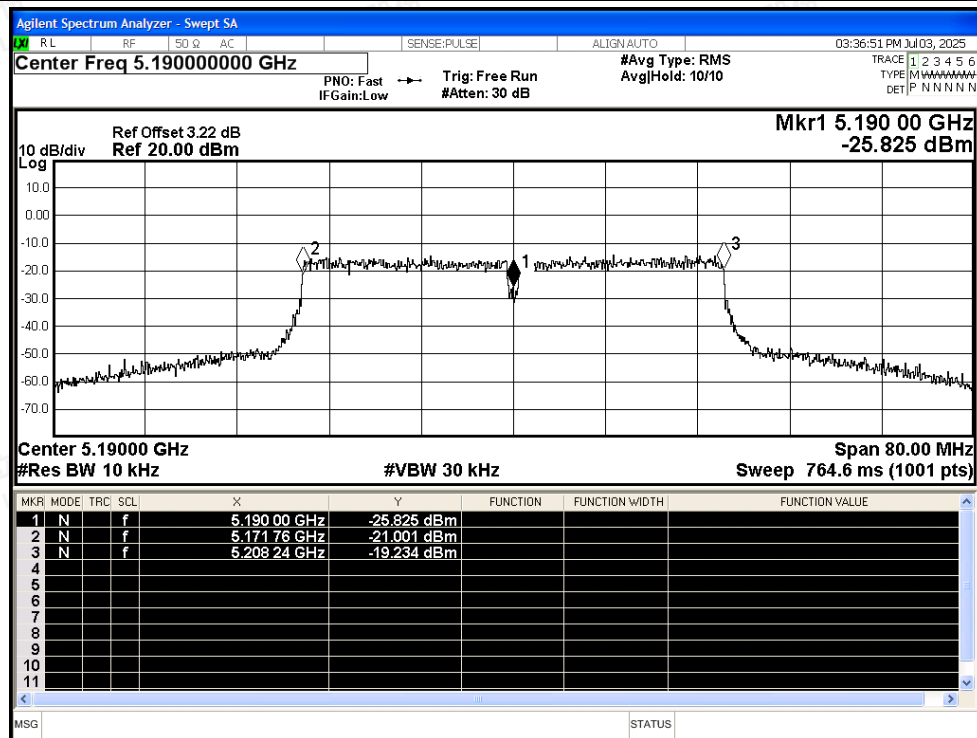

Freq. Stability NVNT n40 5230MHz Ant6

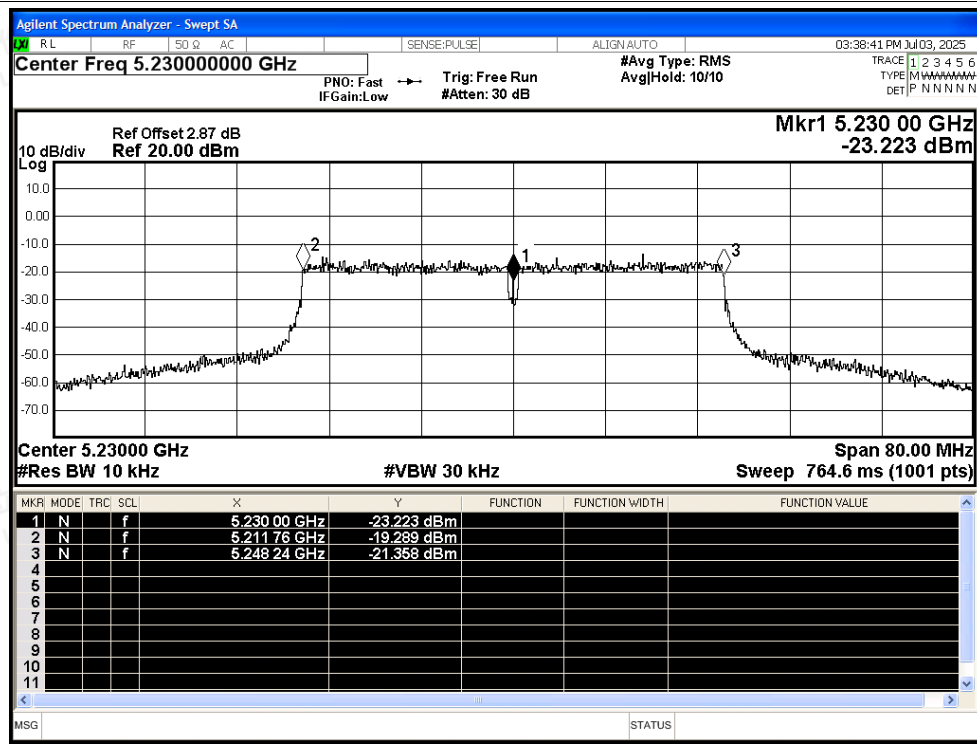

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant6

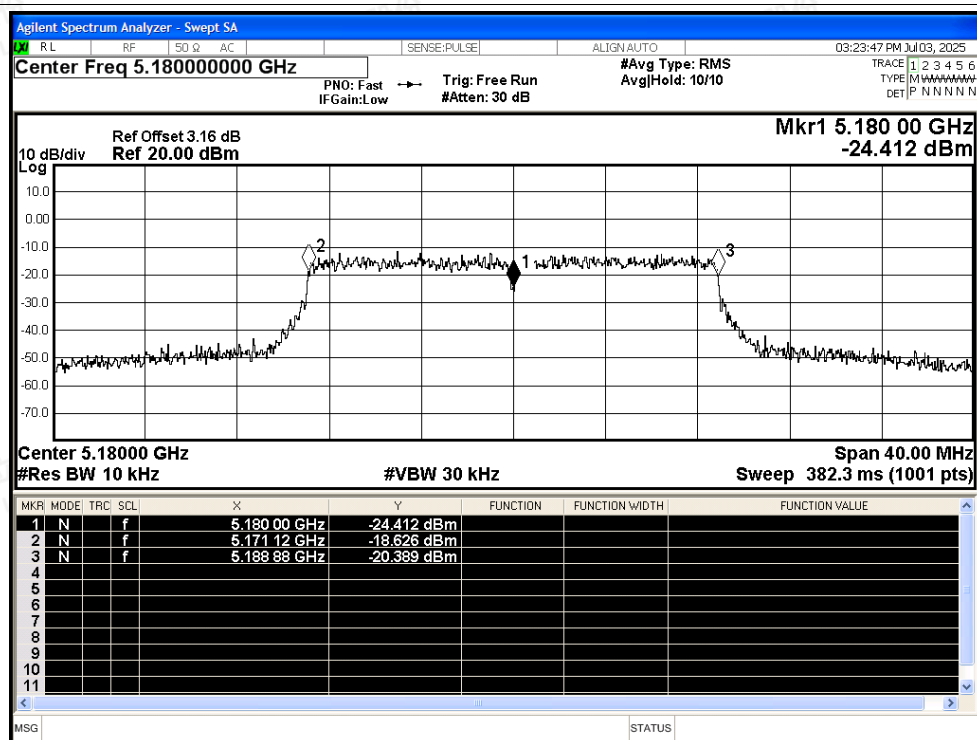

Freq. Stability NVNT ac20 5200MHz Ant6

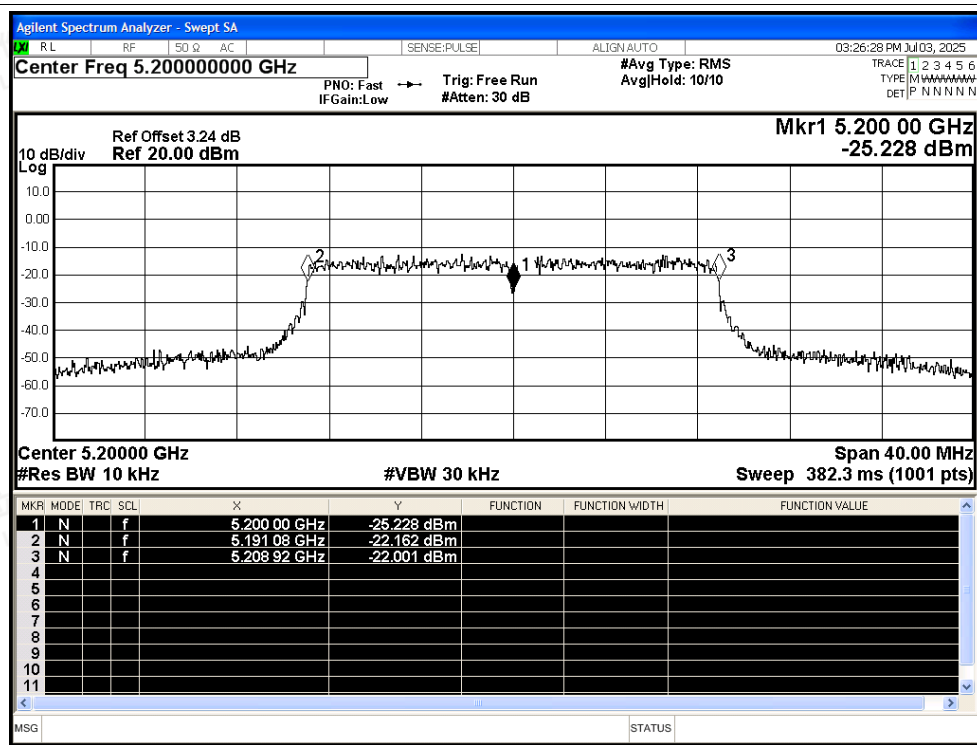

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant6

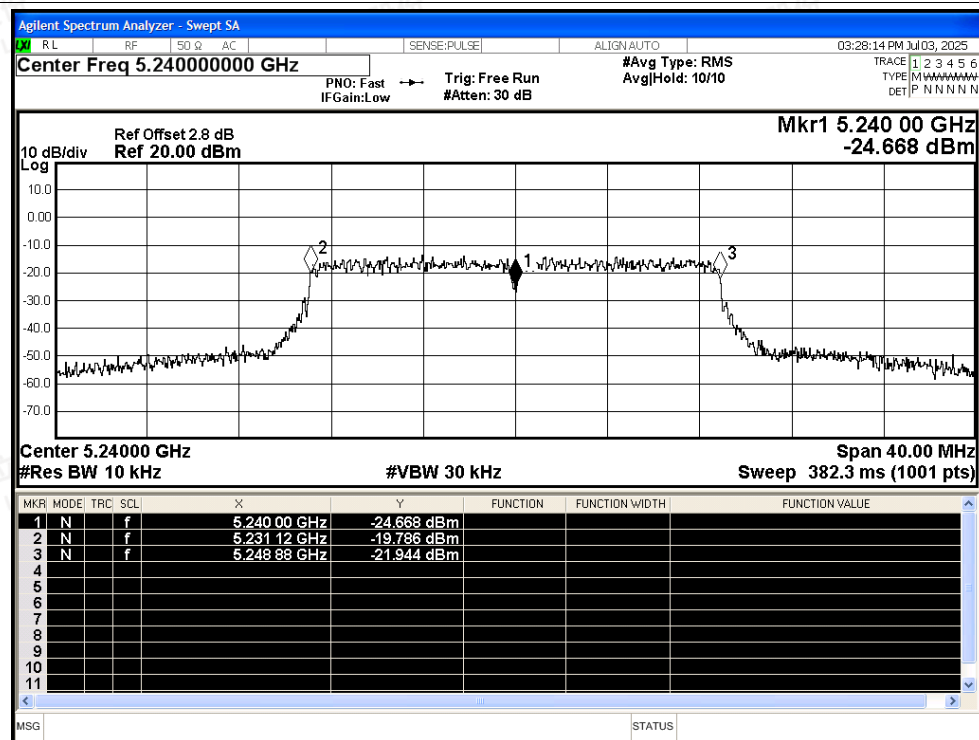

Freq. Stability NVNT ac40 5190MHz Ant6

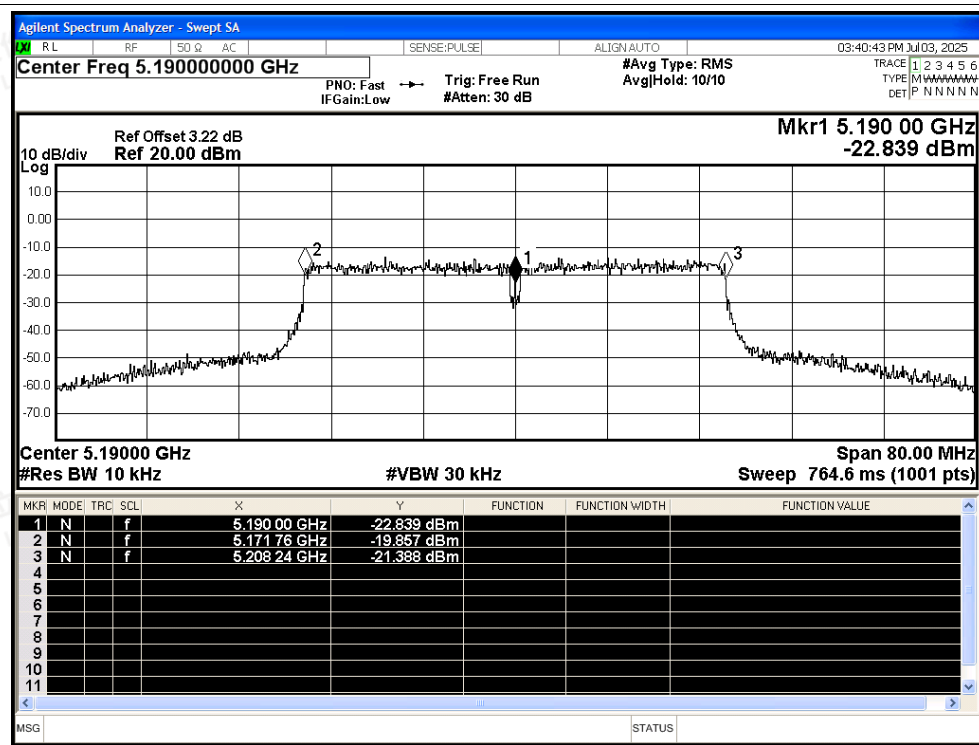

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant6

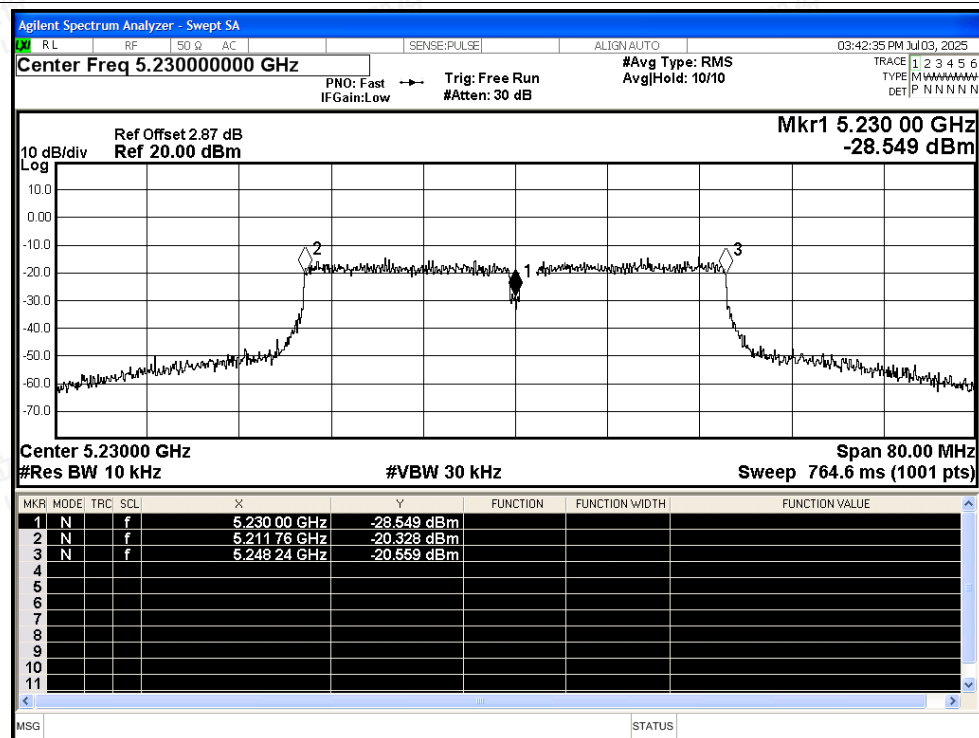


Freq. Stability NVNT ac80 5210MHz Ant6

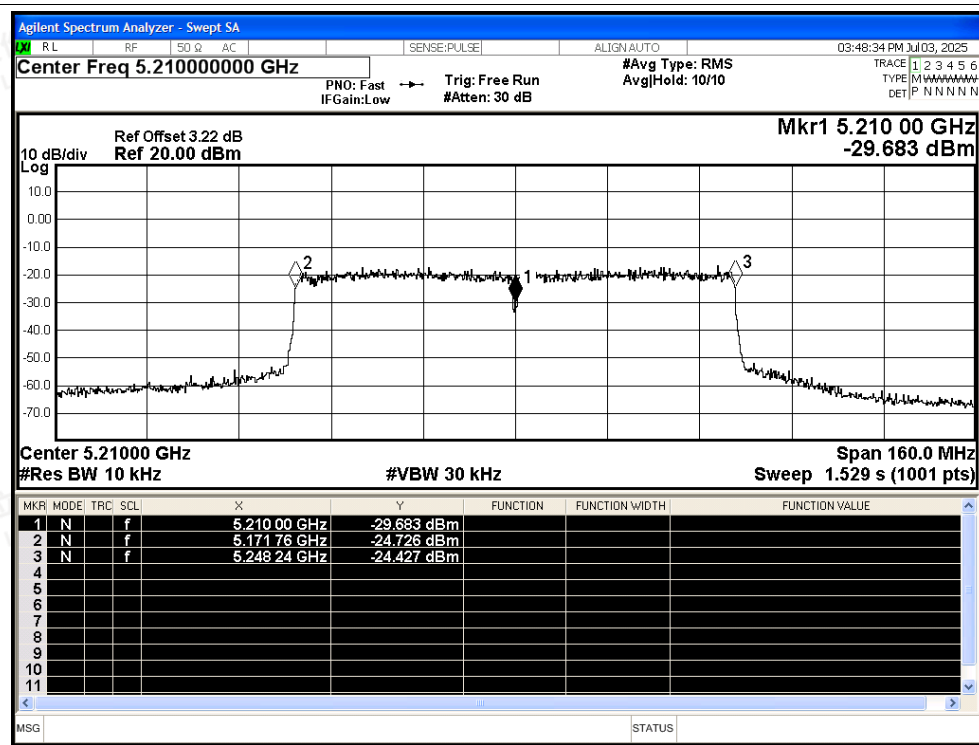




Freq. Stability NVNT ax20 5180MHz Ant6

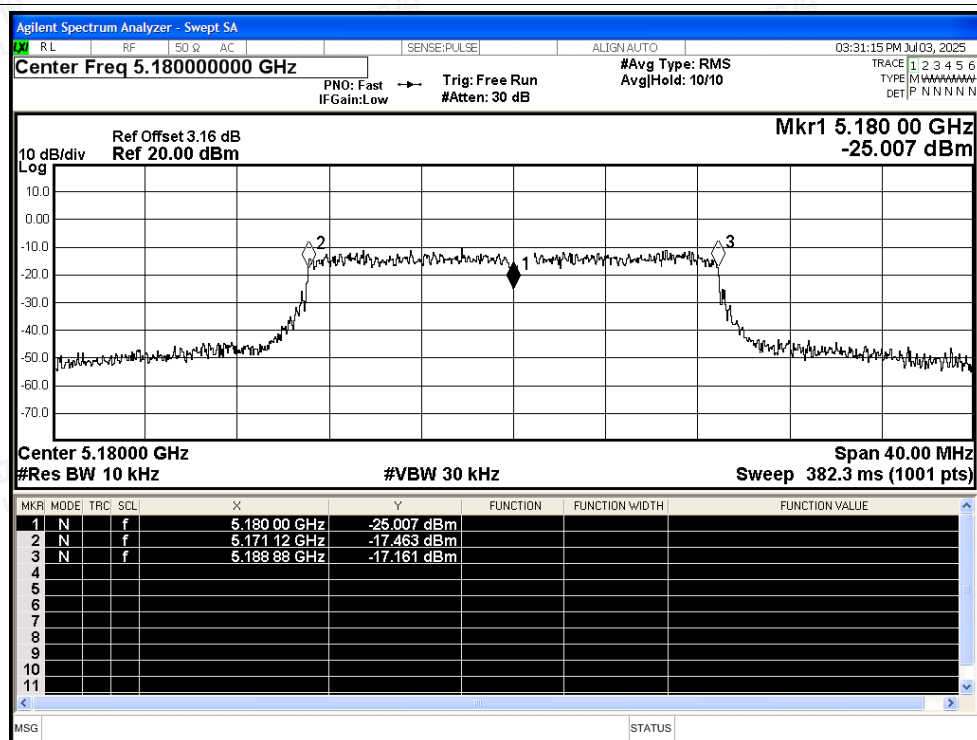

Freq. Stability NVNT ax20 5200MHz Ant6

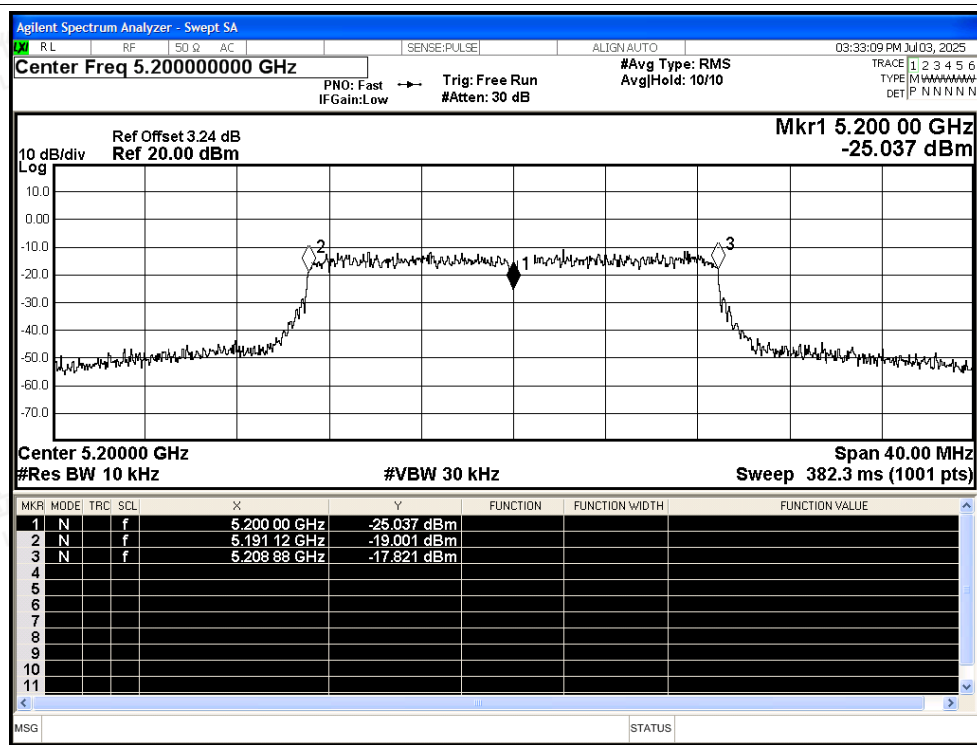

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant6

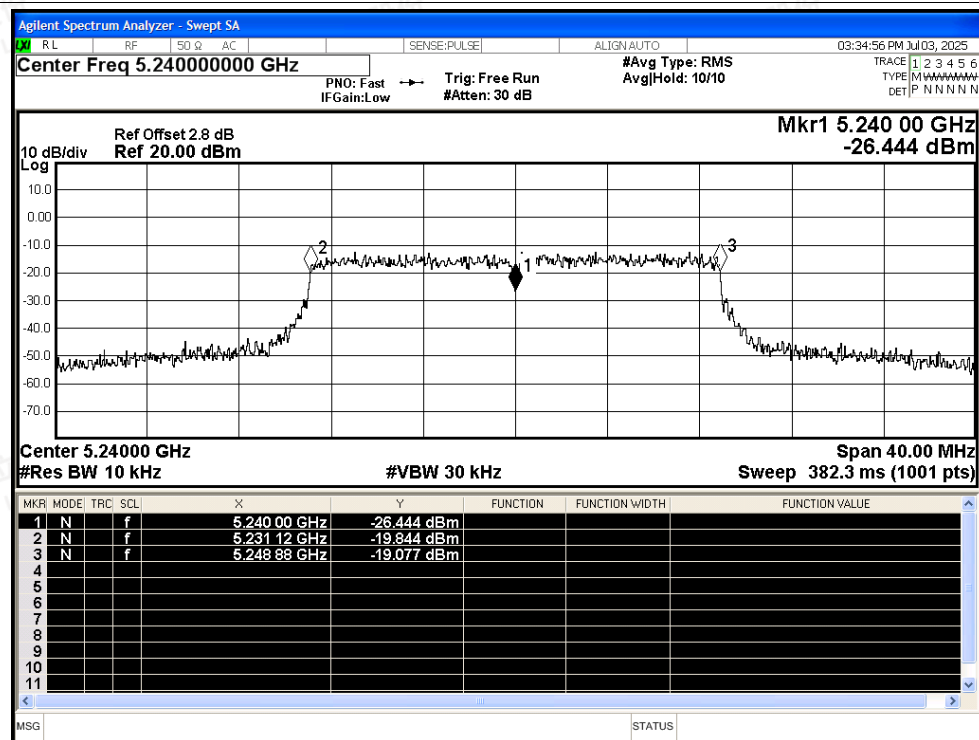

Freq. Stability NVNT ax40 5190MHz Ant6

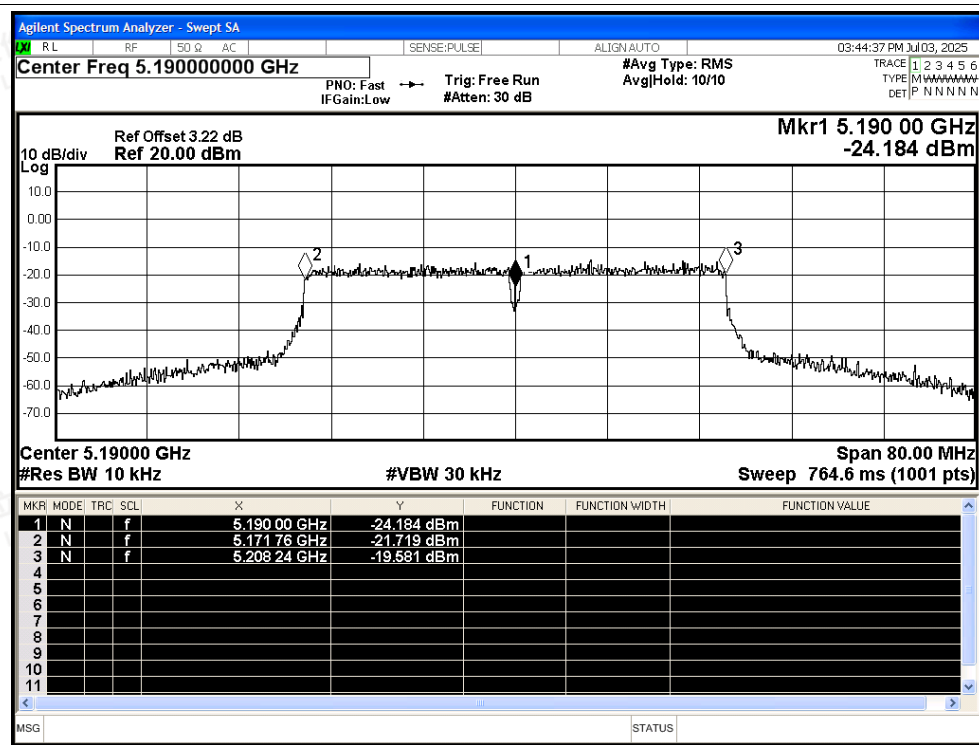

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant6

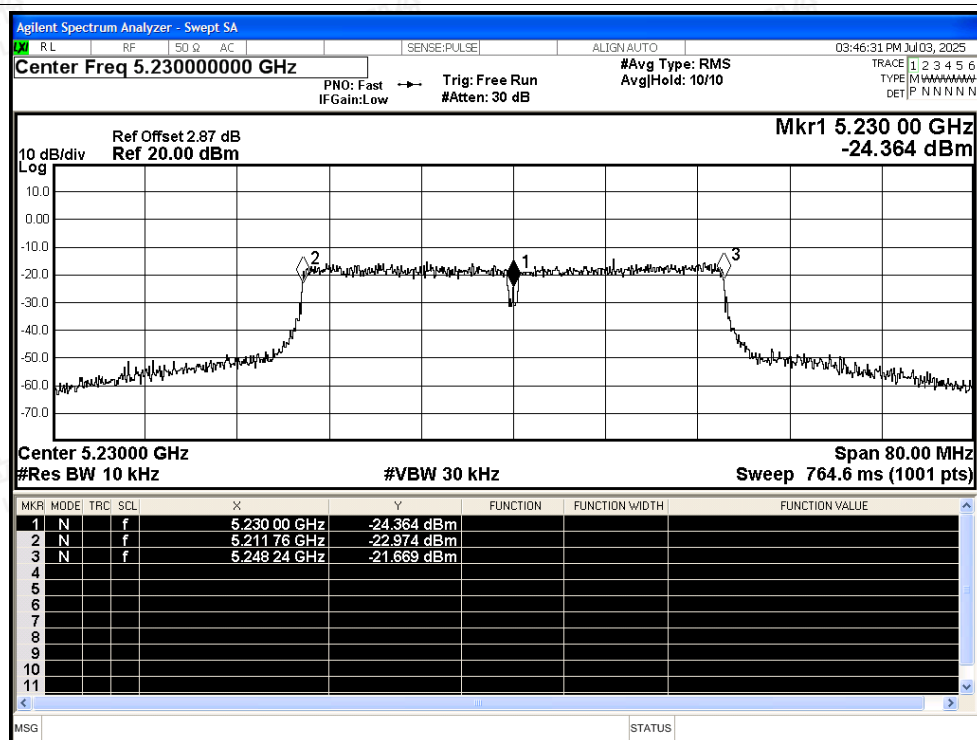

Freq. Stability NVNT ax80 5210MHz Ant6

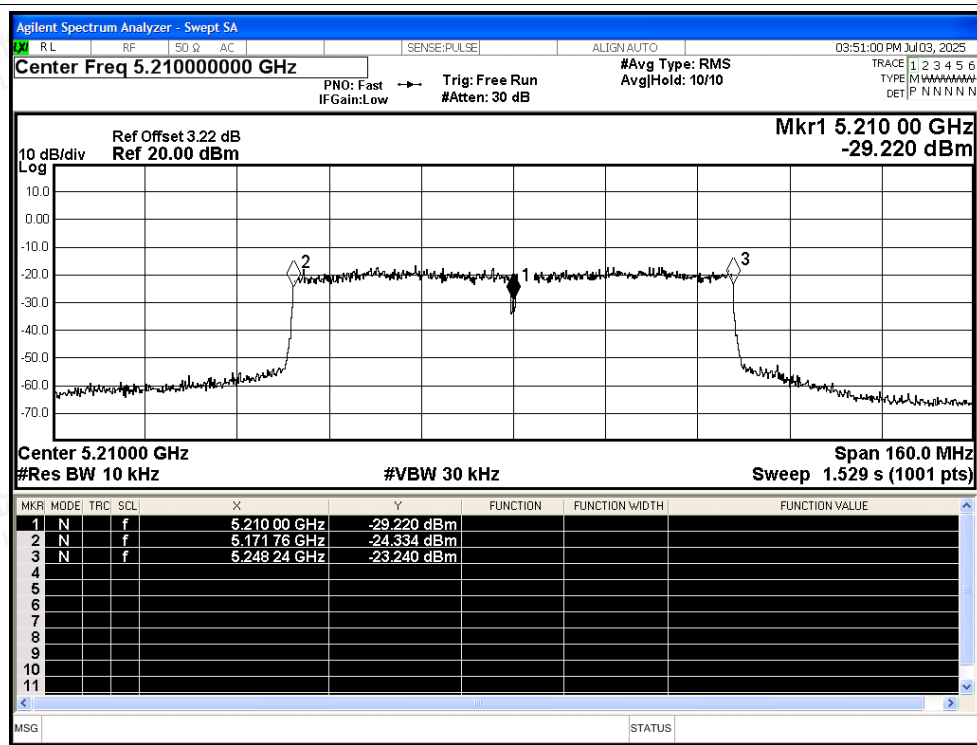

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	93.84	0.28	0.91
NVNT	a	5200	Ant2	94.65	0.24	0.91
NVNT	a	5240	Ant2	94.56	0.24	0.91
NVNT	n20	5180	Ant2	93.77	0.28	1.07
NVNT	n20	5200	Ant2	93.77	0.28	1.07
NVNT	n20	5240	Ant2	93.67	0.28	1.07
NVNT	n40	5190	Ant2	88.29	0.54	2.11
NVNT	n40	5230	Ant2	88.48	0.53	2.1
NVNT	ac20	5180	Ant2	93.72	0.28	1.06
NVNT	ac20	5200	Ant2	93.73	0.28	1.06
NVNT	ac20	5240	Ant2	93.72	0.28	1.06
NVNT	ac40	5190	Ant2	88.14	0.55	2.14
NVNT	ac40	5230	Ant2	88.14	0.55	2.14
NVNT	ac80	5210	Ant2	79.61	0.99	4.13
NVNT	ax20	5180	Ant2	93.82	0.28	1.06
NVNT	ax20	5200	Ant2	93.72	0.28	1.06
NVNT	ax20	5240	Ant2	93.72	0.28	1.06
NVNT	ax40	5190	Ant2	88.48	0.53	2.1
NVNT	ax40	5230	Ant2	88.29	0.54	2.11
NVNT	ax80	5210	Ant2	79.61	0.99	4.13



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

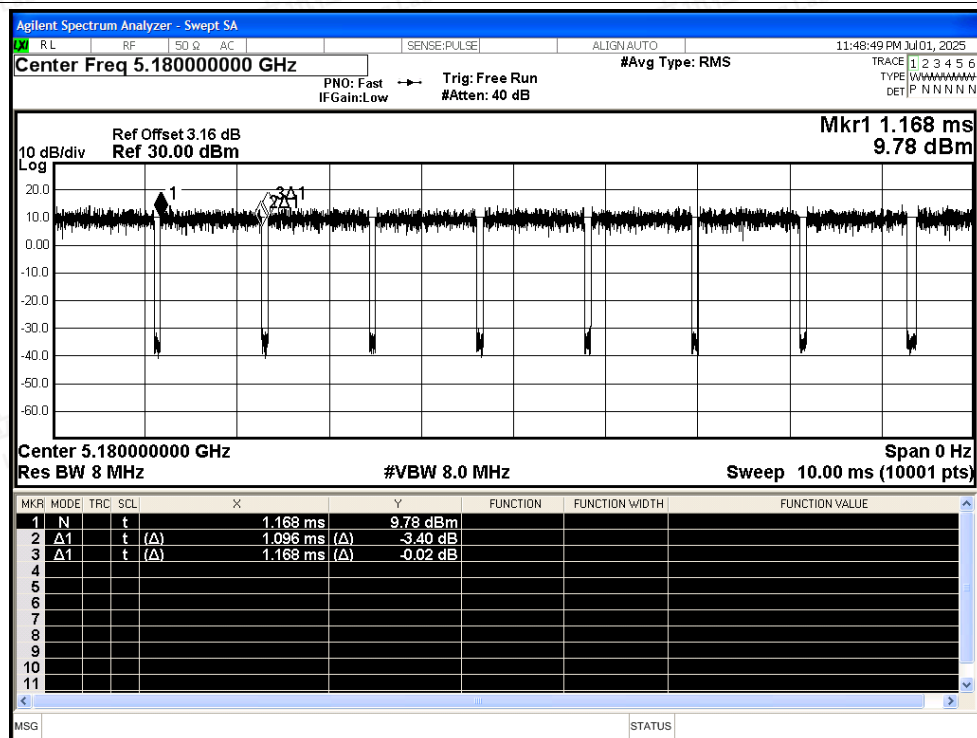

Duty Cycle NVNT a 5200MHz Ant2

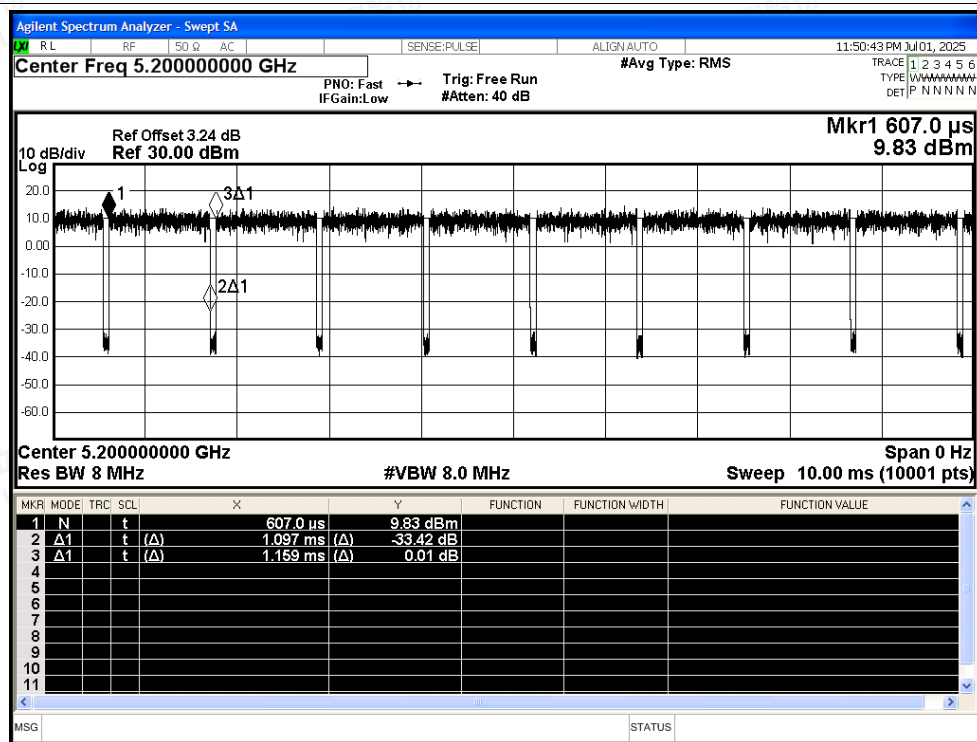

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant2

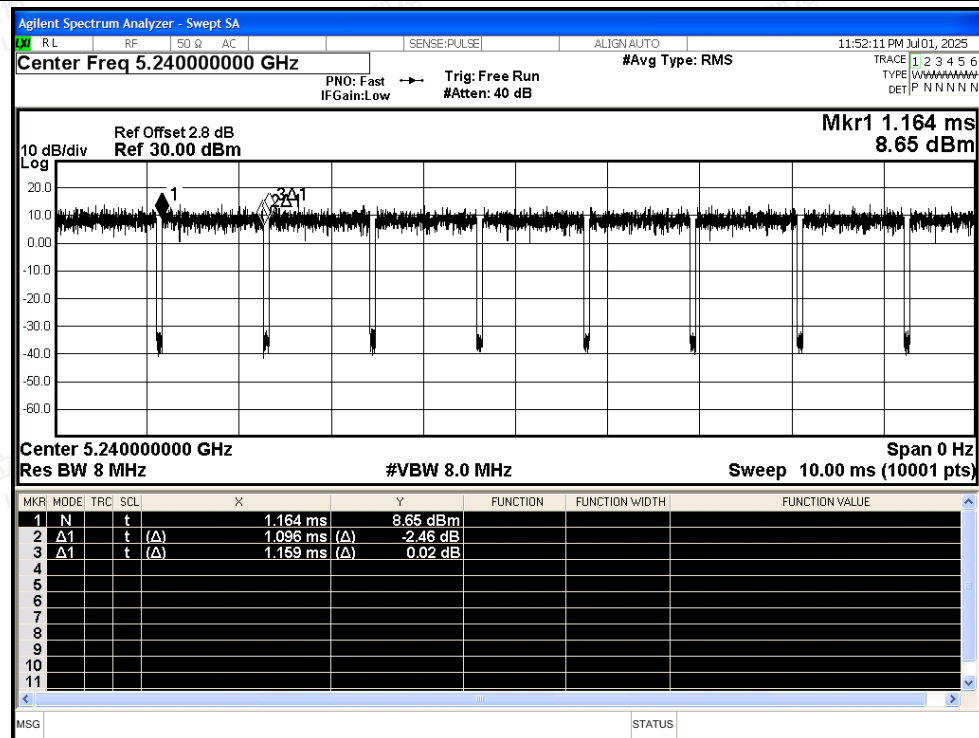

Duty Cycle NVNT n20 5180MHz Ant2

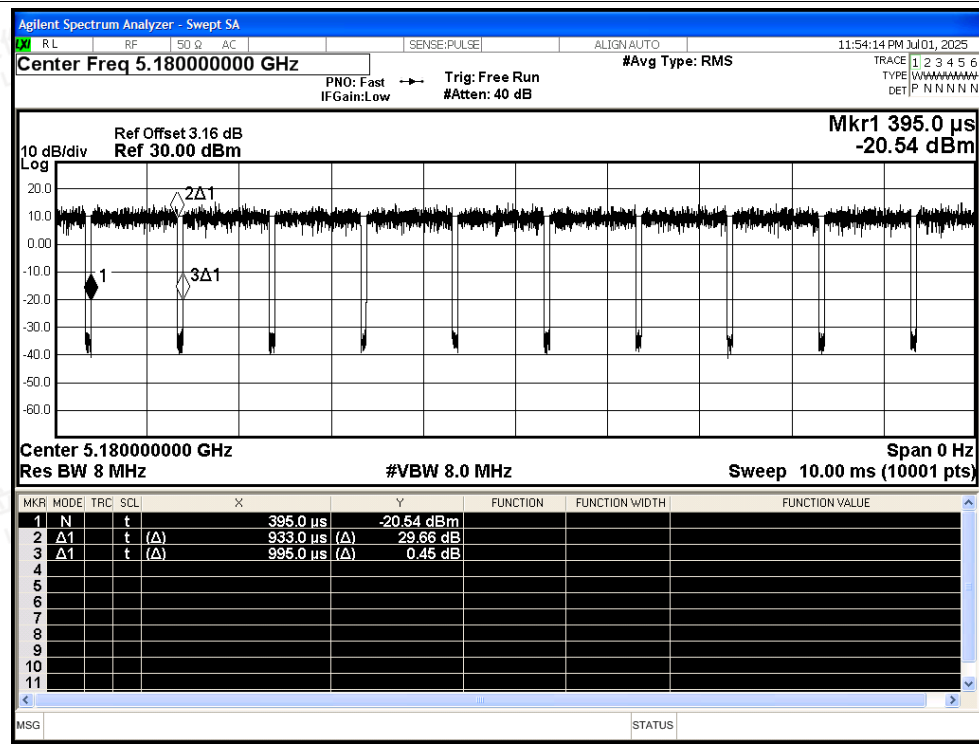

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant2

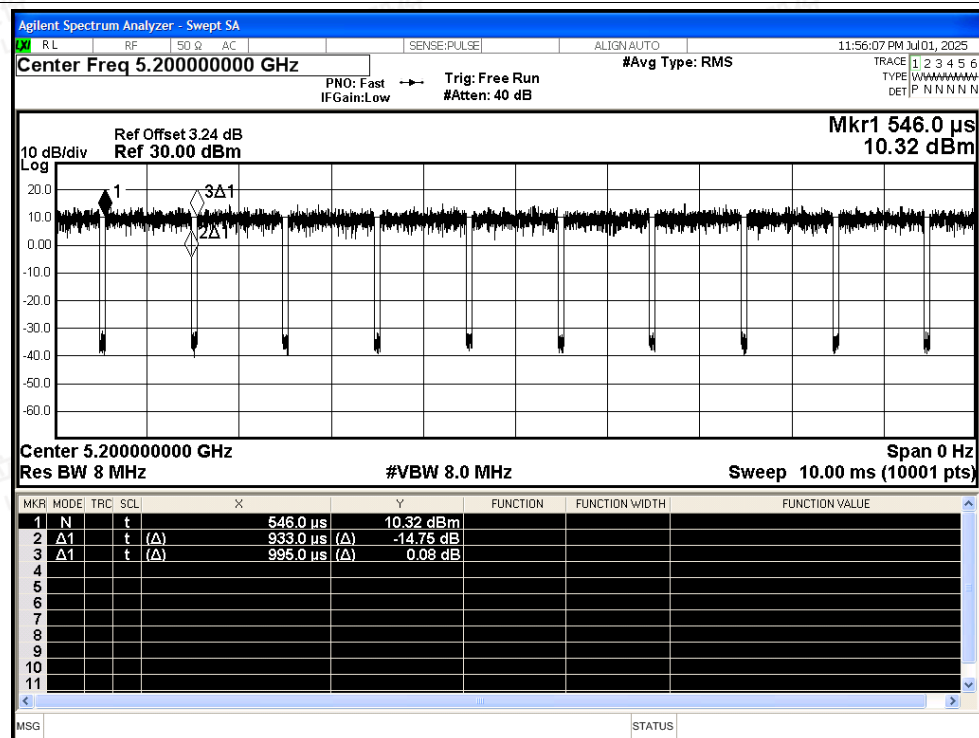

Duty Cycle NVNT n20 5240MHz Ant2

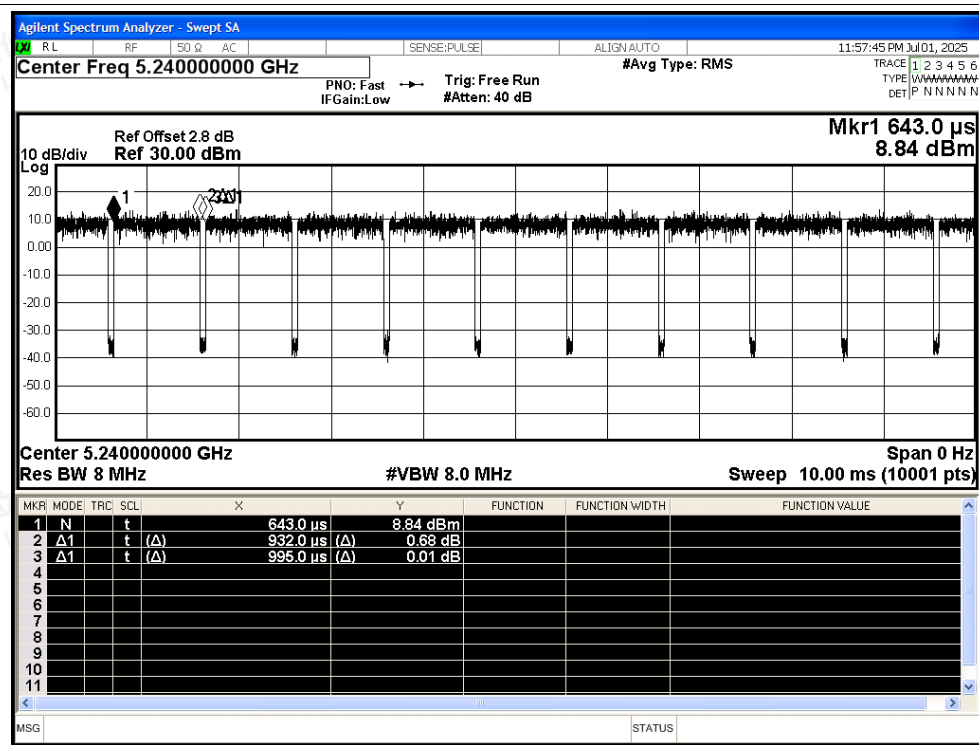

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant2

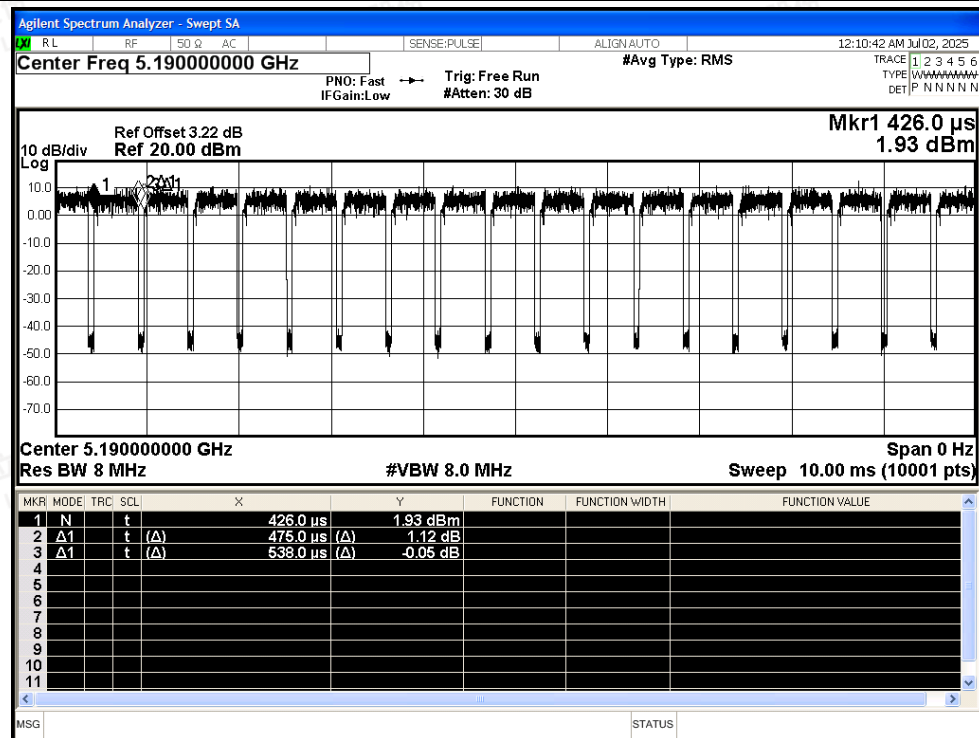

Duty Cycle NVNT n40 5230MHz Ant2

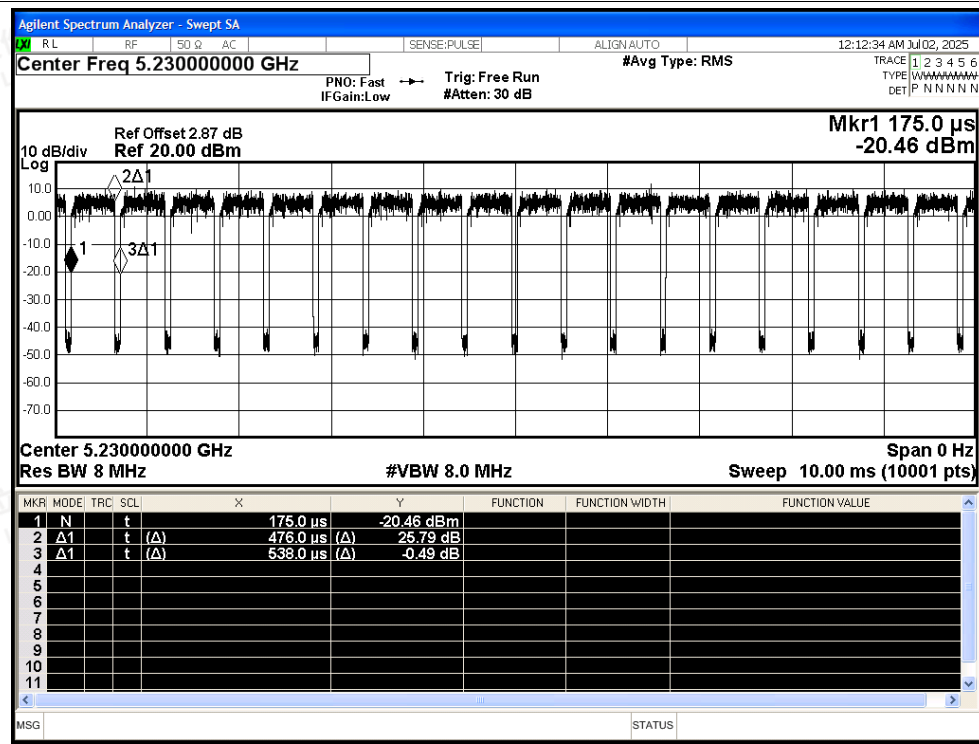

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant2

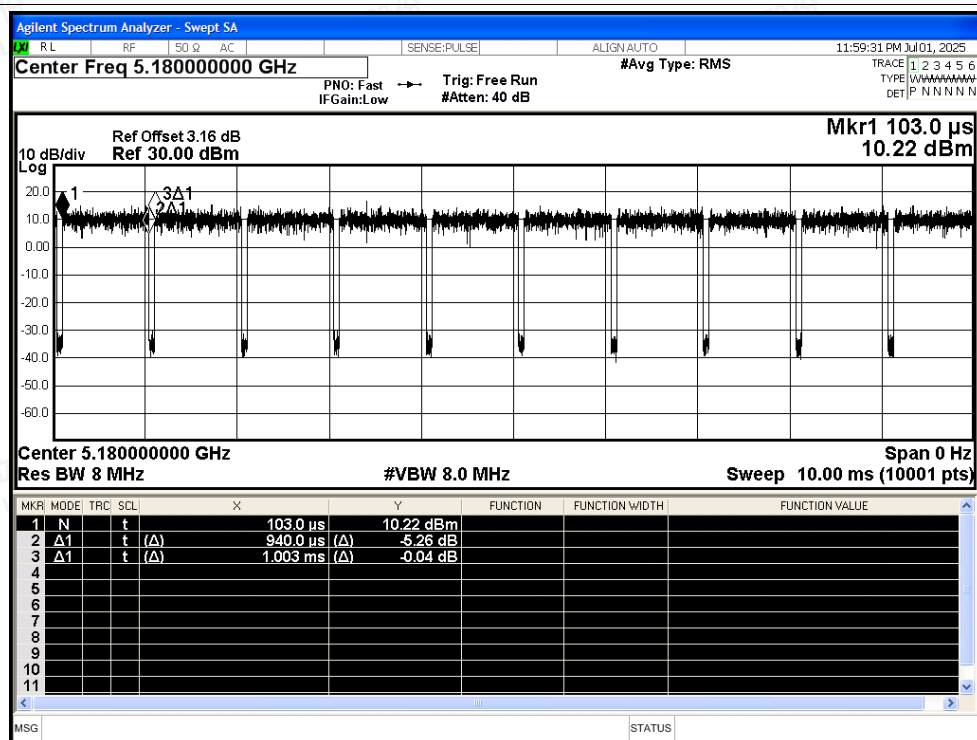

Duty Cycle NVNT ac20 5200MHz Ant2

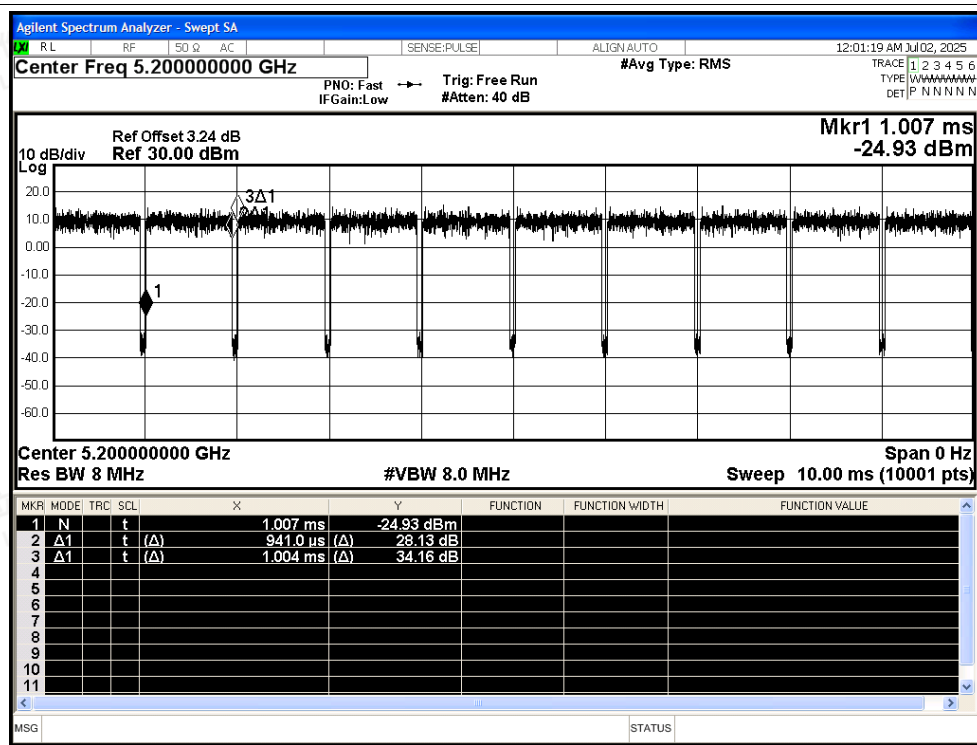

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant2

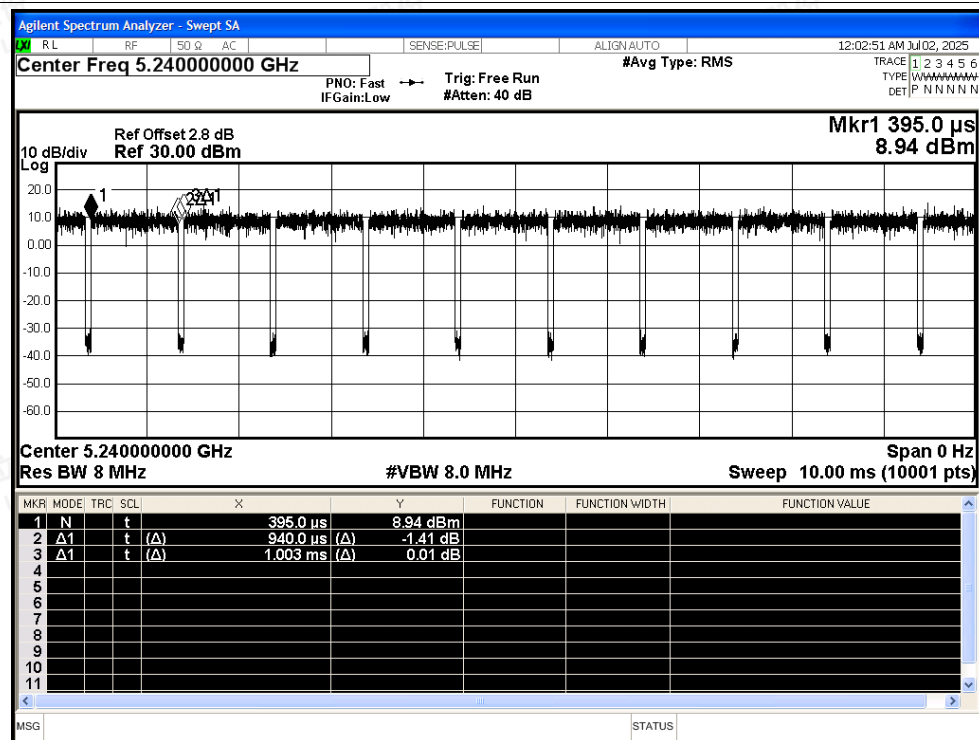


Duty Cycle NVNT ac40 5190MHz Ant2

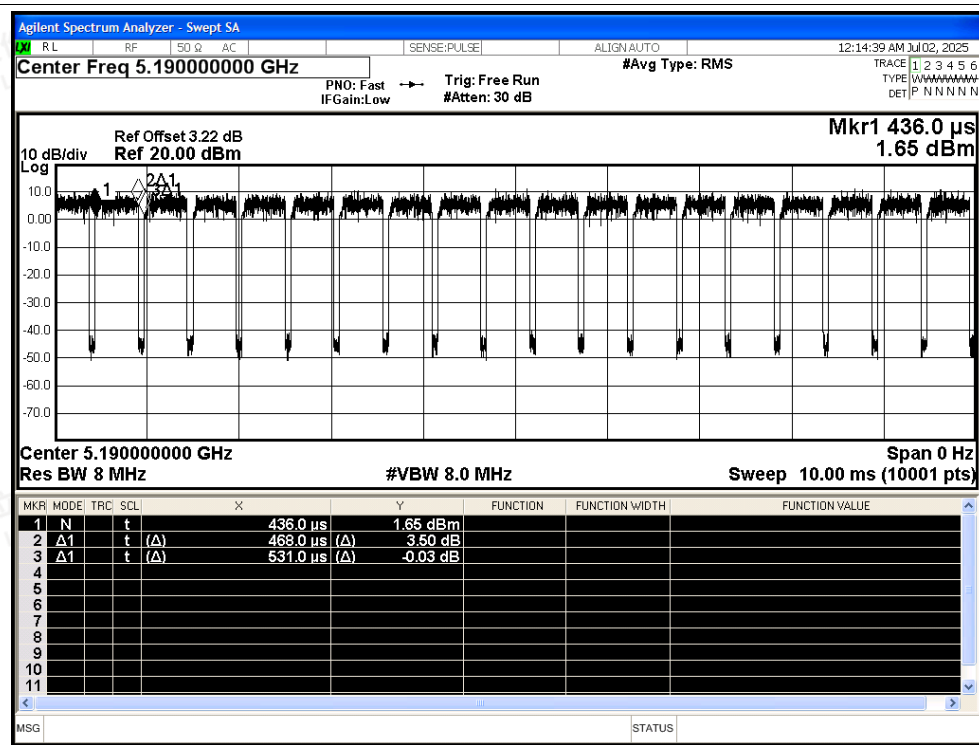




Duty Cycle NVNT ac40 5230MHz Ant2

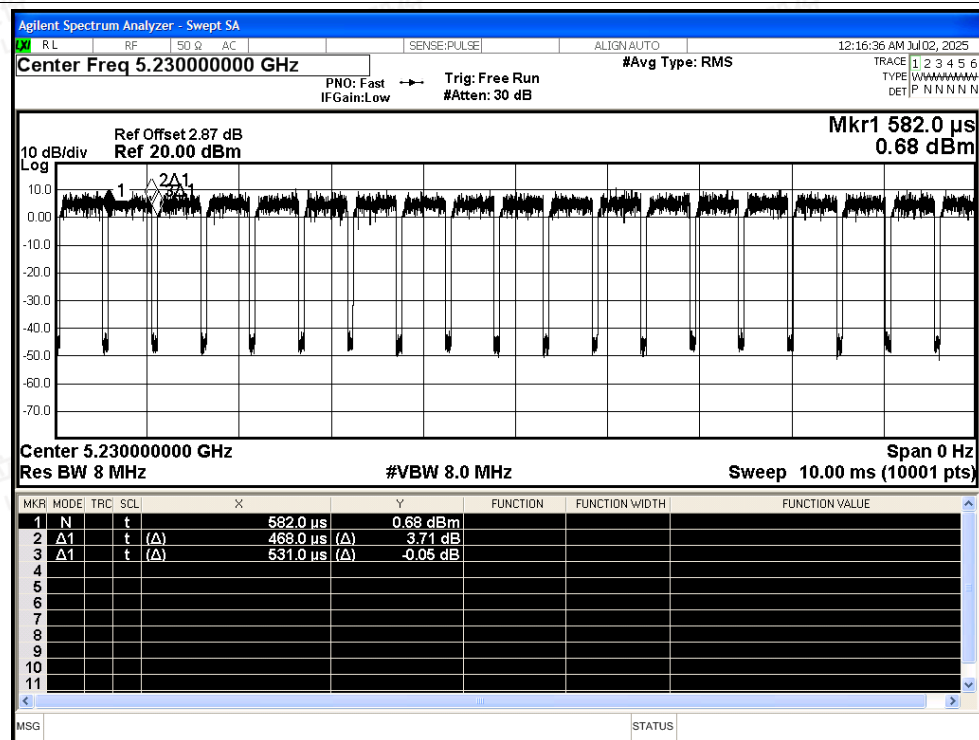

Duty Cycle NVNT ac80 5210MHz Ant2

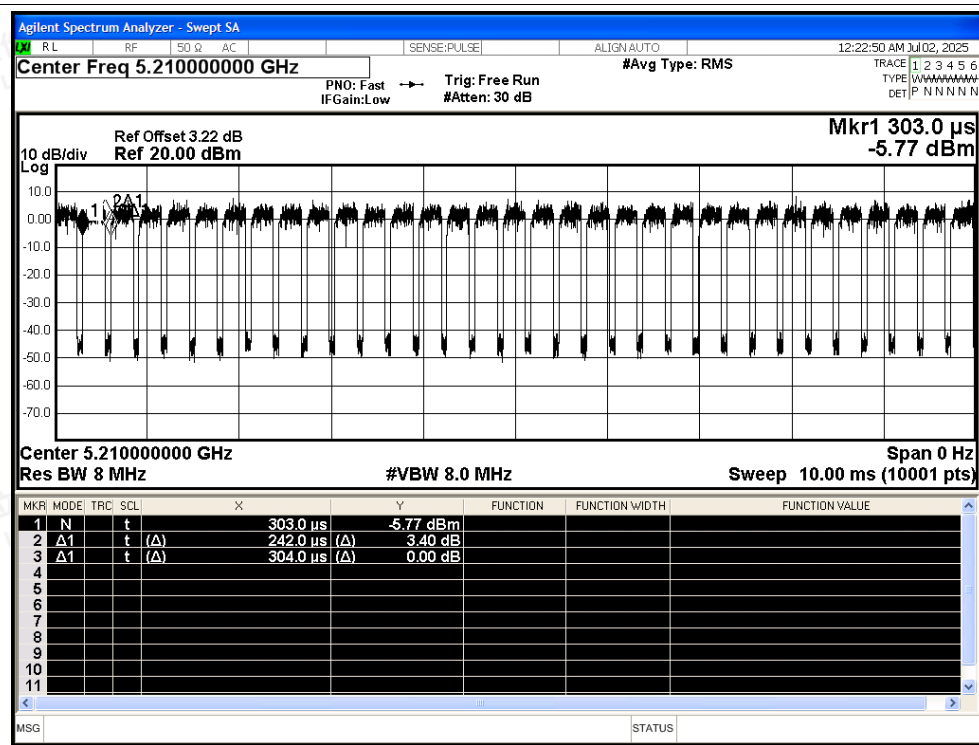

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant2

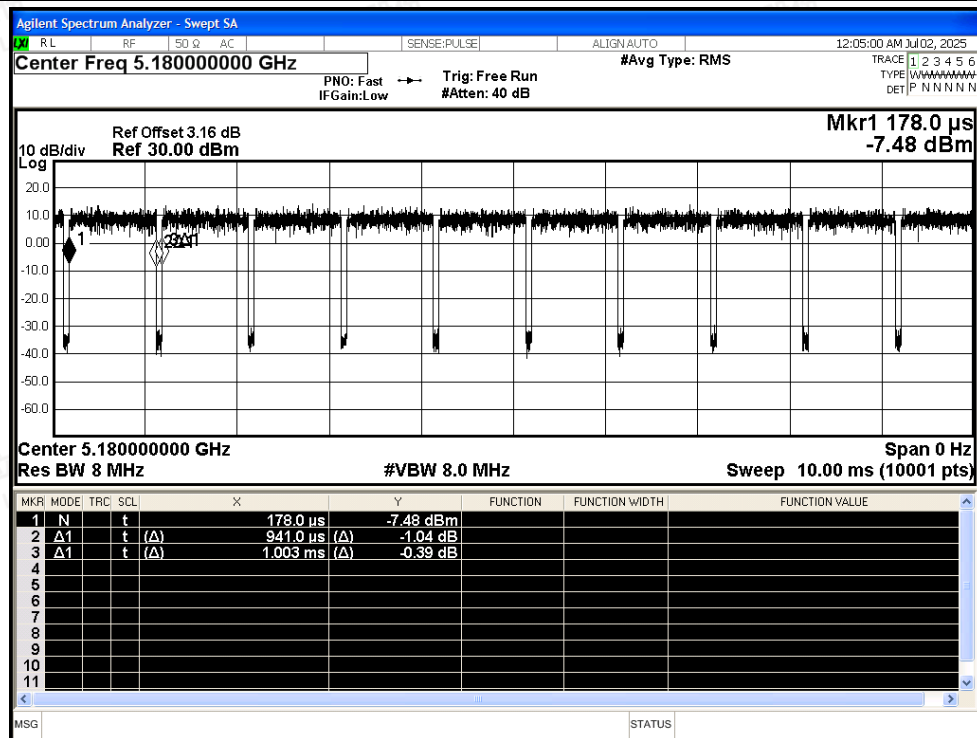

Duty Cycle NVNT ax20 5200MHz Ant2

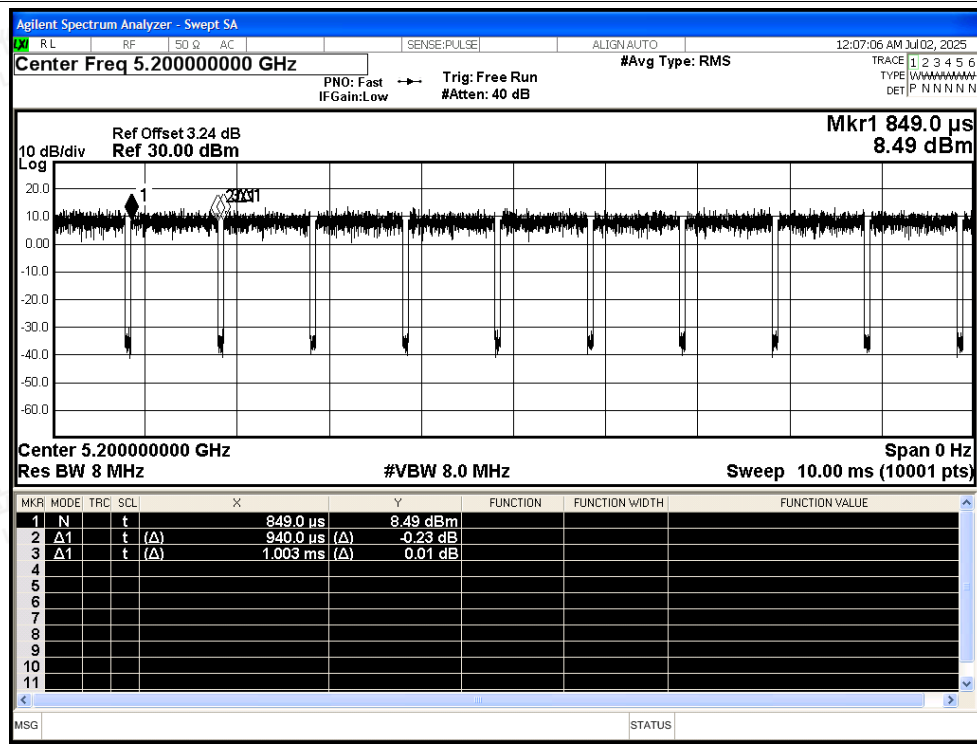

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant2

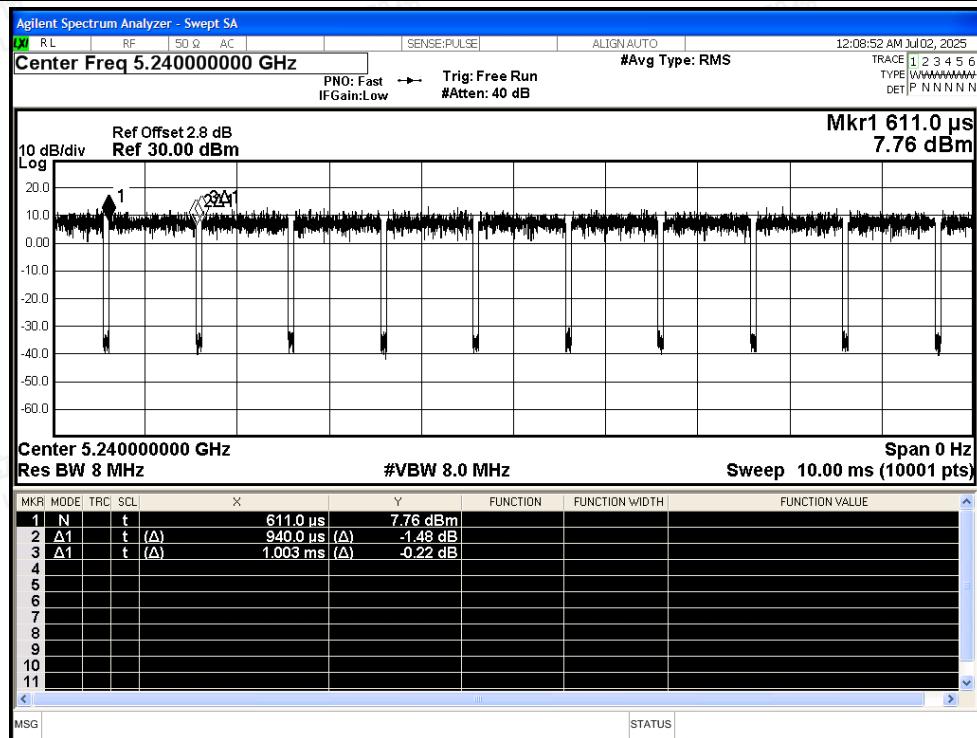

Duty Cycle NVNT ax40 5190MHz Ant2

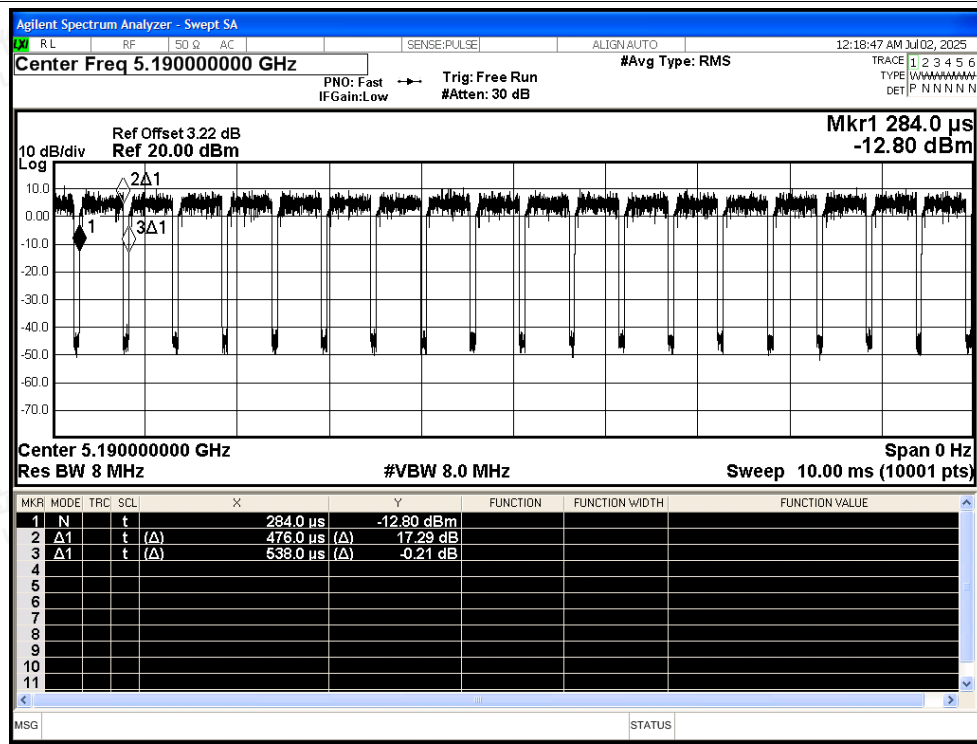

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant2

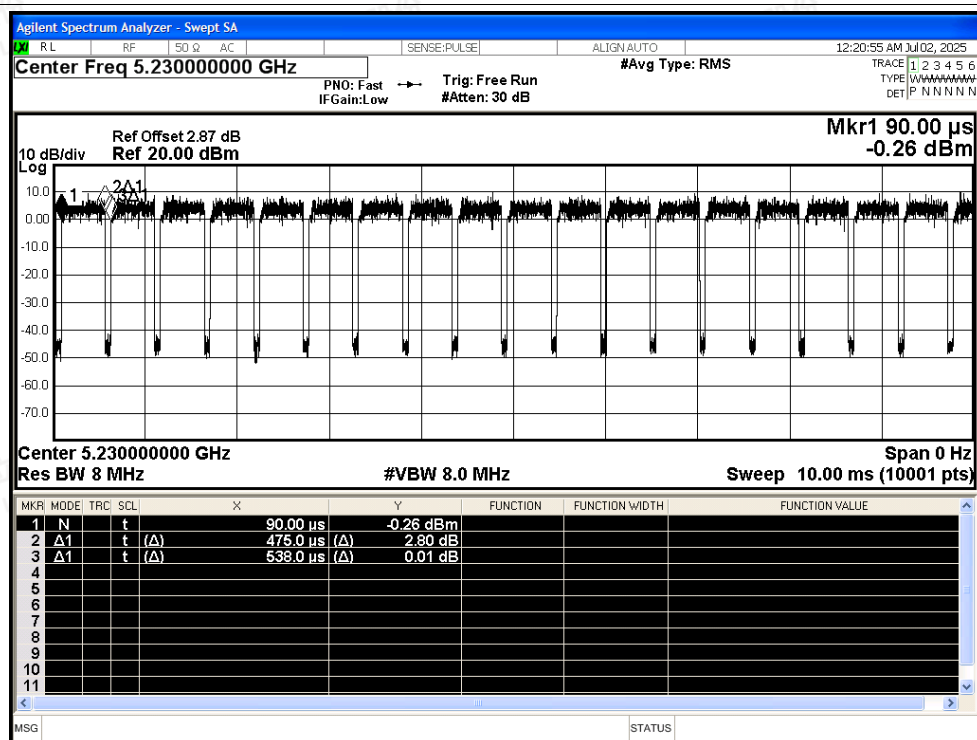

Duty Cycle NVNT ax80 5210MHz Ant2

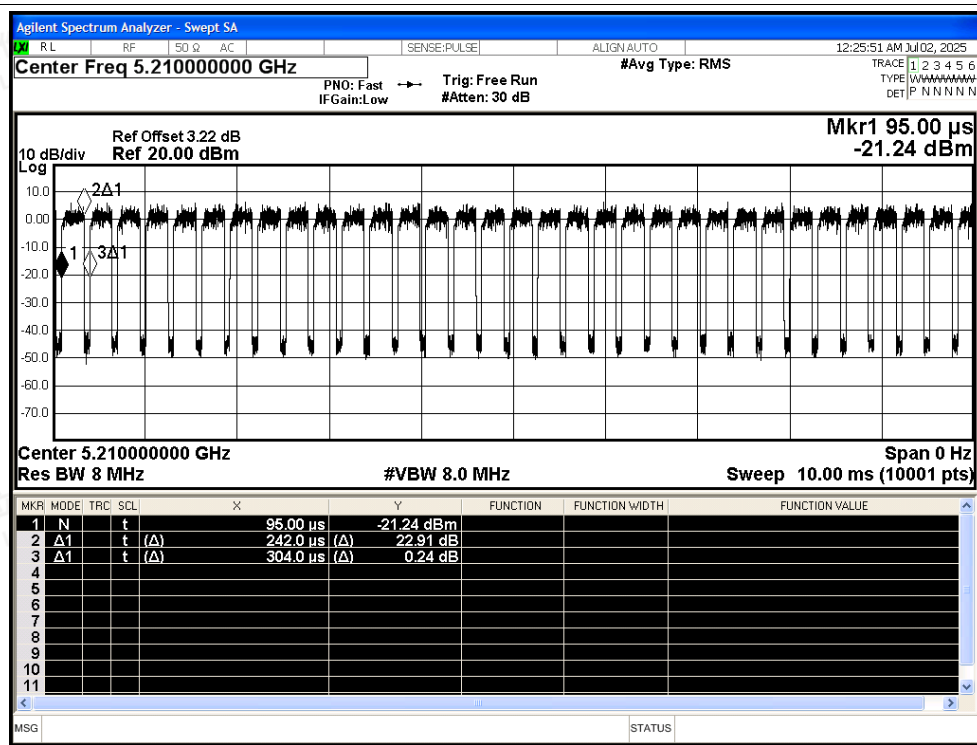

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant3	93.84	0.28	0.91
NVNT	a	5200	Ant3	94.65	0.24	0.91
NVNT	a	5240	Ant3	94.56	0.24	0.91
NVNT	n20	5180	Ant3	93.67	0.28	1.07
NVNT	n20	5200	Ant3	93.77	0.28	1.07
NVNT	n20	5240	Ant3	93.67	0.28	1.07
NVNT	n40	5190	Ant3	88.32	0.54	2.13
NVNT	n40	5230	Ant3	88.14	0.55	2.14
NVNT	ac20	5180	Ant3	93.72	0.28	1.06
NVNT	ac20	5200	Ant3	93.82	0.28	1.06
NVNT	ac20	5240	Ant3	93.82	0.28	1.06
NVNT	ac40	5190	Ant3	88.48	0.53	2.1
NVNT	ac40	5230	Ant3	88.48	0.53	2.1
NVNT	ac80	5210	Ant3	79.28	1.01	4.15
NVNT	ax20	5180	Ant3	93.72	0.28	1.06
NVNT	ax20	5200	Ant3	93.72	0.28	1.06
NVNT	ax20	5240	Ant3	93.72	0.28	1.06
NVNT	ax40	5190	Ant3	88.48	0.53	2.1
NVNT	ax40	5230	Ant3	88.48	0.53	2.1
NVNT	ax80	5210	Ant3	79.61	0.99	4.13



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant3

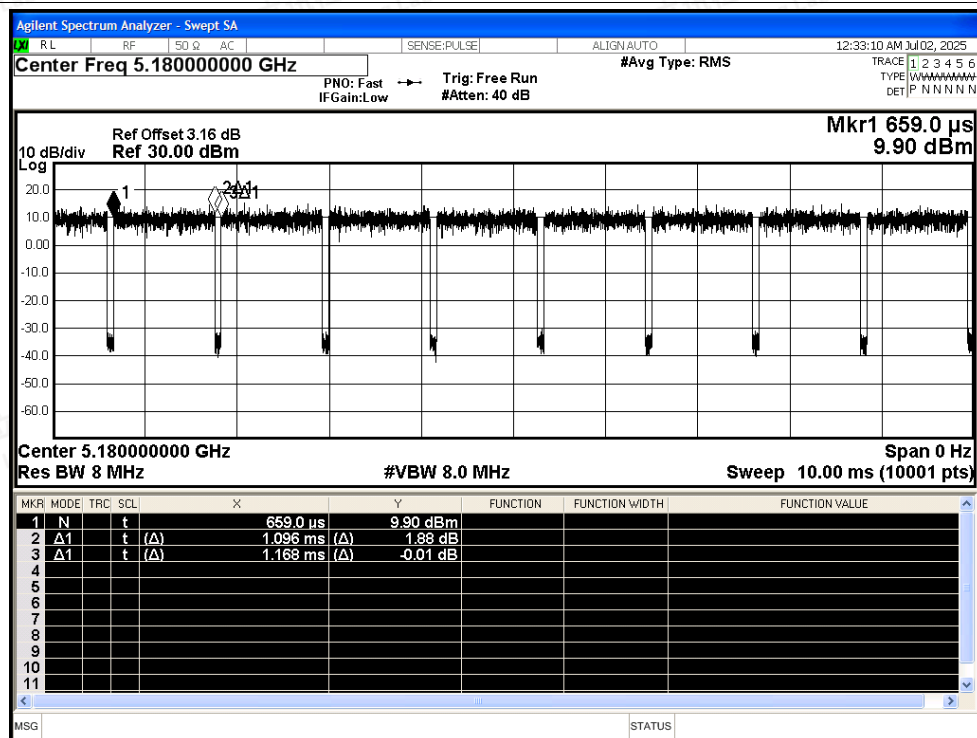

Duty Cycle NVNT a 5200MHz Ant3

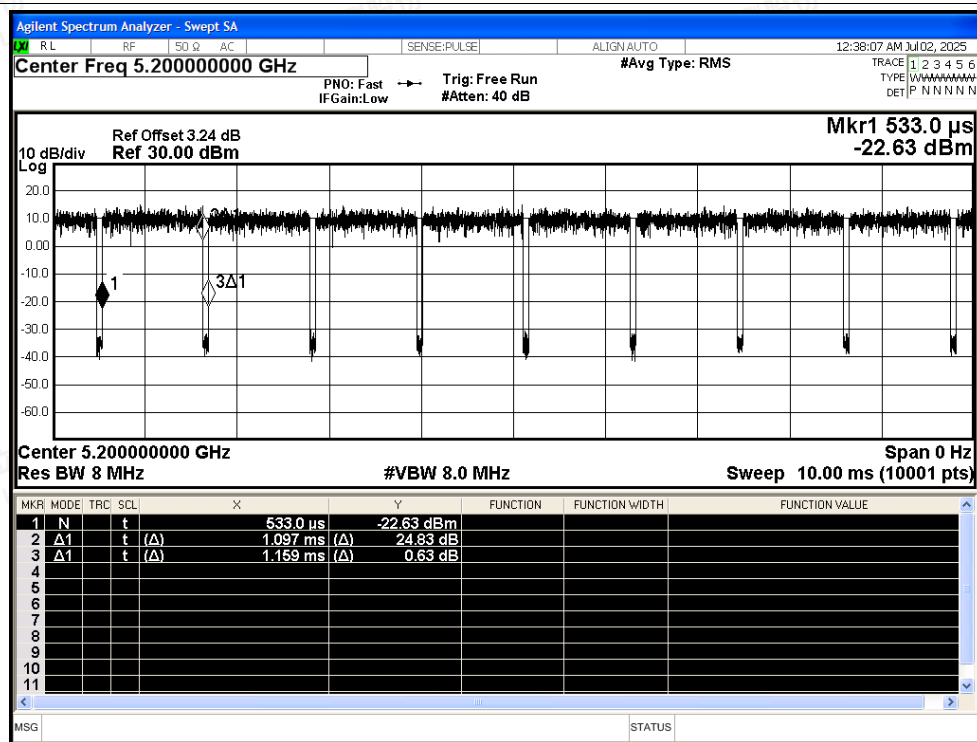

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant3

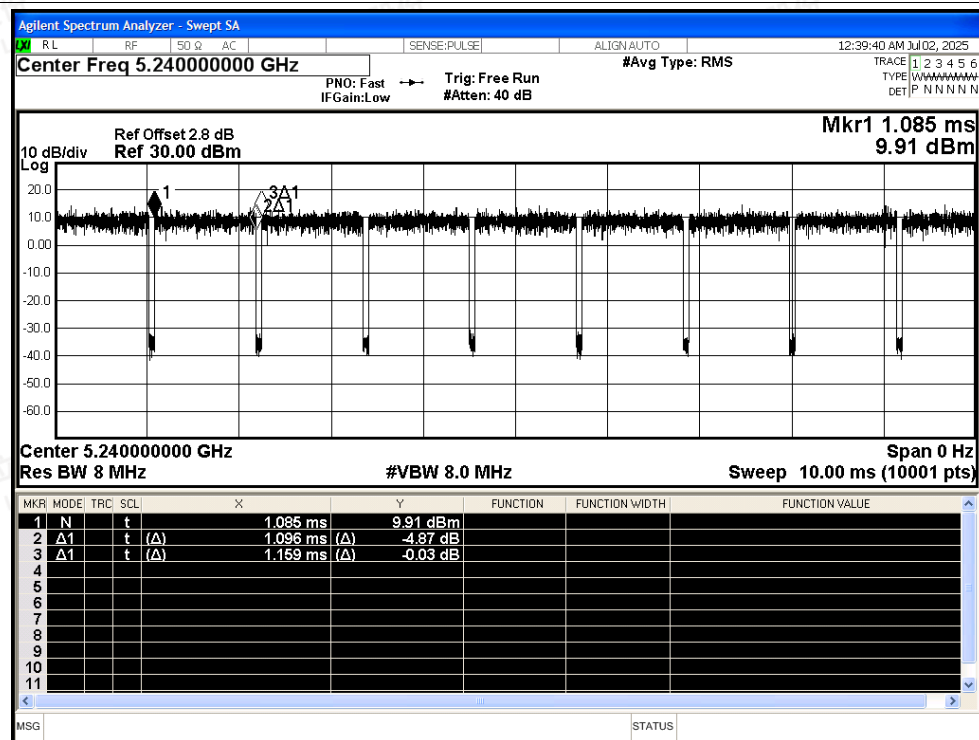

Duty Cycle NVNT n20 5180MHz Ant3

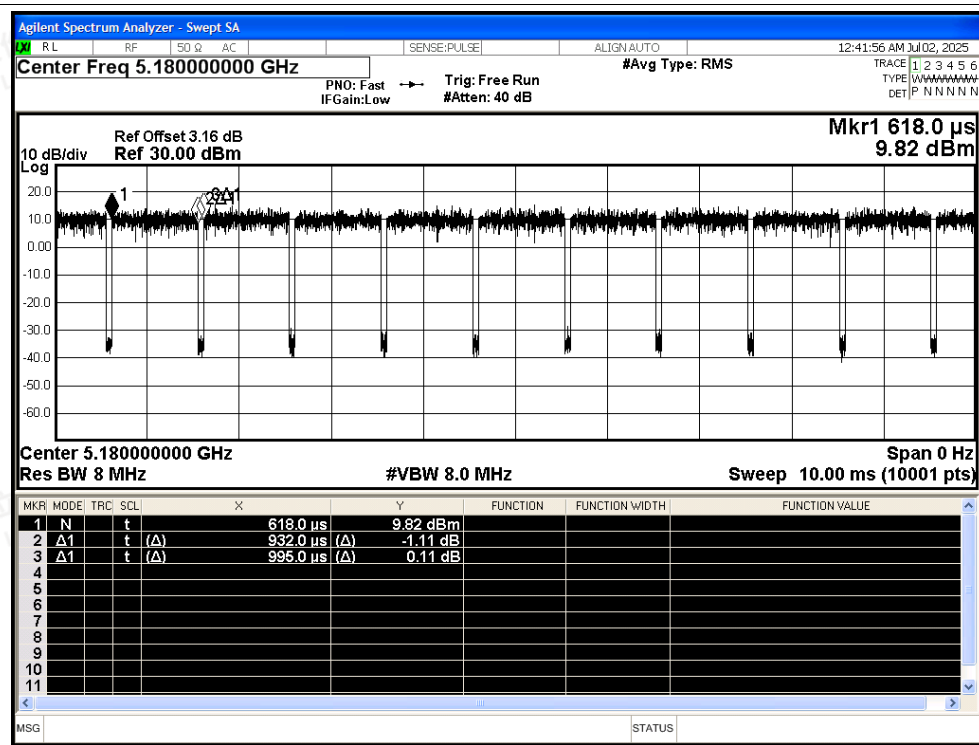

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant3

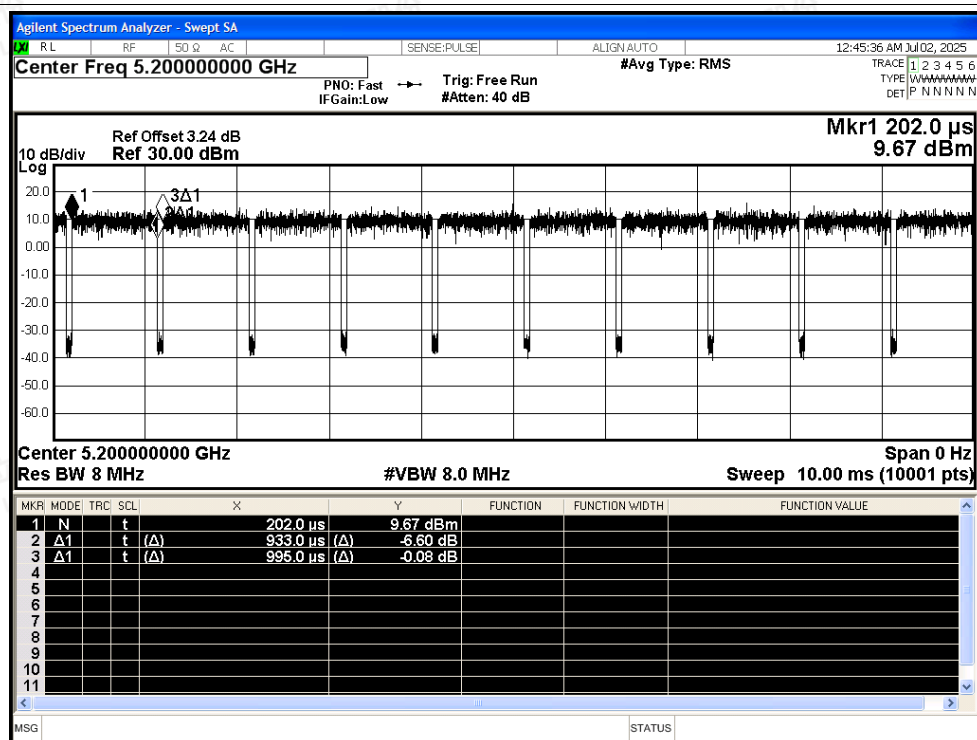

Duty Cycle NVNT n20 5240MHz Ant3

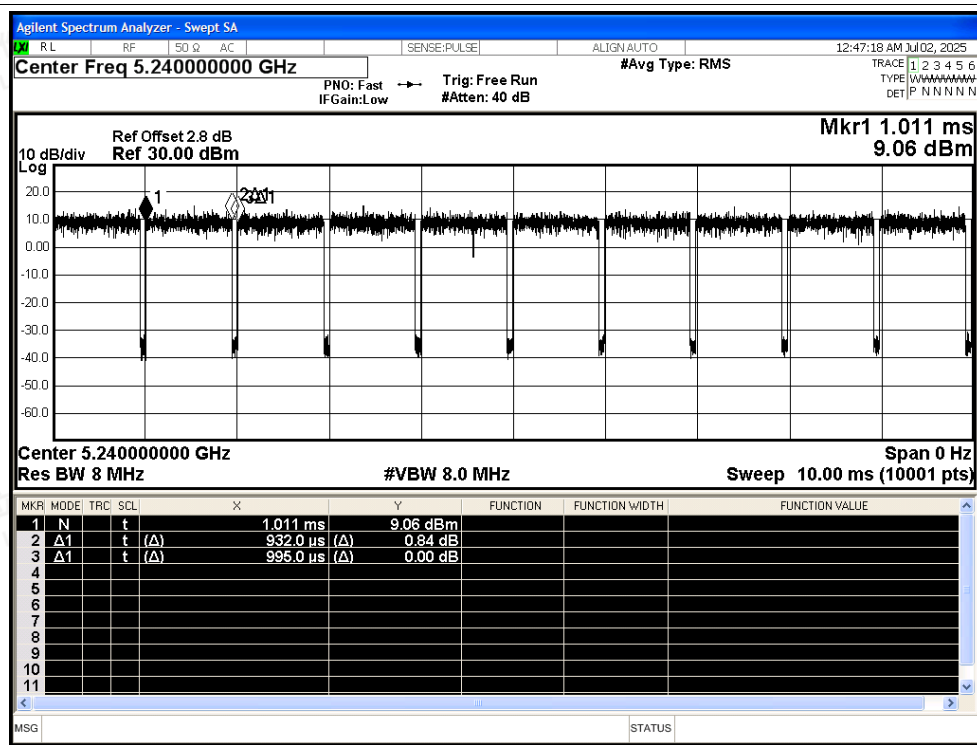

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity