
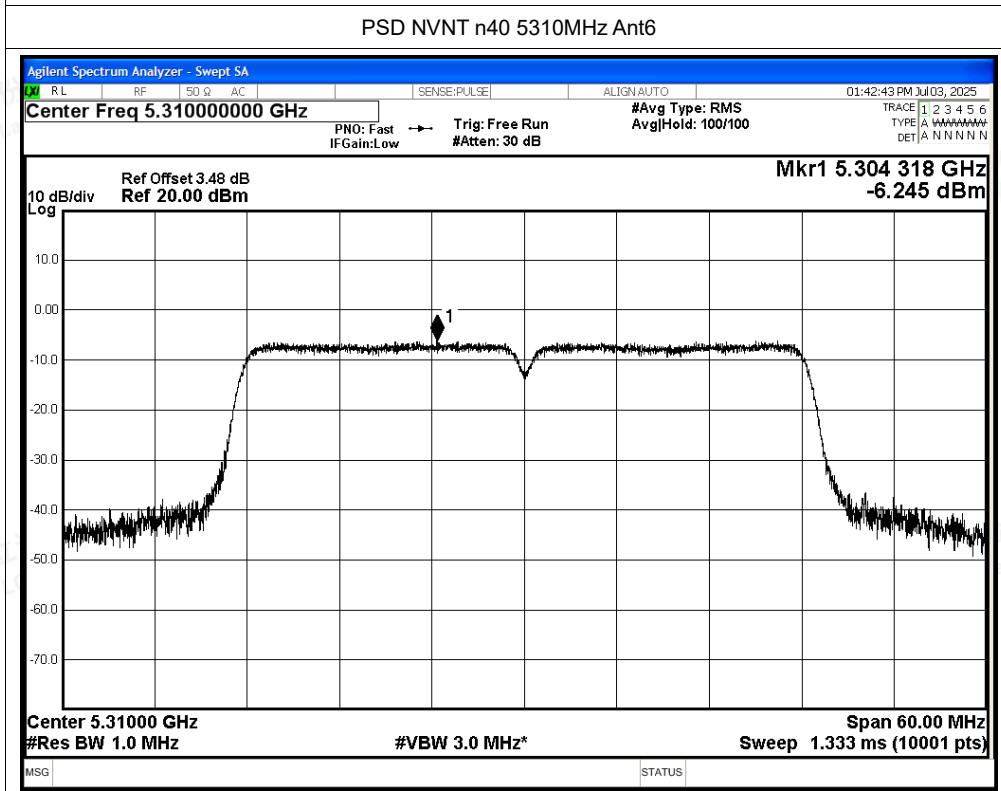


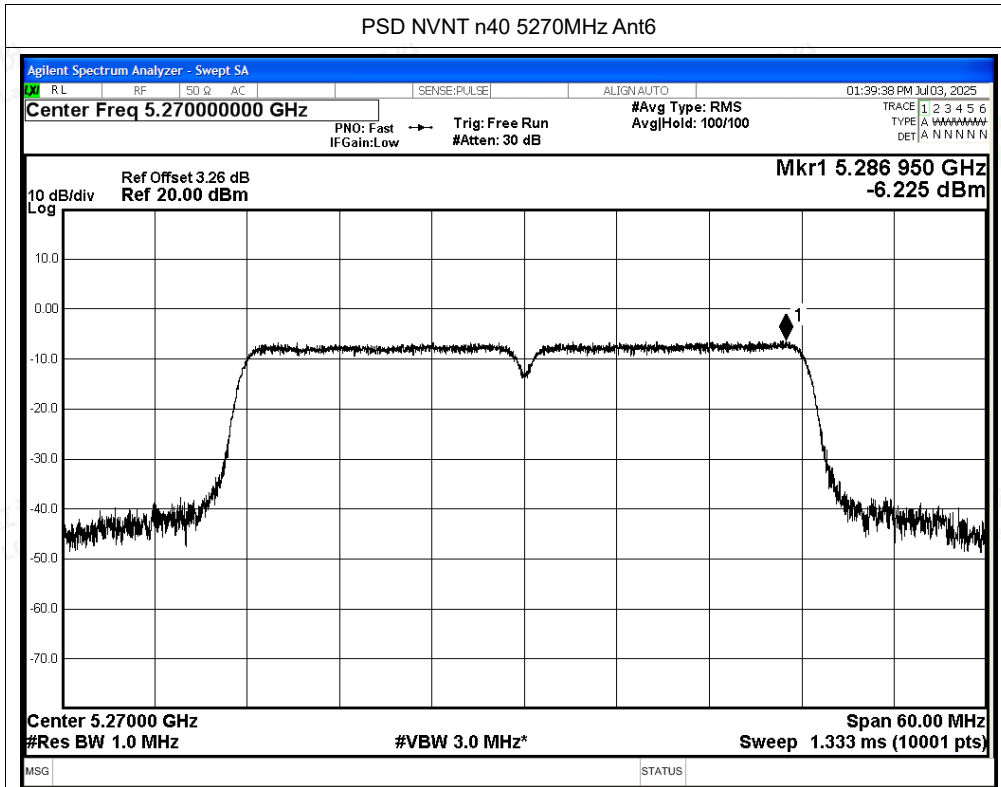

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5260MHz Ant6

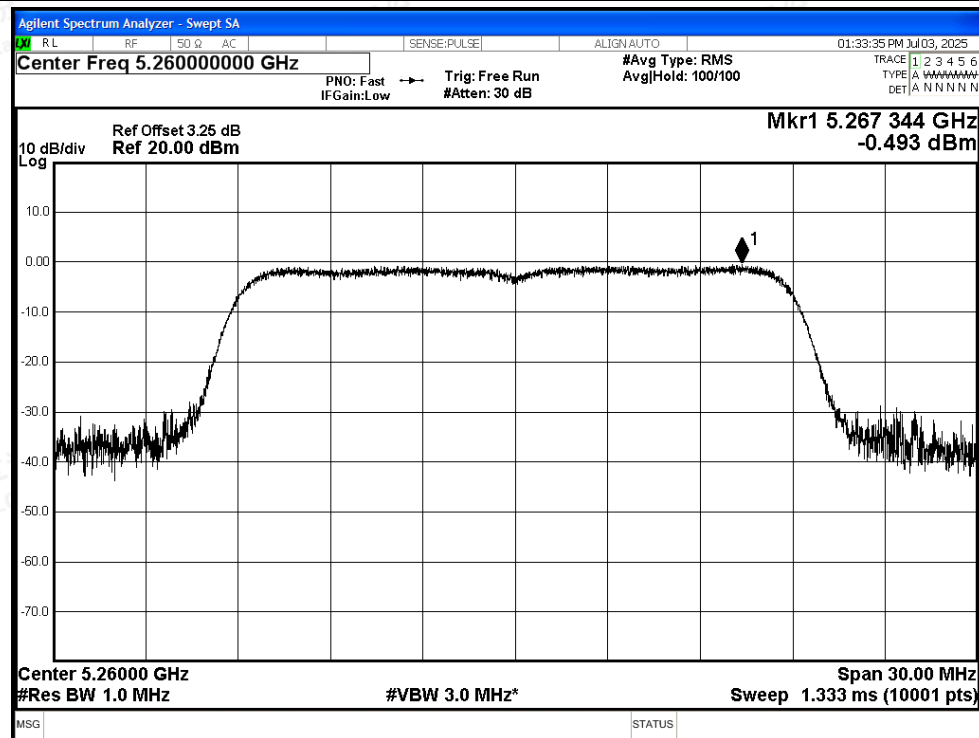

PSD NVNT ac20 5300MHz Ant6

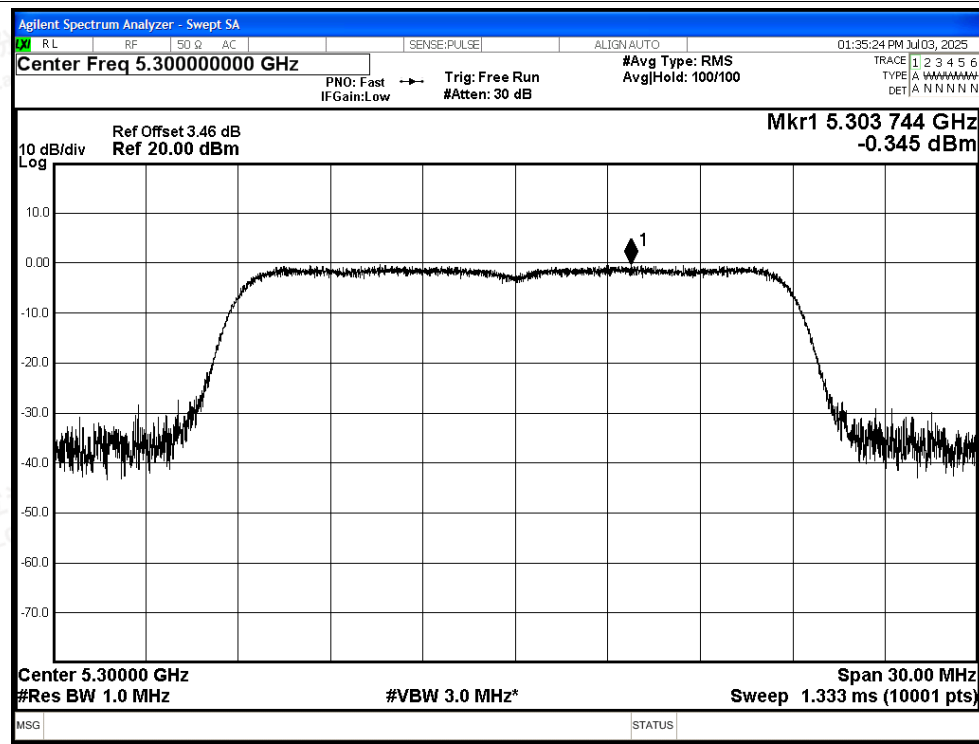

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5320MHz Ant6

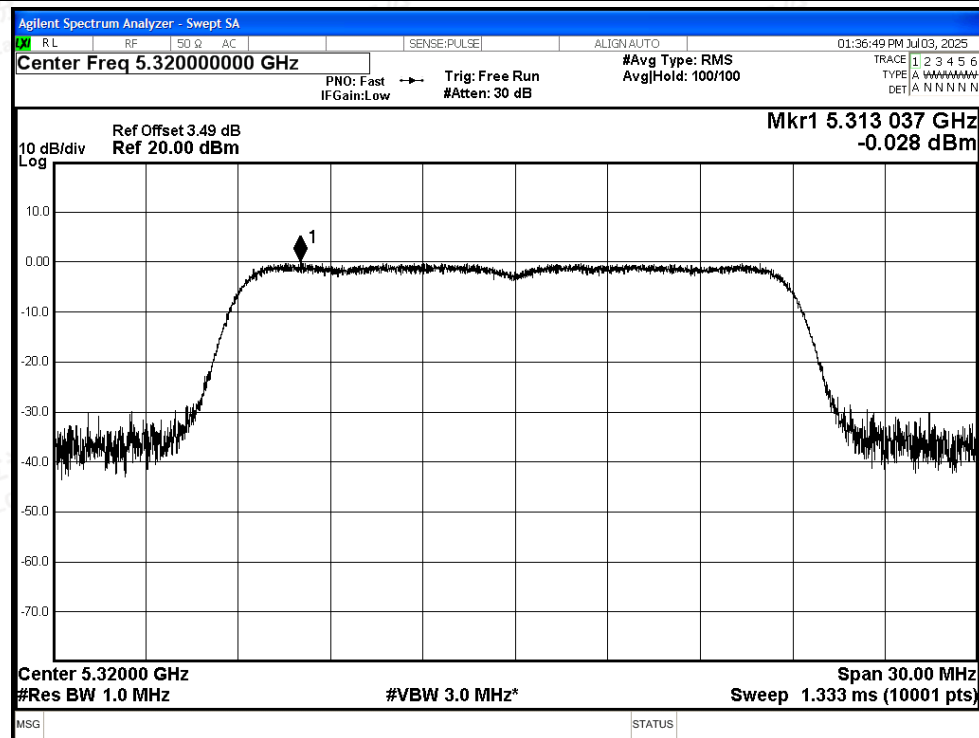


PSD NVNT ac40 5270MHz Ant6

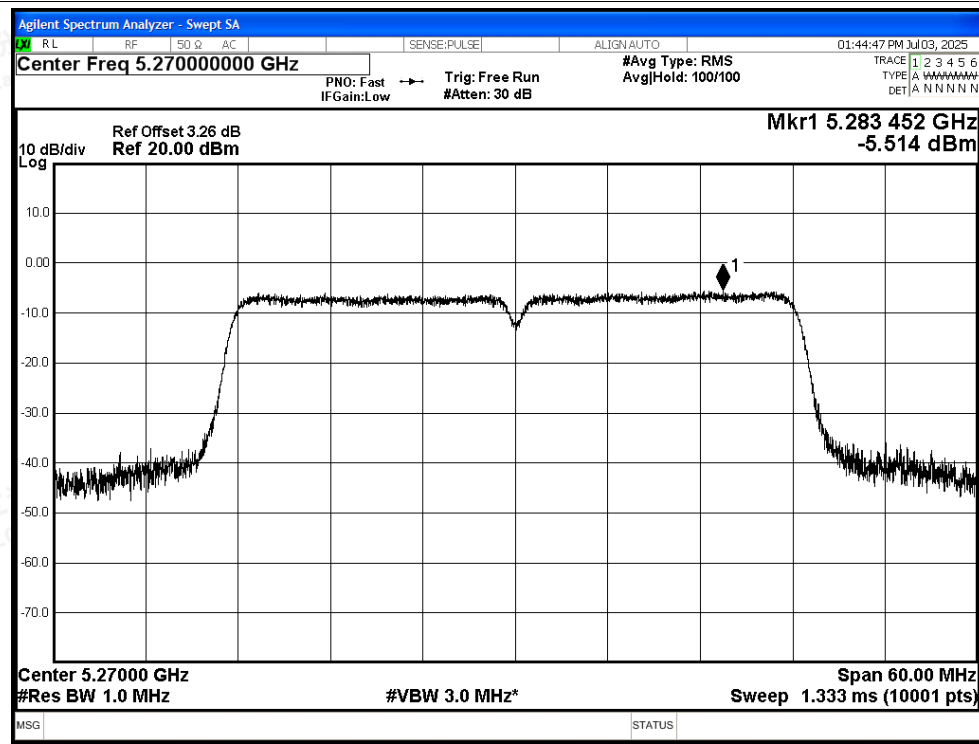




PSD NVNT ac40 5310MHz Ant6

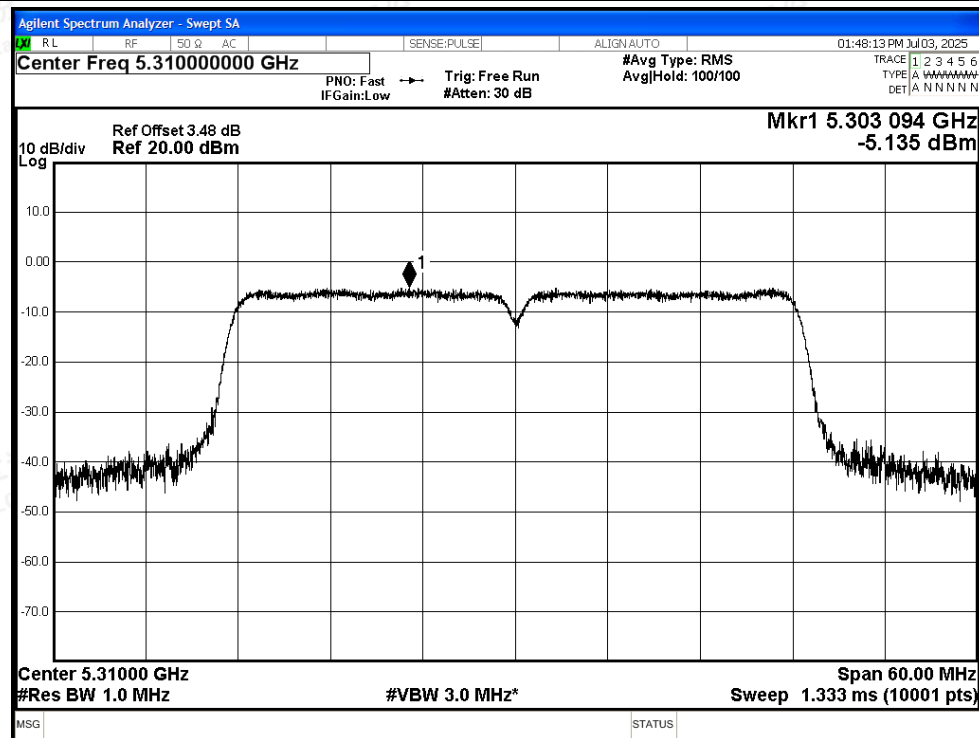

PSD NVNT ac80 5290MHz Ant6

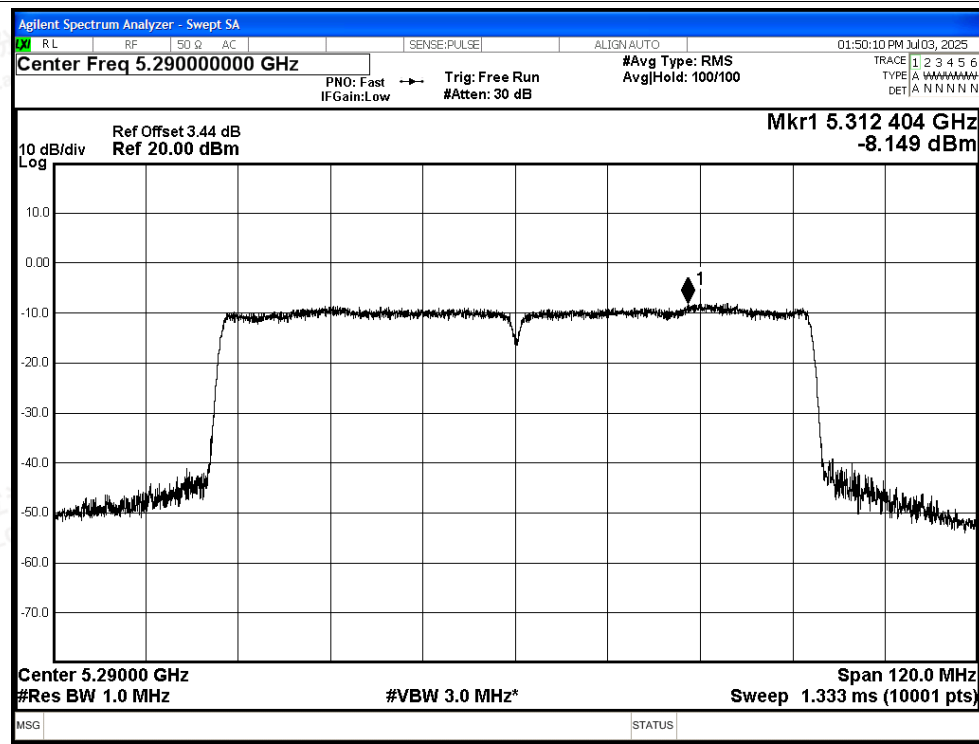

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5260MHz Ant6

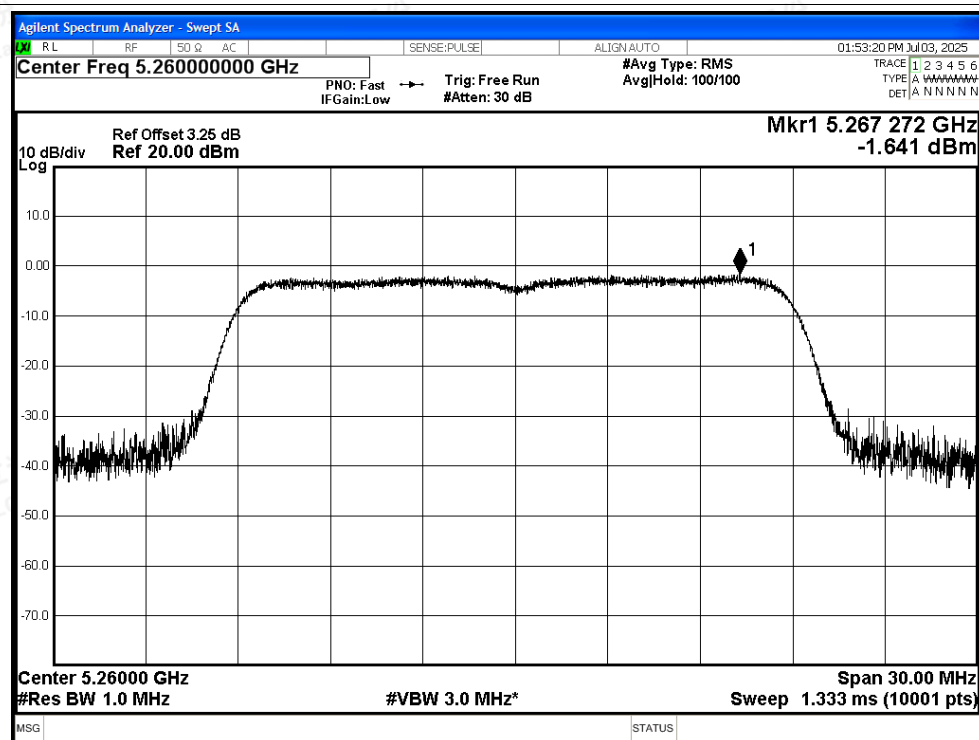

PSD NVNT ax20 5300MHz Ant6

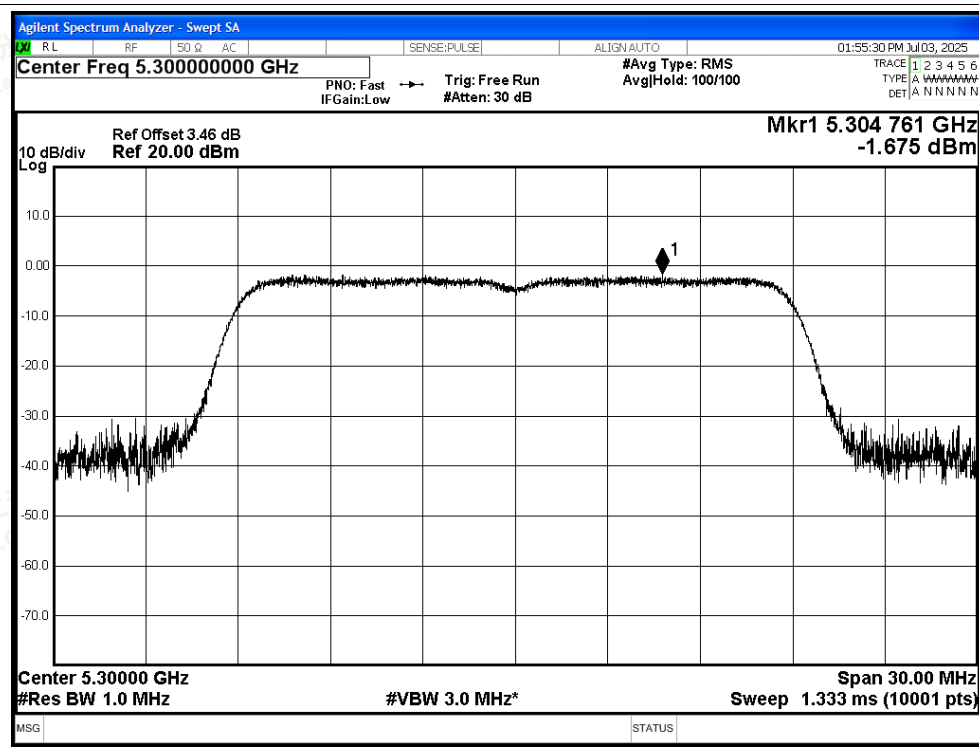

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5320MHz Ant6

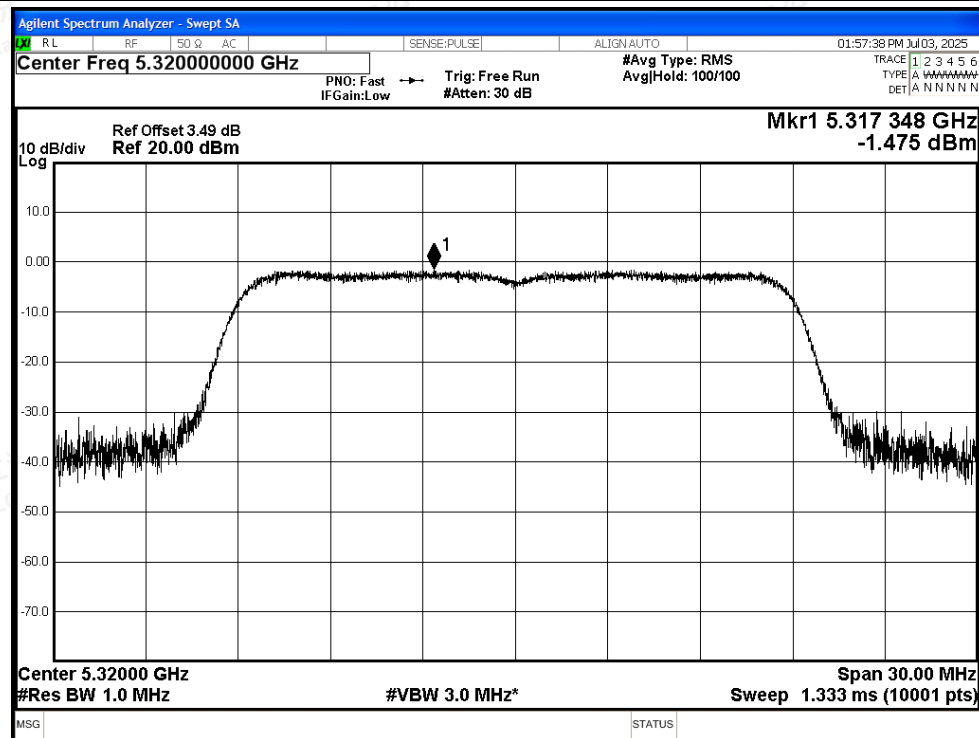

PSD NVNT ax40 5270MHz Ant6

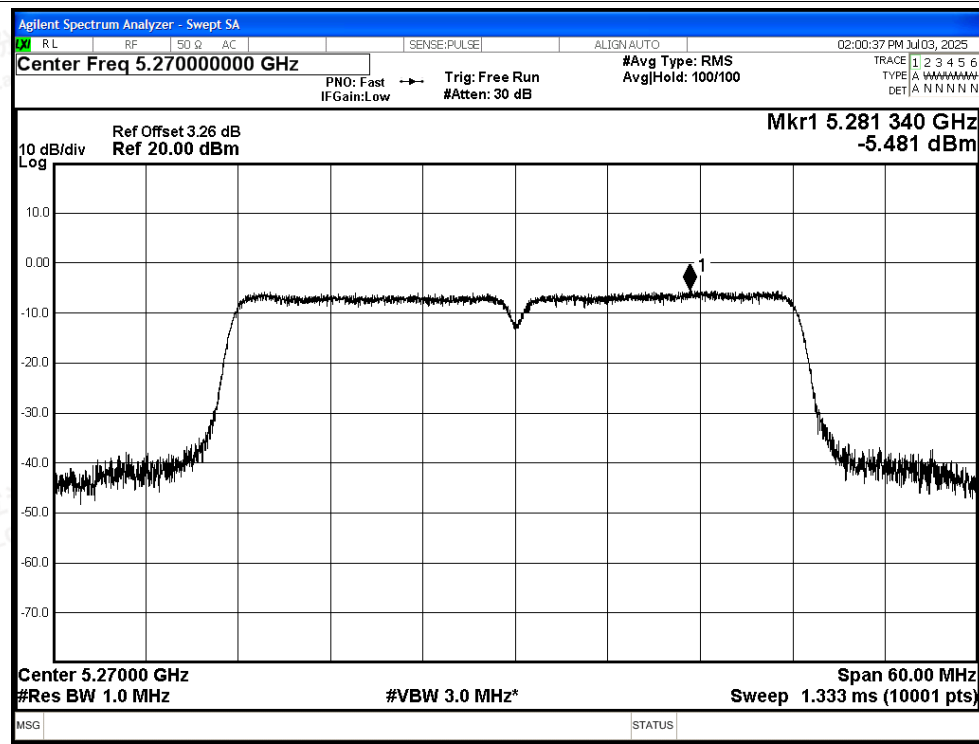

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5310MHz Ant6

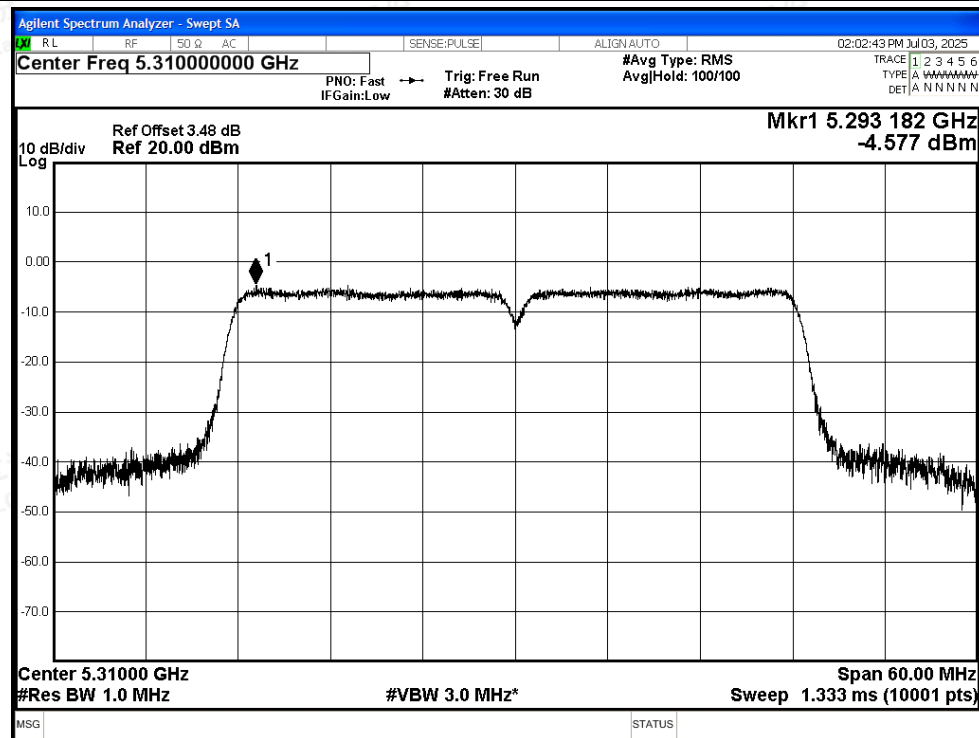

PSD NVNT ax80 5290MHz Ant6

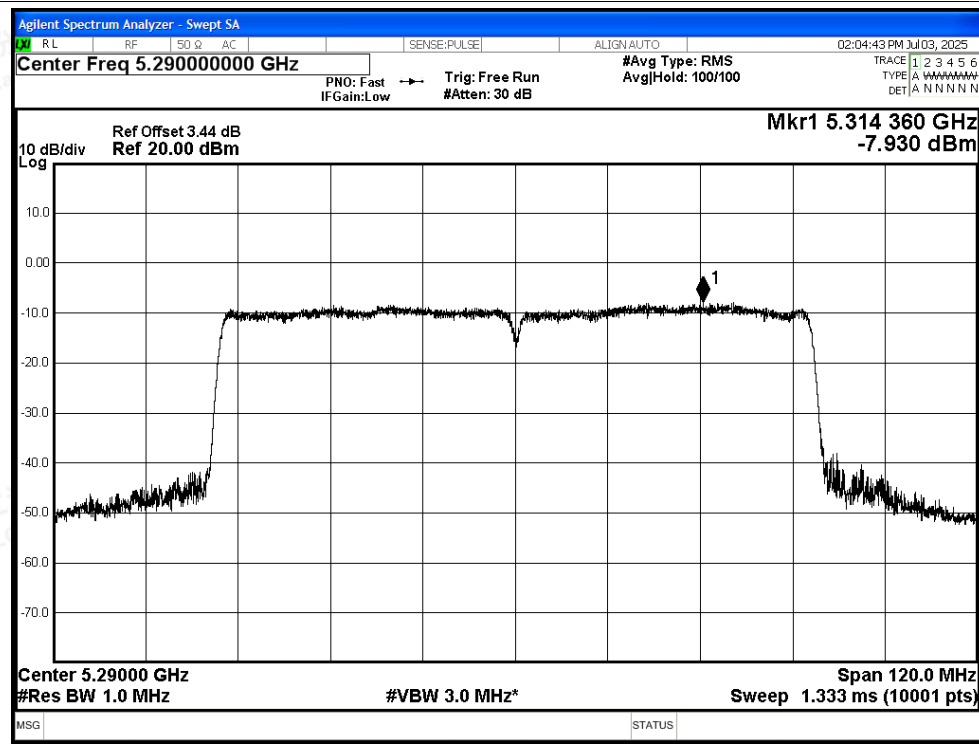

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.92	3.39	-	47.58	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.07	3.39	0.24	39.67	Average	54	Pass
NVNT	a	5260	Ant2	4979.7	-46.22	3.39	-	52.28	Peak	68.2	Pass
NVNT	a	5260	Ant2	4772.22	-56.12	3.39	0.24	42.62	Average	54	Pass
NVNT	a	5260	Ant2	5150	-47.89	3.39	-	50.61	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-56.51	3.39	0.24	42.23	Average	54	Pass
NVNT	a	5320	Ant2	5350	-36.25	3.39	-	62.25	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-52.31	3.39	0.24	46.43	Average	54	Pass
NVNT	a	5320	Ant2	5351	-33	3.39	-	65.50	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.4	-50.73	3.39	0.24	48.01	Average	54	Pass
NVNT	a	5320	Ant2	5460	-50.01	3.39	-	48.49	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.66	3.39	0.24	41.08	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-50.18	3.39	-	48.32	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-58.93	3.39	0.28	39.85	Average	54	Pass
NVNT	n20	5260	Ant2	5146.62	-46.43	3.39	-	52.07	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4787.04	-55.9	3.39	0.28	42.88	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-48.78	3.39	-	49.72	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-56.41	3.39	0.28	42.37	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-37.7	3.39	-	60.80	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-51.8	3.39	0.28	46.98	Average	54	Pass
NVNT	n20	5320	Ant2	5353.2	-36.6	3.39	-	61.90	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-51.8	3.39	0.28	46.98	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-51.18	3.39	-	47.32	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.47	3.39	0.28	41.31	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-50.5	3.39	-	48.00	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-59.01	3.39	0.54	40.03	Average	54	Pass
NVNT	n40	5270	Ant2	4772.97	-45.38	3.39	-	53.12	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4806.99	-53.5	3.39	0.54	45.54	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-48.75	3.39	-	49.75	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-56.79	3.39	0.54	42.25	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-40.41	3.39	-	58.09	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-50.73	3.39	0.55	48.32	Average	54	Pass
NVNT	n40	5310	Ant2	5350.6	-36.77	3.39	-	61.73	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-50.73	3.39	0.55	48.32	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-50.37	3.39	-	48.13	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.91	3.39	0.55	41.14	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4500	-50.37	3.39	-	48.13	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-58.64	3.39	0.28	40.14	Average	54	Pass
NVNT	ac20	5260	Ant2	4928.22	-46.69	3.39	-	51.81	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5149.74	-55.85	3.39	0.28	42.93	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.76	3.39	-	49.74	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-55.85	3.39	0.28	42.93	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-36.85	3.39	-	61.65	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-50.21	3.39	0.28	48.57	Average	54	Pass
NVNT	ac20	5320	Ant2	5350.2	-35.4	3.39	-	63.1	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-50.21	3.39	0.28	48.57	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-48.75	3.39	-	49.75	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.26	3.39	0.28	41.52	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-50.78	3.39	-	47.72	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.85	3.39	0.54	40.19	Average	54	Pass
NVNT	ac40	5270	Ant2	4775.4	-44.98	3.39	-	53.52	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.18	-53.14	3.39	0.54	45.90	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-50.14	3.39	-	48.36	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-56.8	3.39	0.54	42.24	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-33.87	3.39	-	64.63	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-51.16	3.39	0.53	47.87	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-33.87	3.39	-	64.63	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.2	-51.15	3.39	0.53	47.88	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.34	3.39	-	49.16	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.47	3.39	0.53	41.56	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-48.37	3.39	-	50.13	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.63	3.39	0.99	40.86	Average	54	Pass
NVNT	ac80	5290	Ant2	5095.95	-45.04	3.39	-	53.46	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5144.67	-55.84	3.39	0.99	43.65	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-48.27	3.39	-	50.23	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-56.28	3.39	0.99	43.21	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-39.45	3.39	-	59.05	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-50.87	3.39	0.99	48.62	Average	54	Pass
NVNT	ac80	5290	Ant2	5356.5	-37.28	3.39	-	61.22	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5351	-50.49	3.39	0.99	49.00	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-49.88	3.39	-	48.62	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.66	3.39	0.99	41.83	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-50.05	3.39	-	48.45	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-58.68	3.39	0.28	40.10	Average	54	Pass
NVNT	ax20	5260	Ant2	5110.74	-46.03	3.39	-	52.47	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4787.82	-55.62	3.39	0.28	43.16	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-48.14	3.39	-	50.36	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5260	Ant2	5150	-56.37	3.39	0.28	42.41	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-38.52	3.39	-	59.98	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-46.95	3.39	0.28	51.83	Average	54	Pass
NVNT	ax20	5320	Ant2	5353.4	-32.75	3.39	-	65.75	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-46.95	3.39	0.28	51.83	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-49.93	3.39	-	48.57	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.56	3.39	0.28	41.22	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-49.53	3.39	-	48.97	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-59.12	3.39	0.53	39.91	Average	54	Pass
NVNT	ax40	5270	Ant2	4773.78	-45.2	3.39	-	53.30	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.18	-53.09	3.39	0.53	45.94	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-47.71	3.39	-	50.79	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.66	3.39	0.53	42.37	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-37.62	3.39	-	60.88	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-48.49	3.39	0.53	50.54	Average	54	Pass
NVNT	ax40	5310	Ant2	5350.8	-34.02	3.39	-	64.48	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-48.49	3.39	0.53	50.54	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-50.44	3.39	-	48.06	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.42	3.39	0.53	41.61	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-40.9	3.39	-	57.6	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-49.4	3.39	0.99	50.09	Average	54	Pass
NVNT	ax80	5290	Ant2	5350.75	-38.95	3.39	-	59.55	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350.75	-49.25	3.39	0.99	50.24	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-49.46	3.39	-	49.04	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.32	3.39	0.99	42.17	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-50.12	3.39	-	48.38	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.84	3.39	0.99	40.65	Average	54	Pass
NVNT	ax80	5290	Ant2	5149.02	-45.36	3.39	-	53.14	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5133.36	-55.42	3.39	0.99	44.07	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-48.39	3.39	-	50.11	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-55.7	3.39	0.99	43.79	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

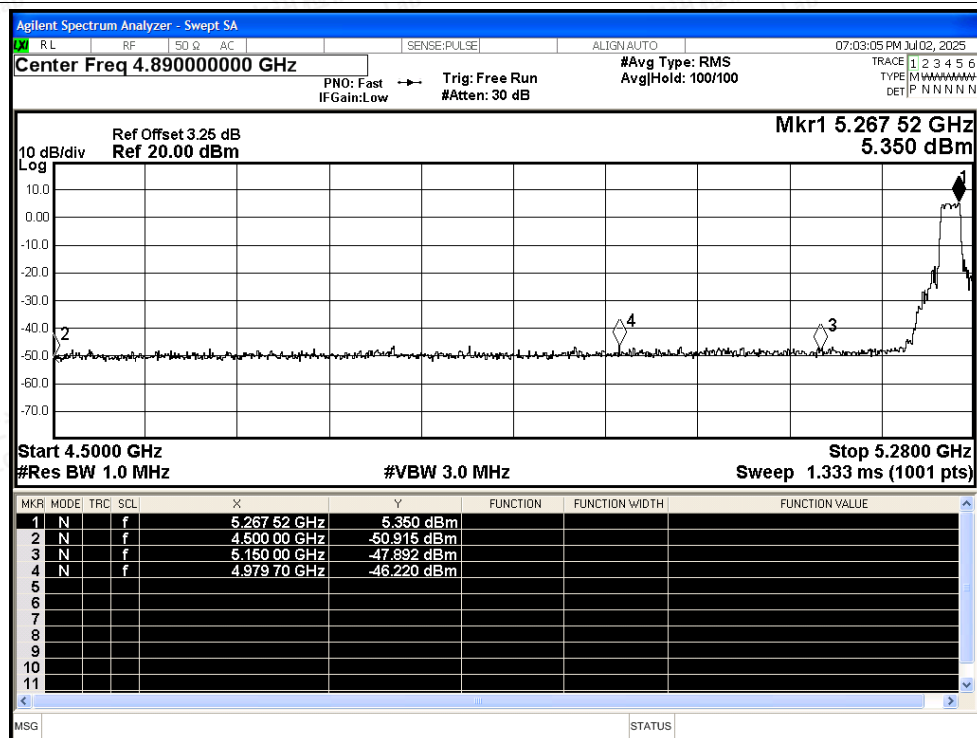

Restrict Band NVNT a 5260MHz Ant2 Average

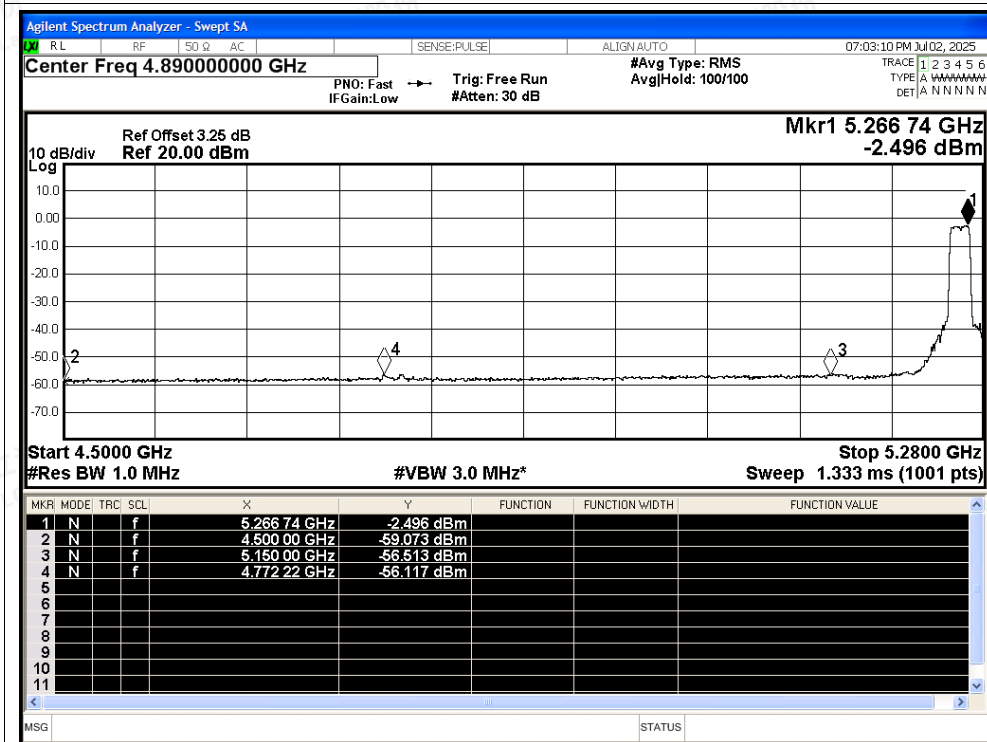

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

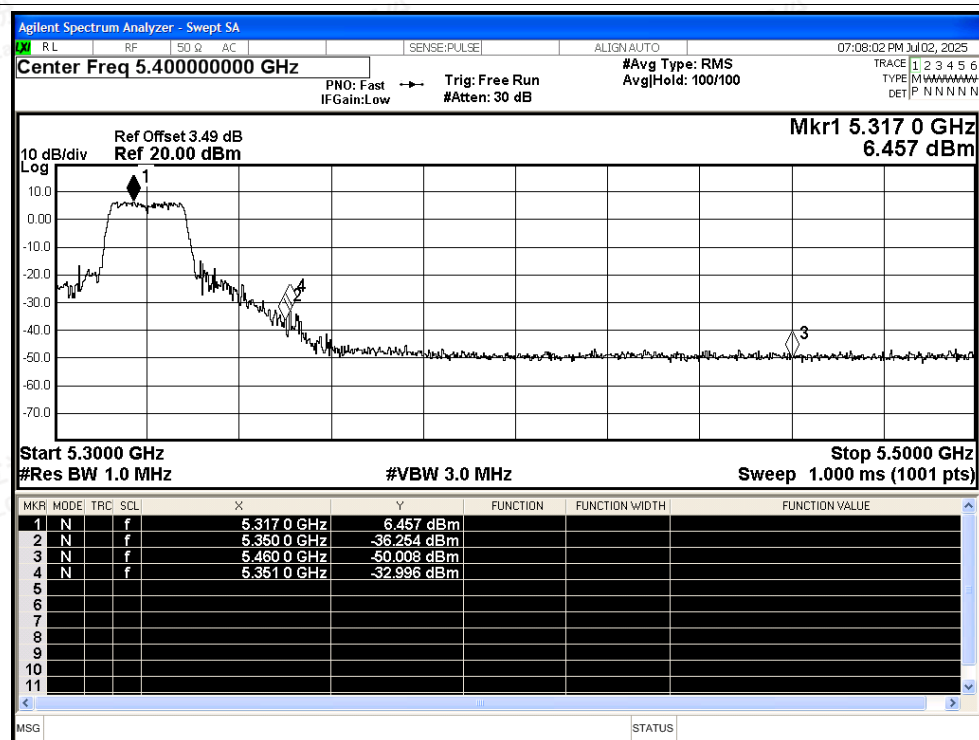

Restrict Band NVNT a 5320MHz Ant2 Average

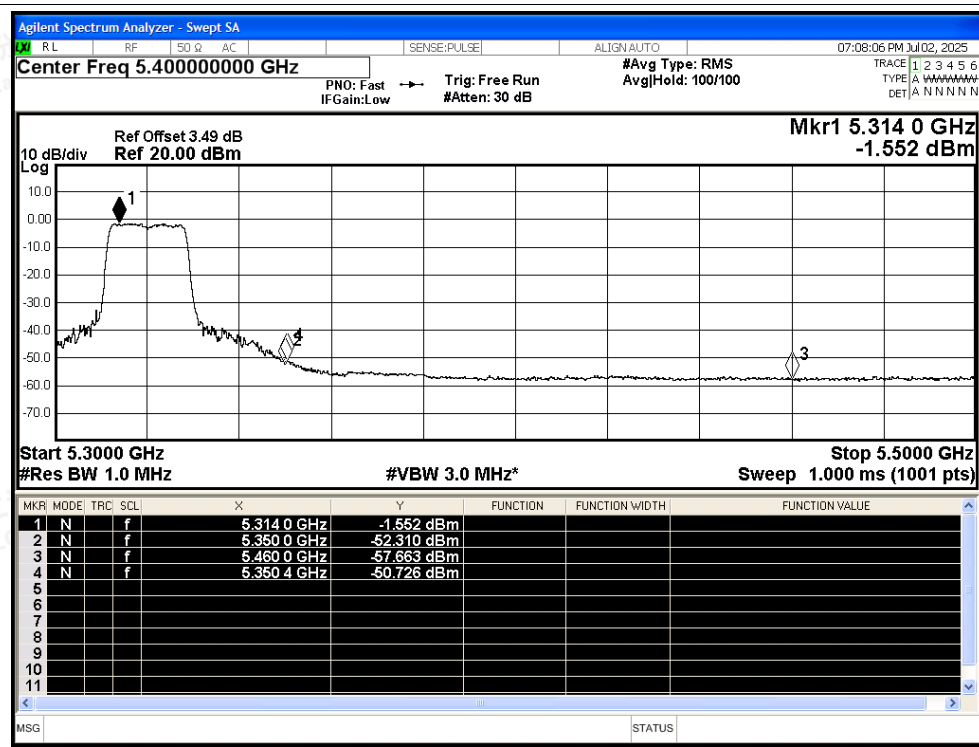

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

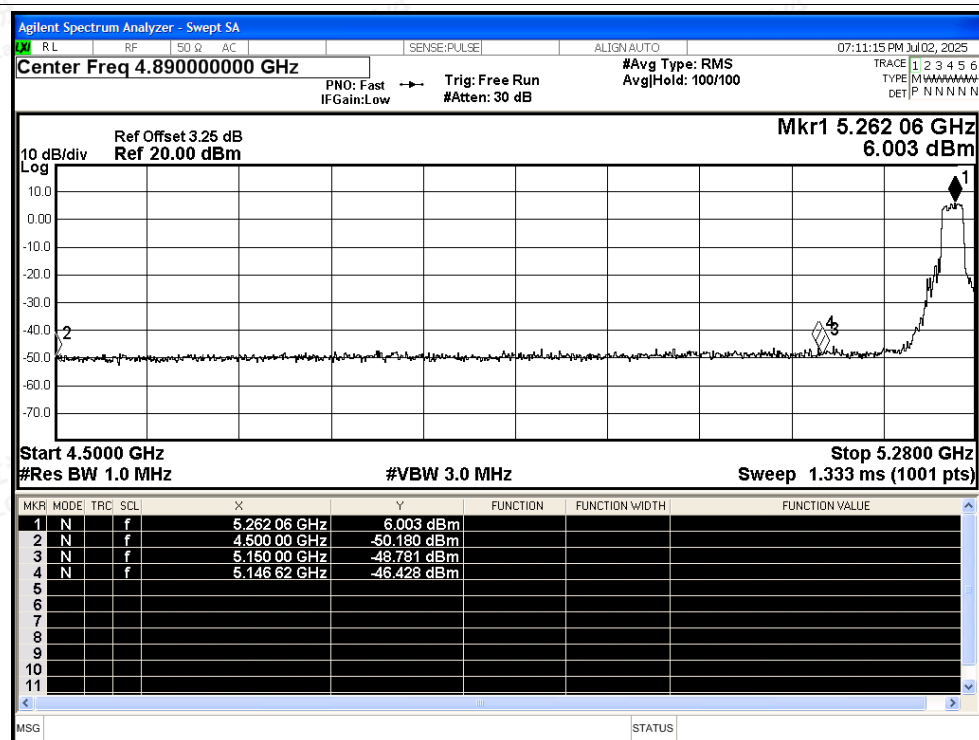

Restrict Band NVNT n20 5260MHz Ant2 Average

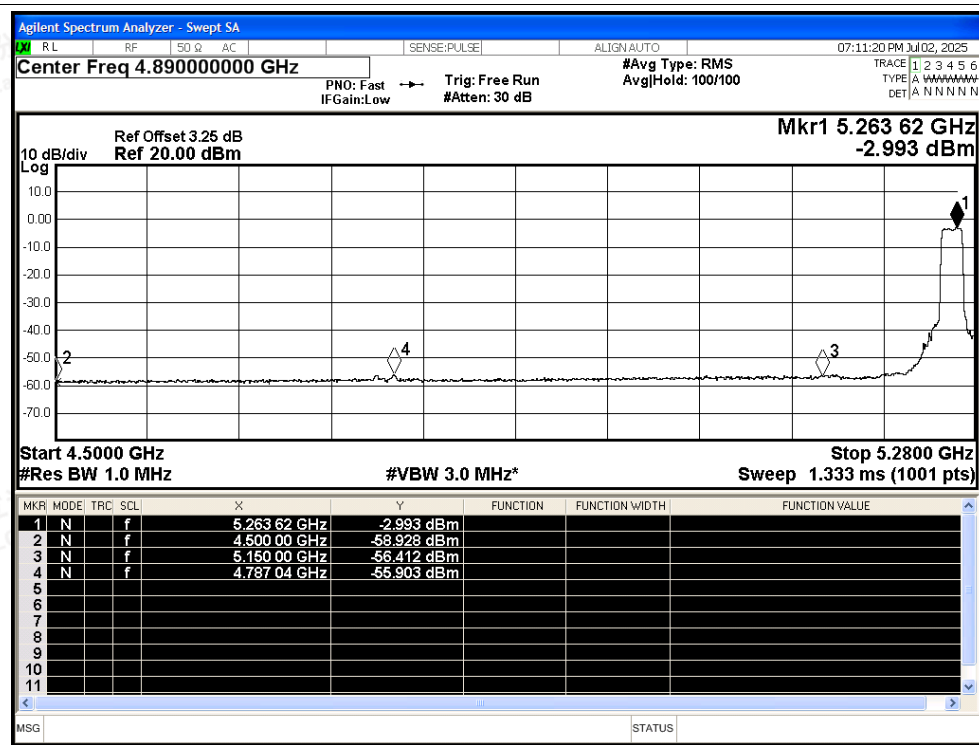

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

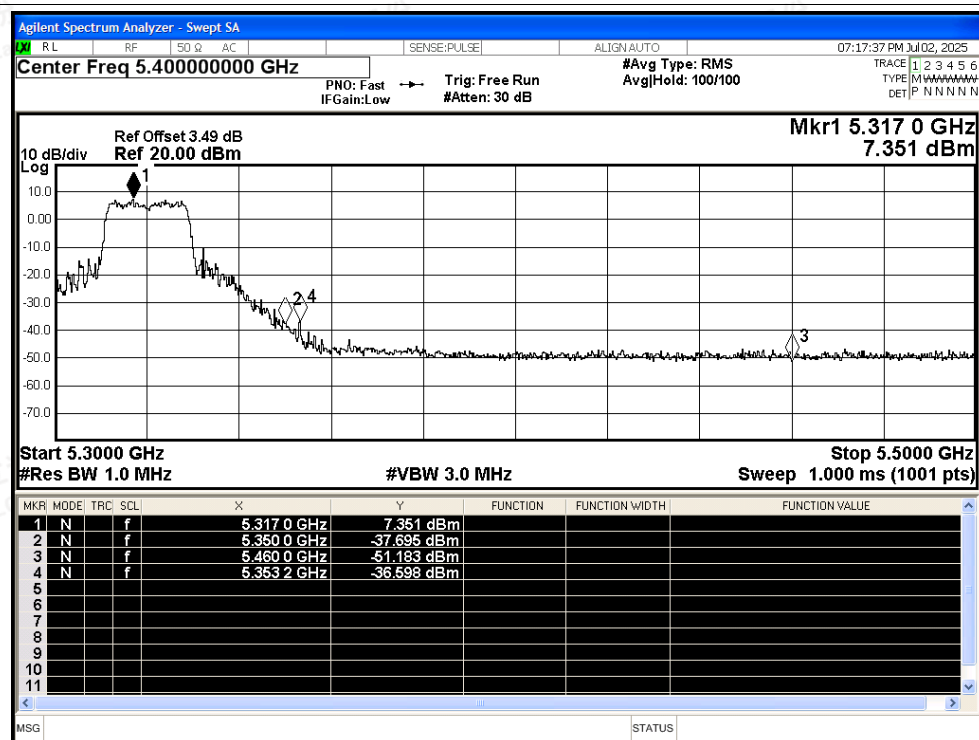

Restrict Band NVNT n20 5320MHz Ant2 Average

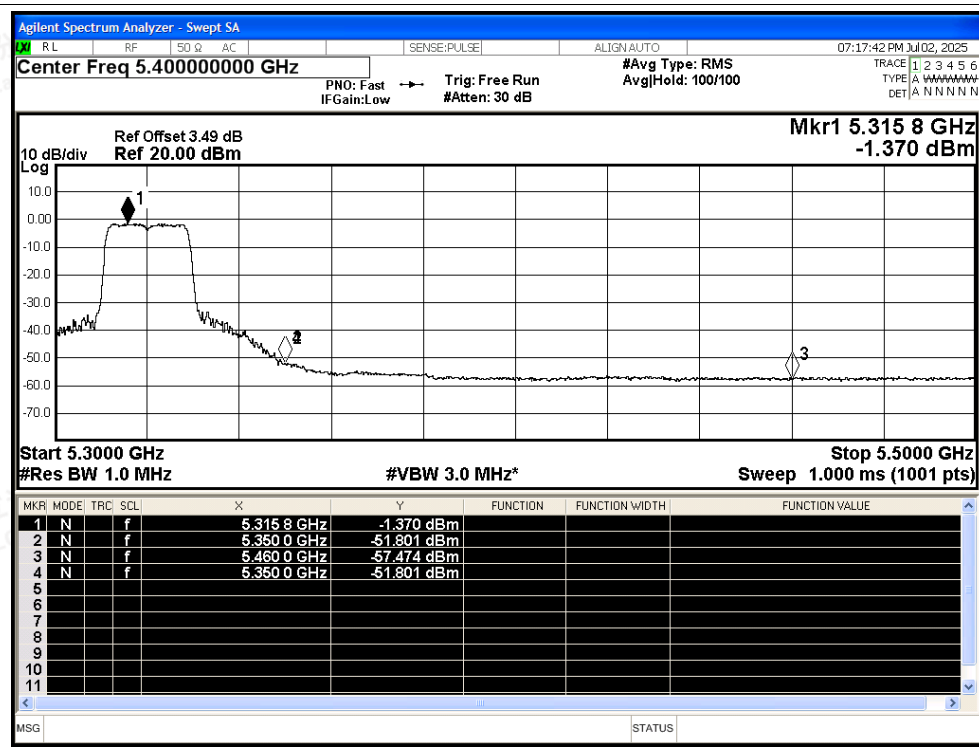

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

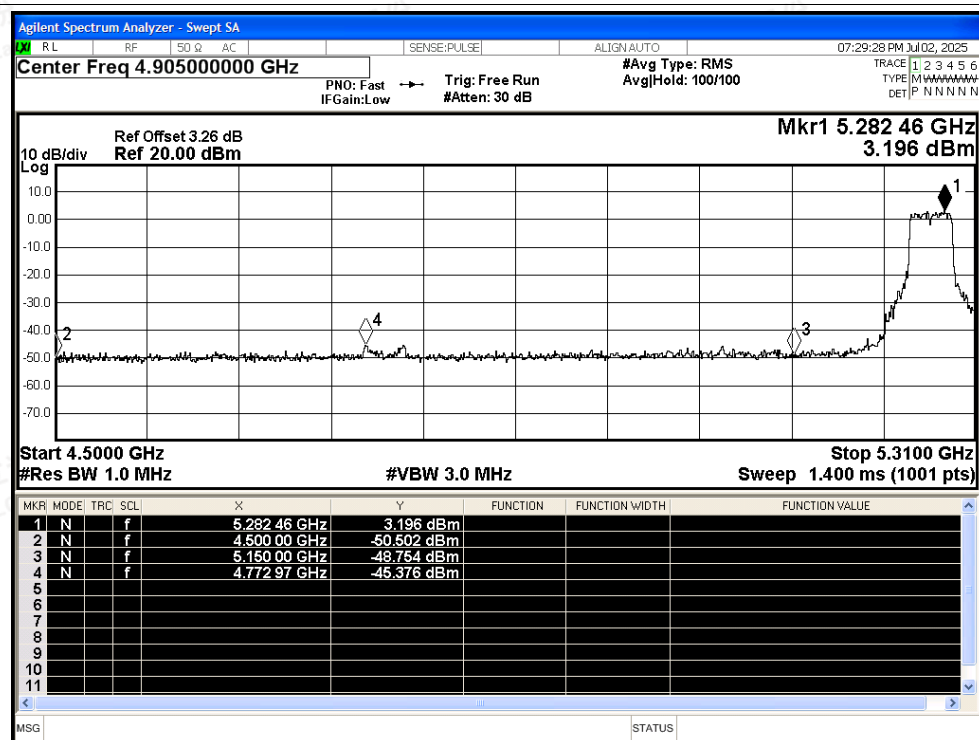

Restrict Band NVNT n40 5270MHz Ant2 Average

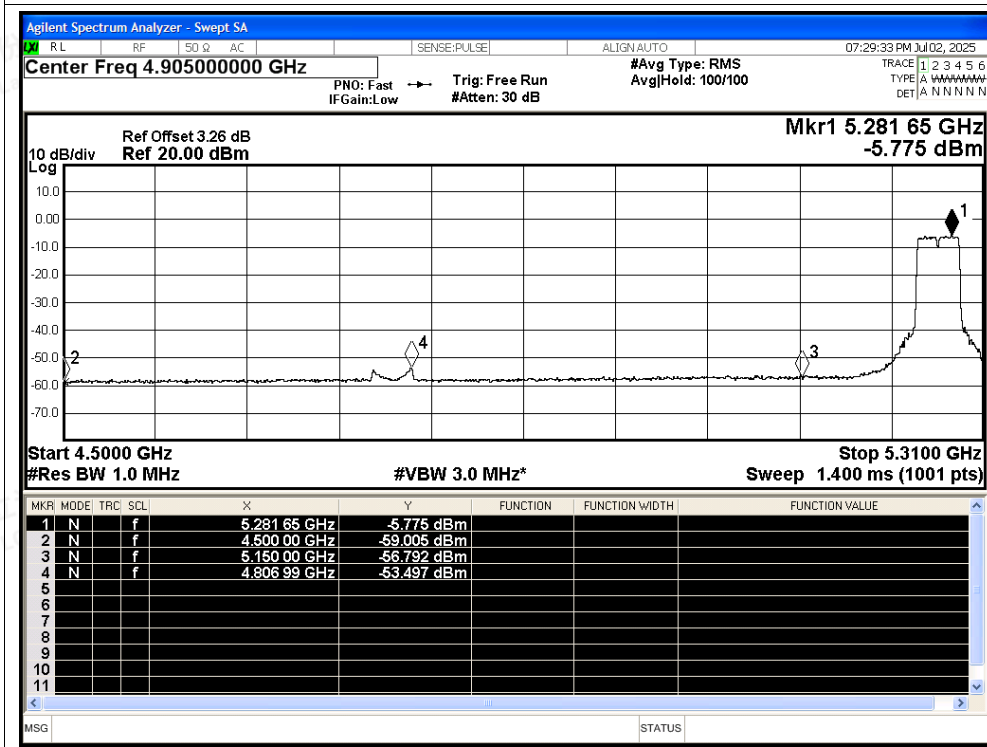

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

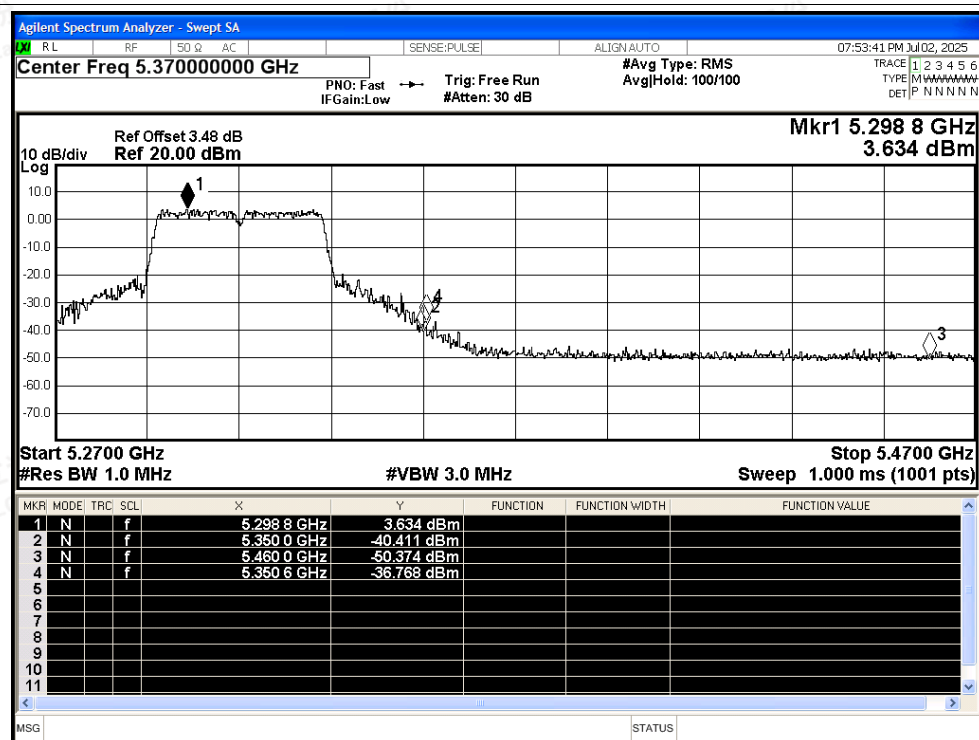

Restrict Band NVNT n40 5310MHz Ant2 Average

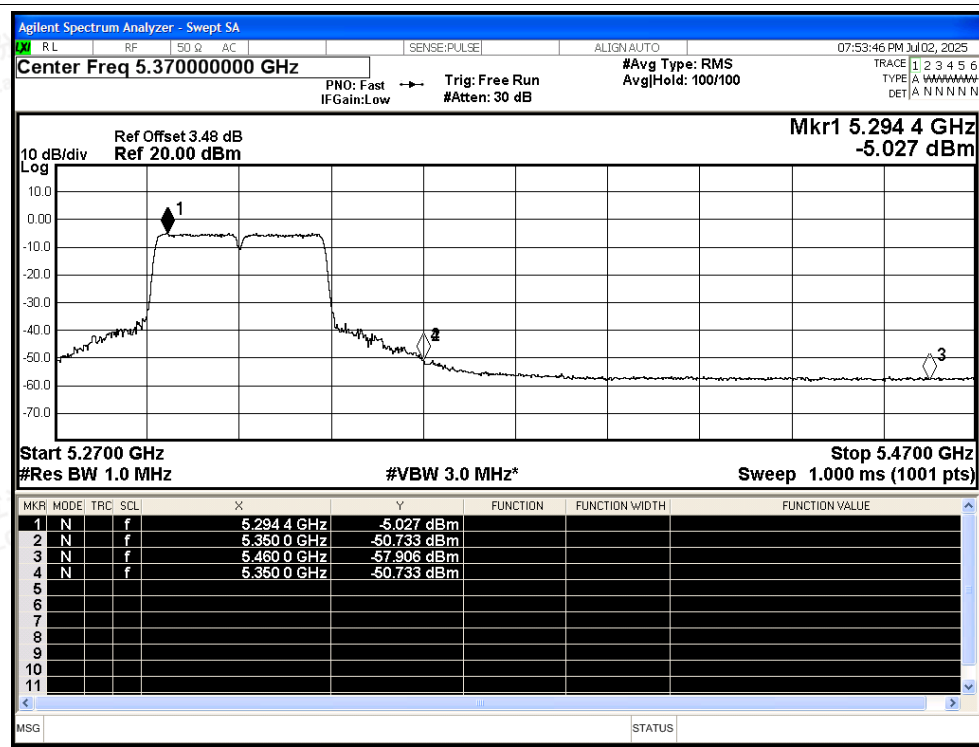

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

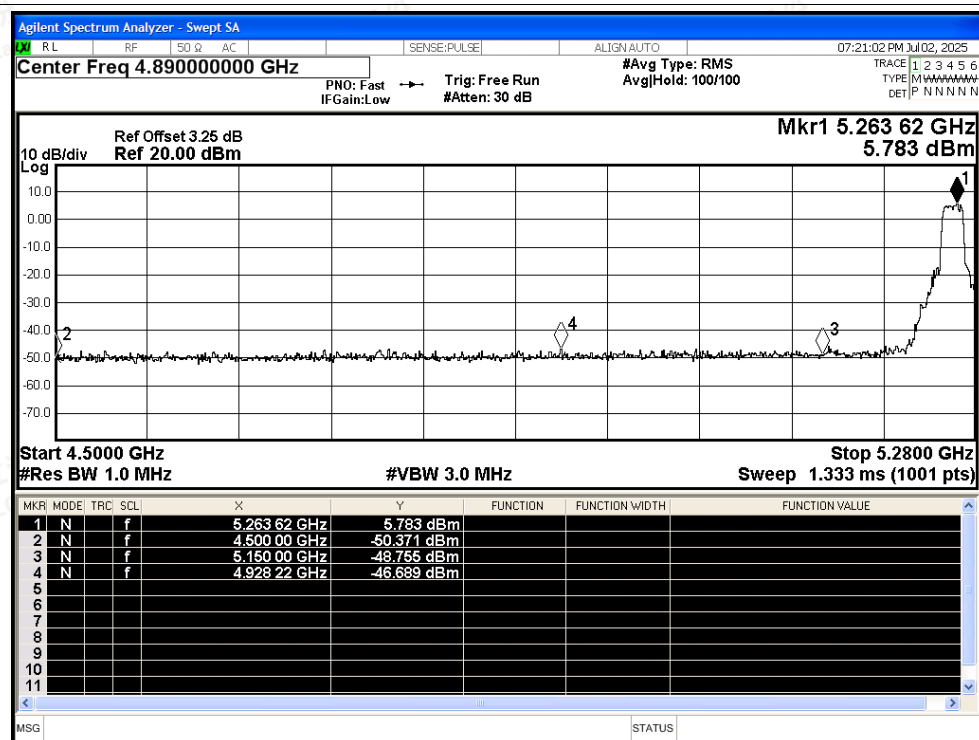

Restrict Band NVNT ac20 5260MHz Ant2 Average

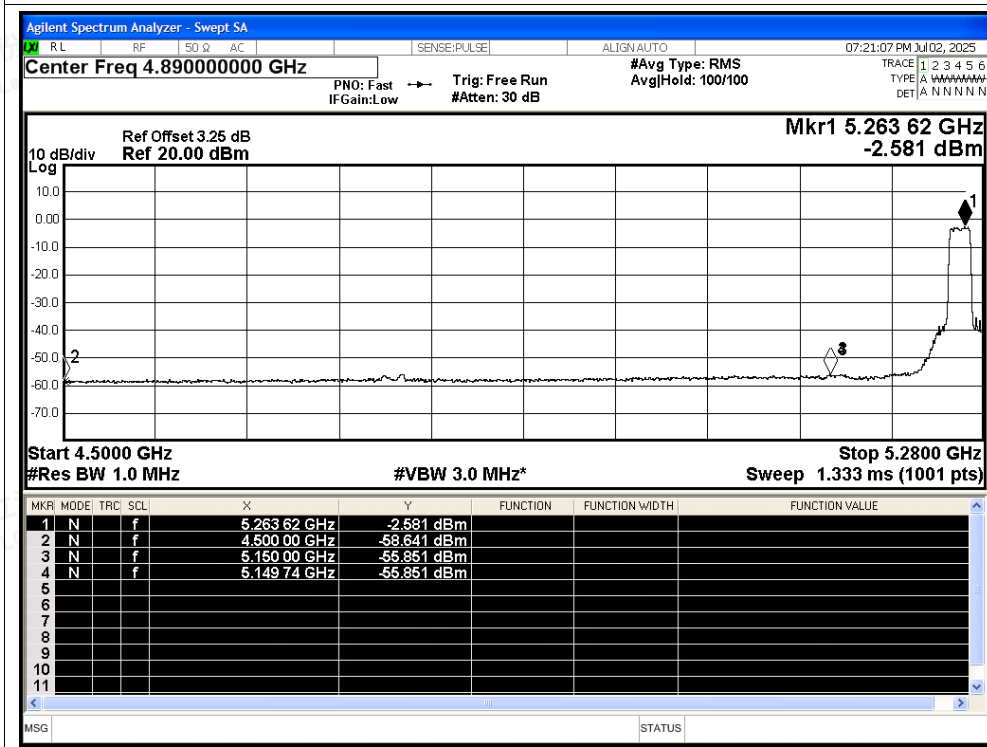

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

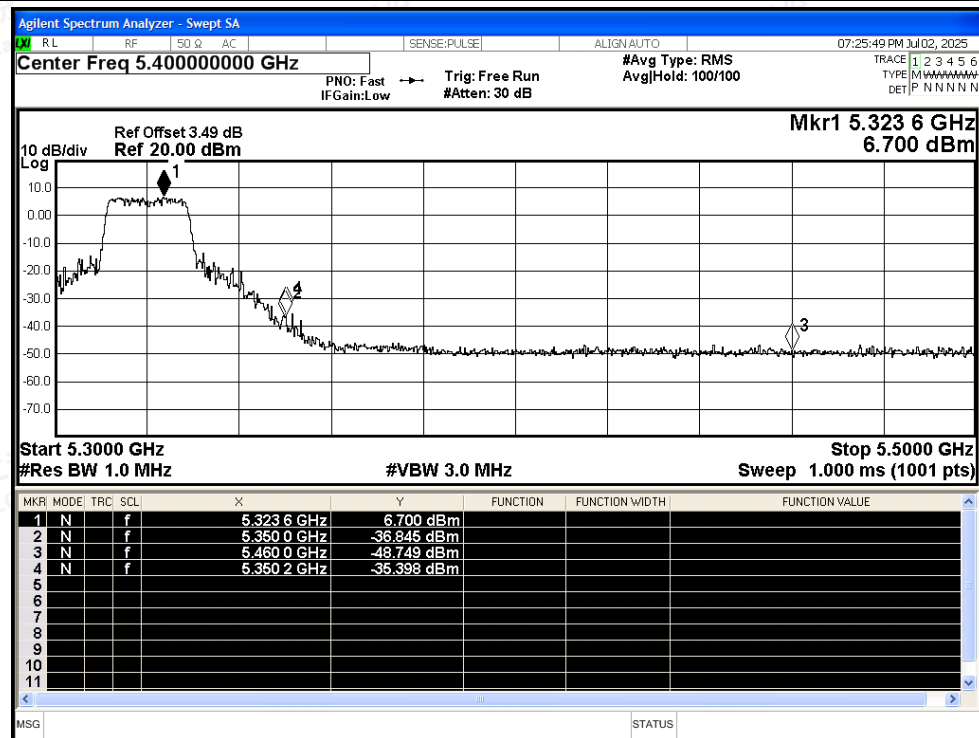

Restrict Band NVNT ac20 5320MHz Ant2 Average

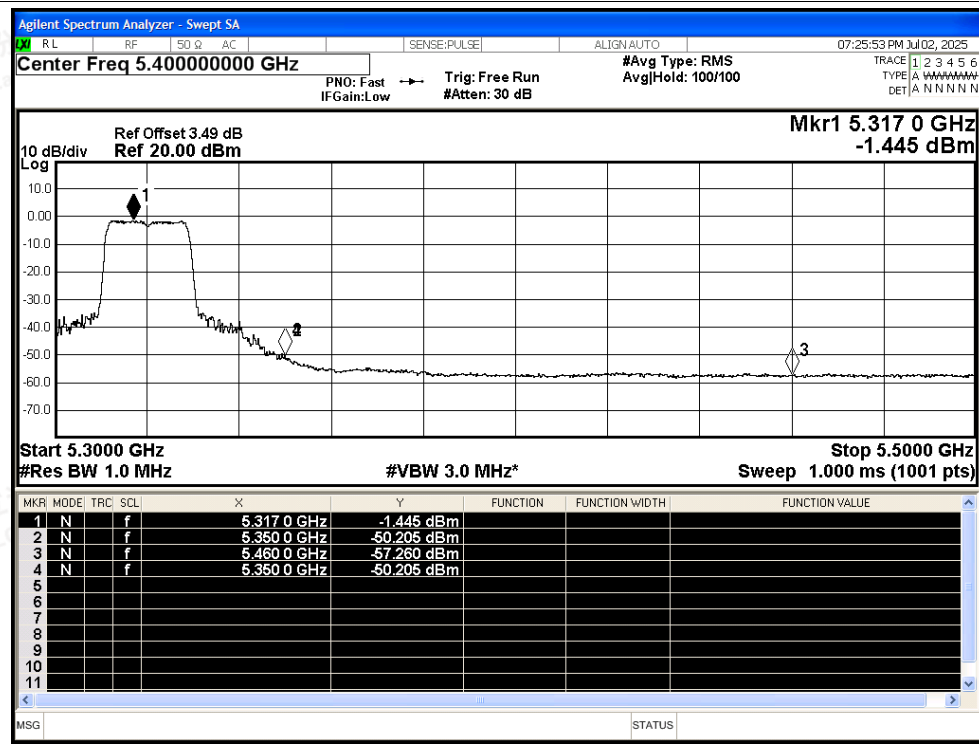

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

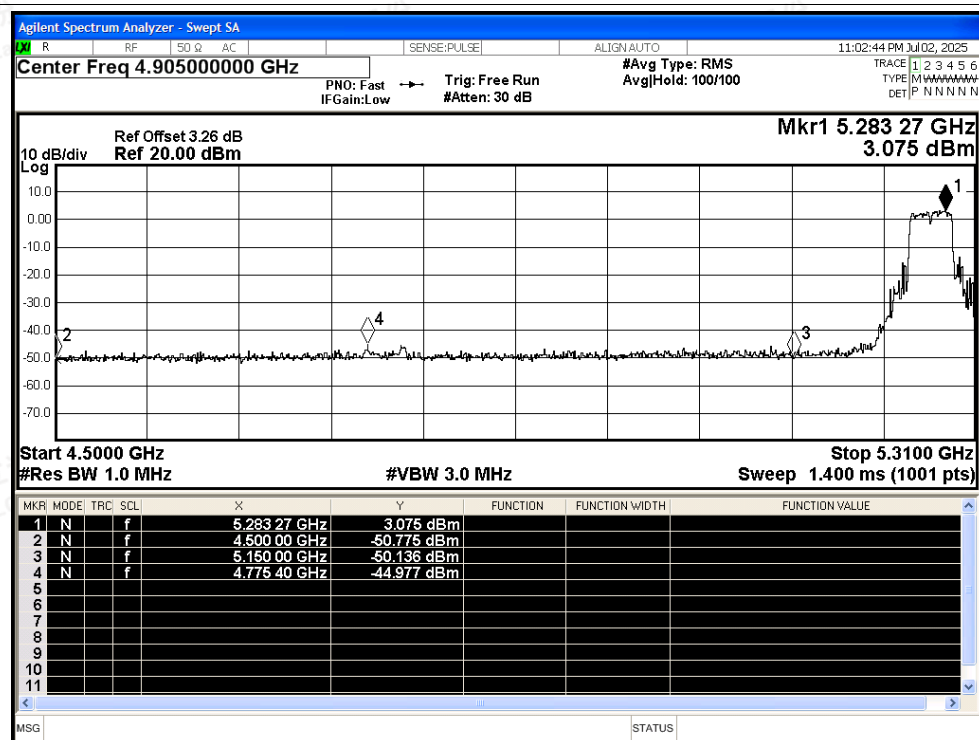

Restrict Band NVNT ac40 5270MHz Ant2 Average

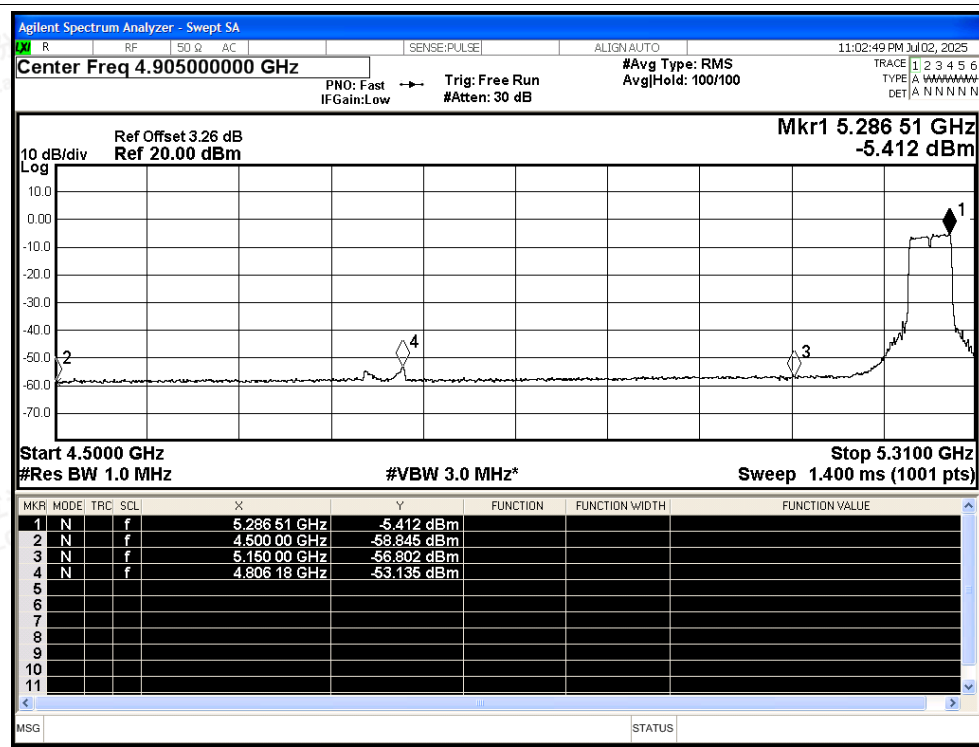

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

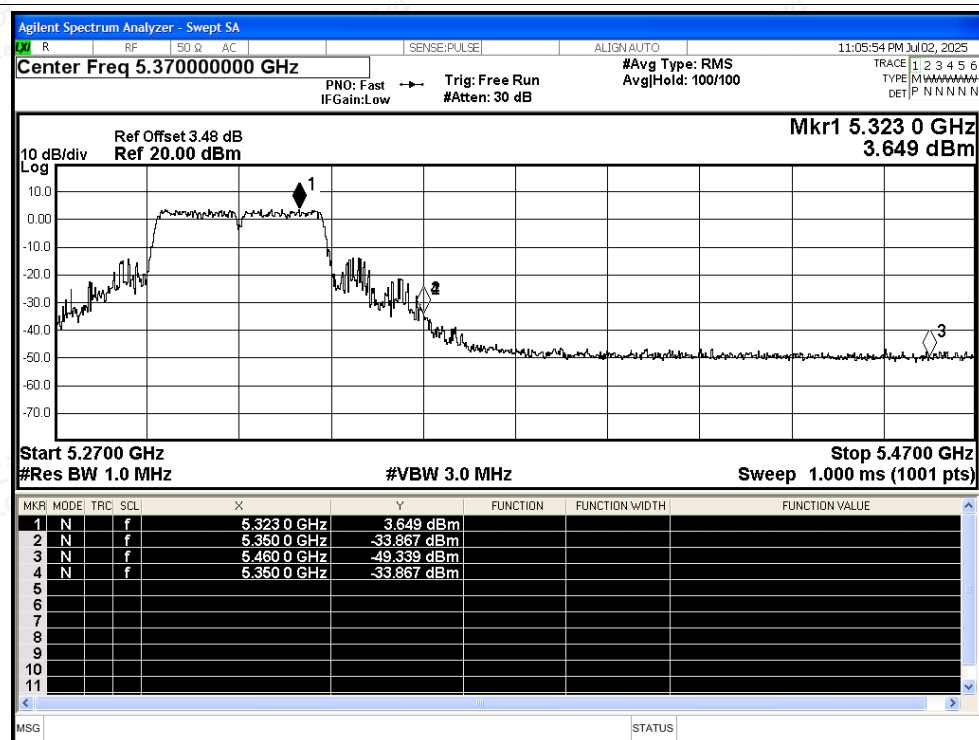

Restrict Band NVNT ac40 5310MHz Ant2 Average

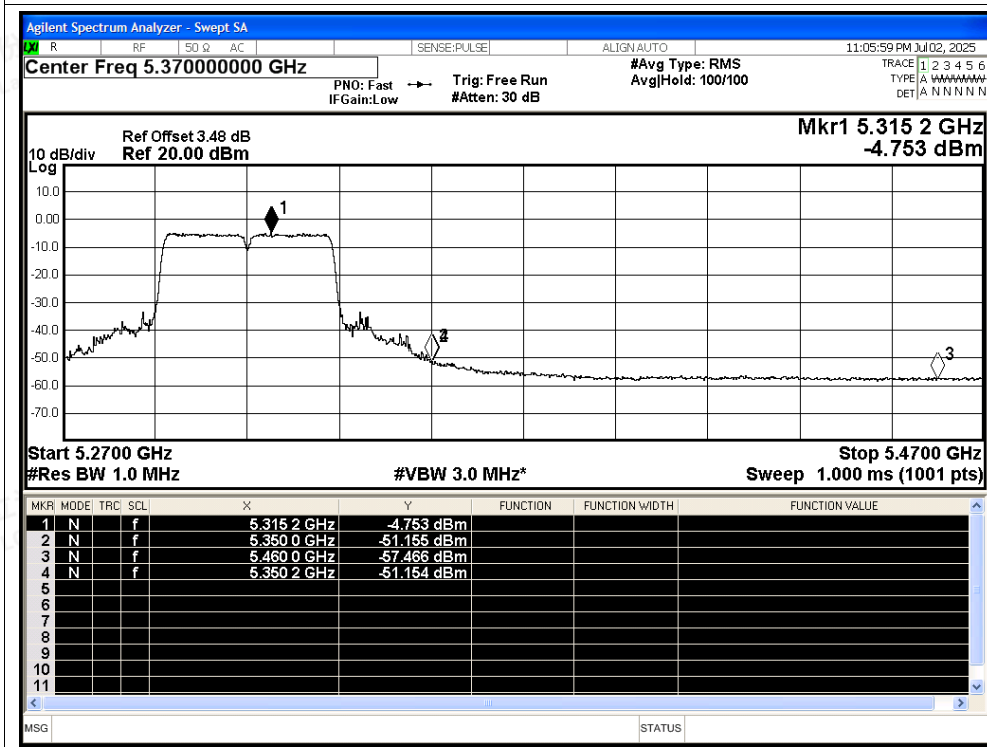

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

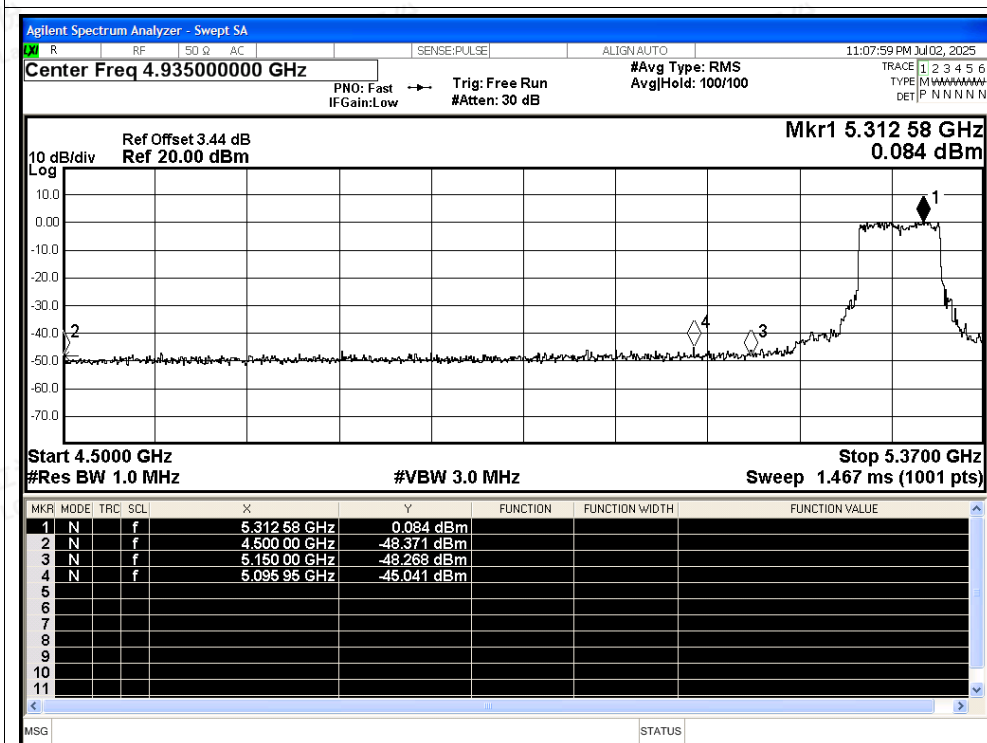

Restrict Band NVNT ac80 5290MHz Ant2 Average

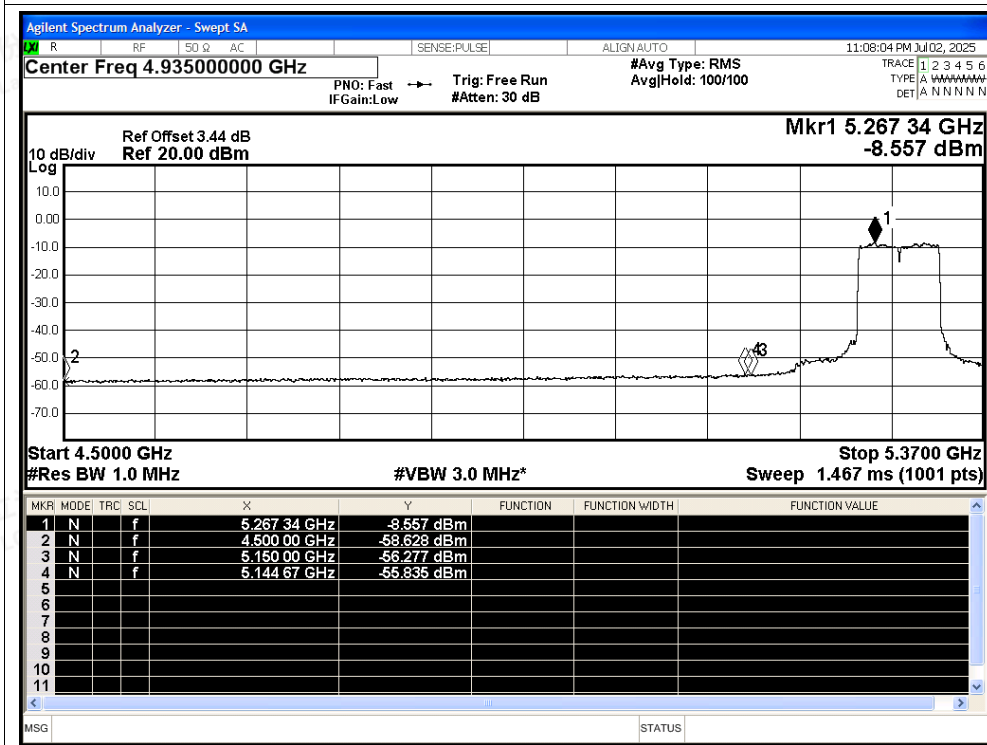

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

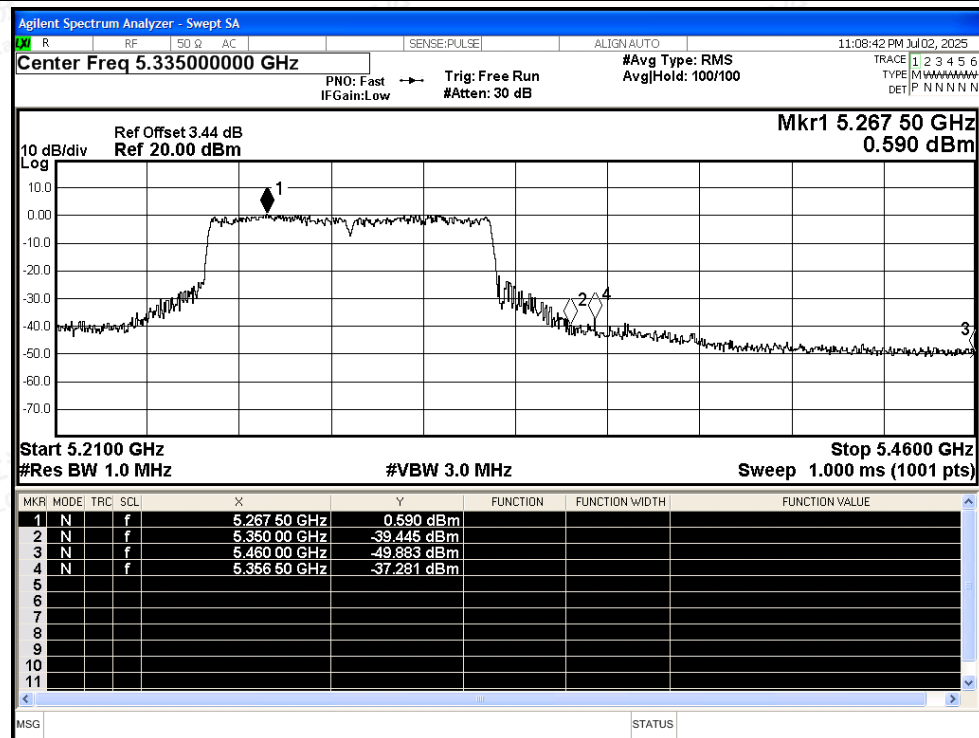

Restrict Band NVNT ac80 5290MHz Ant2 Average

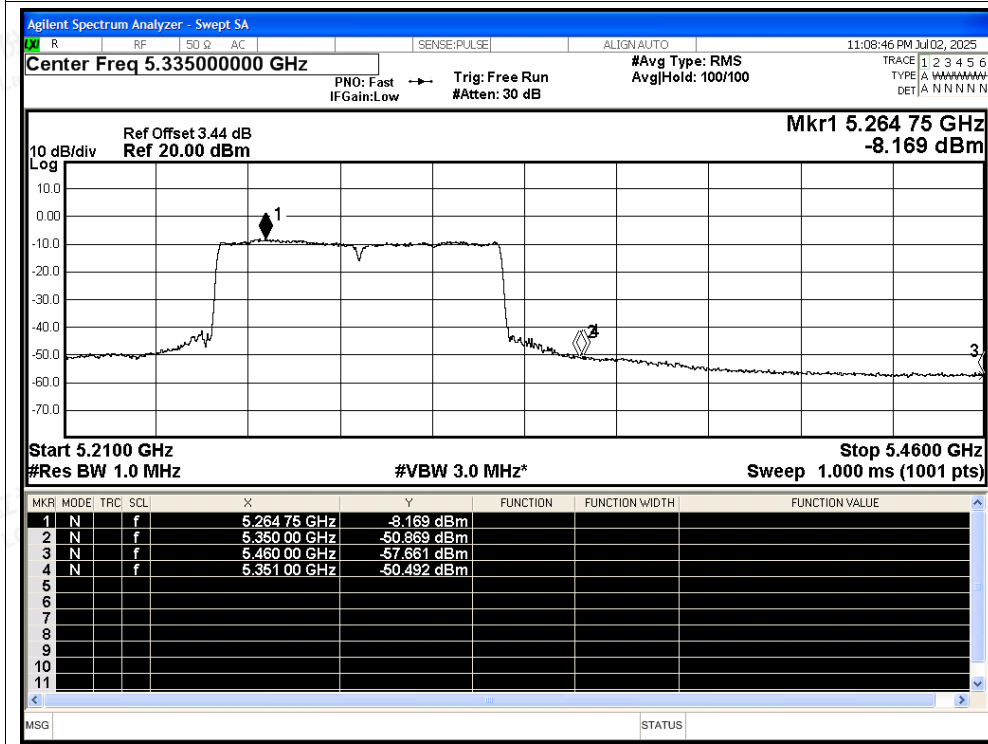

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant2 Peak

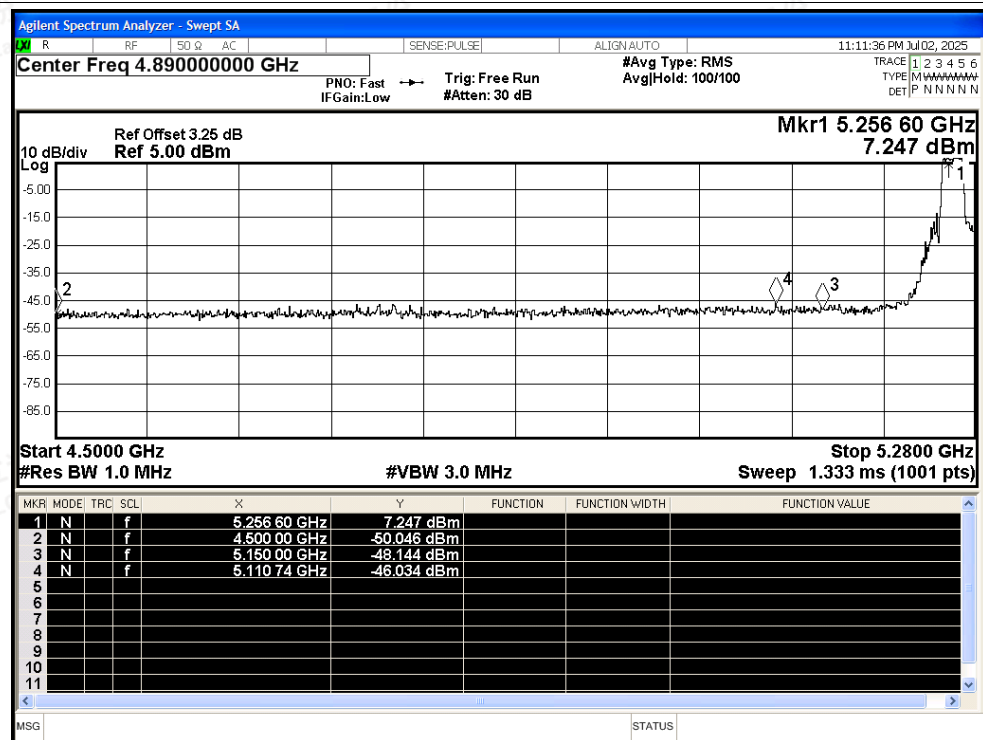

Restrict Band NVNT ax20 5260MHz Ant2 Average

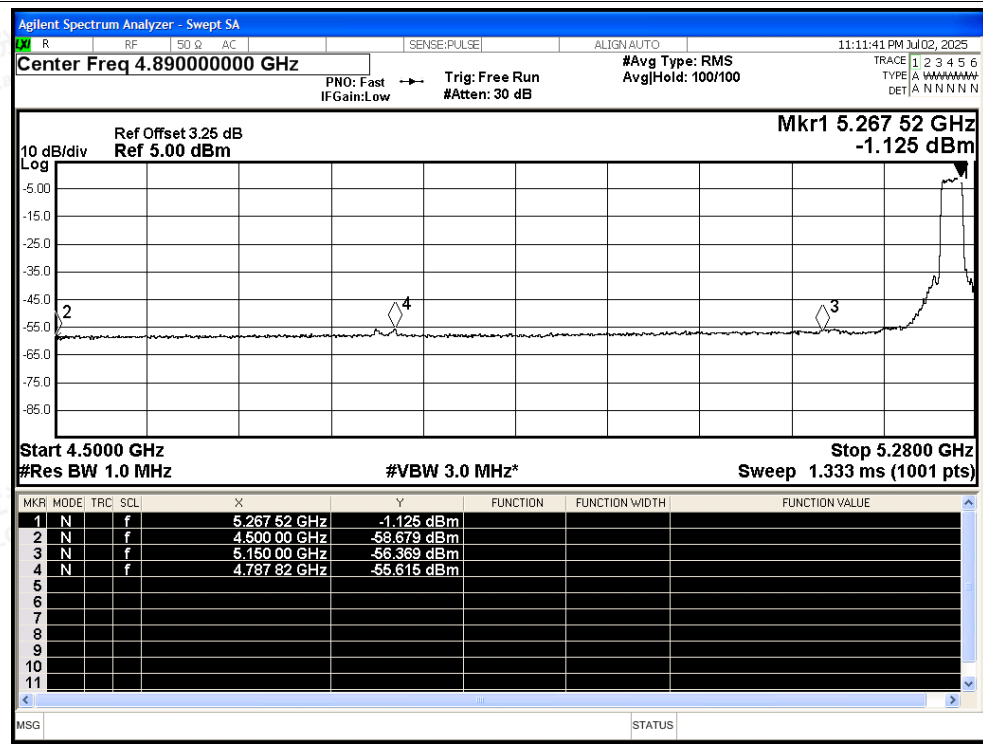

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant2 Peak

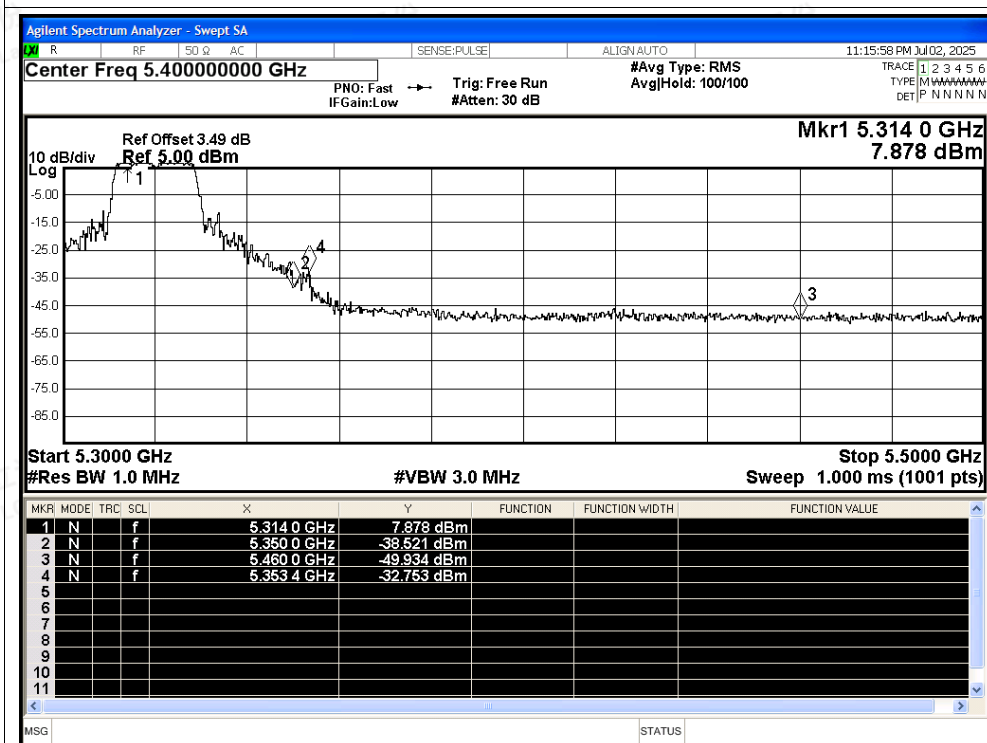

Restrict Band NVNT ax20 5320MHz Ant2 Average

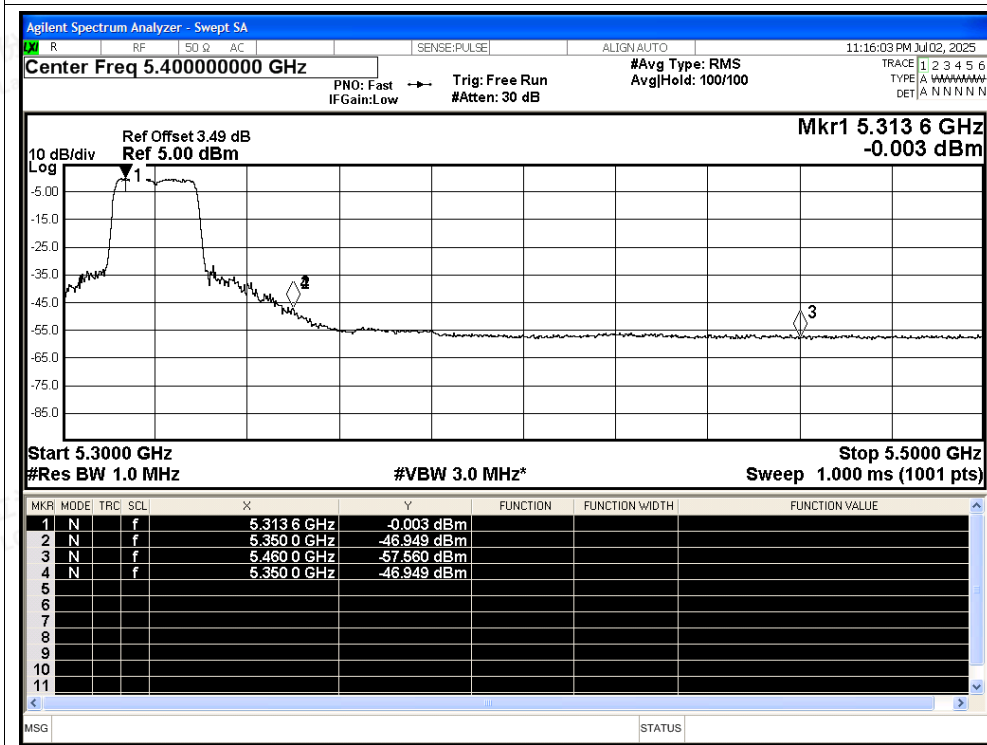

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant2 Peak

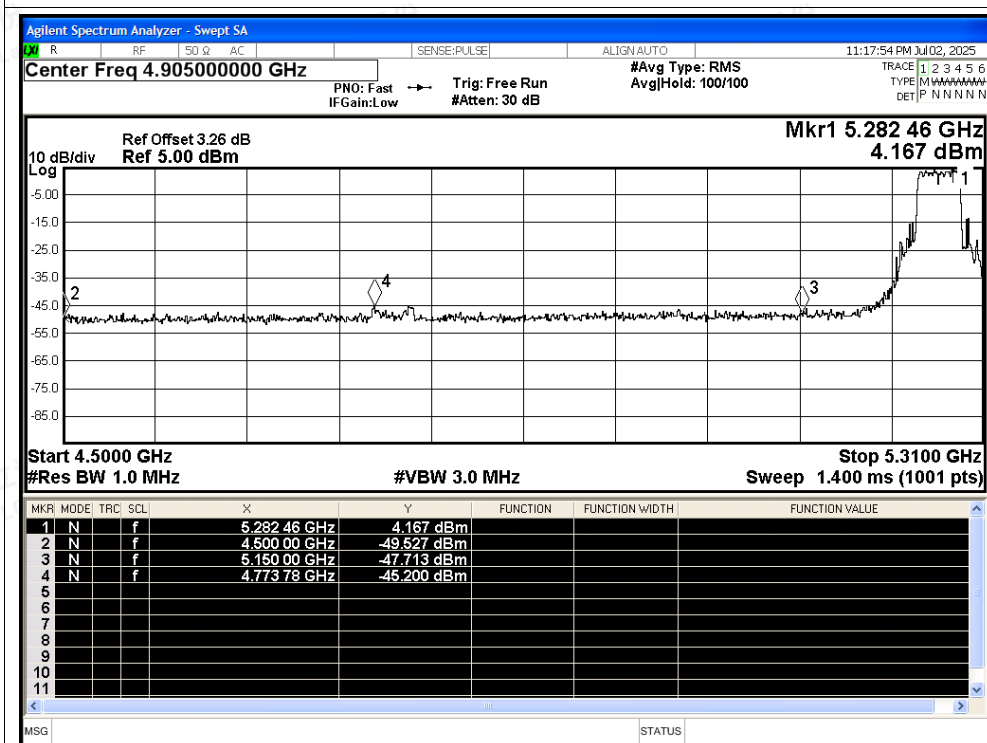

Restrict Band NVNT ax40 5270MHz Ant2 Average

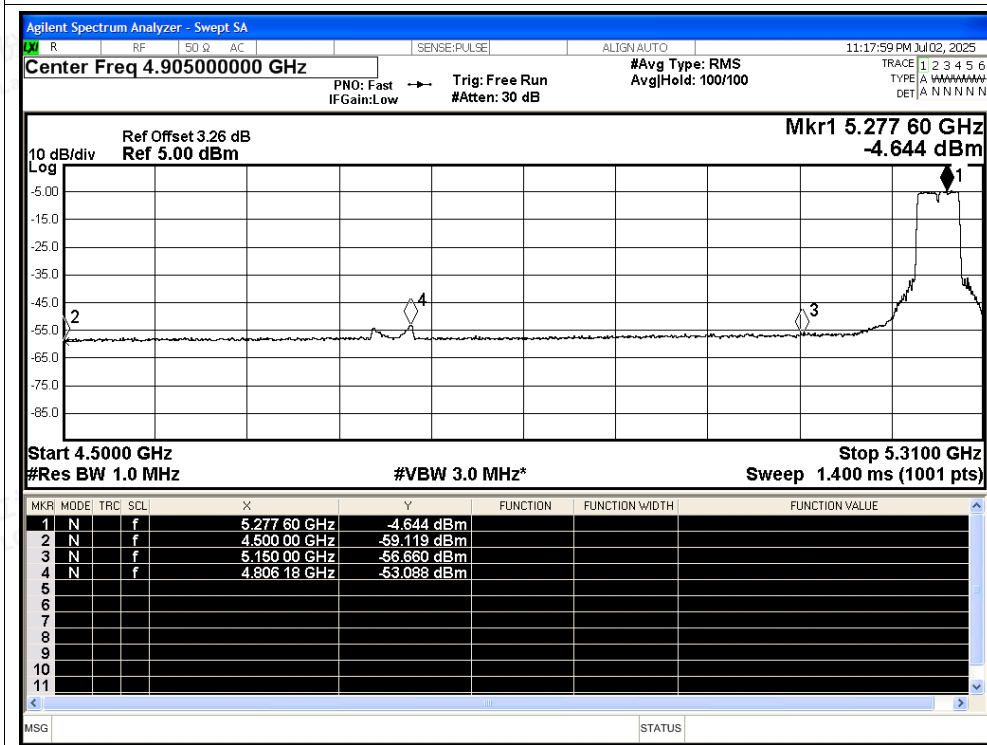

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant2 Peak

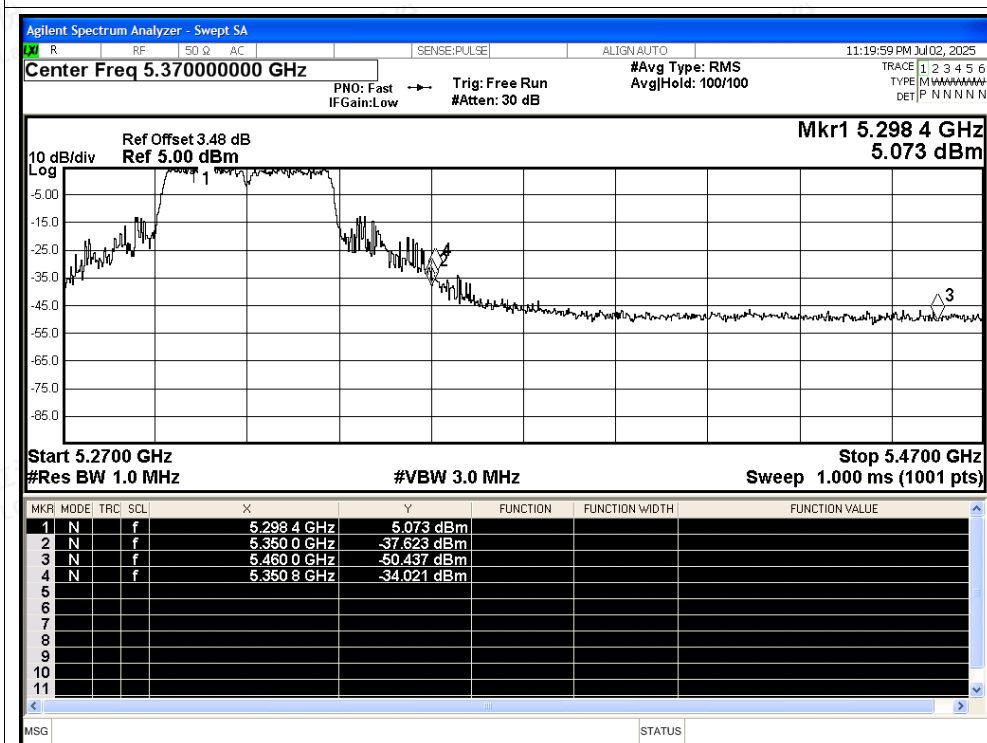

Restrict Band NVNT ax40 5310MHz Ant2 Average

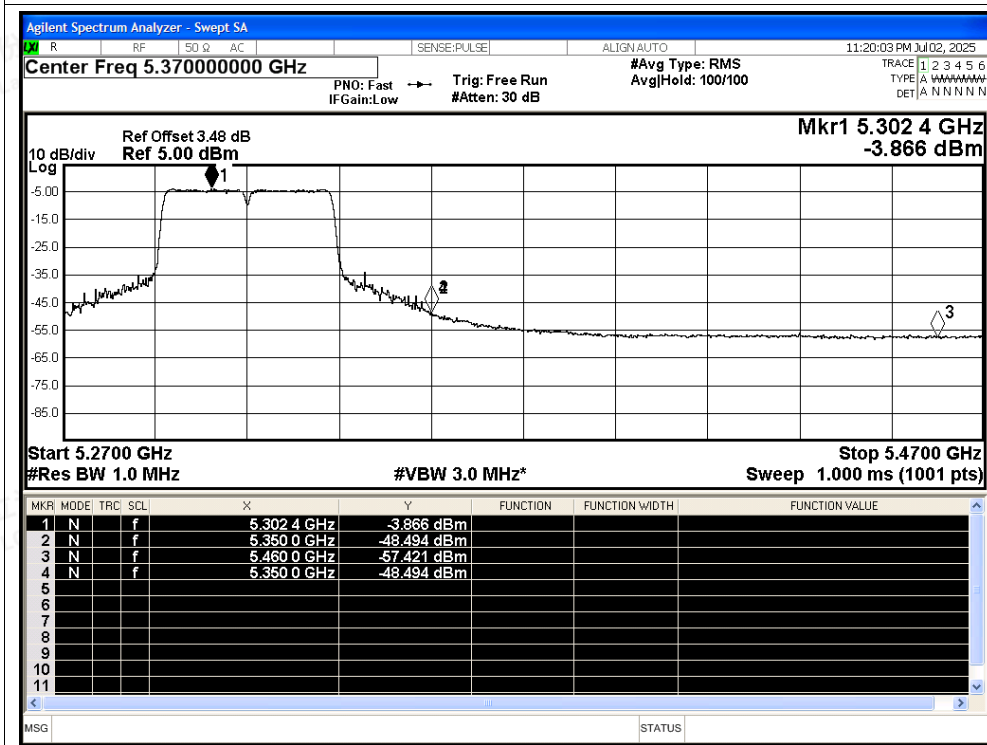

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

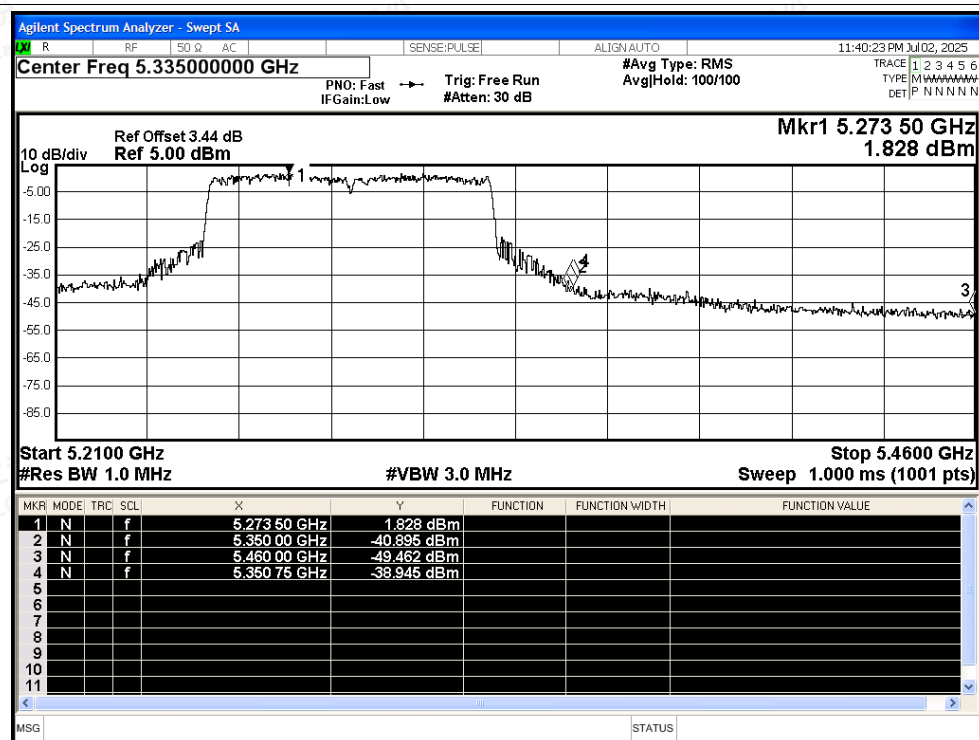

Restrict Band NVNT ax80 5290MHz Ant2 Average

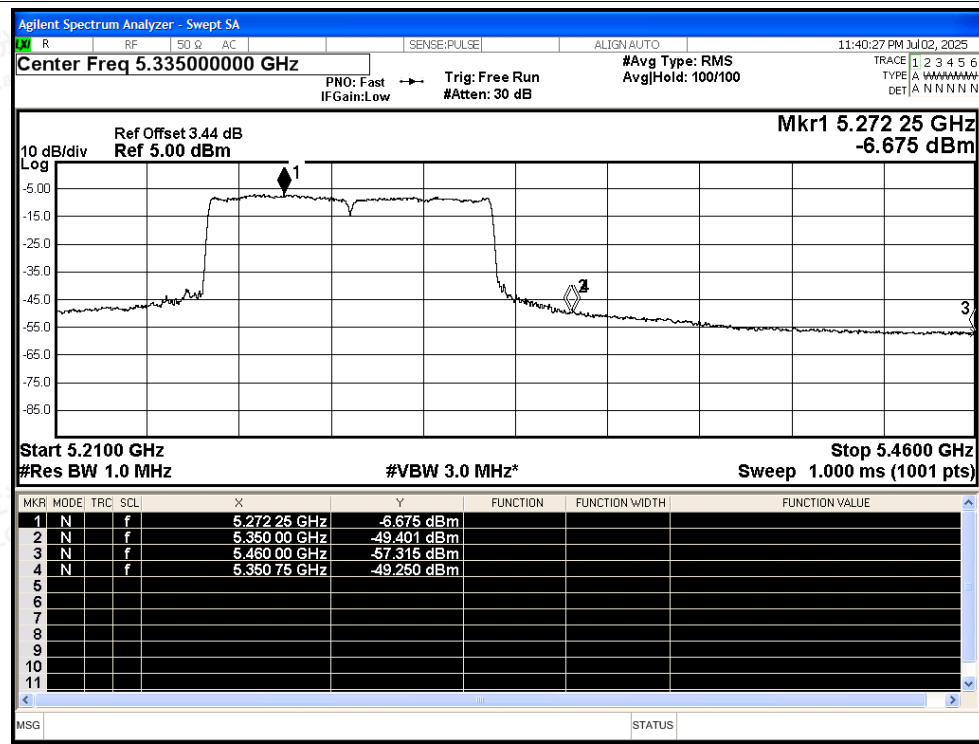

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

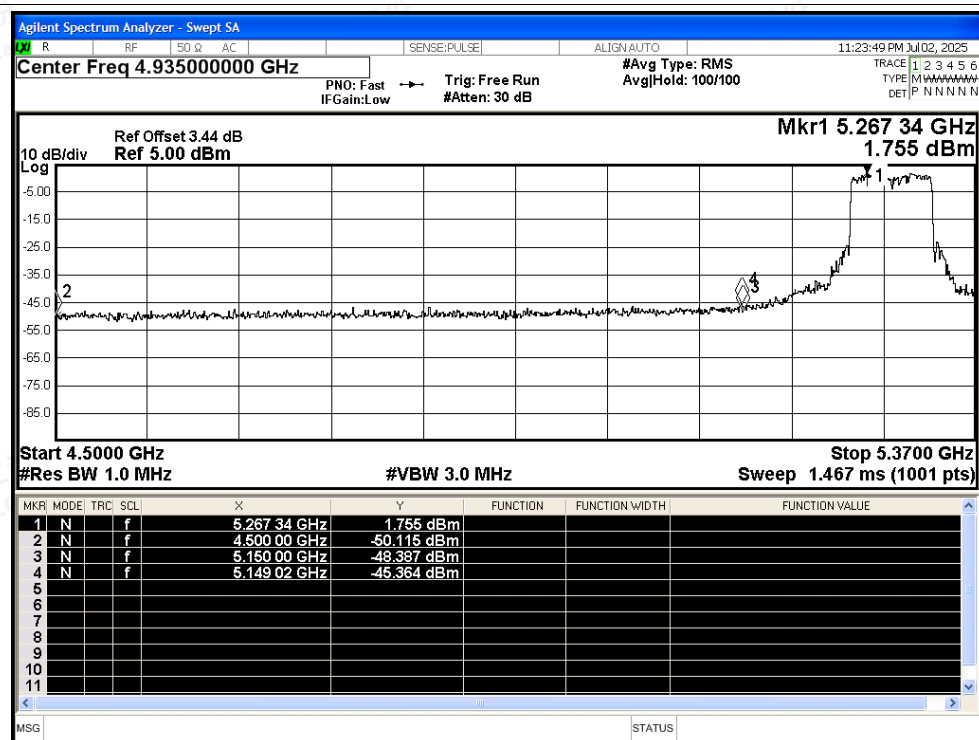

Restrict Band NVNT ax80 5290MHz Ant2 Average

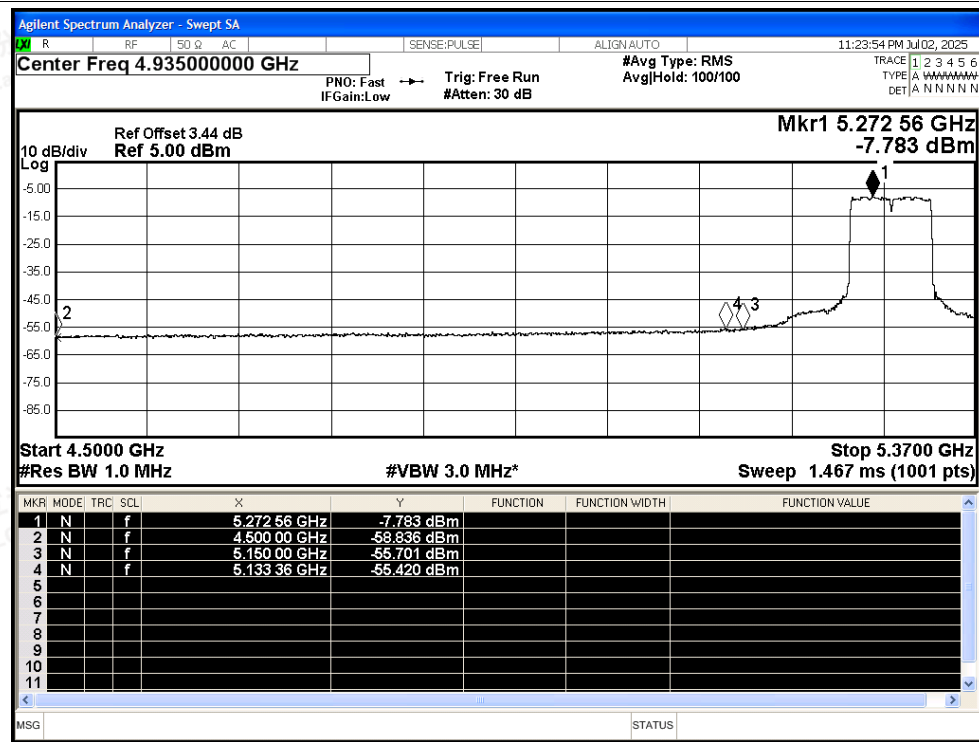

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant3	4500	-51	3.39	-	47.62	Peak	68.2	Pass
NVNT	a	5260	Ant3	4500	-58.31	3.39	0.24	40.55	Average	54	Pass
NVNT	a	5260	Ant3	5103.72	-46.19	3.39	-	52.43	Peak	68.2	Pass
NVNT	a	5260	Ant3	4787.82	-55.6	3.39	0.24	43.26	Average	54	Pass
NVNT	a	5260	Ant3	5150	-47.51	3.39	-	51.11	Peak	68.2	Pass
NVNT	a	5260	Ant3	5150	-56.4	3.39	0.24	42.46	Average	54	Pass
NVNT	a	5320	Ant3	5350	-36.96	3.39	-	61.66	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350	-49.46	3.39	0.24	49.4	Average	54	Pass
NVNT	a	5320	Ant3	5351.8	-33.91	3.39	-	64.71	Peak	68.2	Pass
NVNT	a	5320	Ant3	5350.6	-49.32	3.39	0.24	49.54	Average	54	Pass
NVNT	a	5320	Ant3	5460	-50.03	3.39	-	48.59	Peak	68.2	Pass
NVNT	a	5320	Ant3	5460	-57.69	3.39	0.24	41.17	Average	54	Pass
NVNT	n20	5260	Ant3	4500	-49.55	3.39	-	49.07	Peak	68.2	Pass
NVNT	n20	5260	Ant3	4500	-58.74	3.39	0.28	40.16	Average	54	Pass
NVNT	n20	5260	Ant3	4787.82	-46.27	3.39	-	52.35	Peak	68.2	Pass
NVNT	n20	5260	Ant3	4788.6	-55.31	3.39	0.28	43.59	Average	54	Pass
NVNT	n20	5260	Ant3	5150	-46.49	3.39	-	52.13	Peak	68.2	Pass
NVNT	n20	5260	Ant3	5150	-56.26	3.39	0.28	42.64	Average	54	Pass
NVNT	n20	5320	Ant3	5350	-32.33	3.39	-	66.29	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350	-47.76	3.39	0.28	51.14	Average	54	Pass
NVNT	n20	5320	Ant3	5352.2	-31.51	3.39	-	67.11	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5350	-47.76	3.39	0.28	51.14	Average	54	Pass
NVNT	n20	5320	Ant3	5460	-48.99	3.39	-	49.63	Peak	68.2	Pass
NVNT	n20	5320	Ant3	5460	-57.62	3.39	0.28	41.28	Average	54	Pass
NVNT	n40	5270	Ant3	4500	-50.78	3.39	-	47.84	Peak	68.2	Pass
NVNT	n40	5270	Ant3	4500	-58.07	3.39	0.54	41.09	Average	54	Pass
NVNT	n40	5270	Ant3	4807.8	-43.07	3.39	-	55.55	Peak	68.2	Pass
NVNT	n40	5270	Ant3	4806.99	-52.53	3.39	0.54	46.63	Average	54	Pass
NVNT	n40	5270	Ant3	5150	-48.87	3.39	-	49.75	Peak	68.2	Pass
NVNT	n40	5270	Ant3	5150	-56.53	3.39	0.54	42.63	Average	54	Pass
NVNT	n40	5310	Ant3	5350	-35.93	3.39	-	62.69	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350	-48.91	3.39	0.54	50.25	Average	54	Pass
NVNT	n40	5310	Ant3	5353.8	-35.33	3.39	-	63.29	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5350	-48.91	3.39	0.54	50.25	Average	54	Pass
NVNT	n40	5310	Ant3	5460	-48.58	3.39	-	50.04	Peak	68.2	Pass
NVNT	n40	5310	Ant3	5460	-58.06	3.39	0.54	41.1	Average	54	Pass
NVNT	ac20	5260	Ant3	4500	-50.05	3.39	-	48.57	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	4500	-58.7	3.39	0.28	40.20	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant3	4788.6	-46.05	3.39	-	52.57	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	4787.82	-55.18	3.39	0.28	43.72	Average	54	Pass
NVNT	ac20	5260	Ant3	5150	-48.39	3.39	-	50.23	Peak	68.2	Pass
NVNT	ac20	5260	Ant3	5150	-56.47	3.39	0.28	42.43	Average	54	Pass
NVNT	ac20	5320	Ant3	5350	-32.6	3.39	-	66.02	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5350	-48.17	3.39	0.28	50.73	Average	54	Pass
NVNT	ac20	5320	Ant3	5460	-48.86	3.39	-	49.76	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5460	-57.6	3.39	0.28	41.30	Average	54	Pass
NVNT	ac20	5320	Ant3	5460	-48.86	3.39	-	49.76	Peak	68.2	Pass
NVNT	ac20	5320	Ant3	5460	-57.6	3.39	0.28	41.3	Average	54	Pass
NVNT	ac40	5270	Ant3	4500	-49.48	3.39	-	49.14	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	4500	-59.12	3.39	0.53	40.03	Average	54	Pass
NVNT	ac40	5270	Ant3	4805.37	-44.22	3.39	-	54.4	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	4806.99	-53.31	3.39	0.53	45.84	Average	54	Pass
NVNT	ac40	5270	Ant3	5150	-49.49	3.39	-	49.13	Peak	68.2	Pass
NVNT	ac40	5270	Ant3	5150	-56.96	3.39	0.53	42.19	Average	54	Pass
NVNT	ac40	5310	Ant3	5350	-34.35	3.39	-	64.27	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5350	-49.15	3.39	0.53	50.00	Average	54	Pass
NVNT	ac40	5310	Ant3	5354.6	-33.95	3.39	-	64.67	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5351.8	-48.12	3.39	0.53	51.03	Average	54	Pass
NVNT	ac40	5310	Ant3	5460	-49.74	3.39	-	48.88	Peak	68.2	Pass
NVNT	ac40	5310	Ant3	5460	-57.51	3.39	0.53	41.64	Average	54	Pass
NVNT	ac80	5290	Ant3	4500	-50.21	3.39	-	48.41	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	4500	-58.54	3.39	0.99	41.07	Average	54	Pass
NVNT	ac80	5290	Ant3	5145.54	-45.67	3.39	-	52.95	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5113.35	-55.79	3.39	0.99	43.82	Average	54	Pass
NVNT	ac80	5290	Ant3	5150	-47.21	3.39	-	51.41	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5150	-56.34	3.39	0.99	43.27	Average	54	Pass
NVNT	ac80	5290	Ant3	5350	-38.98	3.39	-	59.64	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5350	-49.39	3.39	0.99	50.22	Average	54	Pass
NVNT	ac80	5290	Ant3	5353.75	-36.77	3.39	-	61.85	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5350.25	-49.3	3.39	0.99	50.31	Average	54	Pass
NVNT	ac80	5290	Ant3	5460	-48.23	3.39	-	50.39	Peak	68.2	Pass
NVNT	ac80	5290	Ant3	5460	-57.25	3.39	0.99	42.36	Average	54	Pass
NVNT	ax20	5260	Ant3	4500	-49.46	3.39	-	49.16	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	4500	-58.98	3.39	0.28	39.92	Average	54	Pass
NVNT	ax20	5260	Ant3	4787.82	-45.07	3.39	-	53.55	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	4787.82	-55.57	3.39	0.28	43.33	Average	54	Pass
NVNT	ax20	5260	Ant3	5150	-47.95	3.39	-	50.67	Peak	68.2	Pass
NVNT	ax20	5260	Ant3	5150	-55.94	3.39	0.28	42.96	Average	54	Pass
NVNT	ax20	5320	Ant3	5350	-35.27	3.39	-	63.35	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant3	5350	-47.44	3.39	0.28	51.46	Average	54	Pass
NVNT	ax20	5320	Ant3	5350.8	-32.68	3.39	-	65.94	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5350.4	-47.4	3.39	0.28	51.50	Average	54	Pass
NVNT	ax20	5320	Ant3	5460	-49.32	3.39	-	49.30	Peak	68.2	Pass
NVNT	ax20	5320	Ant3	5460	-57.61	3.39	0.28	41.29	Average	54	Pass
NVNT	ax40	5270	Ant3	4500	-50.07	3.39	-	48.55	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	4500	-58.88	3.39	0.54	40.28	Average	54	Pass
NVNT	ax40	5270	Ant3	4806.99	-43.74	3.39	-	54.88	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	4806.99	-53.16	3.39	0.54	46.00	Average	54	Pass
NVNT	ax40	5270	Ant3	5150	-48.68	3.39	-	49.94	Peak	68.2	Pass
NVNT	ax40	5270	Ant3	5150	-56.44	3.39	0.54	42.72	Average	54	Pass
NVNT	ax40	5310	Ant3	5350	-35.96	3.39	-	62.66	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5350	-47.08	3.39	0.53	52.07	Average	54	Pass
NVNT	ax40	5310	Ant3	5356.2	-33.81	3.39	-	64.81	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5350	-47.08	3.39	0.53	52.07	Average	54	Pass
NVNT	ax40	5310	Ant3	5460	-50.01	3.39	-	48.61	Peak	68.2	Pass
NVNT	ax40	5310	Ant3	5460	-57.4	3.39	0.53	41.75	Average	54	Pass
NVNT	ax80	5290	Ant3	5350	-40.49	3.39	-	58.13	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5350	-50.73	3.39	0.99	48.88	Average	54	Pass
NVNT	ax80	5290	Ant3	5351.75	-35.44	3.39	-	63.18	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5350.5	-50.3	3.39	0.99	49.31	Average	54	Pass
NVNT	ax80	5290	Ant3	5460	-50.52	3.39	-	48.1	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5460	-57.66	3.39	0.99	41.95	Average	54	Pass
NVNT	ax80	5290	Ant3	4500	-50.04	3.39	-	48.58	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	4500	-58.55	3.39	0.99	41.06	Average	54	Pass
NVNT	ax80	5290	Ant3	4960.23	-45.93	3.39	-	52.69	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5149.02	-55.98	3.39	0.99	43.63	Average	54	Pass
NVNT	ax80	5290	Ant3	5150	-47.17	3.39	-	51.45	Peak	68.2	Pass
NVNT	ax80	5290	Ant3	5150	-56.46	3.39	0.99	43.15	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant3 Peak

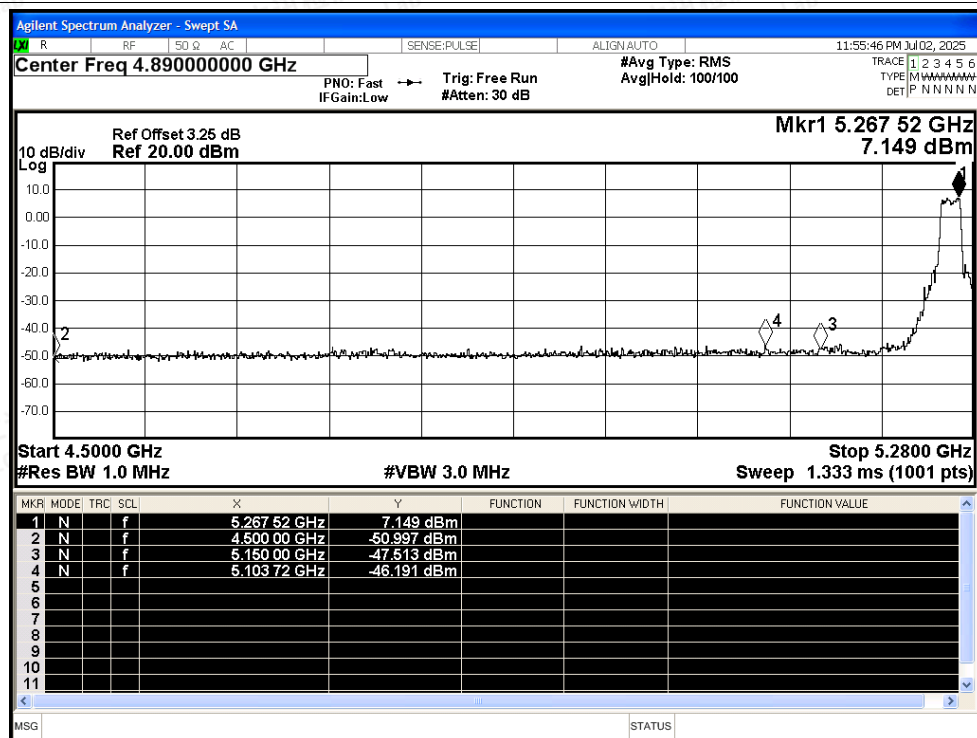

Restrict Band NVNT a 5260MHz Ant3 Average

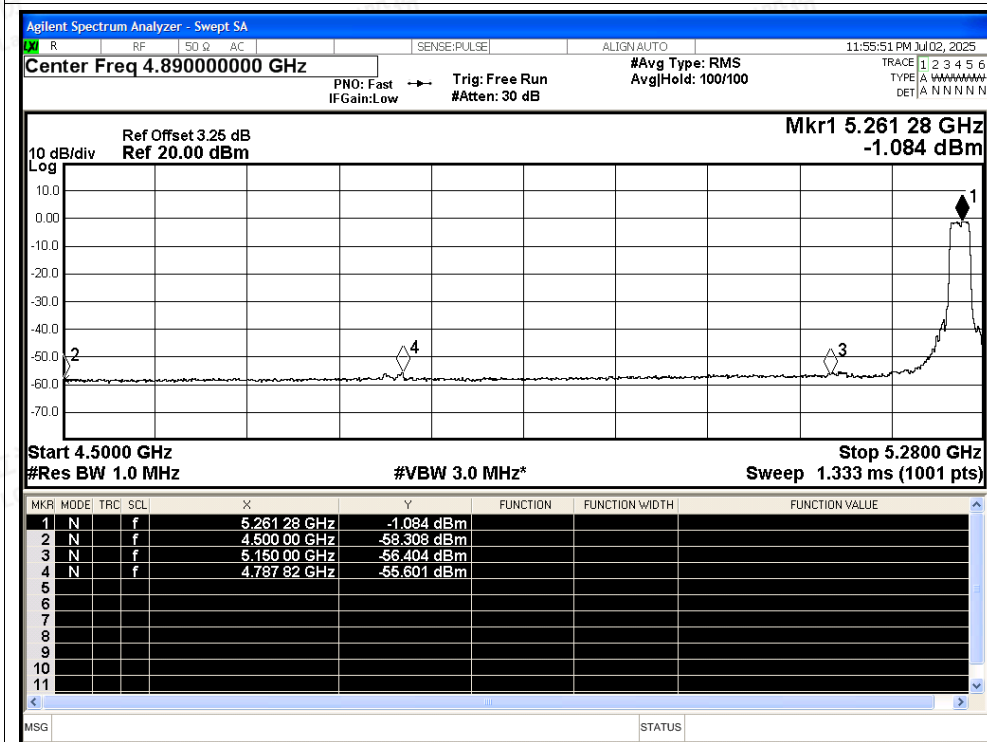

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant3 Peak

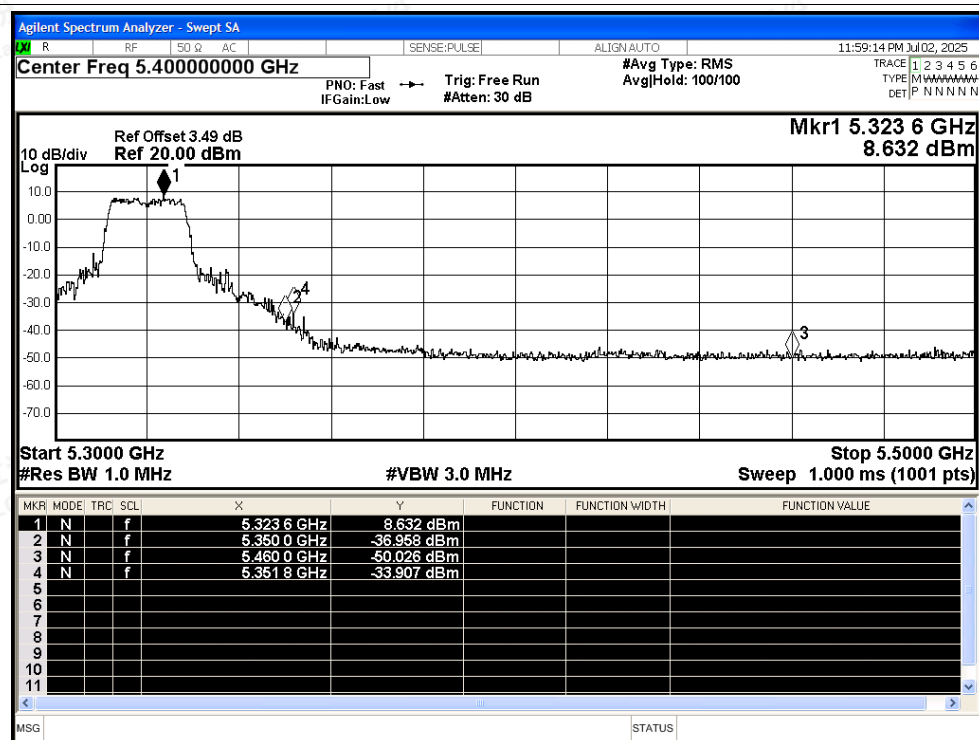

Restrict Band NVNT a 5320MHz Ant3 Average

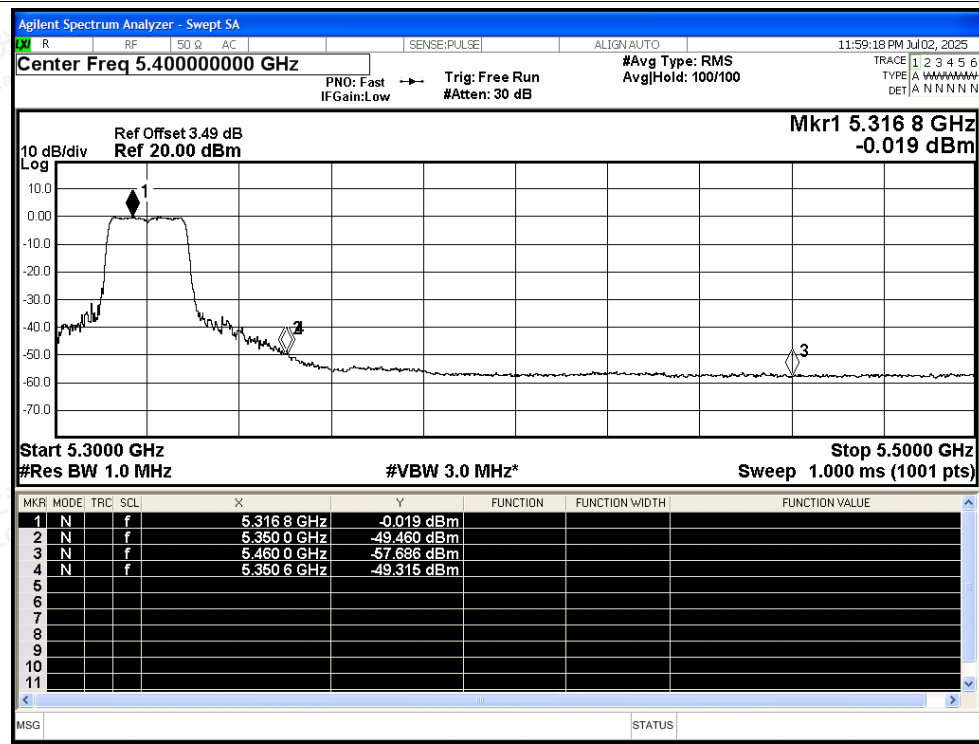

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant3 Peak

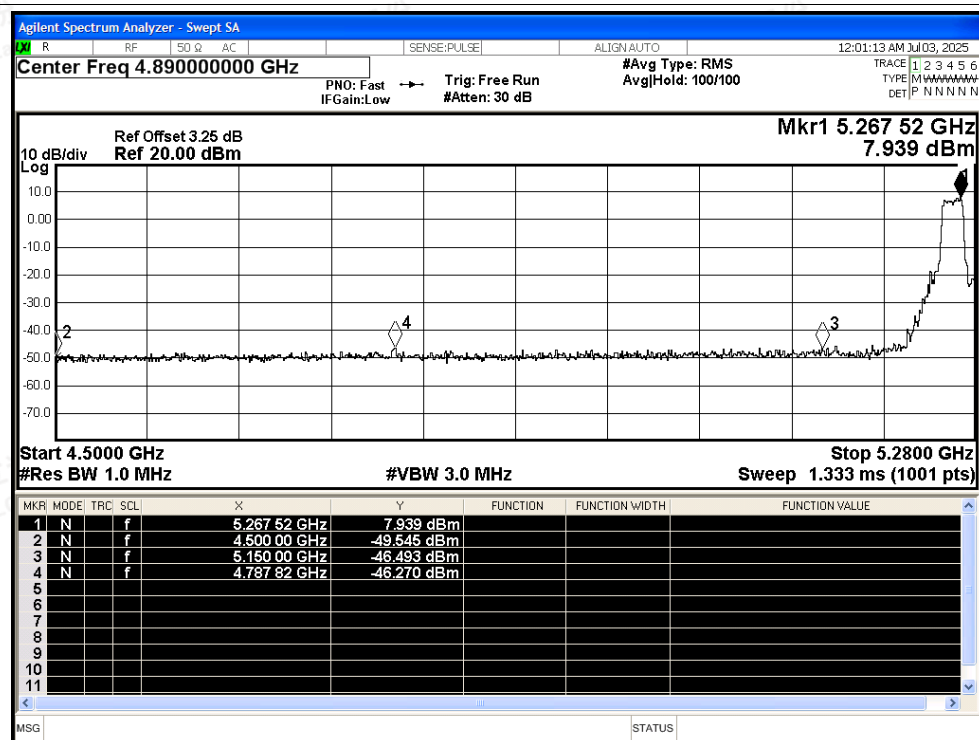

Restrict Band NVNT n20 5260MHz Ant3 Average

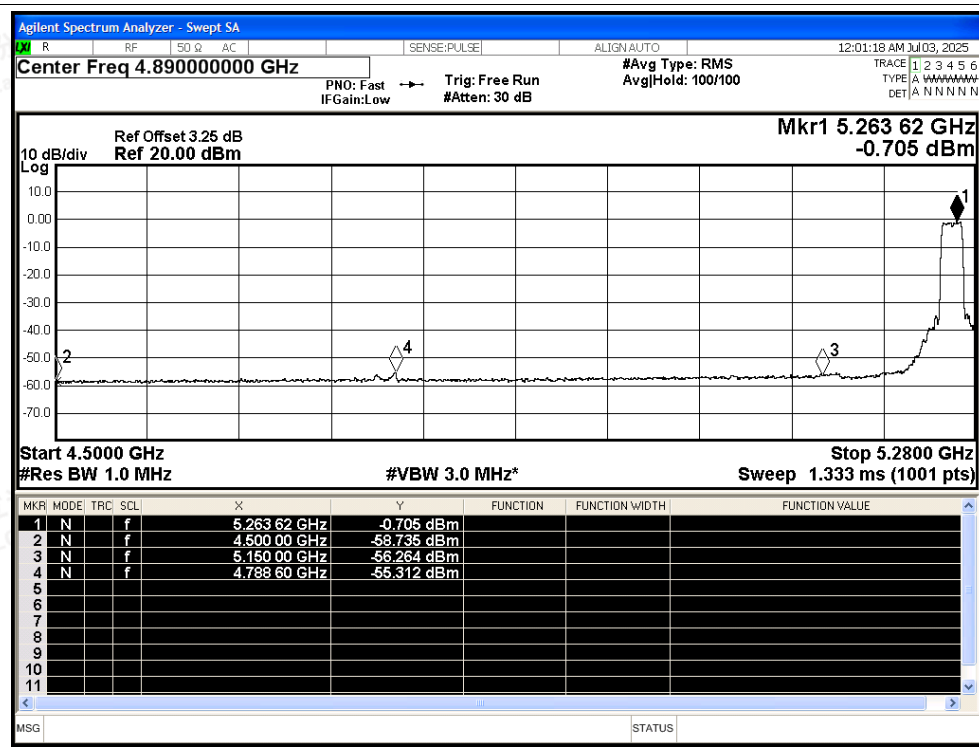

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant3 Peak

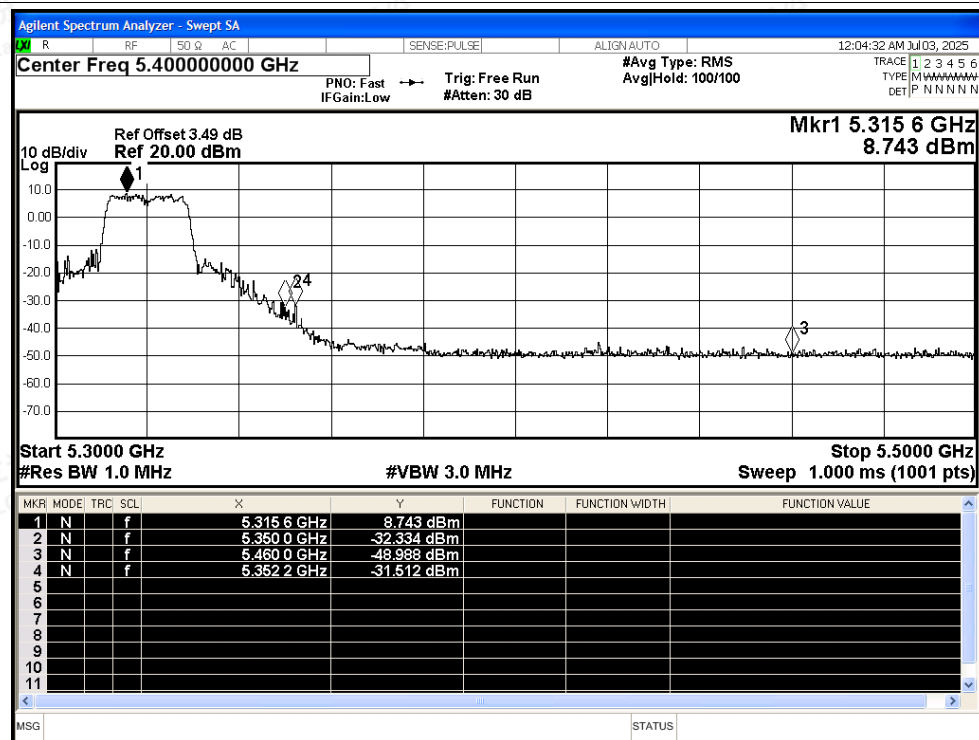


Restrict Band NVNT n20 5320MHz Ant3 Average

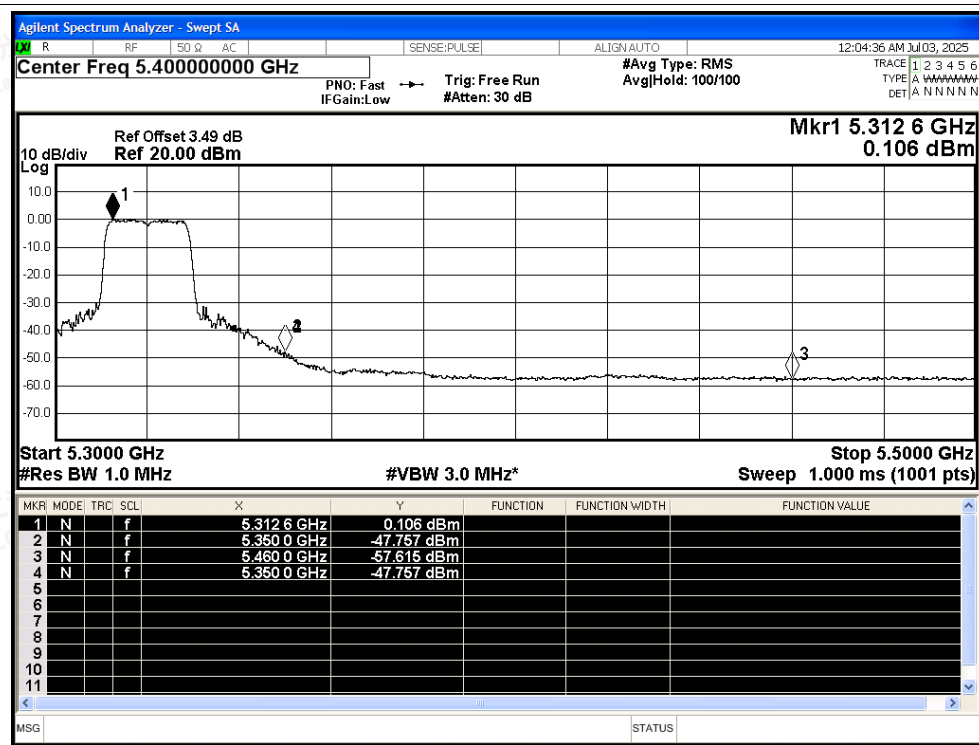




Restrict Band NVNT n40 5270MHz Ant3 Peak

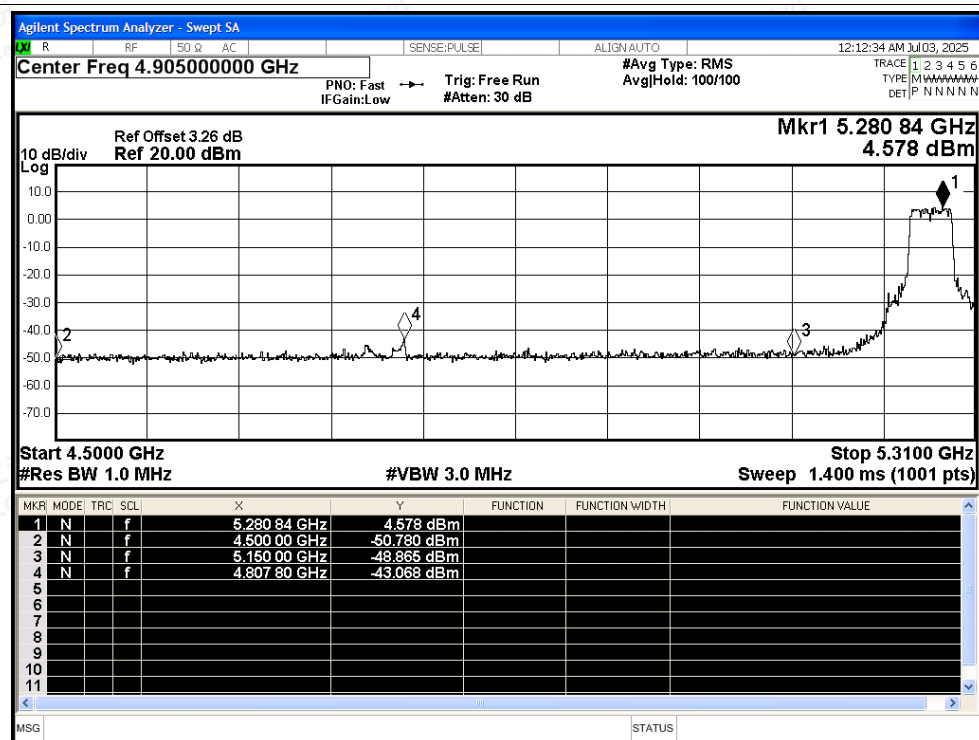

Restrict Band NVNT n40 5270MHz Ant3 Average

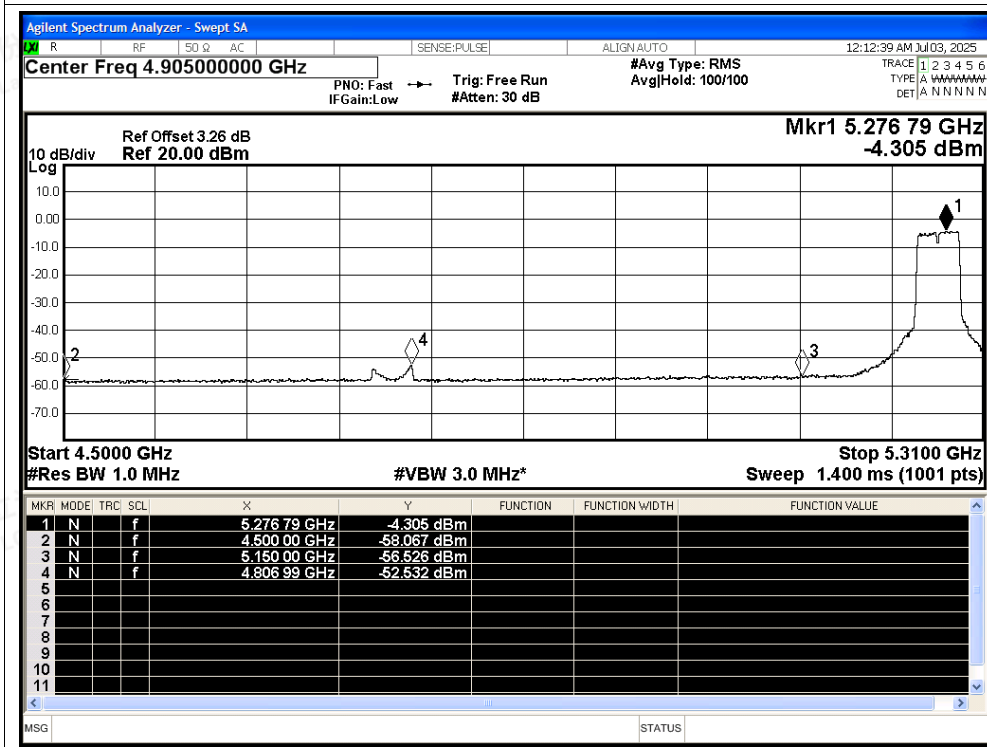

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant3 Peak

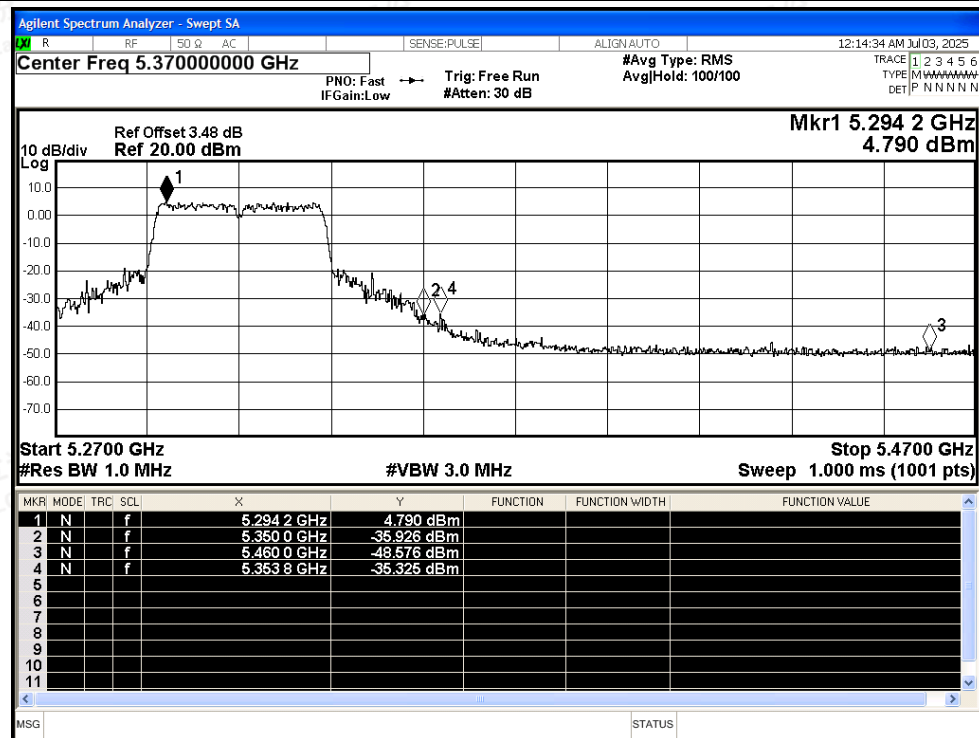

Restrict Band NVNT n40 5310MHz Ant3 Average

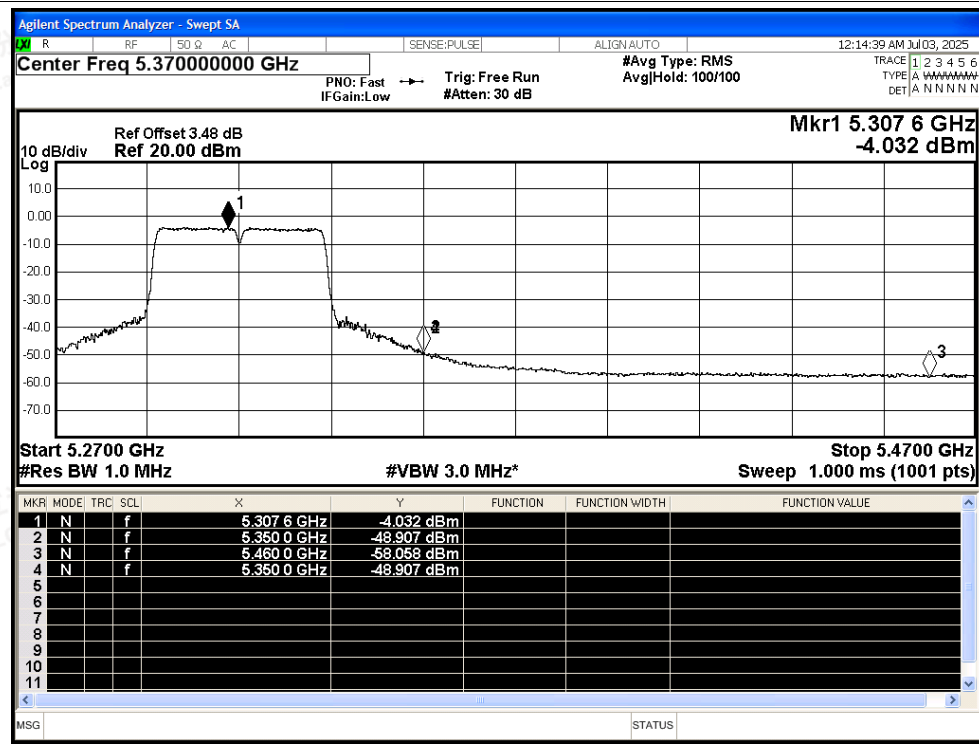

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant3 Peak

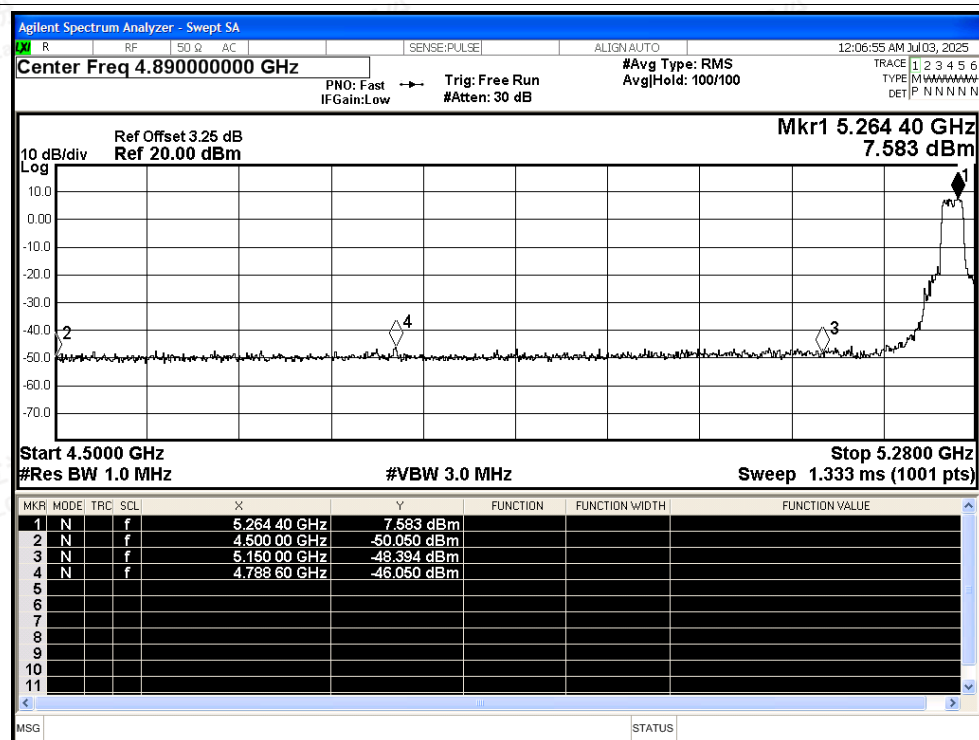

Restrict Band NVNT ac20 5260MHz Ant3 Average

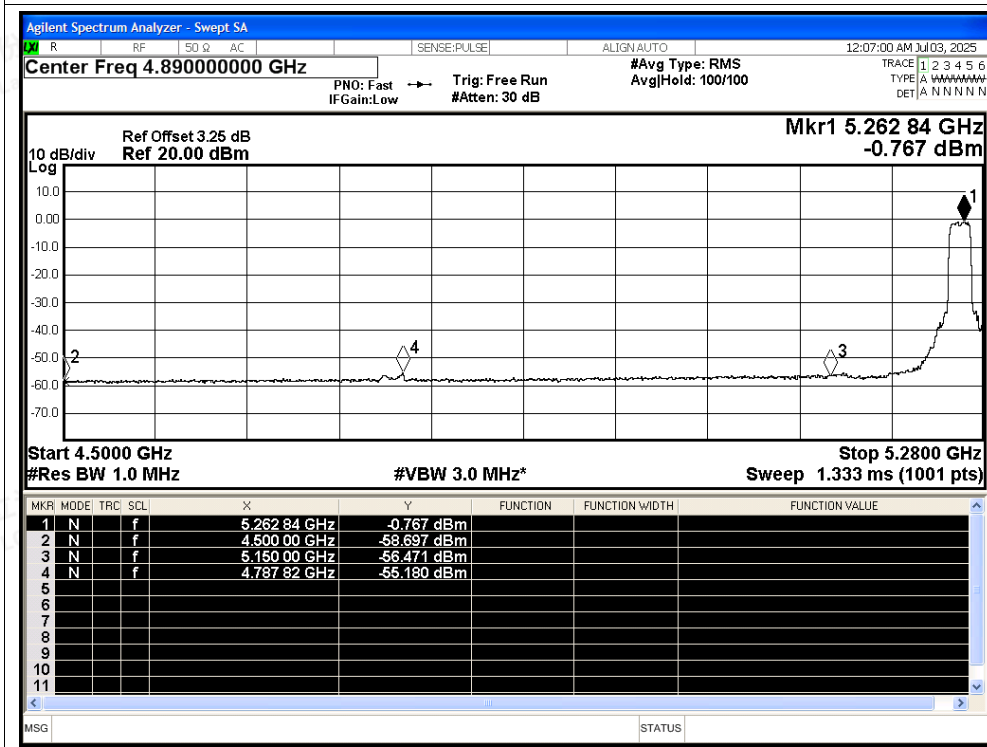

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant3 Peak

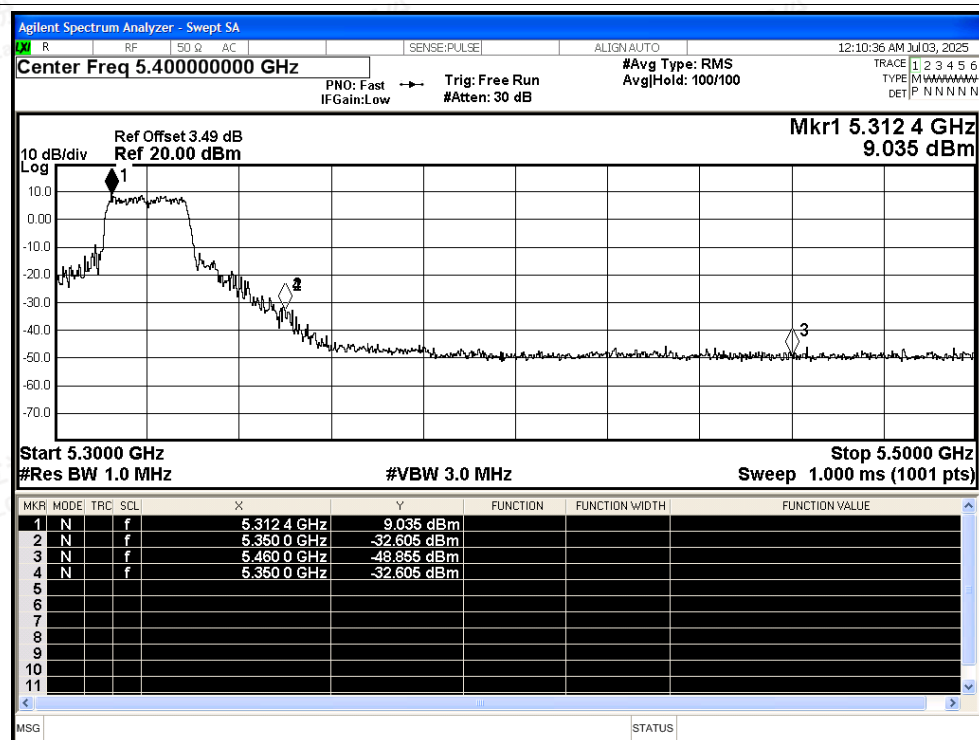

Restrict Band NVNT ac20 5320MHz Ant3 Average

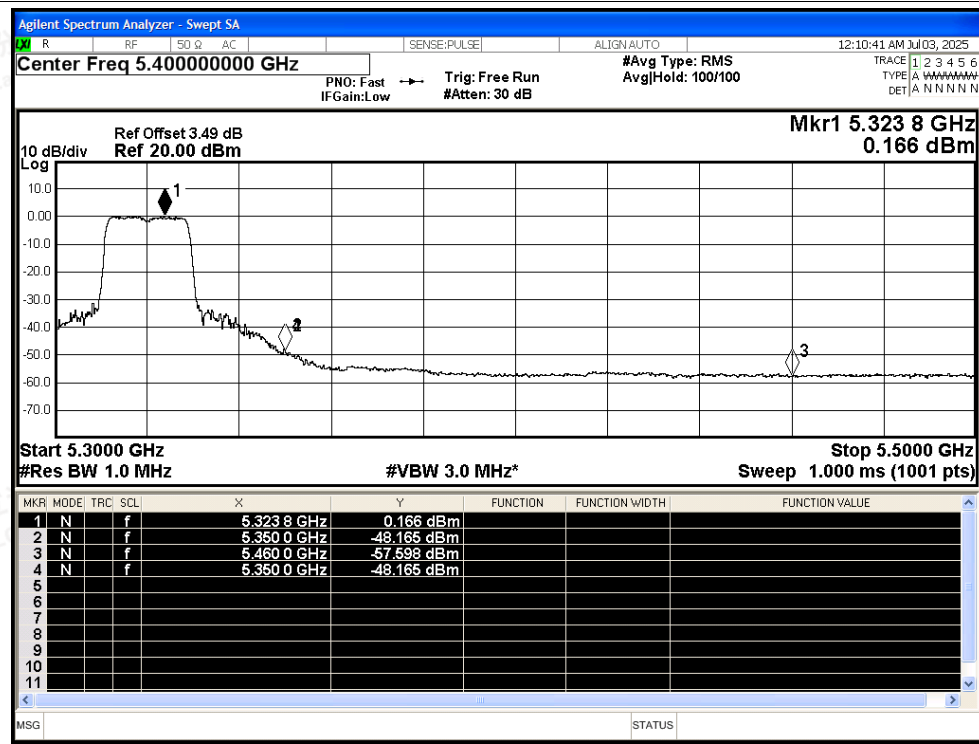

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant3 Peak

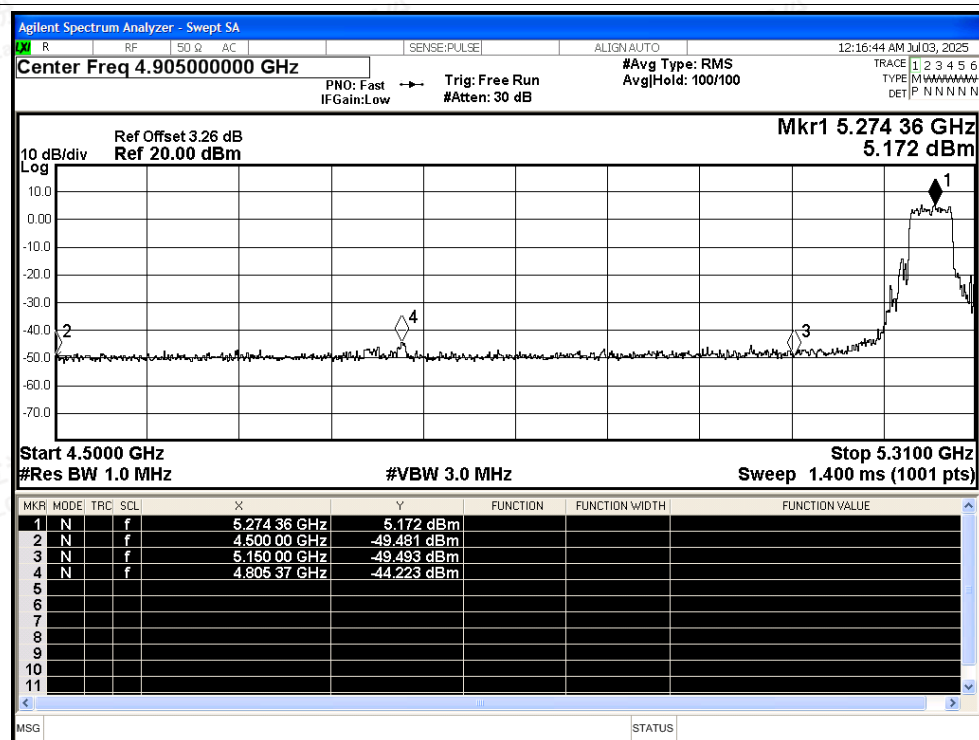

Restrict Band NVNT ac40 5270MHz Ant3 Average

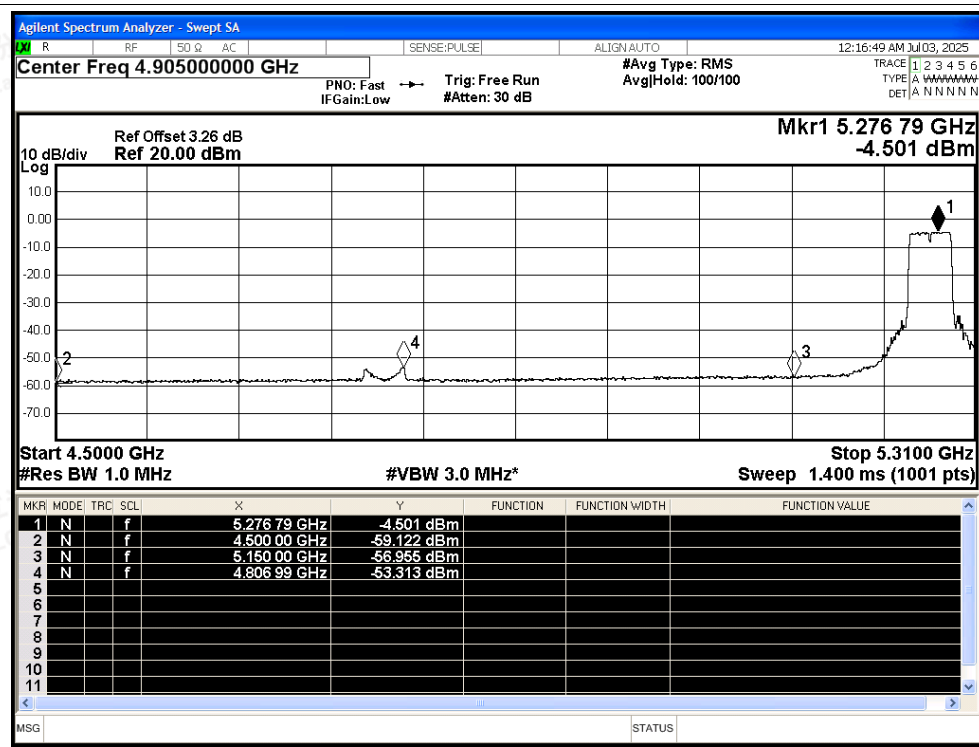

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant3 Peak

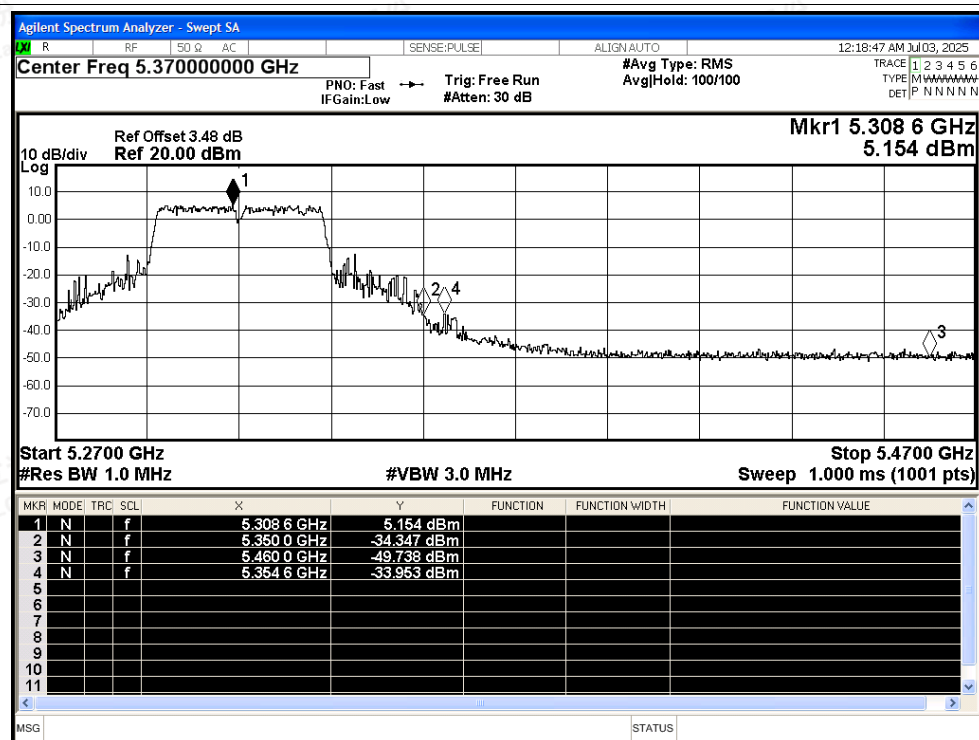

Restrict Band NVNT ac40 5310MHz Ant3 Average

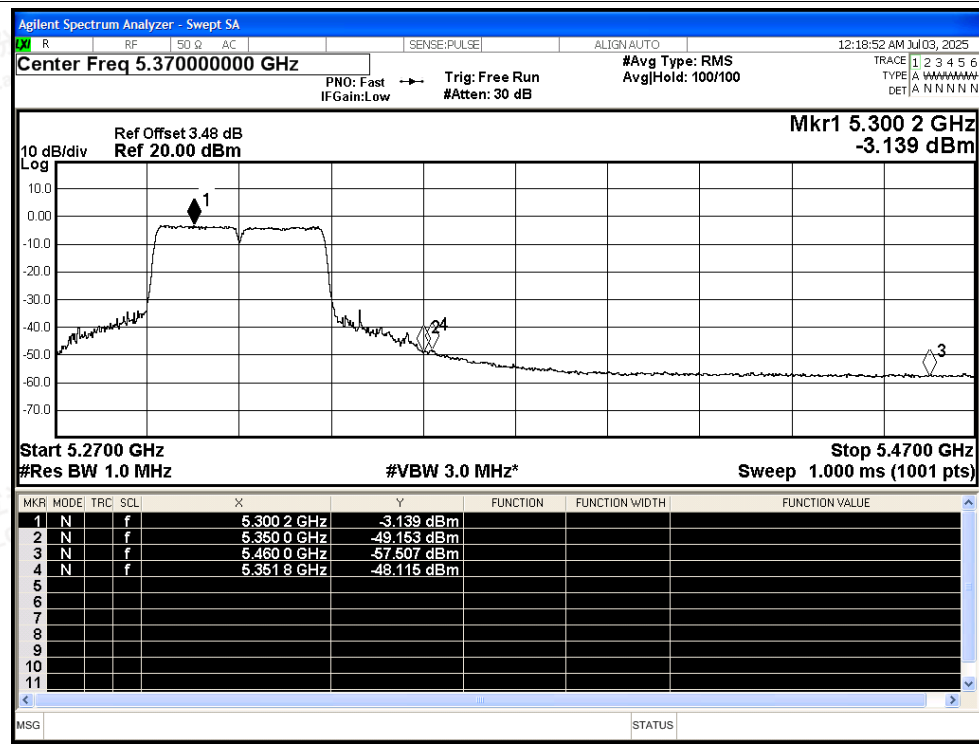

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant3 Peak

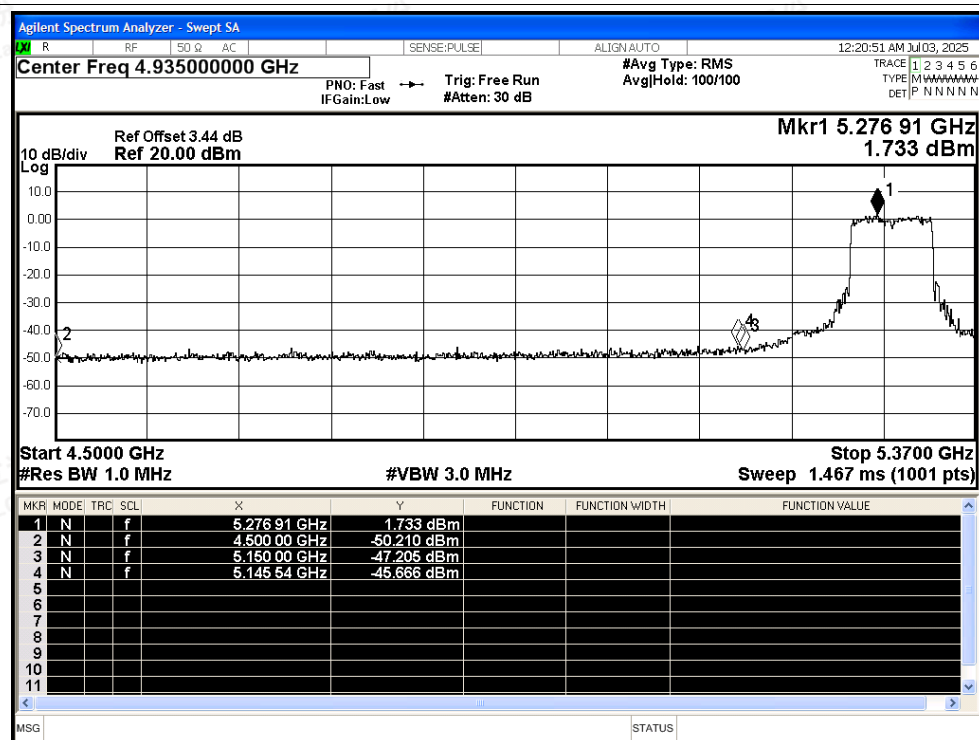

Restrict Band NVNT ac80 5290MHz Ant3 Average

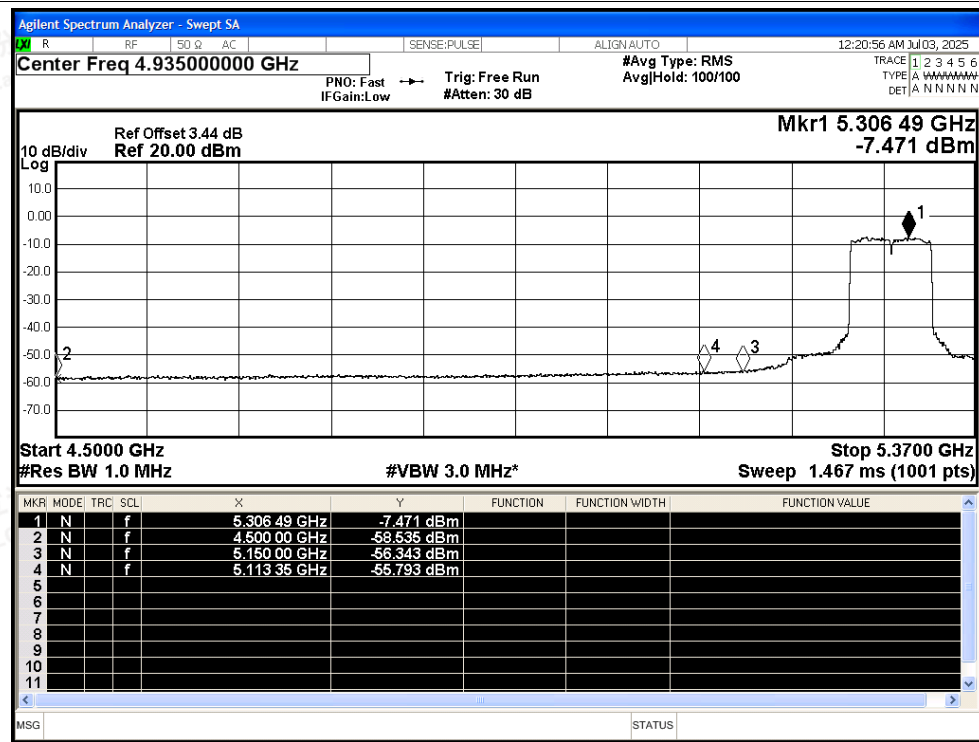

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant3 Peak

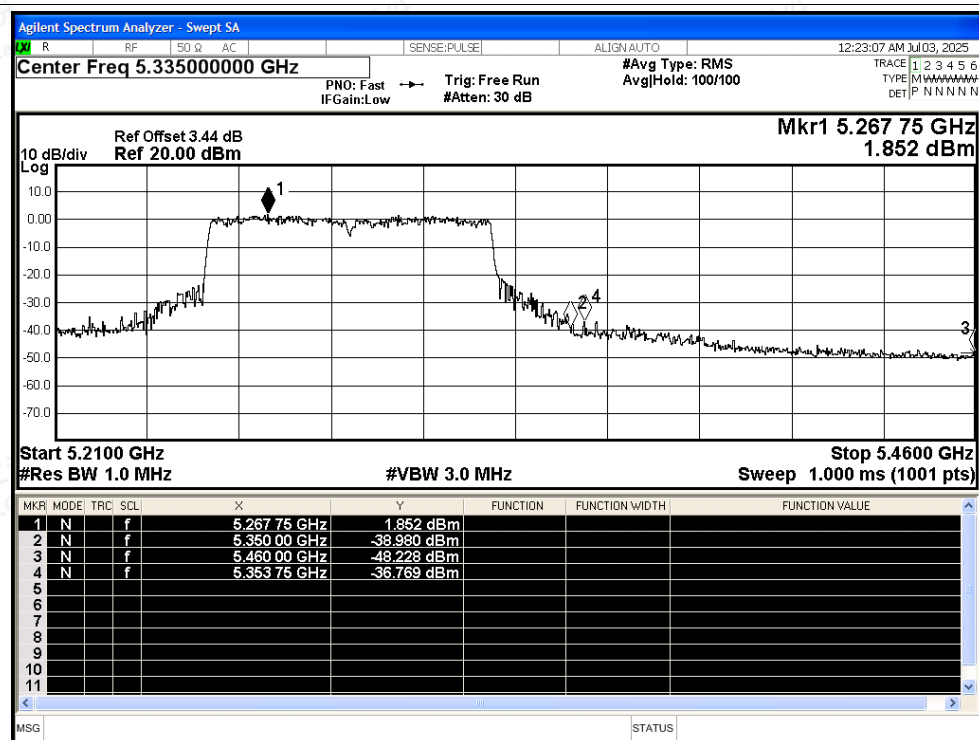

Restrict Band NVNT ac80 5290MHz Ant3 Average

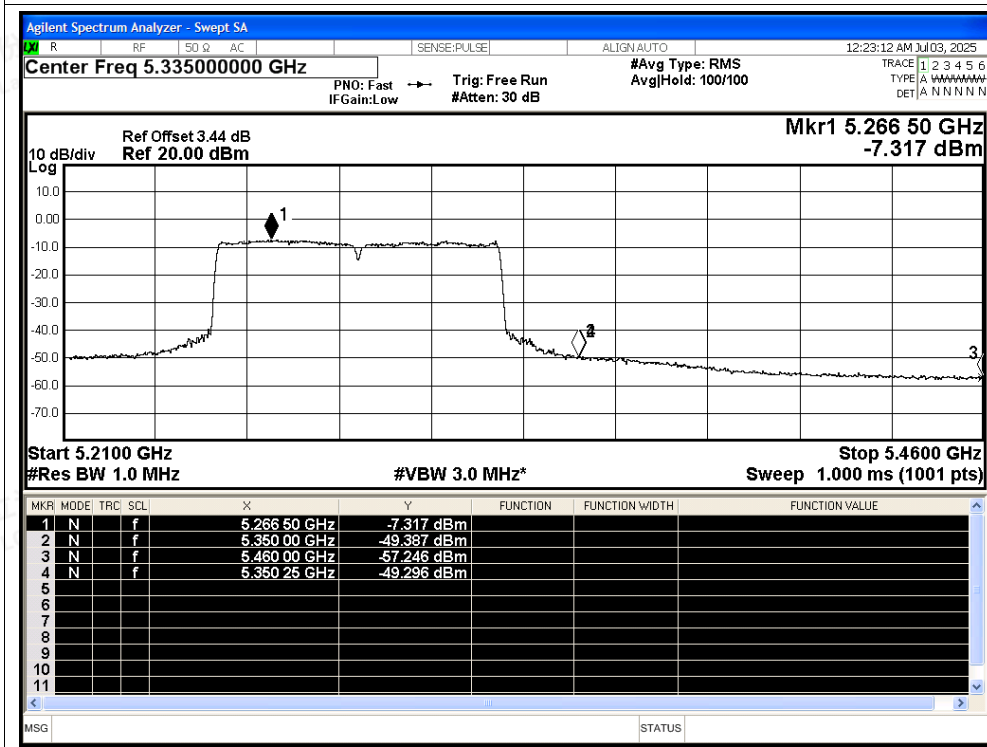

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant3 Peak

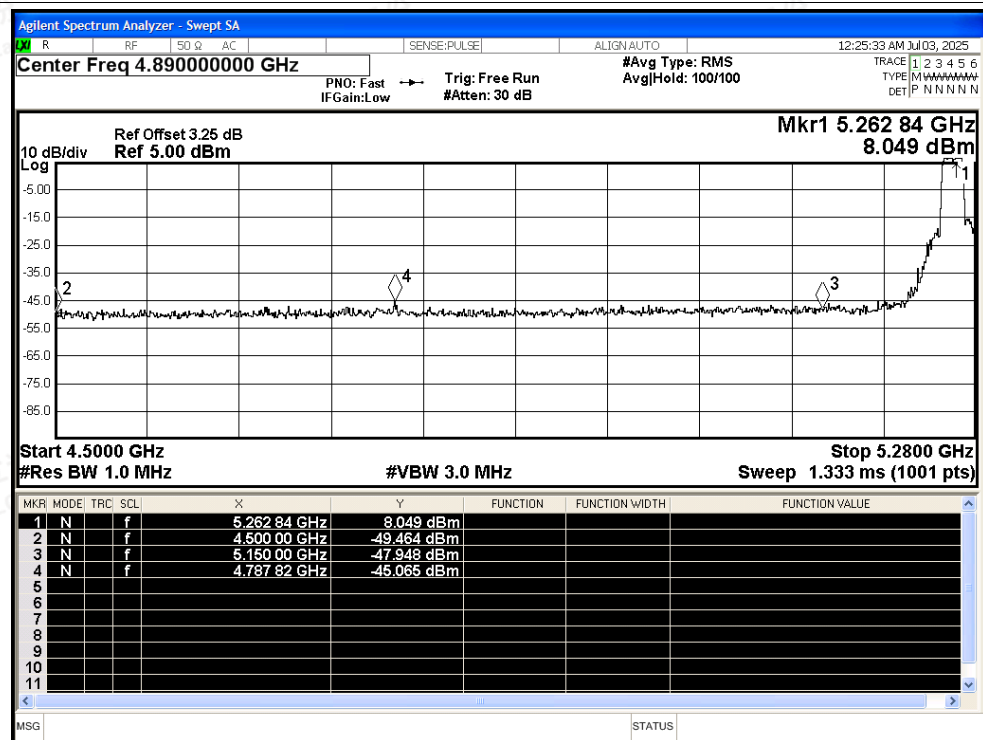

Restrict Band NVNT ax20 5260MHz Ant3 Average

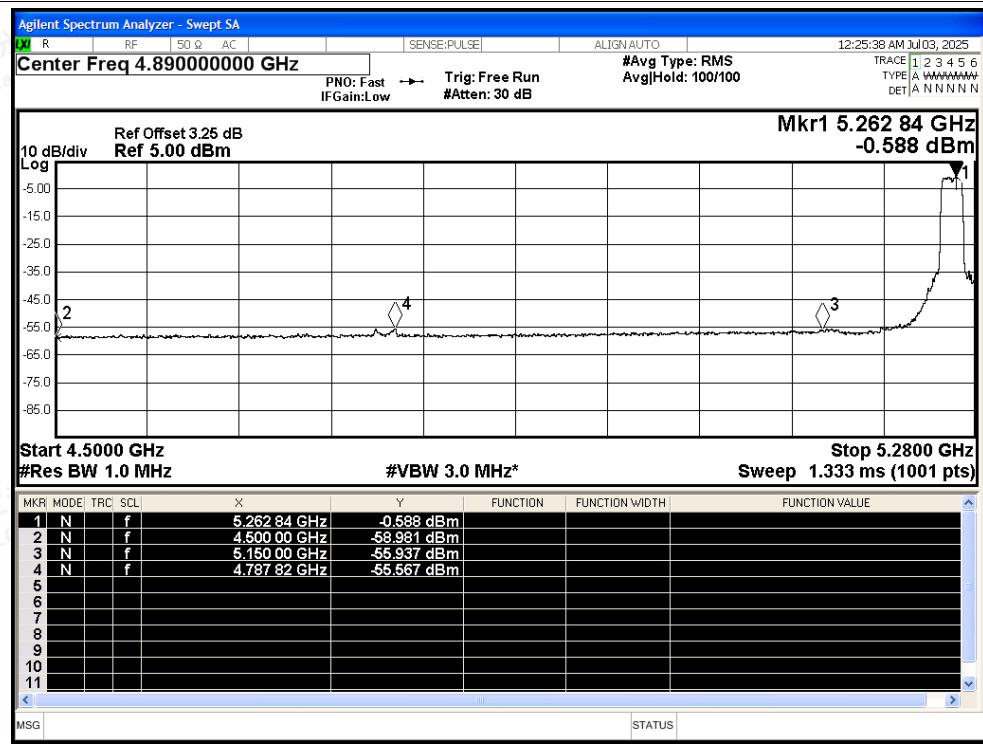

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant3 Peak

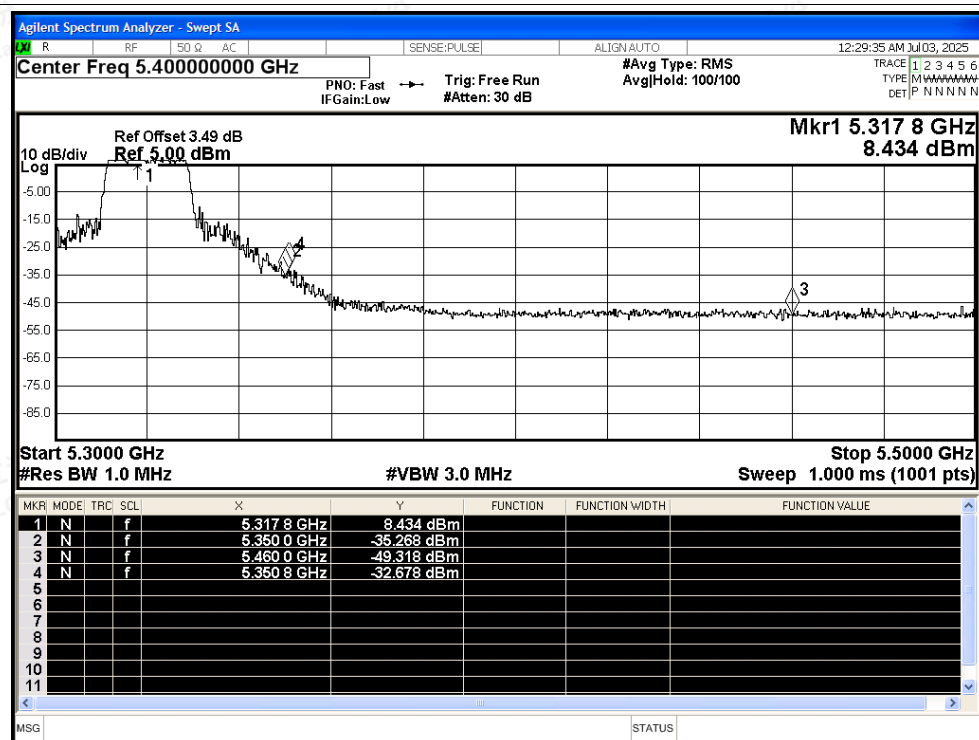

Restrict Band NVNT ax20 5320MHz Ant3 Average

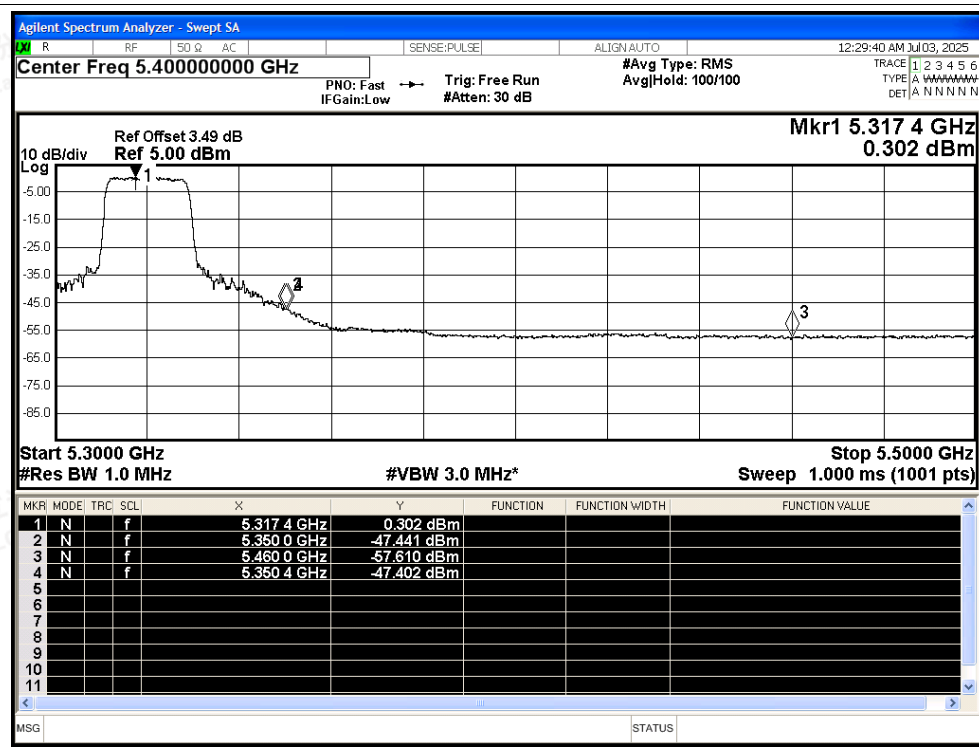

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant3 Peak

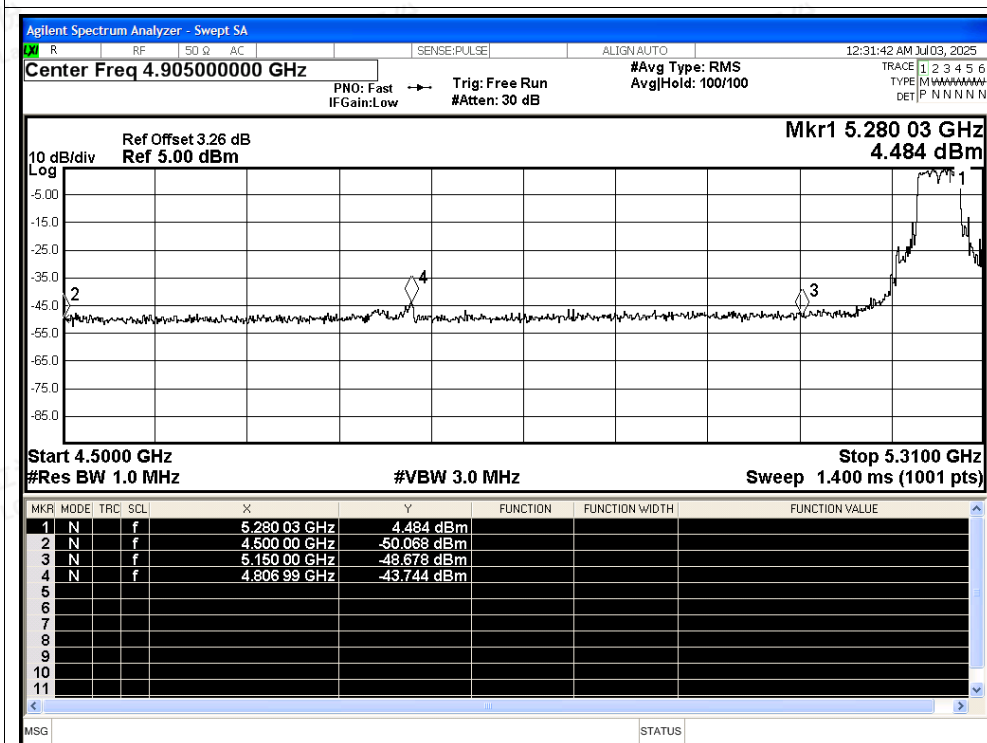

Restrict Band NVNT ax40 5270MHz Ant3 Average

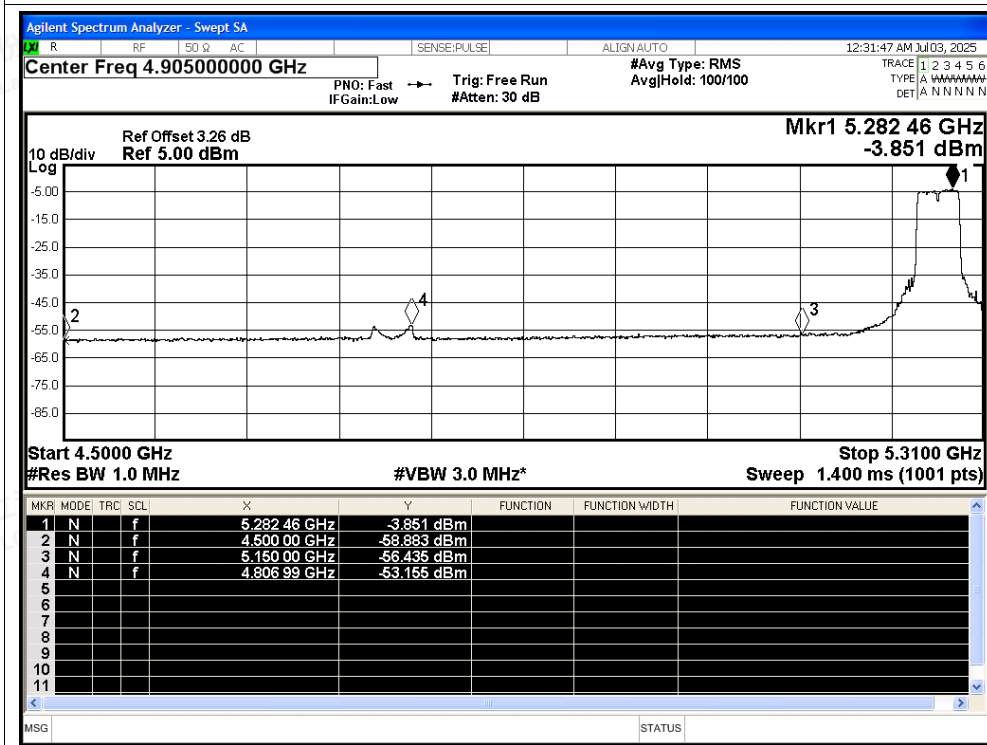

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant3 Peak

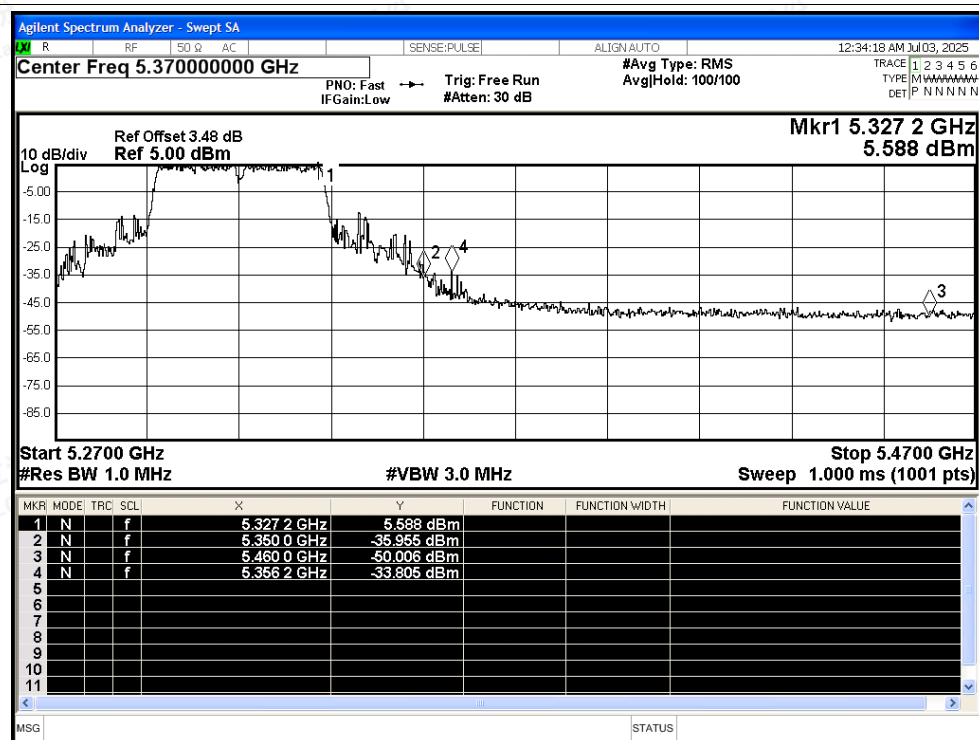

Restrict Band NVNT ax40 5310MHz Ant3 Average

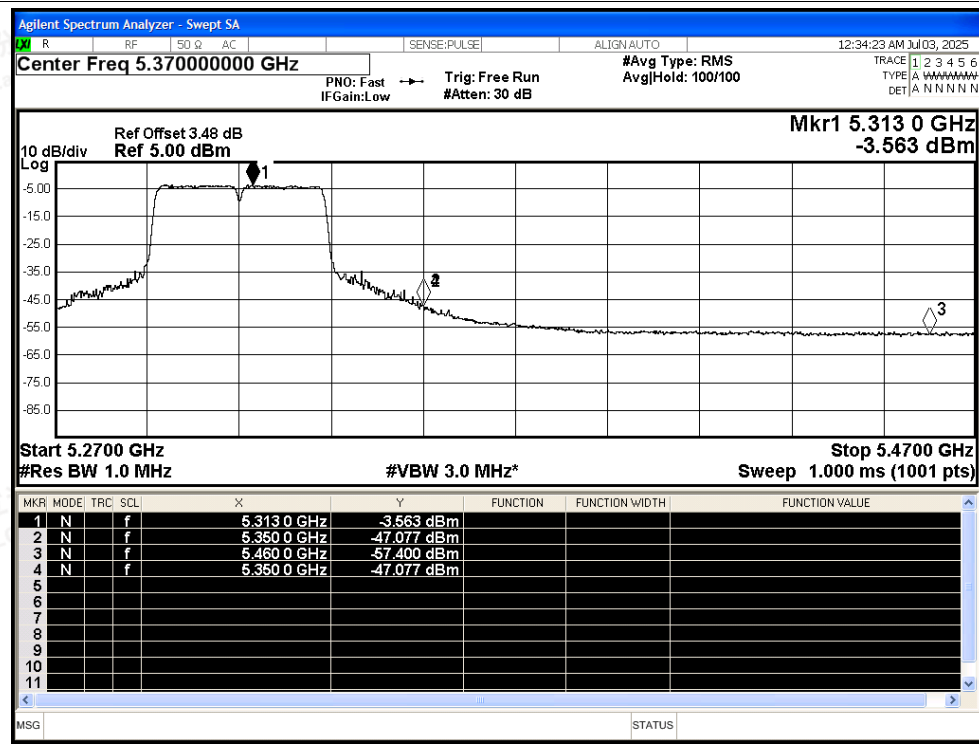

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant3 Peak

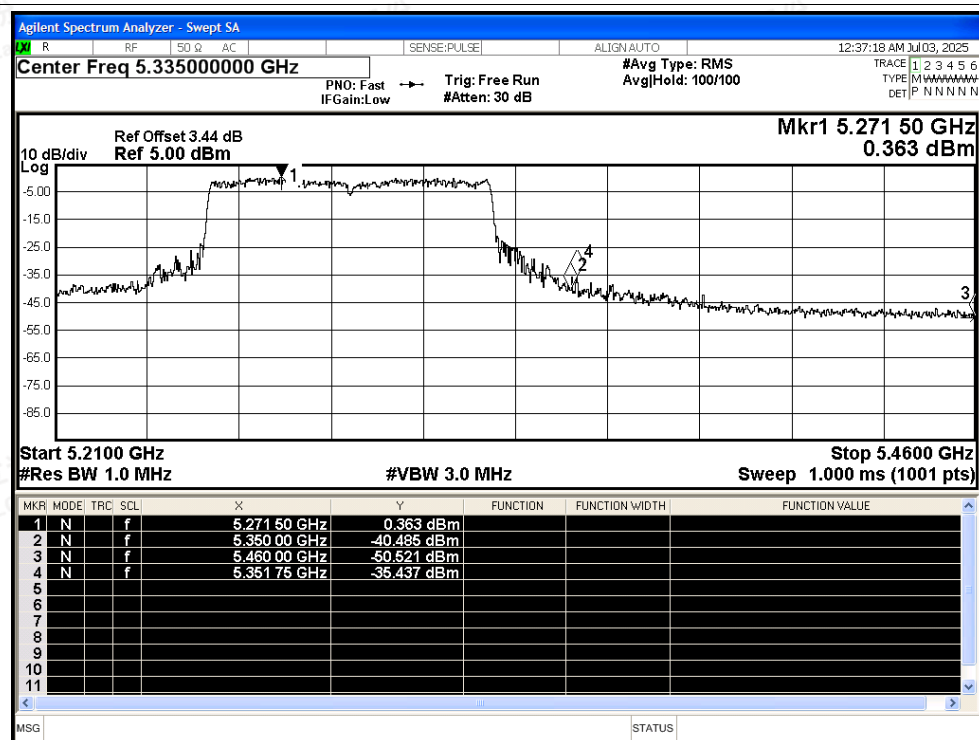

Restrict Band NVNT ax80 5290MHz Ant3 Average

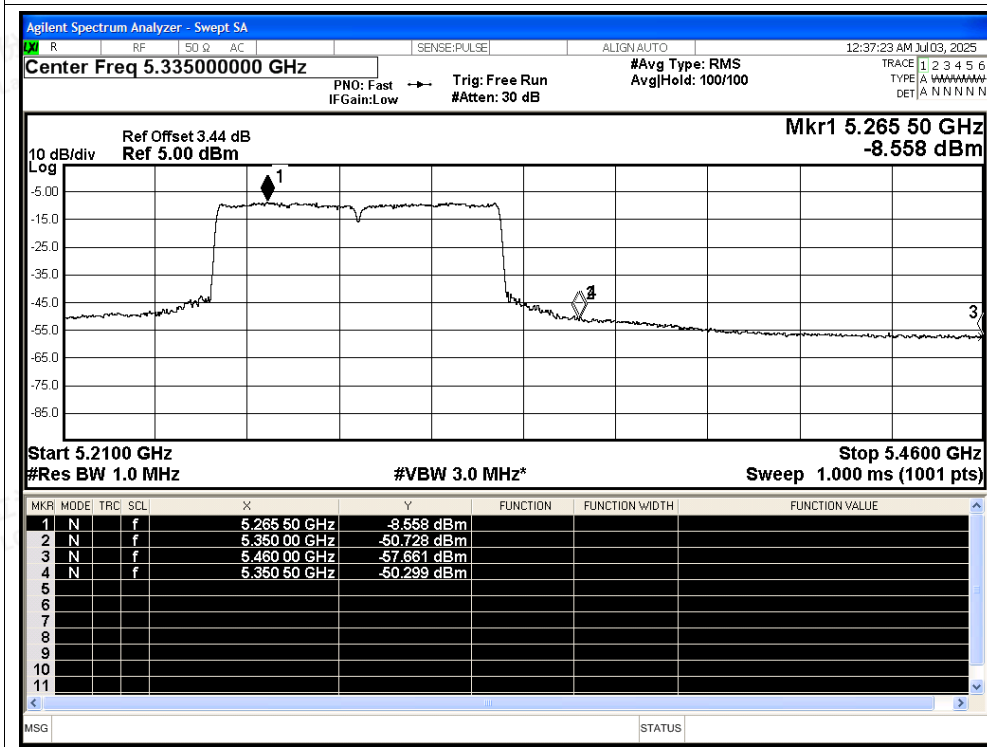

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant3 Peak

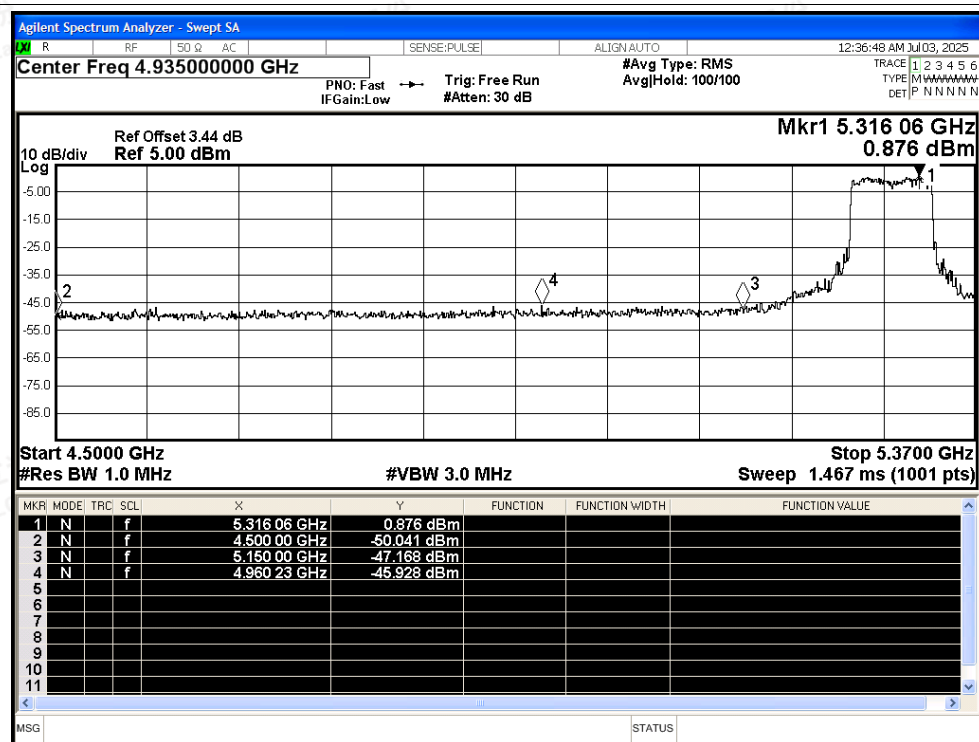

Restrict Band NVNT ax80 5290MHz Ant3 Average

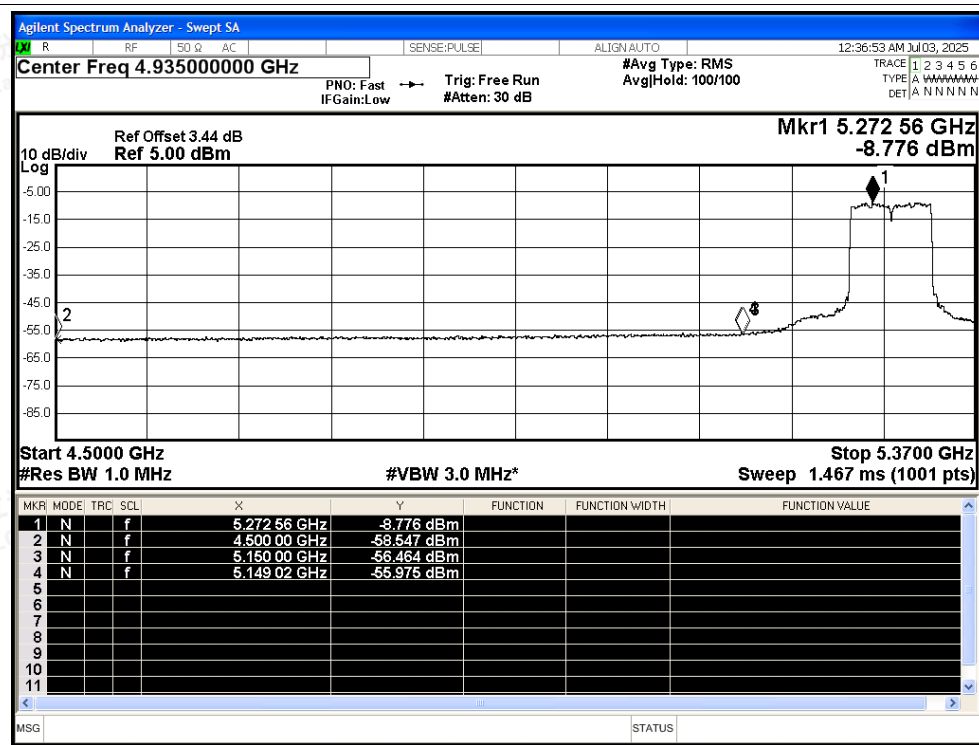



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant5	4500	-46.19	3.93	-	52.97	Peak	68.2	Pass
NVNT	a	5260	Ant5	4500	-55.74	3.93	0.19	43.61	Average	54	Pass
NVNT	a	5260	Ant5	5037.42	-43.24	3.93	-	55.92	Peak	68.2	Pass
NVNT	a	5260	Ant5	4787.04	-52.64	3.93	0.19	46.71	Average	54	Pass
NVNT	a	5260	Ant5	5150	-44.47	3.93	-	54.69	Peak	68.2	Pass
NVNT	a	5260	Ant5	5150	-53.04	3.93	0.19	46.31	Average	54	Pass
NVNT	a	5320	Ant5	5350	-38.92	3.93	-	60.24	Peak	68.2	Pass
NVNT	a	5320	Ant5	5350	-51.77	3.93	0.19	47.58	Average	54	Pass
NVNT	a	5320	Ant5	5350.2	-36.03	3.93	-	63.13	Peak	68.2	Pass
NVNT	a	5320	Ant5	5350.8	-49.66	3.93	0.19	49.69	Average	54	Pass
NVNT	a	5320	Ant5	5460	-49.85	3.93	-	49.31	Peak	68.2	Pass
NVNT	a	5320	Ant5	5460	-57.47	3.93	0.19	41.88	Average	54	Pass
NVNT	n20	5260	Ant5	4500	-50.37	3.93	-	48.79	Peak	68.2	Pass
NVNT	n20	5260	Ant5	4500	-58.84	3.93	0.23	40.55	Average	54	Pass
NVNT	n20	5260	Ant5	5141.16	-45.93	3.93	-	53.23	Peak	68.2	Pass
NVNT	n20	5260	Ant5	4787.04	-55.28	3.93	0.23	44.11	Average	54	Pass
NVNT	n20	5260	Ant5	5150	-48.18	3.93	-	50.98	Peak	68.2	Pass
NVNT	n20	5260	Ant5	5150	-56.33	3.93	0.23	43.06	Average	54	Pass
NVNT	n20	5320	Ant5	5350	-36.23	3.93	-	62.93	Peak	68.2	Pass
NVNT	n20	5320	Ant5	5350	-48.02	3.93	0.23	51.37	Average	54	Pass
NVNT	n20	5320	Ant5	5350.2	-32.02	3.93	-	67.14	Peak	68.2	Pass
NVNT	n20	5320	Ant5	5350	-48.02	3.93	0.23	51.37	Average	54	Pass
NVNT	n20	5320	Ant5	5460	-49.48	3.93	-	49.68	Peak	68.2	Pass
NVNT	n20	5320	Ant5	5460	-57.53	3.93	0.23	41.86	Average	54	Pass
NVNT	n40	5270	Ant5	4500	-49.51	3.93	-	49.65	Peak	68.2	Pass
NVNT	n40	5270	Ant5	4500	-58.55	3.93	0.44	41.05	Average	54	Pass
NVNT	n40	5270	Ant5	4808.61	-43.41	3.93	-	55.75	Peak	68.2	Pass
NVNT	n40	5270	Ant5	4806.18	-53	3.93	0.44	46.60	Average	54	Pass
NVNT	n40	5270	Ant5	5150	-47.2	3.93	-	51.96	Peak	68.2	Pass
NVNT	n40	5270	Ant5	5150	-57.03	3.93	0.44	42.57	Average	54	Pass
NVNT	n40	5310	Ant5	5350	-37.83	3.93	-	61.33	Peak	68.2	Pass
NVNT	n40	5310	Ant5	5350	-48.89	3.93	0.44	50.71	Average	54	Pass
NVNT	n40	5310	Ant5	5352	-36.92	3.93	-	62.24	Peak	68.2	Pass
NVNT	n40	5310	Ant5	5350.2	-48.52	3.93	0.44	51.08	Average	54	Pass
NVNT	n40	5310	Ant5	5460	-49.25	3.93	-	49.91	Peak	68.2	Pass
NVNT	n40	5310	Ant5	5460	-57.19	3.93	0.44	42.41	Average	54	Pass
NVNT	ac20	5260	Ant5	4500	-51.71	3.93	-	47.45	Peak	68.2	Pass
NVNT	ac20	5260	Ant5	4500	-58.42	3.93	0.22	40.96	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant5	4748.82	-45.89	3.93	-	53.27	Peak	68.2	Pass
NVNT	ac20	5260	Ant5	4787.82	-55.31	3.93	0.22	44.07	Average	54	Pass
NVNT	ac20	5260	Ant5	5150	-47.26	3.93	-	51.90	Peak	68.2	Pass
NVNT	ac20	5260	Ant5	5150	-56.34	3.93	0.22	43.04	Average	54	Pass
NVNT	ac20	5320	Ant5	5350	-34.14	3.93	-	65.02	Peak	68.2	Pass
NVNT	ac20	5320	Ant5	5350	-46.94	3.93	0.22	52.44	Average	54	Pass
NVNT	ac20	5320	Ant5	5353	-30.97	3.93	-	68.19	Peak	68.2	Pass
NVNT	ac20	5320	Ant5	5350.2	-46.71	3.93	0.22	52.67	Average	54	Pass
NVNT	ac20	5320	Ant5	5460	-48.2	3.93	-	50.96	Peak	68.2	Pass
NVNT	ac20	5320	Ant5	5460	-57.19	3.93	0.22	42.19	Average	54	Pass
NVNT	ac40	5270	Ant5	4500	-50.08	3.93	-	49.08	Peak	68.2	Pass
NVNT	ac40	5270	Ant5	4500	-58.48	3.93	0.43	41.11	Average	54	Pass
NVNT	ac40	5270	Ant5	4807.8	-43.28	3.93	-	55.88	Peak	68.2	Pass
NVNT	ac40	5270	Ant5	4806.99	-52.39	3.93	0.43	47.20	Average	54	Pass
NVNT	ac40	5270	Ant5	5150	-47.79	3.93	-	51.37	Peak	68.2	Pass
NVNT	ac40	5270	Ant5	5150	-56.57	3.93	0.43	43.02	Average	54	Pass
NVNT	ac40	5310	Ant5	5350	-36.26	3.93	-	62.90	Peak	68.2	Pass
NVNT	ac40	5310	Ant5	5350	-48.06	3.93	0.43	51.53	Average	54	Pass
NVNT	ac40	5310	Ant5	5350.4	-34.57	3.93	-	64.59	Peak	68.2	Pass
NVNT	ac40	5310	Ant5	5350.4	-47.66	3.93	0.43	51.93	Average	54	Pass
NVNT	ac40	5310	Ant5	5460	-47.65	3.93	-	51.51	Peak	68.2	Pass
NVNT	ac40	5310	Ant5	5460	-57.37	3.93	0.43	42.22	Average	54	Pass
NVNT	ac80	5290	Ant5	4500	-50.07	3.93	-	49.09	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	4500	-58.65	3.93	0.83	41.34	Average	54	Pass
NVNT	ac80	5290	Ant5	5149.89	-45.04	3.93	-	54.12	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	5148.15	-55.01	3.93	0.83	44.98	Average	54	Pass
NVNT	ac80	5290	Ant5	5150	-45.04	3.93	-	54.12	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	5150	-55.41	3.93	0.83	44.58	Average	54	Pass
NVNT	ac80	5290	Ant5	5350	-39.9	3.93	-	59.26	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	5350	-49.39	3.93	0.83	50.60	Average	54	Pass
NVNT	ac80	5290	Ant5	5365	-37.25	3.93	-	61.91	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	5350.25	-49.02	3.93	0.83	50.97	Average	54	Pass
NVNT	ac80	5290	Ant5	5460	-49.33	3.93	-	49.83	Peak	68.2	Pass
NVNT	ac80	5290	Ant5	5460	-57.32	3.93	0.83	42.67	Average	54	Pass
NVNT	ax20	5260	Ant5	4500	-49.42	3.93	-	49.74	Peak	68.2	Pass
NVNT	ax20	5260	Ant5	4500	-58.64	3.93	0.22	40.74	Average	54	Pass
NVNT	ax20	5260	Ant5	5142.72	-45.54	3.93	-	53.62	Peak	68.2	Pass
NVNT	ax20	5260	Ant5	4787.82	-55.26	3.93	0.22	44.12	Average	54	Pass
NVNT	ax20	5260	Ant5	5150	-48.61	3.93	-	50.55	Peak	68.2	Pass
NVNT	ax20	5260	Ant5	5150	-56.11	3.93	0.22	43.27	Average	54	Pass
NVNT	ax20	5320	Ant5	5350	-35.72	3.93	-	63.44	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant5	5350	-48.34	3.93	0.22	51.04	Average	54	Pass
NVNT	ax20	5320	Ant5	5351.6	-31.76	3.93	-	67.40	Peak	68.2	Pass
NVNT	ax20	5320	Ant5	5350.4	-47.38	3.93	0.22	52.00	Average	54	Pass
NVNT	ax20	5320	Ant5	5460	-47.57	3.93	-	51.59	Peak	68.2	Pass
NVNT	ax20	5320	Ant5	5460	-57.47	3.93	0.22	41.91	Average	54	Pass
NVNT	ax40	5270	Ant5	4500	-52.01	3.93	-	47.15	Peak	68.2	Pass
NVNT	ax40	5270	Ant5	4500	-58.41	3.93	0.43	41.18	Average	54	Pass
NVNT	ax40	5270	Ant5	4806.18	-44.65	3.93	-	54.51	Peak	68.2	Pass
NVNT	ax40	5270	Ant5	4806.99	-53.92	3.93	0.43	45.67	Average	54	Pass
NVNT	ax40	5270	Ant5	5150	-47.35	3.93	-	51.81	Peak	68.2	Pass
NVNT	ax40	5270	Ant5	5150	-57	3.93	0.43	42.59	Average	54	Pass
NVNT	ax40	5310	Ant5	5350	-35.72	3.93	-	63.44	Peak	68.2	Pass
NVNT	ax40	5310	Ant5	5350	-49.46	3.93	0.43	50.13	Average	54	Pass
NVNT	ax40	5310	Ant5	5350	-49.46	3.93	0.43	49.70	Average	54	Pass
NVNT	ax40	5310	Ant5	5350.4	-49.23	3.93	0.43	50.36	Average	54	Pass
NVNT	ax40	5310	Ant5	5460	-49.95	3.93	-	49.21	Peak	68.2	Pass
NVNT	ax40	5310	Ant5	5460	-57.62	3.93	0.43	41.97	Average	54	Pass
NVNT	ax80	5290	Ant5	5350	-39.41	3.93	-	59.75	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	5350	-51.96	3.93	0.83	48.03	Average	54	Pass
NVNT	ax80	5290	Ant5	5351.25	-38.17	3.93	-	60.99	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	5354	-50.96	3.93	0.83	49.03	Average	54	Pass
NVNT	ax80	5290	Ant5	5460	-49.67	3.93	-	49.49	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	5460	-57.41	3.93	0.83	42.58	Average	54	Pass
NVNT	ax80	5290	Ant5	4500	-49.13	3.93	-	50.03	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	4500	-58.28	3.93	0.83	41.71	Average	54	Pass
NVNT	ax80	5290	Ant5	5035.05	-45.52	3.93	-	53.64	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	5142.93	-55.52	3.93	0.83	44.47	Average	54	Pass
NVNT	ax80	5290	Ant5	5150	-47.84	3.93	-	51.32	Peak	68.2	Pass
NVNT	ax80	5290	Ant5	5150	-55.99	3.93	0.83	44.00	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant5 Peak

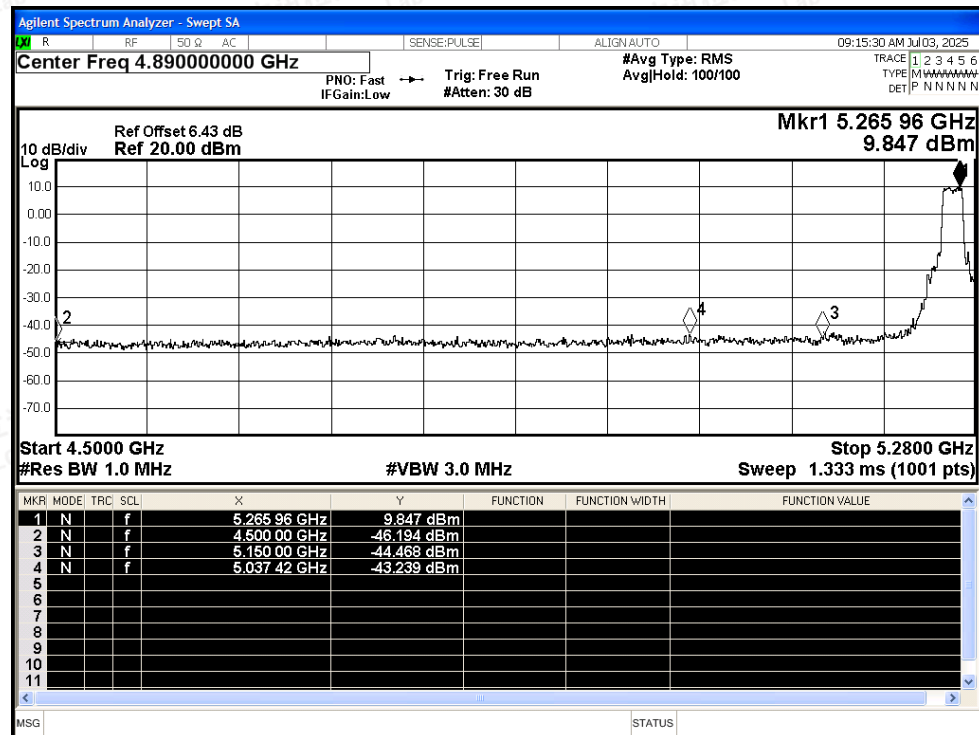


Restrict Band NVNT a 5260MHz Ant5 Average

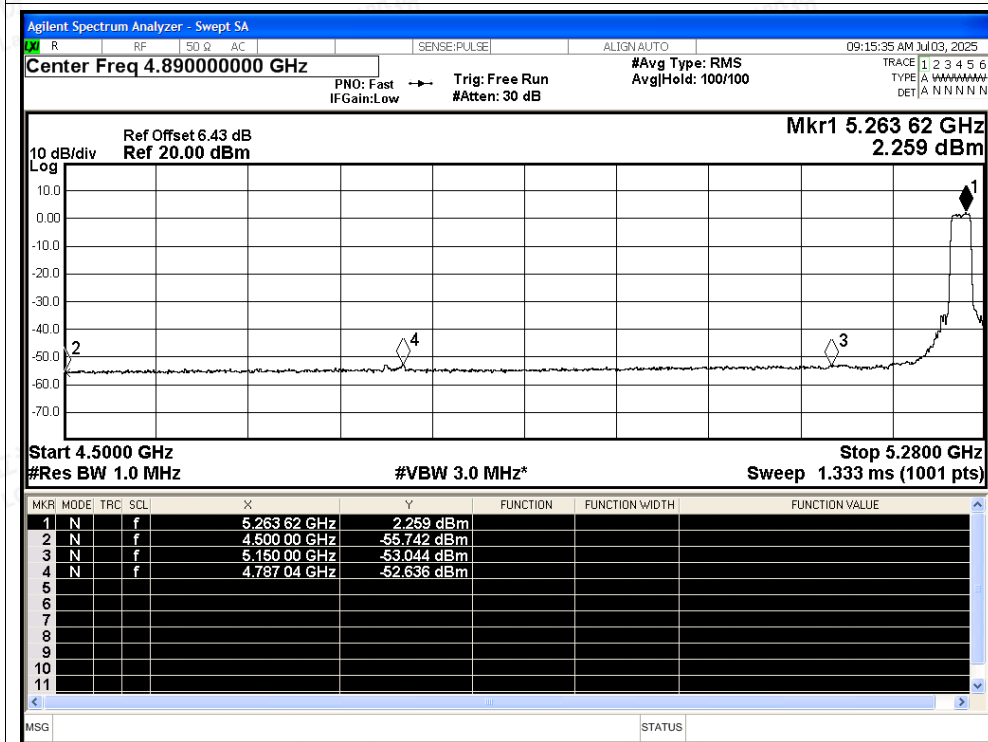




Restrict Band NVNT a 5320MHz Ant5 Peak

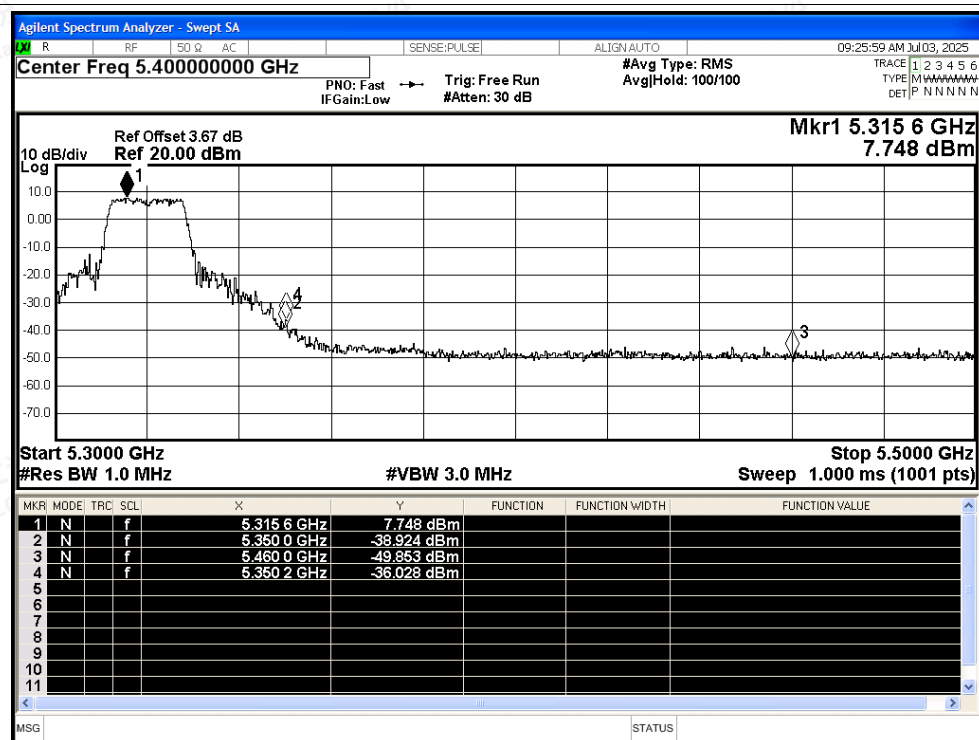

Restrict Band NVNT a 5320MHz Ant5 Average

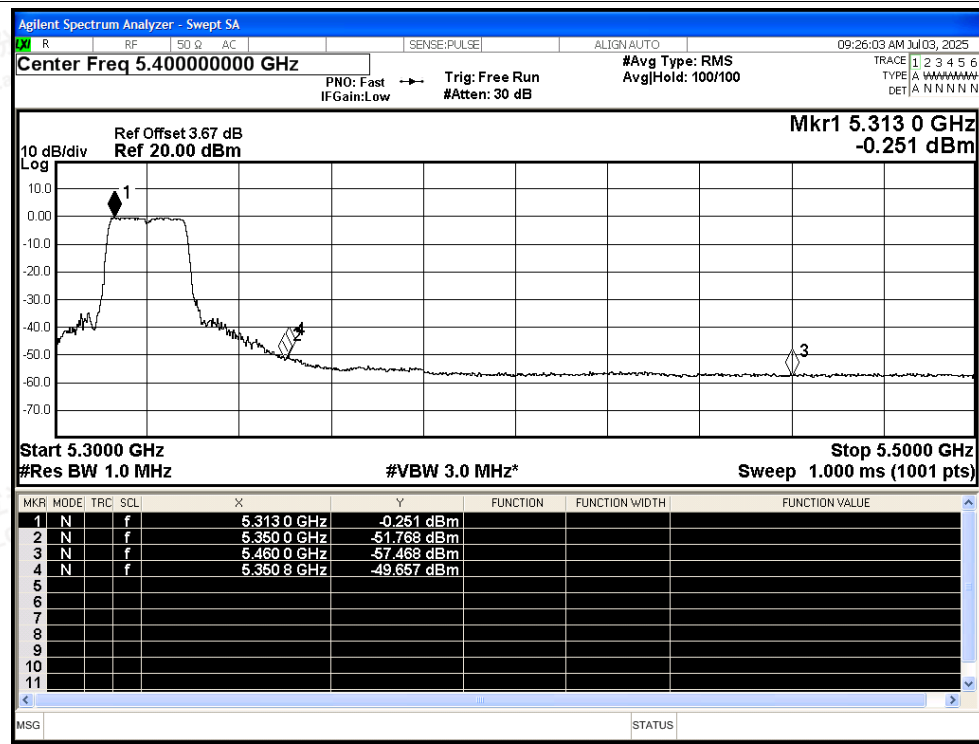

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant5 Peak

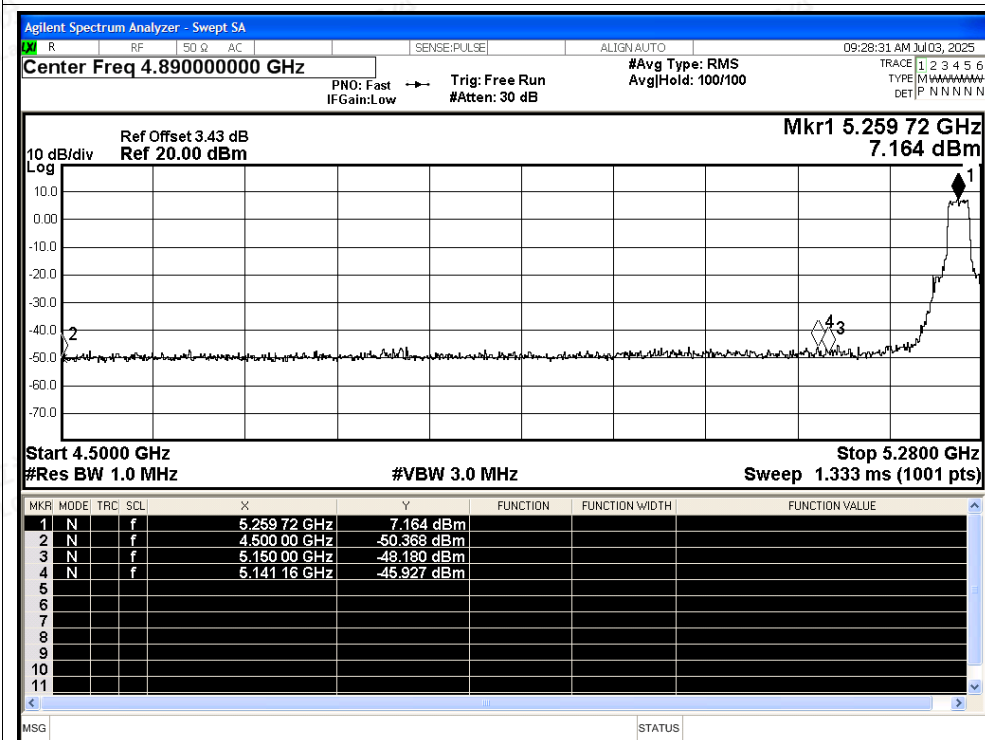

Restrict Band NVNT n20 5260MHz Ant5 Average

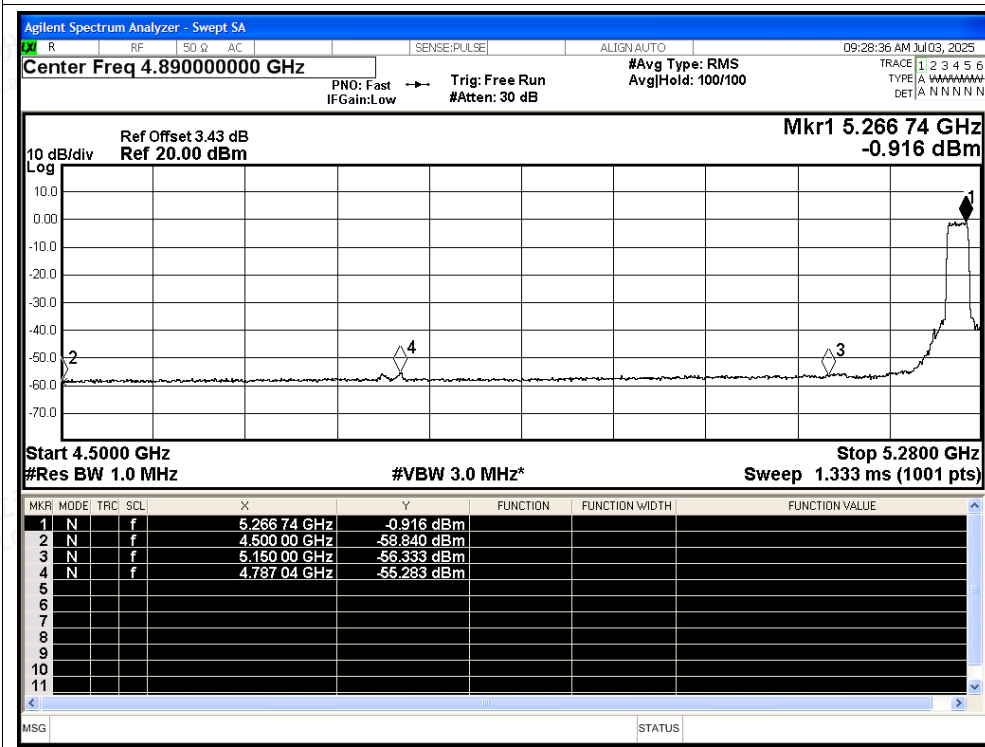

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant5 Peak

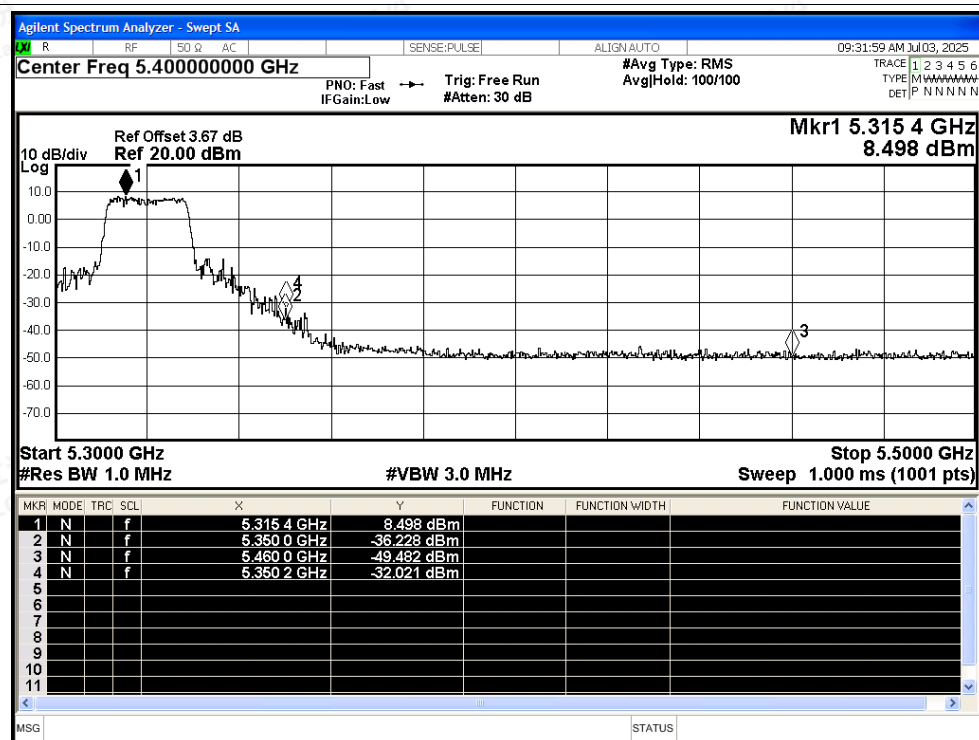

Restrict Band NVNT n20 5320MHz Ant5 Average

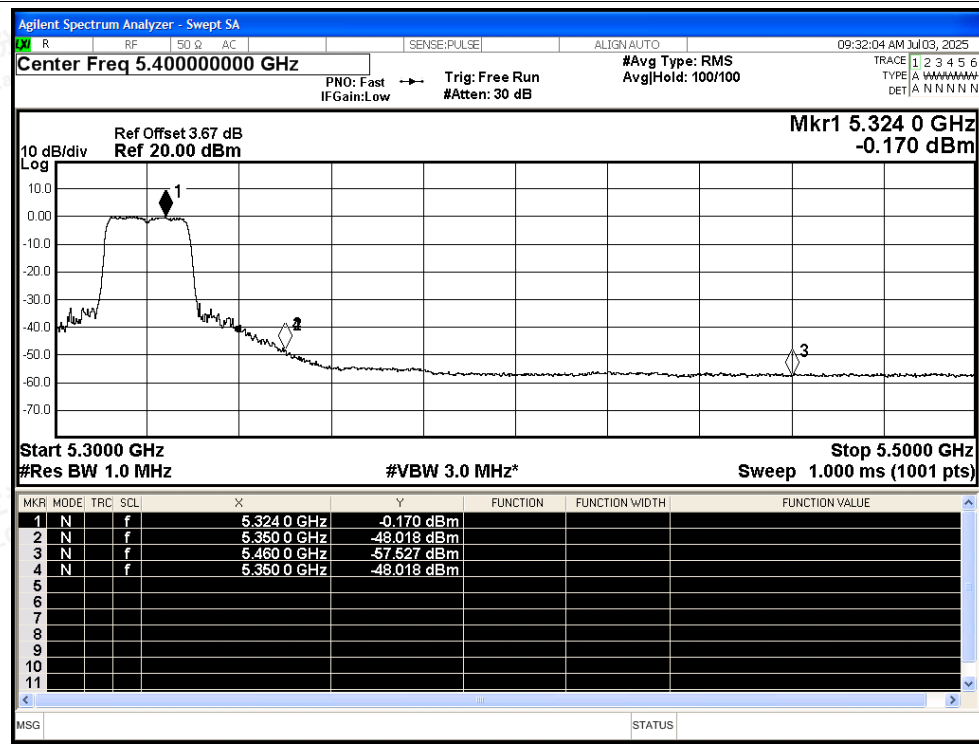

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant5 Peak

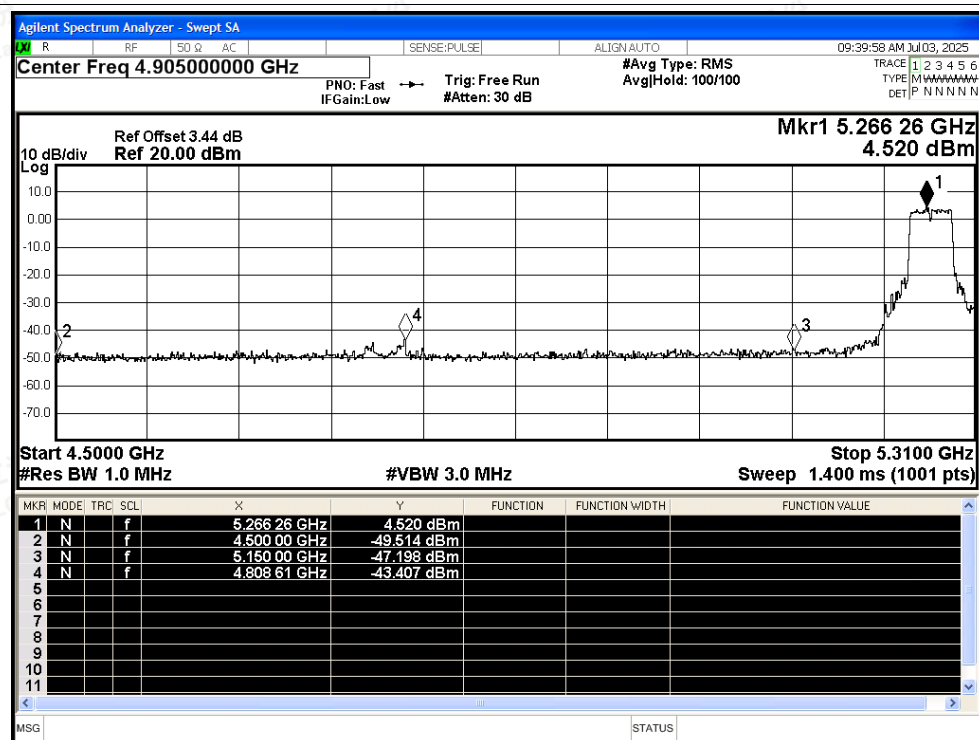

Restrict Band NVNT n40 5270MHz Ant5 Average

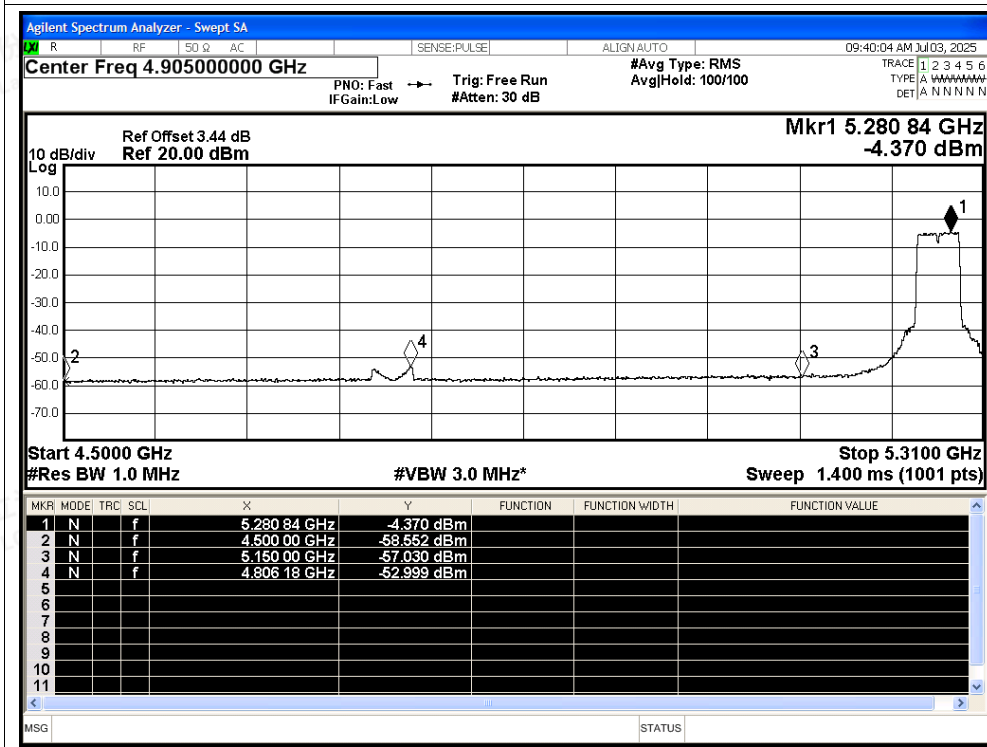

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant5 Peak

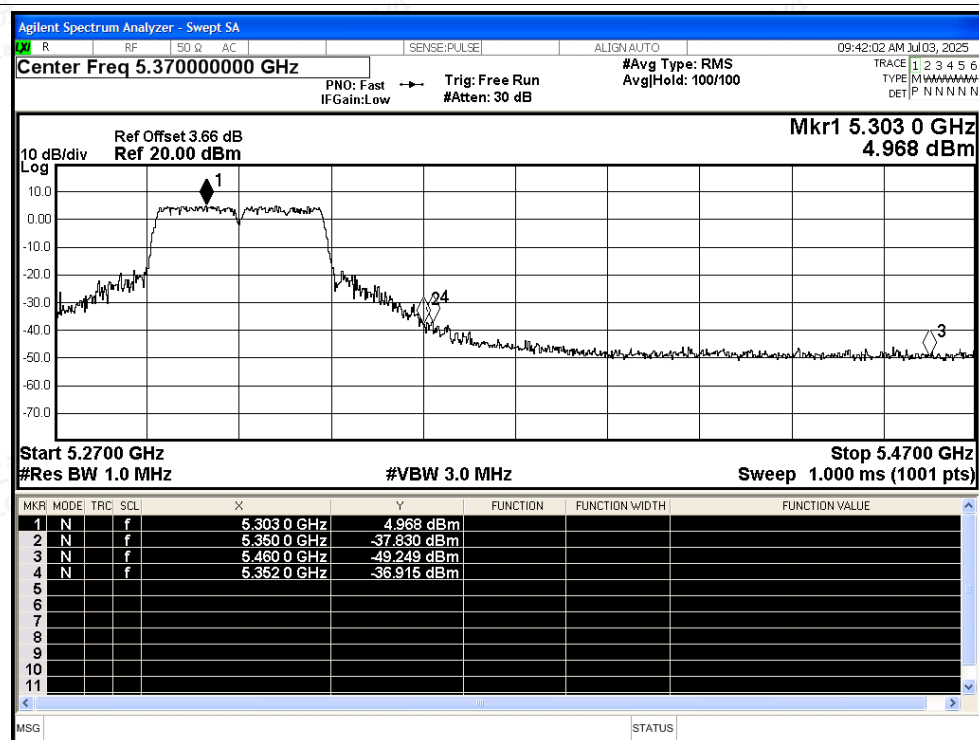

Restrict Band NVNT n40 5310MHz Ant5 Average

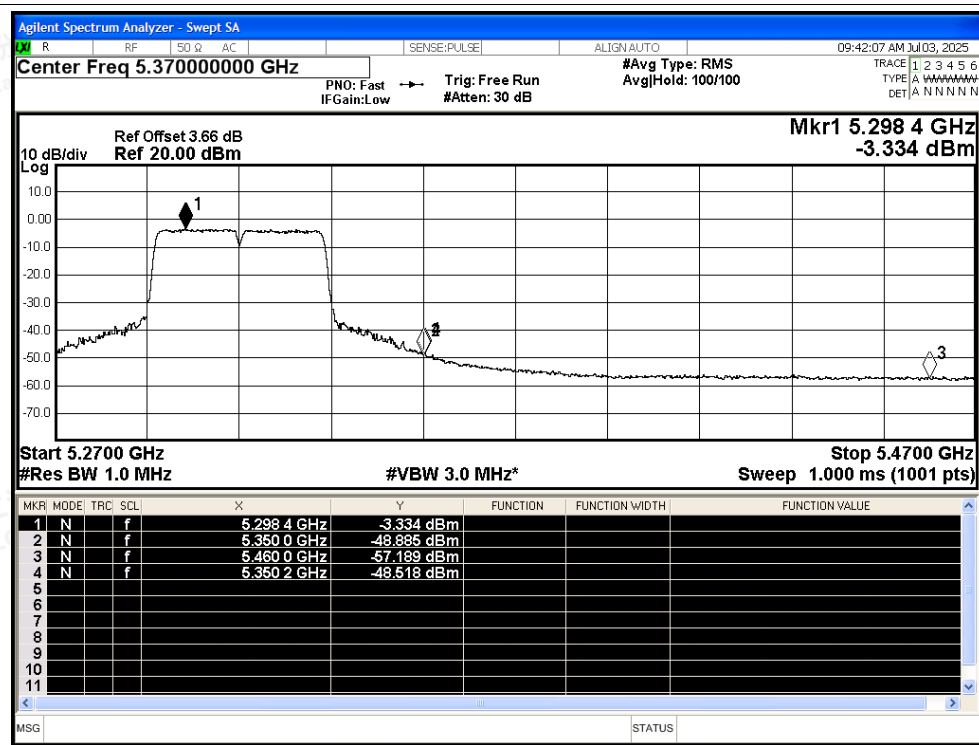

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant5 Peak

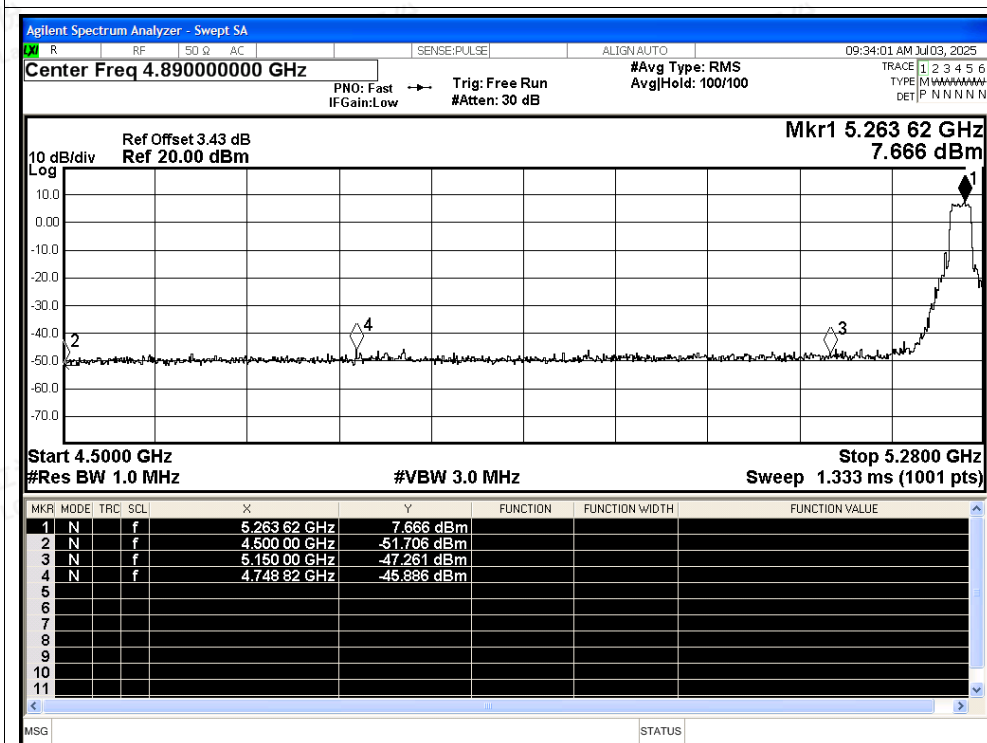

Restrict Band NVNT ac20 5260MHz Ant5 Average

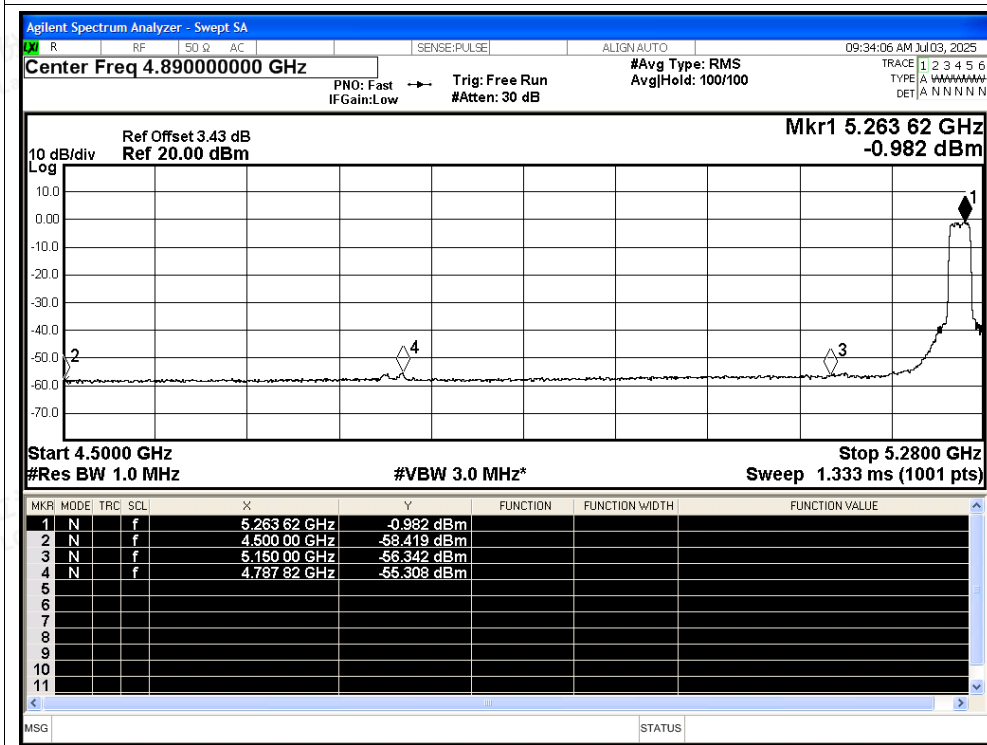

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant5 Peak

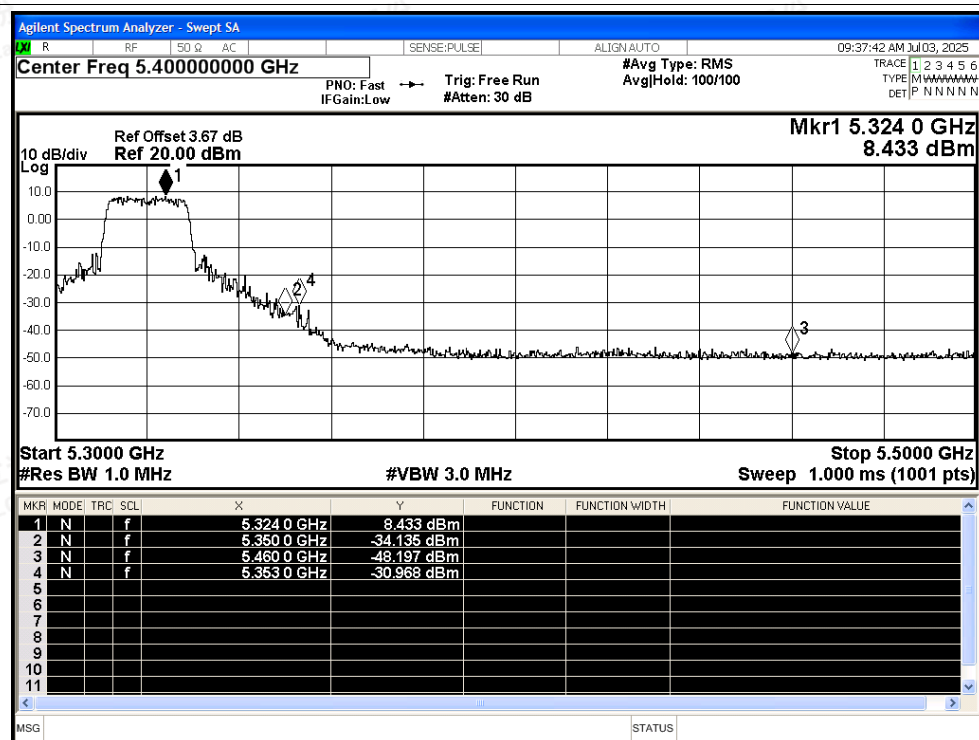

Restrict Band NVNT ac20 5320MHz Ant5 Average

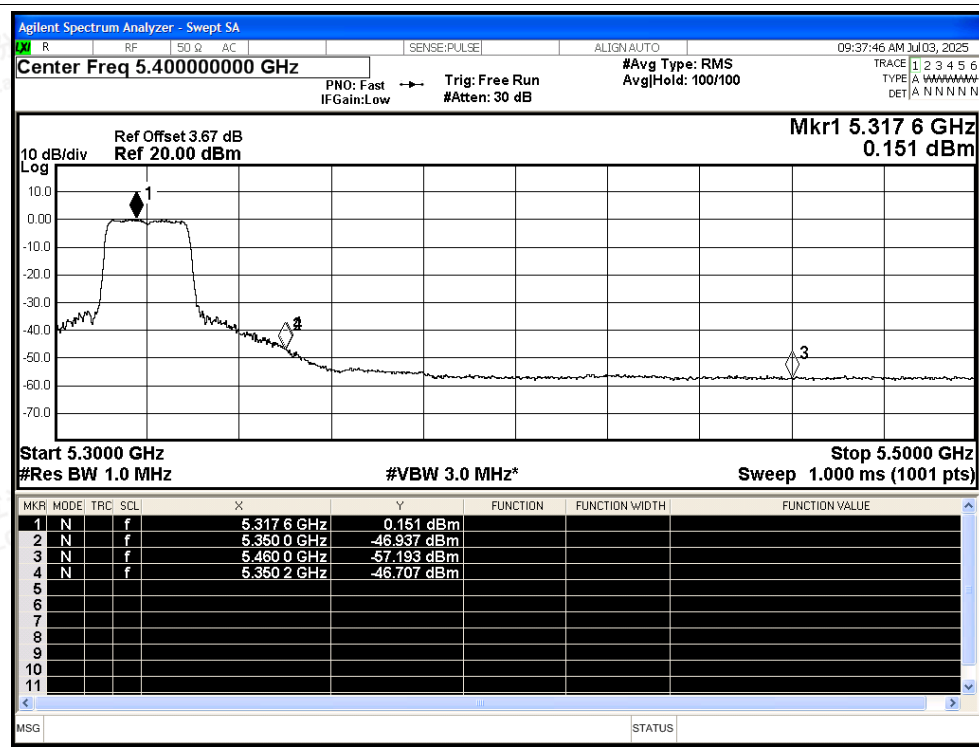

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant5 Peak

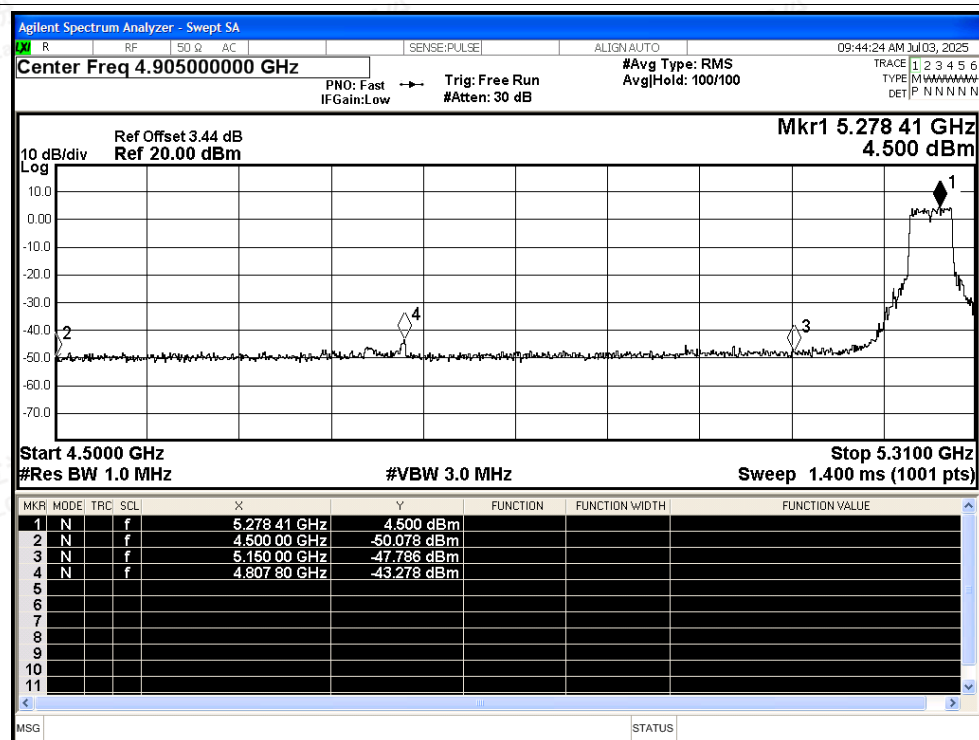

Restrict Band NVNT ac40 5270MHz Ant5 Average

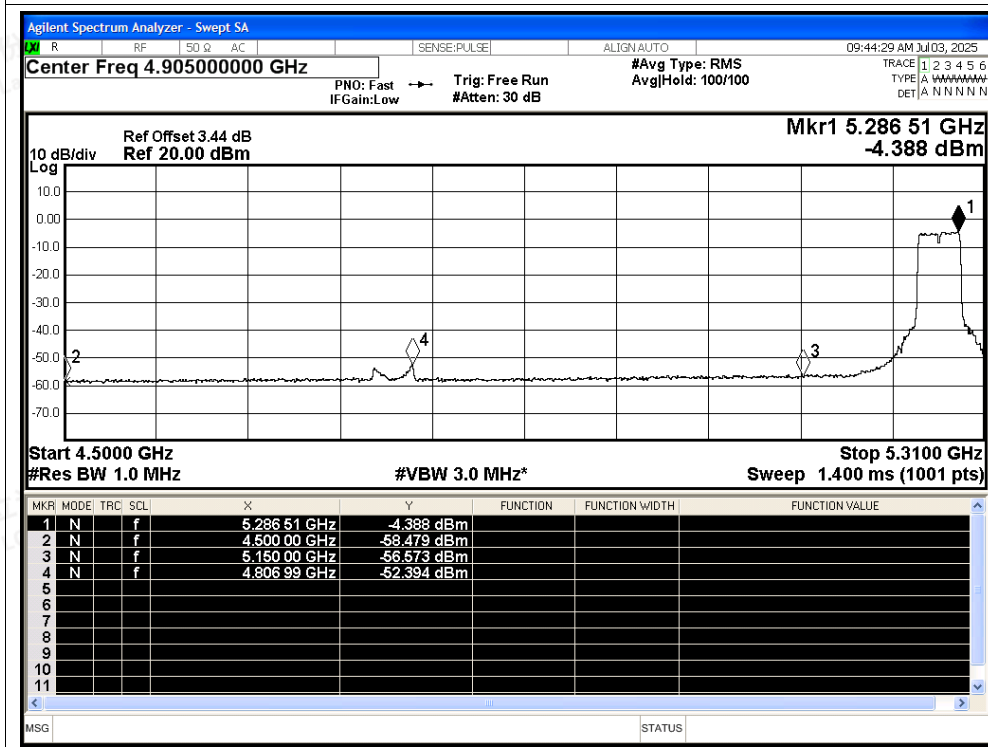

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant5 Peak

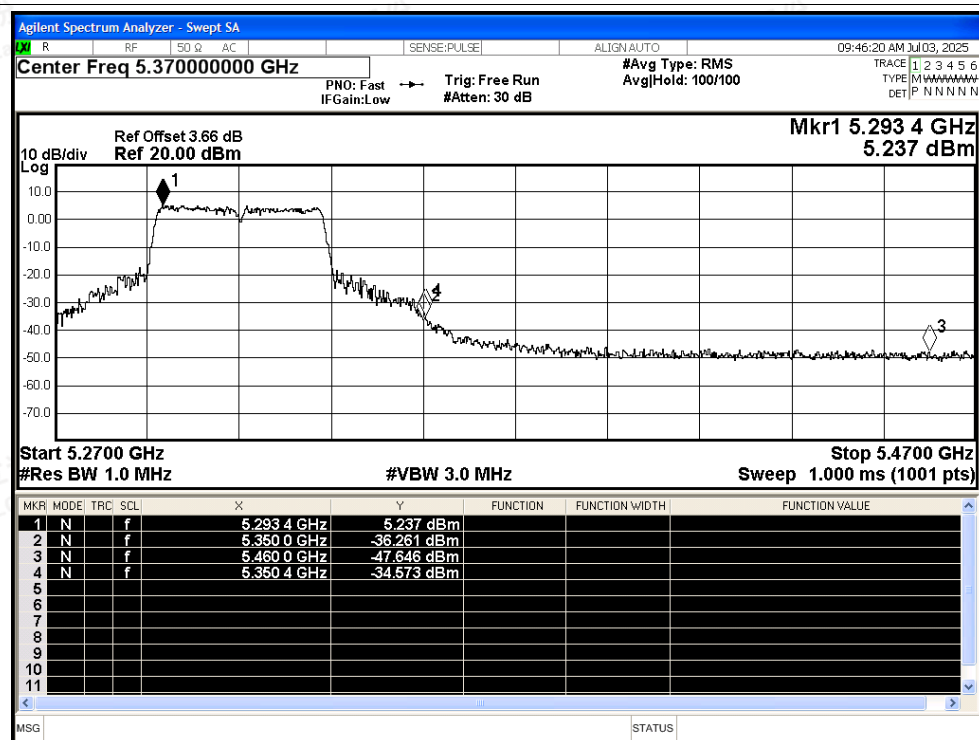

Restrict Band NVNT ac40 5310MHz Ant5 Average

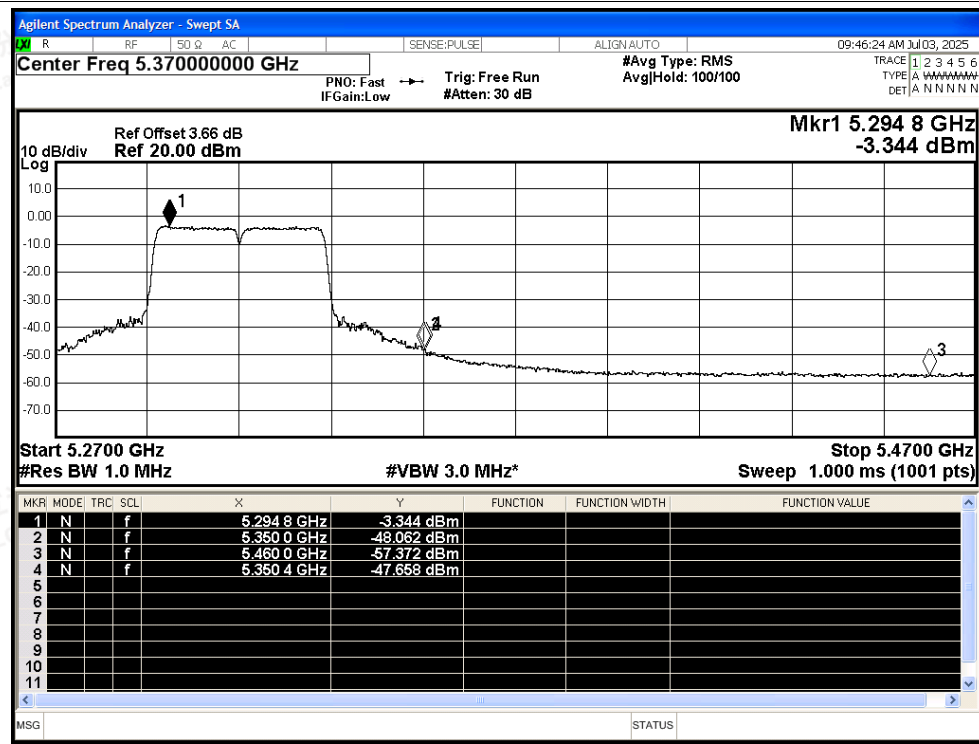

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant5 Peak

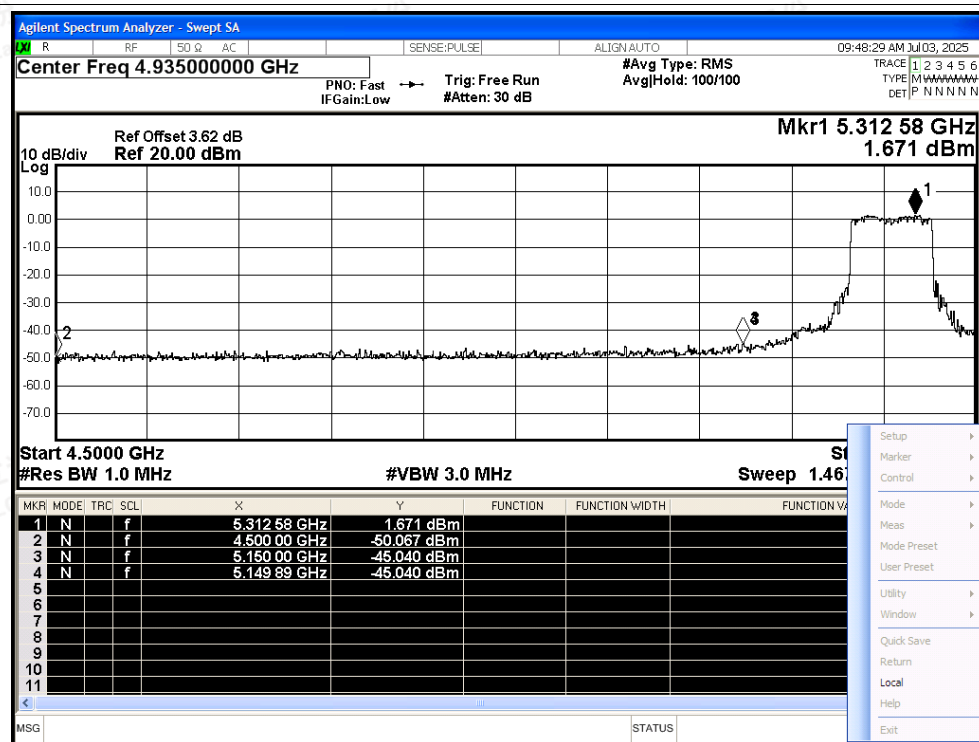


Restrict Band NVNT ac80 5290MHz Ant5 Average

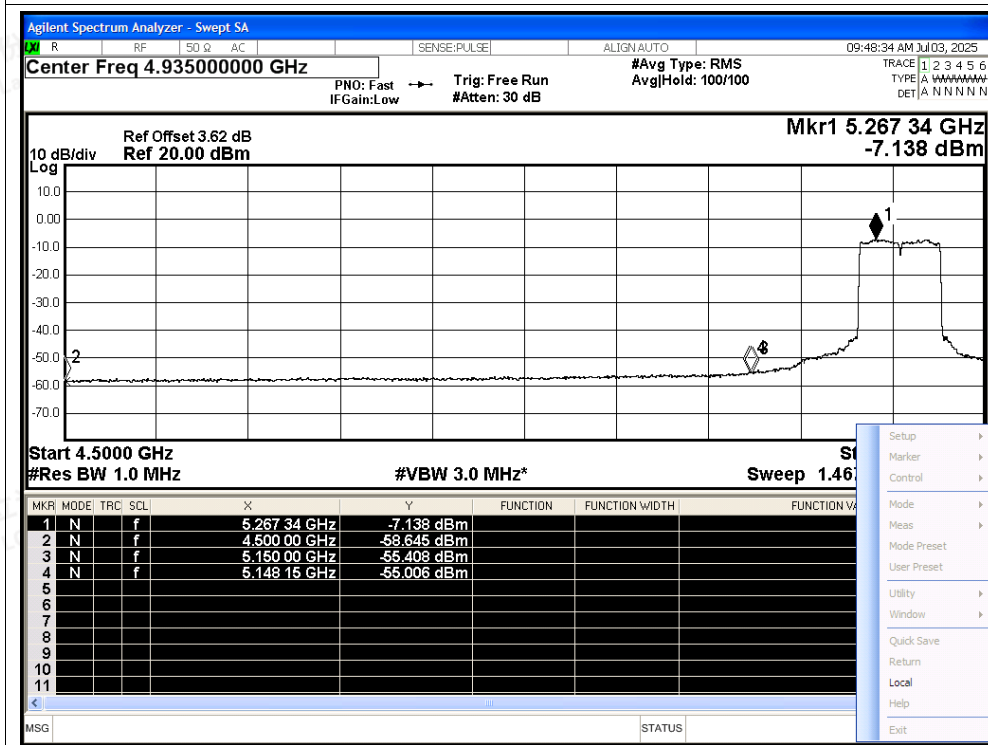




Restrict Band NVNT ac80 5290MHz Ant5 Peak

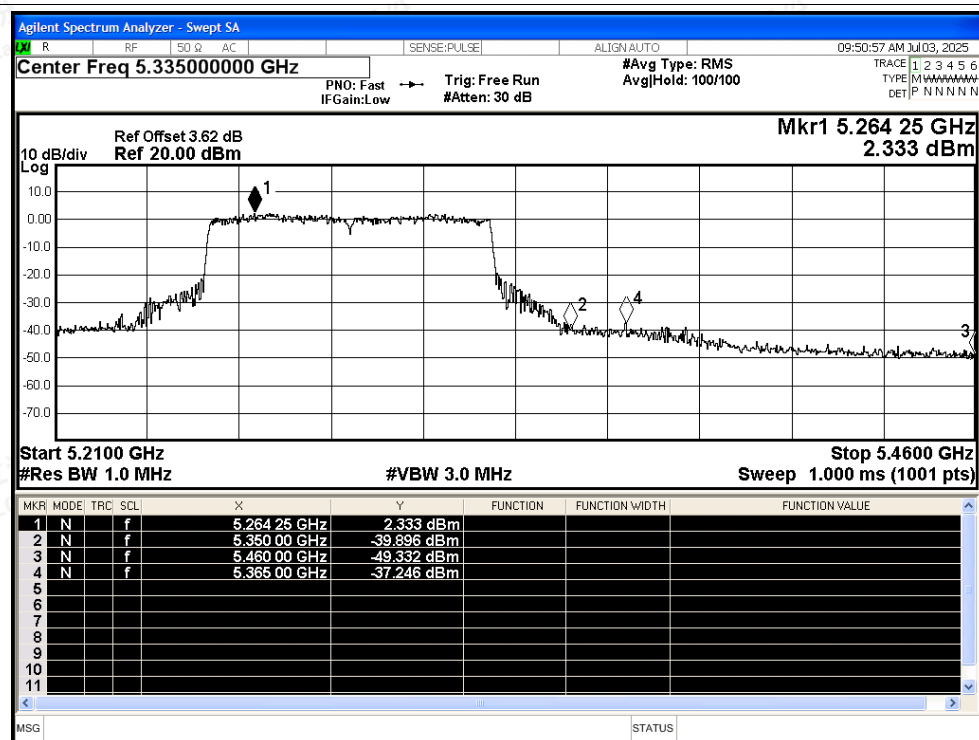

Restrict Band NVNT ac80 5290MHz Ant5 Average

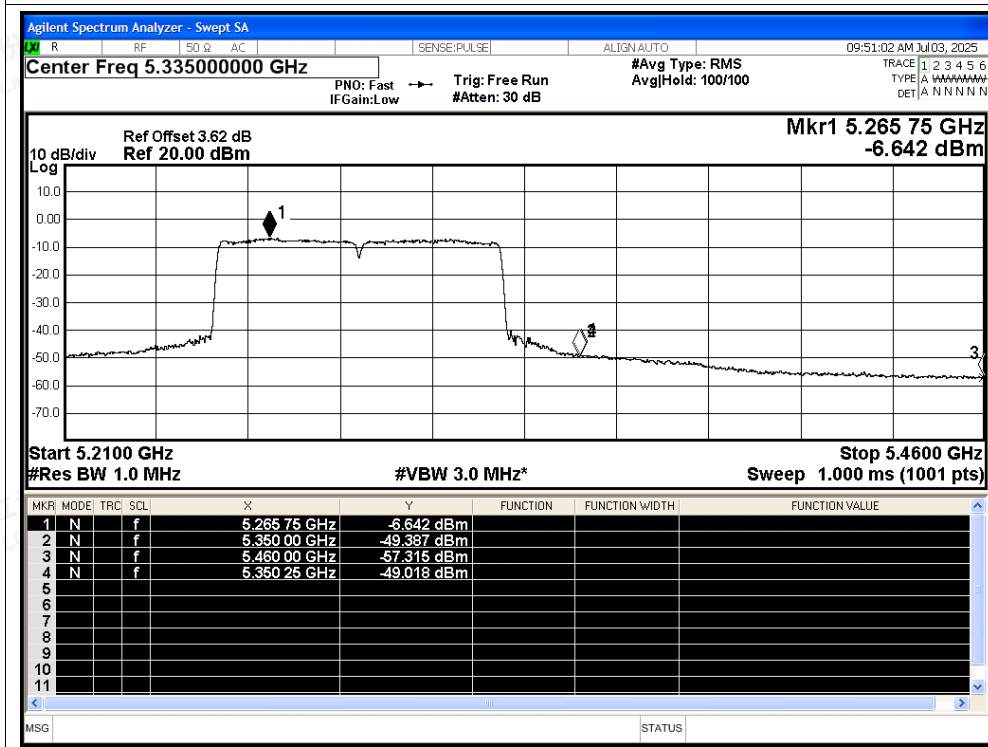

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant5 Peak

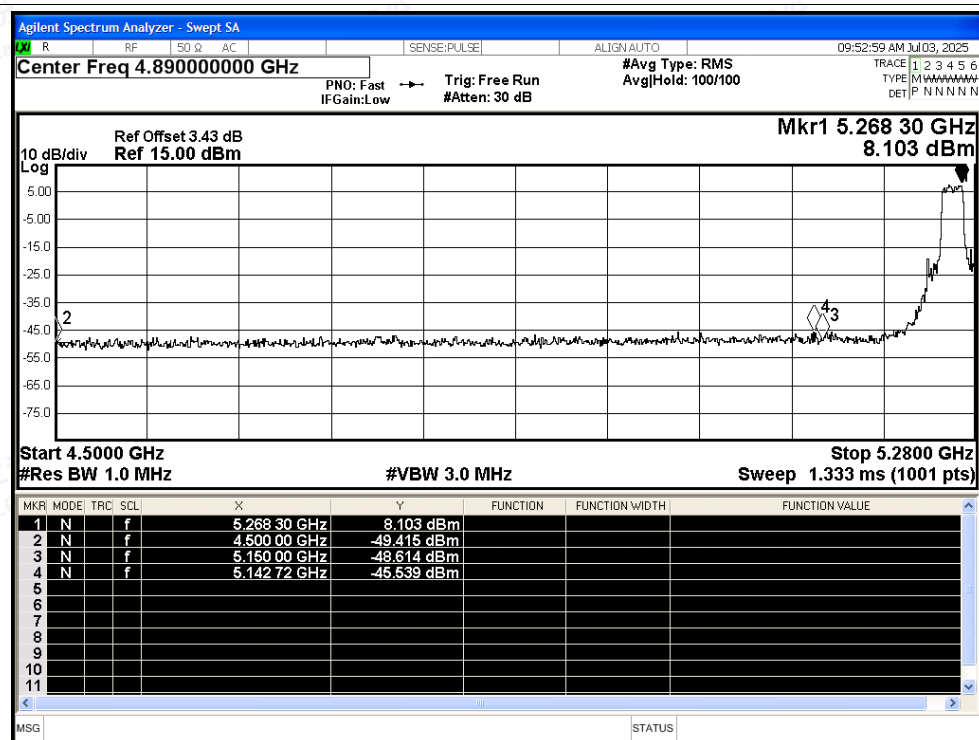

Restrict Band NVNT ax20 5260MHz Ant5 Average

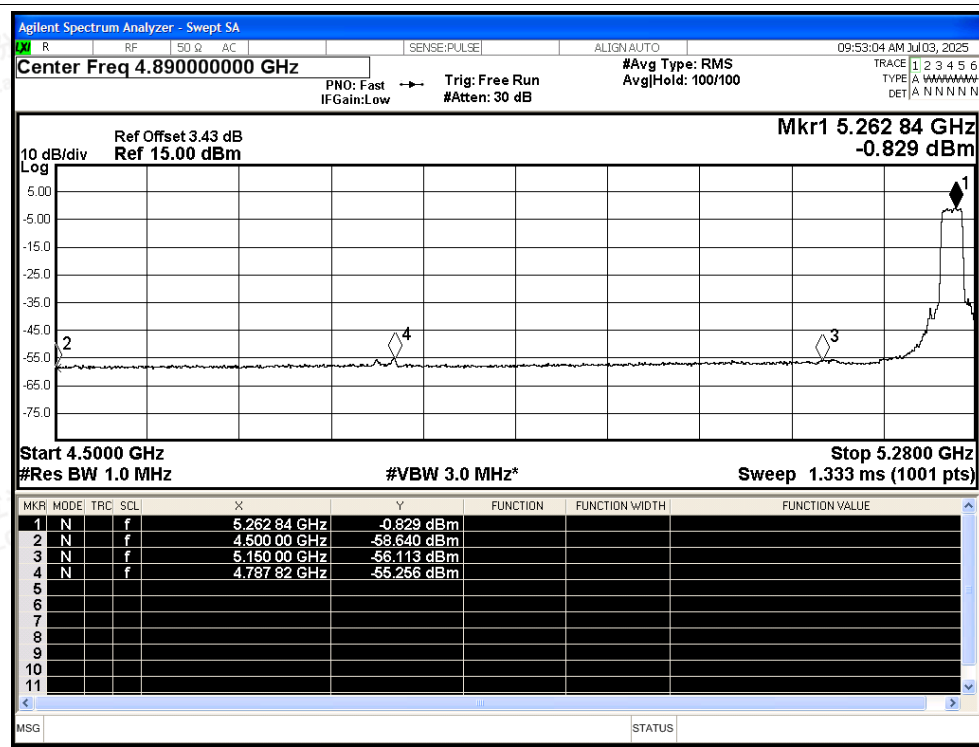

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant5 Peak

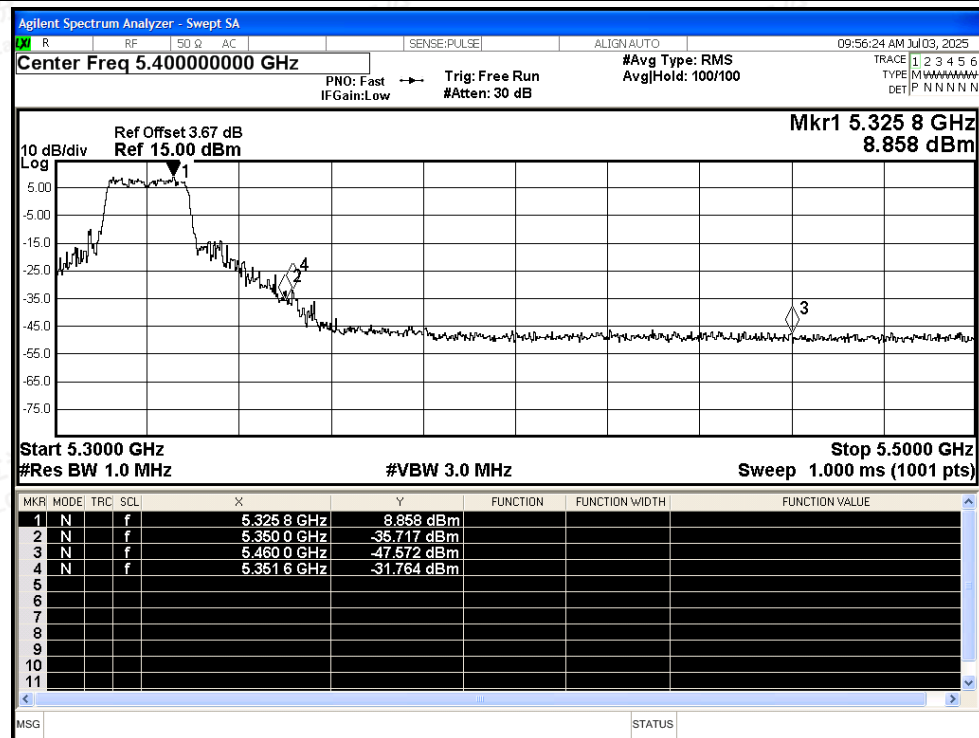

Restrict Band NVNT ax20 5320MHz Ant5 Average

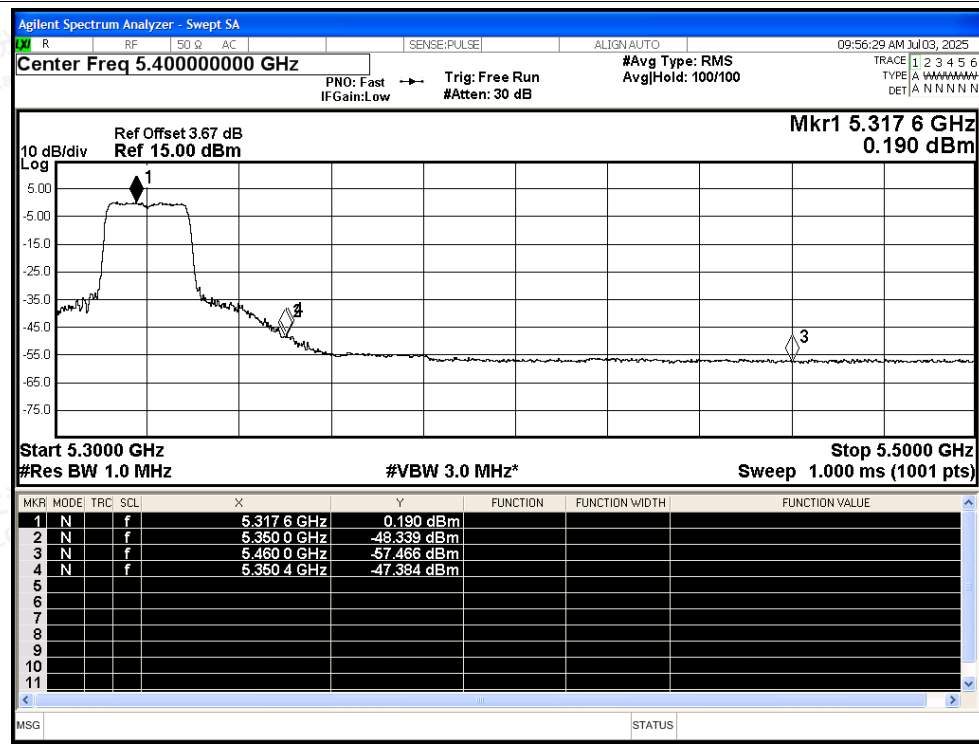

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant5 Peak

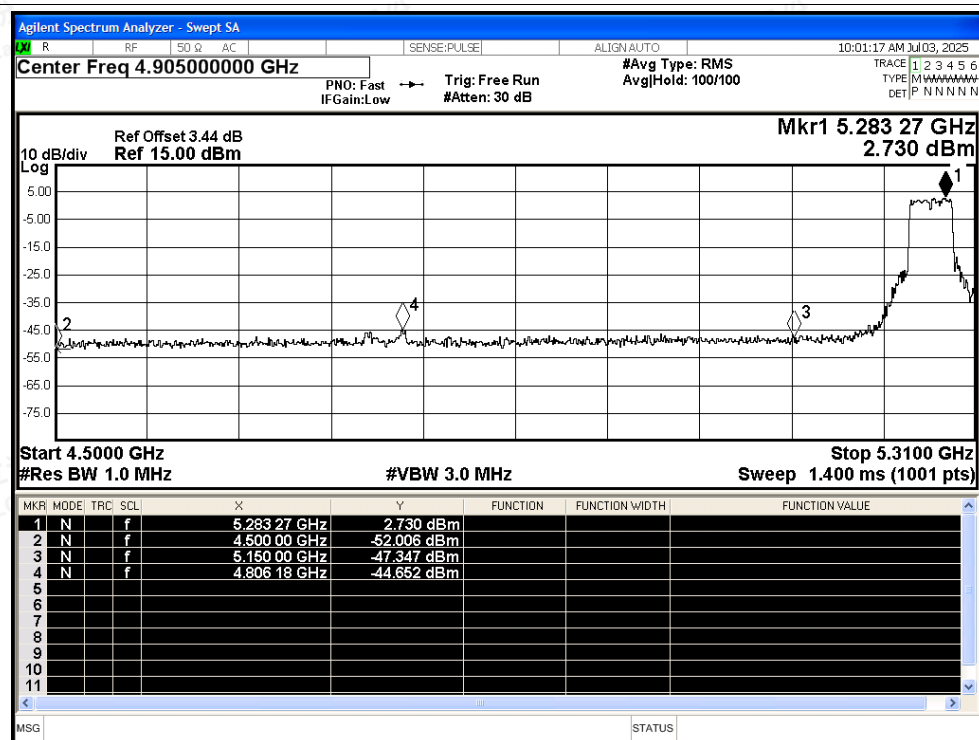

Restrict Band NVNT ax40 5270MHz Ant5 Average

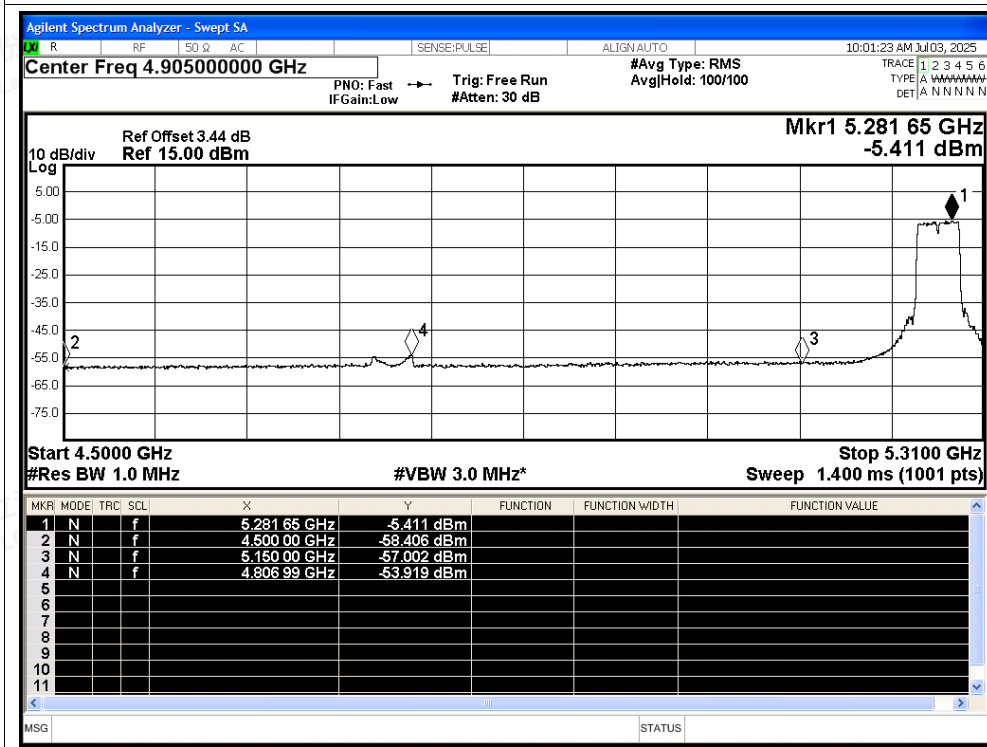

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant5 Peak

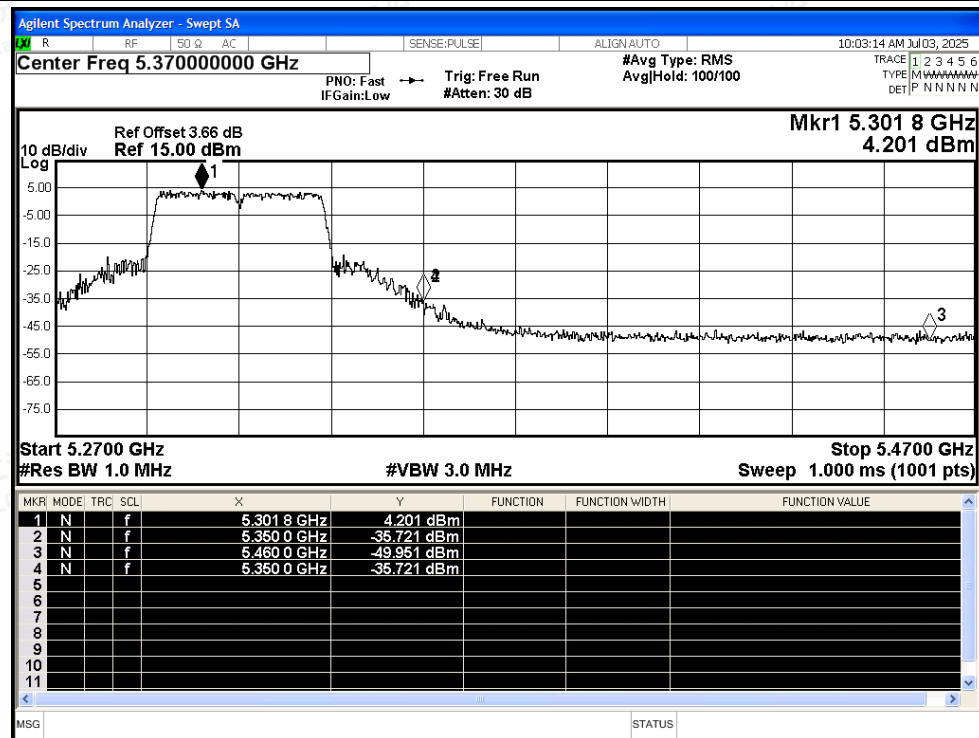

Restrict Band NVNT ax40 5310MHz Ant5 Average

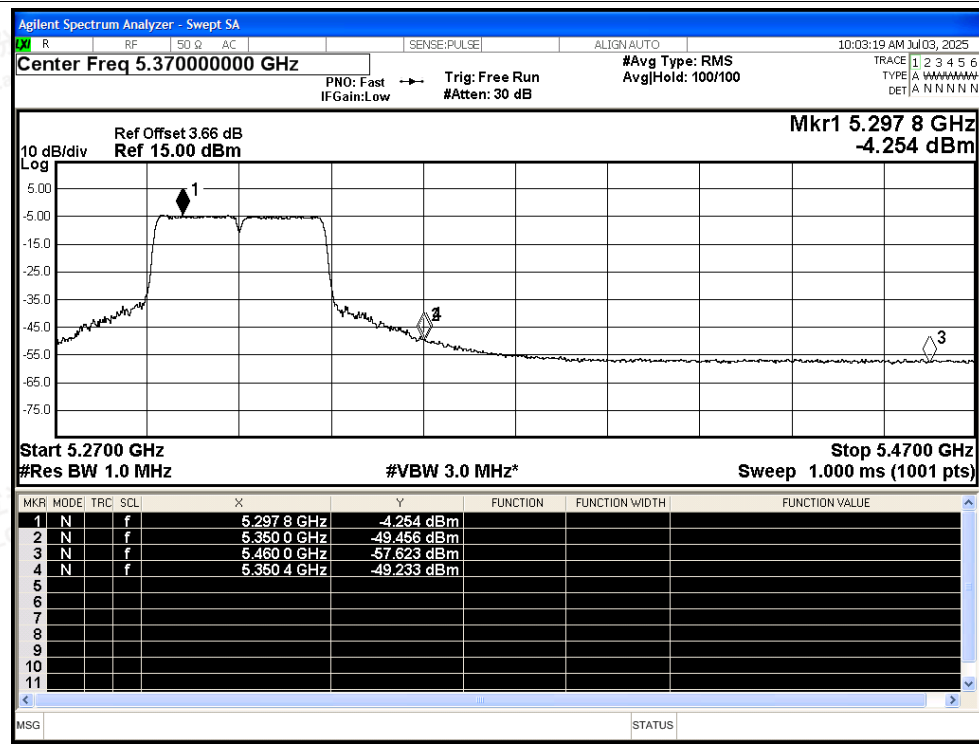

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant5 Peak

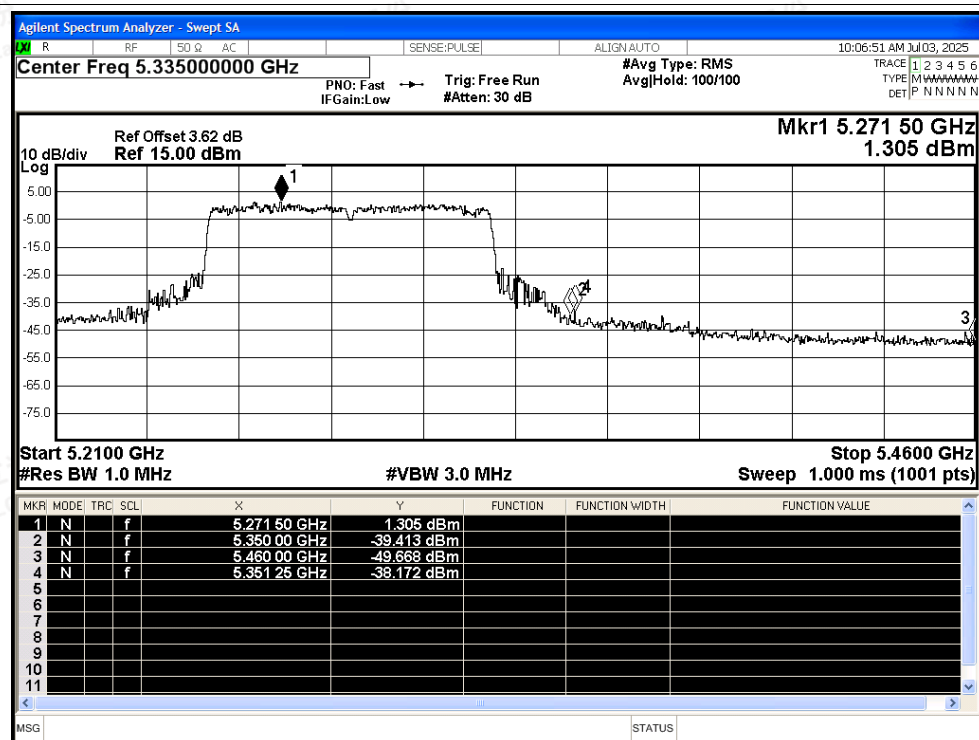

Restrict Band NVNT ax80 5290MHz Ant5 Average

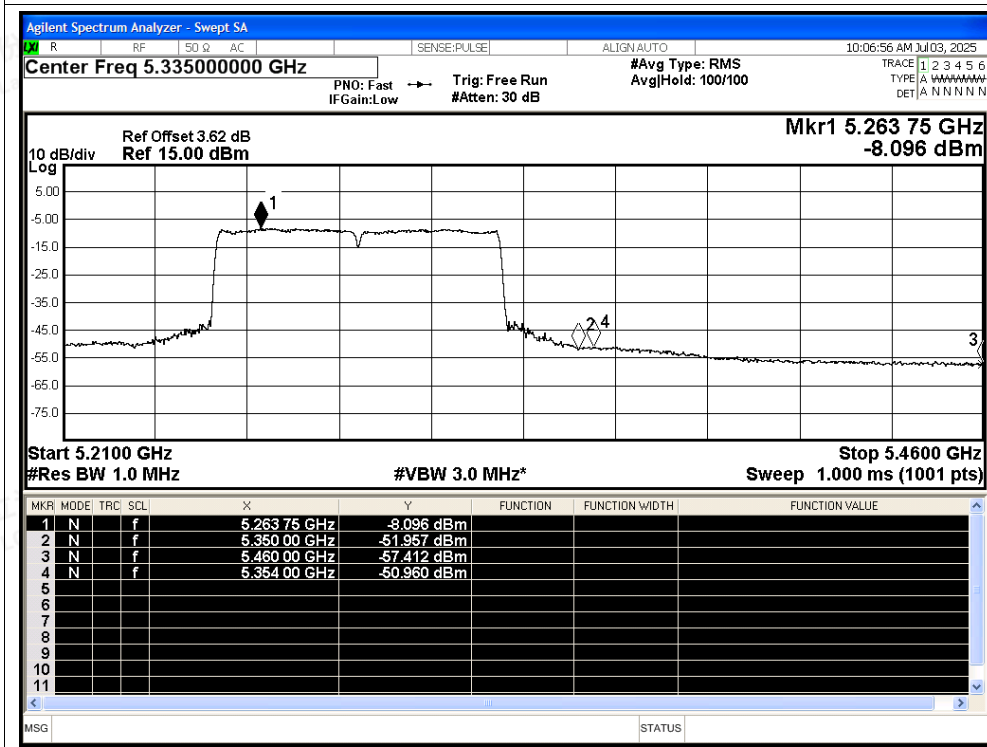

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant5 Peak

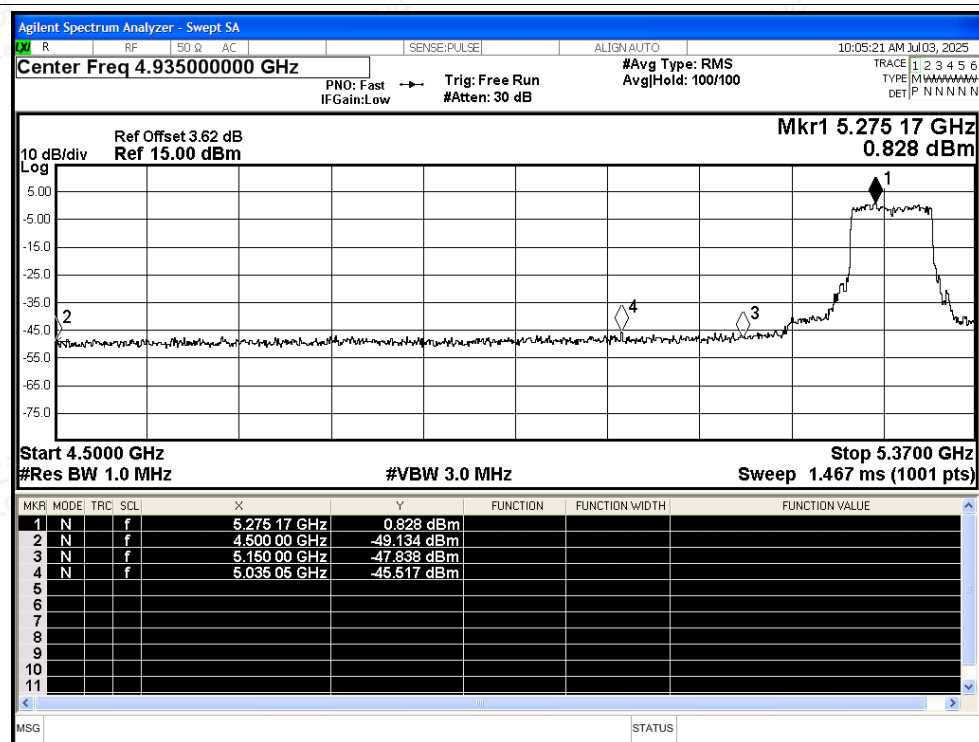

Restrict Band NVNT ax80 5290MHz Ant5 Average

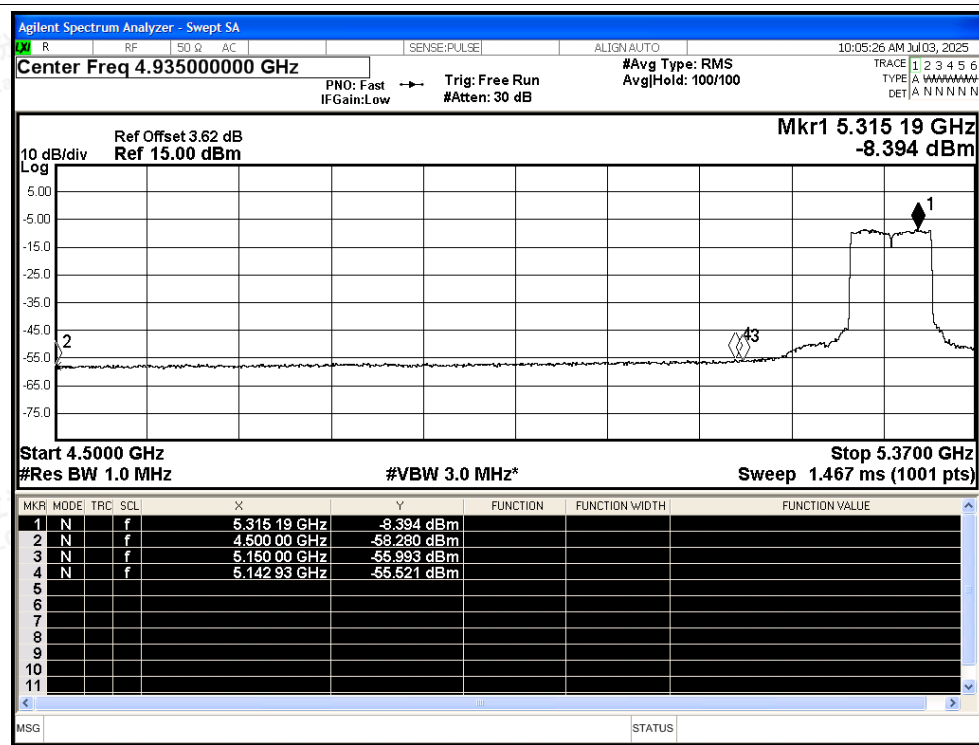

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant6	4500	-50.13	3.87	-	48.97	Peak	68.2	Pass
NVNT	a	5260	Ant6	4500	-59.2	3.87	0.19	40.09	Average	54	Pass
NVNT	a	5260	Ant6	4785.48	-45.83	3.87	-	53.27	Peak	68.2	Pass
NVNT	a	5260	Ant6	4772.22	-55.66	3.87	0.19	43.63	Average	54	Pass
NVNT	a	5260	Ant6	5150	-48.61	3.87	-	50.49	Peak	68.2	Pass
NVNT	a	5260	Ant6	5150	-56.79	3.87	0.19	42.50	Average	54	Pass
NVNT	a	5320	Ant6	5350	-38.54	3.87	-	60.56	Peak	68.2	Pass
NVNT	a	5320	Ant6	5350	-49.74	3.87	0.19	49.55	Average	54	Pass
NVNT	a	5320	Ant6	5353.8	-36.89	3.87	-	62.21	Peak	68.2	Pass
NVNT	a	5320	Ant6	5350	-49.74	3.87	0.19	49.55	Average	54	Pass
NVNT	a	5320	Ant6	5460	-50.94	3.87	-	48.16	Peak	68.2	Pass
NVNT	a	5320	Ant6	5460	-57.55	3.87	0.19	41.74	Average	54	Pass
NVNT	n20	5260	Ant6	4500	-49.19	3.87	-	49.91	Peak	68.2	Pass
NVNT	n20	5260	Ant6	4500	-59.06	3.87	0.23	40.27	Average	54	Pass
NVNT	n20	5260	Ant6	5064.72	-46.21	3.87	-	52.89	Peak	68.2	Pass
NVNT	n20	5260	Ant6	4787.82	-55.56	3.87	0.23	43.77	Average	54	Pass
NVNT	n20	5260	Ant6	5150	-47.54	3.87	-	51.56	Peak	68.2	Pass
NVNT	n20	5260	Ant6	5150	-55.94	3.87	0.23	43.39	Average	54	Pass
NVNT	n20	5320	Ant6	5350	-36.24	3.87	-	62.86	Peak	68.2	Pass
NVNT	n20	5320	Ant6	5350	-49.76	3.87	0.23	49.57	Average	54	Pass
NVNT	n20	5320	Ant6	5350.4	-32.82	3.87	-	66.28	Peak	68.2	Pass
NVNT	n20	5320	Ant6	5350.4	-48.66	3.87	0.23	50.67	Average	54	Pass
NVNT	n20	5320	Ant6	5460	-48.14	3.87	-	50.96	Peak	68.2	Pass
NVNT	n20	5320	Ant6	5460	-57.86	3.87	0.23	41.47	Average	54	Pass
NVNT	n40	5270	Ant6	4500	-50.66	3.87	-	48.44	Peak	68.2	Pass
NVNT	n40	5270	Ant6	4500	-58.63	3.87	0.44	40.91	Average	54	Pass
NVNT	n40	5270	Ant6	4806.18	-45.34	3.87	-	53.76	Peak	68.2	Pass
NVNT	n40	5270	Ant6	4806.99	-54.38	3.87	0.44	45.16	Average	54	Pass
NVNT	n40	5270	Ant6	5150	-48.99	3.87	-	50.11	Peak	68.2	Pass
NVNT	n40	5270	Ant6	5150	-57.05	3.87	0.44	42.49	Average	54	Pass
NVNT	n40	5310	Ant6	5350	-38.17	3.87	-	60.93	Peak	68.2	Pass
NVNT	n40	5310	Ant6	5350	-52.53	3.87	0.44	47.01	Average	54	Pass
NVNT	n40	5310	Ant6	5351.4	-35.72	3.87	-	63.38	Peak	68.2	Pass
NVNT	n40	5310	Ant6	5350	-52.53	3.87	0.44	47.01	Average	54	Pass
NVNT	n40	5310	Ant6	5460	-49.64	3.87	-	49.46	Peak	68.2	Pass
NVNT	n40	5310	Ant6	5460	-57.58	3.87	0.44	41.96	Average	54	Pass
NVNT	ac20	5260	Ant6	4500	-50.24	3.87	-	48.86	Peak	68.2	Pass
NVNT	ac20	5260	Ant6	4500	-58.47	3.87	0.22	40.85	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant6	5092.02	-46.5	3.87	-	52.60	Peak	68.2	Pass
NVNT	ac20	5260	Ant6	5148.96	-55.69	3.87	0.22	43.63	Average	54	Pass
NVNT	ac20	5260	Ant6	5150	-48.99	3.87	-	50.11	Peak	68.2	Pass
NVNT	ac20	5260	Ant6	5150	-56.12	3.87	0.22	43.20	Average	54	Pass
NVNT	ac20	5320	Ant6	5350	-31.68	3.87	-	67.42	Peak	68.2	Pass
NVNT	ac20	5320	Ant6	5350	-49.45	3.87	0.22	49.87	Average	54	Pass
NVNT	ac20	5320	Ant6	5350	-31.68	3.87	-	67.42	Peak	68.2	Pass
NVNT	ac20	5320	Ant6	5350.6	-47.99	3.87	0.22	51.33	Average	54	Pass
NVNT	ac20	5320	Ant6	5460	-48.85	3.87	-	50.25	Peak	68.2	Pass
NVNT	ac20	5320	Ant6	5460	-57.33	3.87	0.22	41.99	Average	54	Pass
NVNT	ac40	5270	Ant6	4500	-47.67	3.87	-	51.43	Peak	68.2	Pass
NVNT	ac40	5270	Ant6	4500	-58.7	3.87	0.44	40.84	Average	54	Pass
NVNT	ac40	5270	Ant6	5110.74	-45.31	3.87	-	53.79	Peak	68.2	Pass
NVNT	ac40	5270	Ant6	4806.99	-53.79	3.87	0.44	45.75	Average	54	Pass
NVNT	ac40	5270	Ant6	5150	-48.82	3.87	-	50.28	Peak	68.2	Pass
NVNT	ac40	5270	Ant6	5150	-57.23	3.87	0.44	42.31	Average	54	Pass
NVNT	ac40	5310	Ant6	5350	-37.92	3.87	-	61.18	Peak	68.2	Pass
NVNT	ac40	5310	Ant6	5350	-50.26	3.87	0.43	49.27	Average	54	Pass
NVNT	ac40	5310	Ant6	5353	-33.49	3.87	-	65.61	Peak	68.2	Pass
NVNT	ac40	5310	Ant6	5350	-50.26	3.87	0.43	49.27	Average	54	Pass
NVNT	ac40	5310	Ant6	5460	-50.37	3.87	-	48.73	Peak	68.2	Pass
NVNT	ac40	5310	Ant6	5460	-58.27	3.87	0.43	41.26	Average	54	Pass
NVNT	ac80	5290	Ant6	4500	-49.03	3.87	-	50.07	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	4500	-58.67	3.87	0.83	41.26	Average	54	Pass
NVNT	ac80	5290	Ant6	5088.12	-46.01	3.87	-	53.09	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	5122.92	-56.15	3.87	0.83	43.78	Average	54	Pass
NVNT	ac80	5290	Ant6	5150	-47.01	3.87	-	52.09	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	5150	-56.36	3.87	0.83	43.57	Average	54	Pass
NVNT	ac80	5290	Ant6	5350	-42.98	3.87	-	56.12	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	5350	-52.38	3.87	0.83	47.55	Average	54	Pass
NVNT	ac80	5290	Ant6	5351	-35.99	3.87	-	63.11	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	5350	-52.38	3.87	0.83	47.55	Average	54	Pass
NVNT	ac80	5290	Ant6	5460	-48.45	3.87	-	50.65	Peak	68.2	Pass
NVNT	ac80	5290	Ant6	5460	-57.45	3.87	0.83	42.48	Average	54	Pass
NVNT	ax20	5260	Ant6	4500	-51.46	3.87	-	47.64	Peak	68.2	Pass
NVNT	ax20	5260	Ant6	4500	-58.39	3.87	0.22	40.93	Average	54	Pass
NVNT	ax20	5260	Ant6	4786.26	-45.49	3.87	-	53.61	Peak	68.2	Pass
NVNT	ax20	5260	Ant6	4787.82	-56.13	3.87	0.22	43.19	Average	54	Pass
NVNT	ax20	5260	Ant6	5150	-48.22	3.87	-	50.88	Peak	68.2	Pass
NVNT	ax20	5260	Ant6	5150	-56.36	3.87	0.22	42.96	Average	54	Pass
NVNT	ax20	5320	Ant6	5350	-38.97	3.87	-	60.13	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant6	5350	-54.08	3.87	0.22	45.24	Average	54	Pass
NVNT	ax20	5320	Ant6	5460	-48.33	3.87	-	50.77	Peak	68.2	Pass
NVNT	ax20	5320	Ant6	5460	-58.04	3.87	0.22	41.28	Average	54	Pass
NVNT	ax20	5320	Ant6	5460	-48.33	3.87	-	50.77	Peak	68.2	Pass
NVNT	ax20	5320	Ant6	5460	-58.04	3.87	0.22	41.28	Average	54	Pass
NVNT	ax40	5270	Ant6	4500	-49.85	3.87	-	49.25	Peak	68.2	Pass
NVNT	ax40	5270	Ant6	4500	-58.72	3.87	0.43	40.81	Average	54	Pass
NVNT	ax40	5270	Ant6	4807.8	-45.13	3.87	-	53.97	Peak	68.2	Pass
NVNT	ax40	5270	Ant6	4806.99	-53.55	3.87	0.43	45.98	Average	54	Pass
NVNT	ax40	5270	Ant6	5150	-49.61	3.87	-	49.49	Peak	68.2	Pass
NVNT	ax40	5270	Ant6	5150	-56.73	3.87	0.43	42.80	Average	54	Pass
NVNT	ax40	5310	Ant6	5350	-37.8	3.87	-	61.30	Peak	68.2	Pass
NVNT	ax40	5310	Ant6	5350	-50.95	3.87	0.44	48.59	Average	54	Pass
NVNT	ax40	5310	Ant6	5350.2	-36.44	3.87	-	62.66	Peak	68.2	Pass
NVNT	ax40	5310	Ant6	5350.8	-50.5	3.87	0.44	49.04	Average	54	Pass
NVNT	ax40	5310	Ant6	5460	-49.04	3.87	-	50.06	Peak	68.2	Pass
NVNT	ax40	5310	Ant6	5460	-57.62	3.87	0.44	41.92	Average	54	Pass
NVNT	ax80	5290	Ant6	5350	-42.95	3.87	-	56.15	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	5350	-51.88	3.87	0.83	48.05	Average	54	Pass
NVNT	ax80	5290	Ant6	5351.75	-35.84	3.87	-	63.26	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	5354	-50.85	3.87	0.83	49.08	Average	54	Pass
NVNT	ax80	5290	Ant6	5460	-49.22	3.87	-	49.88	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	5460	-57.54	3.87	0.83	42.39	Average	54	Pass
NVNT	ax80	5290	Ant6	4500	-49.92	3.87	-	49.18	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	4500	-58.04	3.87	0.83	41.89	Average	54	Pass
NVNT	ax80	5290	Ant6	5149.02	-45.8	3.87	-	53.30	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	5088.12	-56.19	3.87	0.83	43.74	Average	54	Pass
NVNT	ax80	5290	Ant6	5150	-48.67	3.87	-	50.43	Peak	68.2	Pass
NVNT	ax80	5290	Ant6	5150	-56.67	3.87	0.83	43.26	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant6 Peak

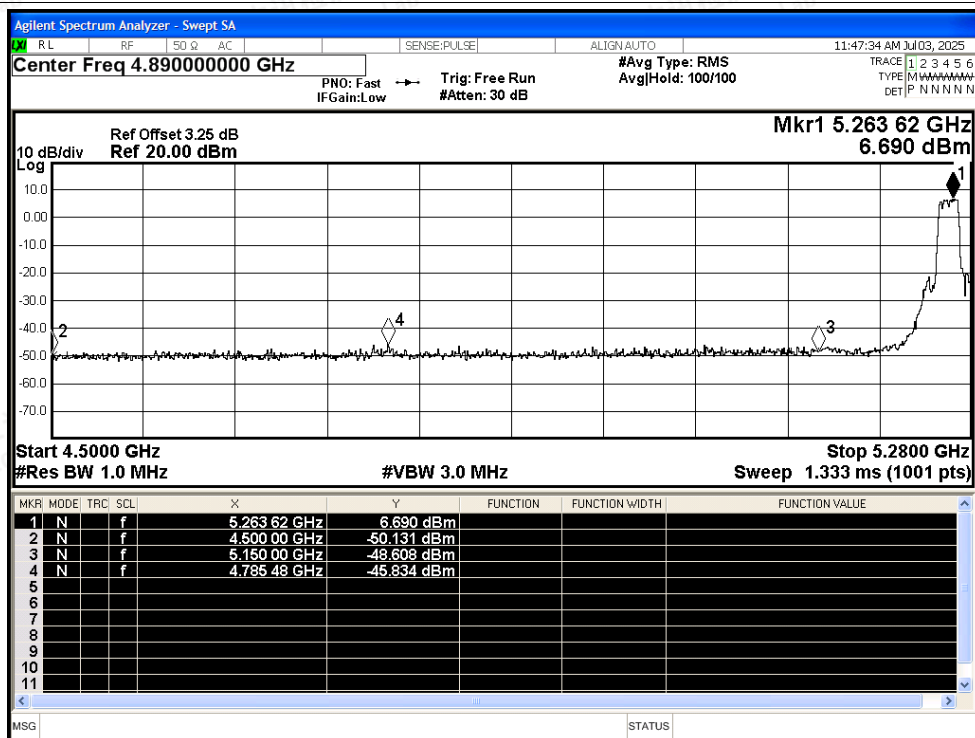

Restrict Band NVNT a 5260MHz Ant6 Average

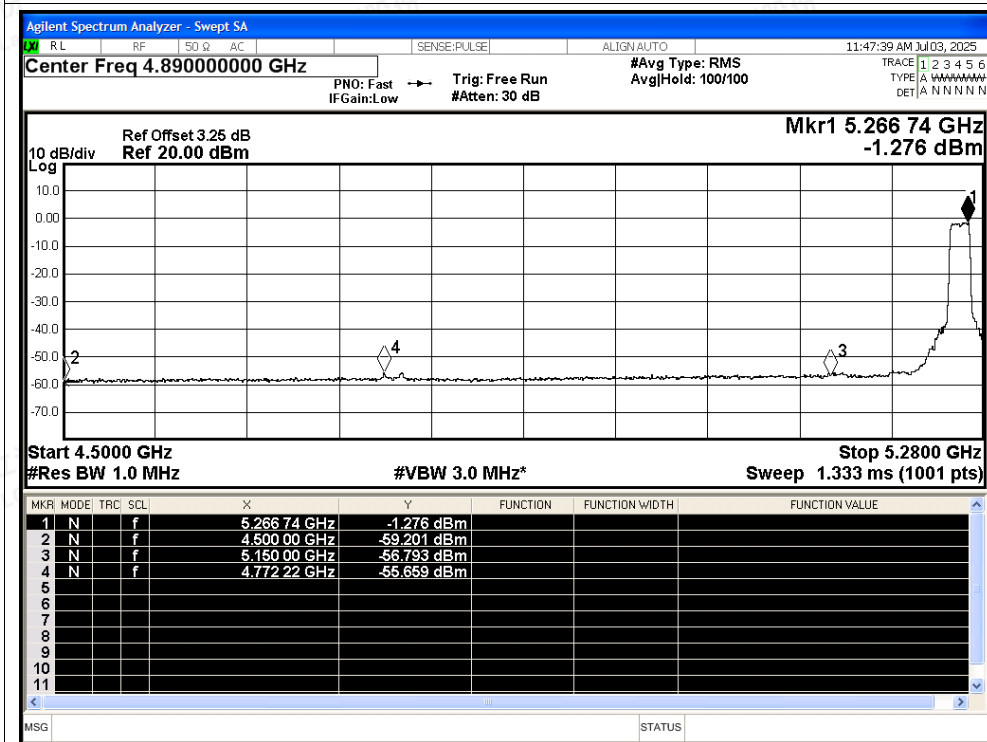

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant6 Peak

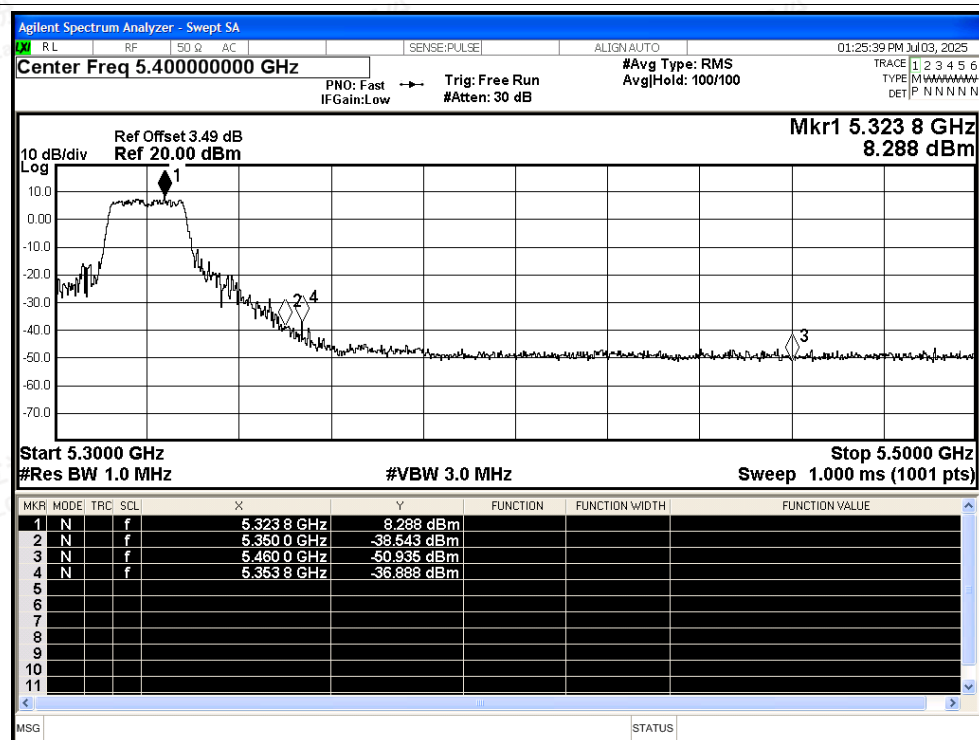

Restrict Band NVNT a 5320MHz Ant6 Average

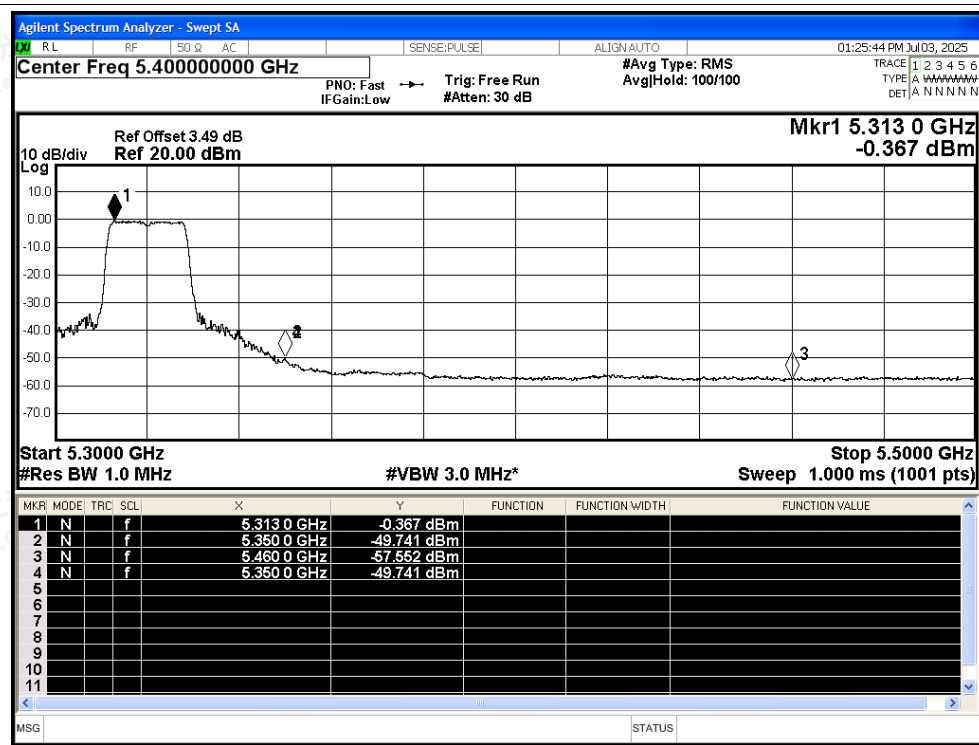

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant6 Peak

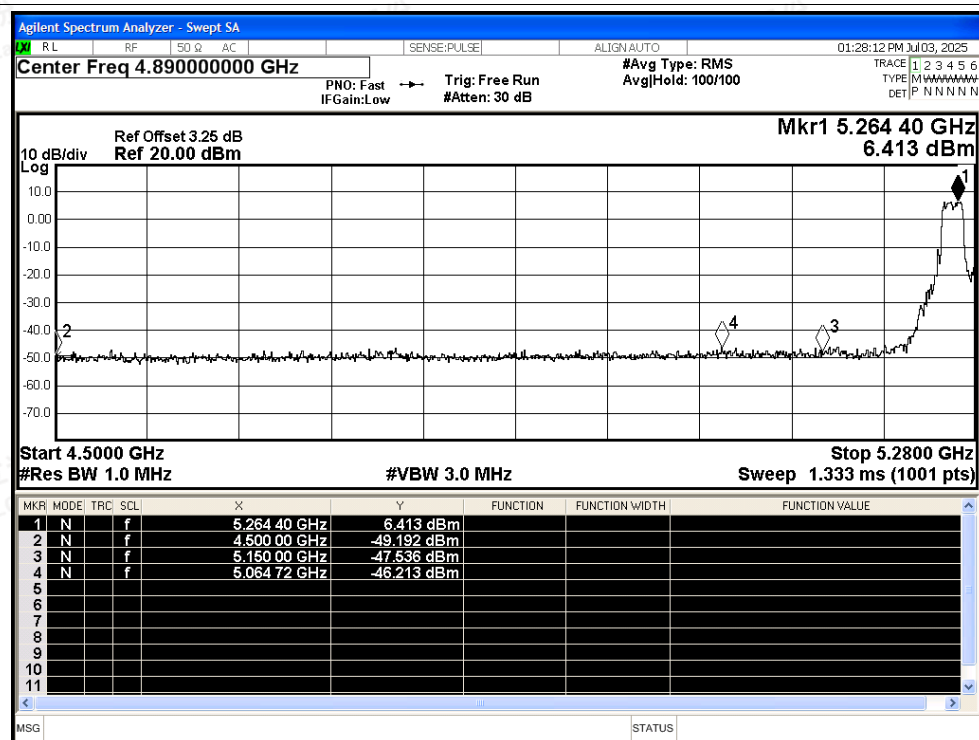

Restrict Band NVNT n20 5260MHz Ant6 Average

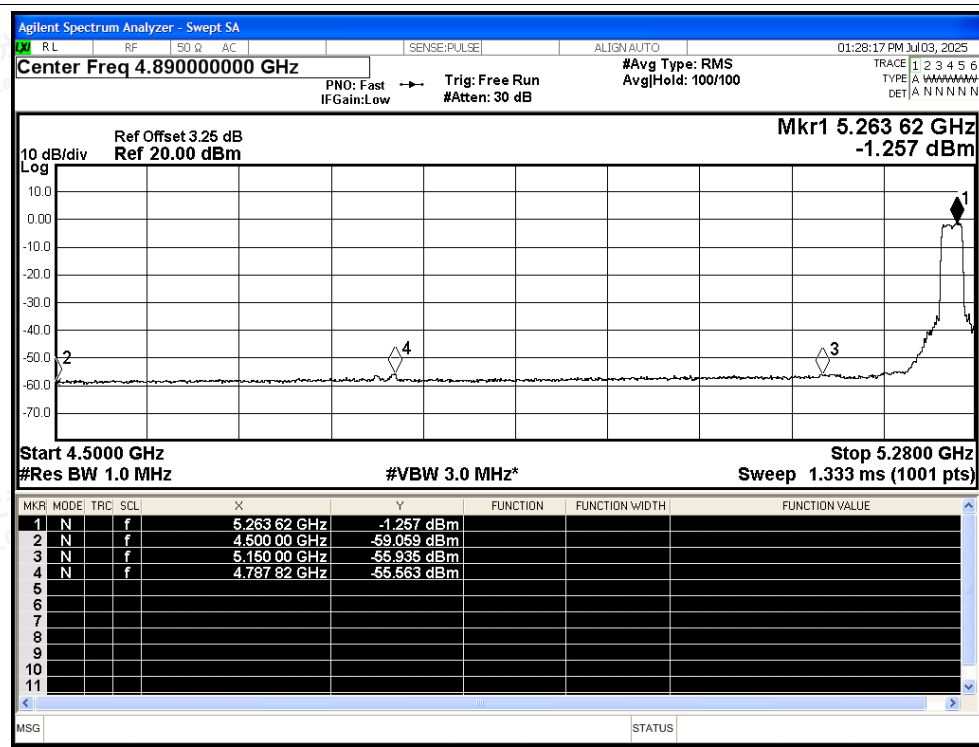

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant6 Peak

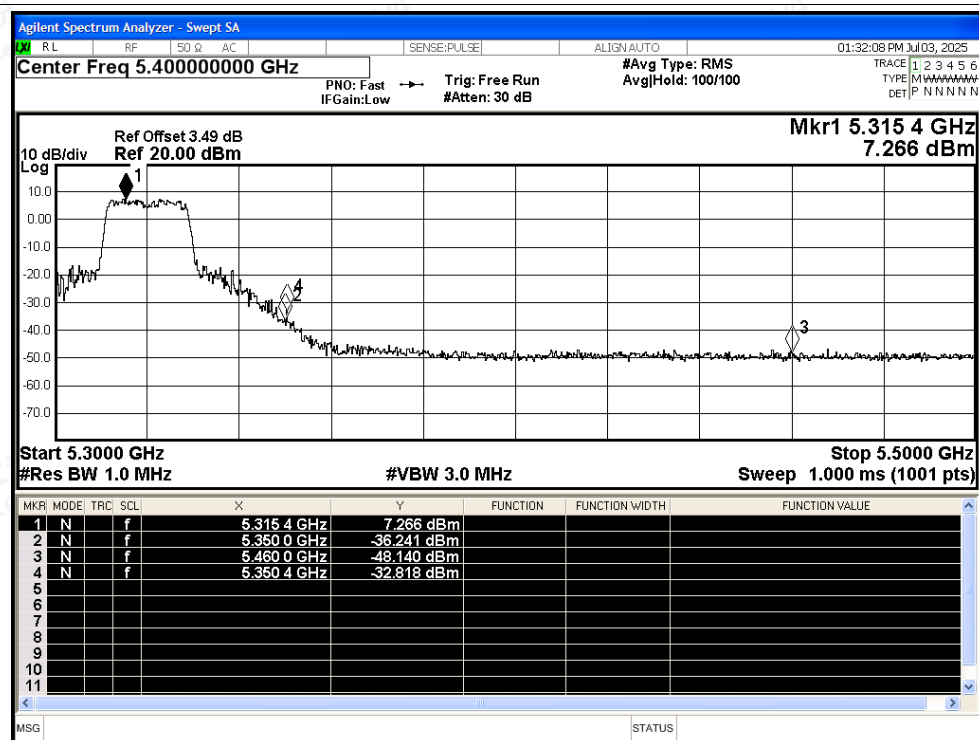

Restrict Band NVNT n20 5320MHz Ant6 Average

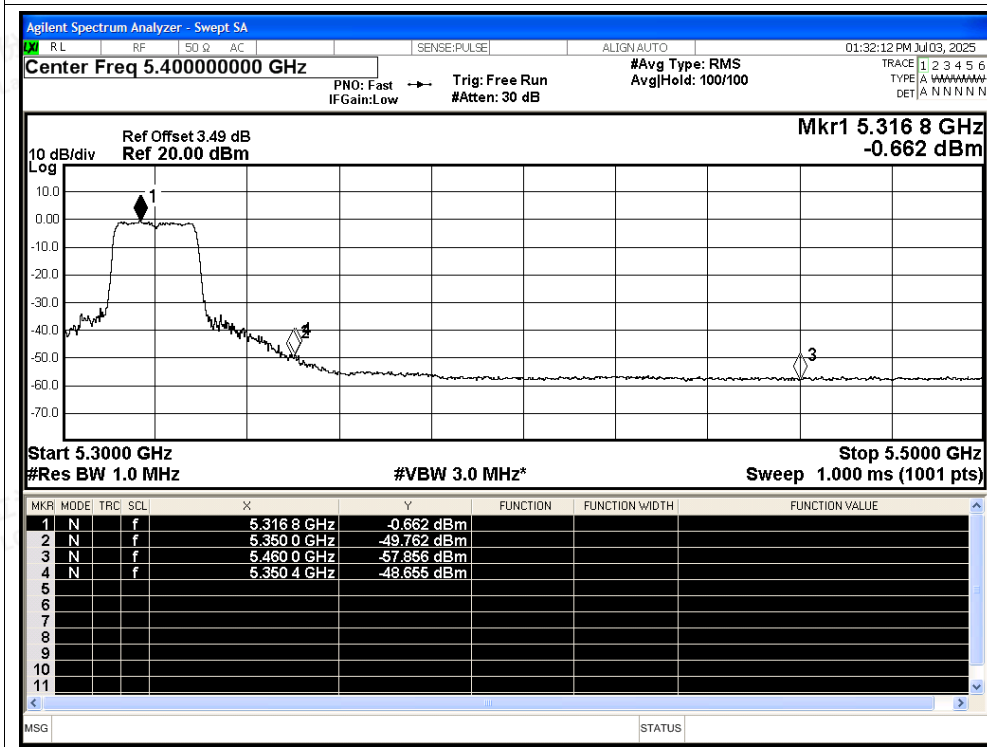

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant6 Peak

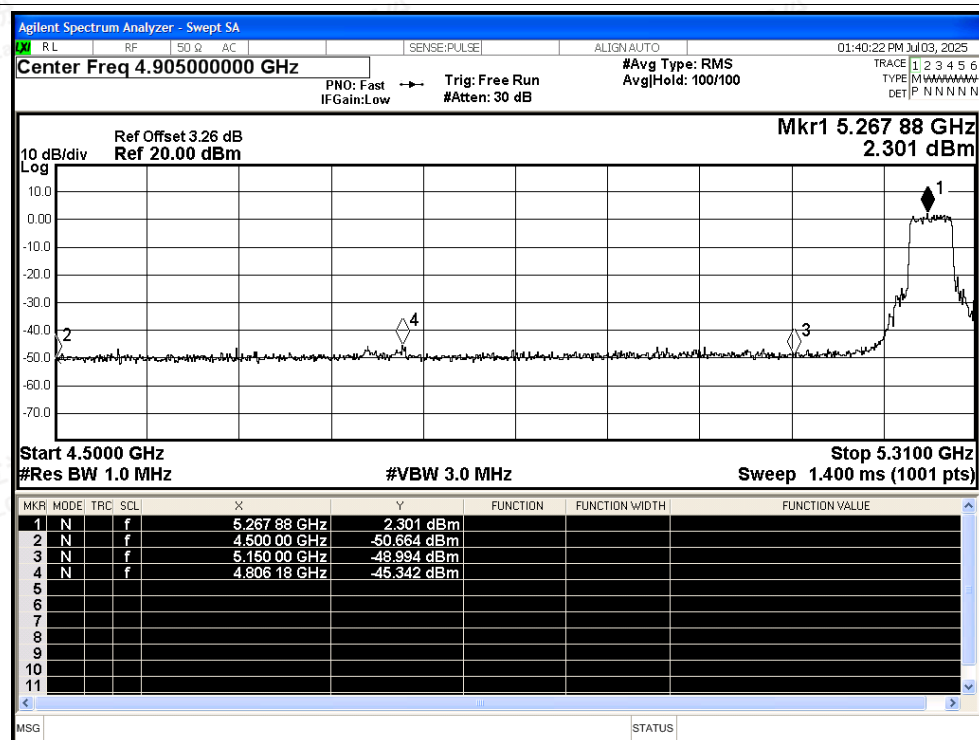

Restrict Band NVNT n40 5270MHz Ant6 Average

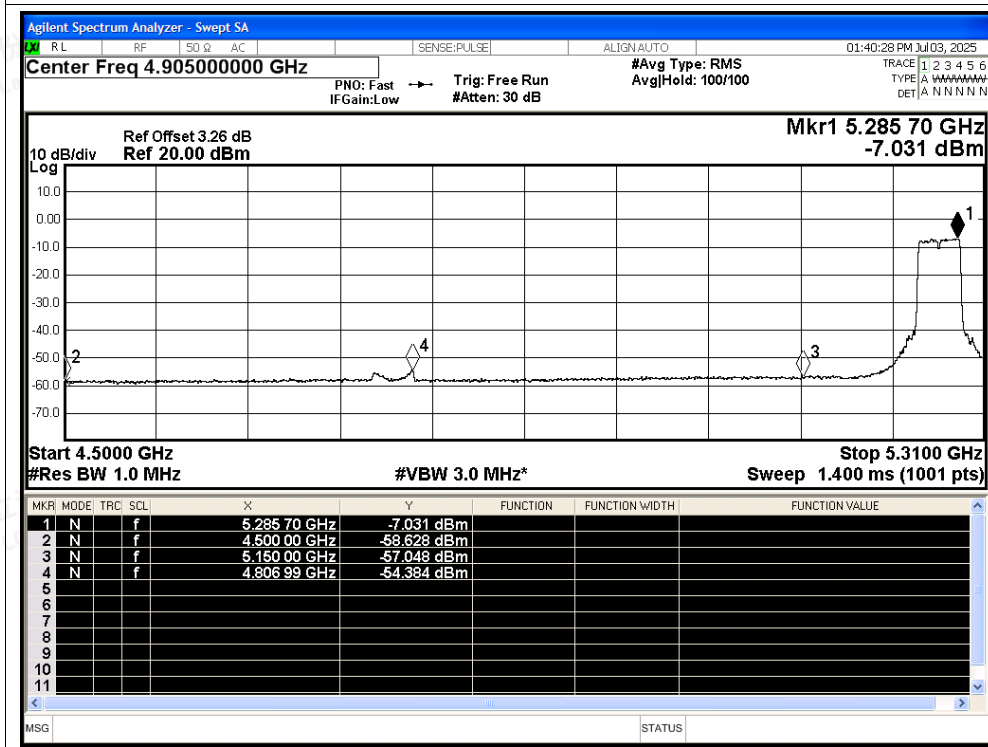

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant6 Peak

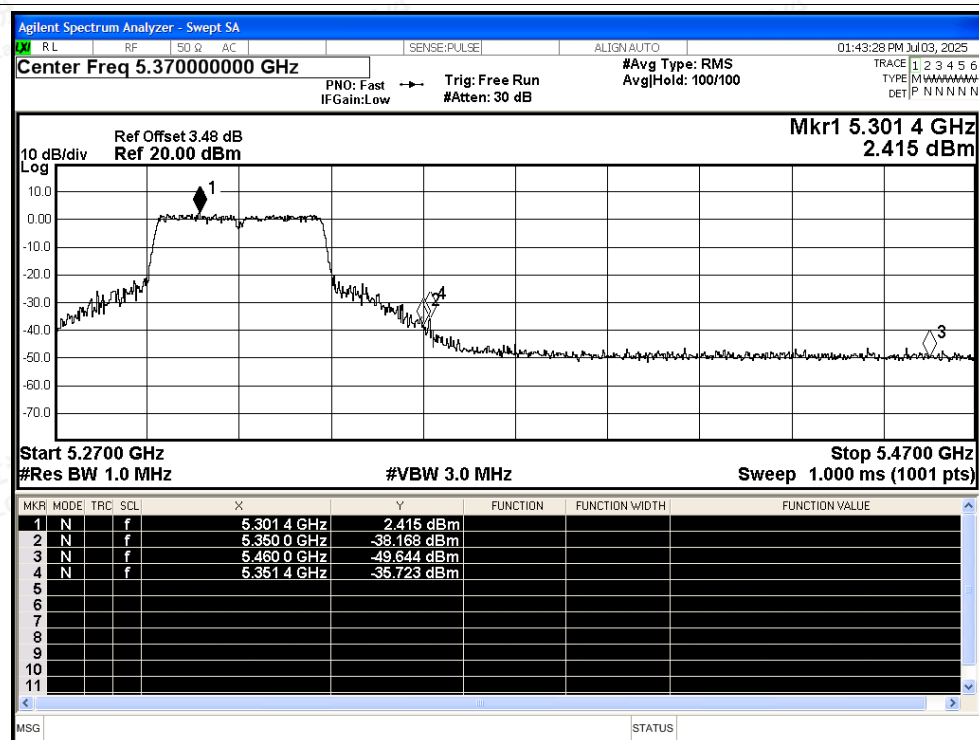

Restrict Band NVNT n40 5310MHz Ant6 Average

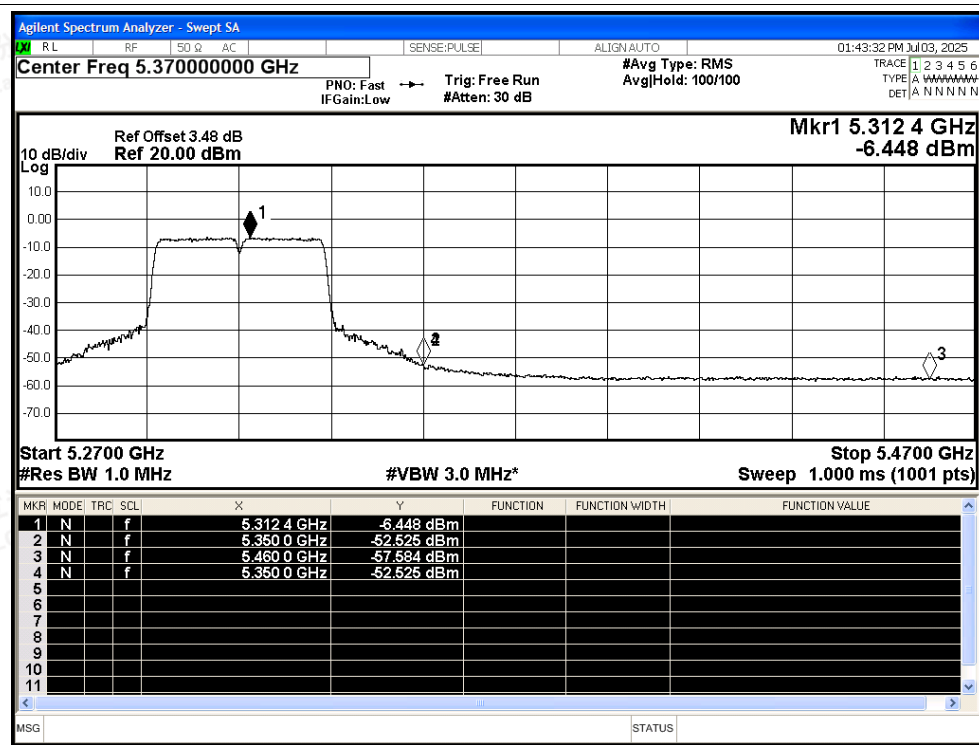

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant6 Peak

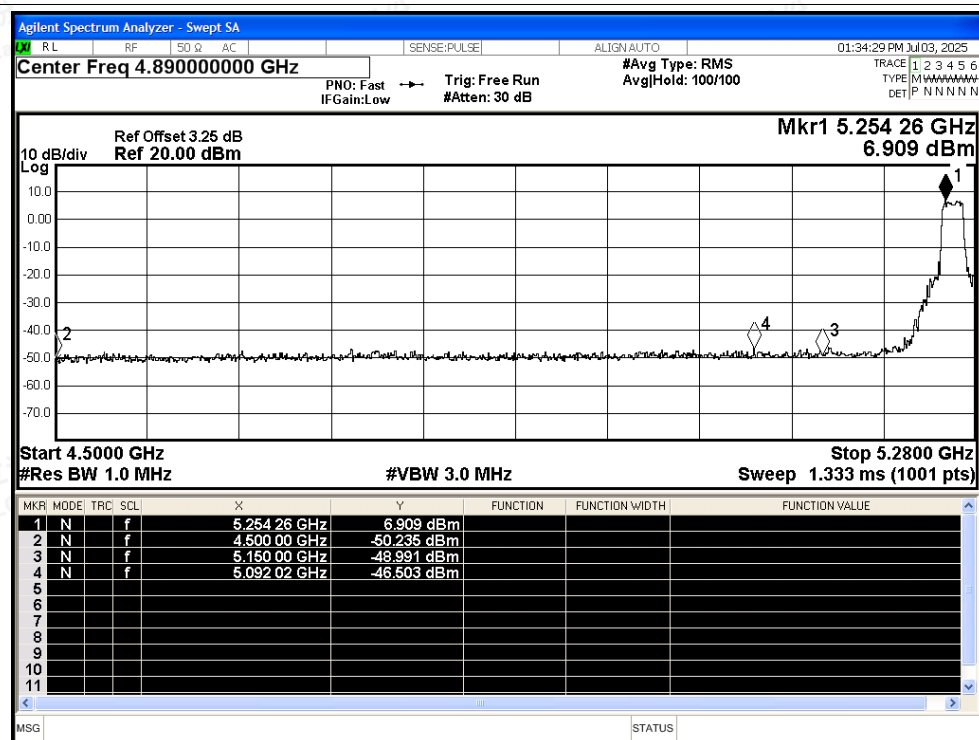

Restrict Band NVNT ac20 5260MHz Ant6 Average

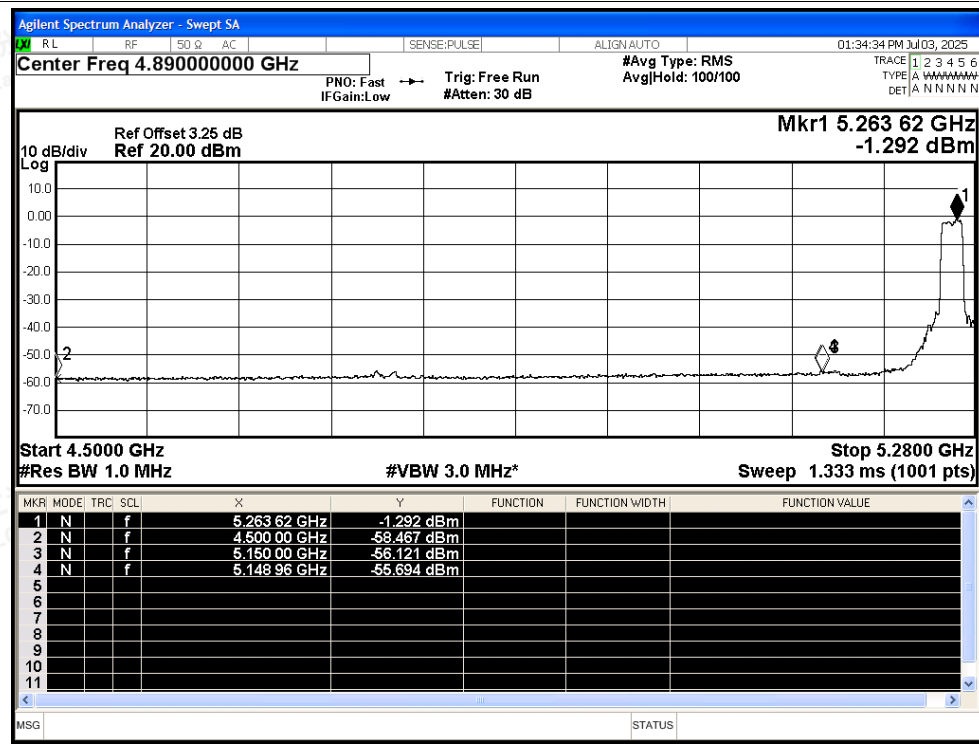

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity