





Restrict Band NVNT ac20 5320MHz Ant6 Peak

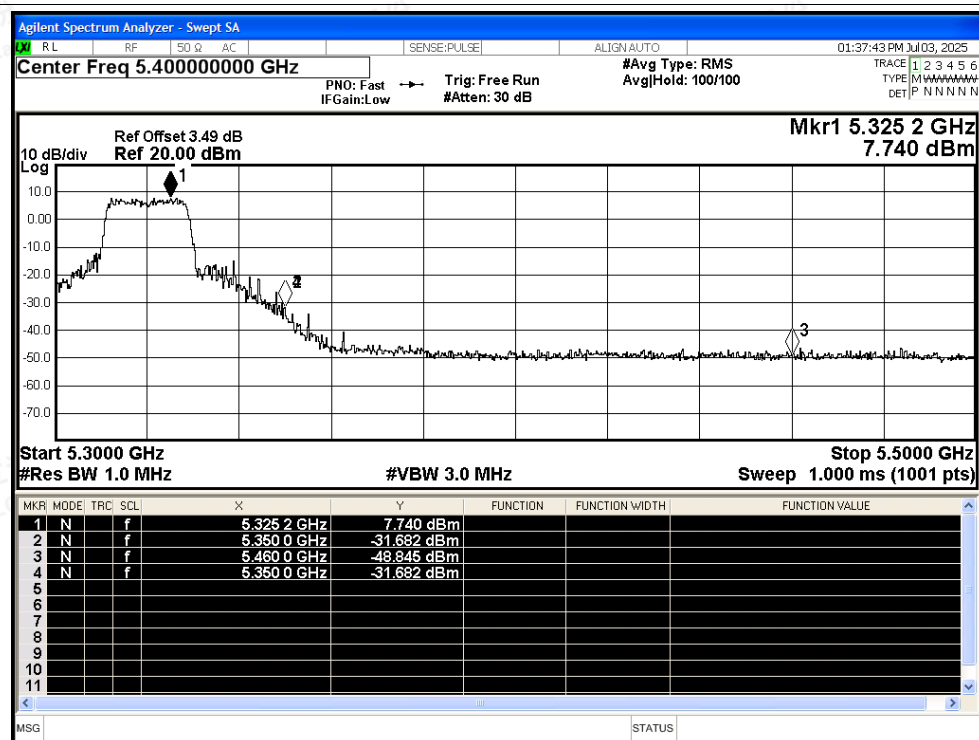

Restrict Band NVNT ac20 5320MHz Ant6 Average

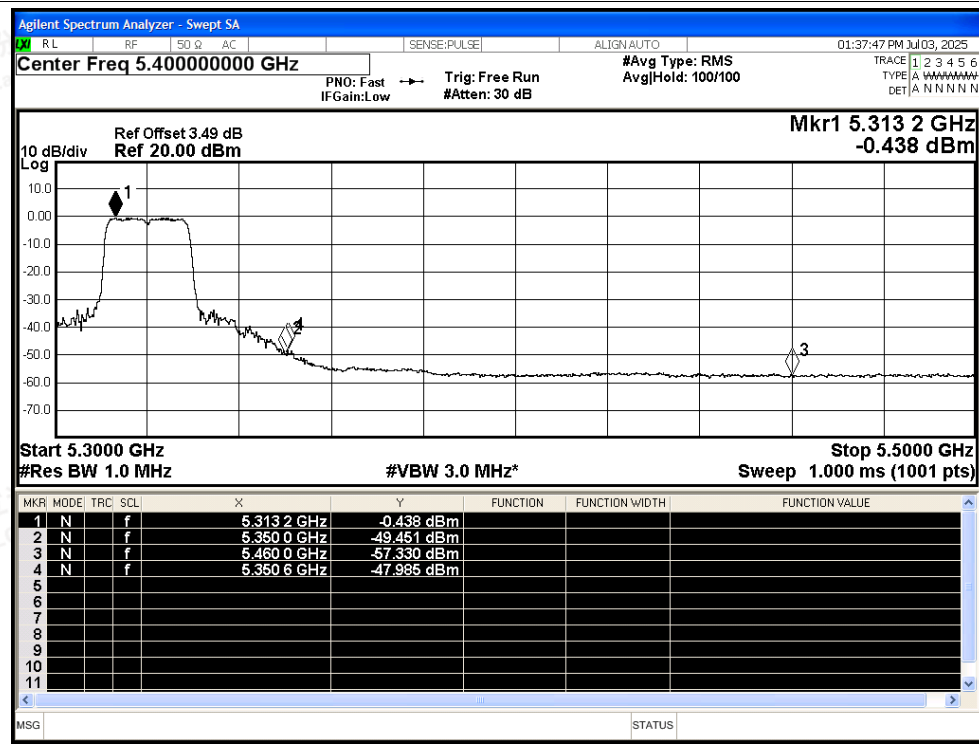

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant6 Peak

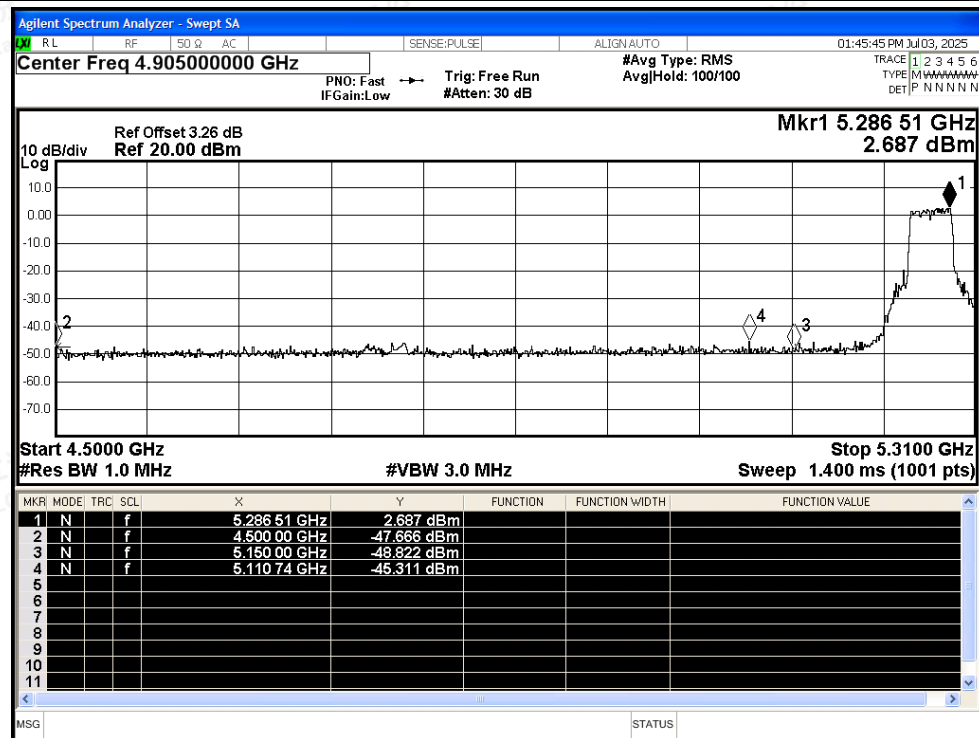

Restrict Band NVNT ac40 5270MHz Ant6 Average

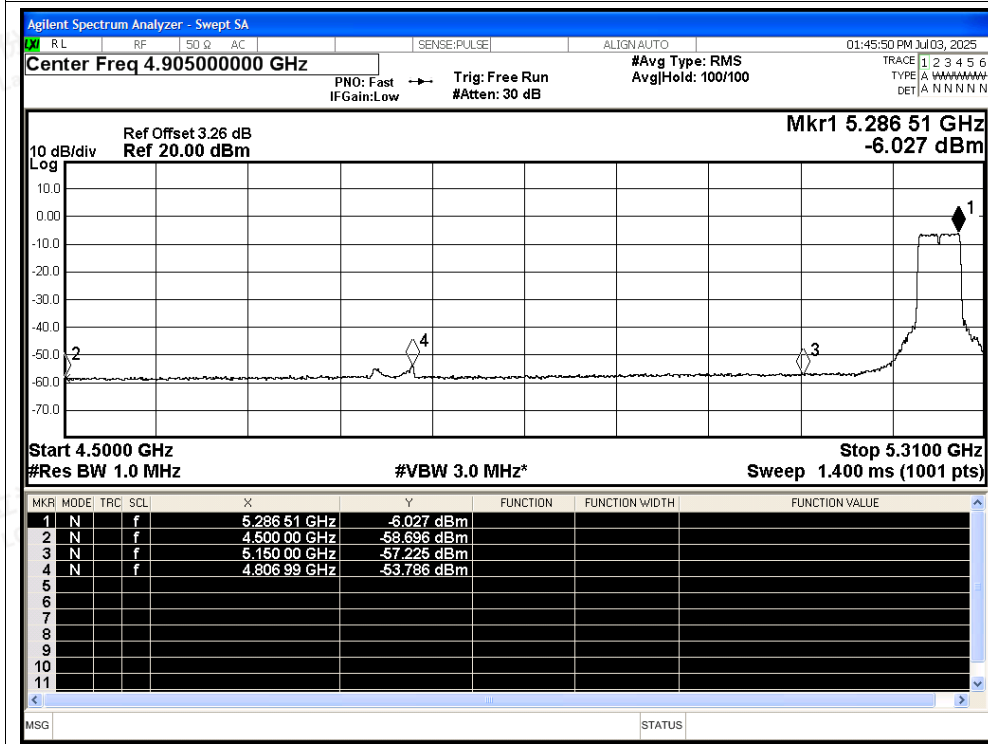

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant6 Peak

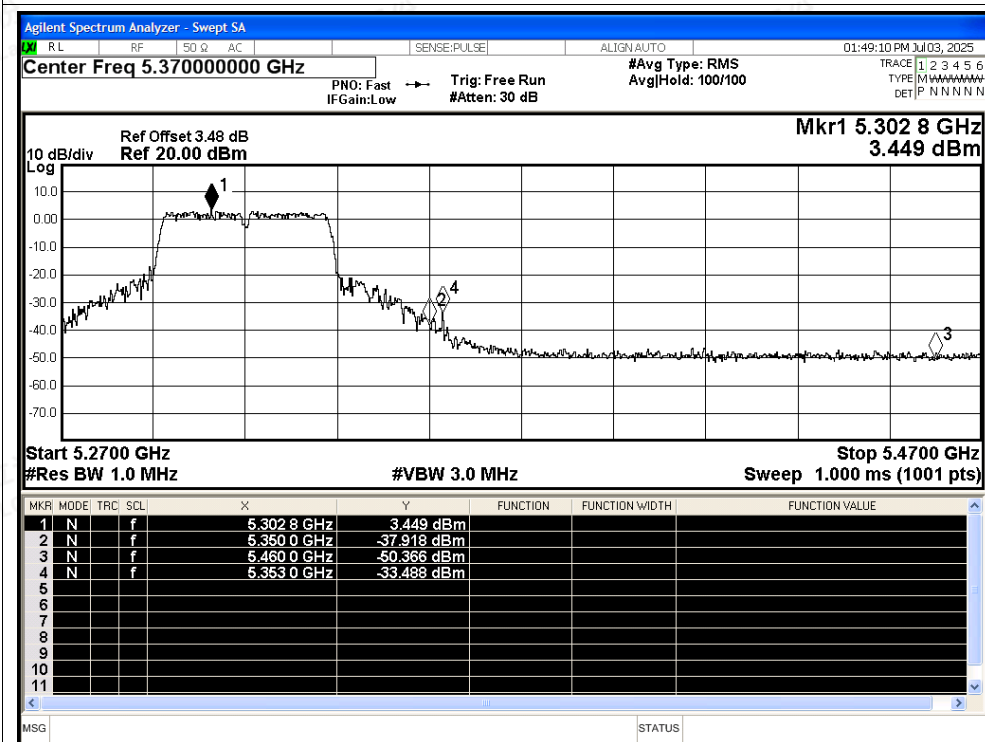

Restrict Band NVNT ac40 5310MHz Ant6 Average

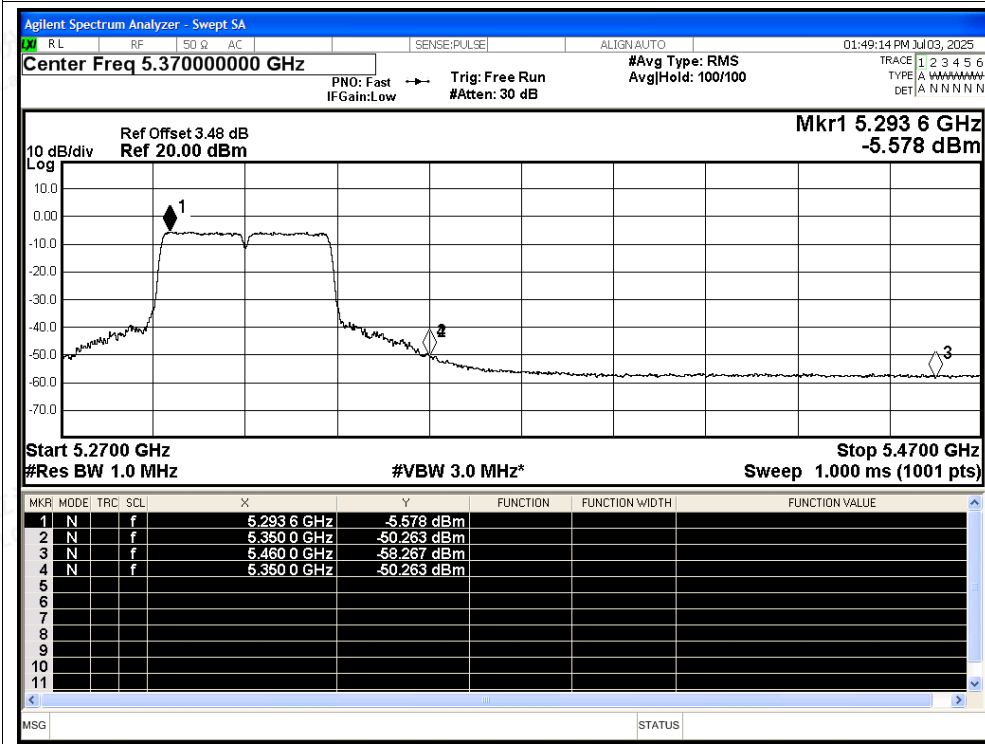

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant6 Peak

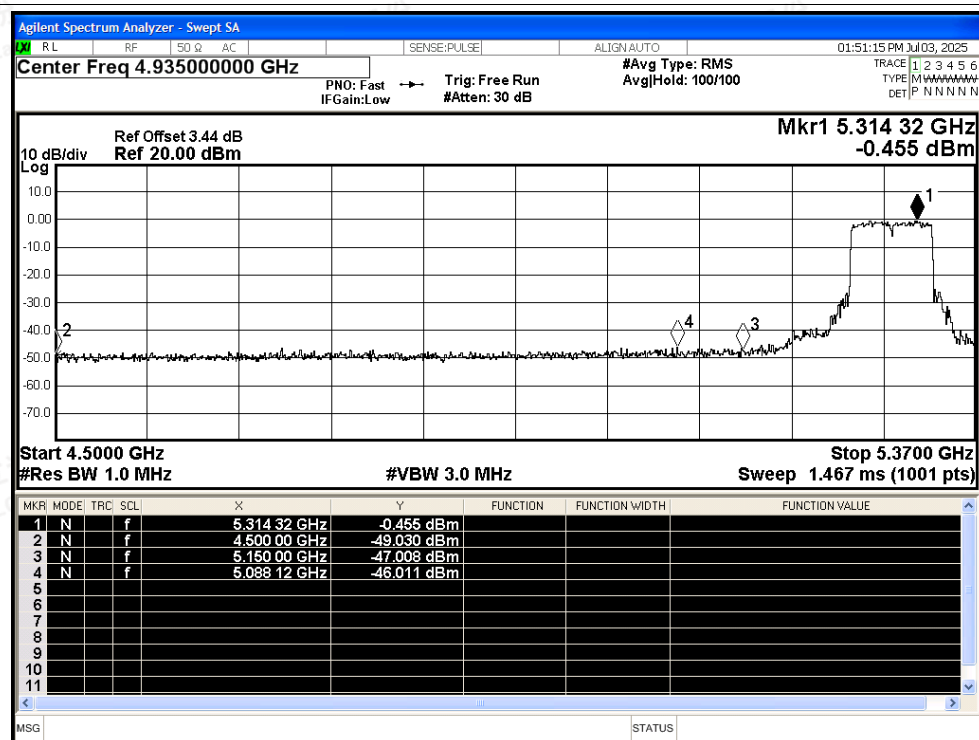

Restrict Band NVNT ac80 5290MHz Ant6 Average

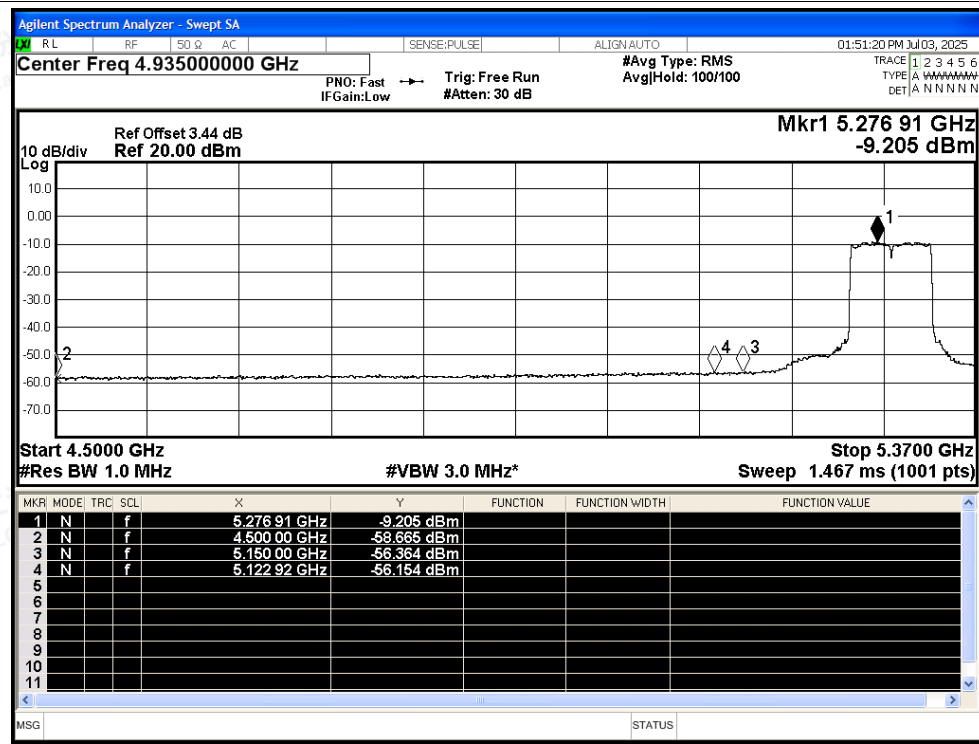

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant6 Peak

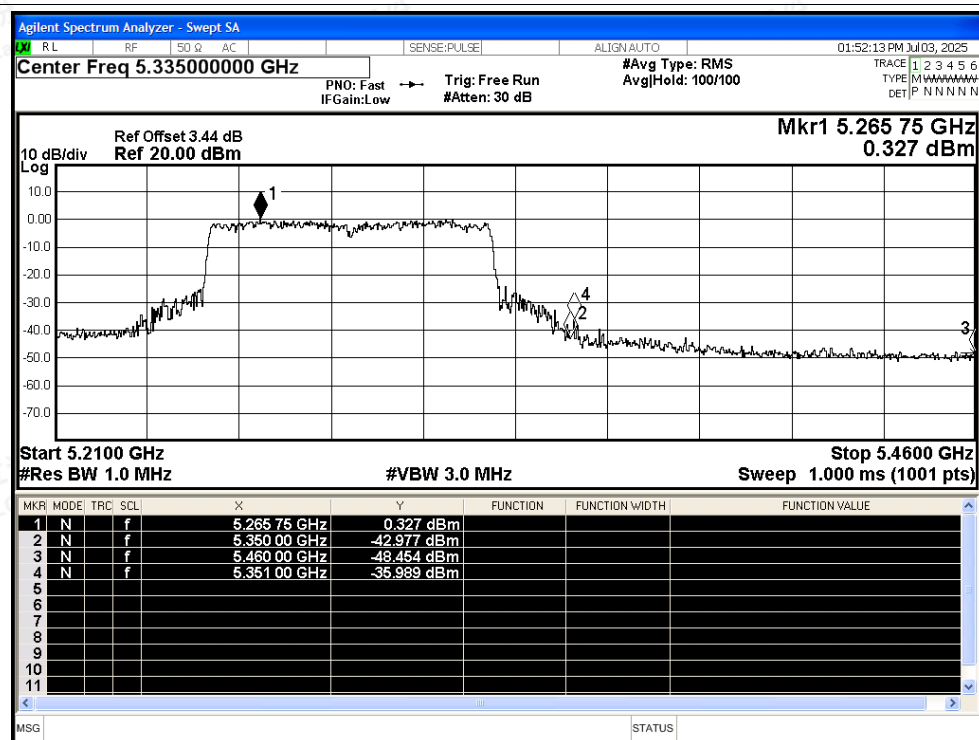

Restrict Band NVNT ac80 5290MHz Ant6 Average

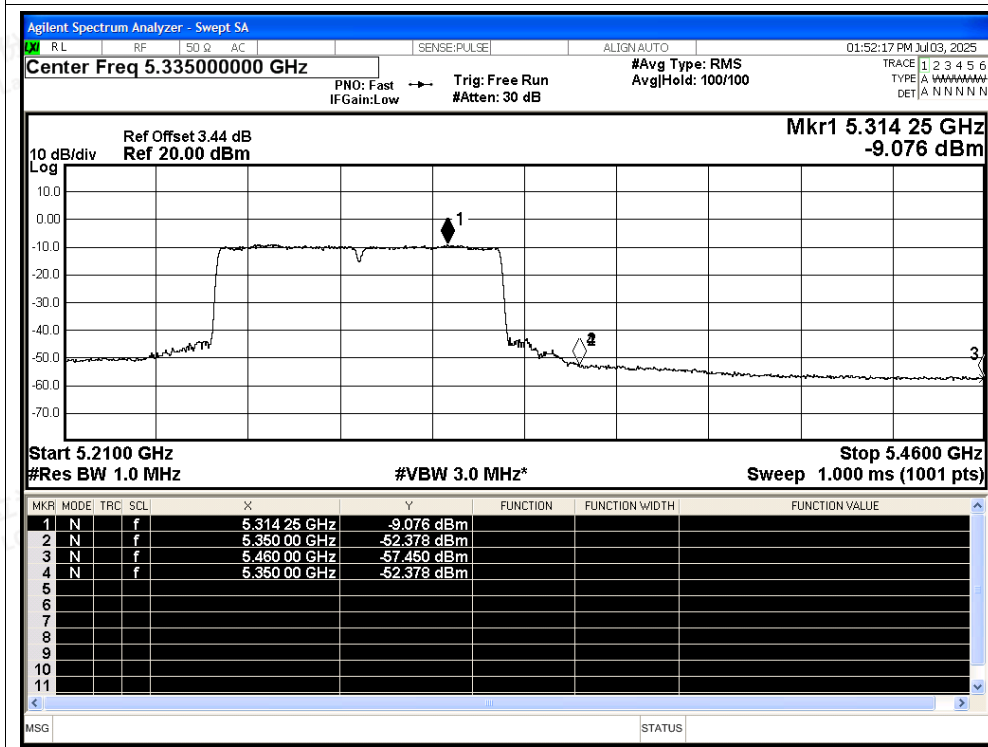

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant6 Peak

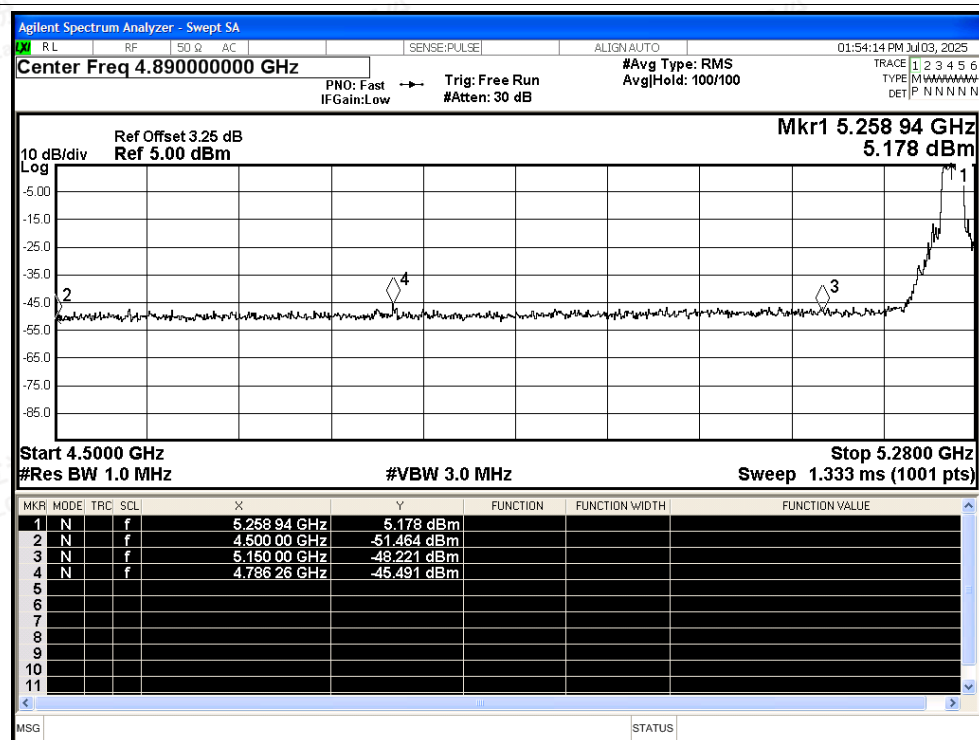

Restrict Band NVNT ax20 5260MHz Ant6 Average

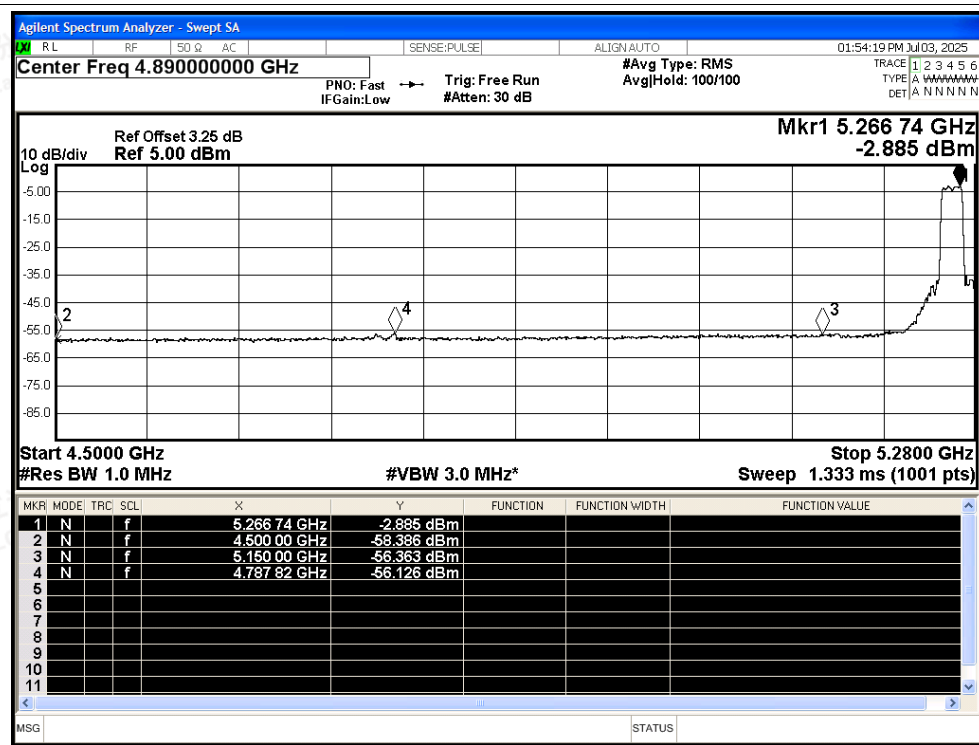

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant6 Peak

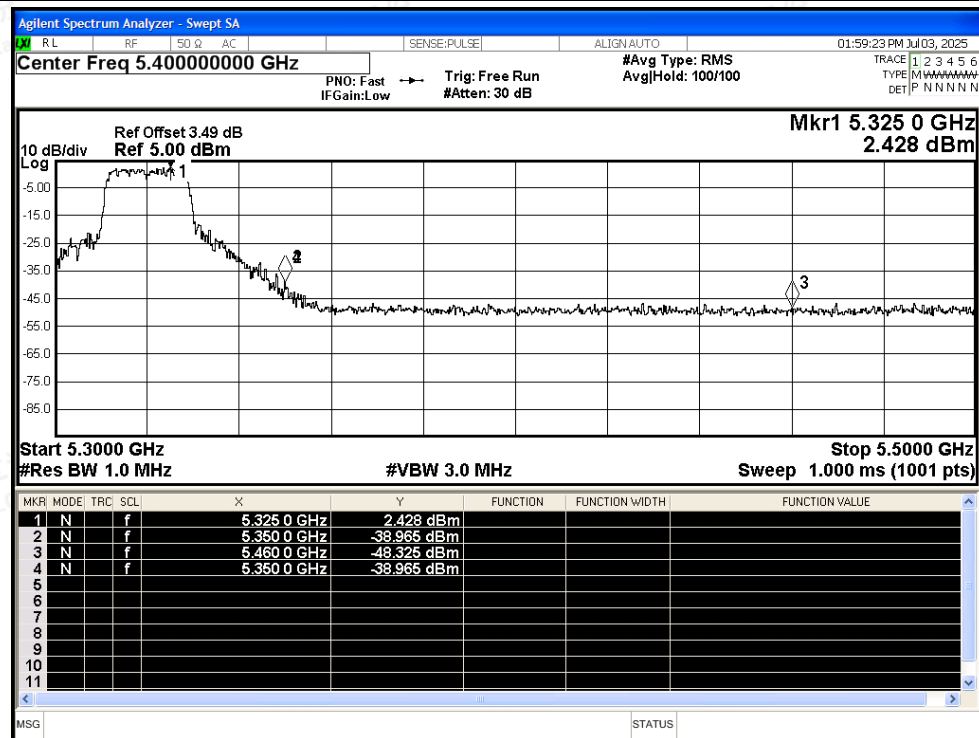

Restrict Band NVNT ax20 5320MHz Ant6 Average

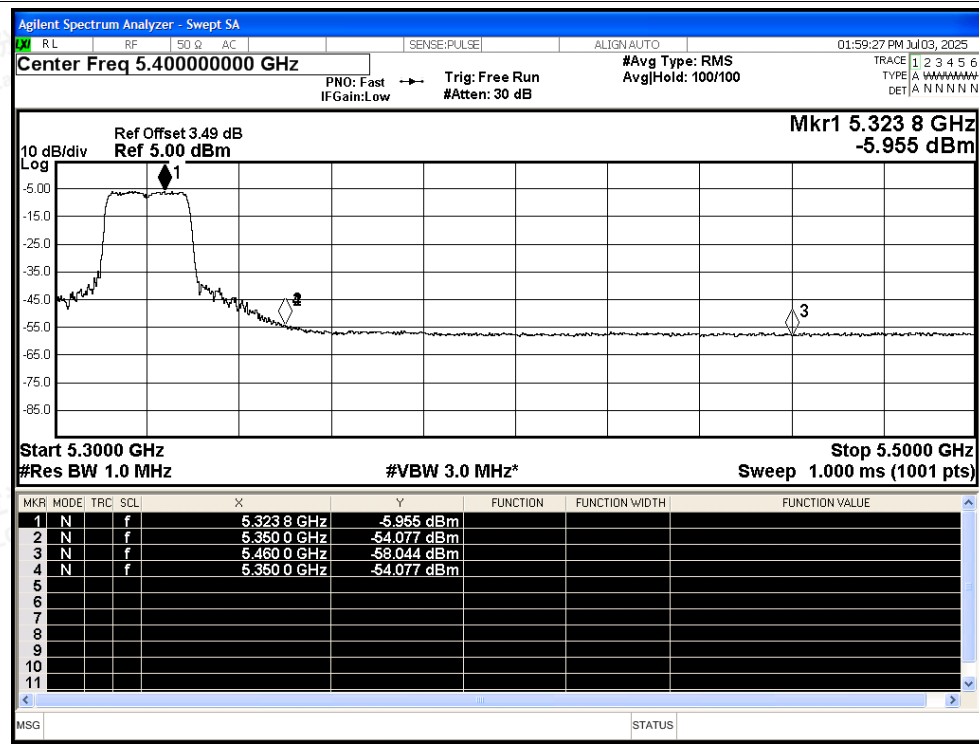

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant6 Peak

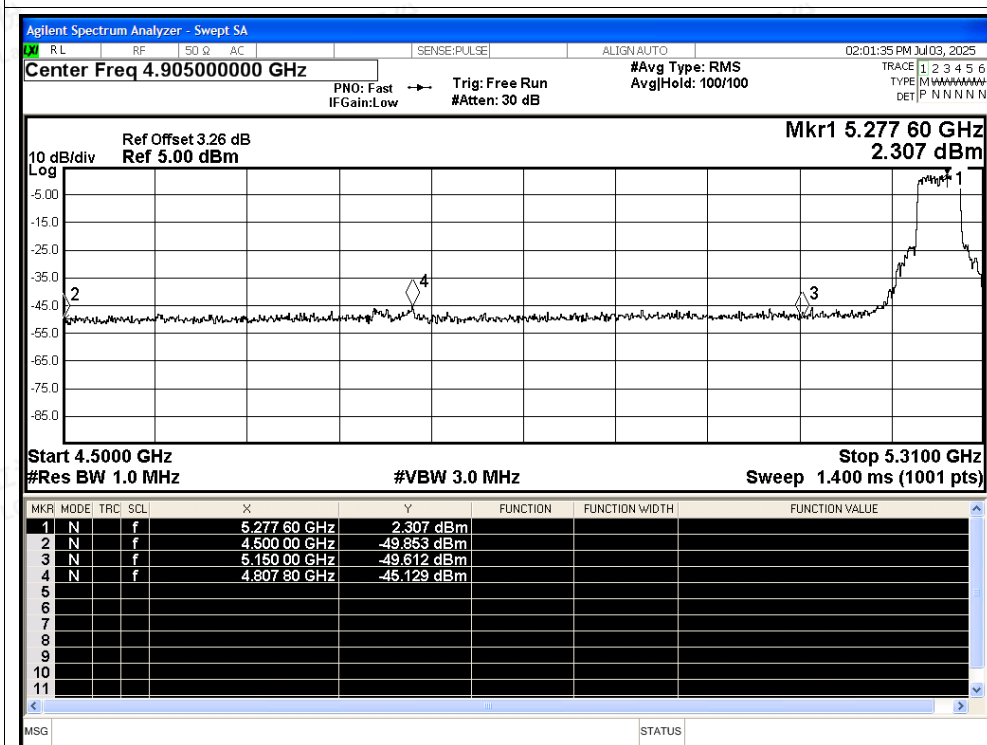

Restrict Band NVNT ax40 5270MHz Ant6 Average

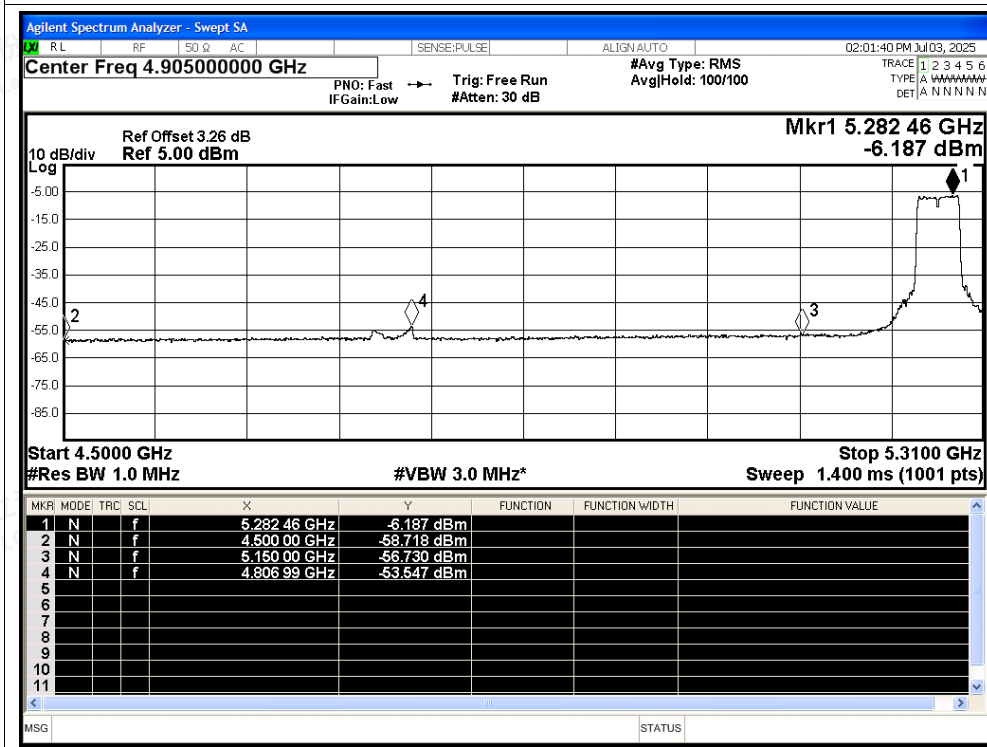

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant6 Peak

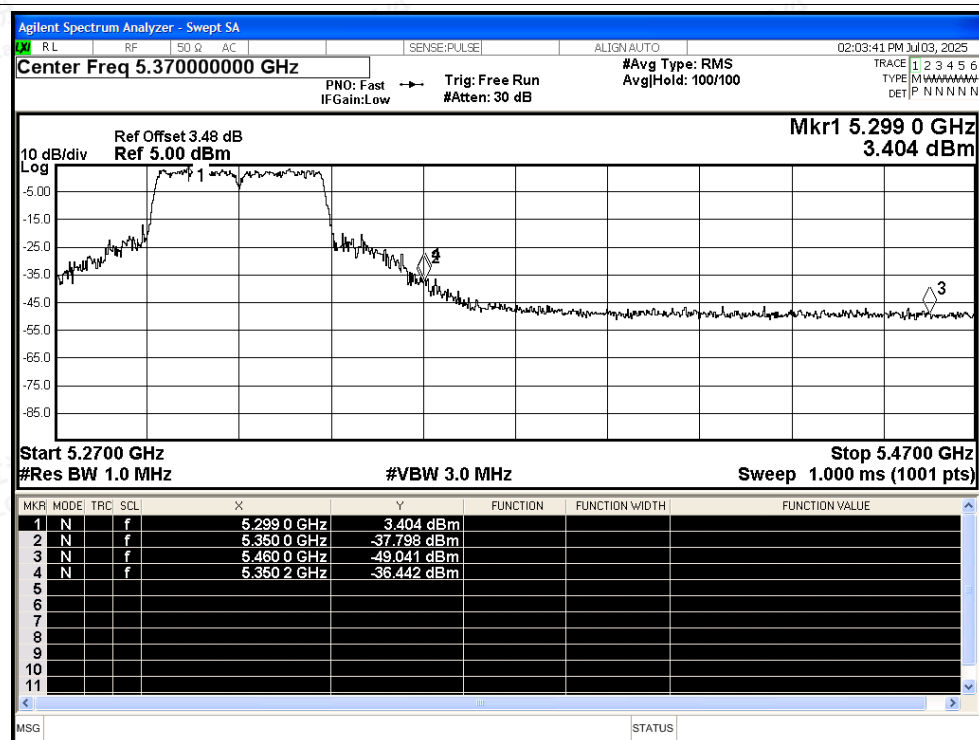

Restrict Band NVNT ax40 5310MHz Ant6 Average

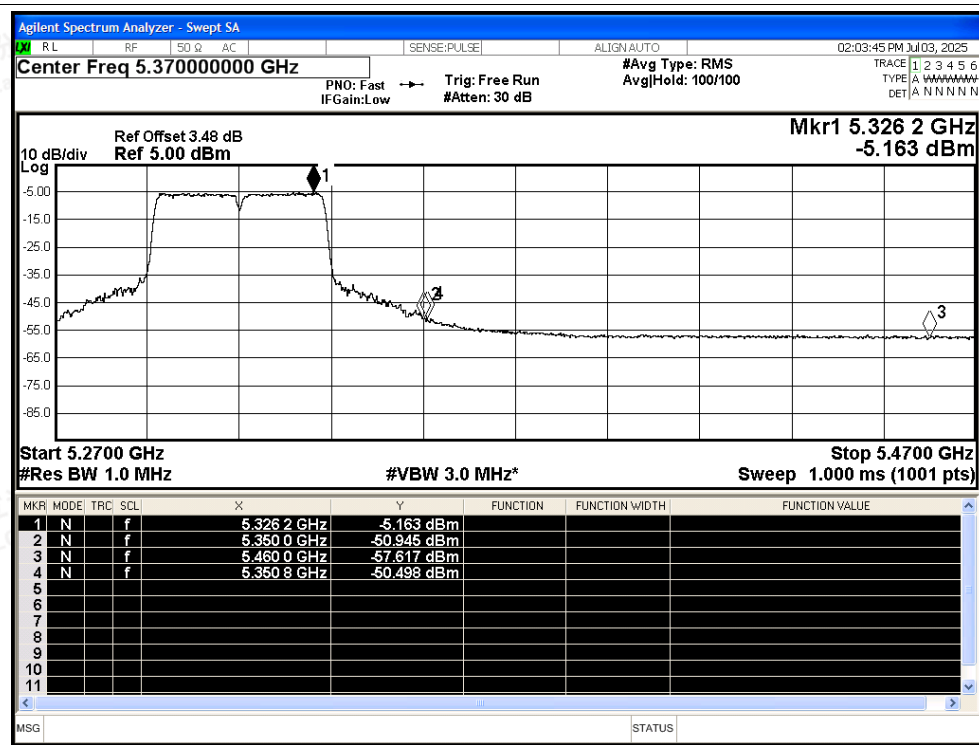

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant6 Peak

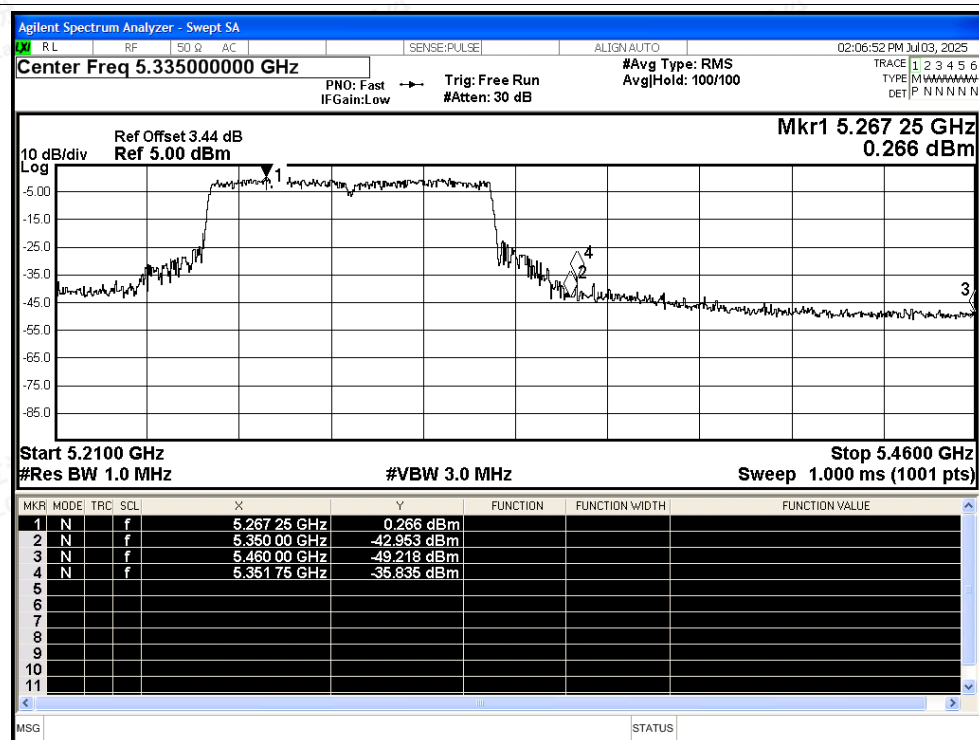

Restrict Band NVNT ax80 5290MHz Ant6 Average

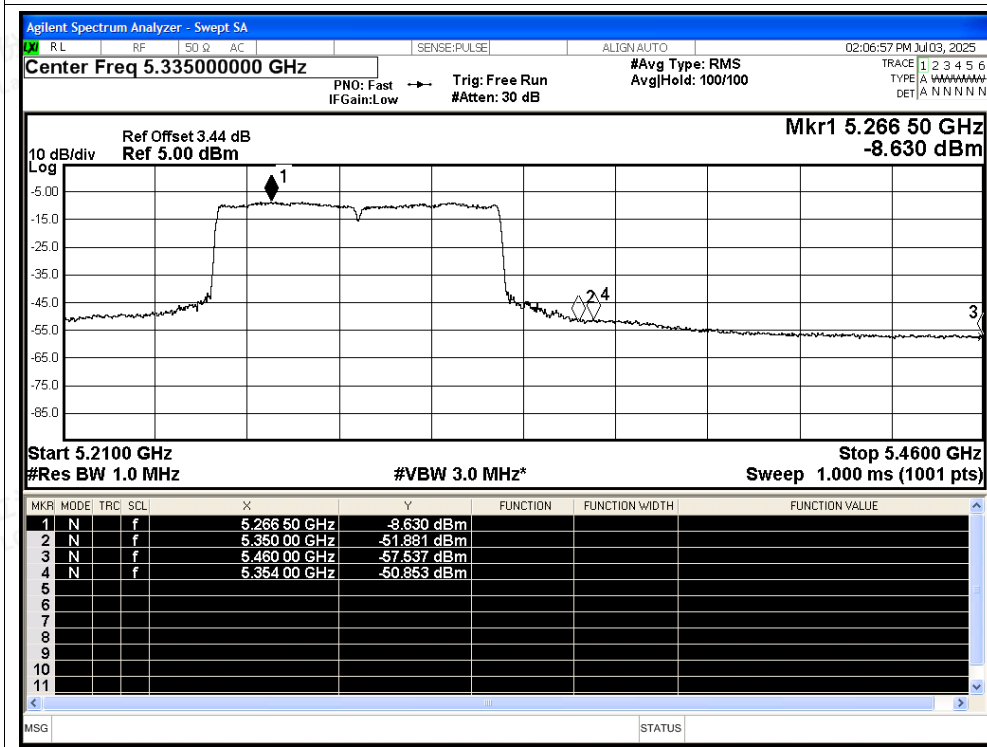

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant6 Peak

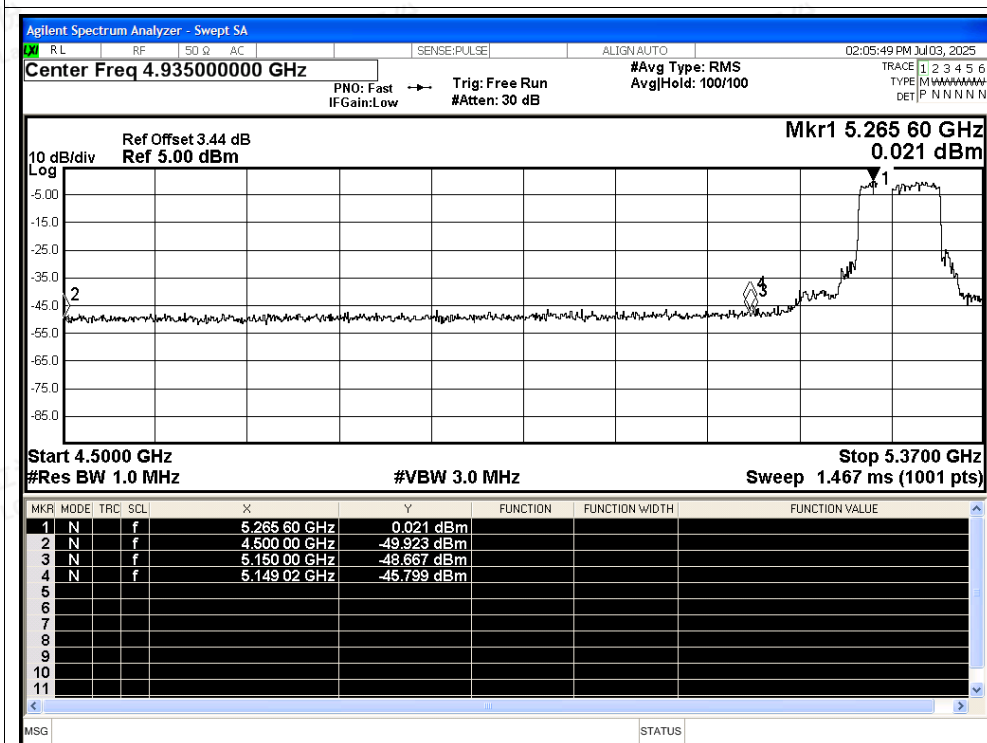

Restrict Band NVNT ax80 5290MHz Ant6 Average

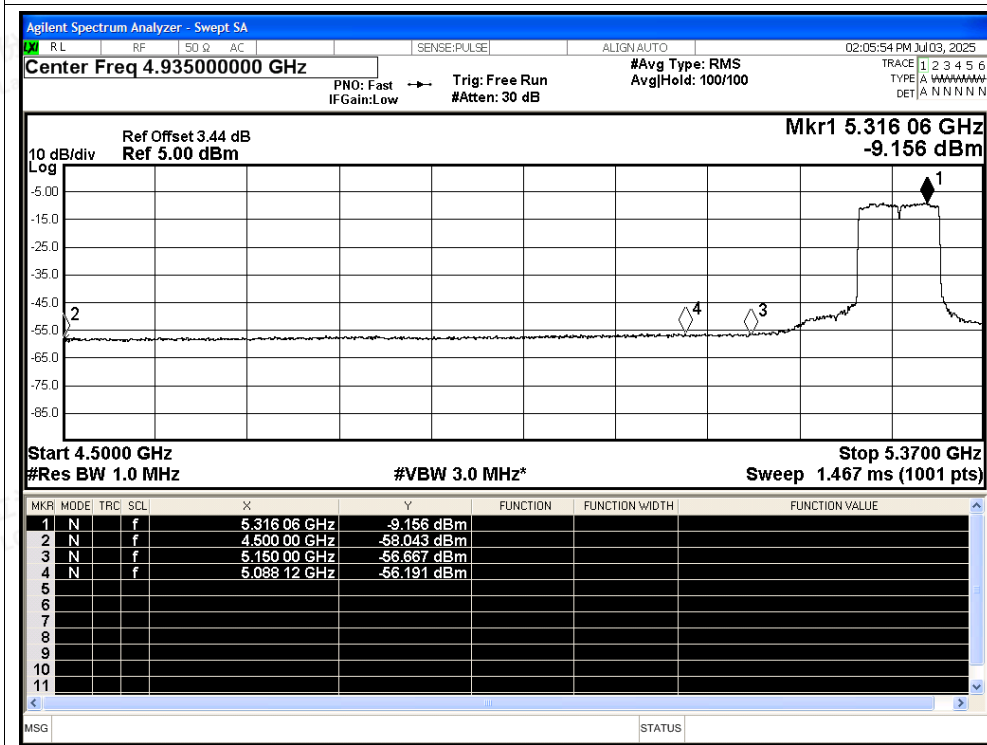

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant2 Power (dBm)	Ant3 Power (dBm)	Sum (Ant2+Ant3)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	-50.18	-49.55	-46.84	6.40	54.72	Peak	68.2	Pass
NVNT	n20	5260	-58.93	-58.74	-55.82	6.40	45.74	Average	54	Pass
NVNT	n20	5260	-46.43	-46.27	-43.34	6.40	58.23	Peak	68.2	Pass
NVNT	n20	5260	-55.9	-55.31	-52.58	6.40	48.98	Average	54	Pass
NVNT	n20	5260	-48.78	-46.49	-44.48	6.40	57.09	Peak	68.2	Pass
NVNT	n20	5260	-56.41	-56.26	-53.32	6.40	48.24	Average	54	Pass
NVNT	n20	5320	-37.7	-35.33	-33.34	6.40	68.22	Peak	68.2	Pass
NVNT	n20	5320	-51.8	-49.76	-47.65	6.40	53.92	Average	54	Pass
NVNT	n20	5320	-36.6	-37.51	-34.02	6.40	67.55	Peak	68.2	Pass
NVNT	n20	5320	-51.8	-57.76	-50.82	6.40	50.75	Average	54	Pass
NVNT	n20	5320	-51.18	-48.99	-46.94	6.40	54.63	Peak	68.2	Pass
NVNT	n20	5320	-57.47	-57.62	-54.53	6.40	47.03	Average	54	Pass
NVNT	n40	5270	-50.5	-50.78	-47.63	6.40	53.94	Peak	68.2	Pass
NVNT	n40	5270	-59.01	-58.07	-55.50	6.40	46.06	Average	54	Pass
NVNT	n40	5270	-45.38	-43.07	-41.06	6.40	60.5	Peak	68.2	Pass
NVNT	n40	5270	-53.5	-52.53	-49.98	6.40	51.59	Average	54	Pass
NVNT	n40	5270	-48.75	-48.87	-45.80	6.40	55.77	Peak	68.2	Pass
NVNT	n40	5270	-56.79	-56.53	-53.65	6.40	47.92	Average	54	Pass
NVNT	n40	5310	-40.41	-35.93	-34.61	6.40	66.96	Peak	68.2	Pass
NVNT	n40	5310	-50.73	-58.91	-50.12	6.40	51.45	Average	54	Pass
NVNT	n40	5310	-36.77	-39.33	-34.85	6.40	66.71	Peak	68.2	Pass
NVNT	n40	5310	-50.73	-56.91	-49.79	6.40	51.78	Average	54	Pass
NVNT	n40	5310	-50.37	-48.58	-46.37	6.40	55.19	Peak	68.2	Pass
NVNT	n40	5310	-57.91	-58.06	-54.97	6.40	46.59	Average	54	Pass
NVNT	ac20	5260	-50.37	-50.05	-47.20	6.40	54.37	Peak	68.2	Pass
NVNT	ac20	5260	-58.64	-58.7	-55.66	6.40	45.91	Average	54	Pass
NVNT	ac20	5260	-46.69	-46.05	-43.35	6.40	58.22	Peak	68.2	Pass
NVNT	ac20	5260	-55.85	-55.18	-52.49	6.40	49.08	Average	54	Pass
NVNT	ac20	5260	-48.76	-48.39	-45.56	6.40	56.01	Peak	68.2	Pass
NVNT	ac20	5260	-55.85	-56.47	-53.14	6.40	48.43	Average	54	Pass
NVNT	ac20	5320	-36.85	-39.6	-35.00	6.40	66.57	Peak	68.2	Pass
NVNT	ac20	5320	-50.21	-55.17	-49.01	6.40	52.56	Average	54	Pass
NVNT	ac20	5320	-35.4	-48.86	-35.21	6.40	66.36	Peak	68.2	Pass
NVNT	ac20	5320	-50.21	-57.6	-49.48	6.40	52.09	Average	54	Pass
NVNT	ac20	5320	-48.75	-48.86	-45.79	6.40	55.77	Peak	68.2	Pass
NVNT	ac20	5320	-57.26	-57.6	-54.42	6.40	47.15	Average	54	Pass
NVNT	ac40	5270	-50.78	-49.48	-47.07	6.40	54.50	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	-58.85	-59.12	-55.97	6.40	45.59	Average	54	Pass
NVNT	ac40	5270	-44.98	-44.22	-41.57	6.40	59.99	Peak	68.2	Pass
NVNT	ac40	5270	-53.14	-53.31	-50.21	6.40	51.35	Average	54	Pass
NVNT	ac40	5270	-50.14	-49.49	-46.79	6.40	54.78	Peak	68.2	Pass
NVNT	ac40	5270	-56.8	-56.96	-53.87	6.40	47.70	Average	54	Pass
NVNT	ac40	5310	-36.87	-36.35	-33.59	6.40	67.98	Peak	68.2	Pass
NVNT	ac40	5310	-51.16	-54.15	-49.39	6.40	52.18	Average	54	Pass
NVNT	ac40	5310	-38.87	-38.95	-35.90	6.40	65.67	Peak	68.2	Pass
NVNT	ac40	5310	-51.15	-55.12	-49.69	6.40	51.88	Average	54	Pass
NVNT	ac40	5310	-49.34	-49.74	-46.53	6.40	55.04	Peak	68.2	Pass
NVNT	ac40	5310	-57.47	-57.51	-54.48	6.40	47.09	Average	54	Pass
NVNT	ac80	5290	-48.37	-50.21	-46.18	6.40	55.38	Peak	68.2	Pass
NVNT	ac80	5290	-58.63	-58.54	-55.57	6.40	45.99	Average	54	Pass
NVNT	ac80	5290	-45.04	-45.67	-42.33	6.40	59.23	Peak	68.2	Pass
NVNT	ac80	5290	-55.84	-55.79	-52.80	6.40	48.76	Average	54	Pass
NVNT	ac80	5290	-48.27	-47.21	-44.70	6.40	56.87	Peak	68.2	Pass
NVNT	ac80	5290	-56.28	-56.34	-53.30	6.40	48.27	Average	54	Pass
NVNT	ac80	5290	-39.45	-38.98	-36.20	6.40	65.37	Peak	68.2	Pass
NVNT	ac80	5290	-50.87	-52.39	-48.55	6.40	53.01	Average	54	Pass
NVNT	ac80	5290	-37.28	-36.77	-34.01	6.40	67.56	Peak	68.2	Pass
NVNT	ac80	5290	-50.49	-56.3	-49.48	6.40	52.09	Average	54	Pass
NVNT	ac80	5290	-49.88	-48.23	-45.97	6.40	55.6	Peak	68.2	Pass
NVNT	ac80	5290	-57.66	-57.25	-54.44	6.40	47.13	Average	54	Pass
NVNT	ax20	5260	-50.05	-49.46	-46.73	6.40	54.83	Peak	68.2	Pass
NVNT	ax20	5260	-58.68	-58.98	-55.82	6.40	45.75	Average	54	Pass
NVNT	ax20	5260	-46.03	-45.07	-42.51	6.40	59.05	Peak	68.2	Pass
NVNT	ax20	5260	-55.62	-55.57	-52.58	6.40	48.98	Average	54	Pass
NVNT	ax20	5260	-48.14	-47.95	-45.03	6.40	56.53	Peak	68.2	Pass
NVNT	ax20	5260	-56.37	-55.94	-53.14	6.40	48.43	Average	54	Pass
NVNT	ax20	5320	-38.52	-35.27	-33.59	6.40	67.98	Peak	68.2	Pass
NVNT	ax20	5320	-56.95	-57.44	-54.18	6.40	47.39	Average	54	Pass
NVNT	ax20	5320	-37.75	-39.68	-35.60	6.40	65.97	Peak	68.2	Pass
NVNT	ax20	5320	-49.95	-52.4	-47.99	6.40	53.57	Average	54	Pass
NVNT	ax20	5320	-49.93	-49.32	-46.60	6.40	54.96	Peak	68.2	Pass
NVNT	ax20	5320	-57.56	-57.61	-54.57	6.40	46.99	Average	54	Pass
NVNT	ax40	5270	-49.53	-50.07	-46.78	6.40	54.79	Peak	68.2	Pass
NVNT	ax40	5270	-59.12	-58.88	-55.99	6.40	45.58	Average	54	Pass
NVNT	ax40	5270	-45.2	-43.74	-41.40	6.40	60.17	Peak	68.2	Pass
NVNT	ax40	5270	-53.09	-53.16	-50.11	6.40	51.45	Average	54	Pass
NVNT	ax40	5270	-47.71	-48.68	-45.16	6.40	56.41	Peak	68.2	Pass
NVNT	ax40	5270	-56.66	-56.44	-53.54	6.40	48.03	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	-37.62	-35.96	-33.70	6.40	67.87	Peak	68.2	Pass
NVNT	ax40	5310	-58.49	-51.08	-50.36	6.40	51.21	Average	54	Pass
NVNT	ax40	5310	-39.02	-39.81	-36.39	6.40	65.18	Peak	68.2	Pass
NVNT	ax40	5310	-58.49	-57.08	-54.72	6.40	46.85	Average	54	Pass
NVNT	ax40	5310	-50.44	-50.01	-47.21	6.40	54.36	Peak	68.2	Pass
NVNT	ax40	5310	-57.42	-57.4	-54.40	6.40	47.17	Average	54	Pass
NVNT	ax80	5290	-40.9	-40.49	-37.68	6.40	63.89	Peak	68.2	Pass
NVNT	ax80	5290	-53.4	-50.73	-48.85	6.40	52.71	Average	54	Pass
NVNT	ax80	5290	-38.95	-35.44	-33.84	6.40	67.73	Peak	68.2	Pass
NVNT	ax80	5290	-52.25	-50.3	-48.16	6.40	53.41	Average	54	Pass
NVNT	ax80	5290	-49.46	-50.52	-46.95	6.40	54.62	Peak	68.2	Pass
NVNT	ax80	5290	-57.32	-57.66	-54.48	6.40	47.09	Average	54	Pass
NVNT	ax80	5290	-50.12	-50.04	-47.07	6.40	54.5	Peak	68.2	Pass
NVNT	ax80	5290	-58.84	-58.55	-55.68	6.40	45.89	Average	54	Pass
NVNT	ax80	5290	-45.36	-45.93	-42.63	6.40	58.94	Peak	68.2	Pass
NVNT	ax80	5290	-55.42	-55.98	-52.68	6.40	48.89	Average	54	Pass
NVNT	ax80	5290	-48.39	-47.17	-44.73	6.40	56.84	Peak	68.2	Pass
NVNT	ax80	5290	-55.7	-56.46	-53.05	6.40	48.51	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant5 Power (dBm)	Ant6 Power (dBm)	Sum (Ant5+Ant6)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	-50.37	-49.19	-46.73	6.94	55.44	Peak	68.2	Pass
NVNT	n20	5260	-58.84	-59.06	-55.94	6.94	46.23	Average	54	Pass
NVNT	n20	5260	-45.93	-46.21	-43.06	6.94	59.11	Peak	68.2	Pass
NVNT	n20	5260	-55.28	-55.56	-52.41	6.94	49.76	Average	54	Pass
NVNT	n20	5260	-48.18	-47.54	-44.84	6.94	57.33	Peak	68.2	Pass
NVNT	n20	5260	-56.33	-55.94	-53.12	6.94	49.05	Average	54	Pass
NVNT	n20	5320	-38.23	-38.24	-35.22	6.94	66.94	Peak	68.2	Pass
NVNT	n20	5320	-52.02	-52.76	-49.36	6.94	52.80	Average	54	Pass
NVNT	n20	5320	-37.02	-37.82	-34.39	6.94	67.78	Peak	68.2	Pass
NVNT	n20	5320	-52.02	-53.66	-49.75	6.94	52.41	Average	54	Pass
NVNT	n20	5320	-49.48	-48.14	-45.75	6.94	56.42	Peak	68.2	Pass
NVNT	n20	5320	-57.53	-57.86	-54.68	6.94	47.49	Average	54	Pass
NVNT	n40	5270	-49.51	-50.66	-47.04	6.94	55.13	Peak	68.2	Pass
NVNT	n40	5270	-58.55	-58.63	-55.58	6.94	46.59	Average	54	Pass
NVNT	n40	5270	-43.41	-45.34	-41.26	6.94	60.91	Peak	68.2	Pass
NVNT	n40	5270	-53	-54.38	-50.63	6.94	51.54	Average	54	Pass
NVNT	n40	5270	-47.2	-48.99	-44.99	6.94	57.17	Peak	68.2	Pass
NVNT	n40	5270	-57.03	-57.05	-54.03	6.94	48.14	Average	54	Pass
NVNT	n40	5310	-37.83	-38.17	-34.99	6.94	67.18	Peak	68.2	Pass
NVNT	n40	5310	-51.89	-52.53	-49.19	6.94	52.98	Average	54	Pass
NVNT	n40	5310	-36.92	-38.72	-34.72	6.94	67.45	Peak	68.2	Pass
NVNT	n40	5310	-54.52	-52.53	-50.40	6.94	51.77	Average	54	Pass
NVNT	n40	5310	-49.25	-49.64	-46.43	6.94	55.74	Peak	68.2	Pass
NVNT	n40	5310	-57.19	-57.58	-54.37	6.94	47.80	Average	54	Pass
NVNT	ac20	5260	-51.71	-50.24	-47.90	6.94	54.26	Peak	68.2	Pass
NVNT	ac20	5260	-58.42	-58.47	-55.43	6.94	46.73	Average	54	Pass
NVNT	ac20	5260	-45.89	-46.5	-43.17	6.94	58.99	Peak	68.2	Pass
NVNT	ac20	5260	-55.31	-55.69	-52.49	6.94	49.68	Average	54	Pass
NVNT	ac20	5260	-47.26	-48.99	-45.03	6.94	57.14	Peak	68.2	Pass
NVNT	ac20	5260	-56.34	-56.12	-53.22	6.94	48.95	Average	54	Pass
NVNT	ac20	5320	-38.14	-36.68	-34.34	6.94	67.83	Peak	68.2	Pass
NVNT	ac20	5320	-56.94	-59.45	-55.01	6.94	47.16	Average	54	Pass
NVNT	ac20	5320	-40.97	-39.68	-37.27	6.94	64.90	Peak	68.2	Pass
NVNT	ac20	5320	-56.71	-57.99	-54.29	6.94	47.87	Average	54	Pass
NVNT	ac20	5320	-48.2	-48.85	-45.50	6.94	56.67	Peak	68.2	Pass
NVNT	ac20	5320	-57.19	-57.33	-54.25	6.94	47.92	Average	54	Pass
NVNT	ac40	5270	-50.08	-47.67	-45.70	6.94	56.47	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	-58.48	-58.7	-55.58	6.94	46.59	Average	54	Pass
NVNT	ac40	5270	-43.28	-45.31	-41.17	6.94	61.00	Peak	68.2	Pass
NVNT	ac40	5270	-52.39	-53.79	-50.02	6.94	52.14	Average	54	Pass
NVNT	ac40	5270	-47.79	-48.82	-45.26	6.94	56.90	Peak	68.2	Pass
NVNT	ac40	5270	-56.57	-57.23	-53.88	6.94	48.29	Average	54	Pass
NVNT	ac40	5310	-36.26	-37.92	-34.00	6.94	68.17	Peak	68.2	Pass
NVNT	ac40	5310	-55.06	-50.26	-49.02	6.94	53.15	Average	54	Pass
NVNT	ac40	5310	-38.57	-39.49	-36.00	6.94	66.17	Peak	68.2	Pass
NVNT	ac40	5310	-58.66	-56.26	-54.29	6.94	47.88	Average	54	Pass
NVNT	ac40	5310	-47.65	-50.37	-45.79	6.94	56.38	Peak	68.2	Pass
NVNT	ac40	5310	-57.37	-58.27	-54.79	6.94	47.38	Average	54	Pass
NVNT	ac80	5290	-50.07	-49.03	-46.51	6.94	55.66	Peak	68.2	Pass
NVNT	ac80	5290	-58.65	-58.67	-55.65	6.94	46.52	Average	54	Pass
NVNT	ac80	5290	-45.04	-46.01	-42.49	6.94	59.68	Peak	68.2	Pass
NVNT	ac80	5290	-55.01	-56.15	-52.53	6.94	49.64	Average	54	Pass
NVNT	ac80	5290	-45.04	-47.01	-42.90	6.94	59.26	Peak	68.2	Pass
NVNT	ac80	5290	-55.41	-56.36	-52.85	6.94	49.32	Average	54	Pass
NVNT	ac80	5290	-39.9	-42.98	-38.16	6.94	64.01	Peak	68.2	Pass
NVNT	ac80	5290	-53.39	-52.38	-49.85	6.94	52.32	Average	54	Pass
NVNT	ac80	5290	-37.25	-37.99	-34.59	6.94	67.57	Peak	68.2	Pass
NVNT	ac80	5290	-54.02	-52.38	-50.11	6.94	52.05	Average	54	Pass
NVNT	ac80	5290	-49.33	-48.45	-45.86	6.94	56.31	Peak	68.2	Pass
NVNT	ac80	5290	-57.32	-57.45	-54.37	6.94	47.79	Average	54	Pass
NVNT	ax20	5260	-49.42	-51.46	-47.31	6.94	54.86	Peak	68.2	Pass
NVNT	ax20	5260	-58.64	-58.39	-55.50	6.94	46.66	Average	54	Pass
NVNT	ax20	5260	-45.54	-45.49	-42.50	6.94	59.66	Peak	68.2	Pass
NVNT	ax20	5260	-55.26	-56.13	-52.66	6.94	49.50	Average	54	Pass
NVNT	ax20	5260	-48.61	-48.22	-45.40	6.94	56.77	Peak	68.2	Pass
NVNT	ax20	5260	-56.11	-56.36	-53.22	6.94	48.94	Average	54	Pass
NVNT	ax20	5320	-35.72	-38.97	-34.04	6.94	68.13	Peak	68.2	Pass
NVNT	ax20	5320	-56.34	-54.08	-52.05	6.94	50.11	Average	54	Pass
NVNT	ax20	5320	-47.76	-48.33	-45.03	6.94	57.14	Peak	68.2	Pass
NVNT	ax20	5320	-57.38	-58.04	-54.69	6.94	47.48	Average	54	Pass
NVNT	ax20	5320	-47.57	-48.33	-44.92	6.94	57.24	Peak	68.2	Pass
NVNT	ax20	5320	-57.47	-58.04	-54.74	6.94	47.43	Average	54	Pass
NVNT	ax40	5270	-52.01	-49.85	-47.79	6.94	54.38	Peak	68.2	Pass
NVNT	ax40	5270	-58.41	-58.72	-55.55	6.94	46.62	Average	54	Pass
NVNT	ax40	5270	-44.65	-45.13	-41.87	6.94	60.29	Peak	68.2	Pass
NVNT	ax40	5270	-53.92	-53.55	-50.72	6.94	51.45	Average	54	Pass
NVNT	ax40	5270	-47.35	-49.61	-45.32	6.94	56.84	Peak	68.2	Pass
NVNT	ax40	5270	-57	-56.73	-53.85	6.94	48.31	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	-37.72	-37.8	-34.75	6.94	67.42	Peak	68.2	Pass
NVNT	ax40	5310	-56.46	-50.95	-49.87	6.94	52.29	Average	54	Pass
NVNT	ax40	5310	-49.46	-36.44	-36.23	6.94	65.94	Peak	68.2	Pass
NVNT	ax40	5310	-54.23	-50.5	-48.97	6.94	53.20	Average	54	Pass
NVNT	ax40	5310	-49.95	-49.04	-46.46	6.94	55.71	Peak	68.2	Pass
NVNT	ax40	5310	-57.62	-57.62	-54.61	6.94	47.56	Average	54	Pass
NVNT	ax80	5290	-39.41	-42.95	-37.82	6.94	64.35	Peak	68.2	Pass
NVNT	ax80	5290	-51.96	-51.88	-48.91	6.94	53.26	Average	54	Pass
NVNT	ax80	5290	-38.17	-39.84	-35.91	6.94	66.25	Peak	68.2	Pass
NVNT	ax80	5290	-54.96	-56.85	-52.79	6.94	49.37	Average	54	Pass
NVNT	ax80	5290	-49.67	-49.22	-46.43	6.94	55.74	Peak	68.2	Pass
NVNT	ax80	5290	-57.41	-57.54	-54.46	6.94	47.70	Average	54	Pass
NVNT	ax80	5290	-49.13	-49.92	-46.50	6.94	55.67	Peak	68.2	Pass
NVNT	ax80	5290	-58.28	-58.04	-55.15	6.94	47.02	Average	54	Pass
NVNT	ax80	5290	-45.52	-45.8	-42.65	6.94	59.52	Peak	68.2	Pass
NVNT	ax80	5290	-55.52	-56.19	-52.83	6.94	49.34	Average	54	Pass
NVNT	ax80	5290	-47.84	-48.67	-45.22	6.94	56.94	Peak	68.2	Pass
NVNT	ax80	5290	-55.99	-56.67	-53.31	6.94	48.86	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5300	Ant2	5300	0	0	25	Pass
NVNT	a	5320	Ant2	5320	0	0	25	Pass
NVNT	n20	5260	Ant2	5260.02	20000	3.8	25	Pass
NVNT	n20	5300	Ant2	5300.02	20000	3.77	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5260.02	20000	3.8	25	Pass
NVNT	ac20	5300	Ant2	5300.02	20000	3.77	25	Pass
NVNT	ac20	5320	Ant2	5320.02	20000	3.76	25	Pass
NVNT	ac40	5270	Ant2	5270	0	0	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant2	5270	0	0	25	Pass
NVNT	ax40	5310	Ant2	5310	0	0	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

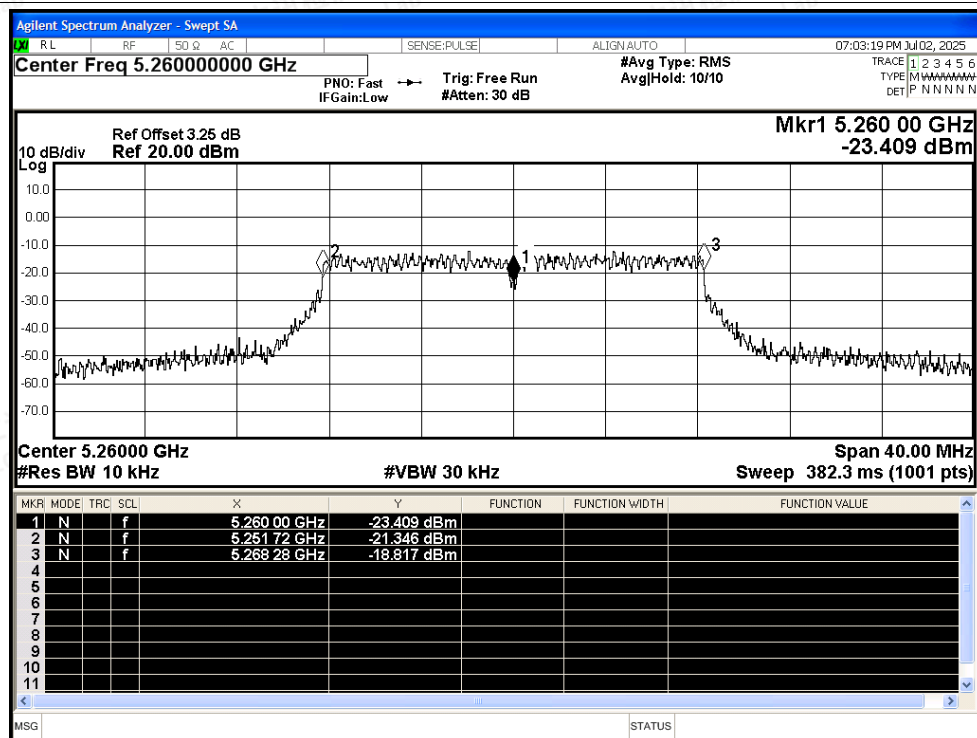

Freq. Stability NVNT a 5300MHz Ant2

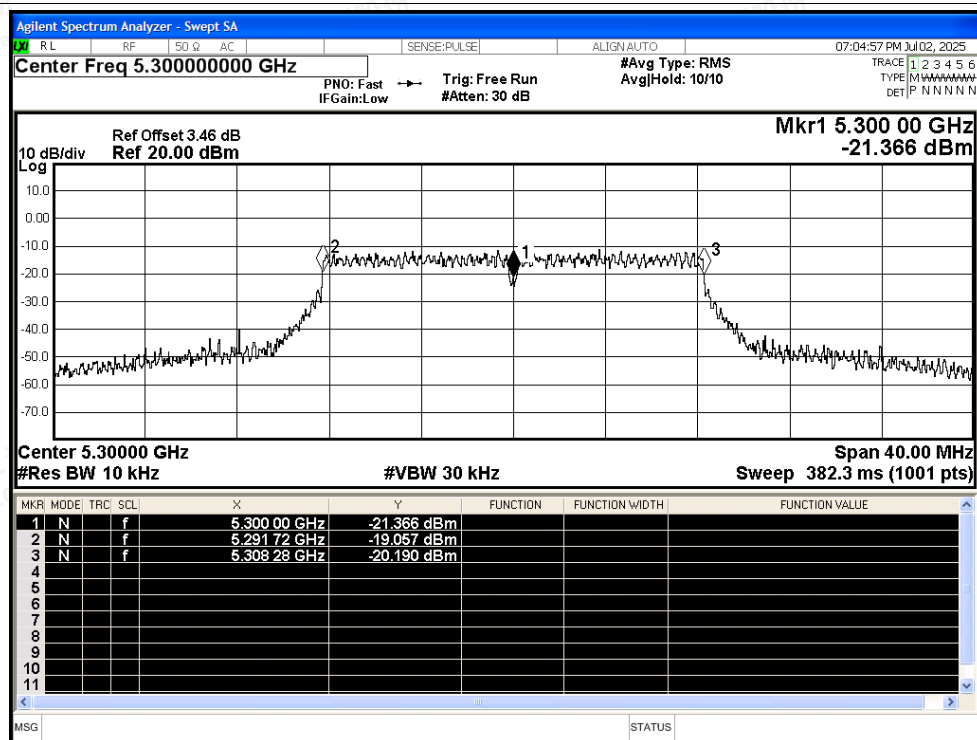

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

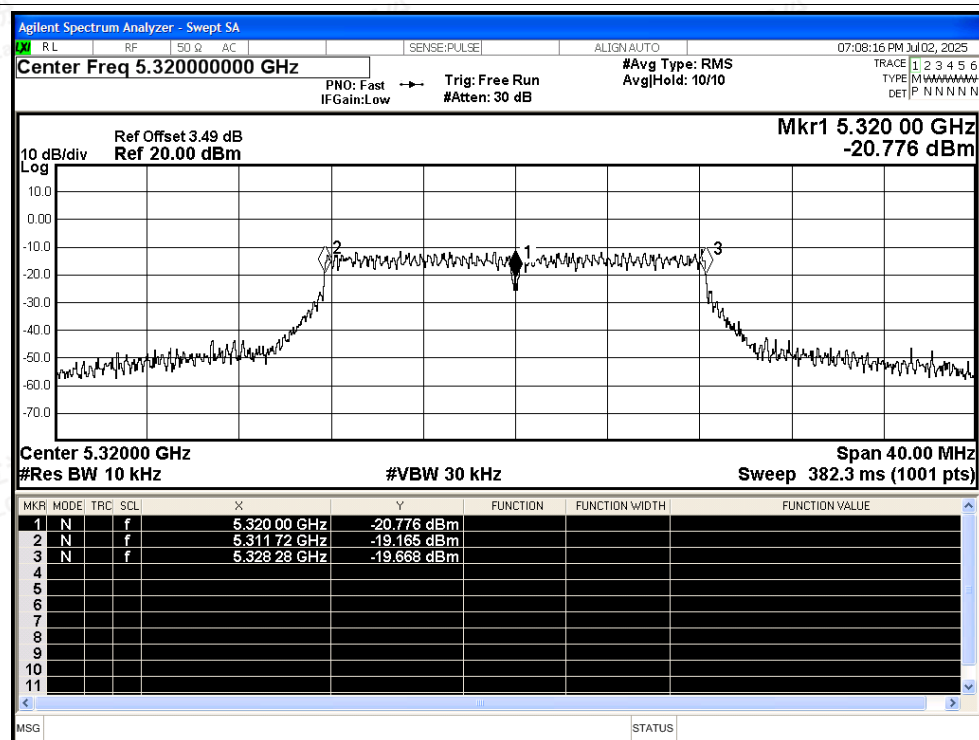

Freq. Stability NVNT n20 5260MHz Ant2

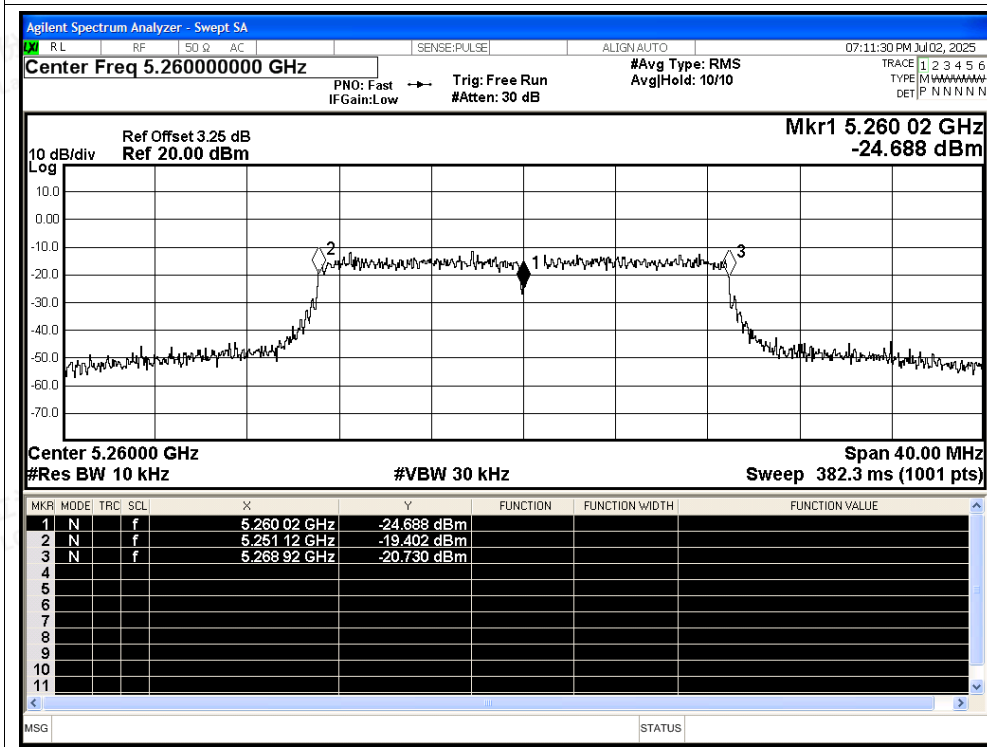

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant2

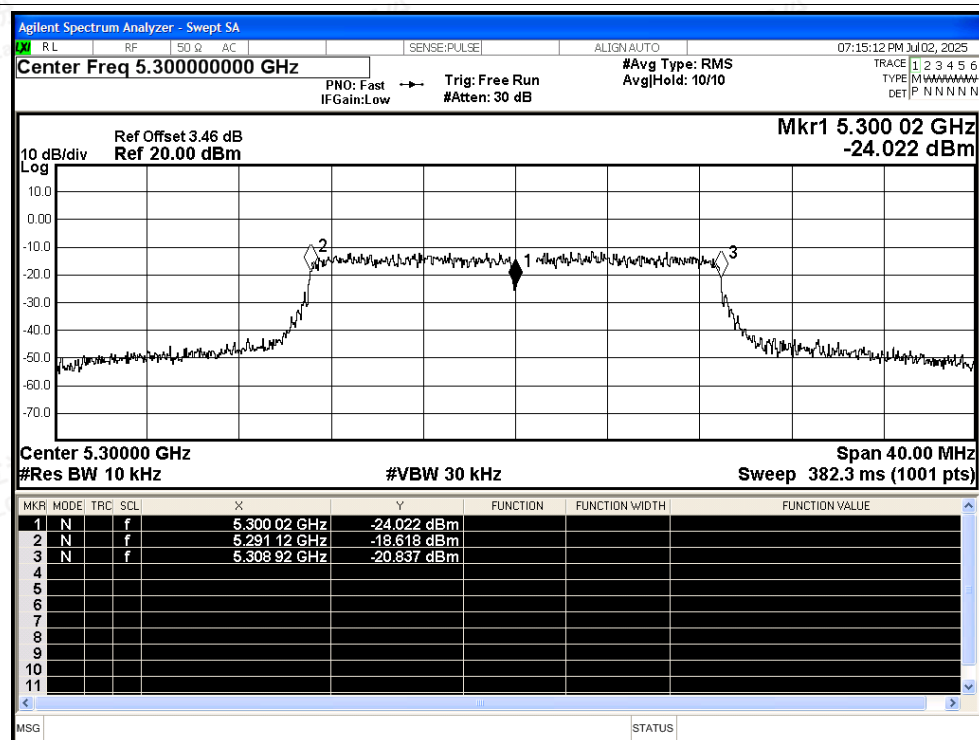

Freq. Stability NVNT n20 5320MHz Ant2

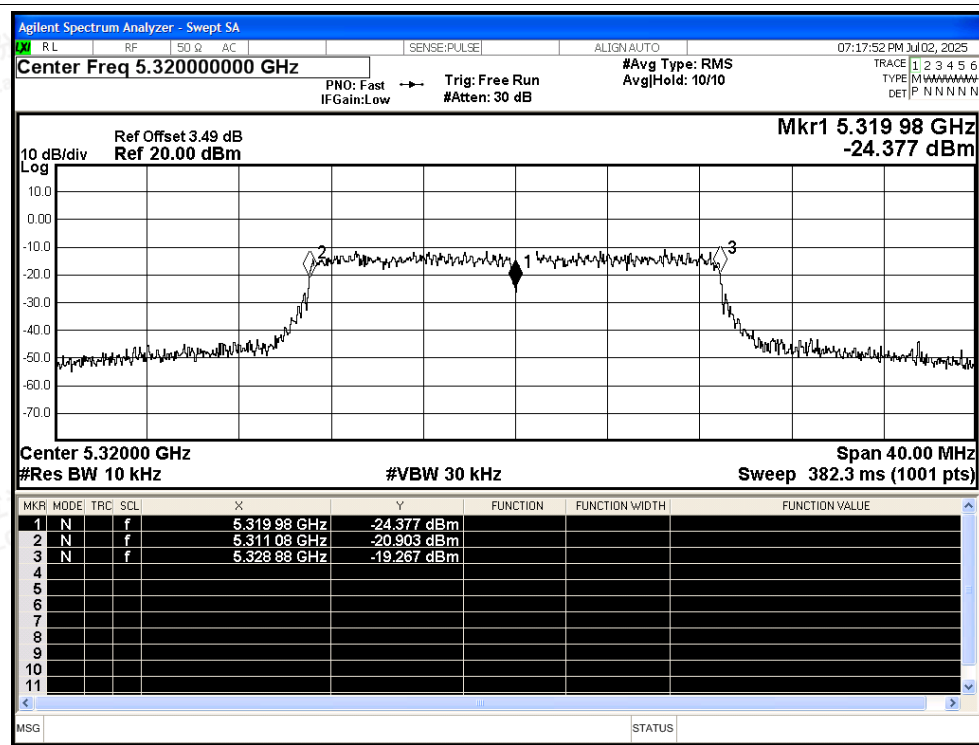

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

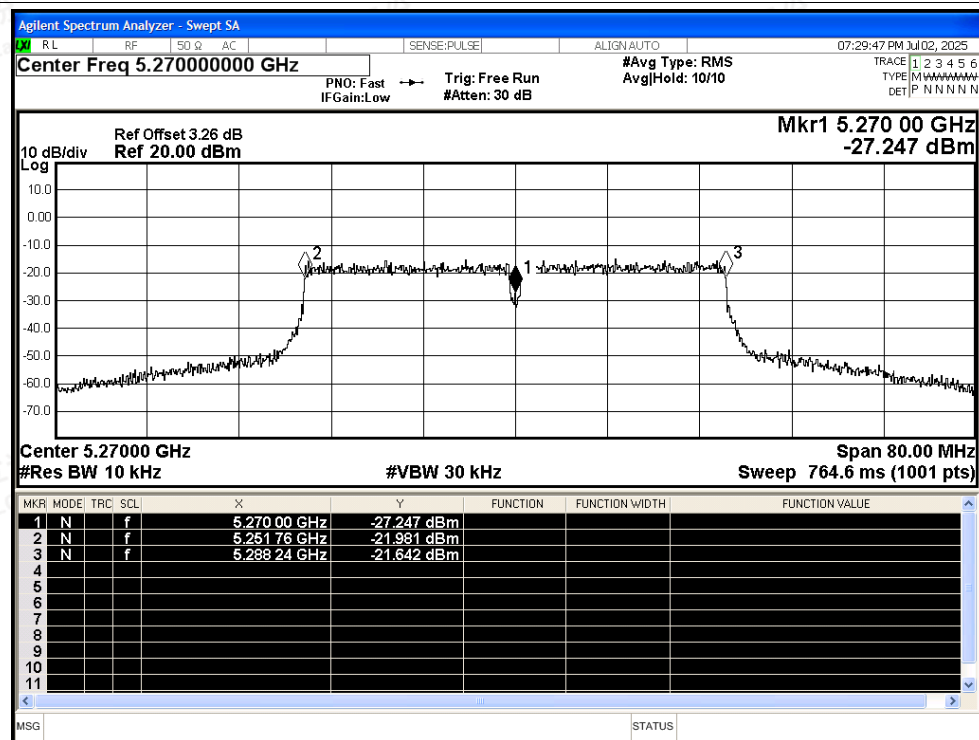

Freq. Stability NVNT n40 5310MHz Ant2

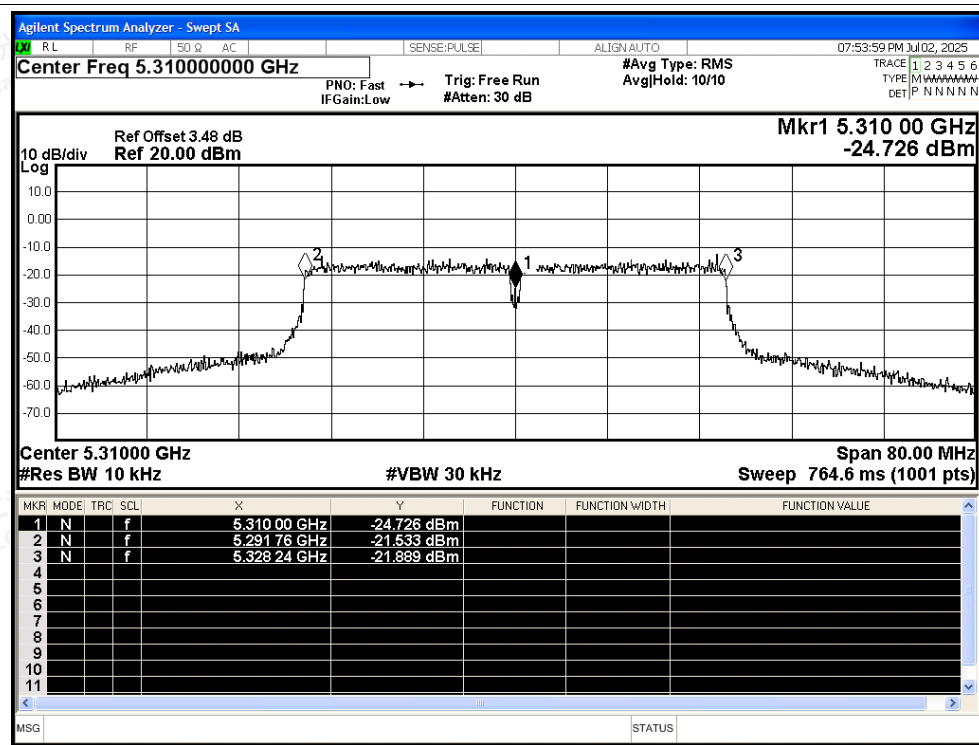

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

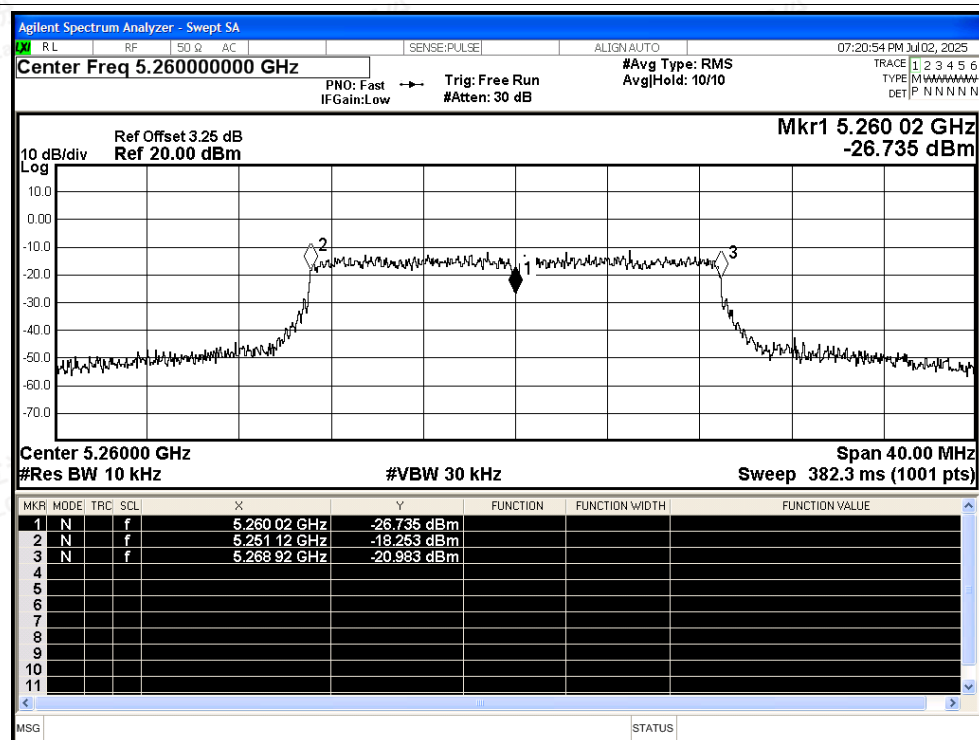

Freq. Stability NVNT ac20 5300MHz Ant2

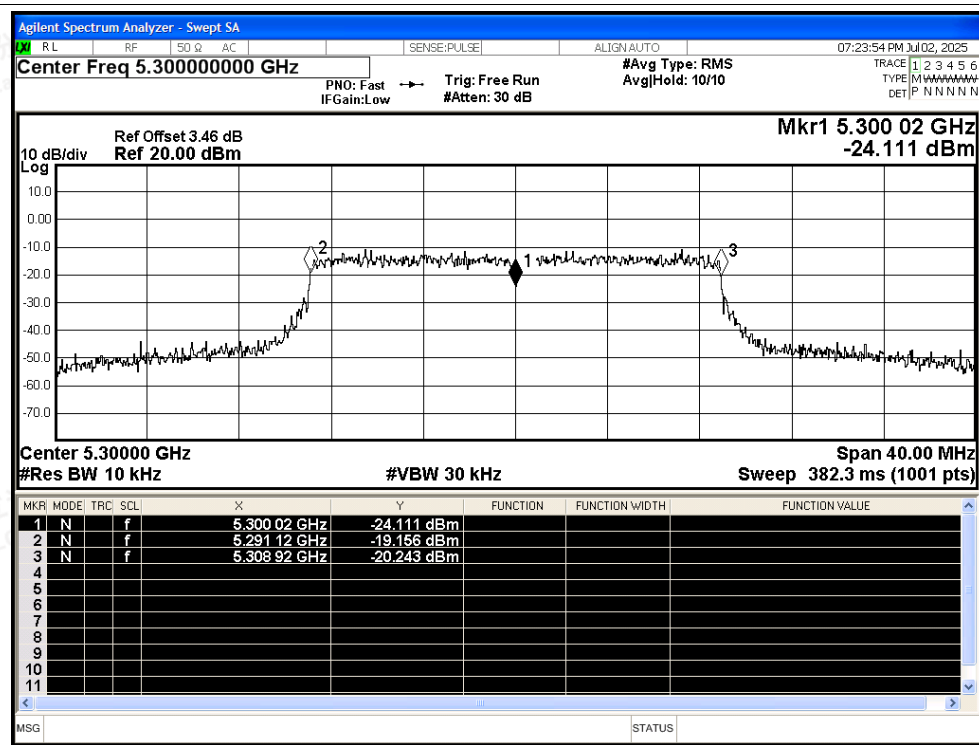

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

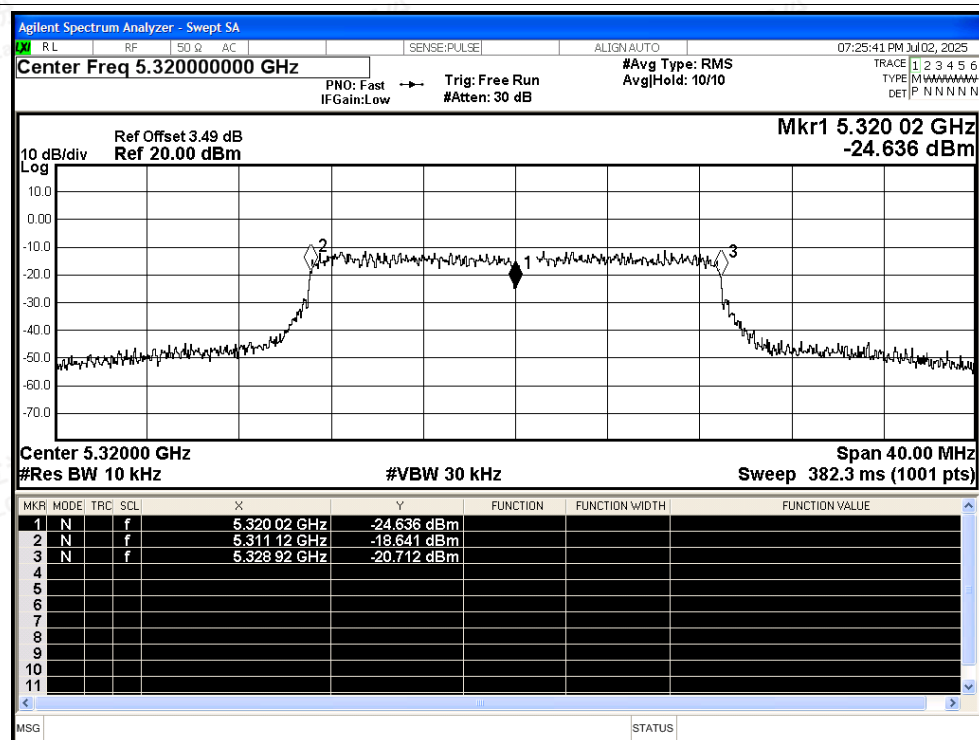

Freq. Stability NVNT ac40 5270MHz Ant2

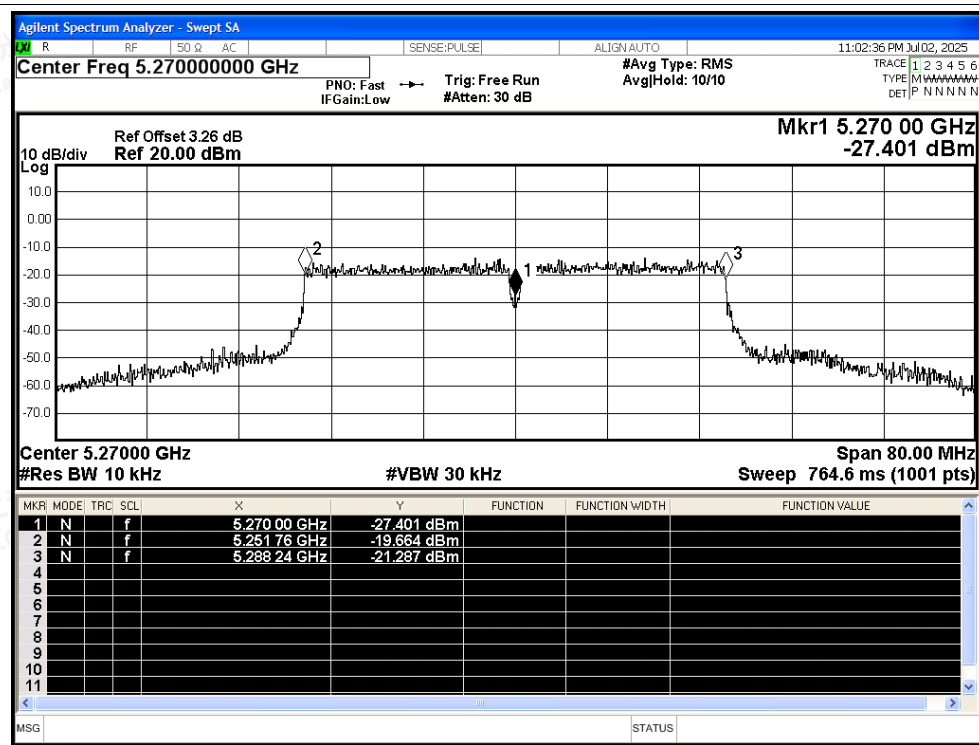

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant2

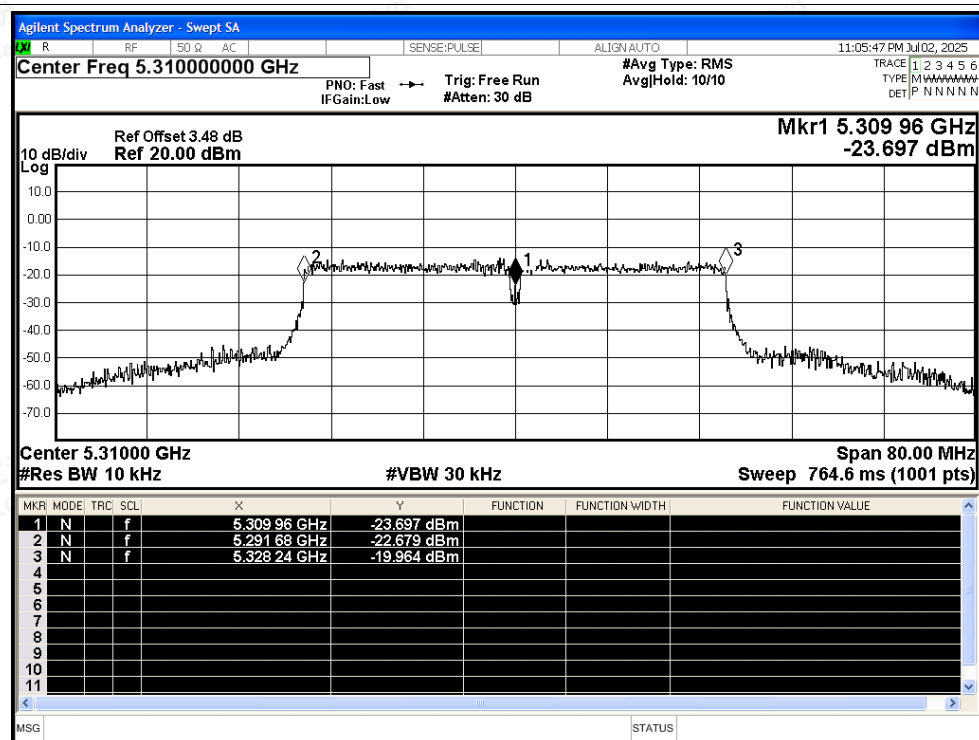

Freq. Stability NVNT ac80 5290MHz Ant2

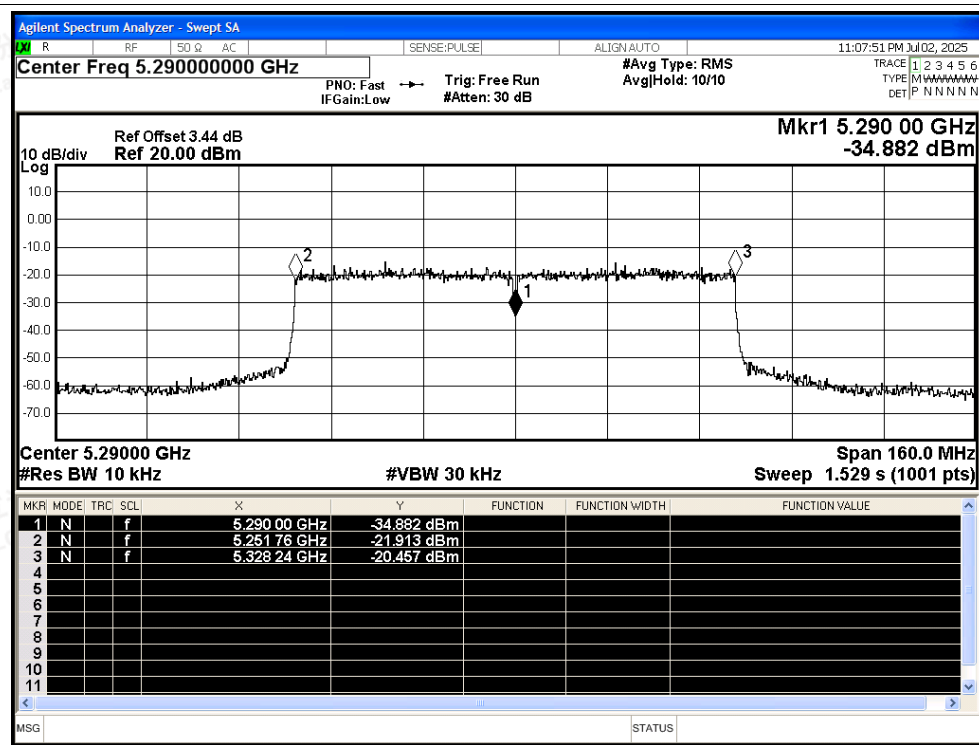

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant2

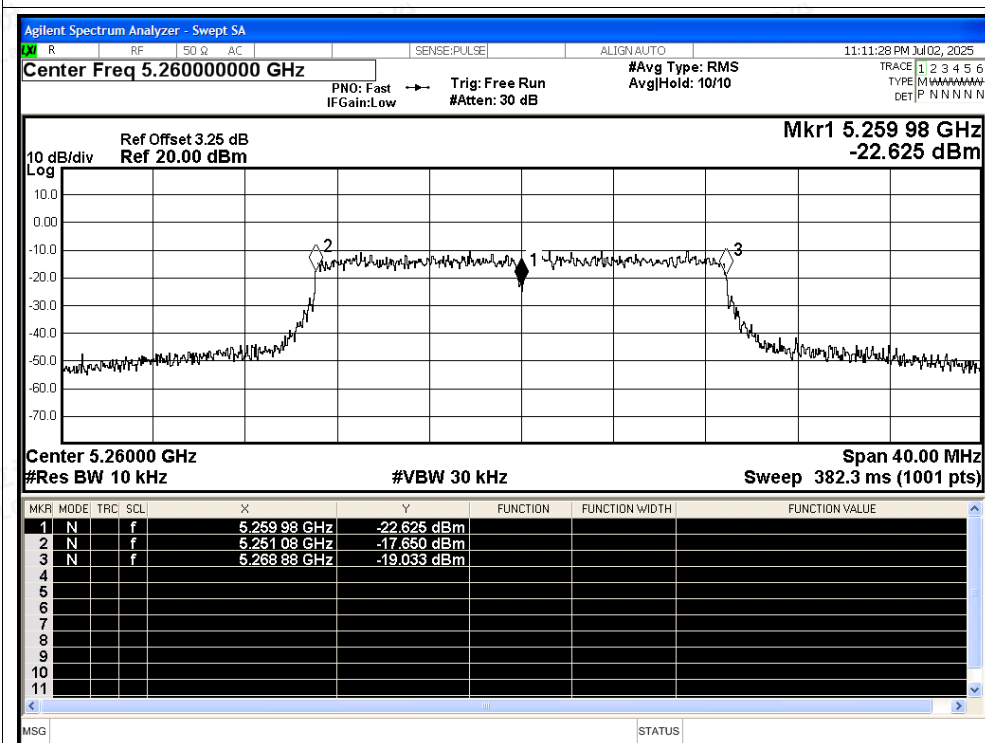

Freq. Stability NVNT ax20 5300MHz Ant2

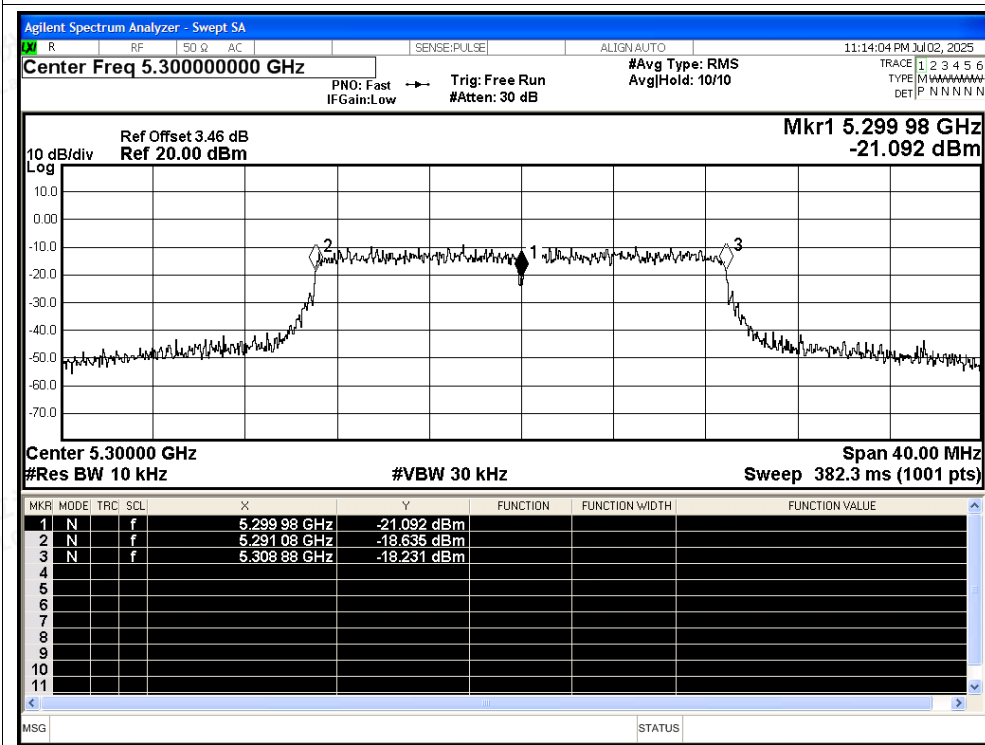

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant2

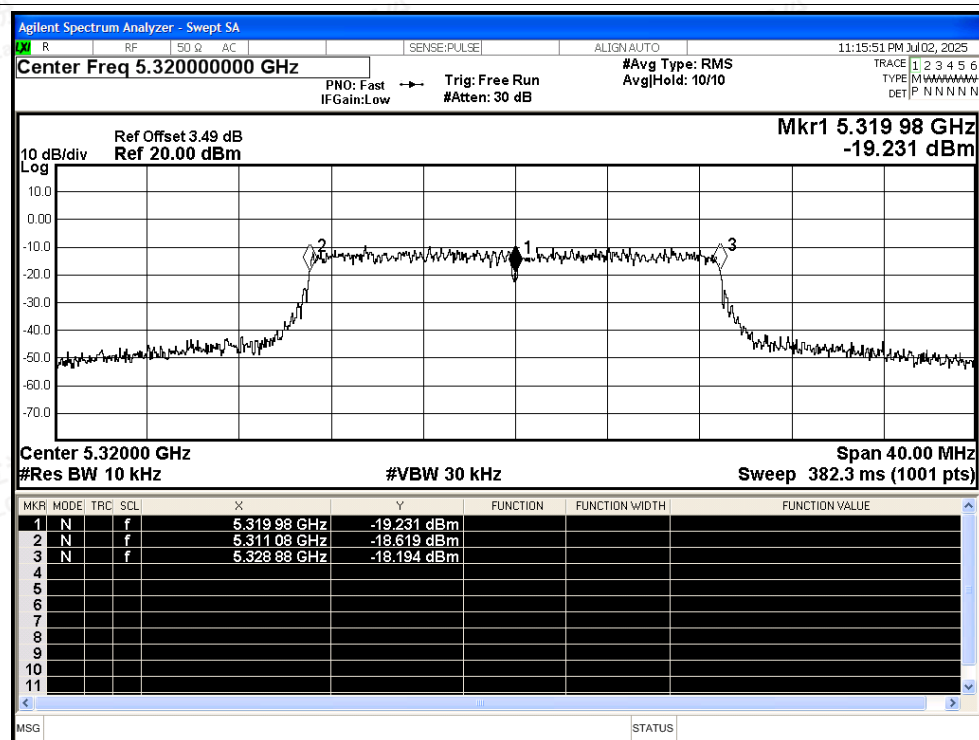

Freq. Stability NVNT ax40 5270MHz Ant2

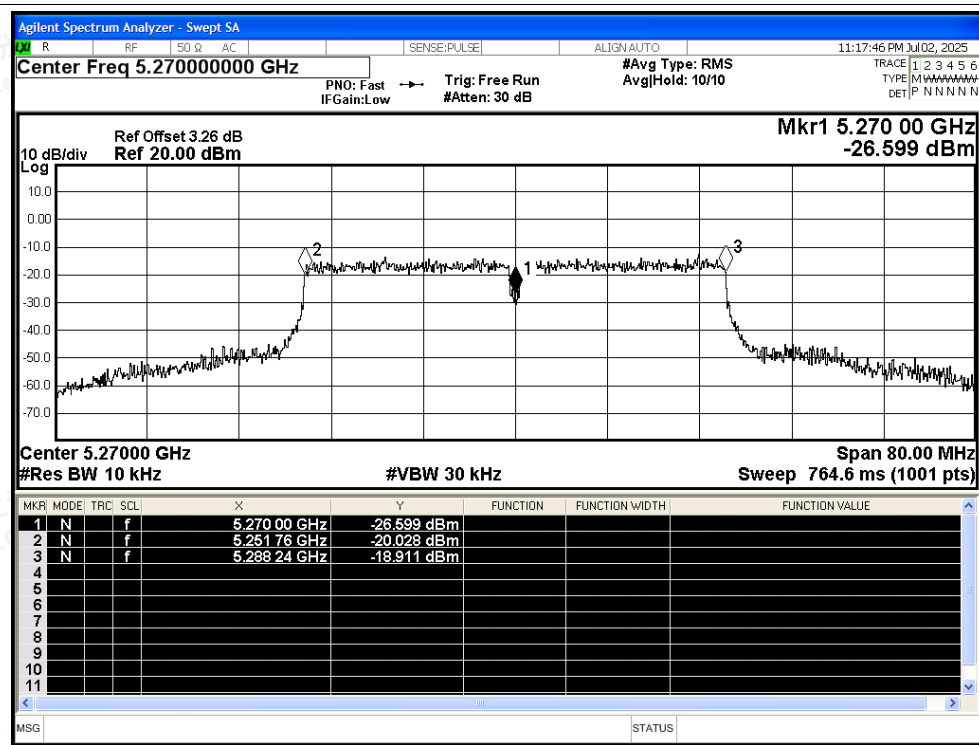

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant2

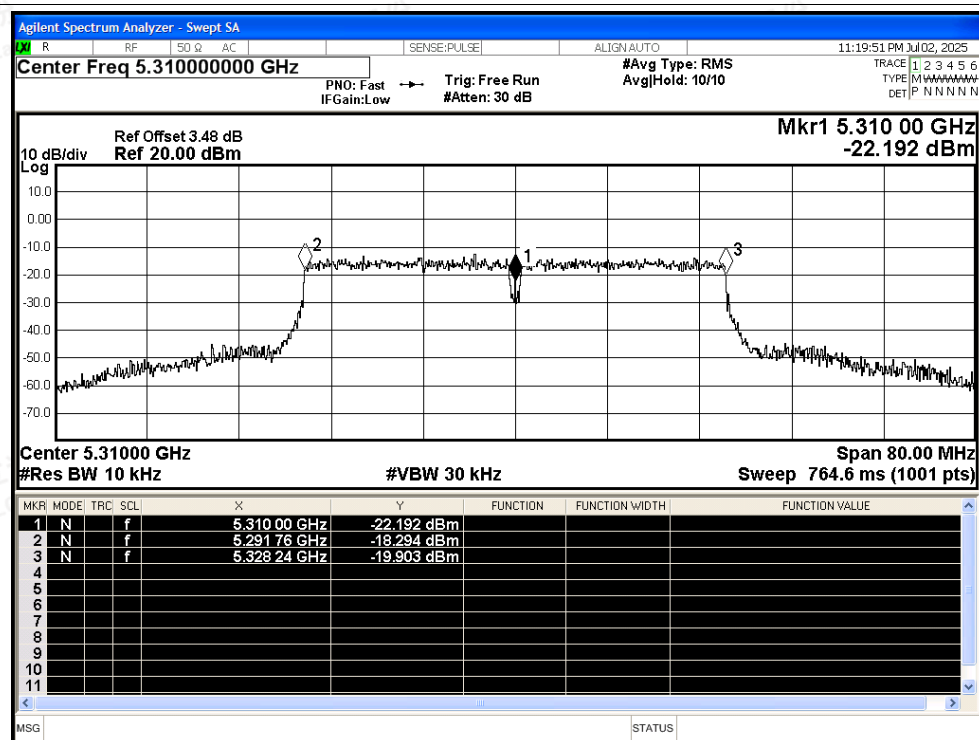

Freq. Stability NVNT ax80 5290MHz Ant2

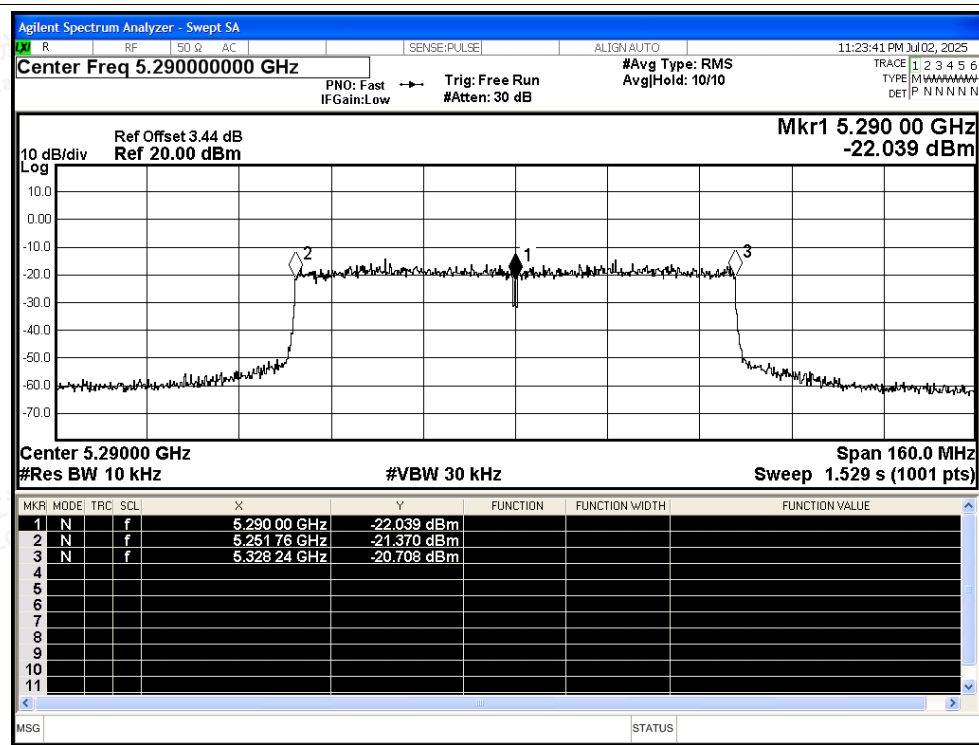

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant3	5260	0	0	25	Pass
NVNT	a	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant3	5260	0	0	25	Pass
NVNT	n20	5300	Ant3	5300.02	20000	3.77	25	Pass
NVNT	n20	5320	Ant3	5319.96	-40000	-7.52	25	Pass
NVNT	n40	5270	Ant3	5270	0	0	25	Pass
NVNT	n40	5310	Ant3	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant3	5270	0	0	25	Pass
NVNT	ac40	5310	Ant3	5310	0	0	25	Pass
NVNT	ac80	5290	Ant3	5290	0	0	25	Pass
NVNT	ax20	5260	Ant3	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant3	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant3	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant3	5270	0	0	25	Pass
NVNT	ax40	5310	Ant3	5310	0	0	25	Pass
NVNT	ax80	5290	Ant3	5290	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant3

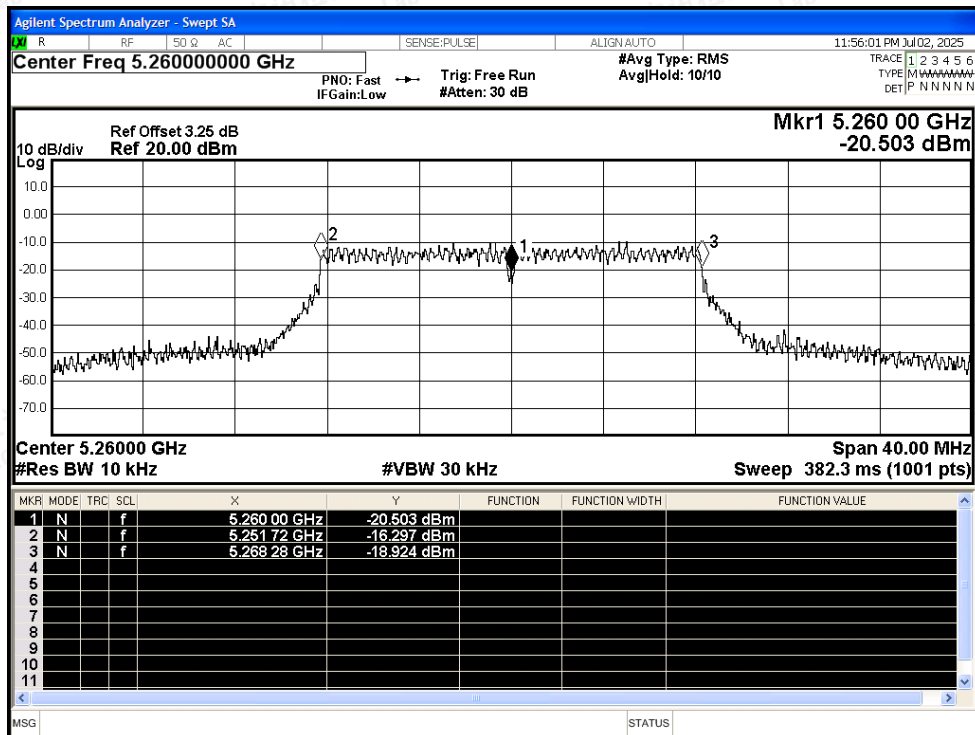

Freq. Stability NVNT a 5300MHz Ant3

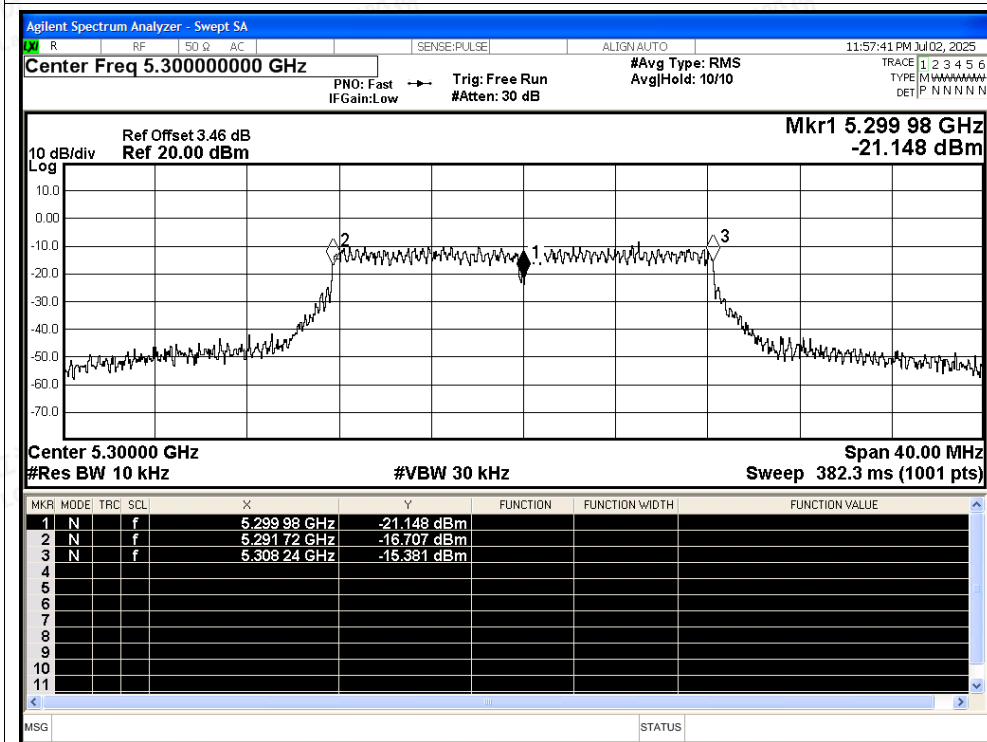

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant3

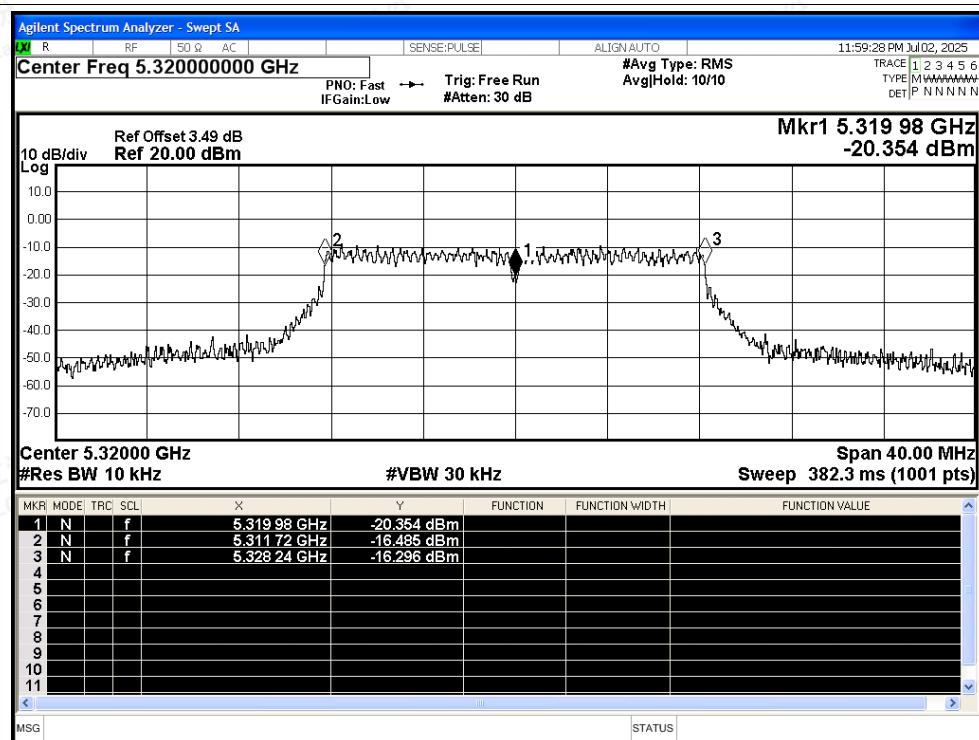

Freq. Stability NVNT n20 5260MHz Ant3

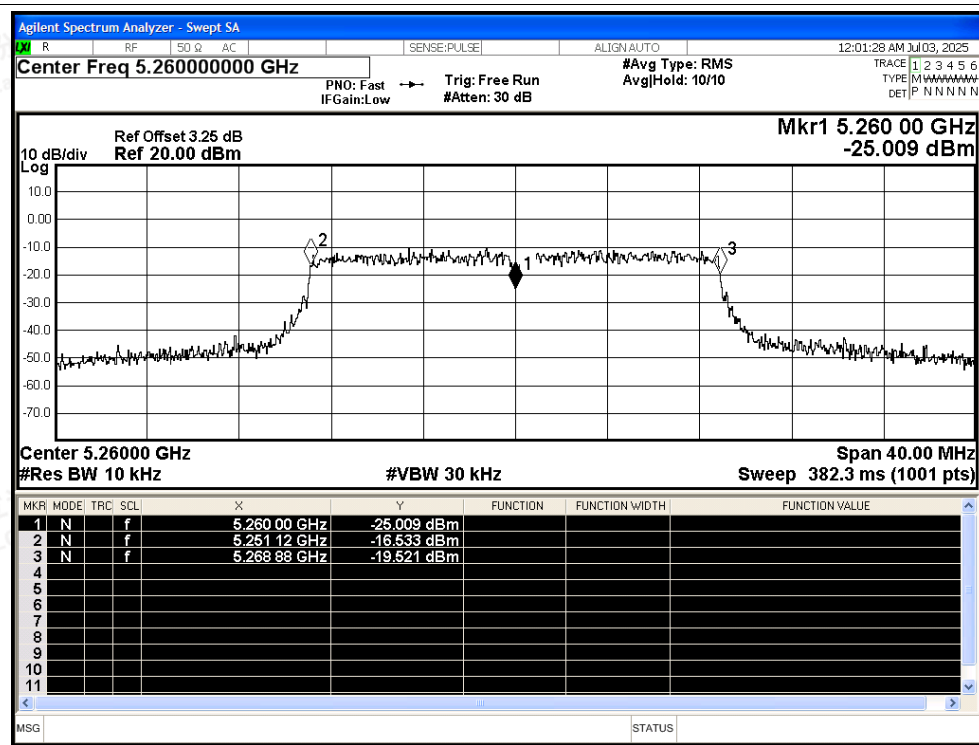

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant3

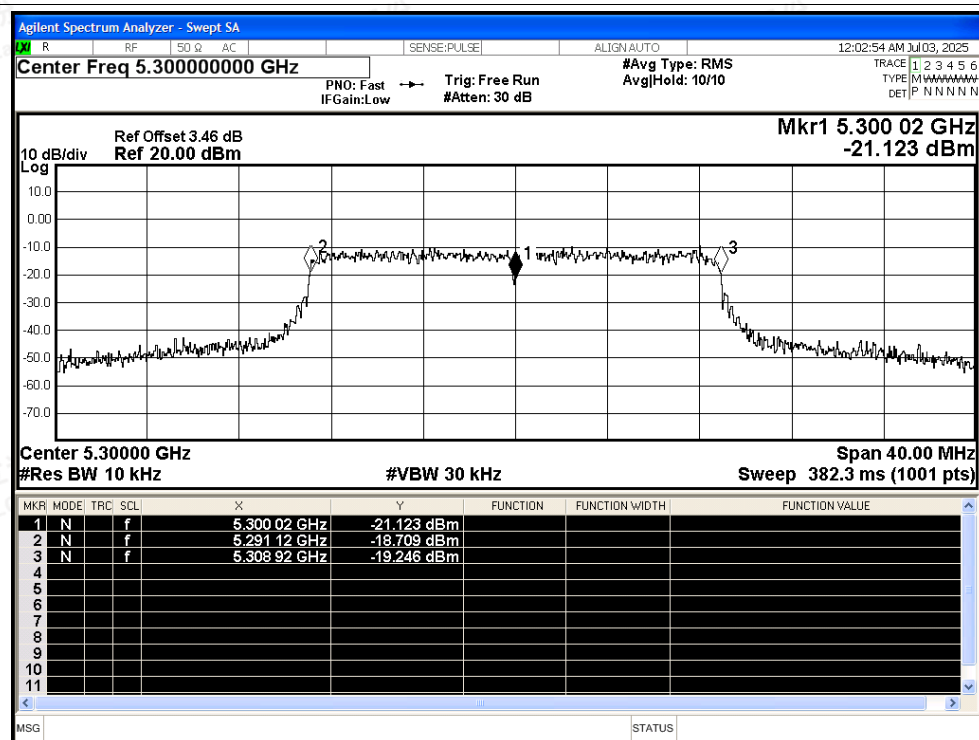

Freq. Stability NVNT n20 5320MHz Ant3

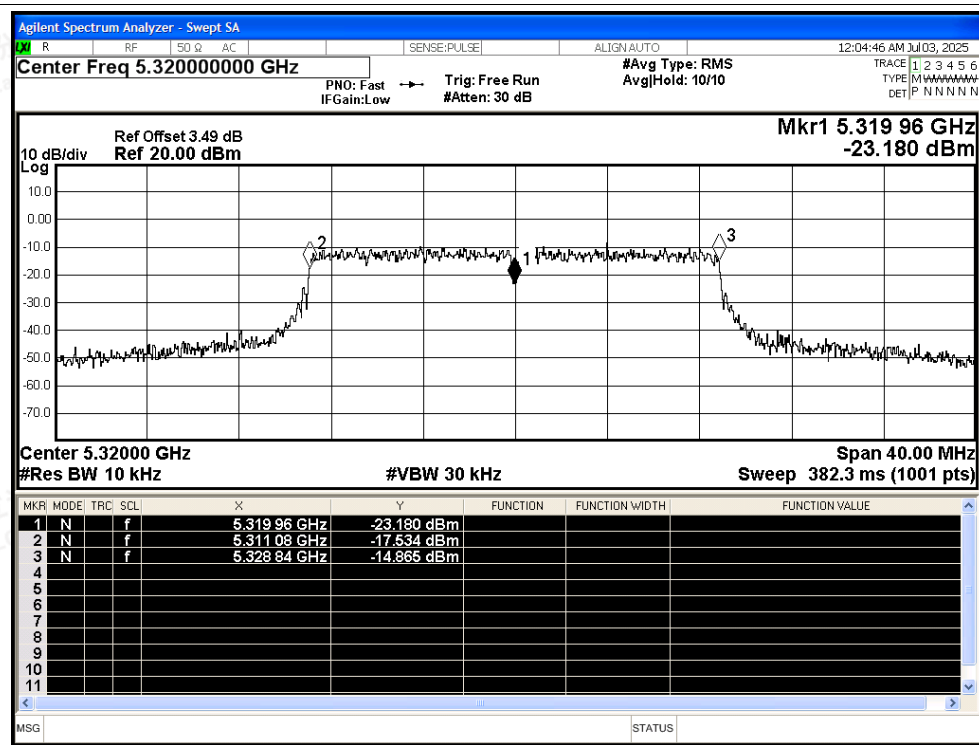

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant3

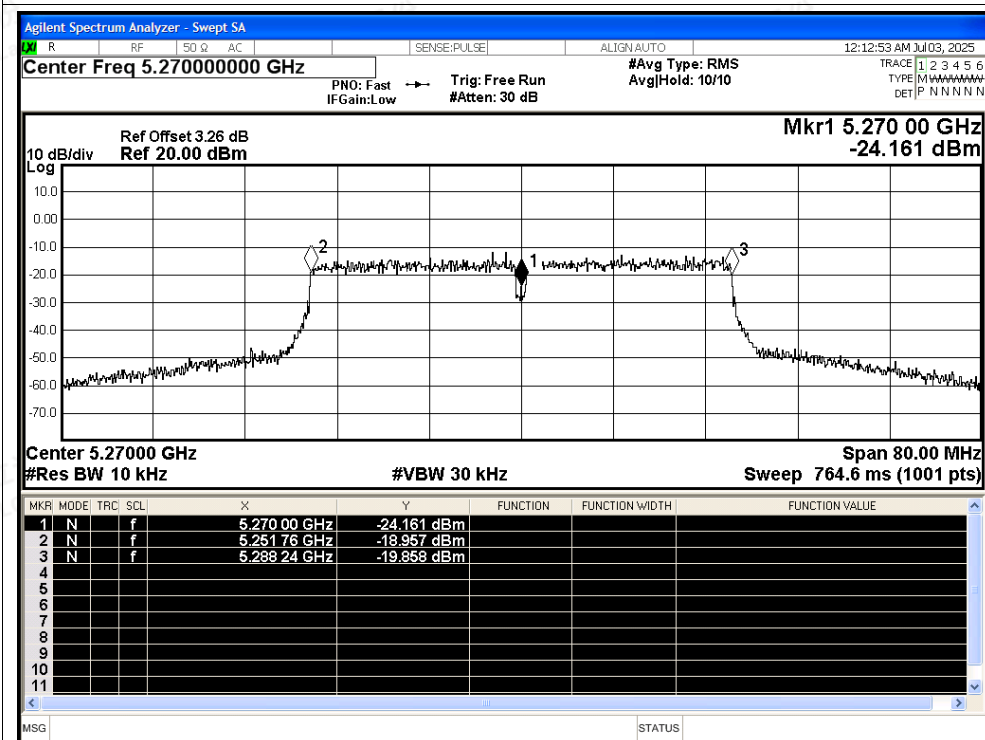

Freq. Stability NVNT n40 5310MHz Ant3

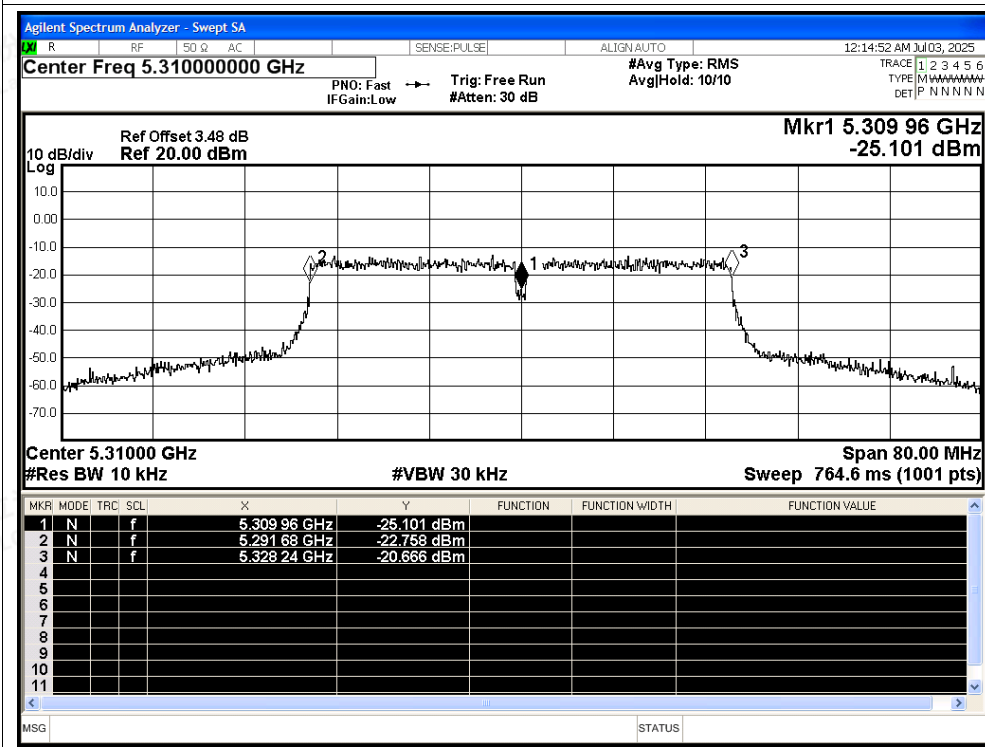

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant3

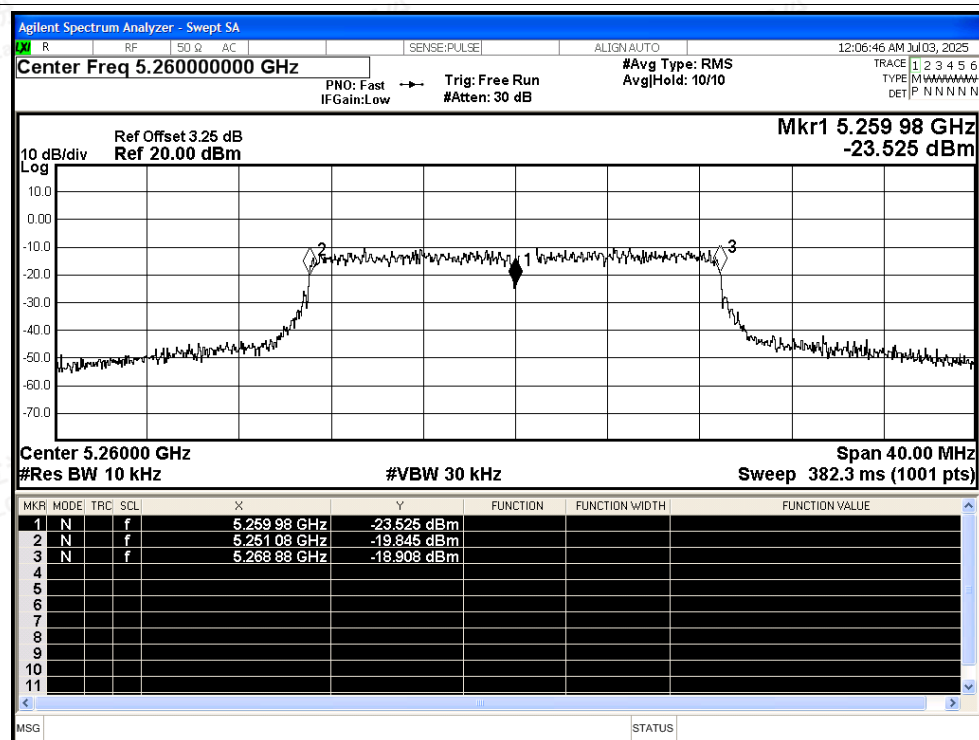

Freq. Stability NVNT ac20 5300MHz Ant3

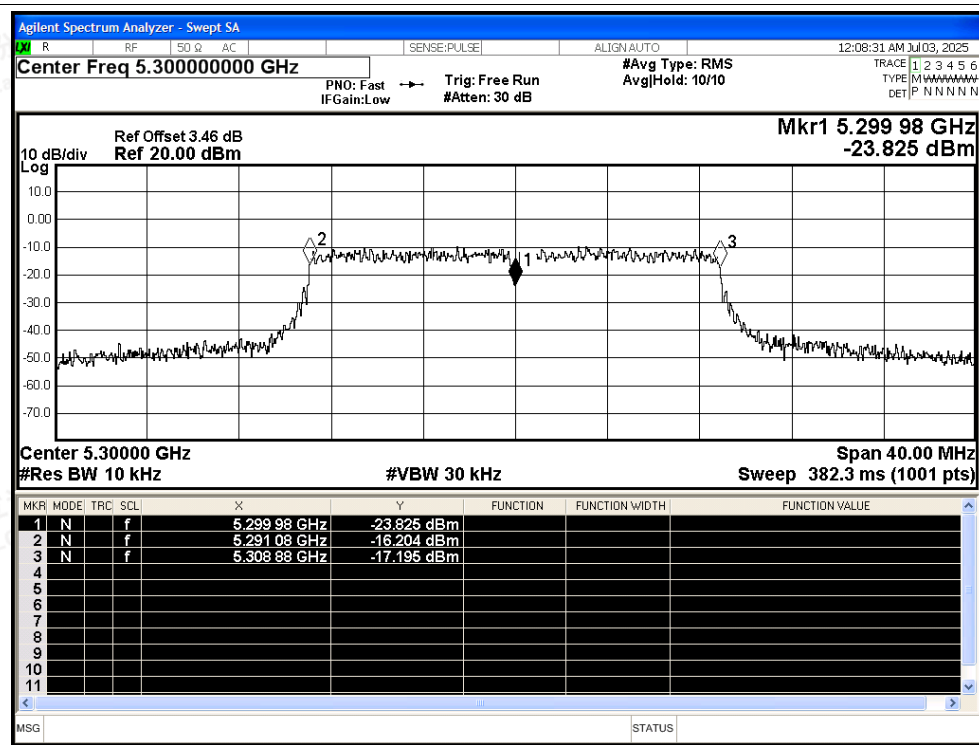

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant3

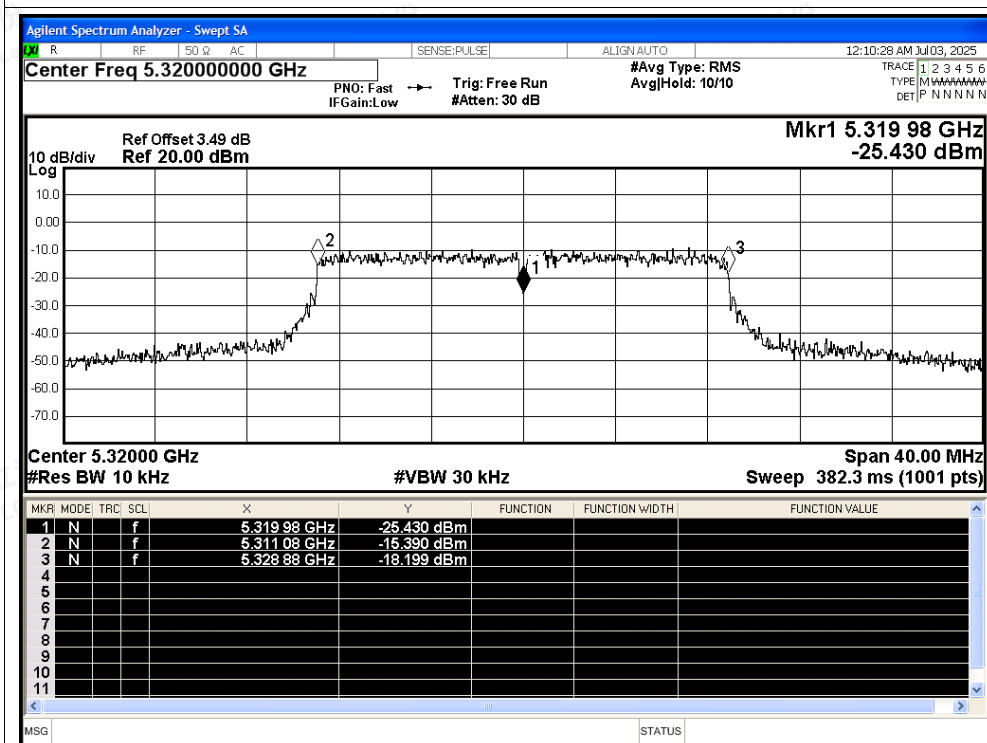

Freq. Stability NVNT ac40 5270MHz Ant3

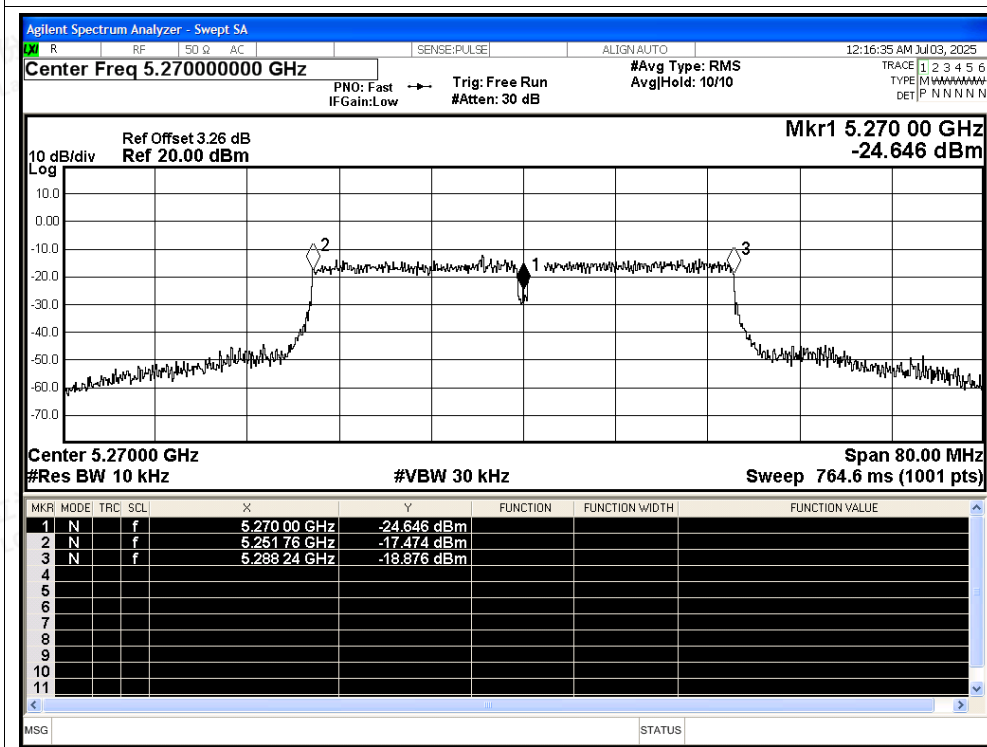

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant3

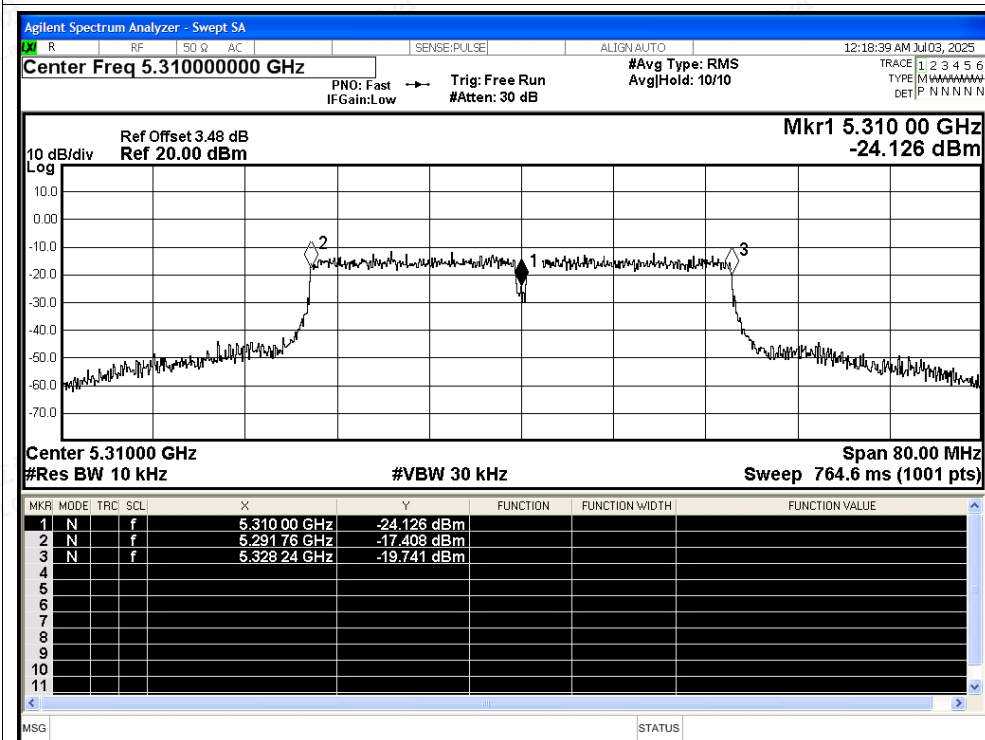

Freq. Stability NVNT ac80 5290MHz Ant3

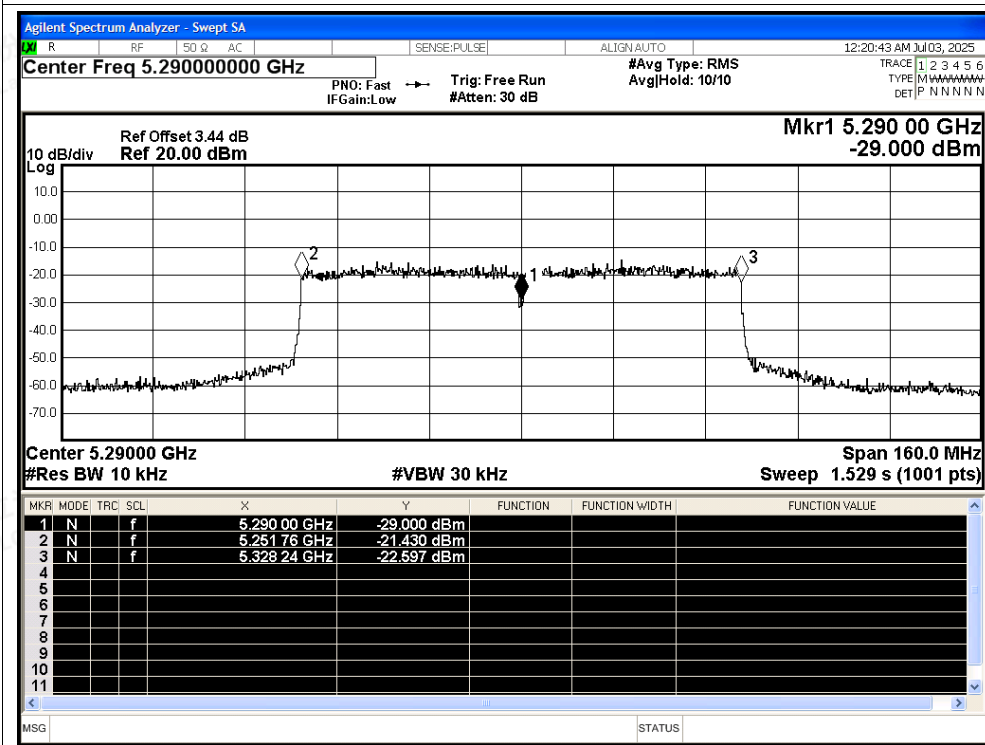

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant3

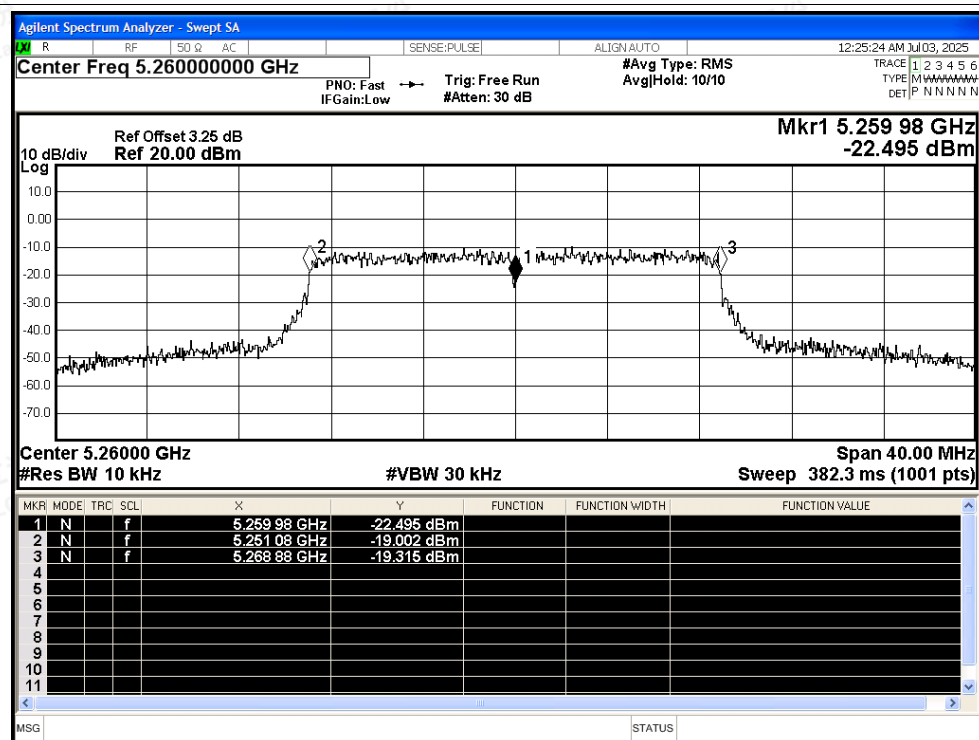

Freq. Stability NVNT ax20 5300MHz Ant3

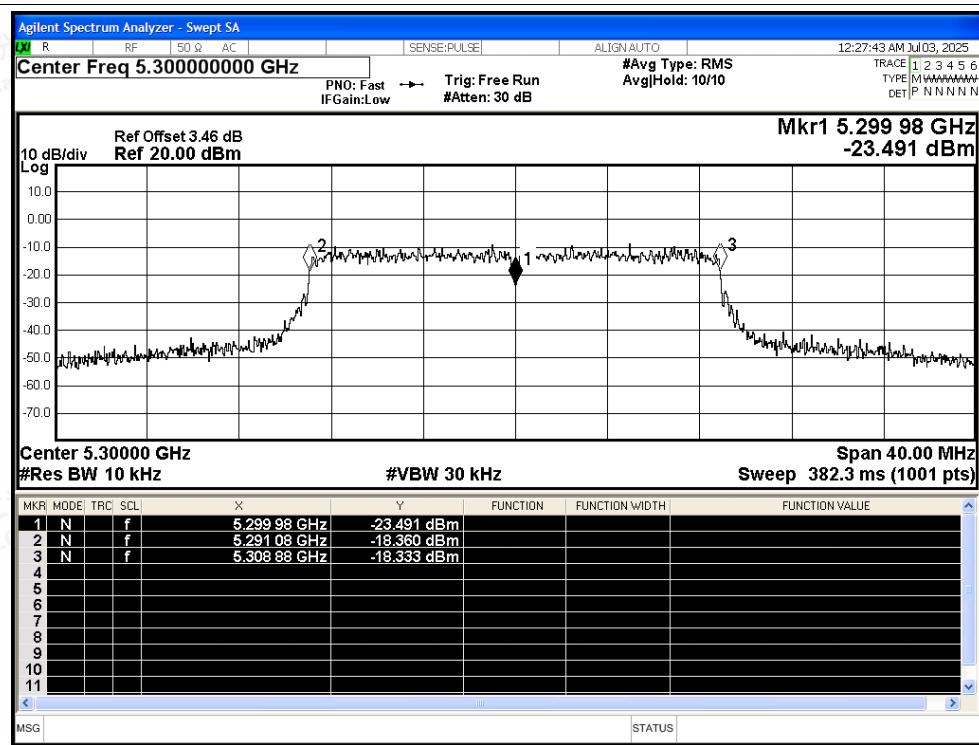

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant3

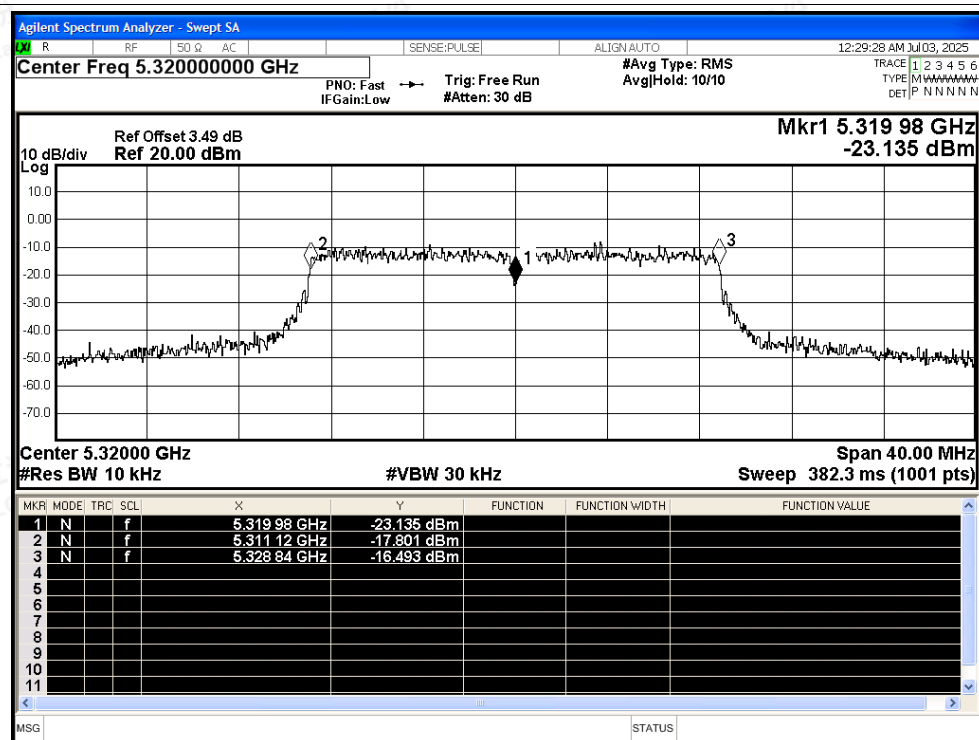

Freq. Stability NVNT ax40 5270MHz Ant3

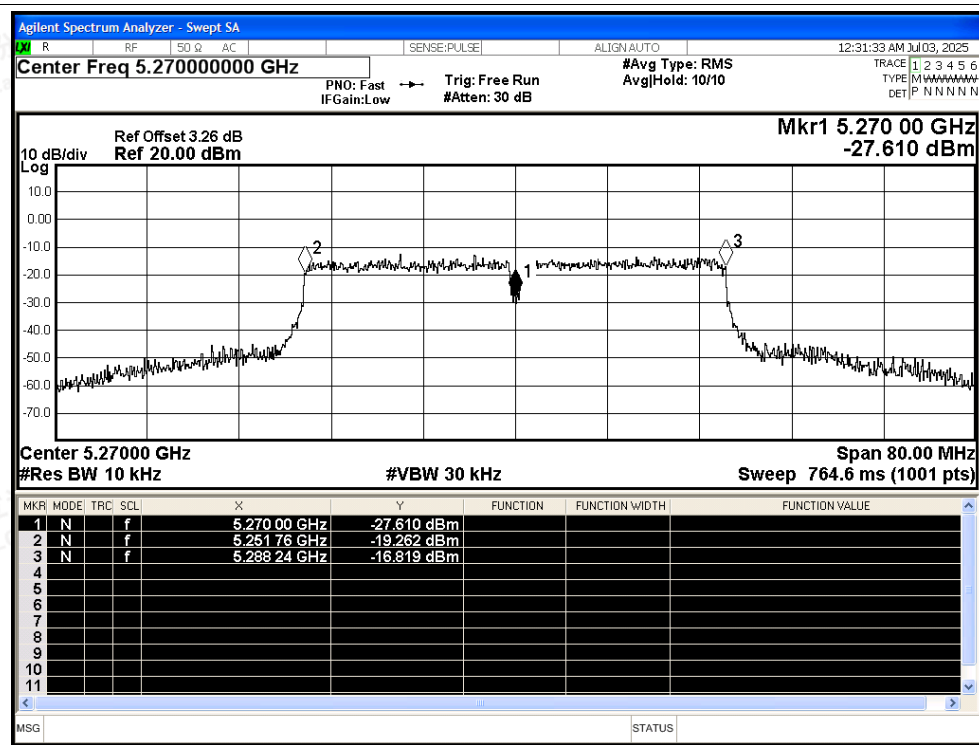

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant3

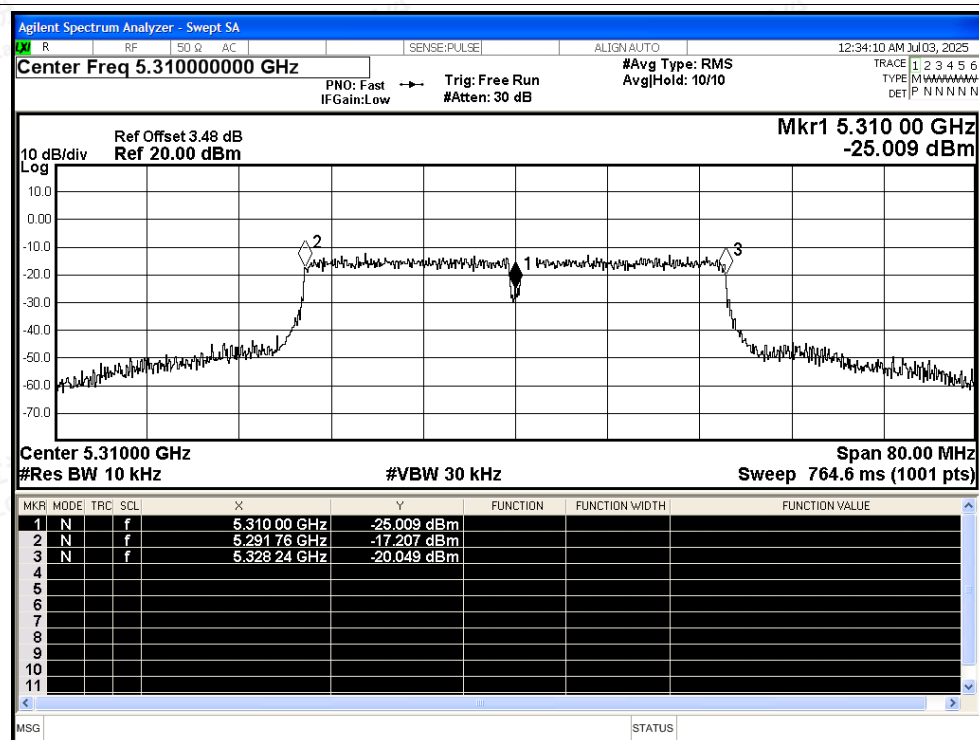

Freq. Stability NVNT ax80 5290MHz Ant3

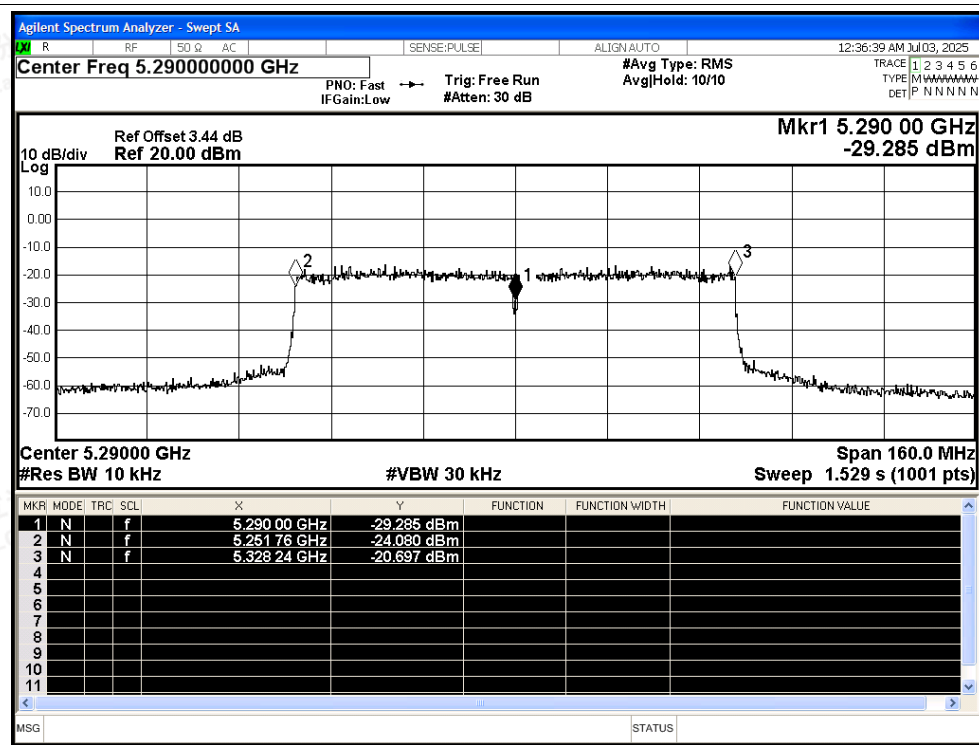

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant5	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant5	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant5	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant5	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant5	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant5	5319.96	-40000	-7.52	25	Pass
NVNT	n40	5270	Ant5	5270	0	0	25	Pass
NVNT	n40	5310	Ant5	5310	0	0	25	Pass
NVNT	ac20	5260	Ant5	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5300	Ant5	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant5	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant5	5270	0	0	25	Pass
NVNT	ac40	5310	Ant5	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant5	5290	0	0	25	Pass
NVNT	ax20	5260	Ant5	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant5	5299.98	-20000	-3.77	25	Pass
NVNT	ax20	5320	Ant5	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant5	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant5	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant5	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant5

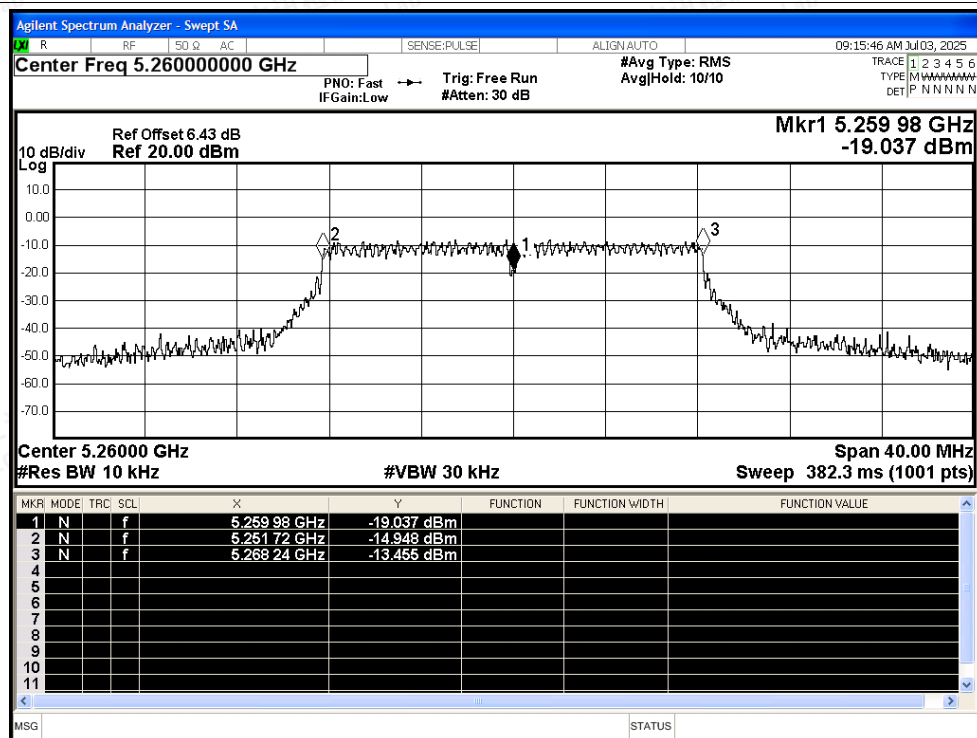

Freq. Stability NVNT a 5300MHz Ant5

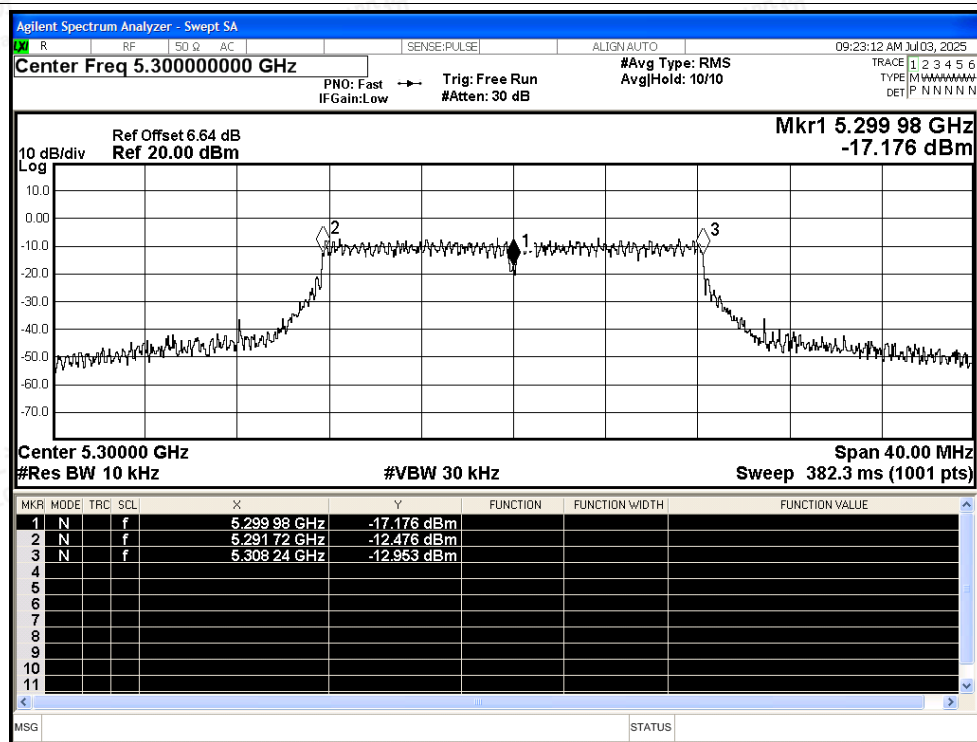

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant5

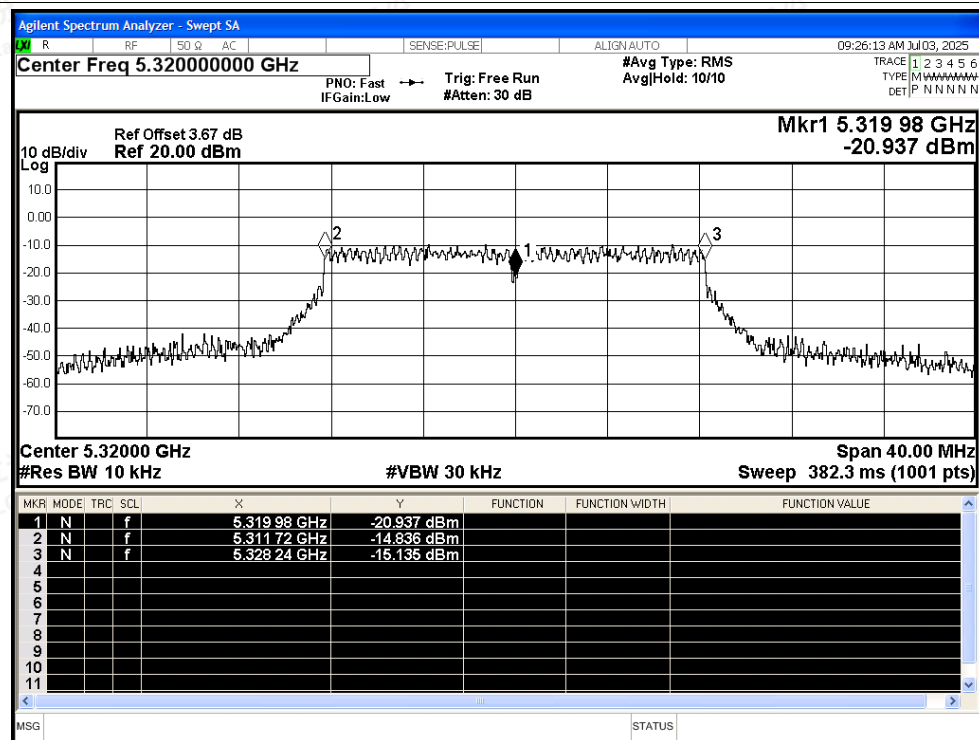


Freq. Stability NVNT n20 5260MHz Ant5

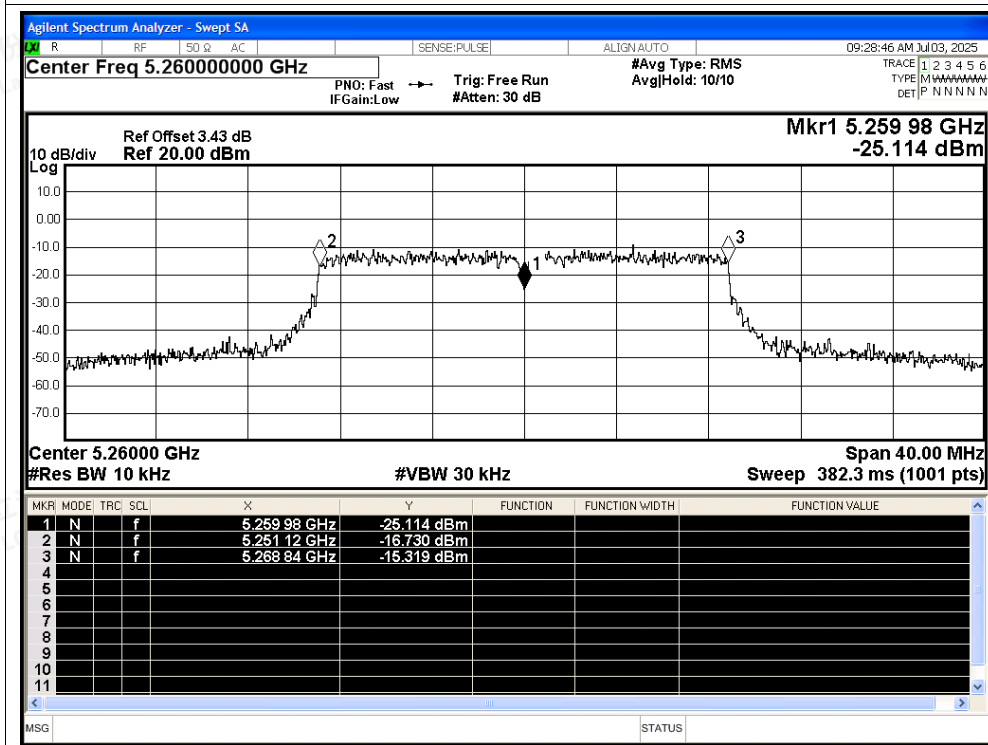




Freq. Stability NVNT n20 5300MHz Ant5

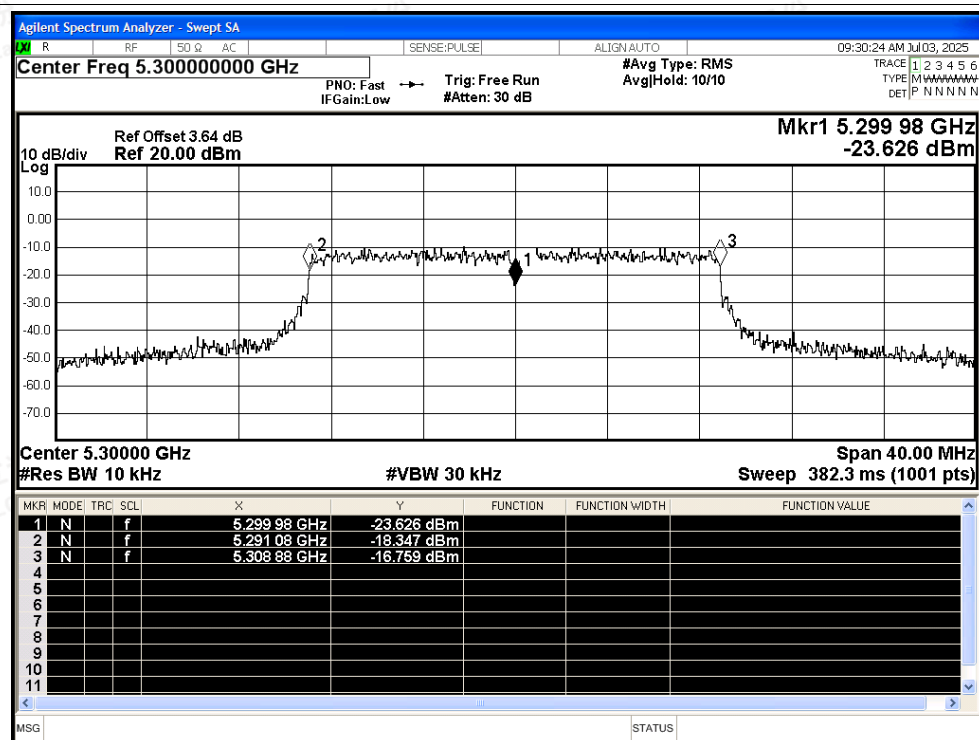

Freq. Stability NVNT n20 5320MHz Ant5

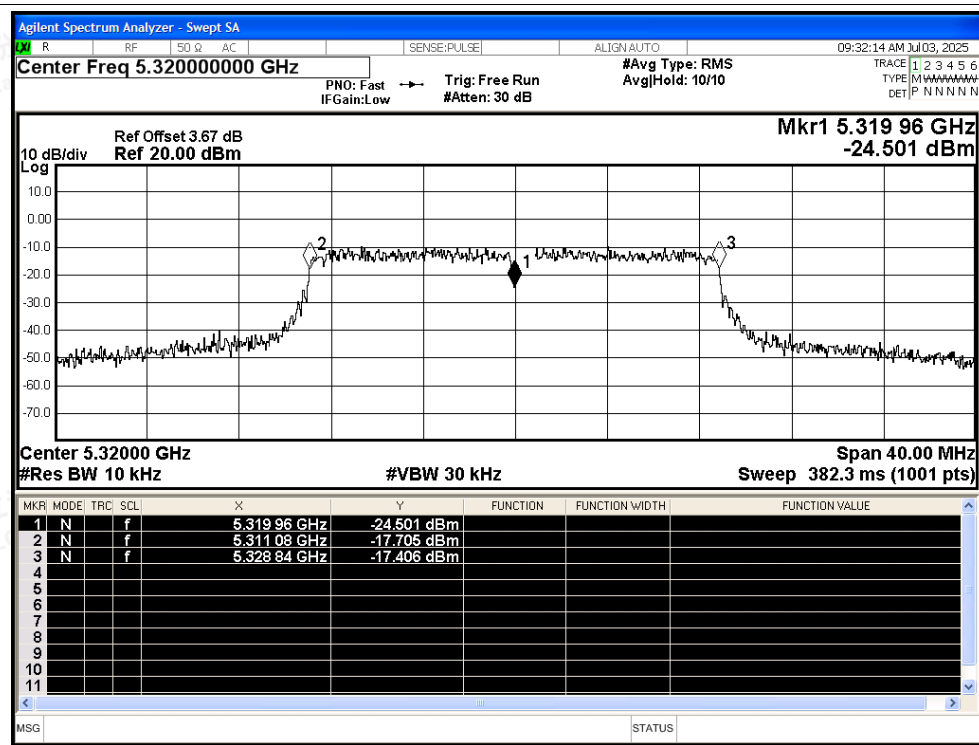

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant5

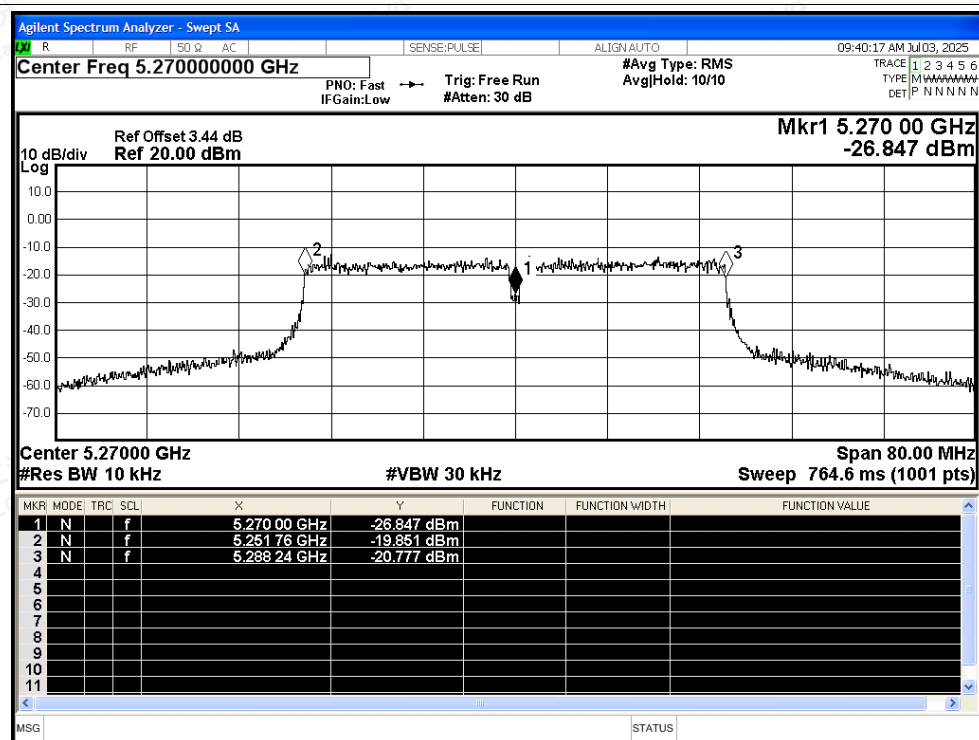

Freq. Stability NVNT n40 5310MHz Ant5

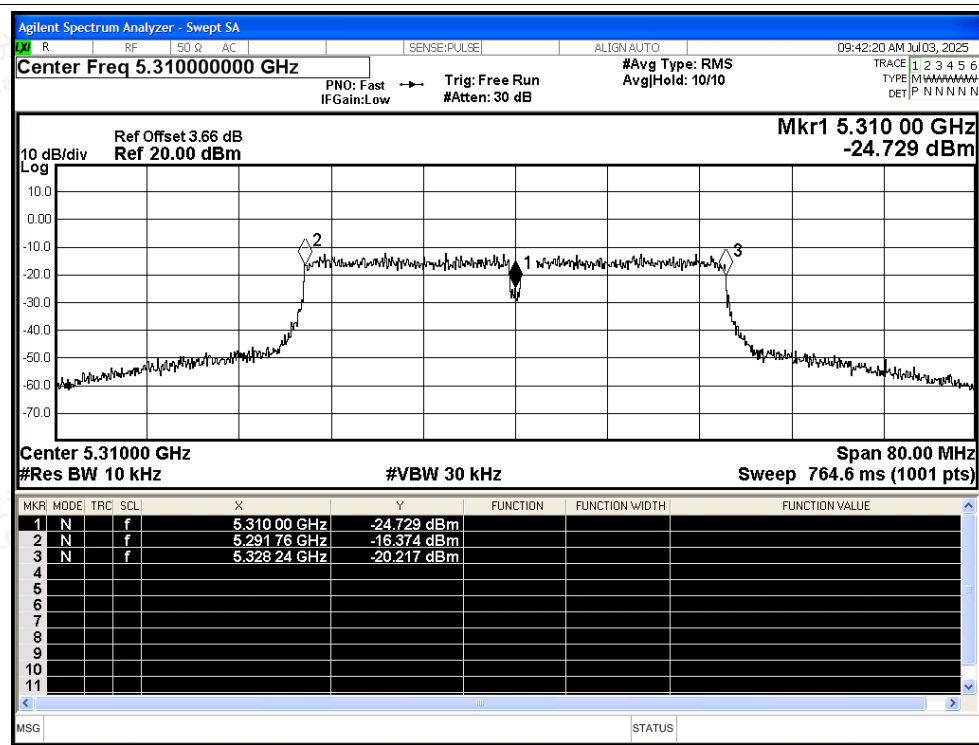

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant5

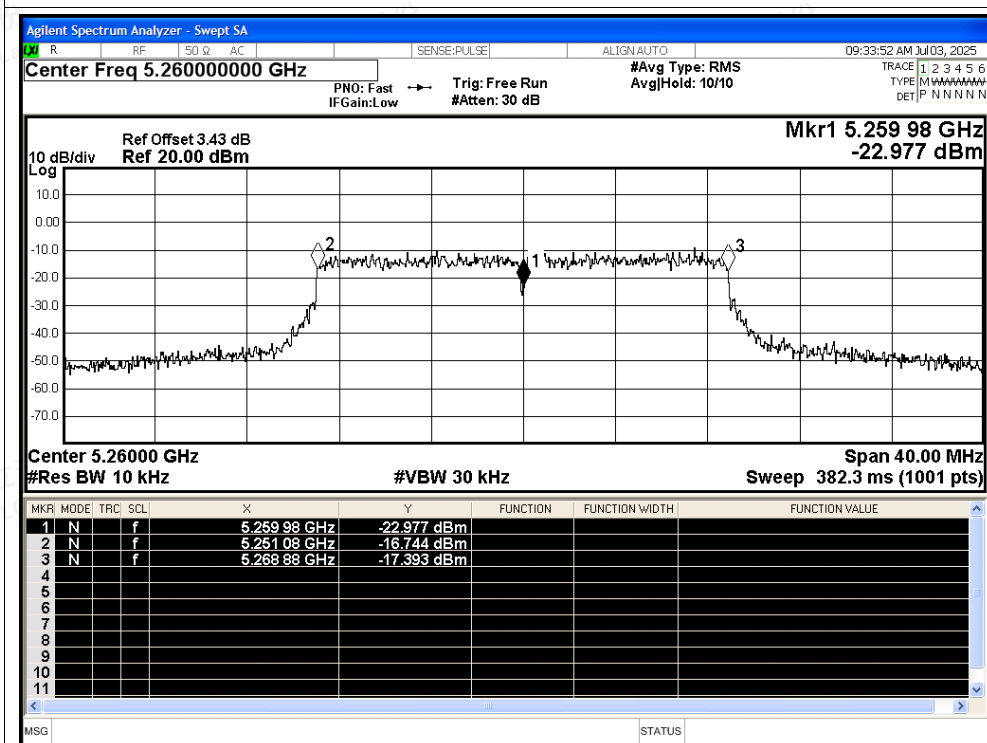

Freq. Stability NVNT ac20 5300MHz Ant5

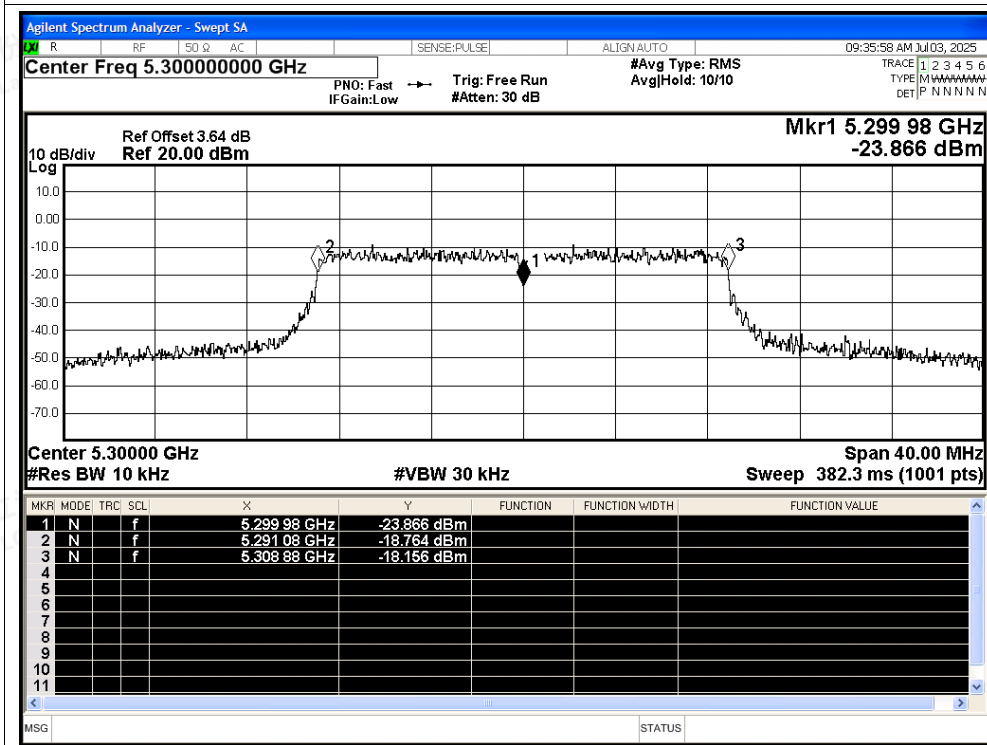

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant5

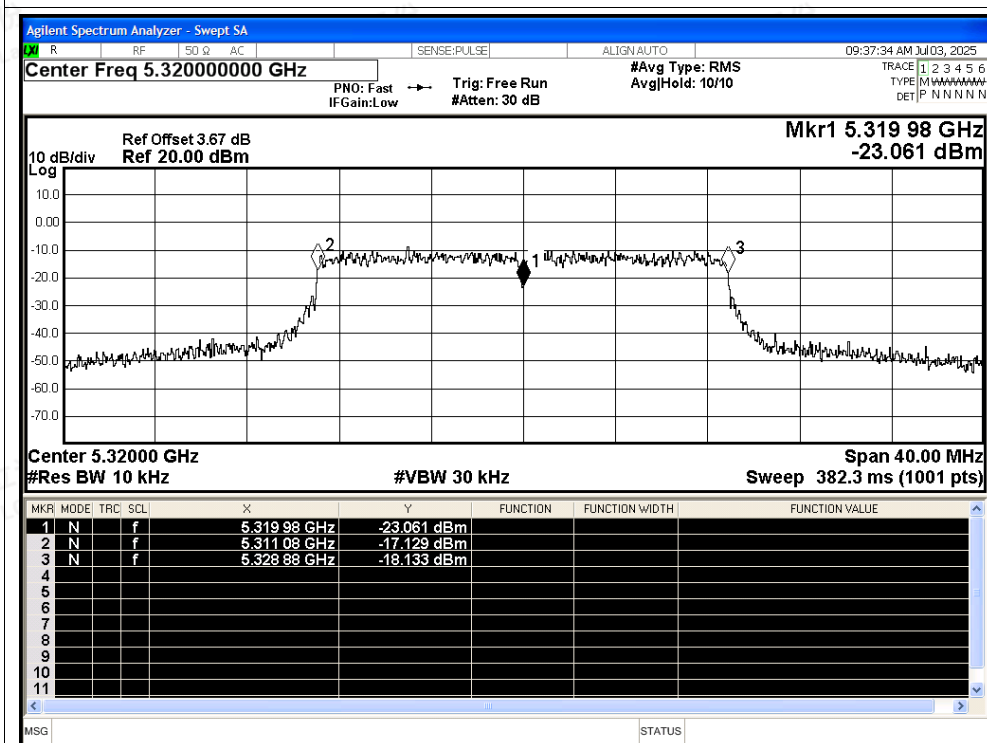

Freq. Stability NVNT ac40 5270MHz Ant5

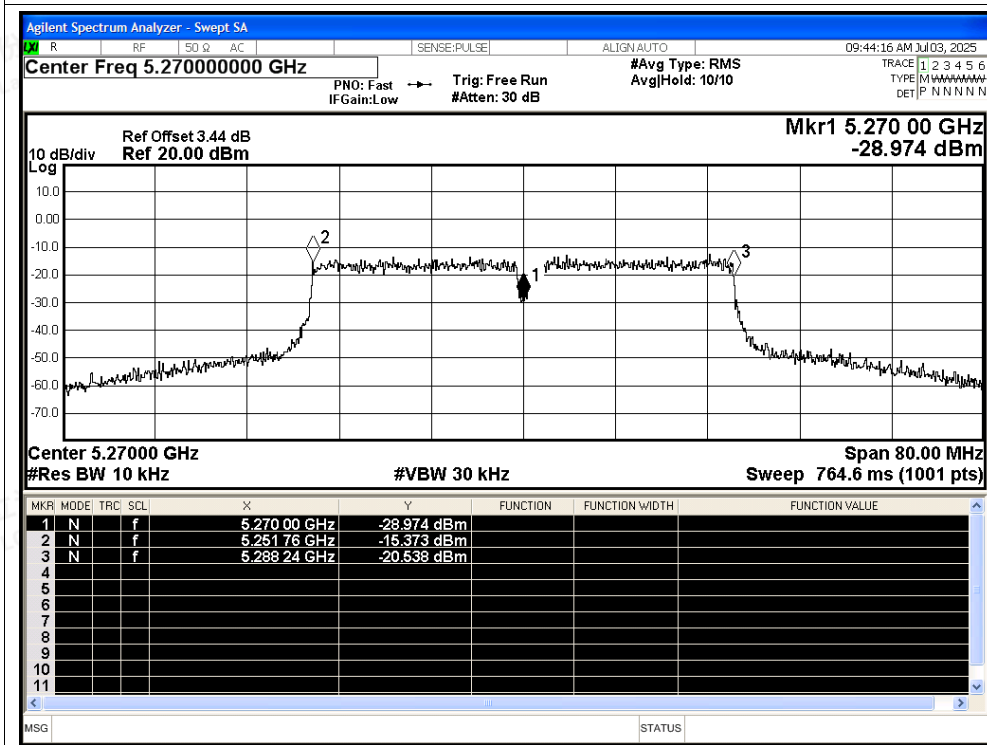

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant5

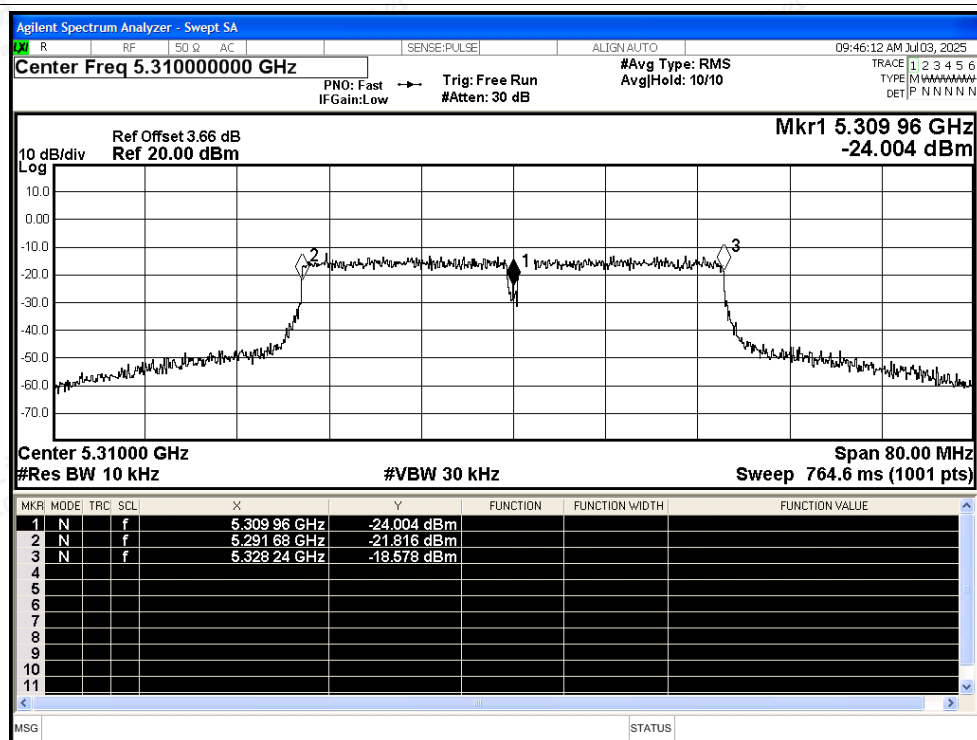

Freq. Stability NVNT ac80 5290MHz Ant5

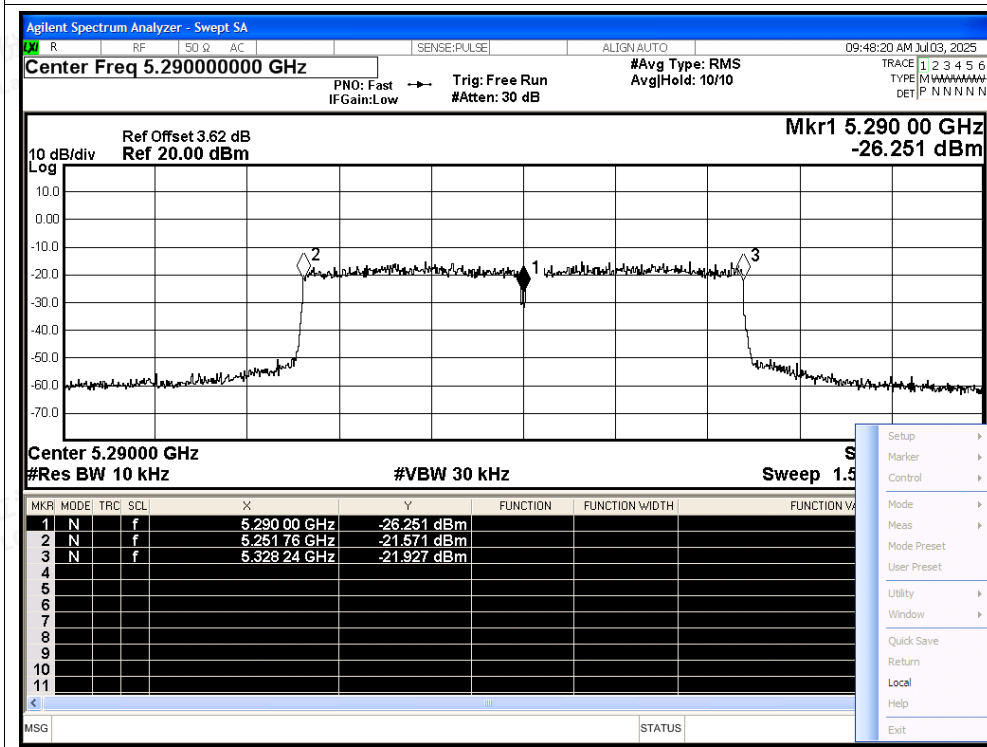

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant5

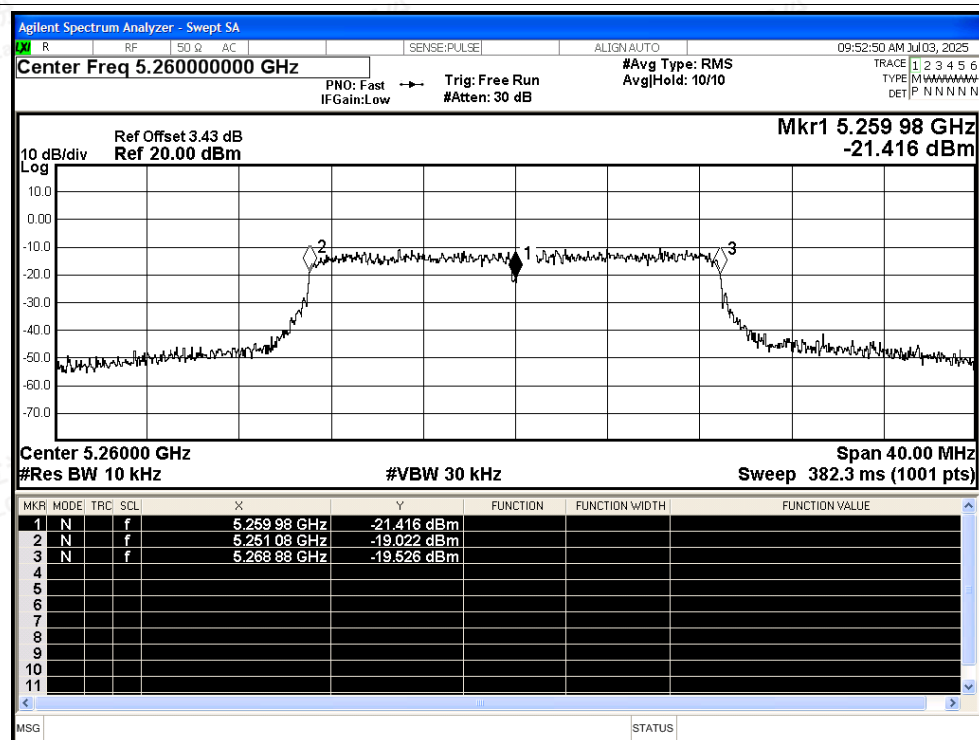

Freq. Stability NVNT ax20 5300MHz Ant5

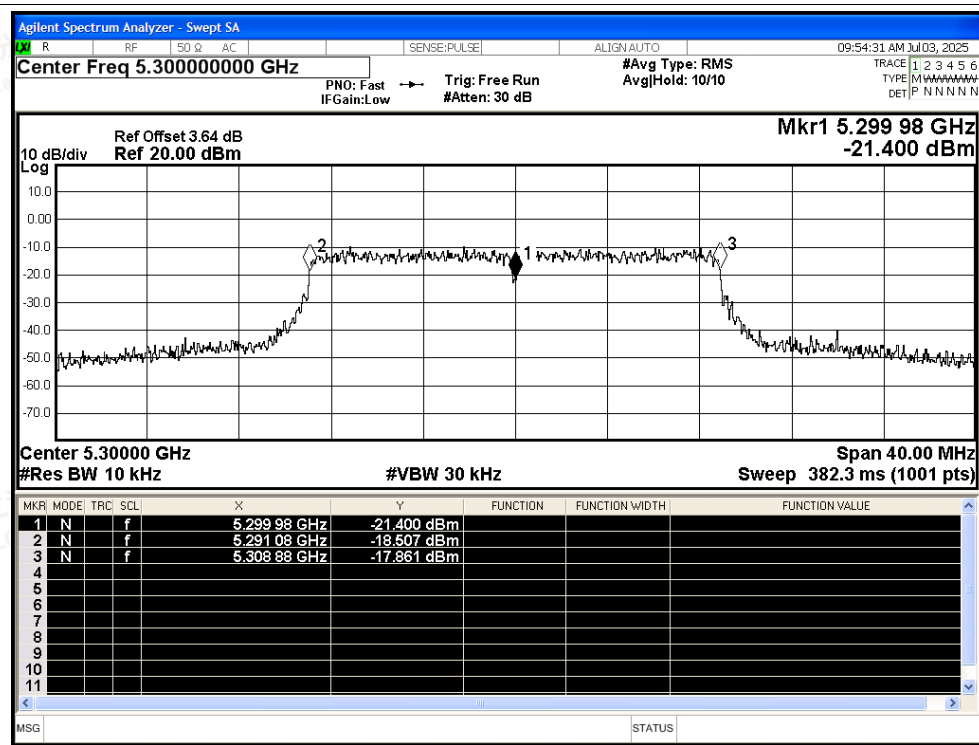

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant5

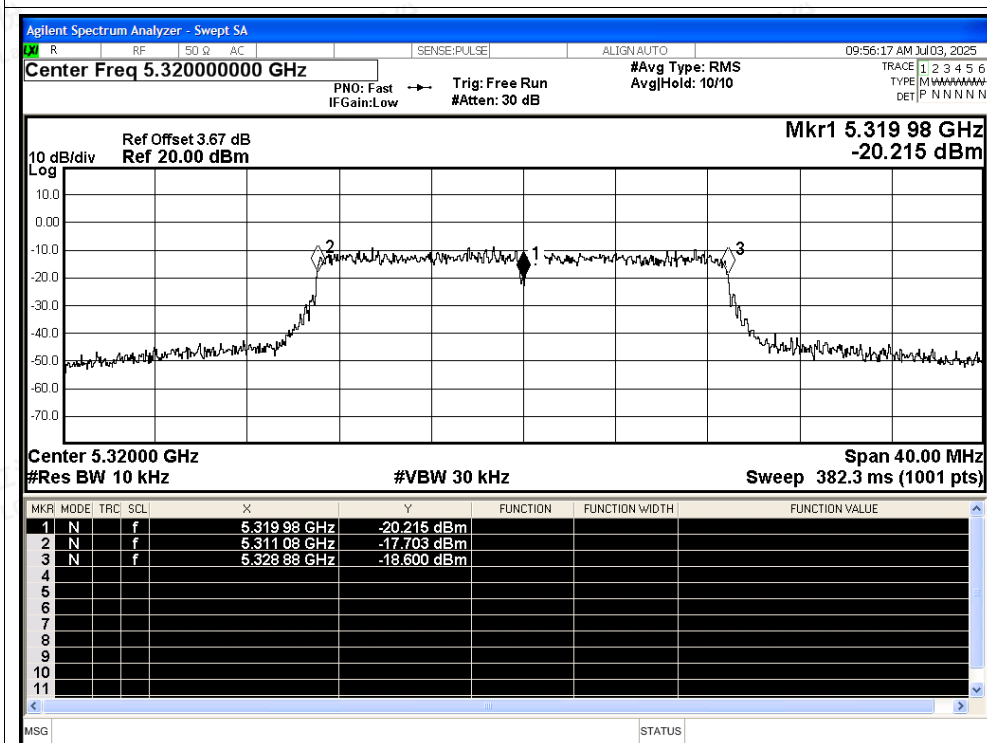

Freq. Stability NVNT ax40 5270MHz Ant5

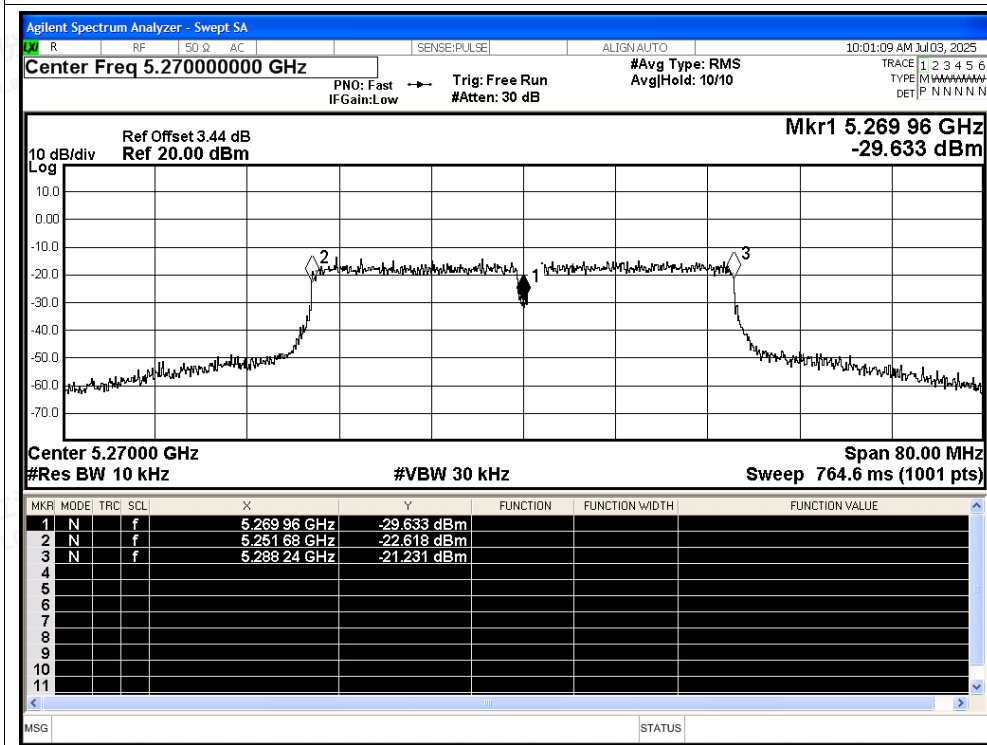

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant5

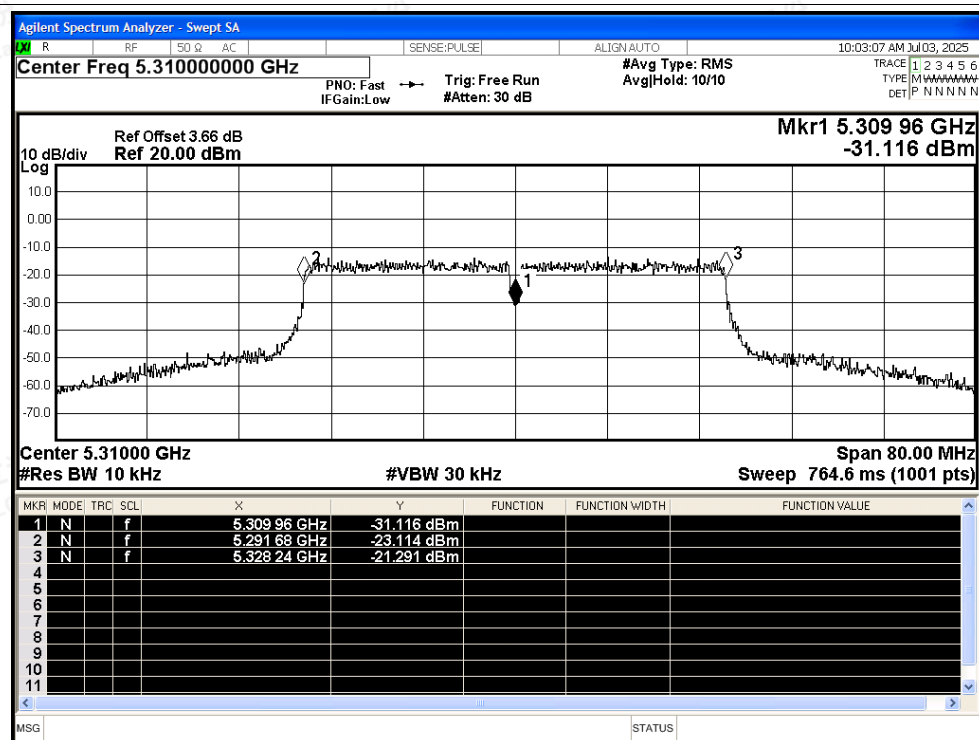

Freq. Stability NVNT ax80 5290MHz Ant5

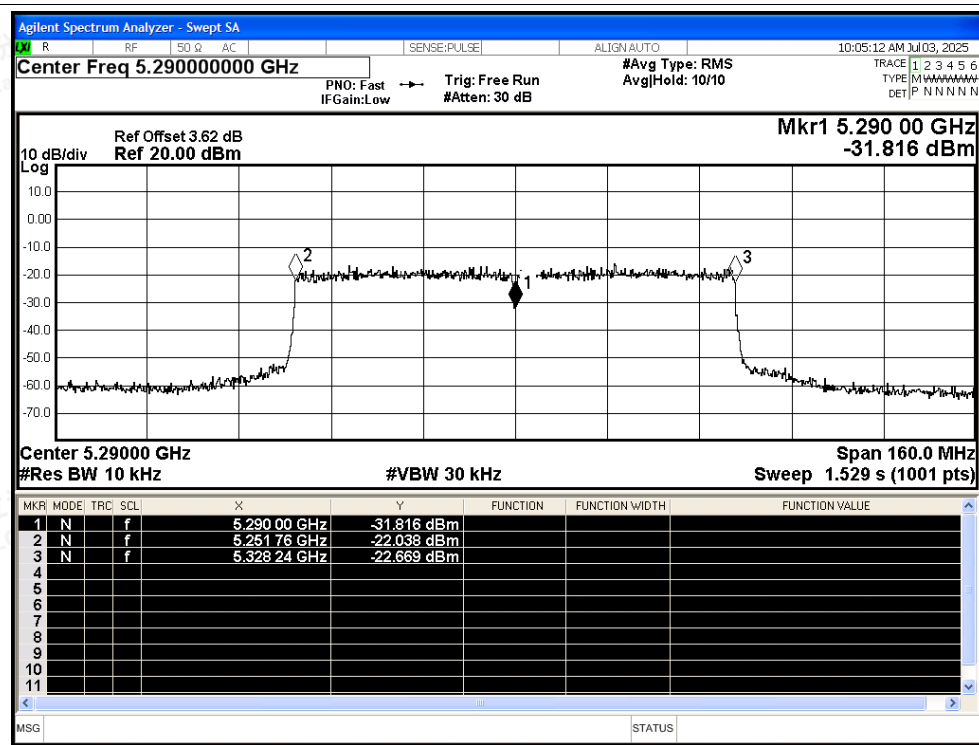

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant6	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant6	5300	0	0	25	Pass
NVNT	a	5320	Ant6	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant6	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant6	5300	0	0	25	Pass
NVNT	n20	5320	Ant6	5319.96	-40000	-7.52	25	Pass
NVNT	n40	5270	Ant6	5270	0	0	25	Pass
NVNT	n40	5310	Ant6	5310	0	0	25	Pass
NVNT	ac20	5260	Ant6	5260	0	0	25	Pass
NVNT	ac20	5300	Ant6	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant6	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant6	5270	0	0	25	Pass
NVNT	ac40	5310	Ant6	5310	0	0	25	Pass
NVNT	ac80	5290	Ant6	5290	0	0	25	Pass
NVNT	ax20	5260	Ant6	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5300	Ant6	5299.96	-40000	-7.55	25	Pass
NVNT	ax20	5320	Ant6	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant6	5270	0	0	25	Pass
NVNT	ax40	5310	Ant6	5310	0	0	25	Pass
NVNT	ax80	5290	Ant6	5290	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant6

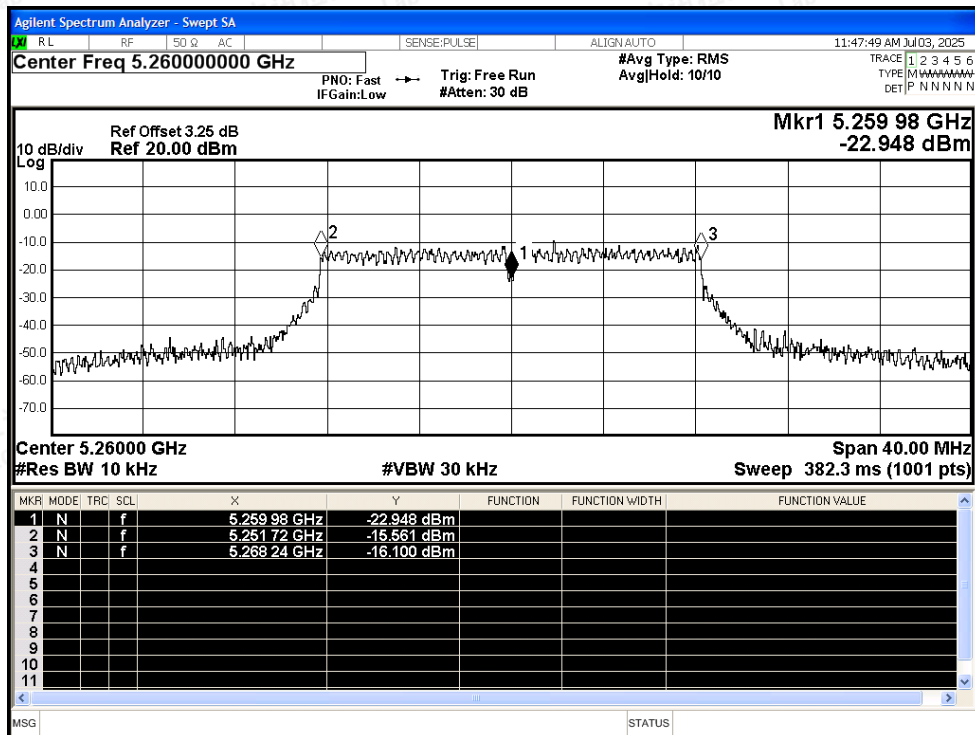

Freq. Stability NVNT a 5300MHz Ant6

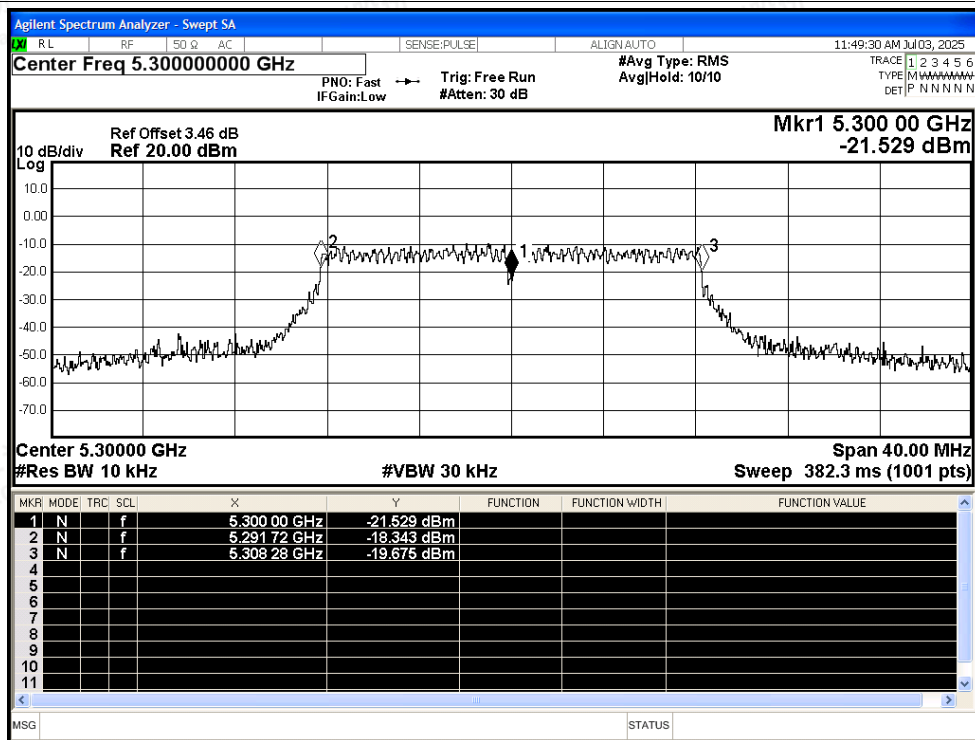

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant6

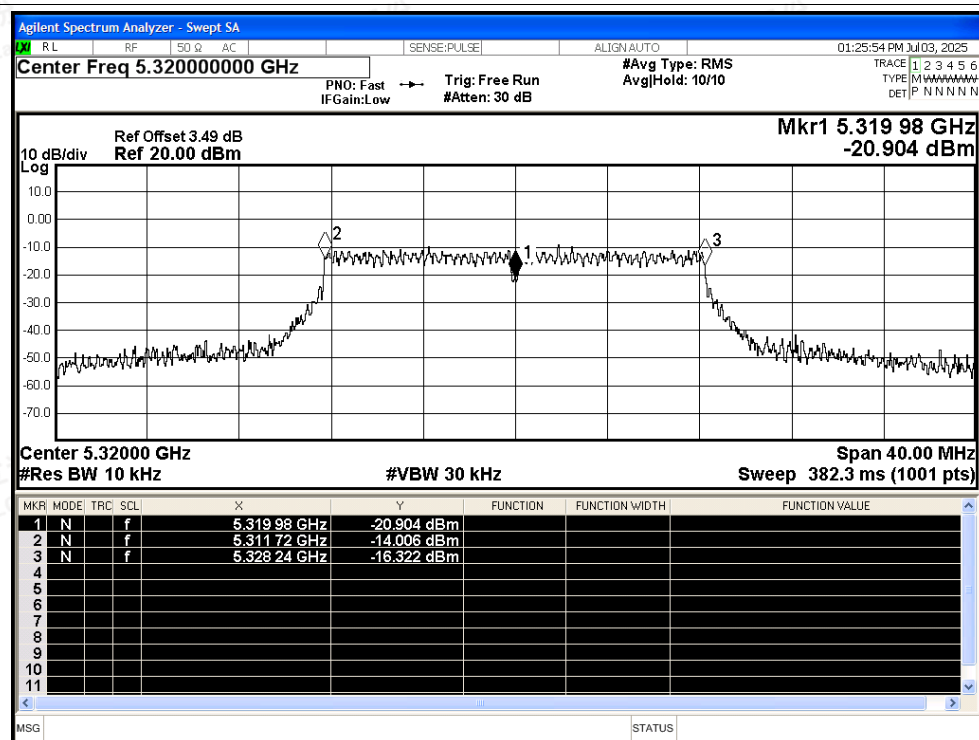

Freq. Stability NVNT n20 5260MHz Ant6

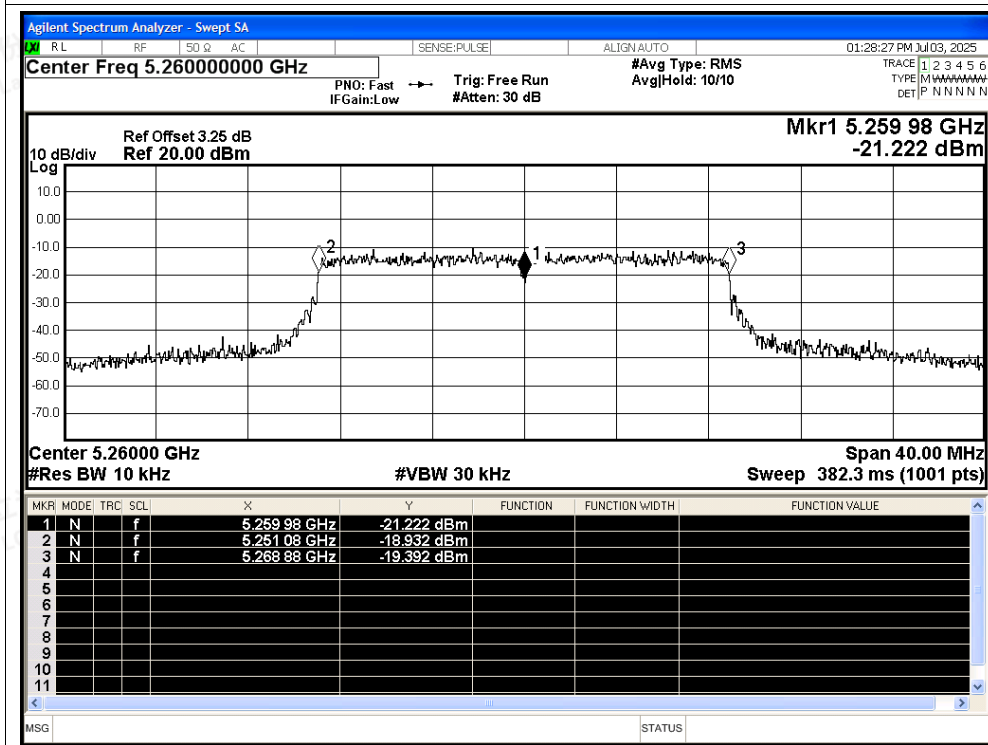

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant6

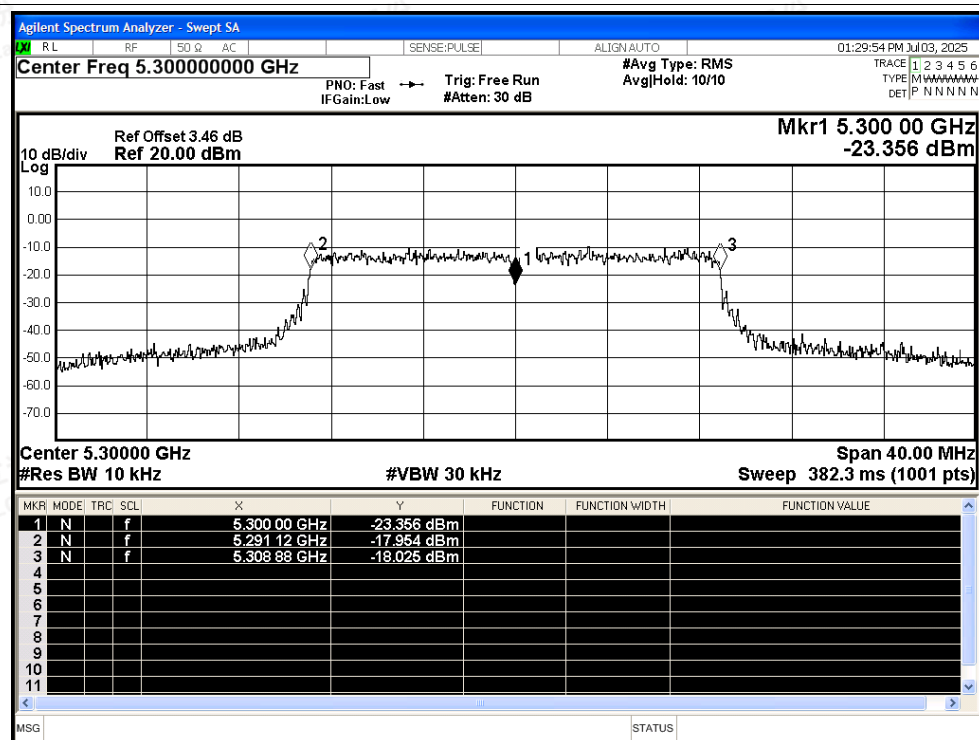

Freq. Stability NVNT n20 5320MHz Ant6

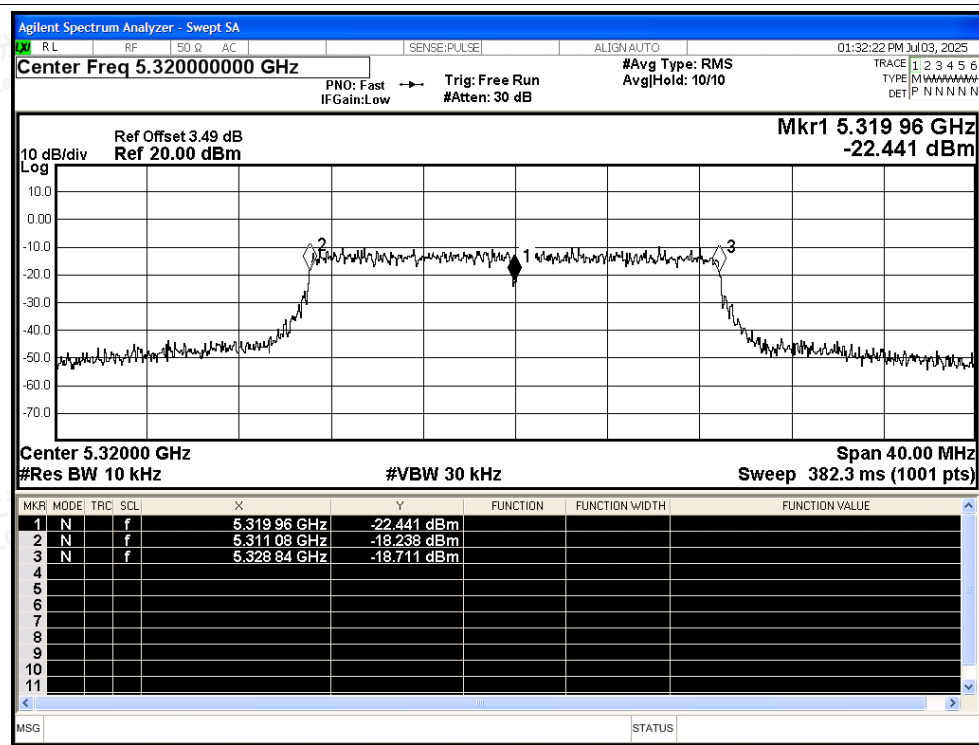

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant6

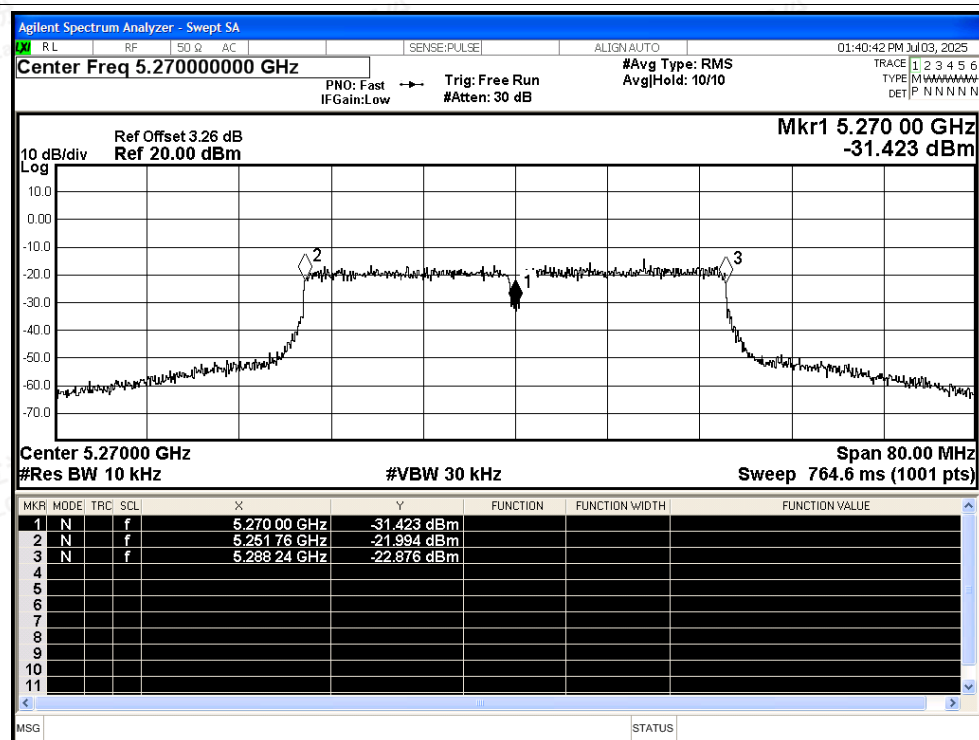

Freq. Stability NVNT n40 5310MHz Ant6

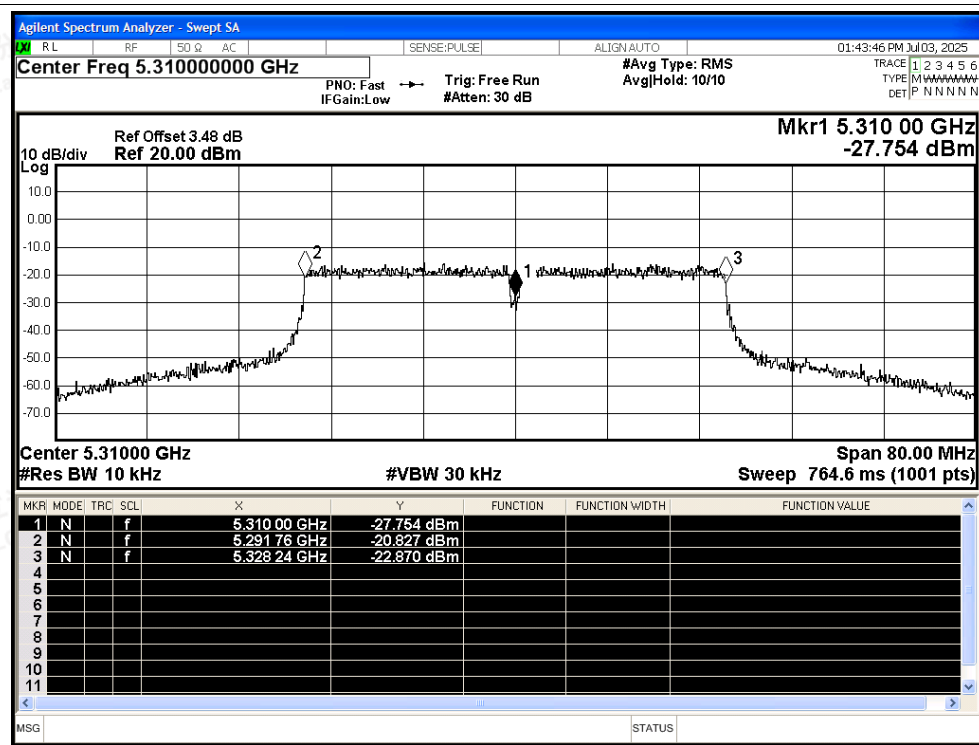

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant6

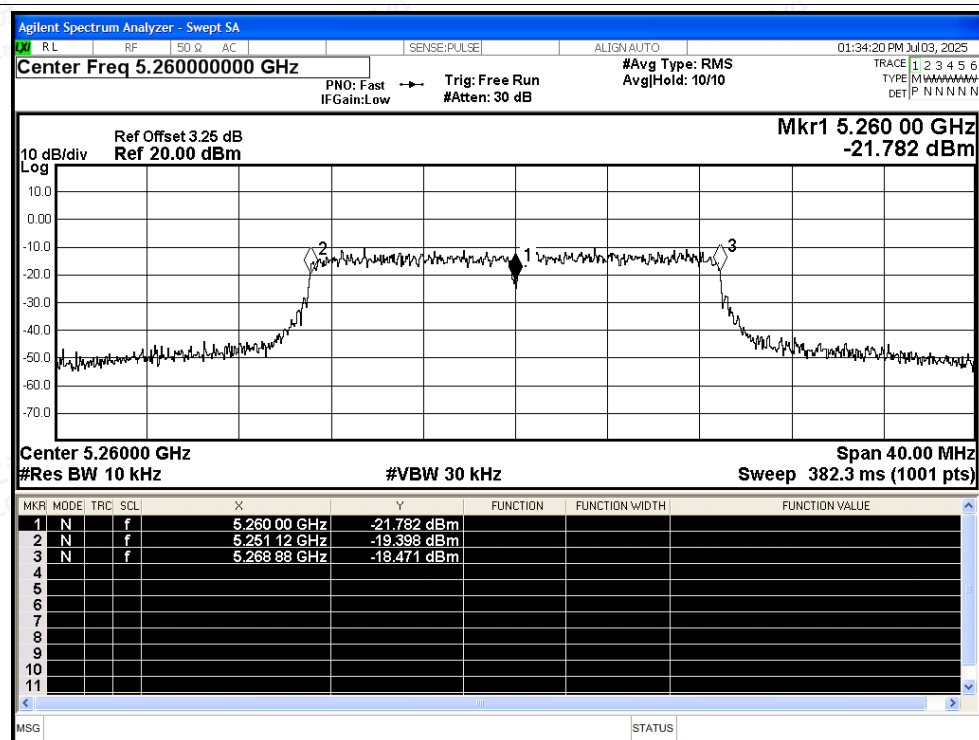

Freq. Stability NVNT ac20 5300MHz Ant6

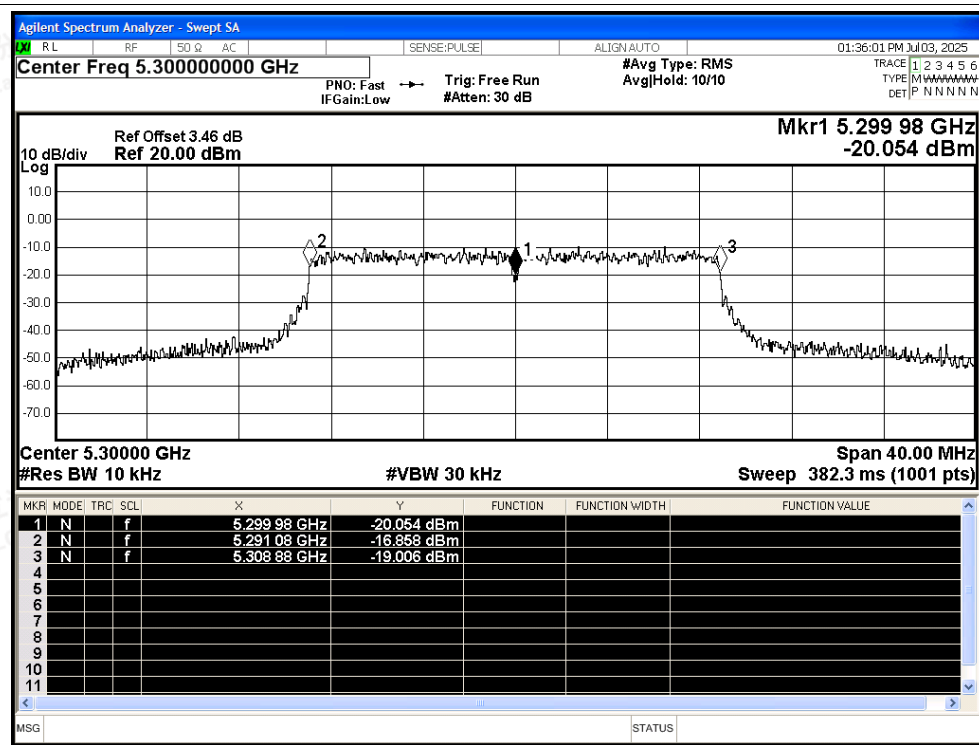

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant6

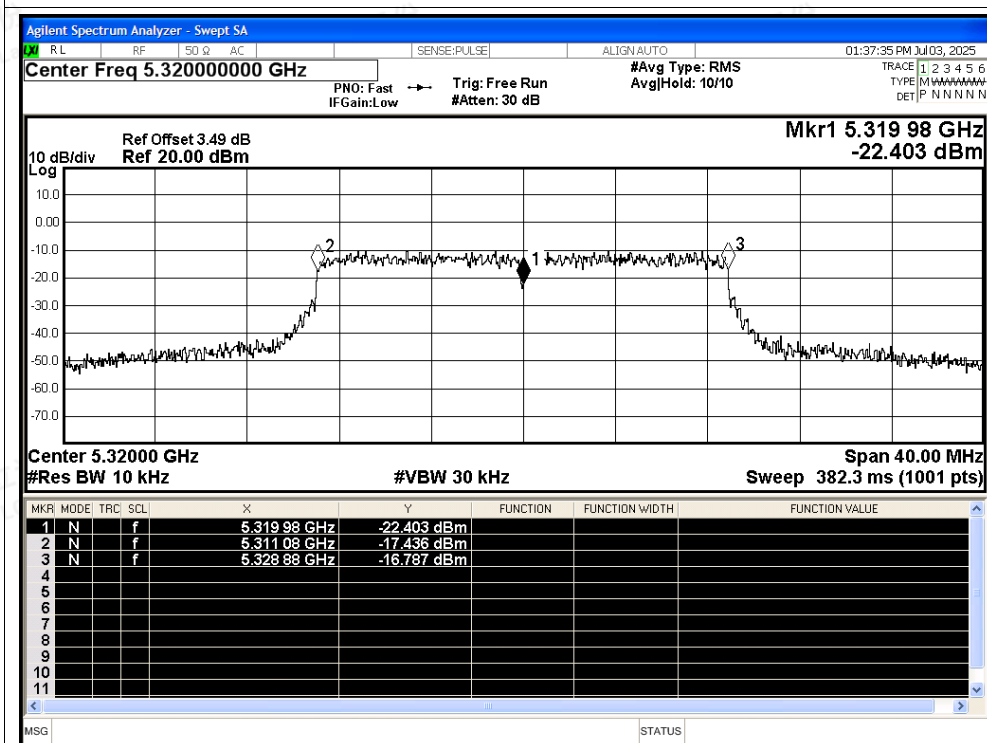

Freq. Stability NVNT ac40 5270MHz Ant6

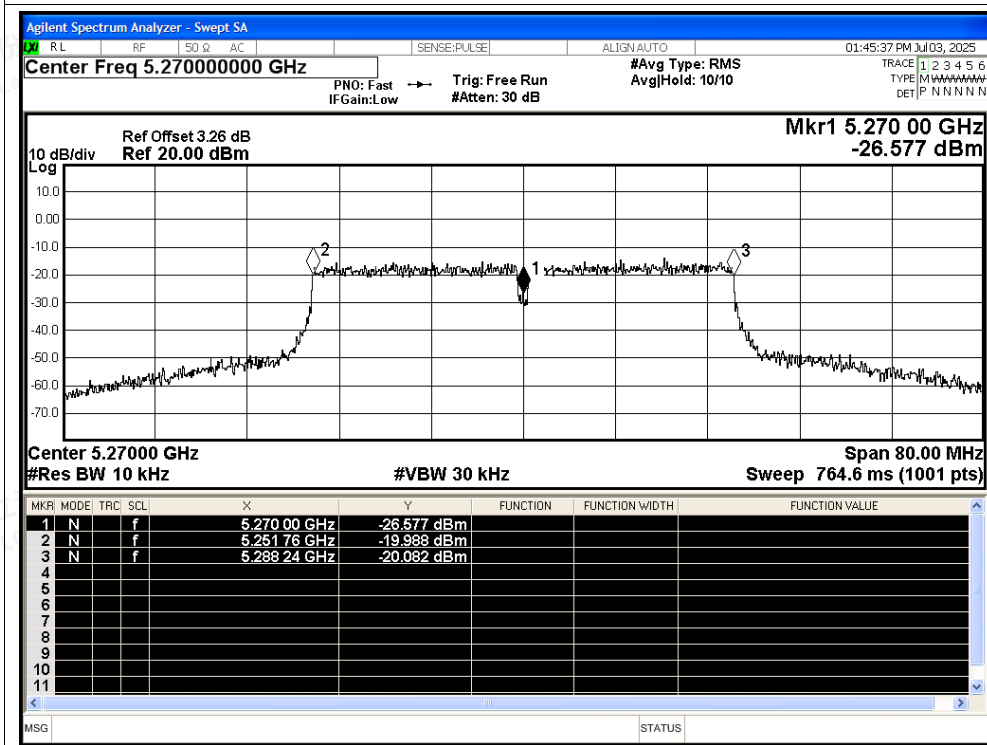

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant6

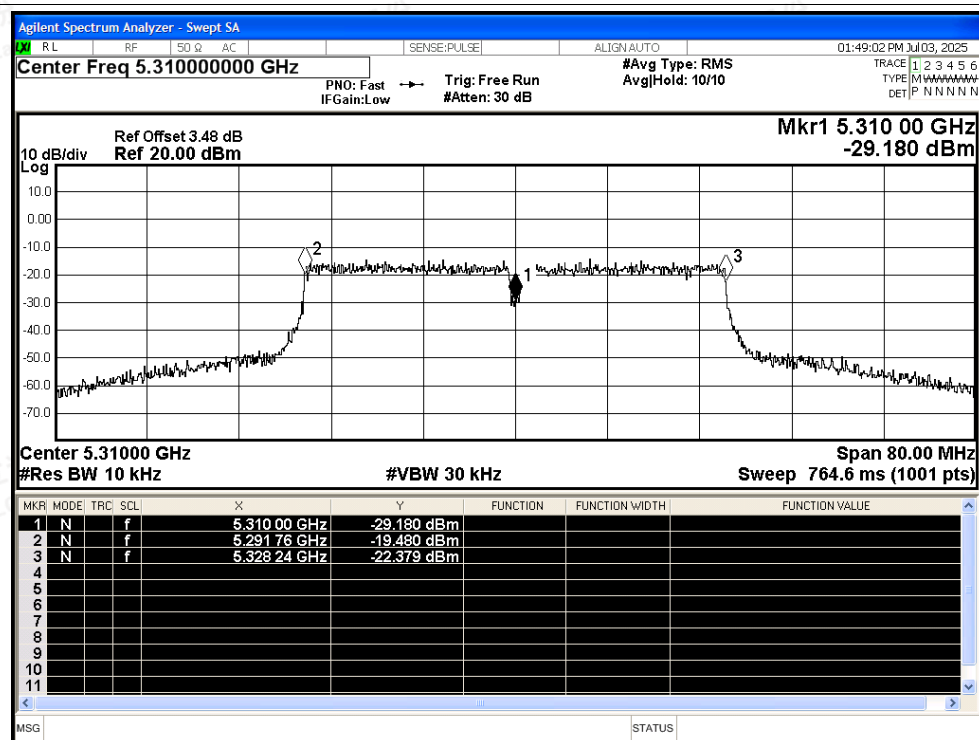

Freq. Stability NVNT ac80 5290MHz Ant6

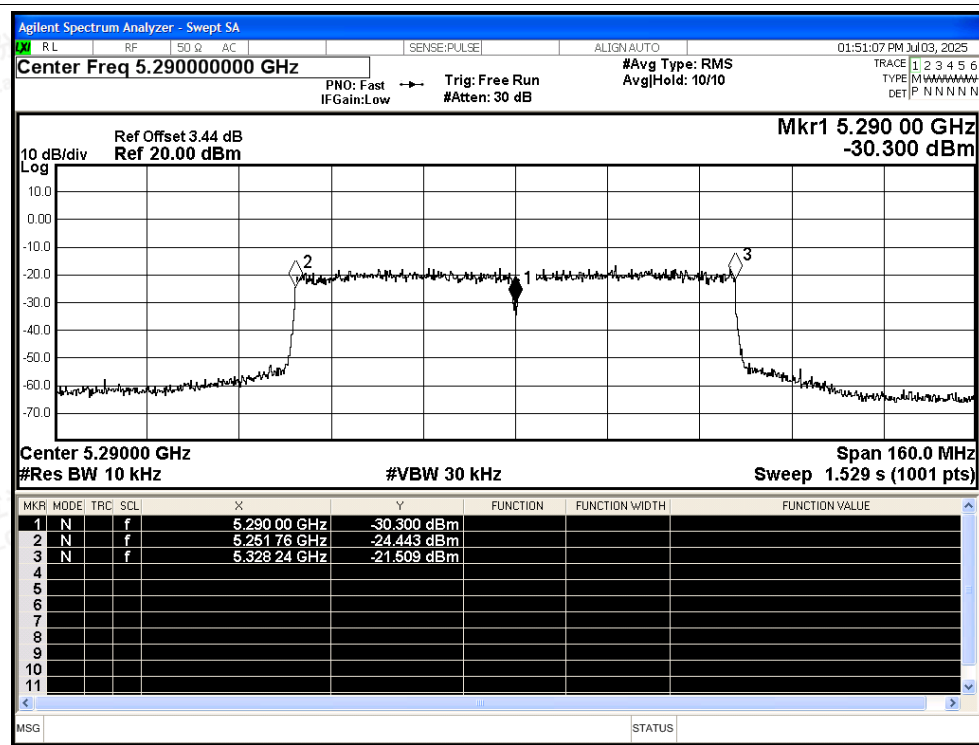

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant6

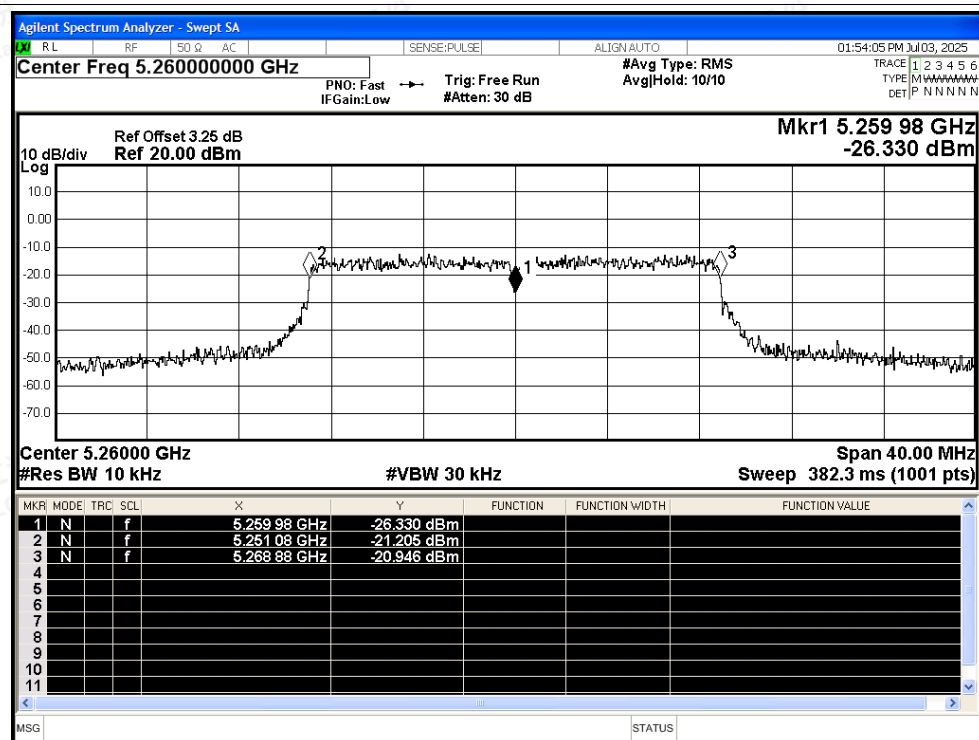

Freq. Stability NVNT ax20 5300MHz Ant6

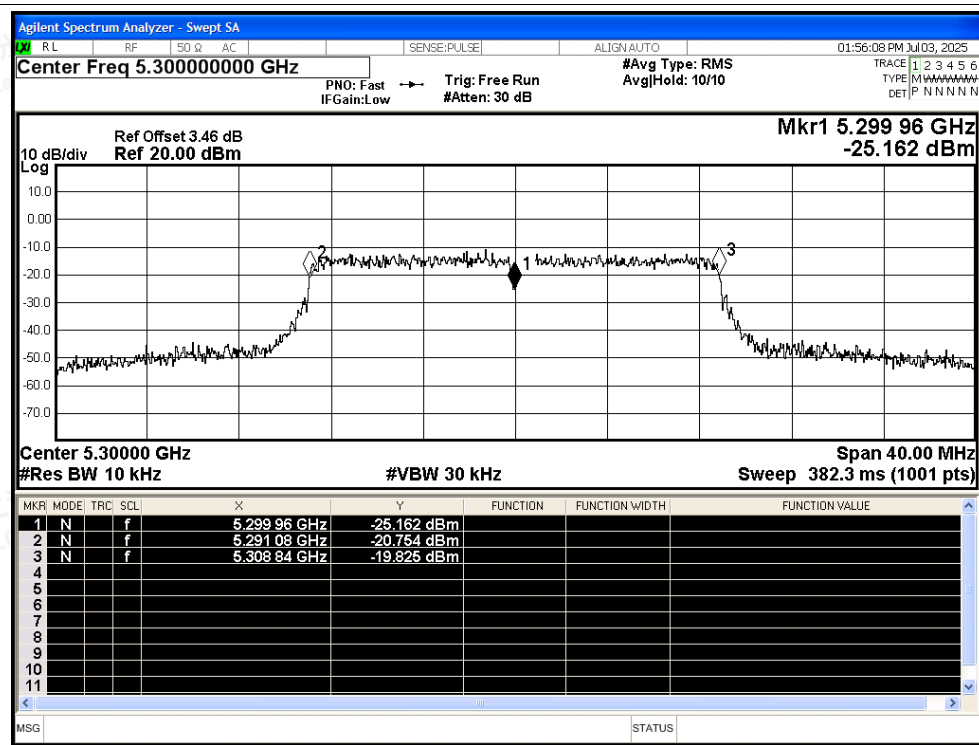

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant6

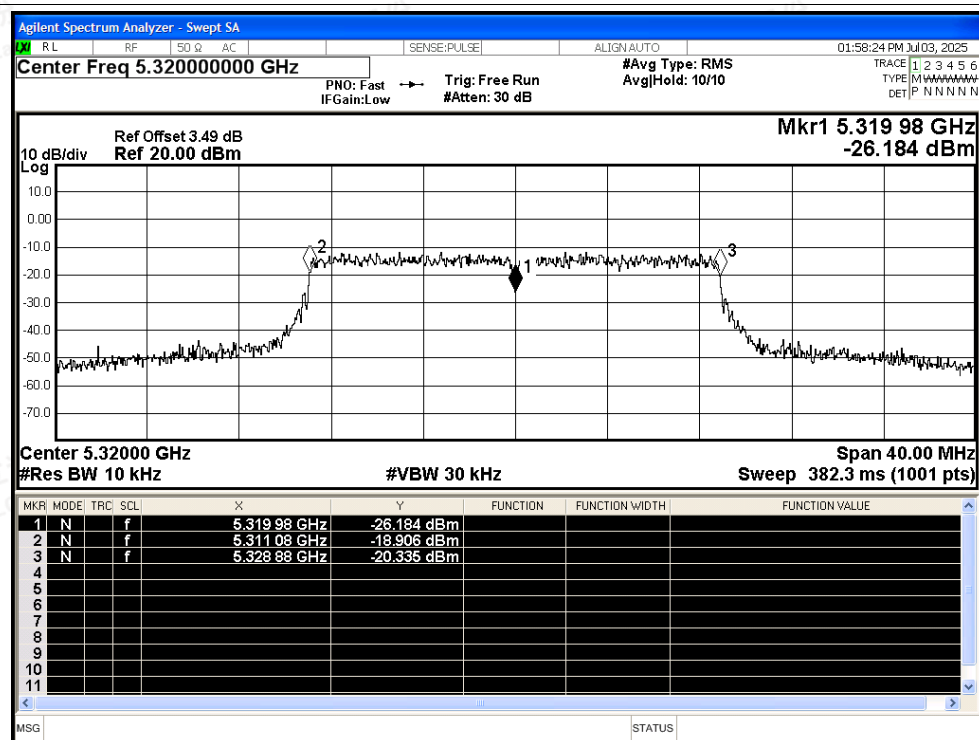

Freq. Stability NVNT ax40 5270MHz Ant6

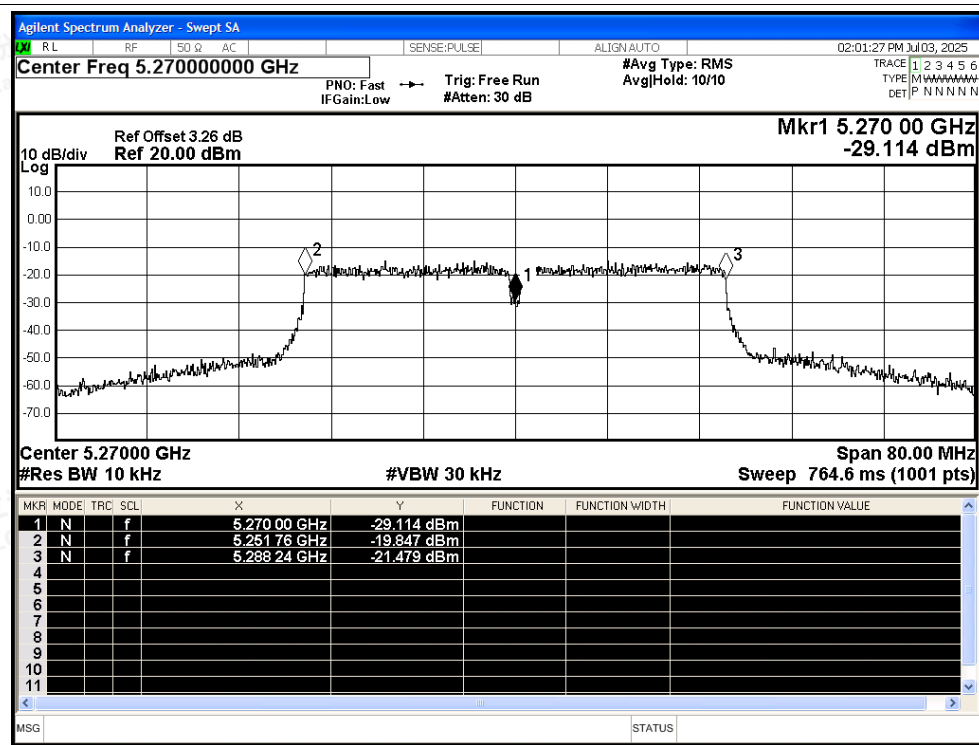

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant6

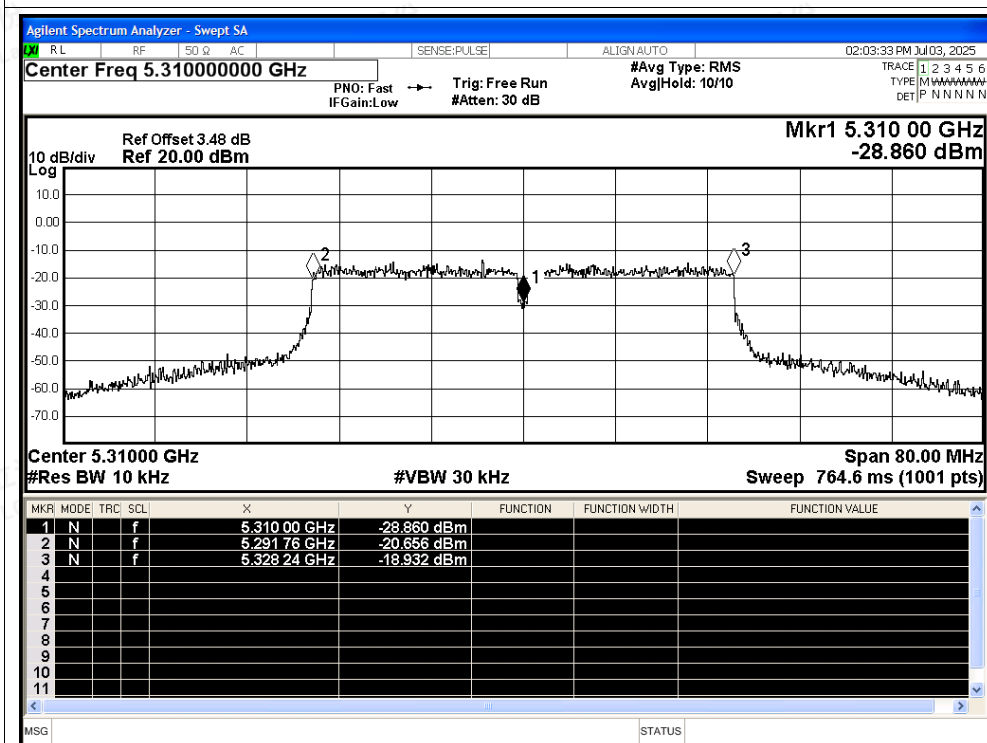

Freq. Stability NVNT ax80 5290MHz Ant6

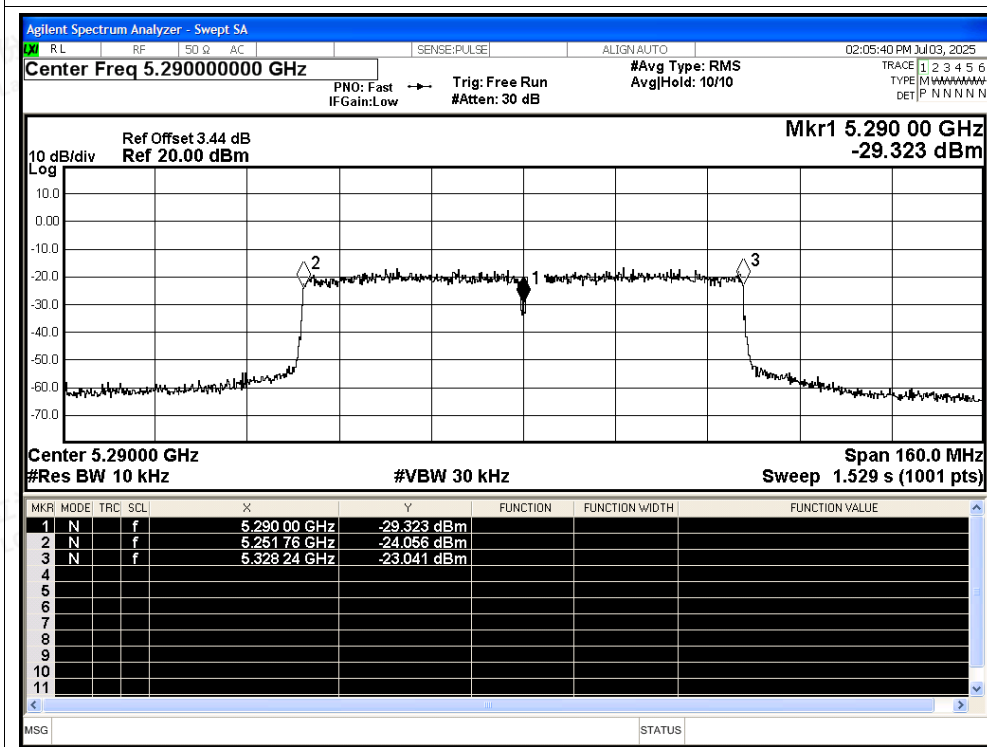

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	94.56	0.24	0.91
NVNT	a	5300	Ant2	94.65	0.24	0.91
NVNT	a	5320	Ant2	94.56	0.24	0.91
NVNT	n20	5260	Ant2	93.77	0.28	1.07
NVNT	n20	5300	Ant2	93.77	0.28	1.07
NVNT	n20	5320	Ant2	93.77	0.28	1.07
NVNT	n40	5270	Ant2	88.32	0.54	2.13
NVNT	n40	5310	Ant2	88.14	0.55	2.14
NVNT	ac20	5260	Ant2	93.72	0.28	1.06
NVNT	ac20	5300	Ant2	93.82	0.28	1.06
NVNT	ac20	5320	Ant2	93.72	0.28	1.06
NVNT	ac40	5270	Ant2	88.31	0.54	2.1
NVNT	ac40	5310	Ant2	88.48	0.53	2.1
NVNT	ac80	5290	Ant2	79.61	0.99	4.13
NVNT	ax20	5260	Ant2	93.72	0.28	1.06
NVNT	ax20	5300	Ant2	93.72	0.28	1.06
NVNT	ax20	5320	Ant2	93.72	0.28	1.06
NVNT	ax40	5270	Ant2	88.48	0.53	2.1
NVNT	ax40	5310	Ant2	88.48	0.53	2.1
NVNT	ax80	5290	Ant2	79.61	0.99	4.13






Test Graphs

Duty Cycle NVNT a 5260MHz Ant2

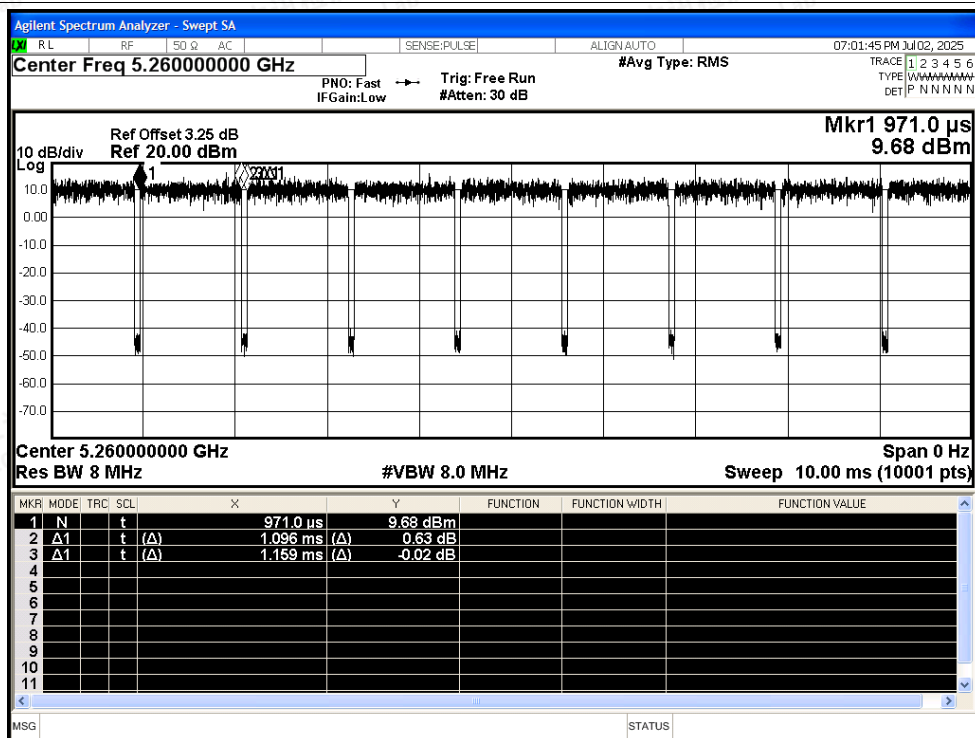

Duty Cycle NVNT a 5300MHz Ant2

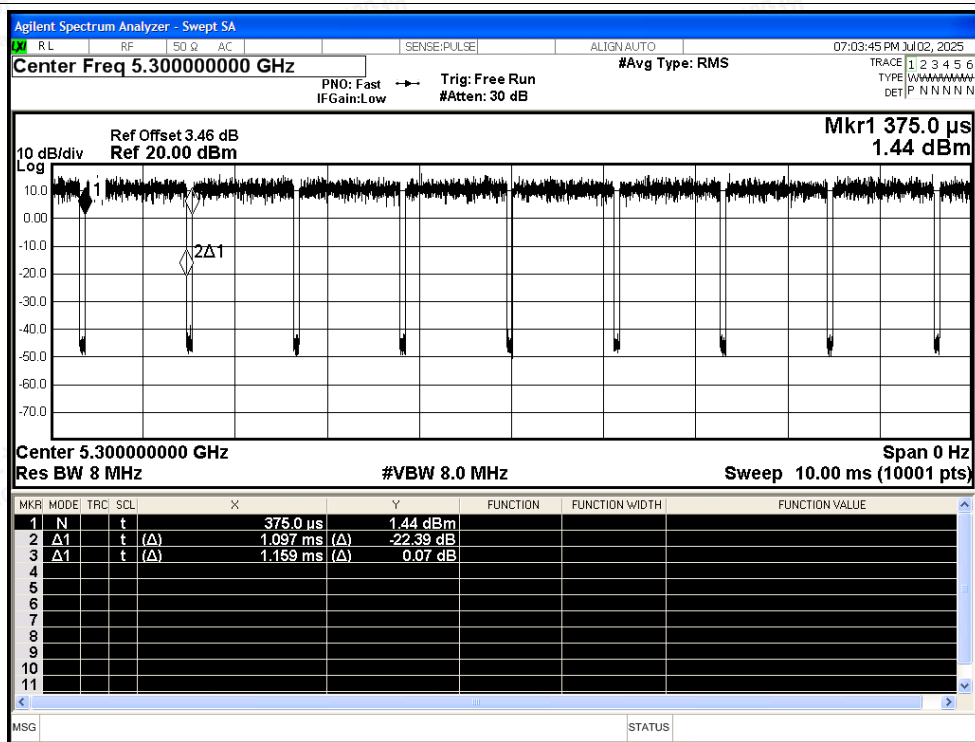

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant2

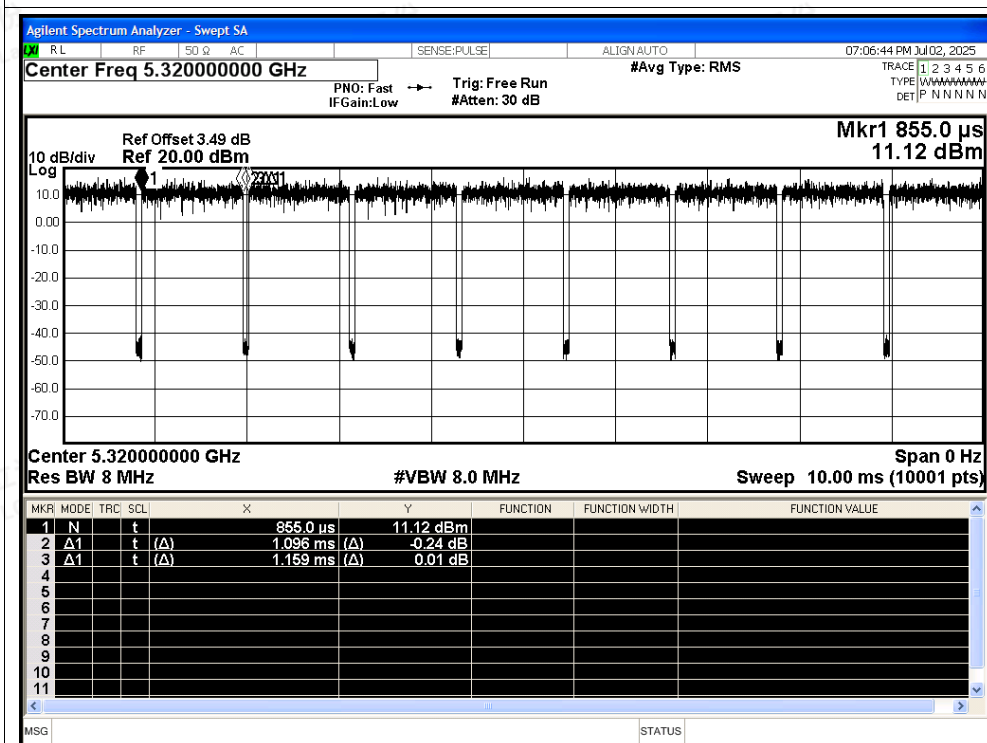

Duty Cycle NVNT n20 5260MHz Ant2

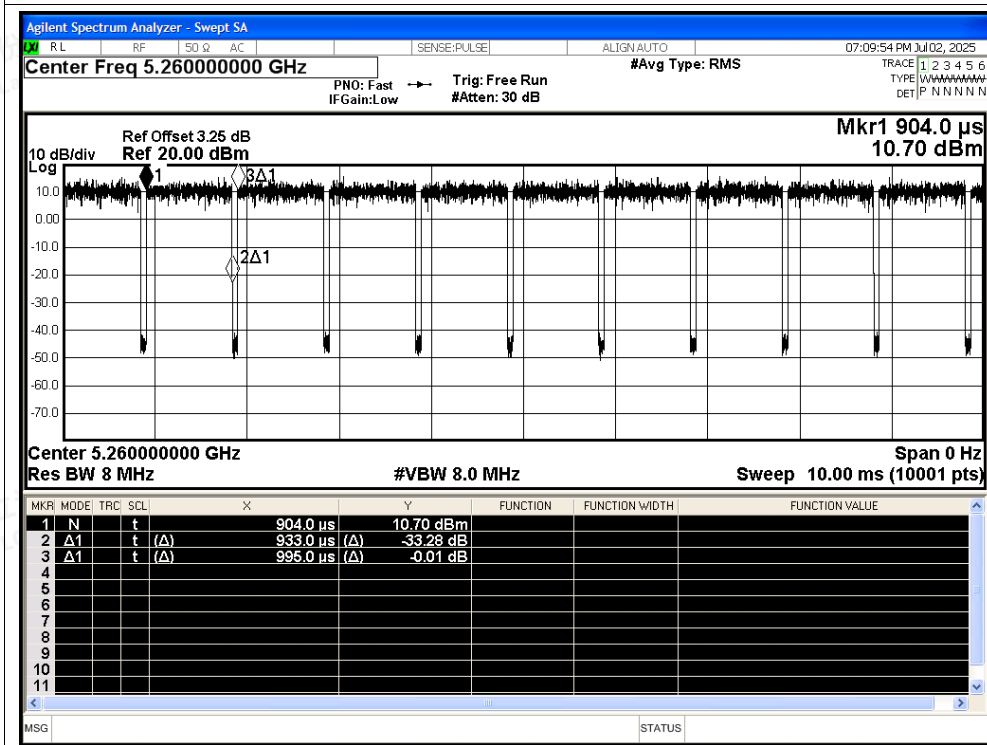

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant2

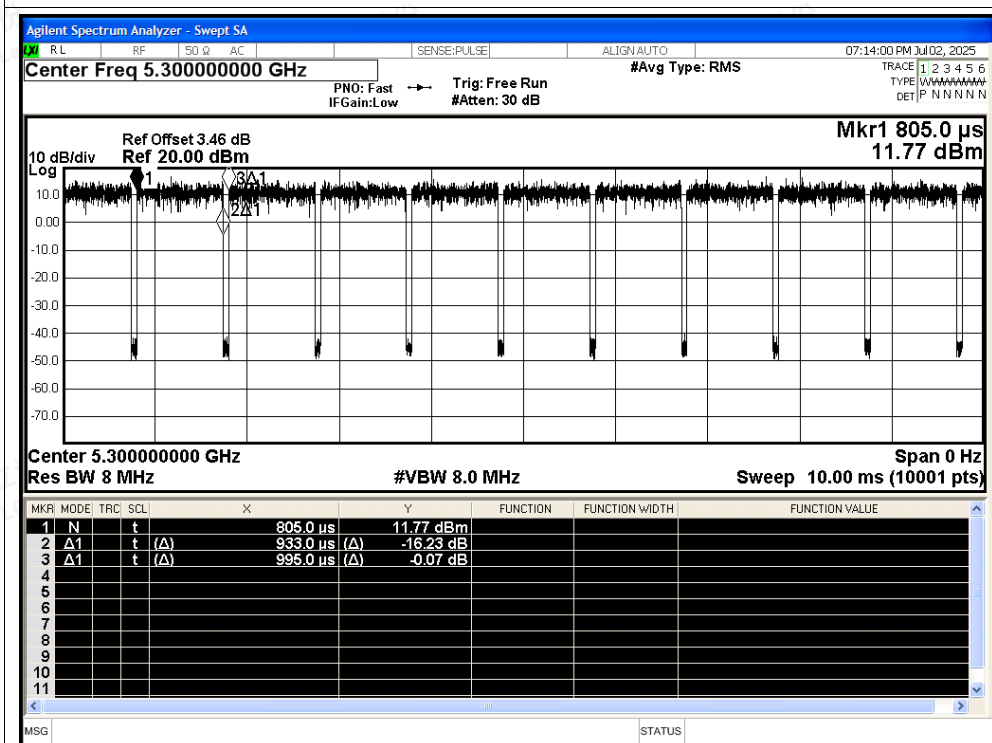

Duty Cycle NVNT n20 5320MHz Ant2

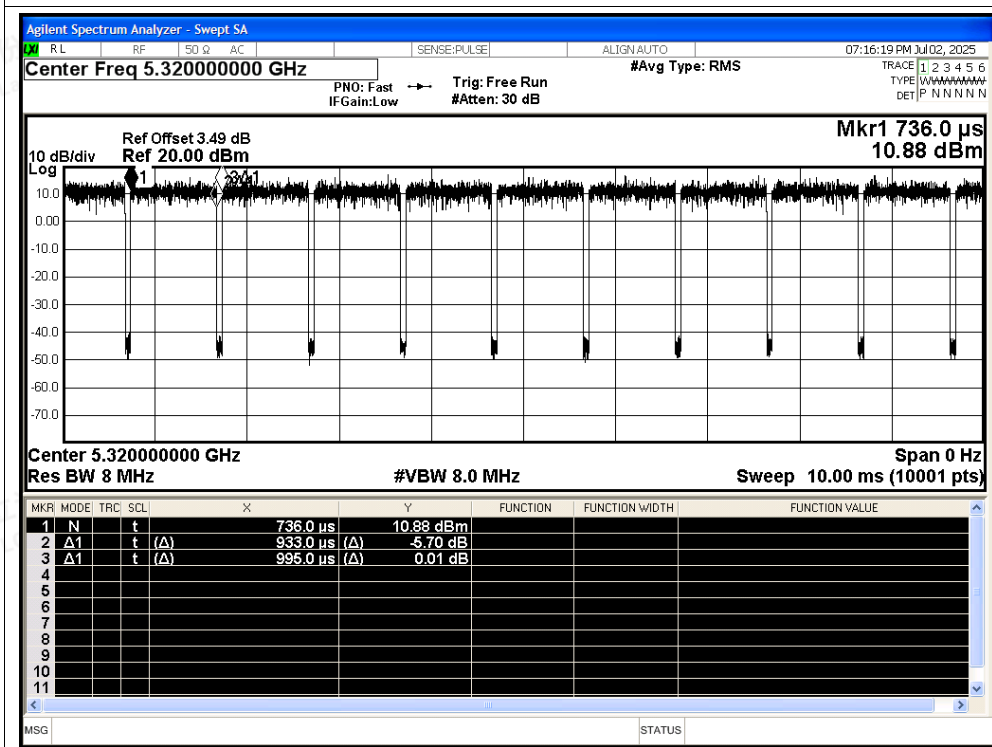

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant2

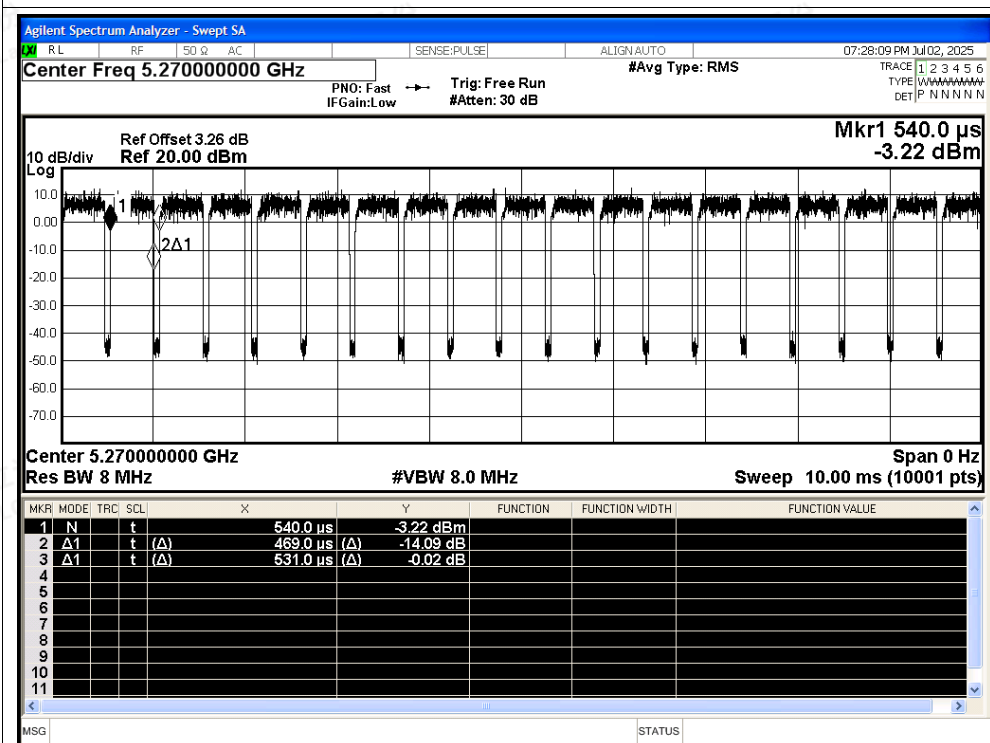

Duty Cycle NVNT n40 5310MHz Ant2

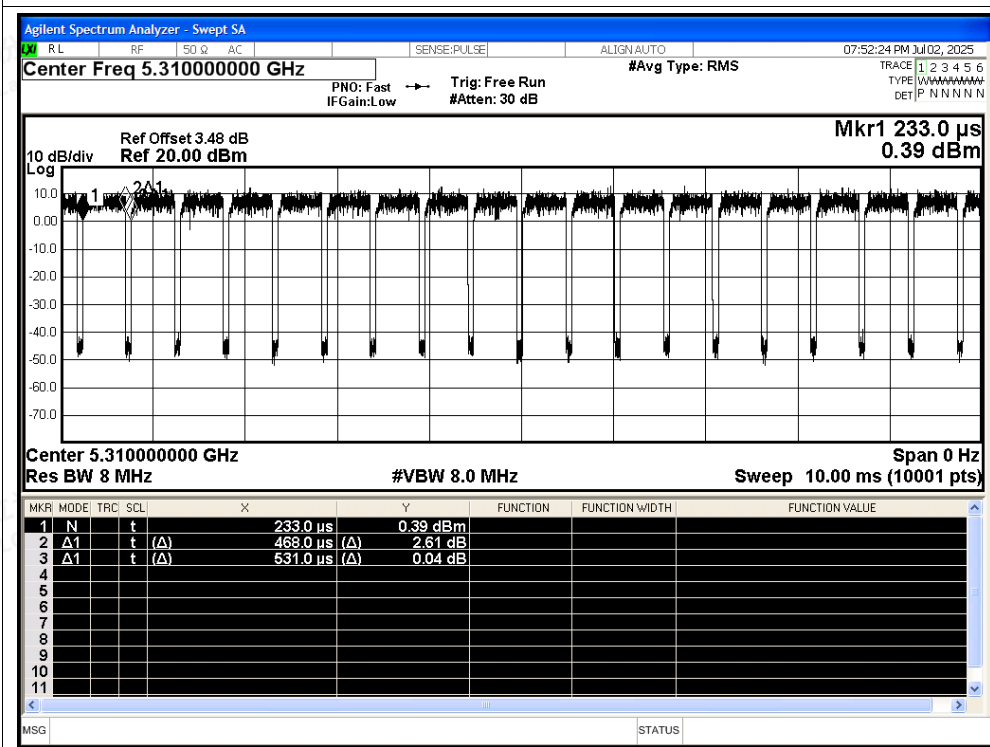

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant2

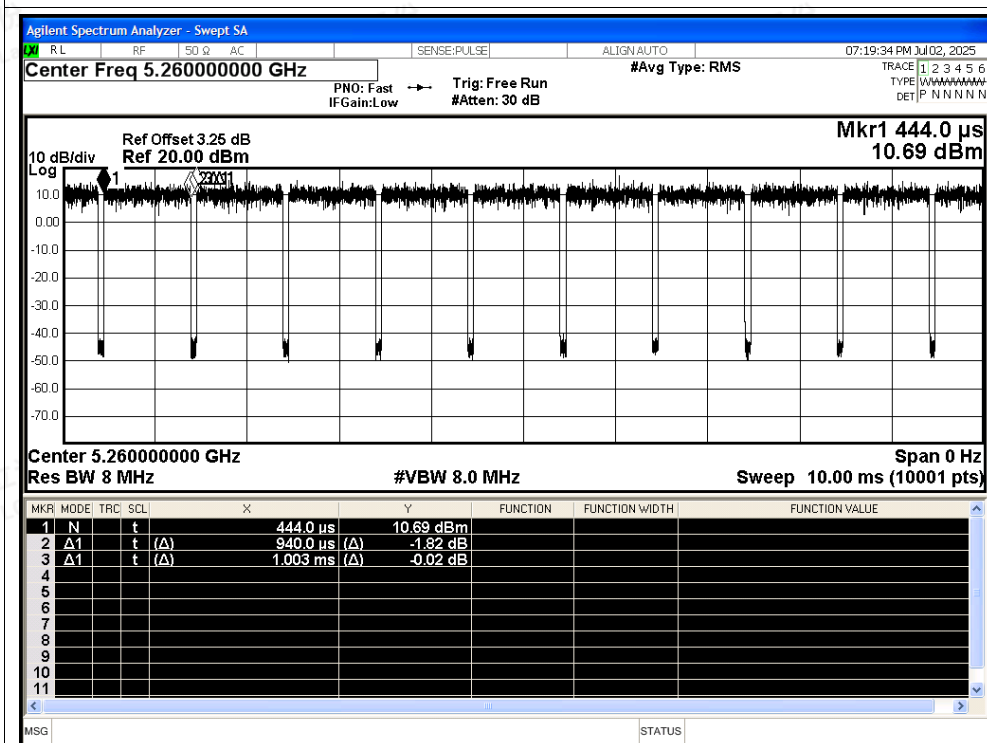

Duty Cycle NVNT ac20 5300MHz Ant2

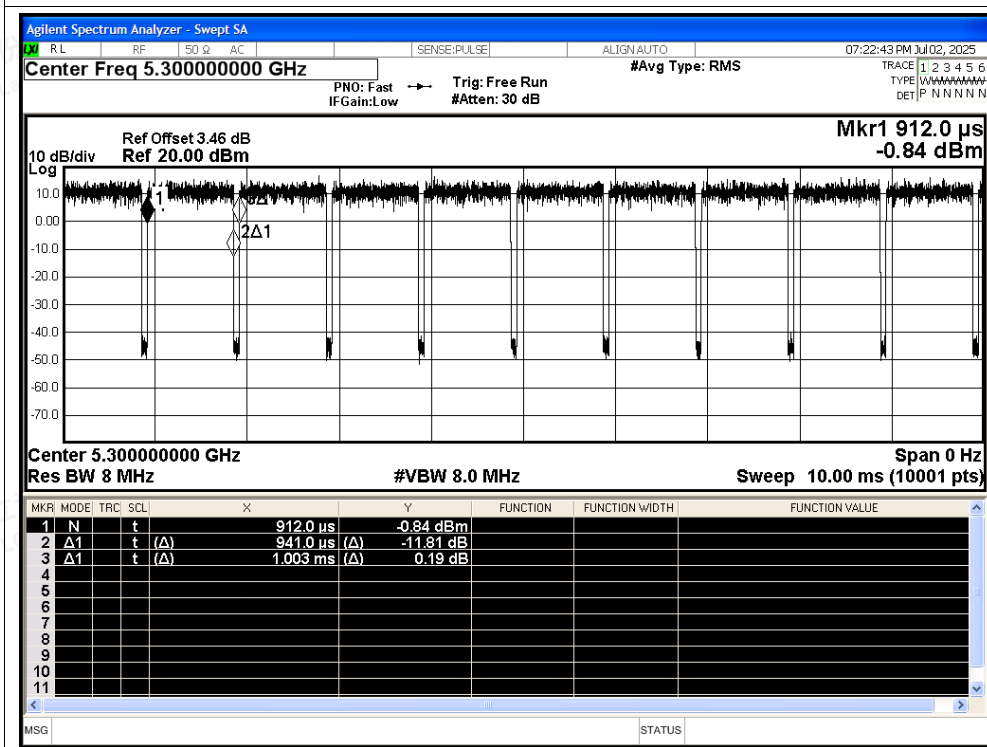

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant2

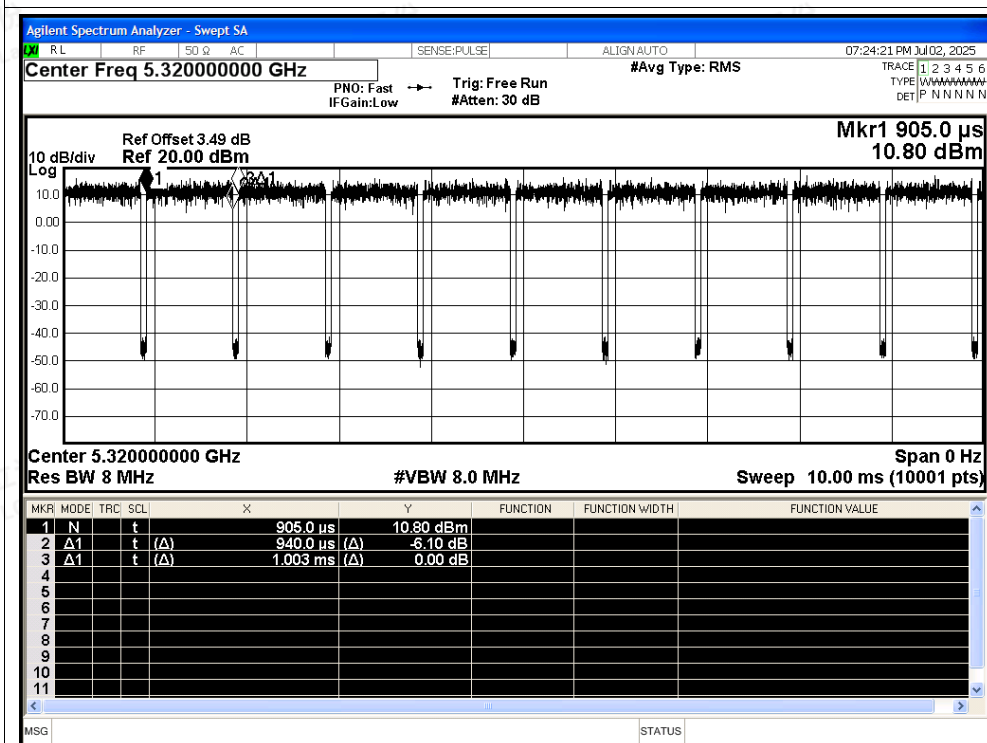

Duty Cycle NVNT ac40 5270MHz Ant2

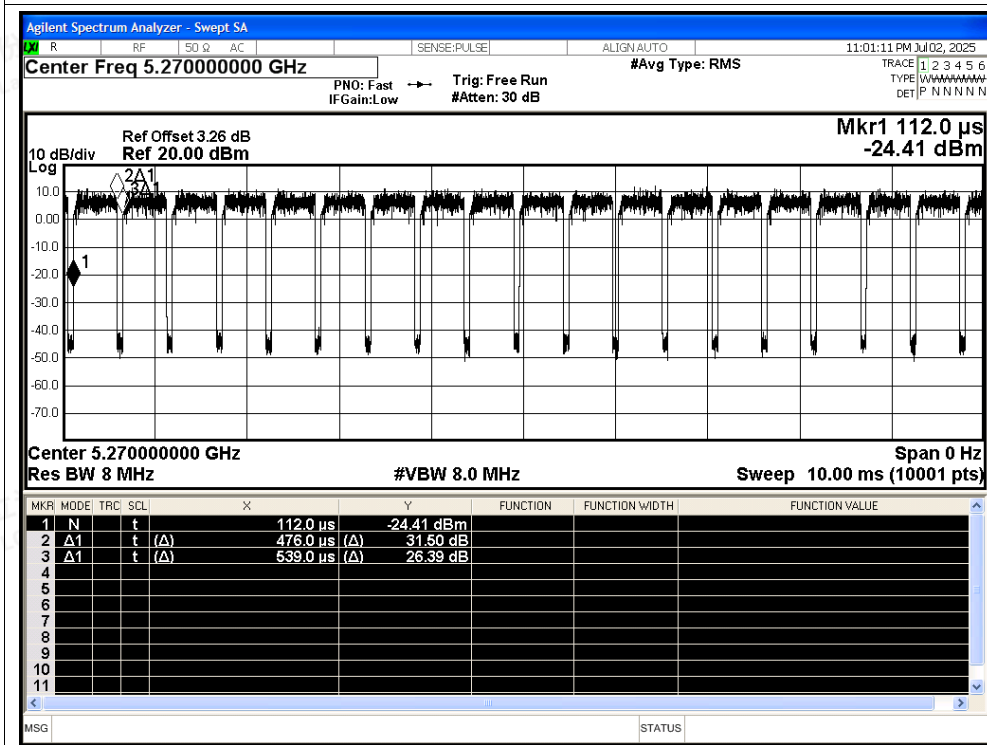

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant2

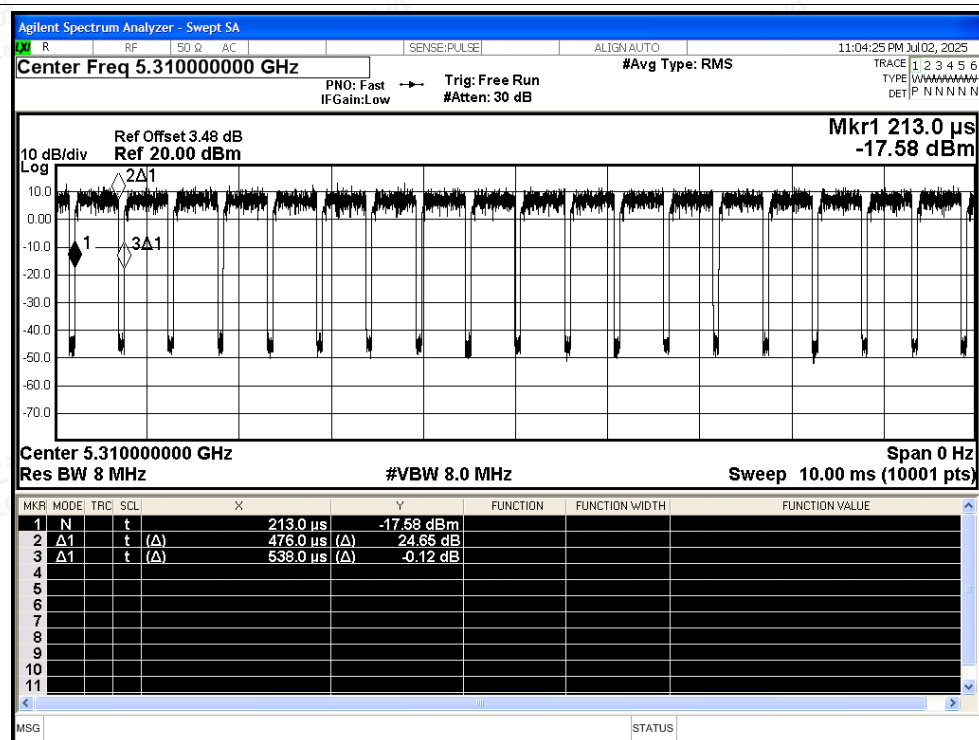

Duty Cycle NVNT ac80 5290MHz Ant2

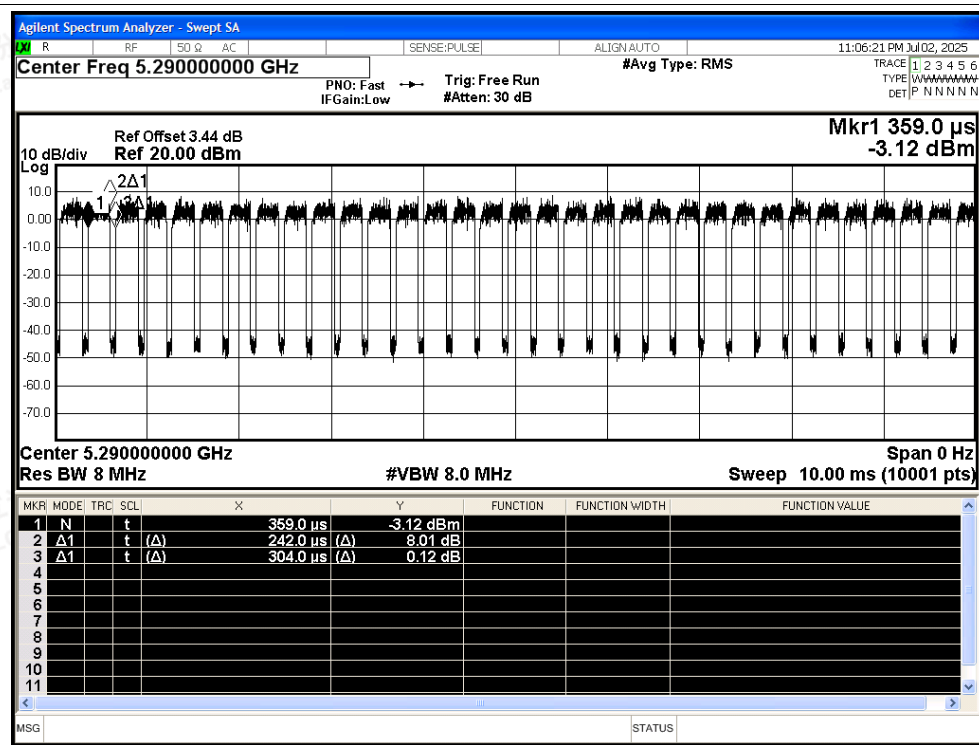

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant2

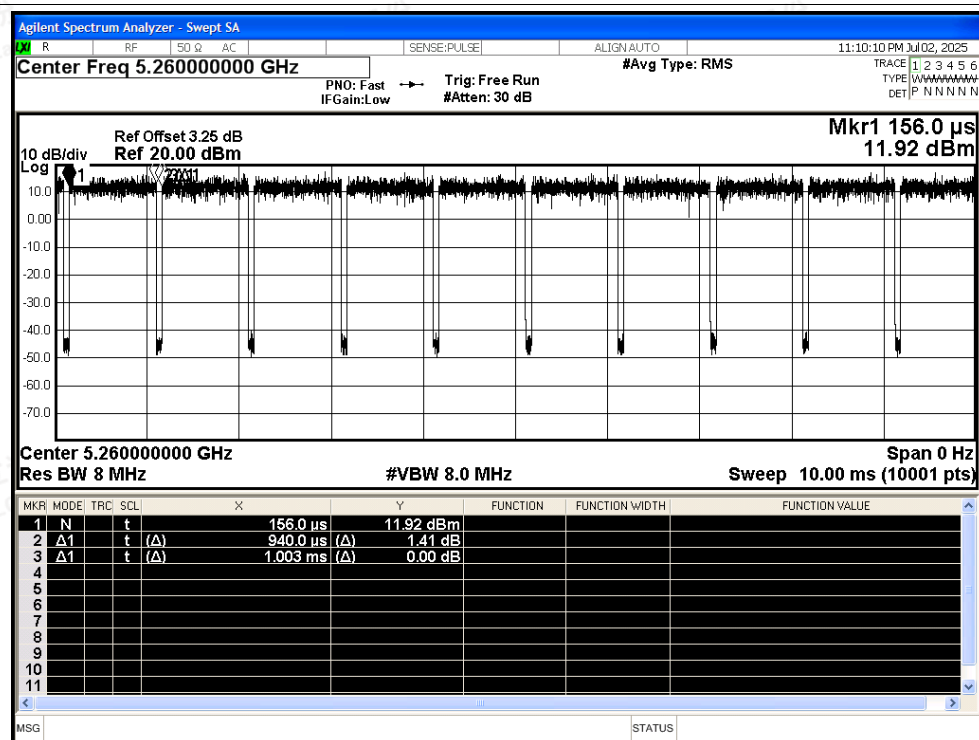

Duty Cycle NVNT ax20 5300MHz Ant2

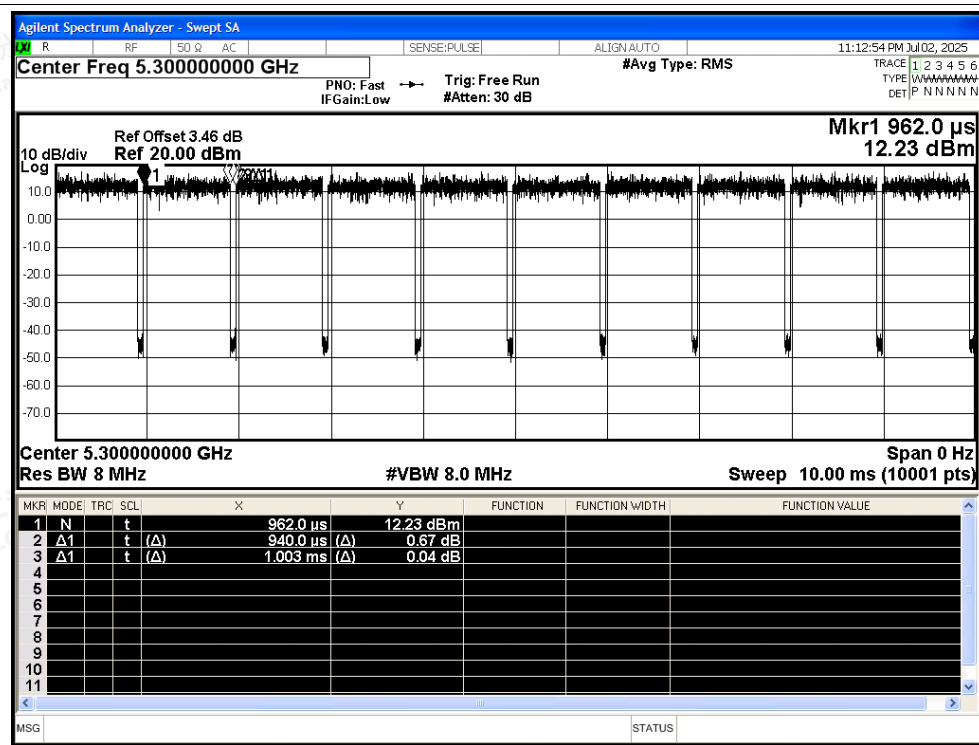

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity