





Restrict Band NVNT n40 5755MHz Ant6 Peak

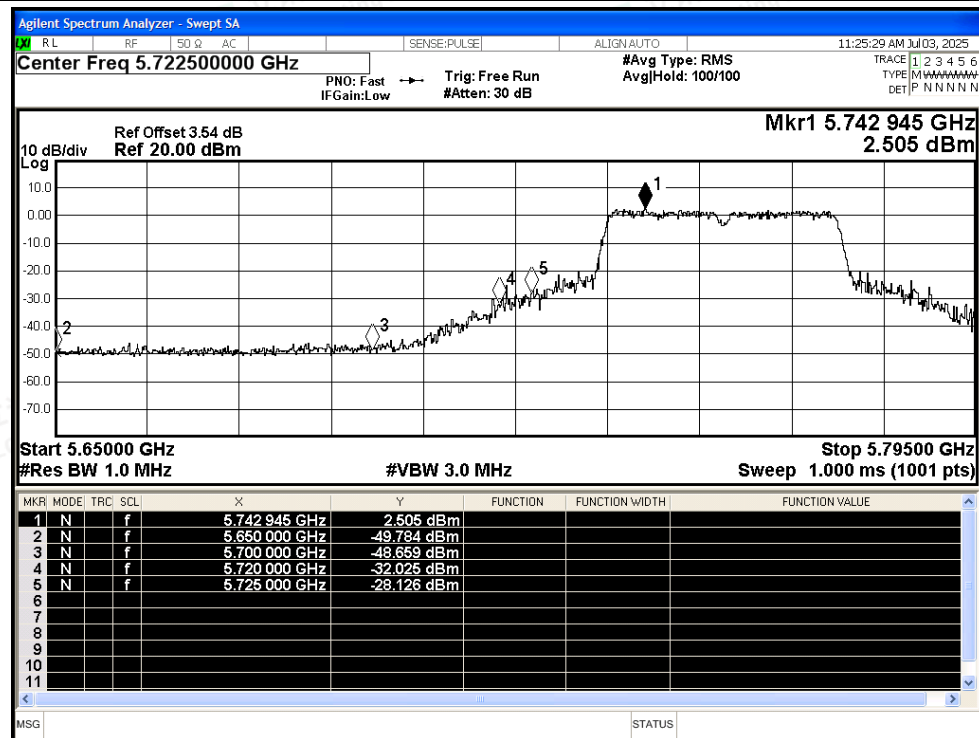

Restrict Band NVNT n40 5755MHz Ant6 Average

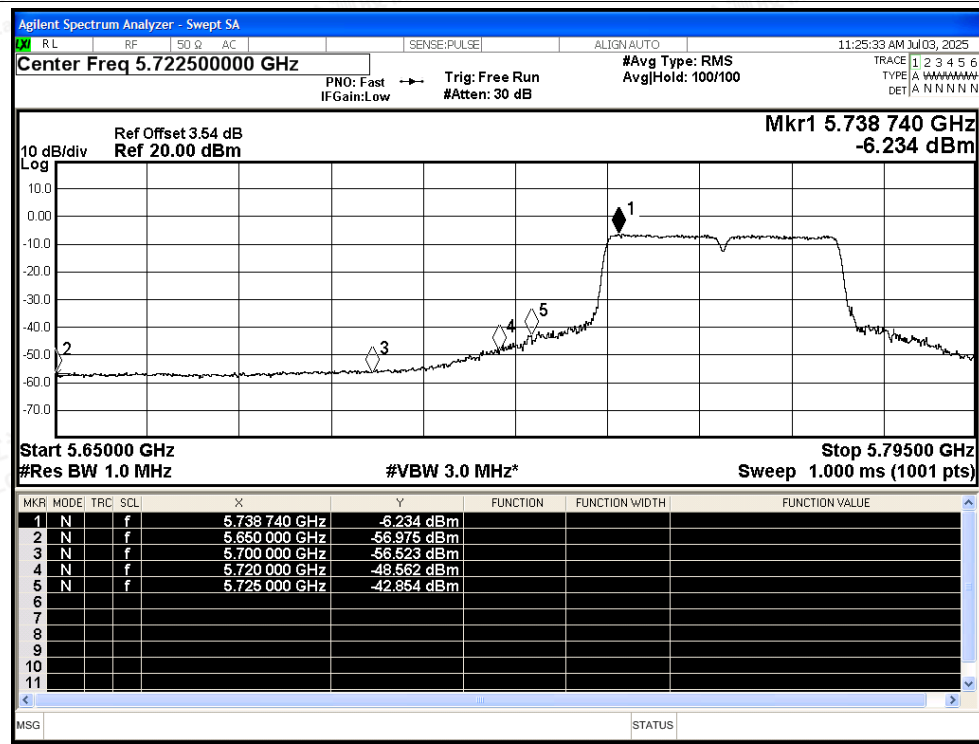

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant6 Peak

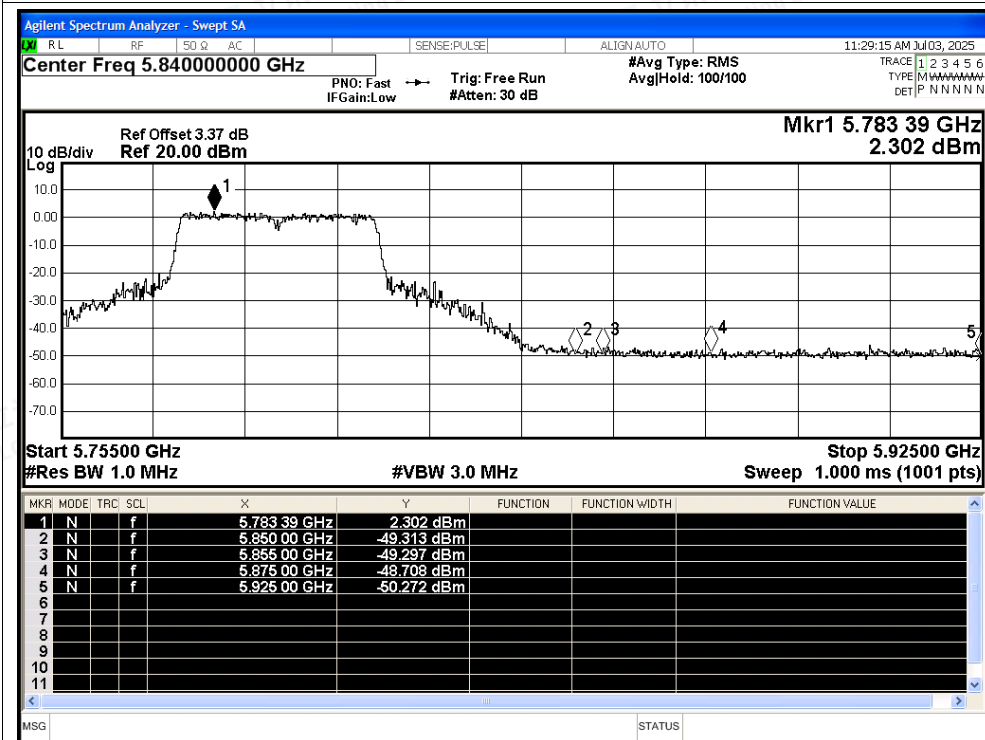

Restrict Band NVNT n40 5795MHz Ant6 Average

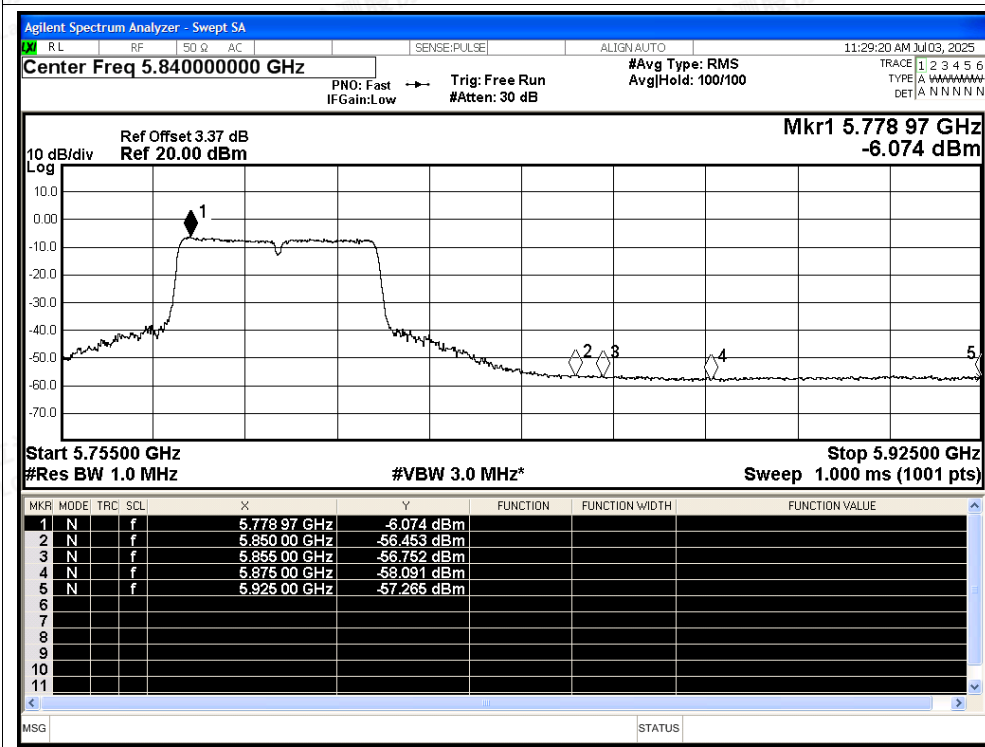

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant6 Peak

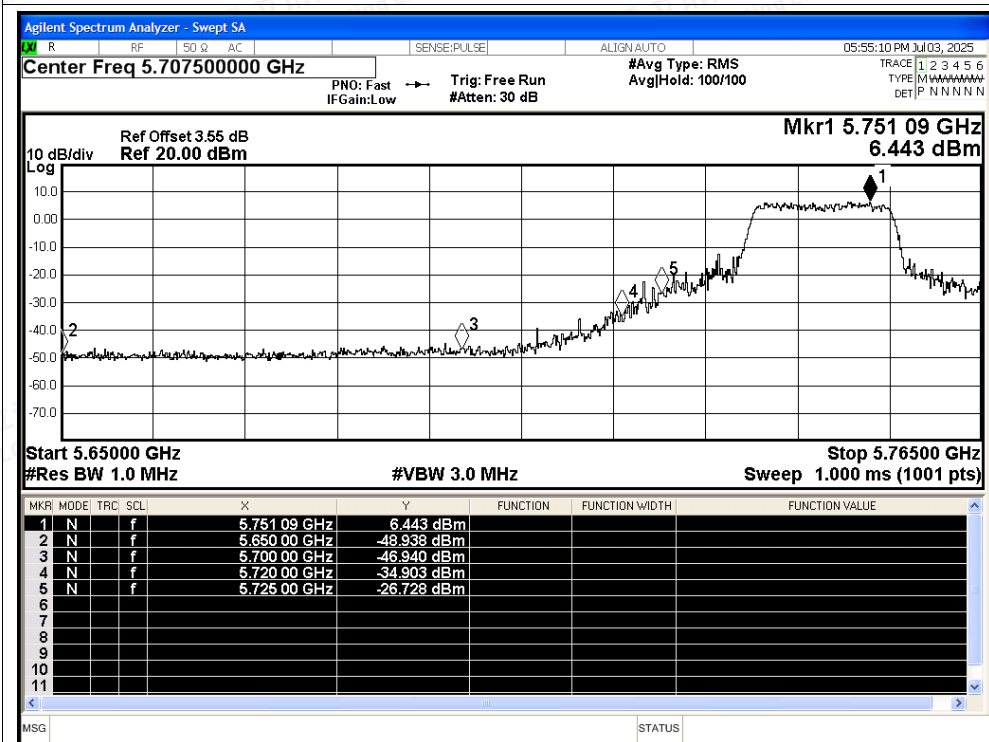

Restrict Band NVNT ac20 5745MHz Ant6 Average

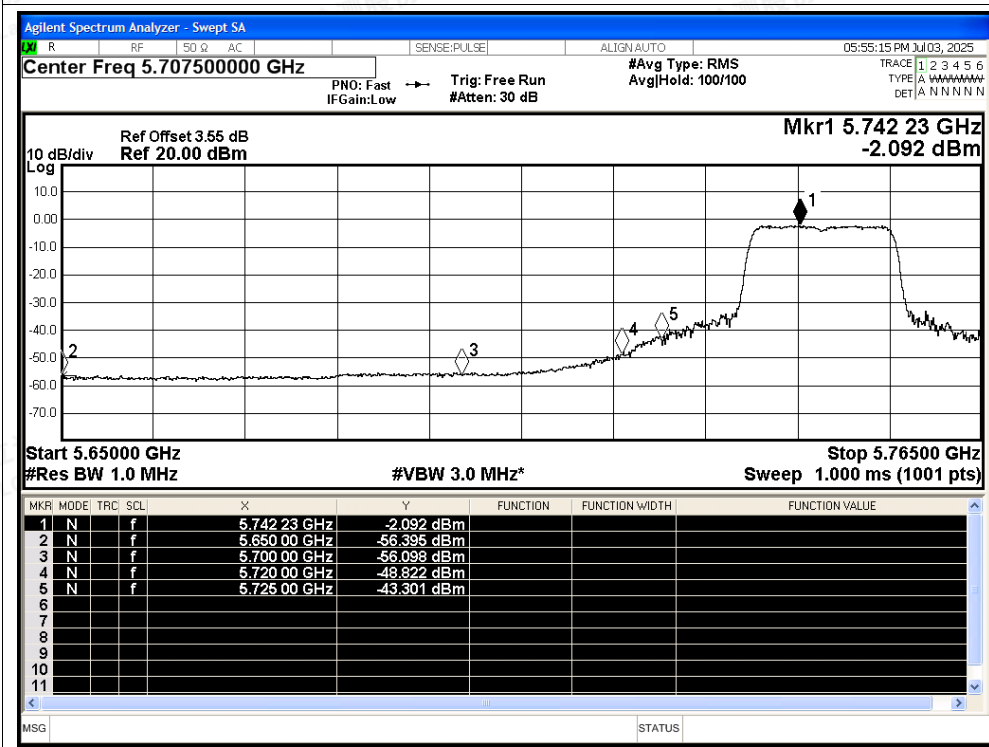

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant6 Peak

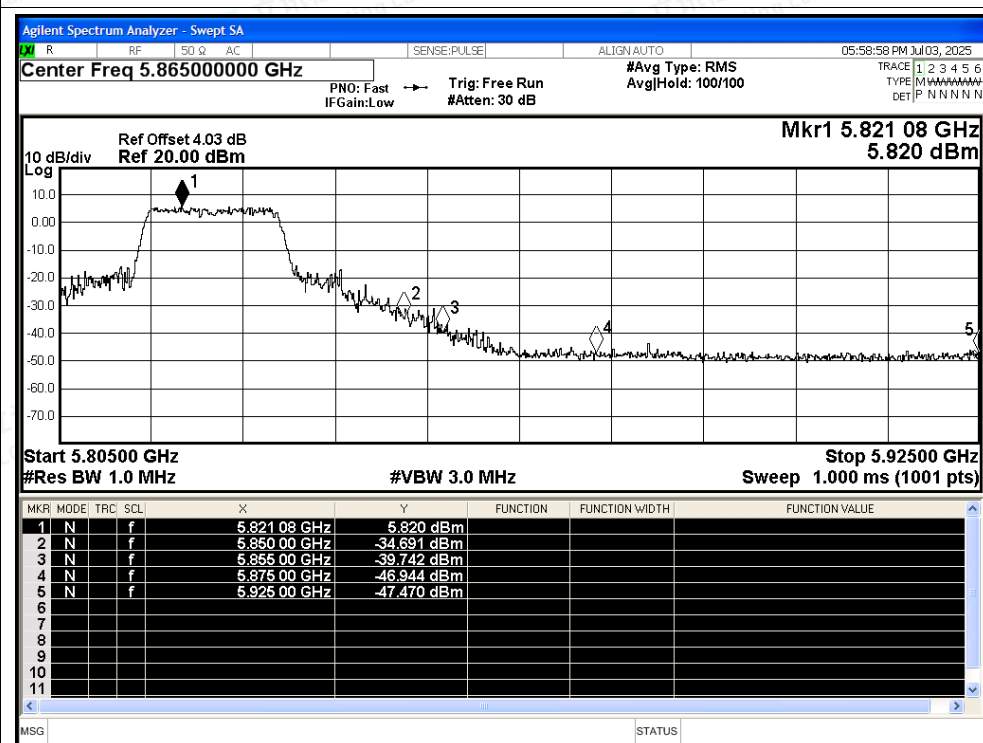

Restrict Band NVNT ac20 5825MHz Ant6 Average

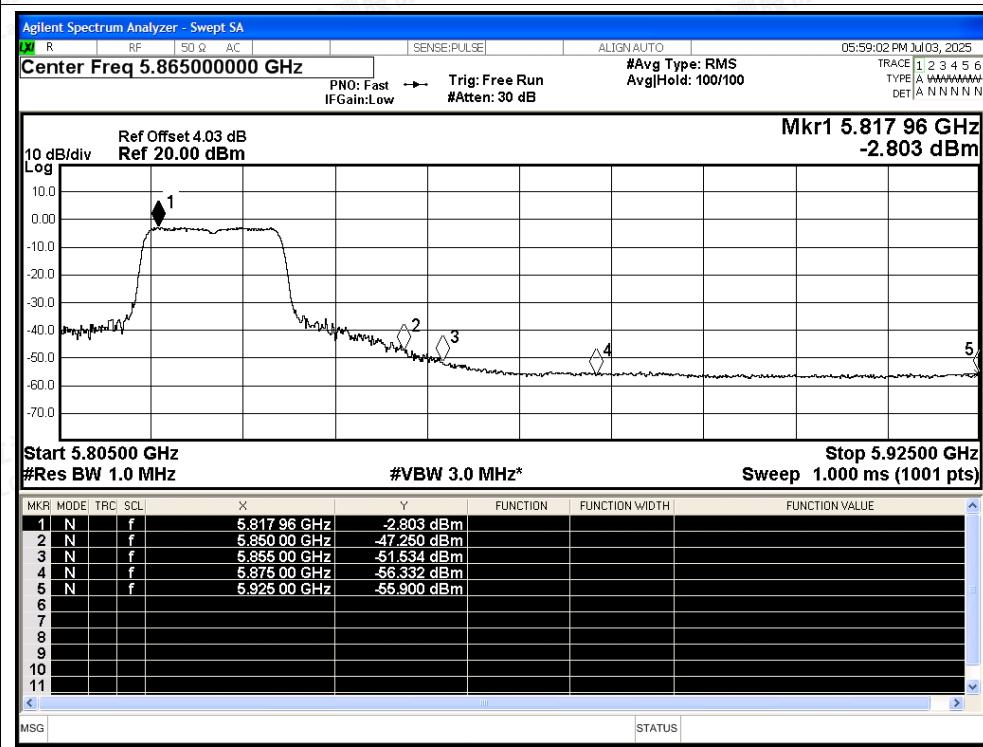

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant6 Peak

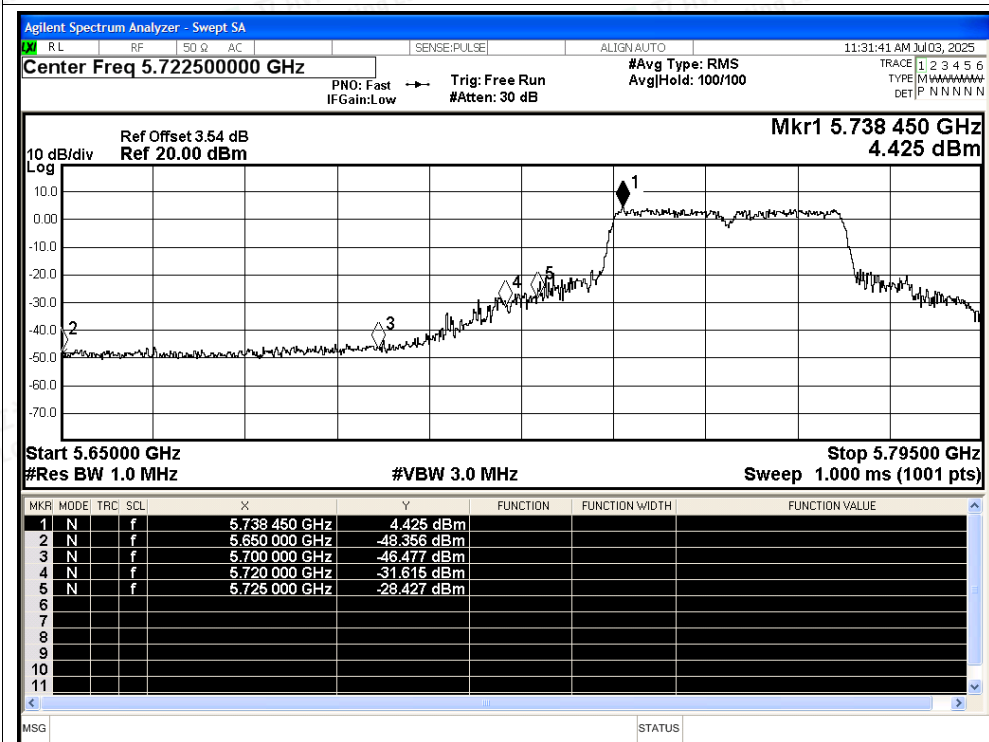

Restrict Band NVNT ac40 5755MHz Ant6 Average

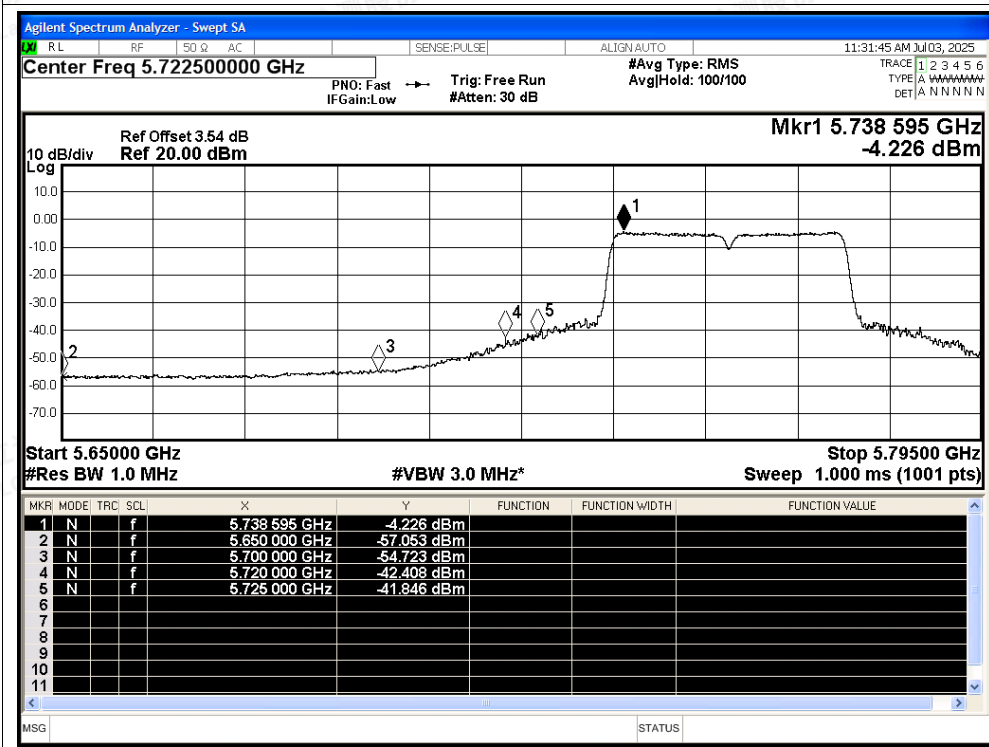

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant6 Peak

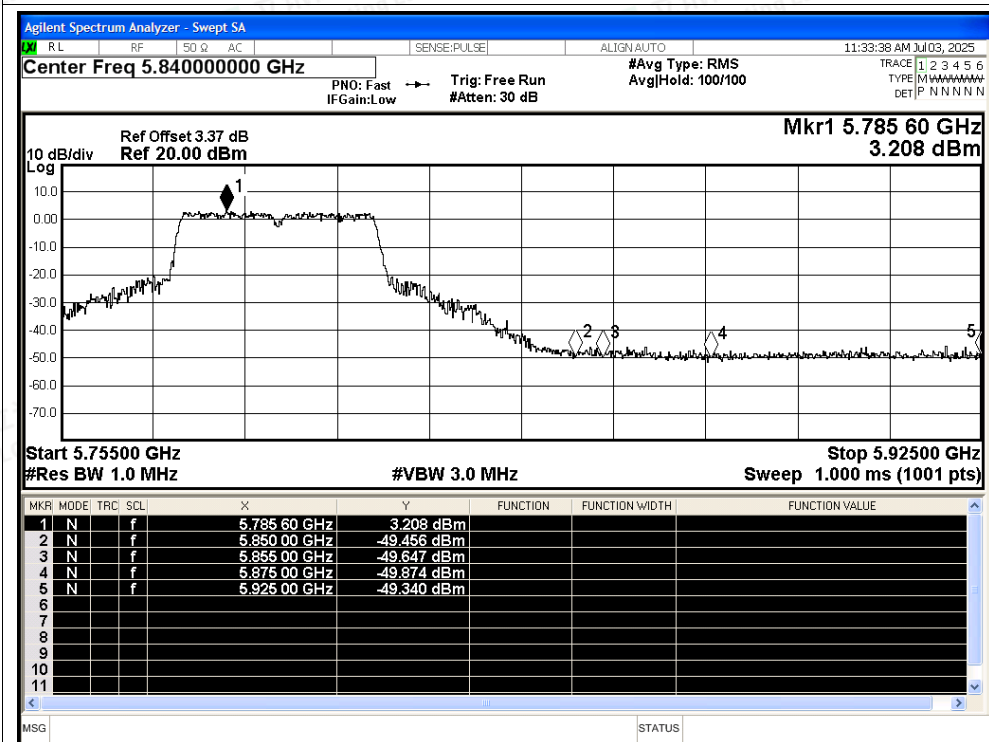

Restrict Band NVNT ac40 5795MHz Ant6 Average

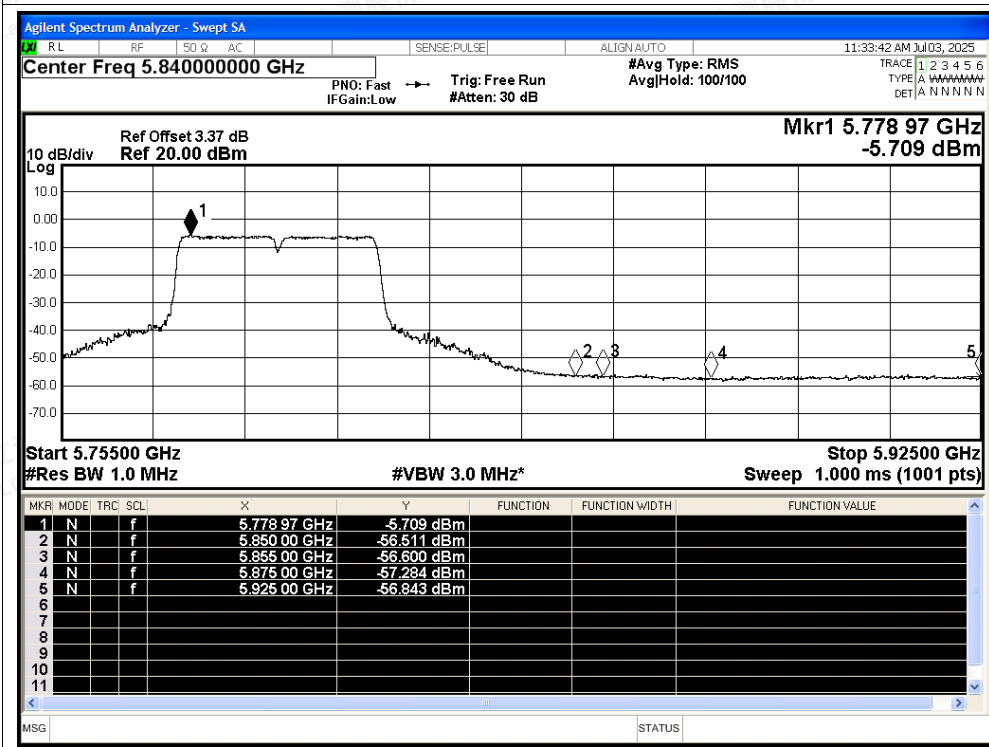

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant6 Peak

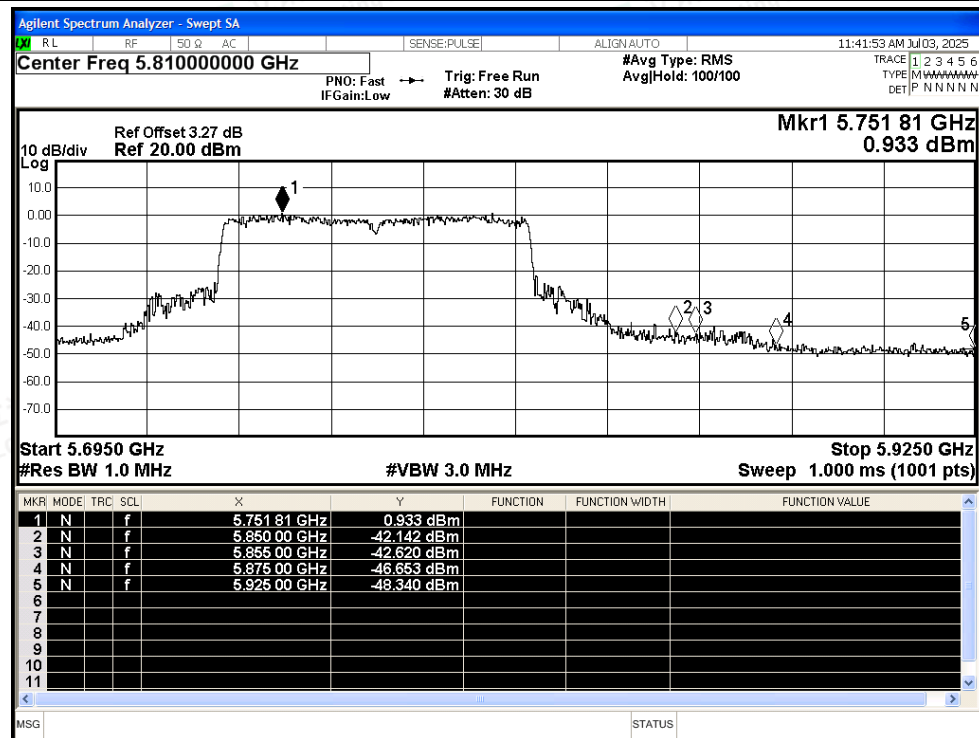

Restrict Band NVNT ac80 5775MHz Ant6 Average

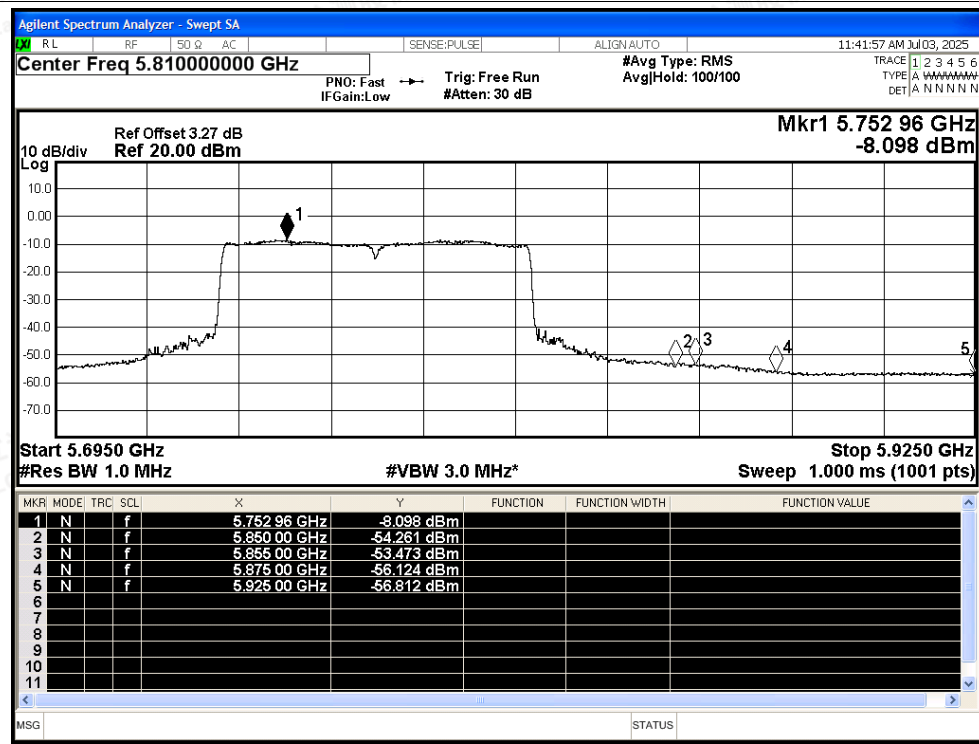

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant6 Peak

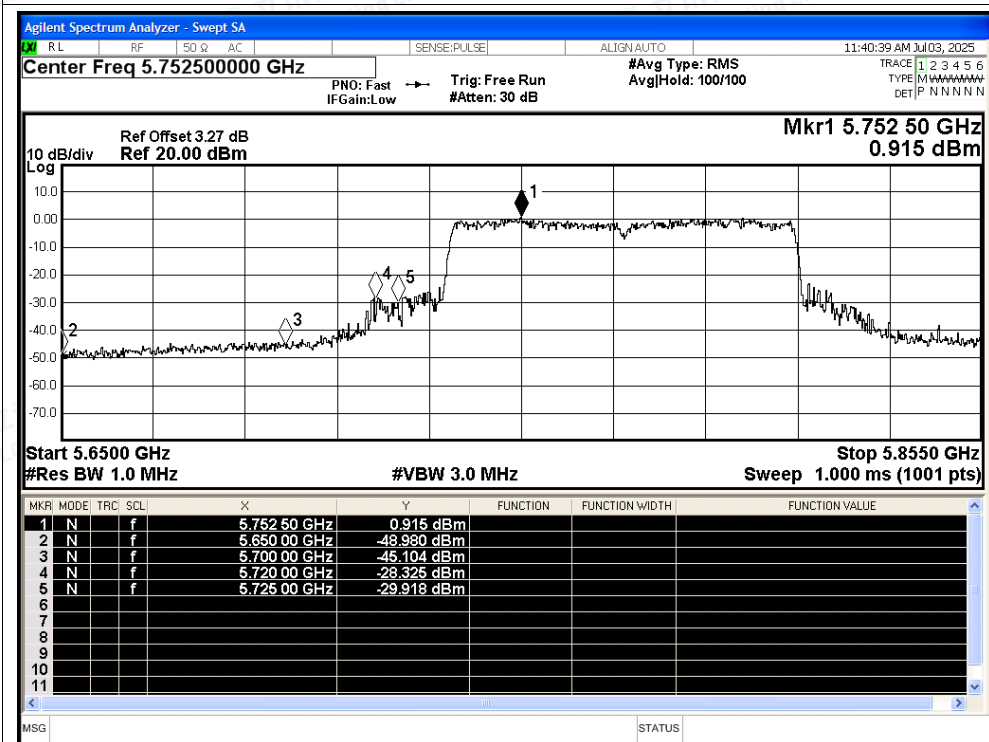

Restrict Band NVNT ac80 5775MHz Ant6 Average

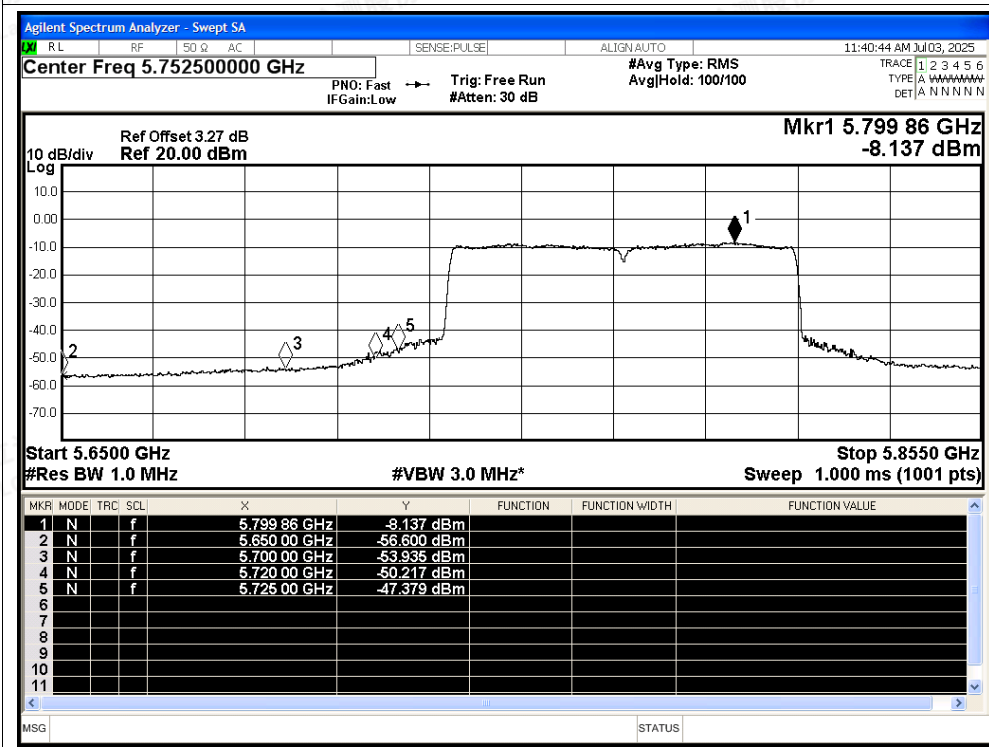

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant6 Peak

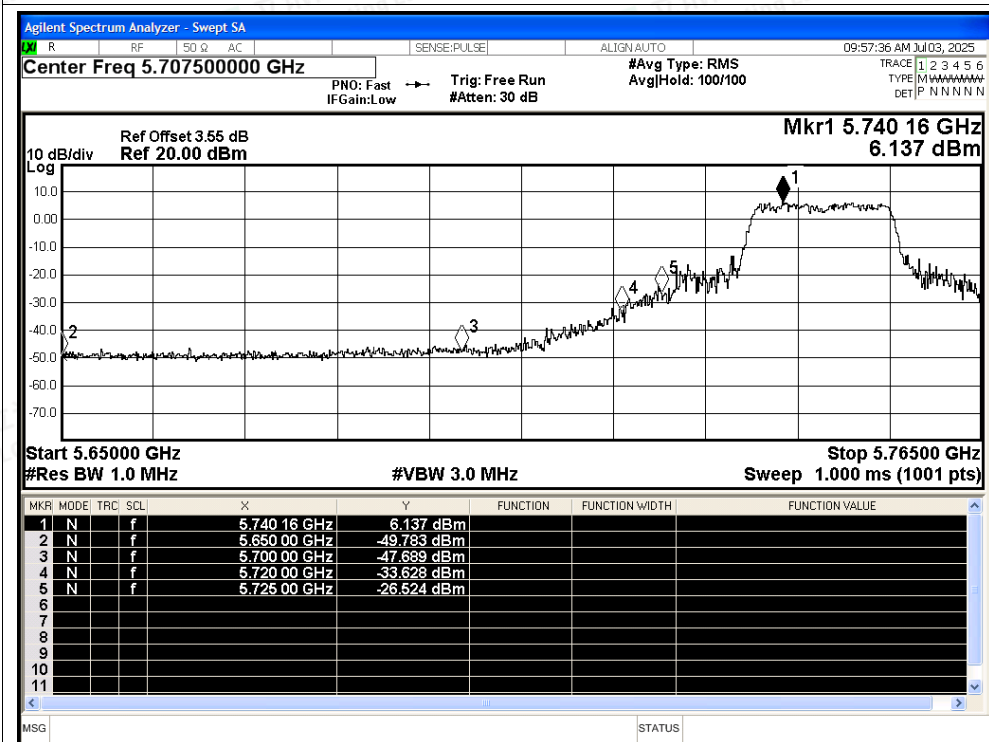

Restrict Band NVNT ax20 5745MHz Ant6 Average

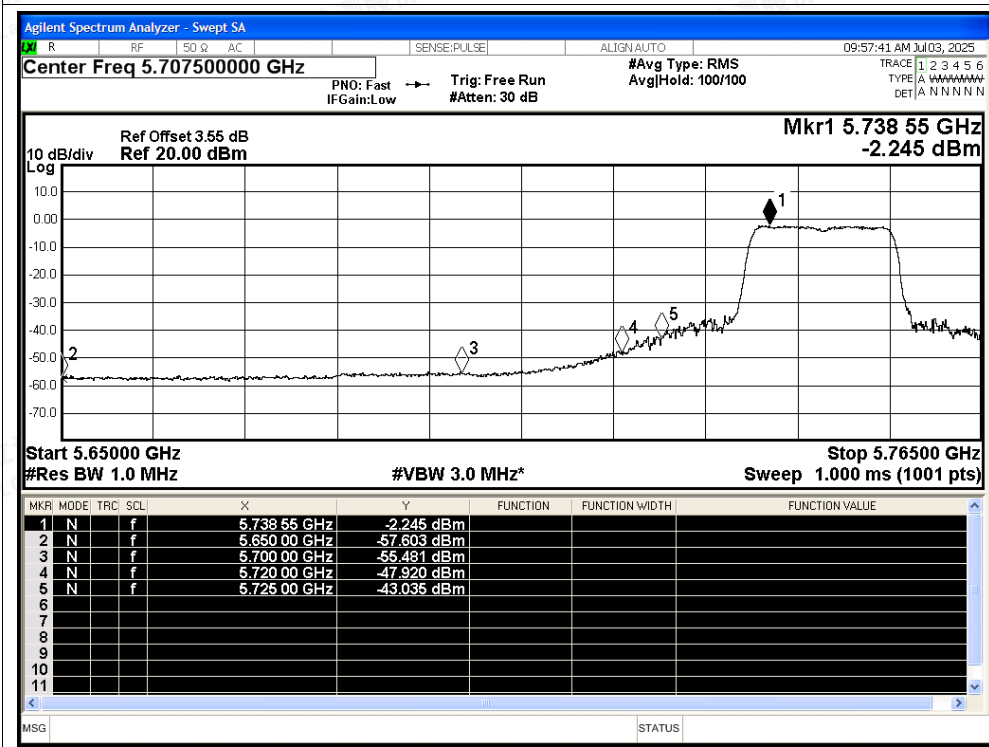

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant6 Peak

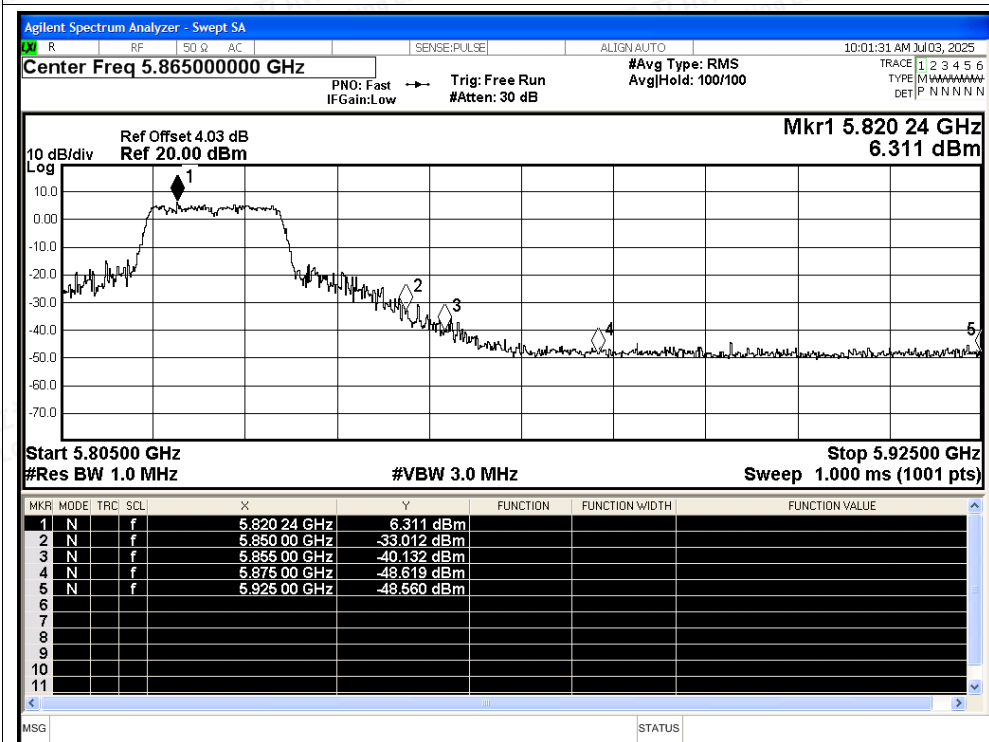

Restrict Band NVNT ax20 5825MHz Ant6 Average

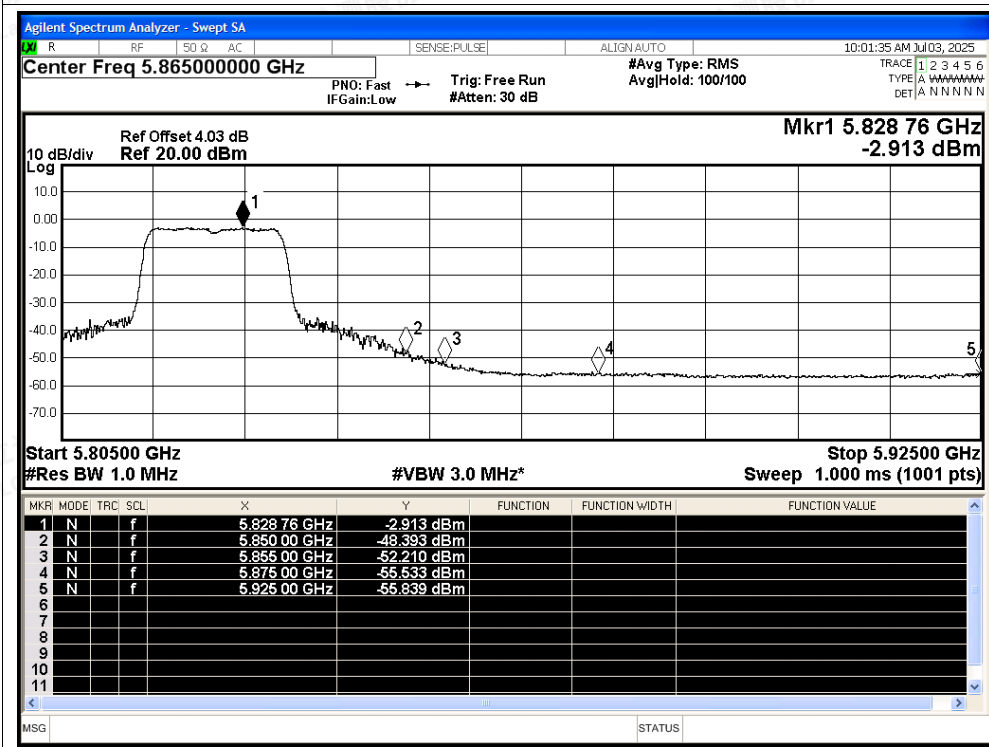

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant6 Peak

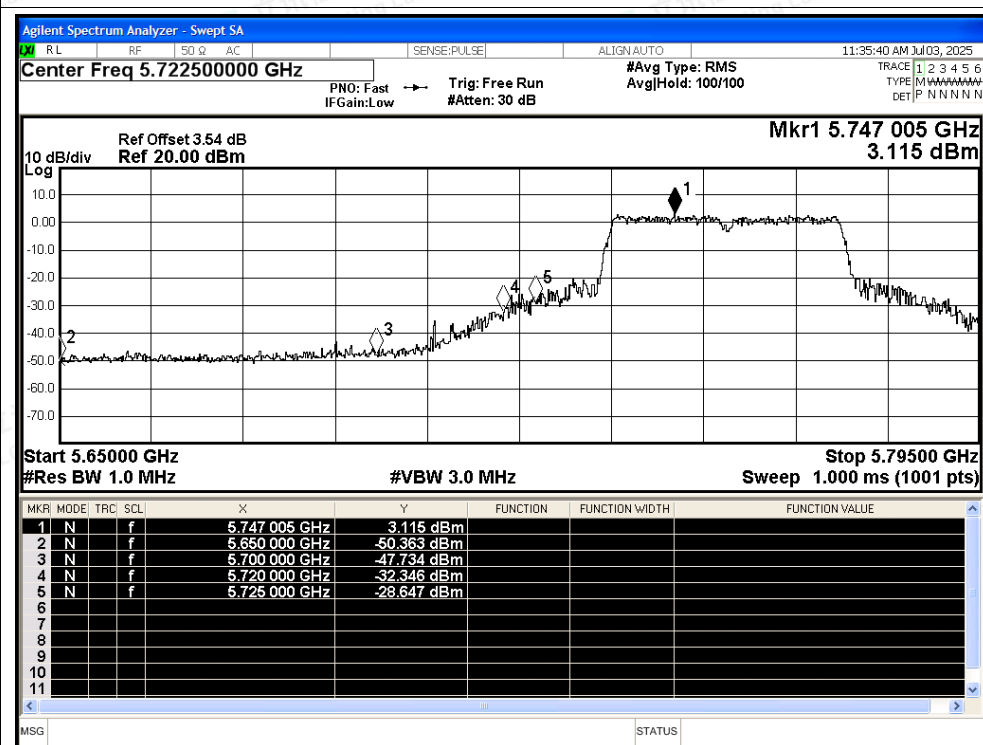

Restrict Band NVNT ax40 5755MHz Ant6 Average

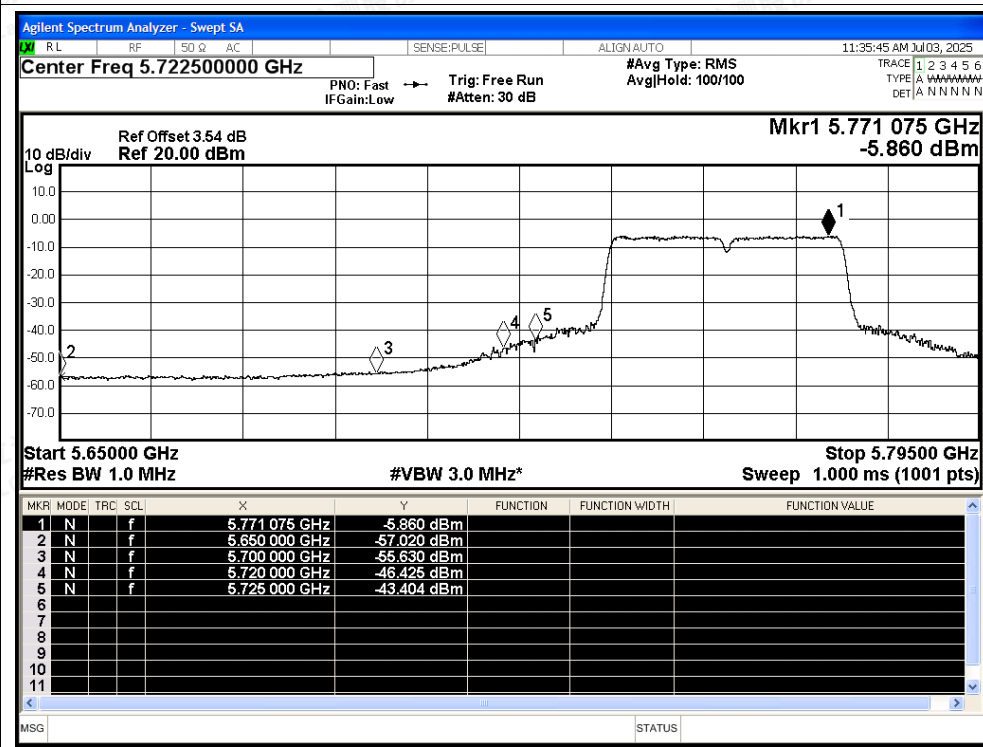

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant6 Peak

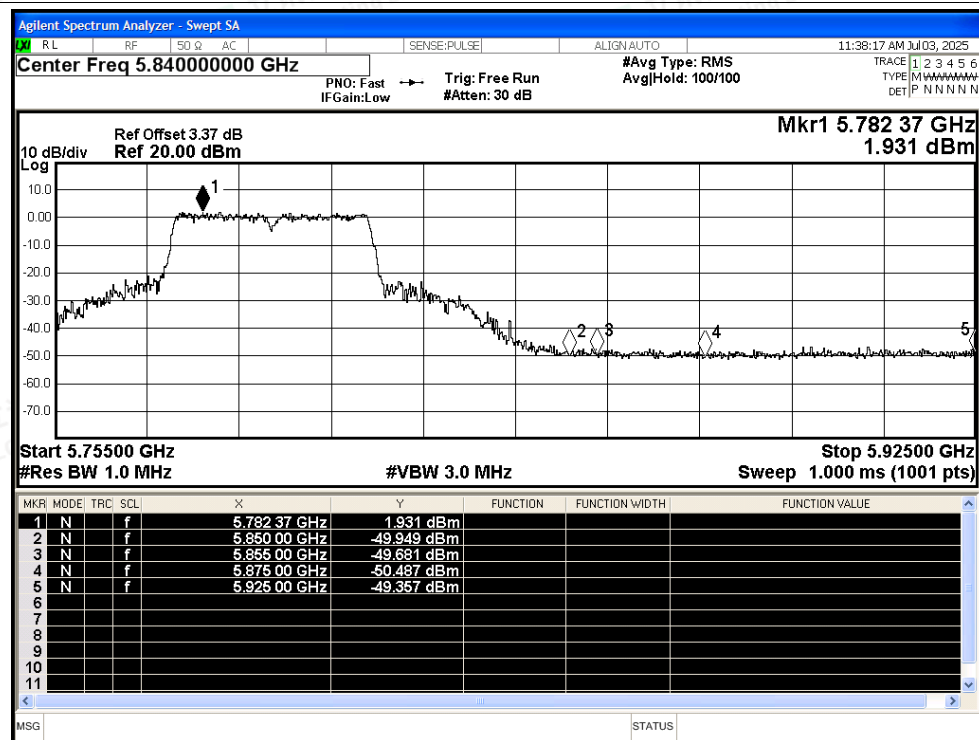

Restrict Band NVNT ax40 5795MHz Ant6 Average

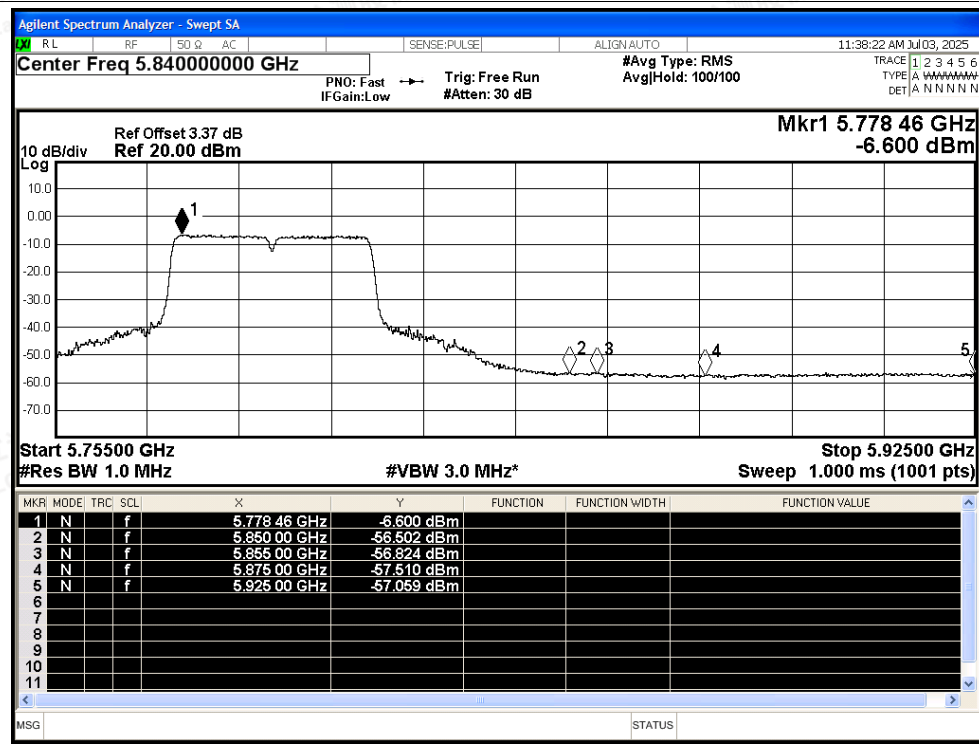

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant6 Peak

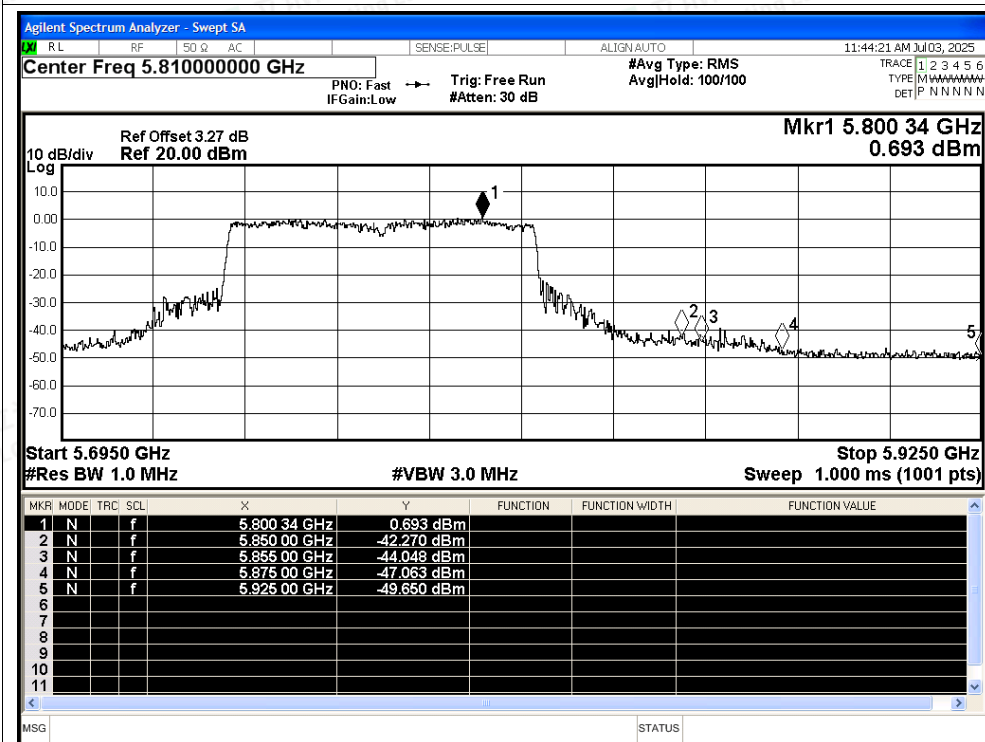

Restrict Band NVNT ax80 5775MHz Ant6 Average

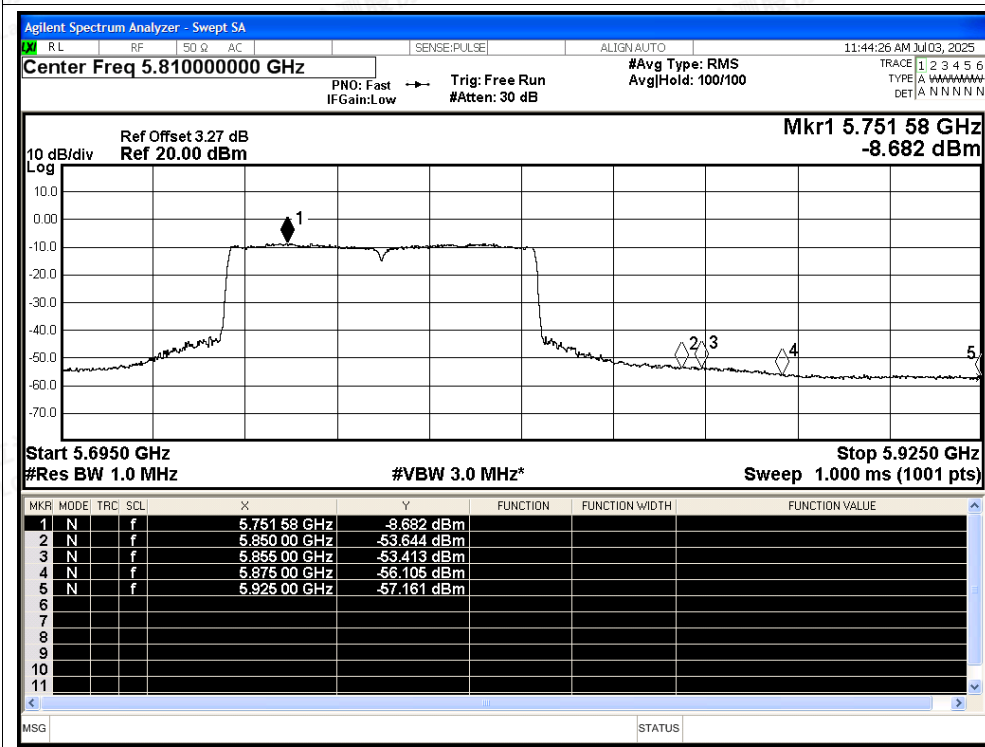

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant6 Peak

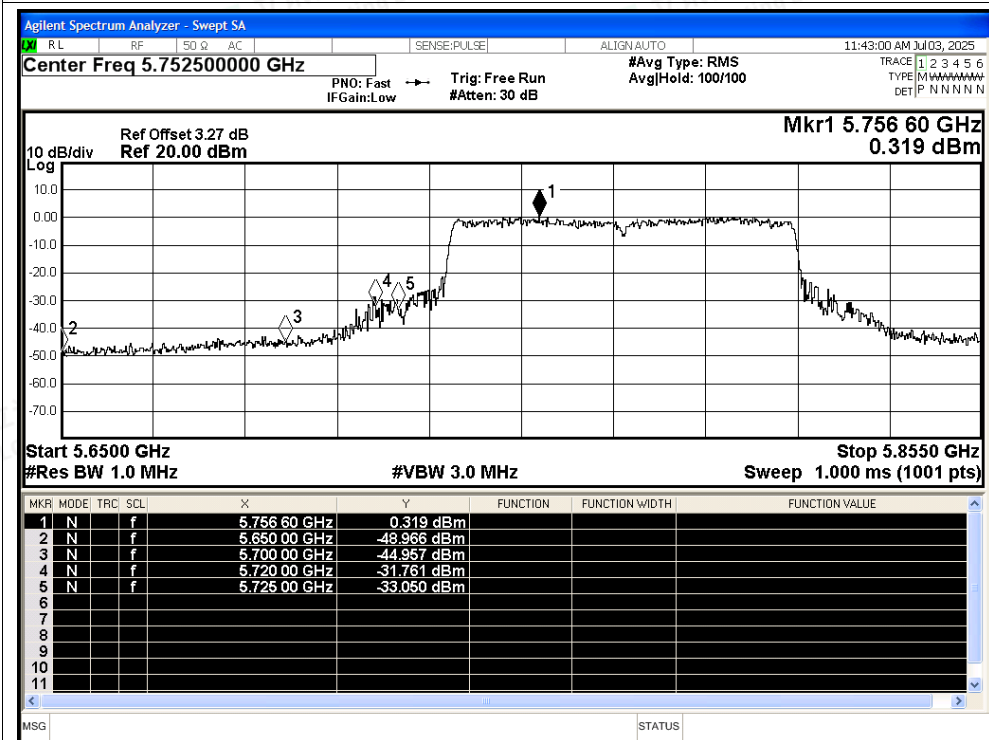

Restrict Band NVNT ax80 5775MHz Ant6 Average

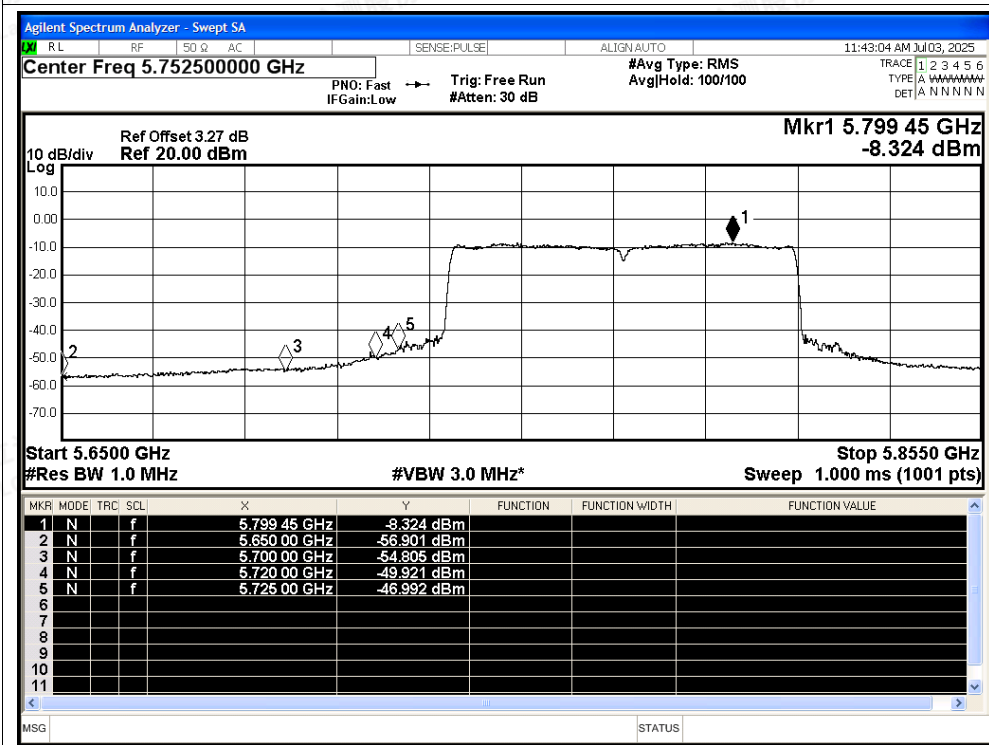

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant2 Power (dBm)	Ant3 Power (dBm)	SUM	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	-48.82	-47.45	-45.07	6.40	-38.73	Peak	-27	Pass
NVNT	n20	5745	-57.1	-57.33	-54.20	6.40	-47.86	Average	-27	Pass
NVNT	n20	5745	-46.93	-47.89	-44.37	6.40	-38.03	Peak	10	Pass
NVNT	n20	5745	-55.52	-55.45	-52.47	6.40	-46.13	Average	10	Pass
NVNT	n20	5745	-34.27	-32.77	-30.45	6.40	-24.11	Peak	15.6	Pass
NVNT	n20	5745	-46.55	-48.15	-44.27	6.40	-37.93	Average	15.6	Pass
NVNT	n20	5745	-26.21	-27	-23.58	6.40	-17.24	Peak	27	Pass
NVNT	n20	5745	-41.95	-41.32	-38.61	6.40	-32.27	Average	27	Pass
NVNT	n20	5825	-36.36	-35.17	-32.71	6.40	-26.37	Peak	27	Pass
NVNT	n20	5825	-48.12	-50.88	-46.27	6.40	-39.93	Average	27	Pass
NVNT	n20	5825	-38.47	-43.34	-37.25	6.40	-30.91	Peak	15.6	Pass
NVNT	n20	5825	-52.03	-54.38	-50.04	6.40	-43.70	Average	15.6	Pass
NVNT	n20	5825	-48.2	-46.32	-44.15	6.40	-37.81	Peak	10	Pass
NVNT	n20	5825	-56	-56.04	-53.01	6.40	-46.67	Average	10	Pass
NVNT	n20	5825	-49.16	-47.59	-45.29	6.40	-38.95	Peak	-27	Pass
NVNT	n20	5825	-55.69	-56.26	-52.96	6.40	-46.62	Average	-27	Pass
NVNT	n40	5755	-48.66	-48.66	-45.65	6.40	-39.31	Peak	-27	Pass
NVNT	n40	5755	-57.14	-56.98	-54.05	6.40	-47.71	Average	-27	Pass
NVNT	n40	5755	-44.68	-46.45	-42.47	6.40	-36.13	Peak	10	Pass
NVNT	n40	5755	-53.7	-54.72	-51.17	6.40	-44.83	Average	10	Pass
NVNT	n40	5755	-31.53	-29.83	-27.59	6.40	-21.25	Peak	15.6	Pass
NVNT	n40	5755	-45.13	-46.46	-42.73	6.40	-36.39	Average	15.6	Pass
NVNT	n40	5755	-27.33	-26.49	-23.88	6.40	-17.54	Peak	27	Pass
NVNT	n40	5755	-43.14	-44.17	-40.61	6.40	-34.27	Average	27	Pass
NVNT	n40	5795	-48.52	-47.36	-44.89	6.40	-38.55	Peak	27	Pass
NVNT	n40	5795	-57.03	-56.4	-53.69	6.40	-47.35	Average	27	Pass
NVNT	n40	5795	-47.63	-46.87	-44.22	6.40	-37.88	Peak	15.6	Pass
NVNT	n40	5795	-56.44	-55.89	-53.15	6.40	-46.81	Average	15.6	Pass
NVNT	n40	5795	-49	-46.41	-44.50	6.40	-38.16	Peak	10	Pass
NVNT	n40	5795	-57.92	-57.8	-54.85	6.40	-48.51	Average	10	Pass
NVNT	n40	5795	-49.09	-48.08	-45.55	6.40	-39.21	Peak	-27	Pass
NVNT	n40	5795	-57.17	-57.35	-54.25	6.40	-47.91	Average	-27	Pass
NVNT	ac20	5745	-49.44	-49.41	-46.41	6.40	-40.07	Peak	-27	Pass
NVNT	ac20	5745	-57.24	-56.73	-53.97	6.40	-47.63	Average	-27	Pass
NVNT	ac20	5745	-45.7	-47.53	-43.51	6.40	-37.17	Peak	10	Pass
NVNT	ac20	5745	-56.06	-55.97	-53.00	6.40	-46.66	Average	10	Pass
NVNT	ac20	5745	-31.79	-29.12	-27.24	6.40	-20.90	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	-48.28	-47.12	-44.65	6.40	-38.31	Average	15.6	Pass
NVNT	ac20	5745	-24.87	-26.44	-22.57	6.40	-16.23	Peak	27	Pass
NVNT	ac20	5745	-43.93	-42.67	-40.24	6.40	-33.90	Average	27	Pass
NVNT	ac20	5825	-35.6	-32.93	-31.05	6.40	-24.71	Peak	27	Pass
NVNT	ac20	5825	-48.41	-47.29	-44.80	6.40	-38.46	Average	27	Pass
NVNT	ac20	5825	-37.71	-38.8	-35.21	6.40	-28.87	Peak	15.6	Pass
NVNT	ac20	5825	-52.62	-52.68	-49.64	6.40	-43.3	Average	15.6	Pass
NVNT	ac20	5825	-46.18	-48.75	-44.27	6.40	-37.93	Peak	10	Pass
NVNT	ac20	5825	-55.35	-56.33	-52.80	6.40	-46.46	Average	10	Pass
NVNT	ac20	5825	-46.33	-48.94	-44.43	6.40	-38.09	Peak	-27	Pass
NVNT	ac20	5825	-56.29	-56.08	-53.17	6.40	-46.83	Average	-27	Pass
NVNT	ac40	5755	-47.46	-48.92	-45.12	6.40	-38.78	Peak	-27	Pass
NVNT	ac40	5755	-57.54	-57.03	-54.27	6.40	-47.93	Average	-27	Pass
NVNT	ac40	5755	-47.99	-45.66	-43.66	6.40	-37.32	Peak	10	Pass
NVNT	ac40	5755	-55.66	-54.64	-52.11	6.40	-45.77	Average	10	Pass
NVNT	ac40	5755	-24.97	-31.97	-24.18	6.40	-17.84	Peak	15.6	Pass
NVNT	ac40	5755	-43.04	-43.5	-40.25	6.40	-33.91	Average	15.6	Pass
NVNT	ac40	5755	-26.6	-25.12	-22.79	6.40	-16.45	Peak	27	Pass
NVNT	ac40	5755	-44.42	-40.86	-39.27	6.40	-32.93	Average	27	Pass
NVNT	ac40	5795	-47.25	-48.35	-44.75	6.40	-38.41	Peak	27	Pass
NVNT	ac40	5795	-56.07	-56.45	-53.25	6.40	-46.91	Average	27	Pass
NVNT	ac40	5795	-48.26	-48.48	-45.36	6.40	-39.02	Peak	15.6	Pass
NVNT	ac40	5795	-56.88	-56.94	-53.90	6.40	-47.56	Average	15.6	Pass
NVNT	ac40	5795	-50.15	-48.99	-46.52	6.40	-40.18	Peak	10	Pass
NVNT	ac40	5795	-58.09	-57.67	-54.86	6.40	-48.52	Average	10	Pass
NVNT	ac40	5795	-47.57	-49.83	-45.54	6.40	-39.2	Peak	-27	Pass
NVNT	ac40	5795	-57.22	-57.33	-54.26	6.40	-47.92	Average	-27	Pass
NVNT	ac80	5775	-45.74	-48.57	-43.92	6.40	-37.58	Peak	27	Pass
NVNT	ac80	5775	-54.23	-55.78	-51.93	6.40	-45.59	Average	27	Pass
NVNT	ac80	5775	-45.51	-46.82	-43.11	6.40	-36.77	Peak	15.6	Pass
NVNT	ac80	5775	-53.96	-56.84	-52.16	6.40	-45.82	Average	15.6	Pass
NVNT	ac80	5775	-47.69	-46.79	-44.21	6.40	-37.87	Peak	10	Pass
NVNT	ac80	5775	-55.96	-57.25	-53.55	6.40	-47.21	Average	10	Pass
NVNT	ac80	5775	-49.08	-50.04	-46.52	6.40	-40.18	Peak	-27	Pass
NVNT	ac80	5775	-56.95	-57.5	-54.21	6.40	-47.87	Average	-27	Pass
NVNT	ac80	5775	-48.39	-48.85	-45.60	6.40	-39.26	Peak	-27	Pass
NVNT	ac80	5775	-56.43	-57.2	-53.79	6.40	-47.45	Average	-27	Pass
NVNT	ac80	5775	-40.37	-46.83	-39.49	6.40	-33.15	Peak	10	Pass
NVNT	ac80	5775	-53.01	-55.12	-50.93	6.40	-44.59	Average	10	Pass
NVNT	ac80	5775	-33.11	-35.8	-31.24	6.40	-24.90	Peak	15.6	Pass
NVNT	ac80	5775	-48.94	-51.67	-47.08	6.40	-40.74	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	-32.96	-32.55	-29.74	6.40	-23.40	Peak	27	Pass
NVNT	ac80	5775	-47.27	-48.23	-44.71	6.40	-38.37	Average	27	Pass
NVNT	ax20	5745	-48.93	-48.99	-45.95	6.40	-39.61	Peak	-27	Pass
NVNT	ax20	5745	-56.8	-57.02	-53.90	6.40	-47.56	Average	-27	Pass
NVNT	ax20	5745	-46.7	-44.86	-42.67	6.40	-36.33	Peak	10	Pass
NVNT	ax20	5745	-54.72	-54.54	-51.62	6.40	-45.28	Average	10	Pass
NVNT	ax20	5745	-30.44	-30.85	-27.63	6.40	-21.29	Peak	15.6	Pass
NVNT	ax20	5745	-46.44	-45.88	-43.14	6.40	-36.8	Average	15.6	Pass
NVNT	ax20	5745	-24.19	-25.99	-21.99	6.40	-15.65	Peak	27	Pass
NVNT	ax20	5745	-39.54	-44.25	-38.28	6.40	-31.94	Average	27	Pass
NVNT	ax20	5825	-32.32	-32.26	-29.28	6.40	-22.94	Peak	27	Pass
NVNT	ax20	5825	-46.98	-47.17	-44.06	6.40	-37.72	Average	27	Pass
NVNT	ax20	5825	-37.23	-35.78	-33.43	6.40	-27.09	Peak	15.6	Pass
NVNT	ax20	5825	-50.83	-51.32	-48.06	6.40	-41.72	Average	15.6	Pass
NVNT	ax20	5825	-47.56	-48.05	-44.79	6.40	-38.45	Peak	10	Pass
NVNT	ax20	5825	-55.85	-55.89	-52.86	6.40	-46.52	Average	10	Pass
NVNT	ax20	5825	-47.38	-46.95	-44.15	6.40	-37.81	Peak	-27	Pass
NVNT	ax20	5825	-55.88	-55.89	-52.87	6.40	-46.53	Average	-27	Pass
NVNT	ax40	5755	-49.28	-48.31	-45.76	6.40	-39.42	Peak	-27	Pass
NVNT	ax40	5755	-57.18	-57.19	-54.17	6.40	-47.83	Average	-27	Pass
NVNT	ax40	5755	-46.24	-47.06	-43.62	6.40	-37.28	Peak	10	Pass
NVNT	ax40	5755	-55.01	-55.76	-52.36	6.40	-46.02	Average	10	Pass
NVNT	ax40	5755	-30.58	-32.62	-28.47	6.40	-22.13	Peak	15.6	Pass
NVNT	ax40	5755	-44.37	-47.97	-42.80	6.40	-36.46	Average	15.6	Pass
NVNT	ax40	5755	-26.75	-28.23	-24.42	6.40	-18.08	Peak	27	Pass
NVNT	ax40	5755	-42.36	-43.58	-39.92	6.40	-33.58	Average	27	Pass
NVNT	ax40	5795	-48.16	-48.21	-45.17	6.40	-38.83	Peak	27	Pass
NVNT	ax40	5795	-56	-56.82	-53.38	6.40	-47.04	Average	27	Pass
NVNT	ax40	5795	-47.01	-50	-45.24	6.40	-38.9	Peak	15.6	Pass
NVNT	ax40	5795	-56.39	-56.98	-53.66	6.40	-47.32	Average	15.6	Pass
NVNT	ax40	5795	-49.54	-50.7	-47.07	6.40	-40.73	Peak	10	Pass
NVNT	ax40	5795	-57.84	-57.81	-54.81	6.40	-48.47	Average	10	Pass
NVNT	ax40	5795	-49.65	-50.81	-47.18	6.40	-40.84	Peak	-27	Pass
NVNT	ax40	5795	-57.19	-57.35	-54.26	6.40	-47.92	Average	-27	Pass
NVNT	ax80	5775	-47.37	-45.59	-43.38	6.40	-37.04	Peak	27	Pass
NVNT	ax80	5775	-55.2	-55.89	-52.52	6.40	-46.18	Average	27	Pass
NVNT	ax80	5775	-46.97	-45.79	-43.33	6.40	-36.99	Peak	15.6	Pass
NVNT	ax80	5775	-55.84	-56.09	-52.95	6.40	-46.61	Average	15.6	Pass
NVNT	ax80	5775	-49.26	-48.81	-46.02	6.40	-39.68	Peak	10	Pass
NVNT	ax80	5775	-57.31	-56.72	-53.99	6.40	-47.65	Average	10	Pass
NVNT	ax80	5775	-49.43	-49.26	-46.33	6.40	-39.99	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	-57.12	-56.99	-54.04	6.40	-47.70	Average	-27	Pass
NVNT	ax80	5775	-49.53	-48.09	-45.74	6.40	-39.40	Peak	-27	Pass
NVNT	ax80	5775	-56.9	-57	-53.94	6.40	-47.60	Average	-27	Pass
NVNT	ax80	5775	-46.5	-45.98	-43.22	6.40	-36.88	Peak	10	Pass
NVNT	ax80	5775	-54.76	-54.97	-51.85	6.40	-45.51	Average	10	Pass
NVNT	ax80	5775	-38.05	-41.1	-36.30	6.40	-29.96	Peak	15.6	Pass
NVNT	ax80	5775	-50.26	-51.6	-47.87	6.40	-41.53	Average	15.6	Pass
NVNT	ax80	5775	-30.21	-32.44	-28.17	6.40	-21.83	Peak	27	Pass
NVNT	ax80	5775	-49.33	-50.67	-46.94	6.40	-40.60	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant5 Power (dBm)	Ant6 Power (dBm)	SUM	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	-48.12	-49.14	-45.59	6.94	-38.65	Peak	-27	Pass
NVNT	n20	5745	-56.81	-57.53	-54.14	6.94	-47.20	Average	-27	Pass
NVNT	n20	5745	-46.74	-46.47	-43.59	6.94	-36.65	Peak	10	Pass
NVNT	n20	5745	-55.07	-55.78	-52.40	6.94	-45.46	Average	10	Pass
NVNT	n20	5745	-28.94	-35.71	-28.11	6.94	-21.17	Peak	15.6	Pass
NVNT	n20	5745	-47.55	-51.3	-46.02	6.94	-39.08	Average	15.6	Pass
NVNT	n20	5745	-24.7	-28.69	-23.24	6.94	-16.30	Peak	27	Pass
NVNT	n20	5745	-39.58	-46.44	-38.77	6.94	-31.83	Average	27	Pass
NVNT	n20	5825	-32.7	-37.83	-31.54	6.94	-24.60	Peak	27	Pass
NVNT	n20	5825	-45.76	-51.52	-44.74	6.94	-37.80	Average	27	Pass
NVNT	n20	5825	-36.17	-44.04	-35.51	6.94	-28.57	Peak	15.6	Pass
NVNT	n20	5825	-50.78	-53.95	-49.07	6.94	-42.13	Average	15.6	Pass
NVNT	n20	5825	-47.38	-48.39	-44.85	6.94	-37.91	Peak	10	Pass
NVNT	n20	5825	-55.29	-55.89	-52.57	6.94	-45.63	Average	10	Pass
NVNT	n20	5825	-48.67	-48.13	-45.38	6.94	-38.44	Peak	-27	Pass
NVNT	n20	5825	-56.07	-56.3	-53.17	6.94	-46.23	Average	-27	Pass
NVNT	n40	5755	-48.23	-49.78	-45.93	6.94	-38.99	Peak	-27	Pass
NVNT	n40	5755	-57.16	-56.98	-54.06	6.94	-47.12	Average	-27	Pass
NVNT	n40	5755	-47.48	-48.66	-45.02	6.94	-38.08	Peak	10	Pass
NVNT	n40	5755	-55.85	-56.52	-53.16	6.94	-46.22	Average	10	Pass
NVNT	n40	5755	-32.83	-32.03	-29.40	6.94	-22.46	Peak	15.6	Pass
NVNT	n40	5755	-47.75	-48.56	-45.13	6.94	-38.19	Average	15.6	Pass
NVNT	n40	5755	-24.87	-28.13	-23.19	6.94	-16.25	Peak	27	Pass
NVNT	n40	5755	-44.23	-42.85	-40.48	6.94	-33.54	Average	27	Pass
NVNT	n40	5795	-50.04	-49.31	-46.65	6.94	-39.71	Peak	27	Pass
NVNT	n40	5795	-56.98	-56.45	-53.70	6.94	-46.76	Average	27	Pass
NVNT	n40	5795	-50.21	-49.3	-46.72	6.94	-39.78	Peak	15.6	Pass
NVNT	n40	5795	-57.41	-56.75	-54.06	6.94	-47.12	Average	15.6	Pass
NVNT	n40	5795	-48.55	-48.71	-45.62	6.94	-38.68	Peak	10	Pass
NVNT	n40	5795	-57.44	-58.09	-54.74	6.94	-47.80	Average	10	Pass
NVNT	n40	5795	-49.9	-50.27	-47.07	6.94	-40.13	Peak	-27	Pass
NVNT	n40	5795	-56.85	-57.27	-54.04	6.94	-47.10	Average	-27	Pass
NVNT	ac20	5745	-48.65	-48.94	-45.78	6.94	-38.84	Peak	-27	Pass
NVNT	ac20	5745	-56.58	-56.4	-53.48	6.94	-46.54	Average	-27	Pass
NVNT	ac20	5745	-46.8	-46.94	-43.86	6.94	-36.92	Peak	10	Pass
NVNT	ac20	5745	-54.58	-56.1	-52.26	6.94	-45.32	Average	10	Pass
NVNT	ac20	5745	-32.04	-34.9	-30.23	6.94	-23.29	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	-45.43	-48.82	-43.79	6.94	-36.85	Average	15.6	Pass
NVNT	ac20	5745	-24.17	-26.73	-22.25	6.94	-15.31	Peak	27	Pass
NVNT	ac20	5745	-37.72	-43.3	-36.66	6.94	-29.72	Average	27	Pass
NVNT	ac20	5825	-31.27	-34.69	-29.64	6.94	-22.70	Peak	27	Pass
NVNT	ac20	5825	-44.96	-47.25	-42.95	6.94	-36.01	Average	27	Pass
NVNT	ac20	5825	-36.91	-39.74	-35.09	6.94	-28.15	Peak	15.6	Pass
NVNT	ac20	5825	-51.3	-51.53	-48.40	6.94	-41.46	Average	15.6	Pass
NVNT	ac20	5825	-47.42	-46.94	-44.16	6.94	-37.22	Peak	10	Pass
NVNT	ac20	5825	-55.56	-56.33	-52.92	6.94	-45.98	Average	10	Pass
NVNT	ac20	5825	-47.17	-47.47	-44.31	6.94	-37.37	Peak	-27	Pass
NVNT	ac20	5825	-55.93	-55.9	-52.90	6.94	-45.96	Average	-27	Pass
NVNT	ac40	5755	-50.23	-48.36	-46.18	6.94	-39.24	Peak	-27	Pass
NVNT	ac40	5755	-57.55	-57.05	-54.28	6.94	-47.34	Average	-27	Pass
NVNT	ac40	5755	-47.72	-46.48	-44.05	6.94	-37.11	Peak	10	Pass
NVNT	ac40	5755	-55.63	-54.72	-52.14	6.94	-45.20	Average	10	Pass
NVNT	ac40	5755	-32.92	-31.62	-29.21	6.94	-22.27	Peak	15.6	Pass
NVNT	ac40	5755	-46.65	-42.41	-41.02	6.94	-34.08	Average	15.6	Pass
NVNT	ac40	5755	-29.53	-28.43	-25.93	6.94	-18.99	Peak	27	Pass
NVNT	ac40	5755	-45.54	-41.85	-40.30	6.94	-33.36	Average	27	Pass
NVNT	ac40	5795	-48.74	-49.46	-46.07	6.94	-39.13	Peak	27	Pass
NVNT	ac40	5795	-57.94	-56.51	-54.16	6.94	-47.22	Average	27	Pass
NVNT	ac40	5795	-48.35	-49.65	-45.94	6.94	-39.00	Peak	15.6	Pass
NVNT	ac40	5795	-57.02	-56.6	-53.79	6.94	-46.85	Average	15.6	Pass
NVNT	ac40	5795	-49.14	-49.87	-46.48	6.94	-39.54	Peak	10	Pass
NVNT	ac40	5795	-57.82	-57.28	-54.53	6.94	-47.59	Average	10	Pass
NVNT	ac40	5795	-48.48	-49.34	-45.88	6.94	-38.94	Peak	-27	Pass
NVNT	ac40	5795	-57.28	-56.84	-54.04	6.94	-47.10	Average	-27	Pass
NVNT	ac80	5775	-46.76	-42.14	-40.85	6.94	-33.91	Peak	27	Pass
NVNT	ac80	5775	-55.37	-54.26	-51.77	6.94	-44.83	Average	27	Pass
NVNT	ac80	5775	-46.12	-42.62	-41.02	6.94	-34.08	Peak	15.6	Pass
NVNT	ac80	5775	-55.7	-53.47	-51.43	6.94	-44.49	Average	15.6	Pass
NVNT	ac80	5775	-48.4	-46.65	-44.43	6.94	-37.49	Peak	10	Pass
NVNT	ac80	5775	-57.03	-56.12	-53.54	6.94	-46.60	Average	10	Pass
NVNT	ac80	5775	-49.59	-48.34	-45.91	6.94	-38.97	Peak	-27	Pass
NVNT	ac80	5775	-56.99	-56.81	-53.89	6.94	-46.95	Average	-27	Pass
NVNT	ac80	5775	-48.21	-48.98	-45.57	6.94	-38.63	Peak	-27	Pass
NVNT	ac80	5775	-57.09	-56.6	-53.83	6.94	-46.89	Average	-27	Pass
NVNT	ac80	5775	-46.51	-45.1	-42.74	6.94	-35.80	Peak	10	Pass
NVNT	ac80	5775	-54	-53.94	-50.96	6.94	-44.02	Average	10	Pass
NVNT	ac80	5775	-30.52	-28.33	-26.28	6.94	-19.34	Peak	15.6	Pass
NVNT	ac80	5775	-50.72	-50.22	-47.45	6.94	-40.51	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	-31.6	-29.92	-27.67	6.94	-20.73	Peak	27	Pass
NVNT	ac80	5775	-48.94	-47.38	-45.08	6.94	-38.14	Average	27	Pass
NVNT	ax20	5745	-46.95	-49.78	-45.13	6.94	-38.19	Peak	-27	Pass
NVNT	ax20	5745	-57.29	-57.6	-54.43	6.94	-47.49	Average	-27	Pass
NVNT	ax20	5745	-48.22	-47.69	-44.94	6.94	-38.00	Peak	10	Pass
NVNT	ax20	5745	-55.78	-55.48	-52.62	6.94	-45.68	Average	10	Pass
NVNT	ax20	5745	-34.48	-33.63	-31.02	6.94	-24.08	Peak	15.6	Pass
NVNT	ax20	5745	-49.41	-47.92	-45.59	6.94	-38.65	Average	15.6	Pass
NVNT	ax20	5745	-21.28	-26.52	-20.14	6.94	-13.20	Peak	27	Pass
NVNT	ax20	5745	-42.36	-43.04	-39.68	6.94	-32.74	Average	27	Pass
NVNT	ax20	5825	-35.31	-33.01	-31.00	6.94	-24.06	Peak	27	Pass
NVNT	ax20	5825	-49.06	-48.39	-45.70	6.94	-38.76	Average	27	Pass
NVNT	ax20	5825	-41.92	-40.13	-37.92	6.94	-30.98	Peak	15.6	Pass
NVNT	ax20	5825	-52.96	-52.21	-49.56	6.94	-42.62	Average	15.6	Pass
NVNT	ax20	5825	-48.52	-48.62	-45.56	6.94	-38.62	Peak	10	Pass
NVNT	ax20	5825	-55.97	-55.53	-52.73	6.94	-45.79	Average	10	Pass
NVNT	ax20	5825	-48.41	-48.56	-45.47	6.94	-38.53	Peak	-27	Pass
NVNT	ax20	5825	-56.7	-55.84	-53.24	6.94	-46.30	Average	-27	Pass
NVNT	ax40	5755	-47.92	-50.36	-45.96	6.94	-39.02	Peak	-27	Pass
NVNT	ax40	5755	-57.08	-57.02	-54.04	6.94	-47.10	Average	-27	Pass
NVNT	ax40	5755	-47.35	-47.73	-44.53	6.94	-37.59	Peak	10	Pass
NVNT	ax40	5755	-55.96	-55.63	-52.78	6.94	-45.84	Average	10	Pass
NVNT	ax40	5755	-33.62	-32.35	-29.93	6.94	-22.99	Peak	15.6	Pass
NVNT	ax40	5755	-47.61	-46.43	-43.97	6.94	-37.03	Average	15.6	Pass
NVNT	ax40	5755	-27.54	-28.65	-25.05	6.94	-18.11	Peak	27	Pass
NVNT	ax40	5755	-44.08	-43.4	-40.72	6.94	-33.78	Average	27	Pass
NVNT	ax40	5795	-47.85	-49.95	-45.76	6.94	-38.82	Peak	27	Pass
NVNT	ax40	5795	-56.93	-56.5	-53.70	6.94	-46.76	Average	27	Pass
NVNT	ax40	5795	-49.7	-49.68	-46.68	6.94	-39.74	Peak	15.6	Pass
NVNT	ax40	5795	-56.95	-56.82	-53.87	6.94	-46.93	Average	15.6	Pass
NVNT	ax40	5795	-48.61	-50.49	-46.44	6.94	-39.50	Peak	10	Pass
NVNT	ax40	5795	-57.68	-57.51	-54.58	6.94	-47.64	Average	10	Pass
NVNT	ax40	5795	-48.36	-49.36	-45.82	6.94	-38.88	Peak	-27	Pass
NVNT	ax40	5795	-57.11	-57.06	-54.07	6.94	-47.13	Average	-27	Pass
NVNT	ax80	5775	-48.84	-42.27	-41.41	6.94	-34.47	Peak	27	Pass
NVNT	ax80	5775	-55.39	-53.64	-51.42	6.94	-44.48	Average	27	Pass
NVNT	ax80	5775	-47.79	-44.05	-42.52	6.94	-35.58	Peak	15.6	Pass
NVNT	ax80	5775	-55.99	-53.41	-51.50	6.94	-44.56	Average	15.6	Pass
NVNT	ax80	5775	-48.92	-47.06	-44.88	6.94	-37.94	Peak	10	Pass
NVNT	ax80	5775	-56.28	-56.11	-53.18	6.94	-46.24	Average	10	Pass
NVNT	ax80	5775	-49.91	-49.65	-46.77	6.94	-39.83	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	-56.78	-57.16	-53.96	6.94	-47.02	Average	-27	Pass
NVNT	ax80	5775	-50.25	-48.97	-46.55	6.94	-39.61	Peak	-27	Pass
NVNT	ax80	5775	-56.86	-56.9	-53.87	6.94	-46.93	Average	-27	Pass
NVNT	ax80	5775	-44.85	-44.96	-41.89	6.94	-34.95	Peak	10	Pass
NVNT	ax80	5775	-54.12	-54.81	-51.44	6.94	-44.50	Average	10	Pass
NVNT	ax80	5775	-37.44	-31.76	-30.72	6.94	-23.78	Peak	15.6	Pass
NVNT	ax80	5775	-50.62	-49.92	-47.25	6.94	-40.31	Average	15.6	Pass
NVNT	ax80	5775	-30.91	-33.05	-28.84	6.94	-21.90	Peak	27	Pass
NVNT	ax80	5775	-48.7	-46.99	-44.75	6.94	-37.81	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant2	5745.02	20000	3.48	25	Pass
NVNT	a	5785	Ant2	5785.02	20000	3.46	25	Pass
NVNT	a	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant2	5785	0	0	25	Pass
NVNT	n20	5825	Ant2	5825	0	0	25	Pass
NVNT	n40	5755	Ant2	5755	0	0	25	Pass
NVNT	n40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac20	5745	Ant2	5745	0	0	25	Pass
NVNT	ac20	5785	Ant2	5785	0	0	25	Pass
NVNT	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant2	5755	0	0	25	Pass
NVNT	ac40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass
NVNT	ax20	5745	Ant2	5745	0	0	25	Pass
NVNT	ax20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant2	5825	0	0	25	Pass
NVNT	ax40	5755	Ant2	5755	0	0	25	Pass
NVNT	ax40	5795	Ant2	5795.04	40000	6.9	25	Pass
NVNT	ax80	5775	Ant2	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant2

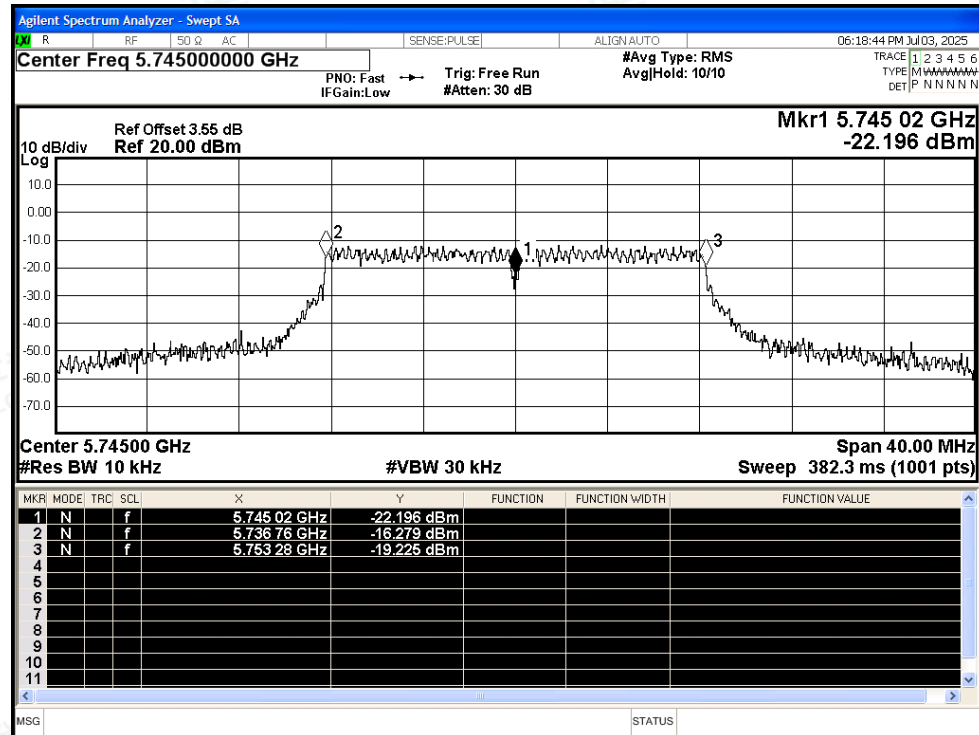

Freq. Stability NVNT a 5785MHz Ant2

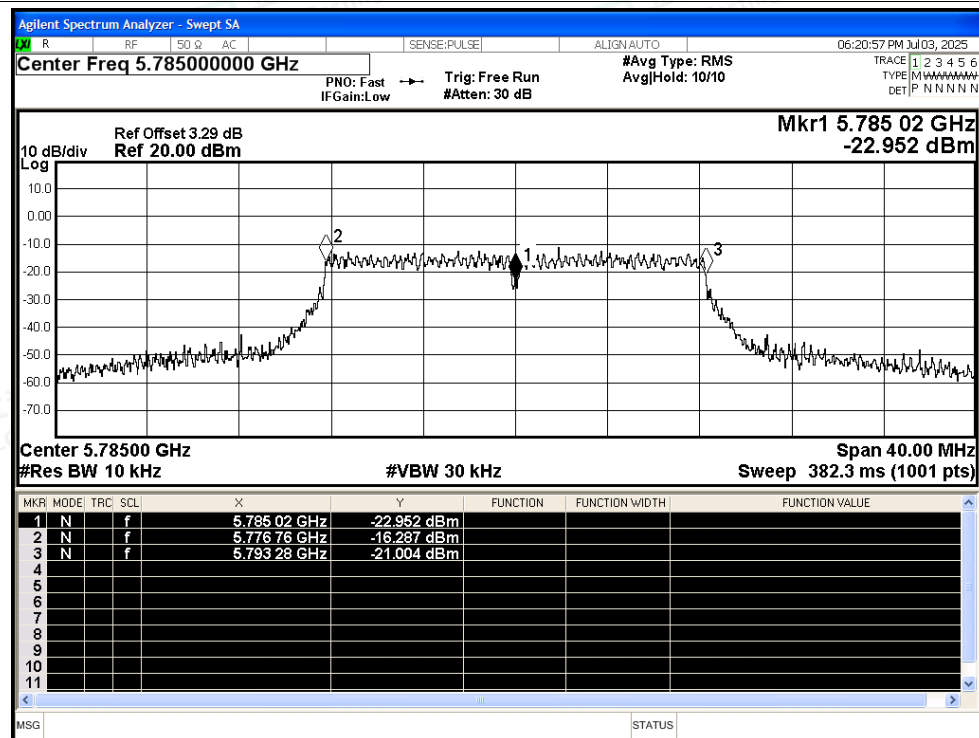

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant2

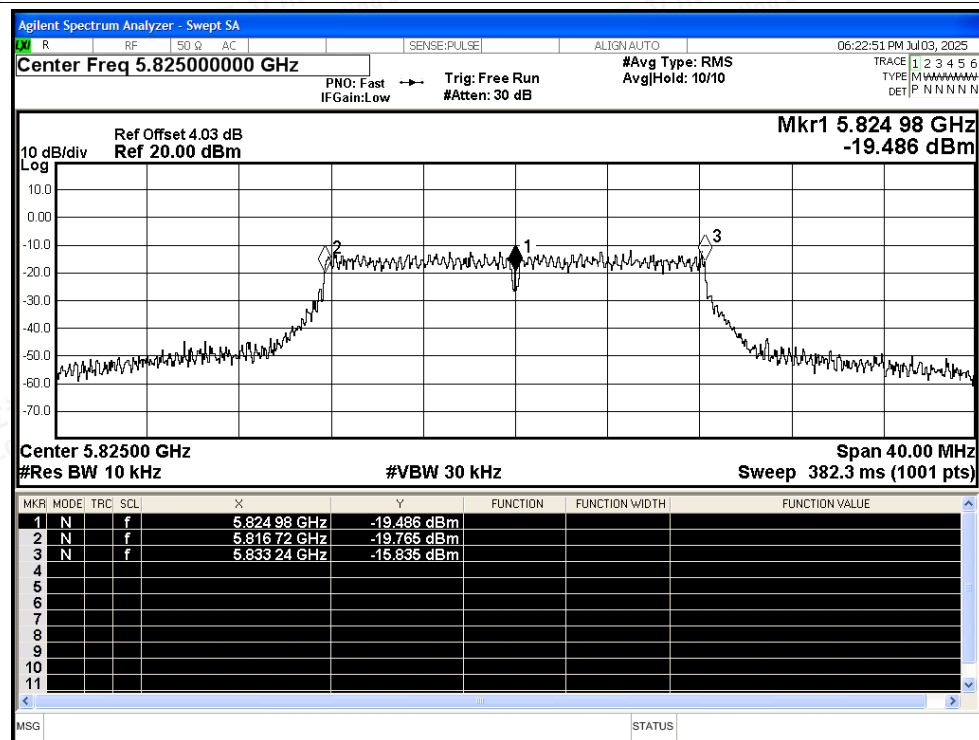

Freq. Stability NVNT n20 5745MHz Ant2

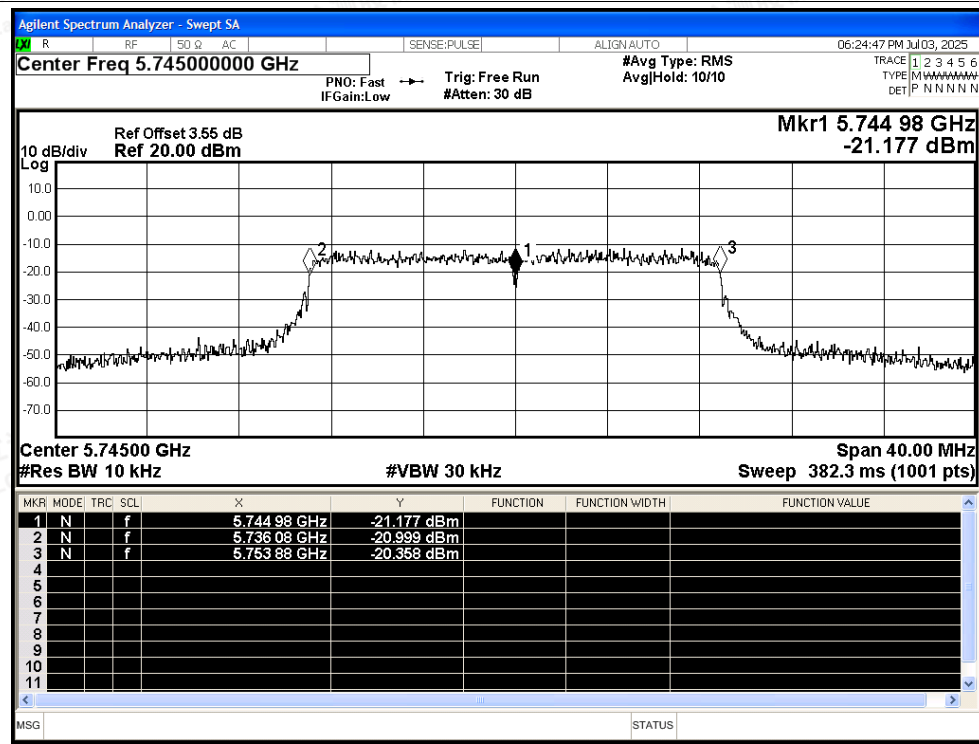

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant2

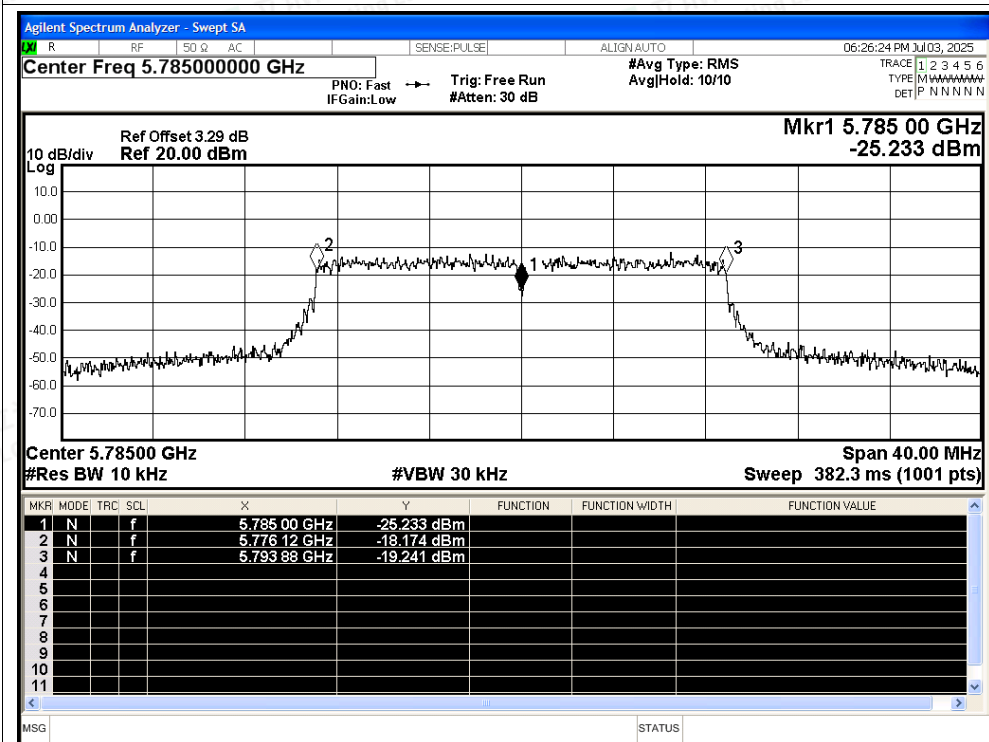

Freq. Stability NVNT n20 5825MHz Ant2

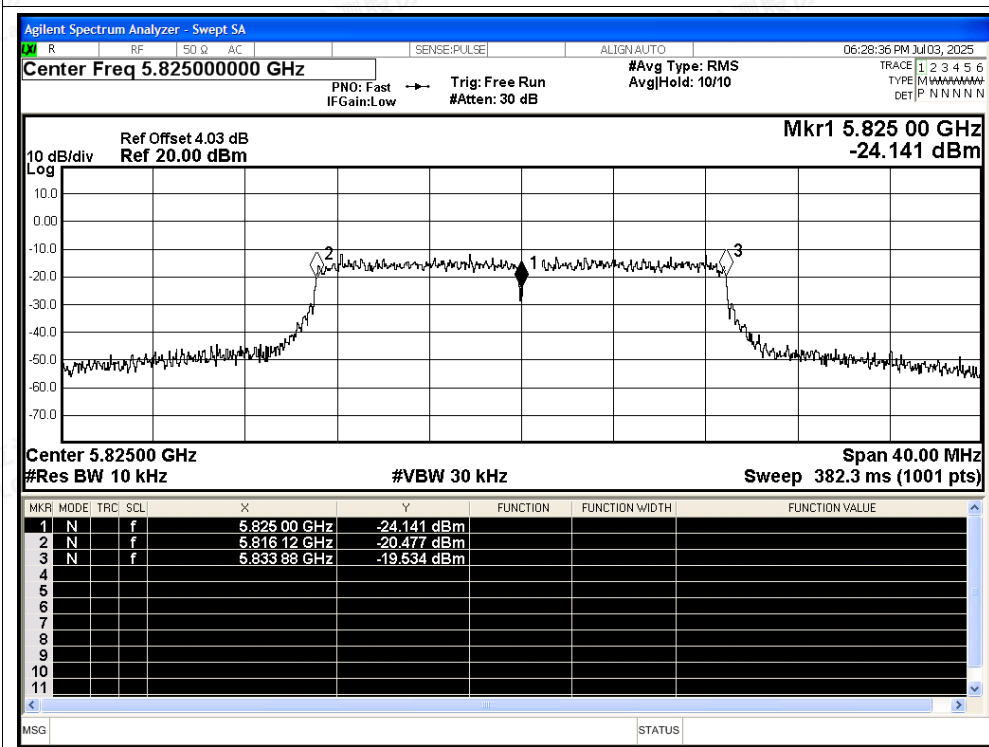

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant2

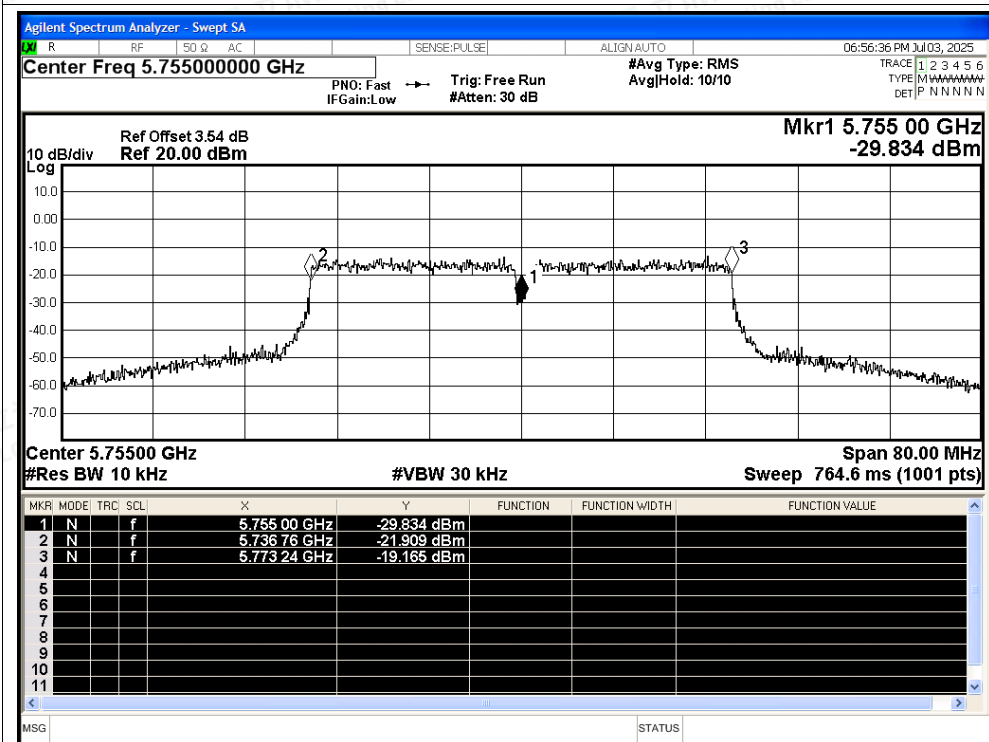

Freq. Stability NVNT n40 5795MHz Ant2

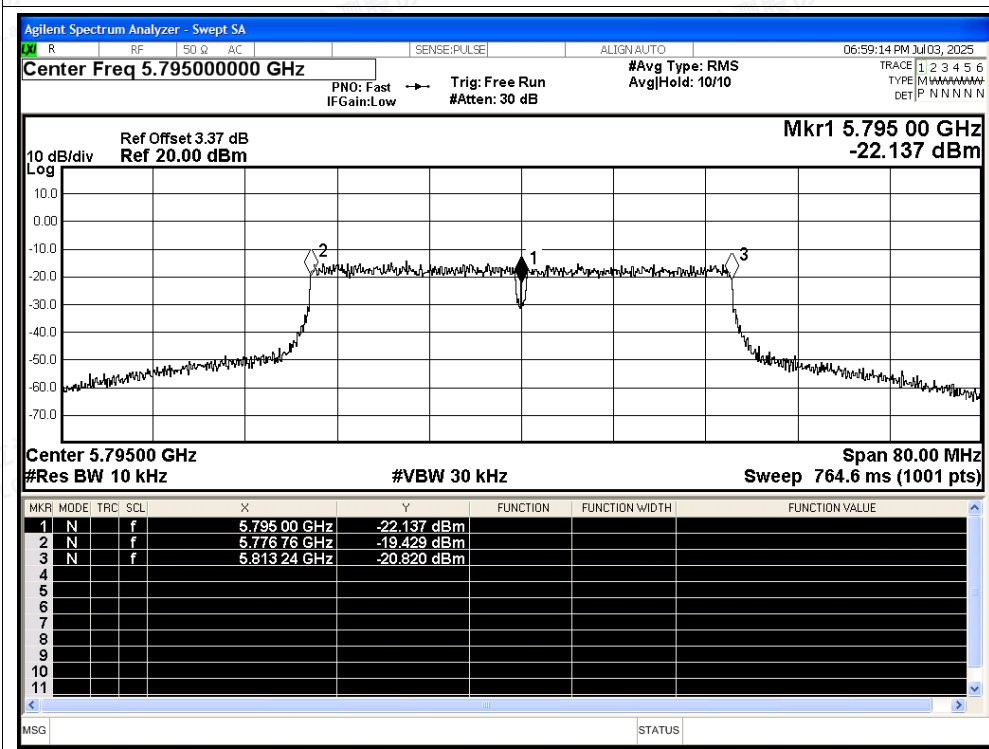

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant2

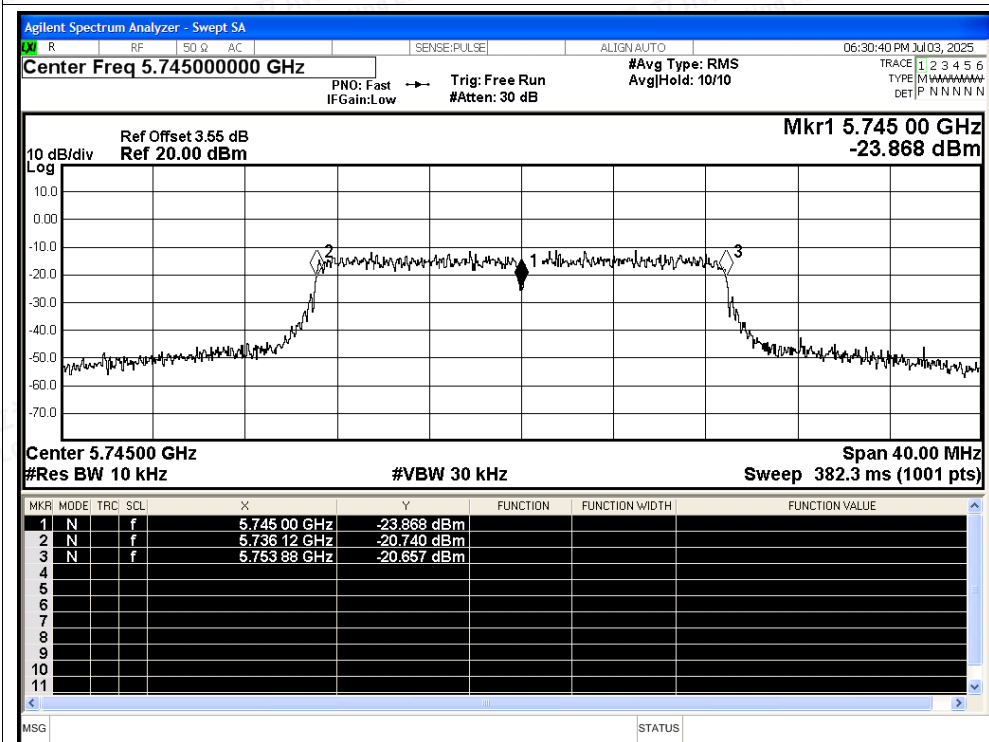

Freq. Stability NVNT ac20 5785MHz Ant2

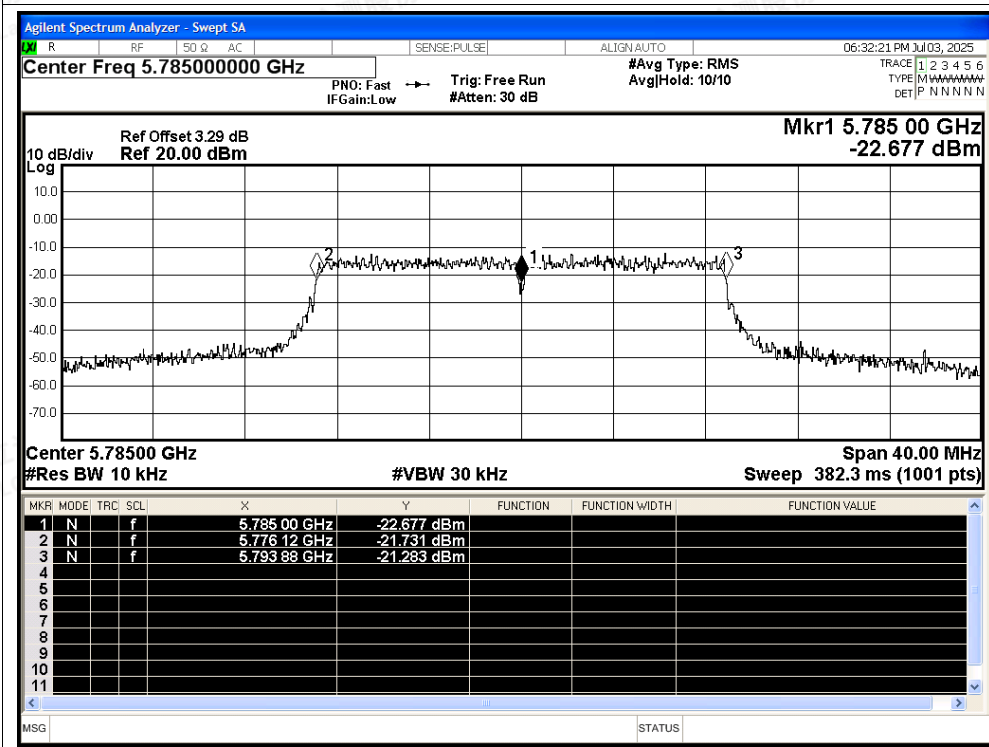

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

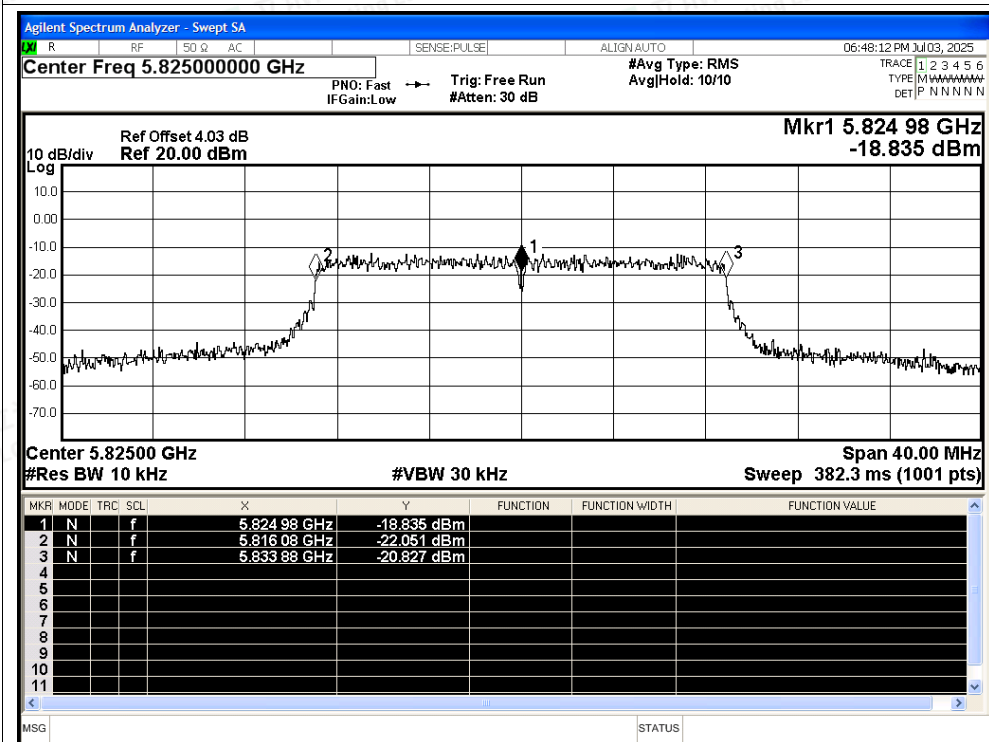

Freq. Stability NVNT ac40 5755MHz Ant2

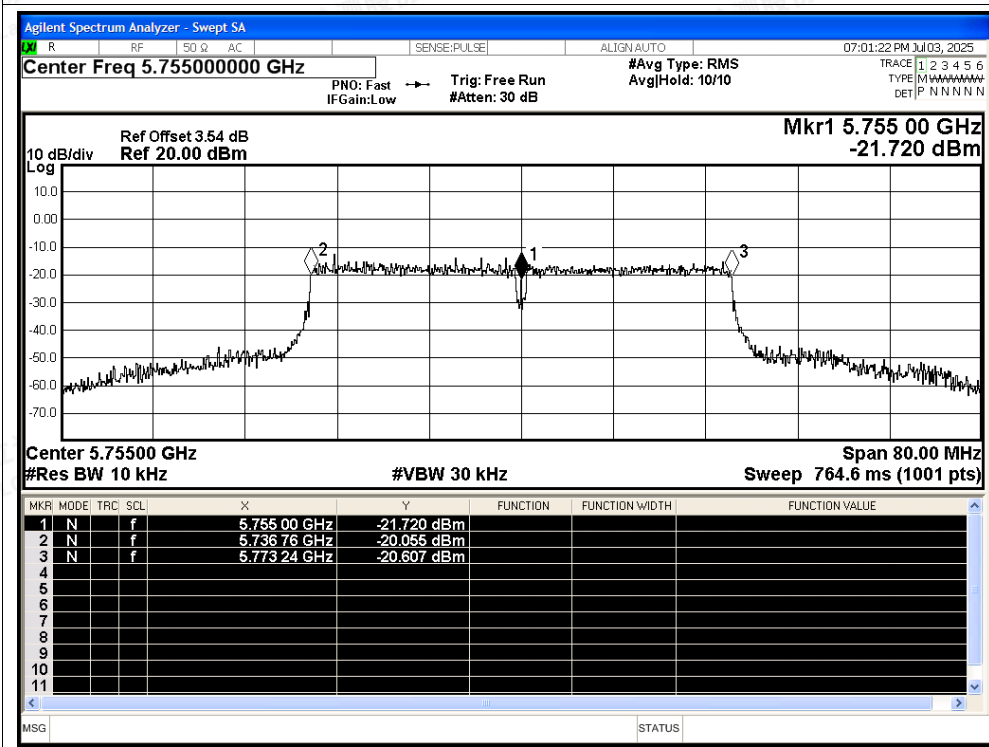

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant2

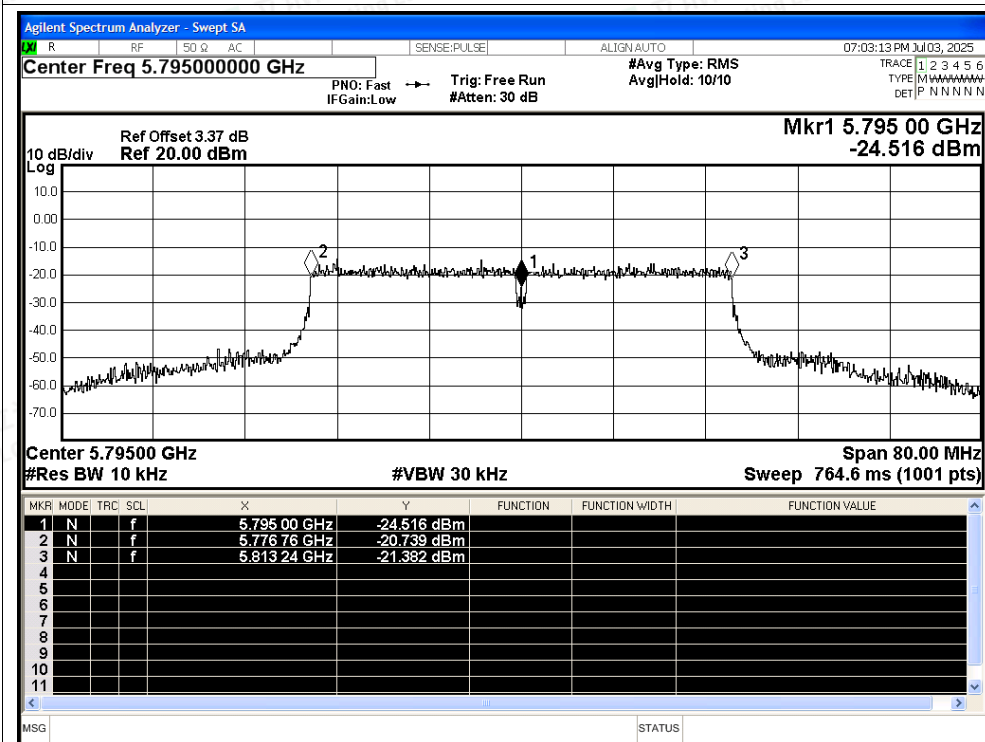

Freq. Stability NVNT ac80 5775MHz Ant2

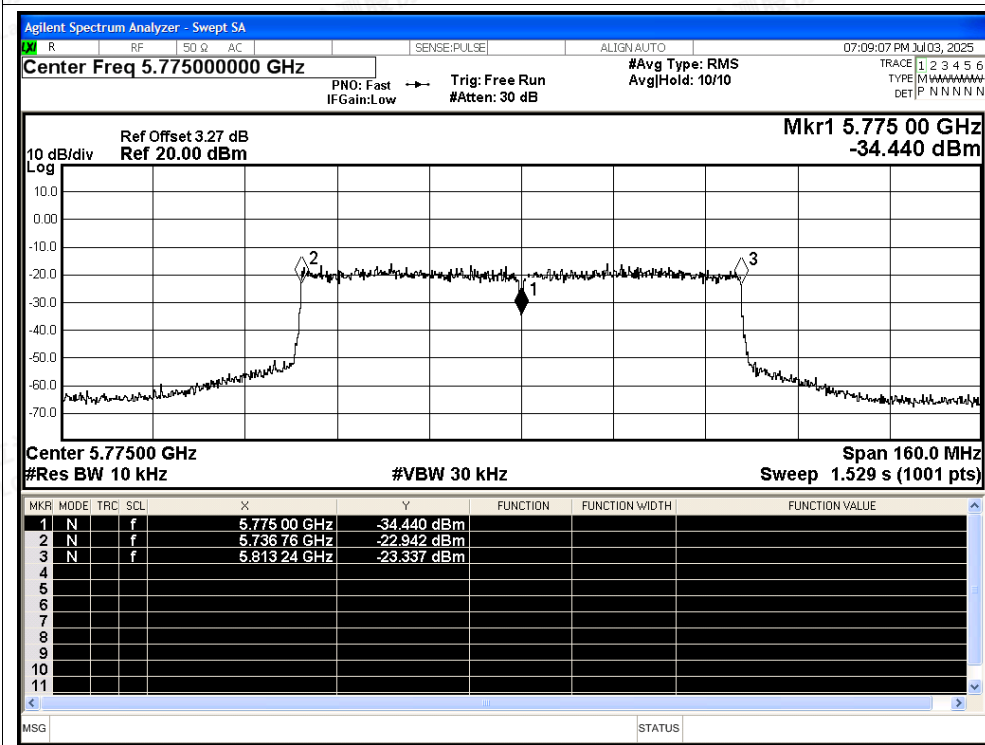

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant2

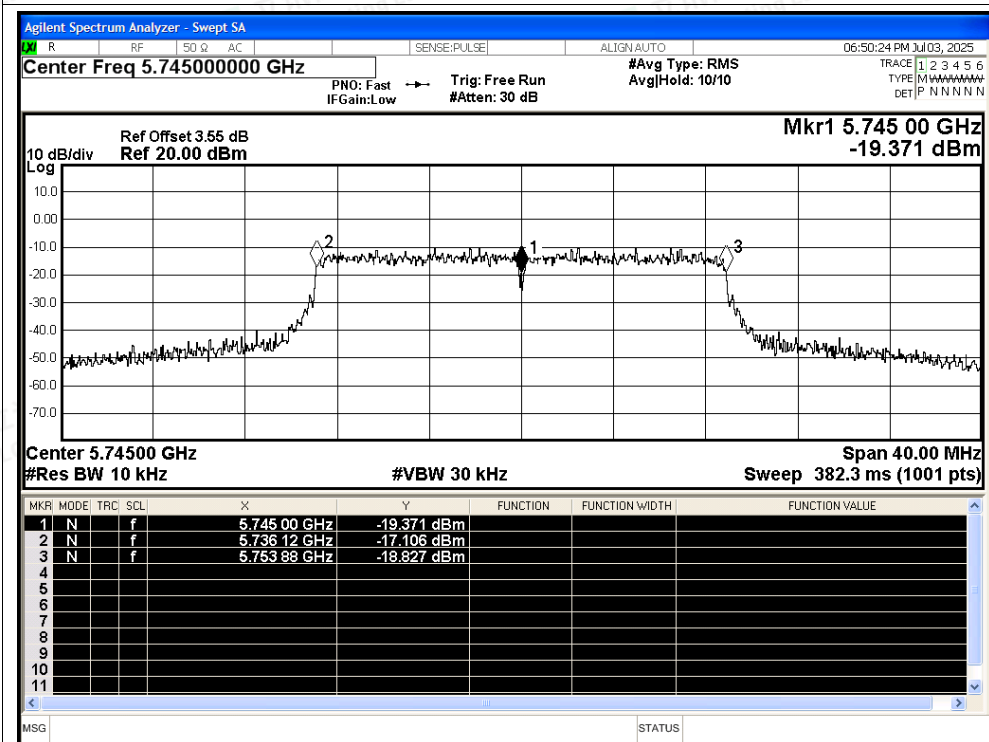

Freq. Stability NVNT ax20 5785MHz Ant2

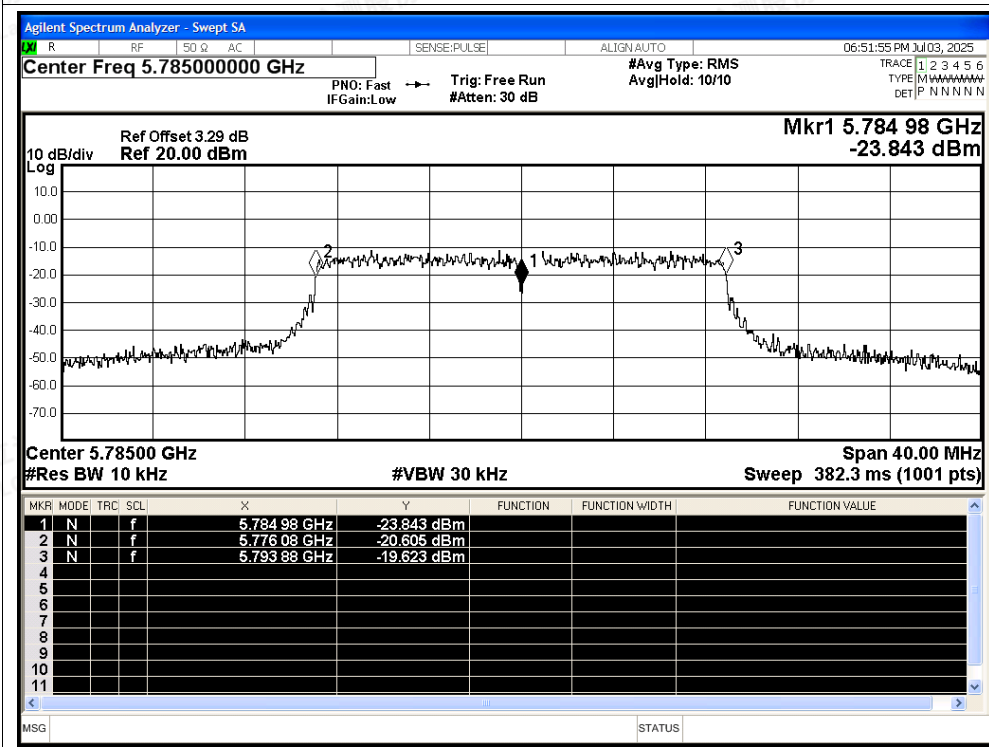

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant2

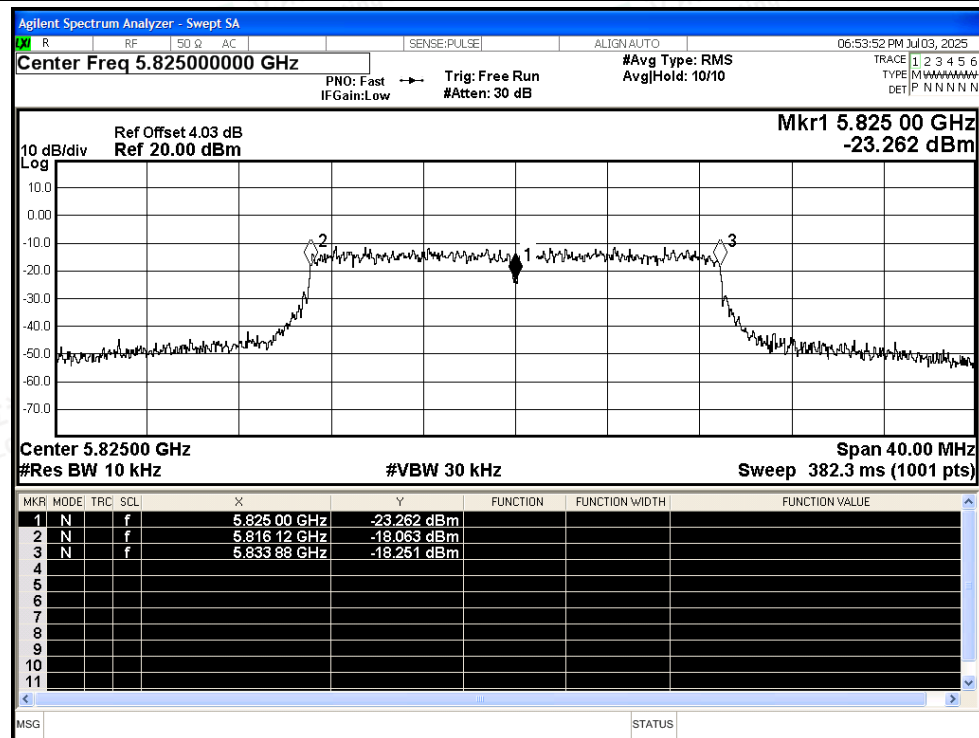

Freq. Stability NVNT ax40 5755MHz Ant2

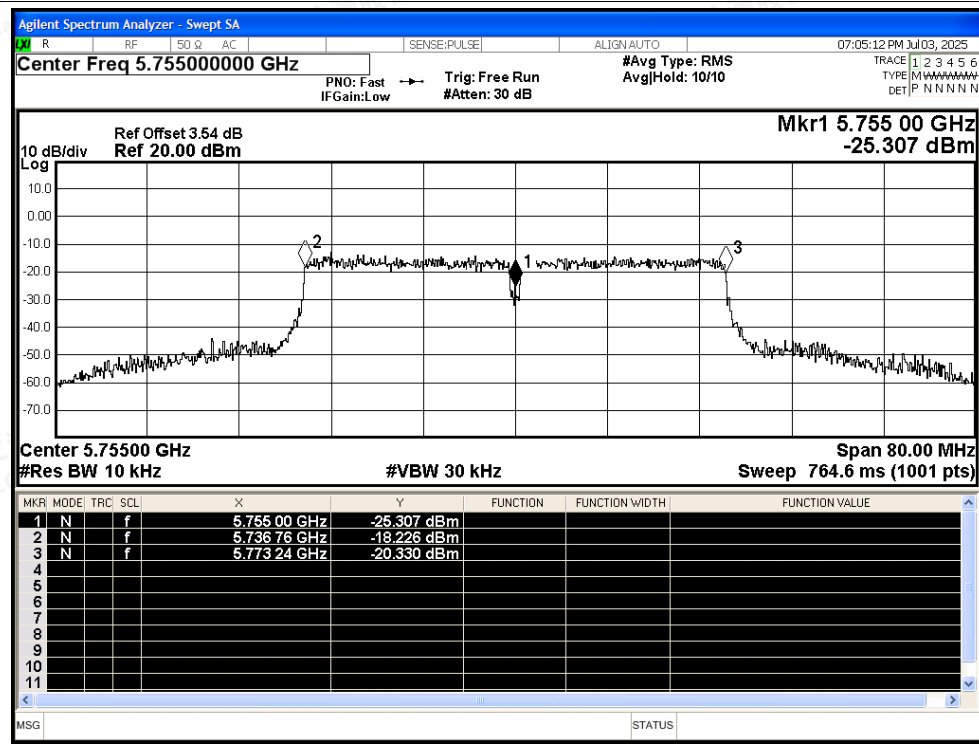

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant2

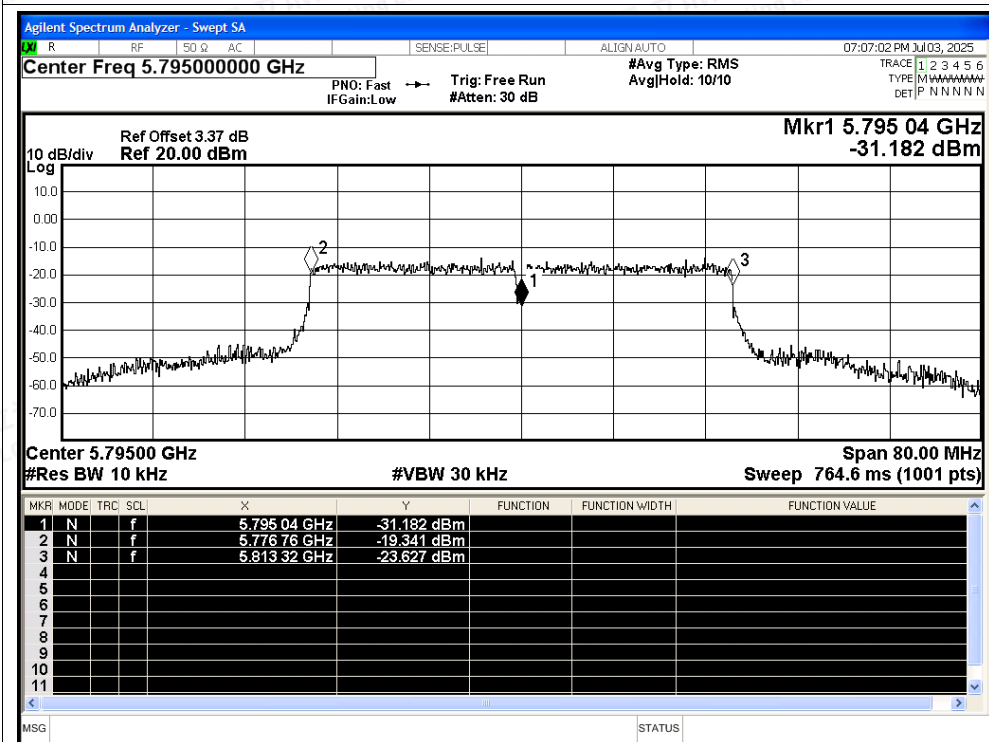

Freq. Stability NVNT ax80 5775MHz Ant2

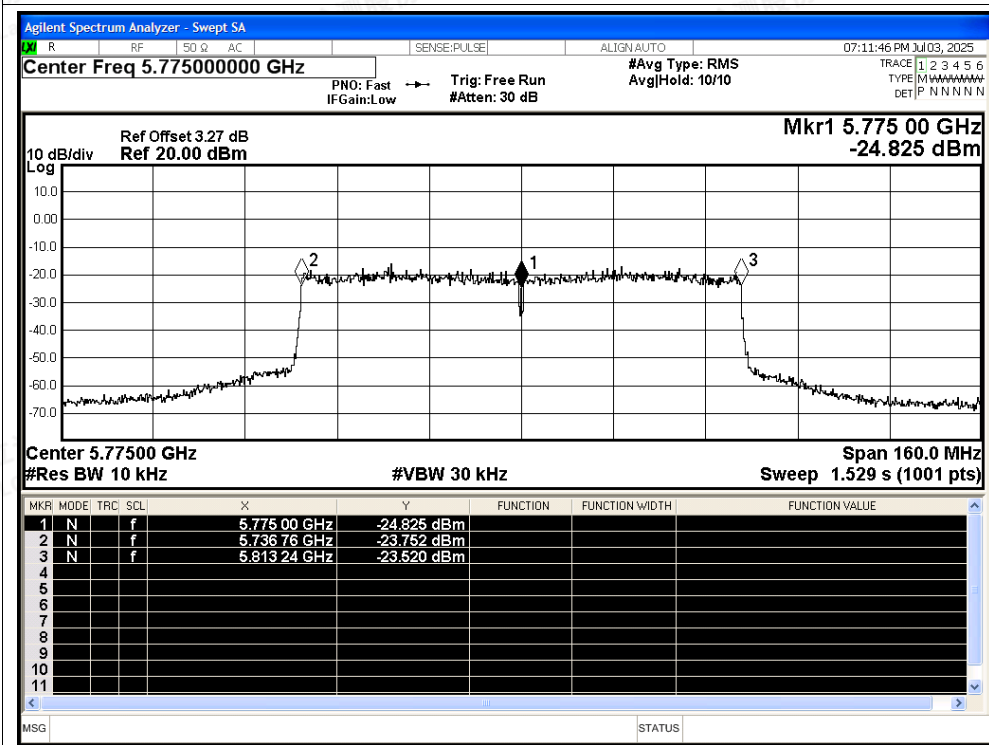

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant3	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant3	5785	0	0	25	Pass
NVNT	a	5825	Ant3	5825	0	0	25	Pass
NVNT	n20	5745	Ant3	5745	0	0	25	Pass
NVNT	n20	5785	Ant3	5785	0	0	25	Pass
NVNT	n20	5825	Ant3	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant3	5755	0	0	25	Pass
NVNT	n40	5795	Ant3	5795	0	0	25	Pass
NVNT	ac20	5745	Ant3	5745.02	20000	3.48	25	Pass
NVNT	ac20	5785	Ant3	5785	0	0	25	Pass
NVNT	ac20	5825	Ant3	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant3	5755.04	40000	6.95	25	Pass
NVNT	ac40	5795	Ant3	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant3	5775	0	0	25	Pass
NVNT	ax20	5745	Ant3	5745.02	20000	3.48	25	Pass
NVNT	ax20	5785	Ant3	5785	0	0	25	Pass
NVNT	ax20	5825	Ant3	5825	0	0	25	Pass
NVNT	ax40	5755	Ant3	5755	0	0	25	Pass
NVNT	ax40	5795	Ant3	5795	0	0	25	Pass
NVNT	ax80	5775	Ant3	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant3

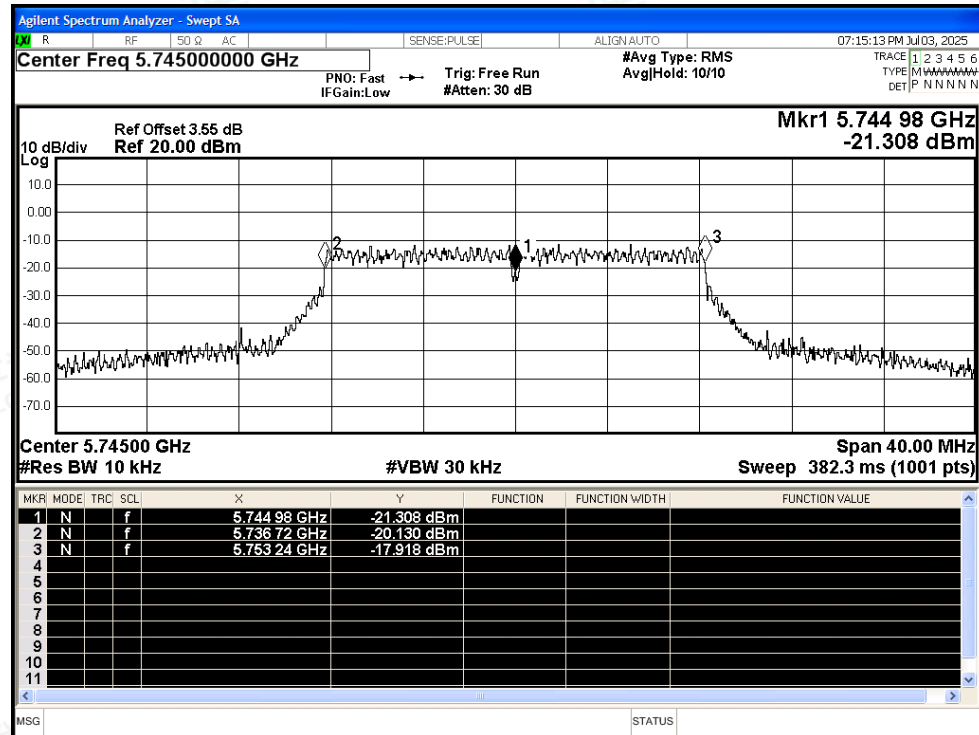

Freq. Stability NVNT a 5785MHz Ant3

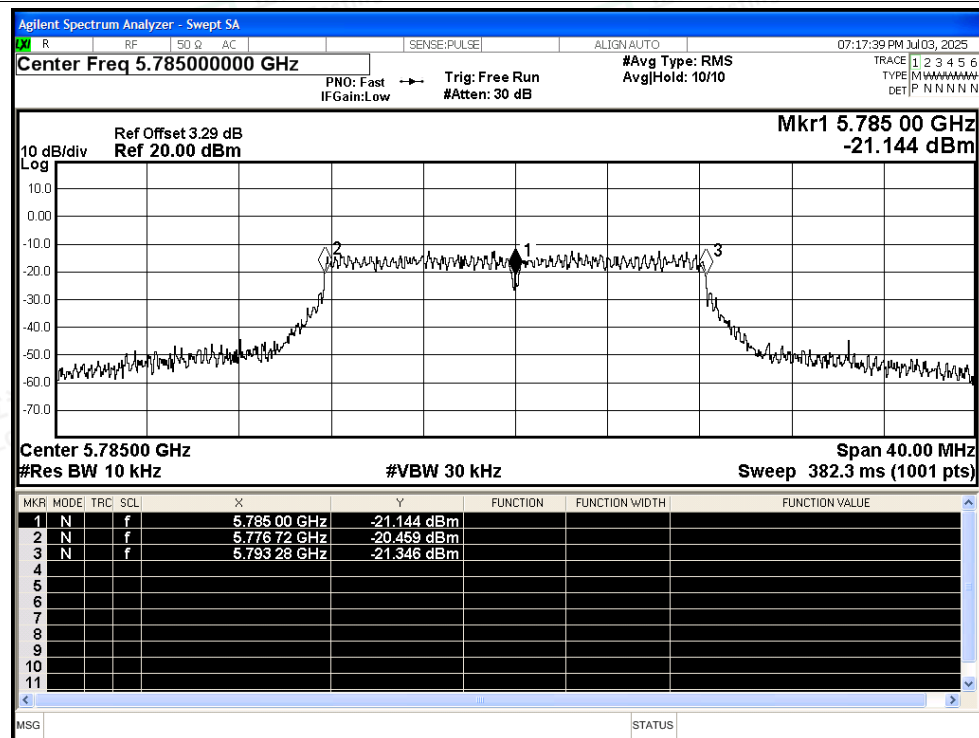

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant3

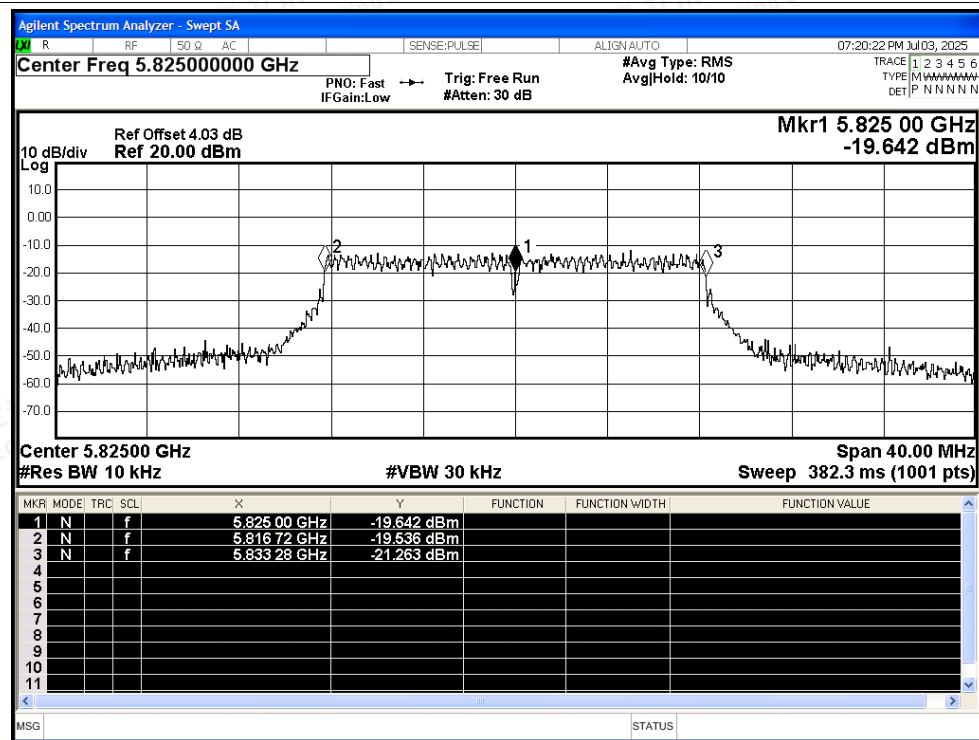

Freq. Stability NVNT n20 5745MHz Ant3

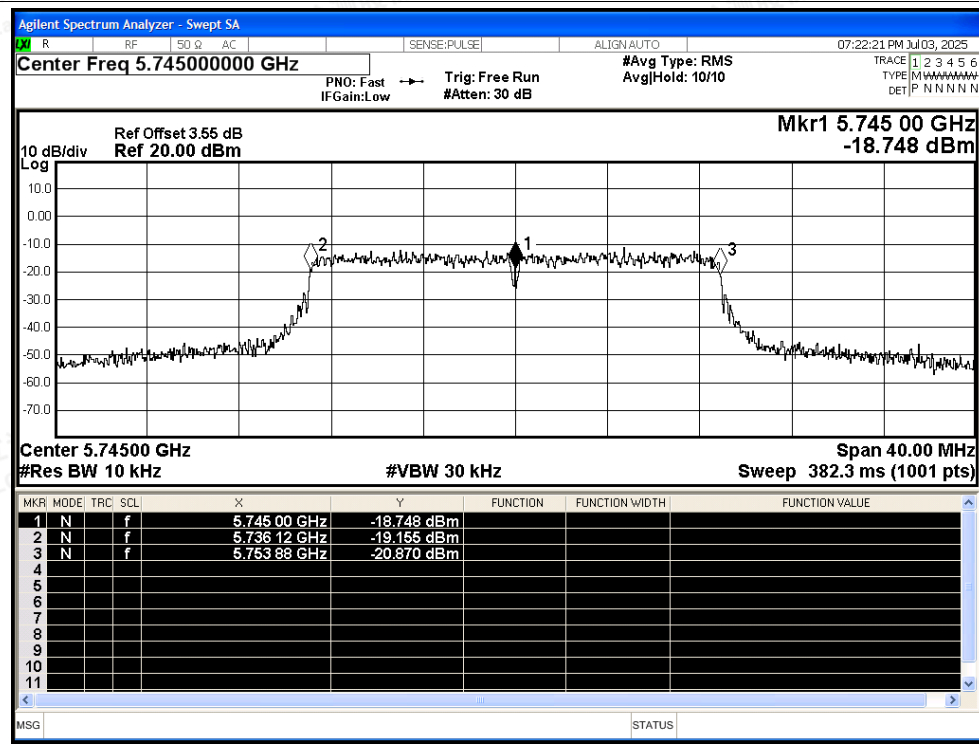

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant3

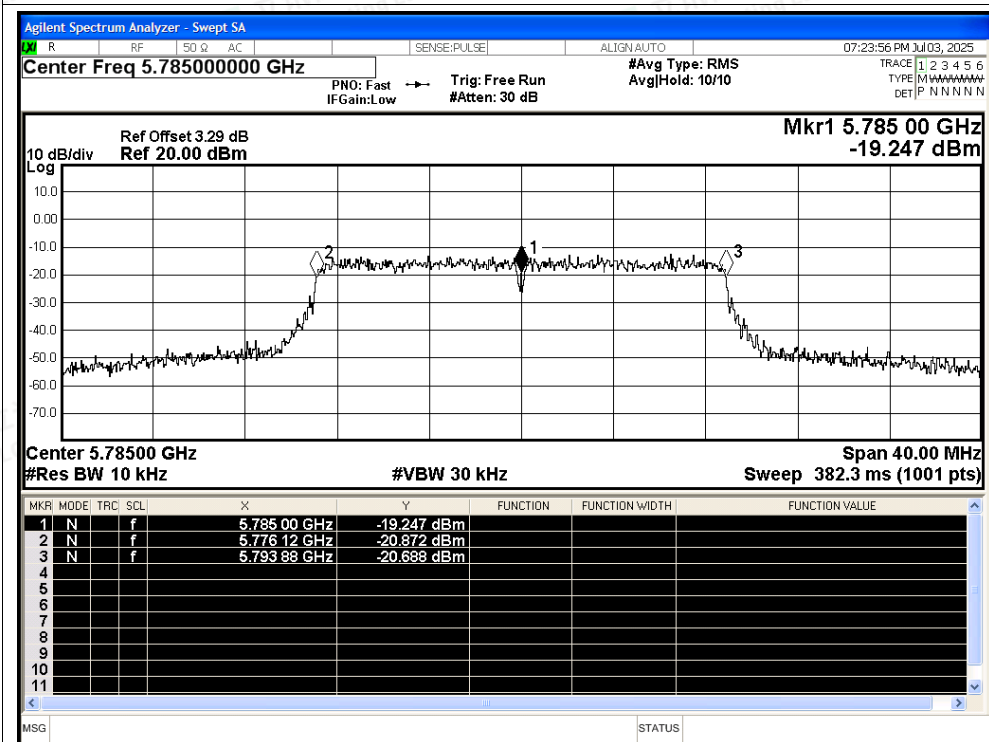

Freq. Stability NVNT n20 5825MHz Ant3

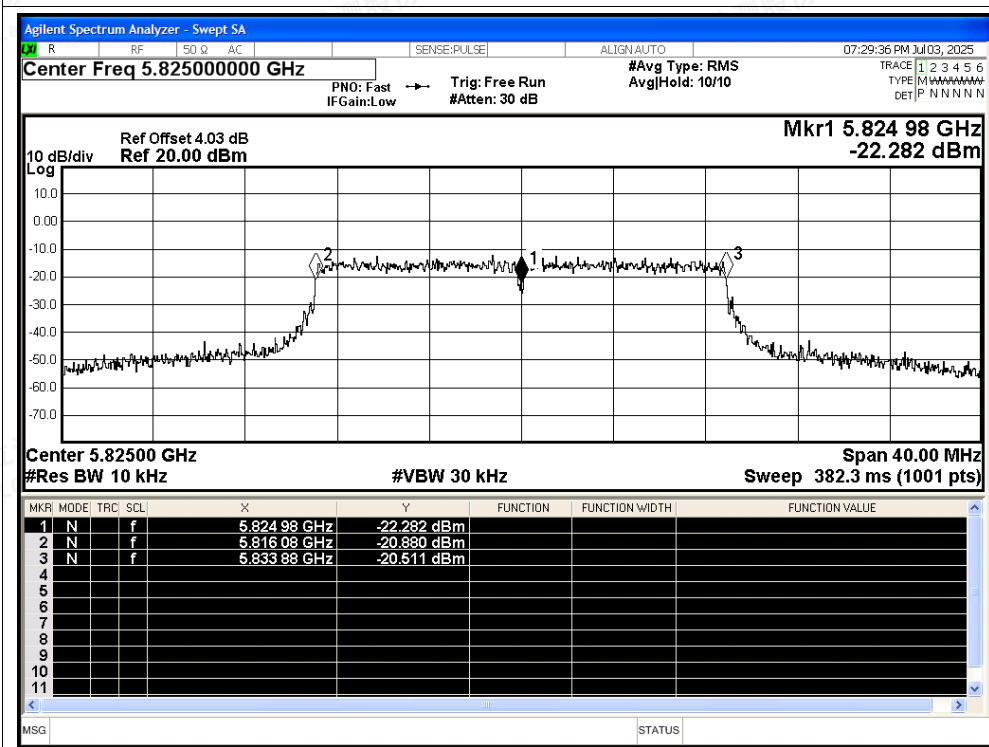

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant3

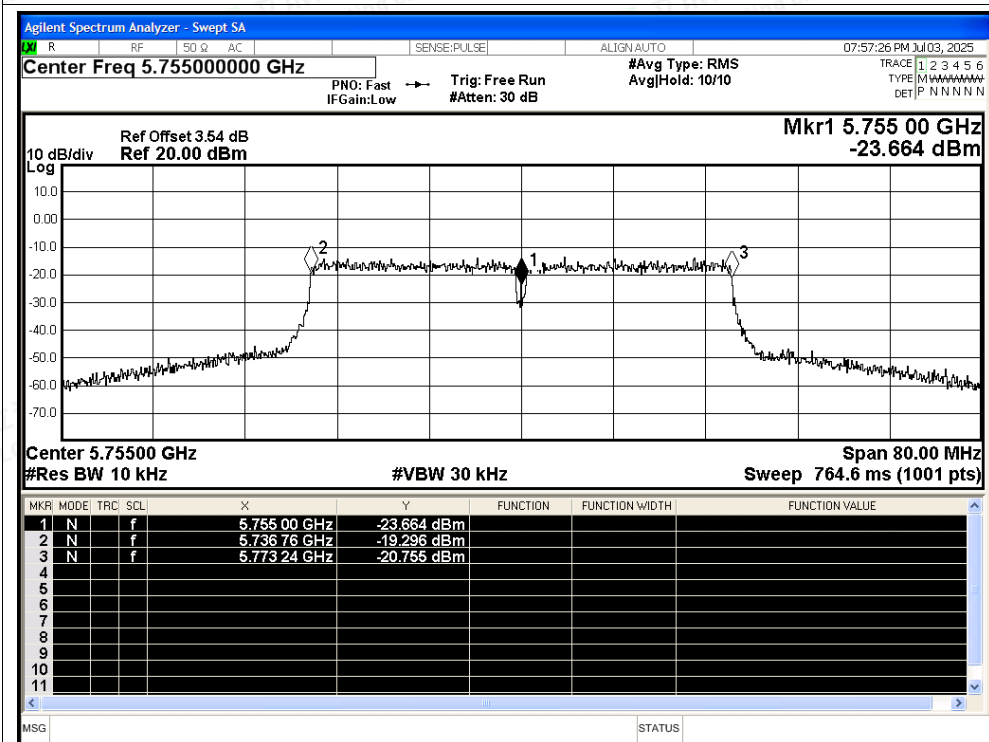

Freq. Stability NVNT n40 5795MHz Ant3

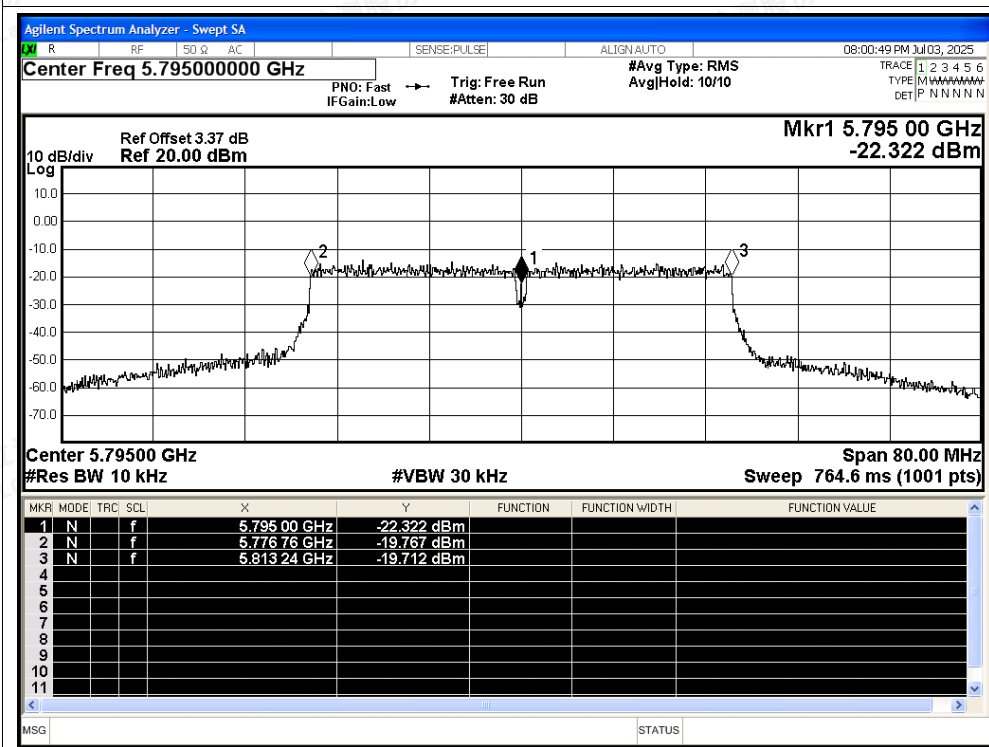

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant3

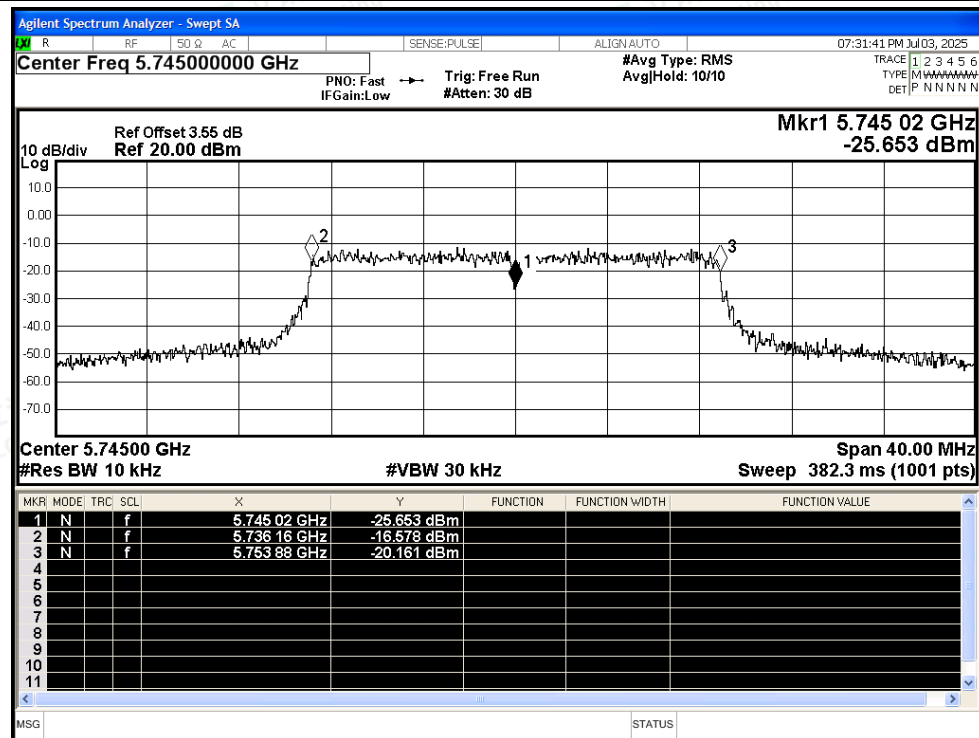

Freq. Stability NVNT ac20 5785MHz Ant3

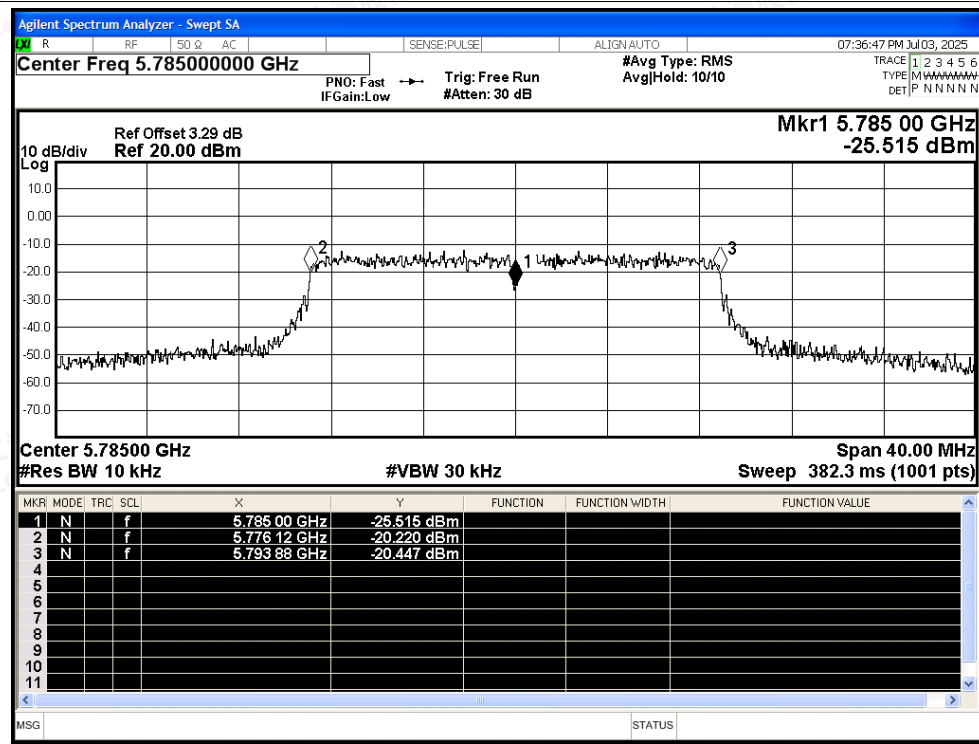

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant3

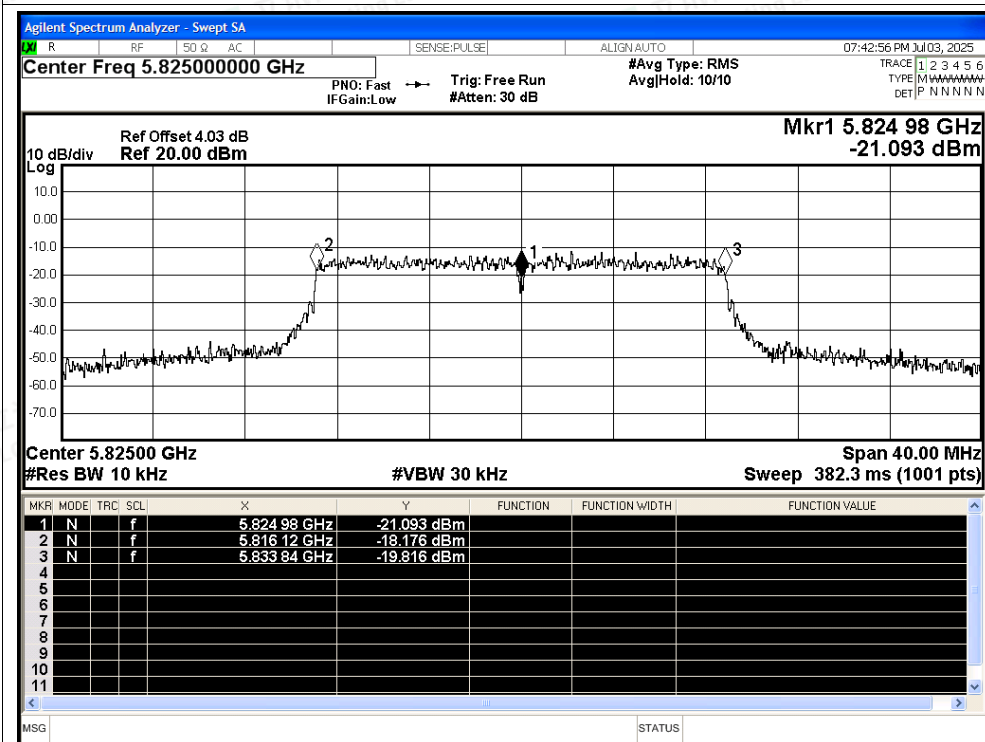

Freq. Stability NVNT ac40 5755MHz Ant3

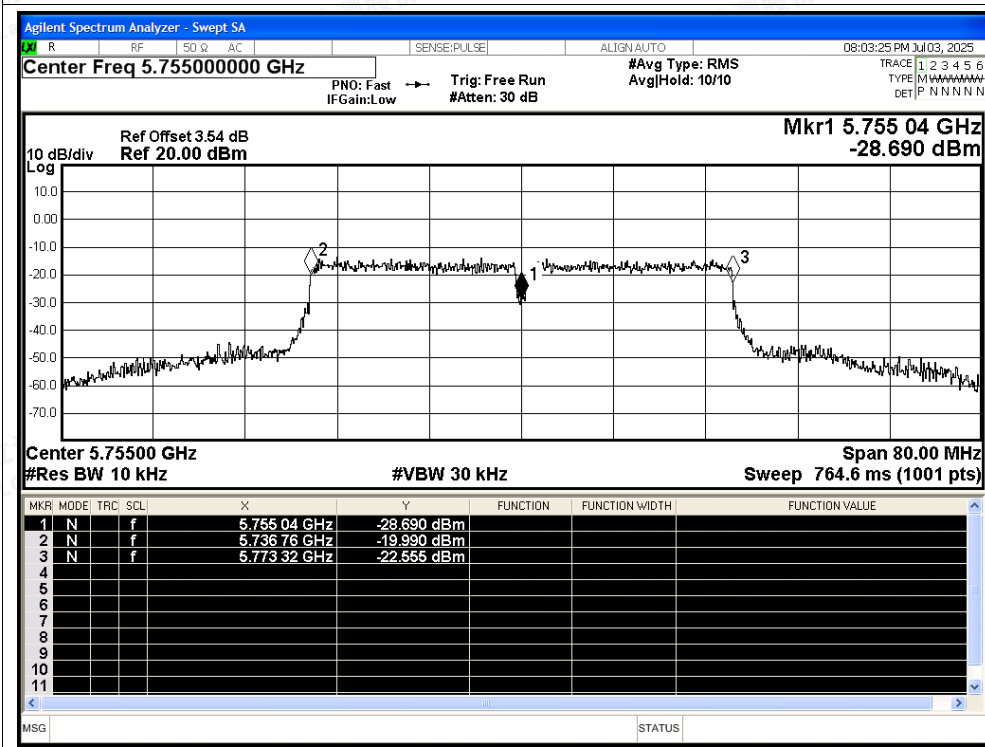

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant3

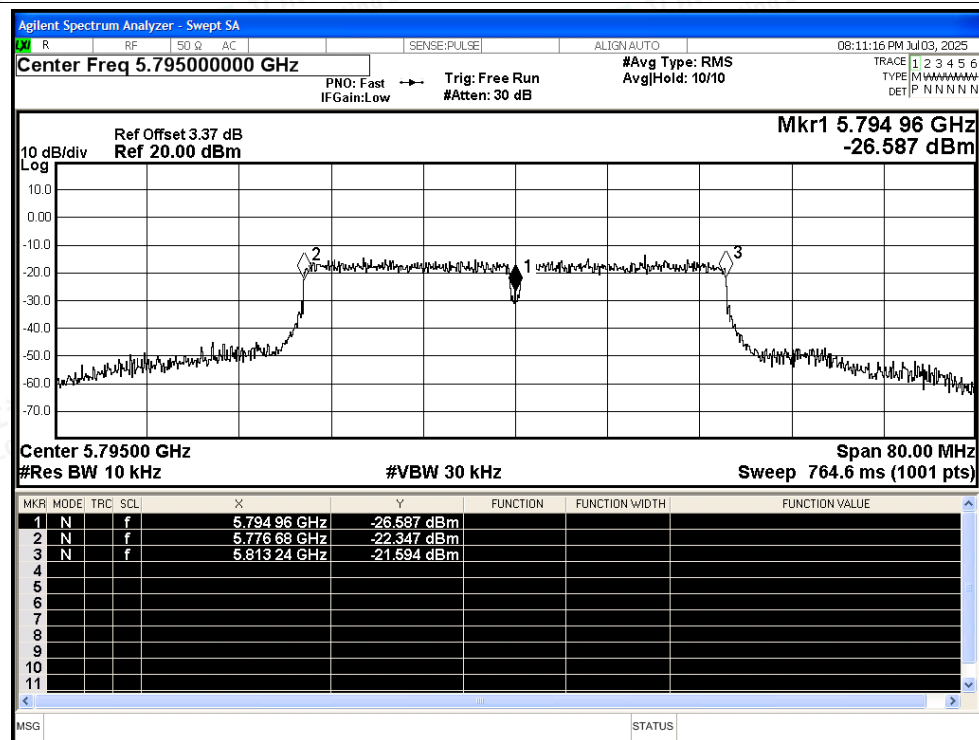

Freq. Stability NVNT ac80 5775MHz Ant3

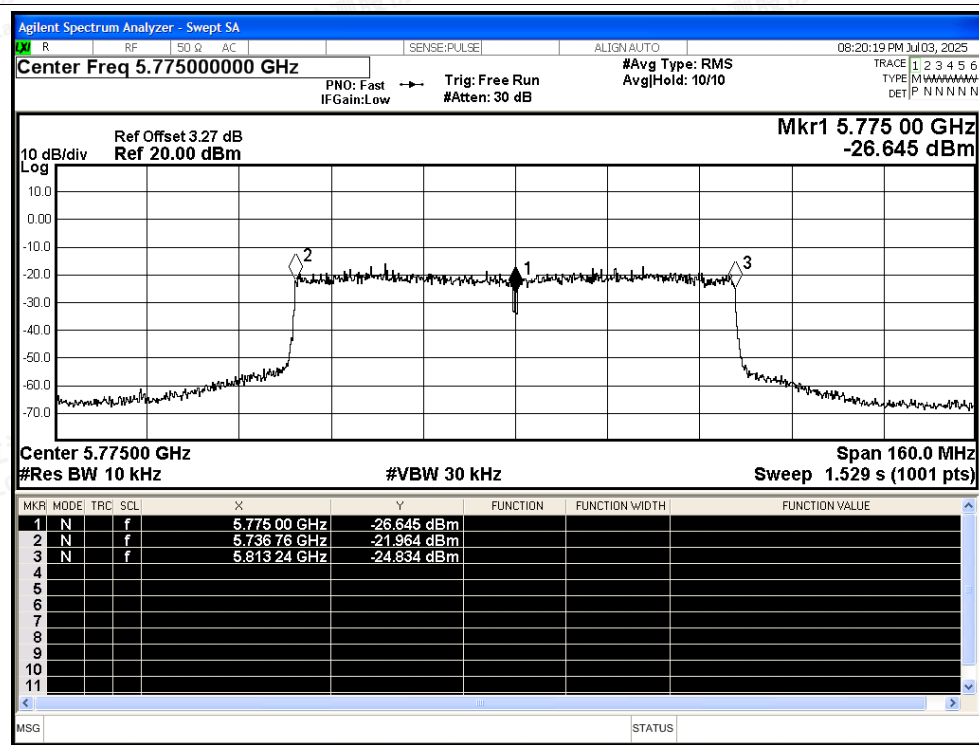

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant3

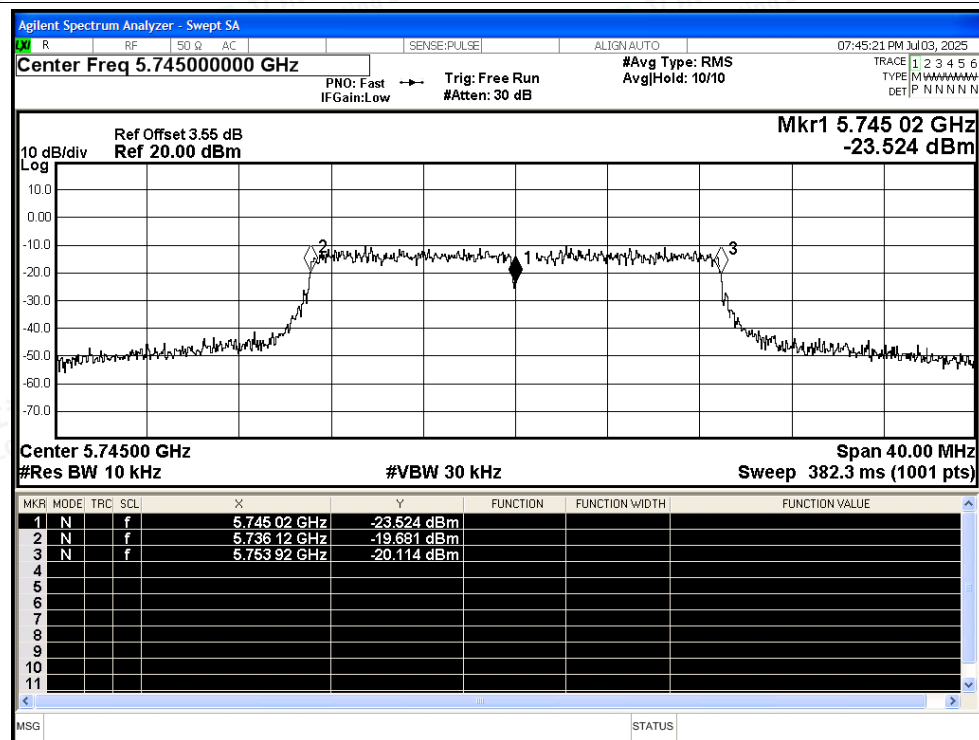

Freq. Stability NVNT ax20 5785MHz Ant3

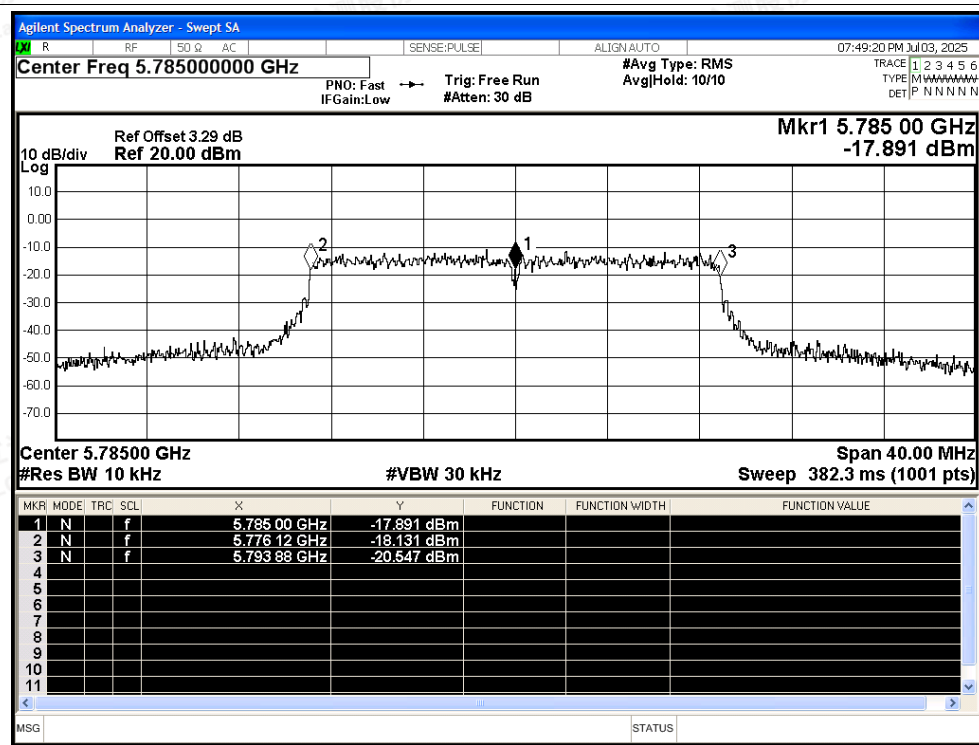

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant3

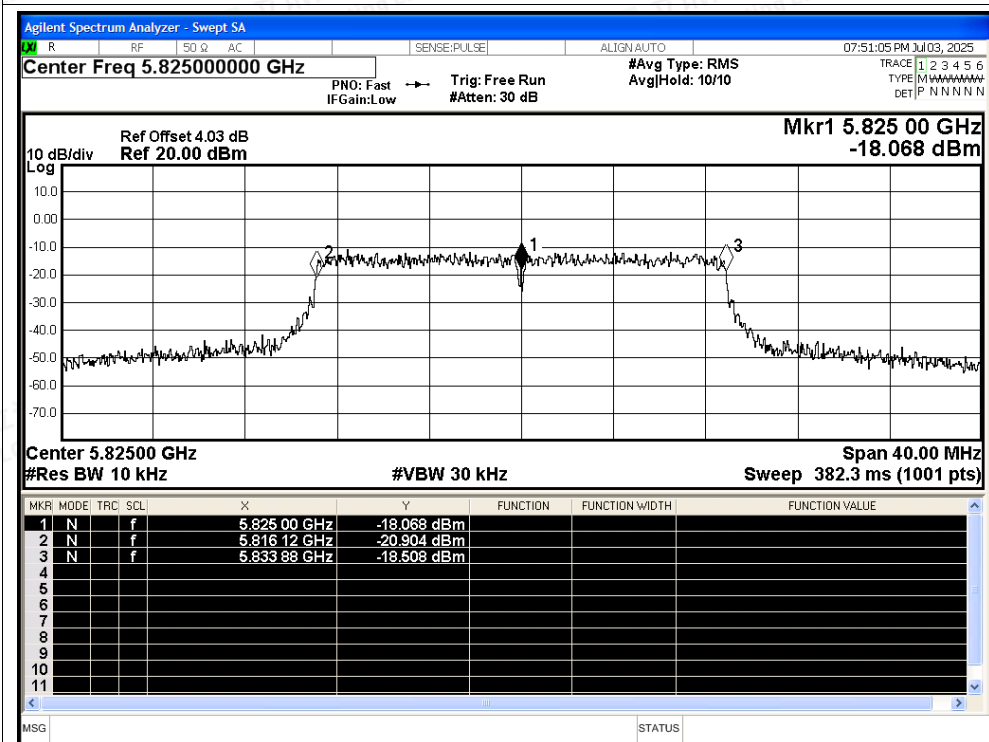

Freq. Stability NVNT ax40 5755MHz Ant3

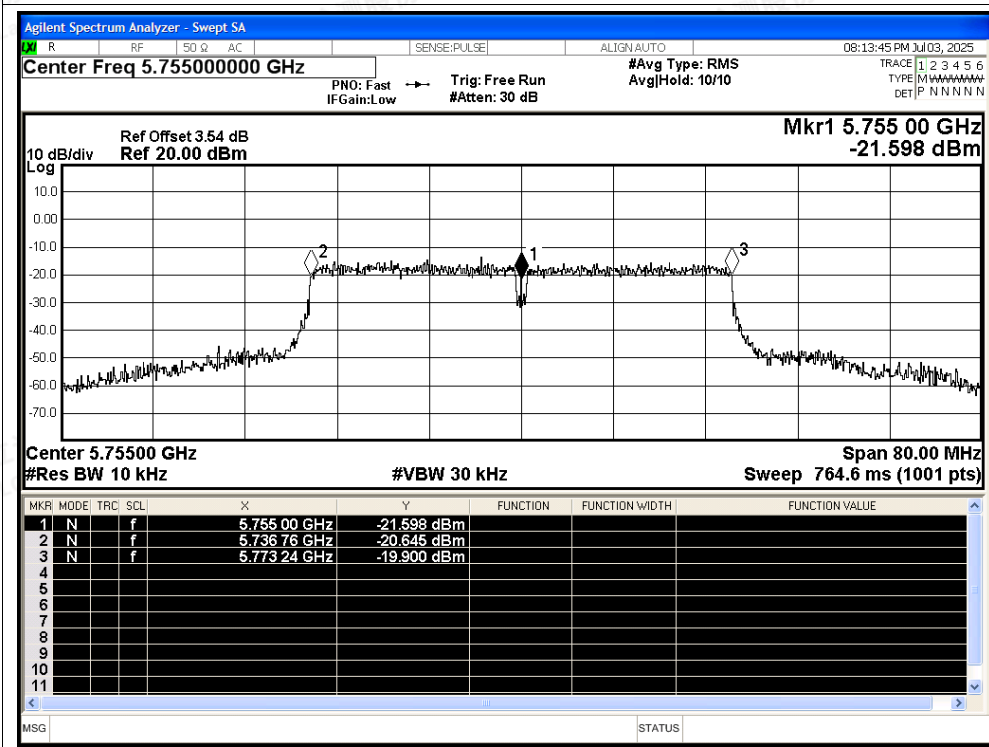

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant3

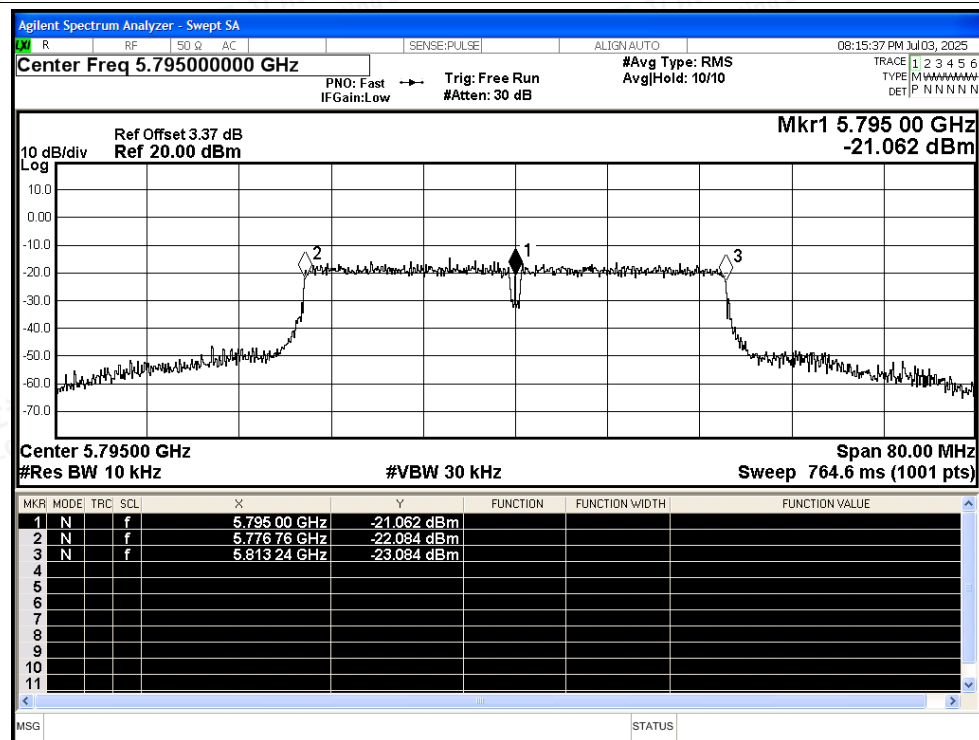

Freq. Stability NVNT ax80 5775MHz Ant3

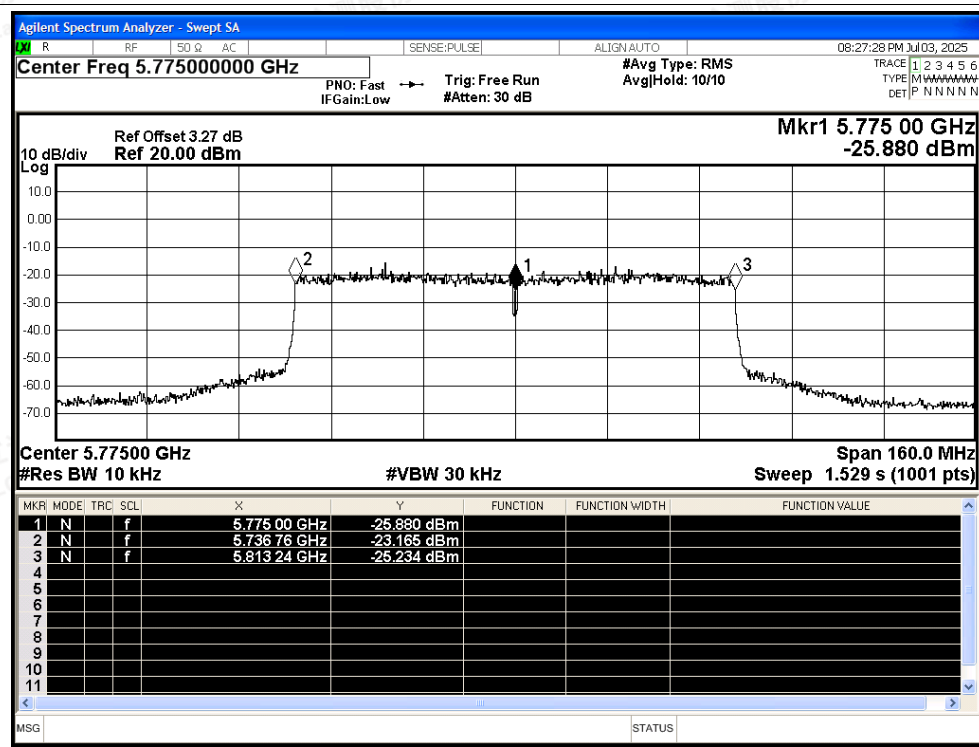

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant5	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant5	5784.98	-20000	-3.46	25	Pass
NVNT	a	5825	Ant5	5825	0	0	25	Pass
NVNT	n20	5745	Ant5	5745	0	0	25	Pass
NVNT	n20	5785	Ant5	5784.98	-20000	-3.46	25	Pass
NVNT	n20	5825	Ant5	5825	0	0	25	Pass
NVNT	n40	5755	Ant5	5755	0	0	25	Pass
NVNT	n40	5795	Ant5	5794.96	-40000	-6.9	25	Pass
NVNT	ac20	5745	Ant5	5745	0	0	25	Pass
NVNT	ac20	5785	Ant5	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant5	5824.96	-40000	-6.87	25	Pass
NVNT	ac40	5755	Ant5	5755	0	0	25	Pass
NVNT	ac40	5795	Ant5	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant5	5775	0	0	25	Pass
NVNT	ax20	5745	Ant5	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant5	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant5	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant5	5755	0	0	25	Pass
NVNT	ax40	5795	Ant5	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant5	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant5

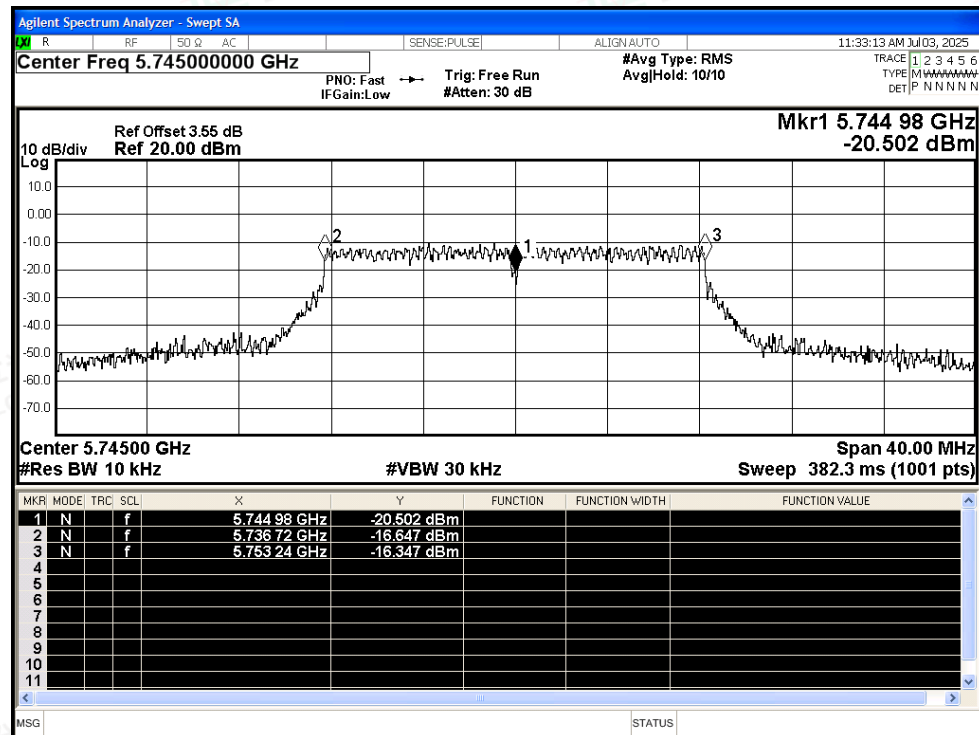

Freq. Stability NVNT a 5785MHz Ant5

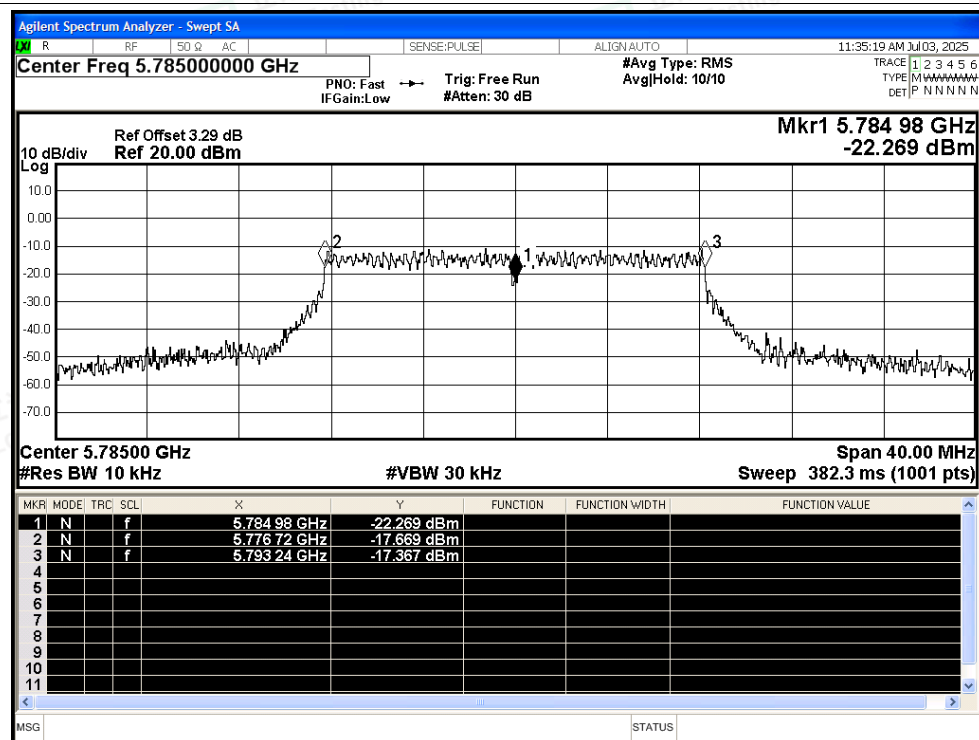

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant5

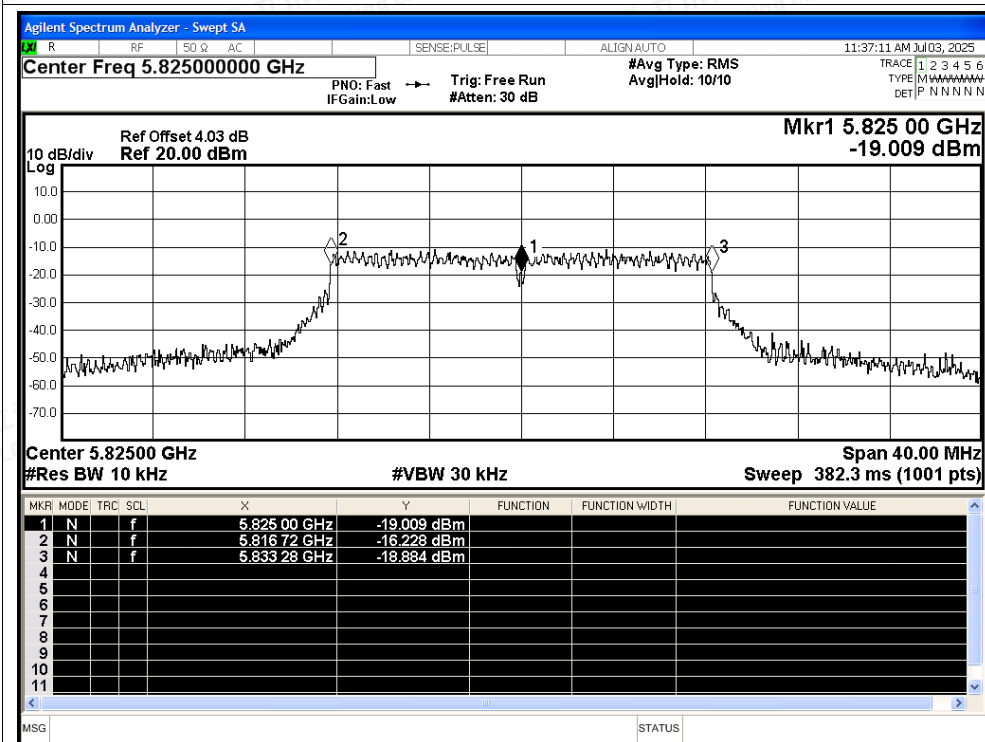

Freq. Stability NVNT n20 5745MHz Ant5

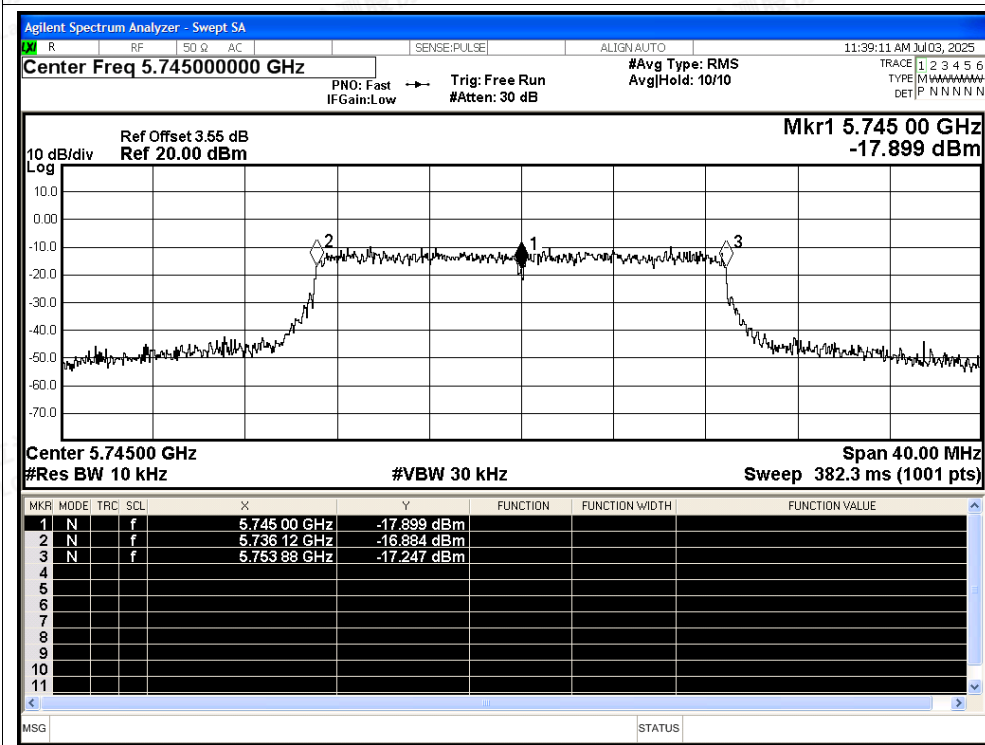

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant5

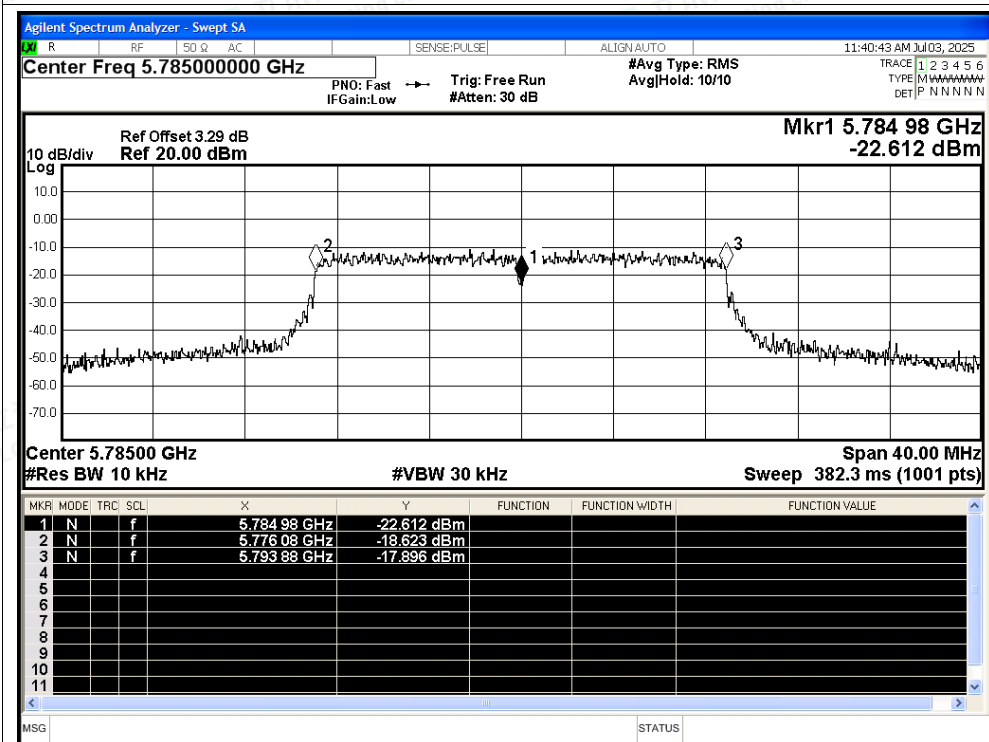

Freq. Stability NVNT n20 5825MHz Ant5

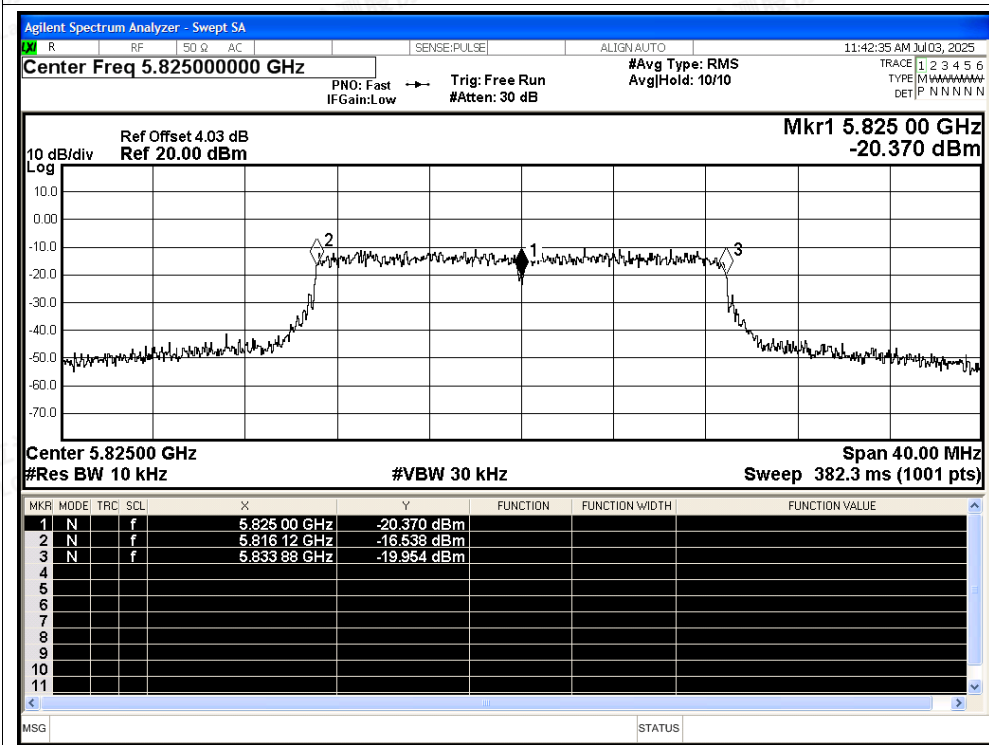

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant5

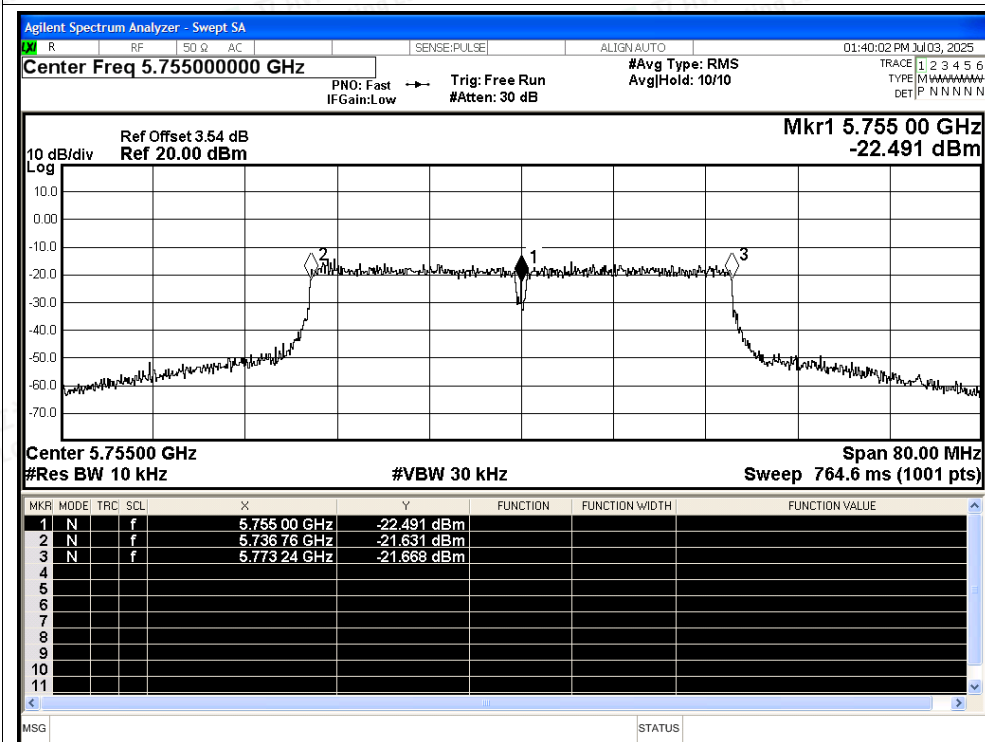

Freq. Stability NVNT n40 5795MHz Ant5

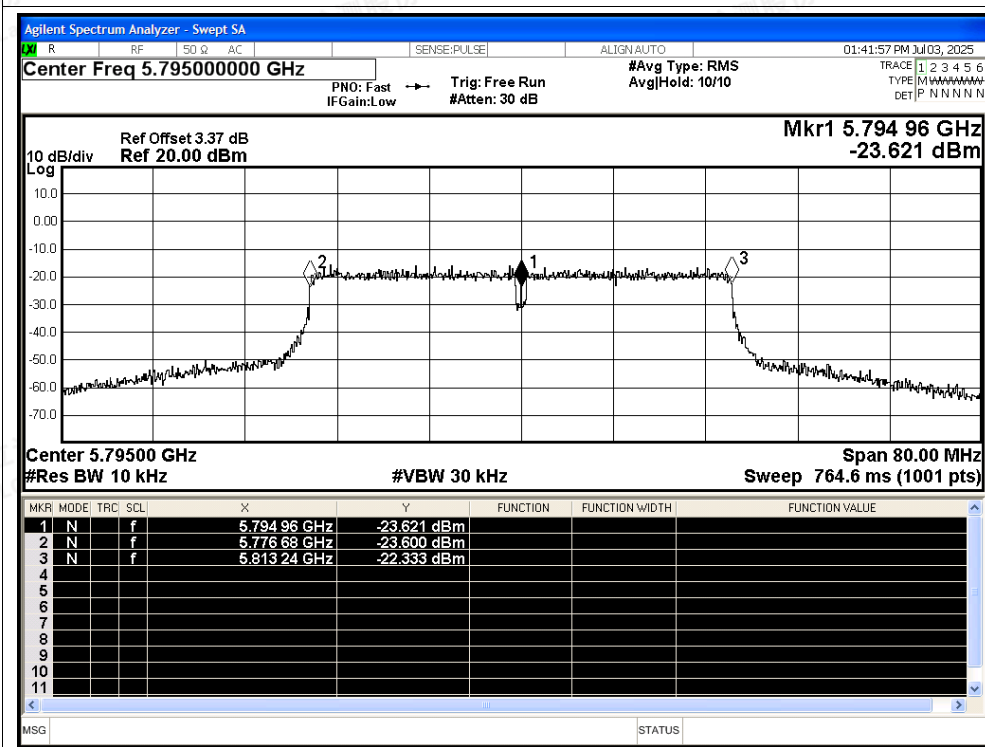

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant5

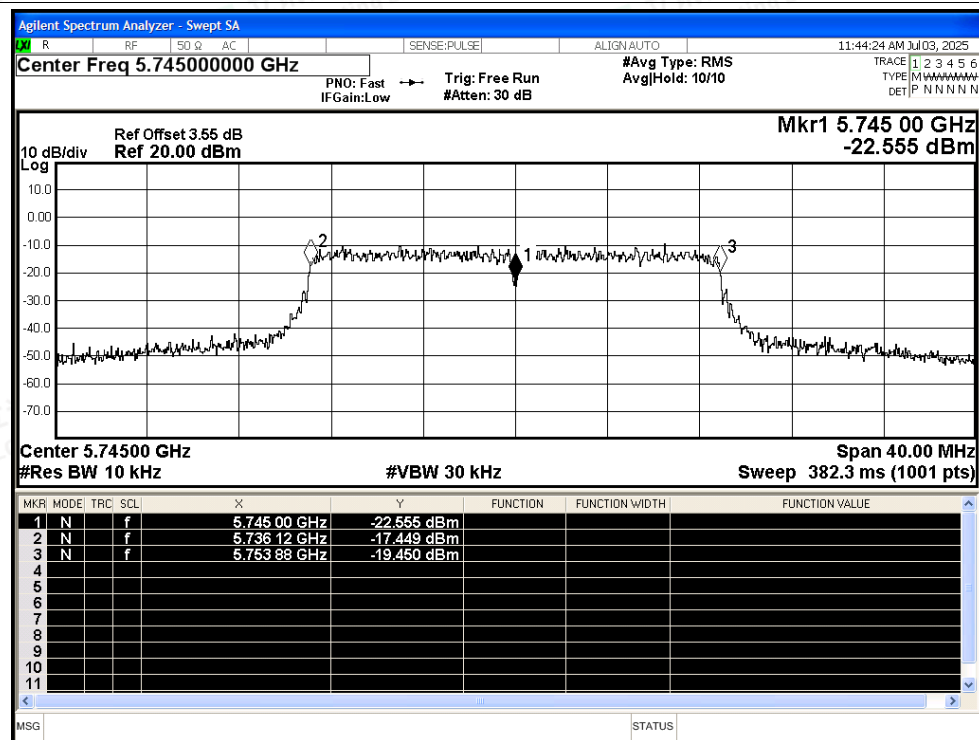

Freq. Stability NVNT ac20 5785MHz Ant5

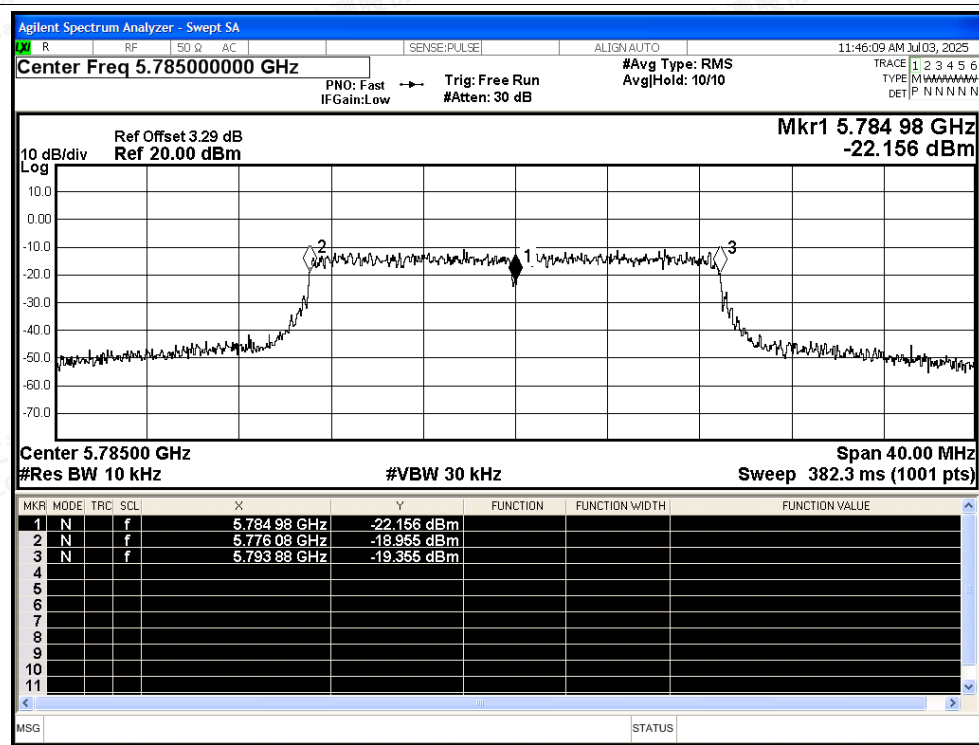

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant5

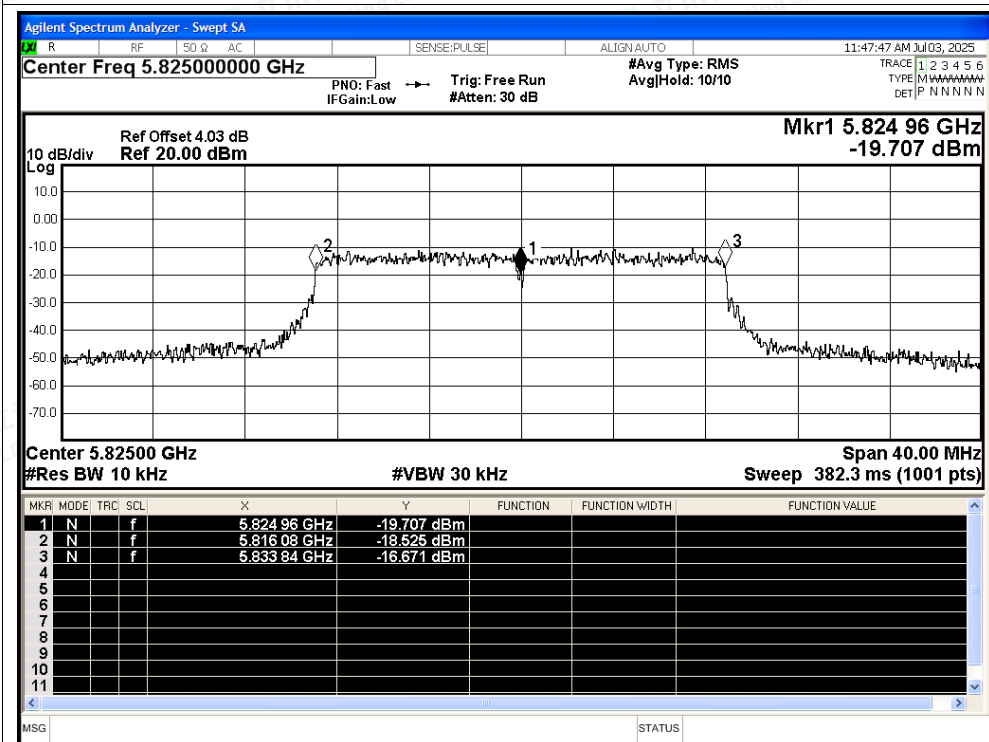

Freq. Stability NVNT ac40 5755MHz Ant5

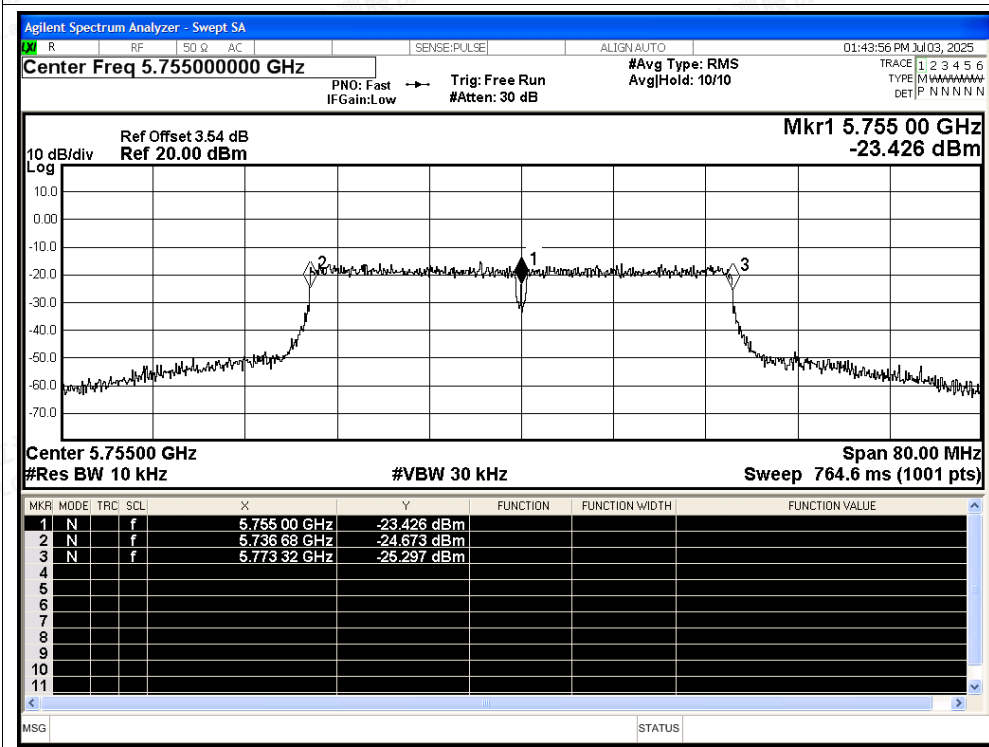

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant5

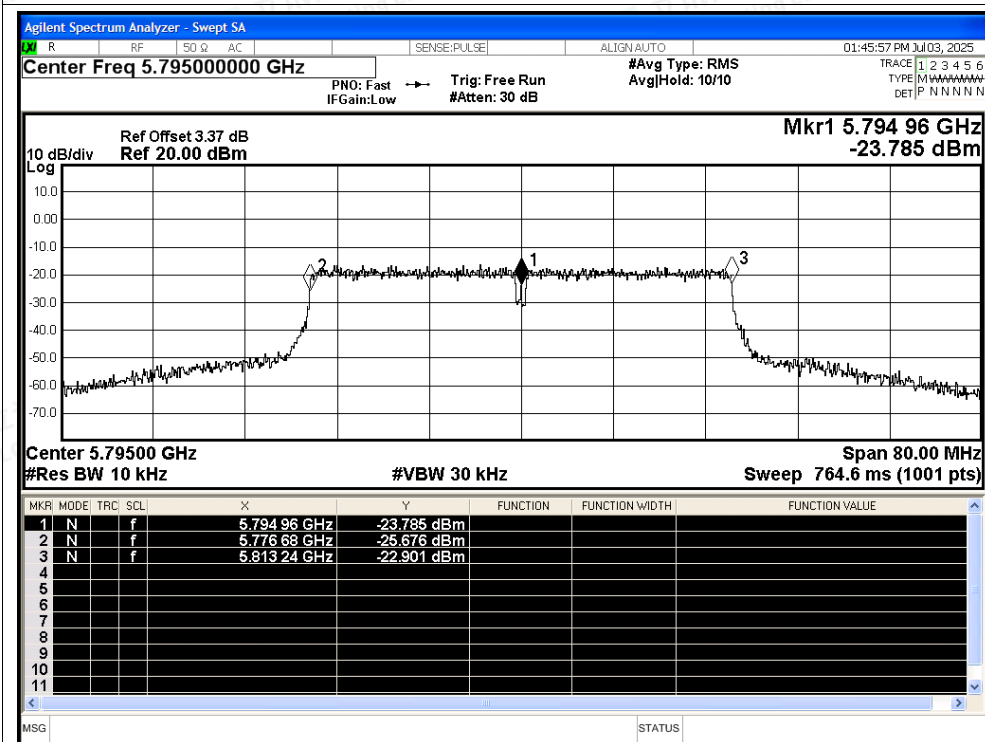

Freq. Stability NVNT ac80 5775MHz Ant5

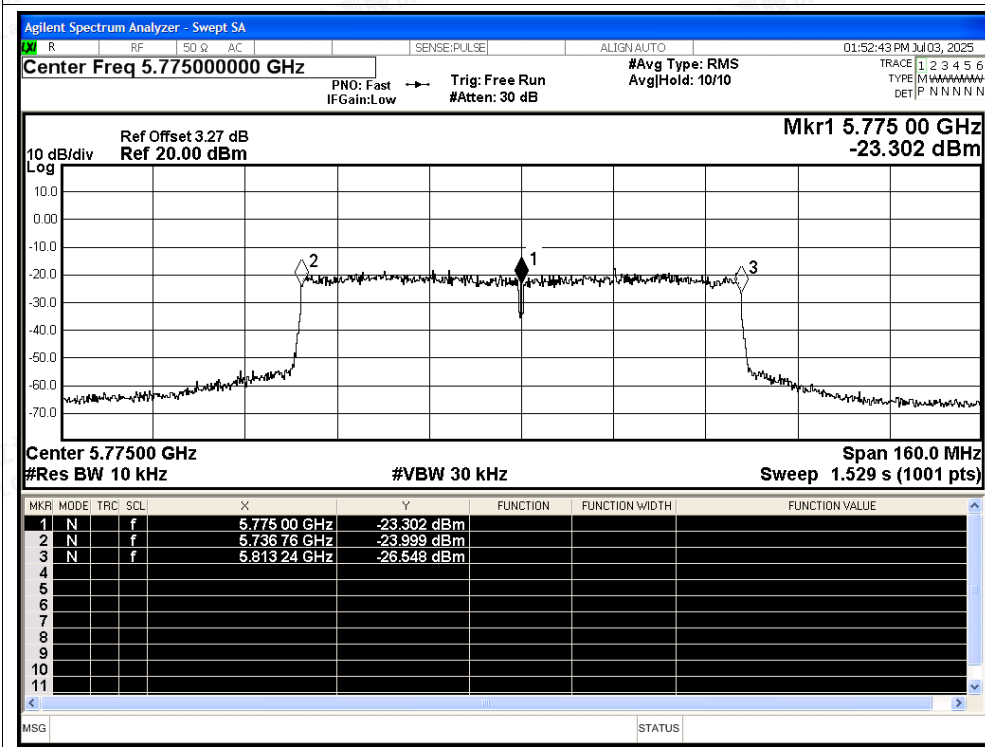

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant5

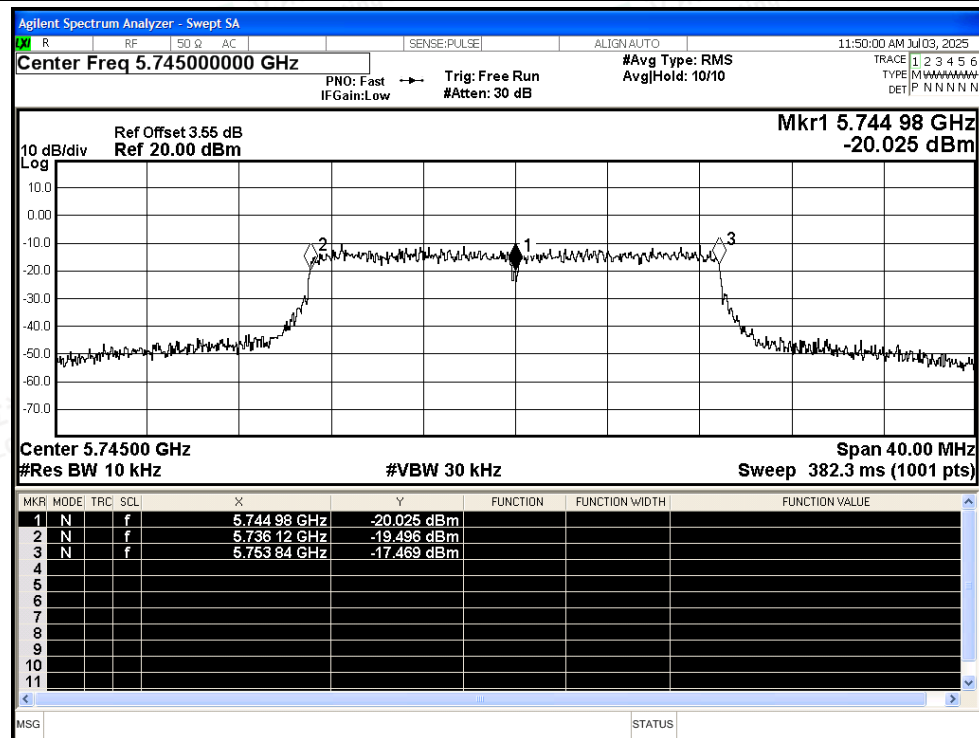

Freq. Stability NVNT ax20 5785MHz Ant5

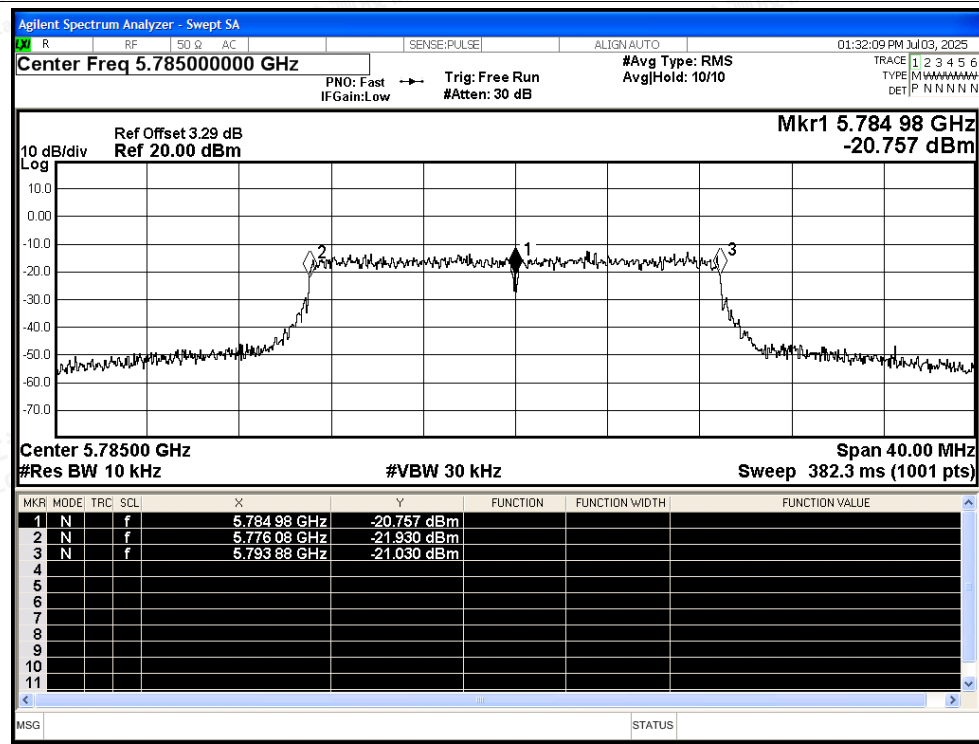

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant5

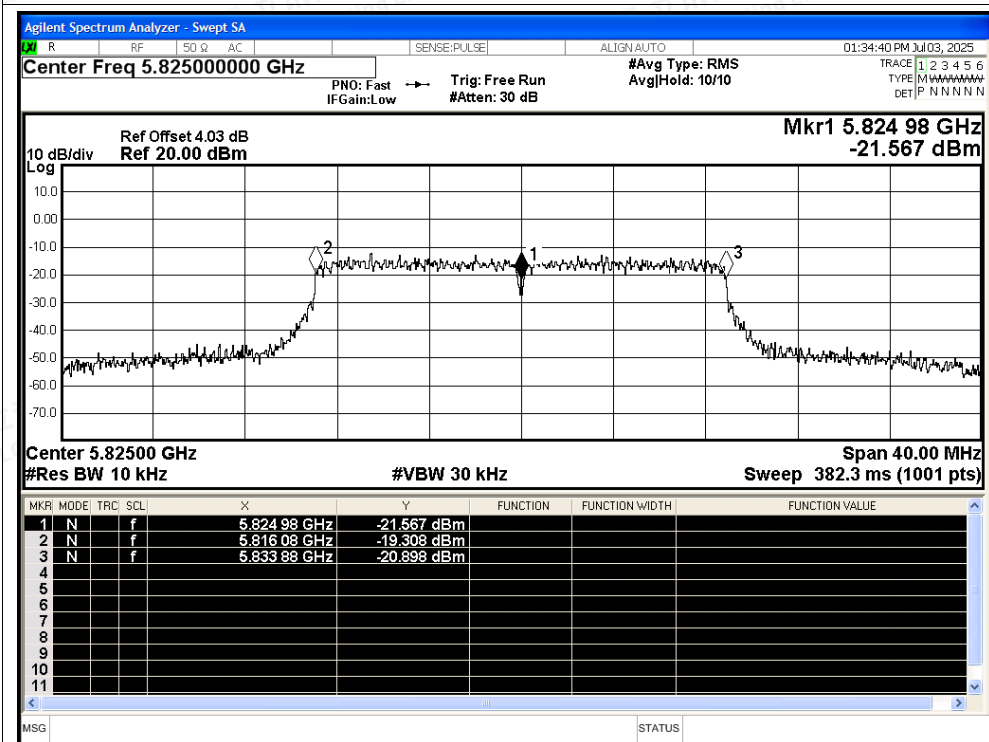

Freq. Stability NVNT ax40 5755MHz Ant5

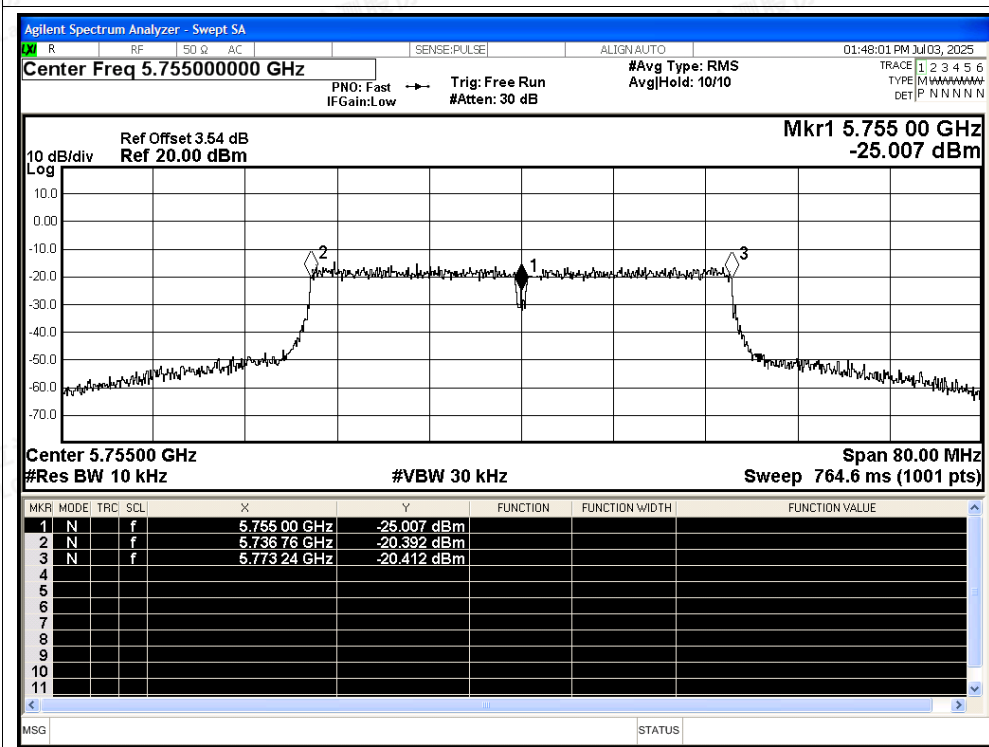

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant5

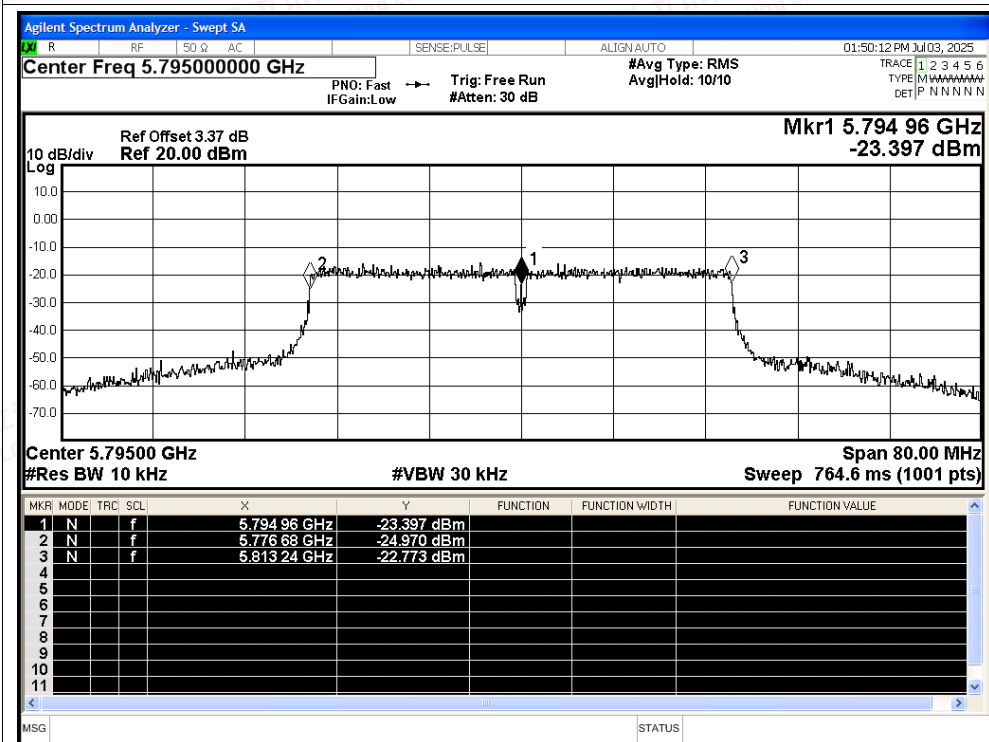

Freq. Stability NVNT ax80 5775MHz Ant5

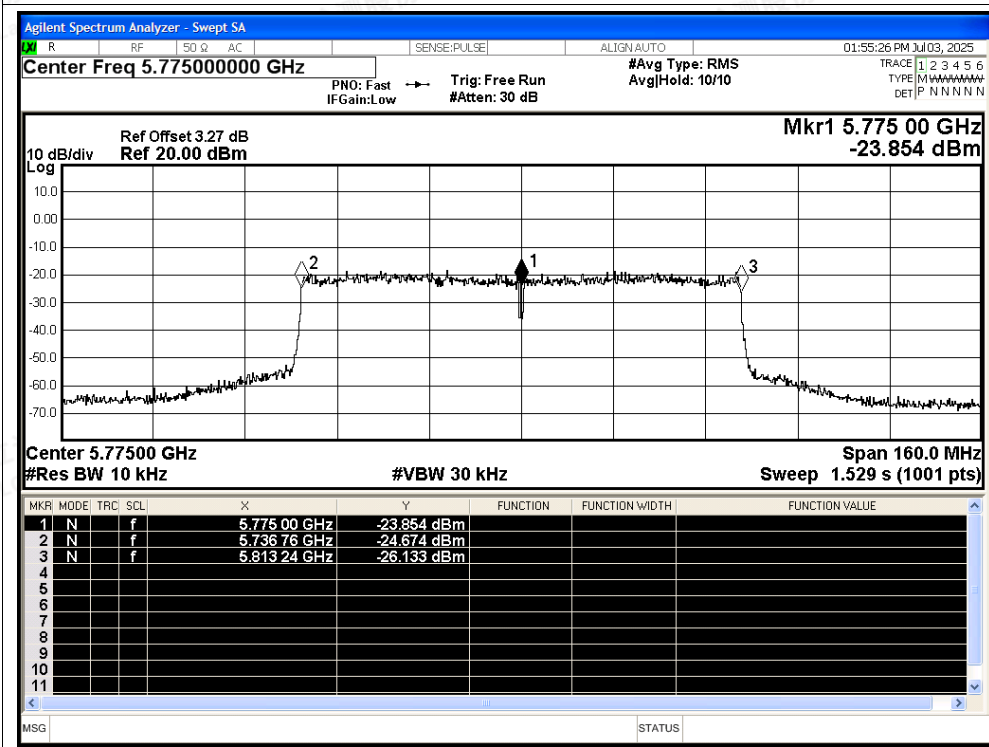

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant6	5745	0	0	25	Pass
NVNT	a	5785	Ant6	5785	0	0	25	Pass
NVNT	a	5825	Ant6	5825	0	0	25	Pass
NVNT	n20	5745	Ant6	5745	0	0	25	Pass
NVNT	n20	5785	Ant6	5785	0	0	25	Pass
NVNT	n20	5825	Ant6	5825	0	0	25	Pass
NVNT	n40	5755	Ant6	5755	0	0	25	Pass
NVNT	n40	5795	Ant6	5795	0	0	25	Pass
NVNT	ac20	5745	Ant6	5745.02	20000	3.48	25	Pass
NVNT	ac20	5785	Ant6	5785	0	0	25	Pass
NVNT	ac20	5825	Ant6	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant6	5755	0	0	25	Pass
NVNT	ac40	5795	Ant6	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant6	5775	0	0	25	Pass
NVNT	ax20	5745	Ant6	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant6	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant6	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant6	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant6	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant6	5775	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant6

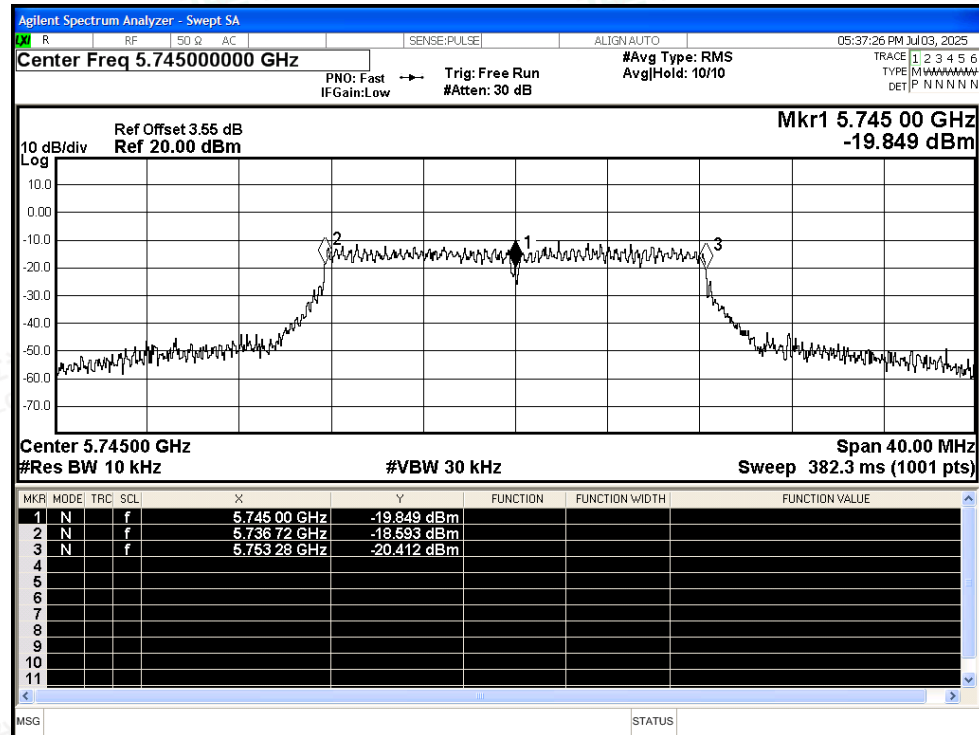

Freq. Stability NVNT a 5785MHz Ant6

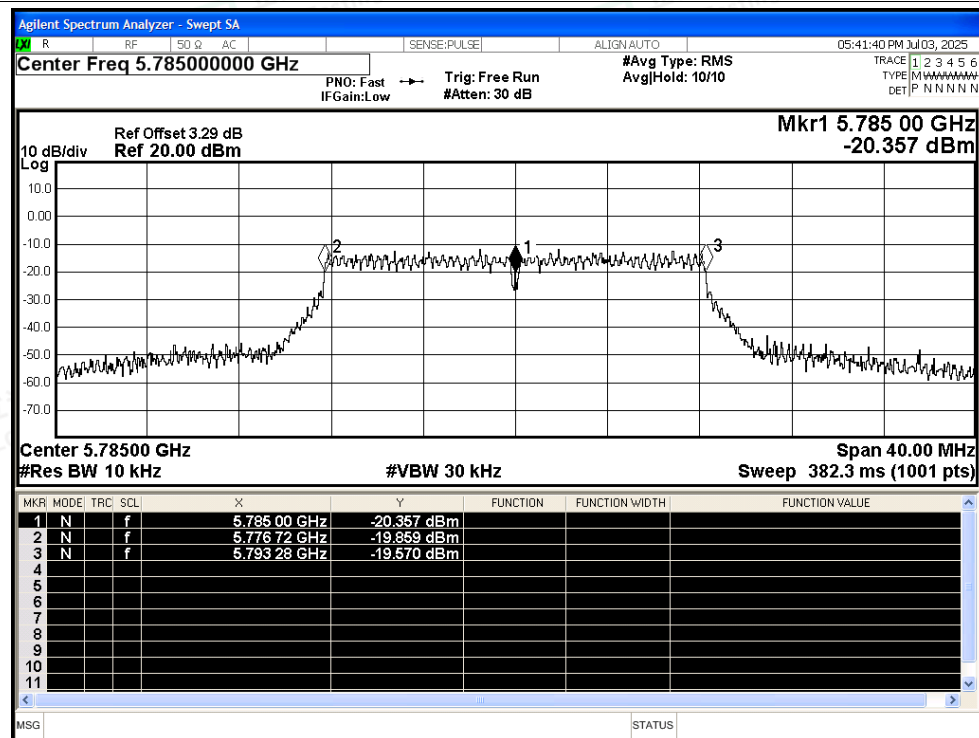

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant6

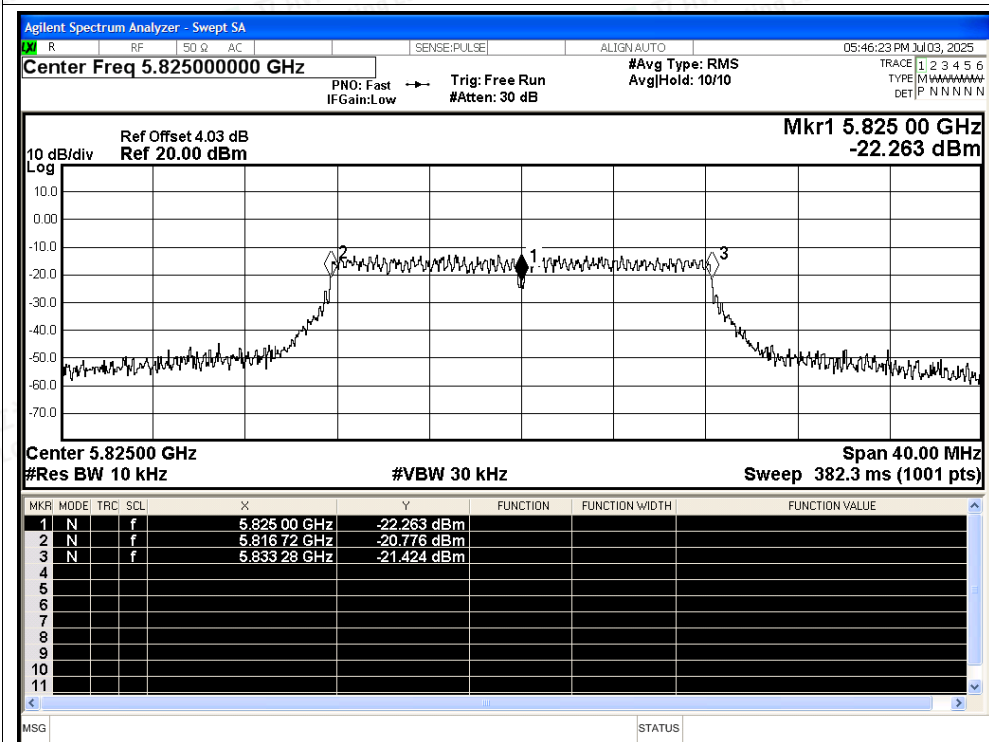

Freq. Stability NVNT n20 5745MHz Ant6

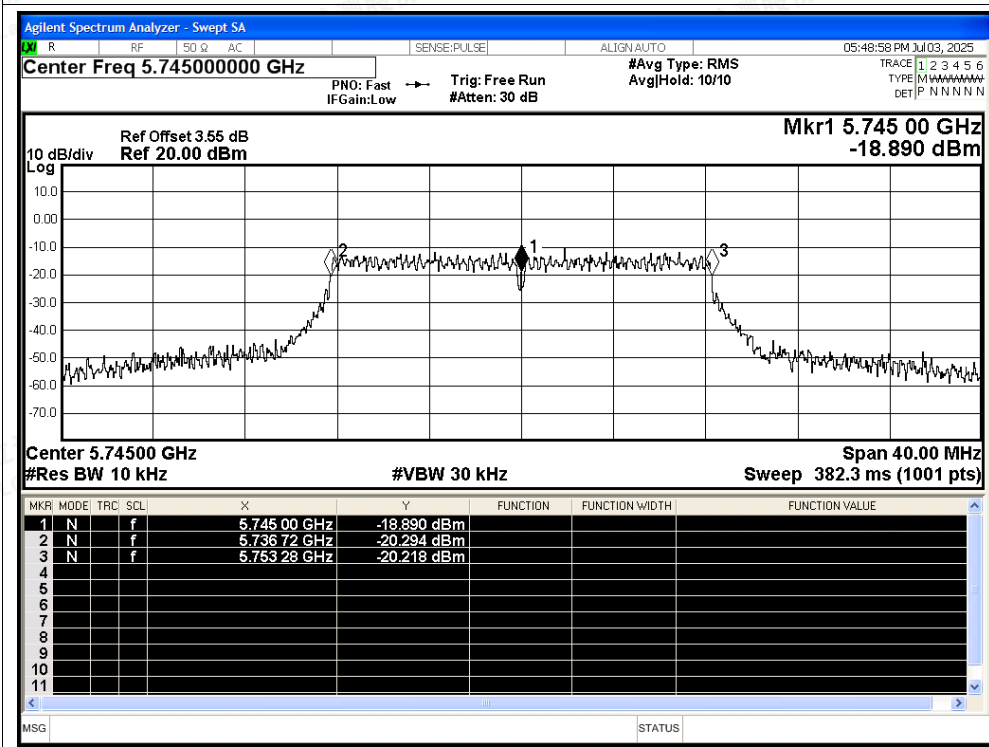

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant6

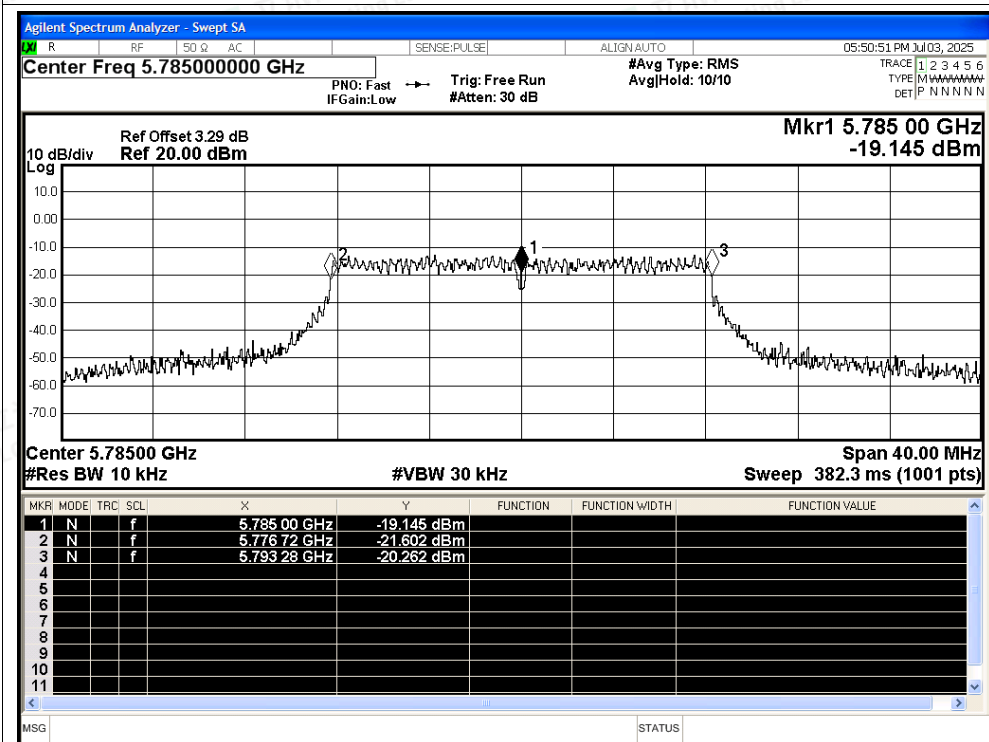

Freq. Stability NVNT n20 5825MHz Ant6

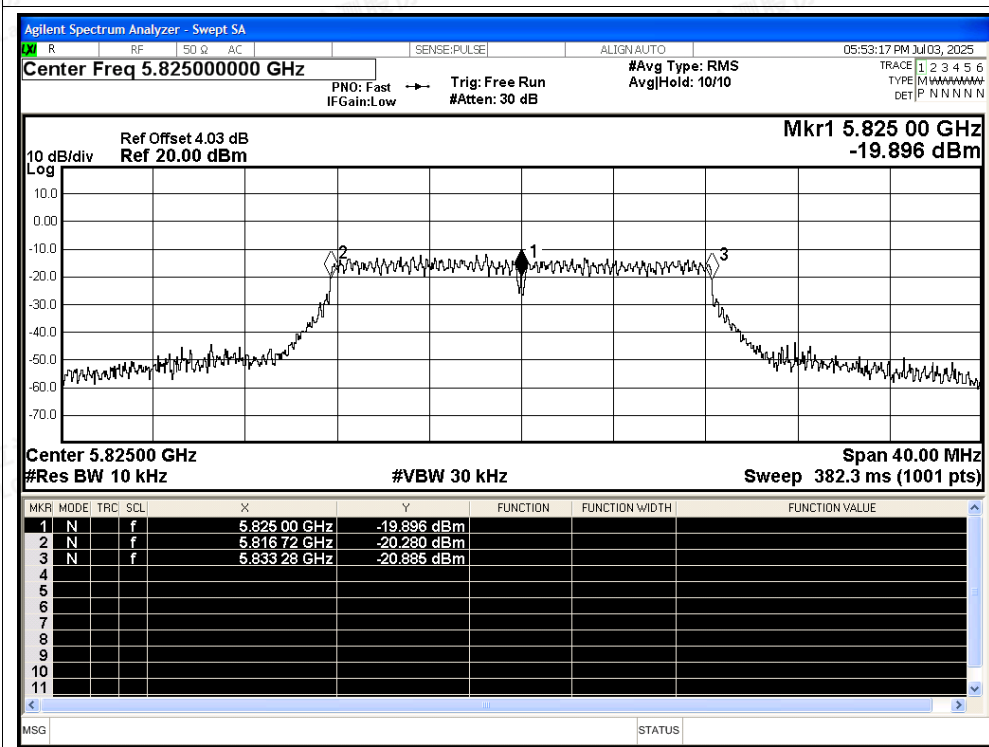

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant6

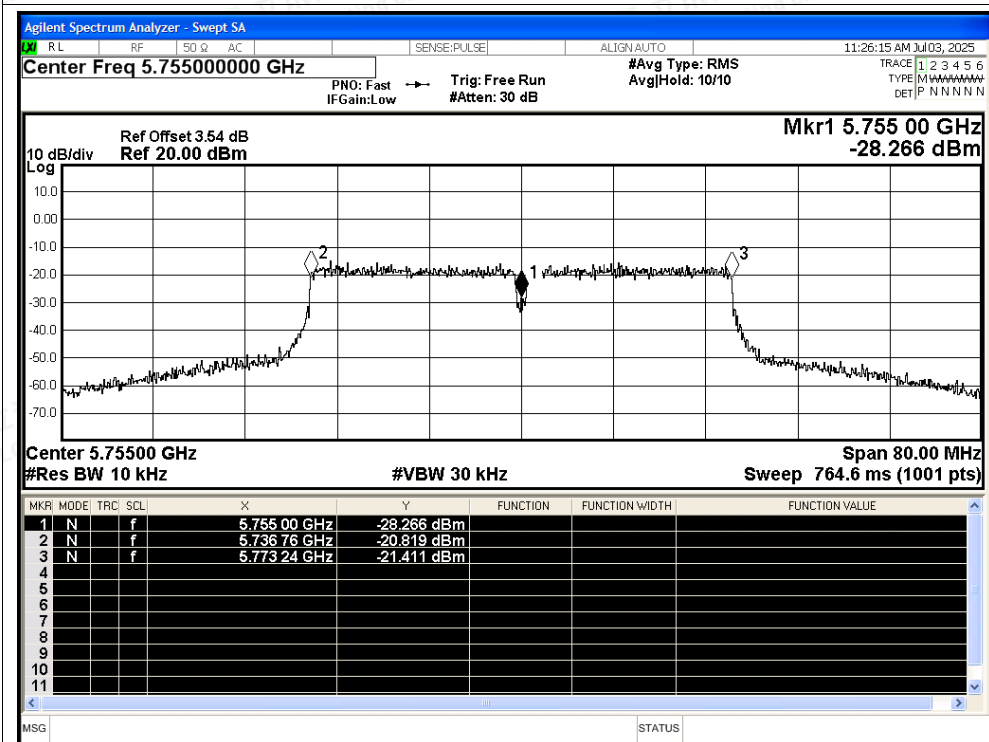

Freq. Stability NVNT n40 5795MHz Ant6

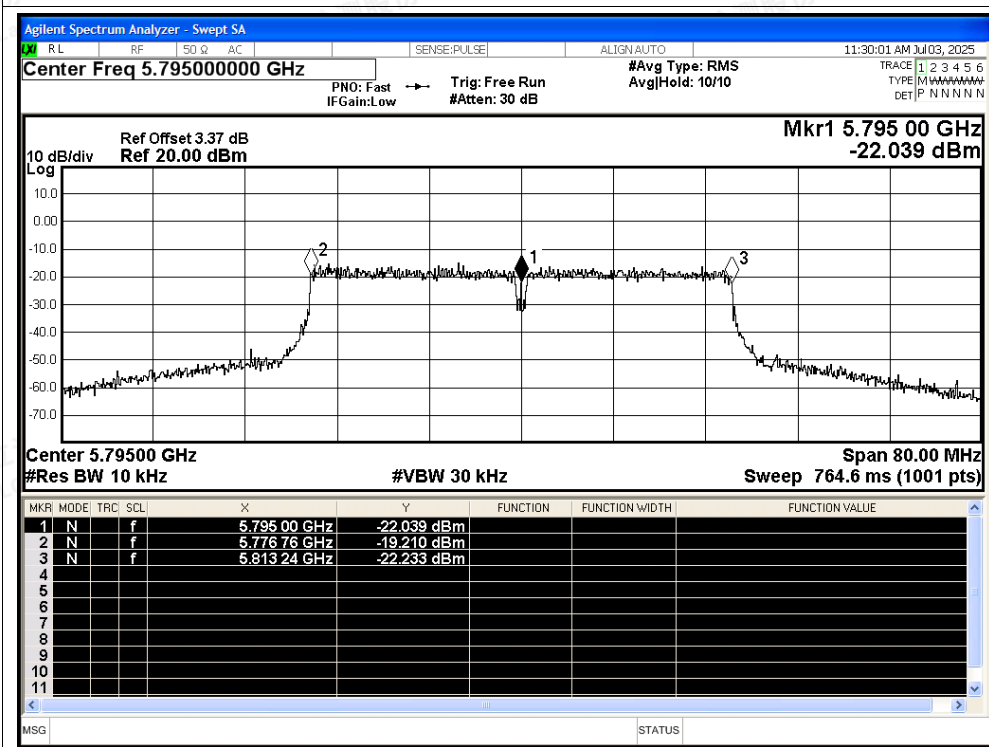

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant6

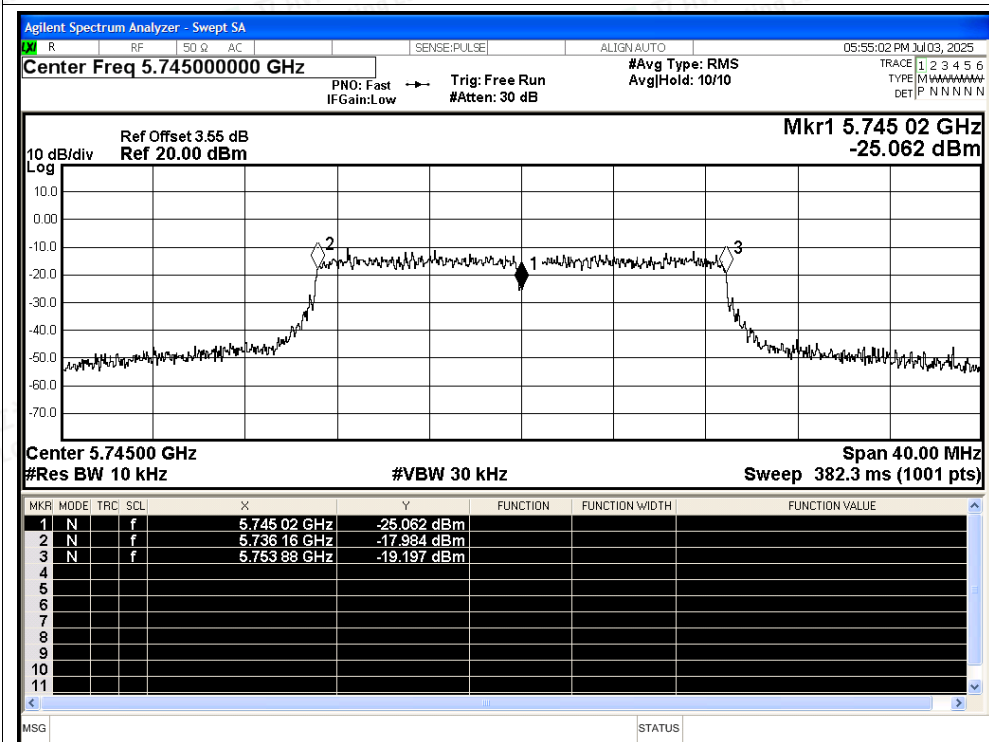

Freq. Stability NVNT ac20 5785MHz Ant6

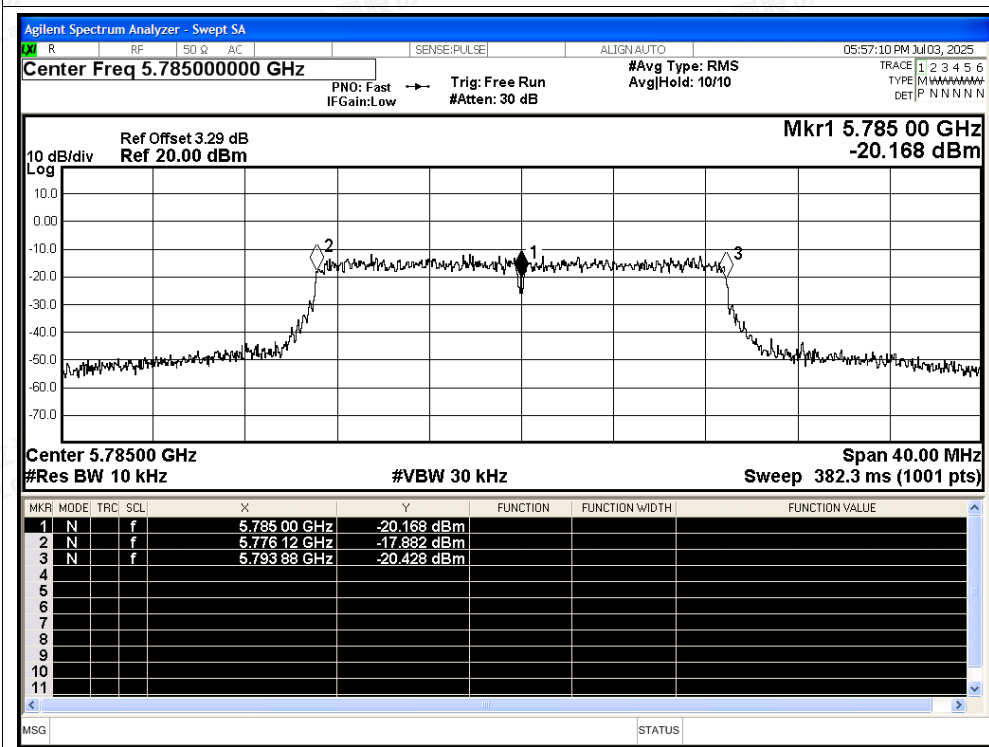

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant6

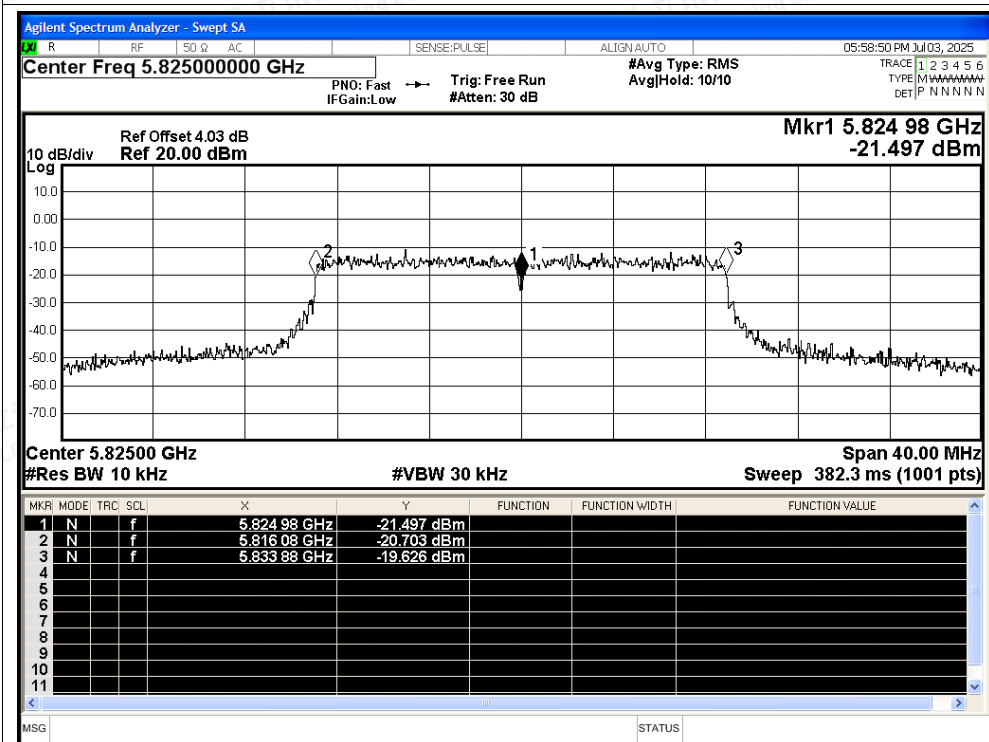

Freq. Stability NVNT ac40 5755MHz Ant6

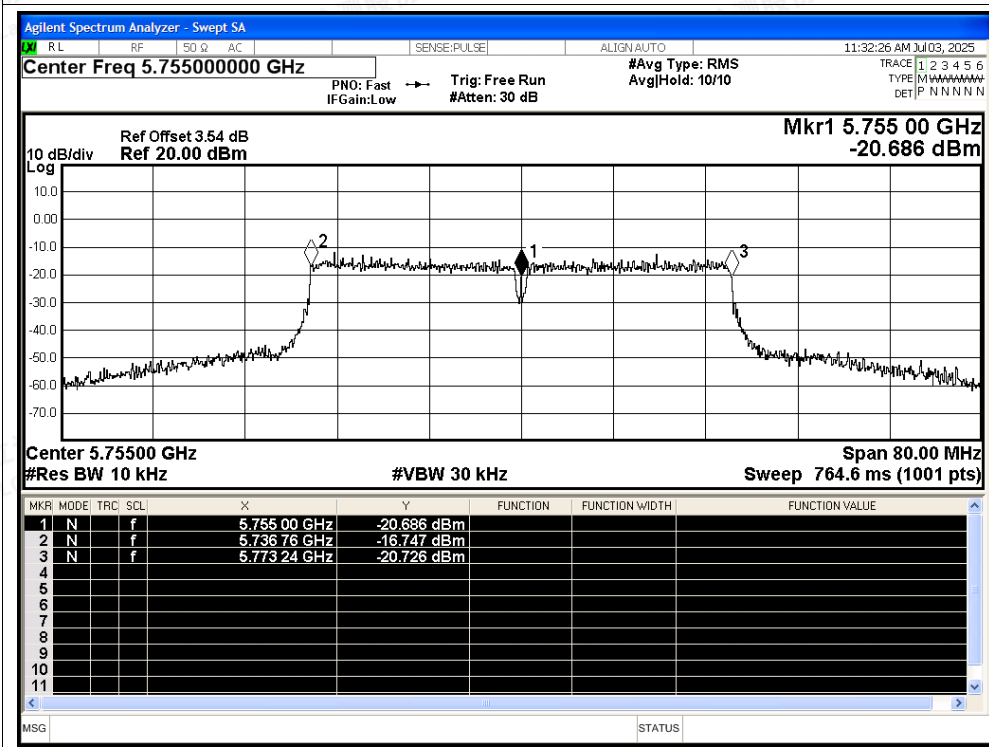

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant6

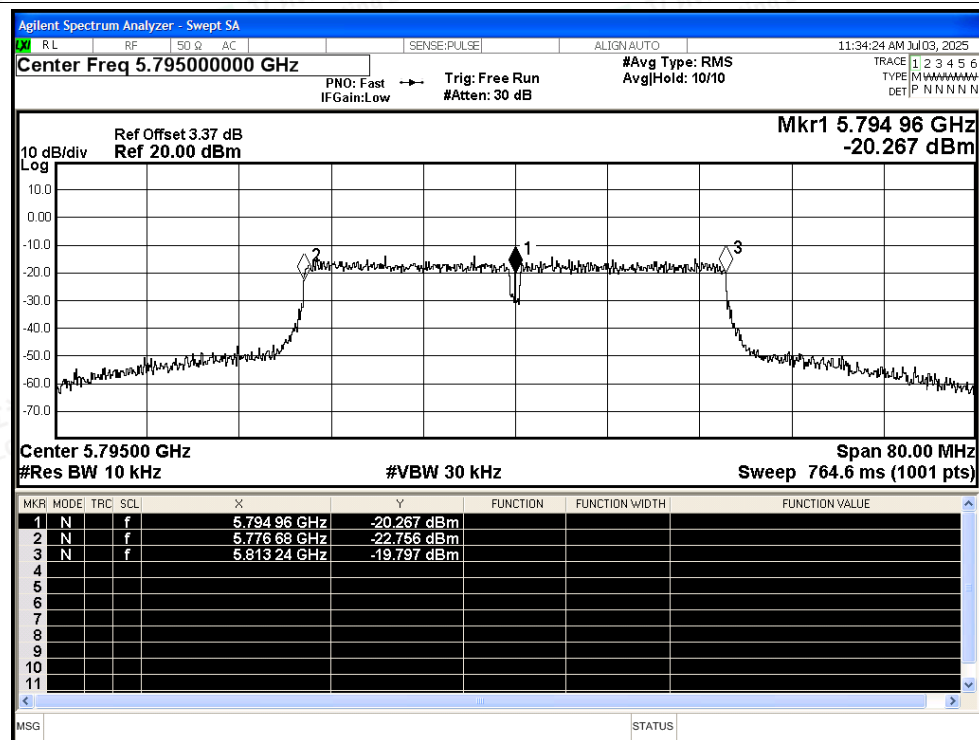

Freq. Stability NVNT ac80 5775MHz Ant6

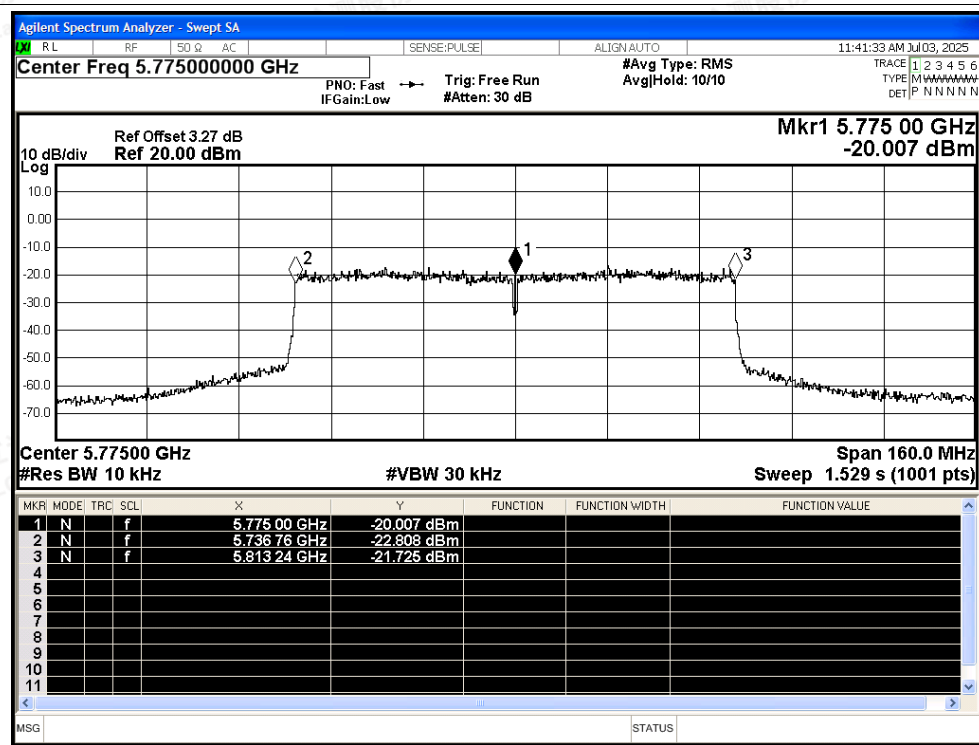

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant6

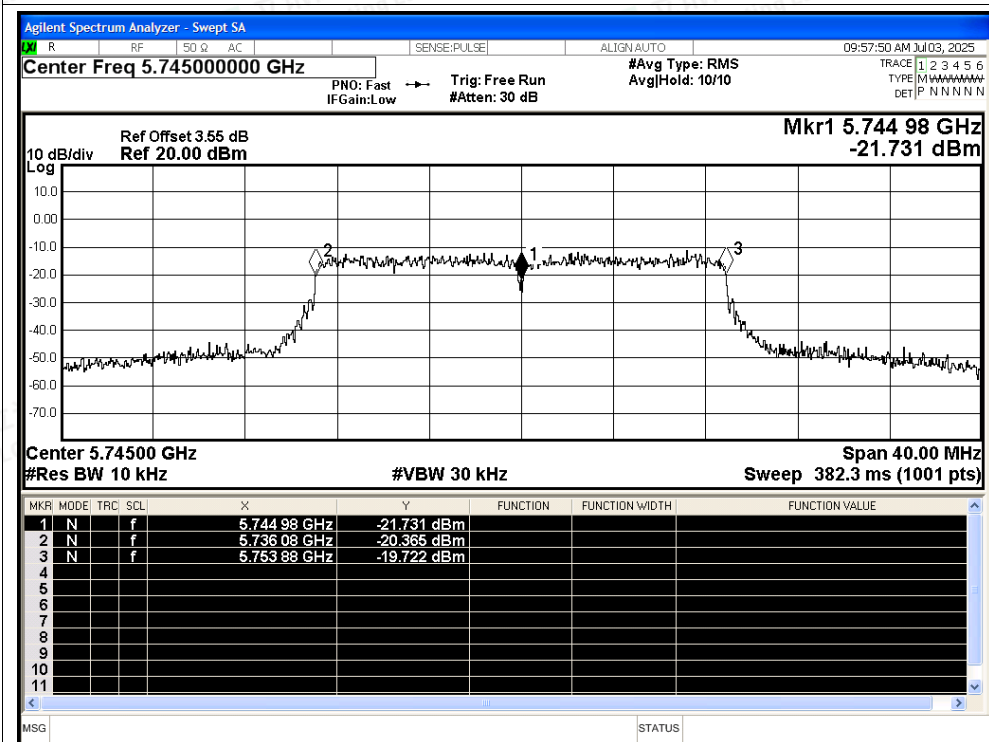

Freq. Stability NVNT ax20 5785MHz Ant6

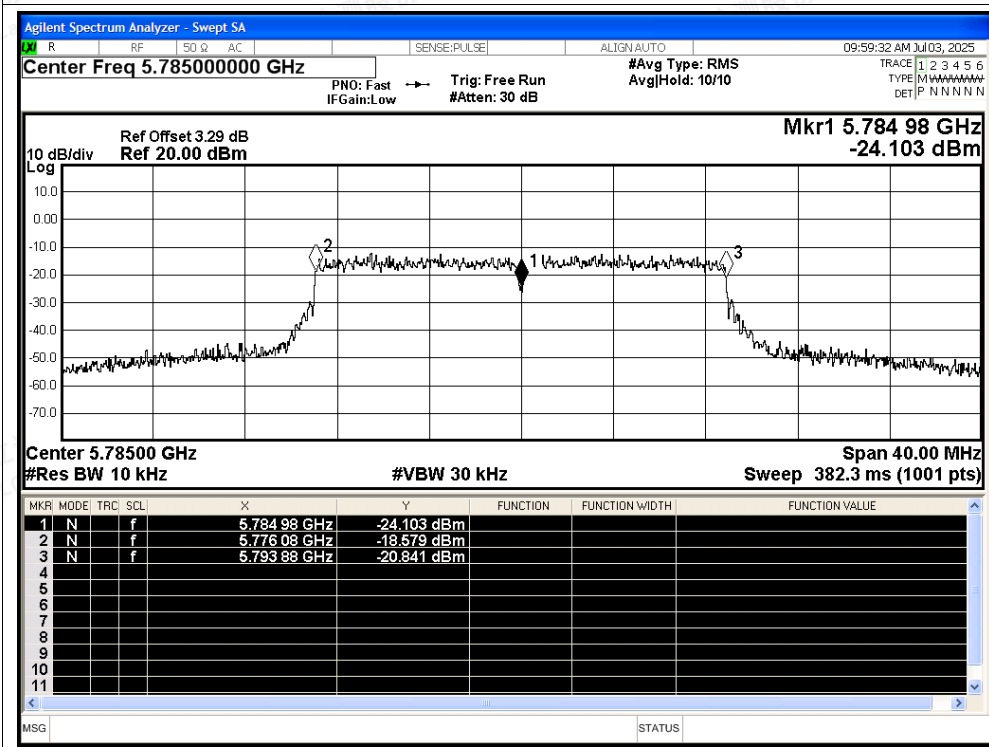

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant6

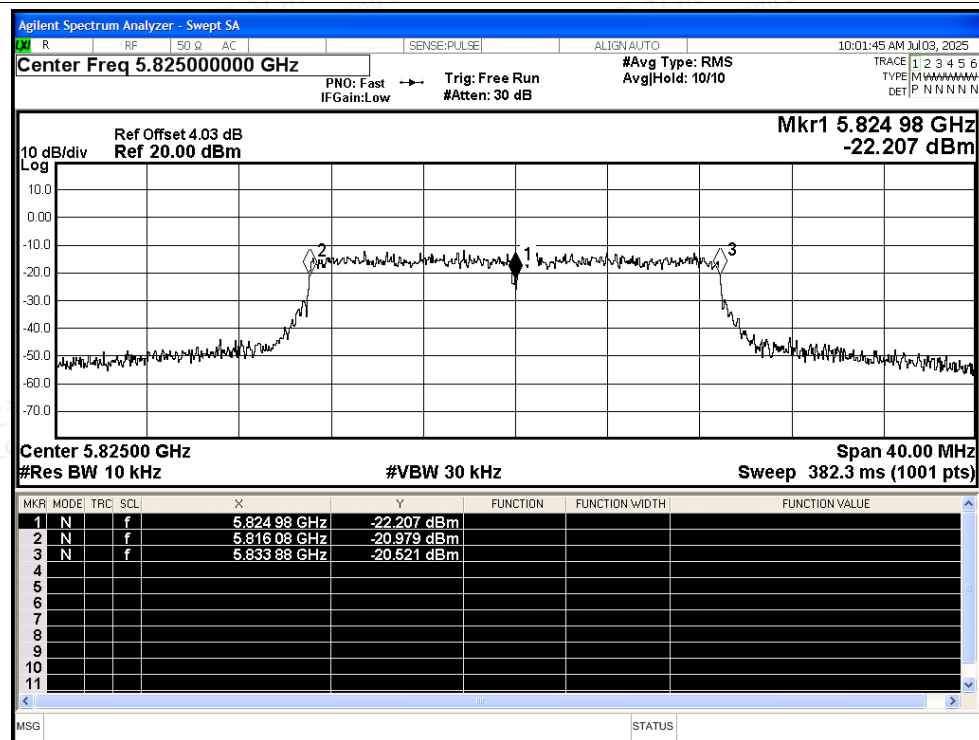

Freq. Stability NVNT ax40 5755MHz Ant6

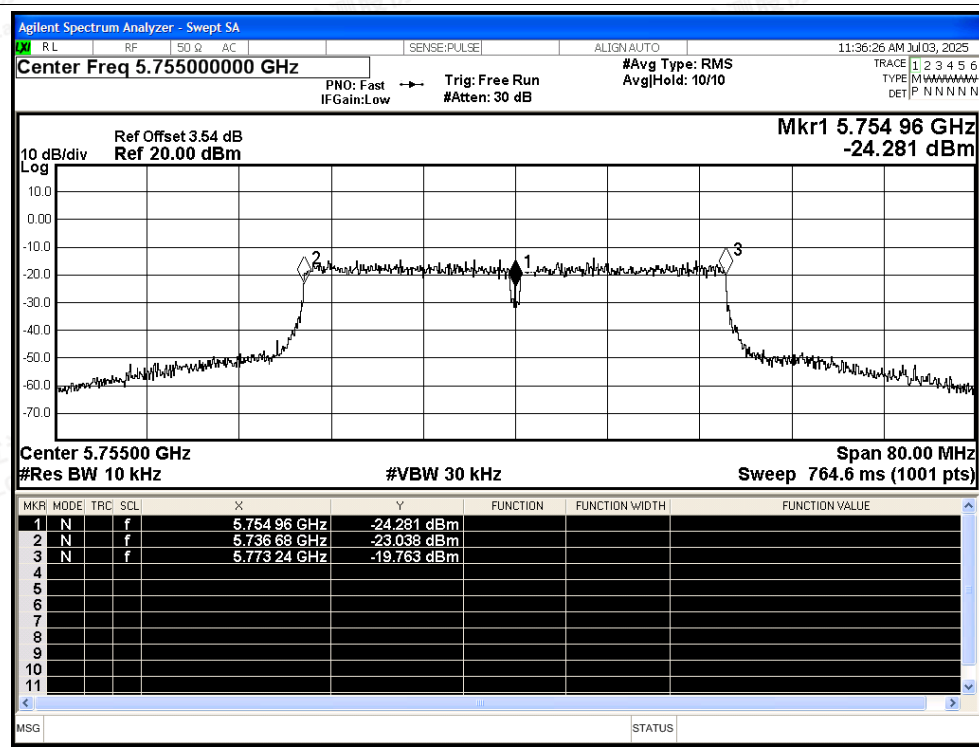

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant6

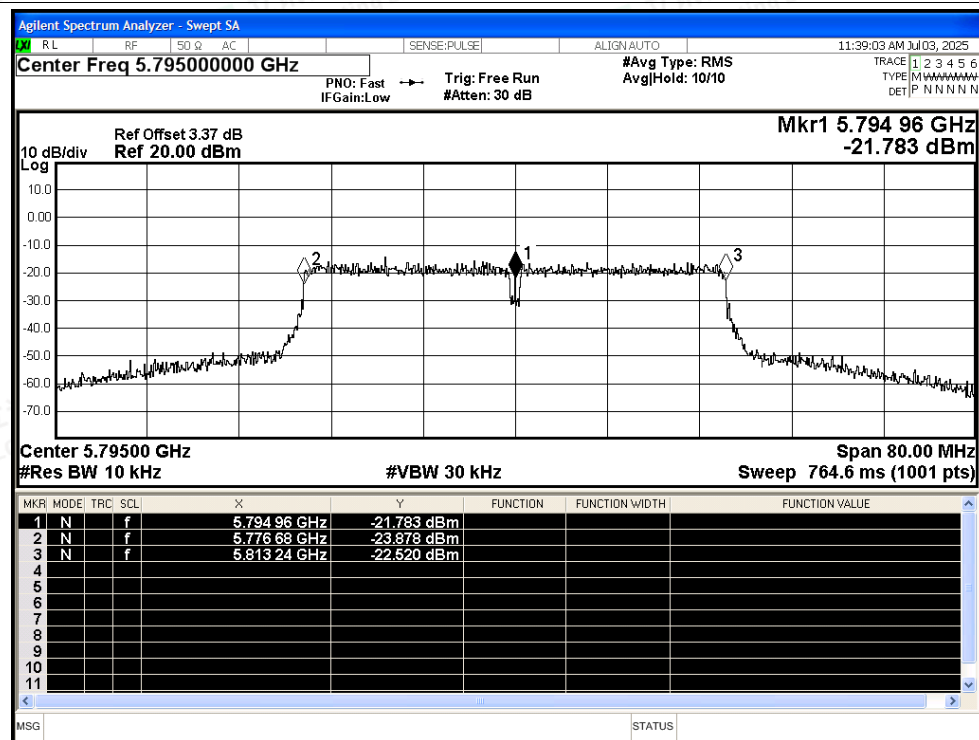

Freq. Stability NVNT ax80 5775MHz Ant6

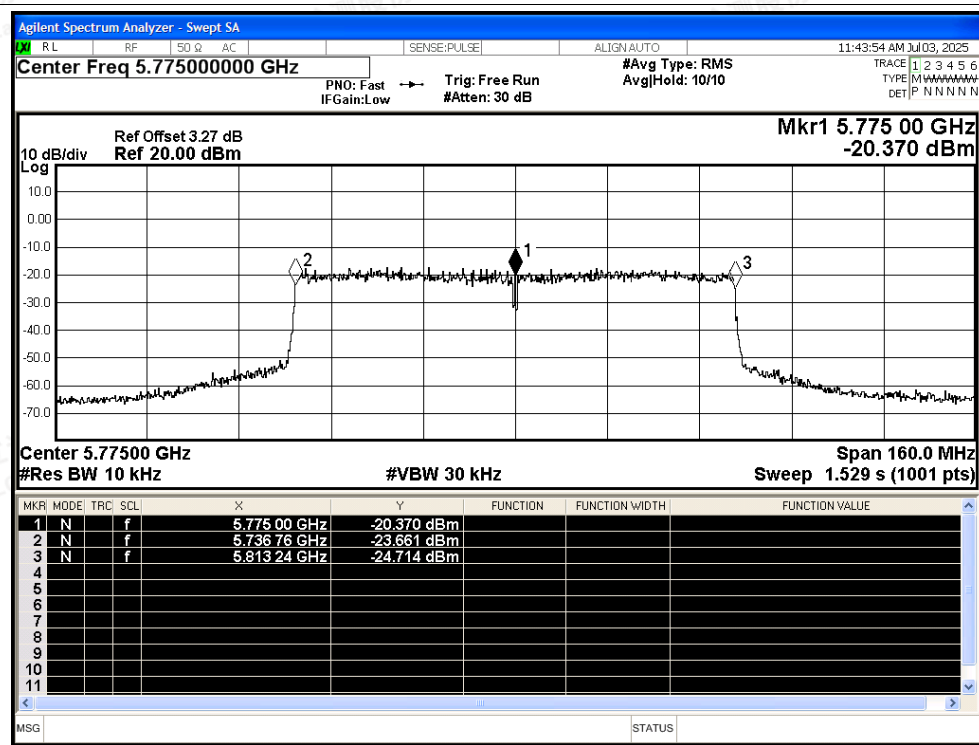

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant2	94.65	0.24	0.91
NVNT	a	5785	Ant2	94.56	0.24	0.91
NVNT	a	5825	Ant2	94.65	0.24	0.91
NVNT	n20	5745	Ant2	93.77	0.28	1.07
NVNT	n20	5785	Ant2	93.77	0.28	1.07
NVNT	n20	5825	Ant2	93.77	0.28	1.07
NVNT	n40	5755	Ant2	88.14	0.55	2.14
NVNT	n40	5795	Ant2	88.14	0.55	2.14
NVNT	ac20	5745	Ant2	93.72	0.28	1.06
NVNT	ac20	5785	Ant2	93.72	0.28	1.06
NVNT	ac20	5825	Ant2	93.72	0.28	1.06
NVNT	ac40	5755	Ant2	88.48	0.53	2.1
NVNT	ac40	5795	Ant2	88.66	0.52	2.1
NVNT	ac80	5775	Ant2	79.61	0.99	4.13
NVNT	ax20	5745	Ant2	93.82	0.28	1.06
NVNT	ax20	5785	Ant2	93.72	0.28	1.06
NVNT	ax20	5825	Ant2	93.82	0.28	1.06
NVNT	ax40	5755	Ant2	88.48	0.53	2.1
NVNT	ax40	5795	Ant2	88.48	0.53	2.1
NVNT	ax80	5775	Ant2	79.61	0.99	4.13



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant2

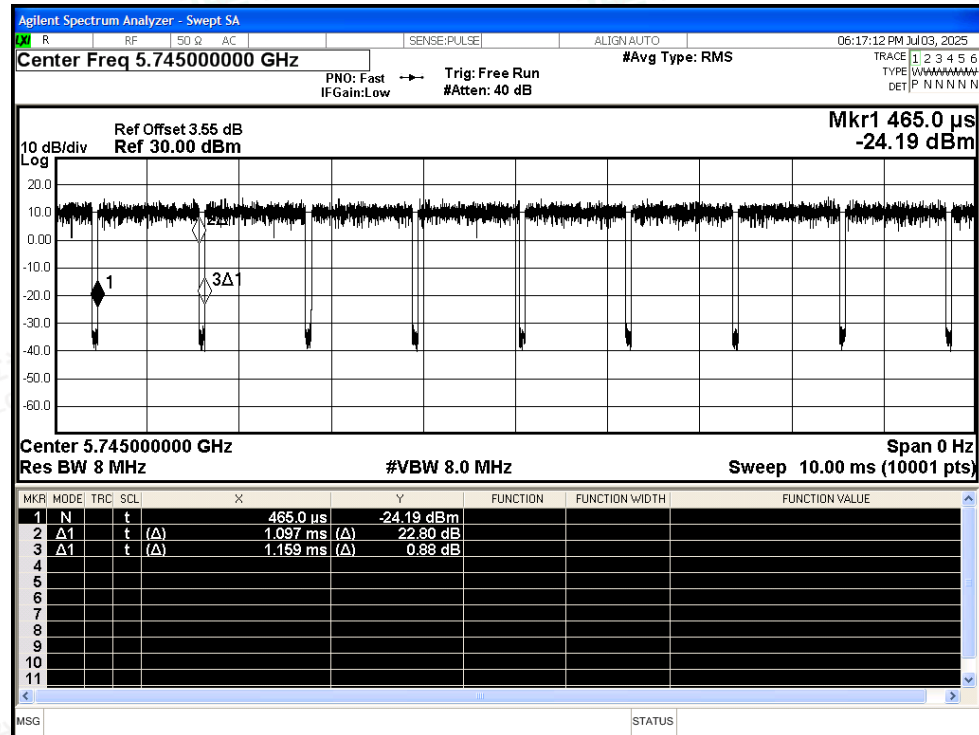

Duty Cycle NVNT a 5785MHz Ant2

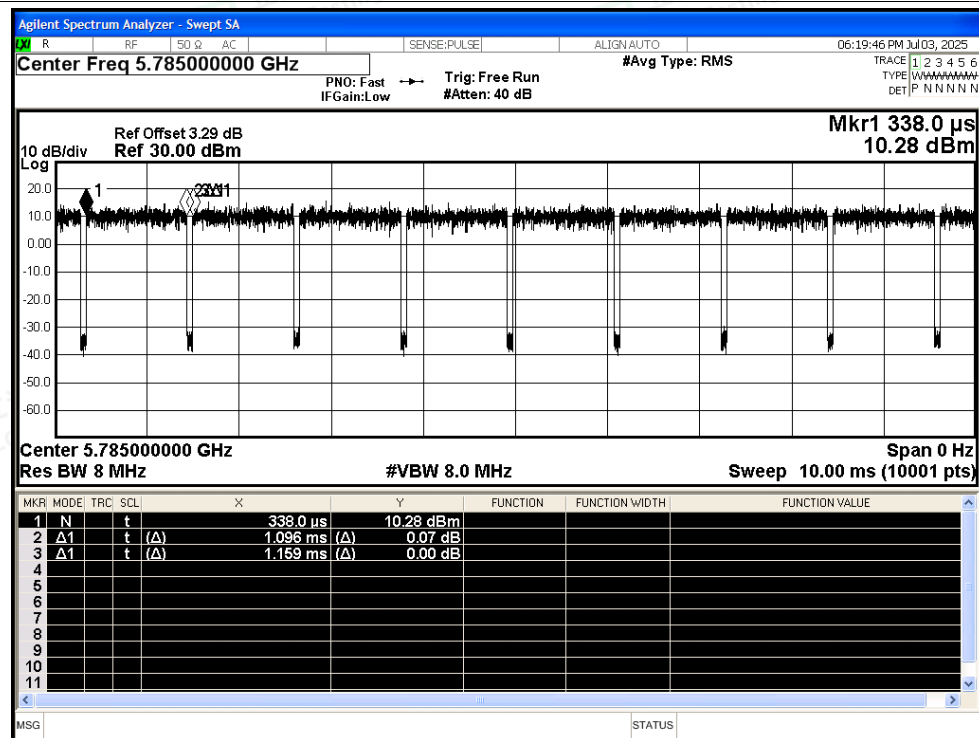

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5825MHz Ant2

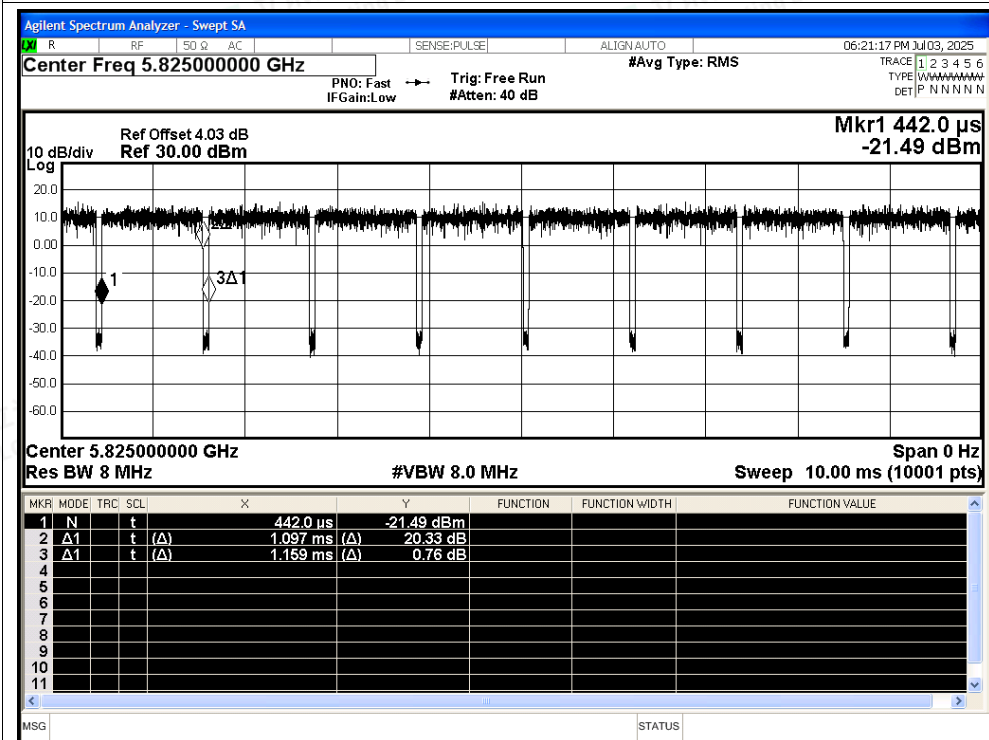

Duty Cycle NVNT n20 5745MHz Ant2

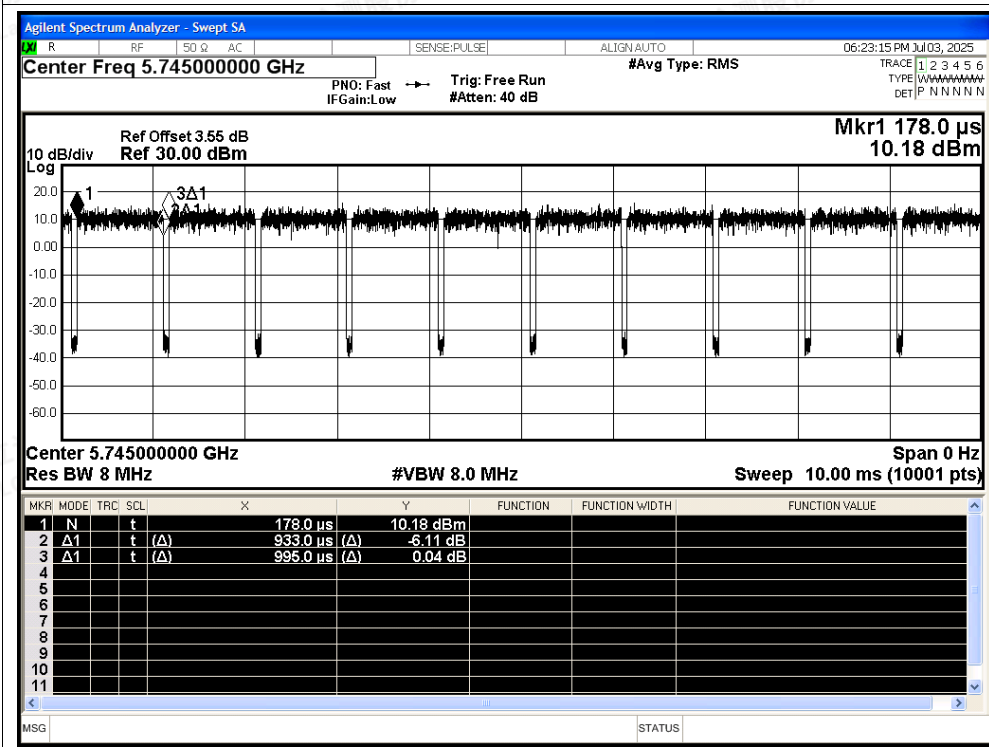

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant2

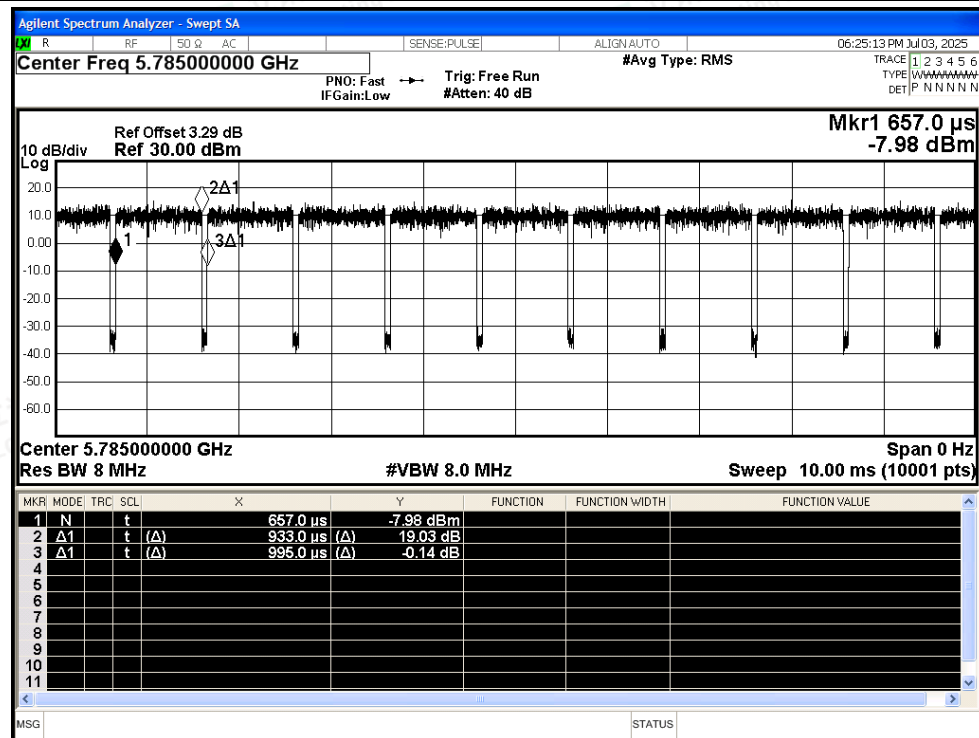

Duty Cycle NVNT n20 5825MHz Ant2

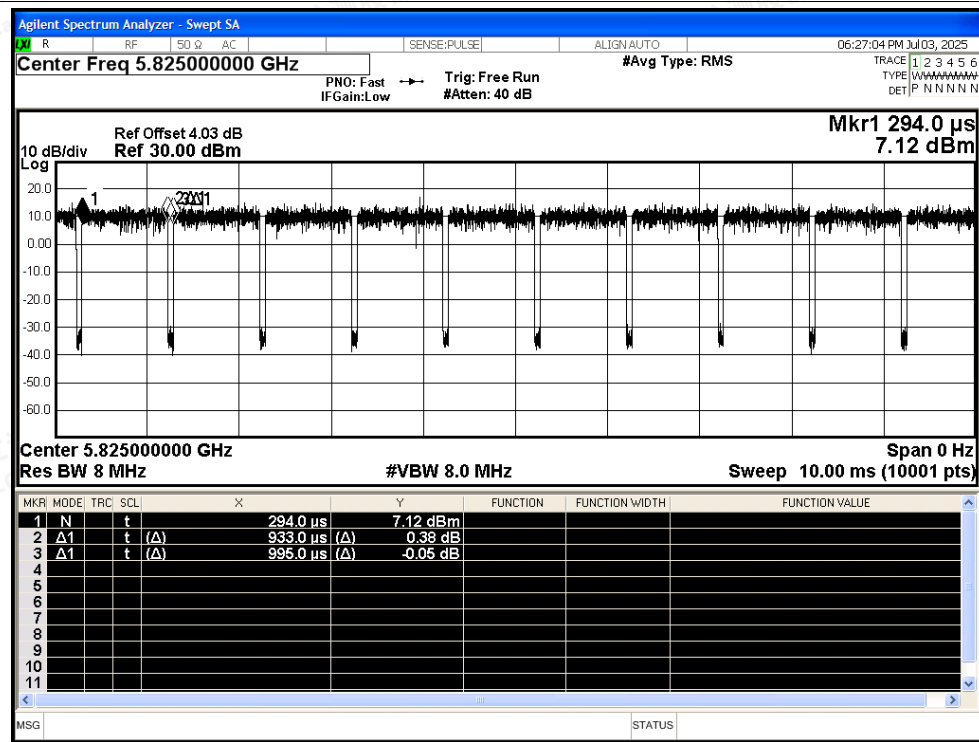

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity