



Appendix M: Test Data for E-UTRA Band 41

Product Name: TABLET PC

Test Model: TEO10M4BK64

Environmental Conditions

Temperature:	23.8°C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



M.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	22.27	PASS
Band41	5MHz	16QAM	39675	1RB#0	22.52	PASS
Band41	5MHz	QPSK	39675	1RB#12	22.33	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.32	PASS
Band41	5MHz	QPSK	39675	1RB#24	22.12	PASS
Band41	5MHz	16QAM	39675	1RB#24	22.26	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.26	PASS
Band41	5MHz	16QAM	39675	12RB#0	21.27	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.28	PASS
Band41	5MHz	16QAM	39675	12RB#6	21.28	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.29	PASS
Band41	5MHz	16QAM	39675	12RB#13	21.29	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.29	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.52	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.13	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.76	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.99	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.65	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.82	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.40	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.99	PASS
Band41	5MHz	16QAM	40620	12RB#0	21.00	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.19	PASS
Band41	5MHz	16QAM	40620	12RB#6	21.20	PASS
Band41	5MHz	QPSK	40620	12RB#13	21.20	PASS
Band41	5MHz	16QAM	40620	12RB#13	21.21	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.21	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.53	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.71	PASS
Band41	5MHz	16QAM	41565	1RB#0	22.75	PASS
Band41	5MHz	QPSK	41565	1RB#12	23.06	PASS
Band41	5MHz	16QAM	41565	1RB#12	22.72	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.59	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#24	22.67	PASS
Band41	5MHz	QPSK	41565	12RB#0	22.40	PASS
Band41	5MHz	16QAM	41565	12RB#0	22.40	PASS
Band41	5MHz	QPSK	41565	12RB#6	22.40	PASS
Band41	5MHz	16QAM	41565	12RB#6	22.40	PASS
Band41	5MHz	QPSK	41565	12RB#13	22.41	PASS
Band41	5MHz	16QAM	41565	12RB#13	22.50	PASS
Band41	5MHz	QPSK	41565	25RB#0	22.50	PASS
Band41	5MHz	16QAM	41565	25RB#0	21.67	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.78	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.23	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.59	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.07	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.75	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.10	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.82	PASS
Band41	10MHz	16QAM	39700	25RB#0	21.81	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.81	PASS
Band41	10MHz	16QAM	39700	25RB#12	21.81	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.75	PASS
Band41	10MHz	16QAM	39700	25RB#25	21.75	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.81	PASS
Band41	10MHz	16QAM	39700	50RB#0	21.07	PASS
Band41	10MHz	QPSK	40620	1RB#0	23.23	PASS
Band41	10MHz	16QAM	40620	1RB#0	22.63	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.95	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.34	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.57	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.96	PASS
Band41	10MHz	QPSK	40620	25RB#0	22.25	PASS
Band41	10MHz	16QAM	40620	25RB#0	22.26	PASS
Band41	10MHz	QPSK	40620	25RB#12	22.26	PASS
Band41	10MHz	16QAM	40620	25RB#12	22.25	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.98	PASS
Band41	10MHz	16QAM	40620	25RB#25	21.98	PASS
Band41	10MHz	QPSK	40620	50RB#0	22.04	PASS
Band41	10MHz	16QAM	40620	50RB#0	21.31	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.80	PASS
Band41	10MHz	16QAM	41540	1RB#0	22.68	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	41540	1RB#24	22.88	PASS
Band41	10MHz	16QAM	41540	1RB#24	22.78	PASS
Band41	10MHz	QPSK	41540	1RB#49	22.83	PASS
Band41	10MHz	16QAM	41540	1RB#49	22.58	PASS
Band41	10MHz	QPSK	41540	25RB#0	21.96	PASS
Band41	10MHz	16QAM	41540	25RB#0	21.96	PASS
Band41	10MHz	QPSK	41540	25RB#12	21.96	PASS
Band41	10MHz	16QAM	41540	25RB#12	21.96	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.94	PASS
Band41	10MHz	16QAM	41540	25RB#25	21.94	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.95	PASS
Band41	10MHz	16QAM	41540	50RB#0	21.28	PASS
Band41	15MHz	QPSK	39725	1RB#0	23.27	PASS
Band41	15MHz	16QAM	39725	1RB#0	22.92	PASS
Band41	15MHz	QPSK	39725	1RB#38	23.15	PASS
Band41	15MHz	16QAM	39725	1RB#38	22.78	PASS
Band41	15MHz	QPSK	39725	1RB#74	23.38	PASS
Band41	15MHz	16QAM	39725	1RB#74	23.13	PASS
Band41	15MHz	QPSK	39725	38RB#0	22.17	PASS
Band41	15MHz	16QAM	39725	38RB#0	22.17	PASS
Band41	15MHz	QPSK	39725	38RB#18	22.17	PASS
Band41	15MHz	16QAM	39725	38RB#18	22.17	PASS
Band41	15MHz	QPSK	39725	38RB#37	22.16	PASS
Band41	15MHz	16QAM	39725	38RB#37	22.16	PASS
Band41	15MHz	QPSK	39725	75RB#0	22.16	PASS
Band41	15MHz	16QAM	39725	75RB#0	21.43	PASS
Band41	15MHz	QPSK	40620	1RB#0	23.62	PASS
Band41	15MHz	16QAM	40620	1RB#0	22.25	PASS
Band41	15MHz	QPSK	40620	1RB#38	23.27	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.84	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.88	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.34	PASS
Band41	15MHz	QPSK	40620	38RB#0	22.11	PASS
Band41	15MHz	16QAM	40620	38RB#0	22.11	PASS
Band41	15MHz	QPSK	40620	38RB#18	22.11	PASS
Band41	15MHz	16QAM	40620	38RB#18	22.11	PASS
Band41	15MHz	QPSK	40620	38RB#37	22.12	PASS
Band41	15MHz	16QAM	40620	38RB#37	22.11	PASS
Band41	15MHz	QPSK	40620	75RB#0	22.11	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	75RB#0	21.41	PASS
Band41	15MHz	QPSK	41515	1RB#0	22.91	PASS
Band41	15MHz	16QAM	41515	1RB#0	22.76	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.88	PASS
Band41	15MHz	16QAM	41515	1RB#38	22.76	PASS
Band41	15MHz	QPSK	41515	1RB#74	22.77	PASS
Band41	15MHz	16QAM	41515	1RB#74	22.67	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.81	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.81	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.82	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.82	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.82	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.78	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.79	PASS
Band41	15MHz	16QAM	41515	75RB#0	20.90	PASS
Band41	20MHz	QPSK	39750	1RB#0	22.89	PASS
Band41	20MHz	16QAM	39750	1RB#0	22.28	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.78	PASS
Band41	20MHz	16QAM	39750	1RB#49	22.17	PASS
Band41	20MHz	QPSK	39750	1RB#99	23.26	PASS
Band41	20MHz	16QAM	39750	1RB#99	22.66	PASS
Band41	20MHz	QPSK	39750	50RB#0	22.17	PASS
Band41	20MHz	16QAM	39750	50RB#0	21.48	PASS
Band41	20MHz	QPSK	39750	50RB#25	22.16	PASS
Band41	20MHz	16QAM	39750	50RB#25	21.47	PASS
Band41	20MHz	QPSK	39750	50RB#50	22.41	PASS
Band41	20MHz	16QAM	39750	50RB#50	21.91	PASS
Band41	20MHz	QPSK	39750	100RB#0	22.26	PASS
Band41	20MHz	16QAM	39750	100RB#0	21.57	PASS
Band41	20MHz	QPSK	40620	1RB#0	23.30	PASS
Band41	20MHz	16QAM	40620	1RB#0	22.70	PASS
Band41	20MHz	QPSK	40620	1RB#49	23.26	PASS
Band41	20MHz	16QAM	40620	1RB#49	22.32	PASS
Band41	20MHz	QPSK	40620	1RB#99	22.51	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.55	PASS
Band41	20MHz	QPSK	40620	50RB#0	22.38	PASS
Band41	20MHz	16QAM	40620	50RB#0	21.62	PASS
Band41	20MHz	QPSK	40620	50RB#25	22.43	PASS
Band41	20MHz	16QAM	40620	50RB#25	21.63	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	50RB#50	21.71	PASS
Band41	20MHz	16QAM	40620	50RB#50	21.03	PASS
Band41	20MHz	QPSK	40620	100RB#0	22.11	PASS
Band41	20MHz	16QAM	40620	100RB#0	21.38	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.82	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.77	PASS
Band41	20MHz	QPSK	41490	1RB#49	22.95	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.92	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.79	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.86	PASS
Band41	20MHz	QPSK	41490	50RB#0	21.84	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.03	PASS
Band41	20MHz	QPSK	41490	50RB#25	21.85	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.03	PASS
Band41	20MHz	QPSK	41490	50RB#50	21.70	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.90	PASS
Band41	20MHz	QPSK	41490	100RB#0	21.73	PASS
Band41	20MHz	16QAM	41490	100RB#0	20.85	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



M.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.17	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.76	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	9.10	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.42	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.40	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.02	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	8.73	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.68	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.01	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	7.96	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.30	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.34	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.22	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.46	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.80	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.54	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.53	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.27	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.26	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.74	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.44	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.93	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.67	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.57	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.14	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.63	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	8.61	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.40	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.62	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.12	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	8.83	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.65	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.69	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	9.59	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	15MHz	QPSK	41515	75RB#0	9.12	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.45	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	8.20	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	9.19	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.61	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.32	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.04	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.12	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.54	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.53	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.38	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.49	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.26	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.77	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Test Graphs

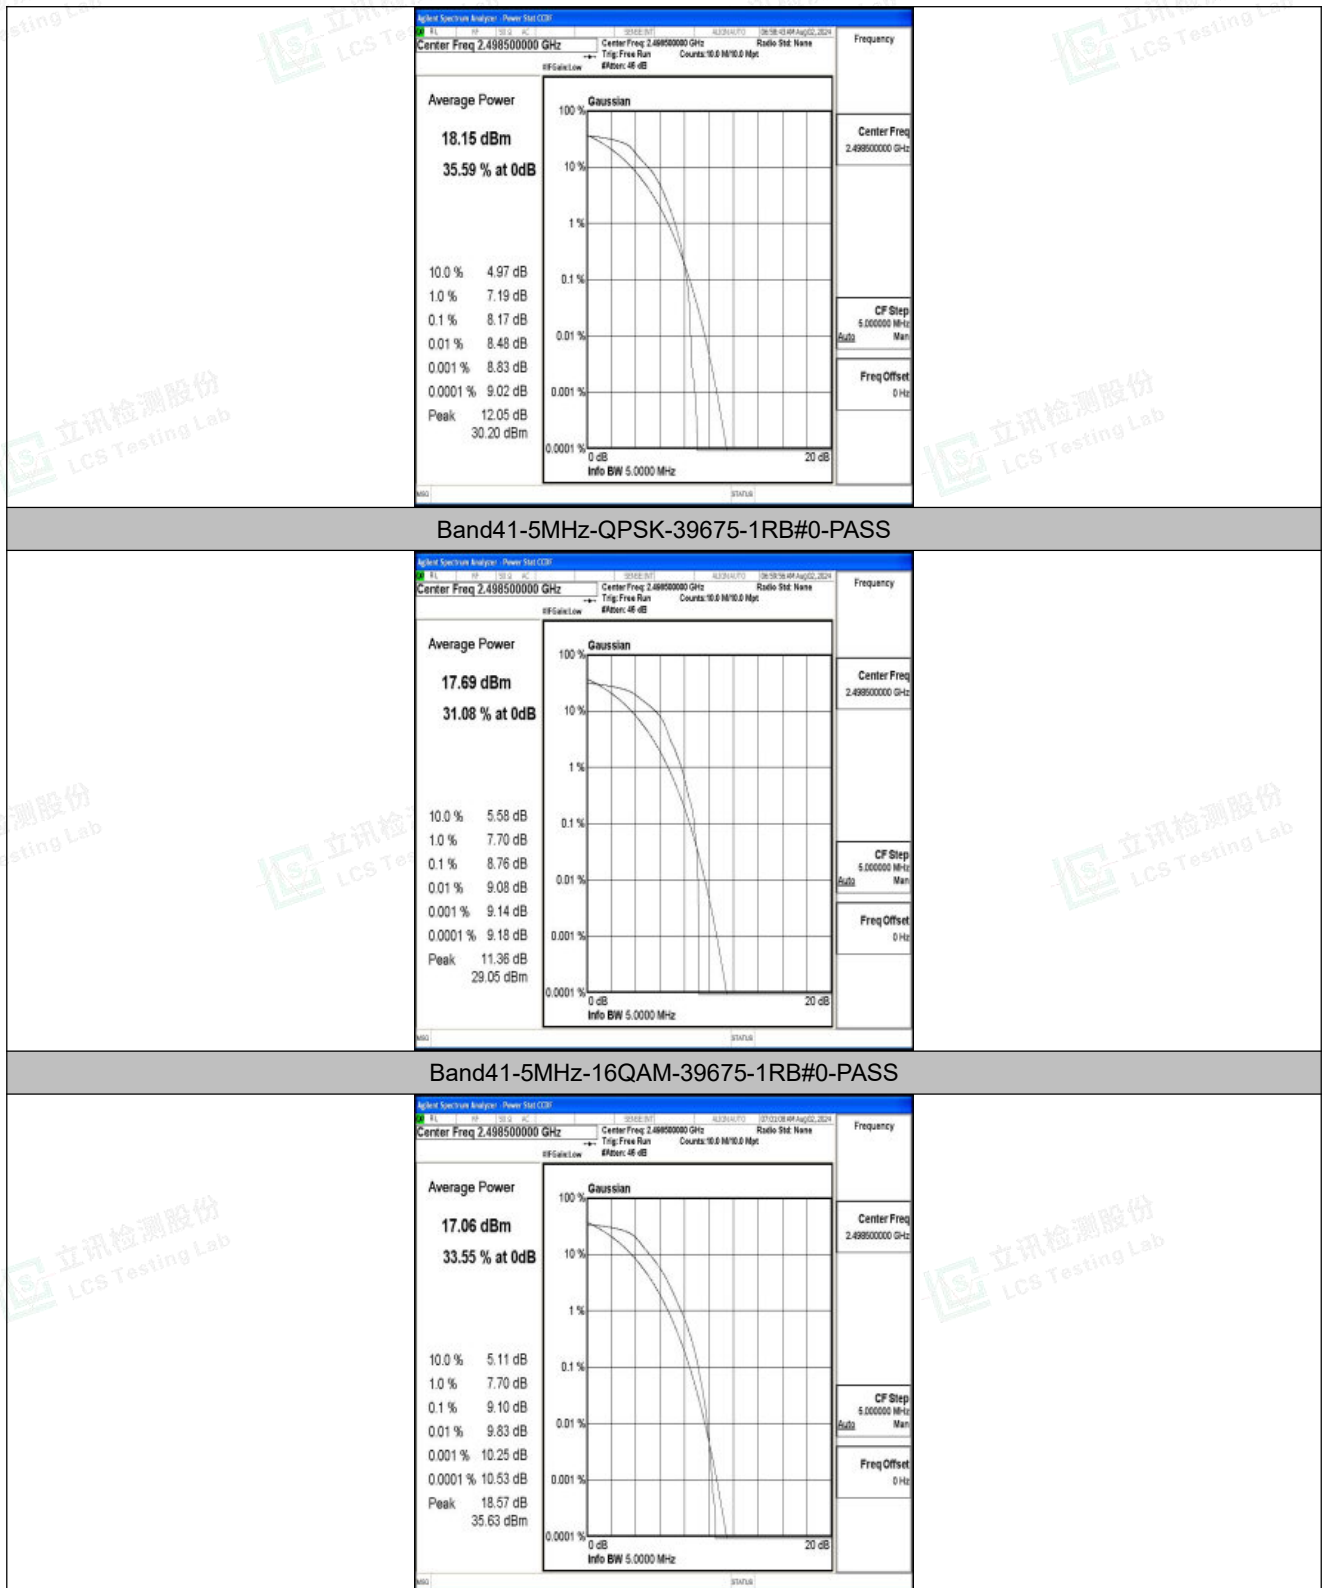

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-39675-25RB#0-PASS

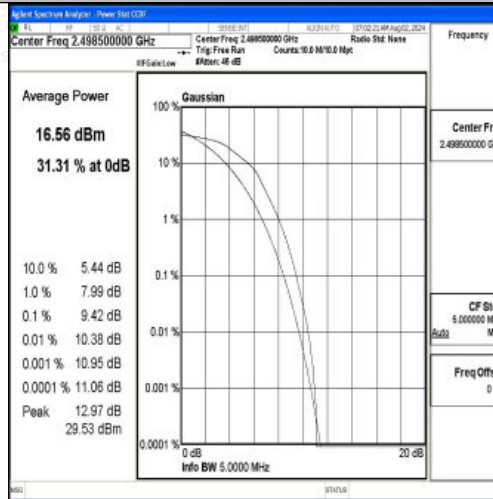

Band41-5MHz-16QAM-39675-25RB#0-PASS

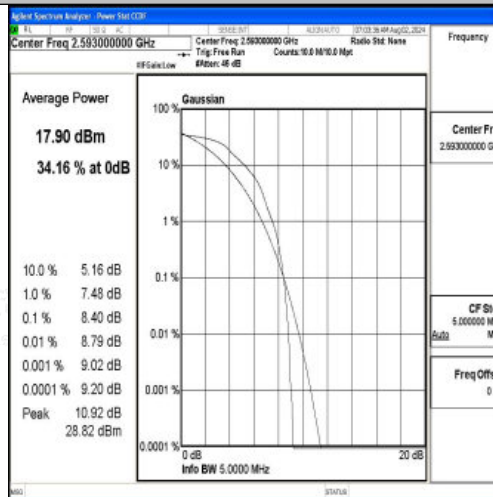

Band41-5MHz-QPSK-40620-1RB#0-PASS

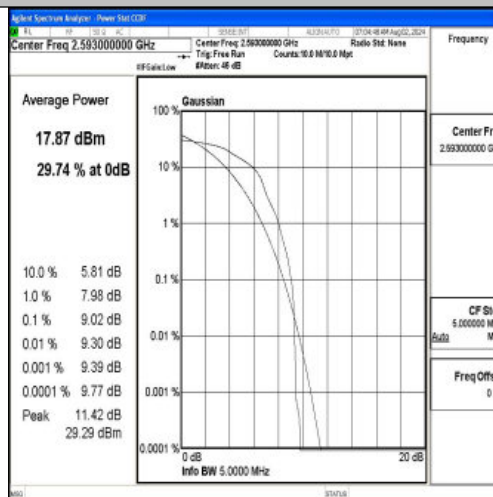

Band41-5MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

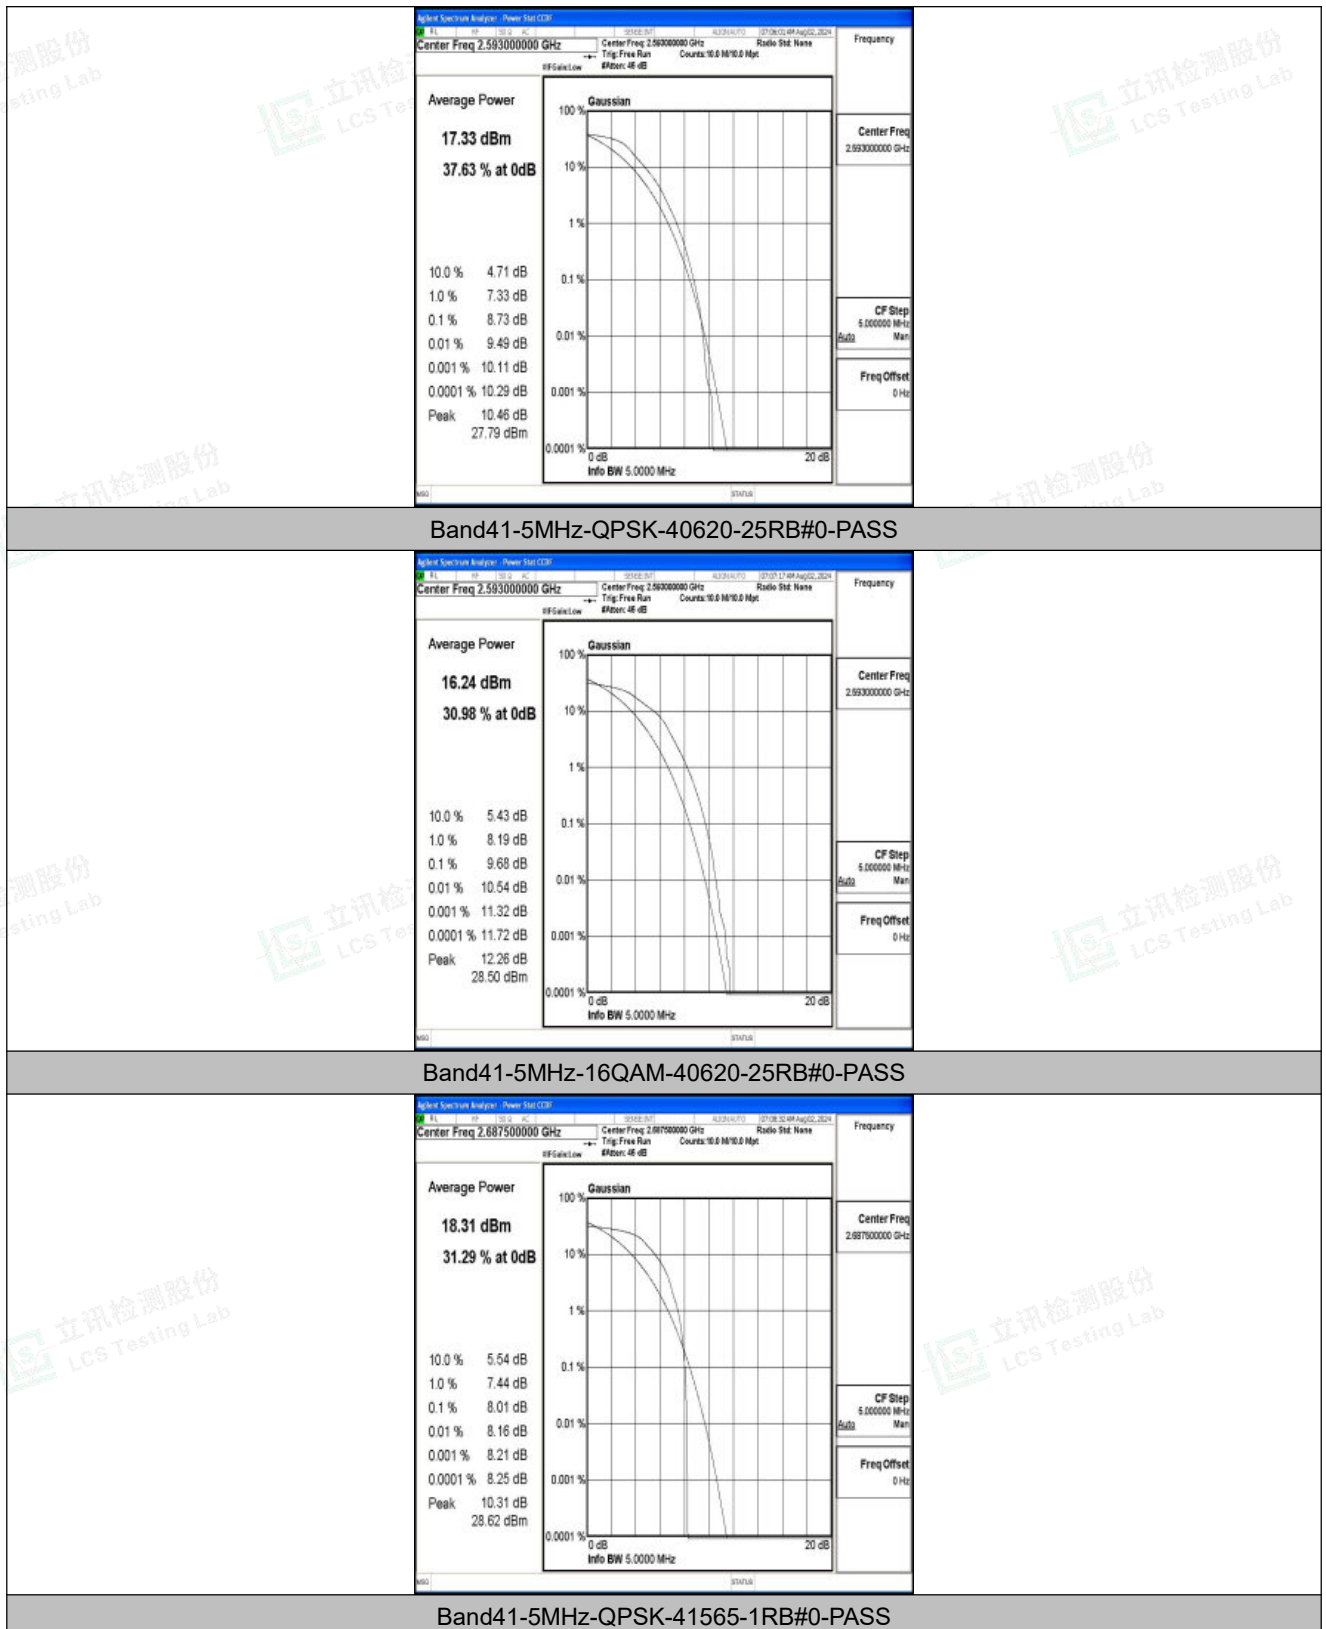


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

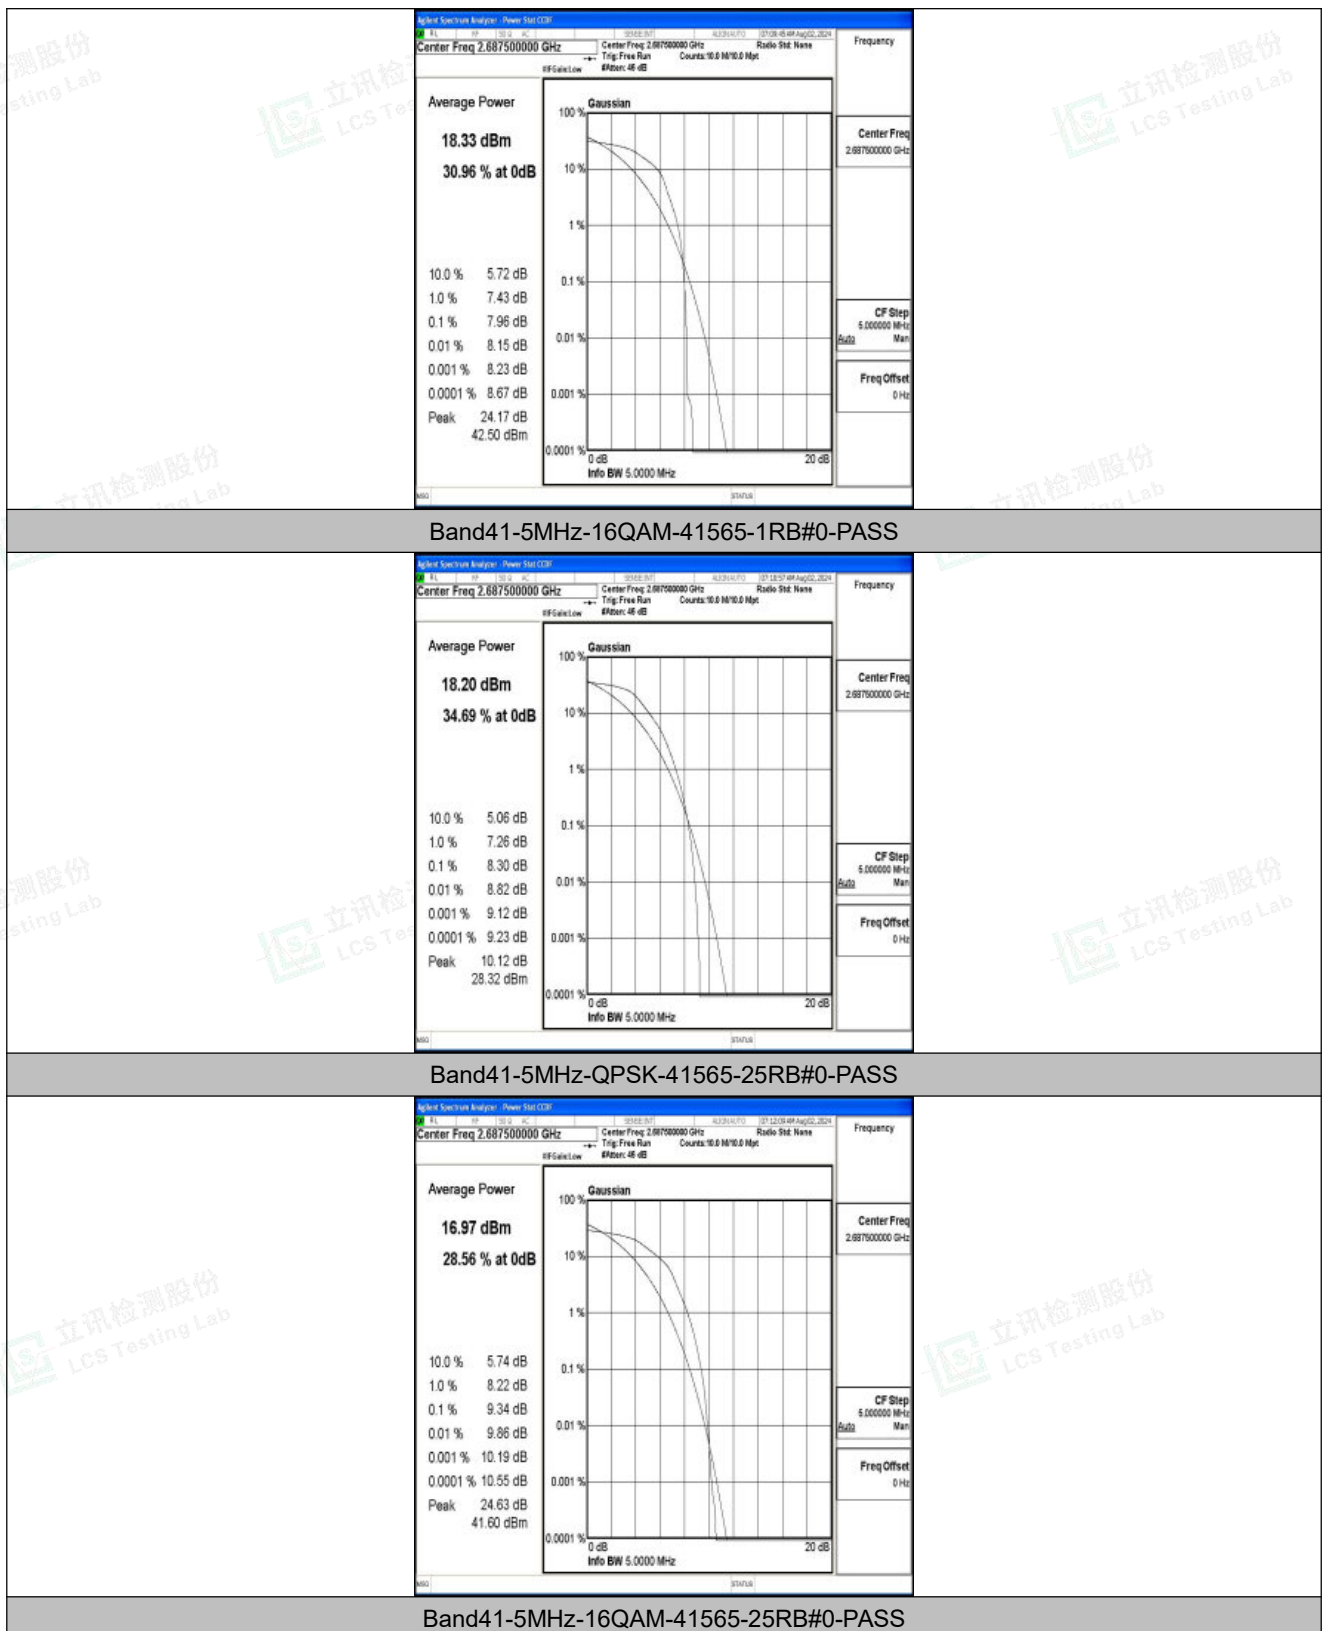

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

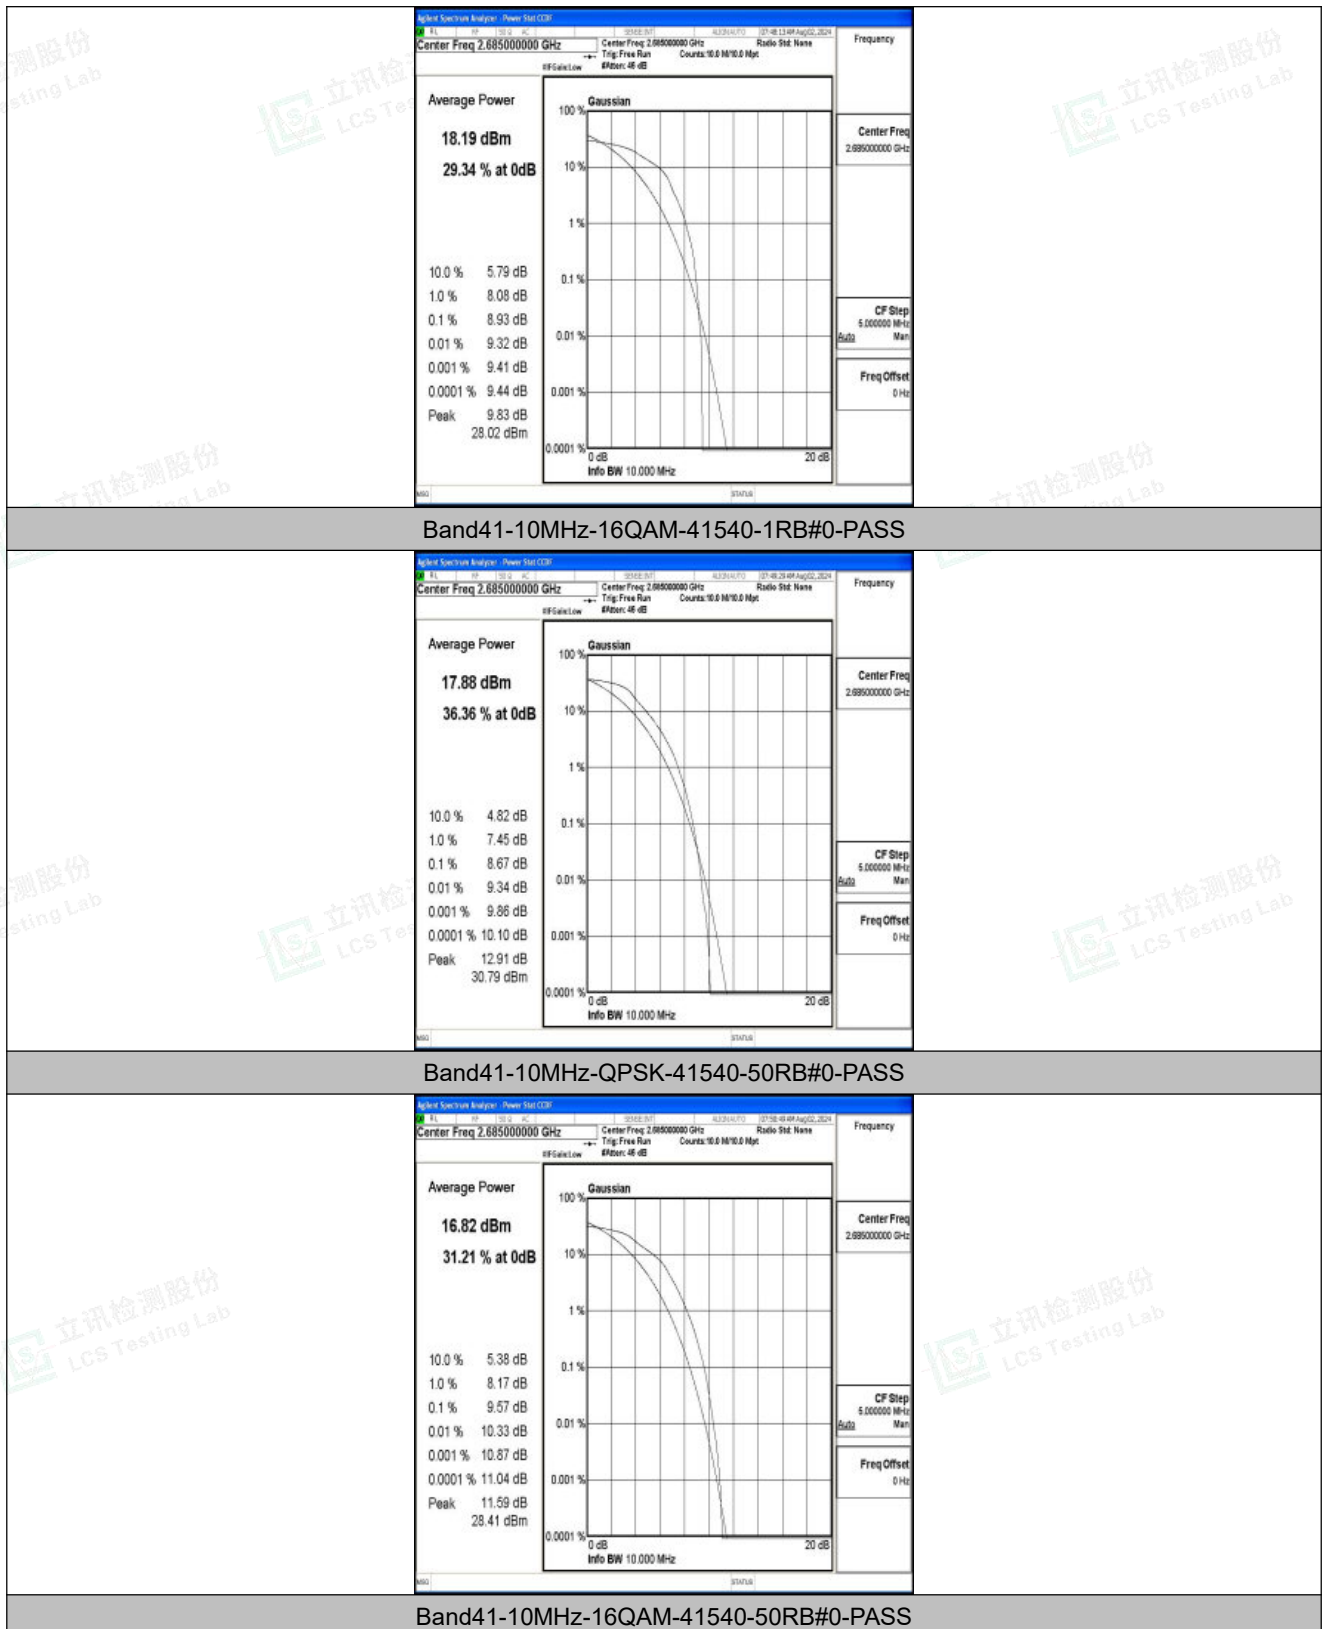


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

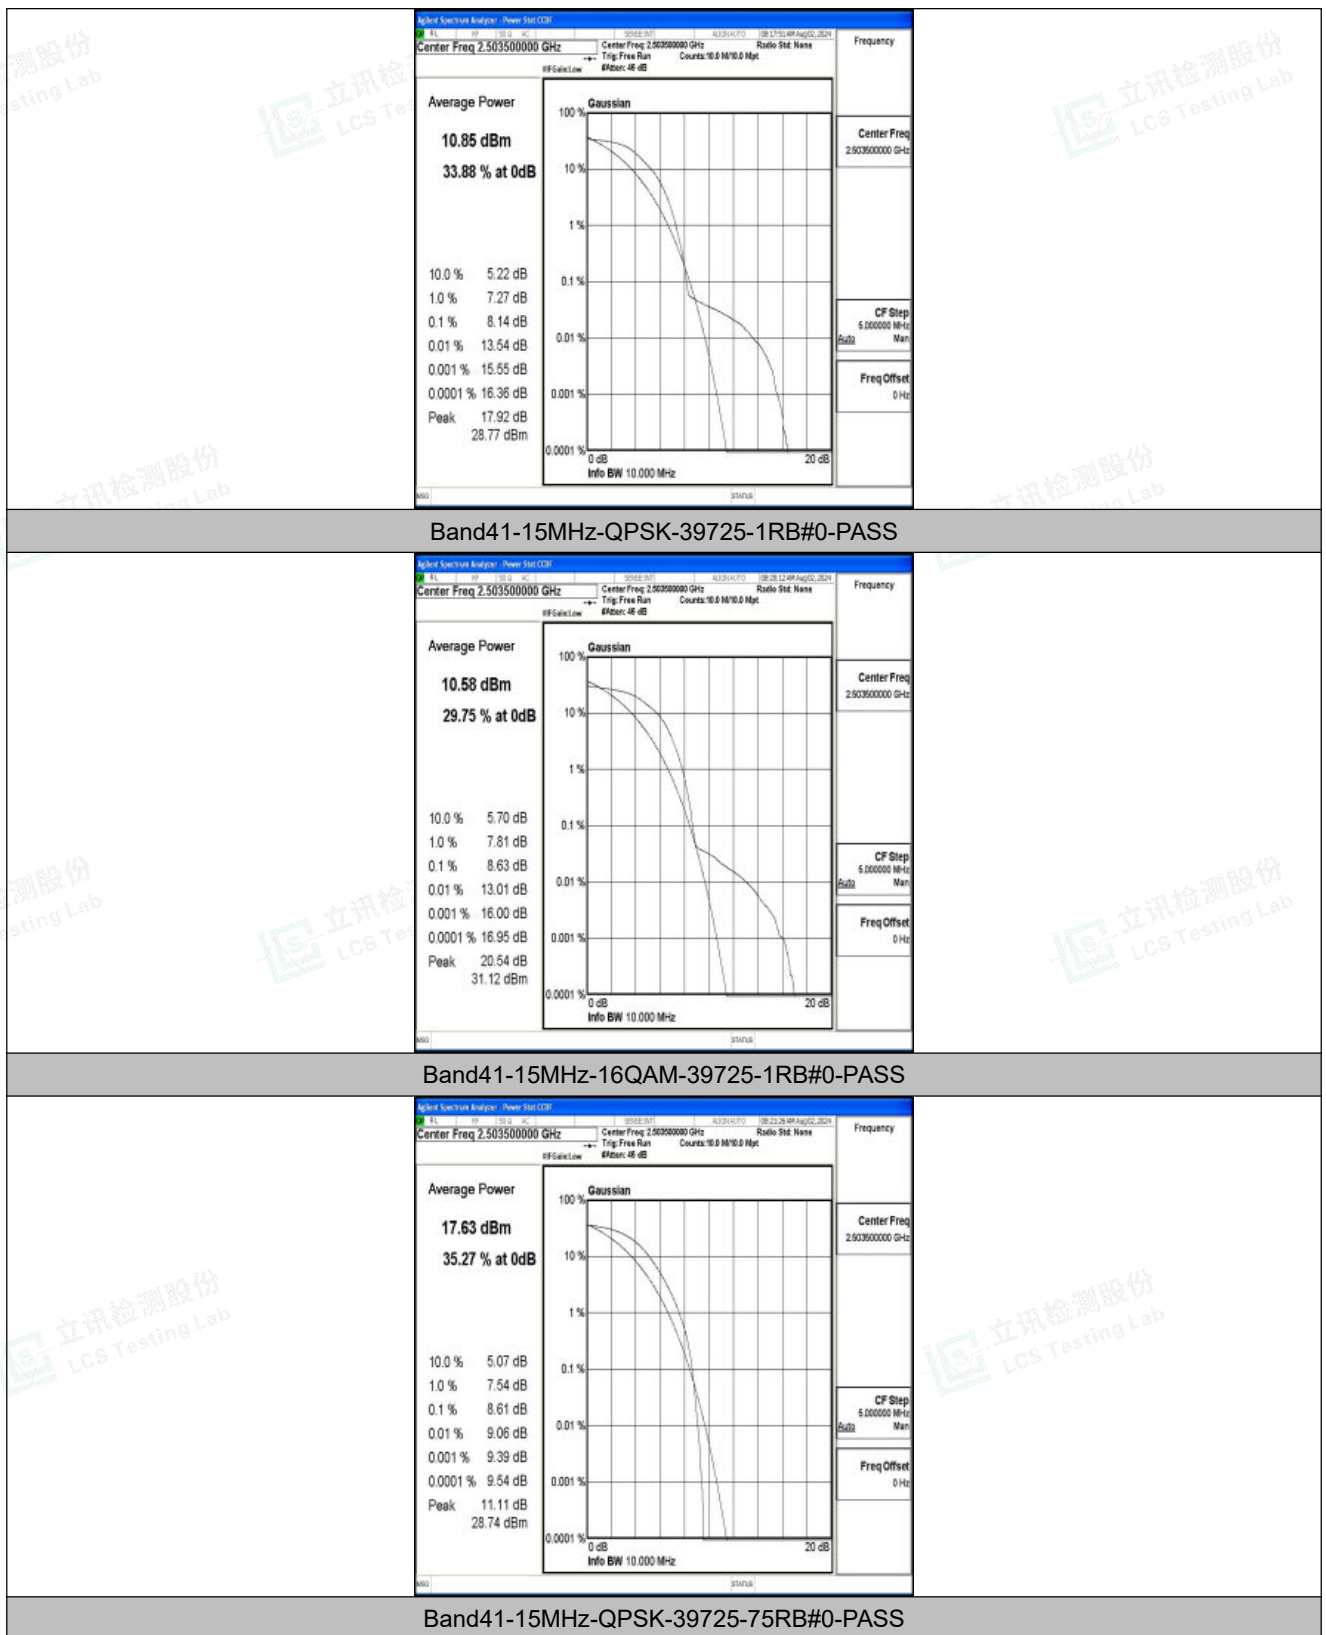


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

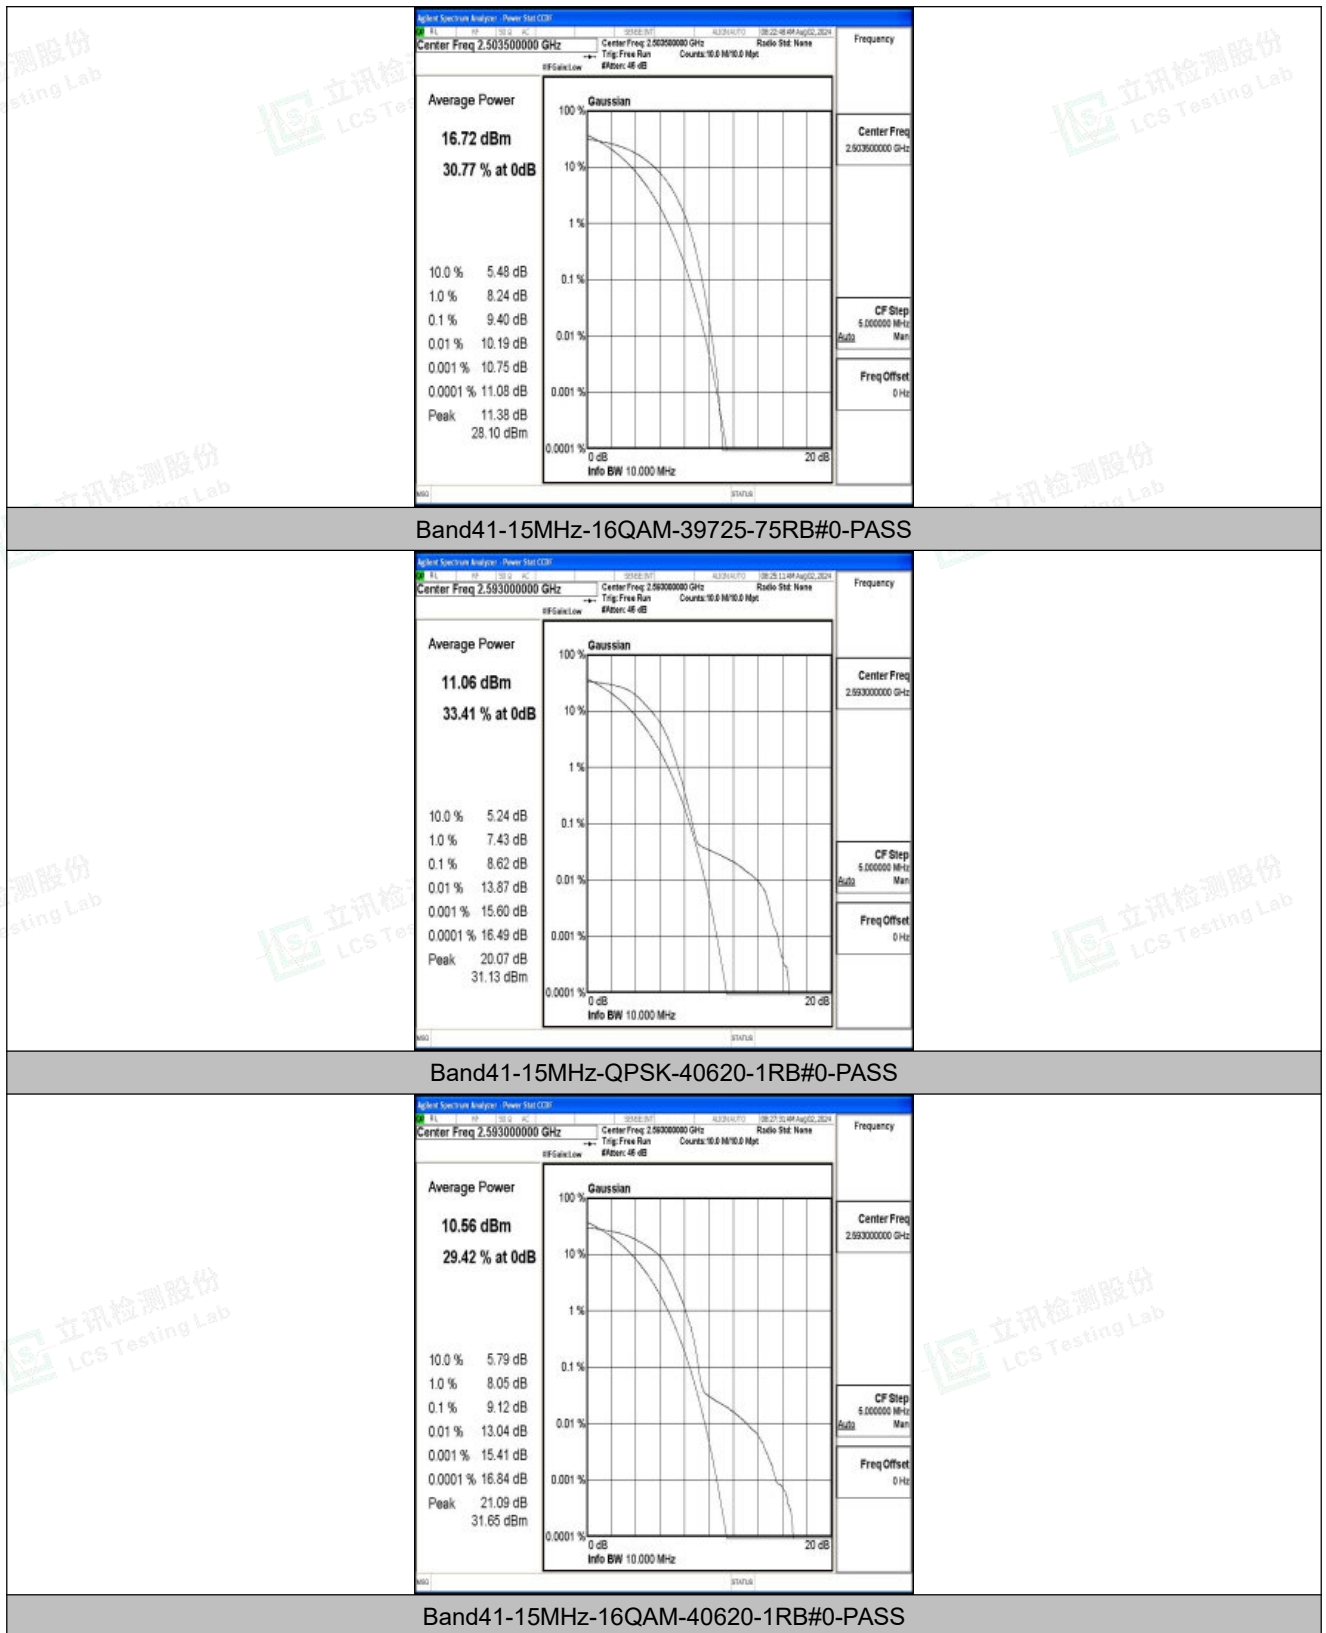

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

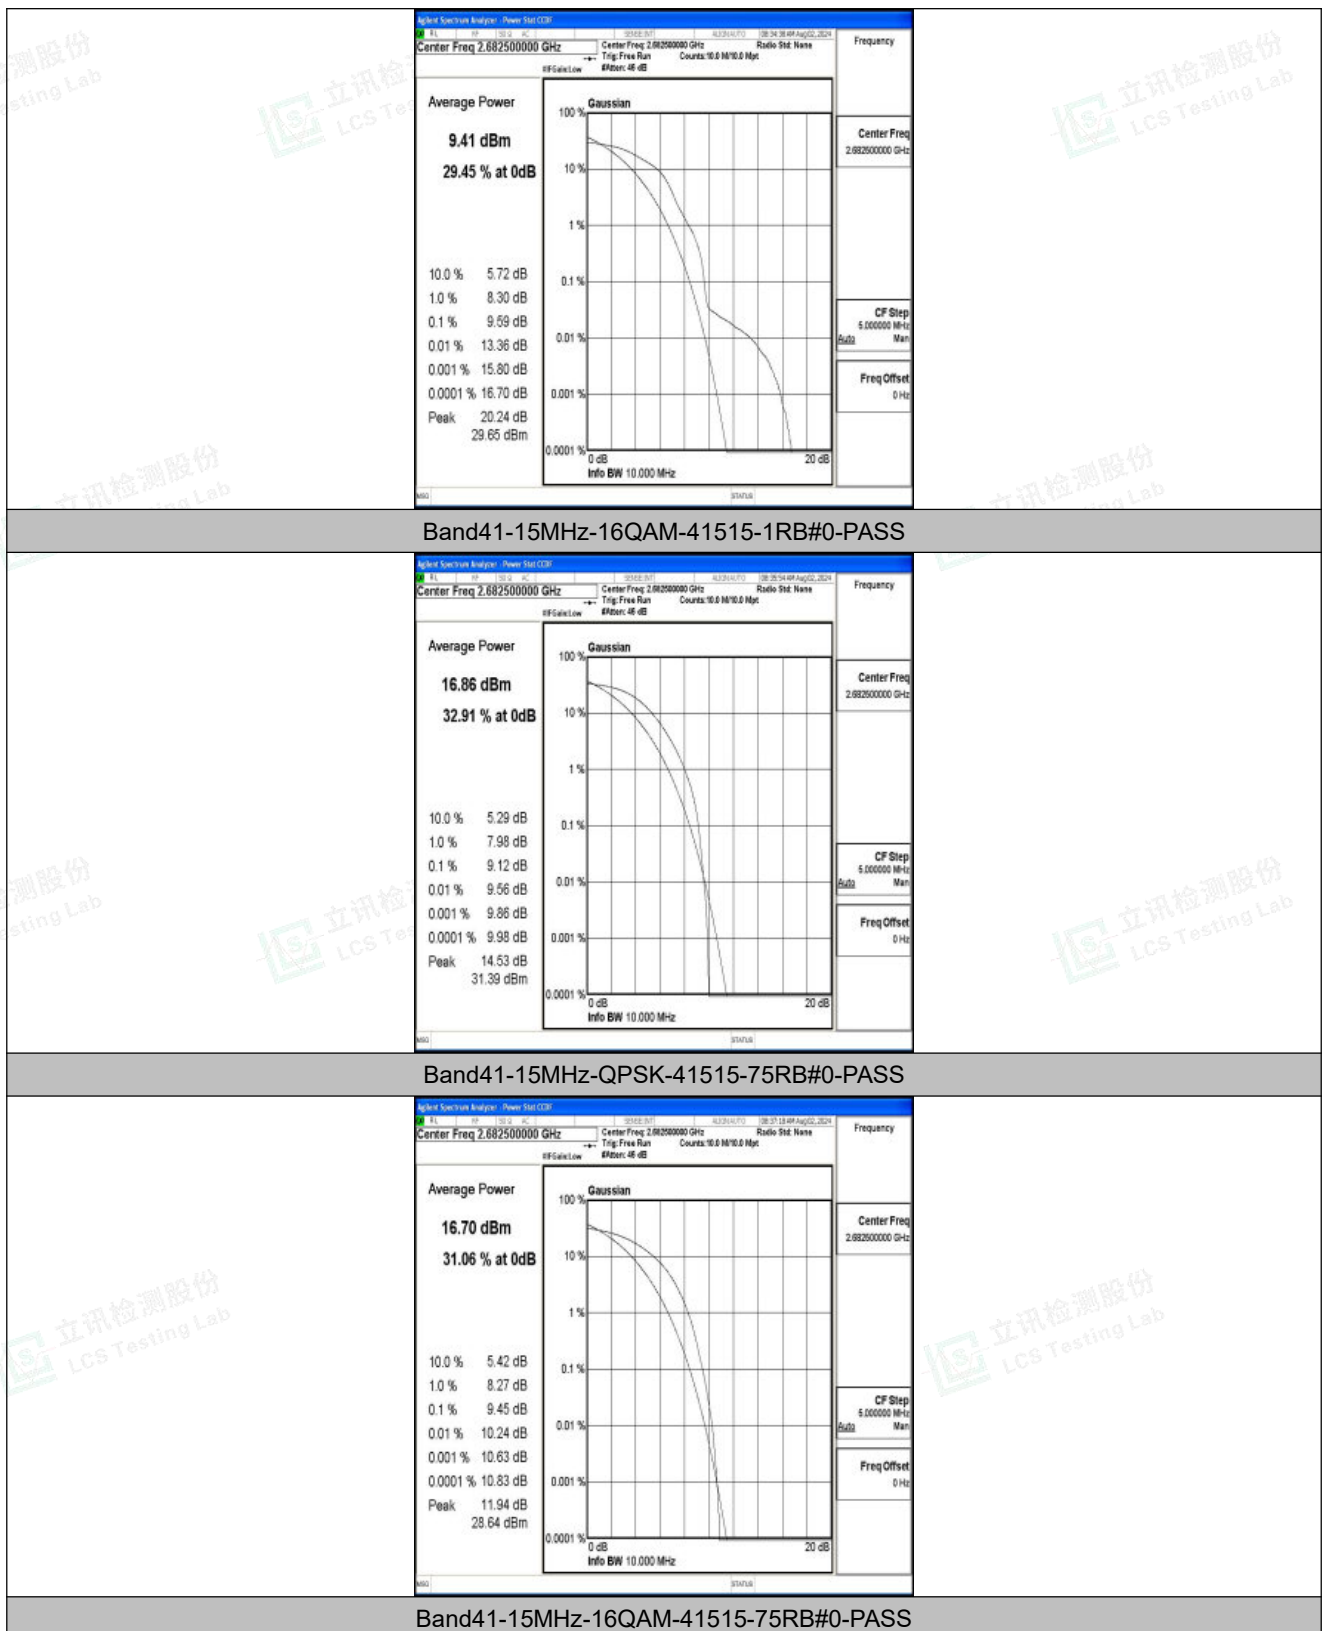

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



M.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5094	5.263	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5017	5.281	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5215	5.241	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5160	5.384	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4962	5.169	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5047	5.283	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9975	9.901	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9858	10.04	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0086	10.21	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9983	11.14	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9927	10.61	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9833	9.925	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.536	15.63	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.505	15.40	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.442	16.12	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.523	16.27	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.444	15.36	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.507	15.68	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.029	20.65	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.953	20.42	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.992	19.87	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.981	20.55	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.992	20.01	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.954	20.22	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

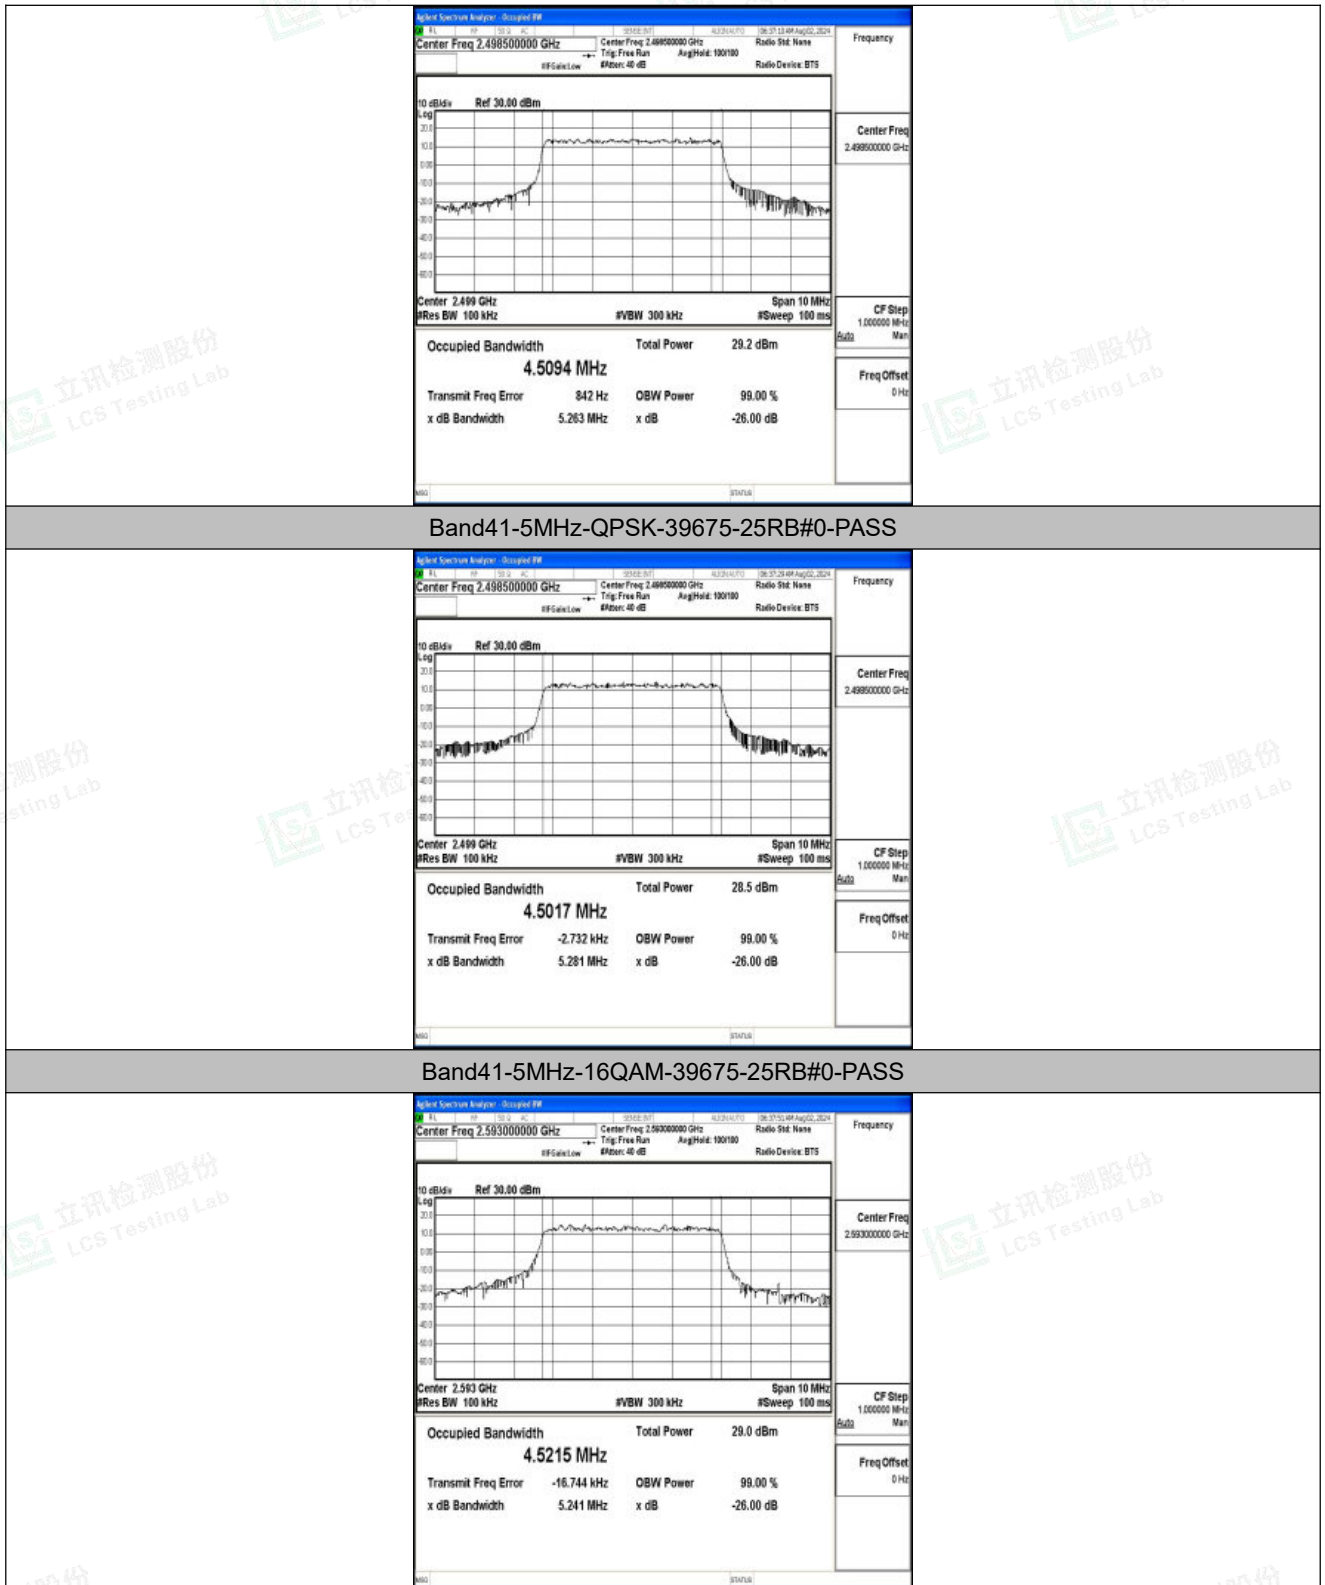


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Band41-5MHz-QPSK-40620-25RB#0-PASS

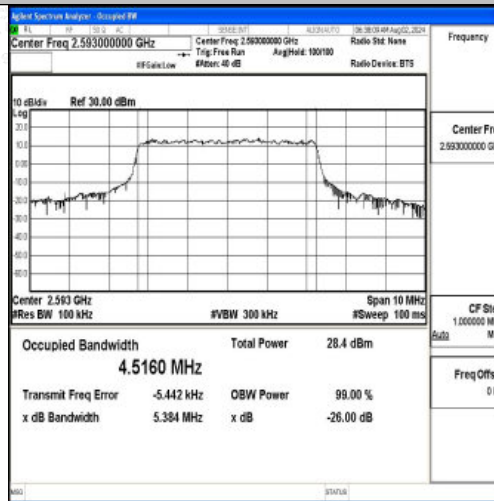

Band41-5MHz-16QAM-40620-25RB#0-PASS

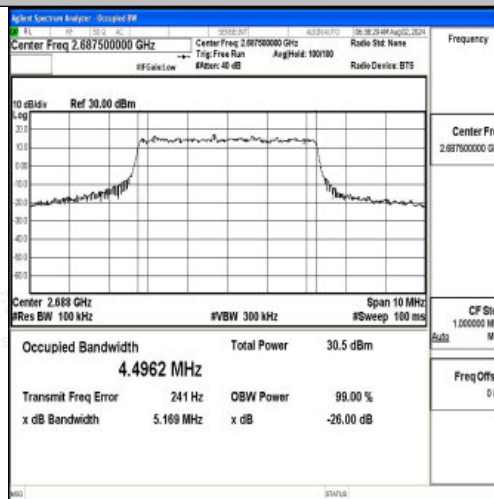

Band41-5MHz-QPSK-41565-25RB#0-PASS

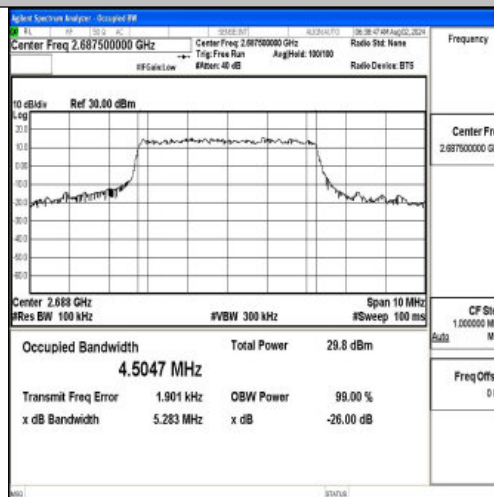

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

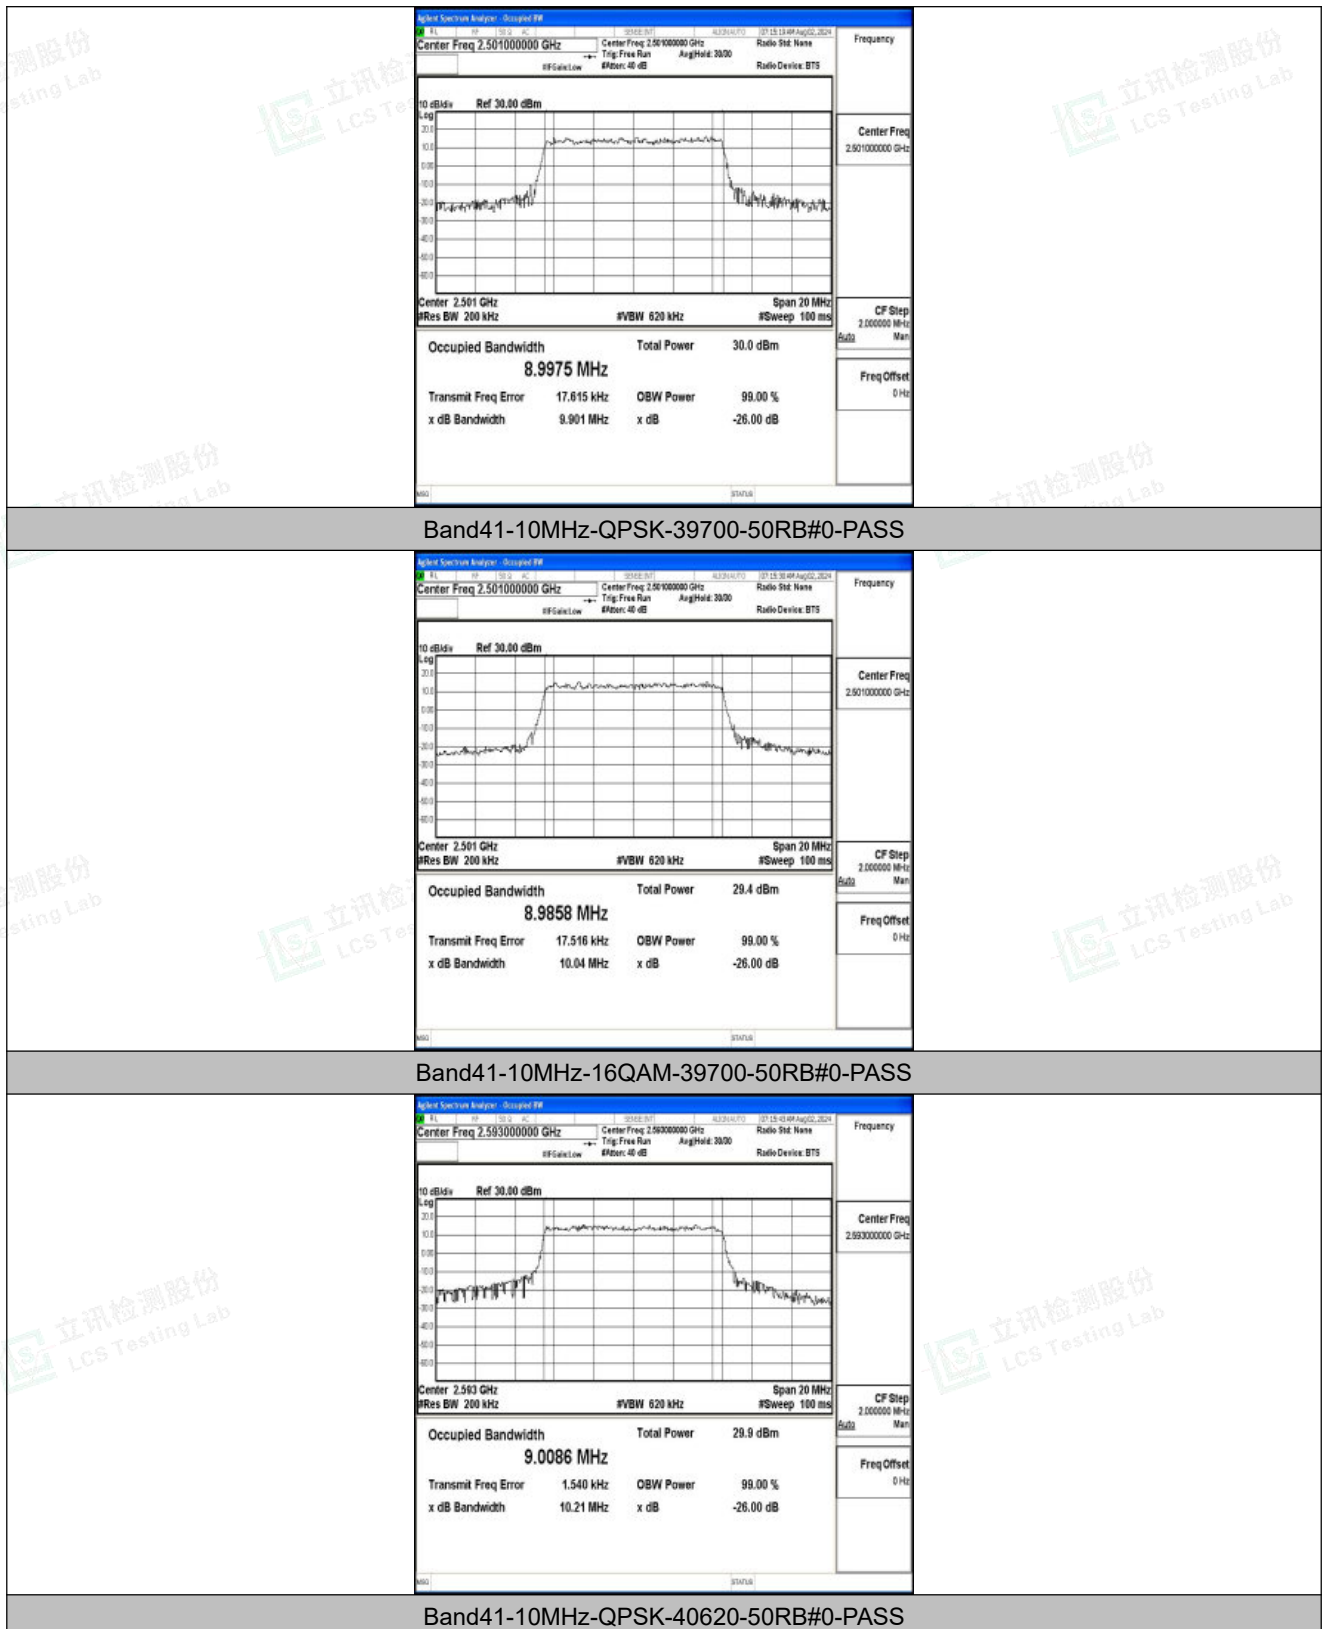

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

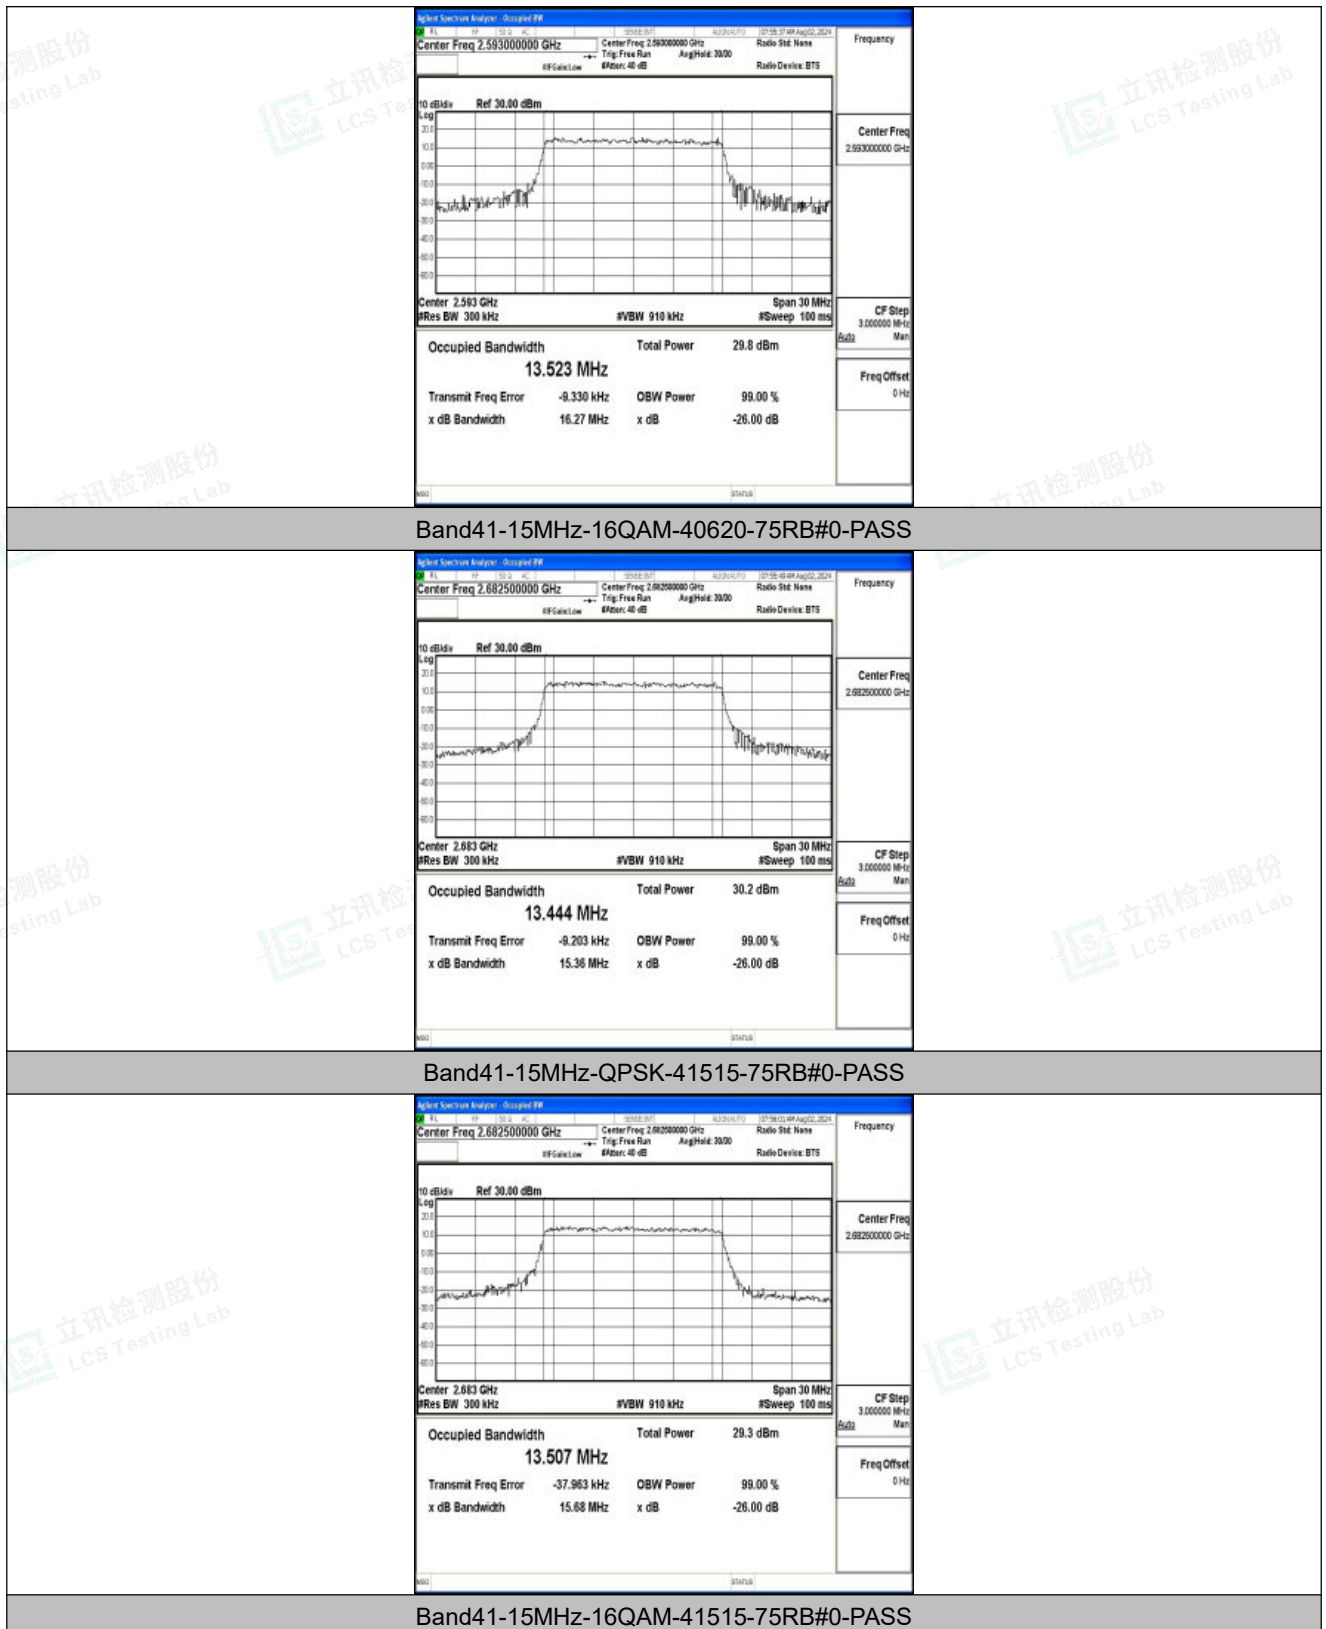

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



M.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.42	-43.84	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.41	-43.44	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.06	-40.62	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.10	-40.32	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-35.05	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.38	-35.50	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.13	-41.57	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.03	-42.97	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.43	-25.73	PASS_Final1
Band41	15MHz	QPSK	39725	75RB#0	2489.43	-35.50	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.43	-35.21	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.34	-36.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.40	-36.46	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.37	-43.66	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.28	-44.74	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.15	-43.42	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.08	-43.78	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-41565-25RB#0-PASS

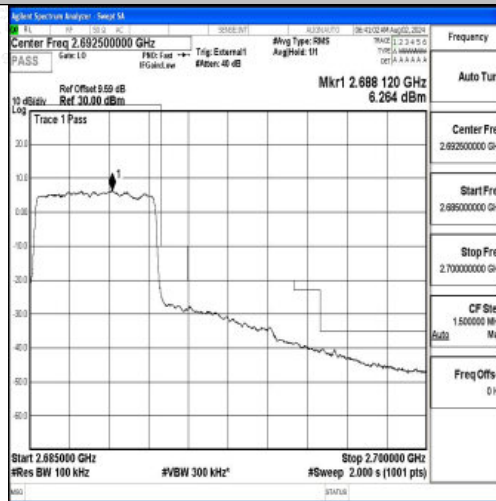

Band41-5MHz-16QAM-41565-25RB#0-PASS

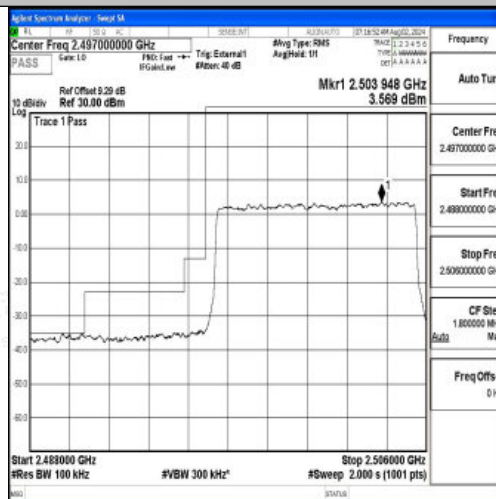

Band41-10MHz-QPSK-39700-50RB#0-PASS

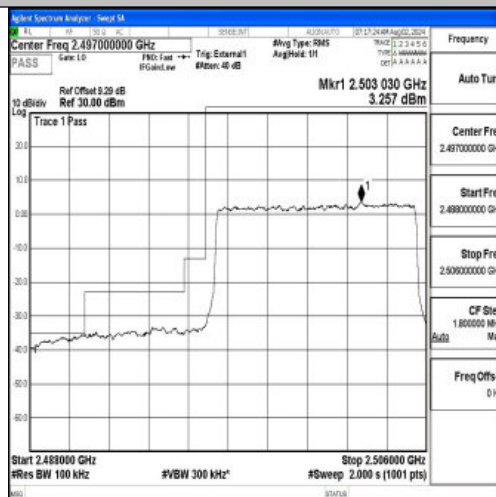

Band41-10MHz-16QAM-39700-50RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

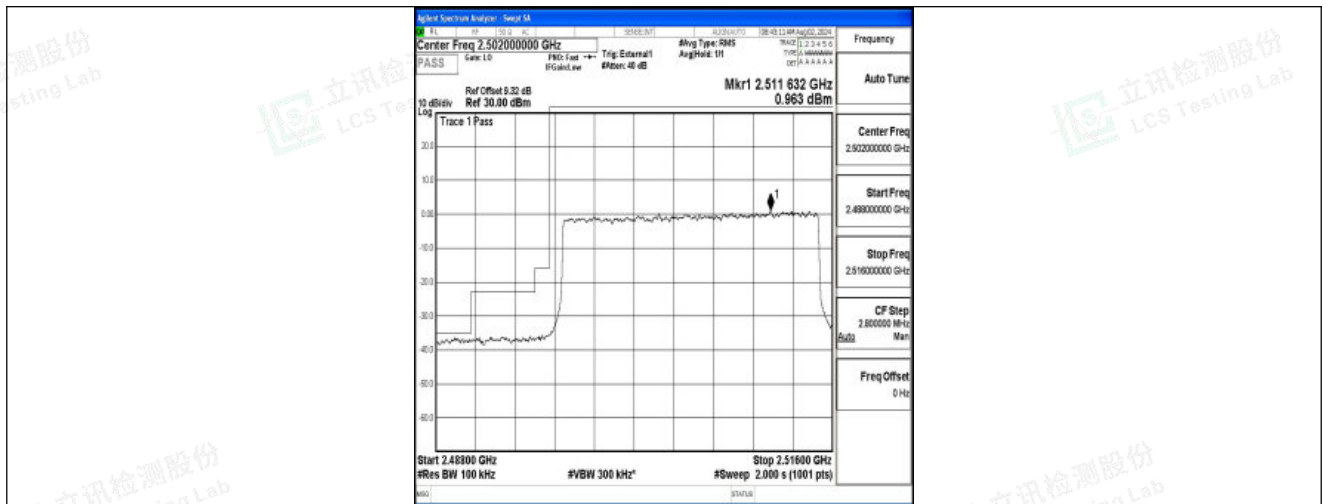

Band41-20MHz-16QAM-39750-100RB#0-PASS

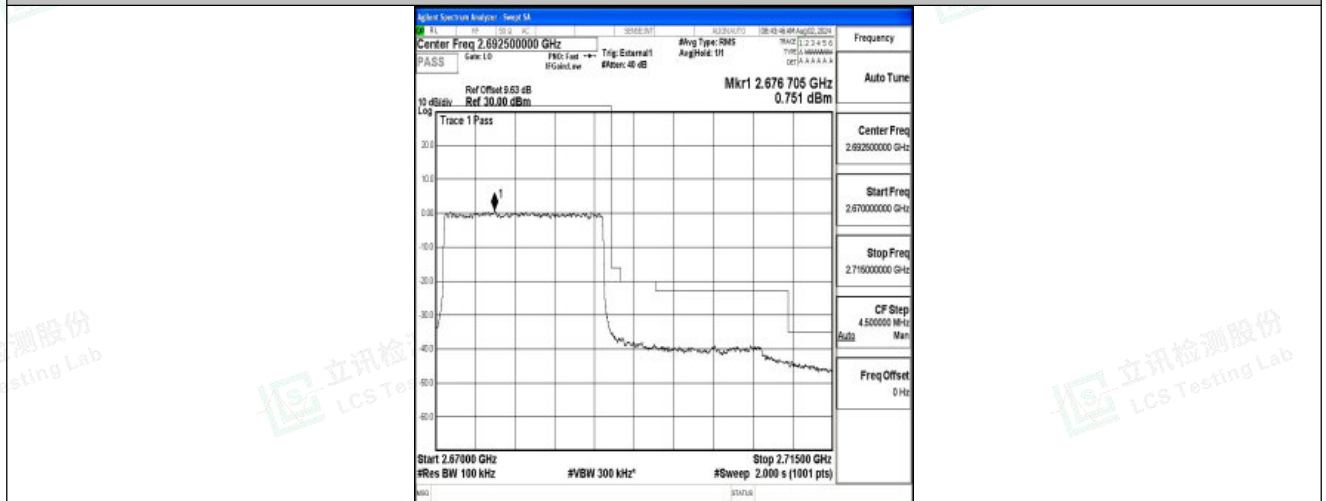

Band41-20MHz-QPSK-41490-100RB#0-PASS

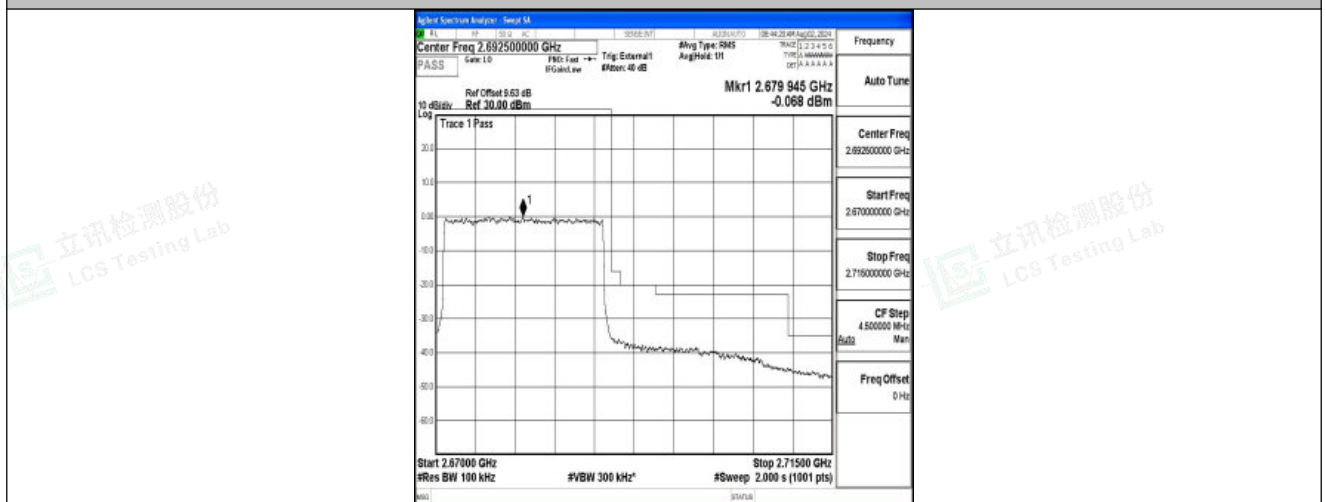

Band41-20MHz-16QAM-41490-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

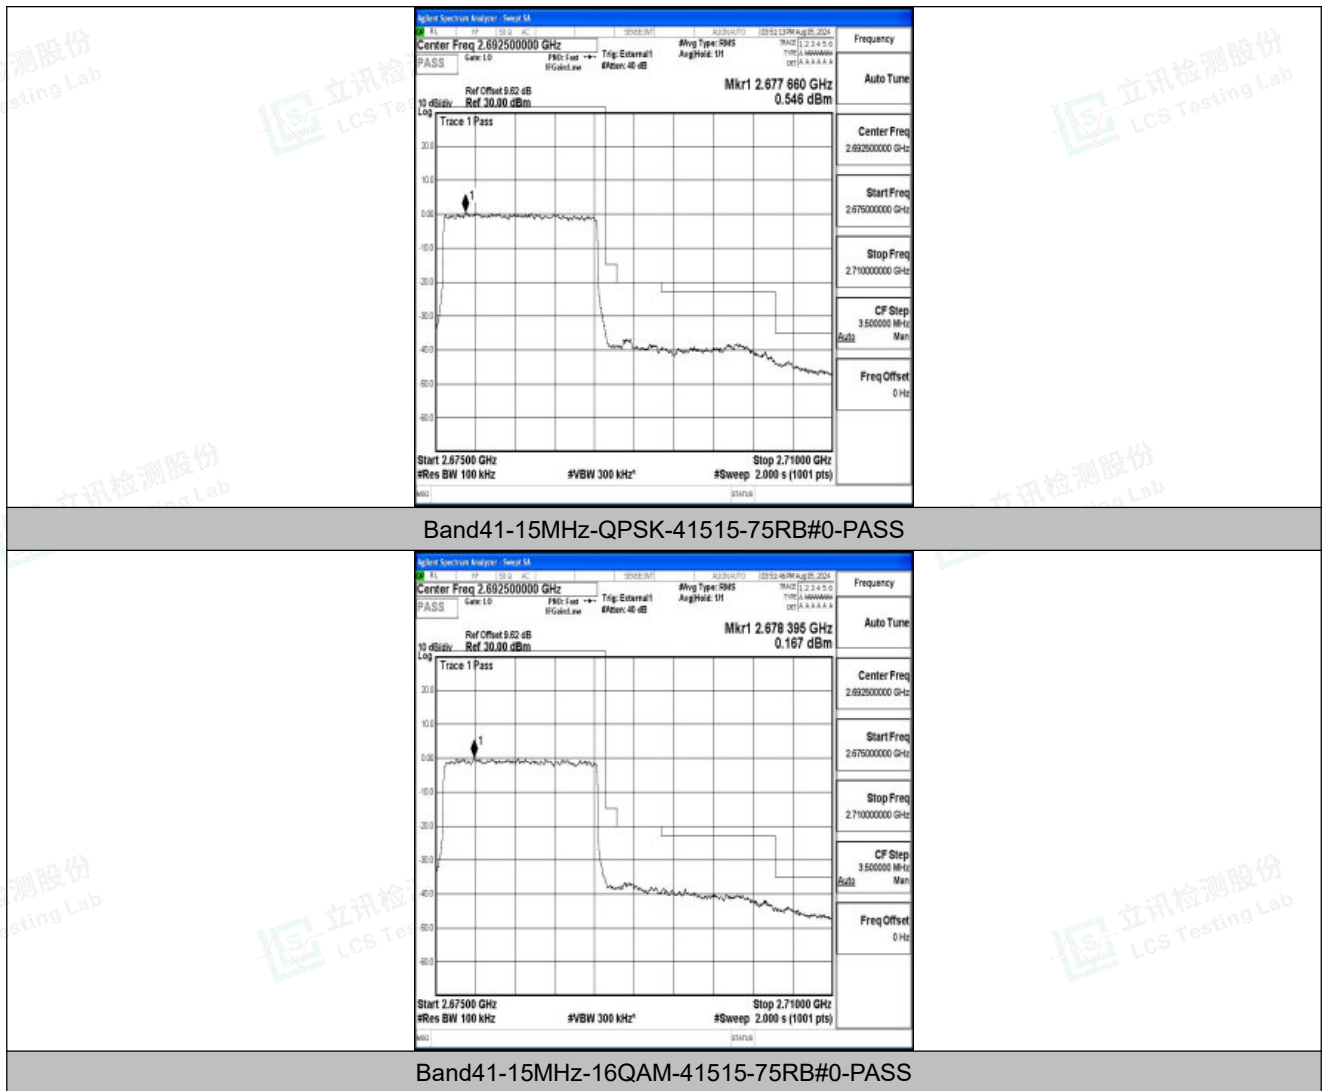

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



M.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-79.33	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-67.81	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-60.72	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~3000	-44.54	PASS
Band41	5MHz	QPSK	39675	1RB#0	3000~18000	-43.58	PASS
Band41	5MHz	QPSK	39675	1RB#0	18000~27000	-38.94	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-77.44	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-66.85	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-60.97	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~3000	-44.59	PASS
Band41	5MHz	16QAM	39675	1RB#0	3000~18000	-43.20	PASS
Band41	5MHz	16QAM	39675	1RB#0	18000~27000	-39.31	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-79.07	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-53.78	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-60.93	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~3000	-43.32	PASS
Band41	5MHz	QPSK	40620	1RB#0	3000~18000	-43.33	PASS
Band41	5MHz	QPSK	40620	1RB#0	18000~27000	-39.16	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-77.96	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-53.83	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-60.96	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~3000	-44.87	PASS
Band41	5MHz	16QAM	40620	1RB#0	3000~18000	-43.55	PASS
Band41	5MHz	16QAM	40620	1RB#0	18000~27000	-39.24	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-76.45	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-67.94	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-60.59	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~3000	-44.32	PASS
Band41	5MHz	QPSK	41565	1RB#0	3000~18000	-43.32	PASS
Band41	5MHz	QPSK	41565	1RB#0	18000~27000	-39.02	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-77.85	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-67.82	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-60.74	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	1000~3000	-42.46	PASS
Band41	5MHz	16QAM	41565	1RB#0	3000~18000	-43.55	PASS
Band41	5MHz	16QAM	41565	1RB#0	18000~27000	-39.15	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-78.65	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-67.89	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-60.92	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~3000	-44.81	PASS
Band41	10MHz	QPSK	39700	1RB#0	3000~18000	-43.63	PASS
Band41	10MHz	QPSK	39700	1RB#0	18000~27000	-39.27	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-75.96	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-67.95	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-60.83	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~3000	-44.47	PASS
Band41	10MHz	16QAM	39700	1RB#0	3000~18000	-43.55	PASS
Band41	10MHz	16QAM	39700	1RB#0	18000~27000	-38.85	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-78.54	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-51.60	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-60.31	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~3000	-42.49	PASS
Band41	10MHz	QPSK	40620	1RB#0	3000~18000	-43.59	PASS
Band41	10MHz	QPSK	40620	1RB#0	18000~27000	-39.19	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-77.60	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-53.54	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-60.68	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~3000	-44.59	PASS
Band41	10MHz	16QAM	40620	1RB#0	3000~18000	-43.60	PASS
Band41	10MHz	16QAM	40620	1RB#0	18000~27000	-39.03	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-77.25	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-66.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-59.26	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~3000	-44.58	PASS
Band41	10MHz	QPSK	41540	1RB#0	3000~18000	-43.78	PASS
Band41	10MHz	QPSK	41540	1RB#0	18000~27000	-39.16	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-74.90	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-67.79	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-60.50	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~3000	-44.56	PASS
Band41	10MHz	16QAM	41540	1RB#0	3000~18000	-43.66	PASS
Band41	10MHz	16QAM	41540	1RB#0	18000~27000	-39.06	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-78.35	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-69.08	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-60.68	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~3000	-42.17	PASS
Band41	15MHz	QPSK	39725	1RB#0	3000~18000	-43.17	PASS
Band41	15MHz	QPSK	39725	1RB#0	18000~27000	-39.11	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-76.00	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-68.70	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-60.85	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~3000	-42.66	PASS
Band41	15MHz	16QAM	39725	1RB#0	3000~18000	-43.50	PASS
Band41	15MHz	16QAM	39725	1RB#0	18000~27000	-39.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-77.29	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-52.85	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-61.05	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~3000	-42.22	PASS
Band41	15MHz	QPSK	40620	1RB#0	3000~18000	-43.66	PASS
Band41	15MHz	QPSK	40620	1RB#0	18000~27000	-39.19	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-76.23	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-52.21	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-60.84	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~3000	-43.29	PASS
Band41	15MHz	16QAM	40620	1RB#0	3000~18000	-43.79	PASS
Band41	15MHz	16QAM	40620	1RB#0	18000~27000	-39.08	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-76.93	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-65.90	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-60.43	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~3000	-42.18	PASS
Band41	15MHz	QPSK	41515	1RB#0	3000~18000	-43.66	PASS
Band41	15MHz	QPSK	41515	1RB#0	18000~27000	-38.83	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-76.42	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-68.83	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-60.97	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~3000	-43.10	PASS
Band41	15MHz	16QAM	41515	1RB#0	3000~18000	-43.60	PASS
Band41	15MHz	16QAM	41515	1RB#0	18000~27000	-39.06	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-78.55	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-67.62	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-60.61	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	1RB#0	1000~3000	-44.34	PASS
Band41	20MHz	QPSK	39750	1RB#0	3000~18000	-43.64	PASS
Band41	20MHz	QPSK	39750	1RB#0	18000~27000	-39.26	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-78.29	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-69.12	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-60.83	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~3000	-43.90	PASS
Band41	20MHz	16QAM	39750	1RB#0	3000~18000	-43.78	PASS
Band41	20MHz	16QAM	39750	1RB#0	18000~27000	-39.06	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-77.10	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-52.67	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-60.19	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~3000	-43.01	PASS
Band41	20MHz	QPSK	40620	1RB#0	3000~18000	-43.57	PASS
Band41	20MHz	QPSK	40620	1RB#0	18000~27000	-39.25	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-76.49	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-53.47	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-61.09	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~3000	-43.18	PASS
Band41	20MHz	16QAM	40620	1RB#0	3000~18000	-43.75	PASS
Band41	20MHz	16QAM	40620	1RB#0	18000~27000	-39.17	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-76.40	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-68.87	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-60.89	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~3000	-40.85	PASS
Band41	20MHz	QPSK	41490	1RB#0	3000~18000	-43.72	PASS
Band41	20MHz	QPSK	41490	1RB#0	18000~27000	-39.37	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-75.60	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-68.29	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-59.92	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~3000	-40.69	PASS
Band41	20MHz	16QAM	41490	1RB#0	3000~18000	-43.64	PASS
Band41	20MHz	16QAM	41490	1RB#0	18000~27000	-39.32	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

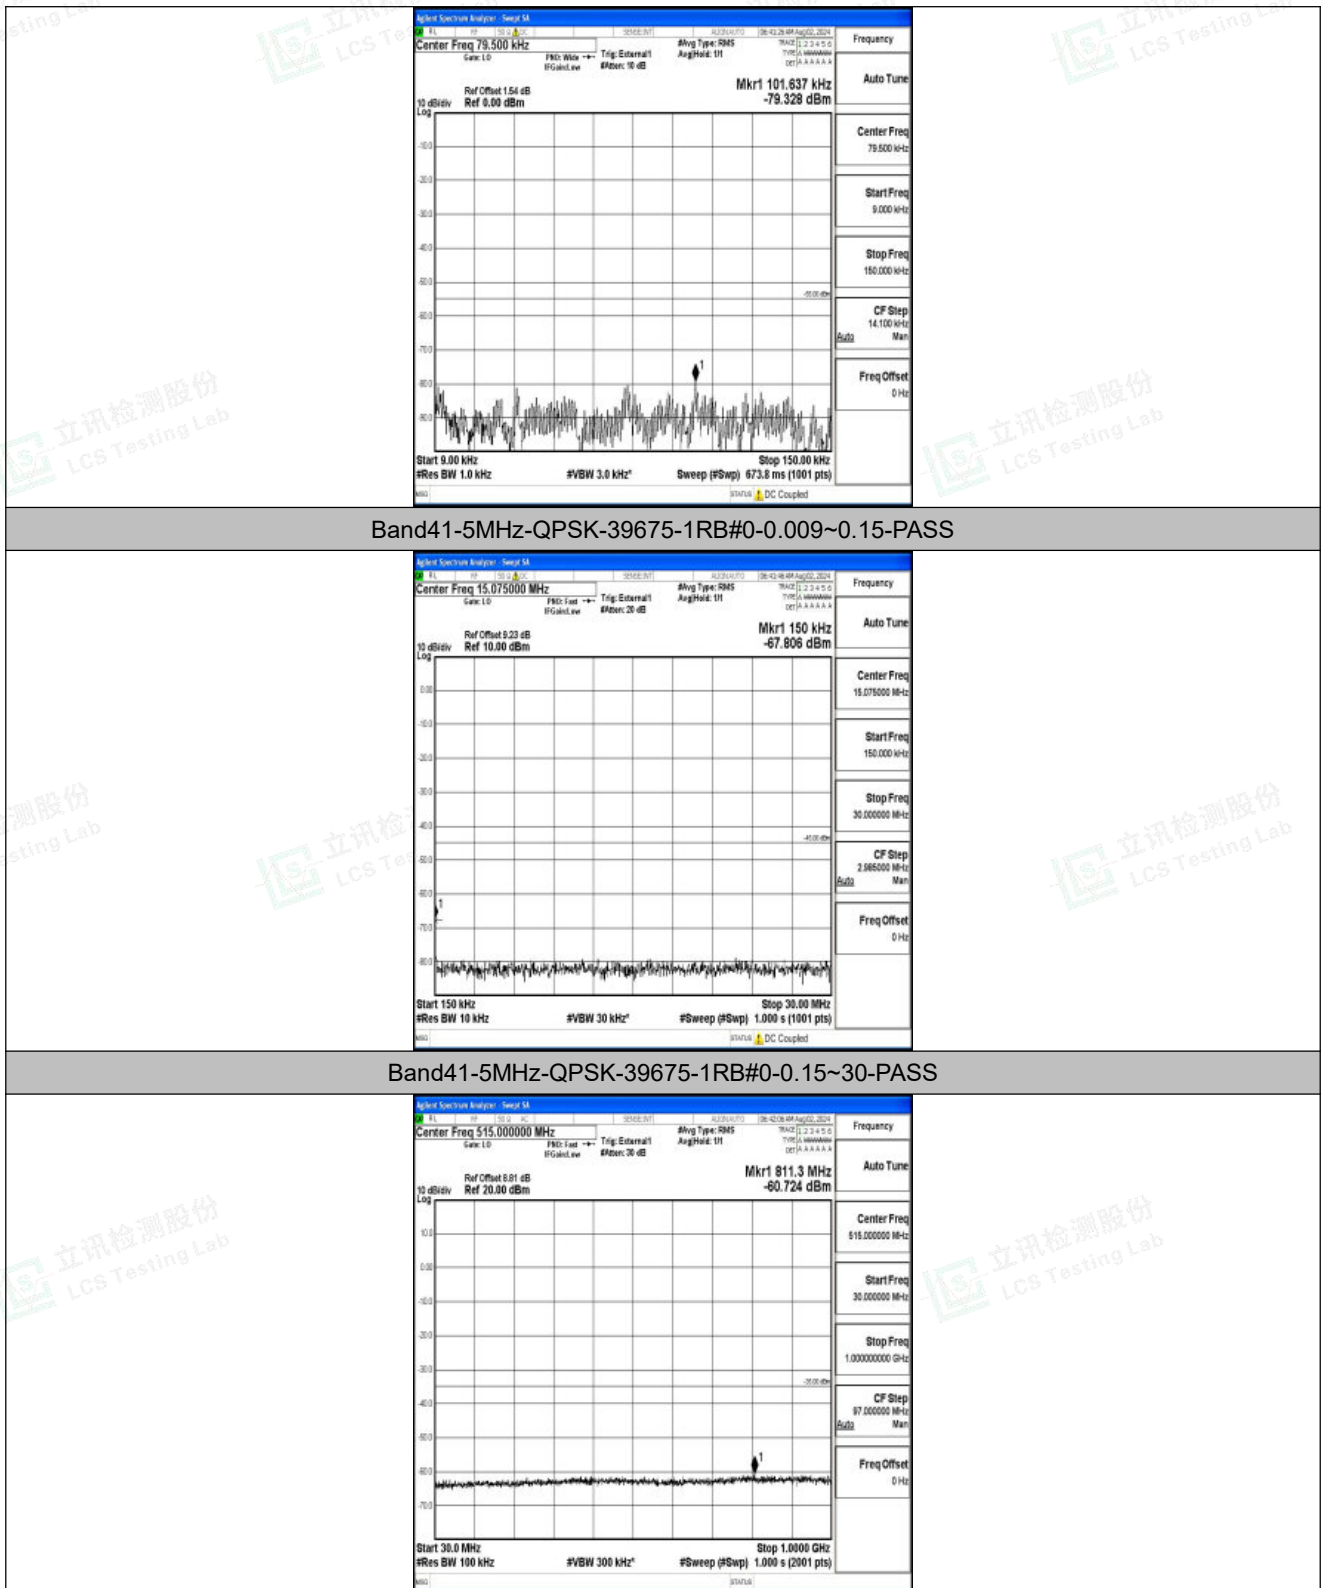

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-39675-1RB#0-30~1000-PASS

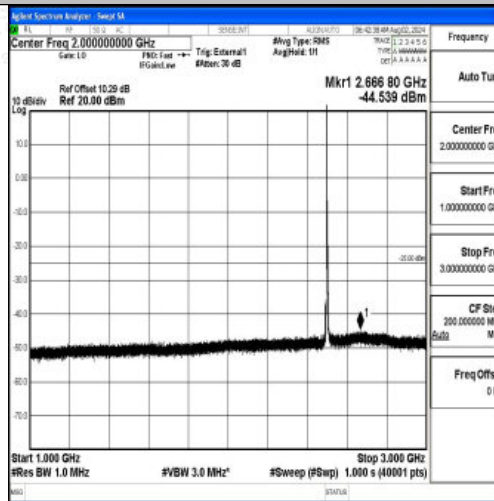

Band41-5MHz-QPSK-39675-1RB#0-1000~3000-PASS

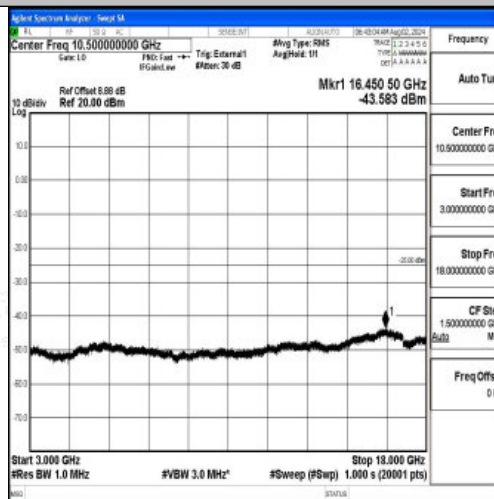

Band41-5MHz-QPSK-39675-1RB#0-3000~18000-PASS

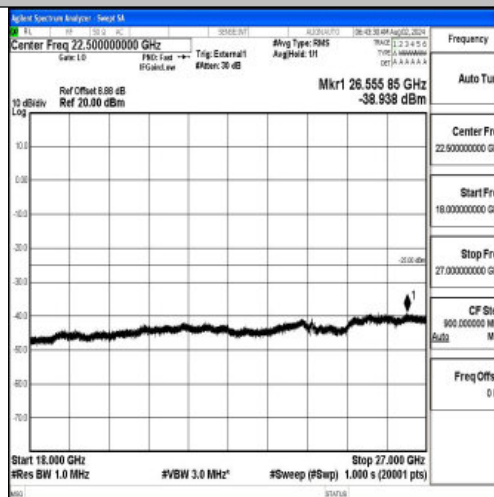

Band41-5MHz-QPSK-39675-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

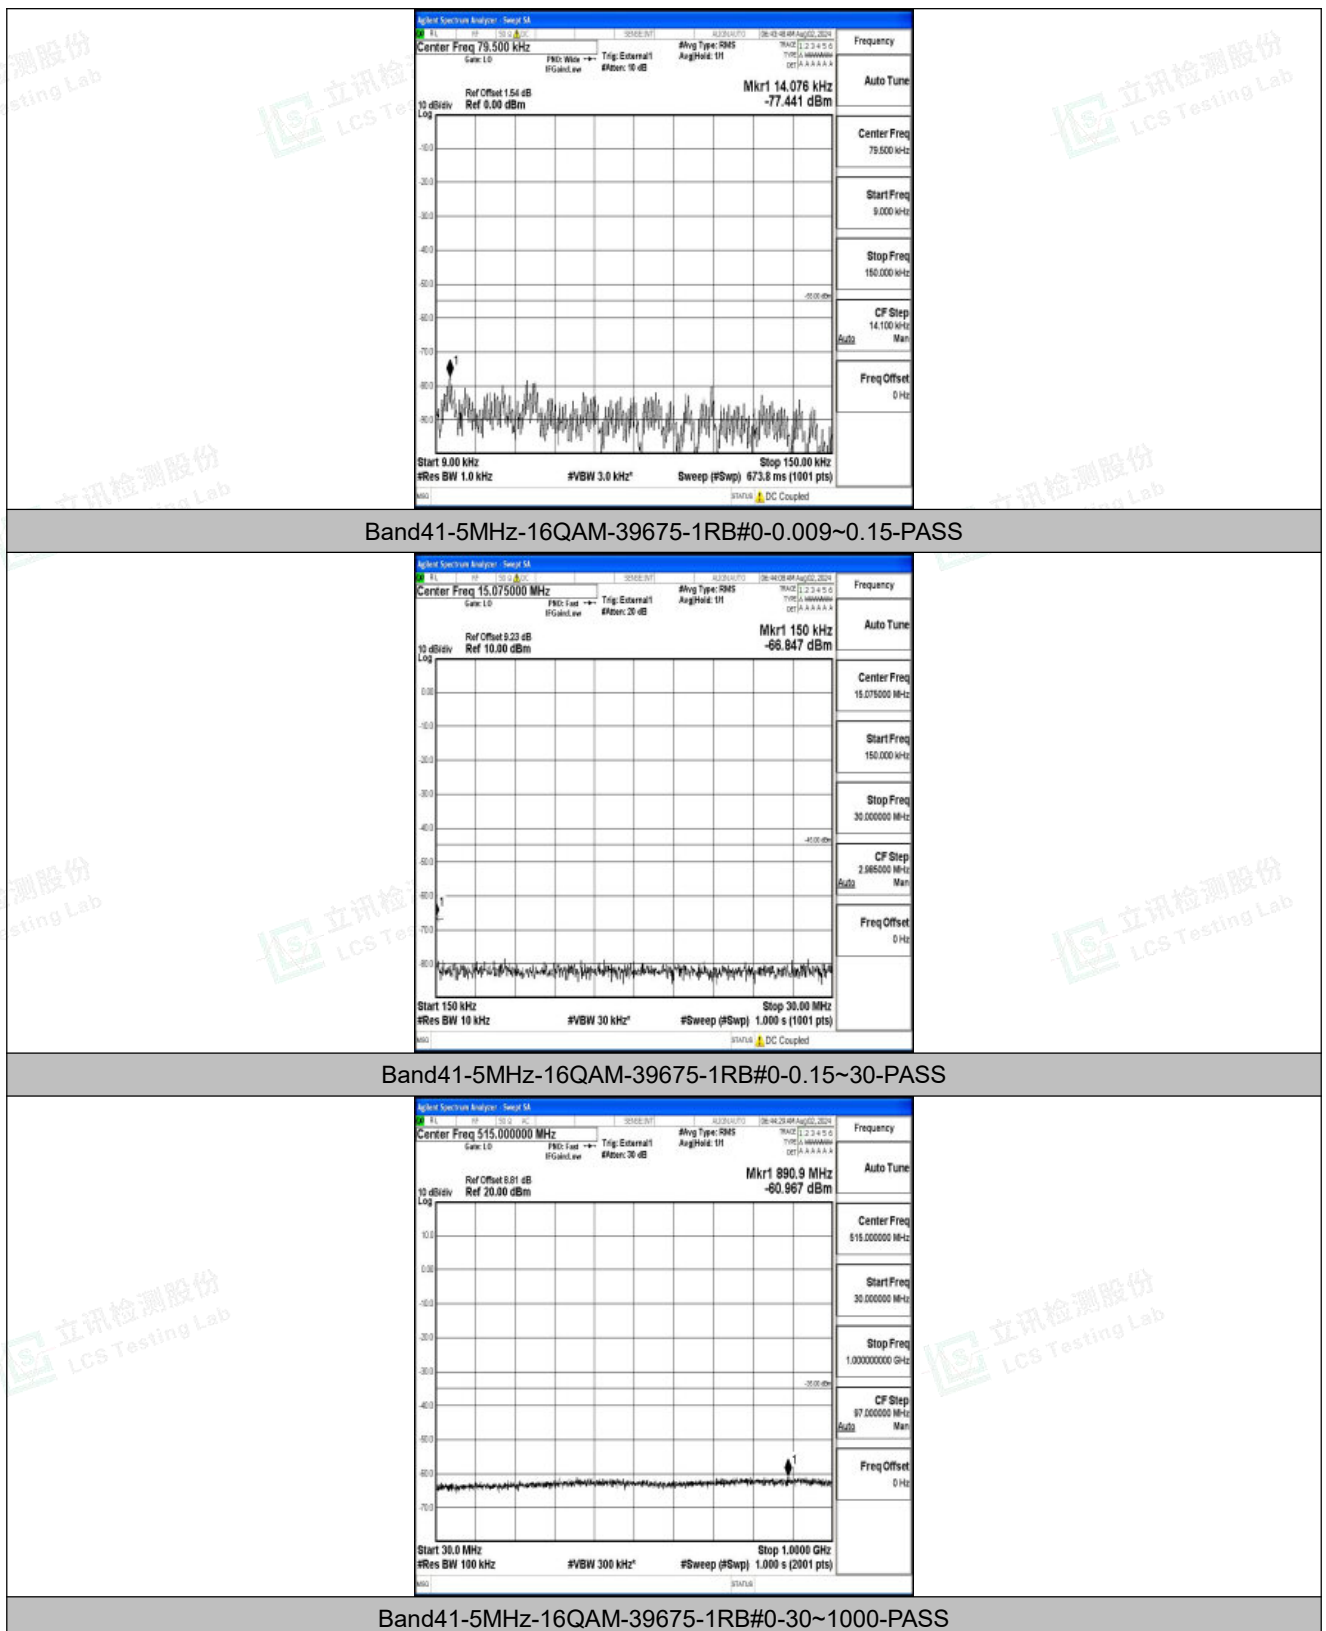


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

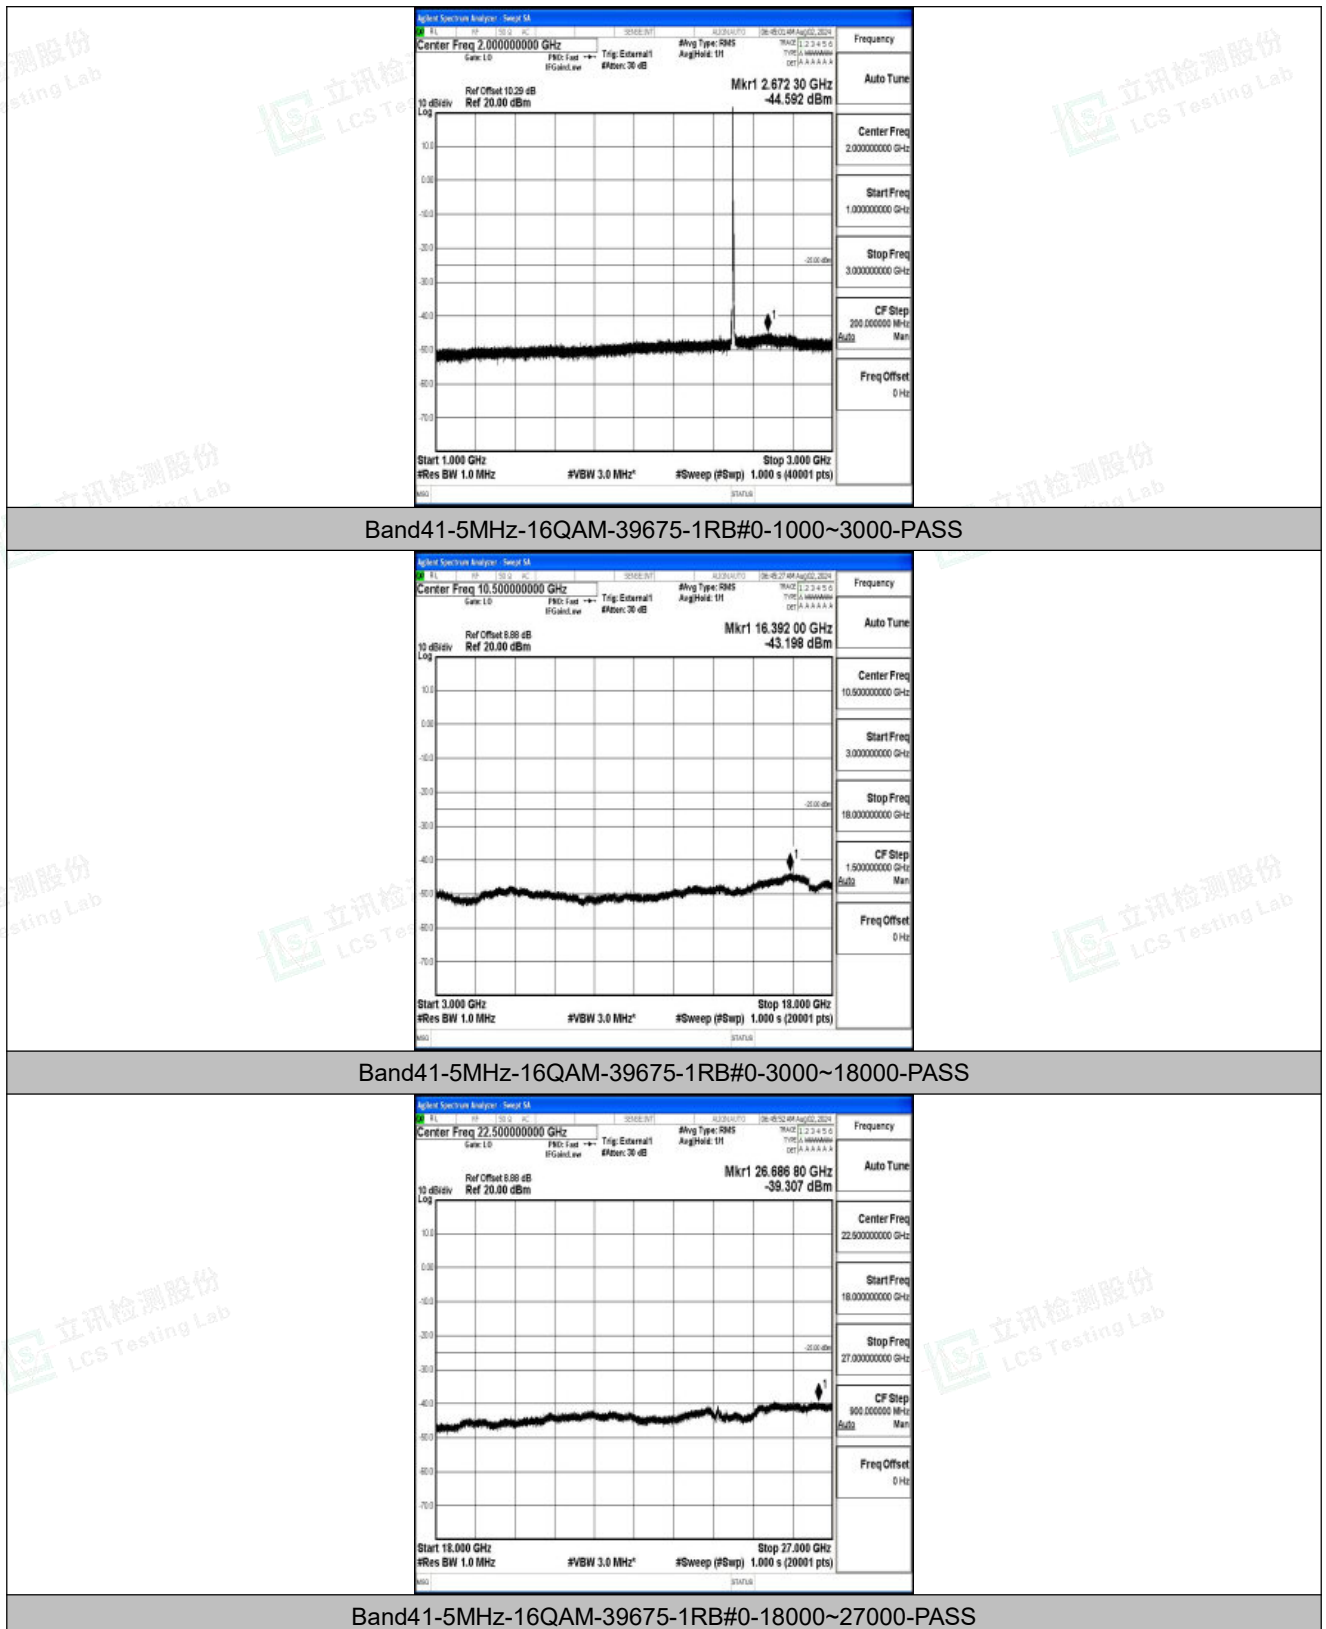


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

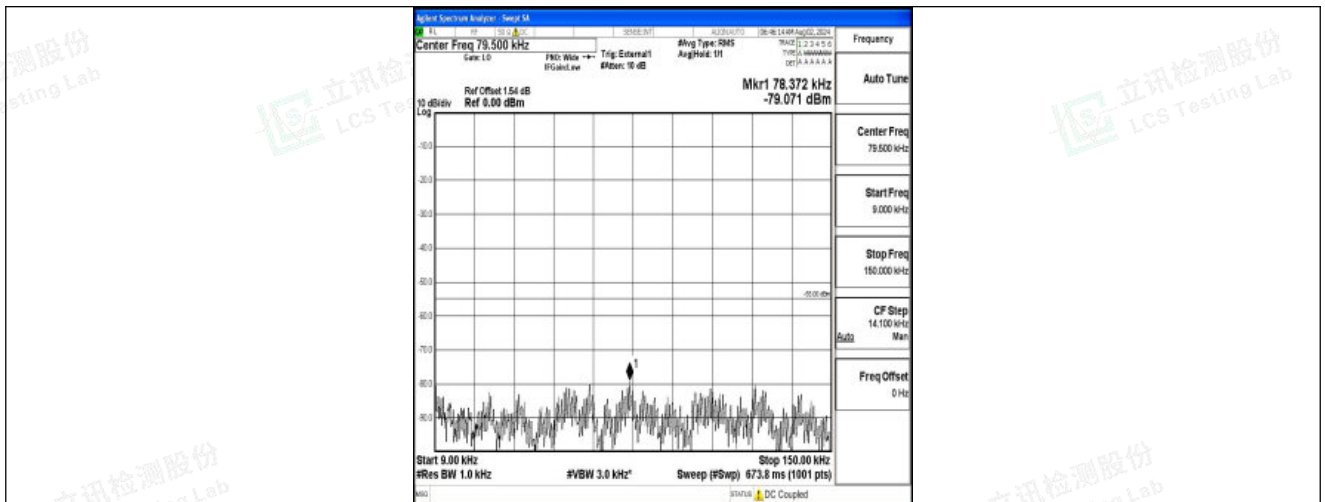

Band41-5MHz-QPSK-40620-1RB#0-0.009~0.15-PASS

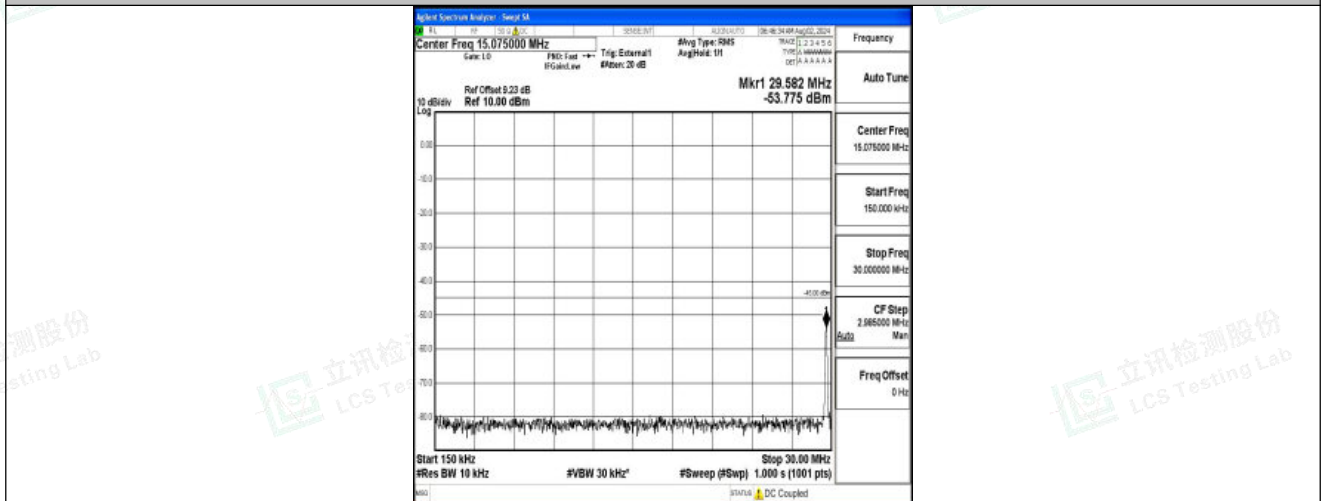

Band41-5MHz-QPSK-40620-1RB#0-0.15~30-PASS

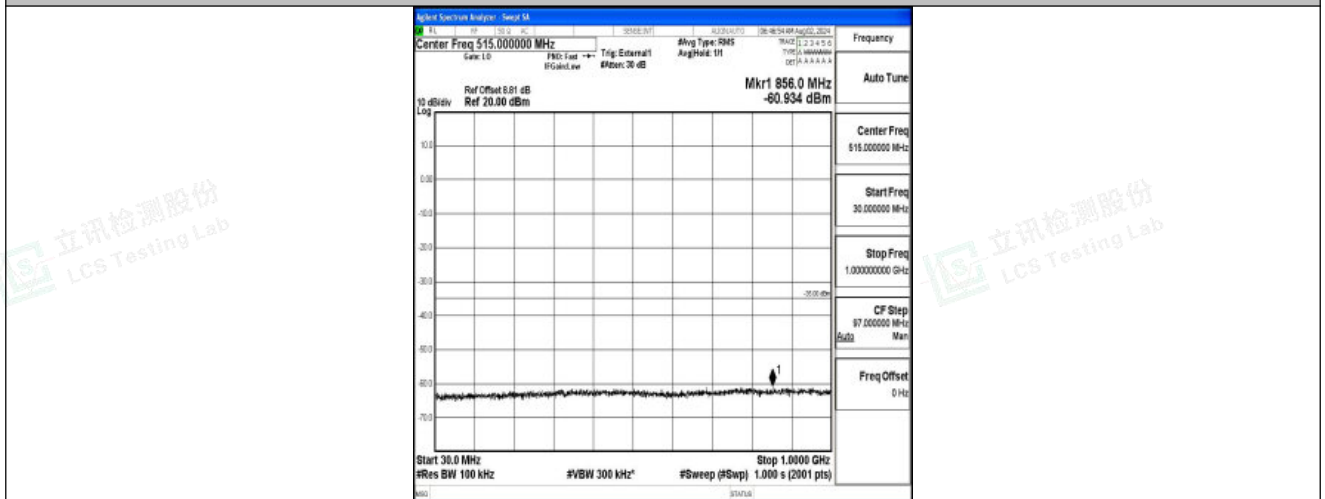

Band41-5MHz-QPSK-40620-1RB#0-30~1000-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity