





Restrict Band NVNT ac20 5180MHz Ant0 Peak

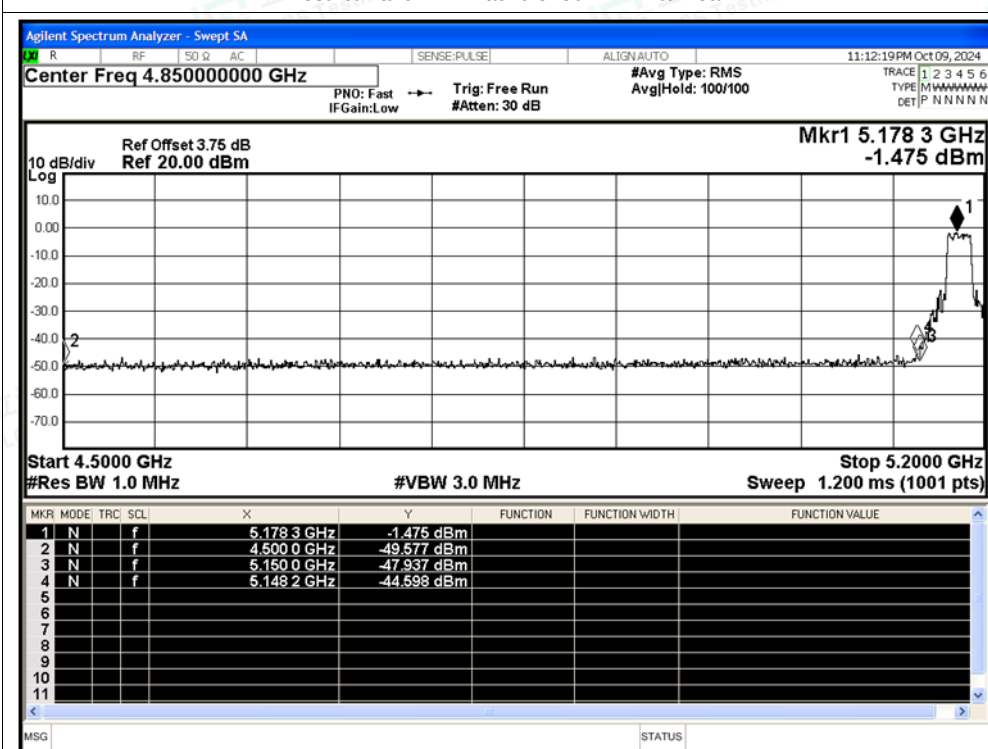


Restrict Band NVNT ac20 5180MHz Ant0 Average

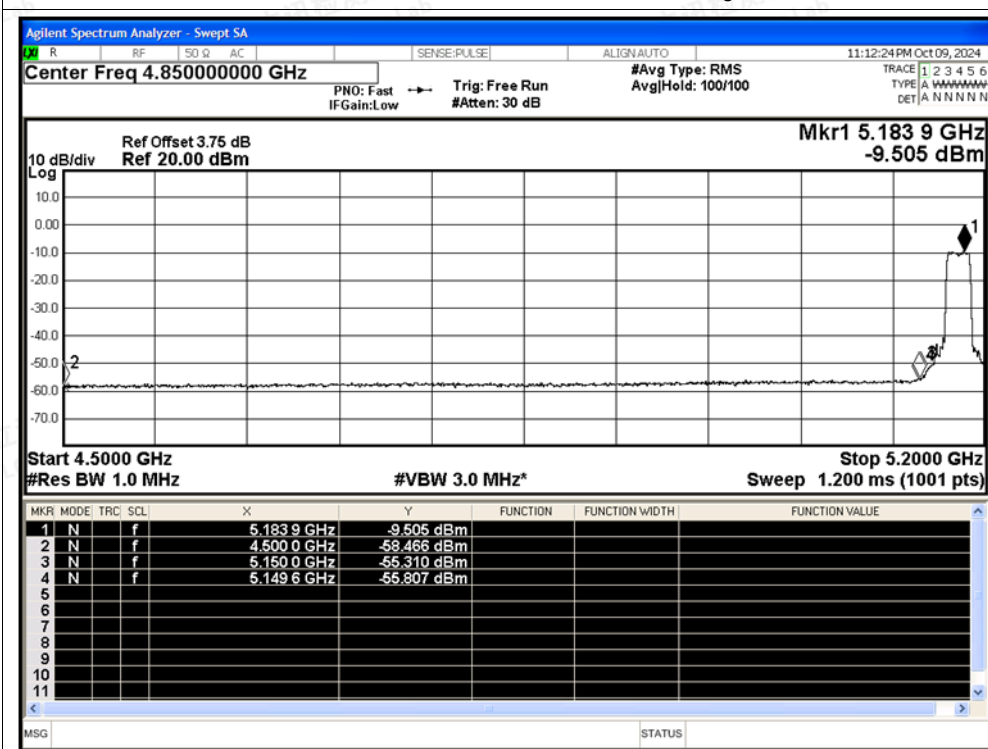


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant0 Peak

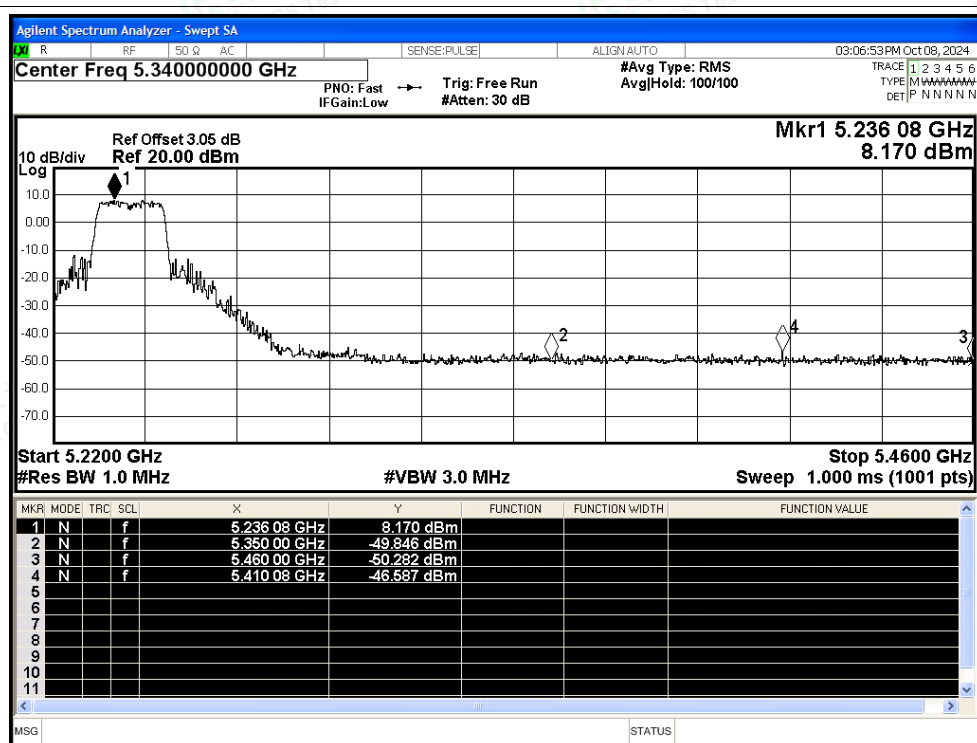


Restrict Band NVNT ac20 5240MHz Ant0 Average

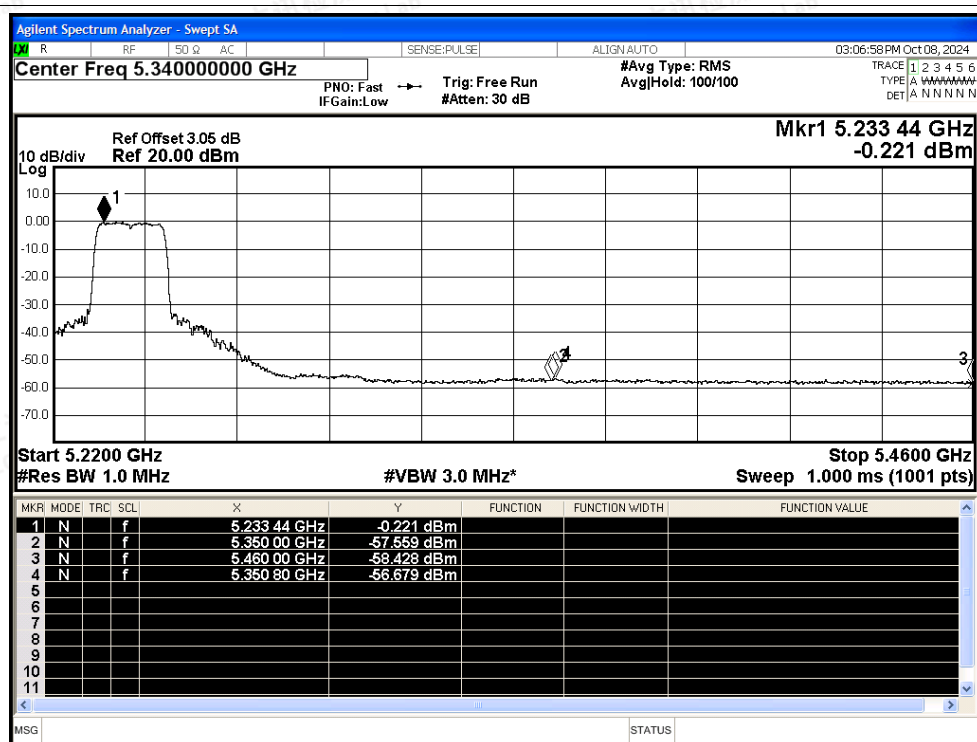




Restrict Band NVNT ac40 5190MHz Ant0 Peak

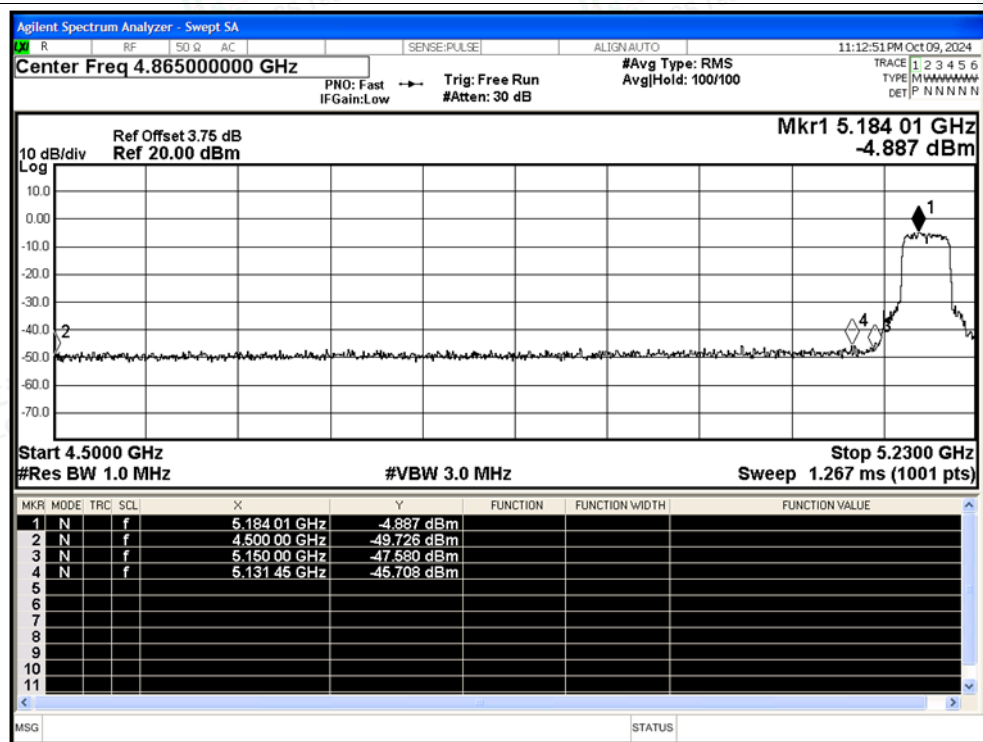


Restrict Band NVNT ac40 5190MHz Ant0 Average

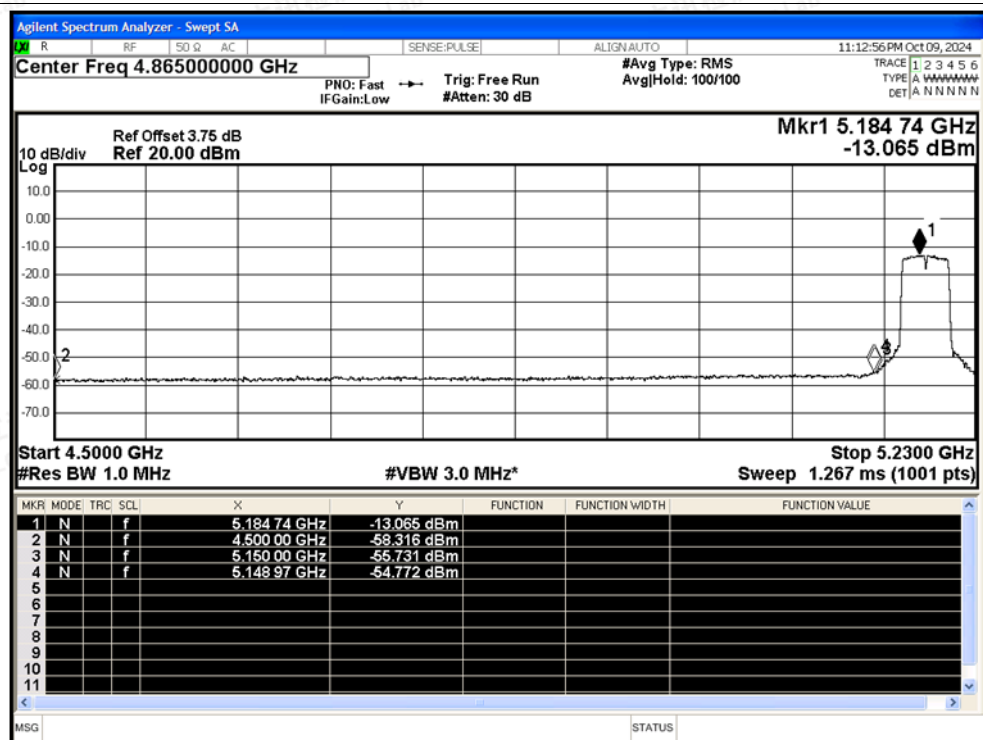




Restrict Band NVNT ac40 5230MHz Ant0 Peak

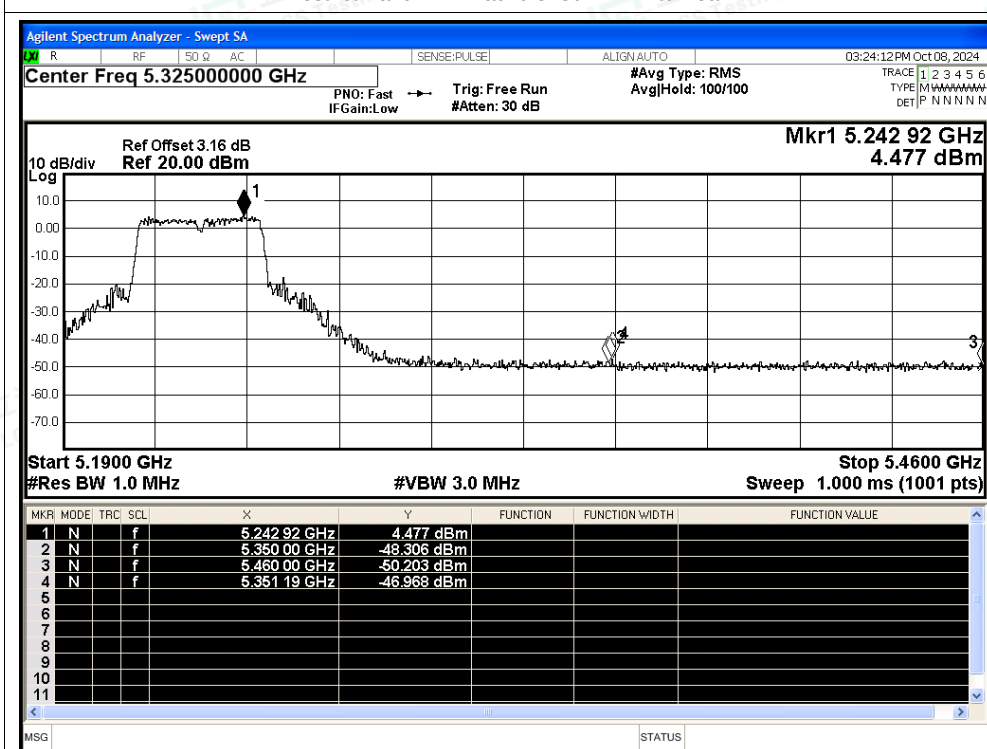


Restrict Band NVNT ac40 5230MHz Ant0 Average

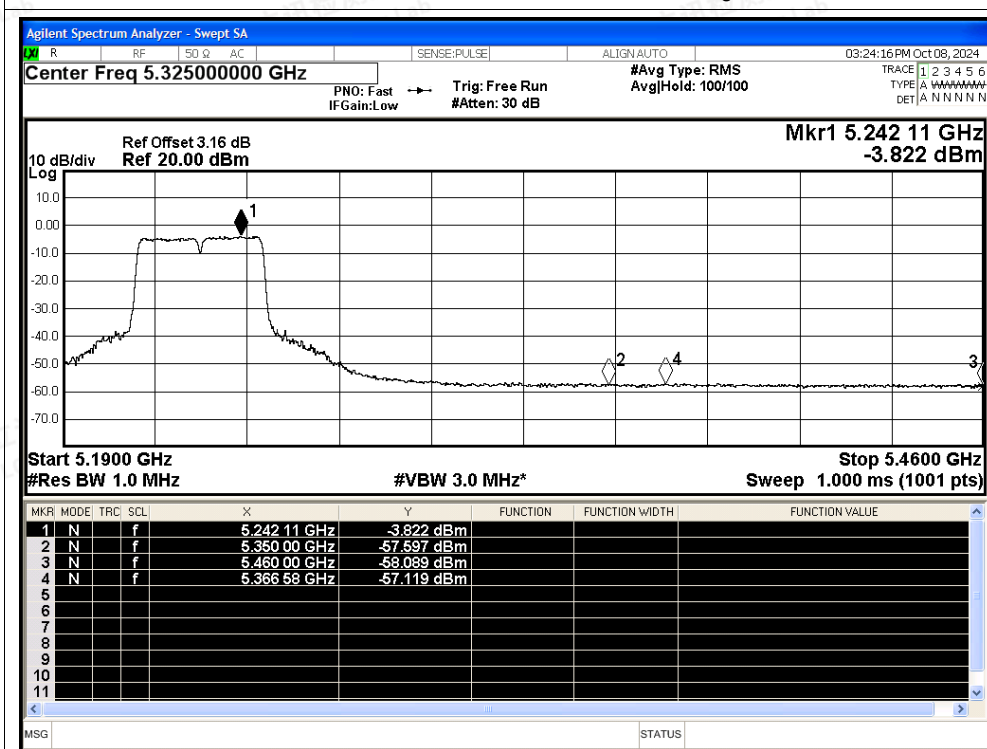


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant0 Peak

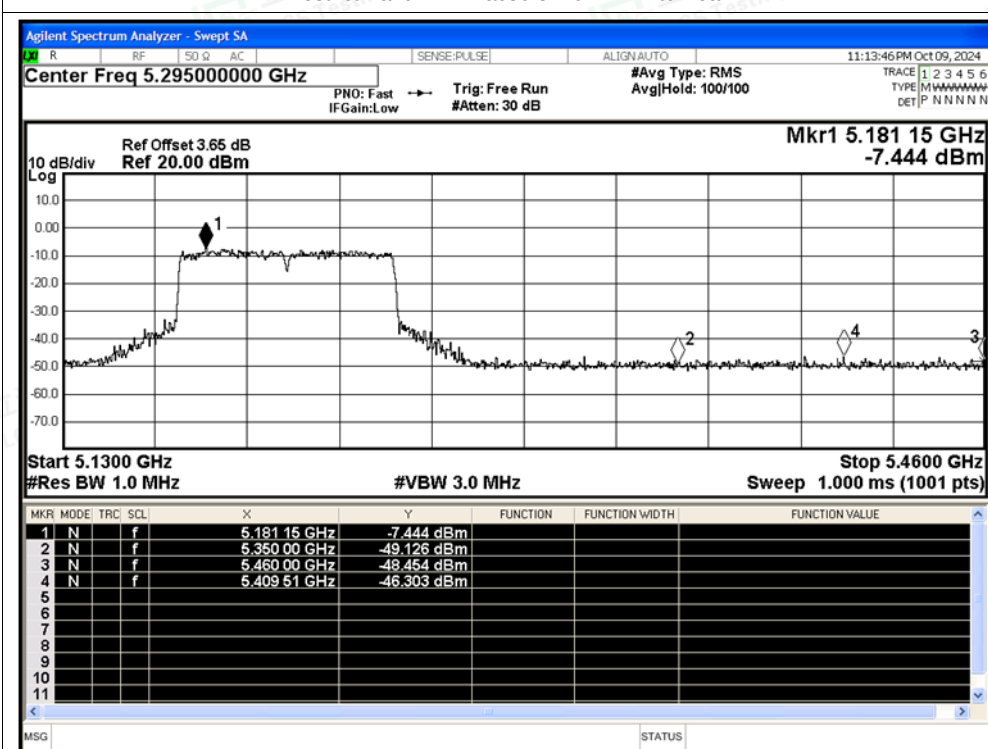


Restrict Band NVNT ac80 5210MHz Ant0 Average

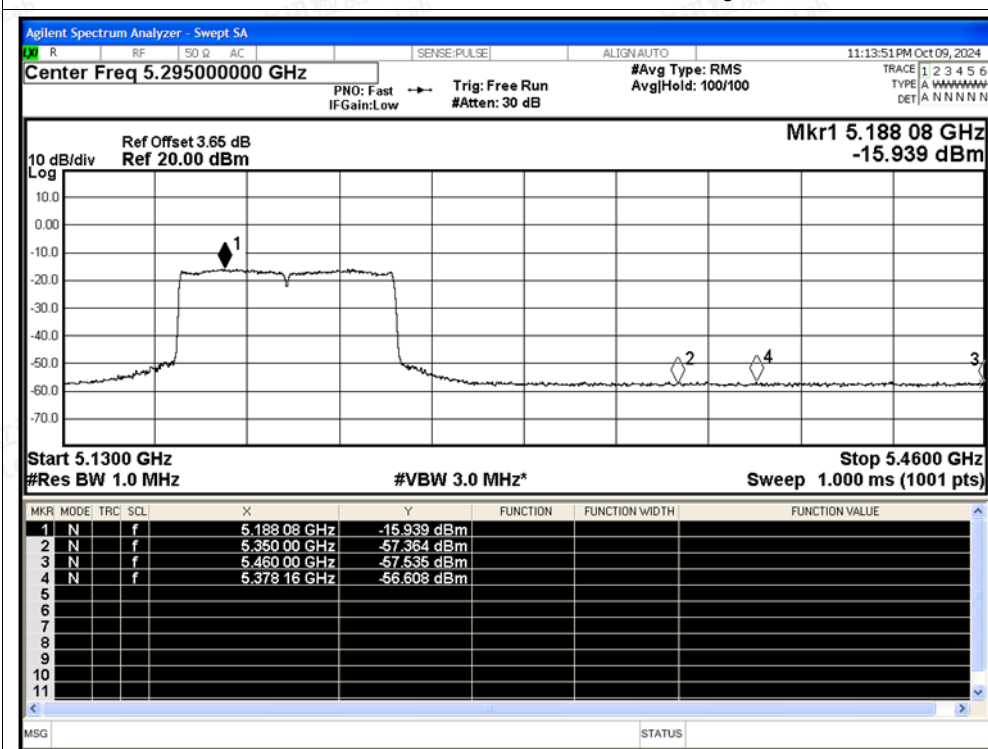


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant0 Peak

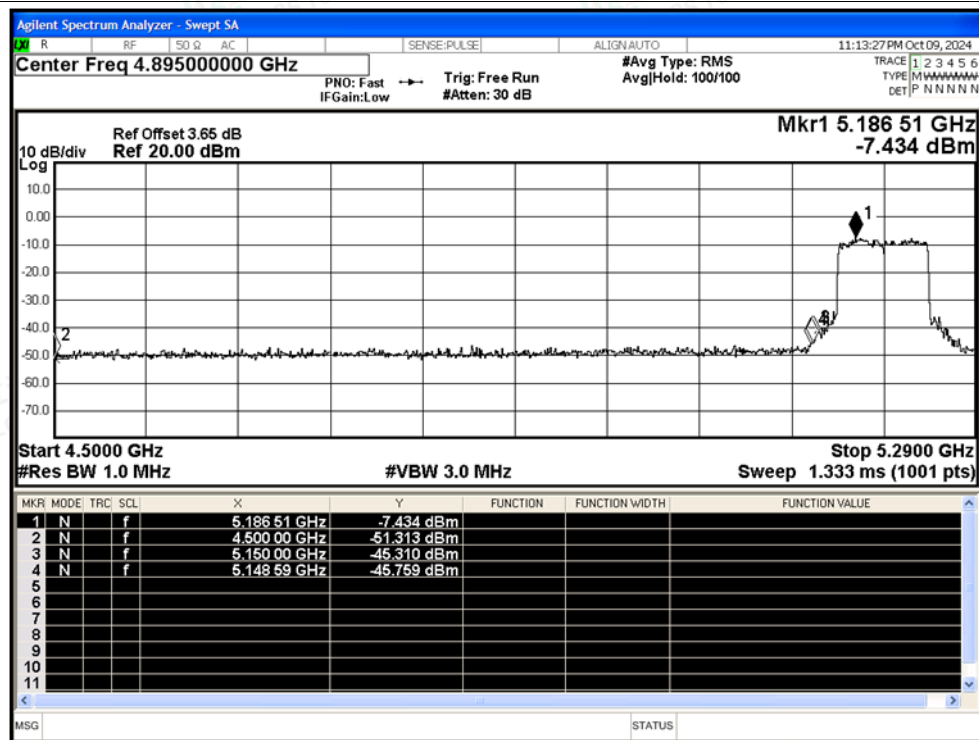


Restrict Band NVNT ac80 5210MHz Ant0 Average

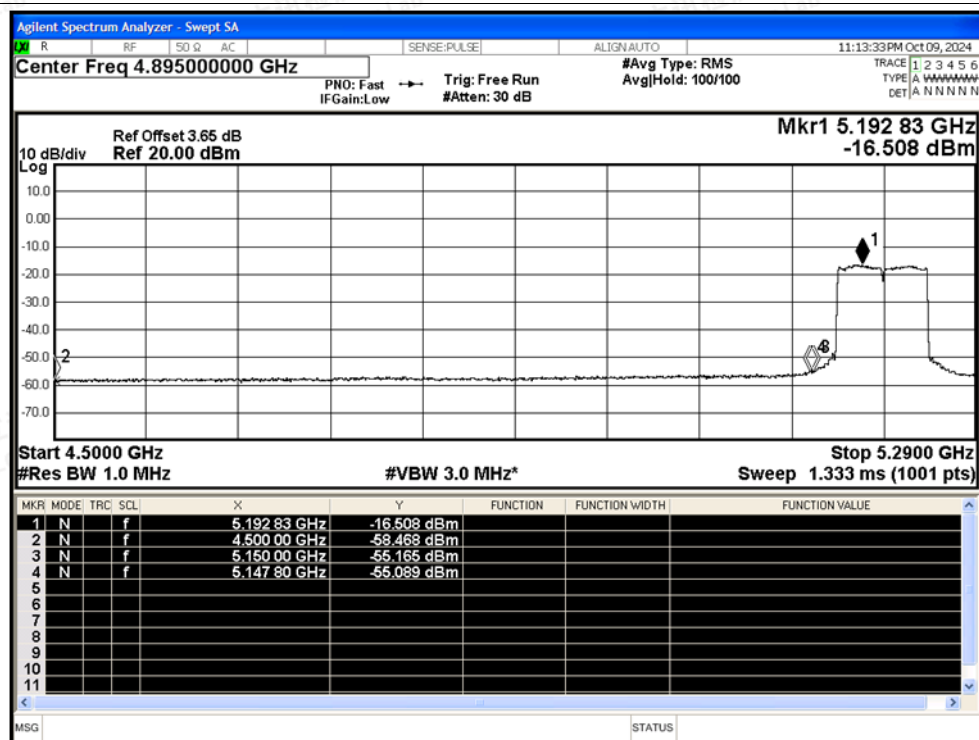


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant0 Peak

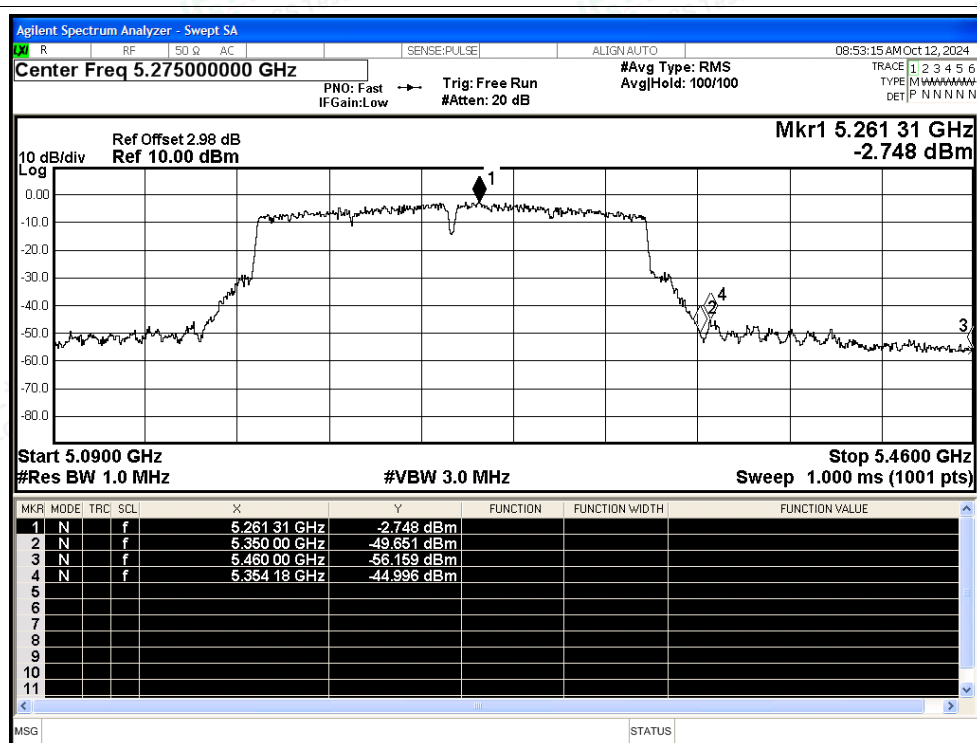


Restrict Band NVNT ac160 5250MHz Ant0 Average

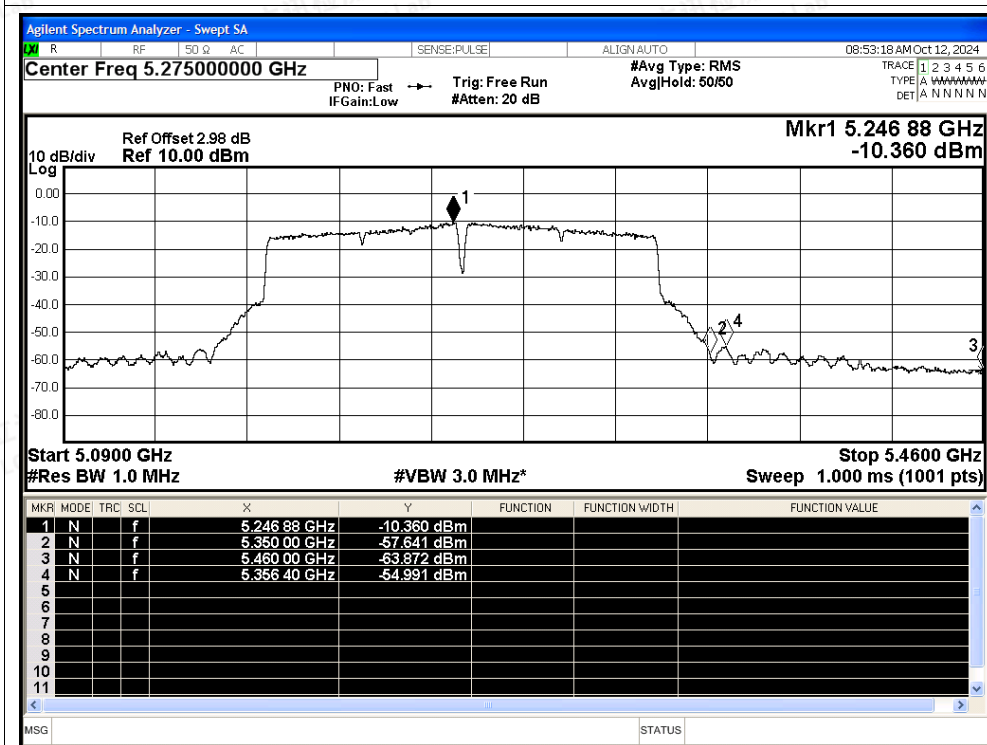




Restrict Band NVNT ac160 5250MHz Ant0 Peak

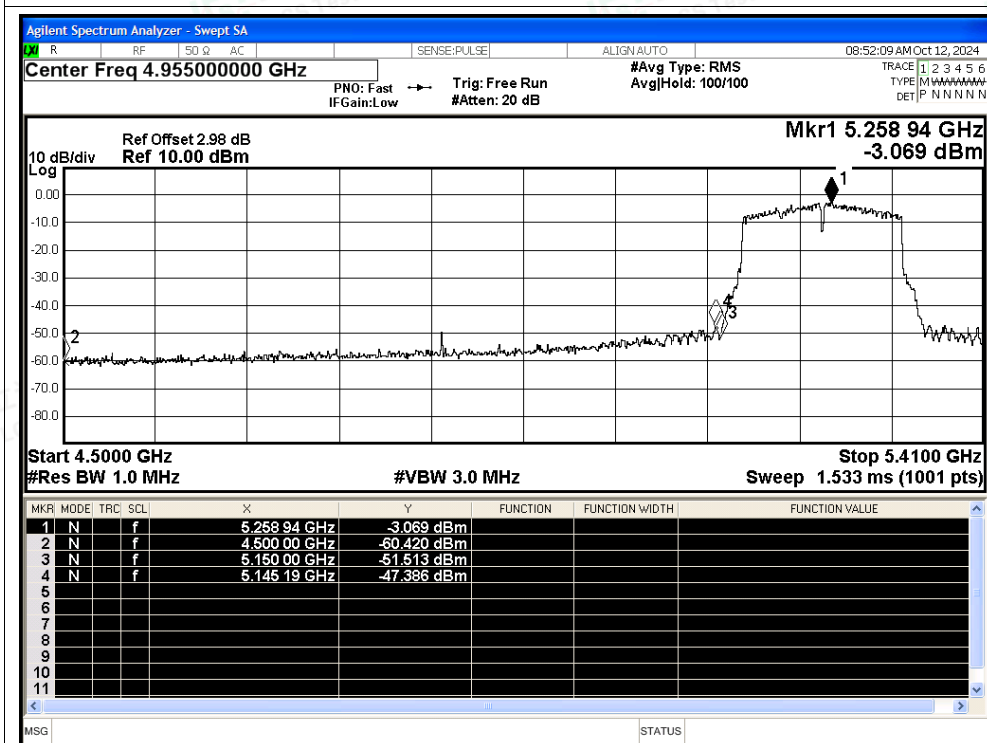


Restrict Band NVNT ac160 5250MHz Ant0 Average

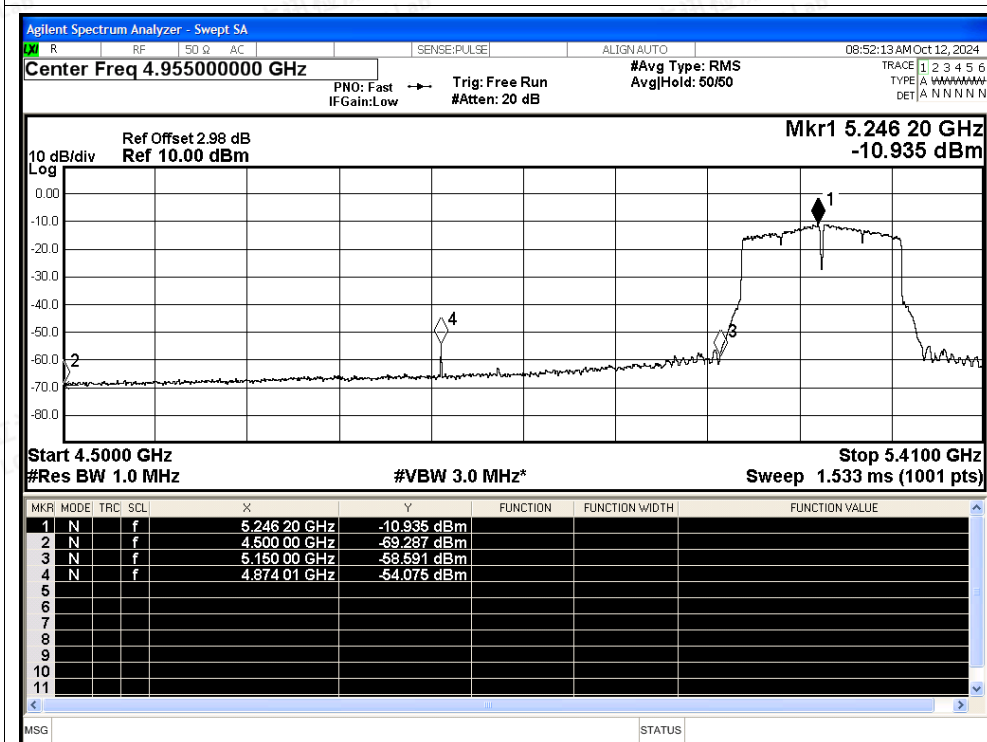


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant0 Peak

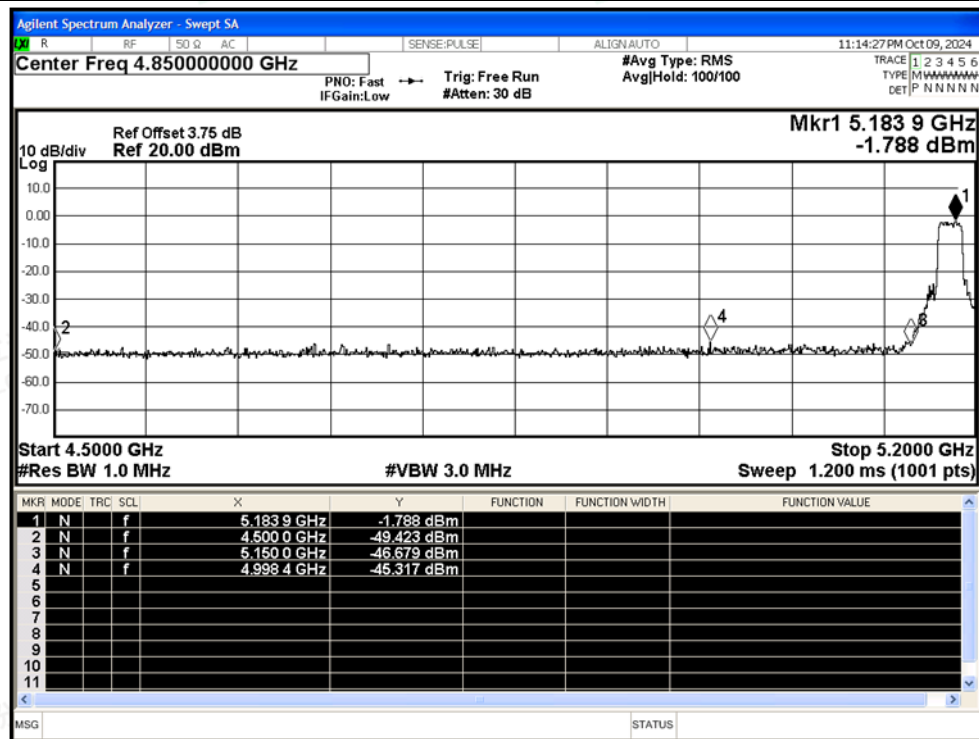


Restrict Band NVNT ax20 5180MHz Ant0 Average

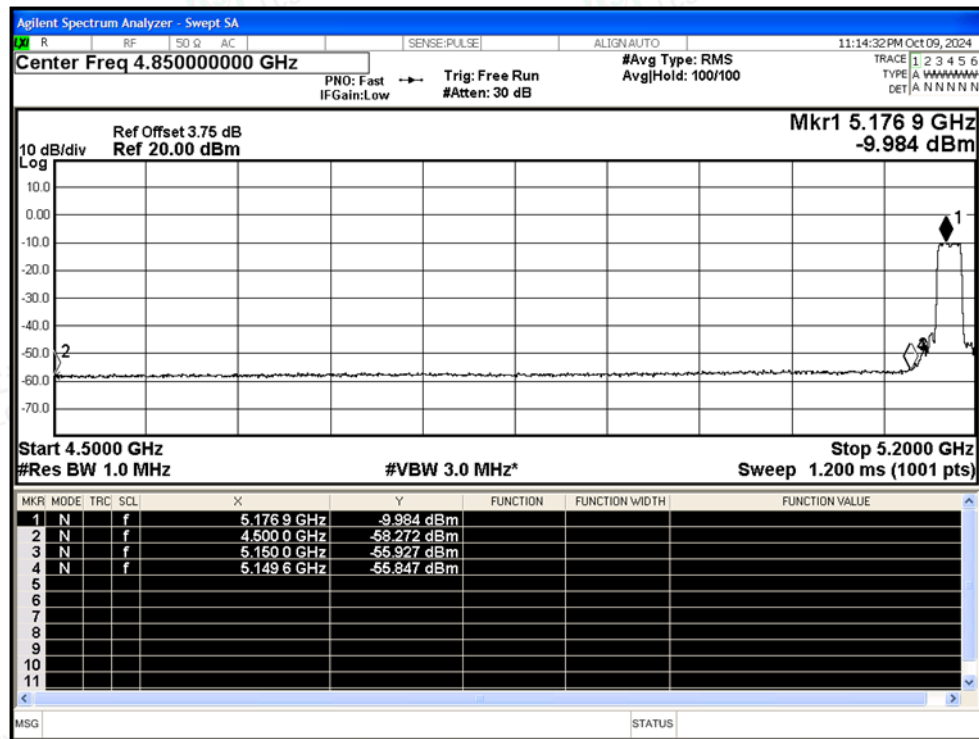




Restrict Band NVNT ax20 5240MHz Ant0 Peak

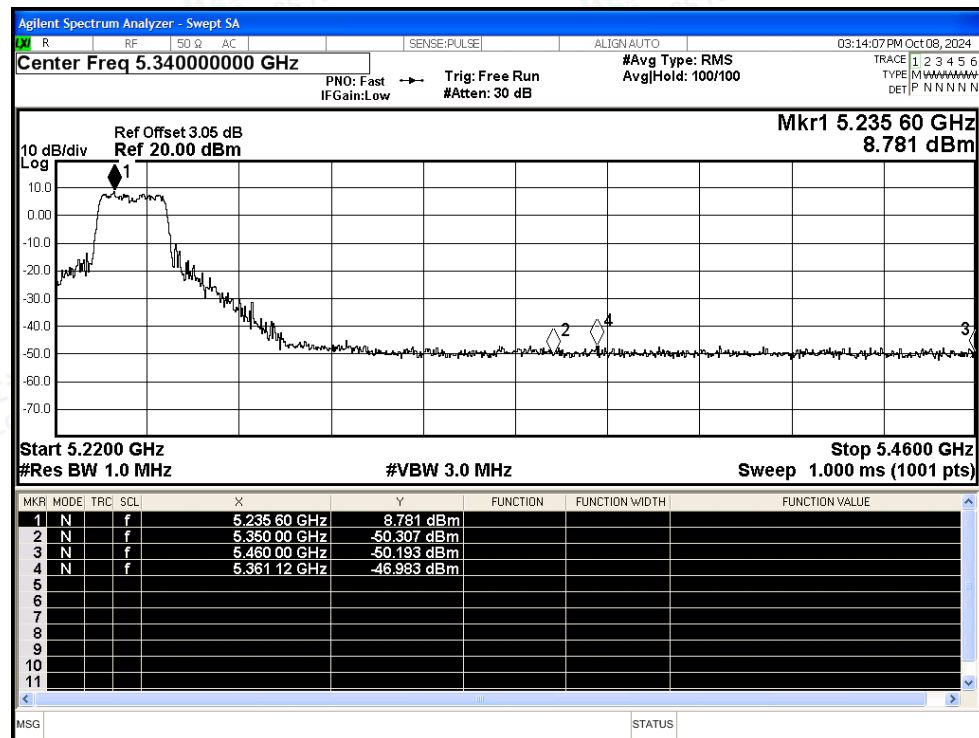


Restrict Band NVNT ax20 5240MHz Ant0 Average

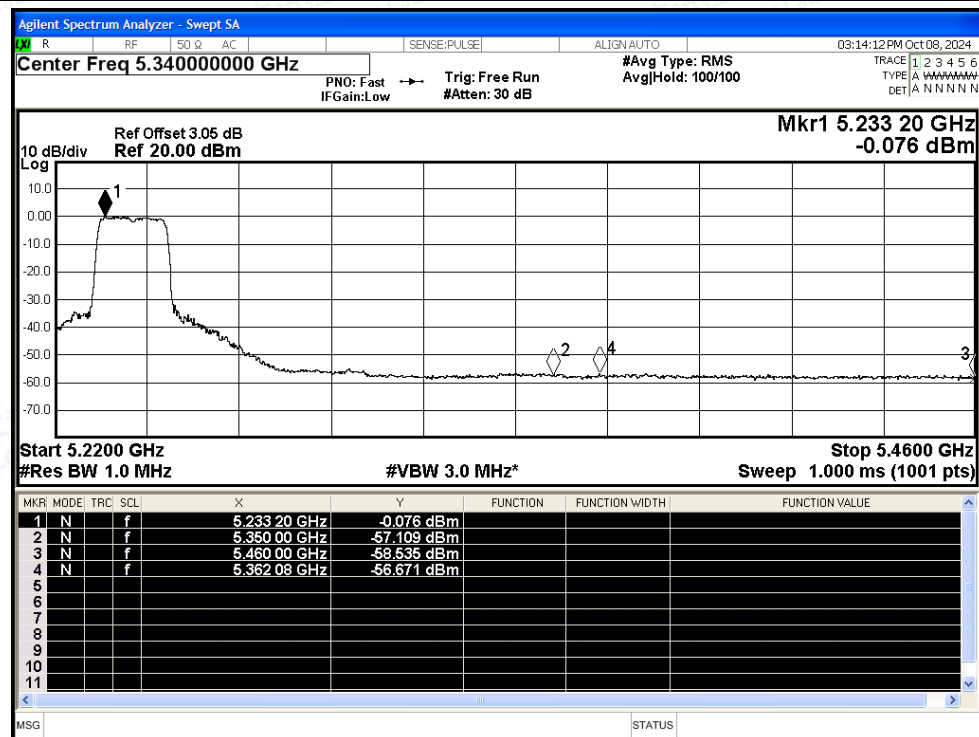


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant0 Peak

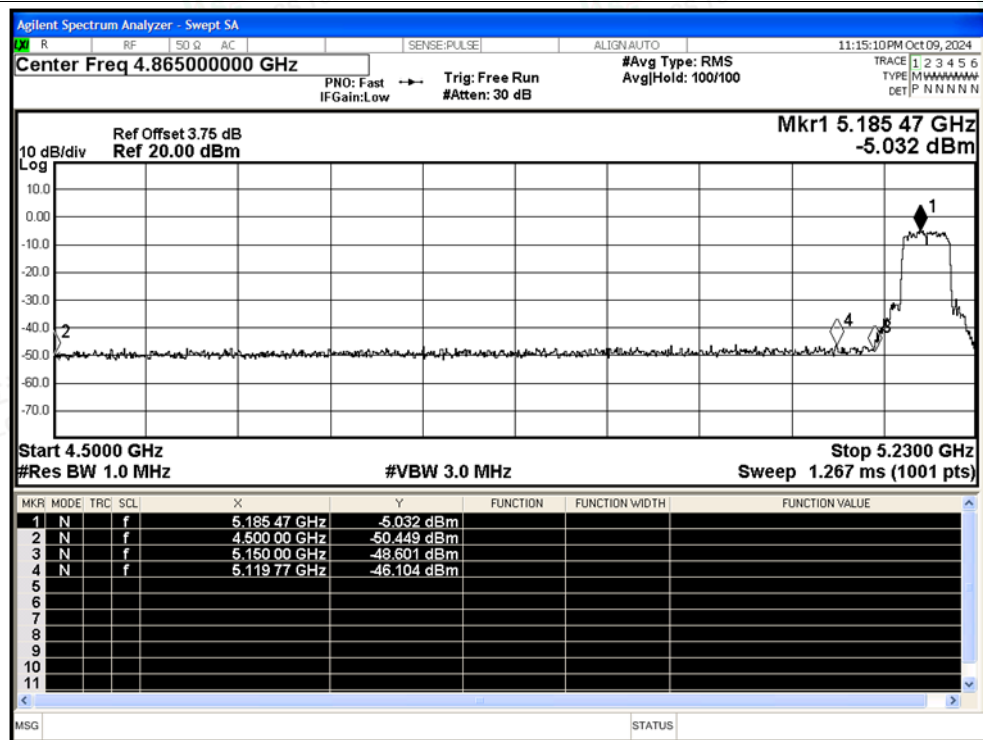


Restrict Band NVNT ax40 5190MHz Ant0 Average

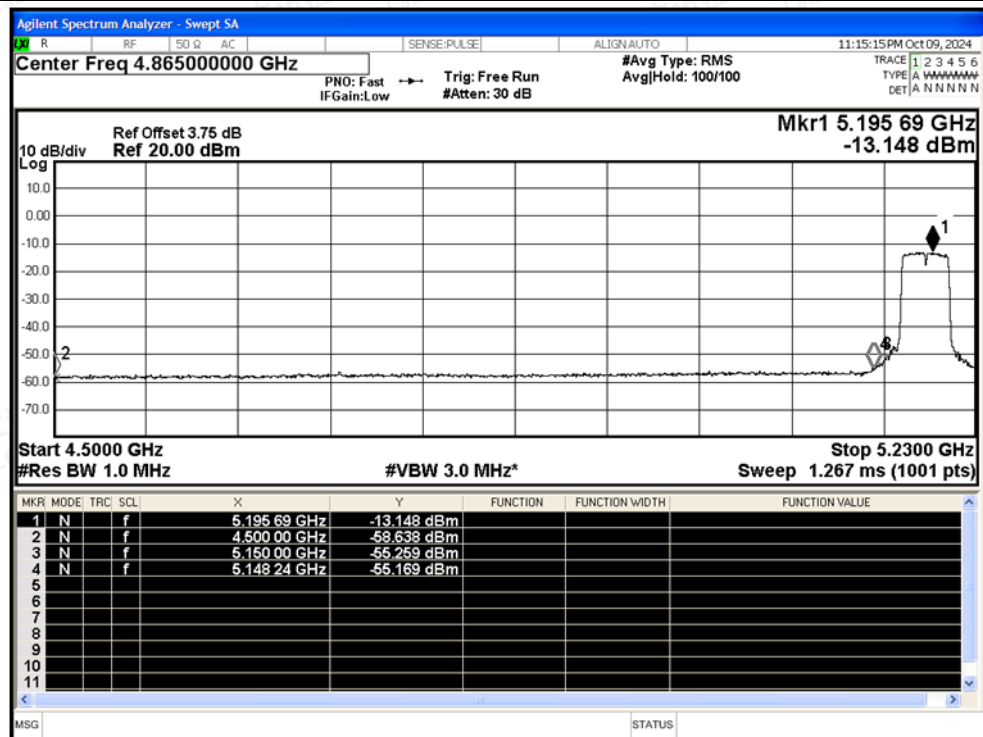




Restrict Band NVNT ax40 5230MHz Ant0 Peak

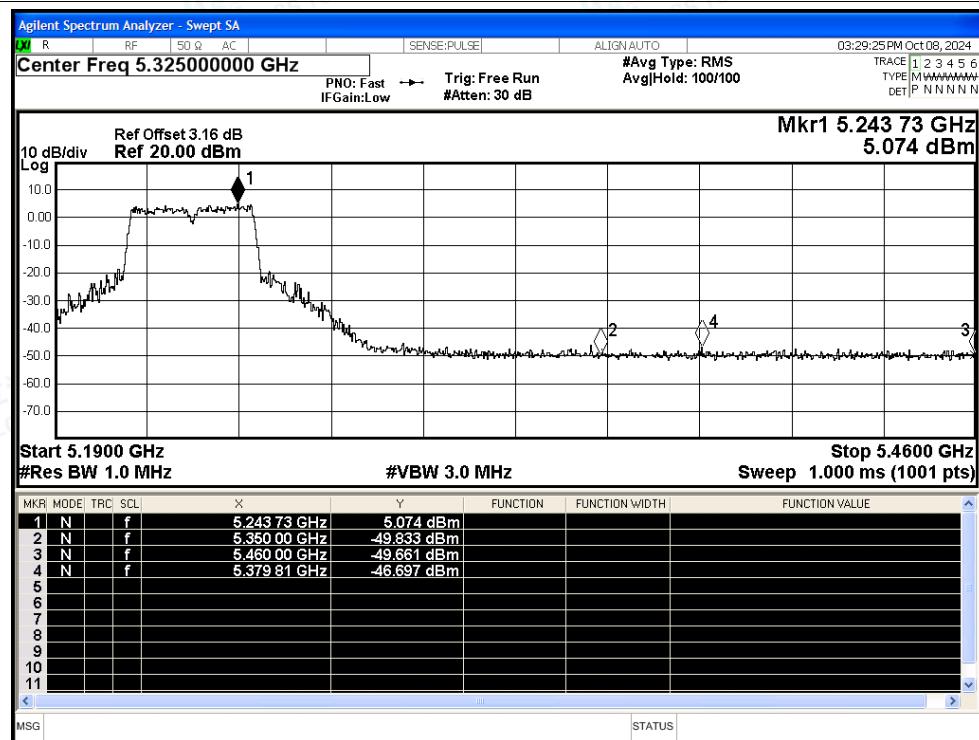


Restrict Band NVNT ax40 5230MHz Ant0 Average

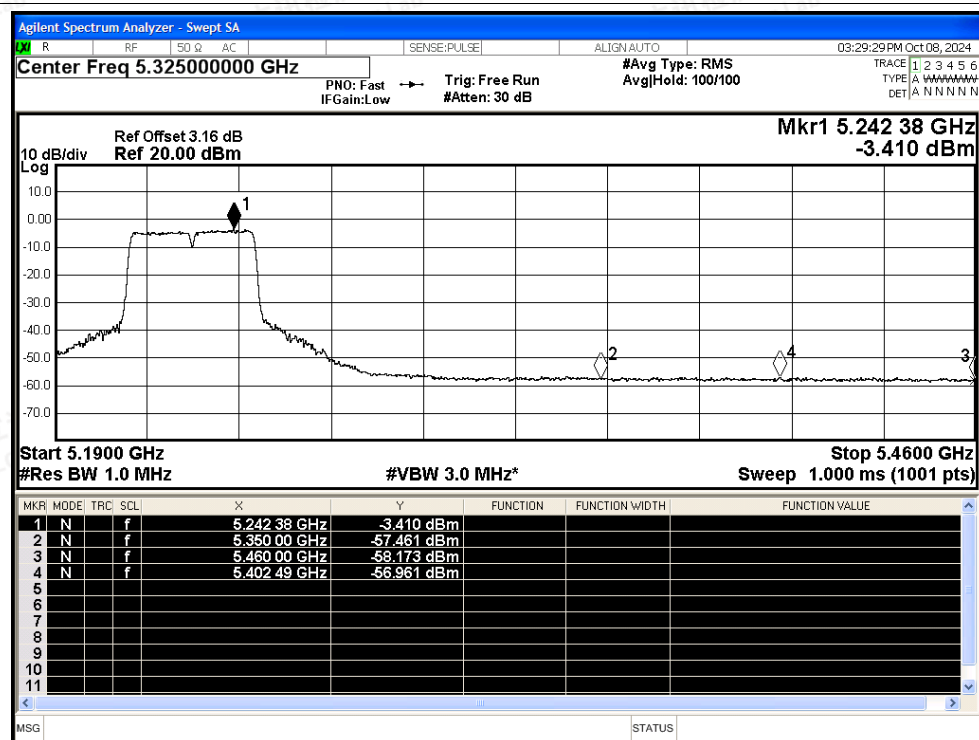


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant0 Peak

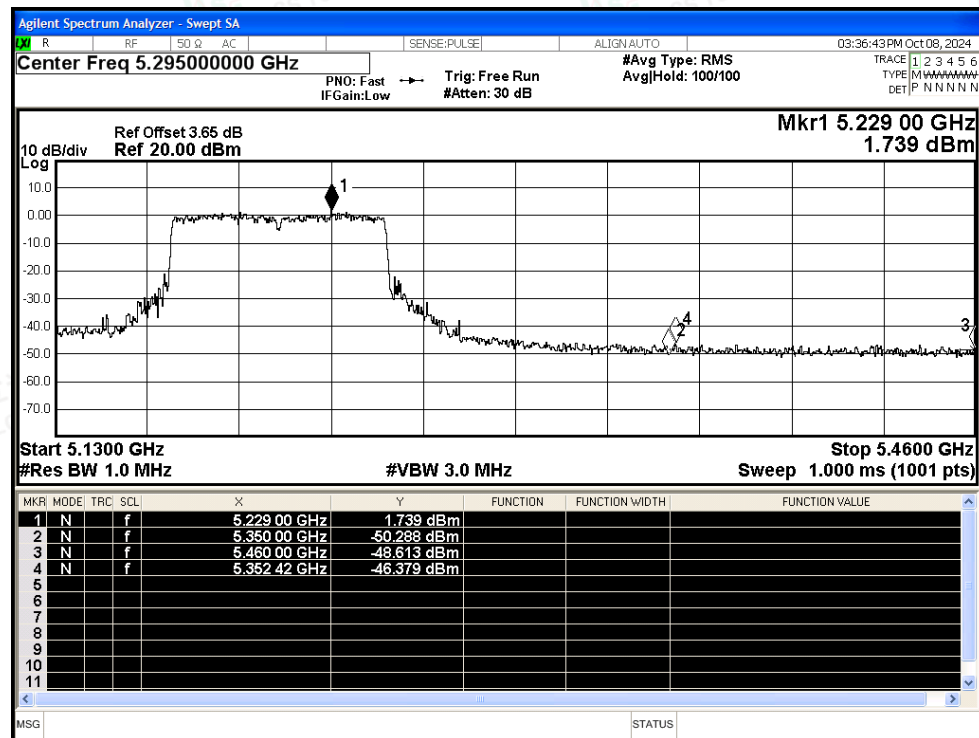


Restrict Band NVNT ax80 5210MHz Ant0 Average

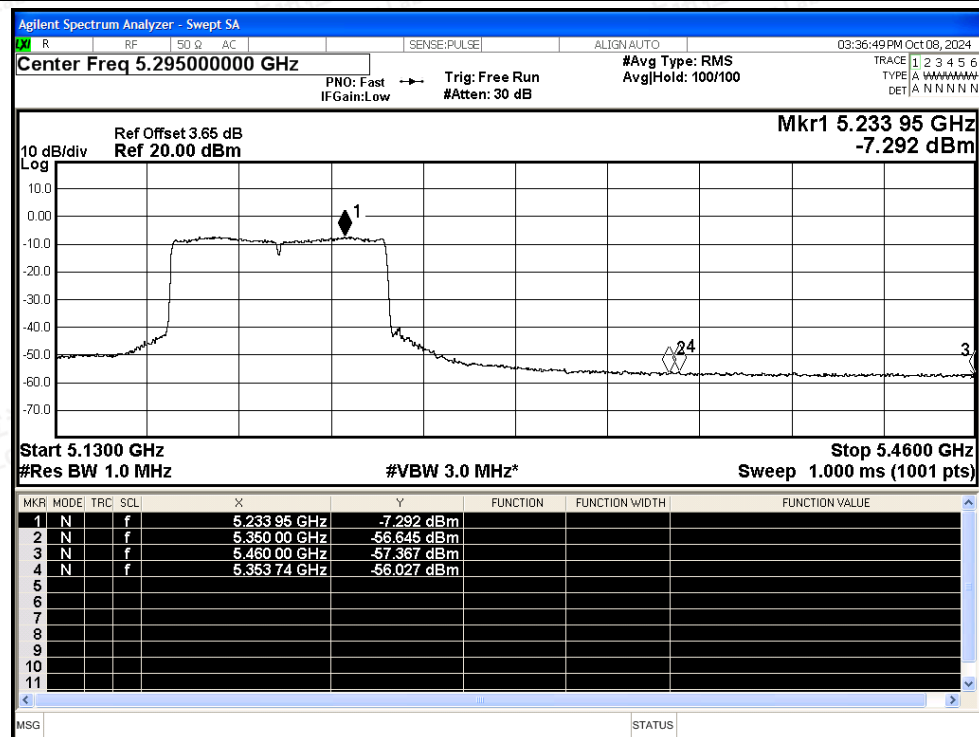


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant0 Peak

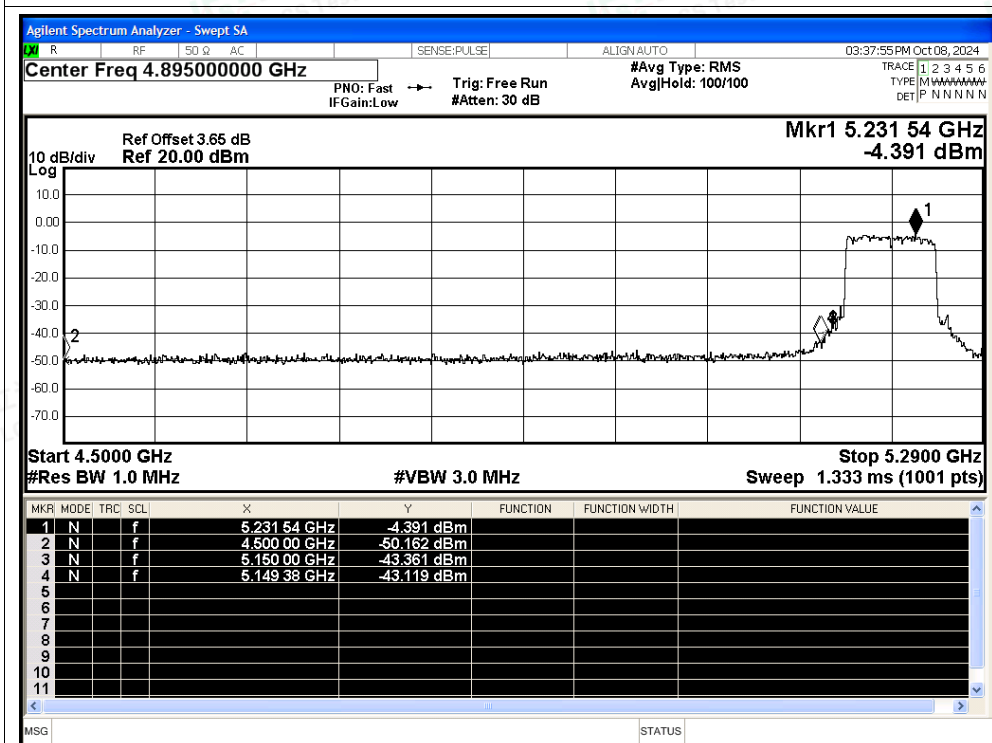


Restrict Band NVNT ax80 5210MHz Ant0 Average

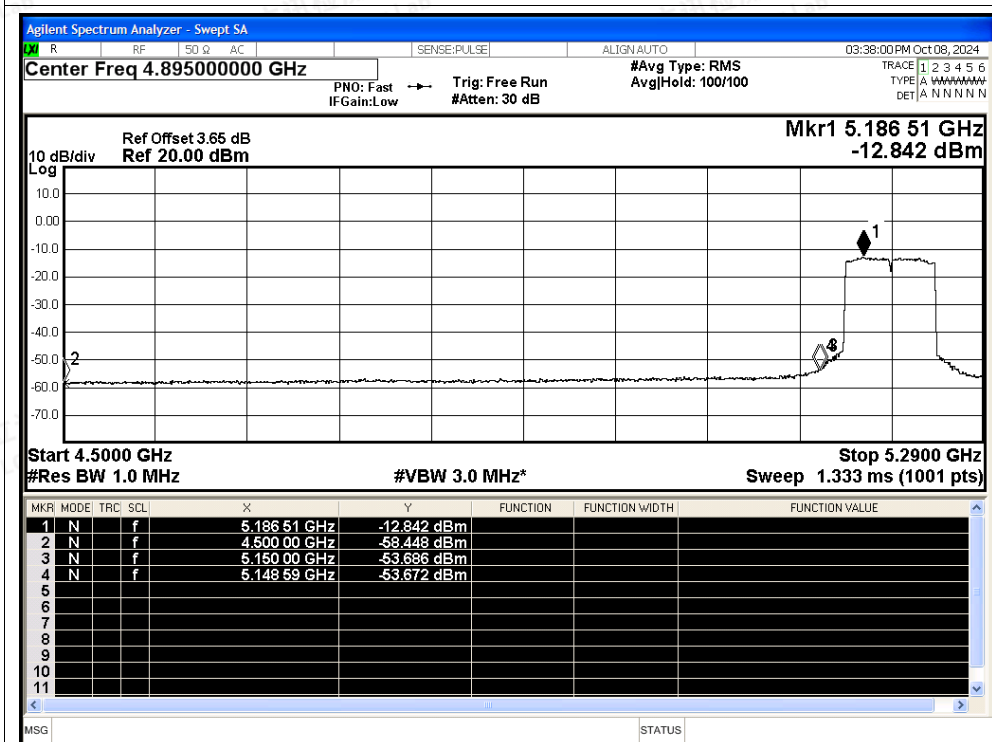




Restrict Band NVNT ax160 5250MHz Ant0 Peak

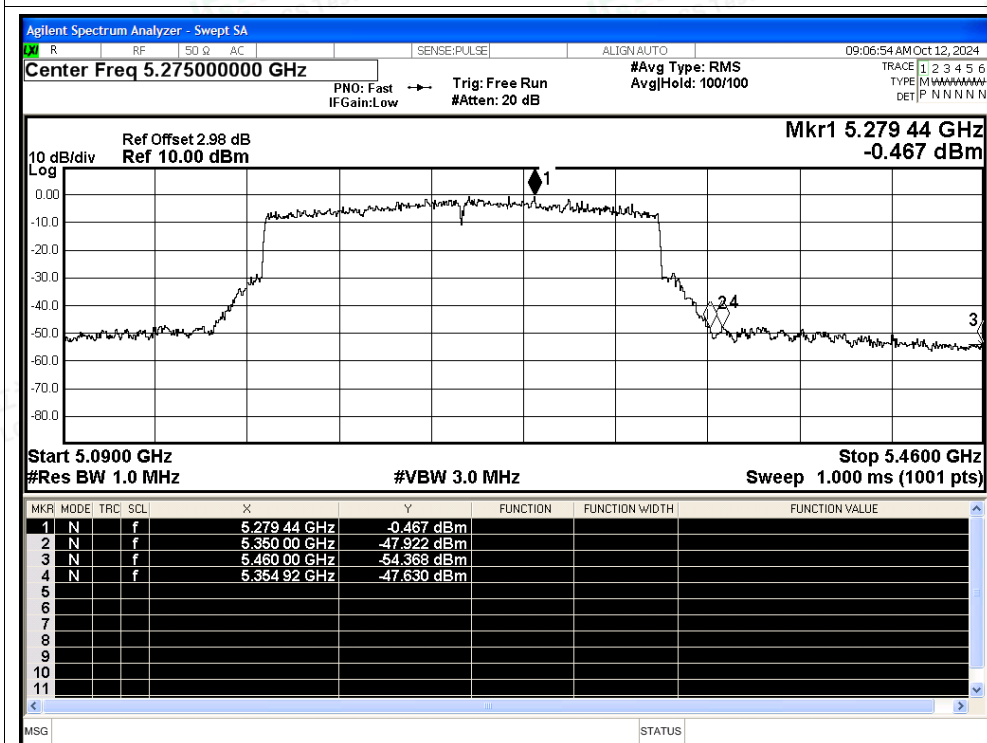


Restrict Band NVNT ax160 5250MHz Ant0 Average

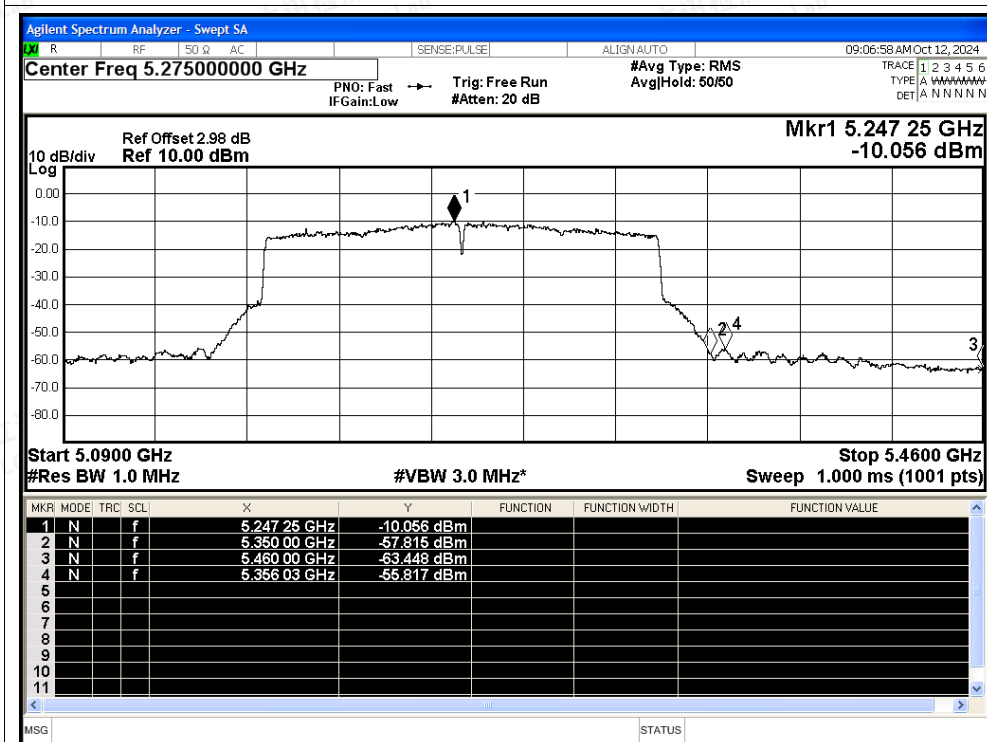


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant0 Peak

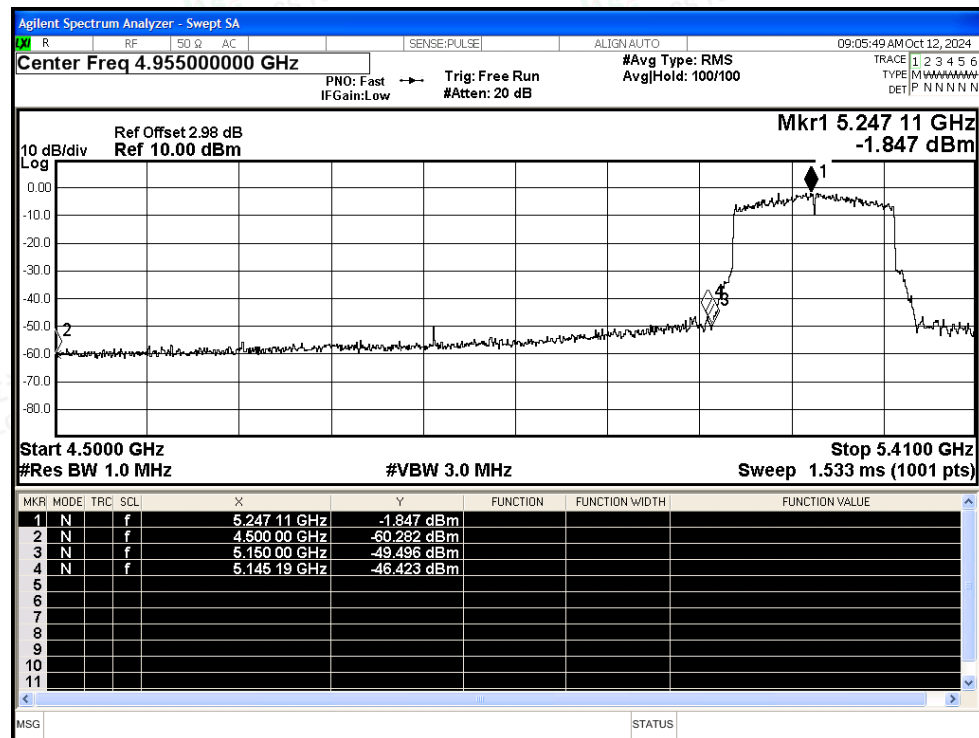

Restrict Band NVNT ax160 5250MHz Ant0 Average

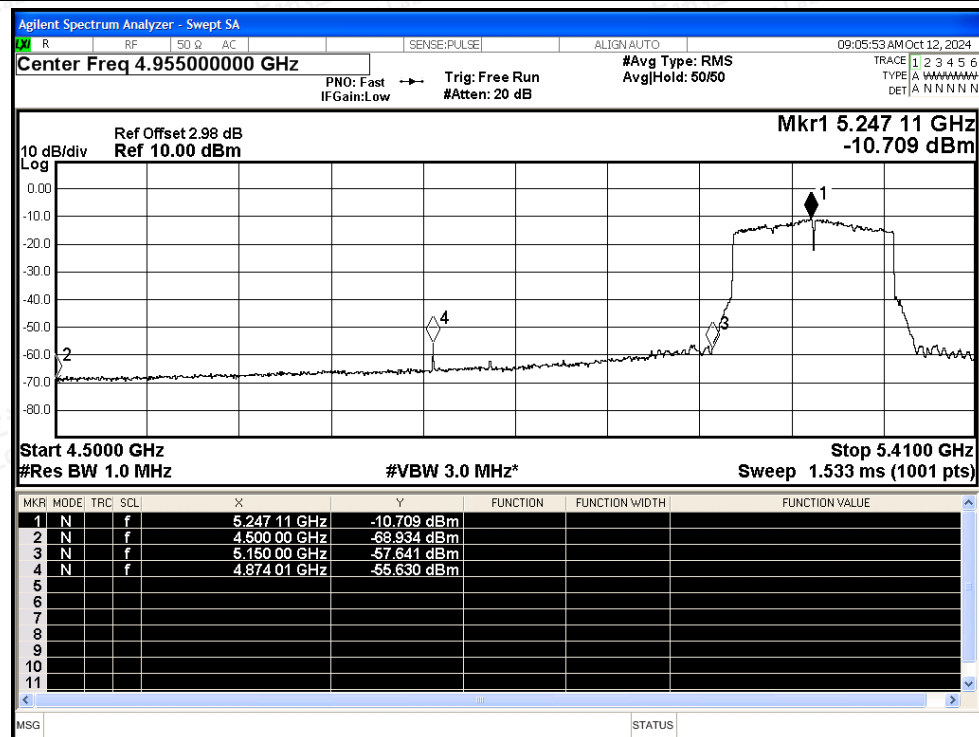

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-48.55	3.09	-	49.77	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-58.16	3.09	0.24	40.4	Average	54	Pass
NVNT	a	5180	Ant1	5148.9	-41.55	3.09	-	56.77	Peak	68.2	Pass
NVNT	a	5180	Ant1	5149.6	-53.77	3.09	0.24	44.79	Average	54	Pass
NVNT	a	5180	Ant1	5150	-41.47	3.09	-	56.85	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-53.29	3.09	0.24	45.27	Average	54	Pass
NVNT	a	5240	Ant1	5350	-49.31	3.09	-	49.01	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-57.59	3.09	0.24	40.97	Average	54	Pass
NVNT	a	5240	Ant1	5371.92	-46.85	3.09	-	51.47	Peak	68.2	Pass
NVNT	a	5240	Ant1	5367.12	-57.05	3.09	0.24	41.51	Average	54	Pass
NVNT	a	5240	Ant1	5460	-49.51	3.09	-	48.81	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-57.98	3.09	0.24	40.58	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-50.69	3.09	-	47.63	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-58.21	3.09	0.12	40.23	Average	54	Pass
NVNT	n20	5180	Ant1	5149.6	-41.42	3.09	-	56.9	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.9	-53.87	3.09	0.12	44.57	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-41.28	3.09	-	57.04	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-54.35	3.09	0.12	44.09	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-49.51	3.09	-	48.81	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-57.08	3.09	0.12	41.36	Average	54	Pass
NVNT	n20	5240	Ant1	5382	-46.53	3.09	-	51.79	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5352.96	-56.9	3.09	0.12	41.54	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-49.42	3.09	-	48.9	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-58.43	3.09	0.12	40.01	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-49.64	3.09	-	48.68	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-58.23	3.09	0.12	40.21	Average	54	Pass
NVNT	n40	5190	Ant1	5149.7	-41.17	3.09	-	57.15	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-53.55	3.09	0.12	44.89	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-41.17	3.09	-	57.15	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-53.55	3.09	0.12	44.89	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-47.74	3.09	-	50.58	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-57.77	3.09	0.12	40.67	Average	54	Pass
NVNT	n40	5230	Ant1	5417.61	-46.41	3.09	-	51.91	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5367.66	-57	3.09	0.12	41.44	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-48.6	3.09	-	49.72	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-58.14	3.09	0.12	40.3	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-50.88	3.09	-	47.44	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5180	Ant1	4500	-58.19	3.09	0.12	40.25	Average	54	Pass
NVNT	ac20	5180	Ant1	5148.9	-41.6	3.09	-	56.72	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5149.6	-54.25	3.09	0.12	44.19	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-40.18	3.09	-	58.14	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-54.44	3.09	0.12	44	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-49.02	3.09	-	49.3	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-56.8	3.09	0.12	41.64	Average	54	Pass
NVNT	ac20	5240	Ant1	5366.64	-46.09	3.09	-	52.23	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5351.28	-56.77	3.09	0.12	41.67	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-49.53	3.09	-	48.79	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-57.91	3.09	0.12	40.53	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-48.93	3.09	-	49.39	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.46	3.09	0.12	39.98	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.24	-39.5	3.09	-	58.82	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-53.71	3.09	0.12	44.73	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-44.27	3.09	-	54.05	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-53.71	3.09	0.12	44.73	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-48.87	3.09	-	49.45	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-57.74	3.09	0.12	40.7	Average	54	Pass
NVNT	ac40	5230	Ant1	5359.83	-47.25	3.09	-	51.07	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5370.63	-56.84	3.09	0.12	41.6	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.73	3.09	-	49.59	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-58.27	3.09	0.12	40.17	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-49.65	3.09	-	48.67	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-56.93	3.09	0.25	41.64	Average	54	Pass
NVNT	ac80	5210	Ant1	5350.77	-45.52	3.09	-	52.8	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5356.05	-56.49	3.09	0.25	42.08	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.16	3.09	-	50.16	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-57.25	3.09	0.25	41.32	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-49.44	3.09	-	48.88	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-58.72	3.09	0.25	39.85	Average	54	Pass
NVNT	ac80	5210	Ant1	5149.38	-42.23	3.09	-	56.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5149.38	-54.08	3.09	0.25	44.49	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-42.06	3.09	-	56.26	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-53.53	3.09	0.25	45.04	Average	54	Pass
NVNT	ac160	5250	Ant1	5350	-50.61	3.09	-	47.71	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-58.07	3.09	0.41	40.66	Average	54	Pass
NVNT	ac160	5250	Ant1	5354.92	-46.69	3.09	-	51.63	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5356.4	-55.73	3.09	0.41	43.00	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-56.25	3.09	-	42.07	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac160	5250	Ant1	5460	-64.94	3.09	0.41	33.79	Average	54	Pass
NVNT	ac160	5250	Ant1	4500	-60.46	3.09	-	37.86	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-69.23	3.09	0.41	29.50	Average	54	Pass
NVNT	ac160	5250	Ant1	5146.1	-48.4	3.09	-	49.92	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4874.01	-54.62	3.09	0.41	44.11	Average	54	Pass
NVNT	ac160	5250	Ant1	5150	-52.6	3.09	-	45.72	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-58.89	3.09	0.41	39.84	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-51.74	3.09	-	46.58	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-57.61	3.09	0.12	40.83	Average	54	Pass
NVNT	ax20	5180	Ant1	5146.8	-44.14	3.09	-	54.18	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-53.8	3.09	0.12	44.64	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-43.41	3.09	-	54.91	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-52.81	3.09	0.12	45.63	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-49.43	3.09	-	48.89	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-57.32	3.09	0.12	41.12	Average	54	Pass
NVNT	ax20	5240	Ant1	5390.88	-46.18	3.09	-	52.14	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5352	-56.64	3.09	0.12	41.8	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-50.54	3.09	-	47.78	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-58.18	3.09	0.12	40.26	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-49.89	3.09	-	48.43	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-58.26	3.09	0.12	40.18	Average	54	Pass
NVNT	ax40	5190	Ant1	5147.51	-38.58	3.09	-	59.74	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5148.24	-54.16	3.09	0.12	44.28	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-42.32	3.09	-	56	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-54.29	3.09	0.12	44.15	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-50.29	3.09	-	48.03	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-57.65	3.09	0.12	40.79	Average	54	Pass
NVNT	ax40	5230	Ant1	5414.37	-47.62	3.09	-	50.7	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5370.09	-56.93	3.09	0.12	41.51	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-48.59	3.09	-	49.73	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-58.11	3.09	0.12	40.33	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-48.91	3.09	-	49.41	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-56.93	3.09	0.25	41.64	Average	54	Pass
NVNT	ax80	5210	Ant1	5416.77	-46.3	3.09	-	52.02	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5355.72	-56.42	3.09	0.25	42.15	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-50.34	3.09	-	47.98	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-57.2	3.09	0.25	41.37	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-51.13	3.09	-	47.19	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-57.72	3.09	0.25	40.85	Average	54	Pass
NVNT	ax80	5210	Ant1	5148.59	-43.99	3.09	-	54.33	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ax80	5210	Ant1	5148.59	-53.85	3.09	0.25	44.72	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-43.75	3.09	-	54.57	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-53.83	3.09	0.25	44.74	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-48.89	3.09	-	49.43	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-57.43	3.09	0.5	41.39	Average	54	Pass
NVNT	ax160	5250	Ant1	5354.92	-45.62	3.09	-	52.70	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5356.4	-56.62	3.09	0.5	42.20	Average	54	Pass
NVNT	ax160	5250	Ant1	5460	-55.69	3.09	-	42.63	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-63.67	3.09	0.5	35.15	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-58.89	3.09	-	39.43	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4500	-68.91	3.09	0.5	29.91	Average	54	Pass
NVNT	ax160	5250	Ant1	5132.45	-47.48	3.09	-	50.84	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4874.01	-55.75	3.09	0.5	43.07	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-49.63	3.09	-	48.69	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5150	-58.81	3.09	0.5	40.01	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

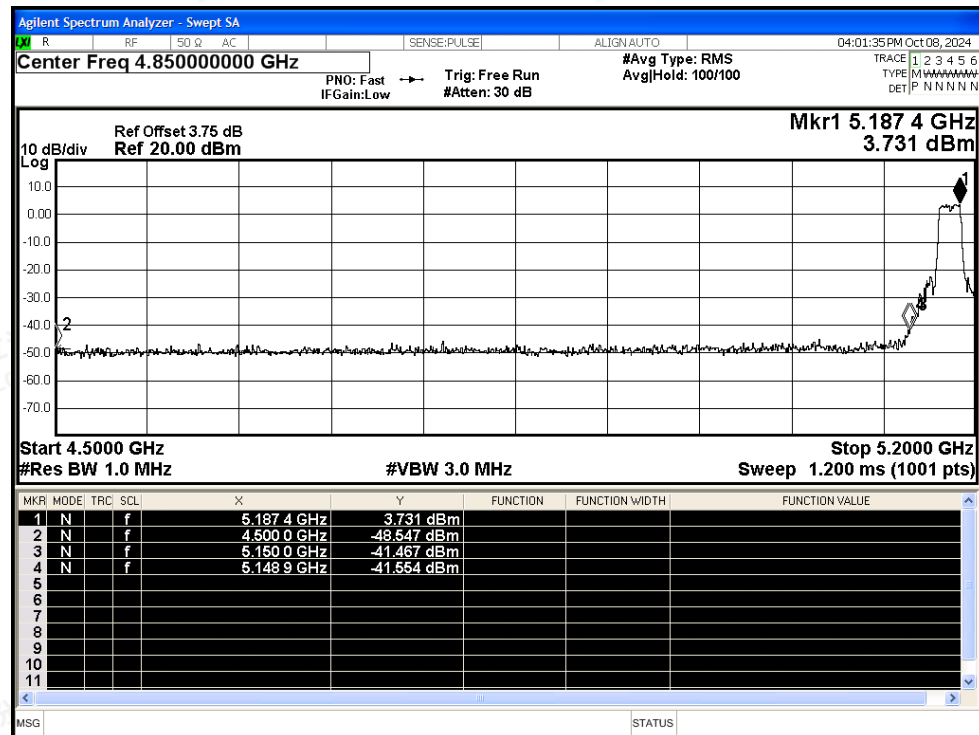


Restrict Band NVNT a 5180MHz Ant1 Average

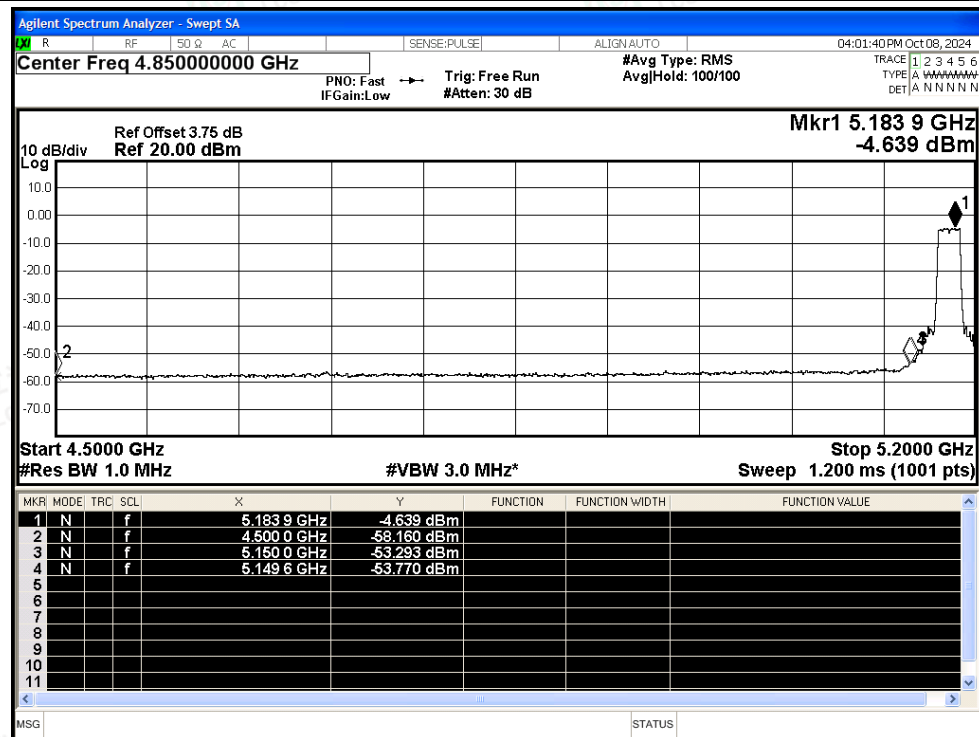








Restrict Band NVNT a 5240MHz Ant1 Peak


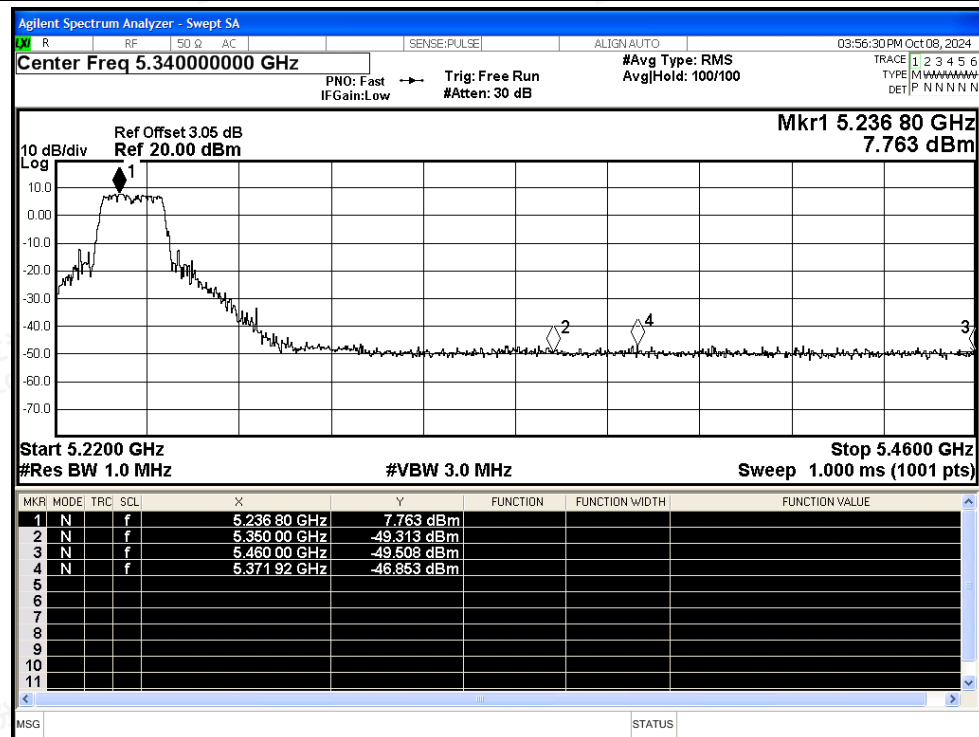




Restrict Band NVNT a 5240MHz Ant1 Average


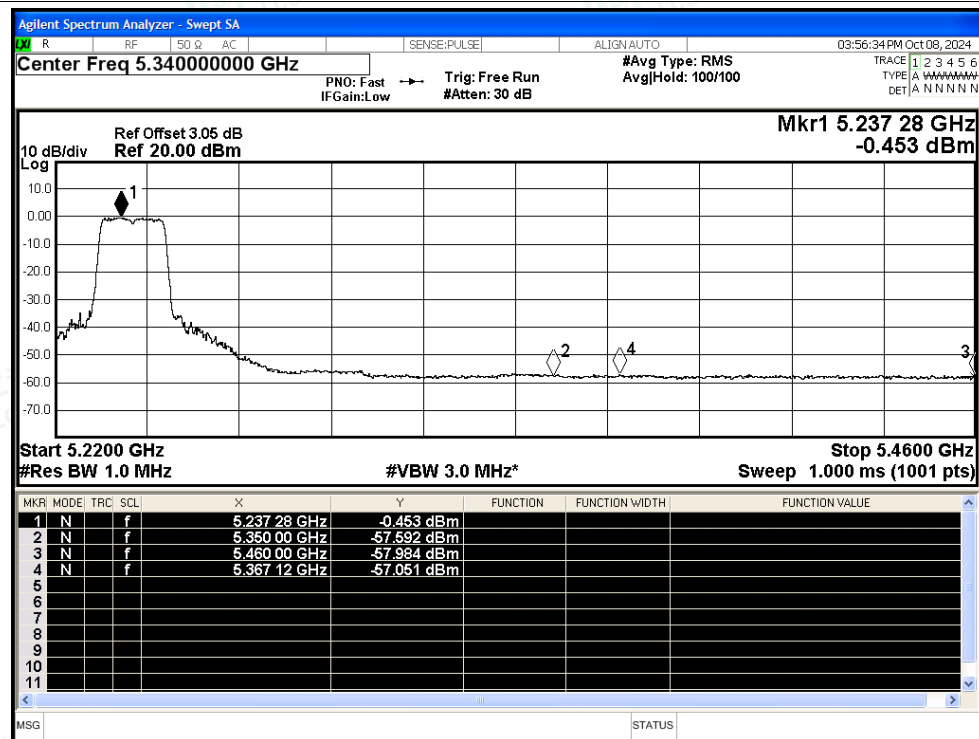


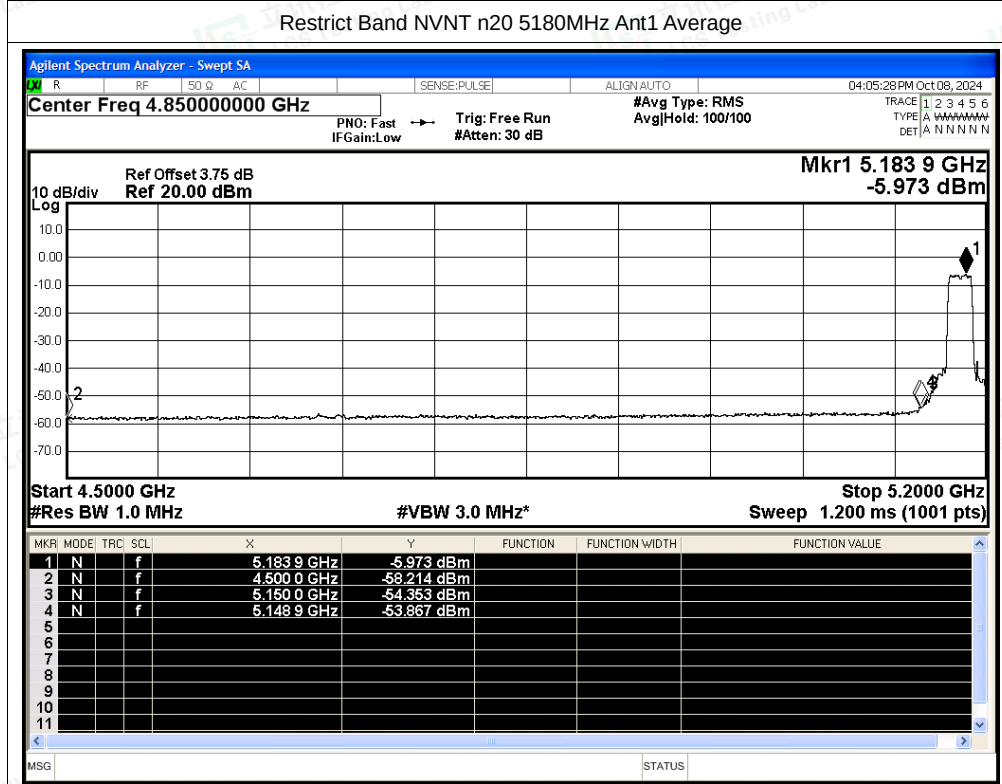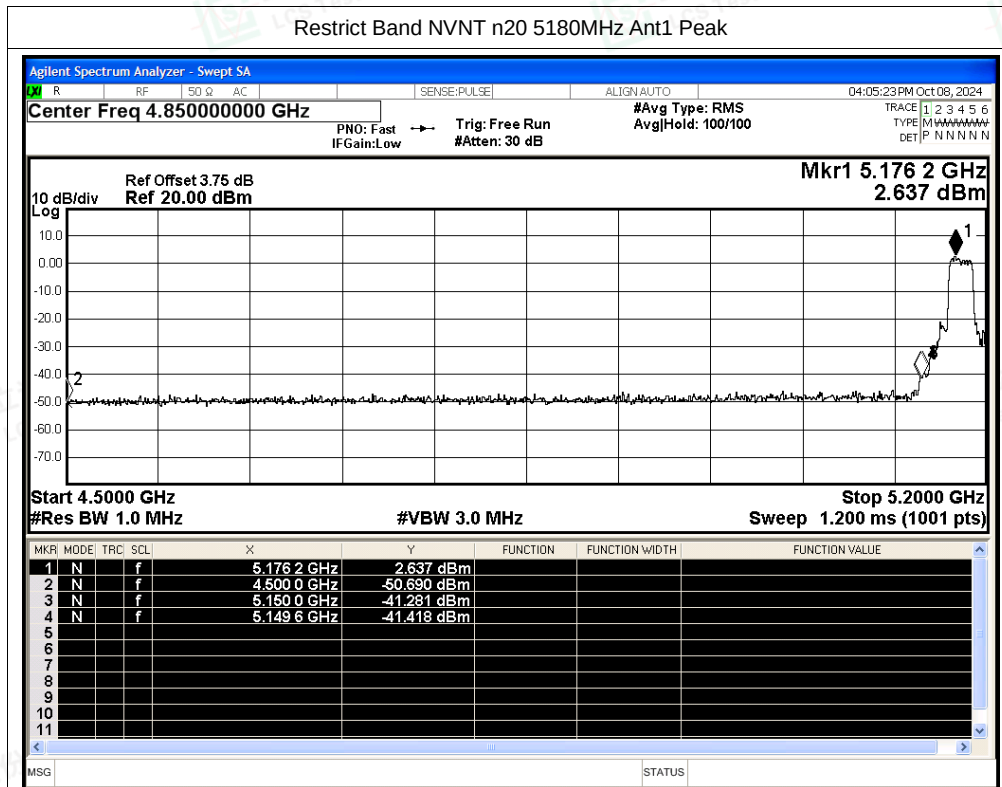

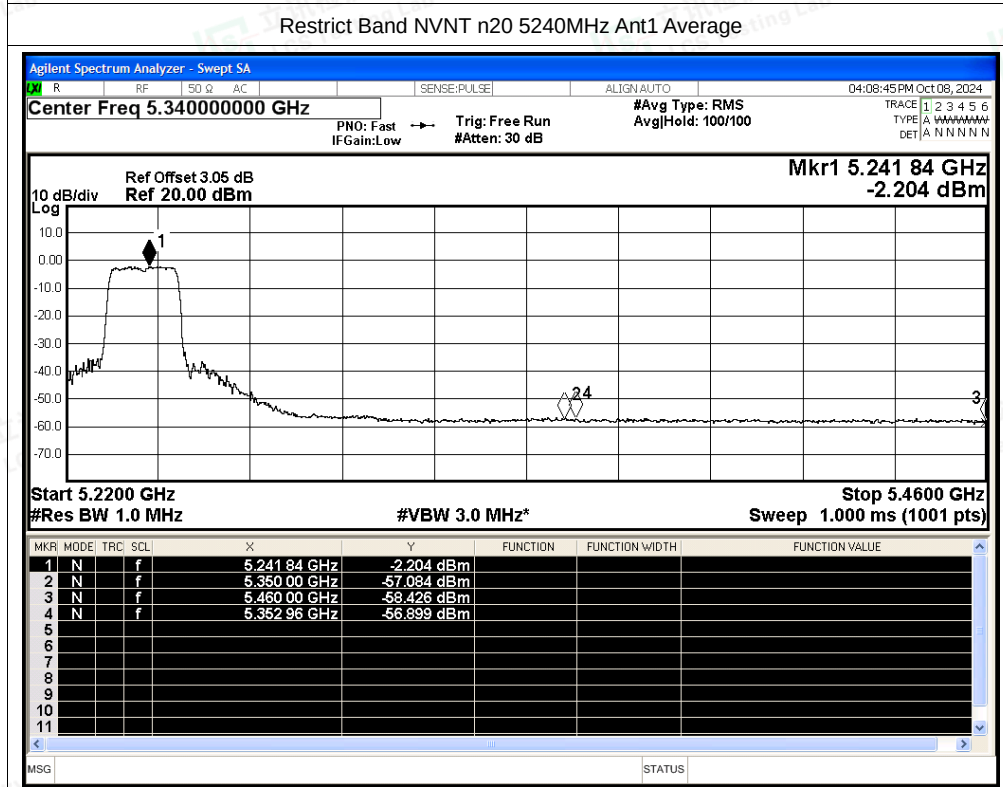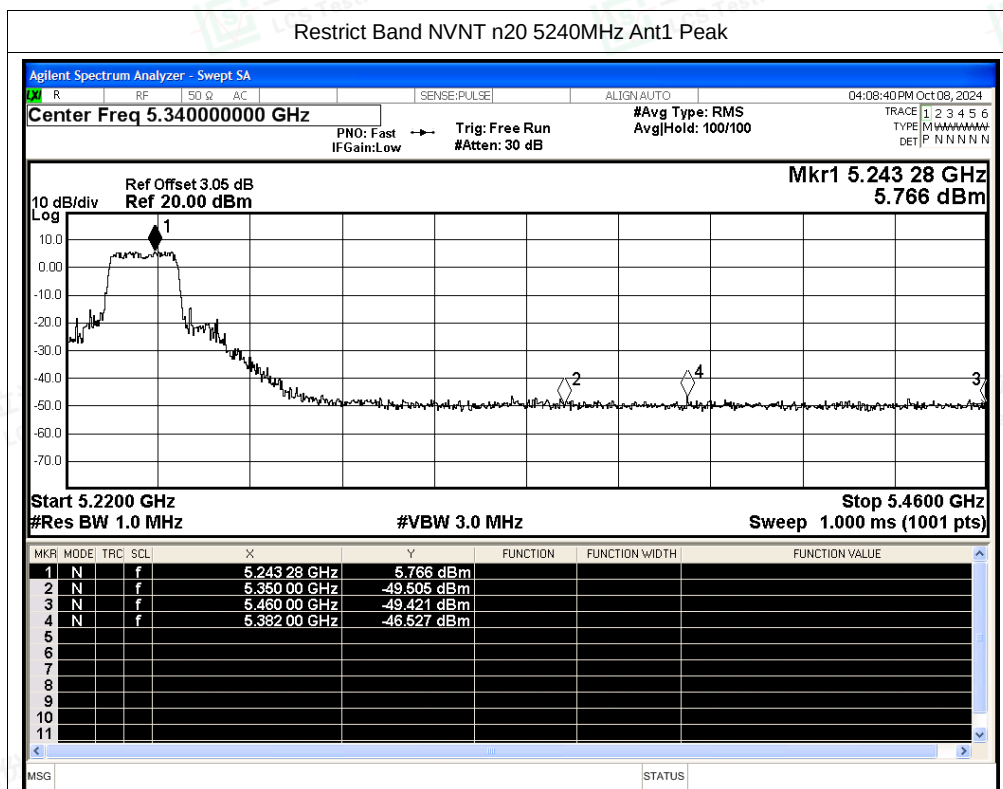

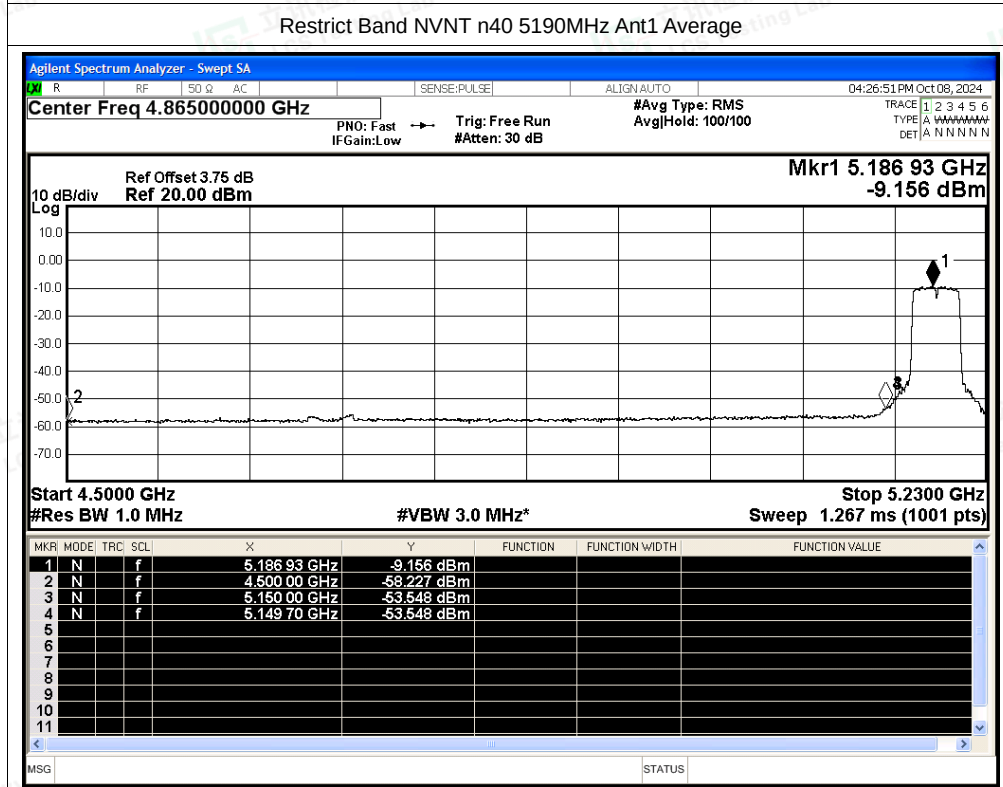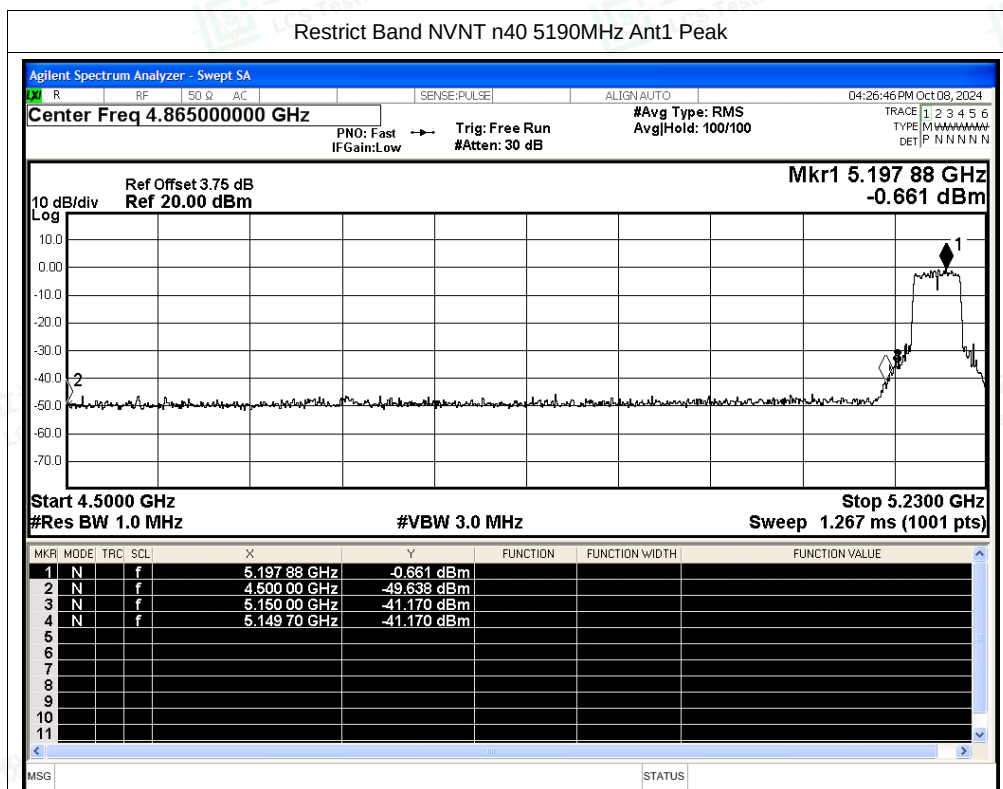


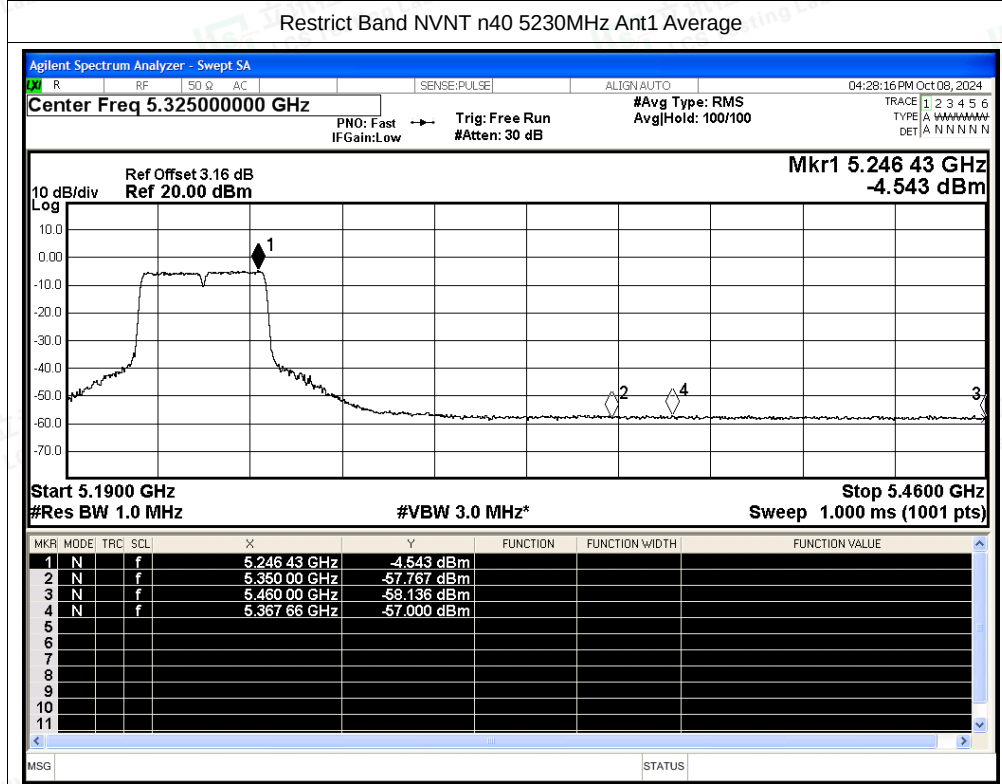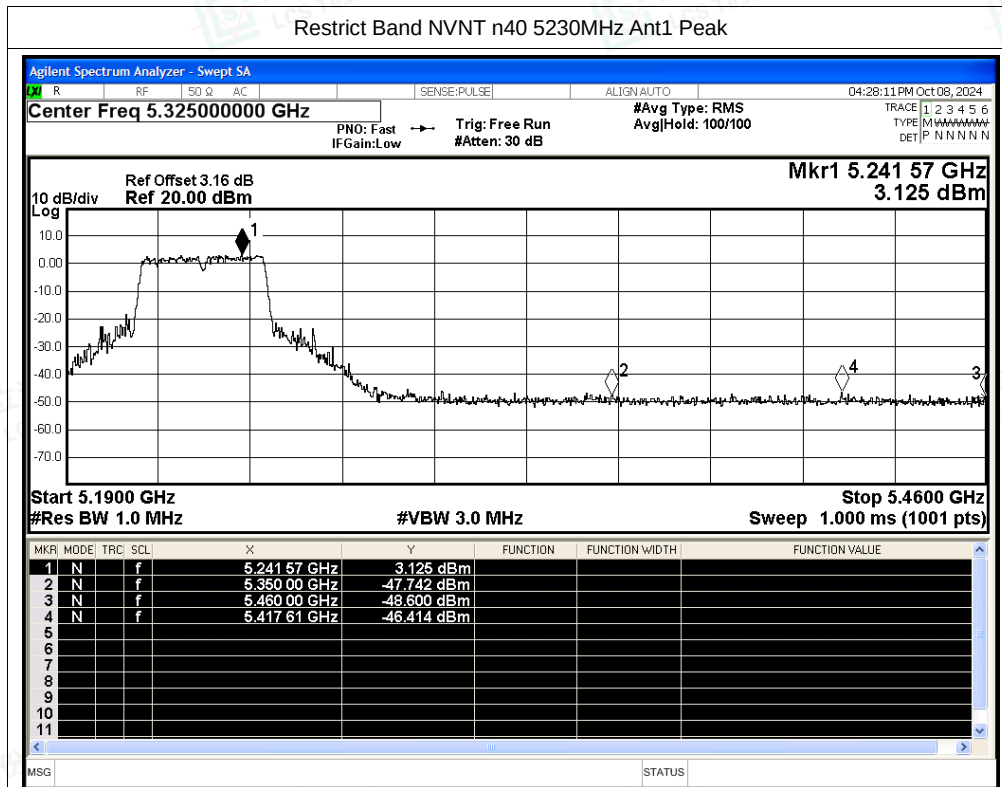

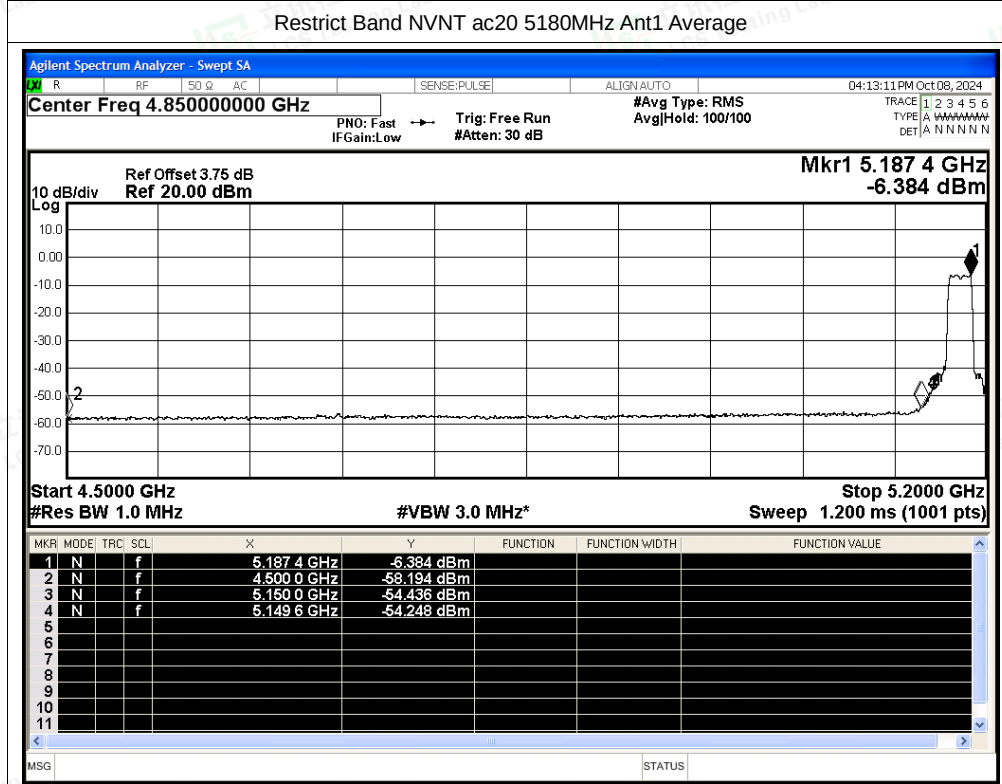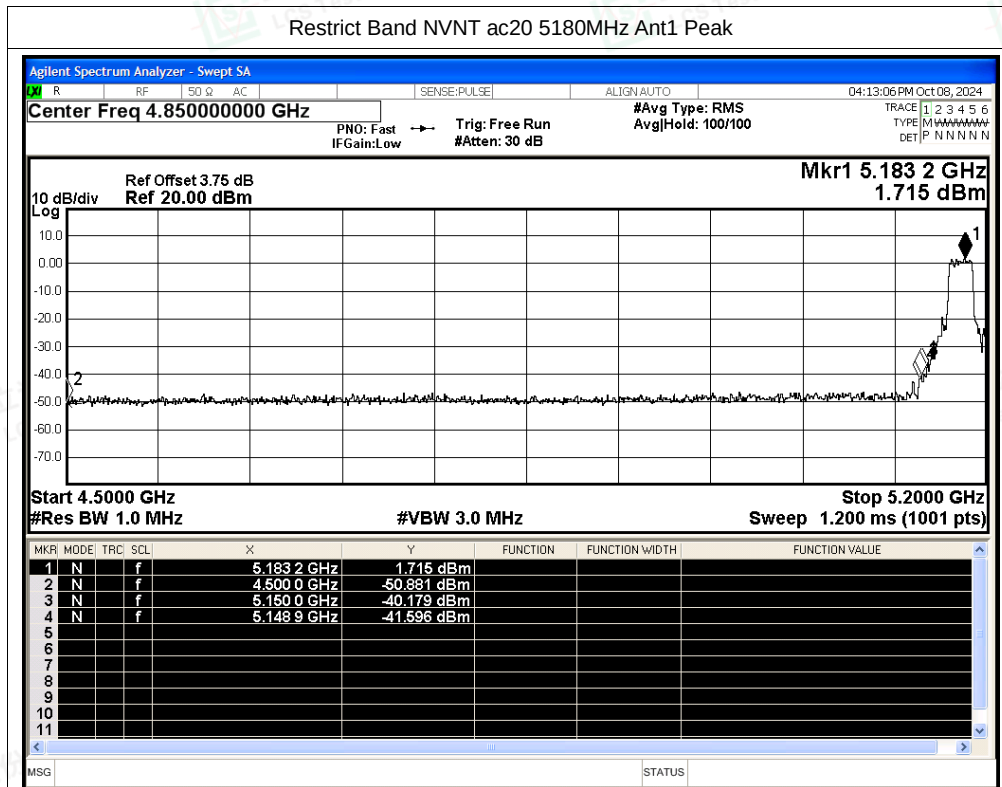




Restrict Band NVNT ac20 5240MHz Ant1 Peak

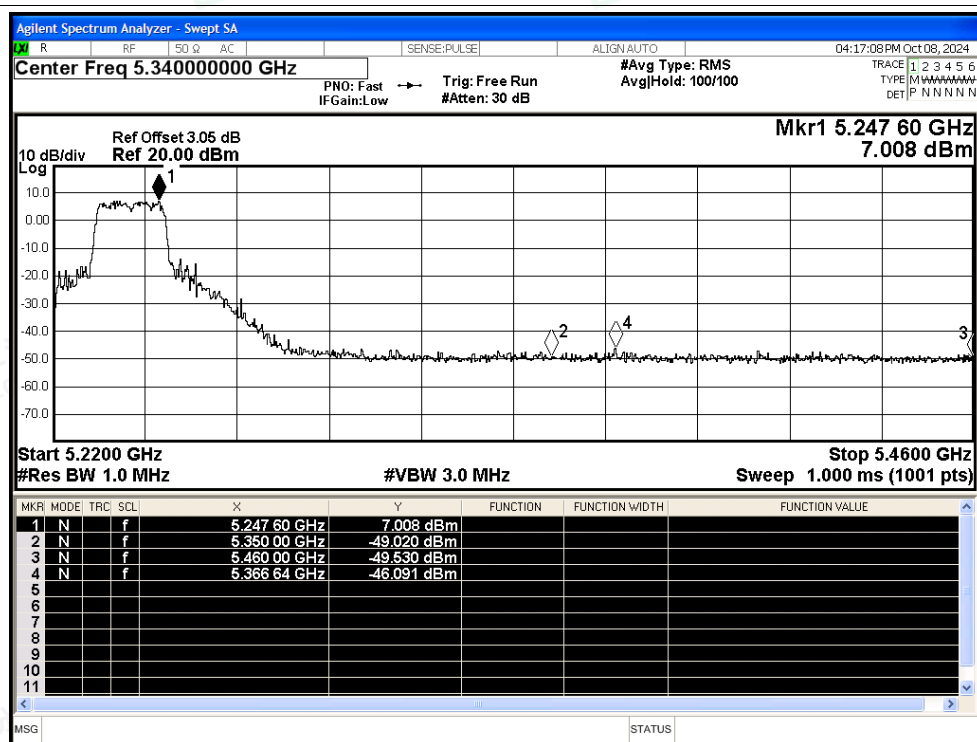


Restrict Band NVNT ac20 5240MHz Ant1 Average

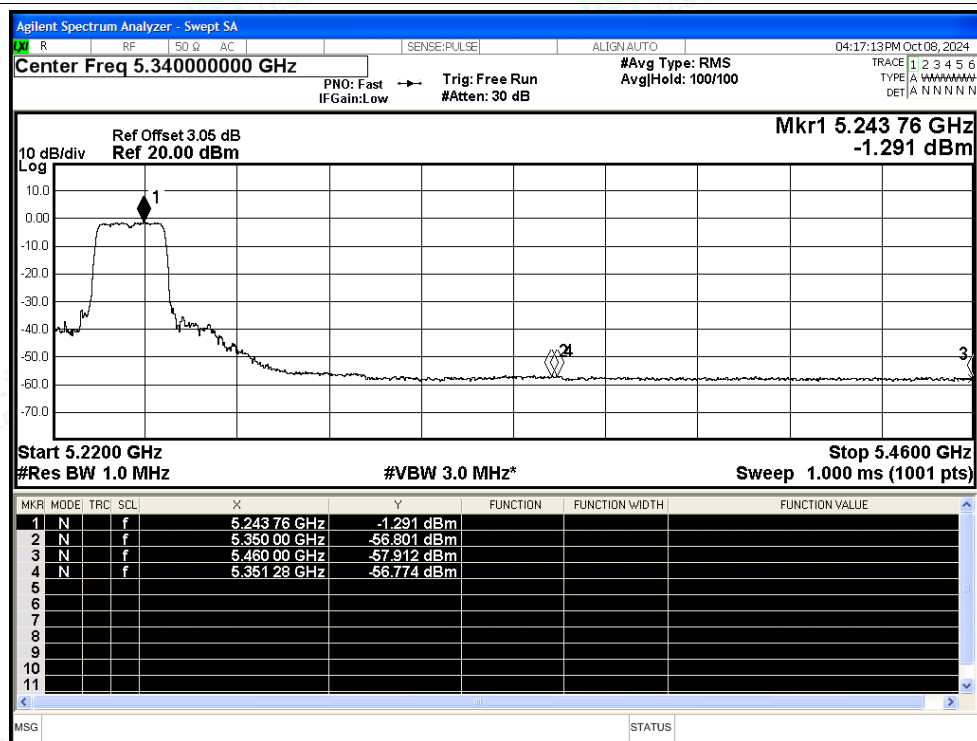




Restrict Band NVNT ac40 5190MHz Ant1 Peak

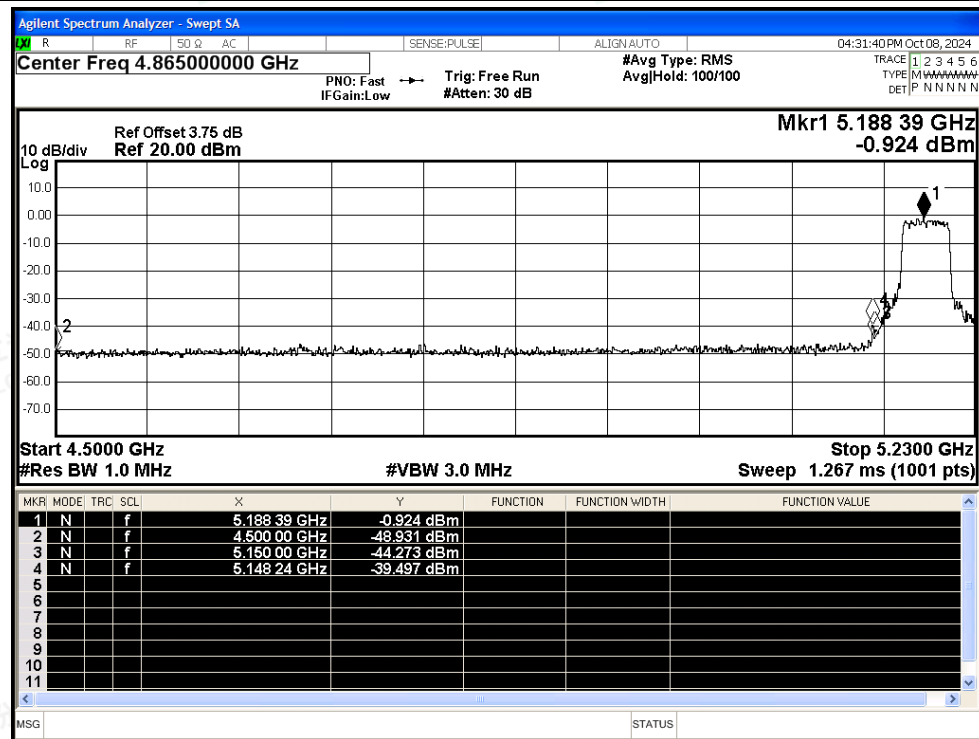


Restrict Band NVNT ac40 5190MHz Ant1 Average

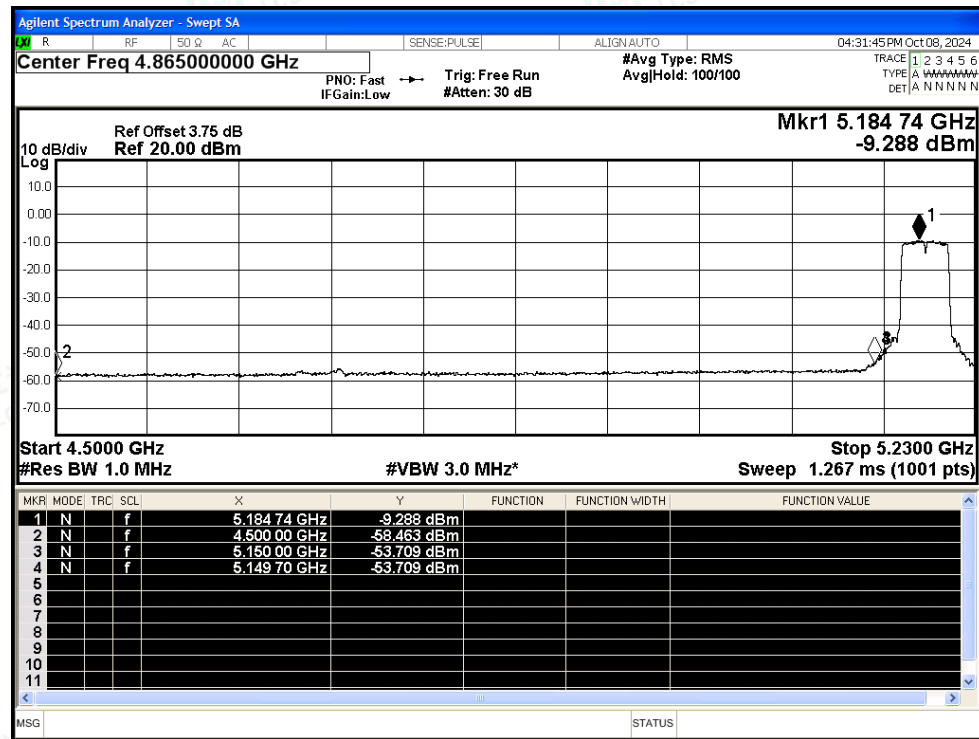






Restrict Band NVNT ac40 5230MHz Ant1 Peak

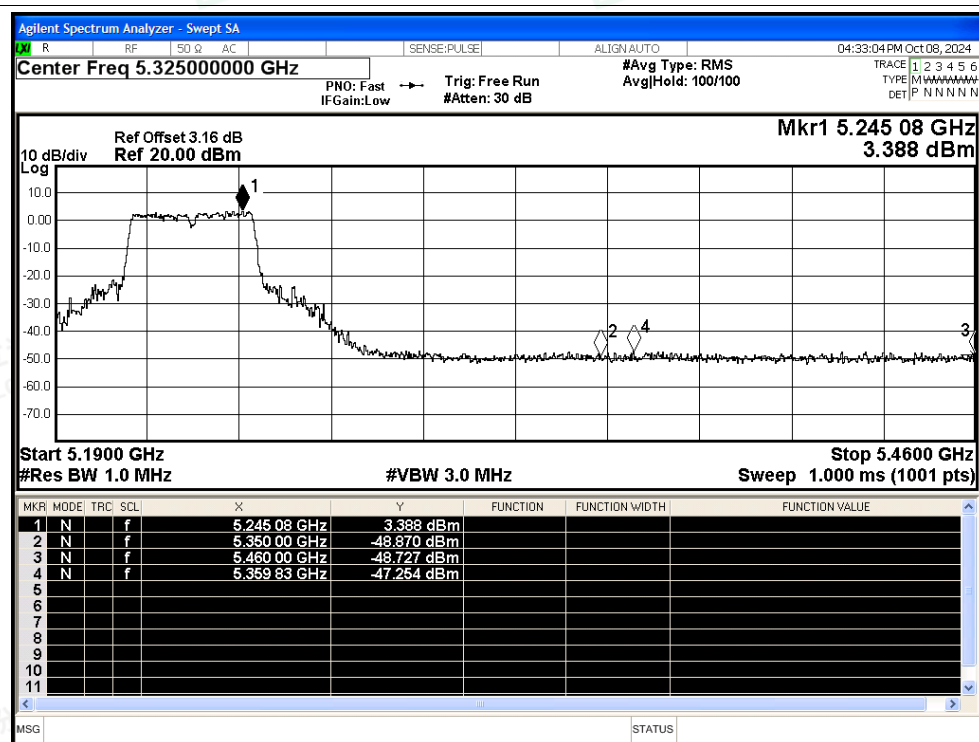


Restrict Band NVNT ac40 5230MHz Ant1 Average

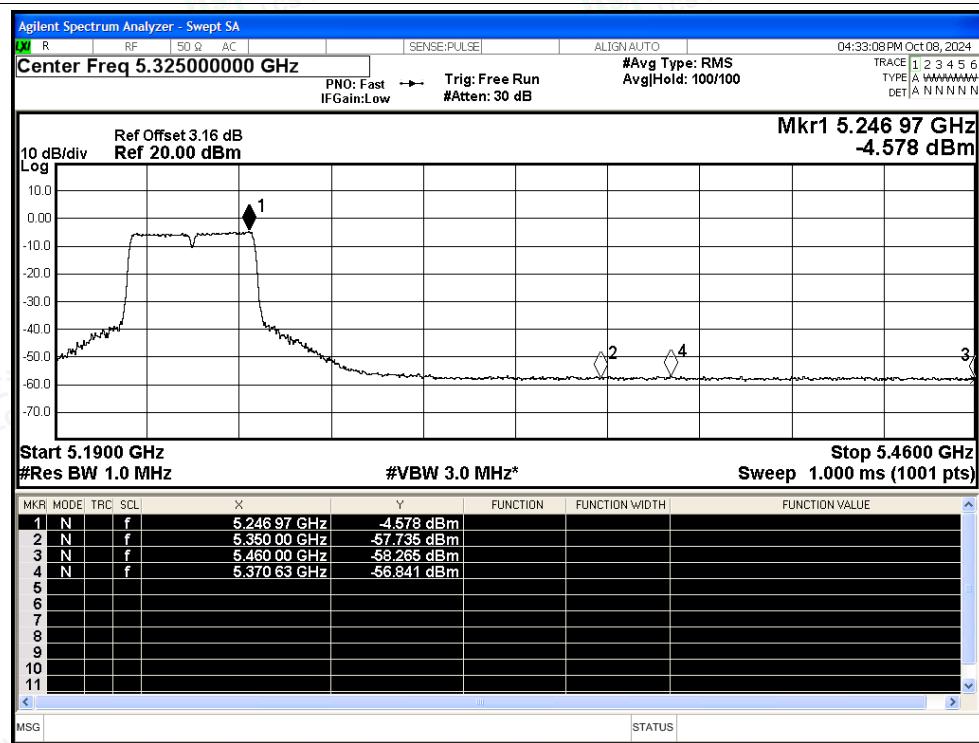

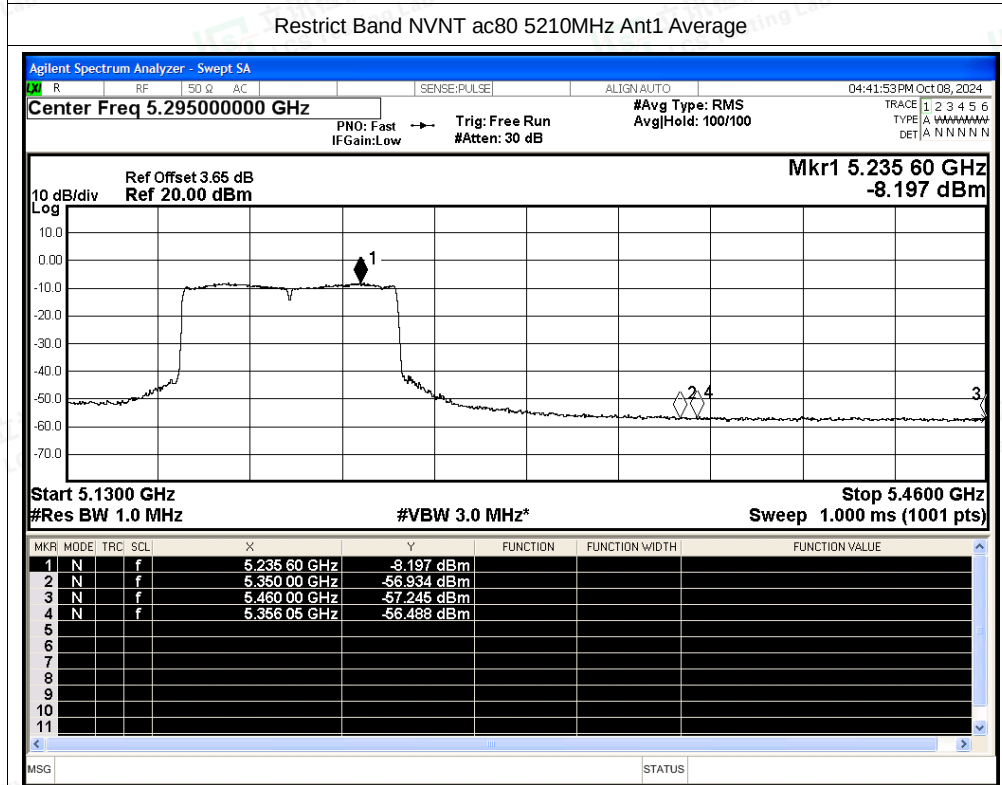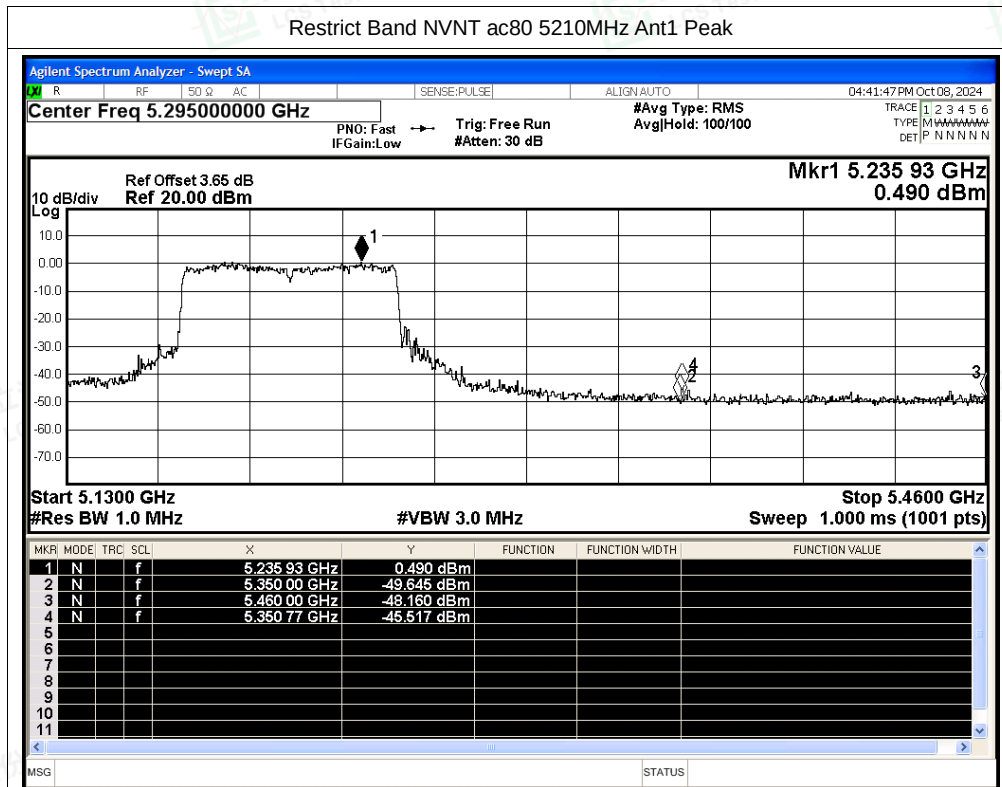






Restrict Band NVNT ac80 5210MHz Ant1 Peak

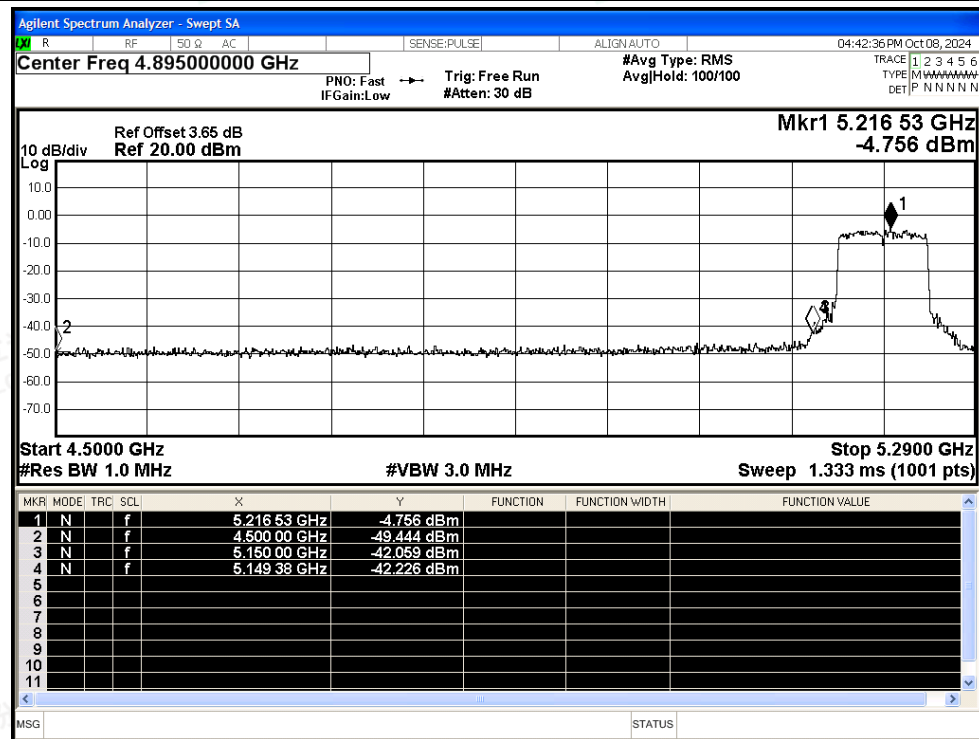


Restrict Band NVNT ac80 5210MHz Ant1 Average

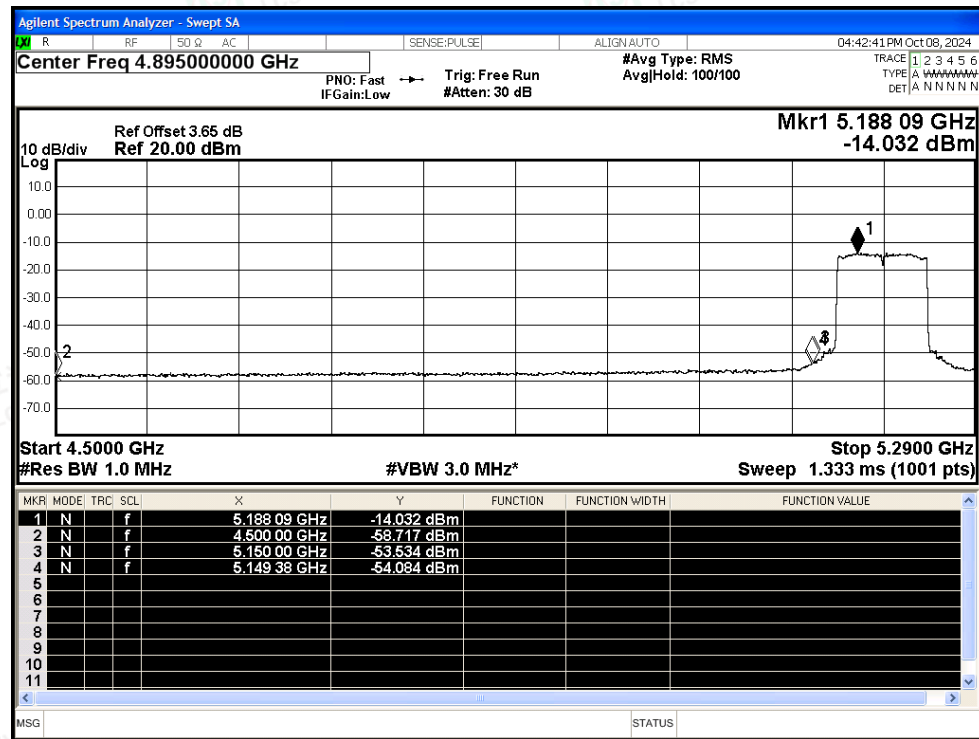

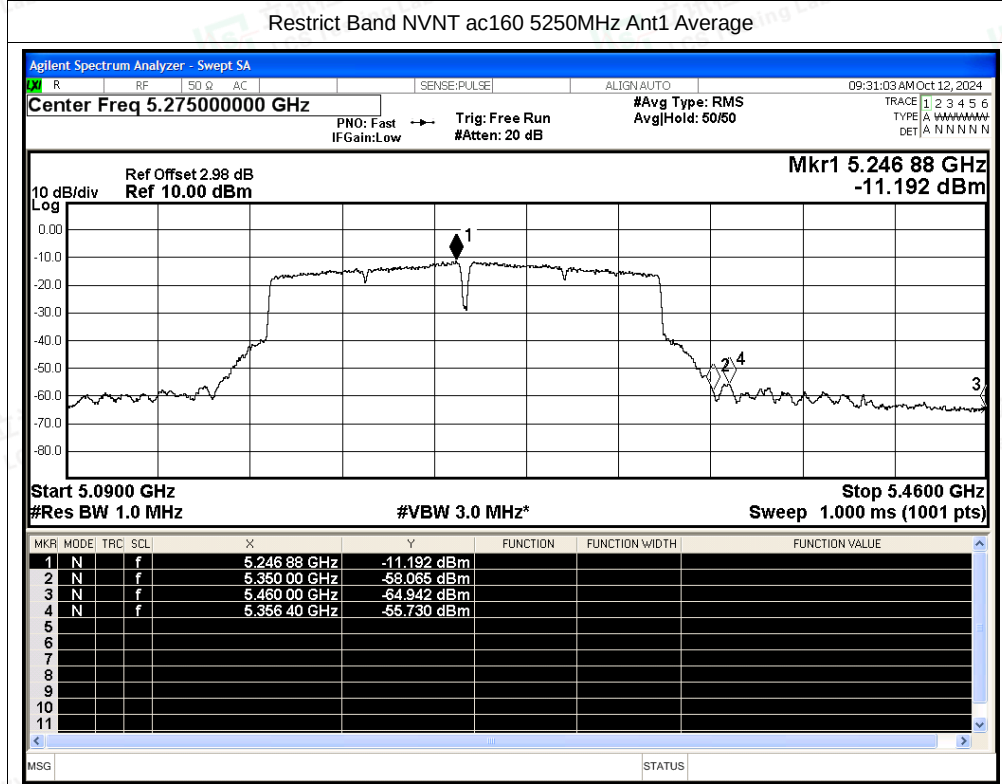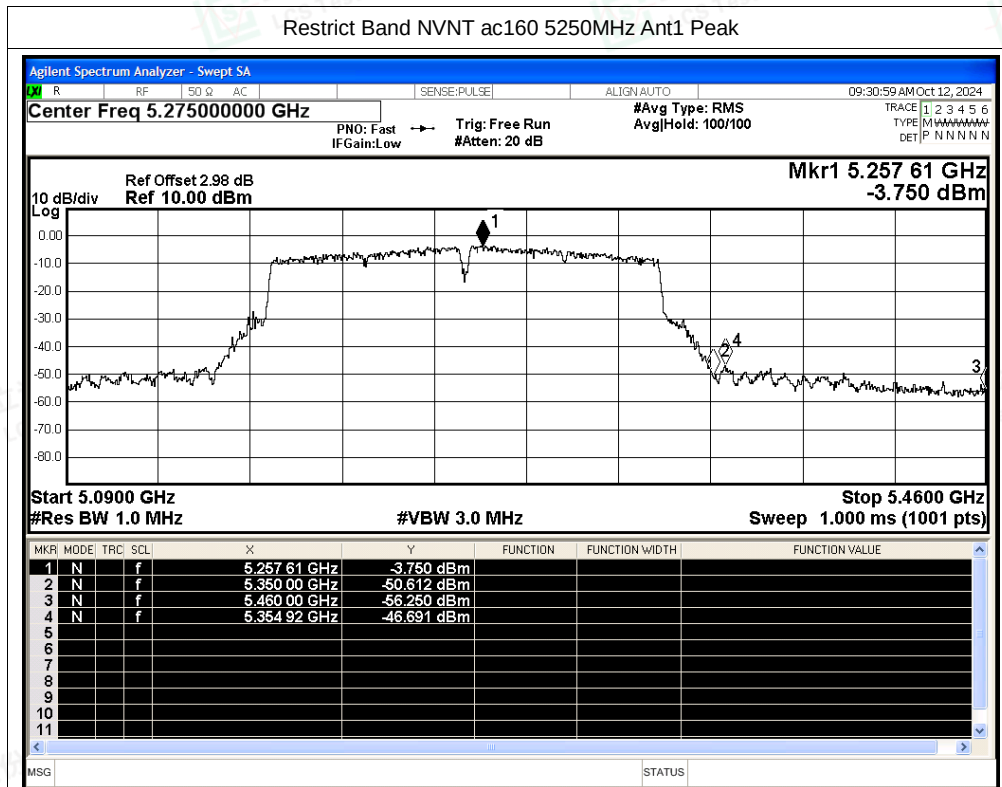




Restrict Band NVNT ac160 5250MHz Ant1 Peak

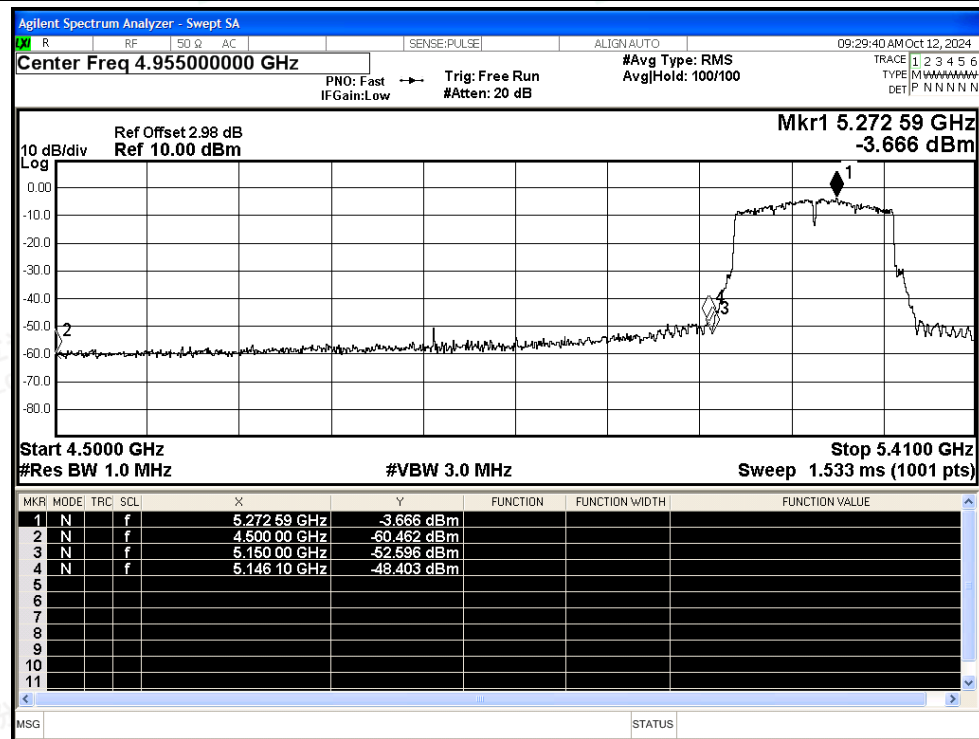


Restrict Band NVNT ac160 5250MHz Ant1 Average

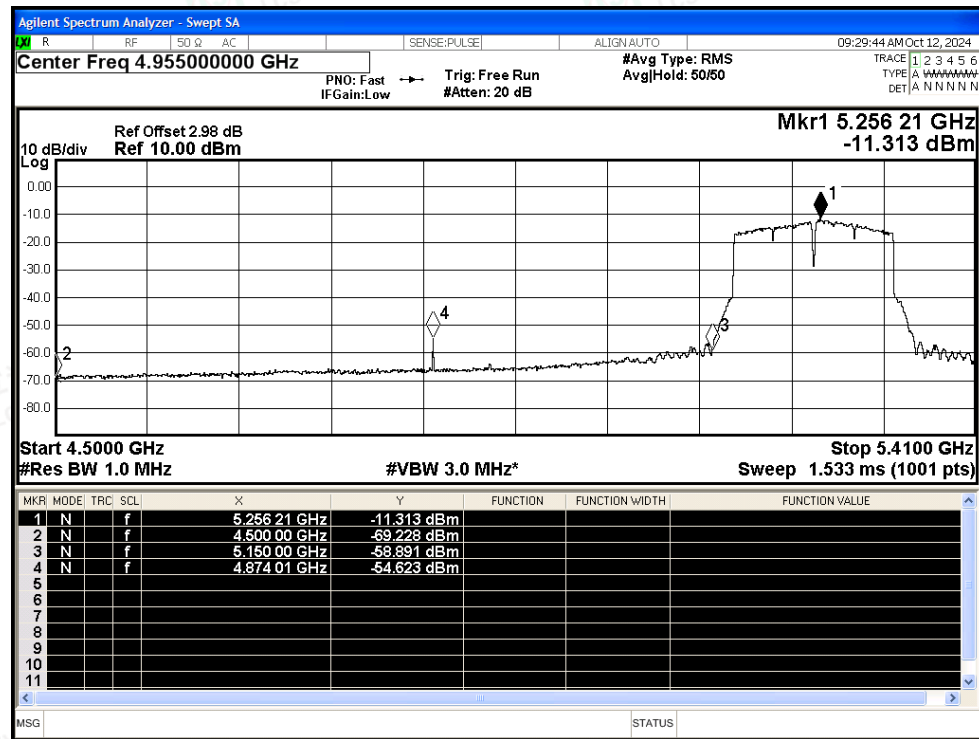




Restrict Band NVNT ax20 5180MHz Ant1 Peak

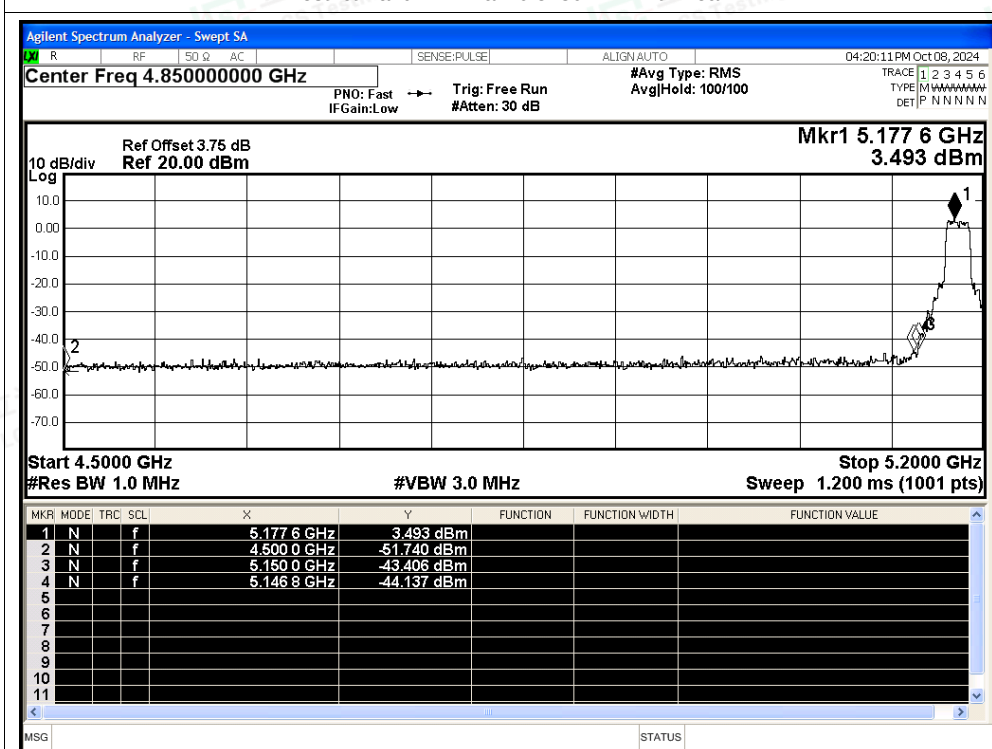


Restrict Band NVNT ax20 5180MHz Ant1 Average

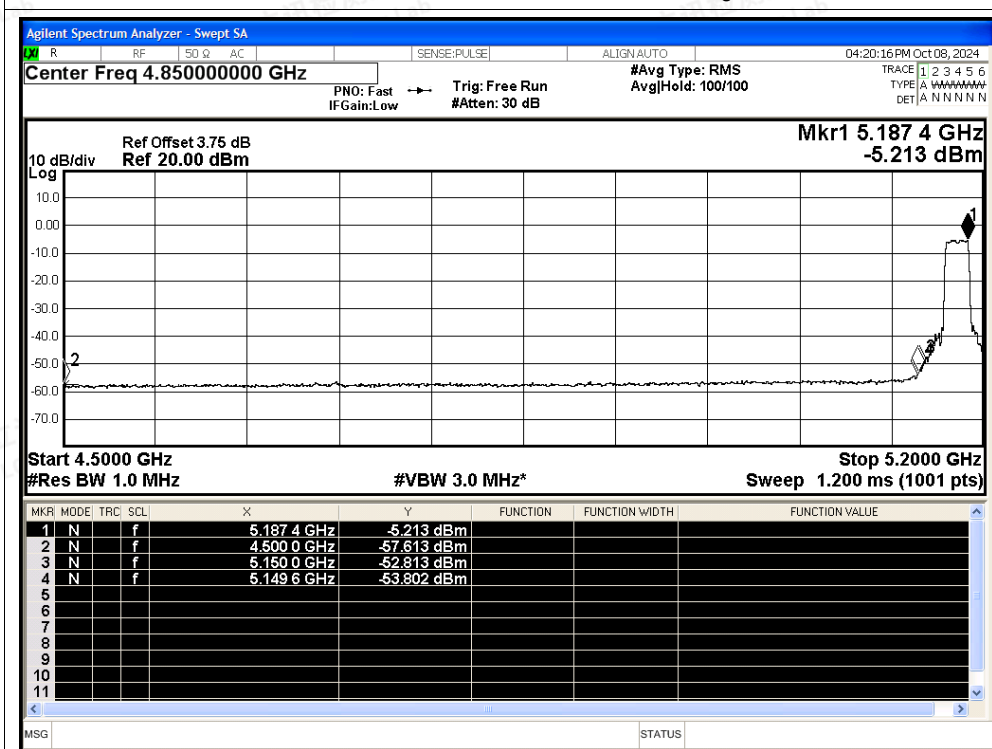


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

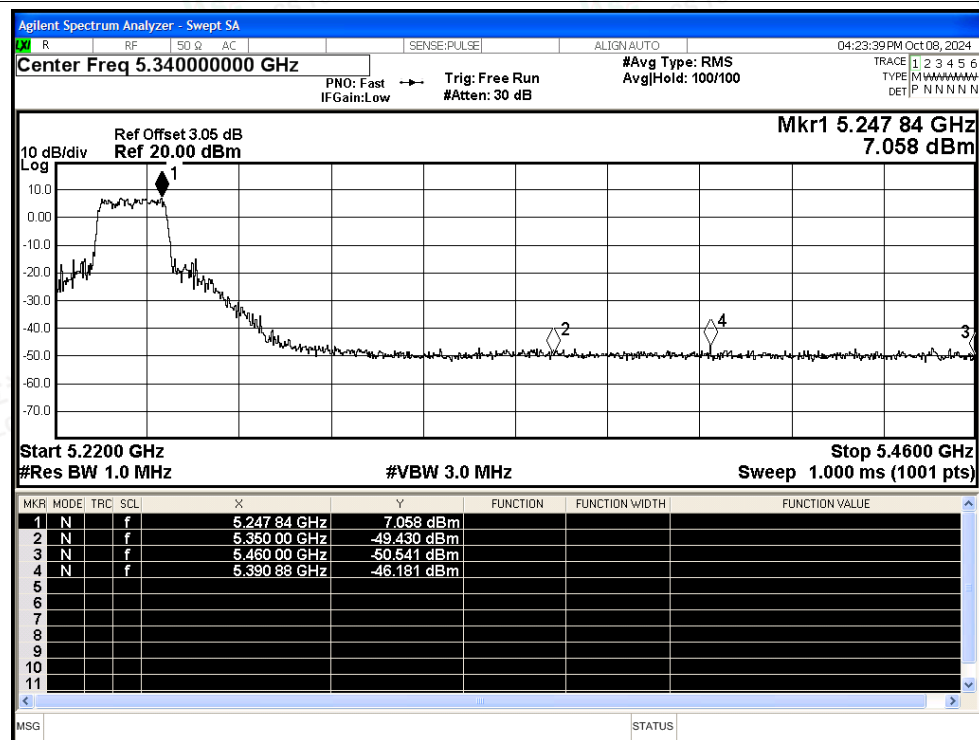


Restrict Band NVNT ax20 5240MHz Ant1 Average

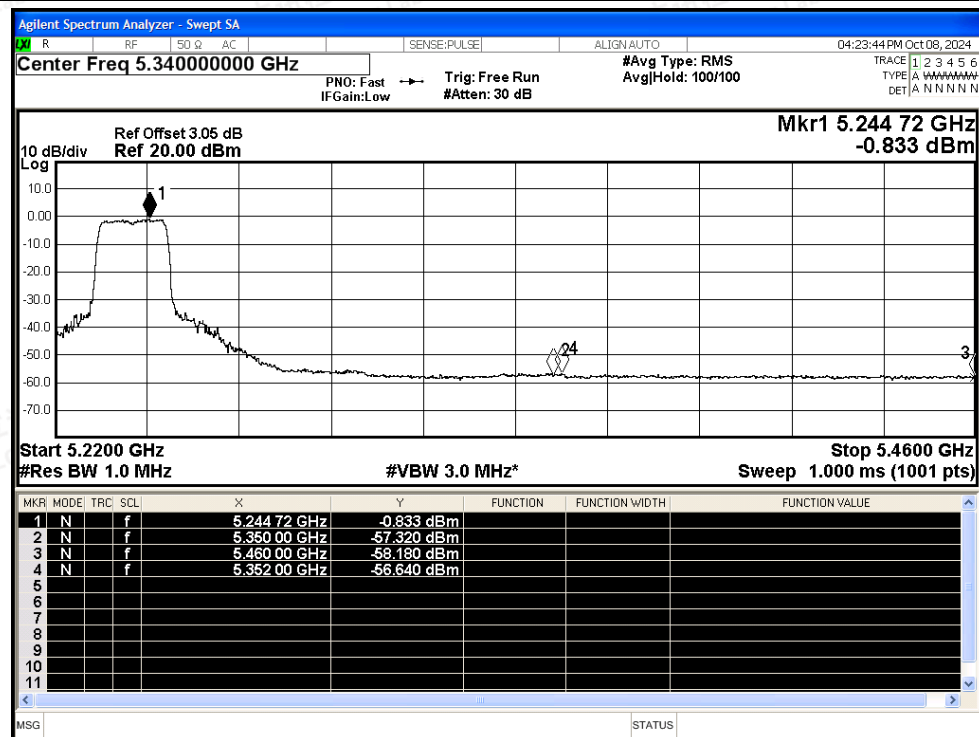


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

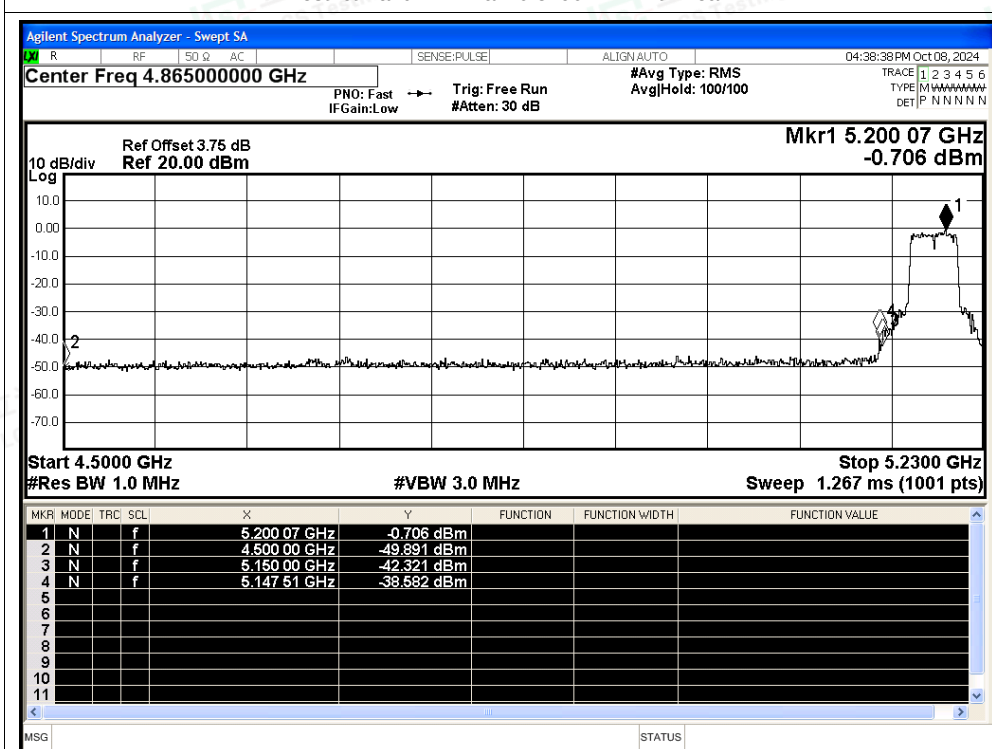


Restrict Band NVNT ax40 5190MHz Ant1 Average

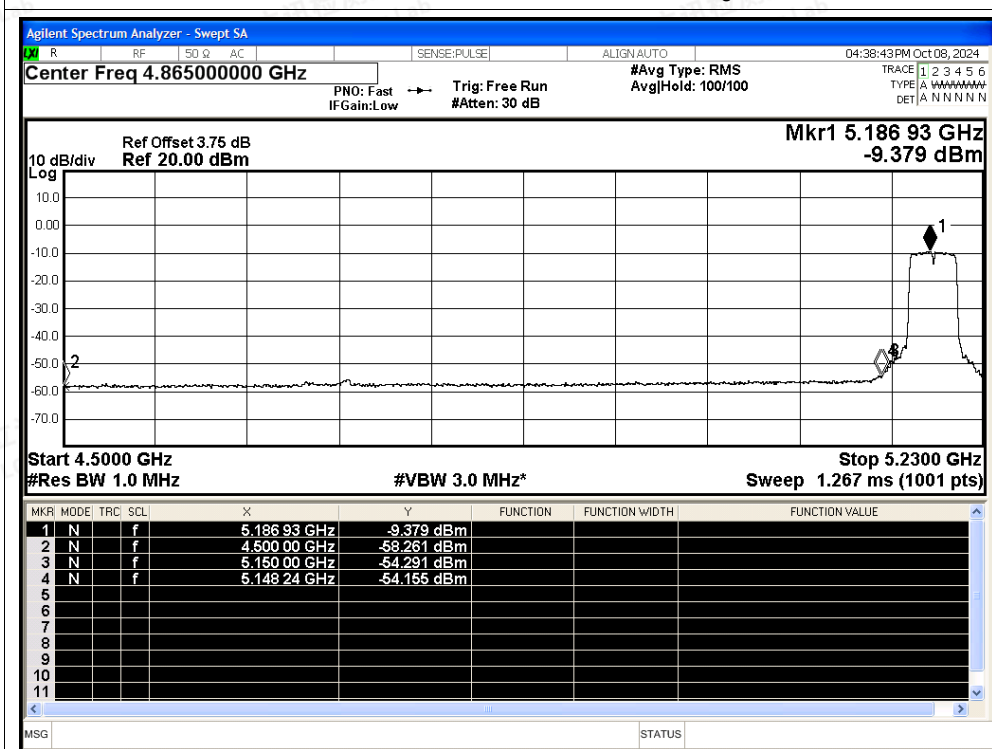


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

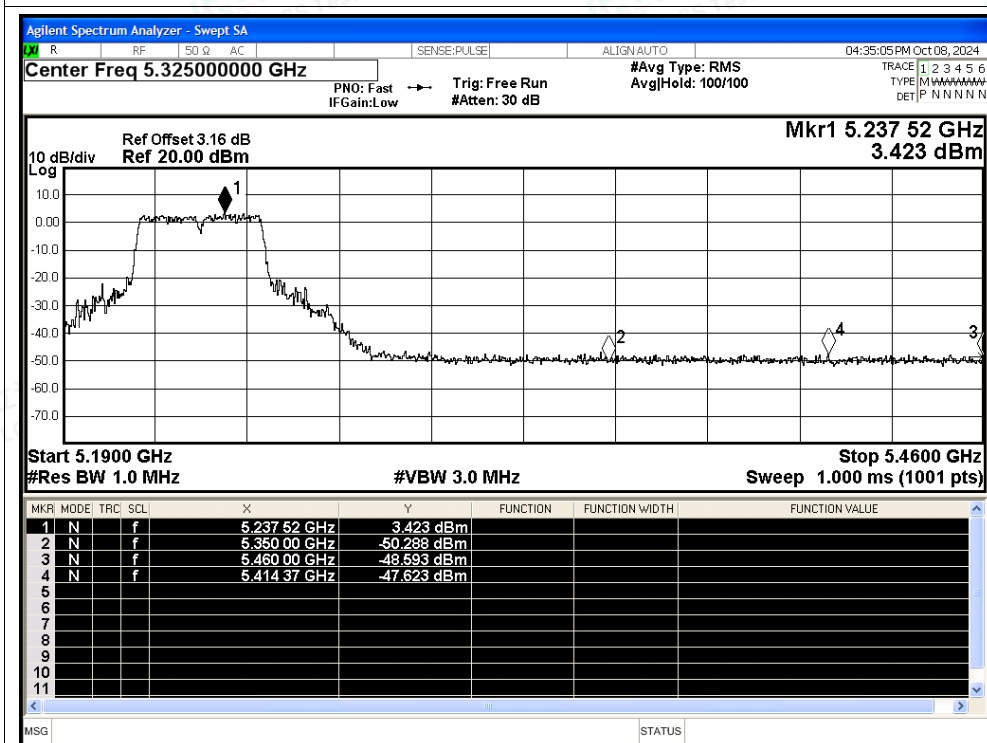


Restrict Band NVNT ax40 5230MHz Ant1 Average

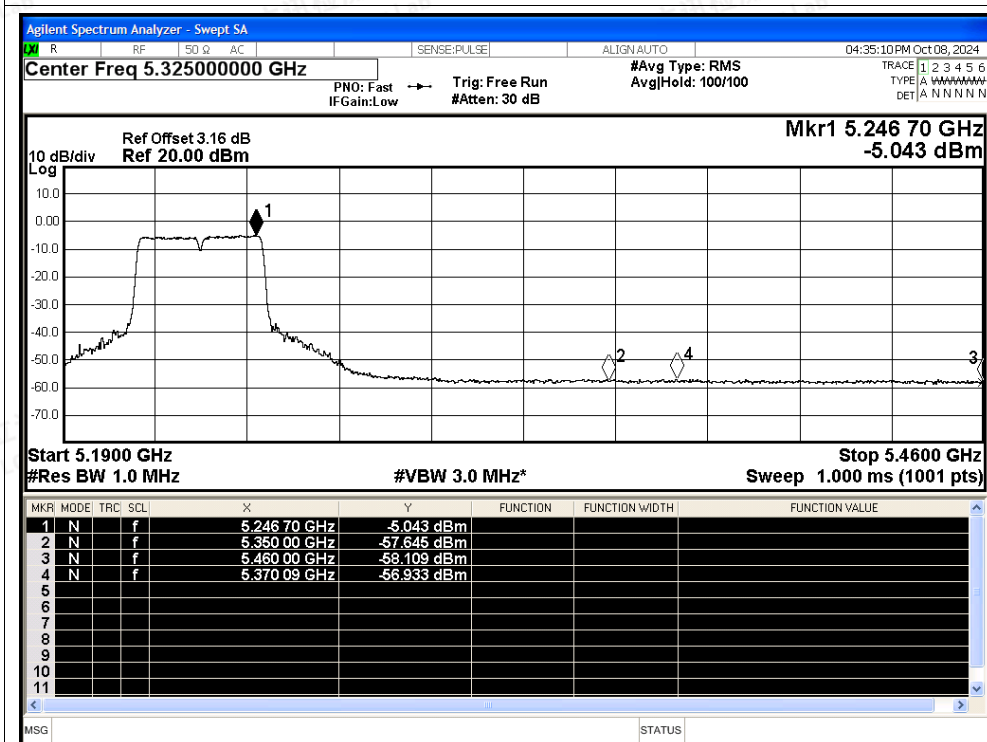


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

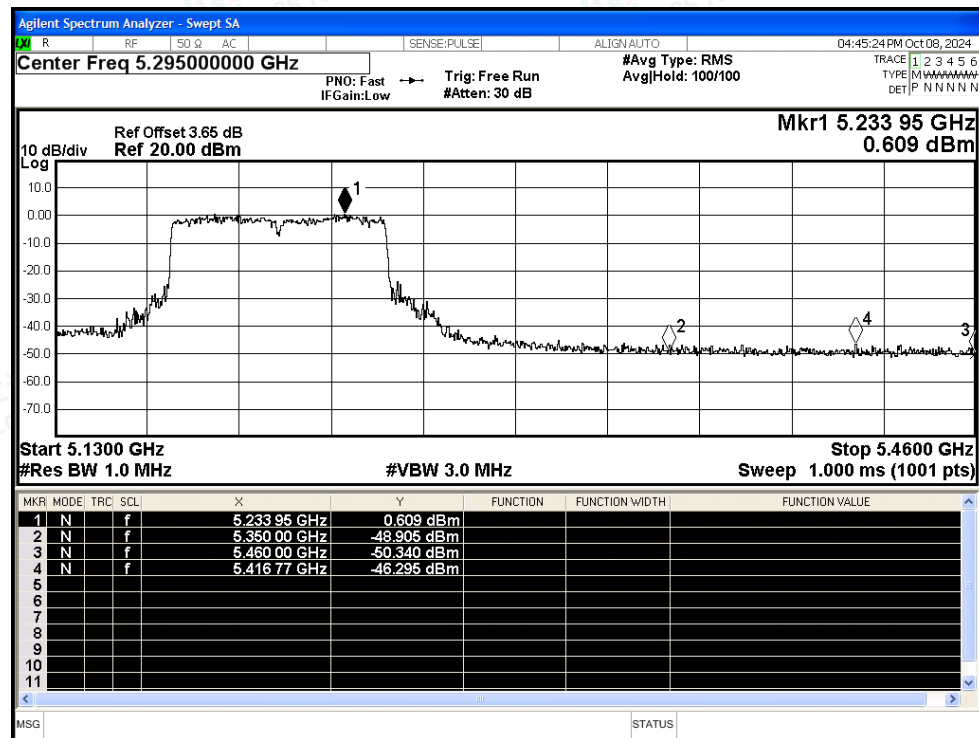


Restrict Band NVNT ax80 5210MHz Ant1 Average

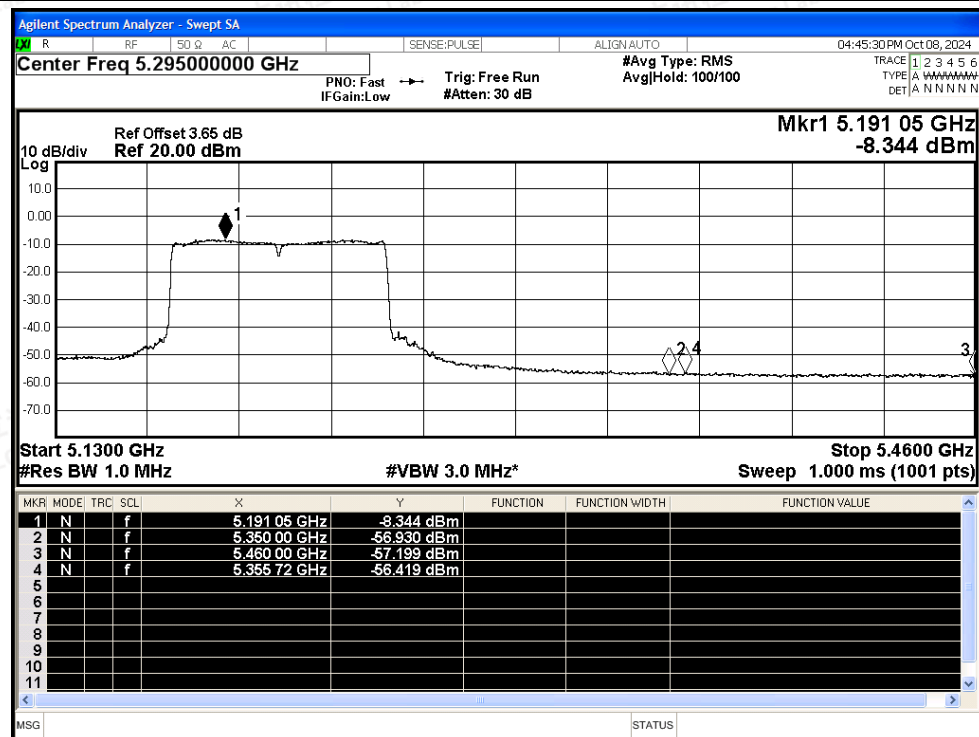




Restrict Band NVNT ax80 5210MHz Ant1 Peak

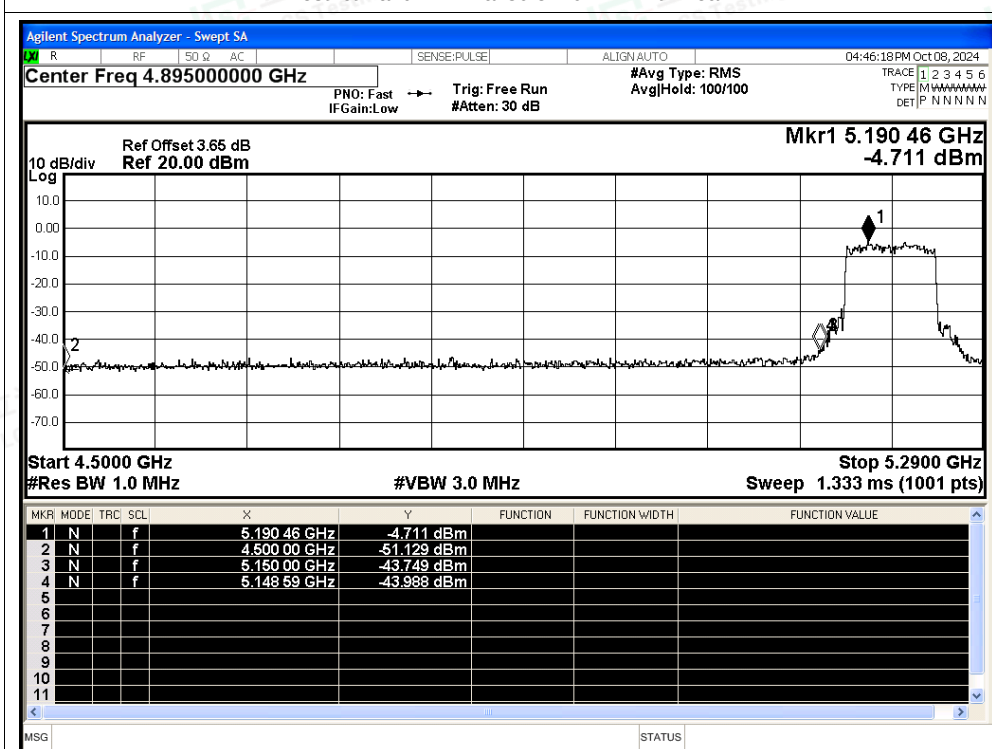


Restrict Band NVNT ax80 5210MHz Ant1 Average

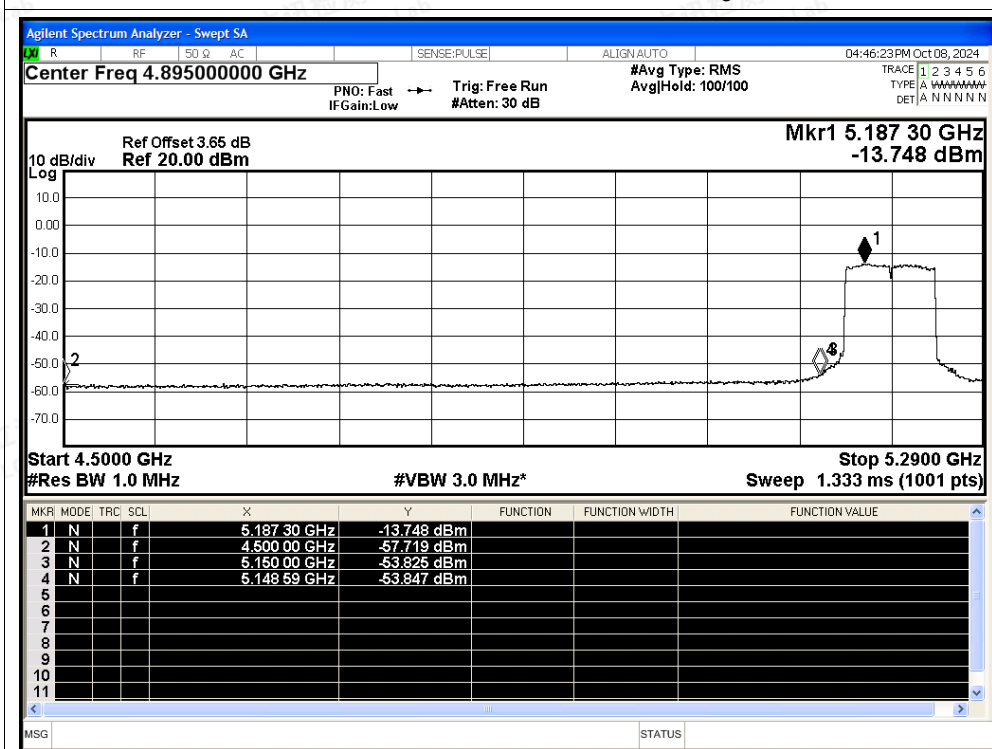




Restrict Band NVNT ax160 5250MHz Ant1 Peak

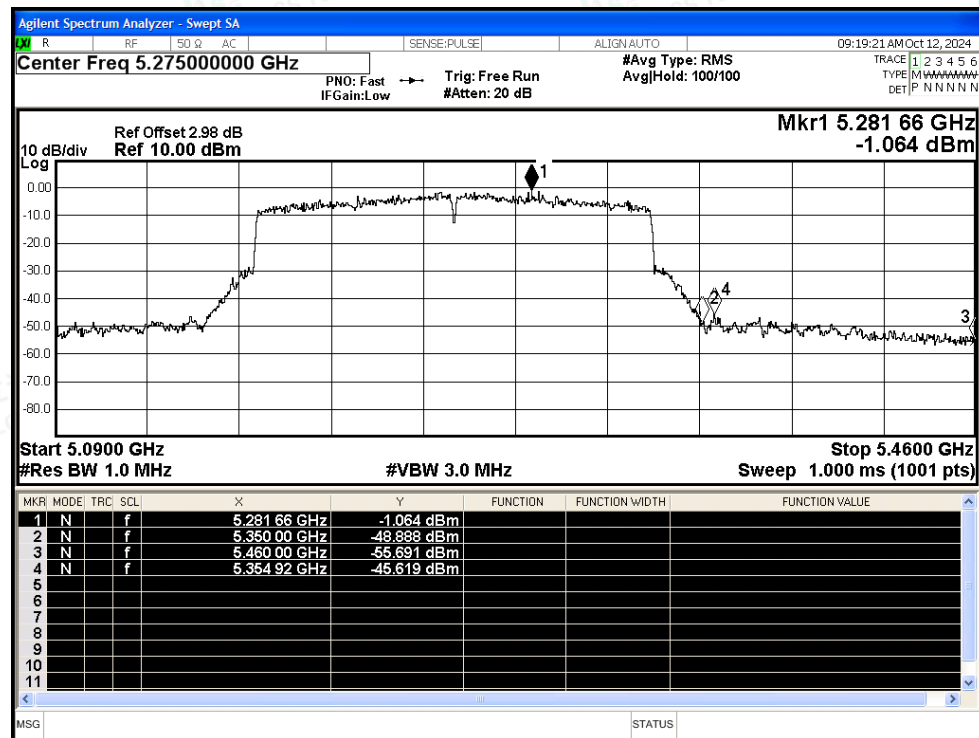


Restrict Band NVNT ax160 5250MHz Ant1 Average

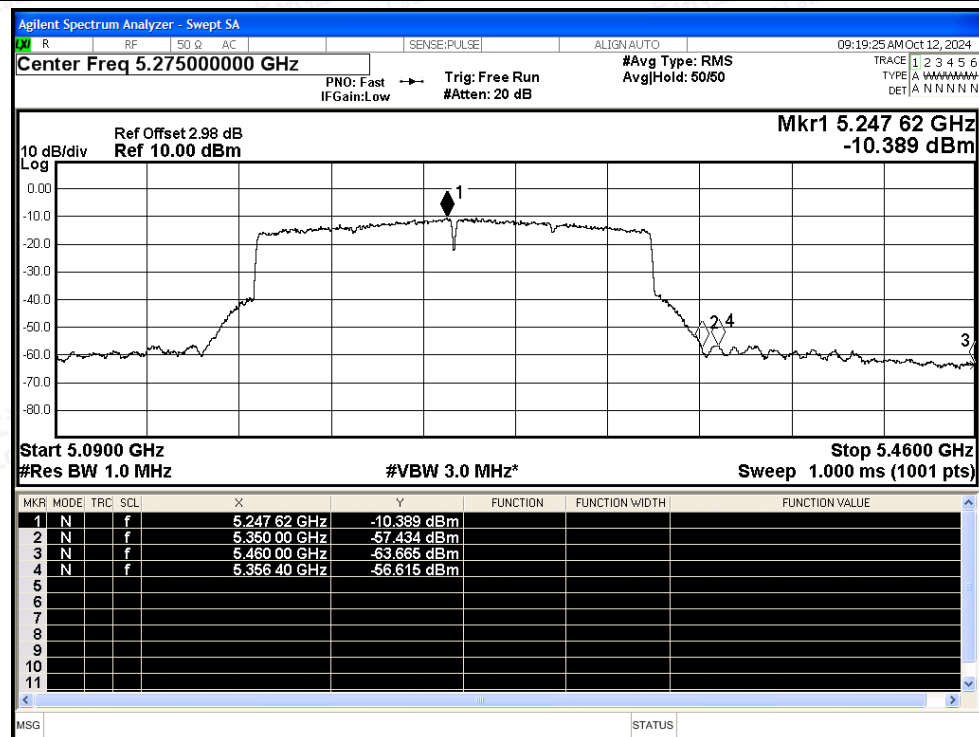


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

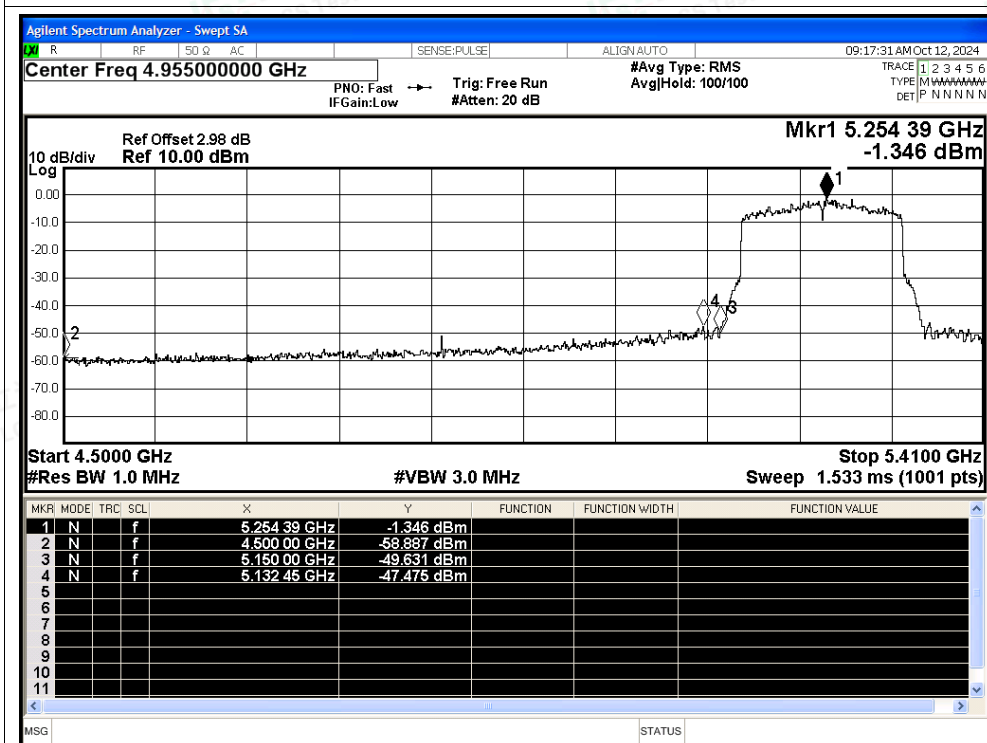

Restrict Band NVNT ax160 5250MHz Ant1 Average

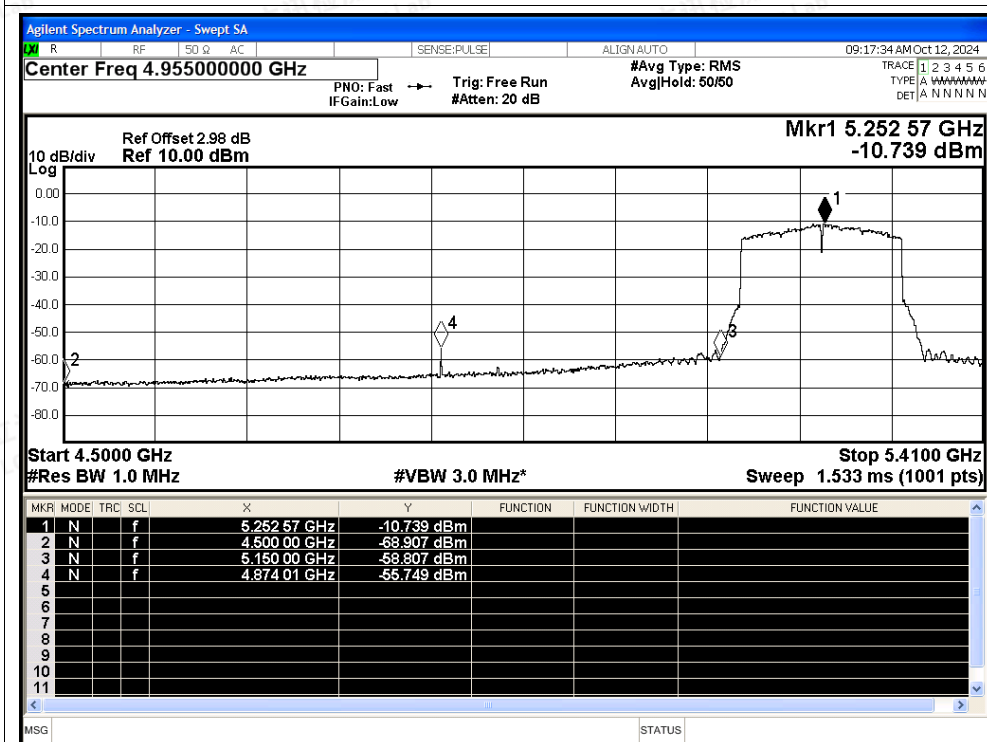

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.56	3.09	-	47.76	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58.53	3.09	0.24	40.03	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-37.77	3.09	-	60.55	Peak	68.2	Pass
NVNT	a	5180	Ant2	5148.2	-52.45	3.09	0.24	46.11	Average	54	Pass
NVNT	a	5180	Ant2	5150	-37.87	3.09	-	60.45	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-52.65	3.09	0.24	45.91	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50.66	3.09	-	47.66	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.41	3.09	0.24	41.15	Average	54	Pass
NVNT	a	5240	Ant2	5373.6	-47.14	3.09	-	51.18	Peak	68.2	Pass
NVNT	a	5240	Ant2	5375.04	-57.01	3.09	0.24	41.55	Average	54	Pass
NVNT	a	5240	Ant2	5460	-50.05	3.09	-	48.27	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-58.19	3.09	0.24	40.37	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-49.54	3.09	-	48.78	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.44	3.09	0.12	40	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-43.11	3.09	-	55.21	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5148.9	-54.64	3.09	0.12	43.8	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-45.46	3.09	-	52.86	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-55.02	3.09	0.12	43.42	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-49.05	3.09	-	49.27	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.63	3.09	0.12	40.81	Average	54	Pass
NVNT	n20	5240	Ant2	5352.48	-47.23	3.09	-	51.09	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5396.64	-56.92	3.09	0.12	41.52	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.25	3.09	-	49.07	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-58.24	3.09	0.12	40.2	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-49.69	3.09	-	48.63	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.29	3.09	0.12	40.15	Average	54	Pass
NVNT	n40	5190	Ant2	5146.78	-43.34	3.09	-	54.98	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-54.48	3.09	0.12	43.96	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-43.68	3.09	-	54.64	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-54.48	3.09	0.12	43.96	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-49.49	3.09	-	48.83	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-57.27	3.09	0.12	41.17	Average	54	Pass
NVNT	n40	5230	Ant2	5392.5	-47.28	3.09	-	51.04	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5367.39	-57.19	3.09	0.12	41.25	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-50.05	3.09	-	48.27	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-58.3	3.09	0.12	40.14	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-49.79	3.09	-	48.53	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-58.21	3.09	0.12	40.23	Average	54	Pass
NVNT	ac20	5180	Ant2	5148.2	-39.43	3.09	-	58.89	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-52.03	3.09	0.12	46.41	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-41.15	3.09	-	57.17	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-52.59	3.09	0.12	45.85	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-50.95	3.09	-	47.37	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.45	3.09	0.12	40.99	Average	54	Pass
NVNT	ac20	5240	Ant2	5379.12	-46.35	3.09	-	51.97	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5380.08	-57.05	3.09	0.12	41.39	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.73	3.09	-	47.59	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.77	3.09	0.12	40.67	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.54	3.09	-	47.78	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.08	3.09	0.12	40.36	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.24	-41.85	3.09	-	56.47	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-54.16	3.09	0.12	44.28	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-43.59	3.09	-	54.73	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-54.16	3.09	0.12	44.28	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-49.37	3.09	-	48.95	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-58	3.09	0.12	40.44	Average	54	Pass
NVNT	ac40	5230	Ant2	5401.14	-46.57	3.09	-	51.75	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5390.07	-56.99	3.09	0.12	41.45	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.84	3.09	-	48.48	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-58.24	3.09	0.12	40.2	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-49.65	3.09	-	48.67	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-56.96	3.09	0.25	41.61	Average	54	Pass
NVNT	ac80	5210	Ant2	5353.41	-46.3	3.09	-	52.02	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5351.76	-56.1	3.09	0.25	42.47	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.72	3.09	-	48.6	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.52	3.09	0.25	41.05	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-50.53	3.09	-	47.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.29	3.09	0.25	40.28	Average	54	Pass
NVNT	ac80	5210	Ant2	5147.8	-43.66	3.09	-	54.66	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5147.8	-53.62	3.09	0.25	44.95	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.8	3.09	-	55.52	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-53.24	3.09	0.25	45.33	Average	54	Pass
NVNT	ac160	5250	Ant2	5350	-50.42	3.09	-	47.9	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-57.78	3.09	0.4	40.94	Average	54	Pass
NVNT	ac160	5250	Ant2	5356.03	-48.6	3.09	-	49.72	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5354.55	-57.2	3.09	0.4	41.52	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-56.95	3.09	-	41.37	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac160	5250	Ant2	5460	-65.88	3.09	0.4	32.84	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-58.89	3.09	-	39.43	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-68.65	3.09	0.4	30.07	Average	54	Pass
NVNT	ac160	5250	Ant2	5146.1	-47.78	3.09	-	50.54	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5144.28	-57.42	3.09	0.4	41.3	Average	54	Pass
NVNT	ac160	5250	Ant2	5150	-54.47	3.09	-	43.85	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-60.52	3.09	0.4	38.2	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-48.97	3.09	-	49.35	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-58.38	3.09	0.12	40.06	Average	54	Pass
NVNT	ax20	5180	Ant2	5148.9	-40.21	3.09	-	58.11	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5147.5	-52.73	3.09	0.12	45.71	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-41.15	3.09	-	57.17	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-52.58	3.09	0.12	45.86	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-50.54	3.09	-	47.78	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-57.46	3.09	0.12	40.98	Average	54	Pass
NVNT	ax20	5240	Ant2	5386.56	-46.99	3.09	-	51.33	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5359.92	-57.03	3.09	0.12	41.41	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-50.43	3.09	-	47.89	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-58.16	3.09	0.12	40.28	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-50.3	3.09	-	48.02	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.27	3.09	0.12	40.17	Average	54	Pass
NVNT	ax40	5190	Ant2	5146.78	-39.68	3.09	-	58.64	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5148.24	-52.64	3.09	0.12	45.8	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-43.65	3.09	-	54.67	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-53.1	3.09	0.12	45.34	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-49.54	3.09	-	48.78	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-57.99	3.09	0.12	40.45	Average	54	Pass
NVNT	ax40	5230	Ant2	5387.1	-47.56	3.09	-	50.76	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350.65	-56.82	3.09	0.12	41.62	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-51.1	3.09	-	47.22	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-58.31	3.09	0.12	40.13	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-48.68	3.09	-	49.64	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-57.84	3.09	0.25	40.73	Average	54	Pass
NVNT	ax80	5210	Ant2	5404.89	-46.66	3.09	-	51.66	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5363.64	-56.45	3.09	0.25	42.12	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-49.54	3.09	-	48.78	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-57.19	3.09	0.25	41.38	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-52.23	3.09	-	46.09	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.57	3.09	0.25	40	Average	54	Pass
NVNT	ax80	5210	Ant2	5149.38	-41.7	3.09	-	56.62	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ax80	5210	Ant2	5147.8	-54.37	3.09	0.25	44.2	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-42.99	3.09	-	55.33	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-54.39	3.09	0.25	44.18	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-51.32	3.09	-	47	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5350	-59.9	3.09	0.5	38.92	Average	54	Pass
NVNT	ax160	5250	Ant2	5362.32	-49.1	3.09	-	49.22	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5371.57	-57.98	3.09	0.5	40.84	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-57.86	3.09	-	40.46	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-65.62	3.09	0.5	33.2	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-61.19	3.09	-	37.13	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-68.39	3.09	0.5	30.43	Average	54	Pass
NVNT	ax160	5250	Ant2	5146.1	-49.36	3.09	-	48.96	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5128.81	-58.94	3.09	0.5	39.88	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-53.61	3.09	-	44.71	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-61.45	3.09	0.5	37.37	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

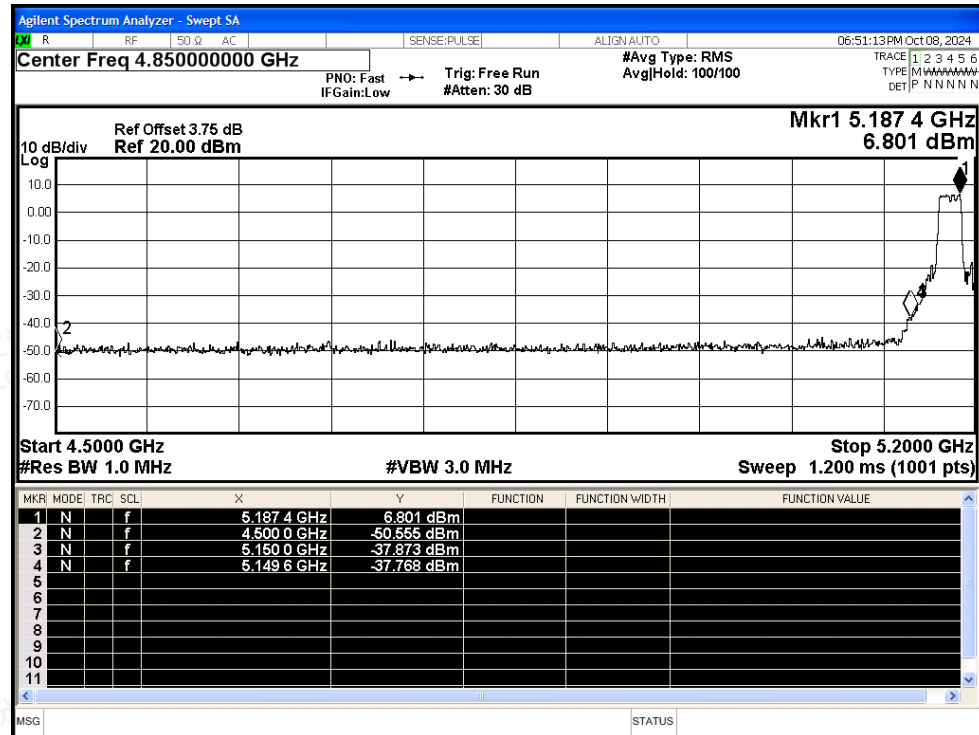


Restrict Band NVNT a 5180MHz Ant2 Average

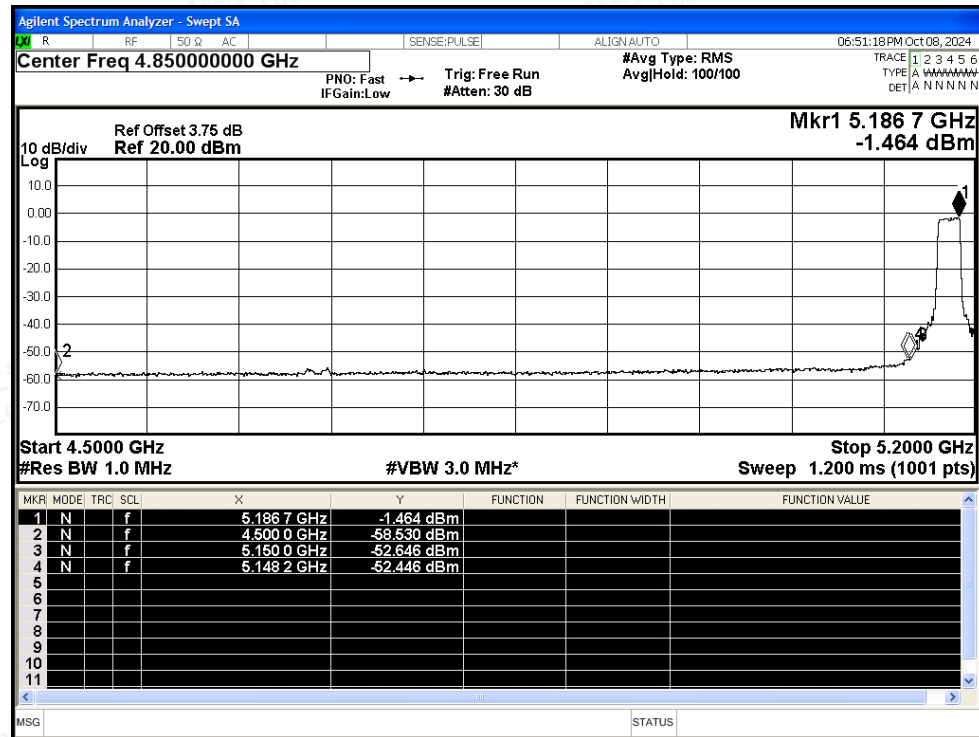




Restrict Band NVNT a 5240MHz Ant2 Peak

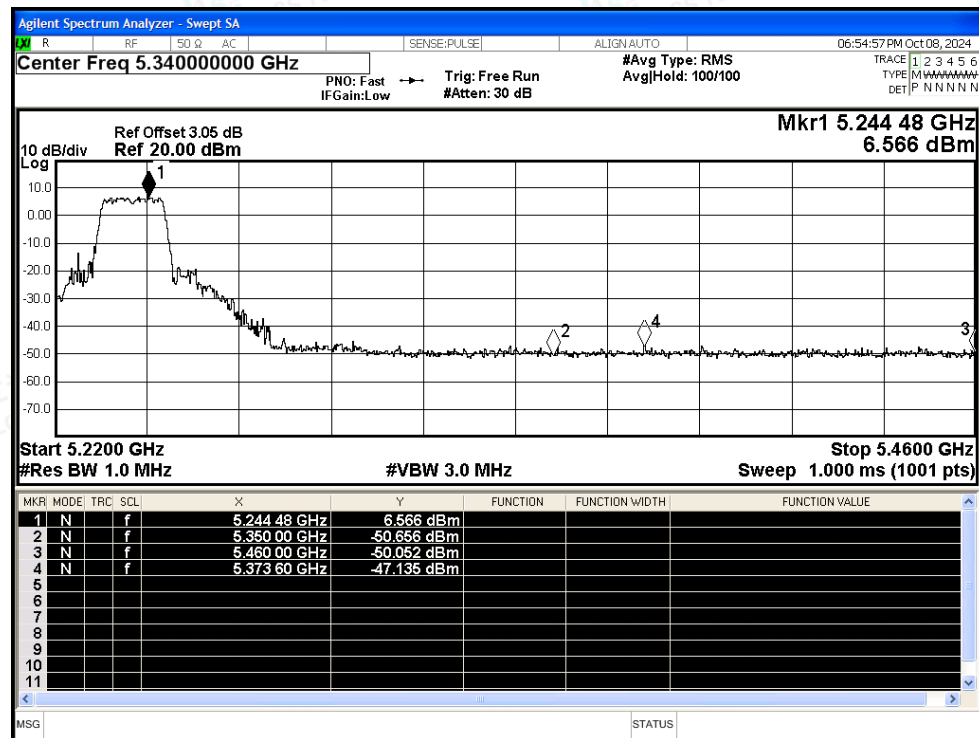


Restrict Band NVNT a 5240MHz Ant2 Average

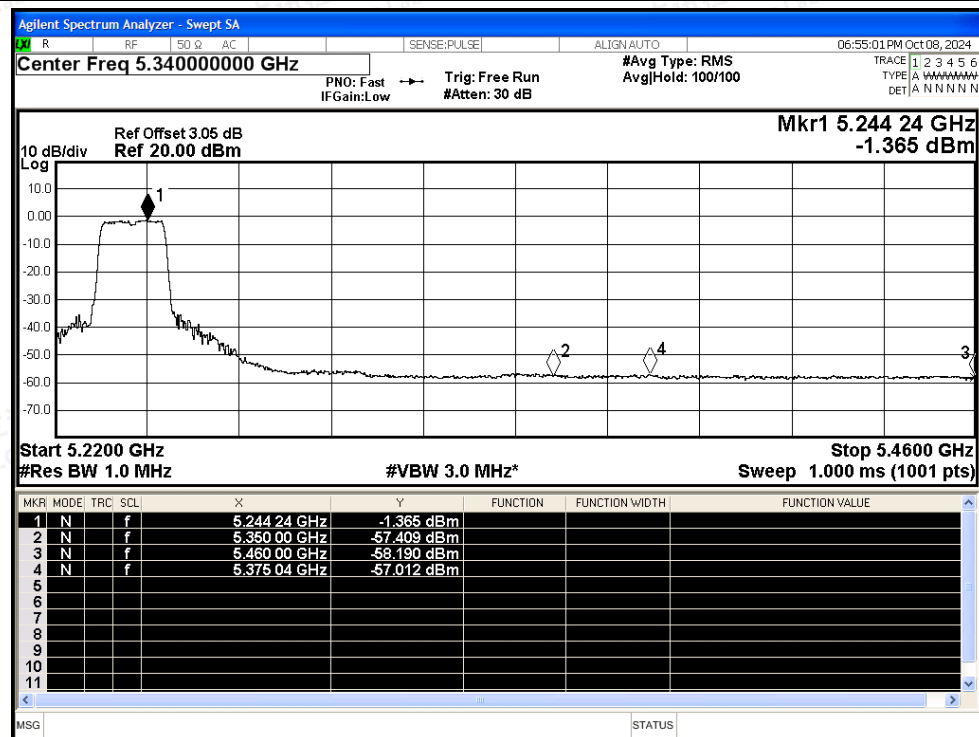


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

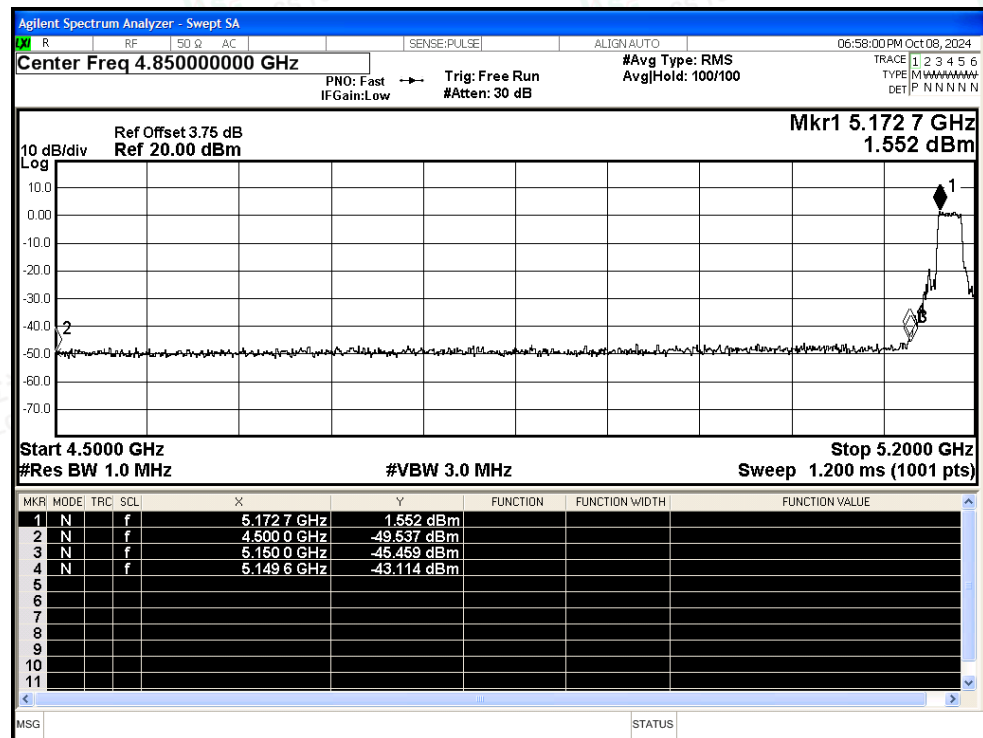


Restrict Band NVNT n20 5180MHz Ant2 Average

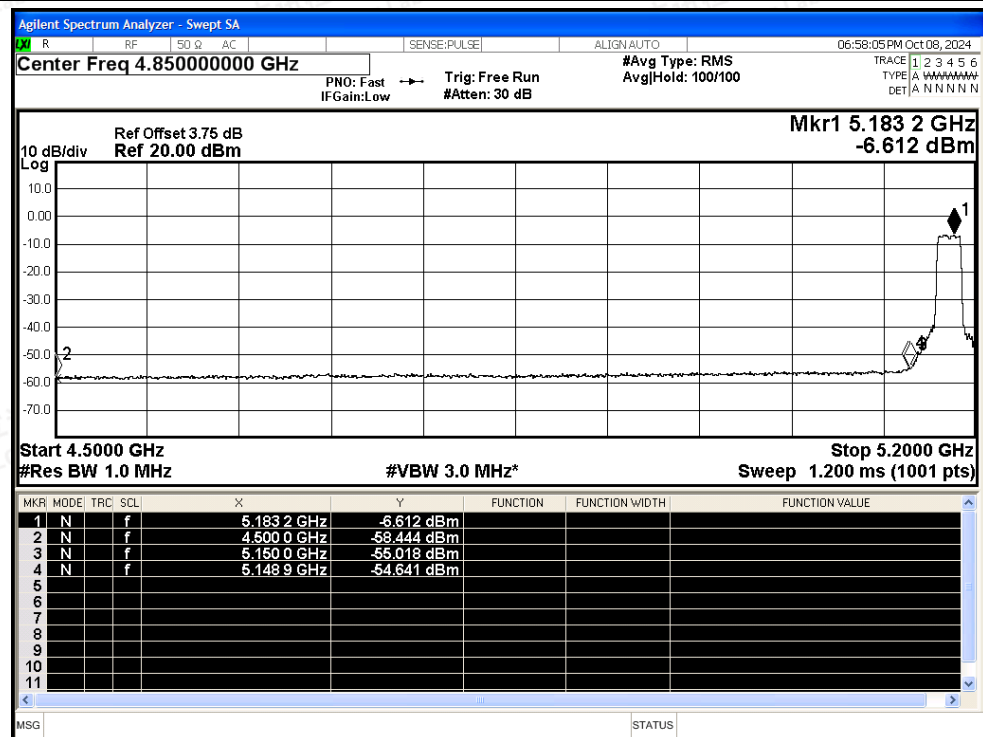


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

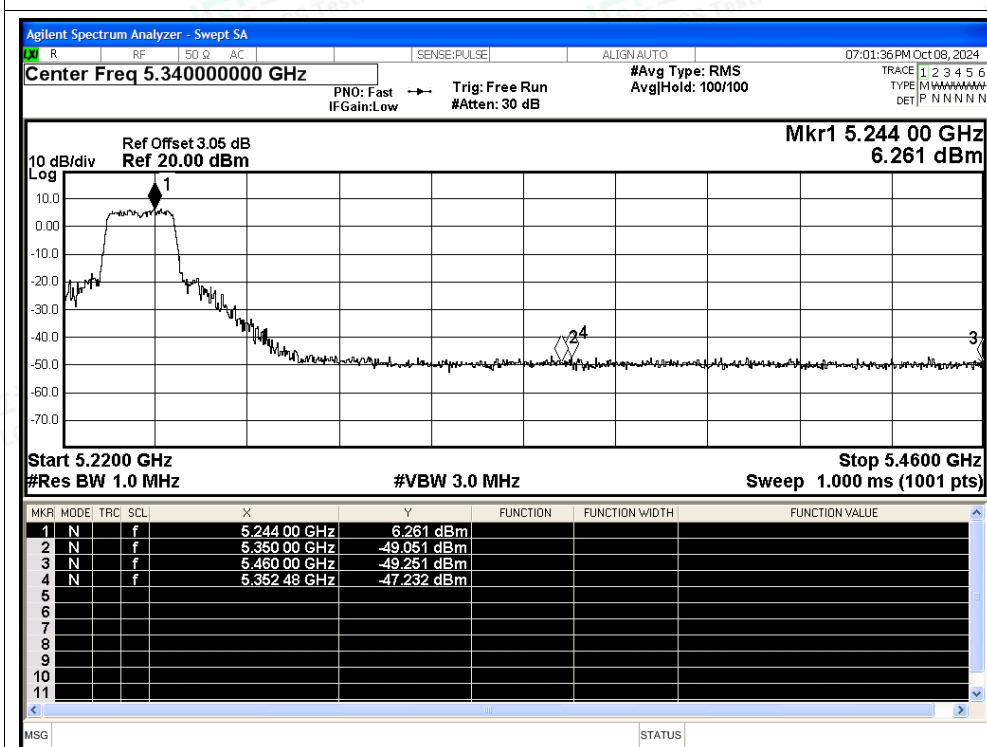


Restrict Band NVNT n20 5240MHz Ant2 Average

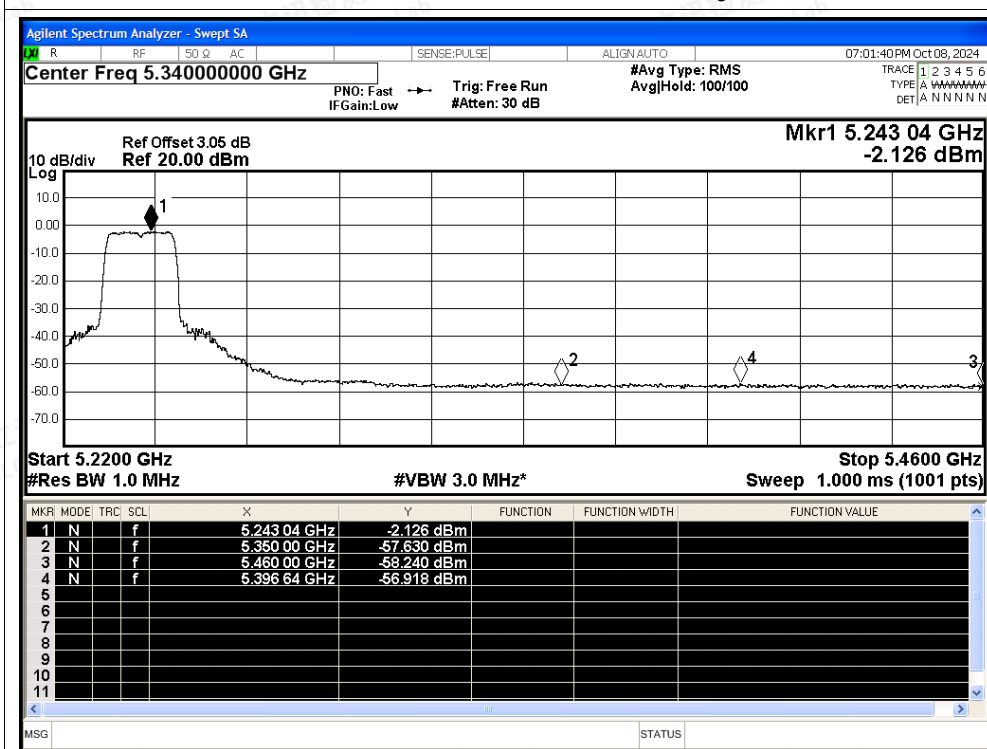




Restrict Band NVNT n40 5190MHz Ant2 Peak

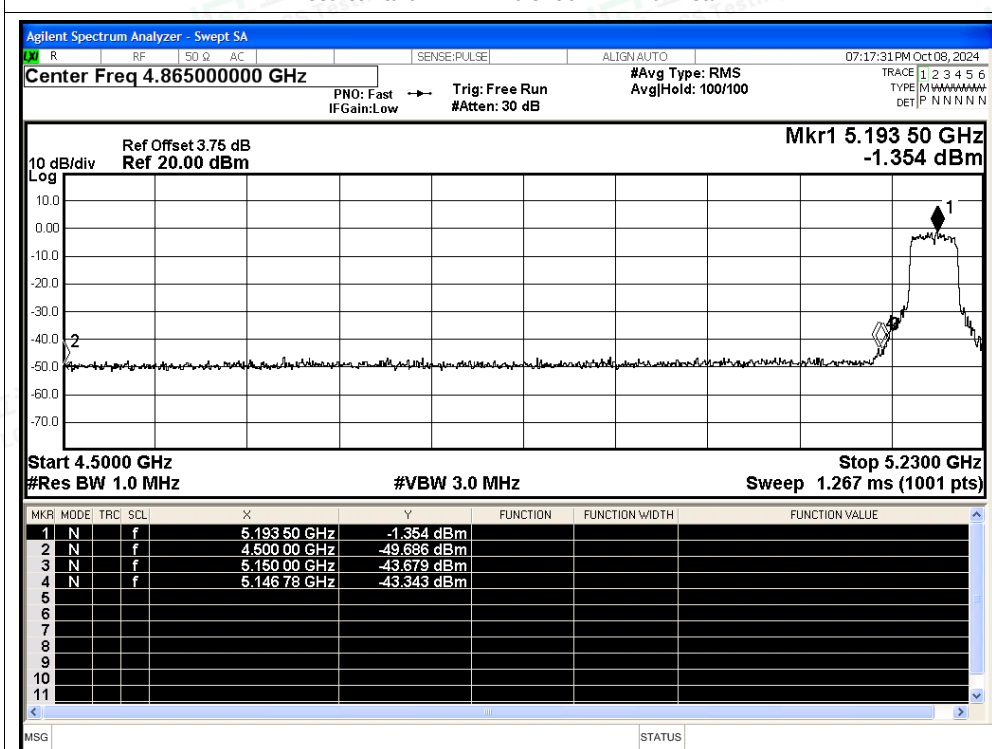


Restrict Band NVNT n40 5190MHz Ant2 Average

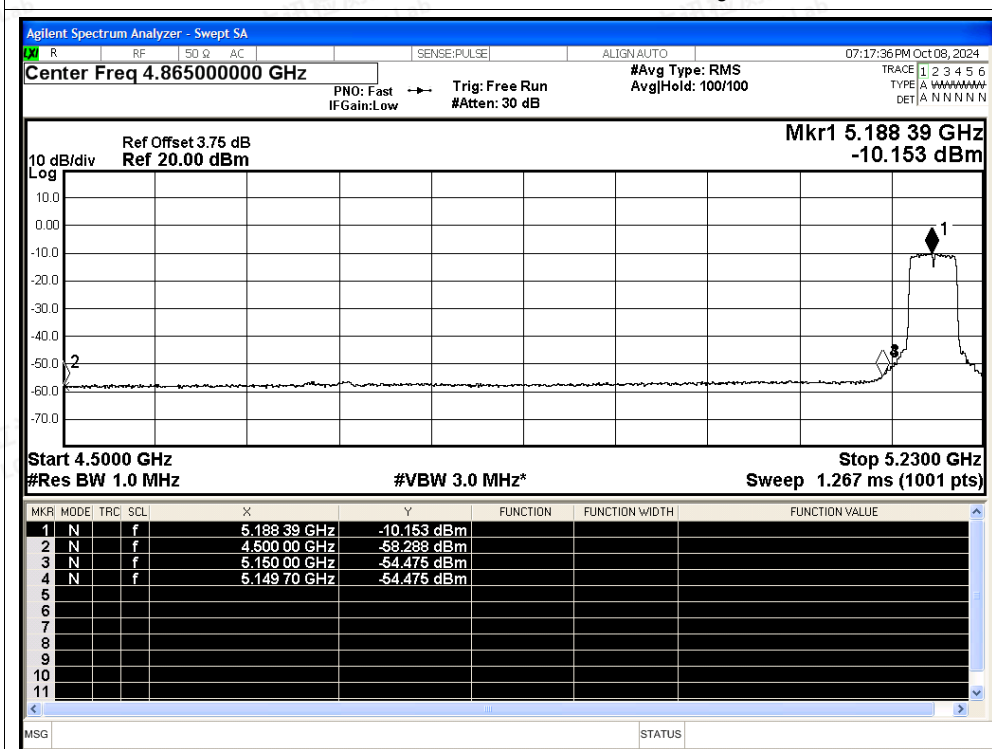


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

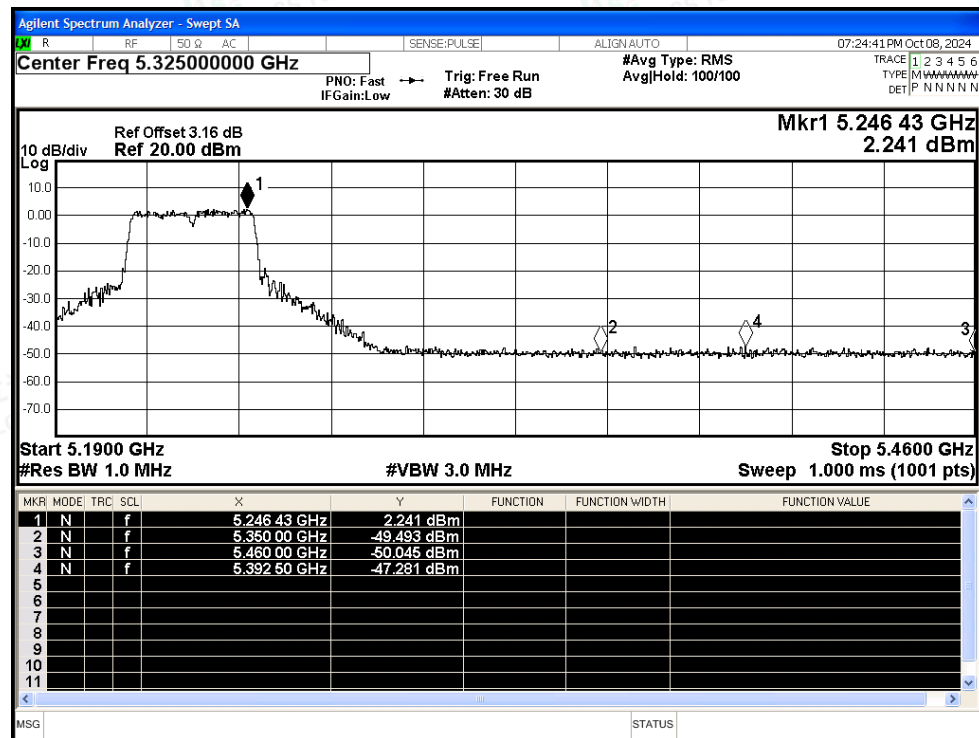


Restrict Band NVNT n40 5230MHz Ant2 Average

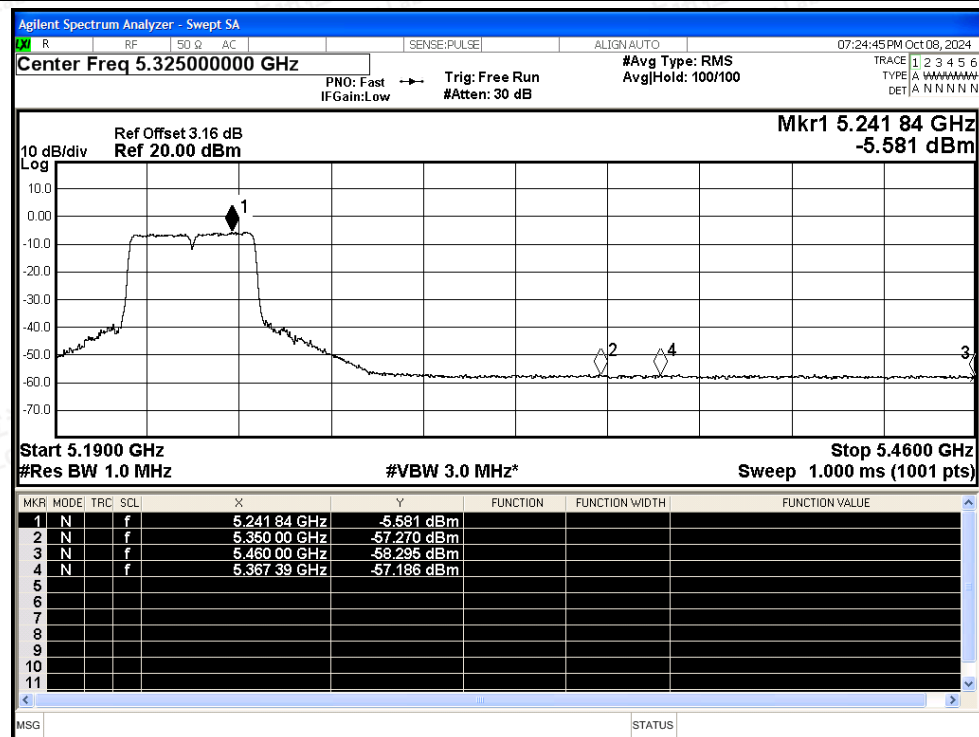




Restrict Band NVNT ac20 5180MHz Ant2 Peak

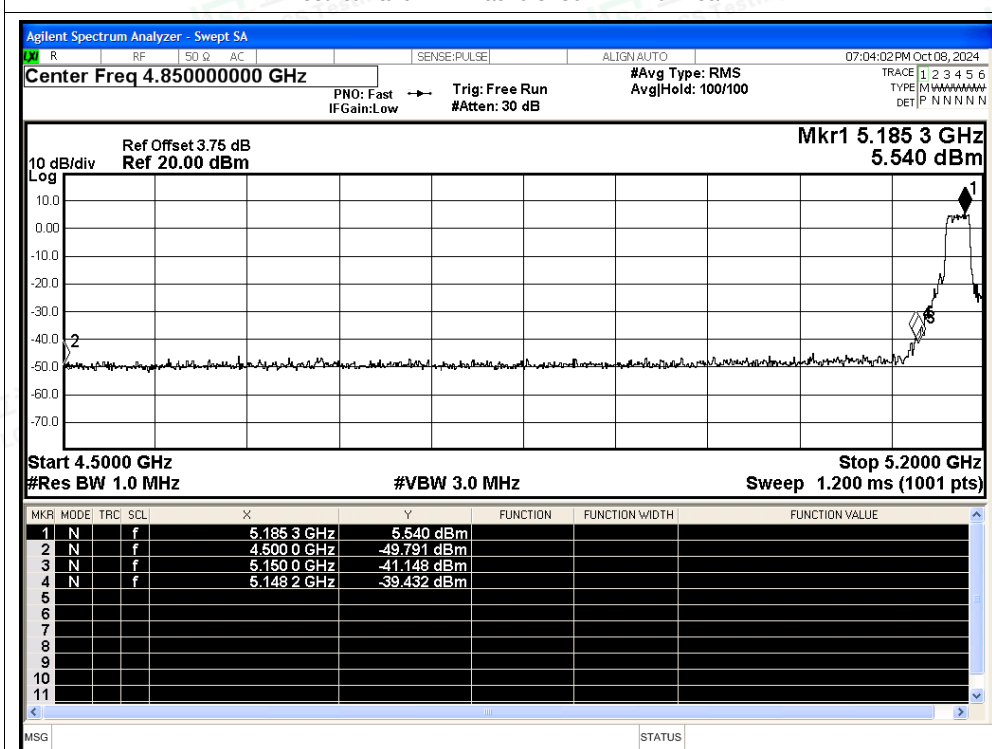


Restrict Band NVNT ac20 5180MHz Ant2 Average

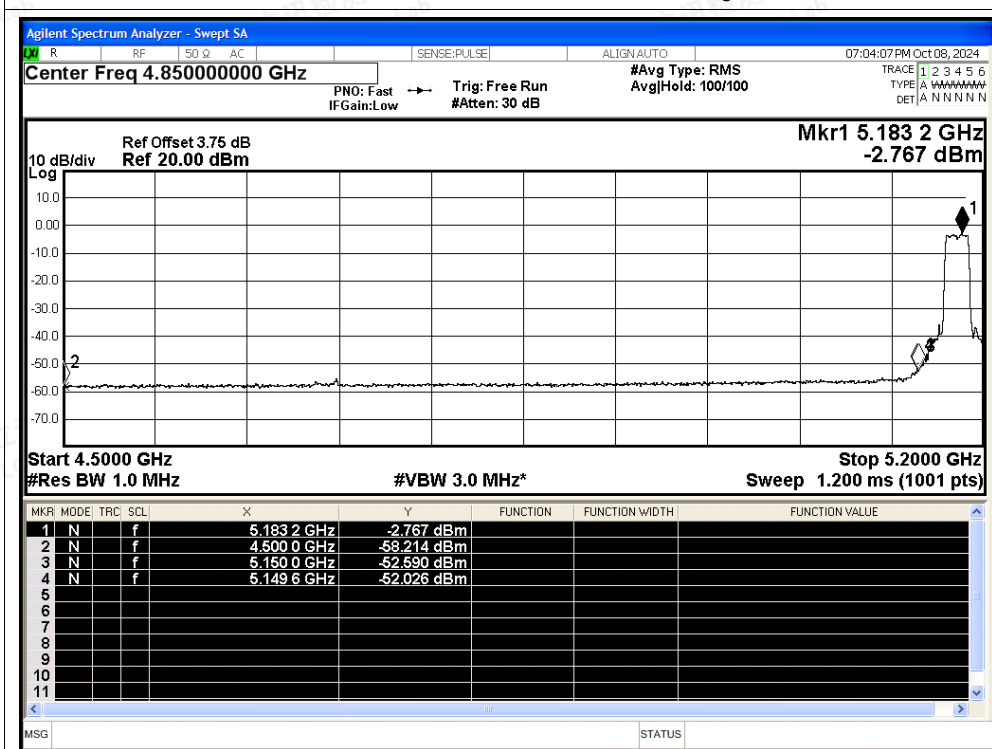


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

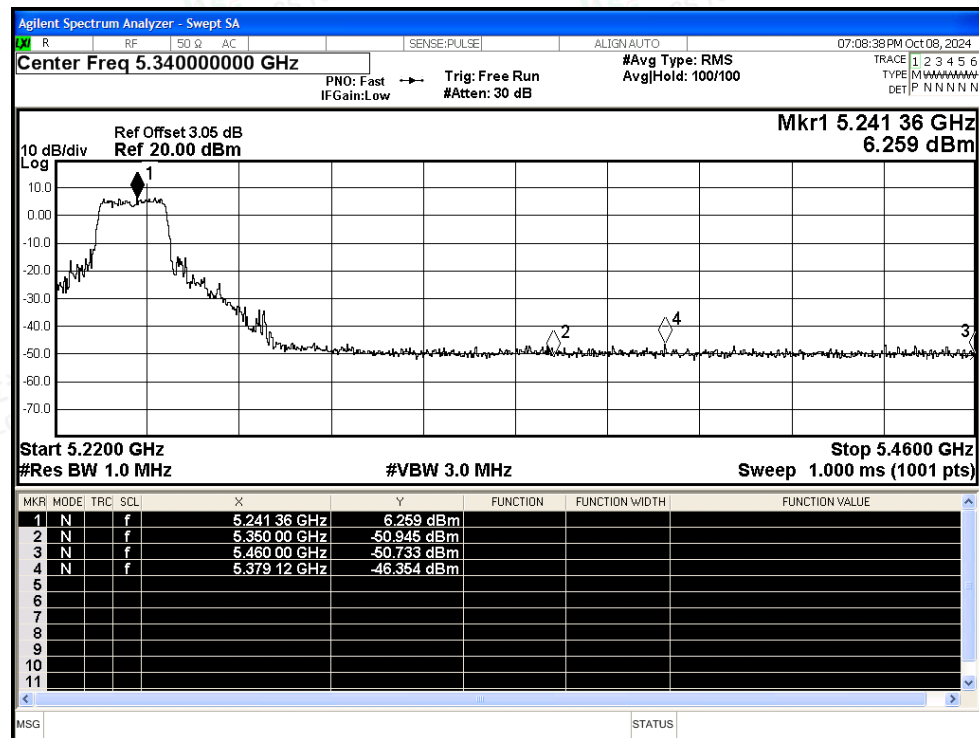


Restrict Band NVNT ac20 5240MHz Ant2 Average

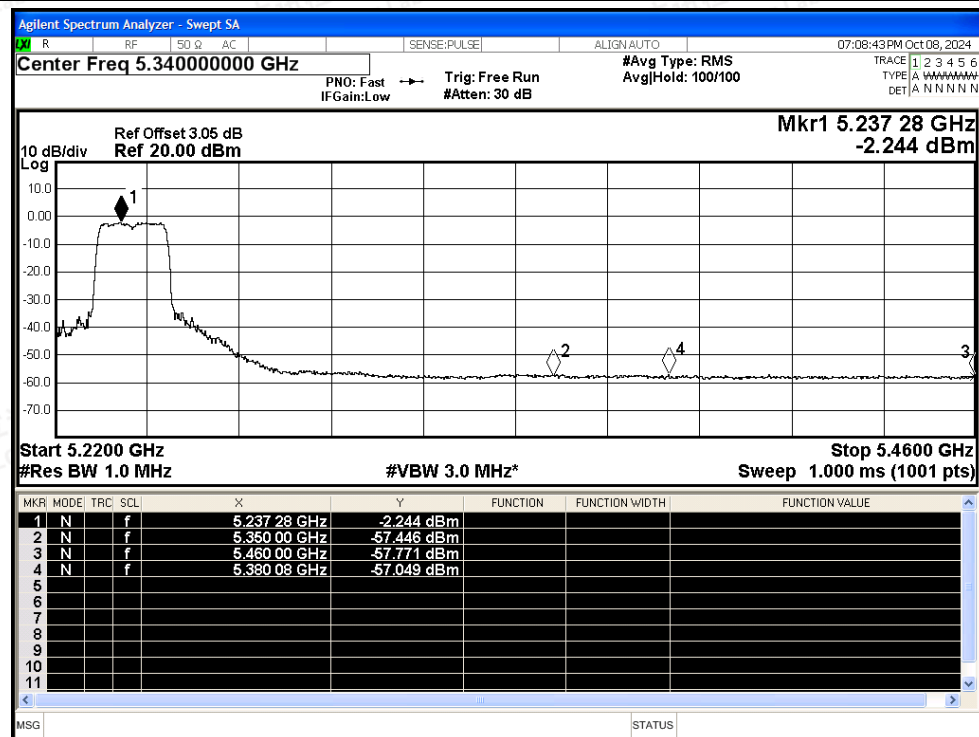


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

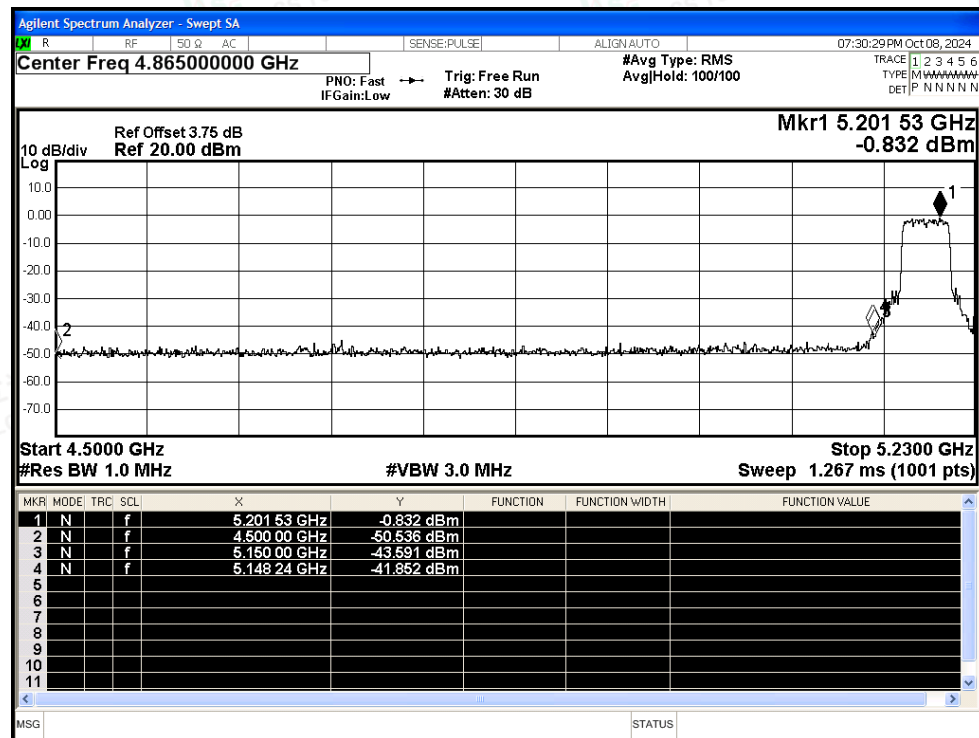


Restrict Band NVNT ac40 5190MHz Ant2 Average

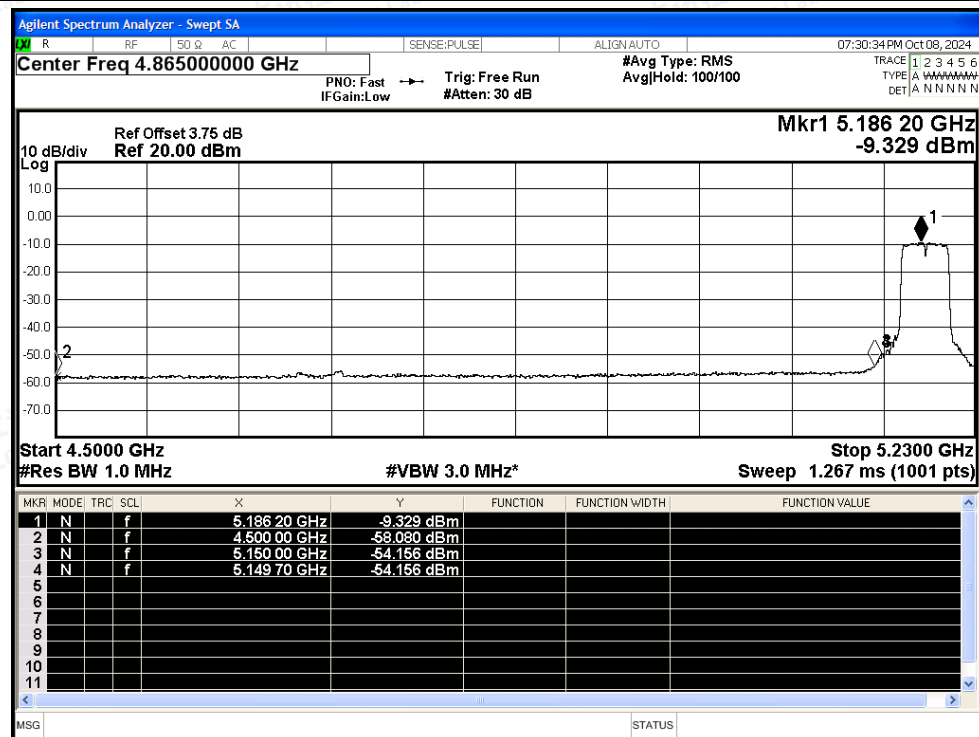




Restrict Band NVNT ac40 5230MHz Ant2 Peak

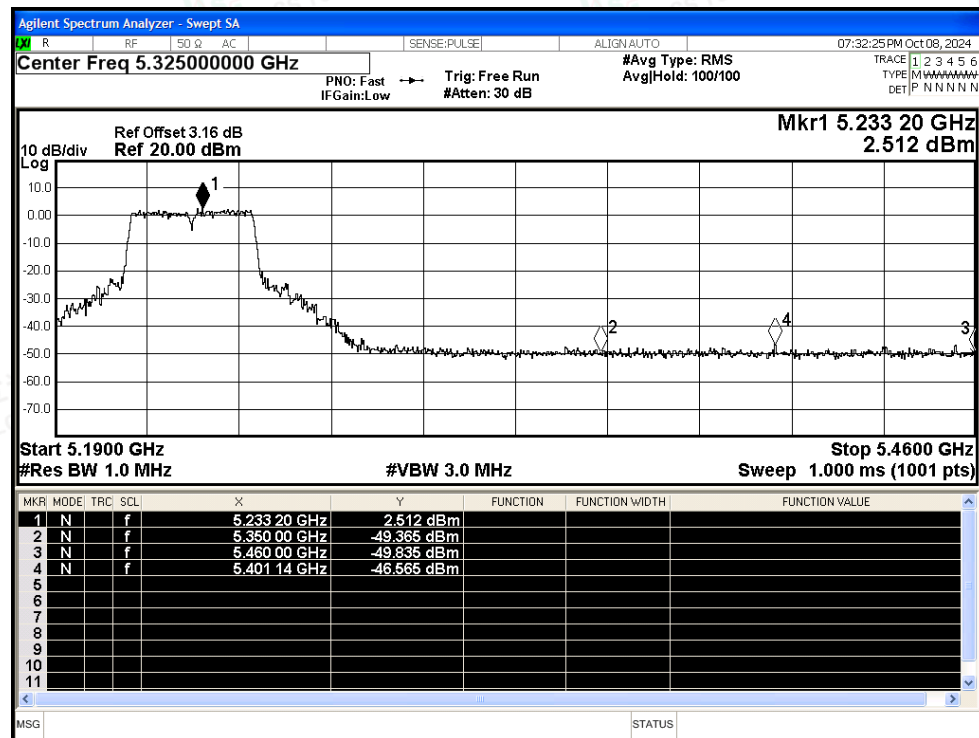


Restrict Band NVNT ac40 5230MHz Ant2 Average

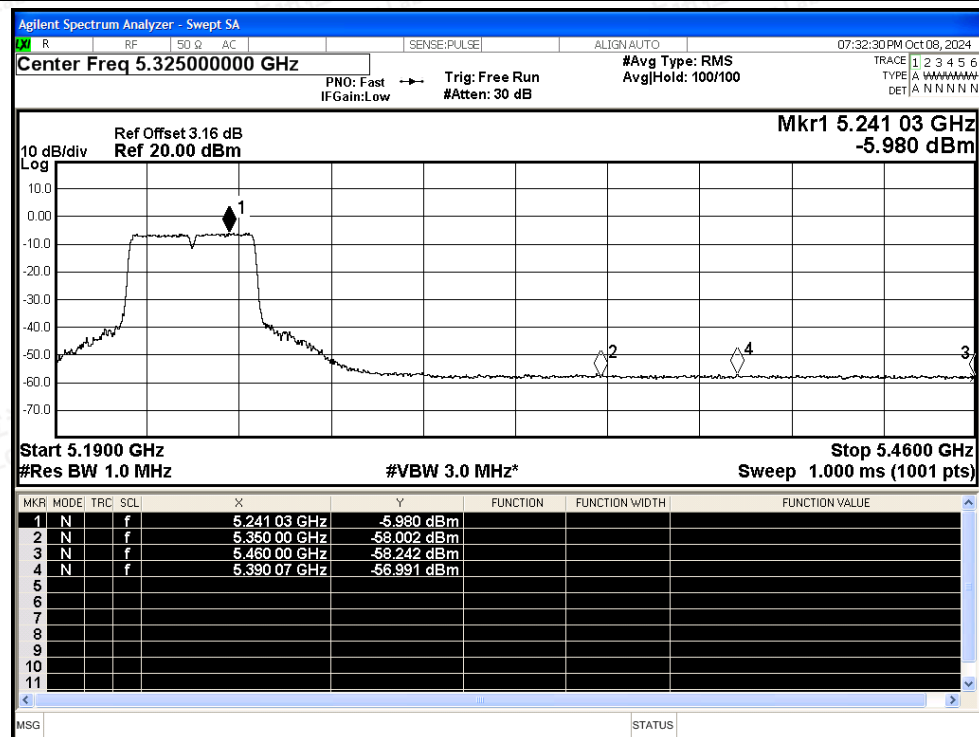




Restrict Band NVNT ac80 5210MHz Ant2 Peak

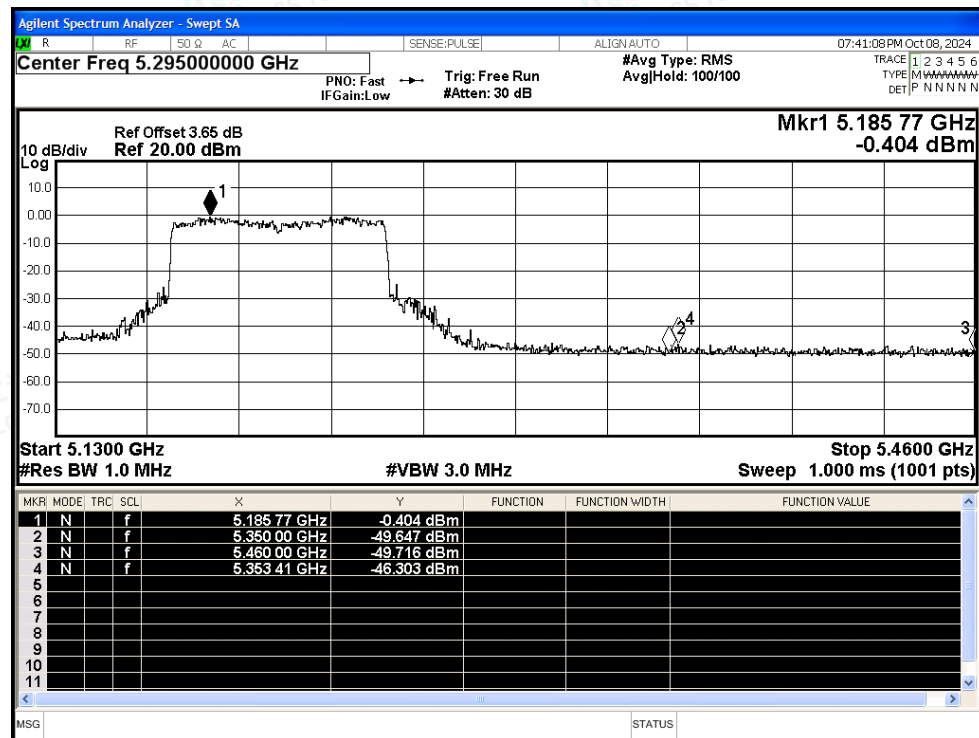


Restrict Band NVNT ac80 5210MHz Ant2 Average

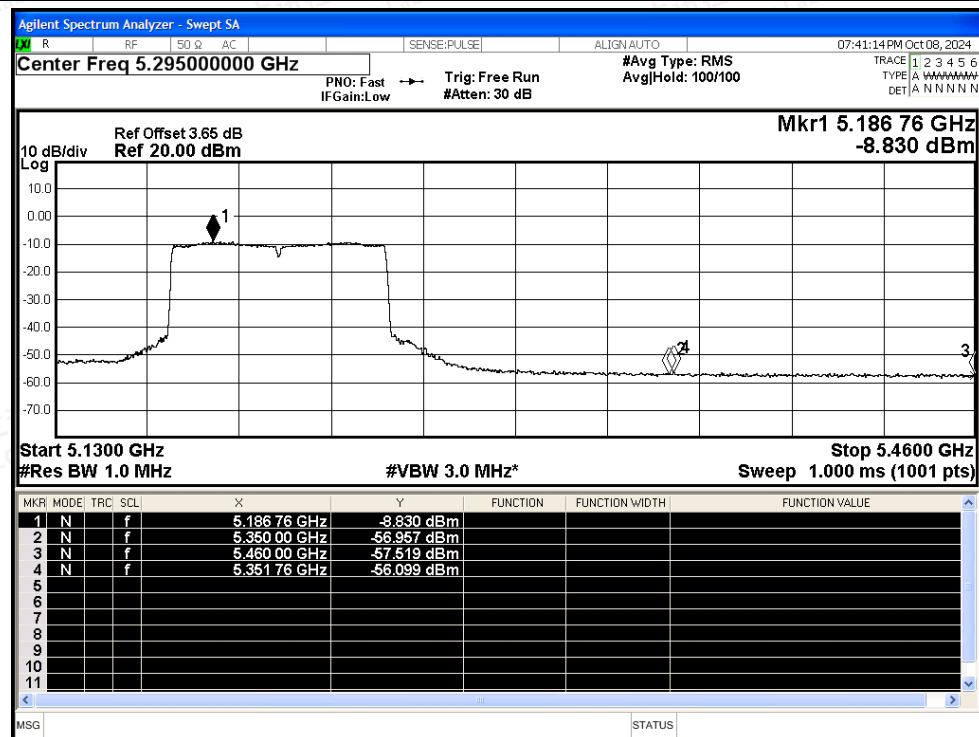


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

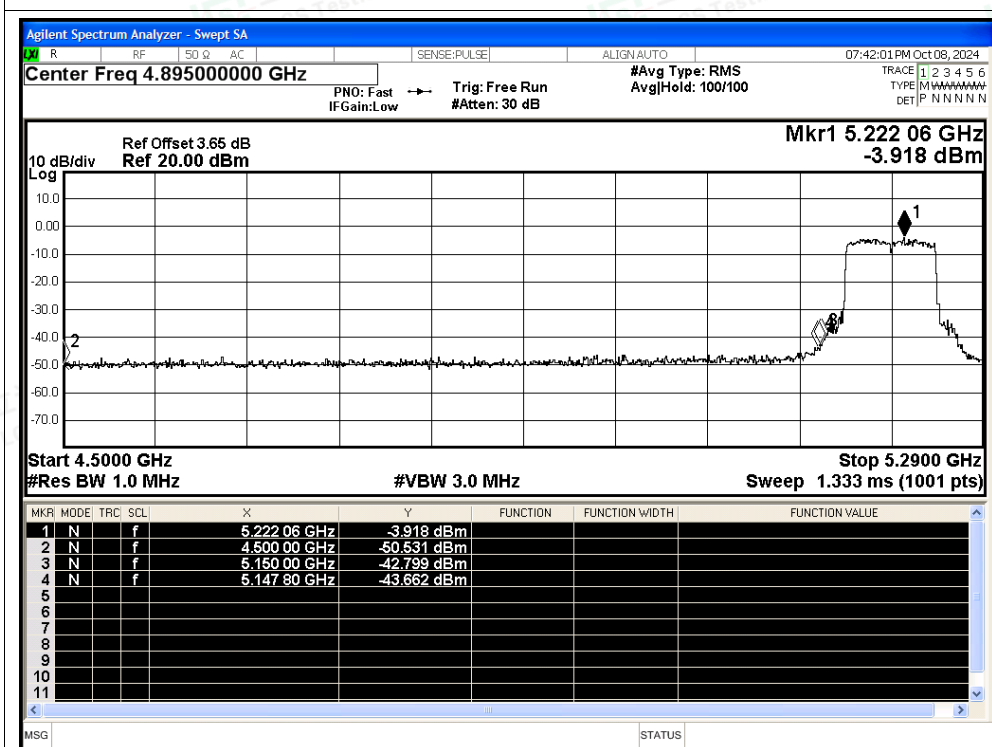


Restrict Band NVNT ac80 5210MHz Ant2 Average

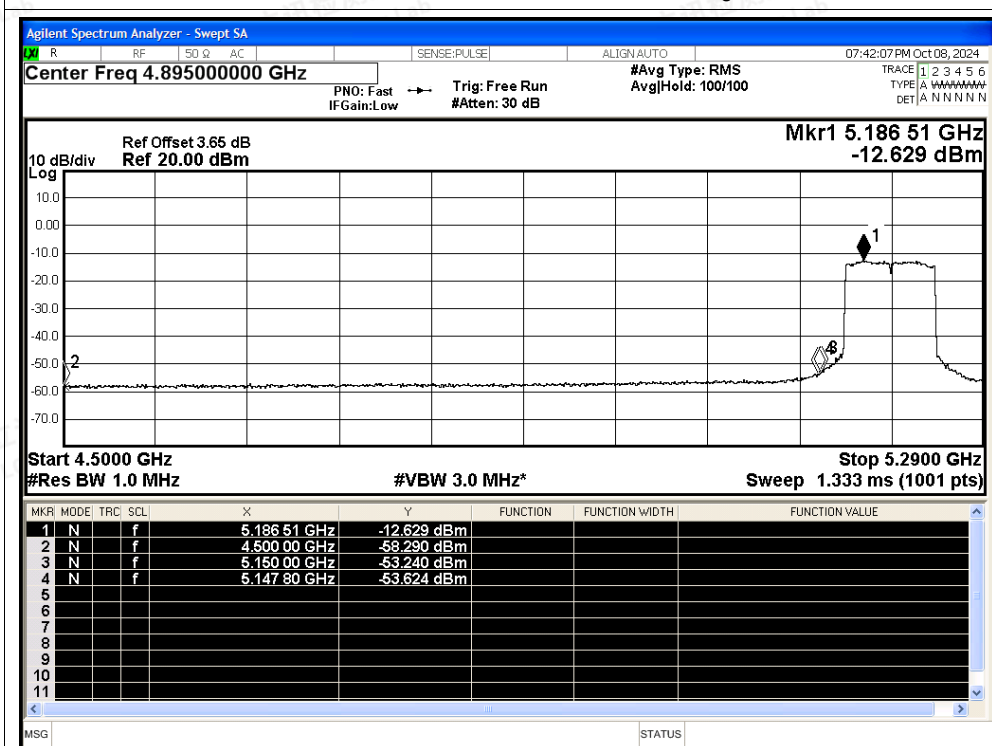


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant2 Peak

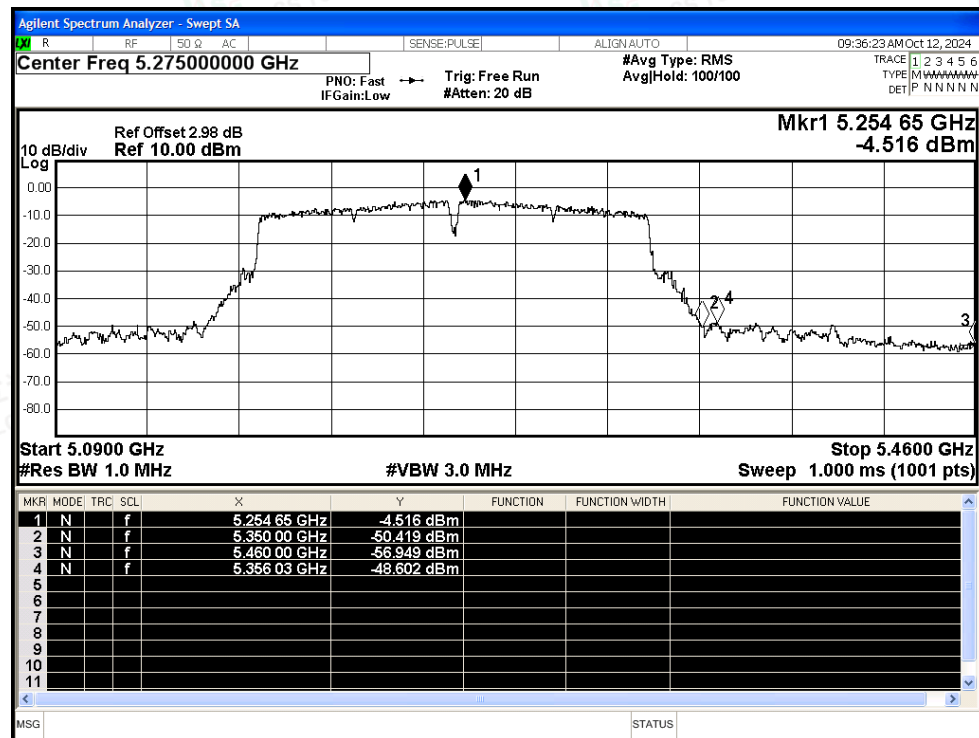


Restrict Band NVNT ac160 5250MHz Ant2 Average

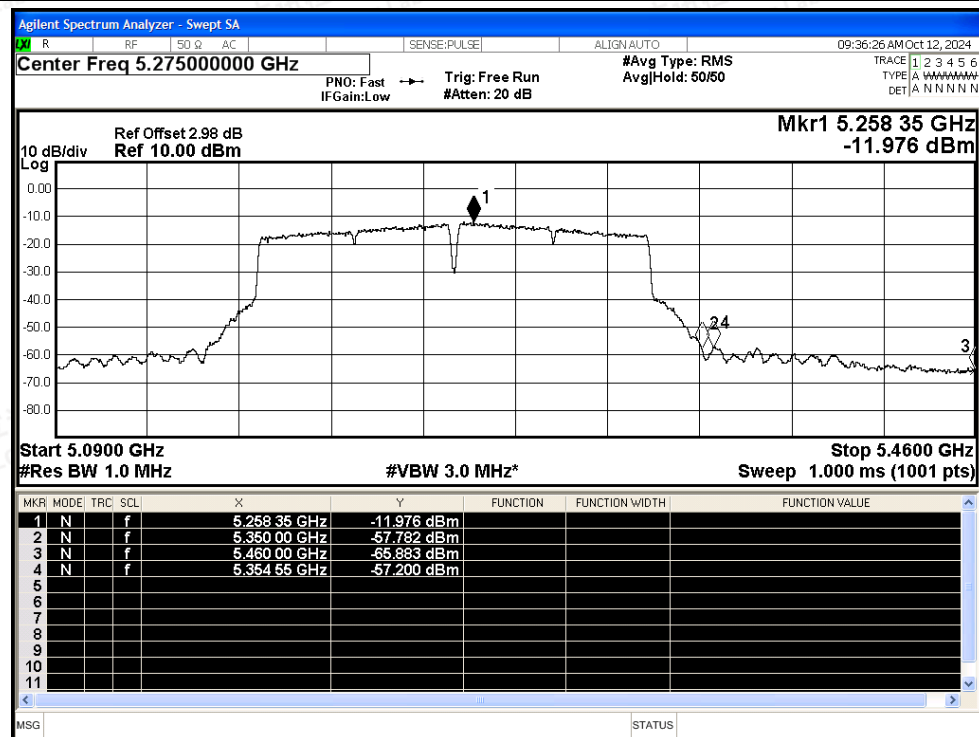


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Restrict Band NVNT ac160 5250MHz Ant2 Peak

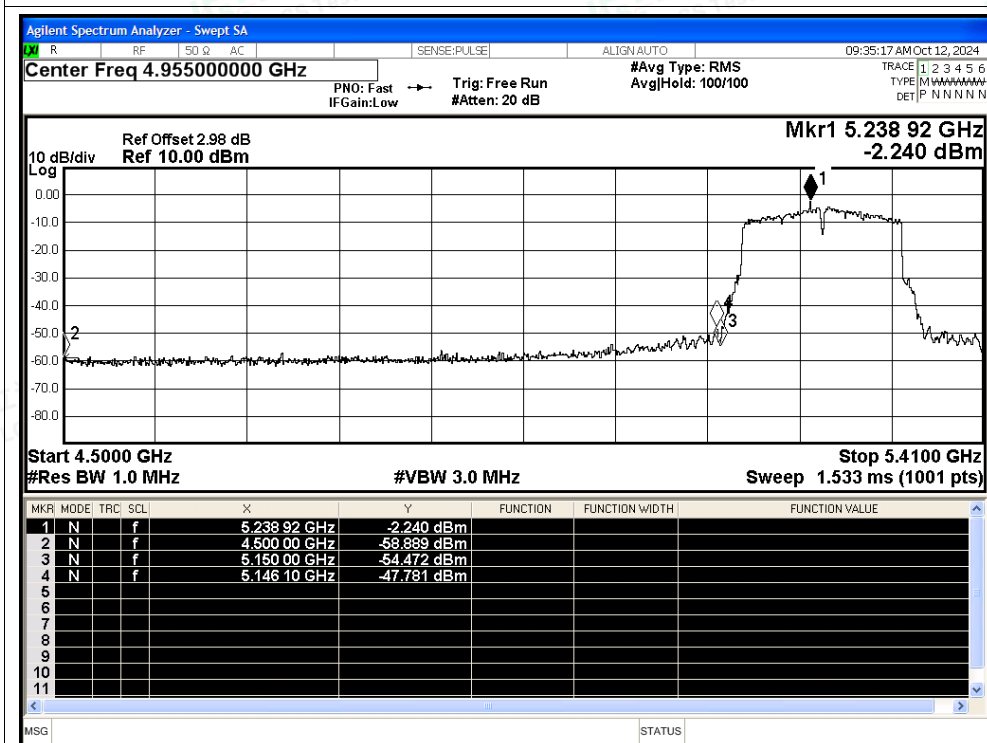


Restrict Band NVNT ac160 5250MHz Ant2 Average

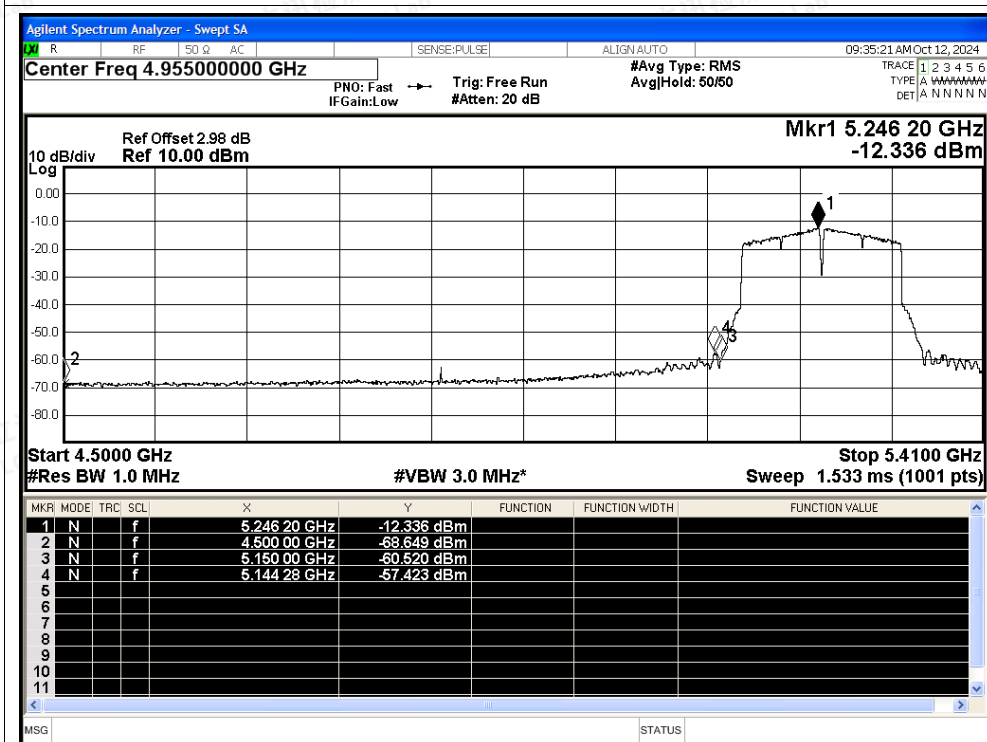


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

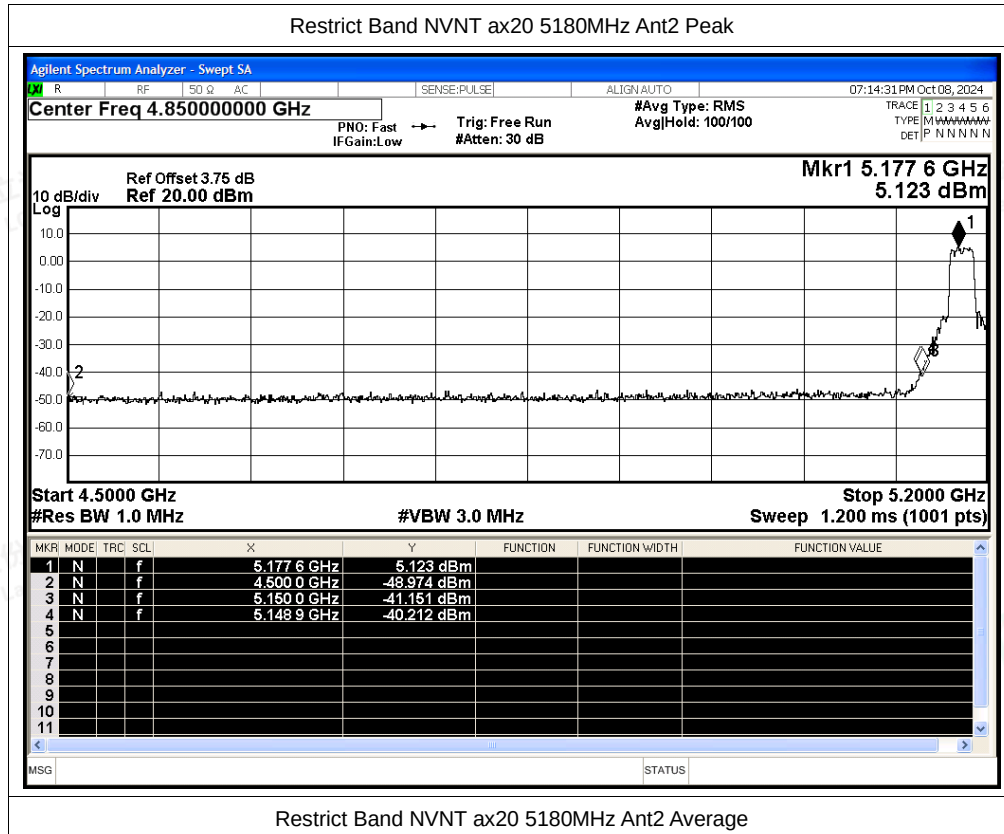

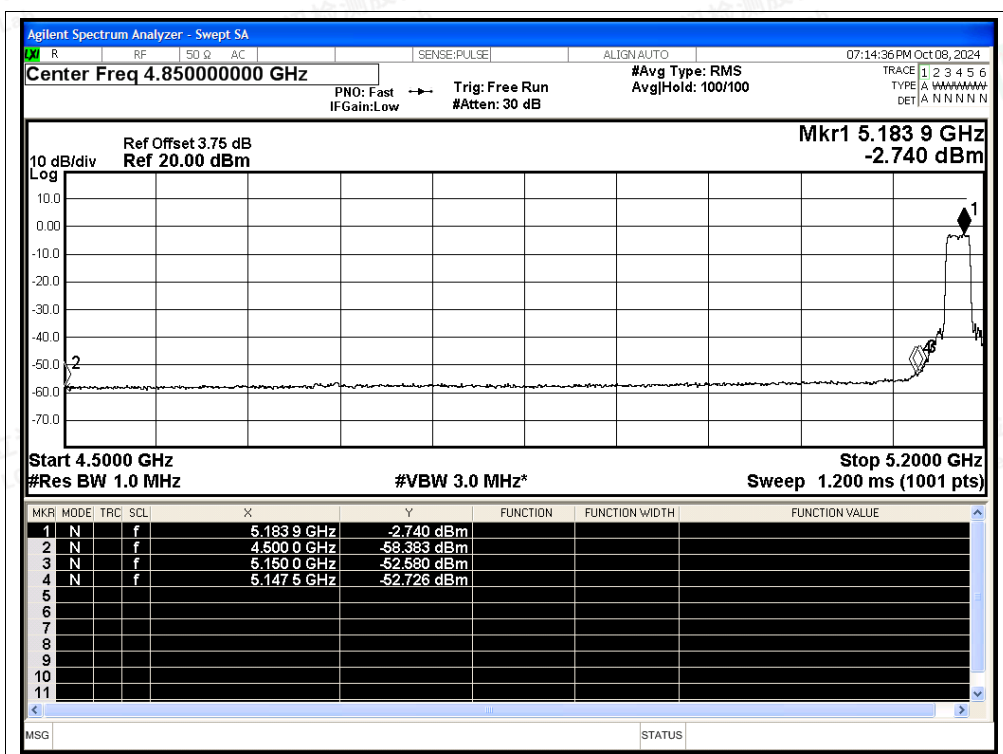




Restrict Band NVNT ax20 5240MHz Ant2 Peak

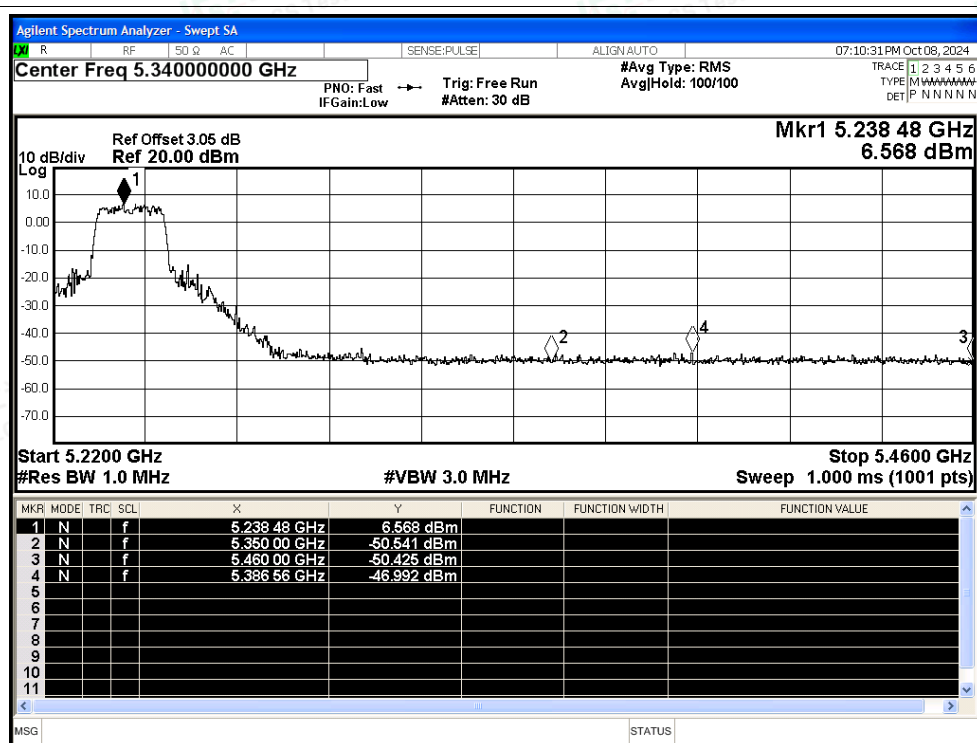


Restrict Band NVNT ax20 5240MHz Ant2 Average

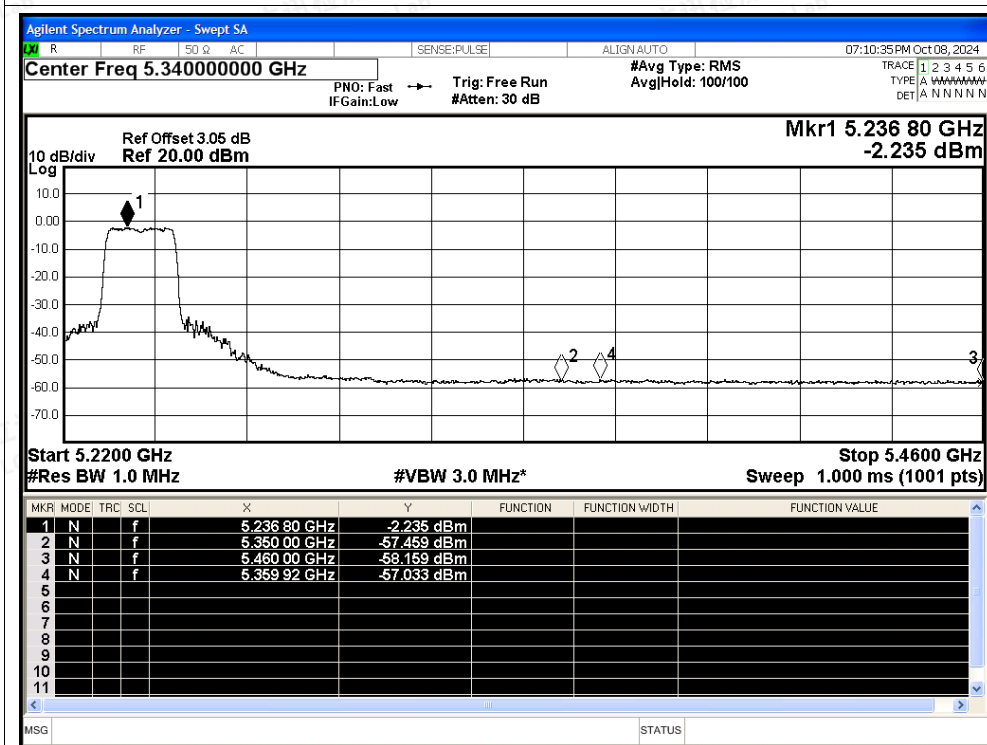


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

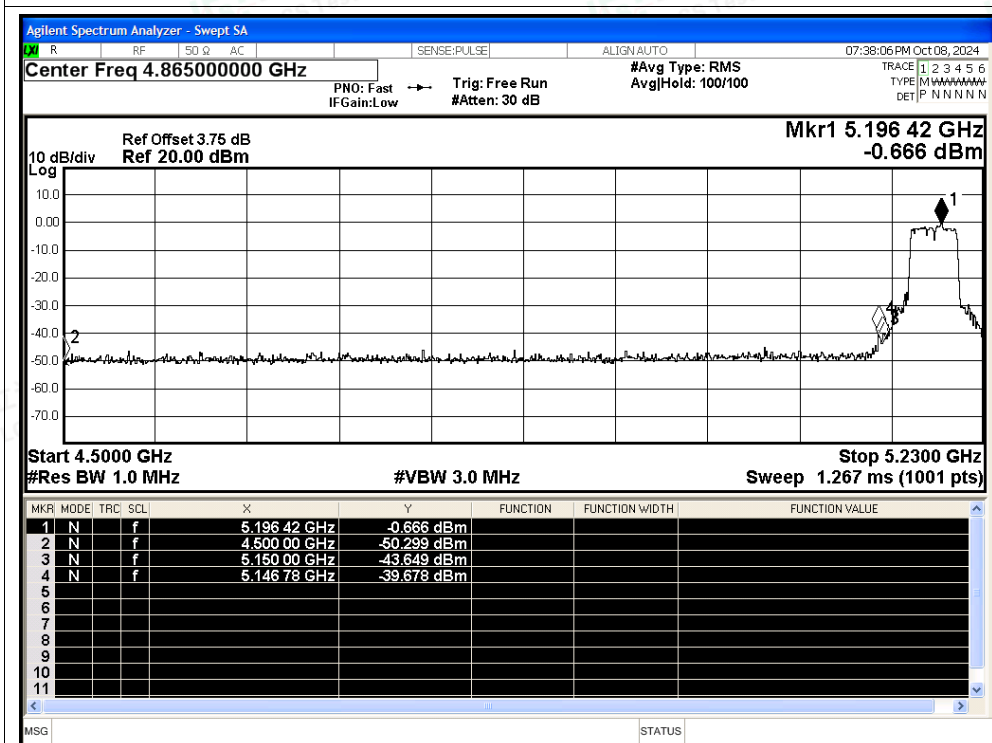


Restrict Band NVNT ax40 5190MHz Ant2 Average

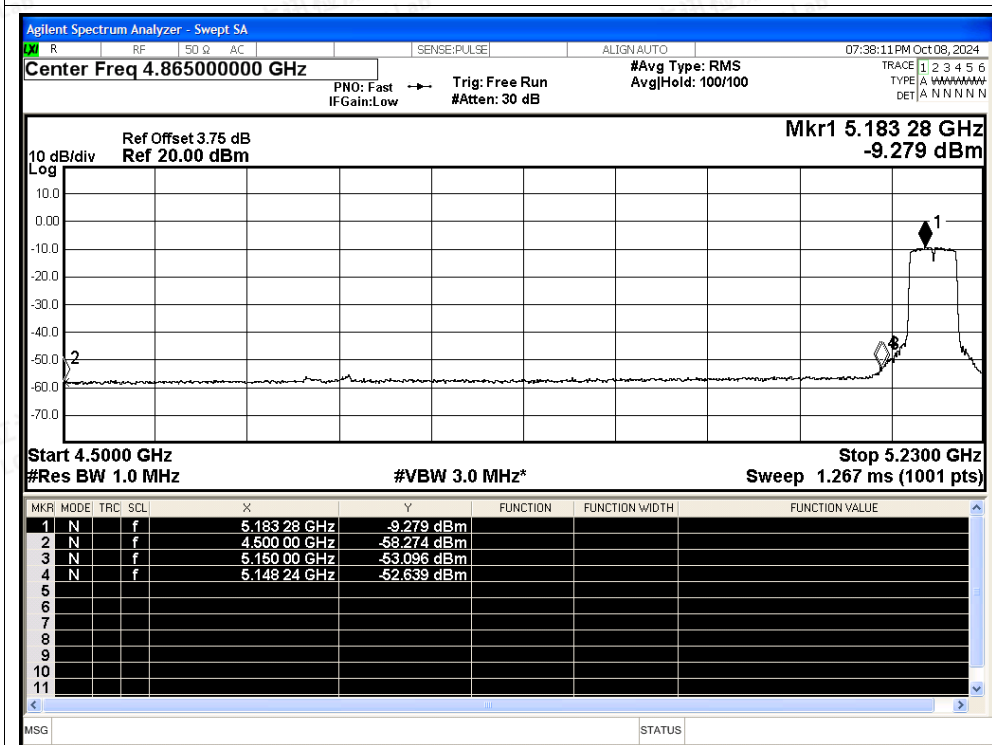


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

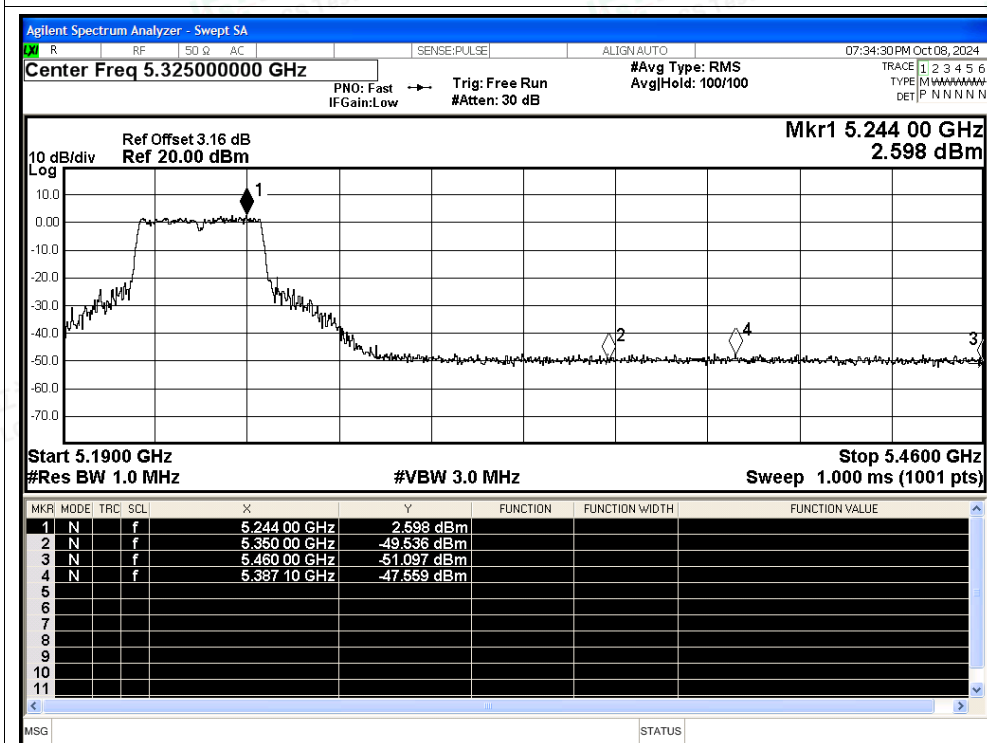


Restrict Band NVNT ax40 5230MHz Ant2 Average

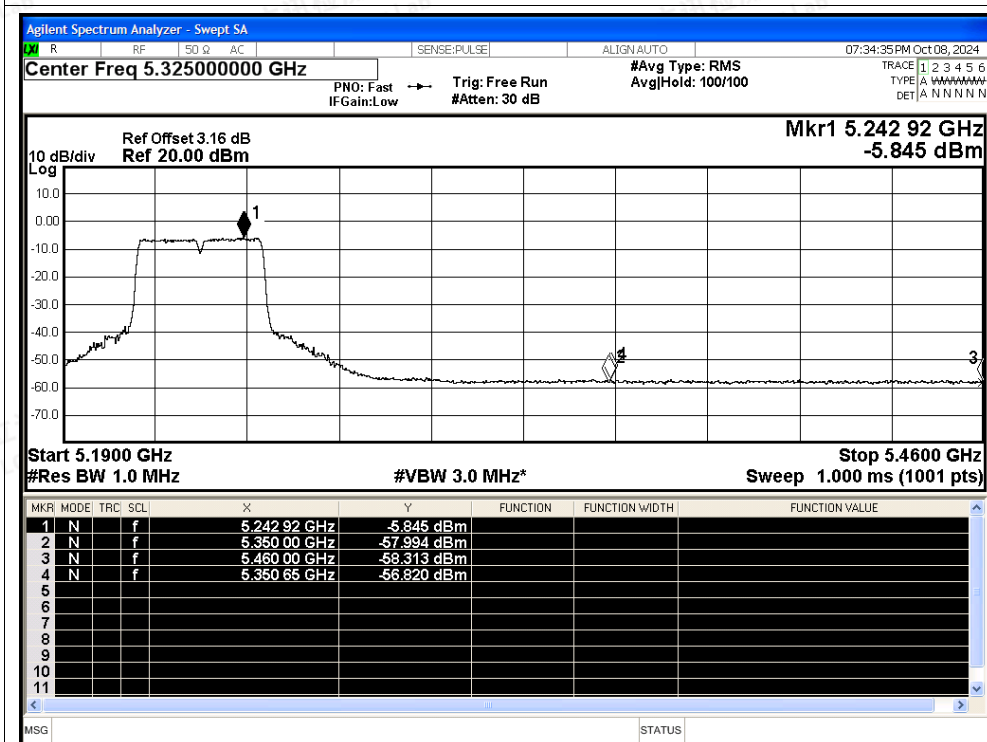




Restrict Band NVNT ax80 5210MHz Ant2 Peak

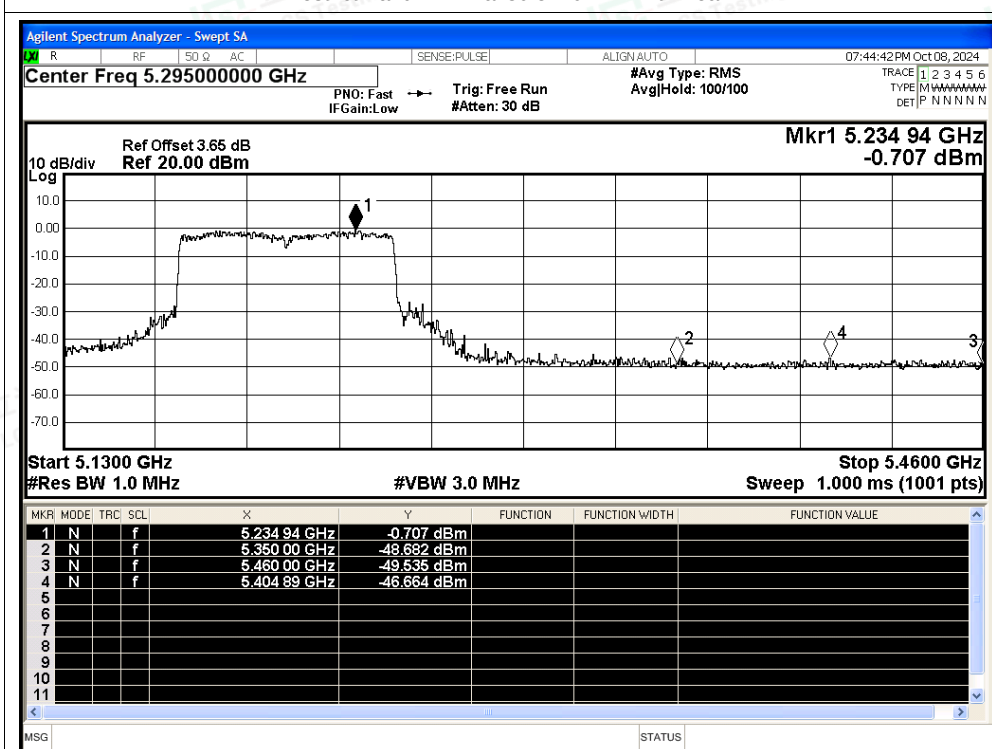


Restrict Band NVNT ax80 5210MHz Ant2 Average

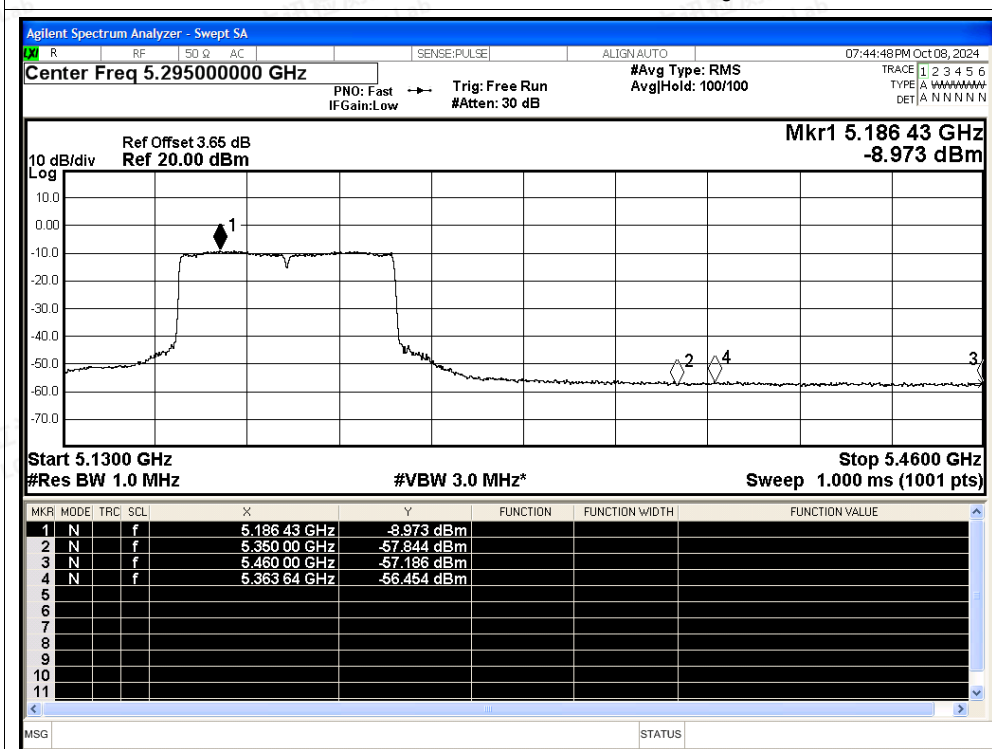


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Restrict Band NVNT ax80 5210MHz Ant2 Peak

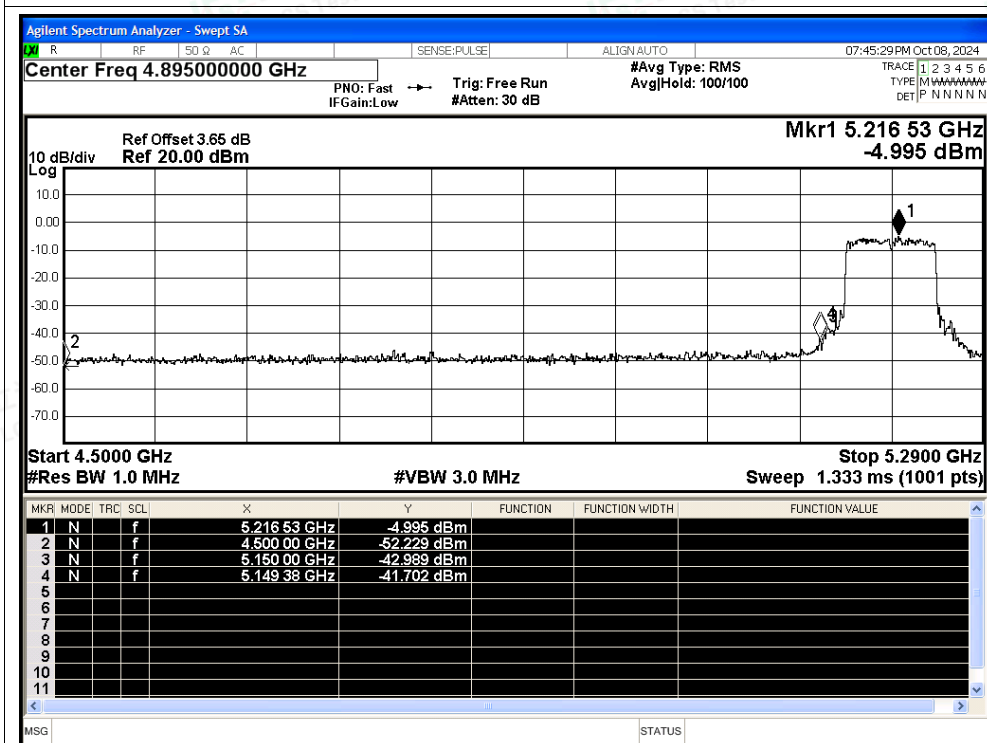


Restrict Band NVNT ax80 5210MHz Ant2 Average

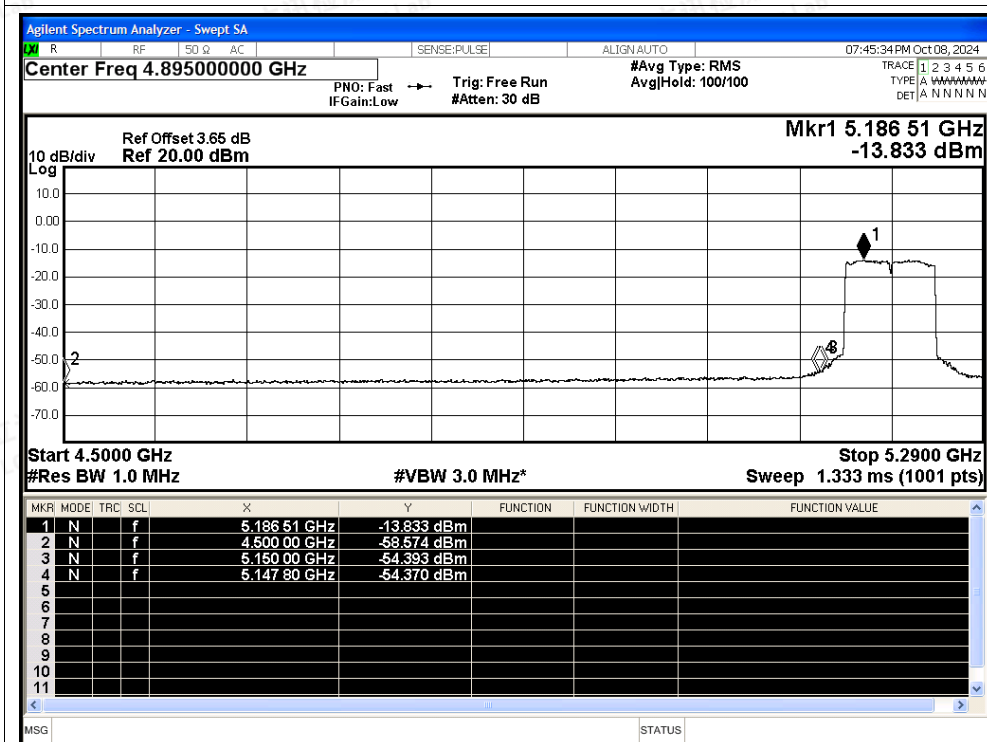


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

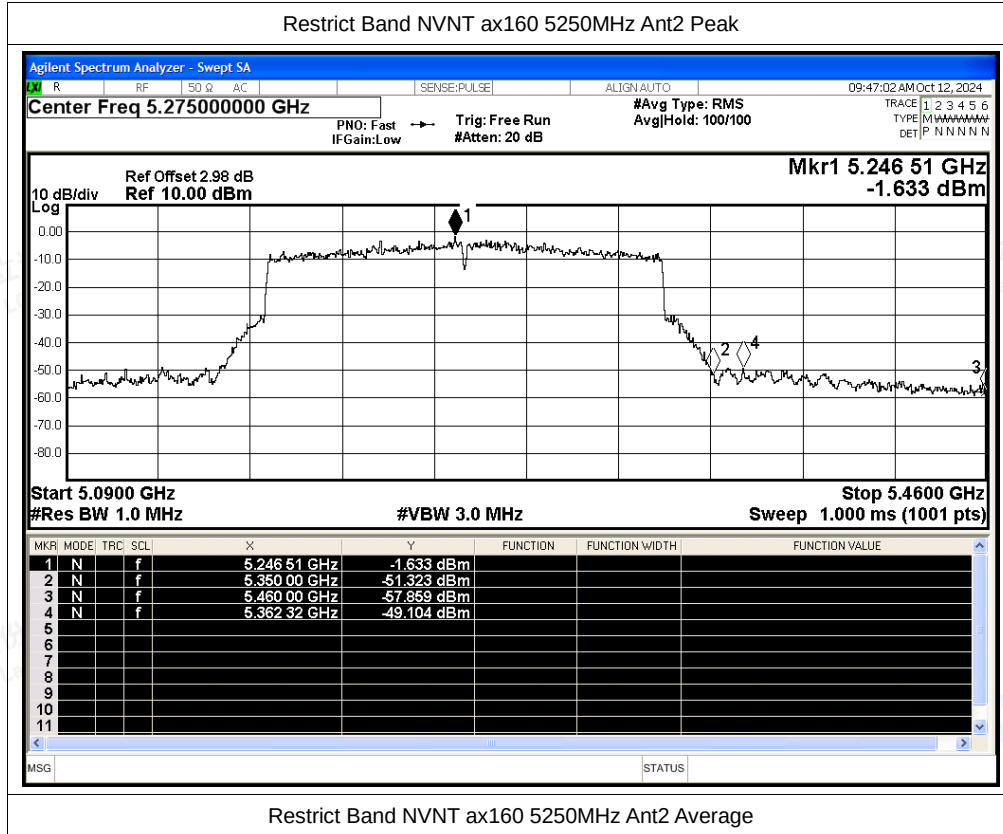

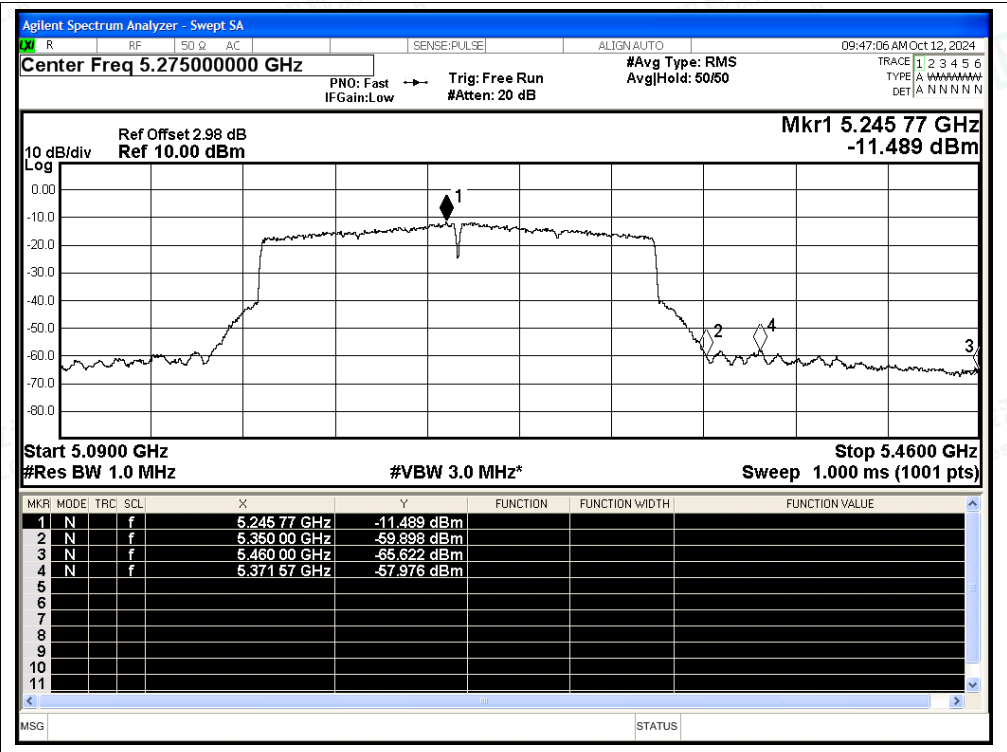



Restrict Band NVNT ax160 5250MHz Ant2 Peak

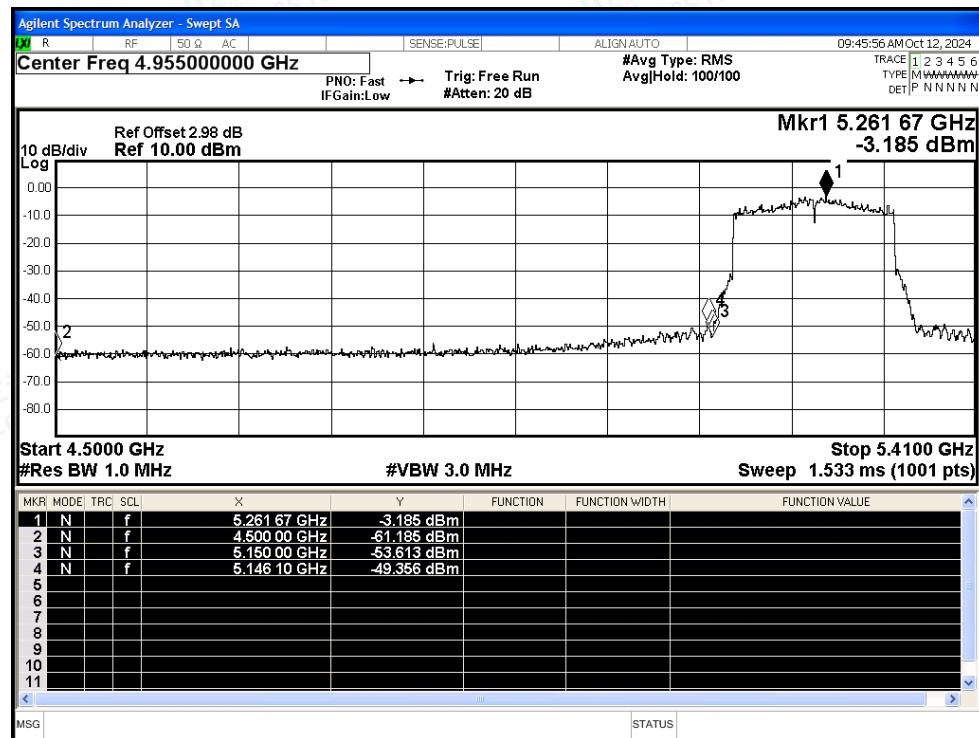

Restrict Band NVNT ax160 5250MHz Ant2 Average

