




802.11ac(VHT20)_MCH_5785MHz_MIMO_NTNV

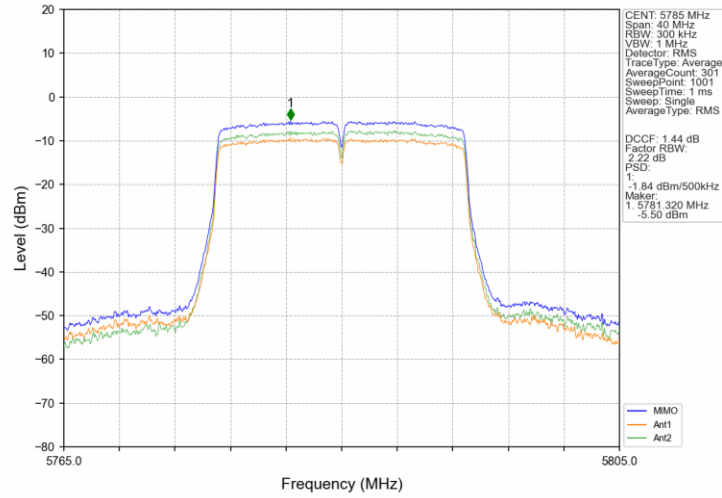


802.11ac(VHT20)_HCH_5825MHz_Ant1_NTNV

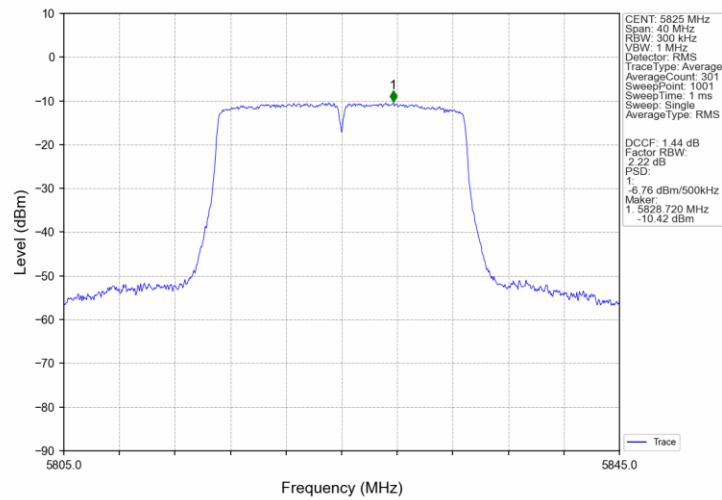


802.11ac(VHT20)_HCH_5825MHz_Ant2_NTNV

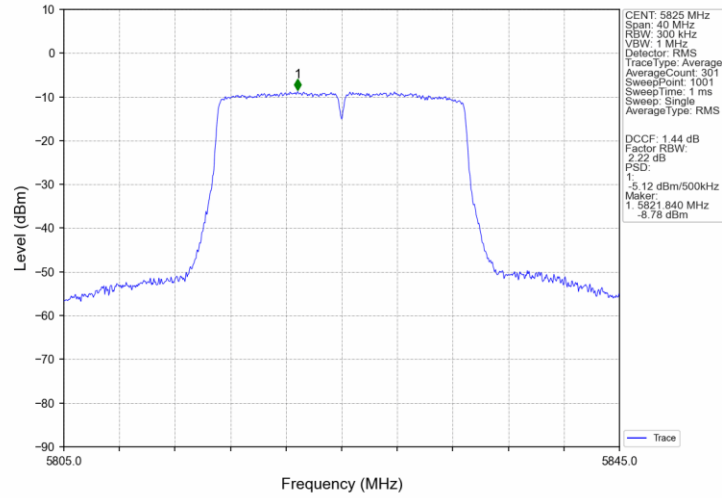


802.11ac(VHT20)_HCH_5825MHz_MIMO_NTNV

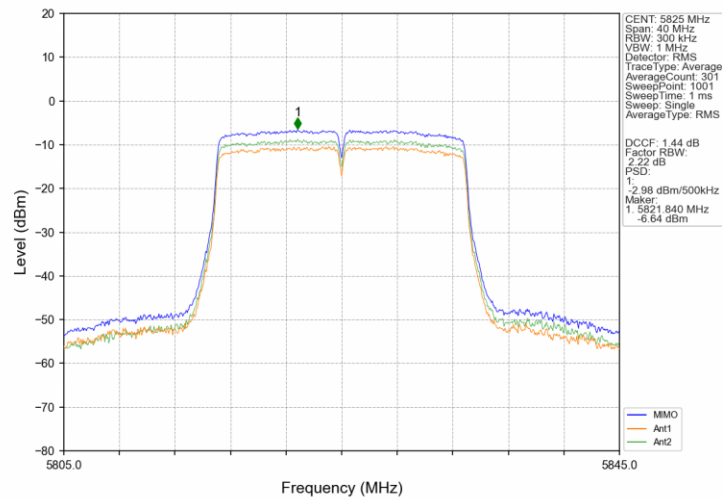


802.11ac(VHT40)_LCH_5755MHz_Ant1_NTNV

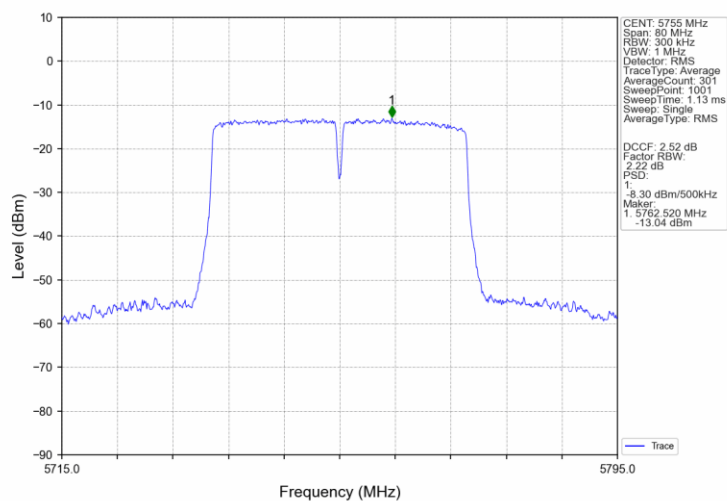


802.11ac(VHT40)_LCH_5755MHz_Ant2_NTNV

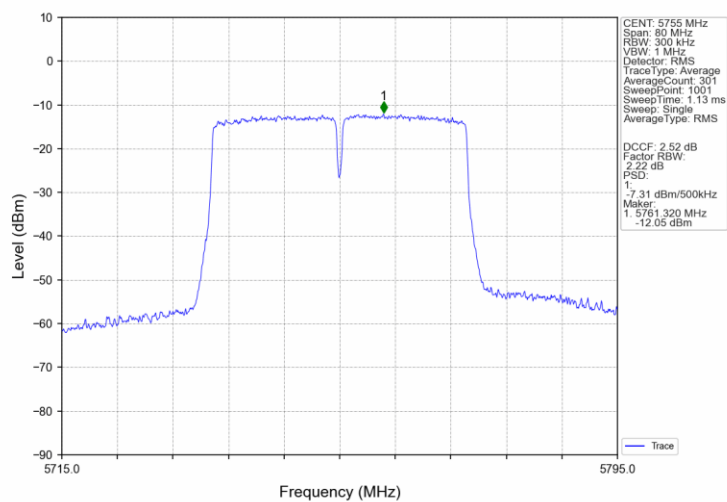


802.11ac(VHT40)_LCH_5755MHz_MIMO_NTNV

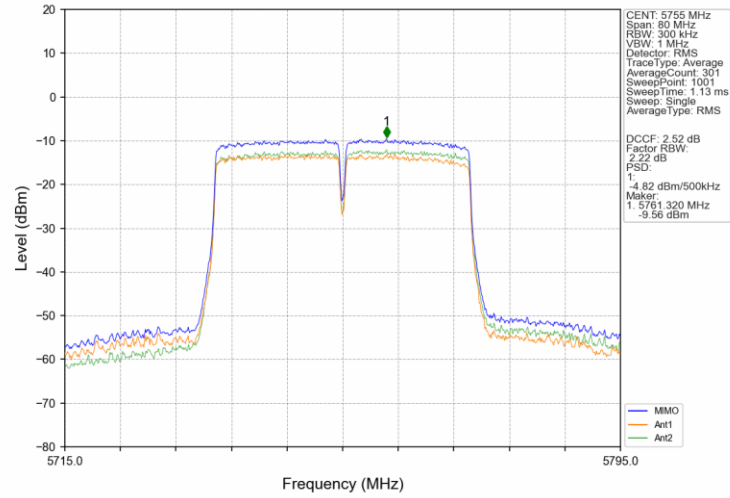


802.11ac(VHT40)_HCH_5795MHz_Ant1_NTNV

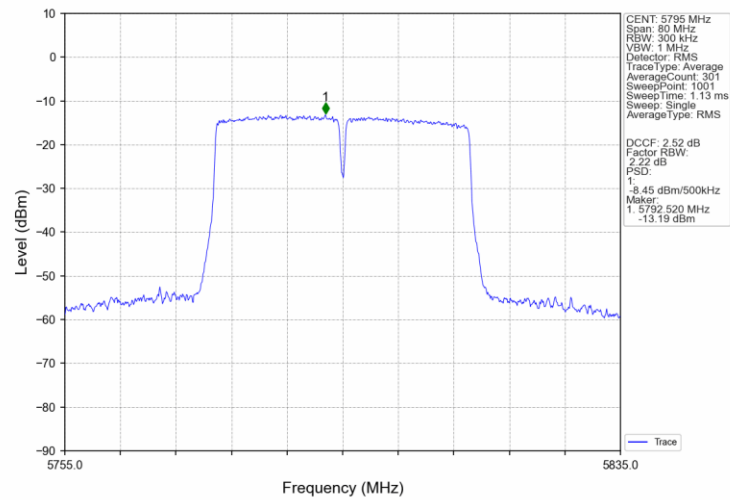


802.11ac(VHT40)_HCH_5795MHz_Ant2_NTNV

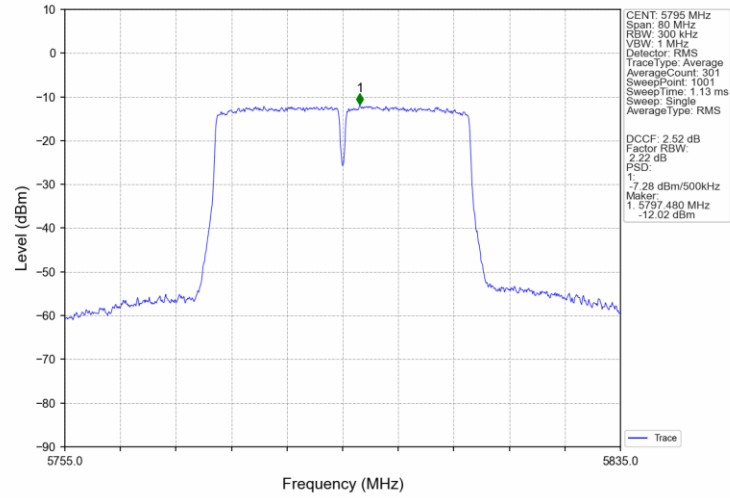


802.11ac(VHT40)_HCH_5795MHz_MIMO_NTNV

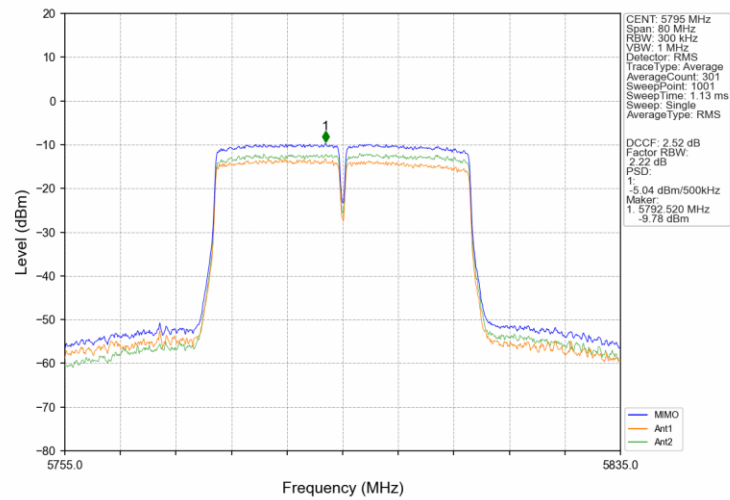


802.11ac(VHT80)_MCH_5775MHz_Ant1_NTNV

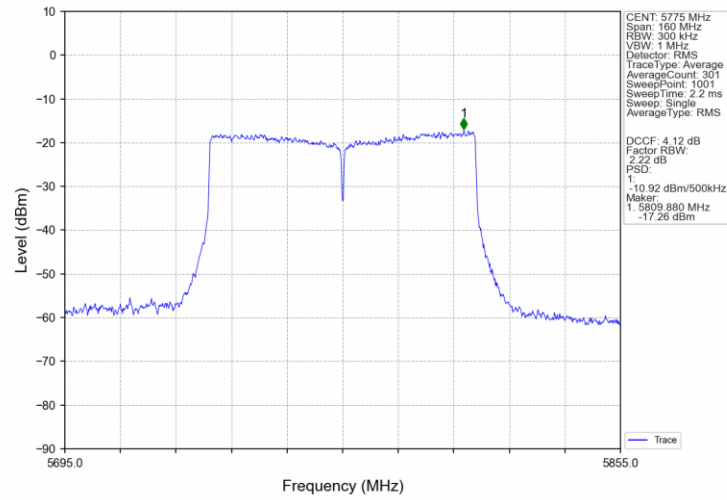


802.11ac(VHT80)_MCH_5775MHz_Ant2_NTNV

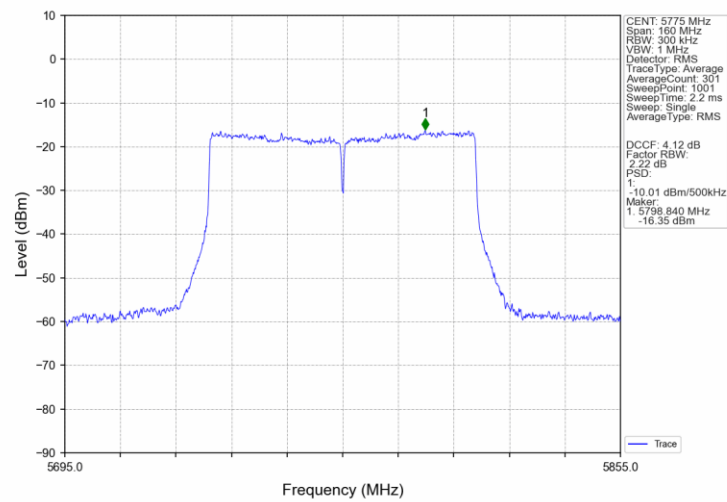


802.11ac(VHT80)_MCH_5775MHz_MIMO_NTNV

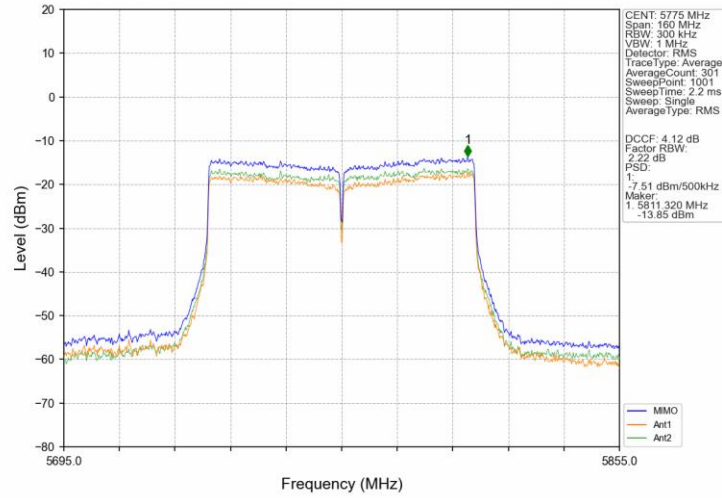


802.11ax(HEW20)_LCH_5745MHz_SU_/_Ant1_NTNV

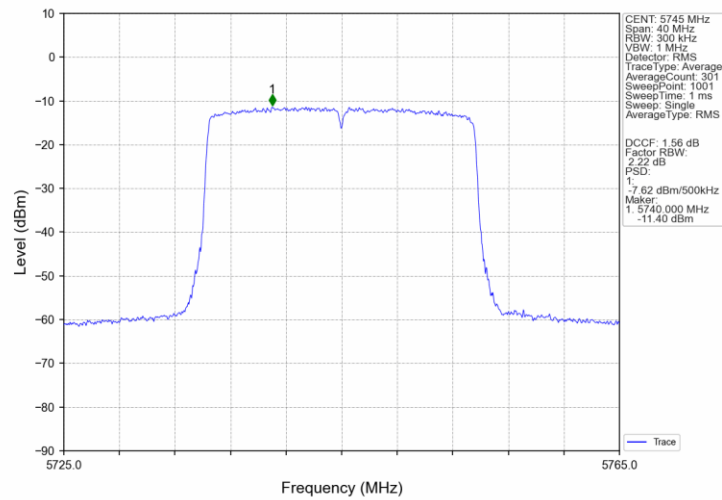


802.11ax(HEW20)_LCH_5745MHz_SU_/_Ant2_NTNV

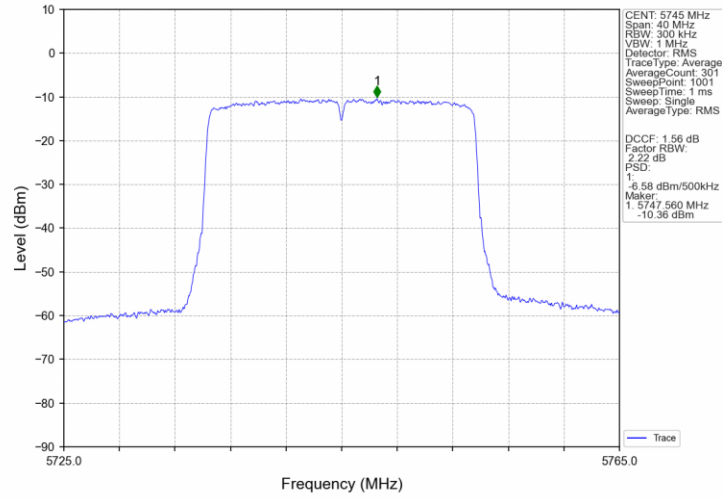


802.11ax(HEW20)_LCH_5745MHz_SU_/_MIMO_NTNV

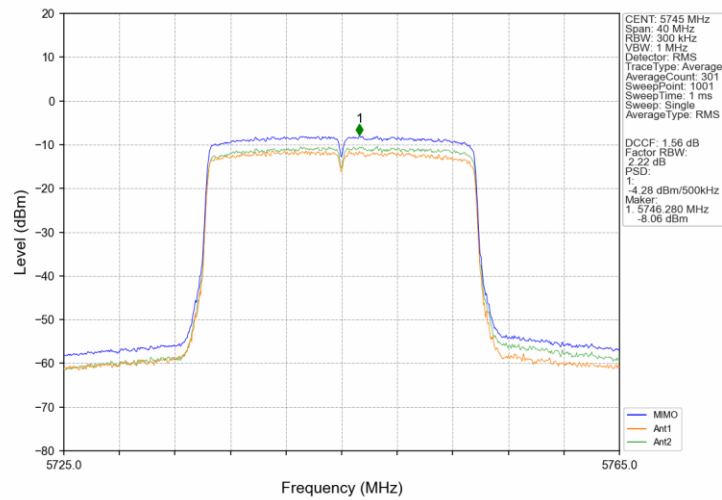


802.11ax(HEW20)_MCH_5785MHz_SU_/_Ant1_NTNV

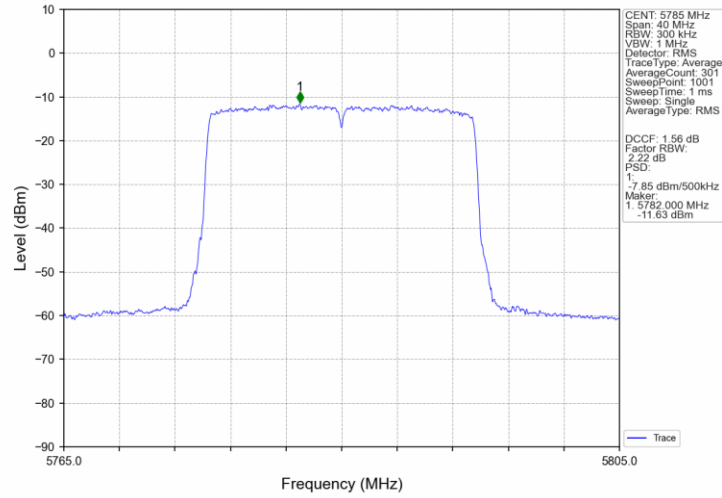


802.11ax(HEW20)_MCH_5785MHz_SU_/_Ant2_NTNV

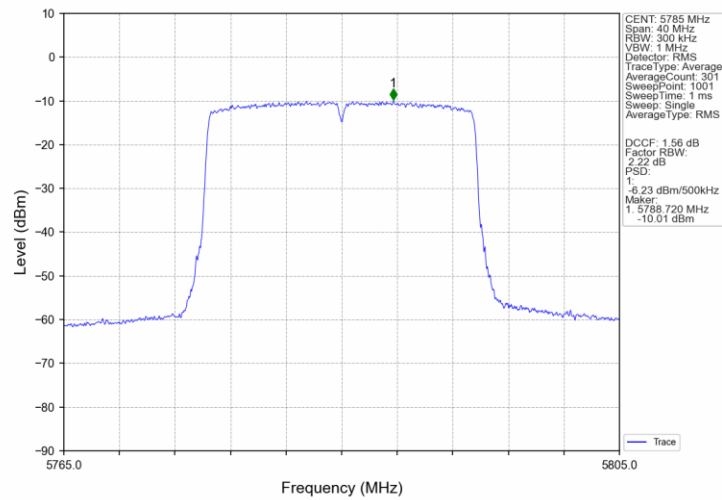


802.11ax(HEW20)_MCH_5785MHz_SU_/_MIMO_NTNV

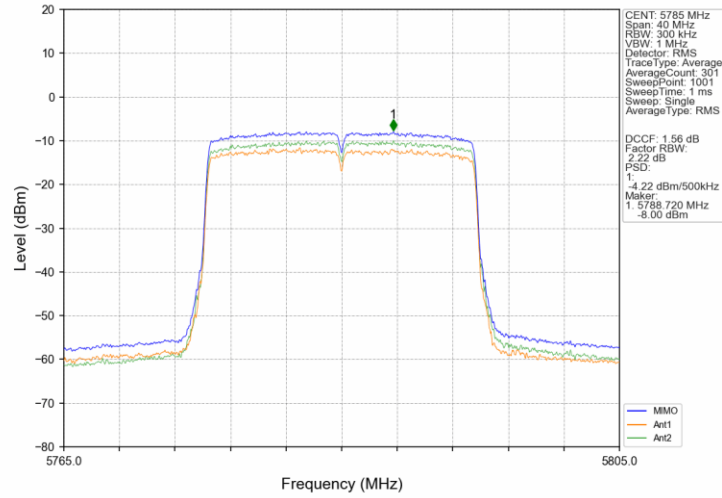


802.11ax(HEW20)_HCH_5825MHz_SU_/_Ant1_NTNV

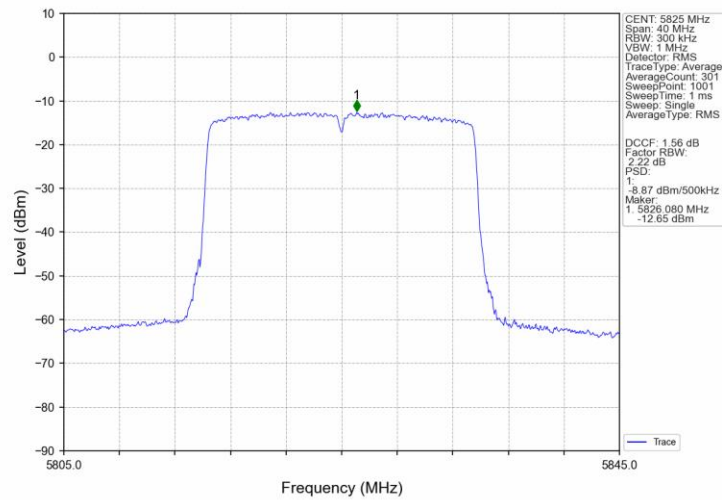


802.11ax(HEW20)_HCH_5825MHz_SU_ / _Ant2_NTNV

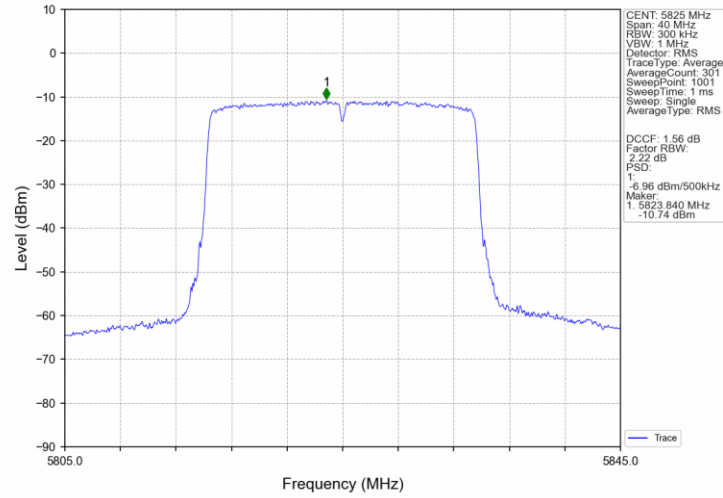


802.11ax(HEW20)_HCH_5825MHz_SU_ / _MIMO_NTNV

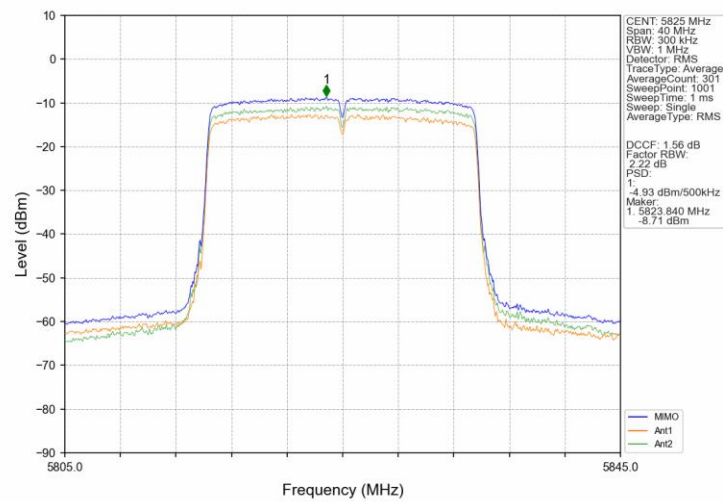


802.11ax(HEW40)_LCH_5755MHz_SU_/_Ant1_NTNV

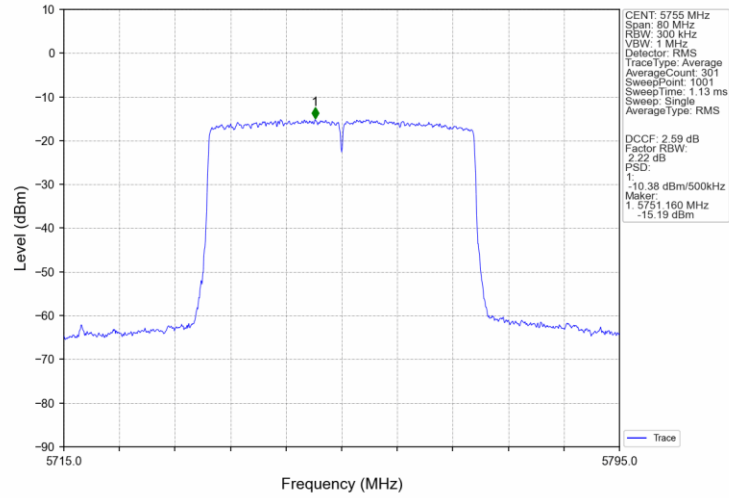


802.11ax(HEW40)_LCH_5755MHz_SU_/_Ant2_NTNV

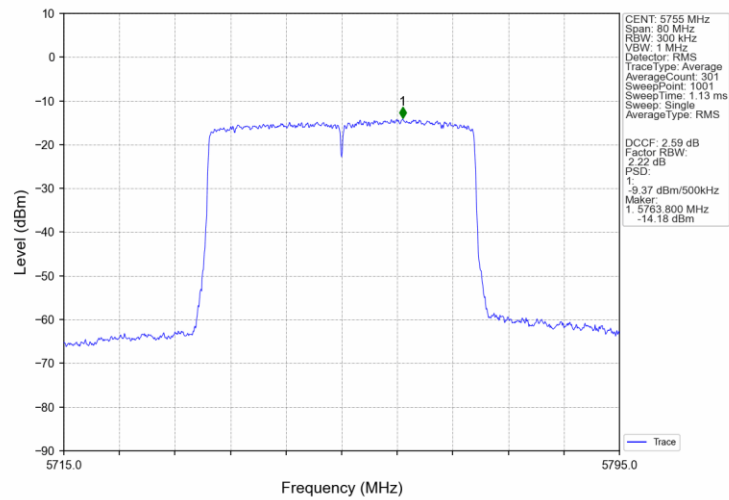


802.11ax(HEW40) LCH 5755MHz_SU / MIMO_NTNV

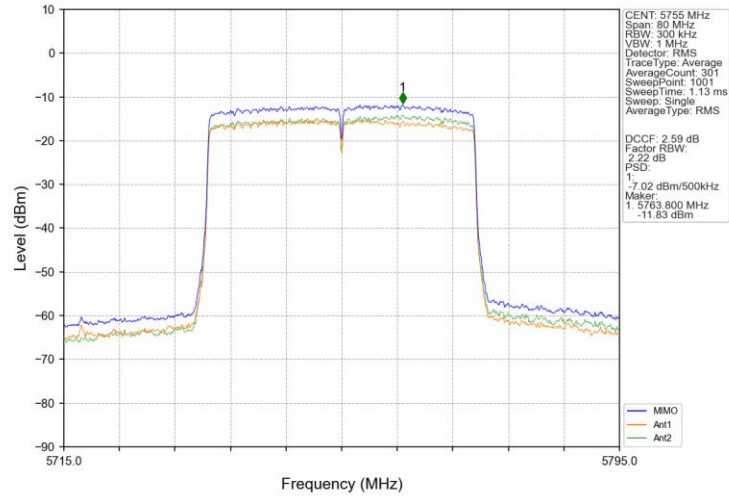


802.11ax(HEW40) HCH 5795MHz_SU / Ant1_NTNV

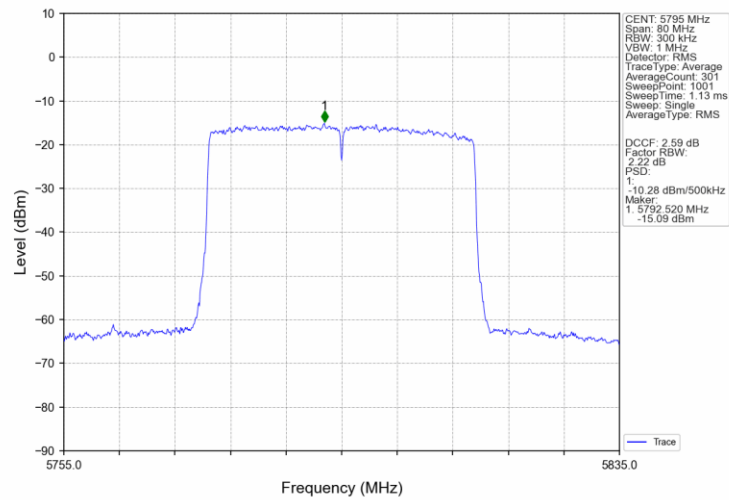


802.11ax(HEW40)_HCH_5795MHz_SU_ / _Ant2_NTNV

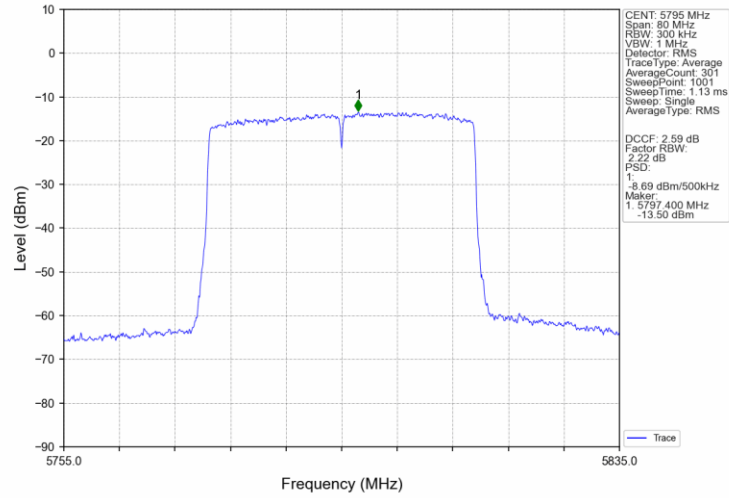


802.11ax(HEW40)_HCH_5795MHz_SU_ / _MIMO_NTNV

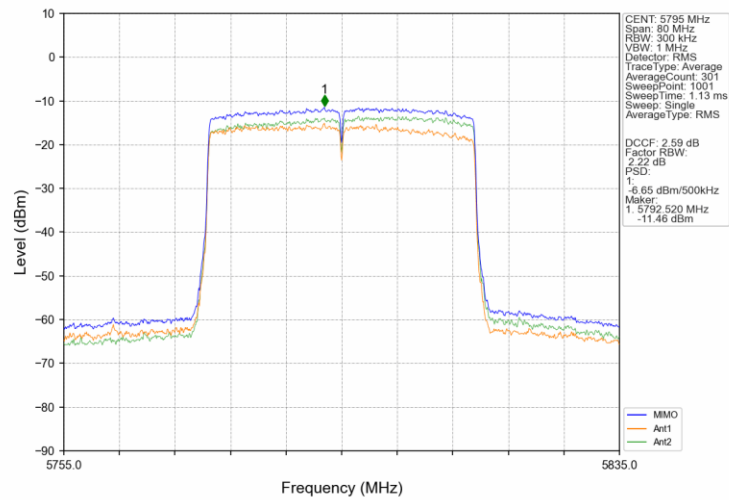


802.11ax(HEW80)_MCH_5775MHz_SU_ / _Ant1_NTNV

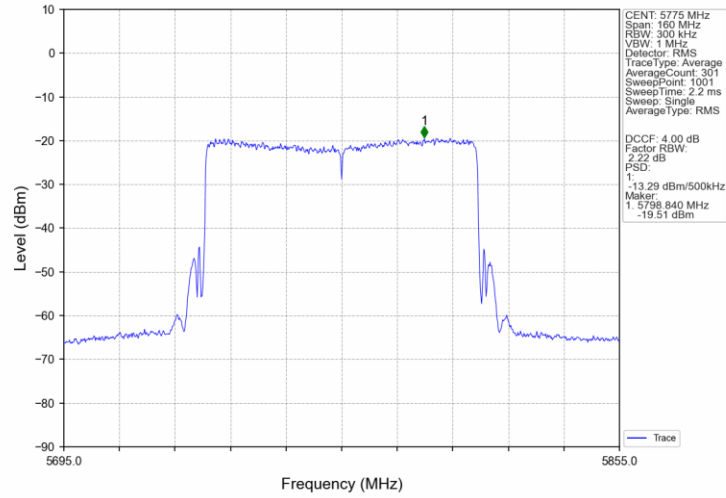

802.11ax(HEW80)_MCH_5775MHz_SU_ / _Ant2_NTNV

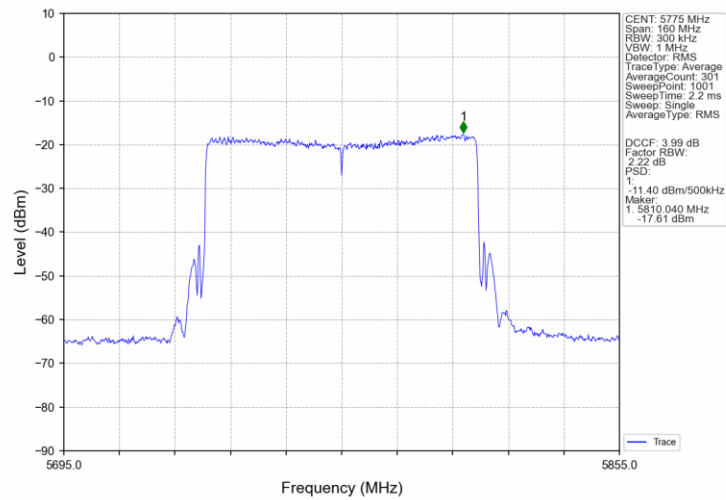

802.11ax(HEW80)_MCH_5775MHz_SU / MIMO_NTNV

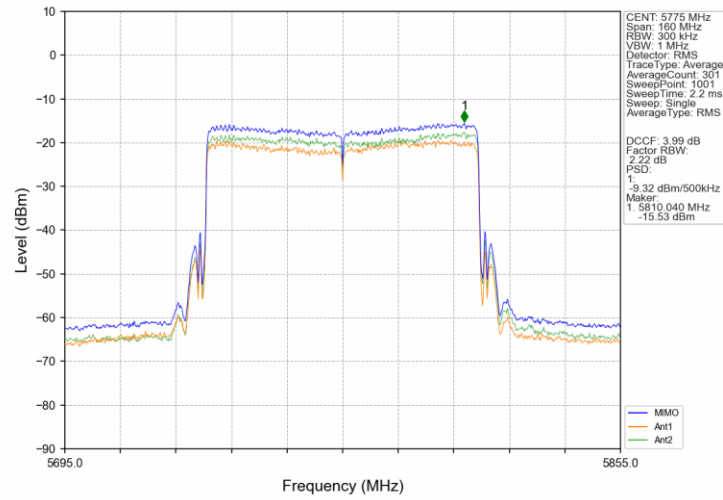

5. Frequency Stability

5.1 Test Result

5.1.1 Ant1

Ant1							
Mode	TX Type	Frequency (MHz)	Temperature (°C)	Voltage	Measured Frequency (MHz)	Limit (MHz)	Verdict
Carrier Wave	SISO	5180	20	LV	5179.969	5150 to 5250	Pass
				NV	5179.969	5150 to 5250	Pass
				HV	5179.969	5150 to 5250	Pass
			-30	NV	5179.969	5150 to 5250	Pass
			-20	NV	5179.969	5150 to 5250	Pass
			-10	NV	5179.969	5150 to 5250	Pass
			0	NV	5179.969	5150 to 5250	Pass
			10	NV	5179.969	5150 to 5250	Pass
			30	NV	5179.969	5150 to 5250	Pass
			40	NV	5179.969	5150 to 5250	Pass
			50	NV	5179.969	5150 to 5250	Pass
		5200	20	LV	5199.968	5150 to 5250	Pass
				NV	5199.968	5150 to 5250	Pass
				HV	5199.968	5150 to 5250	Pass
			-30	NV	5199.968	5150 to 5250	Pass
			-20	NV	5199.968	5150 to 5250	Pass
			-10	NV	5199.968	5150 to 5250	Pass
			0	NV	5199.968	5150 to 5250	Pass
			10	NV	5199.968	5150 to 5250	Pass
			30	NV	5199.968	5150 to 5250	Pass
			40	NV	5199.968	5150 to 5250	Pass
			50	NV	5199.968	5150 to 5250	Pass
		5240	20	LV	5239.968	5150 to 5250	Pass
				NV	5239.968	5150 to 5250	Pass
				HV	5239.968	5150 to 5250	Pass
			-30	NV	5239.968	5150 to 5250	Pass
			-20	NV	5239.968	5150 to 5250	Pass
			-10	NV	5239.968	5150 to 5250	Pass
			0	NV	5239.968	5150 to 5250	Pass
			10	NV	5239.968	5150 to 5250	Pass
			30	NV	5239.968	5150 to 5250	Pass
			40	NV	5239.968	5150 to 5250	Pass
			50	NV	5239.968	5150 to 5250	Pass
		5260	20	LV	5259.968	5250 to 5350	Pass
				NV	5259.968	5250 to 5350	Pass
				HV	5259.968	5250 to 5350	Pass
			-30	NV	5259.968	5250 to 5350	Pass
			-20	NV	5259.968	5250 to 5350	Pass
			-10	NV	5259.968	5250 to 5350	Pass
			0	NV	5259.968	5250 to 5350	Pass
			10	NV	5259.968	5250 to 5350	Pass
			30	NV	5259.968	5250 to 5350	Pass
			40	NV	5259.968	5250 to 5350	Pass
			50	NV	5259.968	5250 to 5350	Pass
		5300	20	LV	5299.967	5250 to 5350	Pass
				NV	5299.968	5250 to 5350	Pass

				HV	5299.968	5250 to 5350	Pass
			-30	NV	5299.968	5250 to 5350	Pass
			-20	NV	5299.968	5250 to 5350	Pass
			-10	NV	5299.968	5250 to 5350	Pass
			0	NV	5299.968	5250 to 5350	Pass
			10	NV	5299.968	5250 to 5350	Pass
			30	NV	5299.968	5250 to 5350	Pass
			40	NV	5299.968	5250 to 5350	Pass
			50	NV	5299.968	5250 to 5350	Pass
		5320	20	LV	5319.967	5250 to 5350	Pass
				NV	5319.967	5250 to 5350	Pass
				HV	5319.968	5250 to 5350	Pass
			-30	NV	5319.968	5250 to 5350	Pass
			-20	NV	5319.968	5250 to 5350	Pass
			-10	NV	5319.968	5250 to 5350	Pass
			0	NV	5319.968	5250 to 5350	Pass
			10	NV	5319.968	5250 to 5350	Pass
			30	NV	5319.968	5250 to 5350	Pass
			40	NV	5319.968	5250 to 5350	Pass
			50	NV	5319.968	5250 to 5350	Pass
		5500	20	LV	5499.966	5470 to 5725	Pass
				NV	5499.966	5470 to 5725	Pass
				HV	5499.966	5470 to 5725	Pass
			-30	NV	5499.966	5470 to 5725	Pass
			-20	NV	5499.966	5470 to 5725	Pass
			-10	NV	5499.967	5470 to 5725	Pass
			0	NV	5499.966	5470 to 5725	Pass
			10	NV	5499.967	5470 to 5725	Pass
			30	NV	5499.967	5470 to 5725	Pass
			40	NV	5499.967	5470 to 5725	Pass
			50	NV	5499.967	5470 to 5725	Pass
		5580	20	LV	5579.965	5470 to 5725	Pass
				NV	5579.966	5470 to 5725	Pass
				HV	5579.966	5470 to 5725	Pass
			-30	NV	5579.966	5470 to 5725	Pass
			-20	NV	5579.966	5470 to 5725	Pass
			-10	NV	5579.966	5470 to 5725	Pass
			0	NV	5579.966	5470 to 5725	Pass
			10	NV	5579.966	5470 to 5725	Pass
			30	NV	5579.966	5470 to 5725	Pass
			40	NV	5579.966	5470 to 5725	Pass
			50	NV	5579.966	5470 to 5725	Pass
		5700	20	LV	5699.965	5470 to 5725	Pass
				NV	5699.965	5470 to 5725	Pass
				HV	5699.965	5470 to 5725	Pass
			-30	NV	5699.965	5470 to 5725	Pass
			-20	NV	5699.965	5470 to 5725	Pass
			-10	NV	5699.965	5470 to 5725	Pass
			0	NV	5699.965	5470 to 5725	Pass
			10	NV	5699.965	5470 to 5725	Pass
			30	NV	5699.965	5470 to 5725	Pass
			40	NV	5699.965	5470 to 5725	Pass
			50	NV	5699.965	5470 to 5725	Pass
		5745	20	LV	5744.965	5725 to 5850	Pass
				NV	5744.965	5725 to 5850	Pass
				HV	5744.965	5725 to 5850	Pass
			-30	NV	5744.965	5725 to 5850	Pass
			-20	NV	5744.965	5725 to 5850	Pass
			-10	NV	5744.965	5725 to 5850	Pass

260612013FW4

			0	NV	5744.965	5725 to 5850	Pass
			10	NV	5744.965	5725 to 5850	Pass
			30	NV	5744.965	5725 to 5850	Pass
			40	NV	5744.965	5725 to 5850	Pass
			50	NV	5744.965	5725 to 5850	Pass
		5785	20	LV	5784.966	5725 to 5850	Pass
				NV	5784.967	5725 to 5850	Pass
				HV	5784.967	5725 to 5850	Pass
			-30	NV	5784.967	5725 to 5850	Pass
			-20	NV	5784.967	5725 to 5850	Pass
			-10	NV	5784.967	5725 to 5850	Pass
			0	NV	5784.967	5725 to 5850	Pass
			10	NV	5784.967	5725 to 5850	Pass
			30	NV	5784.967	5725 to 5850	Pass
			40	NV	5784.967	5725 to 5850	Pass
			50	NV	5784.967	5725 to 5850	Pass
		5825	20	LV	5824.971	5725 to 5850	Pass
				NV	5824.971	5725 to 5850	Pass
				HV	5824.970	5725 to 5850	Pass
			-30	NV	5824.970	5725 to 5850	Pass
			-20	NV	5824.969	5725 to 5850	Pass
			-10	NV	5824.969	5725 to 5850	Pass
			0	NV	5824.969	5725 to 5850	Pass
			10	NV	5824.968	5725 to 5850	Pass
			30	NV	5824.968	5725 to 5850	Pass
			40	NV	5824.968	5725 to 5850	Pass
			50	NV	5824.968	5725 to 5850	Pass
	MIMO	5190	20	LV	5189.969	5150 to 5250	Pass
				NV	5189.969	5150 to 5250	Pass
				HV	5189.970	5150 to 5250	Pass
			-30	NV	5189.970	5150 to 5250	Pass
			-20	NV	5189.970	5150 to 5250	Pass
			-10	NV	5189.970	5150 to 5250	Pass
			0	NV	5189.970	5150 to 5250	Pass
			10	NV	5189.970	5150 to 5250	Pass
			30	NV	5189.970	5150 to 5250	Pass
			40	NV	5189.970	5150 to 5250	Pass
			50	NV	5189.970	5150 to 5250	Pass
		5230	20	LV	5229.969	5150 to 5250	Pass
				NV	5229.969	5150 to 5250	Pass
				HV	5229.969	5150 to 5250	Pass
			-30	NV	5229.969	5150 to 5250	Pass
			-20	NV	5229.969	5150 to 5250	Pass
			-10	NV	5229.969	5150 to 5250	Pass
			0	NV	5229.969	5150 to 5250	Pass
			10	NV	5229.969	5150 to 5250	Pass
			30	NV	5229.969	5150 to 5250	Pass
			40	NV	5229.969	5150 to 5250	Pass
			50	NV	5229.969	5150 to 5250	Pass
		5270	20	LV	5269.968	5250 to 5350	Pass
				NV	5269.968	5250 to 5350	Pass
				HV	5269.968	5250 to 5350	Pass
			-30	NV	5269.968	5250 to 5350	Pass
			-20	NV	5269.969	5250 to 5350	Pass
			-10	NV	5269.969	5250 to 5350	Pass
			0	NV	5269.969	5250 to 5350	Pass
			10	NV	5269.969	5250 to 5350	Pass
			30	NV	5269.969	5250 to 5350	Pass
			40	NV	5269.969	5250 to 5350	Pass

			50	NV	5269.969	5250 to 5350	Pass
		5310	20	LV	5309.968	5250 to 5350	Pass
				NV	5309.968	5250 to 5350	Pass
				HV	5309.968	5250 to 5350	Pass
				NV	5309.968	5250 to 5350	Pass
			-30	NV	5309.968	5250 to 5350	Pass
			-20	NV	5309.968	5250 to 5350	Pass
			-10	NV	5309.968	5250 to 5350	Pass
			0	NV	5309.968	5250 to 5350	Pass
			10	NV	5309.968	5250 to 5350	Pass
			30	NV	5309.968	5250 to 5350	Pass
			40	NV	5309.968	5250 to 5350	Pass
			50	NV	5309.968	5250 to 5350	Pass
		5510	20	LV	5509.967	5470 to 5725	Pass
				NV	5509.967	5470 to 5725	Pass
				HV	5509.967	5470 to 5725	Pass
				NV	5509.967	5470 to 5725	Pass
			-30	NV	5509.967	5470 to 5725	Pass
			-20	NV	5509.967	5470 to 5725	Pass
			-10	NV	5509.967	5470 to 5725	Pass
			0	NV	5509.967	5470 to 5725	Pass
			10	NV	5509.967	5470 to 5725	Pass
			30	NV	5509.967	5470 to 5725	Pass
			40	NV	5509.967	5470 to 5725	Pass
			50	NV	5509.967	5470 to 5725	Pass
		5550	20	LV	5549.966	5470 to 5725	Pass
				NV	5549.966	5470 to 5725	Pass
				HV	5549.966	5470 to 5725	Pass
				NV	5549.966	5470 to 5725	Pass
			-30	NV	5549.966	5470 to 5725	Pass
			-20	NV	5549.967	5470 to 5725	Pass
			-10	NV	5549.967	5470 to 5725	Pass
			0	NV	5549.967	5470 to 5725	Pass
			10	NV	5549.967	5470 to 5725	Pass
			30	NV	5549.967	5470 to 5725	Pass
			40	NV	5549.967	5470 to 5725	Pass
			50	NV	5549.967	5470 to 5725	Pass
		5670	20	LV	5669.966	5470 to 5725	Pass
				NV	5669.966	5470 to 5725	Pass
				HV	5669.966	5470 to 5725	Pass
				NV	5669.966	5470 to 5725	Pass
			-30	NV	5669.966	5470 to 5725	Pass
			-20	NV	5669.966	5470 to 5725	Pass
			-10	NV	5669.966	5470 to 5725	Pass
			0	NV	5669.966	5470 to 5725	Pass
			10	NV	5669.966	5470 to 5725	Pass
			30	NV	5669.966	5470 to 5725	Pass
			40	NV	5669.966	5470 to 5725	Pass
			50	NV	5669.966	5470 to 5725	Pass
		5755	20	LV	5754.965	5725 to 5850	Pass
				NV	5754.965	5725 to 5850	Pass
				HV	5754.965	5725 to 5850	Pass
				NV	5754.965	5725 to 5850	Pass
			-30	NV	5754.965	5725 to 5850	Pass
			-20	NV	5754.965	5725 to 5850	Pass
			-10	NV	5754.965	5725 to 5850	Pass
			0	NV	5754.965	5725 to 5850	Pass
			10	NV	5754.965	5725 to 5850	Pass
			30	NV	5754.965	5725 to 5850	Pass
			40	NV	5754.965	5725 to 5850	Pass
			50	NV	5754.965	5725 to 5850	Pass
		5795	20	LV	5794.964	5725 to 5850	Pass
				NV	5794.965	5725 to 5850	Pass
				HV	5794.965	5725 to 5850	Pass

260612013FW4

			-30	NV	5794.965	5725 to 5850	Pass
			-20	NV	5794.965	5725 to 5850	Pass
			-10	NV	5794.965	5725 to 5850	Pass
			0	NV	5794.965	5725 to 5850	Pass
			10	NV	5794.965	5725 to 5850	Pass
			30	NV	5794.965	5725 to 5850	Pass
			40	NV	5794.965	5725 to 5850	Pass
			50	NV	5794.965	5725 to 5850	Pass
		5210	20	LV	5209.968	5150 to 5250	Pass
				NV	5209.968	5150 to 5250	Pass
				HV	5209.968	5150 to 5250	Pass
			-30	NV	5209.969	5150 to 5250	Pass
			-20	NV	5209.969	5150 to 5250	Pass
			-10	NV	5209.969	5150 to 5250	Pass
			0	NV	5209.969	5150 to 5250	Pass
			10	NV	5209.969	5150 to 5250	Pass
			30	NV	5209.969	5150 to 5250	Pass
			40	NV	5209.969	5150 to 5250	Pass
			50	NV	5209.969	5150 to 5250	Pass
		5290	20	LV	5289.968	5250 to 5350	Pass
				NV	5289.968	5250 to 5350	Pass
				HV	5289.968	5250 to 5350	Pass
			-30	NV	5289.968	5250 to 5350	Pass
			-20	NV	5289.968	5250 to 5350	Pass
			-10	NV	5289.968	5250 to 5350	Pass
			0	NV	5289.968	5250 to 5350	Pass
			10	NV	5289.968	5250 to 5350	Pass
			30	NV	5289.968	5250 to 5350	Pass
			40	NV	5289.968	5250 to 5350	Pass
			50	NV	5289.968	5250 to 5350	Pass
		5530	20	LV	5529.966	5470 to 5725	Pass
				NV	5529.966	5470 to 5725	Pass
				HV	5529.966	5470 to 5725	Pass
			-30	NV	5529.966	5470 to 5725	Pass
			-20	NV	5529.966	5470 to 5725	Pass
			-10	NV	5529.966	5470 to 5725	Pass
			0	NV	5529.966	5470 to 5725	Pass
			10	NV	5529.966	5470 to 5725	Pass
			30	NV	5529.966	5470 to 5725	Pass
			40	NV	5529.966	5470 to 5725	Pass
			50	NV	5529.966	5470 to 5725	Pass
		5610	20	LV	5609.966	5470 to 5725	Pass
				NV	5609.966	5470 to 5725	Pass
				HV	5609.966	5470 to 5725	Pass
			-30	NV	5609.966	5470 to 5725	Pass
			-20	NV	5609.966	5470 to 5725	Pass
			-10	NV	5609.966	5470 to 5725	Pass
			0	NV	5609.966	5470 to 5725	Pass
			10	NV	5609.966	5470 to 5725	Pass
			30	NV	5609.966	5470 to 5725	Pass
			40	NV	5609.966	5470 to 5725	Pass
			50	NV	5609.966	5470 to 5725	Pass
		5775	20	LV	5774.965	5725 to 5850	Pass
				NV	5774.965	5725 to 5850	Pass
				HV	5774.965	5725 to 5850	Pass
			-30	NV	5774.965	5725 to 5850	Pass
			-20	NV	5774.965	5725 to 5850	Pass
			-10	NV	5774.965	5725 to 5850	Pass
			0	NV	5774.965	5725 to 5850	Pass

260612013FW4

			10	NV	5774.965	5725 to 5850	Pass
			30	NV	5774.965	5725 to 5850	Pass
			40	NV	5774.965	5725 to 5850	Pass
			50	NV	5774.965	5725 to 5850	Pass

5.1.2 Ant2

Ant2							
Mode	TX Type	Frequency (MHz)	Temperature (°C)	Voltage	Measured Frequency (MHz)	Limit (MHz)	Verdict
Carrier Wave	SISO	5180	20	LV	5179.969	5150 to 5250	Pass
				NV	5179.969	5150 to 5250	Pass
				HV	5179.969	5150 to 5250	Pass
			-30	NV	5179.969	5150 to 5250	Pass
			-20	NV	5179.969	5150 to 5250	Pass
			-10	NV	5179.969	5150 to 5250	Pass
			0	NV	5179.969	5150 to 5250	Pass
			10	NV	5179.969	5150 to 5250	Pass
			30	NV	5179.969	5150 to 5250	Pass
			40	NV	5179.969	5150 to 5250	Pass
			50	NV	5179.969	5150 to 5250	Pass
		5200	20	LV	5199.968	5150 to 5250	Pass
				NV	5199.968	5150 to 5250	Pass
				HV	5199.968	5150 to 5250	Pass
			-30	NV	5199.968	5150 to 5250	Pass
			-20	NV	5199.968	5150 to 5250	Pass
			-10	NV	5199.968	5150 to 5250	Pass
			0	NV	5199.968	5150 to 5250	Pass
			10	NV	5199.968	5150 to 5250	Pass
			30	NV	5199.968	5150 to 5250	Pass
			40	NV	5199.968	5150 to 5250	Pass
			50	NV	5199.968	5150 to 5250	Pass
		5240	20	LV	5239.968	5150 to 5250	Pass
				NV	5239.968	5150 to 5250	Pass
				HV	5239.968	5150 to 5250	Pass
			-30	NV	5239.968	5150 to 5250	Pass
			-20	NV	5239.968	5150 to 5250	Pass
			-10	NV	5239.968	5150 to 5250	Pass
			0	NV	5239.968	5150 to 5250	Pass
			10	NV	5239.968	5150 to 5250	Pass
			30	NV	5239.968	5150 to 5250	Pass
			40	NV	5239.968	5150 to 5250	Pass
			50	NV	5239.968	5150 to 5250	Pass
		5260	20	LV	5259.968	5250 to 5350	Pass
				NV	5259.968	5250 to 5350	Pass
				HV	5259.968	5250 to 5350	Pass
			-30	NV	5259.968	5250 to 5350	Pass
			-20	NV	5259.968	5250 to 5350	Pass
			-10	NV	5259.968	5250 to 5350	Pass
			0	NV	5259.968	5250 to 5350	Pass
			10	NV	5259.968	5250 to 5350	Pass
			30	NV	5259.968	5250 to 5350	Pass
			40	NV	5259.968	5250 to 5350	Pass
			50	NV	5259.968	5250 to 5350	Pass
		5300	20	LV	5299.968	5250 to 5350	Pass
				NV	5299.968	5250 to 5350	Pass
				HV	5299.968	5250 to 5350	Pass
			-30	NV	5299.968	5250 to 5350	Pass

			-20	NV	5299.968	5250 to 5350	Pass
			-10	NV	5299.968	5250 to 5350	Pass
			0	NV	5299.968	5250 to 5350	Pass
			10	NV	5299.968	5250 to 5350	Pass
			30	NV	5299.968	5250 to 5350	Pass
			40	NV	5299.968	5250 to 5350	Pass
			50	NV	5299.968	5250 to 5350	Pass
		5320	20	LV	5319.968	5250 to 5350	Pass
				NV	5319.968	5250 to 5350	Pass
				HV	5319.968	5250 to 5350	Pass
			-30	NV	5319.968	5250 to 5350	Pass
			-20	NV	5319.968	5250 to 5350	Pass
			-10	NV	5319.968	5250 to 5350	Pass
			0	NV	5319.968	5250 to 5350	Pass
			10	NV	5319.968	5250 to 5350	Pass
			30	NV	5319.968	5250 to 5350	Pass
			40	NV	5319.968	5250 to 5350	Pass
			50	NV	5319.968	5250 to 5350	Pass
		5500	20	LV	5499.966	5470 to 5725	Pass
				NV	5499.966	5470 to 5725	Pass
				HV	5499.966	5470 to 5725	Pass
			-30	NV	5499.966	5470 to 5725	Pass
			-20	NV	5499.966	5470 to 5725	Pass
			-10	NV	5499.966	5470 to 5725	Pass
			0	NV	5499.966	5470 to 5725	Pass
			10	NV	5499.966	5470 to 5725	Pass
			30	NV	5499.966	5470 to 5725	Pass
			40	NV	5499.966	5470 to 5725	Pass
			50	NV	5499.967	5470 to 5725	Pass
		5580	20	LV	5579.966	5470 to 5725	Pass
				NV	5579.966	5470 to 5725	Pass
				HV	5579.966	5470 to 5725	Pass
			-30	NV	5579.966	5470 to 5725	Pass
			-20	NV	5579.966	5470 to 5725	Pass
			-10	NV	5579.966	5470 to 5725	Pass
			0	NV	5579.966	5470 to 5725	Pass
			10	NV	5579.966	5470 to 5725	Pass
			30	NV	5579.966	5470 to 5725	Pass
			40	NV	5579.966	5470 to 5725	Pass
			50	NV	5579.966	5470 to 5725	Pass
		5700	20	LV	5699.966	5470 to 5725	Pass
				NV	5699.966	5470 to 5725	Pass
				HV	5699.966	5470 to 5725	Pass
			-30	NV	5699.966	5470 to 5725	Pass
			-20	NV	5699.966	5470 to 5725	Pass
			-10	NV	5699.966	5470 to 5725	Pass
			0	NV	5699.966	5470 to 5725	Pass
			10	NV	5699.966	5470 to 5725	Pass
			30	NV	5699.966	5470 to 5725	Pass
			40	NV	5699.966	5470 to 5725	Pass
			50	NV	5699.966	5470 to 5725	Pass
		5745	20	LV	5744.964	5725 to 5850	Pass
				NV	5744.964	5725 to 5850	Pass
				HV	5744.964	5725 to 5850	Pass
			-30	NV	5744.964	5725 to 5850	Pass
			-20	NV	5744.964	5725 to 5850	Pass
			-10	NV	5744.964	5725 to 5850	Pass
			0	NV	5744.964	5725 to 5850	Pass
			10	NV	5744.964	5725 to 5850	Pass

260612013FW4

		5785	30	NV	5744.964	5725 to 5850	Pass
			40	NV	5744.964	5725 to 5850	Pass
			50	NV	5744.965	5725 to 5850	Pass
			20	LV	5784.967	5725 to 5850	Pass
				NV	5784.967	5725 to 5850	Pass
				HV	5784.967	5725 to 5850	Pass
			-30	NV	5784.967	5725 to 5850	Pass
			-20	NV	5784.967	5725 to 5850	Pass
			-10	NV	5784.967	5725 to 5850	Pass
			0	NV	5784.967	5725 to 5850	Pass
			10	NV	5784.967	5725 to 5850	Pass
			30	NV	5784.967	5725 to 5850	Pass
			40	NV	5784.967	5725 to 5850	Pass
			50	NV	5784.967	5725 to 5850	Pass
		5825	20	LV	5824.967	5725 to 5850	Pass
				NV	5824.967	5725 to 5850	Pass
				HV	5824.967	5725 to 5850	Pass
			-30	NV	5824.967	5725 to 5850	Pass
			-20	NV	5824.967	5725 to 5850	Pass
			-10	NV	5824.967	5725 to 5850	Pass
			0	NV	5824.967	5725 to 5850	Pass
			10	NV	5824.967	5725 to 5850	Pass
			30	NV	5824.967	5725 to 5850	Pass
			40	NV	5824.967	5725 to 5850	Pass
			50	NV	5824.967	5725 to 5850	Pass
		5190	20	LV	5189.970	5150 to 5250	Pass
				NV	5189.970	5150 to 5250	Pass
				HV	5189.970	5150 to 5250	Pass
			-30	NV	5189.970	5150 to 5250	Pass
			-20	NV	5189.970	5150 to 5250	Pass
			-10	NV	5189.970	5150 to 5250	Pass
			0	NV	5189.970	5150 to 5250	Pass
			10	NV	5189.970	5150 to 5250	Pass
			30	NV	5189.970	5150 to 5250	Pass
			40	NV	5189.969	5150 to 5250	Pass
			50	NV	5189.969	5150 to 5250	Pass
		5230	20	LV	5229.969	5150 to 5250	Pass
				NV	5229.969	5150 to 5250	Pass
				HV	5229.969	5150 to 5250	Pass
			-30	NV	5229.969	5150 to 5250	Pass
			-20	NV	5229.969	5150 to 5250	Pass
			-10	NV	5229.969	5150 to 5250	Pass
			0	NV	5229.969	5150 to 5250	Pass
			10	NV	5229.969	5150 to 5250	Pass
			30	NV	5229.969	5150 to 5250	Pass
			40	NV	5229.969	5150 to 5250	Pass
			50	NV	5229.969	5150 to 5250	Pass
		5270	20	LV	5269.969	5250 to 5350	Pass
				NV	5269.969	5250 to 5350	Pass
				HV	5269.969	5250 to 5350	Pass
			-30	NV	5269.969	5250 to 5350	Pass
			-20	NV	5269.969	5250 to 5350	Pass
			-10	NV	5269.969	5250 to 5350	Pass
			0	NV	5269.969	5250 to 5350	Pass
			10	NV	5269.969	5250 to 5350	Pass
			30	NV	5269.969	5250 to 5350	Pass
			40	NV	5269.969	5250 to 5350	Pass
			50	NV	5269.969	5250 to 5350	Pass
		5310	20	LV	5309.968	5250 to 5350	Pass

				NV	5309.968	5250 to 5350	Pass
				HV	5309.968	5250 to 5350	Pass
			-30	NV	5309.968	5250 to 5350	Pass
			-20	NV	5309.968	5250 to 5350	Pass
			-10	NV	5309.968	5250 to 5350	Pass
			0	NV	5309.968	5250 to 5350	Pass
			10	NV	5309.968	5250 to 5350	Pass
			30	NV	5309.968	5250 to 5350	Pass
			40	NV	5309.969	5250 to 5350	Pass
			50	NV	5309.968	5250 to 5350	Pass
		5510	20	LV	5509.967	5470 to 5725	Pass
				NV	5509.967	5470 to 5725	Pass
				HV	5509.967	5470 to 5725	Pass
			-30	NV	5509.967	5470 to 5725	Pass
			-20	NV	5509.967	5470 to 5725	Pass
			-10	NV	5509.967	5470 to 5725	Pass
			0	NV	5509.967	5470 to 5725	Pass
			10	NV	5509.967	5470 to 5725	Pass
			30	NV	5509.967	5470 to 5725	Pass
			40	NV	5509.967	5470 to 5725	Pass
			50	NV	5509.967	5470 to 5725	Pass
		5550	20	LV	5549.967	5470 to 5725	Pass
				NV	5549.967	5470 to 5725	Pass
				HV	5549.967	5470 to 5725	Pass
			-30	NV	5549.967	5470 to 5725	Pass
			-20	NV	5549.967	5470 to 5725	Pass
			-10	NV	5549.967	5470 to 5725	Pass
			0	NV	5549.967	5470 to 5725	Pass
			10	NV	5549.967	5470 to 5725	Pass
			30	NV	5549.967	5470 to 5725	Pass
			40	NV	5549.967	5470 to 5725	Pass
			50	NV	5549.967	5470 to 5725	Pass
		5670	20	LV	5669.966	5470 to 5725	Pass
				NV	5669.966	5470 to 5725	Pass
				HV	5669.966	5470 to 5725	Pass
			-30	NV	5669.966	5470 to 5725	Pass
			-20	NV	5669.966	5470 to 5725	Pass
			-10	NV	5669.966	5470 to 5725	Pass
			0	NV	5669.966	5470 to 5725	Pass
			10	NV	5669.966	5470 to 5725	Pass
			30	NV	5669.966	5470 to 5725	Pass
			40	NV	5669.966	5470 to 5725	Pass
			50	NV	5669.966	5470 to 5725	Pass
		5755	20	LV	5754.965	5725 to 5850	Pass
				NV	5754.965	5725 to 5850	Pass
				HV	5754.965	5725 to 5850	Pass
			-30	NV	5754.965	5725 to 5850	Pass
			-20	NV	5754.965	5725 to 5850	Pass
			-10	NV	5754.965	5725 to 5850	Pass
			0	NV	5754.965	5725 to 5850	Pass
			10	NV	5754.965	5725 to 5850	Pass
			30	NV	5754.965	5725 to 5850	Pass
			40	NV	5754.965	5725 to 5850	Pass
			50	NV	5754.965	5725 to 5850	Pass
		5795	20	LV	5794.965	5725 to 5850	Pass
				NV	5794.965	5725 to 5850	Pass
				HV	5794.965	5725 to 5850	Pass
			-30	NV	5794.965	5725 to 5850	Pass
			-20	NV	5794.965	5725 to 5850	Pass

260612013FW4

			-10	NV	5794.965	5725 to 5850	Pass
			0	NV	5794.965	5725 to 5850	Pass
			10	NV	5794.965	5725 to 5850	Pass
			30	NV	5794.965	5725 to 5850	Pass
			40	NV	5794.965	5725 to 5850	Pass
			50	NV	5794.965	5725 to 5850	Pass
		5210	20	LV	5209.969	5150 to 5250	Pass
				NV	5209.969	5150 to 5250	Pass
				HV	5209.969	5150 to 5250	Pass
			-30	NV	5209.969	5150 to 5250	Pass
			-20	NV	5209.969	5150 to 5250	Pass
			-10	NV	5209.969	5150 to 5250	Pass
			0	NV	5209.969	5150 to 5250	Pass
			10	NV	5209.969	5150 to 5250	Pass
			30	NV	5209.969	5150 to 5250	Pass
			40	NV	5209.969	5150 to 5250	Pass
			50	NV	5209.969	5150 to 5250	Pass
		5290	20	LV	5289.968	5250 to 5350	Pass
				NV	5289.968	5250 to 5350	Pass
				HV	5289.968	5250 to 5350	Pass
			-30	NV	5289.968	5250 to 5350	Pass
			-20	NV	5289.968	5250 to 5350	Pass
			-10	NV	5289.968	5250 to 5350	Pass
			0	NV	5289.968	5250 to 5350	Pass
			10	NV	5289.968	5250 to 5350	Pass
			30	NV	5289.968	5250 to 5350	Pass
			40	NV	5289.968	5250 to 5350	Pass
			50	NV	5289.968	5250 to 5350	Pass
		5530	20	LV	5529.967	5470 to 5725	Pass
				NV	5529.967	5470 to 5725	Pass
				HV	5529.967	5470 to 5725	Pass
			-30	NV	5529.967	5470 to 5725	Pass
			-20	NV	5529.967	5470 to 5725	Pass
			-10	NV	5529.967	5470 to 5725	Pass
			0	NV	5529.967	5470 to 5725	Pass
			10	NV	5529.967	5470 to 5725	Pass
			30	NV	5529.967	5470 to 5725	Pass
			40	NV	5529.967	5470 to 5725	Pass
			50	NV	5529.967	5470 to 5725	Pass
		5610	20	LV	5609.966	5470 to 5725	Pass
				NV	5609.966	5470 to 5725	Pass
				HV	5609.966	5470 to 5725	Pass
			-30	NV	5609.966	5470 to 5725	Pass
			-20	NV	5609.966	5470 to 5725	Pass
			-10	NV	5609.966	5470 to 5725	Pass
			0	NV	5609.966	5470 to 5725	Pass
			10	NV	5609.966	5470 to 5725	Pass
			30	NV	5609.966	5470 to 5725	Pass
			40	NV	5609.966	5470 to 5725	Pass
			50	NV	5609.966	5470 to 5725	Pass
		5775	20	LV	5774.965	5725 to 5850	Pass
				NV	5774.965	5725 to 5850	Pass
				HV	5774.965	5725 to 5850	Pass
			-30	NV	5774.965	5725 to 5850	Pass
			-20	NV	5774.965	5725 to 5850	Pass
			-10	NV	5774.965	5725 to 5850	Pass
			0	NV	5774.965	5725 to 5850	Pass
			10	NV	5774.965	5725 to 5850	Pass
			30	NV	5774.965	5725 to 5850	Pass



260612013FW4

			40	NV	5774.965	5725 to 5850	Pass
			50	NV	5774.965	5725 to 5850	Pass

6. Form731

6.1 Test Result

6.1.1 Form731

Lower Freq (MHz)	High Freq (MHz)	MAX Power (W)	MAX Power (dBm)
5180	5240	0.0151	11.78
5260	5320	0.0140	11.45
5500	5700	0.0167	12.23
5745	5825	0.0174	12.40
5190	5230	0.0157	11.96
5270	5310	0.0143	11.56
5510	5670	0.0174	12.41
5755	5795	0.0184	12.64
5210	5210	0.0130	11.15
5290	5290	0.0136	11.32
5530	5610	0.0125	10.98
5775	5775	0.0161	12.06

***** End of Report *****