Appendix A: Effective (Isotropic) Radiated Power Output Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band40	5MHz	QPSK	38725	1RB#0	22.25	PASS
Band40	5MHz	QPSK	38725	1RB#12	22.39	PASS
Band40	5MHz	QPSK	38725	1RB#24	22.34	PASS
Band40	5MHz	QPSK	38725	12RB#0	21.24	PASS
Band40	5MHz	QPSK	38725	12RB#6	21.27	PASS
Band40	5MHz	QPSK	38725	12RB#13	21.32	PASS
Band40	5MHz	QPSK	38725	25RB#0	21.33	PASS
Band40	5MHz	QPSK	38750	1RB#0	22.17	PASS
Band40	5MHz	QPSK	38750	1RB#12	22.37	PASS
Band40	5MHz	QPSK	38750	1RB#24	22.30	PASS
Band40	5MHz	QPSK	38750	12RB#0	21.33	PASS
Band40	5MHz	QPSK	38750	12RB#6	21.32	PASS
Band40	5MHz	QPSK	38750	12RB#13	21.36	PASS
Band40	5MHz	QPSK	38750	25RB#0	21.35	PASS
Band40	5MHz	QPSK	38775	1RB#0	22.35	PASS
Band40	5MHz	QPSK	38775	1RB#12	22.57	PASS
Band40	5MHz	QPSK	38775	1RB#24	22.48	PASS
Band40	5MHz	QPSK	38775	12RB#0	21.42	PASS
Band40	5MHz	QPSK	38775	12RB#6	21.44	PASS
Band40	5MHz	QPSK	38775	12RB#13	21.42	PASS
Band40	5MHz	QPSK	38775	25RB#0	21.39	PASS
Band40	5MHz	16QAM	38725	1RB#0	21.56	PASS
Band40	5MHz	16QAM	38725	1RB#12	21.70	PASS
Band40	5MHz	16QAM	38725	1RB#24	21.74	PASS
Band40	5MHz	16QAM	38725	12RB#0	20.26	PASS
Band40	5MHz	16QAM	38725	12RB#6	20.27	PASS
Band40	5MHz	16QAM	38725	12RB#13	20.31	PASS
Band40	5MHz	16QAM	38725	25RB#0	20.36	PASS
Band40	5MHz	16QAM	38750	1RB#0	21.56	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band40	5MHz	16QAM	38750	1RB#12	21.65	PASS
Band40	5MHz	16QAM	38750	1RB#24	21.67	PASS
Band40	5MHz	16QAM	38750	12RB#0	20.39	PASS
Band40	5MHz	16QAM	38750	12RB#6	20.36	PASS
Band40	5MHz	16QAM	38750	12RB#13	20.43	PASS
Band40	5MHz	16QAM	38750	25RB#0	20.37	PASS
Band40	5MHz	16QAM	38775	1RB#0	21.47	PASS
Band40	5MHz	16QAM	38775	1RB#12	21.62	PASS
Band40	5MHz	16QAM	38775	1RB#24	21.53	PASS
Band40	5MHz	16QAM	38775	12RB#0	20.36	PASS
Band40	5MHz	16QAM	38775	12RB#6	20.39	PASS
Band40	5MHz	16QAM	38775	12RB#13	20.38	PASS
Band40	5MHz	16QAM	38775	25RB#0	20.41	PASS
Band40	10MHz	QPSK	38750	1RB#0	22.24	PASS
Band40	10MHz	QPSK	38750	1RB#24	22.53	PASS
Band40	10MHz	QPSK	38750	1RB#49	22.43	PASS
Band40	10MHz	QPSK	38750	25RB#0	21.29	PASS
Band40	10MHz	QPSK	38750	25RB#12	21.30	PASS
Band40	10MHz	QPSK	38750	25RB#25	21.43	PASS
Band40	10MHz	QPSK	38750	50RB#0	21.35	PASS
Band40	10MHz	16QAM	38750	1RB#0	21.45	PASS
Band40	10MHz	16QAM	38750	1RB#24	21.73	PASS
Band40	10MHz	16QAM	38750	1RB#49	21.62	PASS
Band40	10MHz	16QAM	38750	25RB#0	20.34	PASS
Band40	10MHz	16QAM	38750	25RB#12	20.35	PASS
Band40	10MHz	16QAM	38750	25RB#25	20.46	PASS
Band40	10MHz	16QAM	38750	50RB#0	20.31	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band40	5MHz	QPSK	38725	1RB#0	6.02	13	PASS
Band40	5MHz	QPSK	38725	25RB#0	5.80	13	PASS
Band40	5MHz	QPSK	38750	1RB#0	5.08	13	PASS
Band40	5MHz	QPSK	38750	25RB#0	5.60	13	PASS
Band40	5MHz	QPSK	38775	1RB#0	5.64	13	PASS
Band40	5MHz	QPSK	38775	25RB#0	5.61	13	PASS
Band40	5MHz	16QAM	38725	1RB#0	6.78	13	PASS
Band40	5MHz	16QAM	38725	25RB#0	6.50	13	PASS
Band40	5MHz	16QAM	38750	1RB#0	6.91	13	PASS
Band40	5MHz	16QAM	38750	25RB#0	6.35	13	PASS
Band40	5MHz	16QAM	38775	1RB#0	6.32	13	PASS
Band40	5MHz	16QAM	38775	25RB#0	6.18	13	PASS
Band40	10MHz	QPSK	38750	1RB#0	6.56	13	PASS
Band40	10MHz	QPSK	38750	50RB#0	5.66	13	PASS
Band40	10MHz	16QAM	38750	1RB#0	6.40	13	PASS
Band40	10MHz	16QAM	38750	50RB#0	6.37	13	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Test Graphs

Band40-5MHz-QPSK-38725-1RB#0
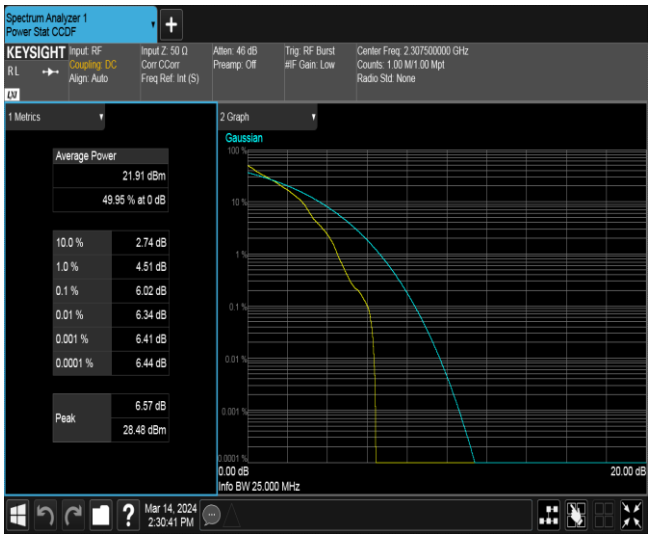

Band40-5MHz-QPSK-38725-25RB#0
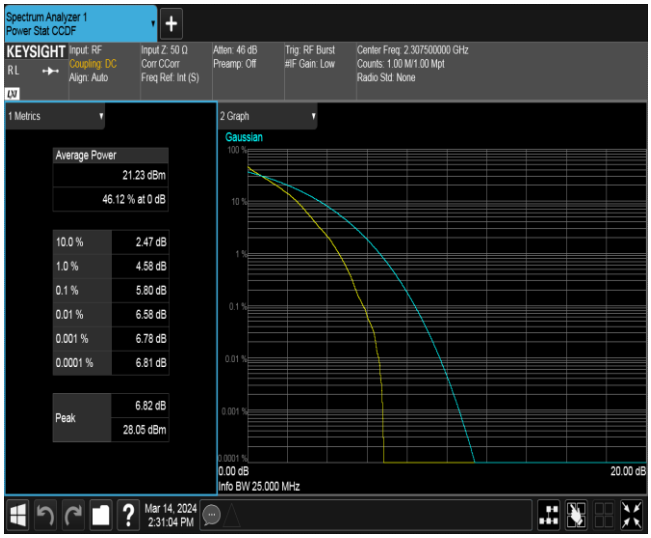

Band40-5MHz-QPSK-38750-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

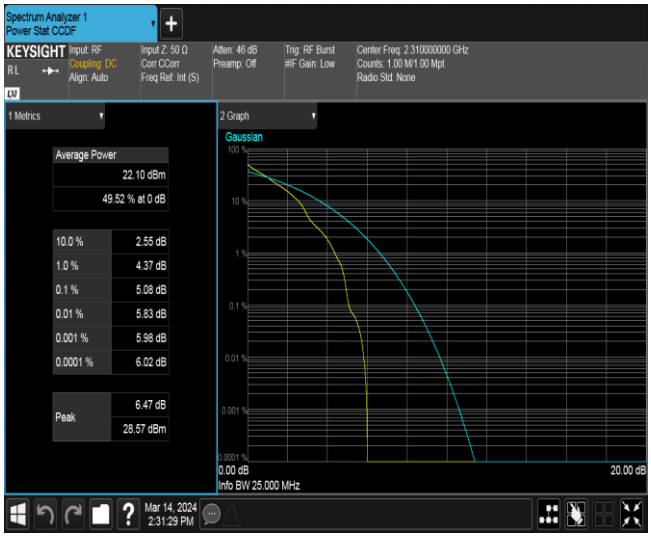

Band40-5MHz-QPSK-38750-25RB#0

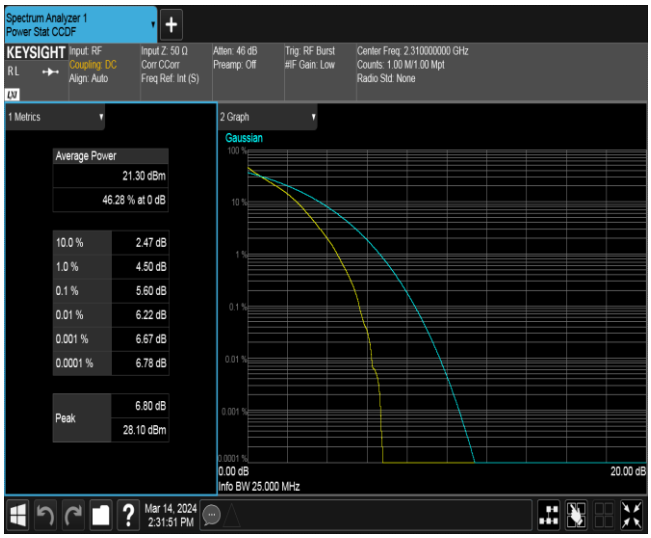

Band40-5MHz-QPSK-38775-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

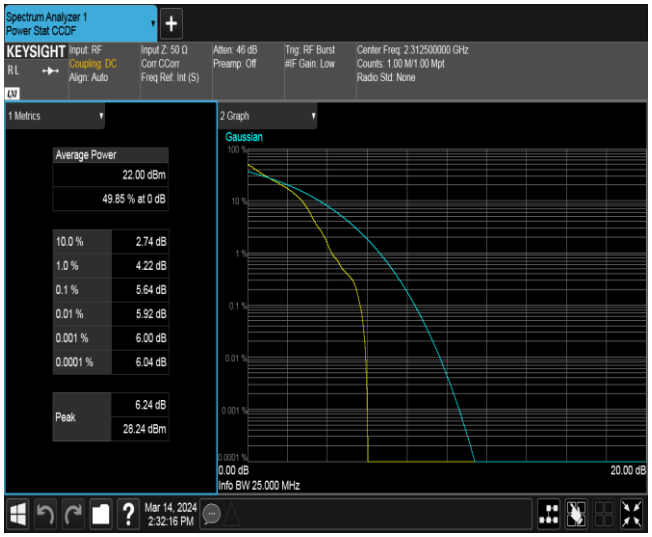

Band40-5MHz-QPSK-38775-25RB#0

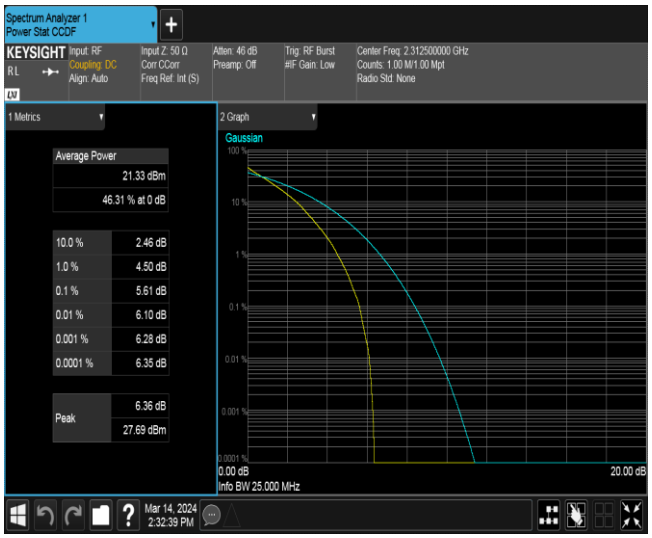

Band40-5MHz-16QAM-38725-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

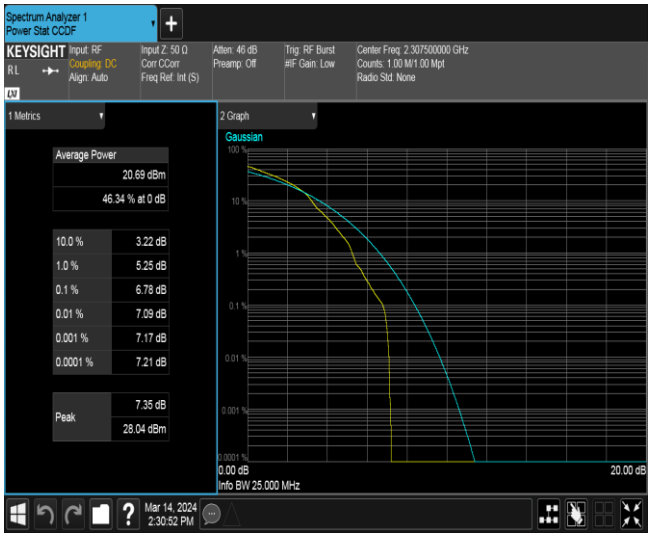

Band40-5MHz-16QAM-38725-25RB#0

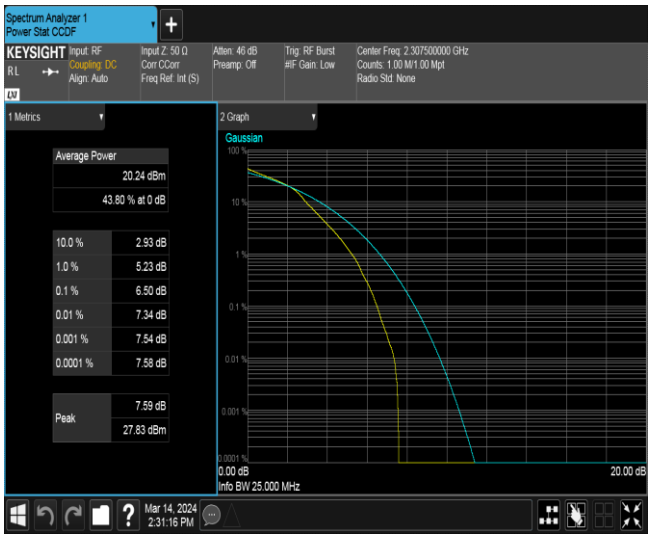

Band40-5MHz-16QAM-38750-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

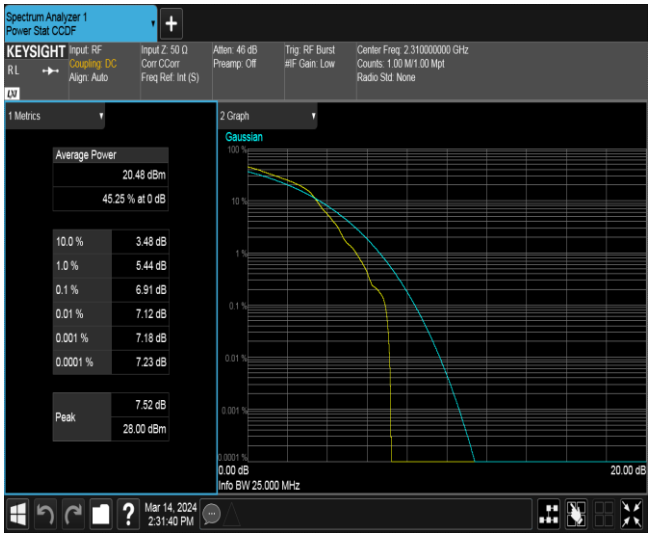

Band40-5MHz-16QAM-38750-25RB#0

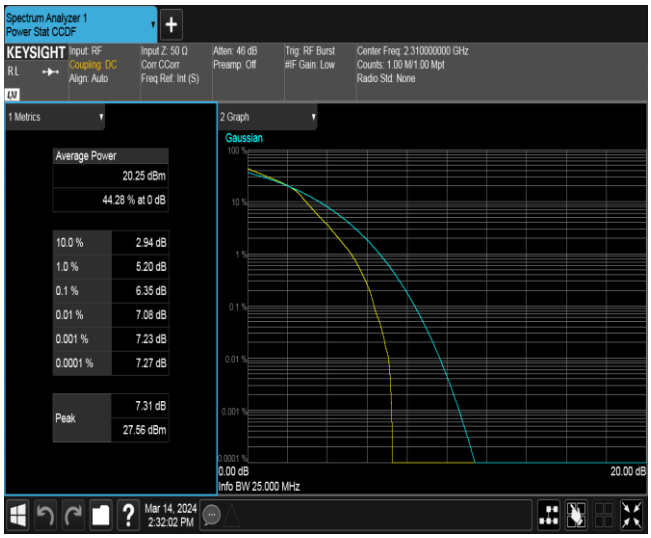

Band40-5MHz-16QAM-38775-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

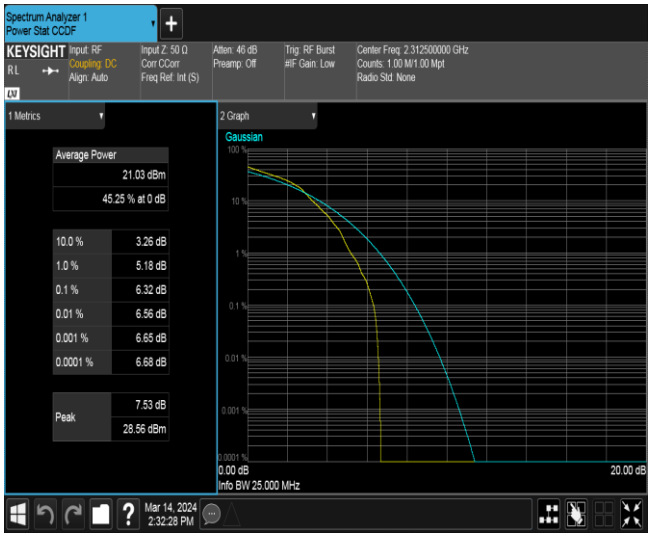

Band40-5MHz-16QAM-38775-25RB#0

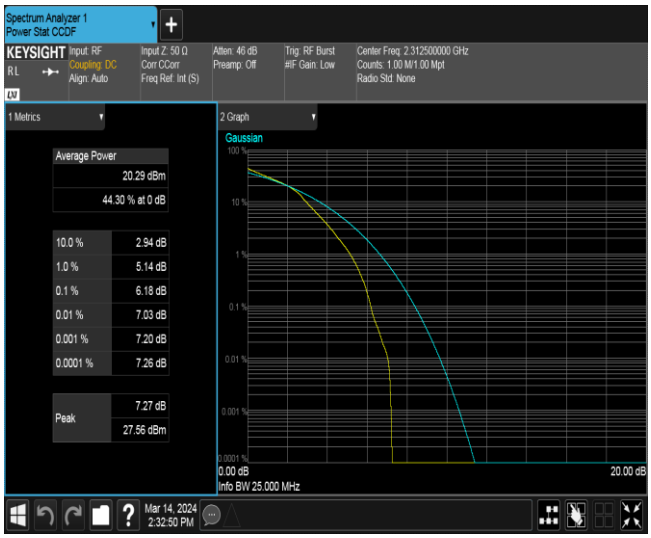

Band40-10MHz-QPSK-38750-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

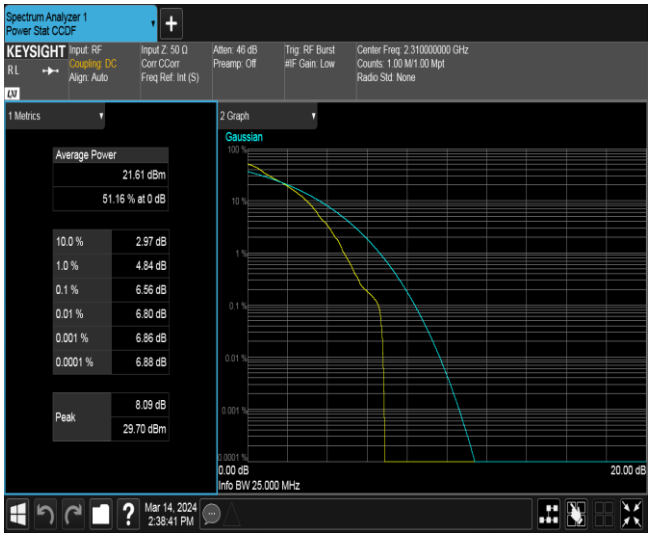

Band40-10MHz-QPSK-38750-50RB#0

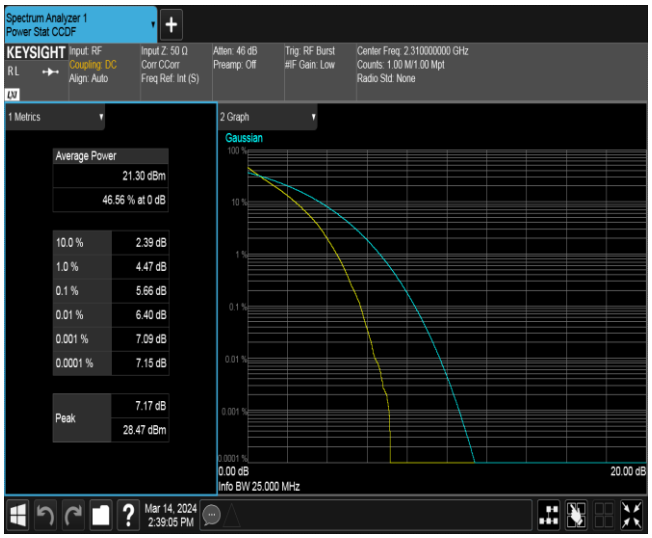

Band40-10MHz-16QAM-38750-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

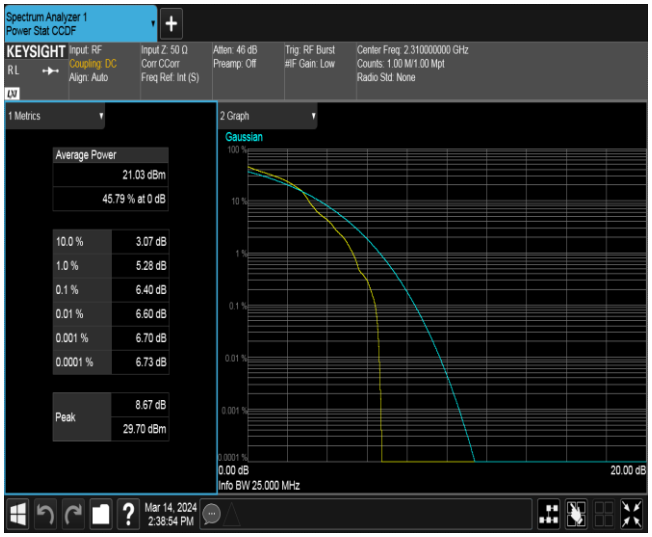

Band40-10MHz-16QAM-38750-50RB#0

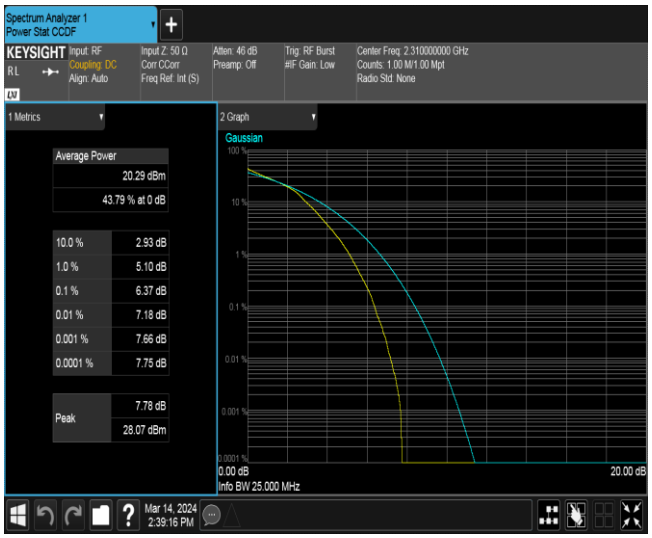

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band40	5MHz	QPSK	38725	25RB#0	4.5025	4.987	PASS
Band40	5MHz	QPSK	38750	25RB#0	4.4954	4.979	PASS
Band40	5MHz	QPSK	38775	25RB#0	4.5000	4.860	PASS
Band40	5MHz	16QAM	38725	25RB#0	4.4978	4.918	PASS
Band40	5MHz	16QAM	38750	25RB#0	4.5011	4.996	PASS
Band40	5MHz	16QAM	38775	25RB#0	4.5092	4.973	PASS
Band40	10MHz	QPSK	38750	50RB#0	8.9686	9.533	PASS
Band40	10MHz	16QAM	38750	50RB#0	8.9763	9.517	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Test Graphs

Band40-5MHz-QPSK-38725-25RB#0
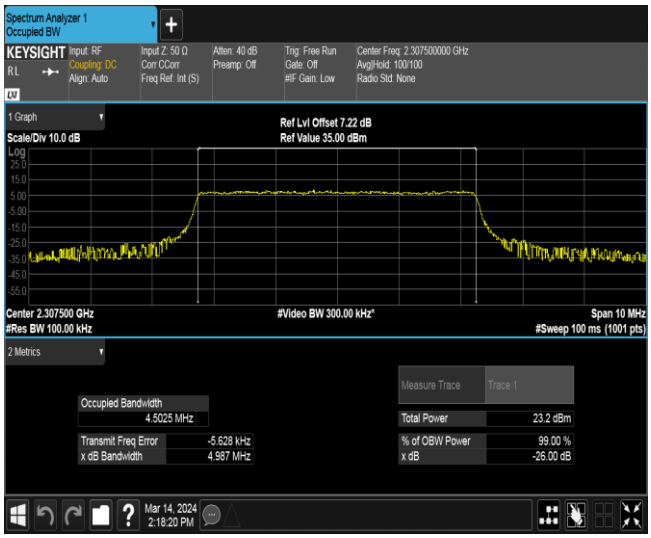
Band40-5MHz-QPSK-38750-25RB#0
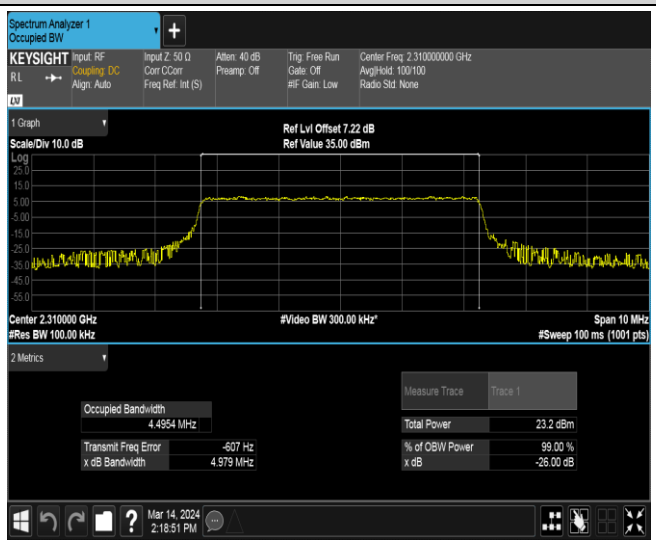
Band40-5MHz-QPSK-38775-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

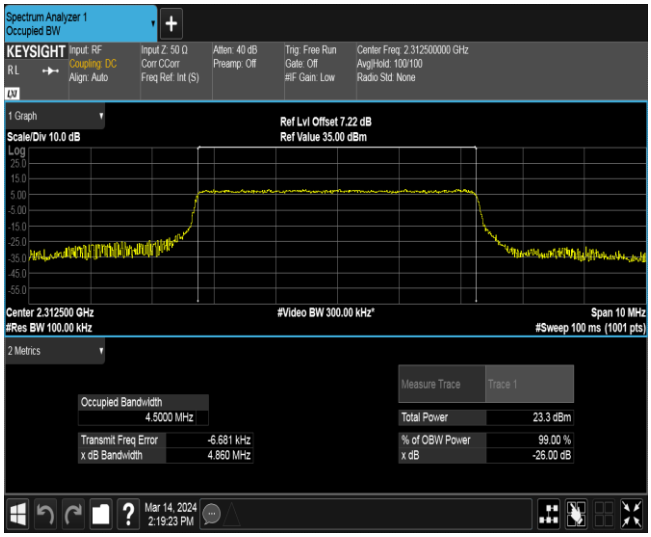

Band40-5MHz-16QAM-38725-25RB#0

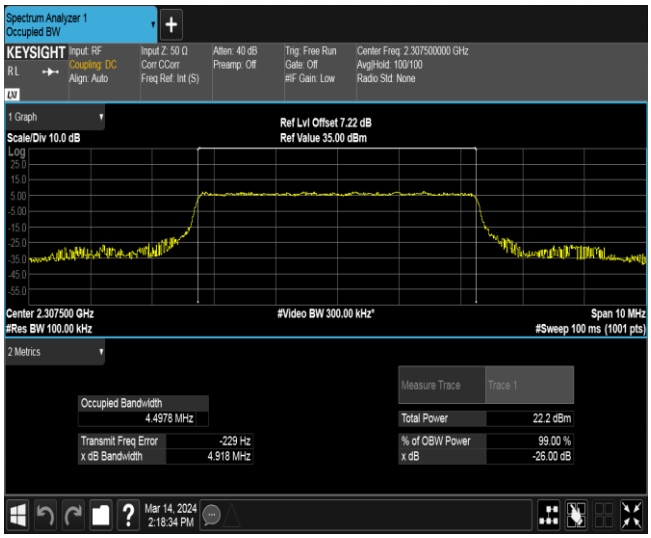

Band40-5MHz-16QAM-38750-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

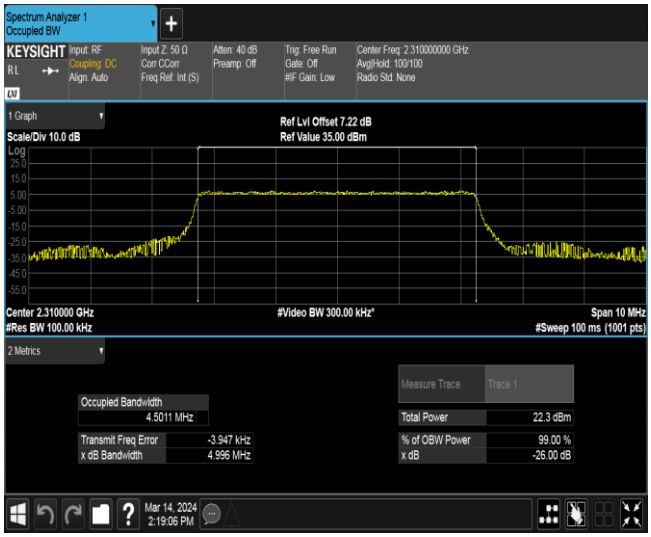

Band40-5MHz-16QAM-38775-25RB#0

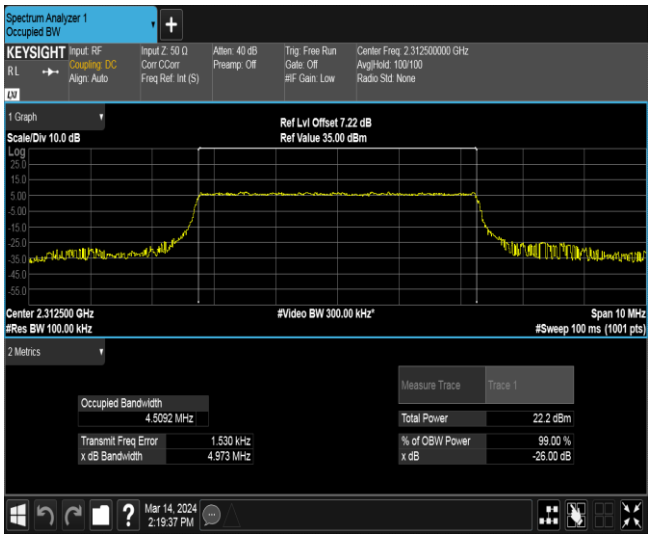

Band40-10MHz-QPSK-38750-50RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

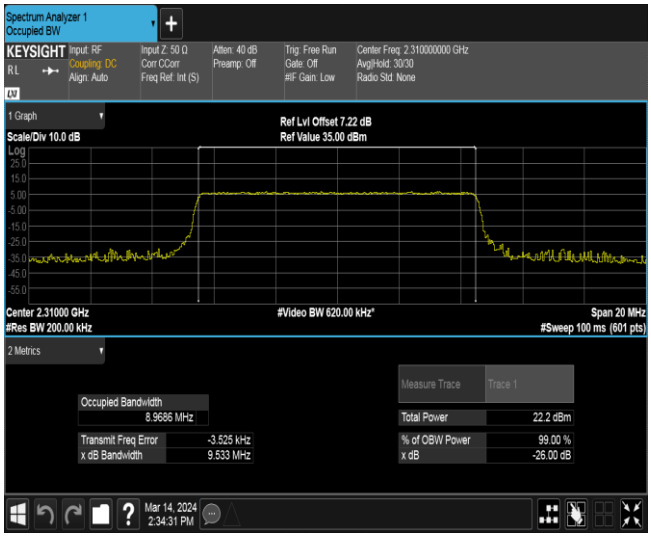

Band40-10MHz-16QAM-38750-50RB#0

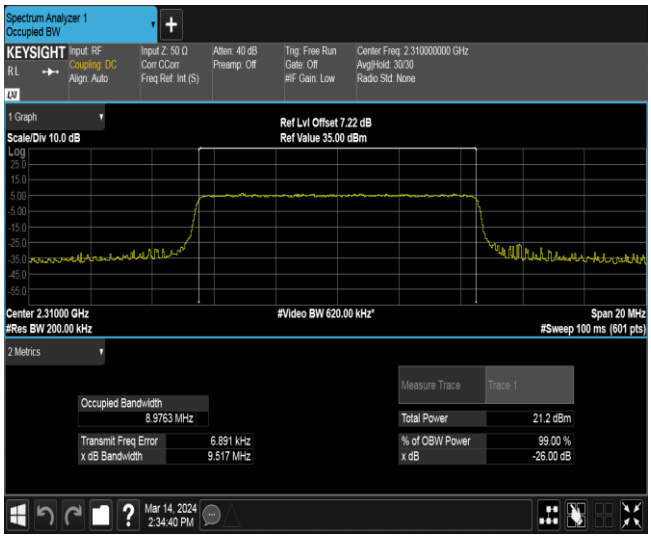

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band40	5MHz	QPSK	38725	1RB#0	-17.61	PASS
Band40	5MHz	QPSK	38725	1RB#24	-43.98	PASS
Band40	5MHz	QPSK	38725	25RB#0	-27.82	PASS
Band40	5MHz	QPSK	38775	1RB#0	-42.92	PASS
Band40	5MHz	QPSK	38775	1RB#24	-16.90	PASS
Band40	5MHz	QPSK	38775	25RB#0	-28.40	PASS
Band40	5MHz	16QAM	38725	1RB#0	-17.69	PASS
Band40	5MHz	16QAM	38725	1RB#24	-43.84	PASS
Band40	5MHz	16QAM	38725	25RB#0	-29.76	PASS
Band40	5MHz	16QAM	38775	1RB#0	-41.51	PASS
Band40	5MHz	16QAM	38775	1RB#24	-15.90	PASS
Band40	5MHz	16QAM	38775	25RB#0	-28.39	PASS
Band40	10MHz	QPSK	38750	1RB#0	-19.61,-42.72	PASS
Band40	10MHz	QPSK	38750	1RB#49	-42.67,-22.37	PASS
Band40	10MHz	QPSK	38750	50RB#0	-34.12,-34.49	PASS
Band40	10MHz	16QAM	38750	1RB#0	-20.97,-44.55	PASS
Band40	10MHz	16QAM	38750	1RB#49	-44.03,-20.07	PASS
Band40	10MHz	16QAM	38750	50RB#0	-35.38,-34.32	PASS

Test Graphs

Band40-5MHz-QPSK-38725-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

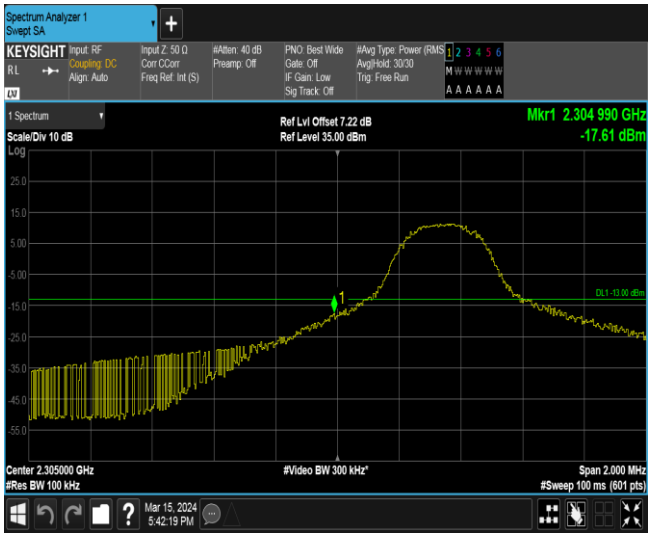

Band40-5MHz-QPSK-38725-1RB#24

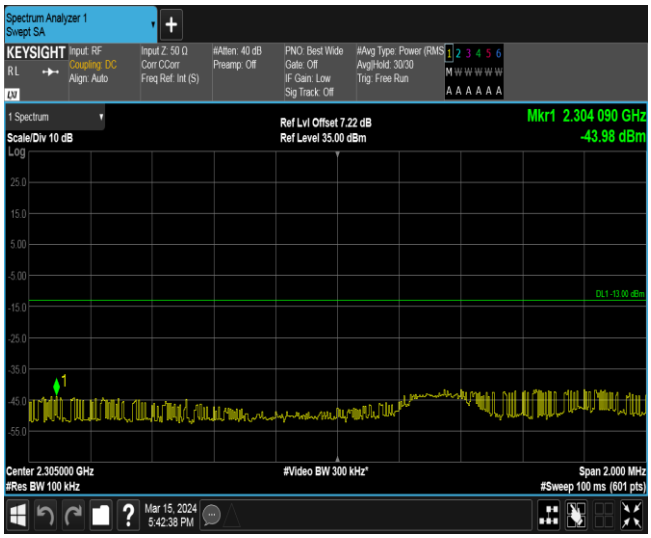

Band40-5MHz-QPSK-38725-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

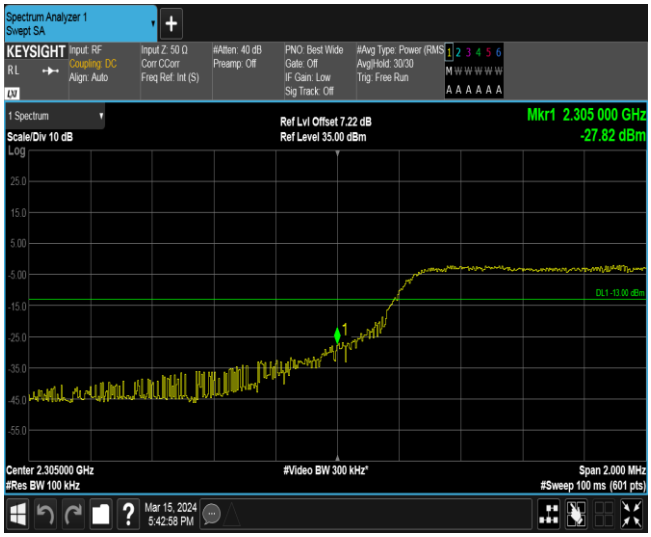

Band40-5MHz-QPSK-38775-1RB#0

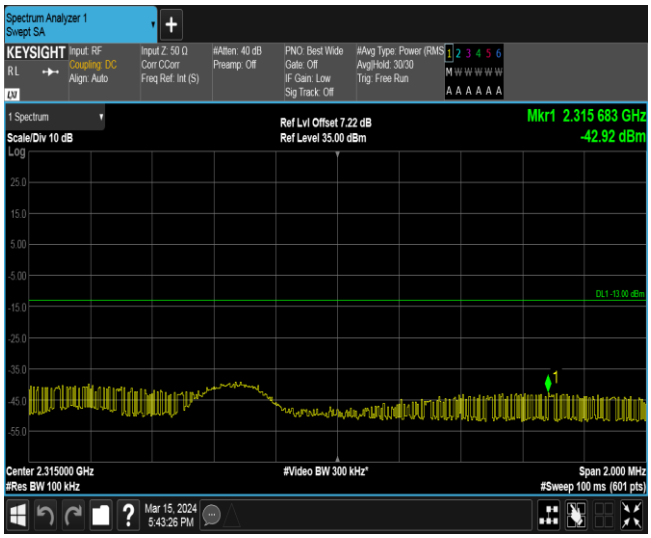

Band40-5MHz-QPSK-38775-1RB#24

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

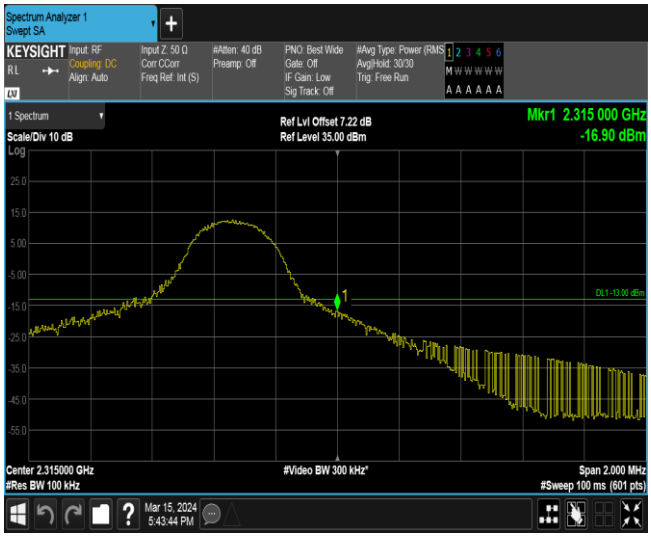

Band40-5MHz-QPSK-38775-25RB#0

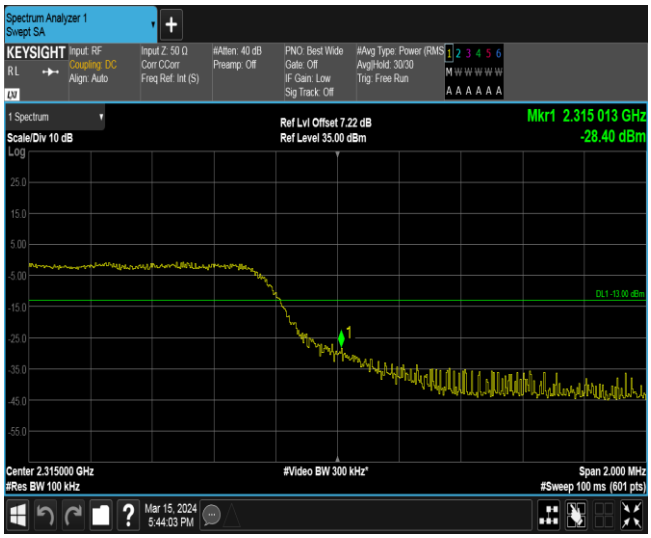

Band40-5MHz-16QAM-38725-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

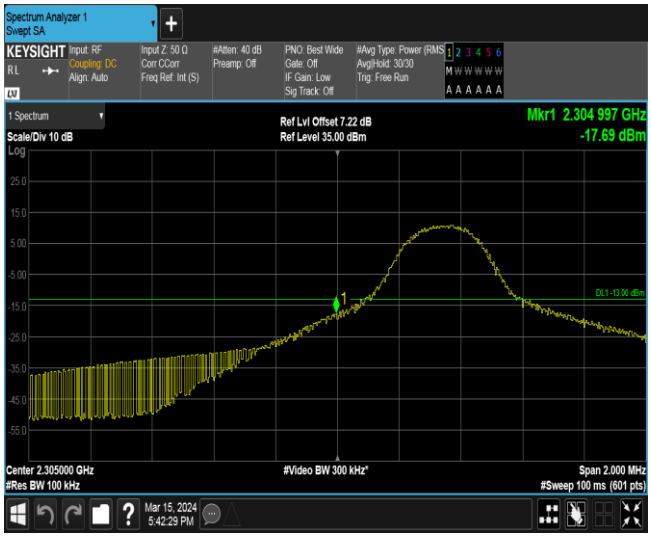

Band40-5MHz-16QAM-38725-1RB#24

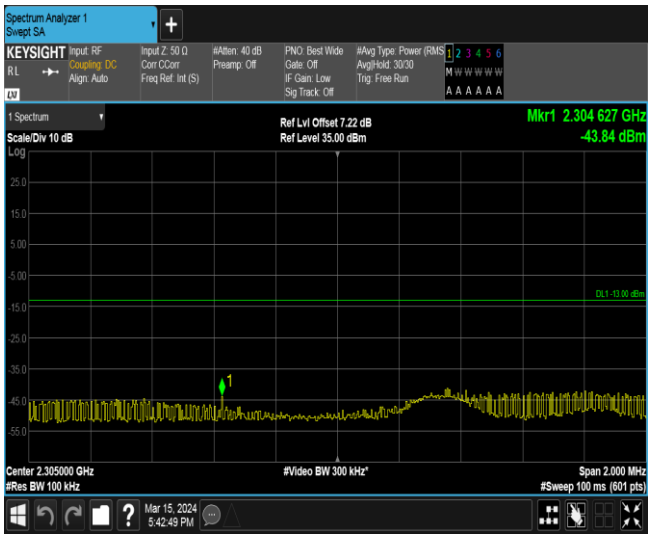

Band40-5MHz-16QAM-38725-25RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

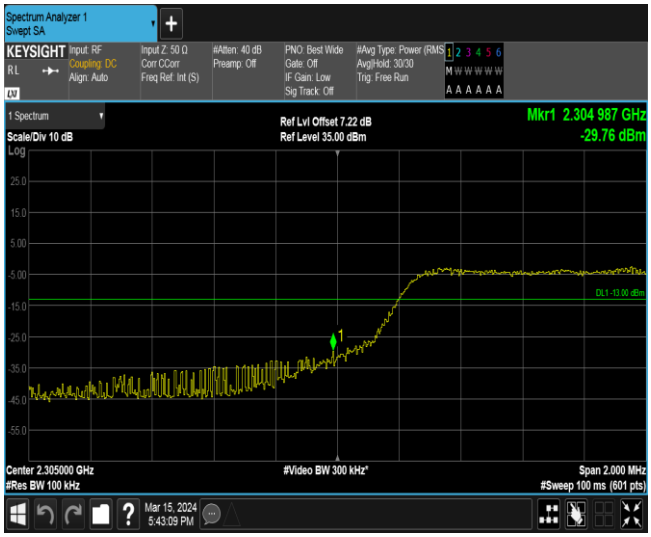

Band40-5MHz-16QAM-38775-1RB#0

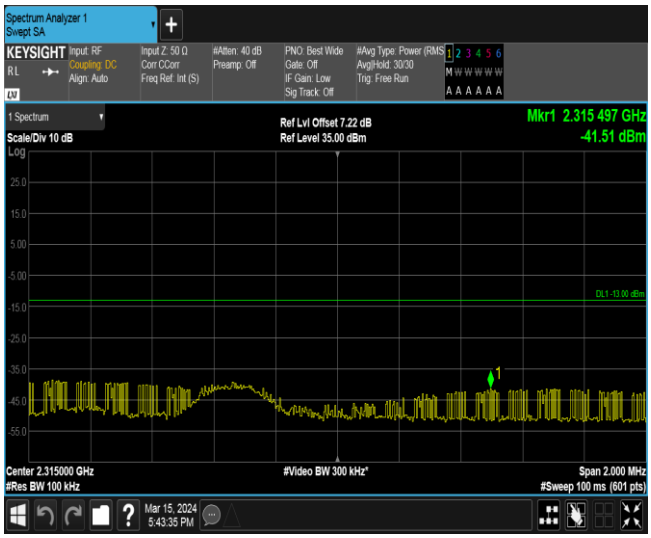

Band40-5MHz-16QAM-38775-1RB#24

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

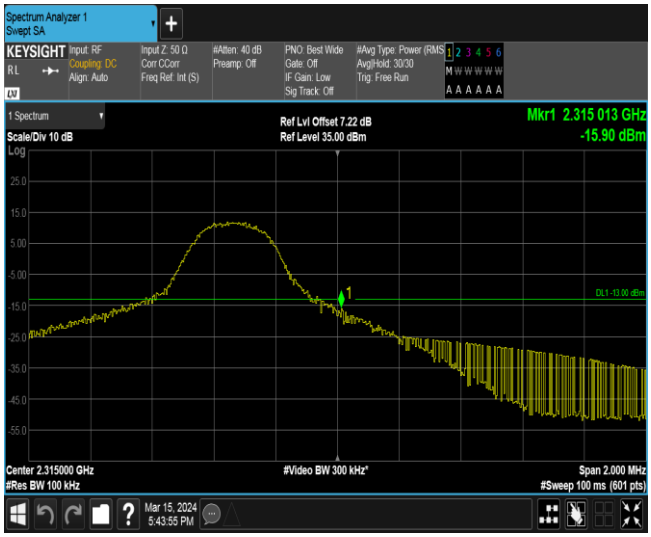

Band40-5MHz-16QAM-38775-25RB#0

Band40-10MHz-QPSK-38750-1RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

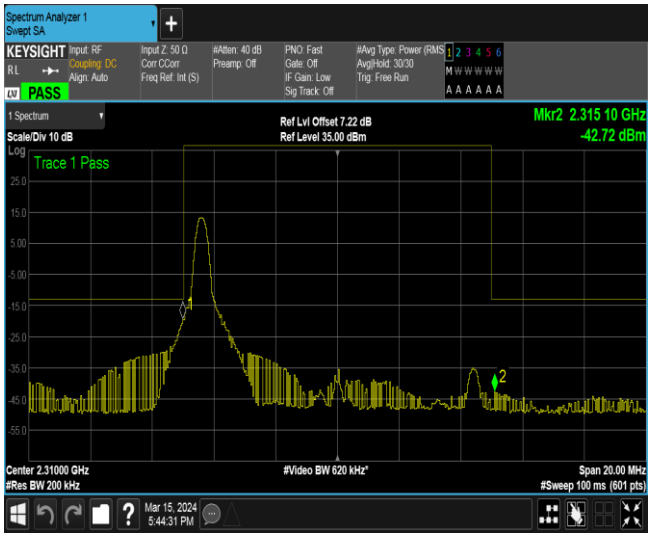

Band40-10MHz-QPSK-38750-1RB#49

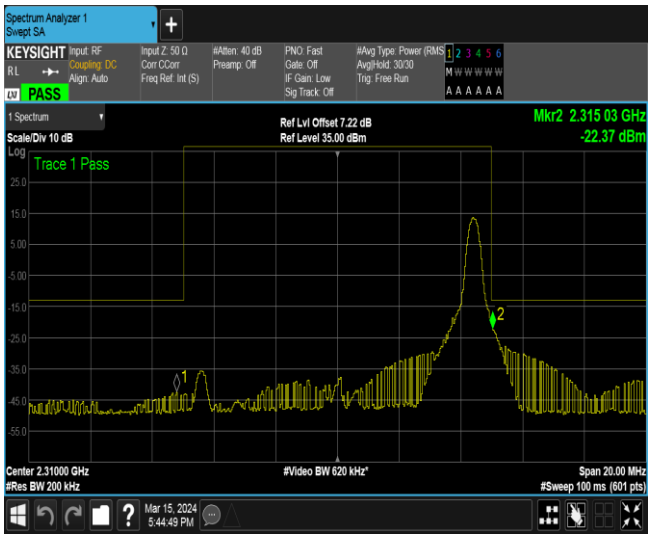

Band40-10MHz-QPSK-38750-50RB#0

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

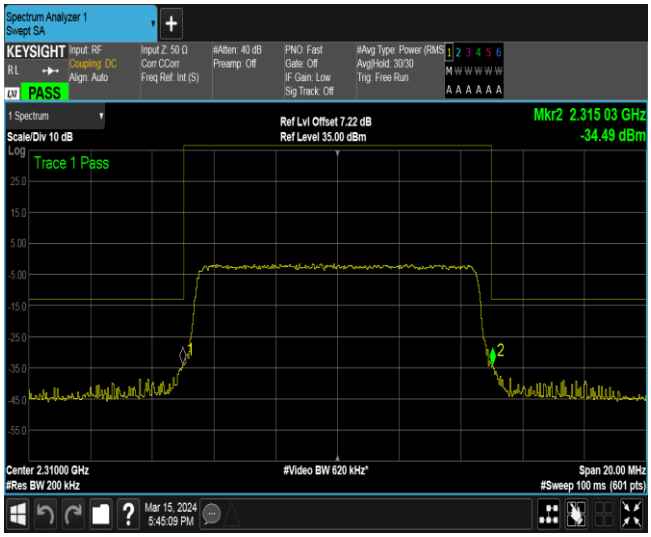

Band40-10MHz-16QAM-38750-1RB#0

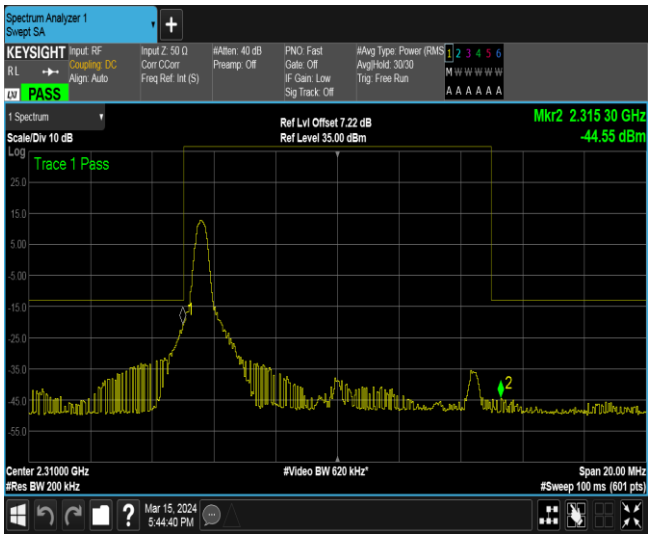

Band40-10MHz-16QAM-38750-1RB#49

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

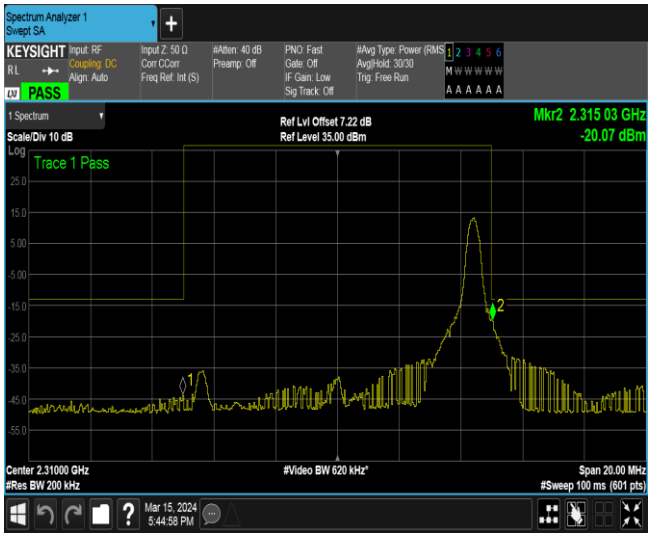

Band40-10MHz-16QAM-38750-50RB#0

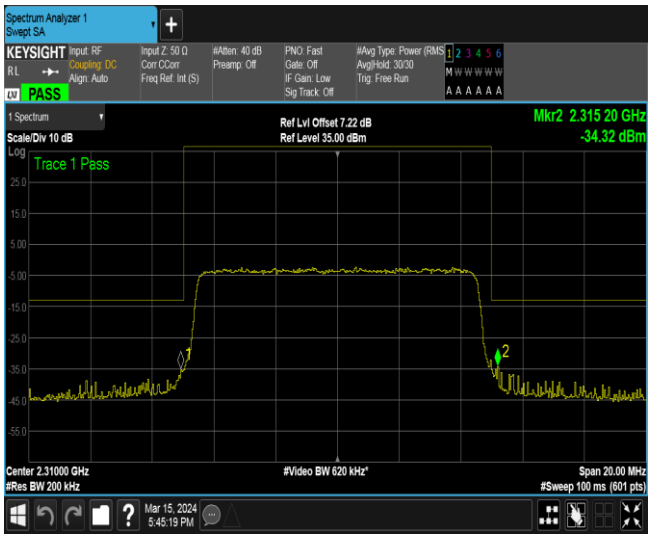

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band40	5MHz	QPSK	38725	1RB#0	Range1:30~1000MHz	-55.76	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range2:1000~2288MHz	-62.72	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range3:2288~2292MHz	-52.71	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range4:2292~2296MHz	-54.08	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range5:2296~2300MHz	-54.51	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range6:2300~2305MHz	-53.69	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range7:2320~2324MHz	-53.23	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range8:2324~2328MHz	-53.26	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range9:2328~2337MHz	-41.98	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range10:2337~2341MHz	-53.73	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range11:2341~2345MHz	-53.74	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range12:2360~2365MHz	-53.64	PASS
Band40	5MHz	QPSK	38725	1RB#0	Range13:2365~26500MHz	-52.16	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range1:30~1000MHz	-56.03	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range2:1000~2288MHz	-53.41	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range3:2288~2292MHz	-53.82	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range4:2292~2296MHz	-52.54	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range5:2296~2300MHz	-54.58	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range6:2300~2305MHz	-54.44	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range7:2320~2324MHz	-53.7	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range8:2324~2328MHz	-52.94	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range9:2328~2337MHz	-42.97	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range10:2337~2341MHz	-53.14	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range11:2341~2345MHz	-53.35	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range12:2360~2365MHz	-53.38	PASS
Band40	5MHz	QPSK	38750	1RB#0	Range13:2365~26500MHz	-52.16	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range1:30~1000MHz	-55.36	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range2:1000~2288MHz	-51.98	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range3:2288~2292MHz	-51.51	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range4:2292~2296MHz	-52.81	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range5:2296~2300MHz	-53.67	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range6:2300~2305MHz	-53.81	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band40	5MHz	QPSK	38775	1RB#0	Range7:2320~2324MHz	-52.13	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range8:2324~2328MHz	-52.23	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range9:2328~2337MHz	-43.06	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range10:2337~2341MHz	-52.23	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range11:2341~2345MHz	-53.57	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range12:2360~2365MHz	-53.3	PASS
Band40	5MHz	QPSK	38775	1RB#0	Range13:2365~26500MHz	-53.92	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range1:30~1000MHz	-55.13	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range2:1000~2288MHz	-53.6	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range3:2288~2292MHz	-53.92	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range4:2292~2296MHz	-53.78	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range5:2296~2300MHz	-52.82	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range6:2300~2305MHz	-54.7	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range7:2320~2324MHz	-53.12	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range8:2324~2328MHz	-53.61	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range9:2328~2337MHz	-42.6	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range10:2337~2341MHz	-52.78	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range11:2341~2345MHz	-52.18	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range12:2360~2365MHz	-53.18	PASS
Band40	5MHz	16QAM	38725	1RB#0	Range13:2365~26500MHz	-53.31	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range1:30~1000MHz	-55.12	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range2:1000~2288MHz	-54	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range3:2288~2292MHz	-51.92	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range4:2292~2296MHz	-52.93	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range5:2296~2300MHz	-53.45	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range6:2300~2305MHz	-53.23	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range7:2320~2324MHz	-52.49	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range8:2324~2328MHz	-53.33	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range9:2328~2337MHz	-43.45	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range10:2337~2341MHz	-53.09	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range11:2341~2345MHz	-53.87	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range12:2360~2365MHz	-54.09	PASS
Band40	5MHz	16QAM	38750	1RB#0	Range13:2365~26500MHz	-52.44	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range1:30~1000MHz	-54.38	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range2:1000~2288MHz	-52.92	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range3:2288~2292MHz	-53.4	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range4:2292~2296MHz	-53.39	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range5:2296~2300MHz	-53.11	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range6:2300~2305MHz	-54.24	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band40	5MHz	16QAM	38775	1RB#0	Range7:2320~2324MHz	-53.54	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range8:2324~2328MHz	-52.99	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range9:2328~2337MHz	-43.14	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range10:2337~2341MHz	-52.9	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range11:2341~2345MHz	-53.3	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range12:2360~2365MHz	-53.38	PASS
Band40	5MHz	16QAM	38775	1RB#0	Range13:2365~26500MHz	-52.41	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range1:30~1000MHz	-55.36	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range2:1000~2288MHz	-53.73	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range3:2288~2292MHz	-53.43	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range4:2292~2296MHz	-51.95	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range5:2296~2300MHz	-53.94	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range6:2300~2305MHz	-54.26	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range7:2320~2324MHz	-54.14	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range8:2324~2328MHz	-52.84	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range9:2328~2337MHz	-42.78	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range10:2337~2341MHz	-51.63	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range11:2341~2345MHz	-54.05	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range12:2360~2365MHz	-54.6	PASS
Band40	10MHz	QPSK	38750	1RB#0	Range13:2365~26500MHz	-51.93	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range1:30~1000MHz	-55.15	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range2:1000~2288MHz	-53.36	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range3:2288~2292MHz	-52.73	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range4:2292~2296MHz	-52.63	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range5:2296~2300MHz	-54.12	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range6:2300~2305MHz	-53.44	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range7:2320~2324MHz	-53.41	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range8:2324~2328MHz	-53.2	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range9:2328~2337MHz	-43.14	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range10:2337~2341MHz	-53.24	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range11:2341~2345MHz	-53.69	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range12:2360~2365MHz	-52.8	PASS
Band40	10MHz	16QAM	38750	1RB#0	Range13:2365~26500MHz	-52.88	PASS

Test Graphs

Band40-5MHz-QPSK-38725-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

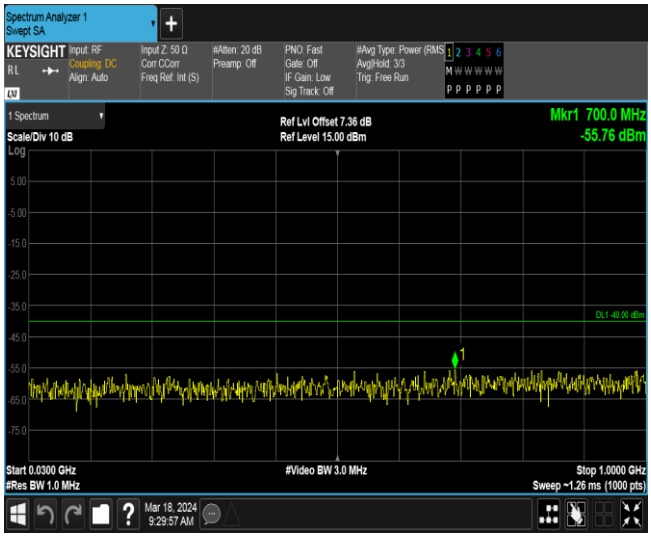

Band40-5MHz-QPSK-38725-1RB#0-Range2:1000~2288MHz

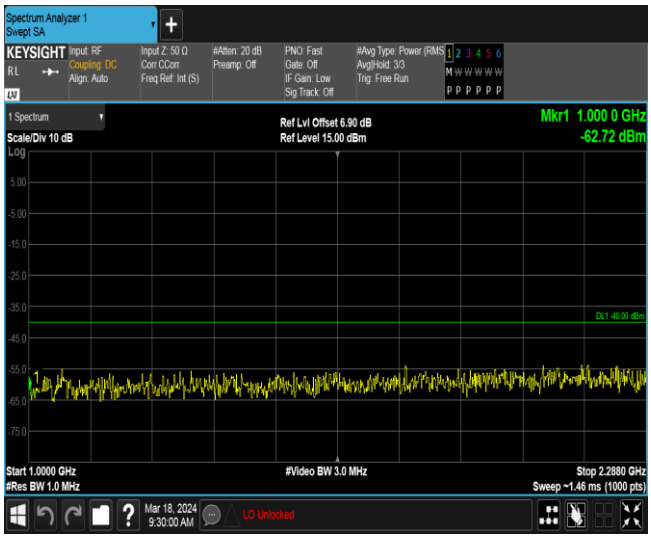

Band40-5MHz-QPSK-38725-1RB#0-Range3:2288~2292MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

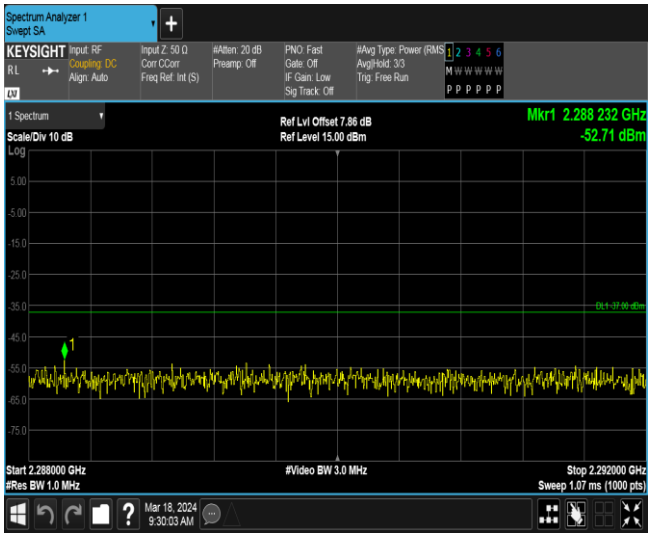

Band40-5MHz-QPSK-38725-1RB#0-Range4:2292~2296MHz

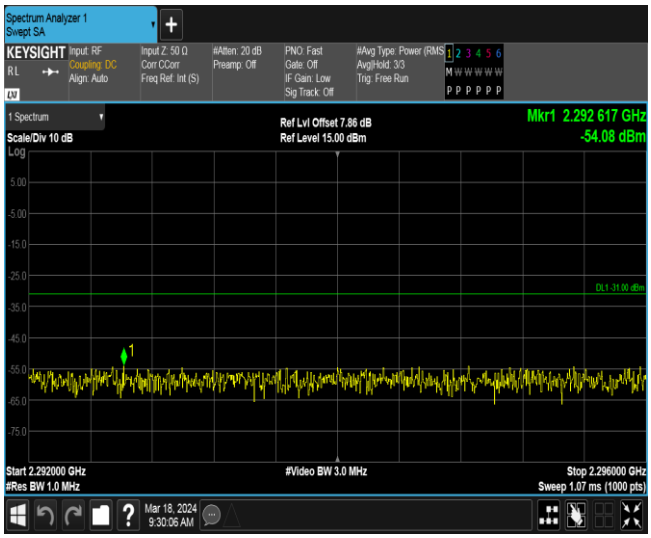

Band40-5MHz-QPSK-38725-1RB#0-Range5:2296~2300MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

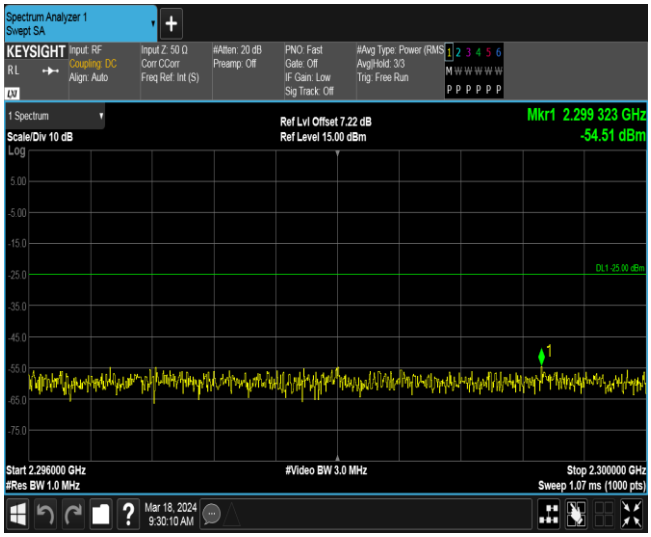

Band40-5MHz-QPSK-38725-1RB#0-Range6:2300~2305MHz

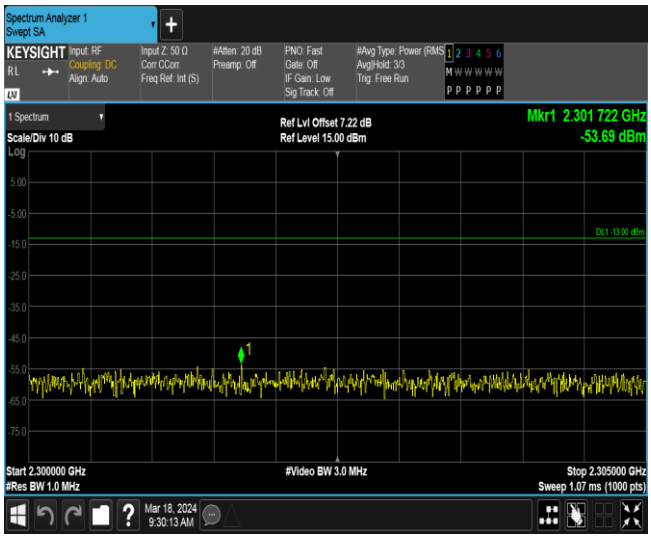

Band40-5MHz-QPSK-38725-1RB#0-Range7:2320~2324MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

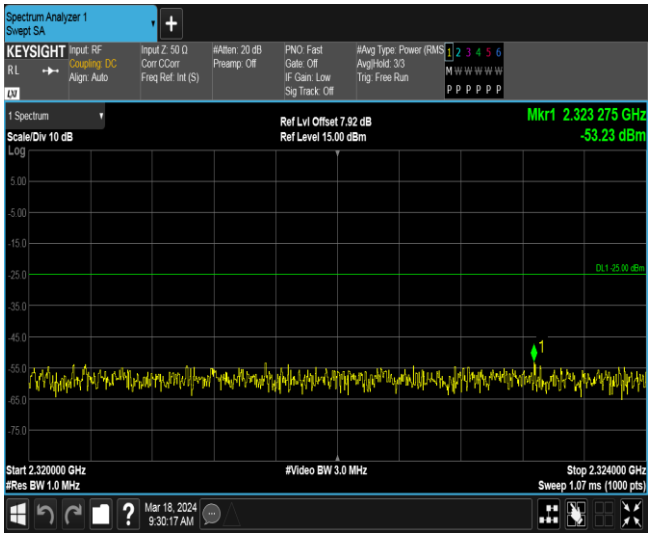

Band40-5MHz-QPSK-38725-1RB#0-Range8:2324~2328MHz

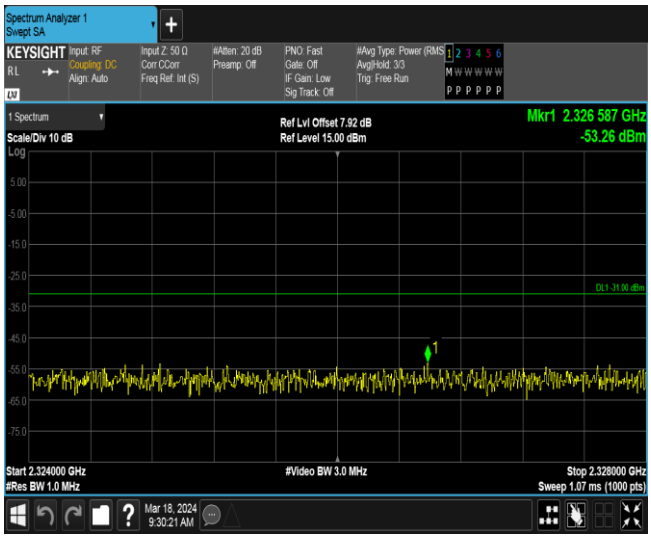

Band40-5MHz-QPSK-38725-1RB#0-Range9:2328~2337MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

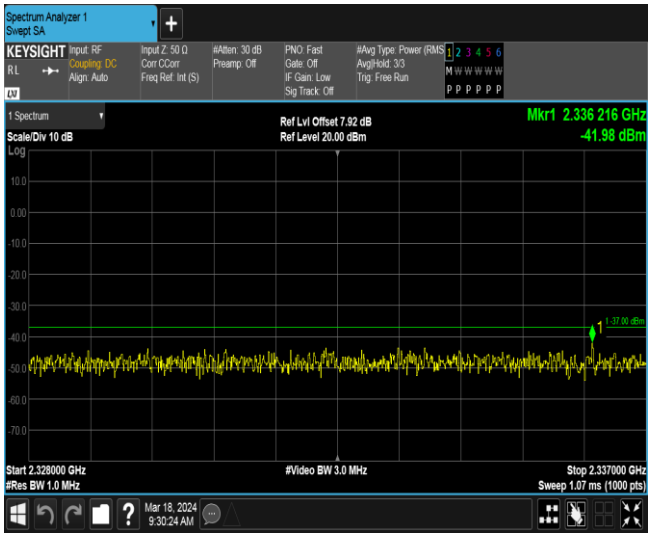

Band40-5MHz-QPSK-38725-1RB#0-Range10:2337~2341MHz

Band40-5MHz-QPSK-38725-1RB#0-Range11:2341~2345MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

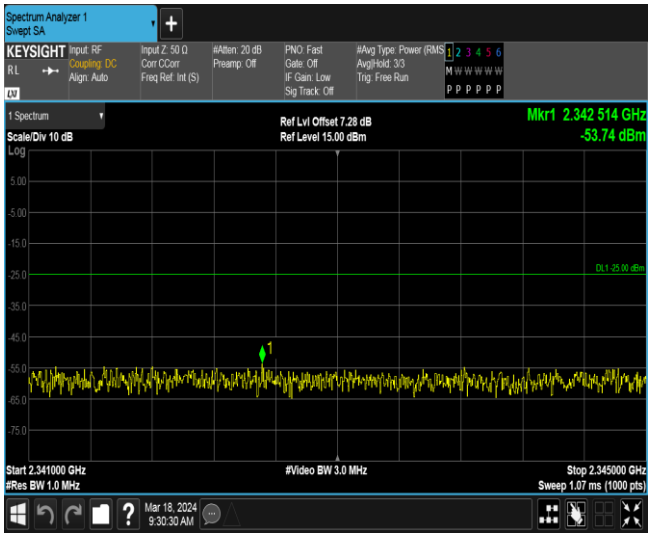

Band40-5MHz-QPSK-38725-1RB#0-Range12:2360~2365MHz

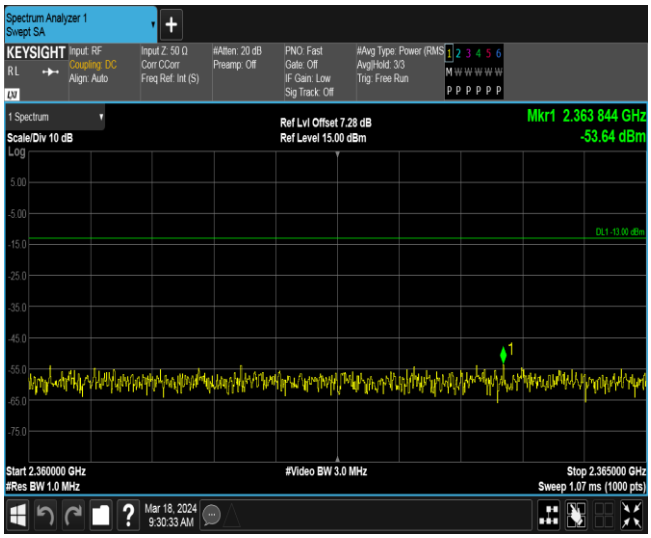

Band40-5MHz-QPSK-38725-1RB#0-Range13:2365~26500MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

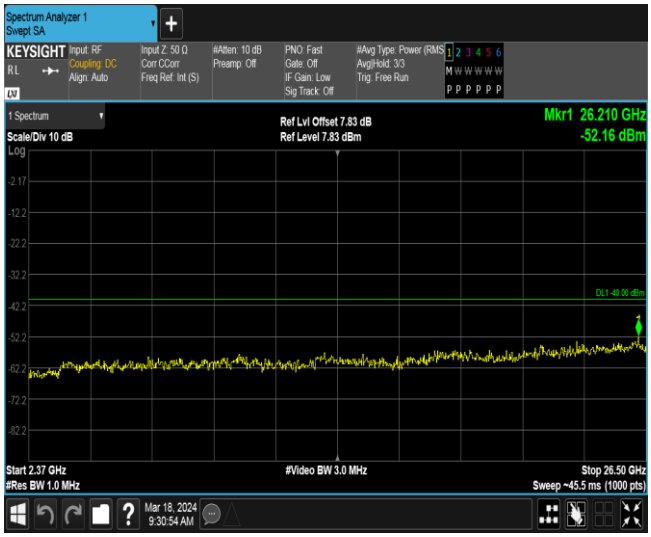

Band40-5MHz-QPSK-38750-1RB#0-Range1:30~1000MHz

Band40-5MHz-QPSK-38750-1RB#0-Range2:1000~2288MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band40-5MHz-QPSK-38750-1RB#0-Range3:2288~2292MHz

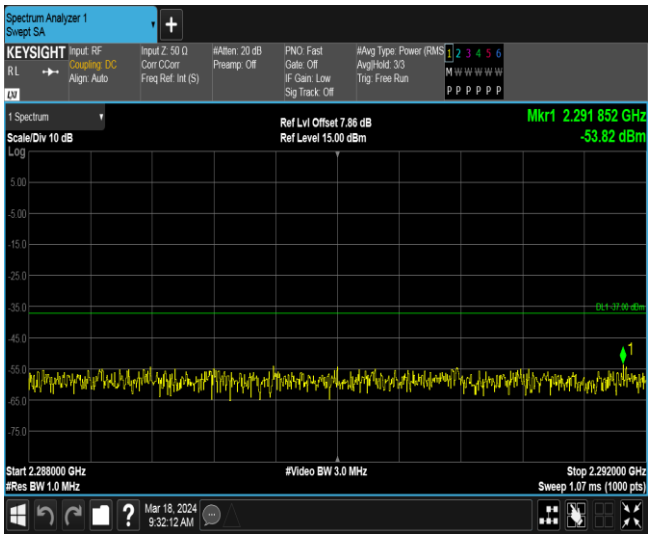

Band40-5MHz-QPSK-38750-1RB#0-Range4:2292~2296MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

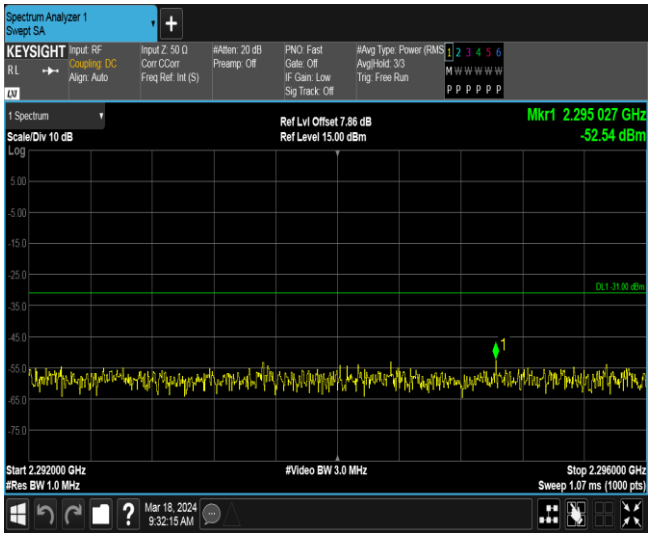

Band40-5MHz-QPSK-38750-1RB#0-Range5:2296~2300MHz

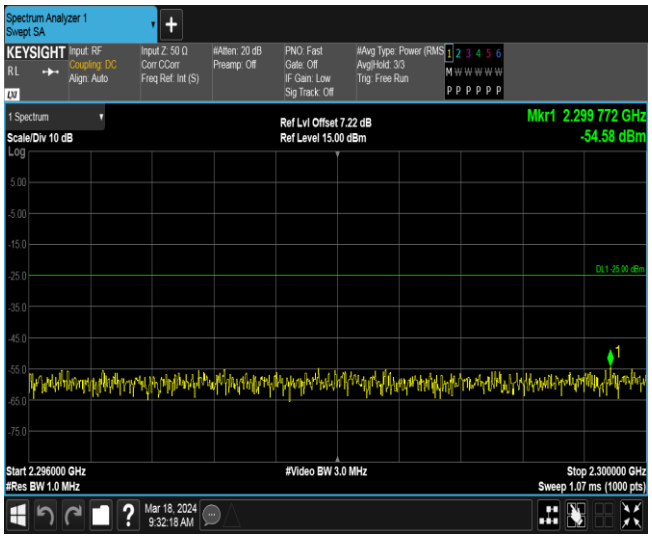

Band40-5MHz-QPSK-38750-1RB#0-Range6:2300~2305MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

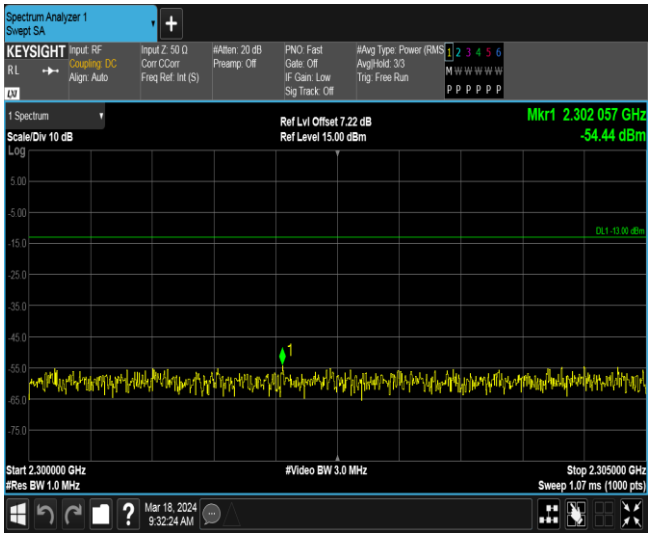

Band40-5MHz-QPSK-38750-1RB#0-Range7:2320~2324MHz

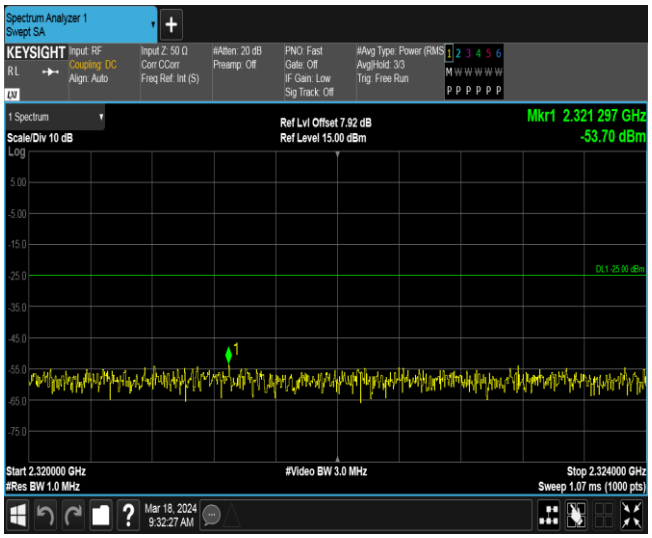

Band40-5MHz-QPSK-38750-1RB#0-Range8:2324~2328MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

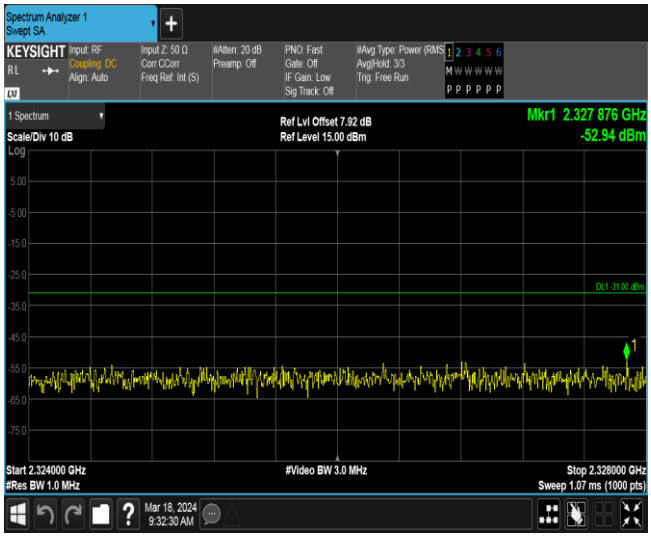

Band40-5MHz-QPSK-38750-1RB#0-Range9:2328~2337MHz

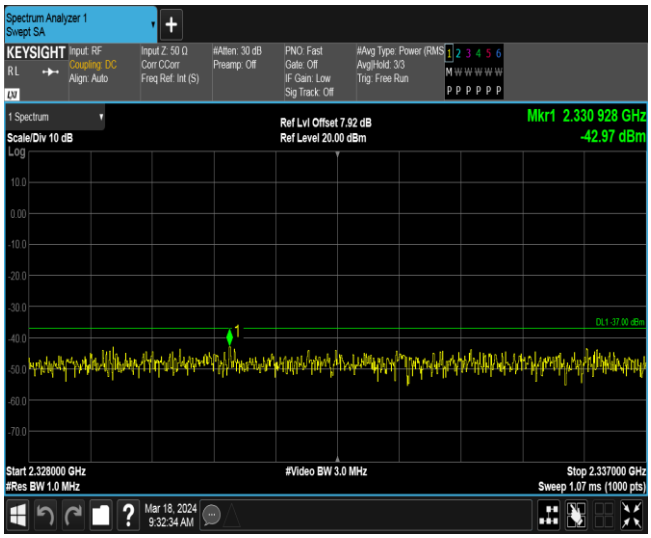

Band40-5MHz-QPSK-38750-1RB#0-Range10:2337~2341MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

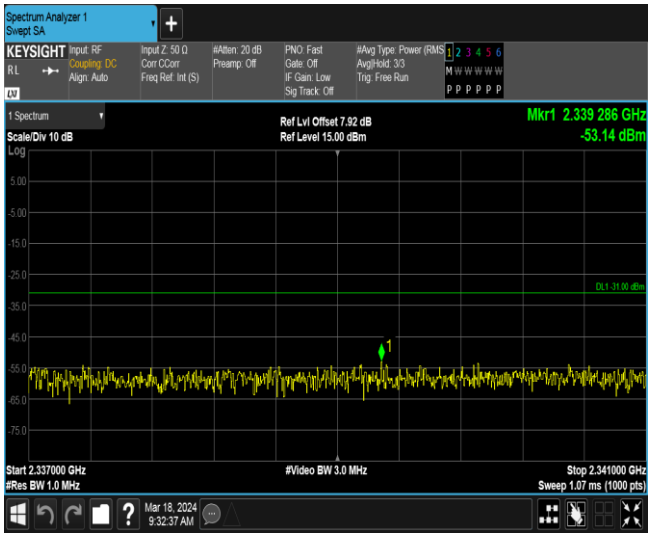

Band40-5MHz-QPSK-38750-1RB#0-Range11:2341~2345MHz

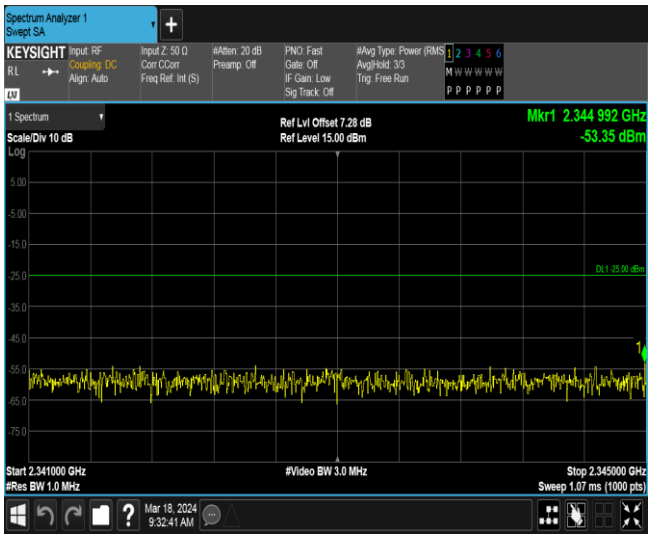

Band40-5MHz-QPSK-38750-1RB#0-Range12:2360~2365MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

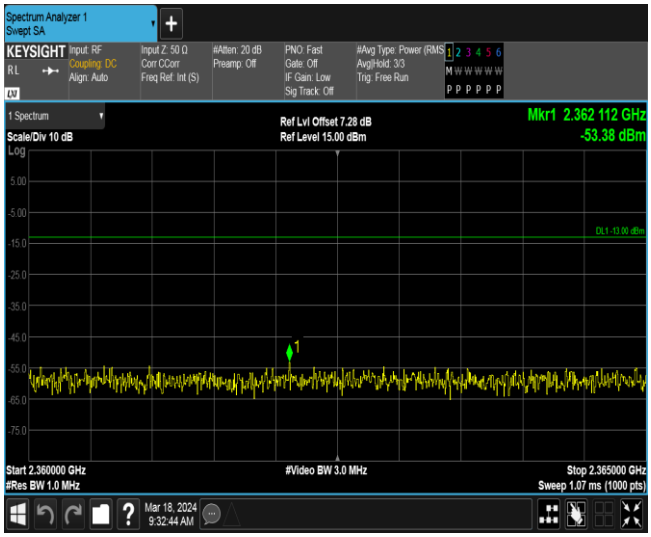

Band40-5MHz-QPSK-38750-1RB#0-Range13:2365~26500MHz

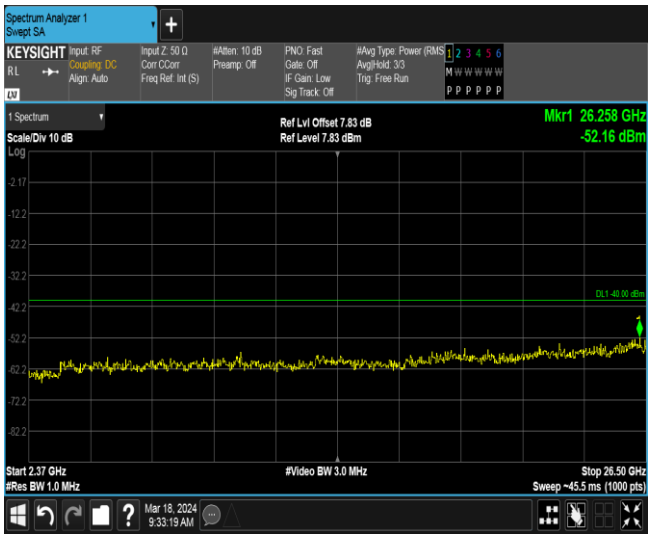

Band40-5MHz-QPSK-38775-1RB#0-Range1:30~1000MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

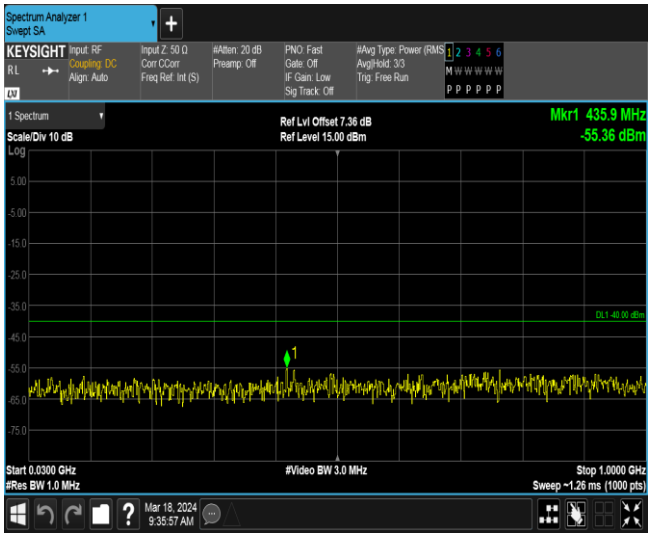

Band40-5MHz-QPSK-38775-1RB#0-Range2:1000~2288MHz

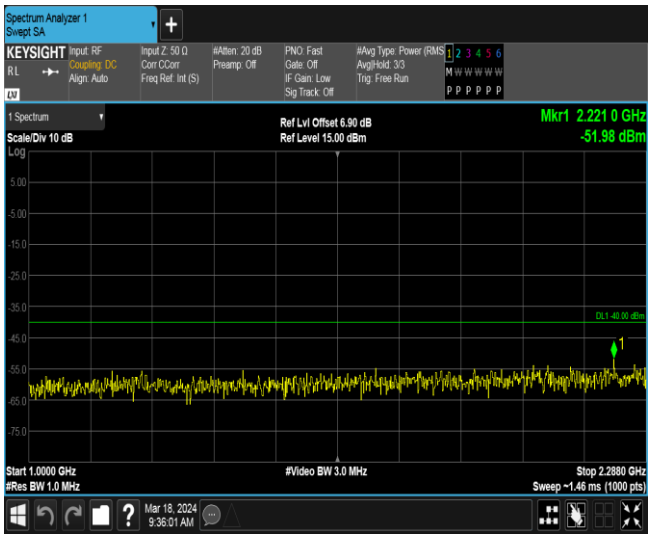

Band40-5MHz-QPSK-38775-1RB#0-Range3:2288~2292MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

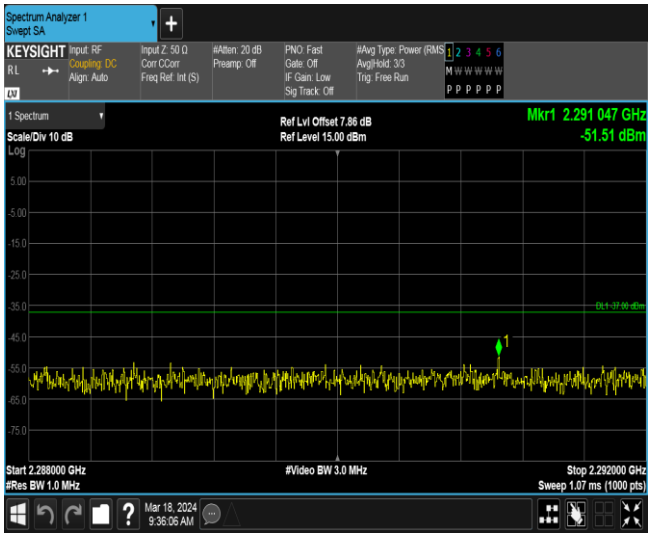

Band40-5MHz-QPSK-38775-1RB#0-Range4:2292~2296MHz

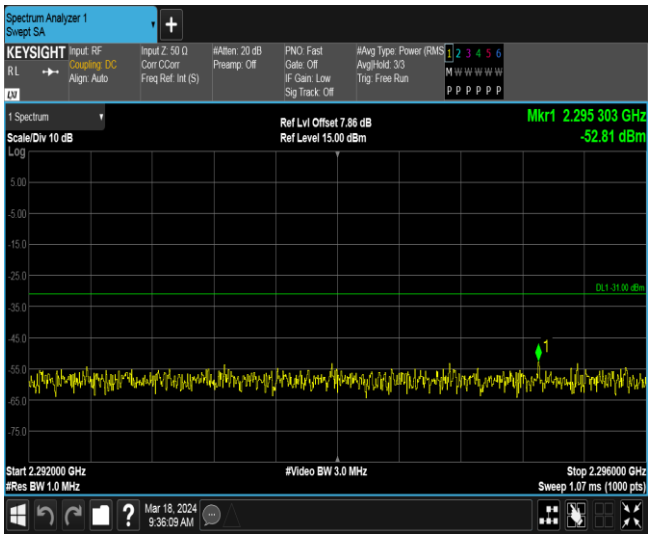

Band40-5MHz-QPSK-38775-1RB#0-Range5:2296~2300MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

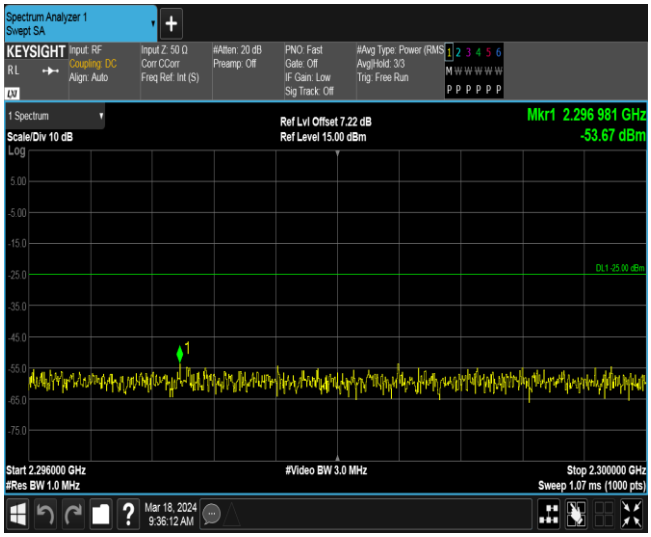

Band40-5MHz-QPSK-38775-1RB#0-Range6:2300~2305MHz

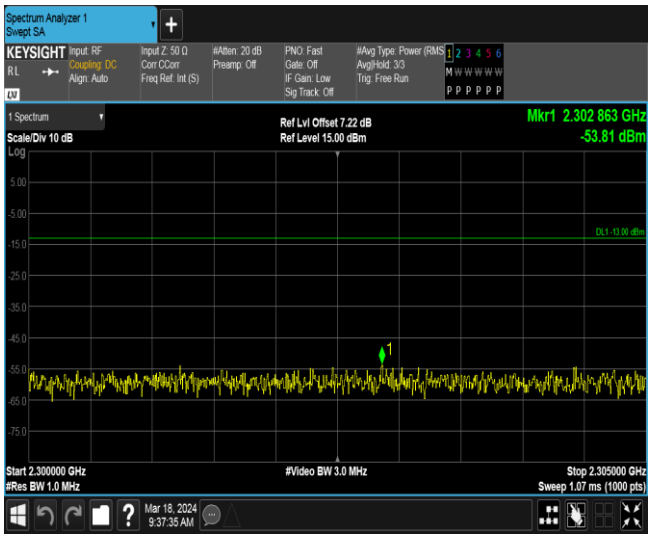

Band40-5MHz-QPSK-38775-1RB#0-Range7:2320~2324MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

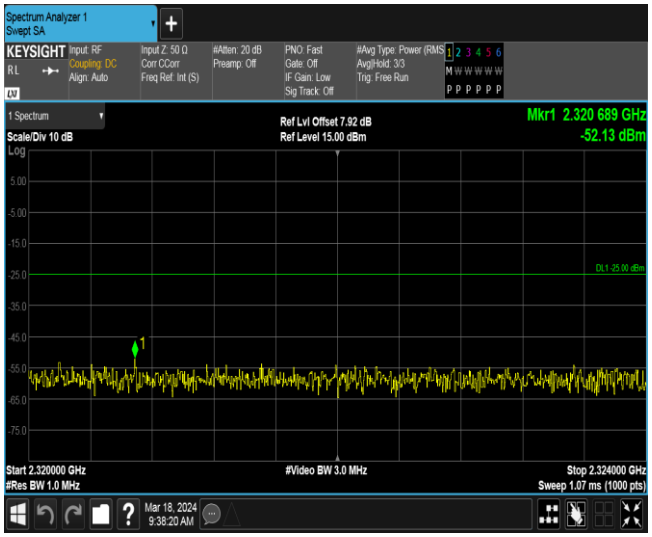

Band40-5MHz-QPSK-38775-1RB#0-Range8:2324~2328MHz

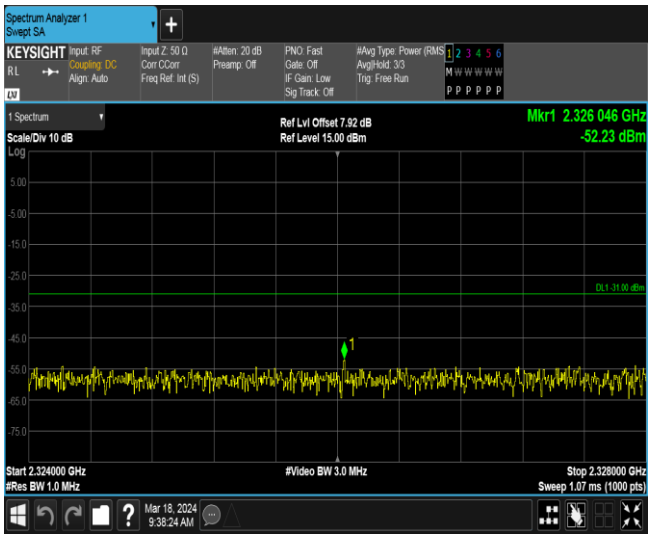

Band40-5MHz-QPSK-38775-1RB#0-Range9:2328~2337MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

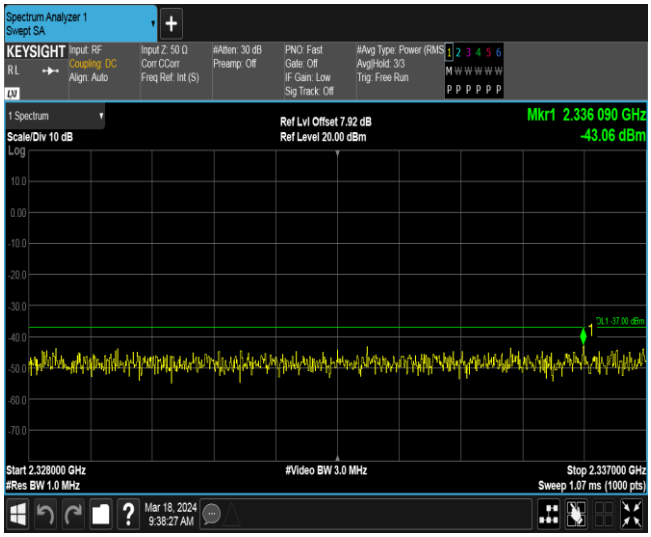

Band40-5MHz-QPSK-38775-1RB#0-Range10:2337~2341MHz

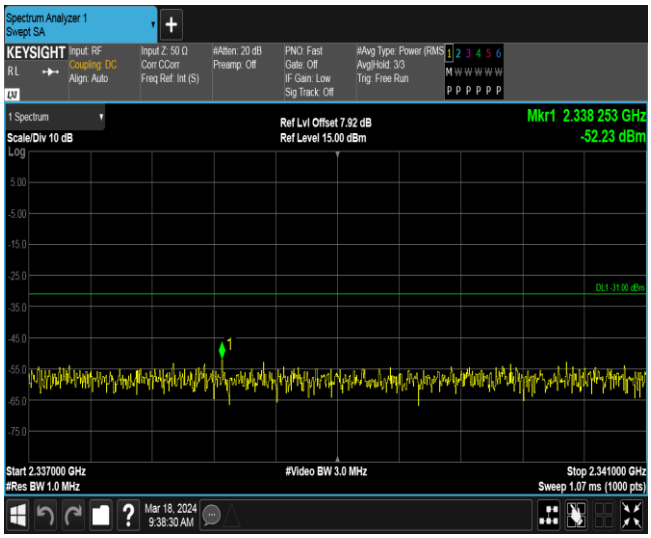

Band40-5MHz-QPSK-38775-1RB#0-Range11:2341~2345MHz

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.