

Appendix A: Maximum Power Spectral Density Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	21.79	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#24	20.95	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#49	21.59	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	19.27	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#12	19.72	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#25	19.47	PASS
Band40(2305-2315)	5MHz	QPSK	38725	50RB#0	20.11	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	21.48	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#24	21.12	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#49	21.65	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	19.04	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#12	19.79	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#25	19.47	PASS
Band40(2305-2315)	5MHz	16QAM	38725	50RB#0	19.24	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#0	22.02	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#24	21.97	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#49	21.89	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	19.60	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#12	19.37	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#25	20.08	PASS
Band40(2305-2315)	5MHz	QPSK	38750	50RB#0	18.86	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#0	21.13	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#24	21.78	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#49	21.51	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	19.28	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#12	19.81	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#25	19.91	PASS
Band40(2305-2315)	5MHz	16QAM	38750	50RB#0	20.50	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	21.70	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#24	22.04	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#49	22.04	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	19.65	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#12	19.21	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#25	20.61	PASS
Band40(2305-2315)	5MHz	QPSK	38775	50RB#0	19.98	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	21.51	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#24	21.53	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#49	22.65	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	18.56	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#12	19.49	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#25	19.70	PASS
Band40(2305-2315)	5MHz	16QAM	38775	50RB#0	19.29	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	21.81	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#24	22.17	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#49	22.33	PASS
Band40(2305-2315)	10MHz	QPSK	38750	25RB#0	19.58	PASS
Band40(2305-2315)	10MHz	QPSK	38750	25RB#12	19.52	PASS
Band40(2305-2315)	10MHz	QPSK	38750	25RB#25	19.91	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	17.92	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	21.07	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#24	21.15	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#49	21.54	PASS
Band40(2305-2315)	10MHz	16QAM	38750	25RB#0	19.67	PASS
Band40(2305-2315)	10MHz	16QAM	38750	25RB#12	19.37	PASS
Band40(2305-2315)	10MHz	16QAM	38750	25RB#25	18.15	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	16.28	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	10.88	13	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	10.59	13	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	11.39	13	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	11.54	13	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#0	10.40	13	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	10.35	13	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#0	11.24	13	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	11.13	13	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	10.30	13	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	10.69	13	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	11.28	13	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	11.09	13	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	10.13	13	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	10.43	13	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	11.59	13	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	11.71	13	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Test Graphs



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.




Band40(2305-2315)-5MHz-16QAM-38750-1RB#0-PASS

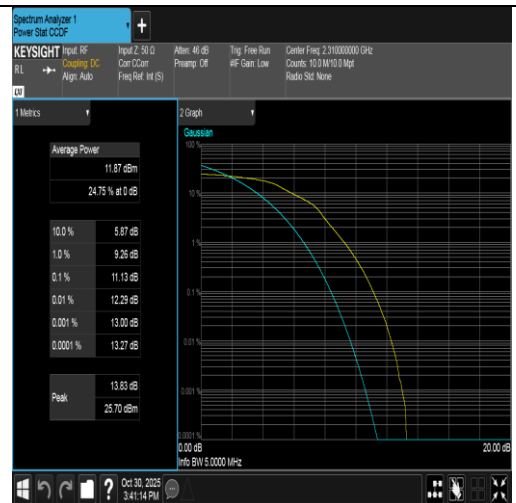


Band40(2305-2315)-5MHz-16QAM-38750-25RB#0-PASS




Band40(2305-2315)-5MHz-QPSK-38775-1RB#0-PASS

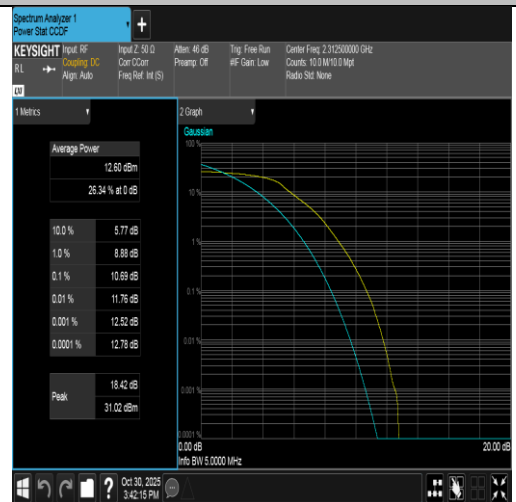

Band40(2305-2315)-5MHz-QPSK-38775-25RB#0-PASS

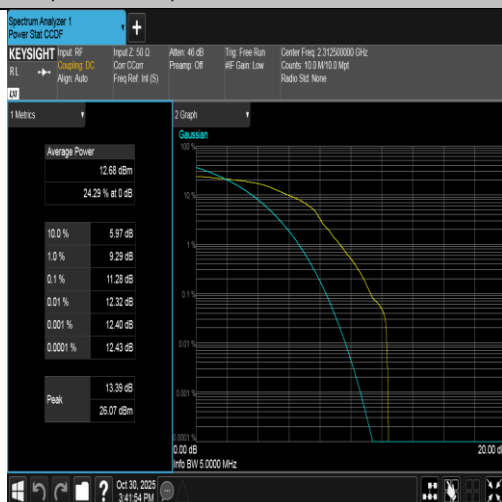


Band40(2305-2315)-5MHz-16QAM-38775-1RB#0-PASS

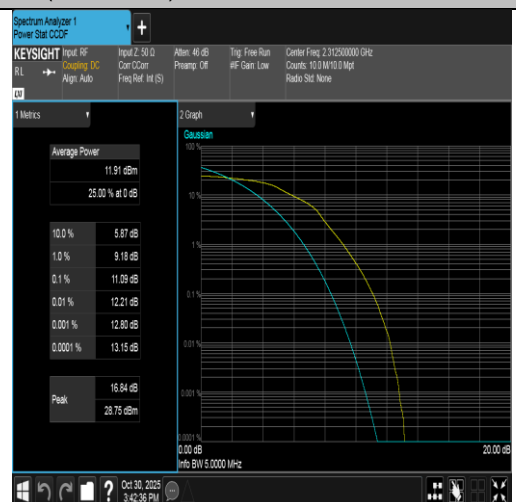


Band40(2305-2315)-5MHz-16QAM-38775-25RB#0-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

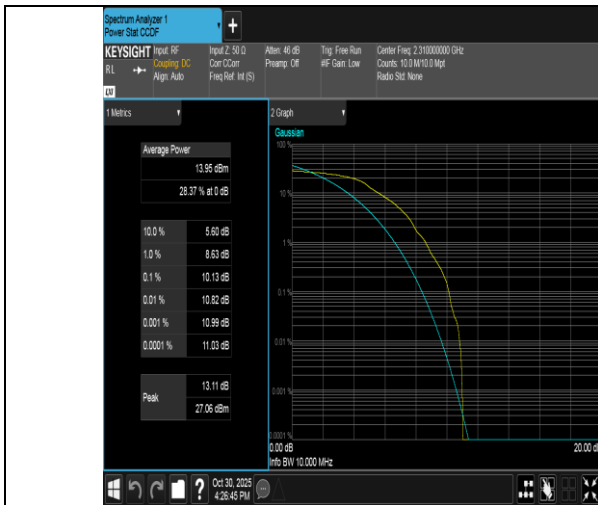


Band40(2305-2315)-10MHz-QPSK-38750-1RB#0-PASS

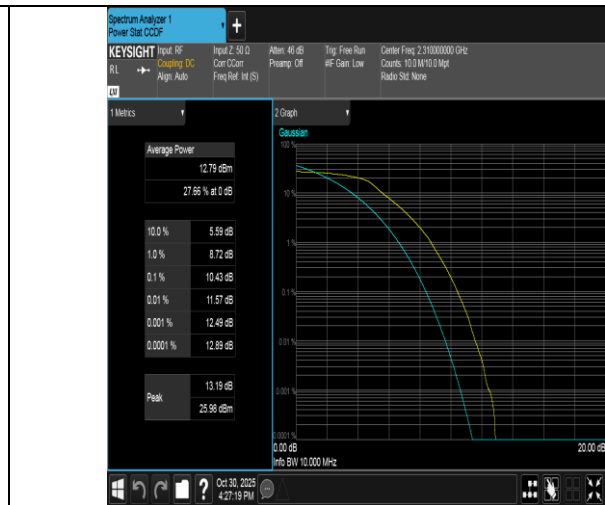

Band40(2305-2315)-10MHz-QPSK-38750-50RB#0-PASS

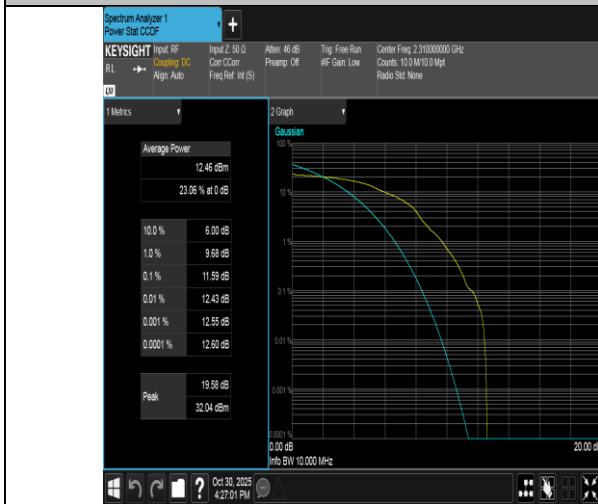

Band40(2305-2315)-10MHz-16QAM-38750-1RB#0-PASS

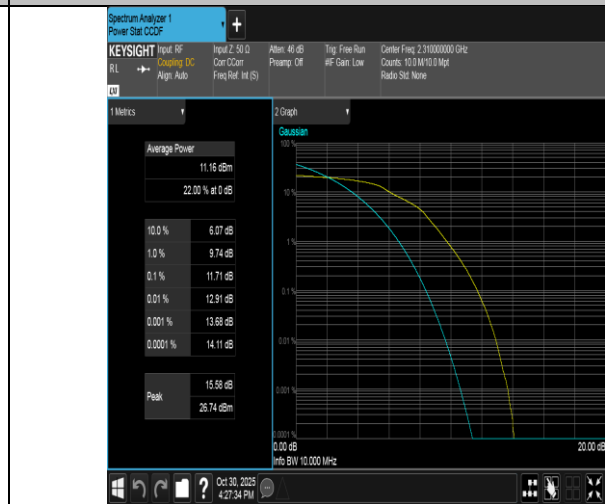

Band40(2305-2315)-10MHz-16QAM-38750-50RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd
Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd
Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	4.5082	5.065	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	4.5425	5.347	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	4.5273	5.183	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	4.5087	5.169	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	4.5132	5.118	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	4.5183	5.104	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	9.0093	10.09	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	8.9965	9.996	PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Attestation of Global Compliance(Shenzhen)Co., Ltd


Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd

Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: <http://www.agccert.com/>

Test Graphs

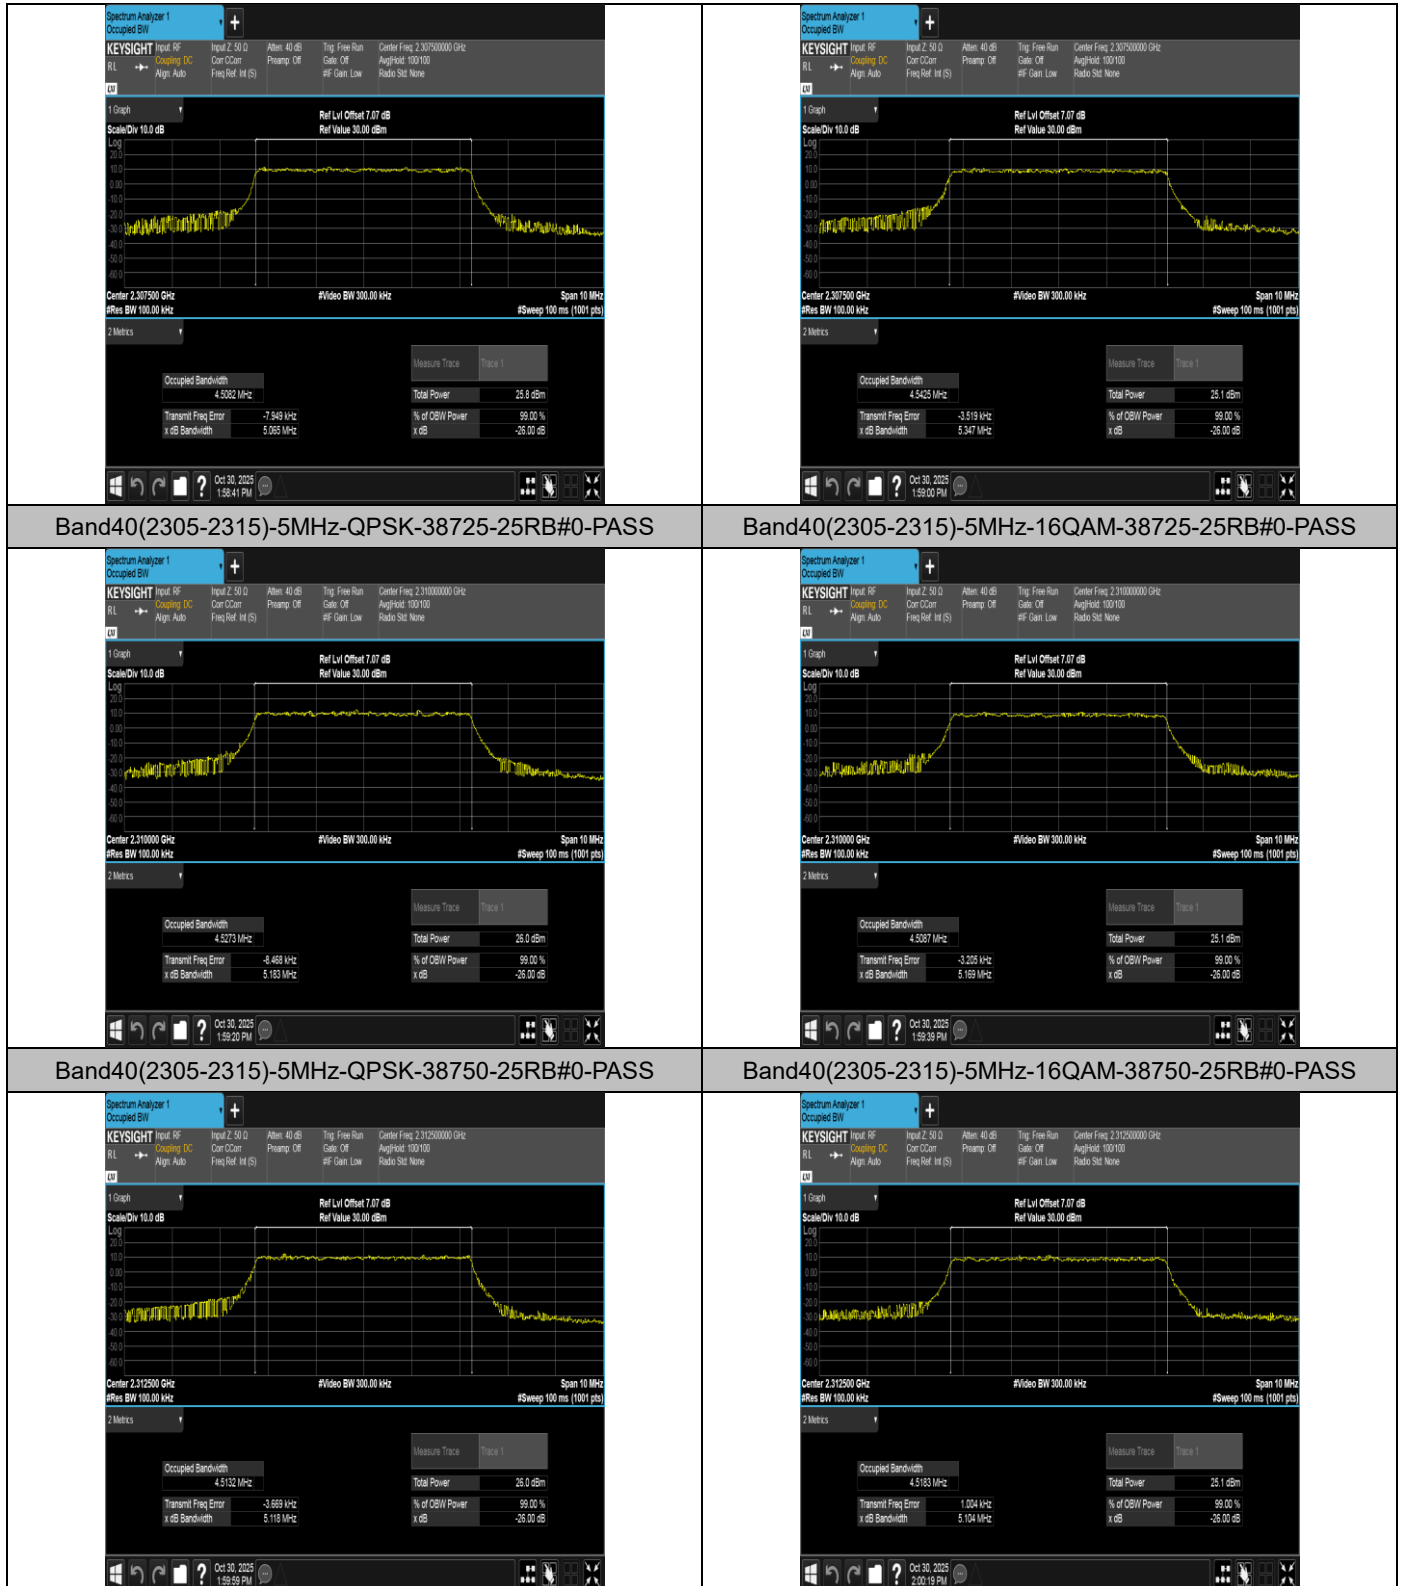

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

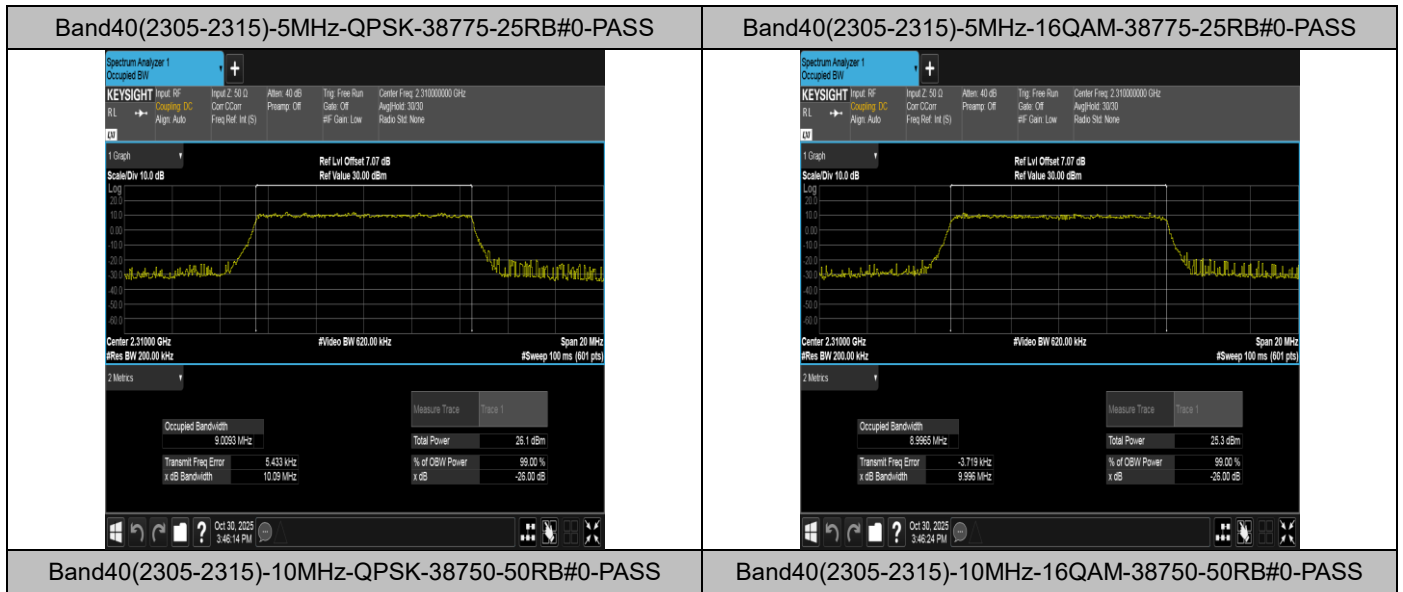


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	-23.60	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#24	-23.47	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	-38.93	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	-23.54	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#24	-22.00	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	-38.78	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	-23.35	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#24	-21.76	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	-50.74	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	-22.82	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#24	-22.67	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	-38.01	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	-32.88	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#49	-32.73	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	-41.79	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	-34.34	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#49	-46.02	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	-43.60	PASS


Test Graphs

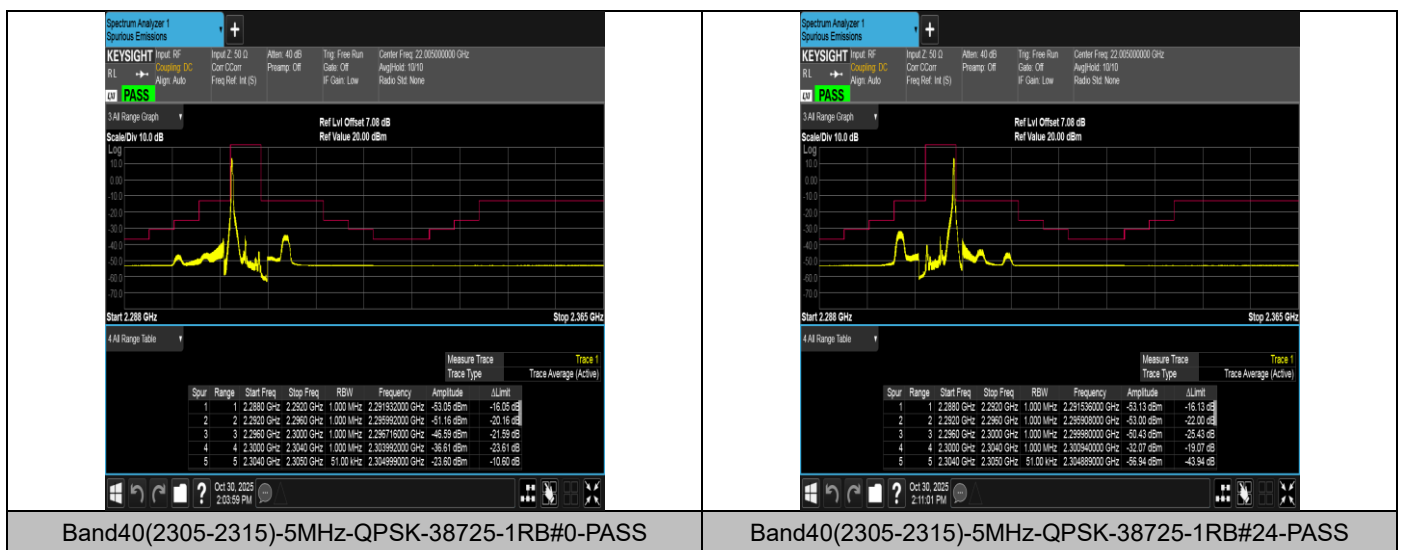


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

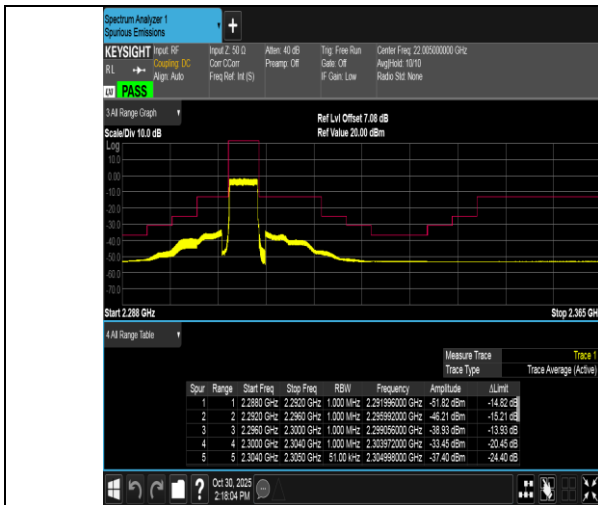

Band40(2305-2315)-5MHz-QPSK-38725-25RB#0-PASS

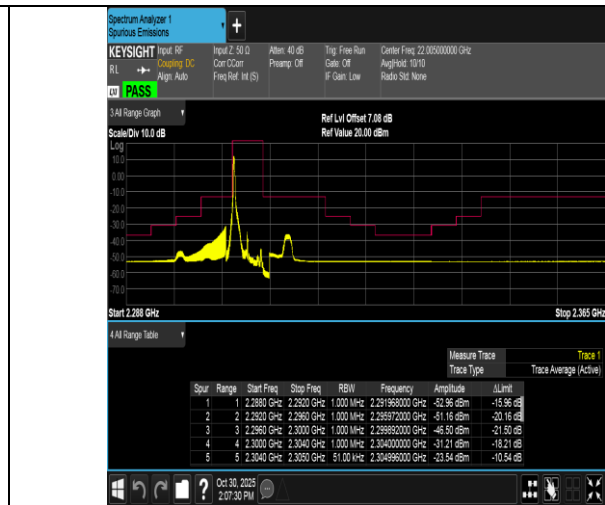


Band40(2305-2315)-5MHz-16QAM-38725-1RB#0-PASS

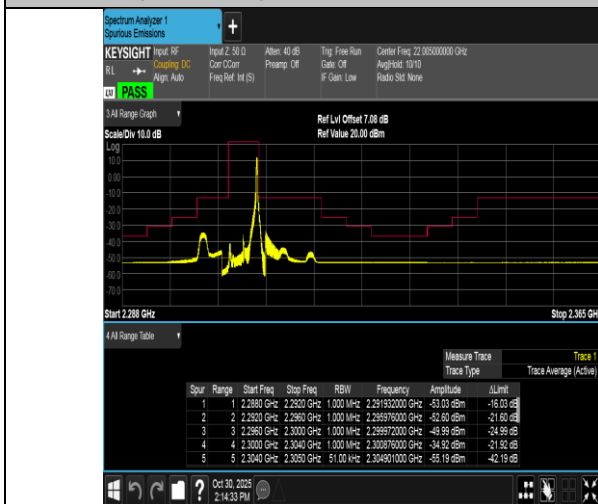


Band40(2305-2315)-5MHz-16QAM-38725-1RB#24-PASS



Band40(2305-2315)-5MHz-16QAM-38725-25RB#0-PASS

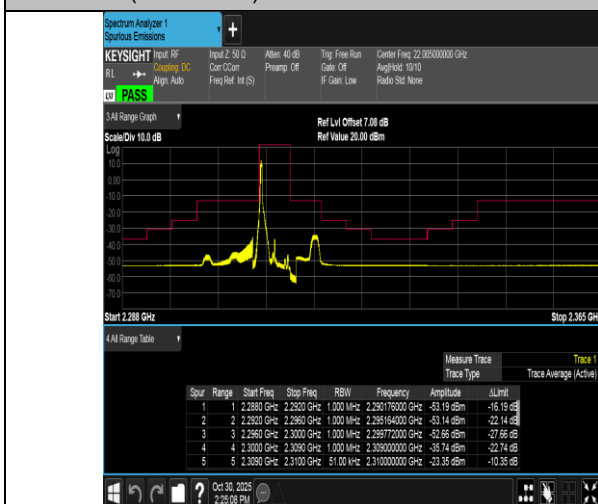

Band40(2305-2315)-5MHz-QPSK-38775-1RB#0-PASS

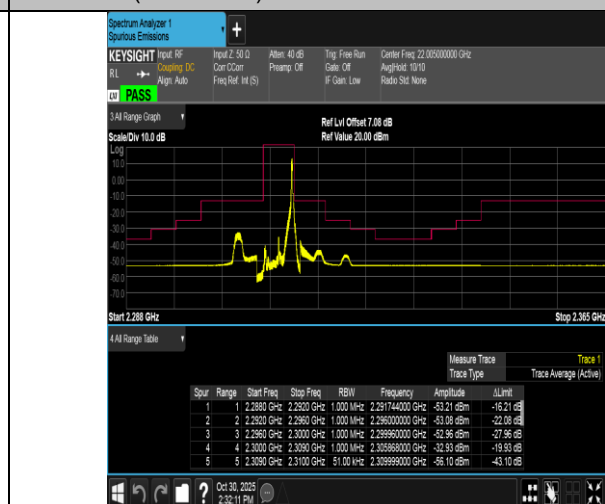

Band40(2305-2315)-5MHz-QPSK-38775-1RB#24-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Attestation of Global Compliance(Shenzhen)Co., Ltd

Attestation of Global Compliance(Shenzhen)Std & Tech Co., Ltd


Tel: +86-755 2523 4088 E-mail: agc@agccert.com Web: http://www.agccert.com/




Band40(2305-2315)-5MHz-QPSK-38775-25RB#0-PASS

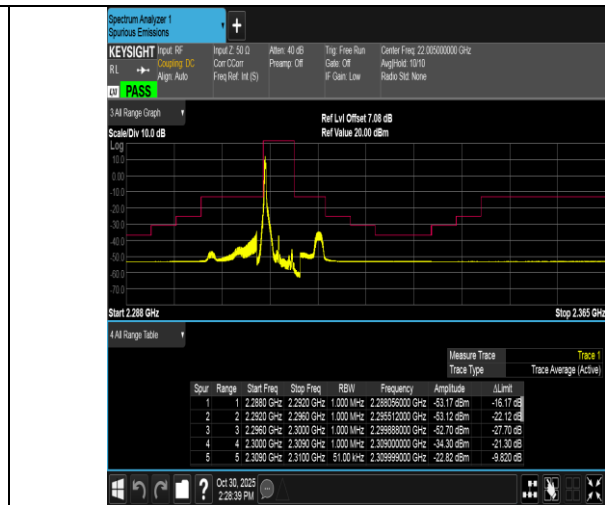


Band40(2305-2315)-5MHz-16QAM-38775-1RB#0-PASS

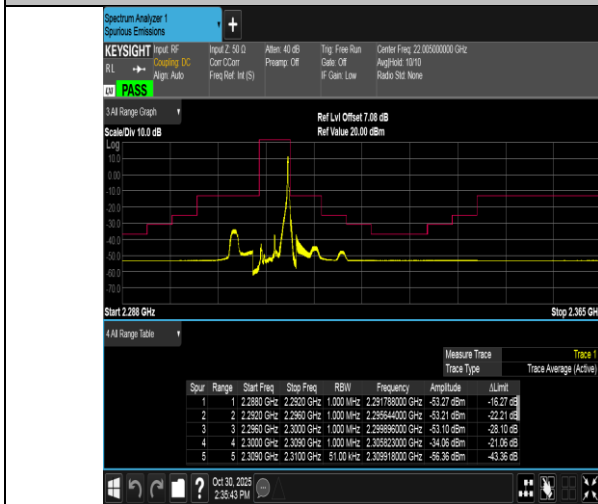


Band40(2305-2315)-5MHz-16QAM-38775-1RB#24-PASS

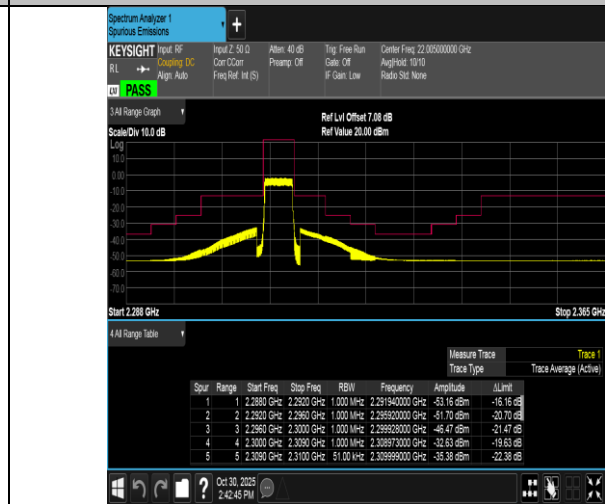

Band40(2305-2315)-5MHz-16QAM-38775-25RB#0-PASS

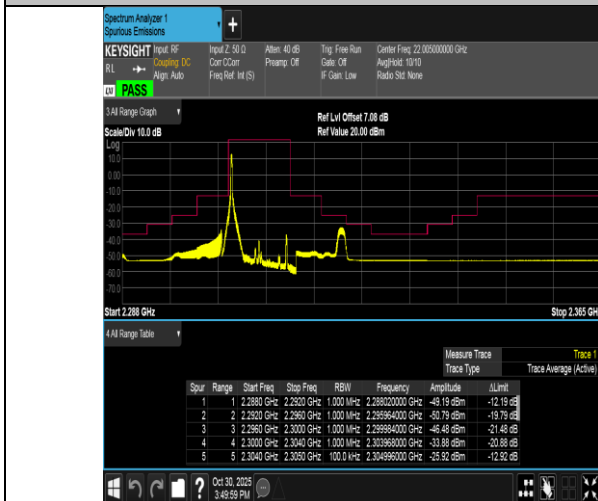


Band40(2305-2315)-10MHz-QPSK-38750-1RB#0-PASS

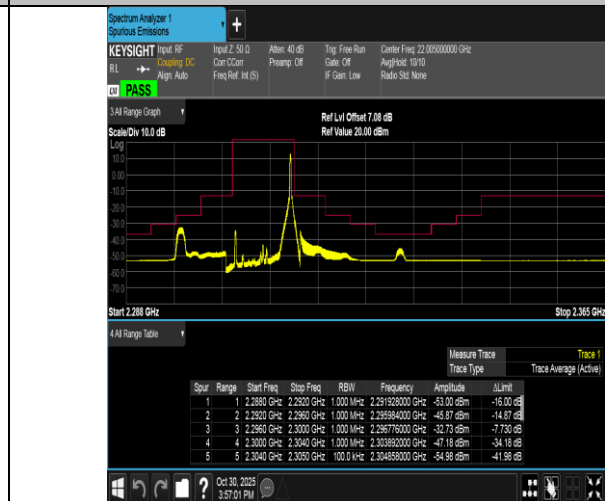


Band40(2305-2315)-10MHz-QPSK-38750-1RB#49-PASS


Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

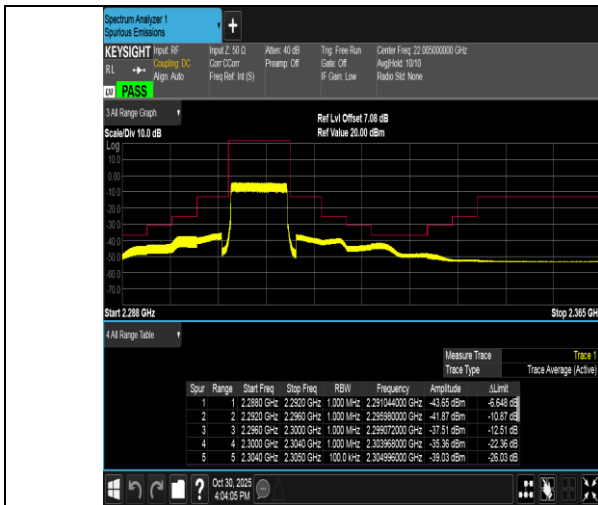

Band40(2305-2315)-10MHz-QPSK-38750-50RB#0-PASS

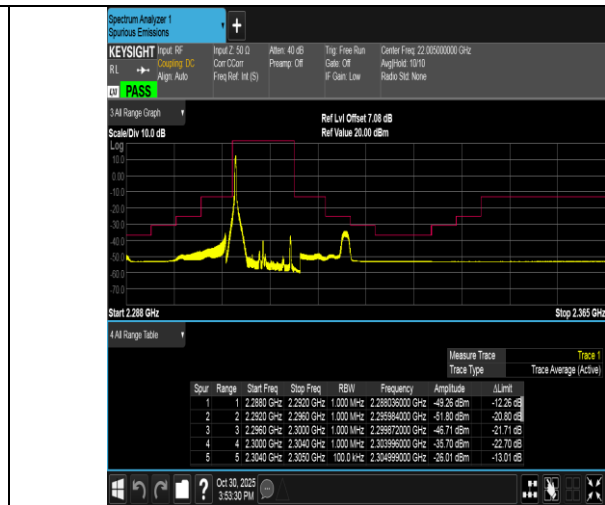

Band40(2305-2315)-10MHz-16QAM-38750-1RB#0-PASS

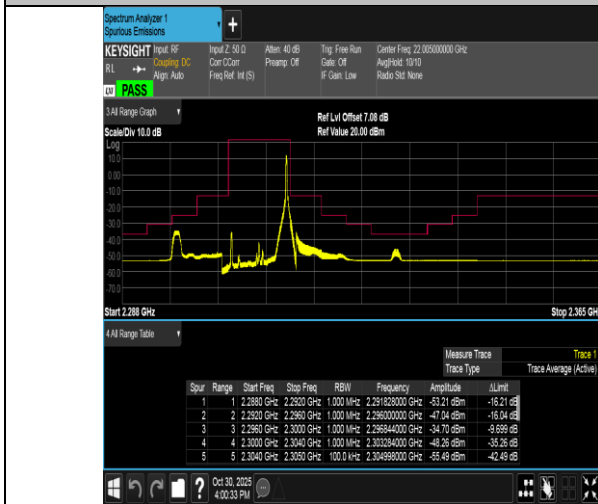

Band40(2305-2315)-10MHz-16QAM-38750-1RB#49-PASS



Band40(2305-2315)-10MHz-16QAM-38750-50RB#0-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	30~1000	-62.69	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	1000~3000	-50.77	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#0	3000~26500	-51.86	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#24	30~1000	-63.11	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#24	1000~3000	-50.81	PASS
Band40(2305-2315)	5MHz	QPSK	38725	1RB#24	3000~26500	-59.04	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	30~1000	-63.01	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	1000~3000	-50.73	PASS
Band40(2305-2315)	5MHz	QPSK	38725	25RB#0	3000~26500	-60.78	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	30~1000	-63.13	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	1000~3000	-50.83	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#0	3000~26500	-57.72	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#24	30~1000	-62.03	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#24	1000~3000	-50.78	PASS
Band40(2305-2315)	5MHz	16QAM	38725	1RB#24	3000~26500	-52.01	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	30~1000	-63.23	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	1000~3000	-50.72	PASS
Band40(2305-2315)	5MHz	16QAM	38725	25RB#0	3000~26500	-62.07	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#0	30~1000	-63.12	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#0	1000~3000	-50.75	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#0	3000~26500	-52.34	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#24	30~1000	-63.17	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#24	1000~3000	-50.79	PASS
Band40(2305-2315)	5MHz	QPSK	38750	1RB#24	3000~26500	-53.29	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	30~1000	-63.19	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	1000~3000	-50.75	PASS
Band40(2305-2315)	5MHz	QPSK	38750	25RB#0	3000~26500	-60.47	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#0	30~1000	-63.12	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#0	1000~3000	-50.71	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#0	3000~26500	-55.02	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#24	30~1000	-63.28	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#24	1000~3000	-50.80	PASS
Band40(2305-2315)	5MHz	16QAM	38750	1RB#24	3000~26500	-55.93	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	30~1000	-63.12	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.


Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	1000~3000	-50.79	PASS
Band40(2305-2315)	5MHz	16QAM	38750	25RB#0	3000~26500	-61.85	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	30~1000	-63.17	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	1000~3000	-50.74	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#0	3000~26500	-55.48	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#24	30~1000	-63.22	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#24	1000~3000	-50.79	PASS
Band40(2305-2315)	5MHz	QPSK	38775	1RB#24	3000~26500	-55.41	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	30~1000	-63.16	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	1000~3000	-50.79	PASS
Band40(2305-2315)	5MHz	QPSK	38775	25RB#0	3000~26500	-63.62	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	30~1000	-63.21	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	1000~3000	-50.78	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#0	3000~26500	-54.86	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#24	30~1000	-62.94	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#24	1000~3000	-50.78	PASS
Band40(2305-2315)	5MHz	16QAM	38775	1RB#24	3000~26500	-57.14	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	30~1000	-63.31	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	1000~3000	-50.78	PASS
Band40(2305-2315)	5MHz	16QAM	38775	25RB#0	3000~26500	-60.92	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	30~1000	-62.75	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	1000~3000	-50.58	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#0	3000~26500	-63.70	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#49	30~1000	-63.21	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#49	1000~3000	-50.83	PASS
Band40(2305-2315)	10MHz	QPSK	38750	1RB#49	3000~26500	-52.41	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	30~1000	-62.32	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	1000~3000	-48.78	PASS
Band40(2305-2315)	10MHz	QPSK	38750	50RB#0	3000~26500	-62.20	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	30~1000	-62.92	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	1000~3000	-50.82	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#0	3000~26500	-53.19	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#49	30~1000	-62.84	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#49	1000~3000	-50.81	PASS
Band40(2305-2315)	10MHz	16QAM	38750	1RB#49	3000~26500	-50.09	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	30~1000	-62.91	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	1000~3000	-49.87	PASS
Band40(2305-2315)	10MHz	16QAM	38750	50RB#0	3000~26500	-63.47	PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

Test Graphs



Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the “Dedicated Testing/Inspection Stamp” is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

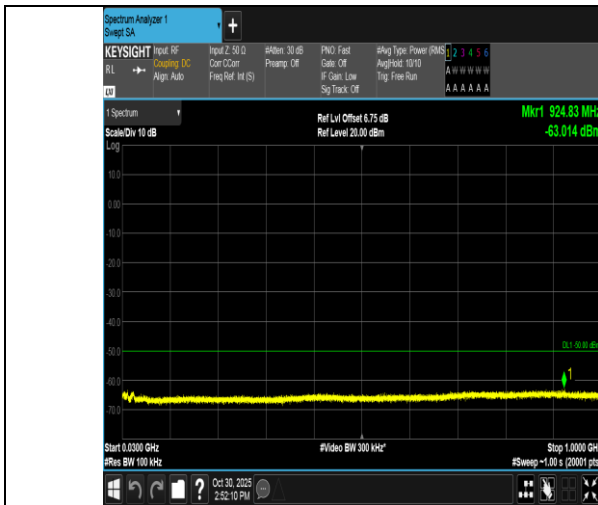

Band40(2305-2315)-5MHz-QPSK-38725-25RB#0-30~1000-PASS



Band40(2305-2315)-5MHz-QPSK-38725-25RB#0-1000~3000-PASS



Band40(2305-2315)-5MHz-QPSK-38725-25RB#0-3000~26500-PASS



Band40(2305-2315)-5MHz-16QAM-38725-1RB#0-30~1000-PASS




Band40(2305-2315)-5MHz-16QAM-38725-1RB#0-1000~3000-PASS



Band40(2305-2315)-5MHz-16QAM-38725-1RB#0-3000~26500-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

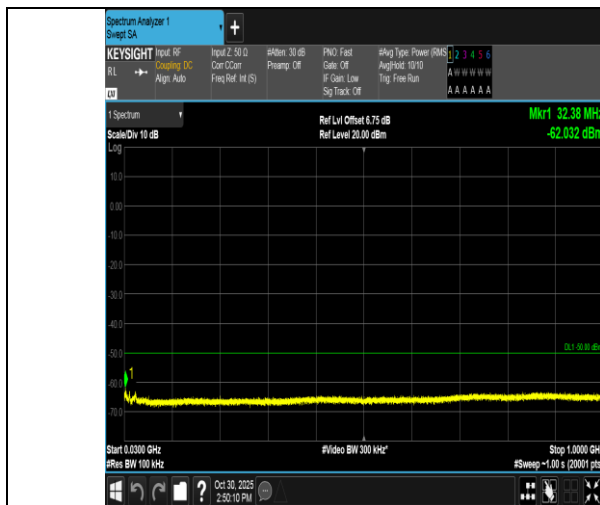


Band40(2305-2315)-5MHz-16QAM-38725-1RB#24-30~1000-PASS



Band40(2305-2315)-5MHz-16QAM-38725-1RB#24-1000~3000-PASS



Band40(2305-2315)-5MHz-16QAM-38725-1RB#24-3000~26500-PASS

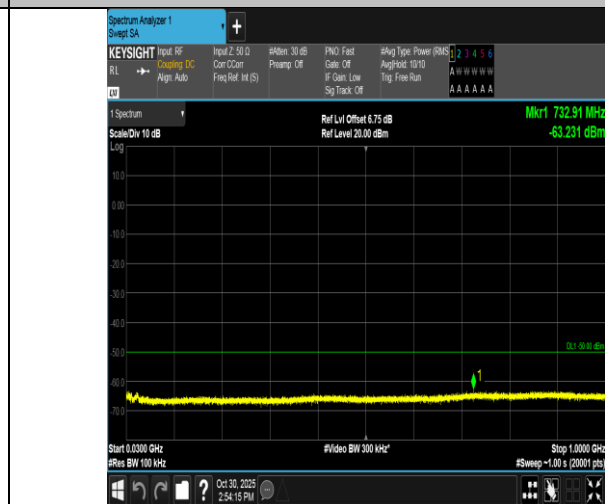

Band40(2305-2315)-5MHz-16QAM-38725-25RB#0-30~1000-PASS



Band40(2305-2315)-5MHz-16QAM-38725-25RB#0-1000~3000-PASS




Band40(2305-2315)-5MHz-16QAM-38725-25RB#0-3000~26500-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band40(2305-2315)-5MHz-QPSK-38750-1RB#0-30~1000-PASS

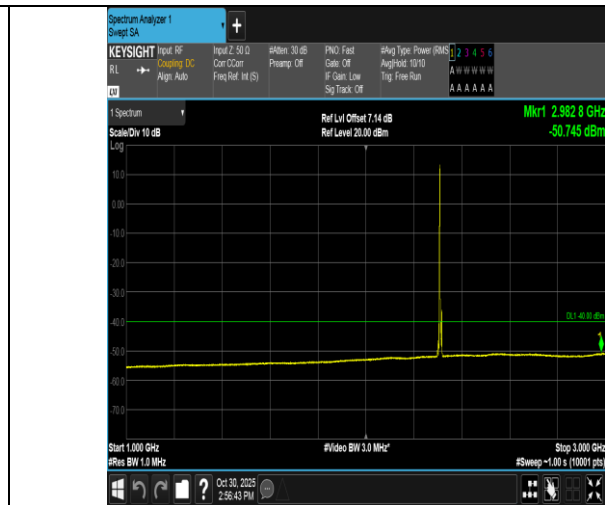

Band40(2305-2315)-5MHz-QPSK-38750-1RB#0-1000~3000-PASS



Band40(2305-2315)-5MHz-QPSK-38750-1RB#0-3000~26500-PASS



Band40(2305-2315)-5MHz-QPSK-38750-1RB#24-30~1000-PASS



Band40(2305-2315)-5MHz-QPSK-38750-1RB#24-1000~3000-PASS



Band40(2305-2315)-5MHz-QPSK-38750-1RB#24-3000~26500-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band40(2305-2315)-5MHz-QPSK-38750-25RB#0-30~1000-PASS



Band40(2305-2315)-5MHz-QPSK-38750-25RB#0-1000~3000-PASS




Band40(2305-2315)-5MHz-QPSK-38750-25RB#0-3000~26500-PASS



Band40(2305-2315)-5MHz-16QAM-38750-1RB#0-30~1000-PASS



Band40(2305-2315)-5MHz-16QAM-38750-1RB#0-1000~3000-PASS

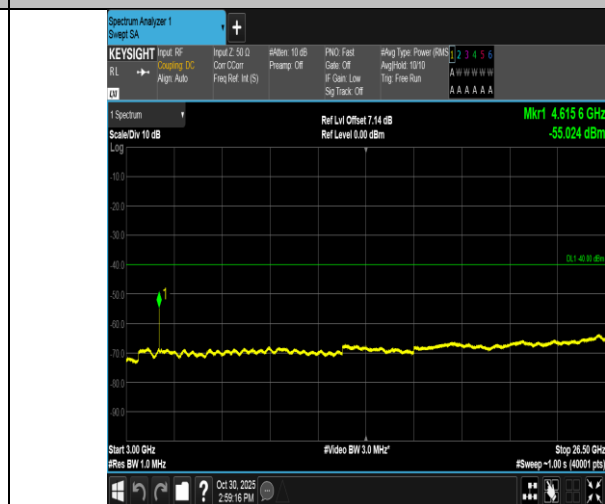


Band40(2305-2315)-5MHz-16QAM-38750-1RB#0-3000~26500-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.



Band40(2305-2315)-5MHz-16QAM-38750-1RB#24-30~1000-PASS

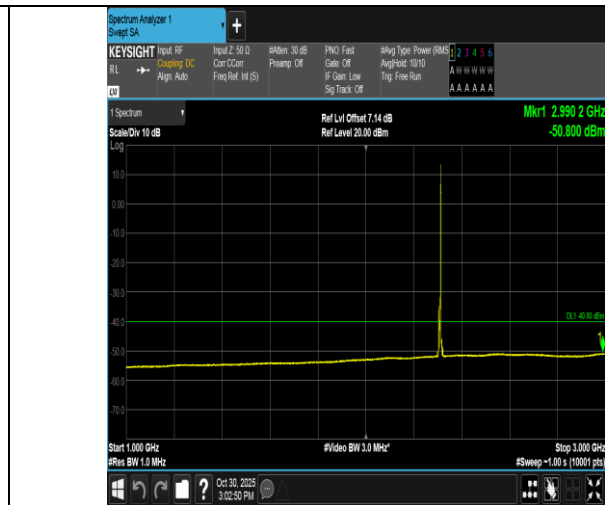

Band40(2305-2315)-5MHz-16QAM-38750-1RB#24-1000~3000-PASS



Band40(2305-2315)-5MHz-16QAM-38750-1RB#24-3000~26500-PASS



Band40(2305-2315)-5MHz-16QAM-38750-25RB#0-30~1000-PASS




Band40(2305-2315)-5MHz-16QAM-38750-25RB#0-3000~26500-PASS




Band40(2305-2315)-5MHz-QPSK-38775-1RB#0-30~1000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.

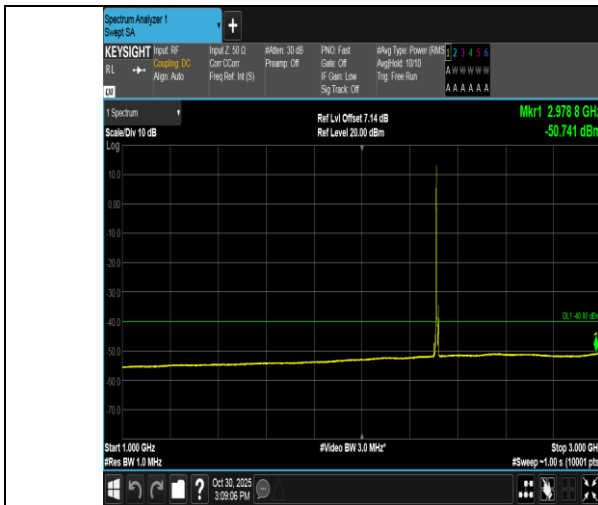


Band40(2305-2315)-5MHz-QPSK-38775-1RB#0-1000~3000-PASS

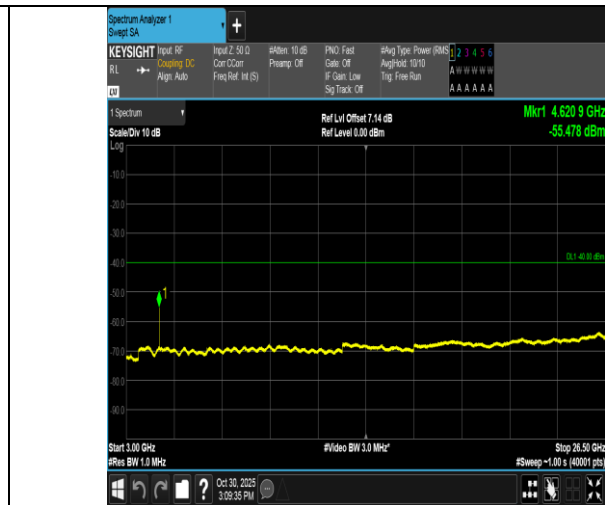

Band40(2305-2315)-5MHz-QPSK-38775-1RB#0-3000~26500-PASS



Band40(2305-2315)-5MHz-QPSK-38775-1RB#24-30~1000-PASS

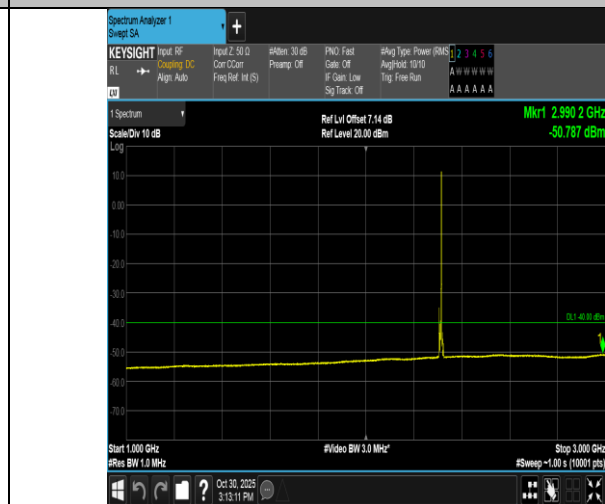

Band40(2305-2315)-5MHz-QPSK-38775-1RB#24-1000~3000-PASS



Band40(2305-2315)-5MHz-QPSK-38775-1RB#24-3000~26500-PASS



Band40(2305-2315)-5MHz-QPSK-38775-25RB#0-30~1000-PASS

Any report having not been signed by authorized approver, or having been altered without authorization, or having not been stamped by the "Dedicated Testing/Inspection Stamp" is deemed to be invalid. Copying or excerpting portion of, or altering the content of the report is not permitted without the written authorization of AGC. The test results presented in the report apply only to the tested sample. Any objections to report issued by AGC should be submitted to AGC within 15days after the issuance of the test report. Further enquiry of validity or verification of the test report should be addressed to AGC by agc01@agccert.com.