






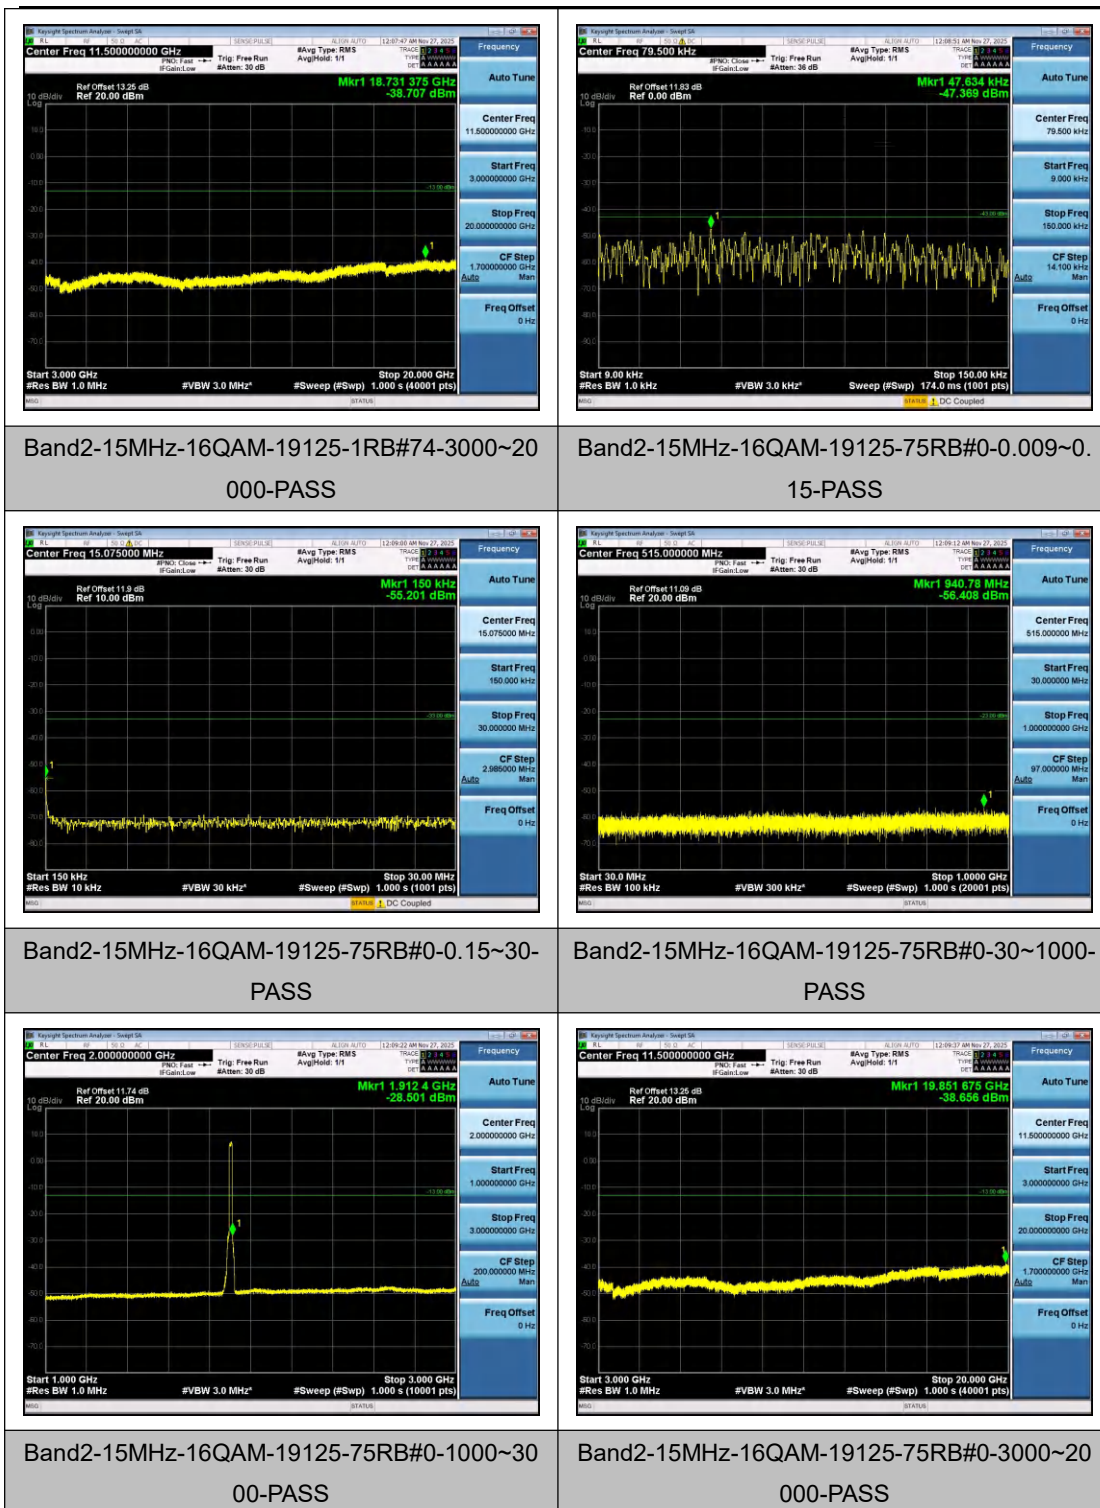


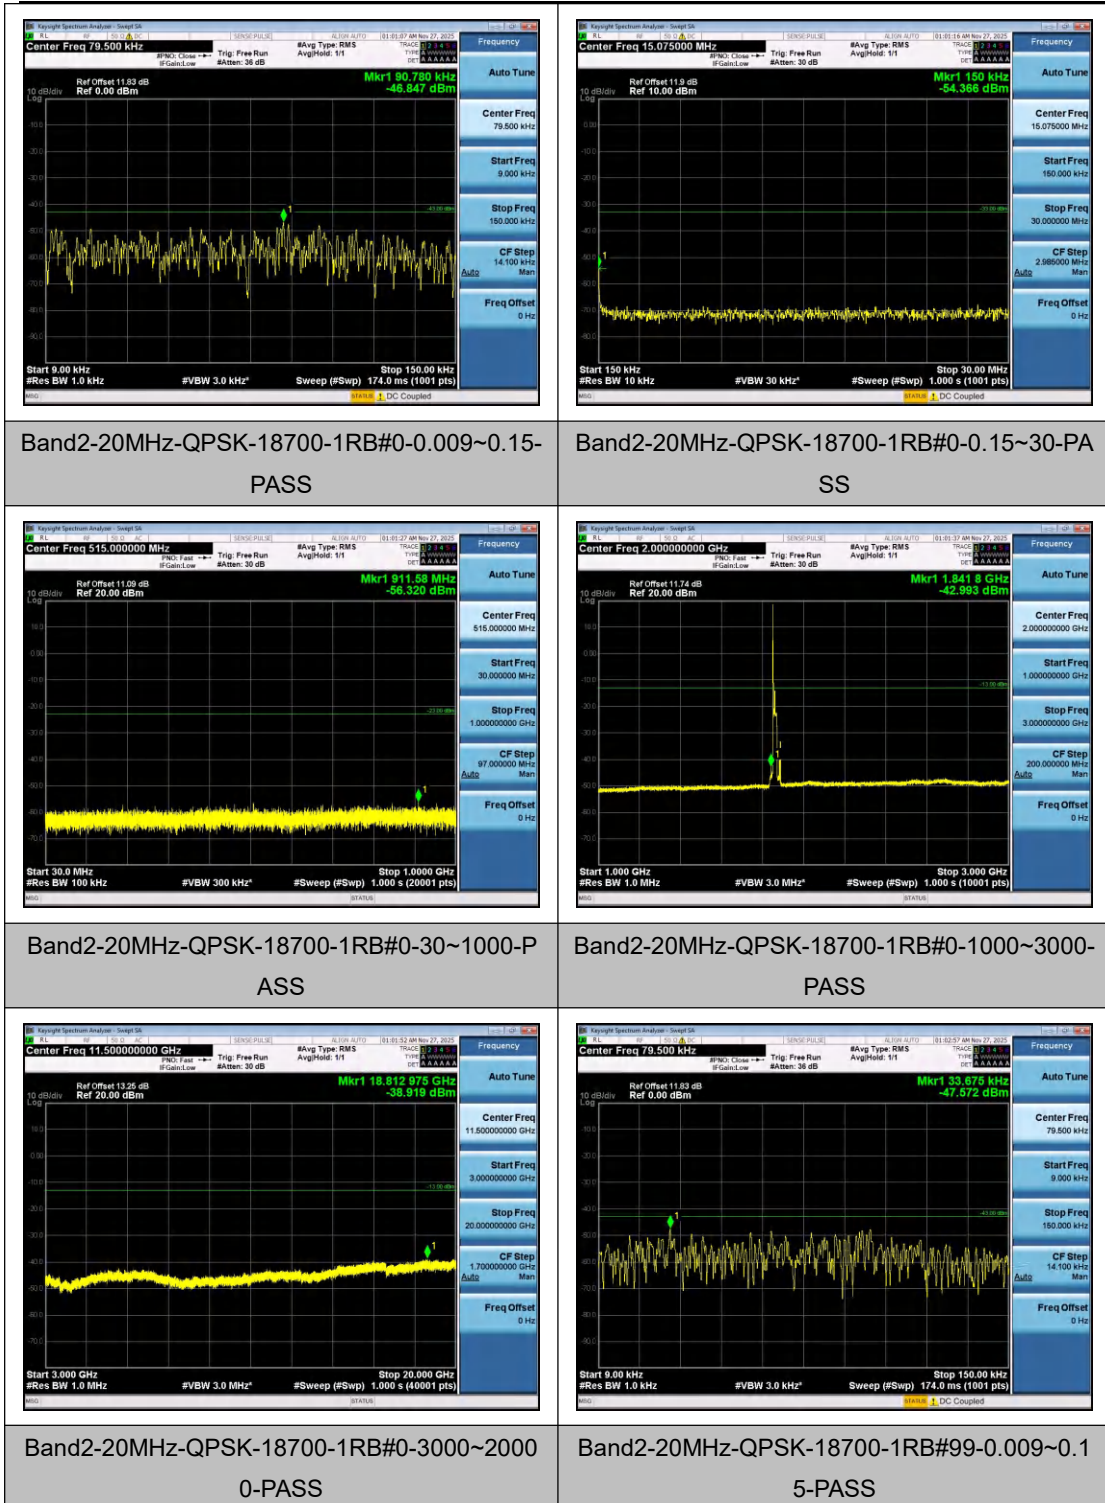


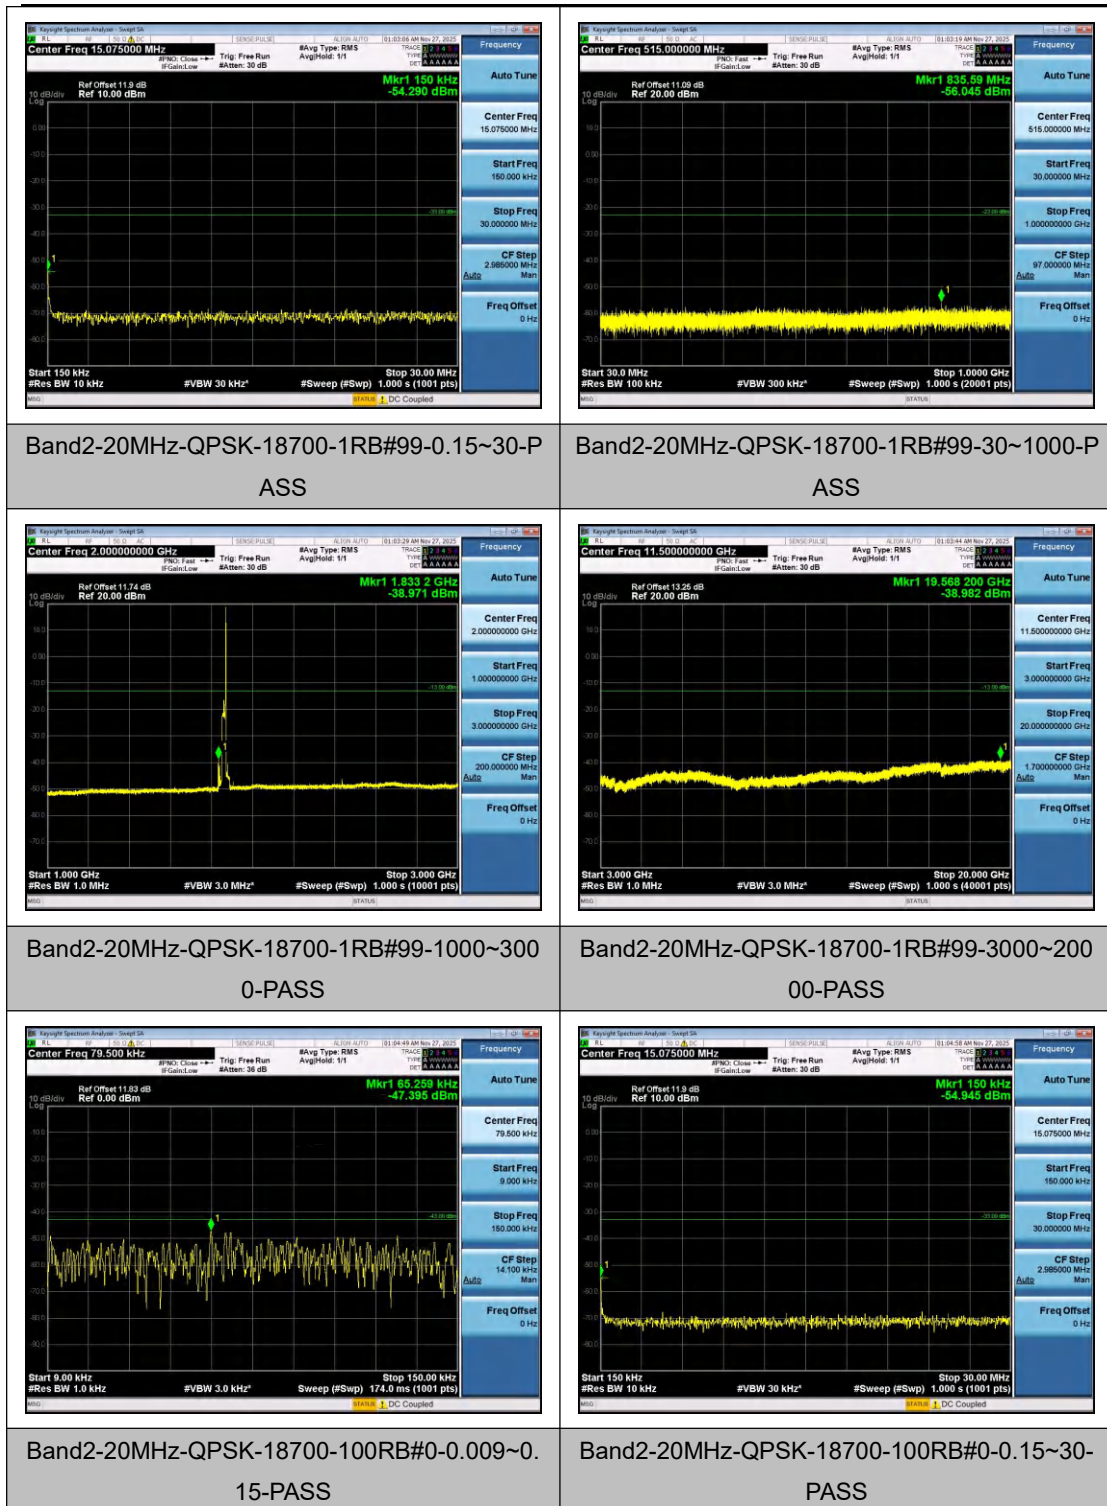


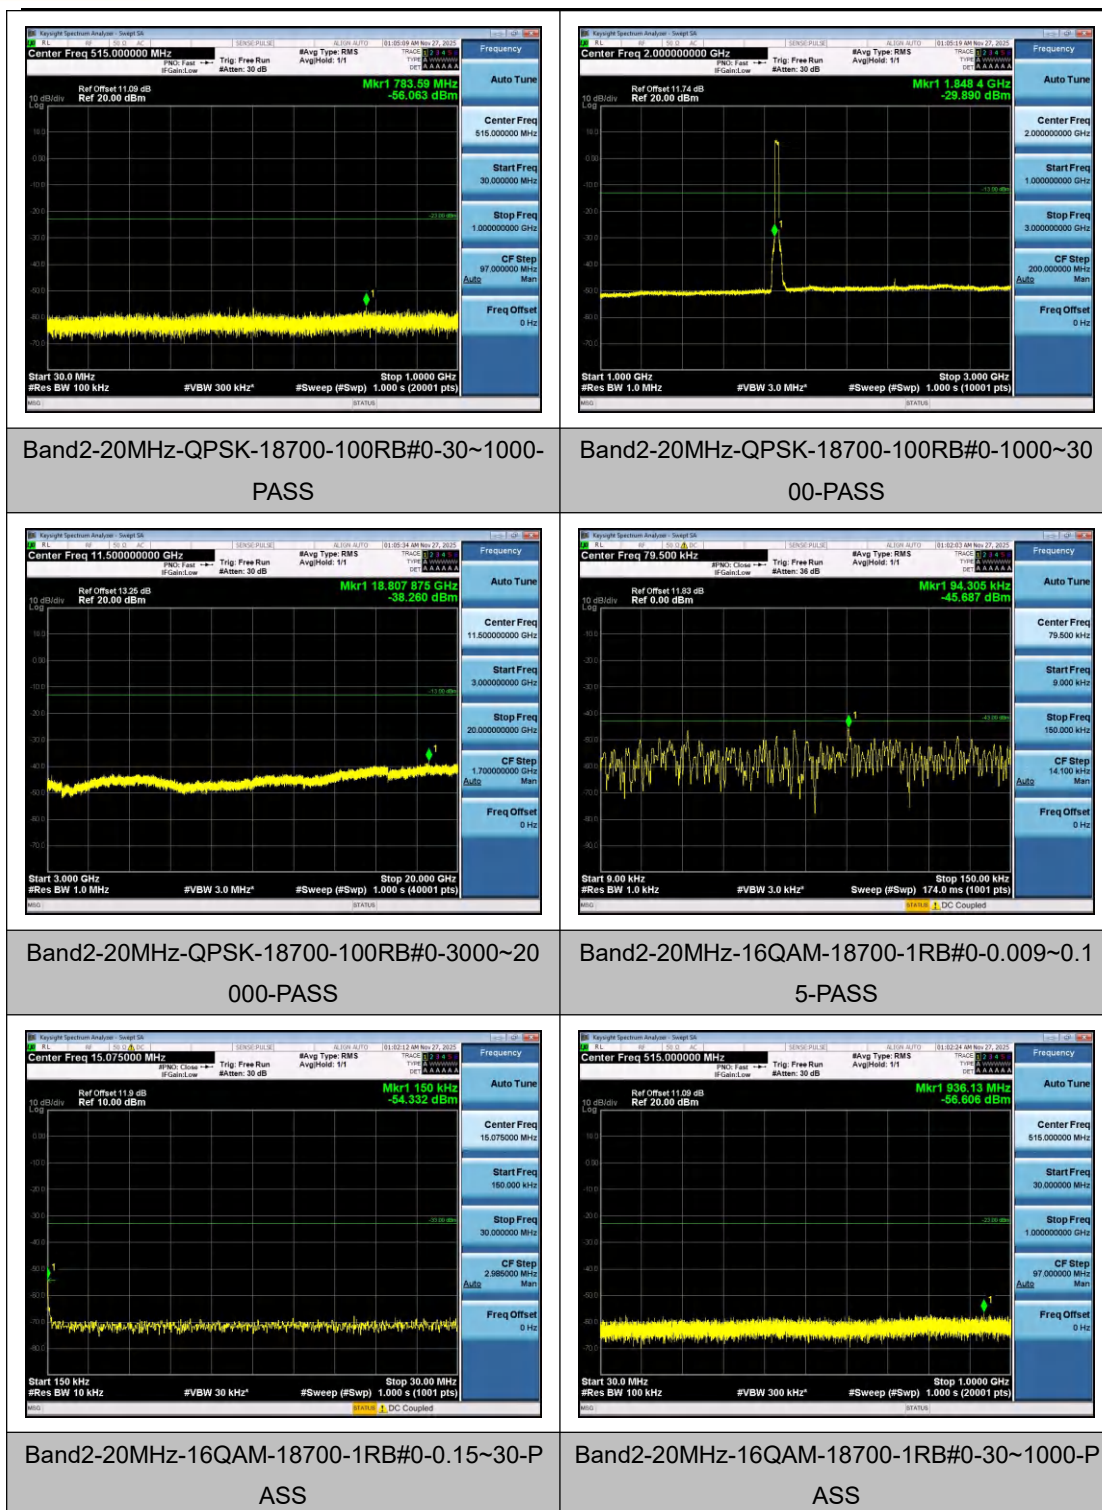

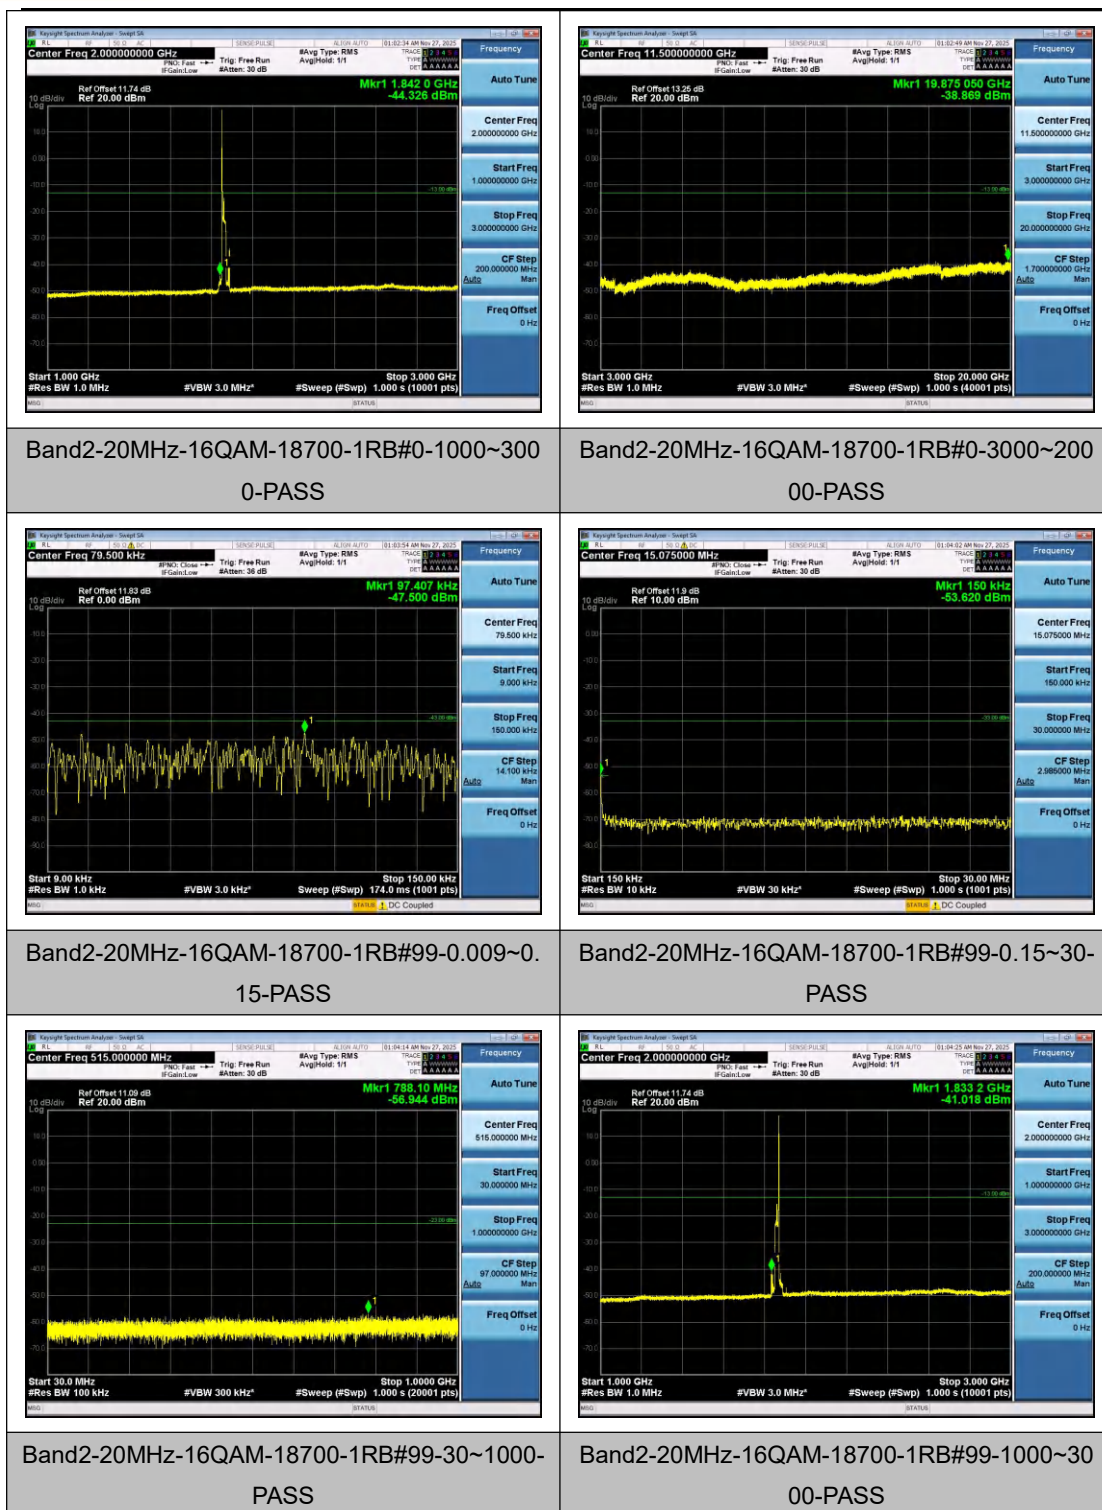


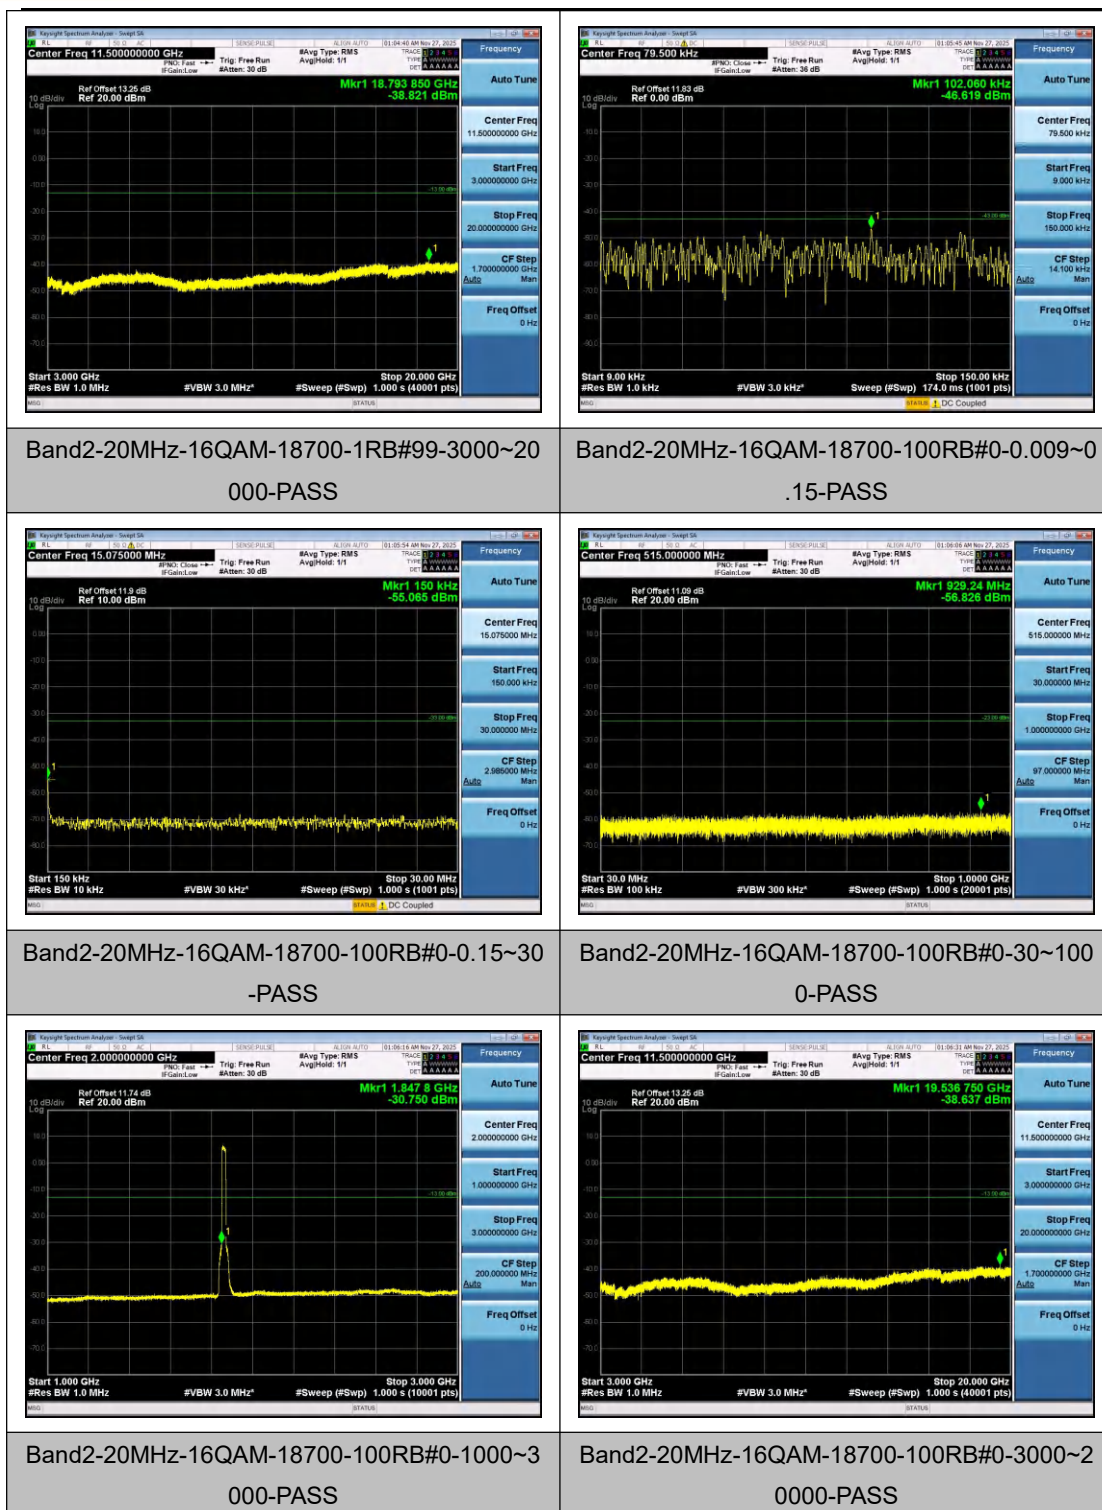


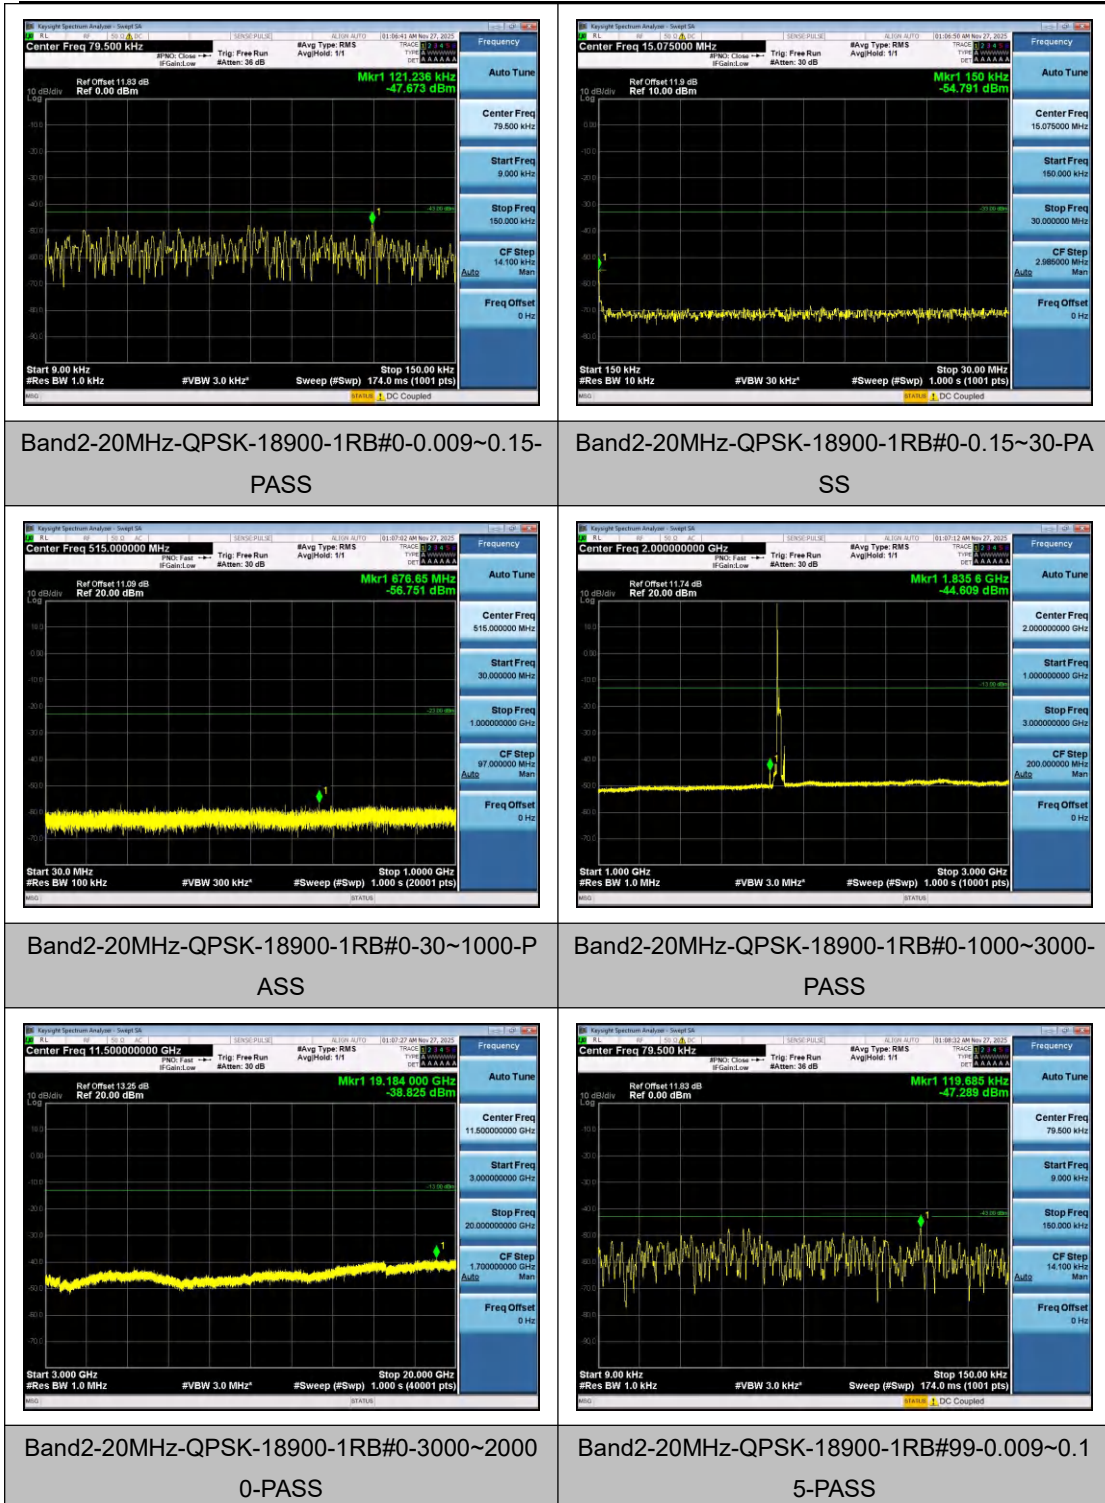


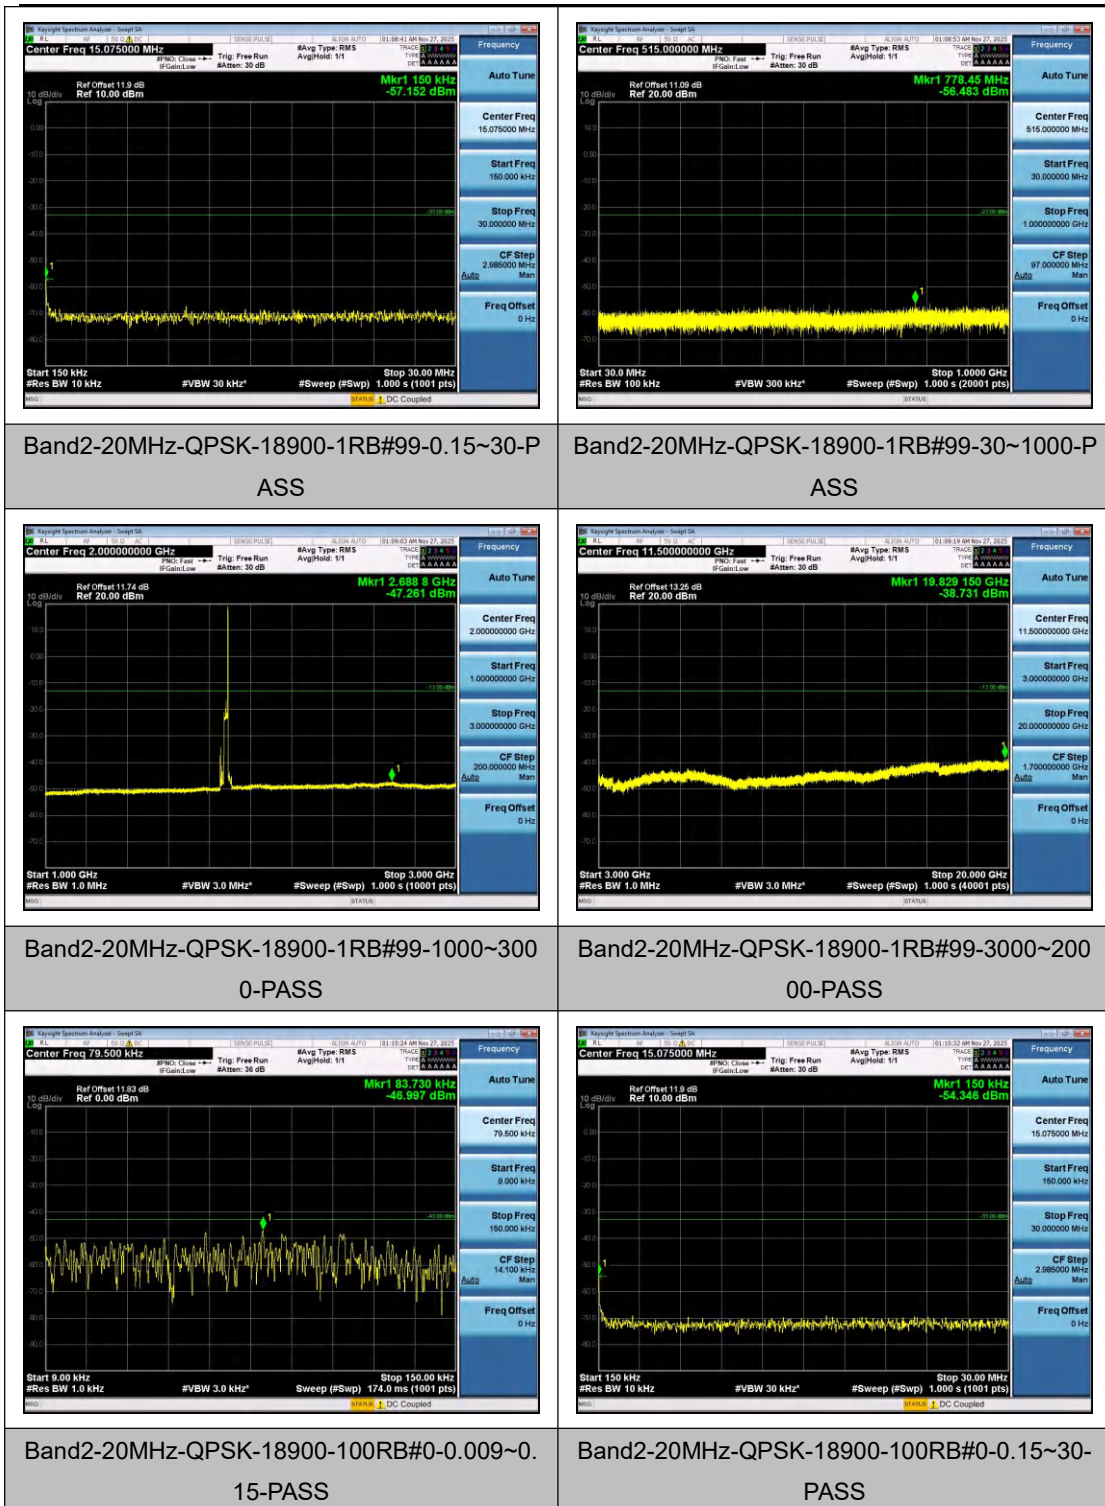



Band2-20MHz-QPSK-18900-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-18900-100RB#0-1000~3000-PASS
Band2-20MHz-QPSK-18900-100RB#0-3000~20000-PASS	Band2-20MHz-16QAM-18900-1RB#0-0.009~0.15-PASS
Band2-20MHz-16QAM-18900-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-18900-1RB#0-30~1000-PASS

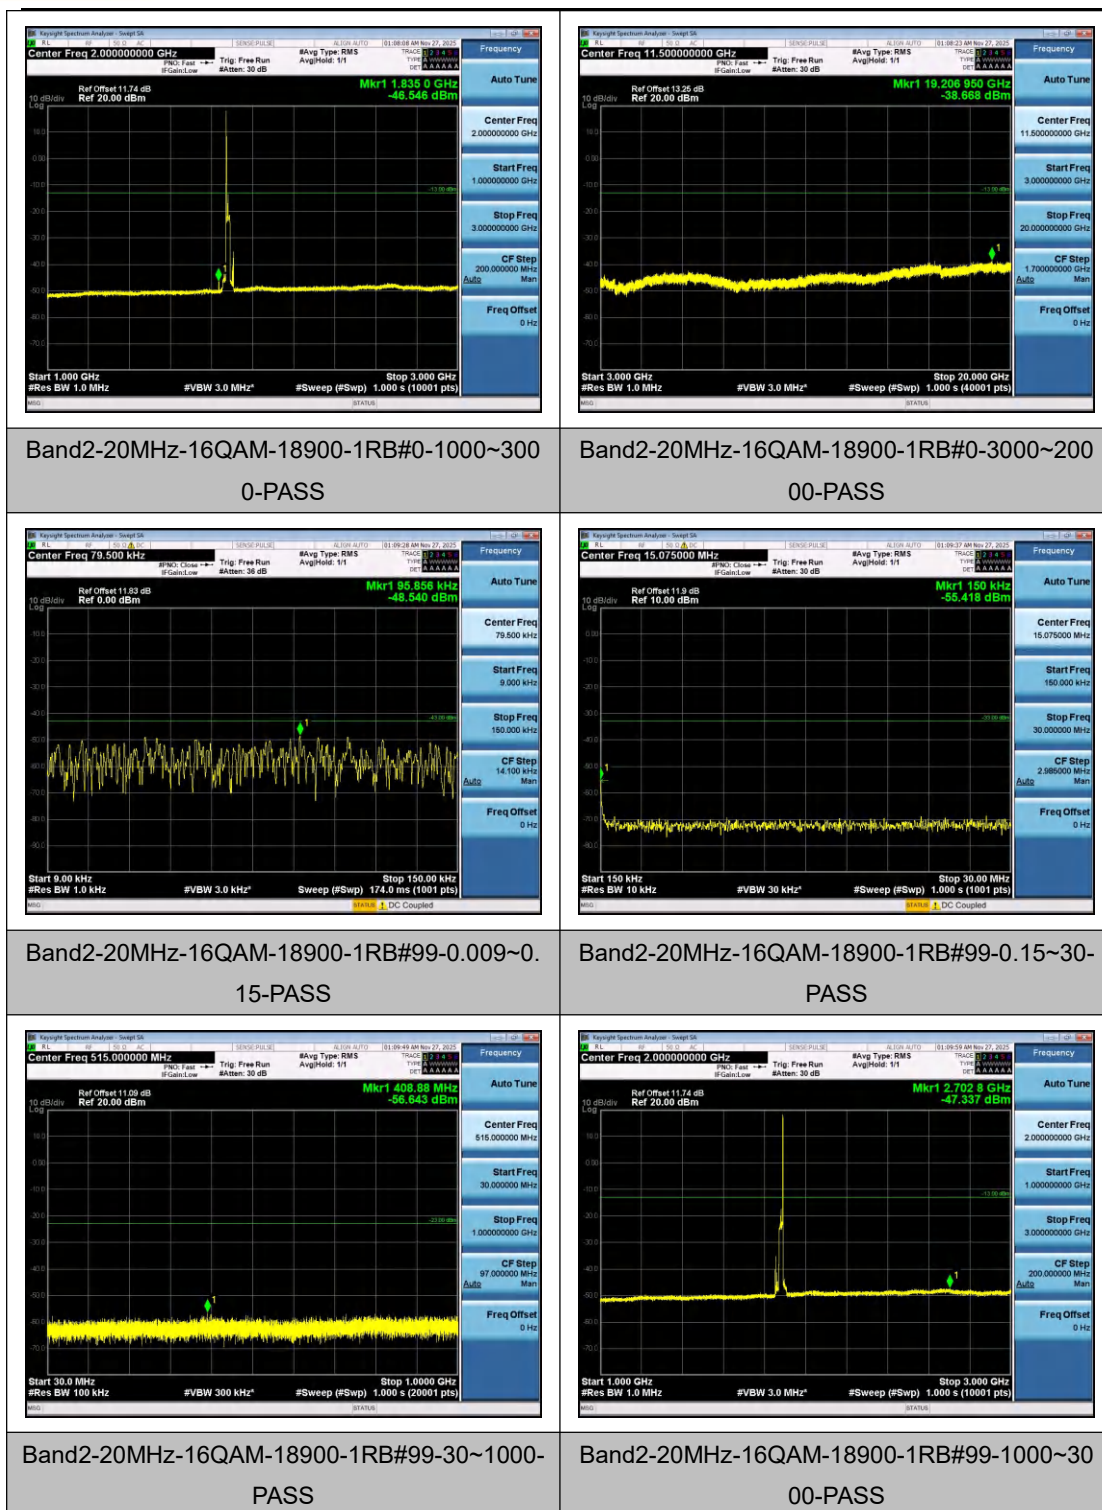


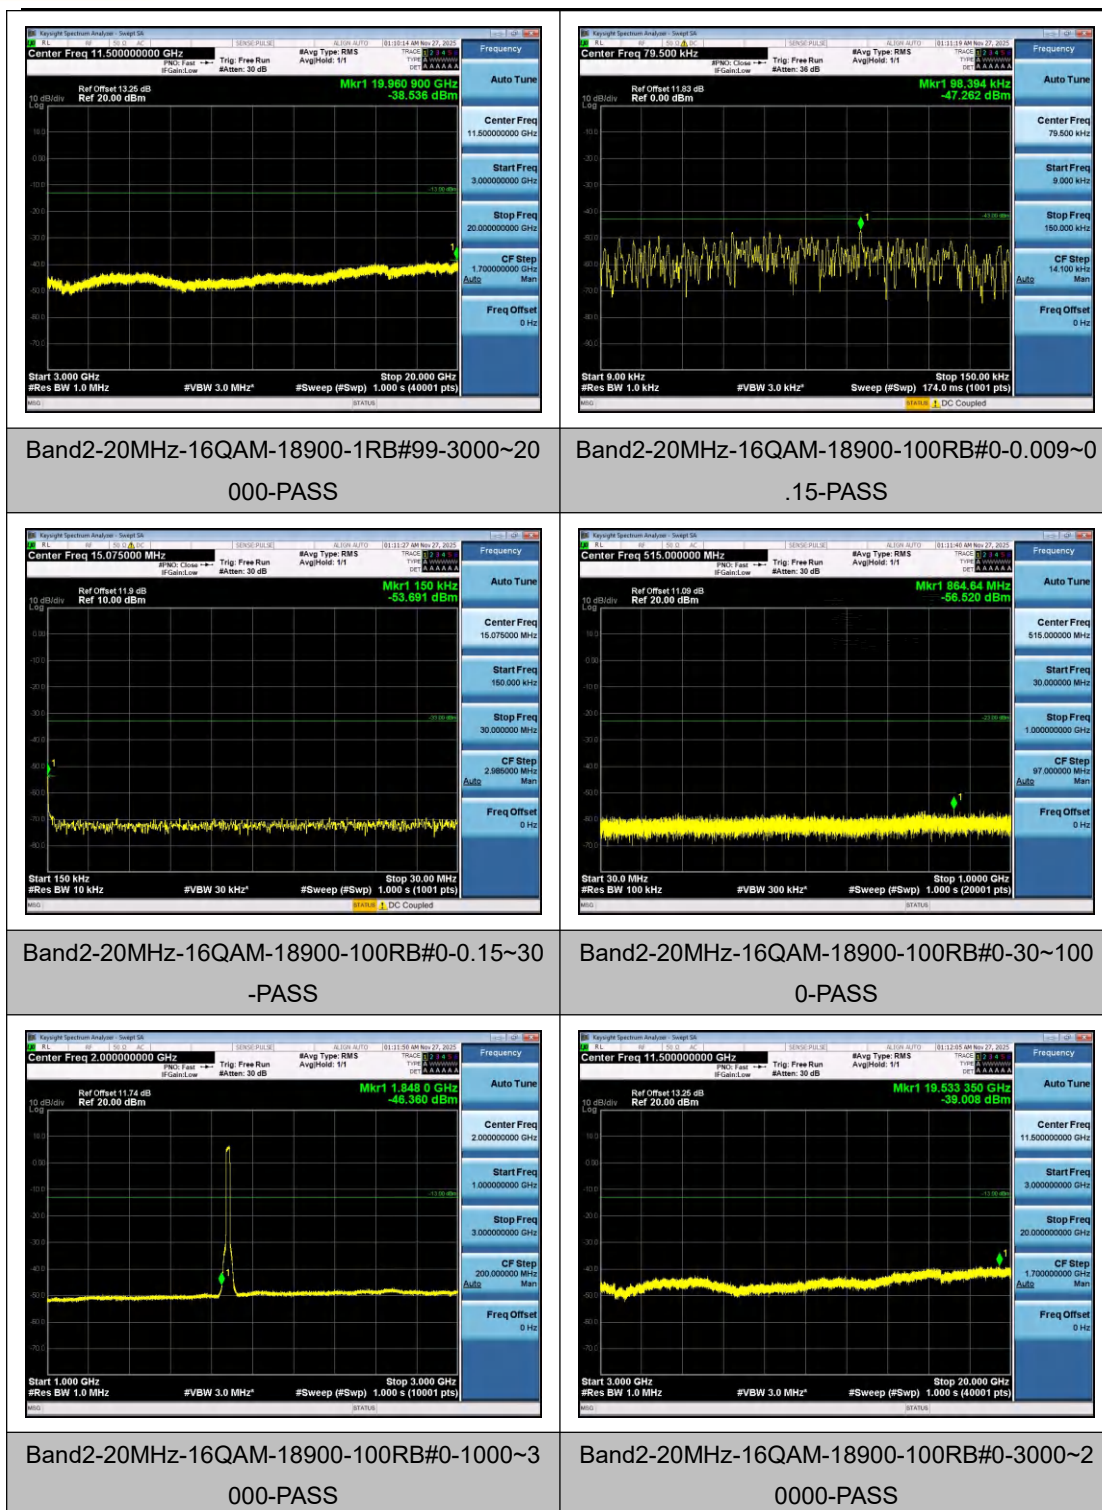


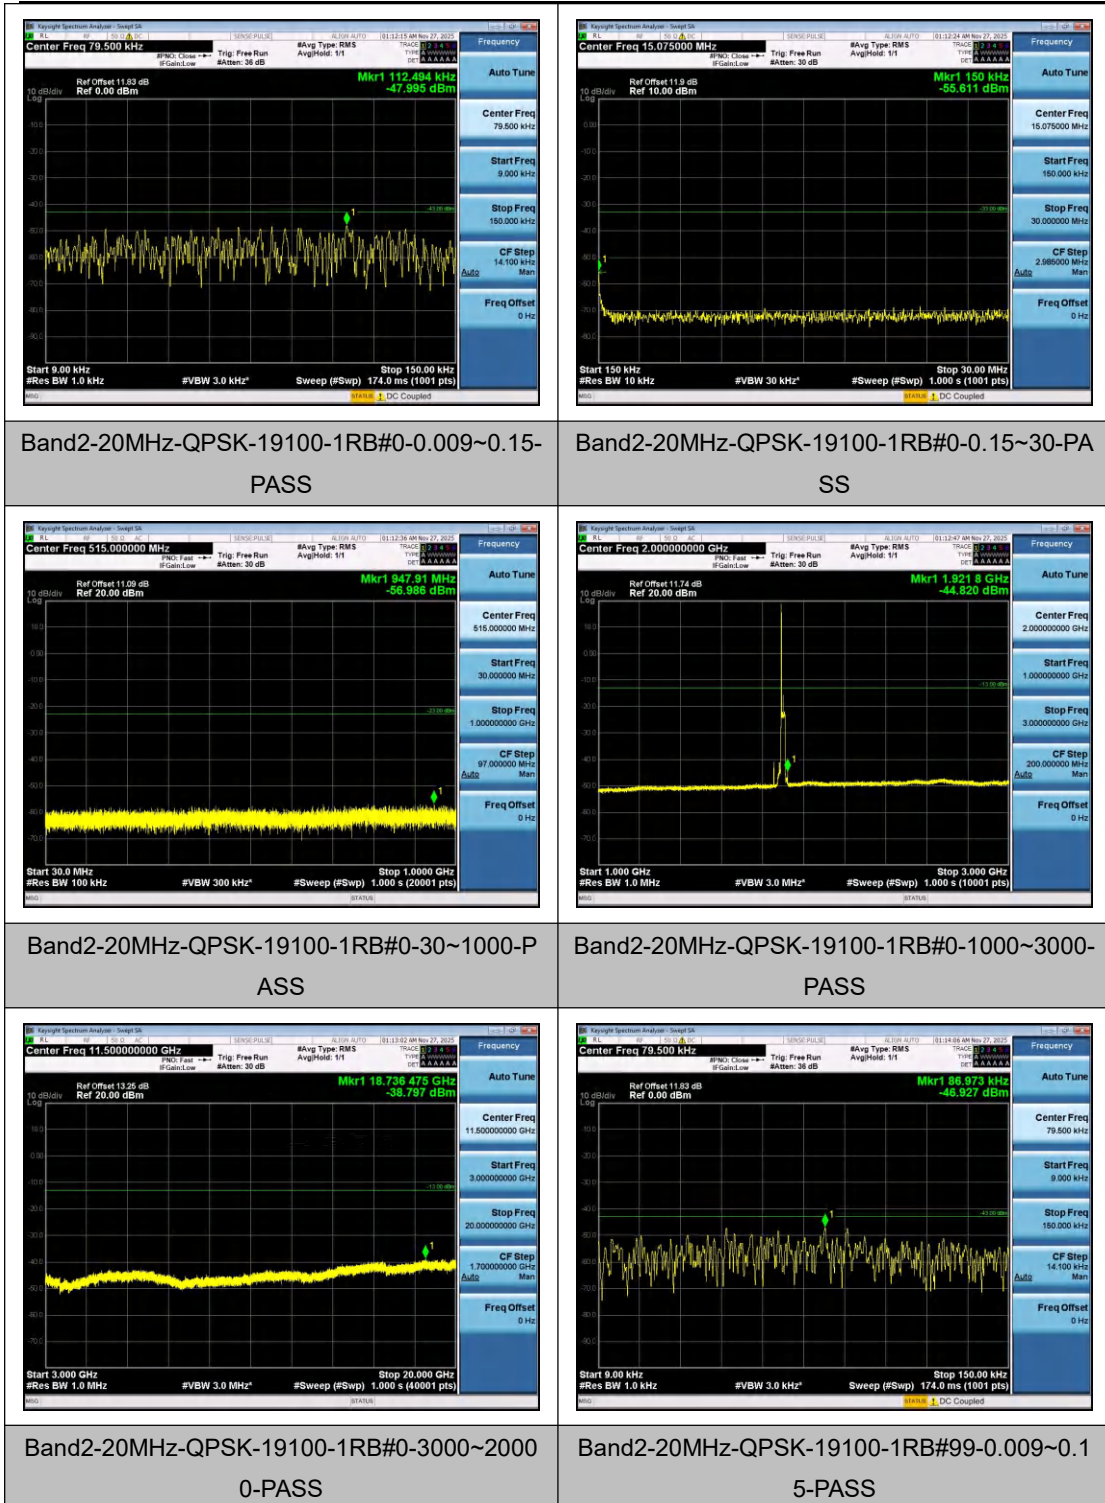

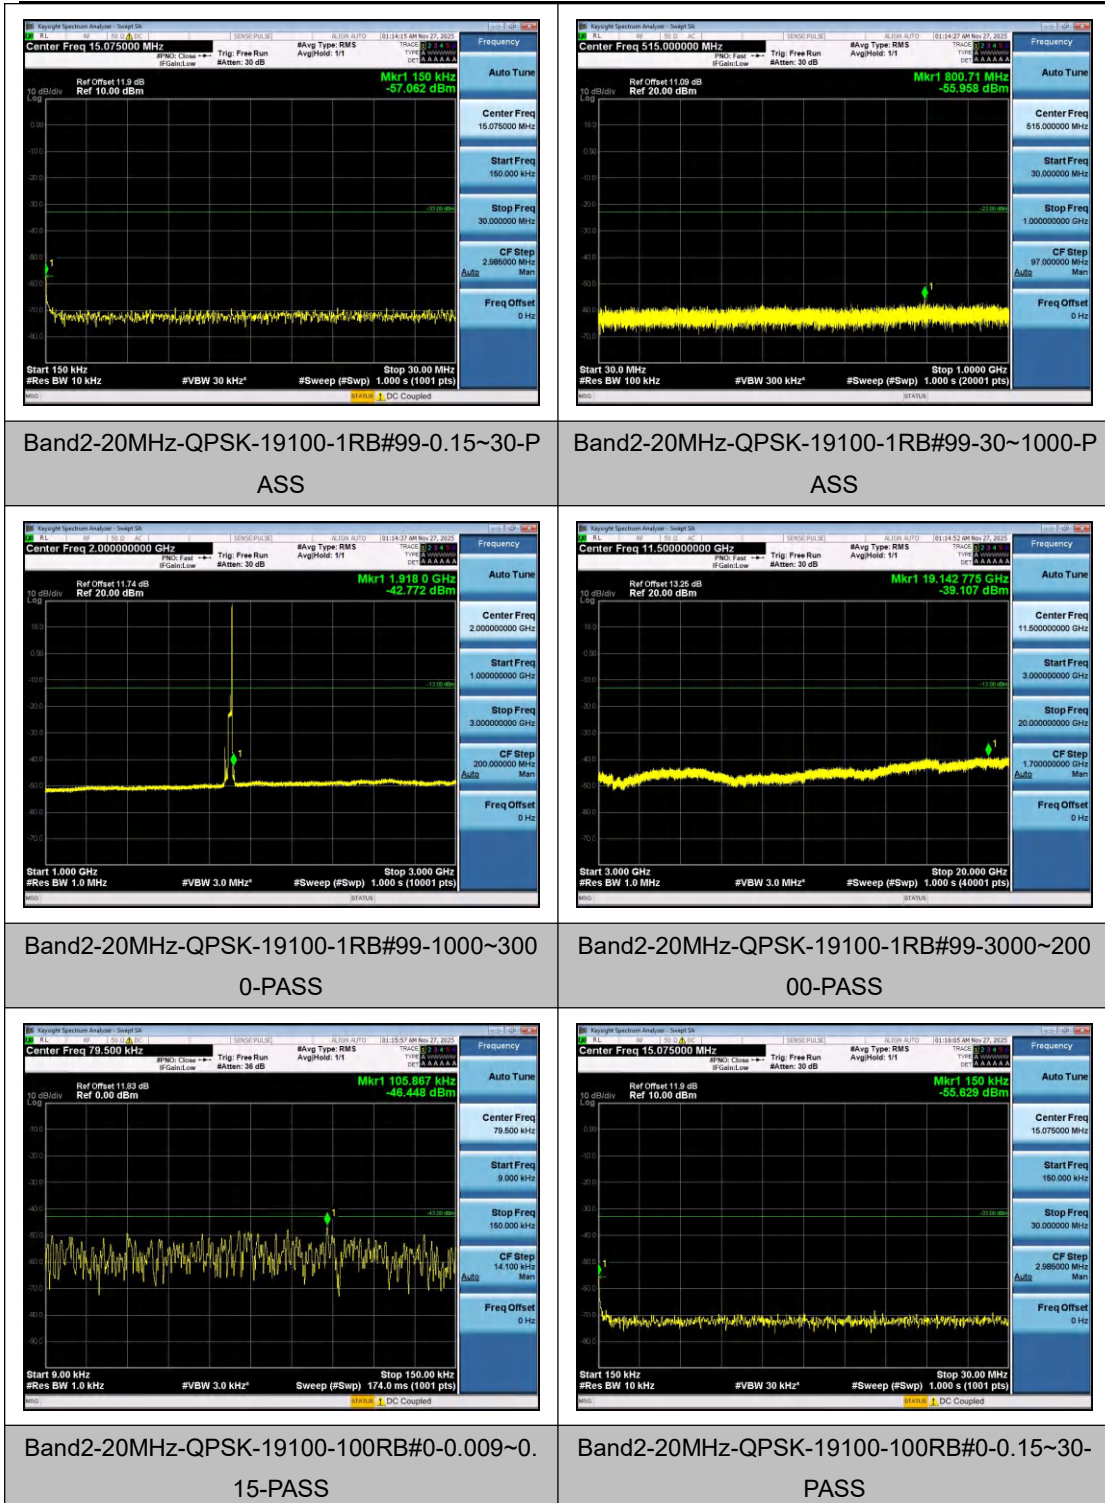

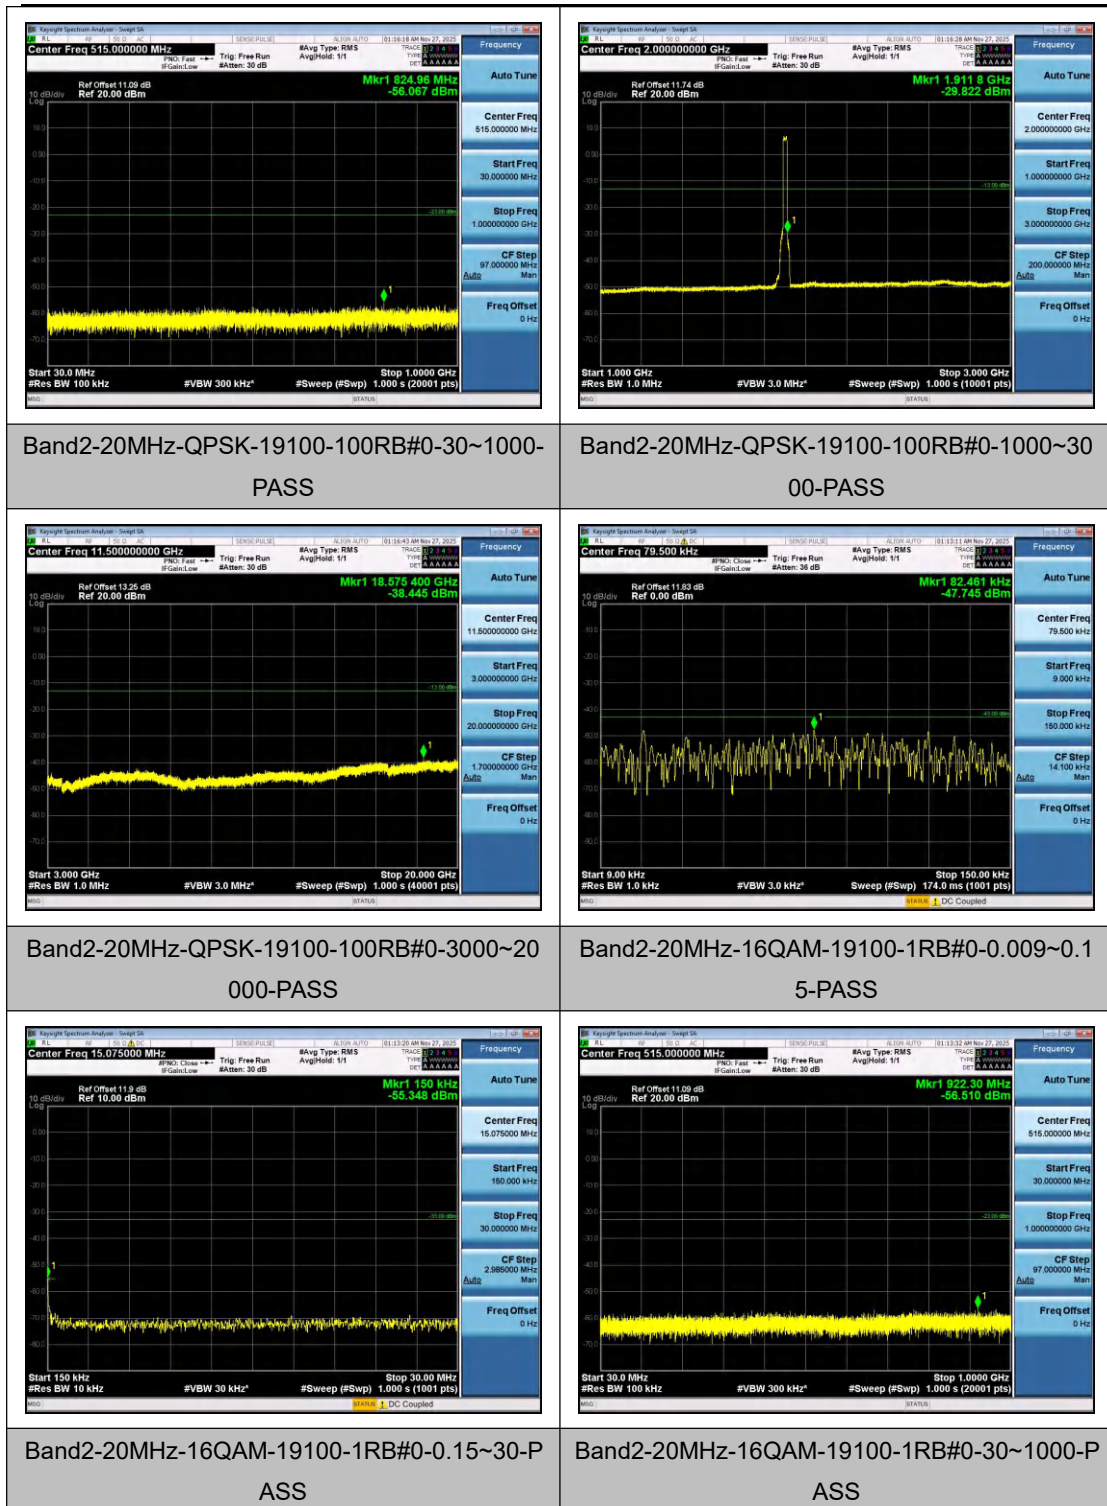

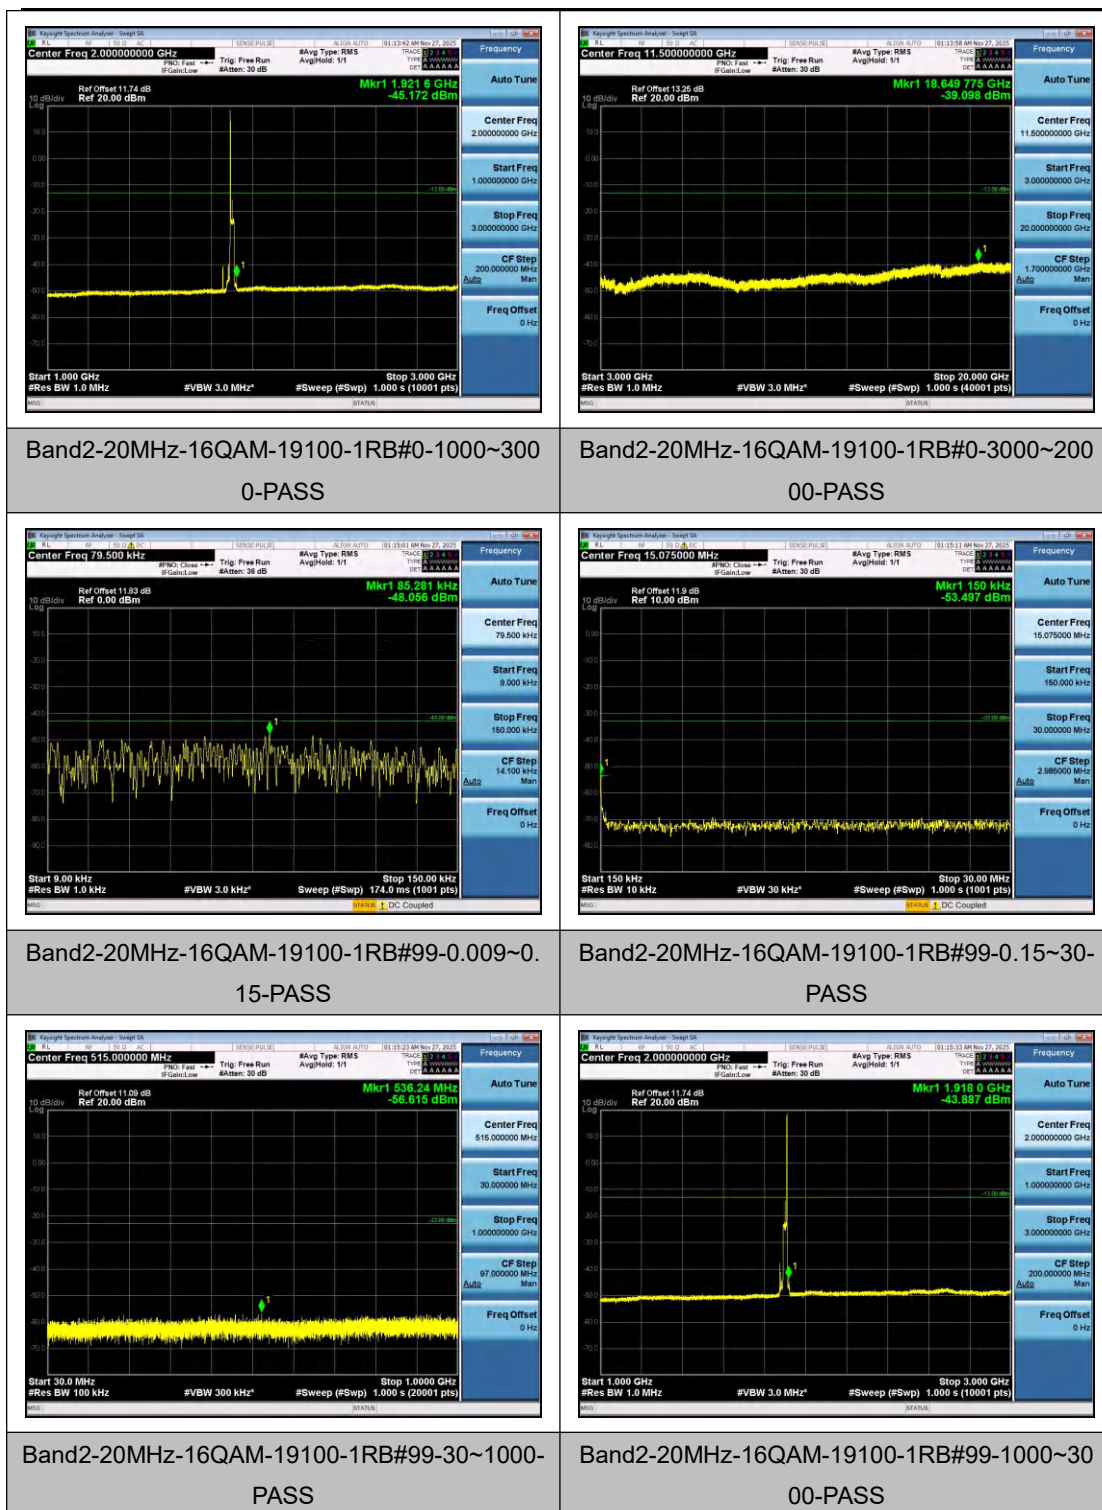

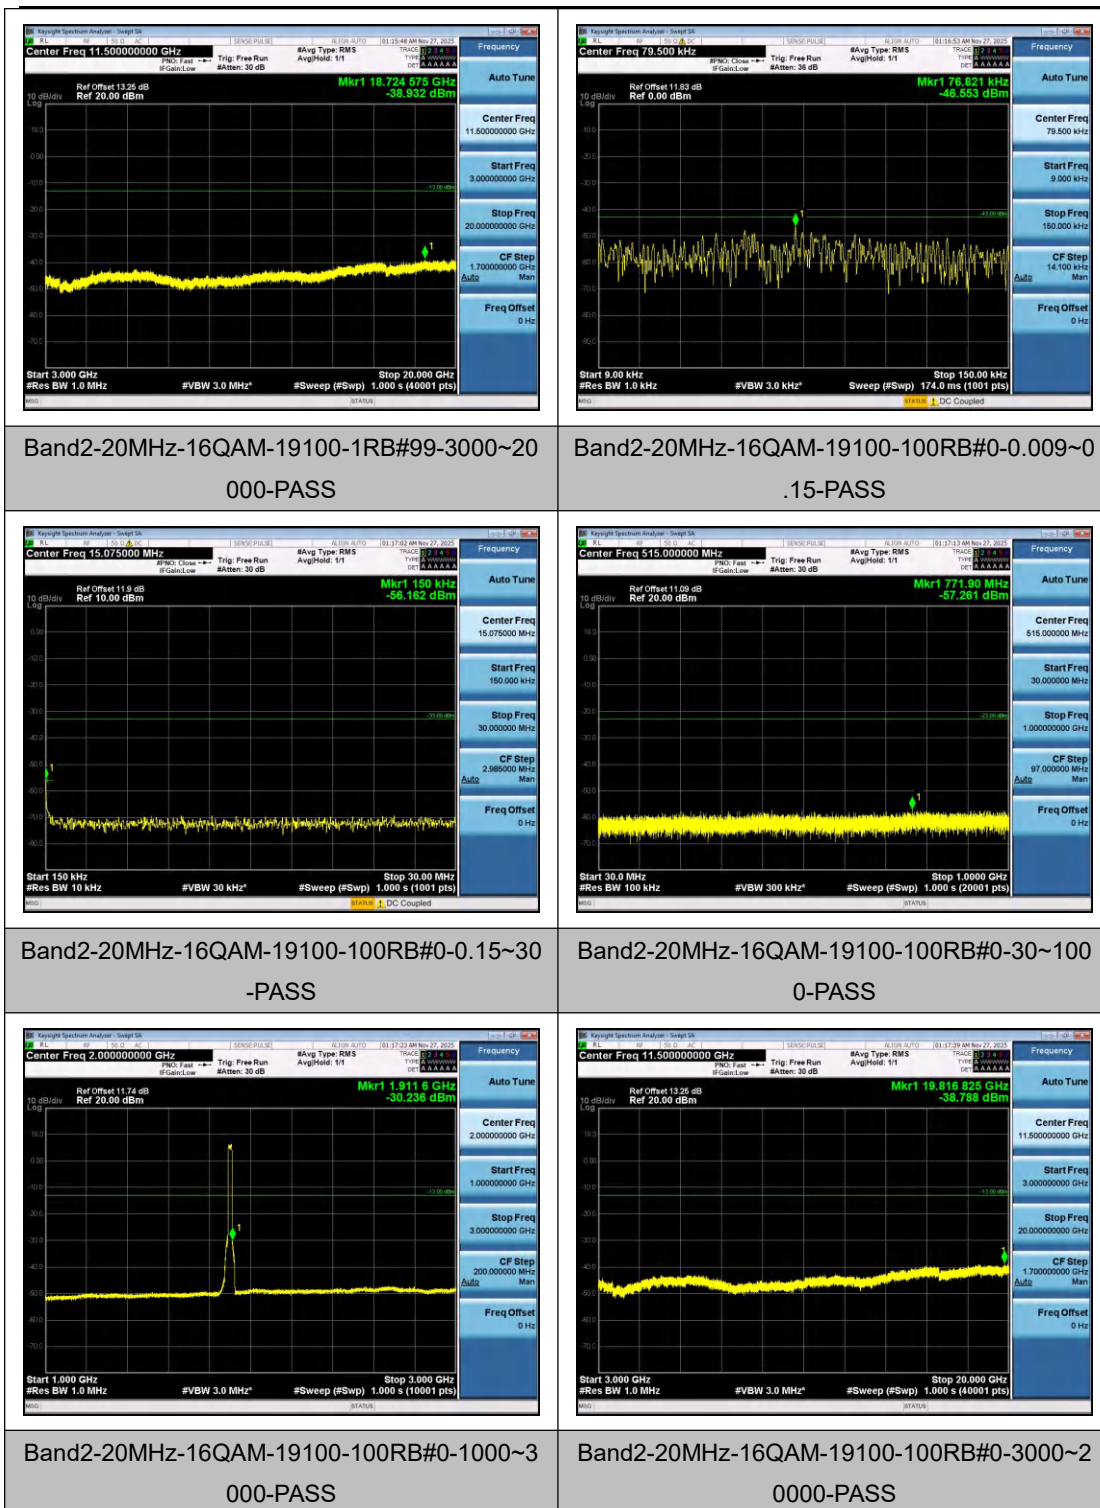

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band 2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15793	1851.23673	1850-1910	PASS
Band 2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15874	1851.23694	1850-1910	PASS
Band 2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15974	1851.23744	1850-1910	PASS
Band 2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15695	1851.23805	1850-1910	PASS
Band 2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.1575	1851.2373	1850-1910	PASS
Band 2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15759	1851.23809	1850-1910	PASS
Band 2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45652	1880.53532	1850-1910	PASS
Band 2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.4589	1880.537	1850-1910	PASS
Band 2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.4562	1880.5371	1850-1910	PASS
Band 2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45674	1880.53674	1850-1910	PASS
Band 2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45901	1880.53891	1850-1910	PASS
Band 2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45645	1880.53695	1850-1910	PASS
Band 2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75712	1909.83962	1850-1910	PASS
Band 2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75786	1909.83756	1850-1910	PASS
Band 2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75684	1909.83864	1850-1910	PASS
Band 2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75632	1909.83792	1850-1910	PASS
Band 2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75649	1909.83819	1850-1910	PASS
Band 2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75789	1909.83819	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	3MHz	QPSK	1861 5	15RB# 0	VN	NT	1850.16 495	1852.83 535	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	VL	NT	1850.16 349	1852.83 839	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	VH	NT	1850.16 265	1852.83 425	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	VN	NT	1850.16 621	1852.83 421	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	VL	NT	1850.16 39	1852.83 71	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	VH	NT	1850.16 532	1852.83 602	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	VN	NT	1878.66 165	1881.34 215	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	VL	NT	1878.66 523	1881.33 883	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	VH	NT	1878.66 402	1881.33 852	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	VN	NT	1878.66 437	1881.33 737	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	VL	NT	1878.66 488	1881.33 098	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	VH	NT	1878.66 204	1881.33 634	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	VN	NT	1907.16 01	1909.83 82	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	VL	NT	1907.16 129	1909.83 559	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	VH	NT	1907.15 888	1909.83 758	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	VN	NT	1907.16 066	1909.83 406	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	VL	NT	1907.16 206	1909.83 706	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	VH	NT	1907.16 198	1909.83 418	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	VN	NT	1850.26 168	1854.73 098	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	VL	NT	1850.25 91	1854.73 03	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	VH	NT	1850.25 94	1854.73 49	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	5MHz	16QA M	1862 5	25RB# 0	VN	NT	1850.26 221	1854.73 091	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	VL	NT	1850.26 514	1854.73 344	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	VH	NT	1850.26 602	1854.73 772	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	VN	NT	1877.76 1	1882.23 4	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	VL	NT	1877.76 168	1882.23 298	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	VH	NT	1877.76 044	1882.23 234	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	VN	NT	1877.76 081	1882.23 551	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	VL	NT	1877.76 226	1882.23 126	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	VH	NT	1877.76 407	1882.23 437	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	VN	NT	1905.26 6	1909.73 37	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	VL	NT	1905.26 705	1909.73 255	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	VH	NT	1905.26 932	1909.73 122	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	VN	NT	1905.26 714	1909.73 314	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	VL	NT	1905.26 608	1909.73 748	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	VH	NT	1905.26 408	1909.73 608	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	VN	NT	1850.53 811	1859.46 061	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	VL	NT	1850.53 826	1859.46 176	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	VH	NT	1850.53 477	1859.45 787	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	VN	NT	1850.54 424	1859.46 754	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	VL	NT	1850.53 812	1859.47 252	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	VH	NT	1850.54 362	1859.47 192	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	10MH z	QPSK	1890 0	50RB# 0	VN	NT	1875.52 705	1884.46 305	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	VL	NT	1875.52 681	1884.46 461	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	VH	NT	1875.53 588	1884.46 138	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	VN	NT	1875.53 069	1884.46 489	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	VL	NT	1875.53 367	1884.46 557	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	VH	NT	1875.52 212	1884.46 552	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	VN	NT	1900.53 721	1909.46 401	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	VL	NT	1900.54 136	1909.46 836	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	VH	NT	1900.53 689	1909.46 839	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	VN	NT	1900.54 092	1909.47 312	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	VL	NT	1900.54 352	1909.46 882	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	VH	NT	1900.54 135	1909.47 265	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	VN	NT	1850.79 573	1864.18 873	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	VL	NT	1850.79 331	1864.20 931	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	VH	NT	1850.79 074	1864.18 674	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	VN	NT	1850.79 996	1864.17 796	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	VL	NT	1850.79 209	1864.18 909	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	VH	NT	1850.79 893	1864.19 993	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	VN	NT	1873.32 569	1886.70 569	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	VL	NT	1873.31 073	1886.70 073	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	VH	NT	1873.30 948	1886.70 248	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	15MH z	16QA M	1890 0	75RB# 0	VN	NT	1873.30 751	1886.71 351	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	VL	NT	1873.30 906	1886.71 306	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	VH	NT	1873.30 821	1886.70 821	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	VN	NT	1895.80 877	1909.19 677	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	VL	NT	1895.80 87	1909.19 57	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	VH	NT	1895.80 966	1909.20 266	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	VN	NT	1895.79 482	1909.19 682	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	VL	NT	1895.78 614	1909.19 514	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	VH	NT	1895.79 527	1909.19 827	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	VN	NT	1851.09 177	1868.90 277	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	VL	NT	1851.06 345	1868.90 545	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	VH	NT	1851.08 421	1868.90 921	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	VN	NT	1851.08 7	1868.91 9	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	VL	NT	1851.05 757	1868.90 157	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	VH	NT	1851.07 521	1868.92 621	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	VN	NT	1871.08 985	1888.92 885	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	VL	NT	1871.07 205	1888.93 405	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	VH	NT	1871.09 477	1888.93 677	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	VN	NT	1871.09 15	1888.93 05	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	VL	NT	1871.09 512	1888.94 412	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	VH	NT	1871.10 769	1888.94 369	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	20MH z	QPSK	1910 0	100RB #0	VN	NT	1891.08 335	1908.93 235	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	VL	NT	1891.08 502	1908.93 202	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	VH	NT	1891.08 56	1908.93 86	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	VN	NT	1891.04 92	1908.93 72	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	VL	NT	1891.05 466	1908.93 266	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	VH	NT	1891.05 952	1908.93 452	1850-1 910	PAS S

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	-30	1850.15 673	1851.23 853	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	-20	1850.15 74	1851.23 69	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	-10	1850.15 738	1851.23 768	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	0	1850.15 614	1851.23 854	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	10	1850.15 949	1851.23 829	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	20	1850.15 688	1851.23 688	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	30	1850.15 832	1851.23 812	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	40	1850.16 012	1851.23 562	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1860 7	6RB#0	NV	50	1850.15 885	1851.23 715	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	-30	1850.15 758	1851.23 748	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	-20	1850.15 865	1851.23 865	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	-10	1850.15 481	1851.23 861	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	0	1850.15 724	1851.23 834	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	10	1850.15 598	1851.23 778	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	20	1850.15 744	1851.23 684	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	30	1850.15 847	1851.23 807	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	40	1850.15 741	1851.23 781	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1860 7	6RB#0	NV	50	1850.15 513	1851.23 763	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	-30	1879.45 641	1880.53 761	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	-20	1879.45 951	1880.53 781	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	-10	1879.45 705	1880.53 725	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	0	1879.45 674	1880.53 794	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	10	1879.45 936	1880.53 736	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	20	1879.45 977	1880.53 837	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	30	1879.45 67	1880.53 78	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	40	1879.45 69	1880.53 72	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1890 0	6RB#0	NV	50	1879.45 765	1880.53 795	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	-30	1879.45 497	1880.53 677	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	-20	1879.45 723	1880.53 833	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	-10	1879.45 72	1880.53 82	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	0	1879.45 497	1880.53 777	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	10	1879.45 771	1880.53 791	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	20	1879.45 658	1880.53 718	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	30	1879.45 703	1880.53 693	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	40	1879.45 858	1880.53 758	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1890 0	6RB#0	NV	50	1879.45 911	1880.53 481	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	-30	1908.75 71	1909.83 84	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	-20	1908.75 731	1909.83 911	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	-10	1908.75 715	1909.83 695	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	0	1908.75 665	1909.83 835	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	10	1908.75 748	1909.83 838	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	20	1908.75 745	1909.83 605	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	30	1908.75 715	1909.83 755	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	40	1908.75 8	1909.83 97	1850-1 910	PAS S
Ban d2	1.4MH z	QPSK	1919 3	6RB#0	NV	50	1908.75 669	1909.83 749	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	-30	1908.75 638	1909.83 848	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	-20	1908.75 976	1909.83 896	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	-10	1908.75 92	1909.83 83	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	0	1908.75 648	1909.83 808	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	10	1908.76 052	1909.83 712	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	20	1908.76 113	1909.83 823	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	30	1908.75 695	1909.83 635	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	40	1908.76 067	1909.83 837	1850-1 910	PAS S
Ban d2	1.4MH z	16QA M	1919 3	6RB#0	NV	50	1908.75 758	1909.83 778	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	-30	1850.16 543	1852.84 053	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	-20	1850.16 478	1852.84 118	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	-10	1850.16 535	1852.84 135	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	0	1850.16 251	1852.83 711	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	10	1850.16 388	1852.84 198	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	20	1850.16 341	1852.83 981	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	30	1850.16 237	1852.84 387	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	40	1850.16 491	1852.84 271	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1861 5	15RB# 0	NV	50	1850.16 375	1852.83 665	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	-30	1850.16 127	1852.83 477	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	-20	1850.16 767	1852.83 207	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	-10	1850.16 426	1852.83 606	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	0	1850.16 383	1852.83 143	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	10	1850.16 645	1852.83 635	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	20	1850.16 423	1852.83 223	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	30	1850.16 397	1852.83 247	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	40	1850.16 278	1852.83 338	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1861 5	15RB# 0	NV	50	1850.16 342	1852.83 782	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	-30	1878.66 326	1881.34 006	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	-20	1878.66 406	1881.33 926	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	-10	1878.66 272	1881.33 932	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	0	1878.66 326	1881.33 856	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	10	1878.66 347	1881.34 097	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	20	1878.66 128	1881.34 188	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	30	1878.66 286	1881.34 166	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	40	1878.66 276	1881.33 866	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1890 0	15RB# 0	NV	50	1878.66 397	1881.34 197	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	-30	1878.66 368	1881.33 748	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	-20	1878.66 402	1881.33 542	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	-10	1878.66 183	1881.33 503	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	0	1878.66 654	1881.33 184	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	10	1878.66 37	1881.33 57	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	20	1878.66 511	1881.33 311	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	30	1878.66 388	1881.33 608	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	40	1878.66 226	1881.33 086	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1890 0	15RB# 0	NV	50	1878.66 352	1881.33 492	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	-30	1907.16 05	1909.83 7	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	-20	1907.16 146	1909.83 656	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	-10	1907.16 139	1909.83 809	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	0	1907.15 989	1909.83 649	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	10	1907.16 101	1909.83 741	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	20	1907.16 007	1909.83 277	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	30	1907.15 836	1909.83 816	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	40	1907.16 052	1909.83 772	1850-1 910	PAS S
Ban d2	3MHz	QPSK	1918 5	15RB# 0	NV	50	1907.15 982	1909.84 042	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	-30	1907.16 172	1909.83 392	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	-20	1907.16 255	1909.83 215	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	-10	1907.16 24	1909.83 36	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	0	1907.16 266	1909.83 486	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	10	1907.16 166	1909.83 596	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	20	1907.16 231	1909.83 241	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	30	1907.16 098	1909.83 398	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	40	1907.16 283	1909.83 553	1850-1 910	PAS S
Ban d2	3MHz	16QA M	1918 5	15RB# 0	NV	50	1907.16 114	1909.83 414	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	-30	1850.26 272	1854.73 242	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	-20	1850.25 851	1854.73 041	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	-10	1850.26 053	1854.73 413	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	0	1850.25 598	1854.73 268	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	10	1850.26 133	1854.73 753	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	20	1850.26 81	1854.73 71	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	30	1850.26 254	1854.73 204	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	40	1850.25 696	1854.73 076	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1862 5	25RB# 0	NV	50	1850.25 563	1854.73 283	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	-30	1850.26 274	1854.74 204	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	-20	1850.26 436	1854.74 616	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	-10	1850.26 823	1854.73 113	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	0	1850.26 502	1854.73 222	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	10	1850.26 356	1854.74 106	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	20	1850.26 28	1854.74 23	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	30	1850.26 359	1854.74 429	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	40	1850.26 399	1854.74 329	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1862 5	25RB# 0	NV	50	1850.26 262	1854.73 412	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	-30	1877.76 223	1882.23 403	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	-20	1877.75 753	1882.23 203	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	-10	1877.76 11	1882.23 19	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	0	1877.76 223	1882.23 273	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	10	1877.75 855	1882.23 375	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	20	1877.75 795	1882.23 185	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	30	1877.75 645	1882.23 175	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	40	1877.76 376	1882.23 586	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1890 0	25RB# 0	NV	50	1877.75 652	1882.23 222	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	-30	1877.76 848	1882.23 758	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	-20	1877.76 153	1882.23 293	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	-10	1877.76 389	1882.23 569	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	0	1877.76 346	1882.23 636	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	10	1877.76 404	1882.23 434	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	20	1877.76 401	1882.23 651	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	30	1877.76 306	1882.23 876	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	40	1877.76 513	1882.23 713	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1890 0	25RB# 0	NV	50	1877.76 36	1882.23 42	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	NV	-30	1905.26 456	1909.73 436	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	NV	-20	1905.26 57	1909.72 88	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	NV	-10	1905.26 782	1909.73 192	1850-1 910	PAS S
Ban d2	5MHz	QPSK	1917 5	25RB# 0	NV	0	1905.26 291	1909.72 821	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	-30	1905.26 362	1909.73 902	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	-20	1905.26 632	1909.73 732	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	-10	1905.26 741	1909.73 631	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	0	1905.26 647	1909.73 417	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	10	1905.26 055	1909.73 895	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	20	1905.26 549	1909.73 449	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	30	1905.26 555	1909.73 585	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	40	1905.26 571	1909.73 721	1850-1 910	PAS S
Ban d2	5MHz	16QA M	1917 5	25RB# 0	NV	50	1905.26 814	1909.73 624	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	-30	1850.53 706	1859.46 636	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	-20	1850.53 582	1859.46 102	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	-10	1850.53 905	1859.46 105	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	0	1850.53 706	1859.47 236	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	10	1850.53 656	1859.45 726	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	20	1850.53 686	1859.46 496	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	30	1850.53 978	1859.45 338	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	40	1850.53 734	1859.46 364	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1865 0	50RB# 0	NV	50	1850.54 128	1859.45 638	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	-30	1850.53 88	1859.47 1	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	-20	1850.54 019	1859.47 329	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	-10	1850.53 831	1859.46 661	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	0	1850.54 051	1859.45 941	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	10	1850.53 857	1859.46 937	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	20	1850.54 387	1859.46 697	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	30	1850.55 931	1859.46 301	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	40	1850.54 437	1859.44 707	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1865 0	50RB# 0	NV	50	1850.55 282	1859.46 832	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	-30	1875.53 078	1884.46 498	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	-20	1875.53 581	1884.46 671	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	-10	1875.53 218	1884.46 328	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	0	1875.52 823	1884.46 583	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	10	1875.51 762	1884.46 632	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	20	1875.53 319	1884.47 069	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	30	1875.53 654	1884.47 014	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	40	1875.53 538	1884.46 508	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1890 0	50RB# 0	NV	50	1875.53 589	1884.46 569	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	-30	1875.53 433	1884.46 643	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	-20	1875.52 83	1884.46 5	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	-10	1875.52 787	1884.46 597	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	0	1875.52 602	1884.46 472	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	10	1875.54 128	1884.46 678	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	20	1875.54 053	1884.45 873	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	30	1875.52 858	1884.46 178	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	40	1875.53 896	1884.46 556	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1890 0	50RB# 0	NV	50	1875.53 562	1884.46 352	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	-30	1900.53 665	1909.46 455	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	-20	1900.53 903	1909.47 093	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	-10	1900.53 964	1909.47 184	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	0	1900.53 965	1909.46 645	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	10	1900.53 651	1909.47 231	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	20	1900.53 903	1909.46 343	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	30	1900.53 176	1909.46 676	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	40	1900.53 959	1909.46 899	1850-1 910	PAS S
Ban d2	10MH z	QPSK	1915 0	50RB# 0	NV	50	1900.54 065	1909.46 205	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com