

Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	-30	1900.53 501	1909.46 491	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	-20	1900.53 954	1909.47 314	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	-10	1900.54 9	1909.47 08	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	0	1900.54 23	1909.46 77	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	10	1900.54 211	1909.47 221	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	20	1900.54 124	1909.46 774	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	30	1900.53 373	1909.46 793	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	40	1900.53 581	1909.47 801	1850-1 910	PAS S
Ban d2	10MH z	16QA M	1915 0	50RB# 0	NV	50	1900.54 282	1909.47 052	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	-30	1850.79 247	1864.19 947	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	-20	1850.79 033	1864.19 633	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	-10	1850.80 413	1864.18 513	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	0	1850.79 011	1864.19 411	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	10	1850.79 985	1864.19 385	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	20	1850.80 216	1864.19 916	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	30	1850.79 524	1864.18 624	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	40	1850.78 726	1864.19 526	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1867 5	75RB# 0	NV	50	1850.78 376	1864.19 476	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	-30	1850.80 21	1864.16 91	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	-20	1850.80 182	1864.18 982	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	-10	1850.79 634	1864.18 834	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	0	1850.79 959	1864.18 059	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	10	1850.80 07	1864.18 37	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	20	1850.79 902	1864.19 402	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	30	1850.79 938	1864.18 838	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	40	1850.80 152	1864.18 552	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1867 5	75RB# 0	NV	50	1850.79 626	1864.18 826	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	-30	1873.30 533	1886.71 233	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	-20	1873.31 432	1886.69 732	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	-10	1873.30 415	1886.70 115	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	0	1873.31 064	1886.71 064	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	10	1873.30 574	1886.70 774	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	20	1873.31 438	1886.70 238	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	30	1873.30 599	1886.69 699	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	40	1873.30 793	1886.69 593	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1890 0	75RB# 0	NV	50	1873.31 018	1886.69 918	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	-30	1873.32 925	1886.70 225	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	-20	1873.30 942	1886.70 842	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	-10	1873.30 638	1886.70 238	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	0	1873.30 386	1886.71 486	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	10	1873.28 744	1886.70 244	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	20	1873.31 543	1886.70 643	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	30	1873.31 26	1886.70 36	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	40	1873.29 621	1886.69 321	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1890 0	75RB# 0	NV	50	1873.31 064	1886.70 464	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	-30	1895.81 062	1909.19 562	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	-20	1895.80 919	1909.19 619	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	-10	1895.80 856	1909.18 756	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	0	1895.80 129	1909.19 229	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	10	1895.80 185	1909.19 885	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	20	1895.81 098	1909.19 698	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	30	1895.81 041	1909.19 541	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	40	1895.79 157	1909.20 457	1850-1 910	PAS S
Ban d2	15MH z	QPSK	1912 5	75RB# 0	NV	50	1895.79 253	1909.20 553	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	-30	1895.80 173	1909.20 273	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	-20	1895.78 816	1909.20 416	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	-10	1895.78 878	1909.20 078	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	0	1895.78 609	1909.19 909	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	10	1895.79 352	1909.20 152	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	20	1895.79 549	1909.20 849	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	30	1895.80 294	1909.20 694	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	40	1895.79 738	1909.19 138	1850-1 910	PAS S
Ban d2	15MH z	16QA M	1912 5	75RB# 0	NV	50	1895.79 309	1909.20 509	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	-30	1851.07 852	1868.90 552	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	-20	1851.07 223	1868.91 123	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	-10	1851.07 771	1868.92 271	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	0	1851.09 478	1868.90 578	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	10	1851.07 85	1868.90 05	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	20	1851.07 622	1868.92 122	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	30	1851.09 214	1868.90 814	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	40	1851.07 384	1868.91 684	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1870 0	100RB #0	NV	50	1851.08 099	1868.89 399	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	-30	1851.08 29	1868.93 99	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	-20	1851.06 389	1868.92 689	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	-10	1851.08 82	1868.92 82	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	0	1851.06 839	1868.93 639	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	10	1851.06 971	1868.94 171	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	20	1851.09 268	1868.91 668	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	30	1851.08 208	1868.94 608	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	40	1851.08 065	1868.90 865	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1870 0	100RB #0	NV	50	1851.06 887	1868.94 187	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	-30	1871.09 902	1888.93 202	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	-20	1871.06 749	1888.92 249	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	-10	1871.08 398	1888.92 398	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	0	1871.06 16	1888.93 26	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	10	1871.07 079	1888.93 879	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	20	1871.07 574	1888.92 774	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	30	1871.09 976	1888.92 676	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	40	1871.09 046	1888.92 746	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1890 0	100RB #0	NV	50	1871.09 794	1888.92 294	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	-30	1871.10 586	1888.94 086	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	-20	1871.10 27	1888.93 27	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	-10	1871.11 97	1888.93 47	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	0	1871.11 07	1888.93 47	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	10	1871.10 638	1888.92 838	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	20	1871.10 968	1888.93 568	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	30	1871.10 482	1888.94 882	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	40	1871.11 256	1888.94 256	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1890 0	100RB #0	NV	50	1871.10 518	1888.93 118	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	-30	1891.07 867	1908.93 467	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	-20	1891.08 132	1908.92 832	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	-10	1891.07 915	1908.92 815	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	0	1891.07 698	1908.93 098	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	10	1891.07 942	1908.93 542	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	20	1891.06 849	1908.92 749	1850-1 910	PAS S

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	30	1891.07 884	1908.92 584	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	40	1891.07 216	1908.93 216	1850-1 910	PAS S
Ban d2	20MH z	QPSK	1910 0	100RB #0	NV	50	1891.07 378	1908.93 378	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	-30	1891.07 804	1908.93 004	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	-20	1891.07 462	1908.92 662	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	-10	1891.07 262	1908.93 262	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	10	1891.07 303	1908.93 003	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	20	1891.05 542	1908.94 342	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	30	1891.06 189	1908.93 489	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	40	1891.04 309	1908.92 809	1850-1 910	PAS S
Ban d2	20MH z	16QA M	1910 0	100RB #0	NV	50	1891.06 74	1908.93 64	1850-1 910	PAS S


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

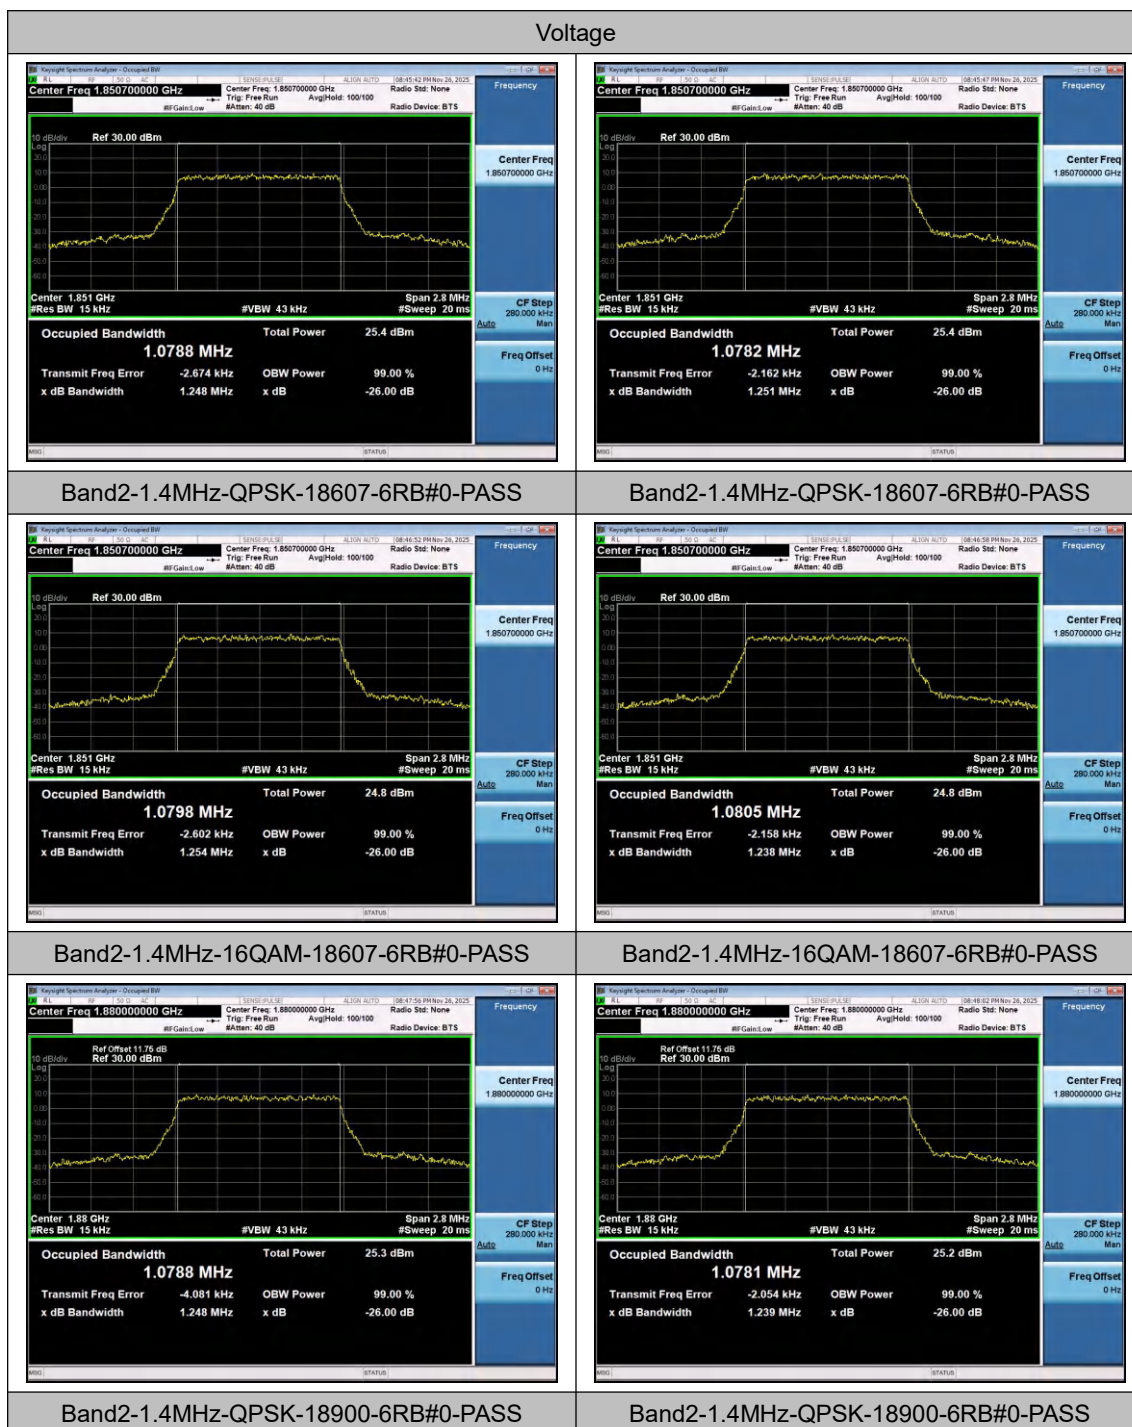


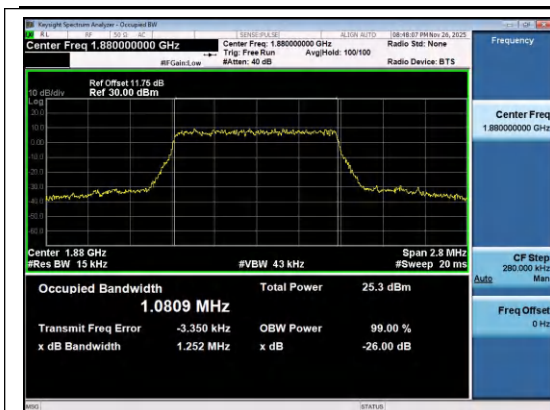


Band2-1.4MHz-QPSK-18900-6RB#0-PASS

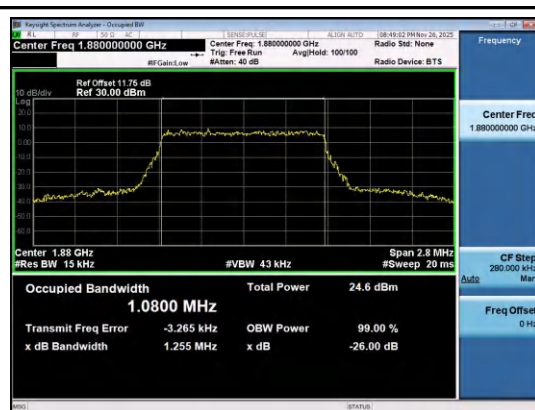

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

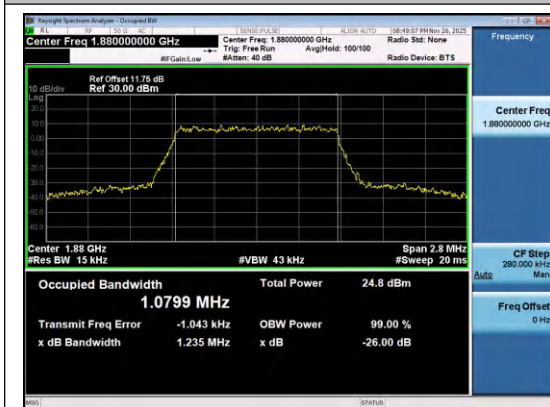

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

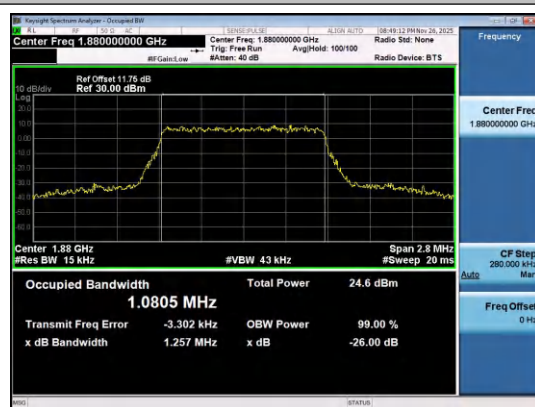


Band2-1.4MHz-16QAM-18900-6RB#0-PASS



Band2-1.4MHz-QPSK-19193-6RB#0-PASS




Band2-1.4MHz-QPSK-19193-6RB#0-PASS

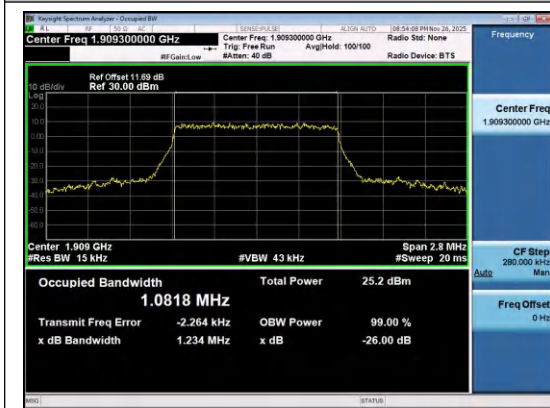



Band2-1.4MHz-QPSK-19193-6RB#0-PASS



Band2-1.4MHz-16QAM-19193-6RB#0-PASS

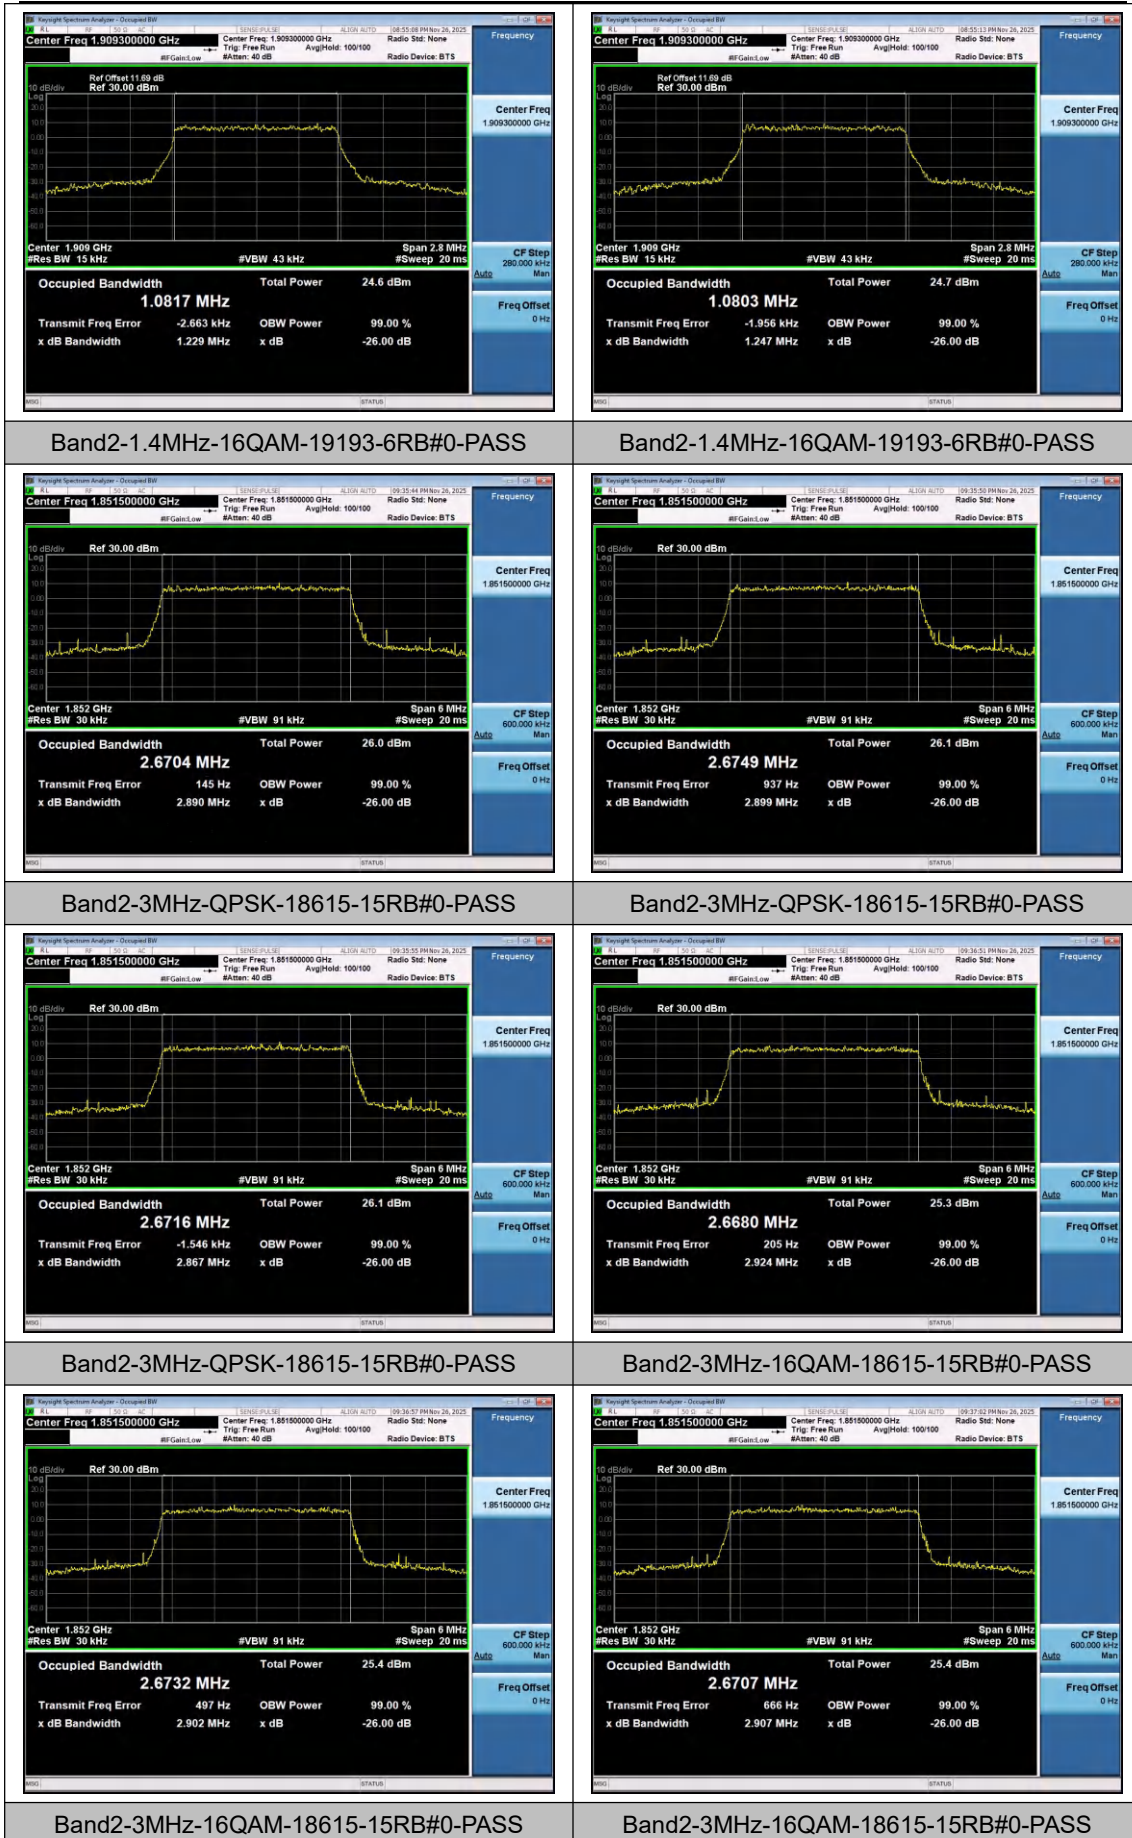


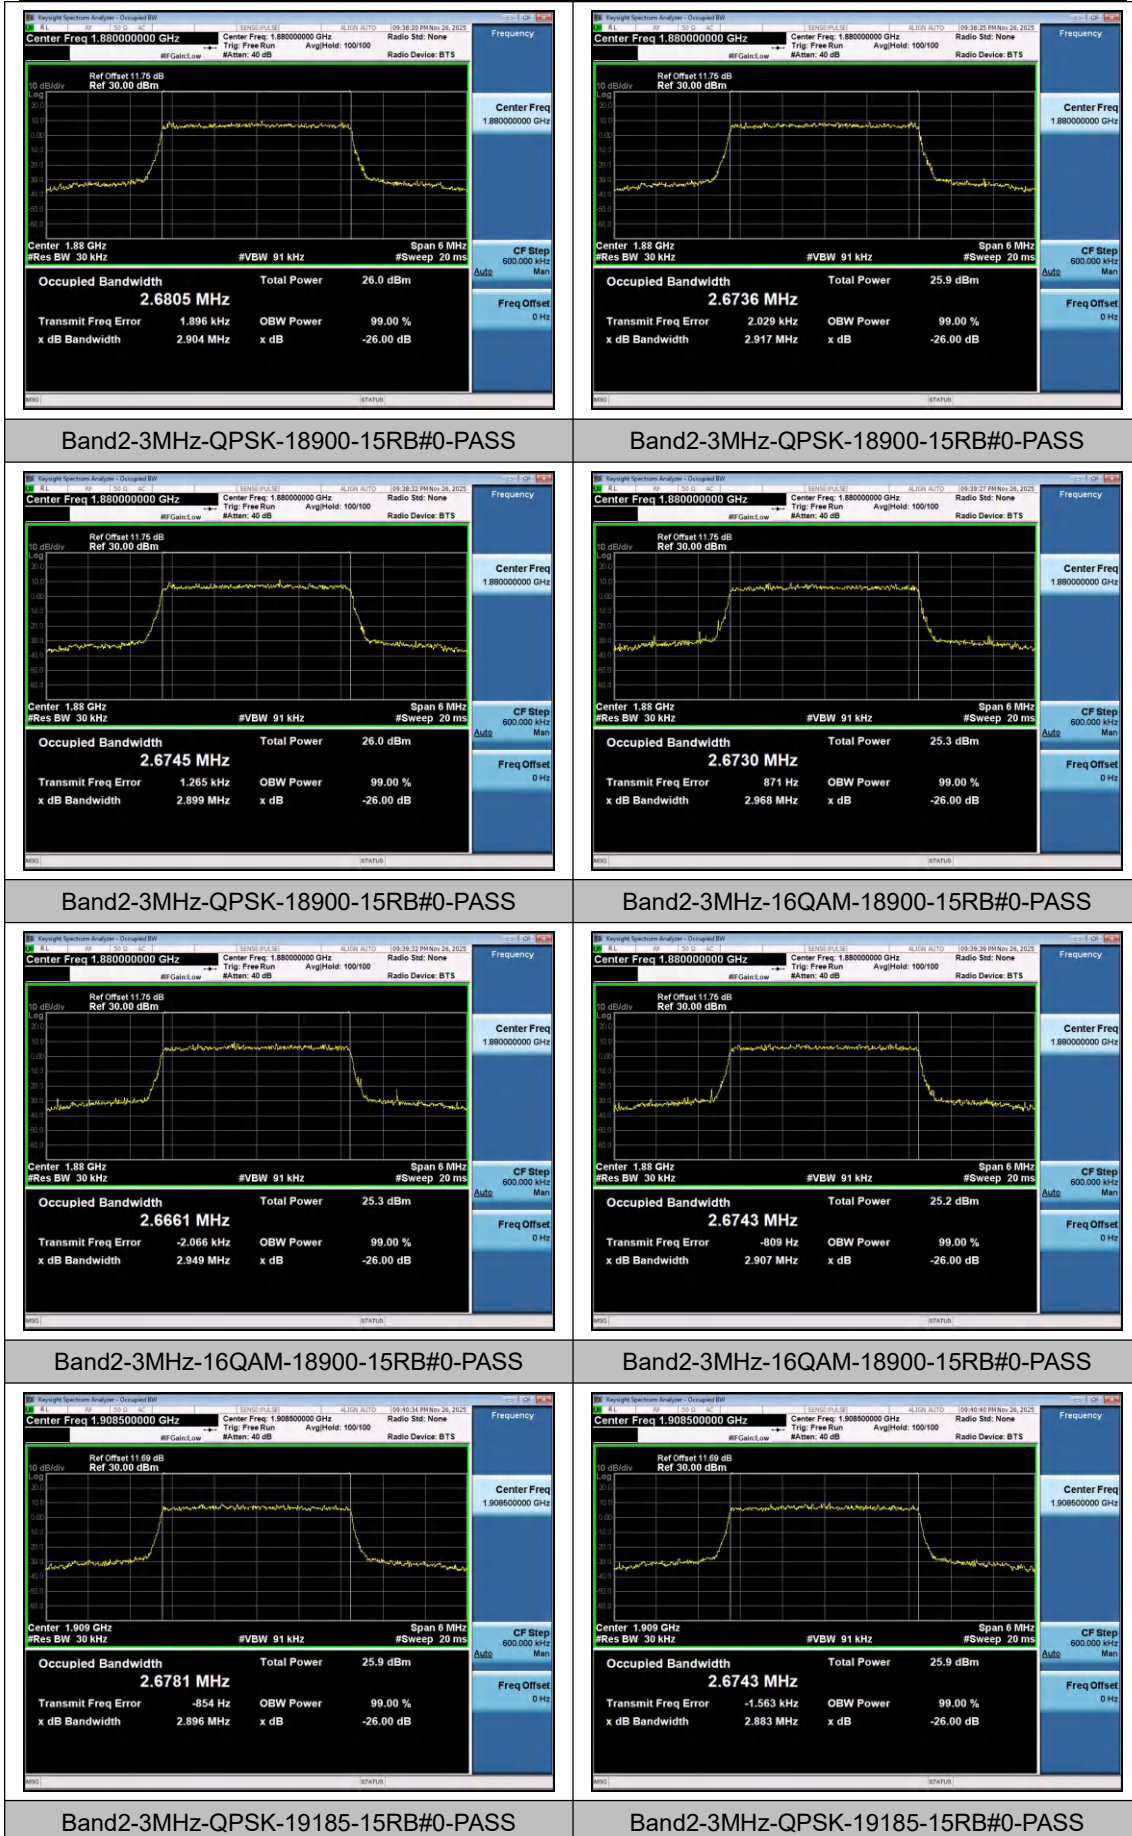

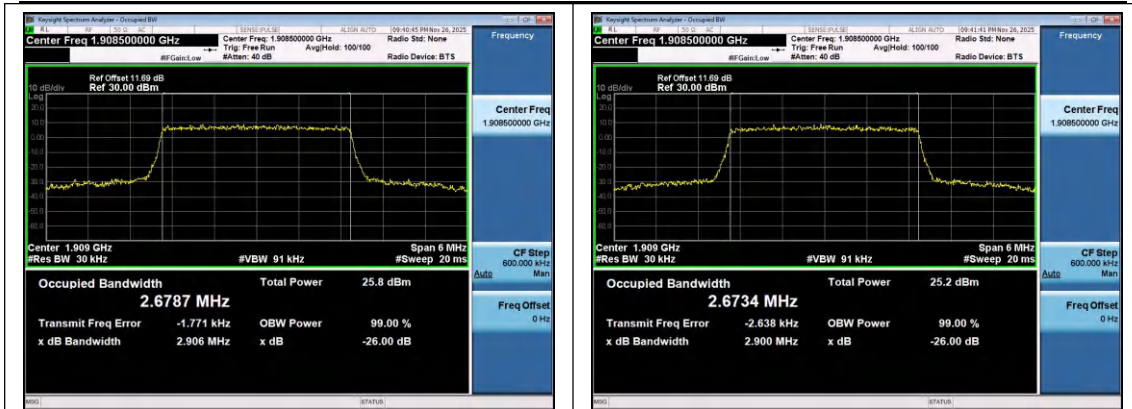


Band2-3MHz-QPSK-19185-15RB#0-PASS

Band2-3MHz-16QAM-19185-15RB#0-PASS

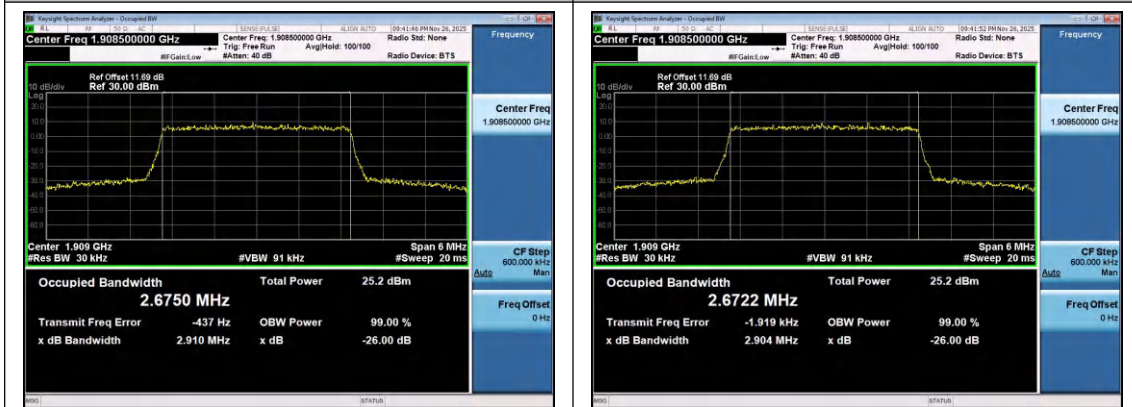


Band2-3MHz-16QAM-19185-15RB#0-PASS

Band2-3MHz-16QAM-19185-15RB#0-PASS

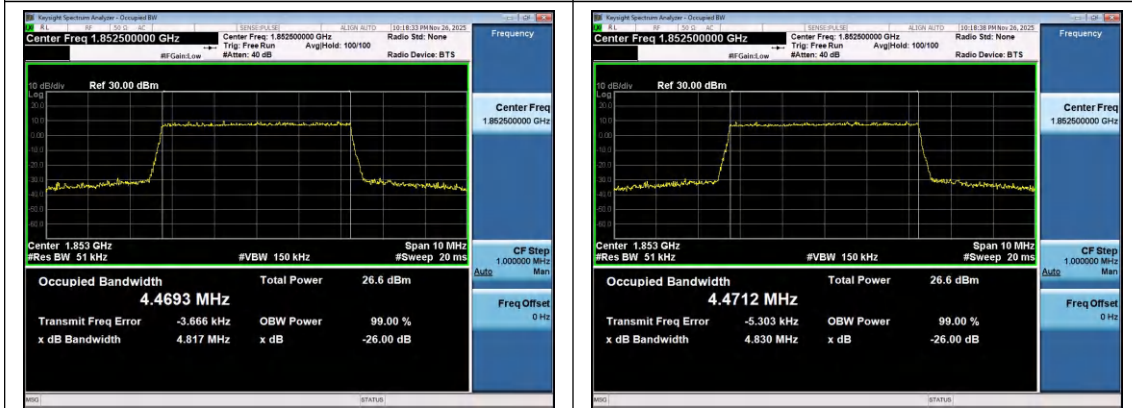


Band2-5MHz-QPSK-18625-25RB#0-PASS


Band2-5MHz-QPSK-18625-25RB#0-PASS

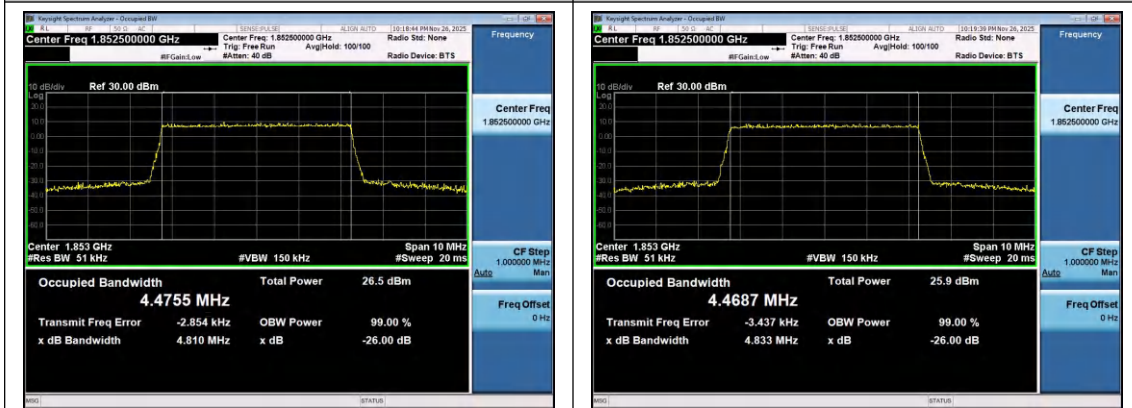

Band2-5MHz-QPSK-18625-25RB#0-PASS


Band2-5MHz-16QAM-18625-25RB#0-PASS

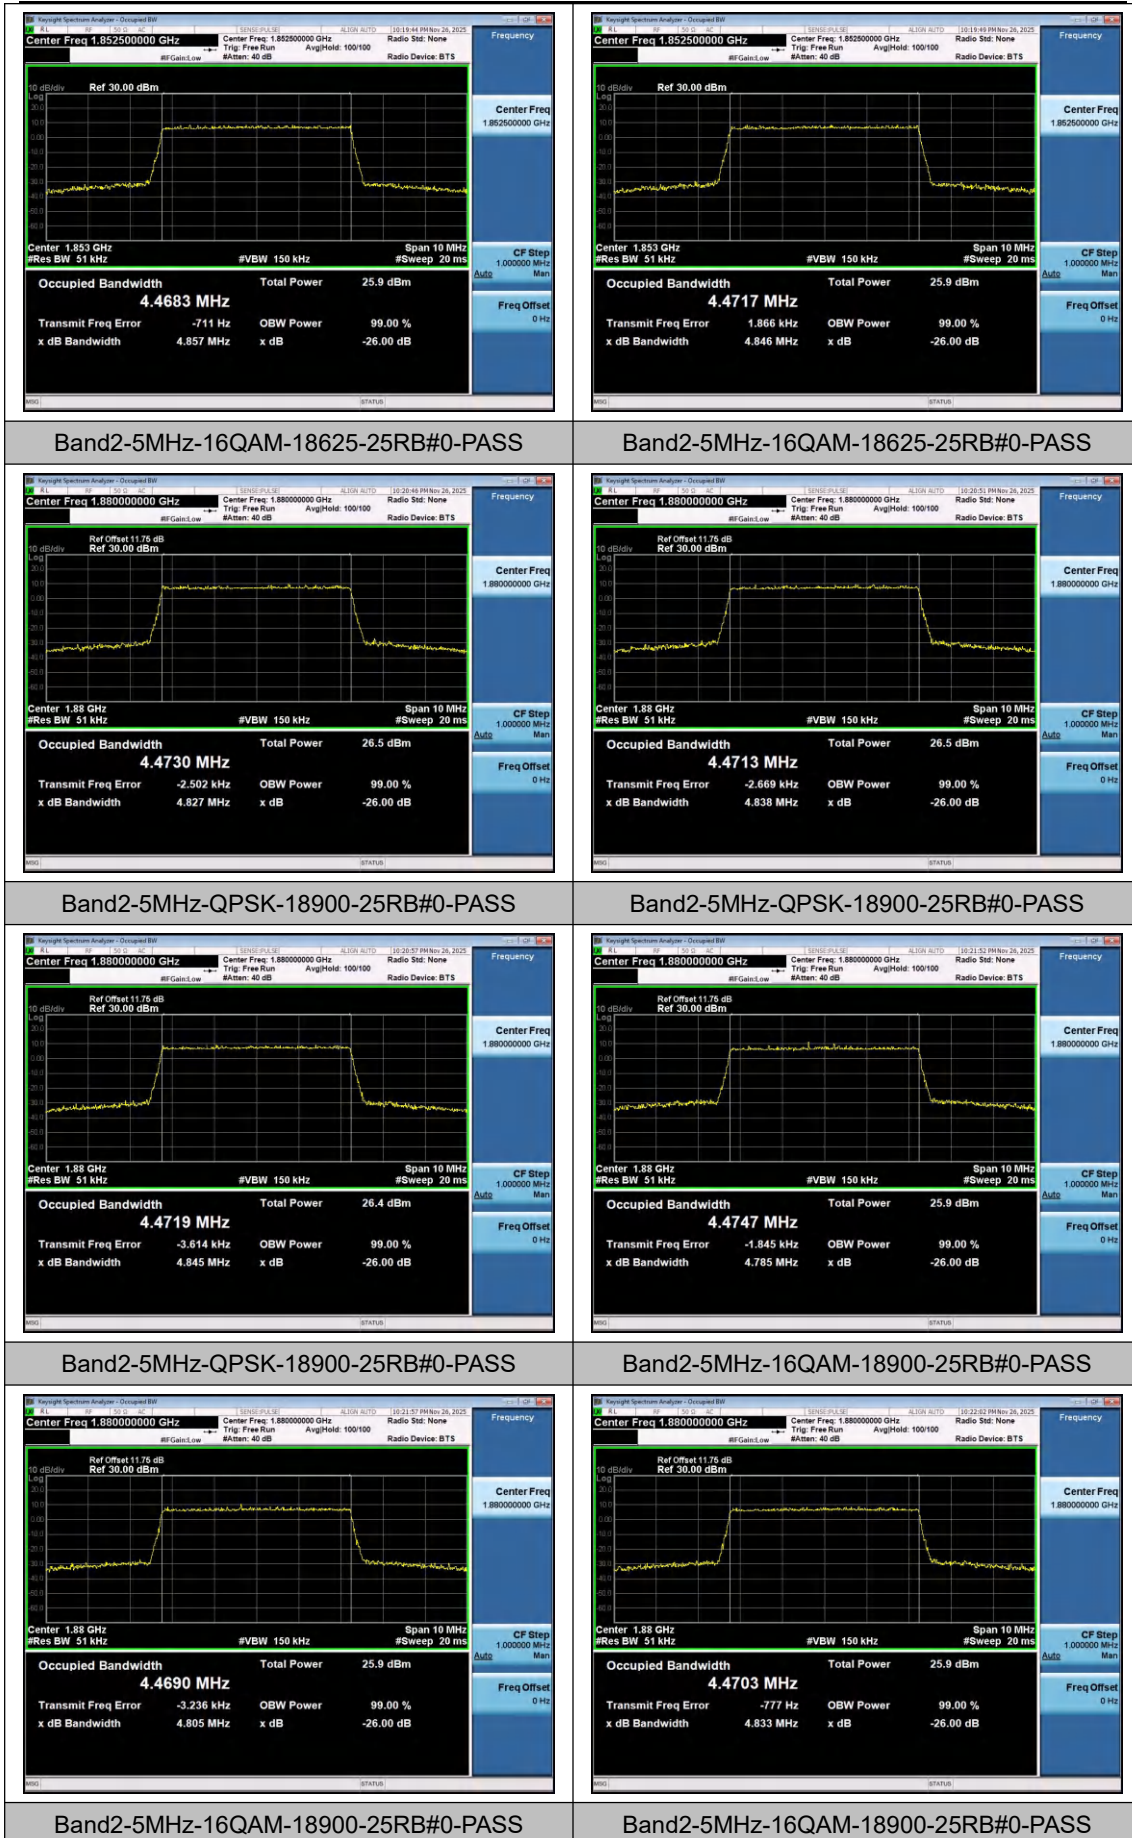

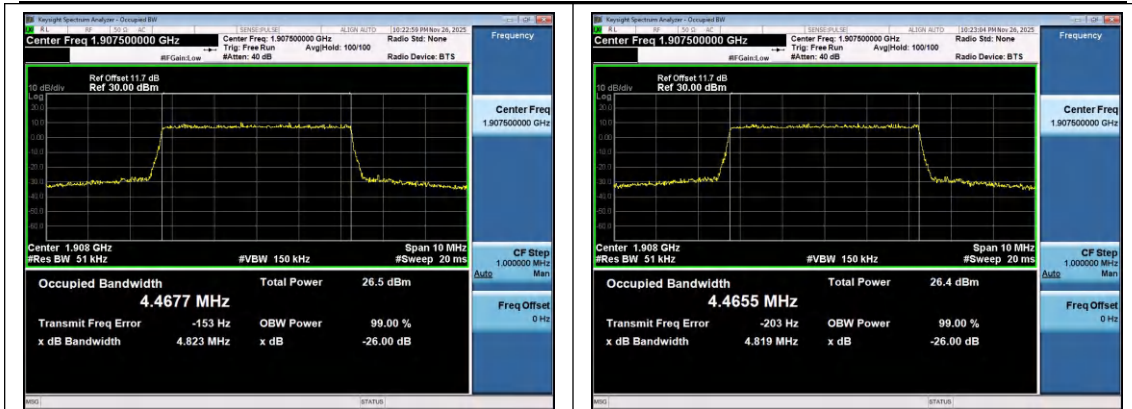


Band2-5MHz-QPSK-19175-25RB#0-PASS

Band2-5MHz-QPSK-19175-25RB#0-PASS

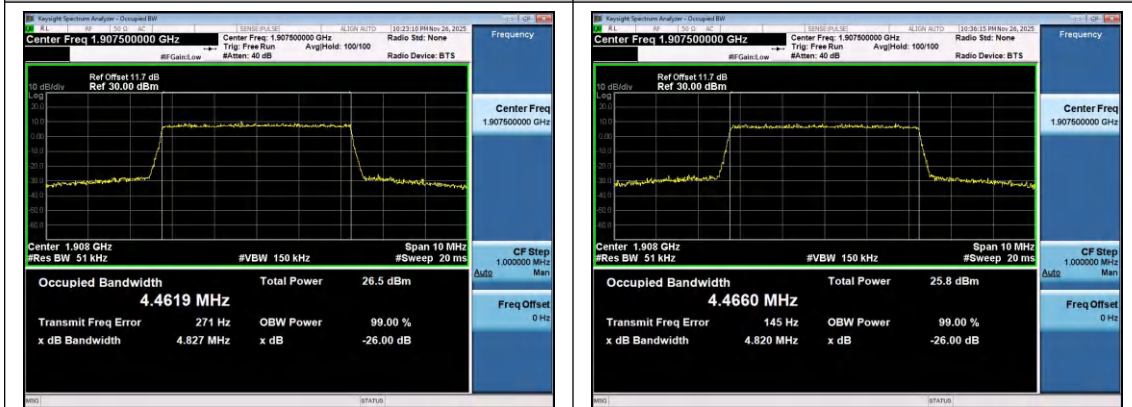


Band2-5MHz-QPSK-19175-25RB#0-PASS

Band2-5MHz-16QAM-19175-25RB#0-PASS

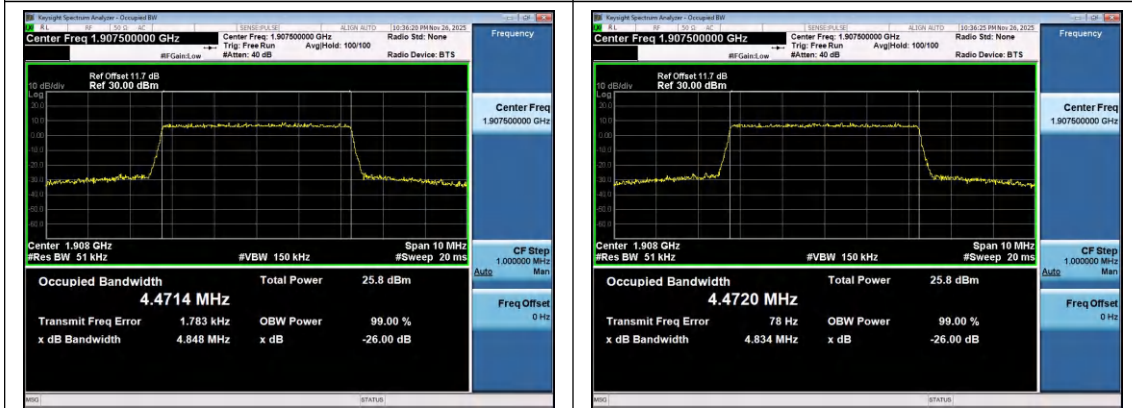


Band2-5MHz-16QAM-19175-25RB#0-PASS


Band2-5MHz-16QAM-19175-25RB#0-PASS

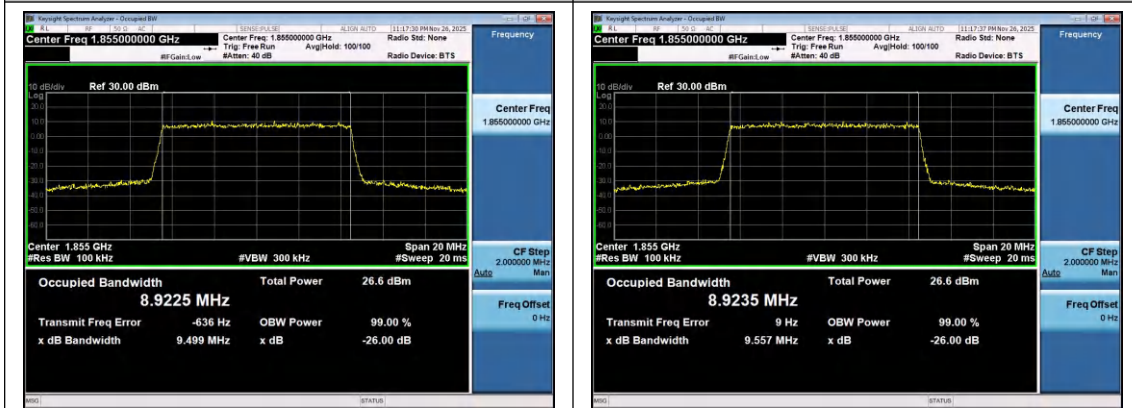


Band2-10MHz-QPSK-18650-50RB#0-PASS


Band2-10MHz-QPSK-18650-50RB#0-PASS

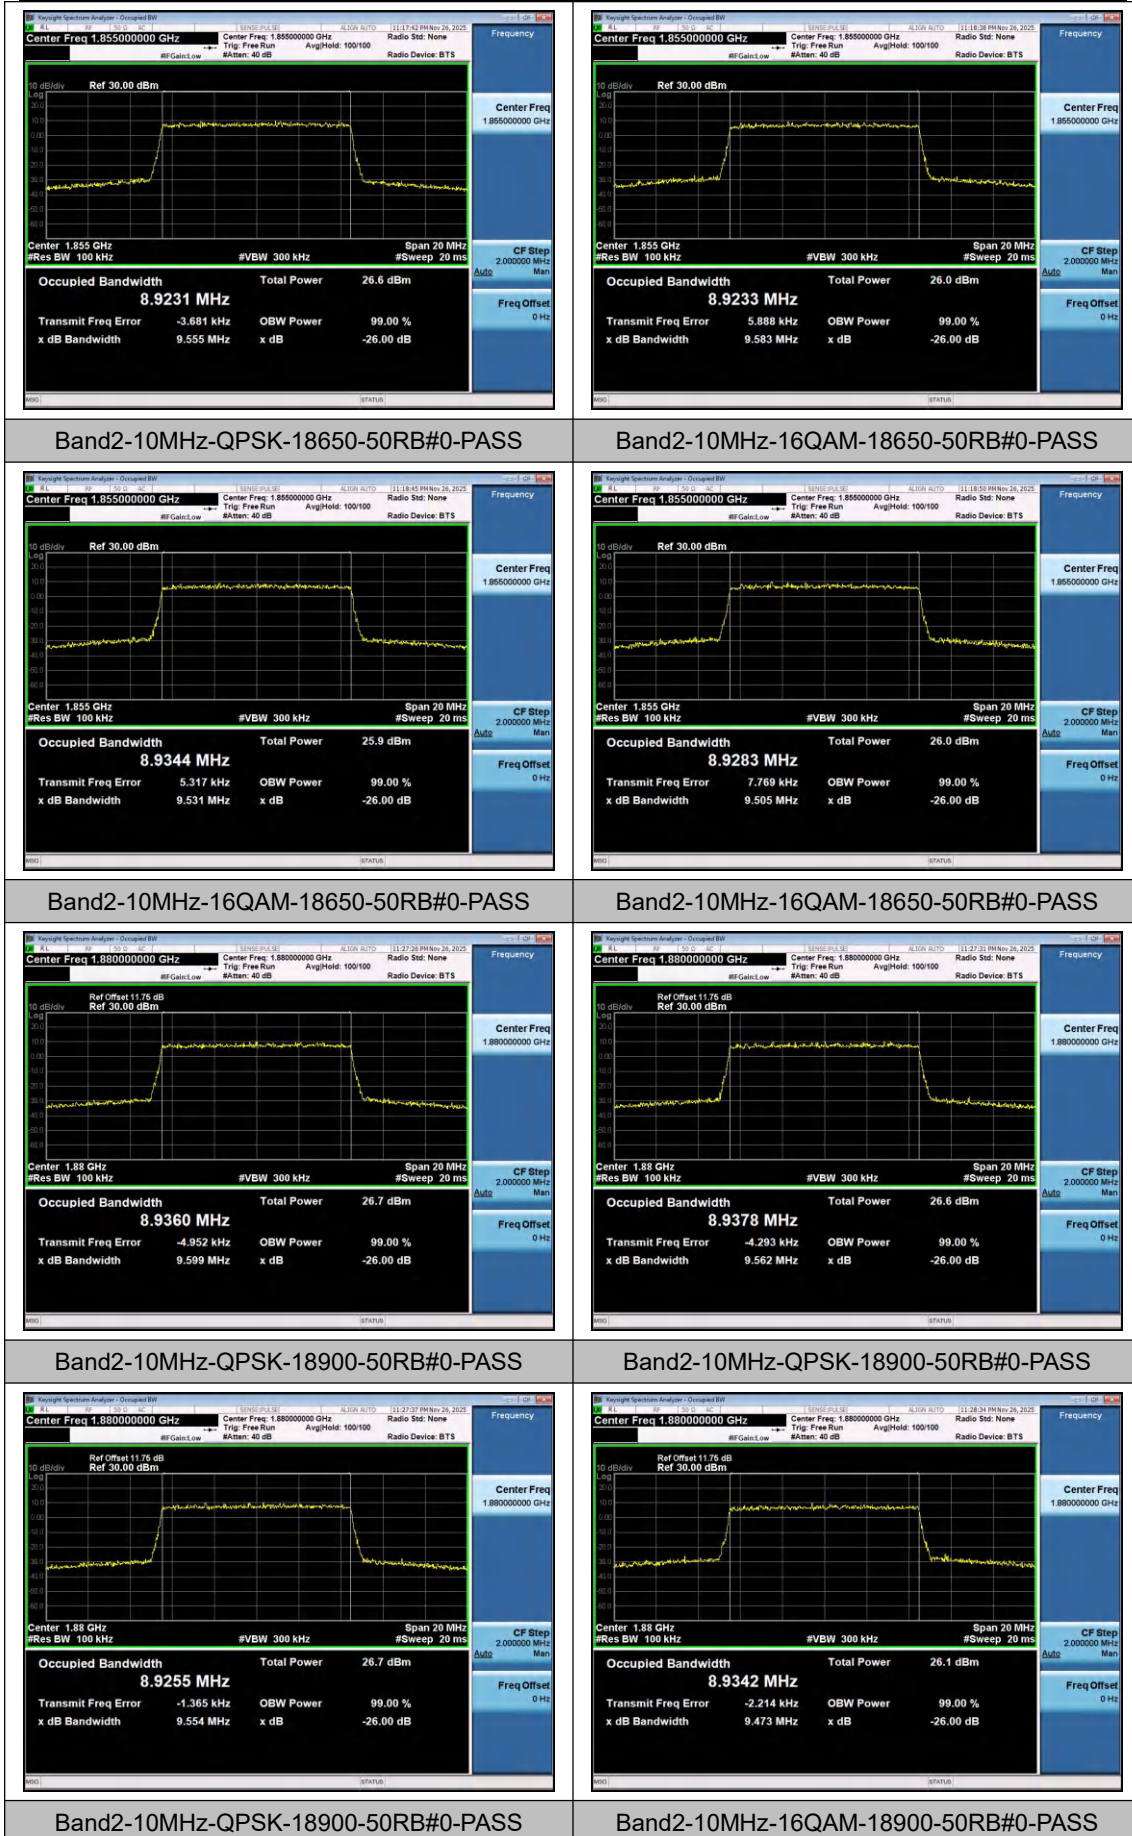


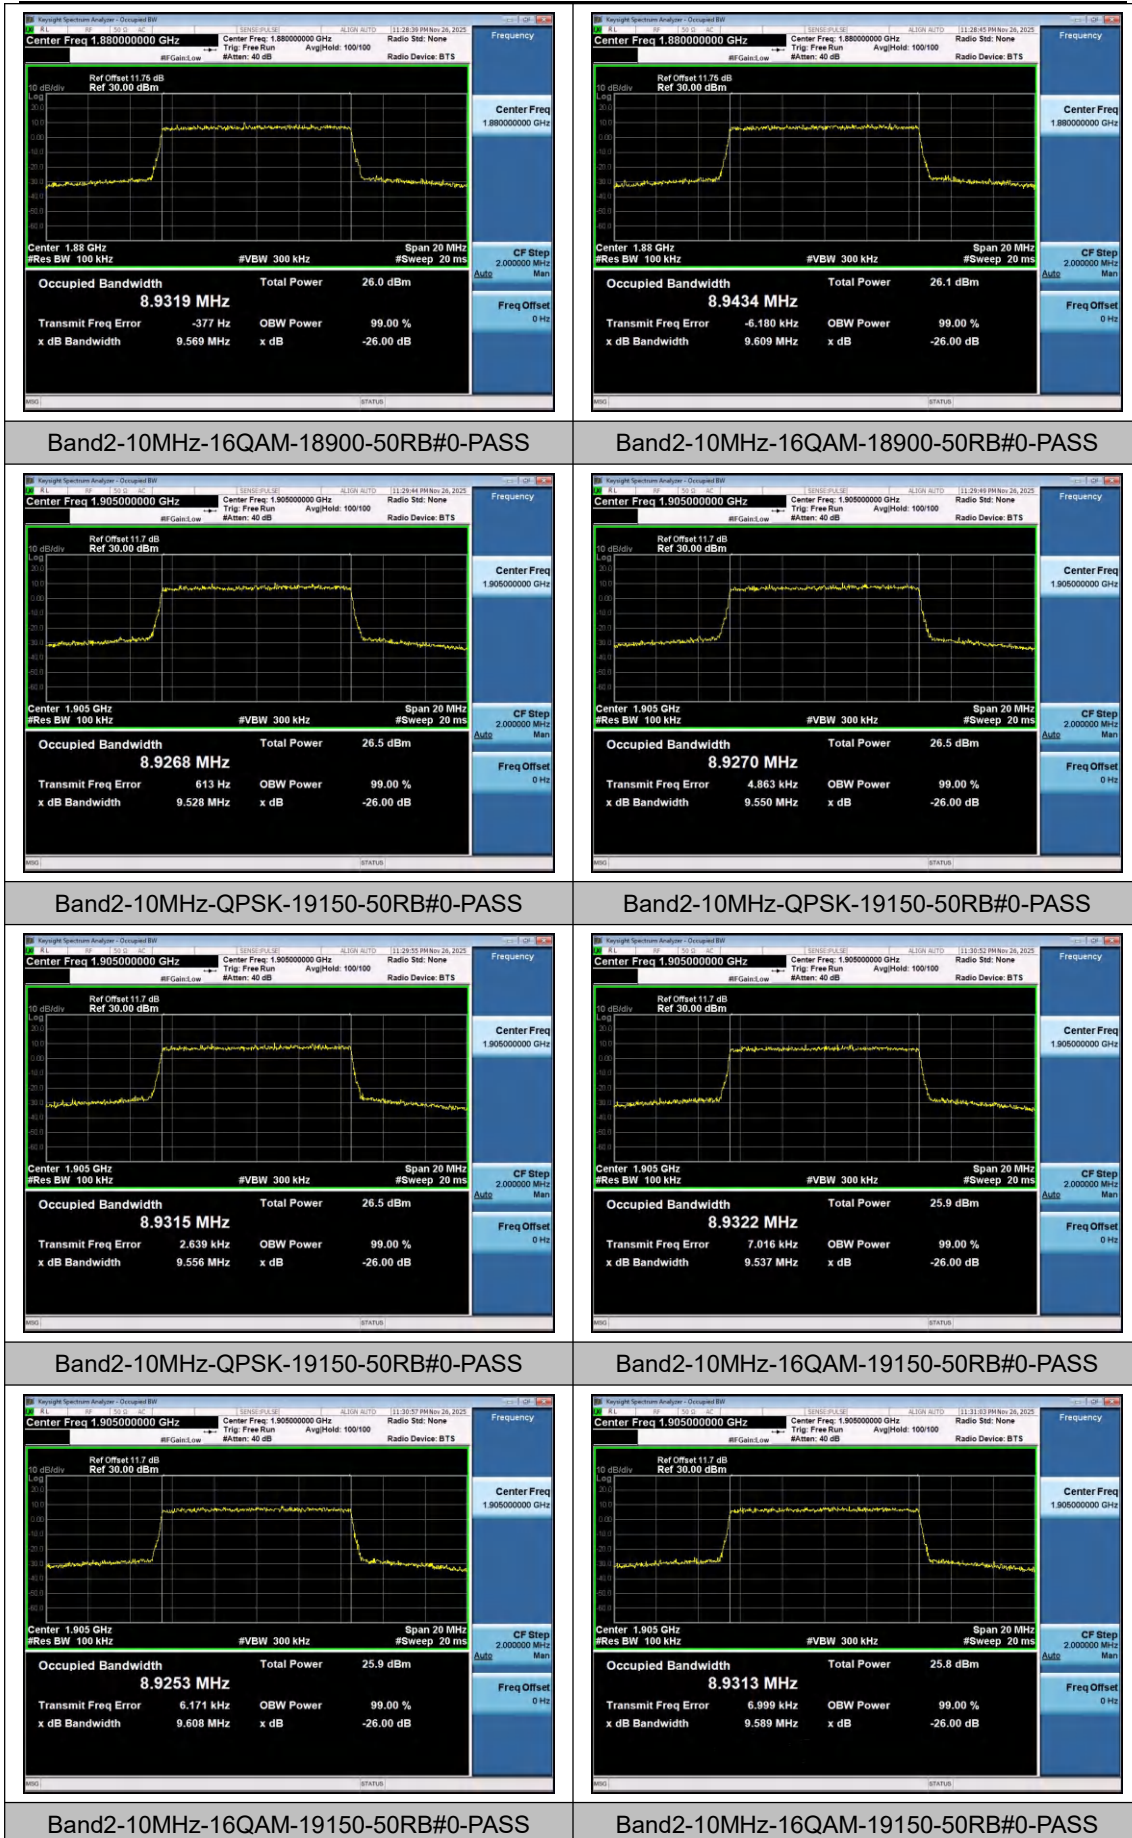




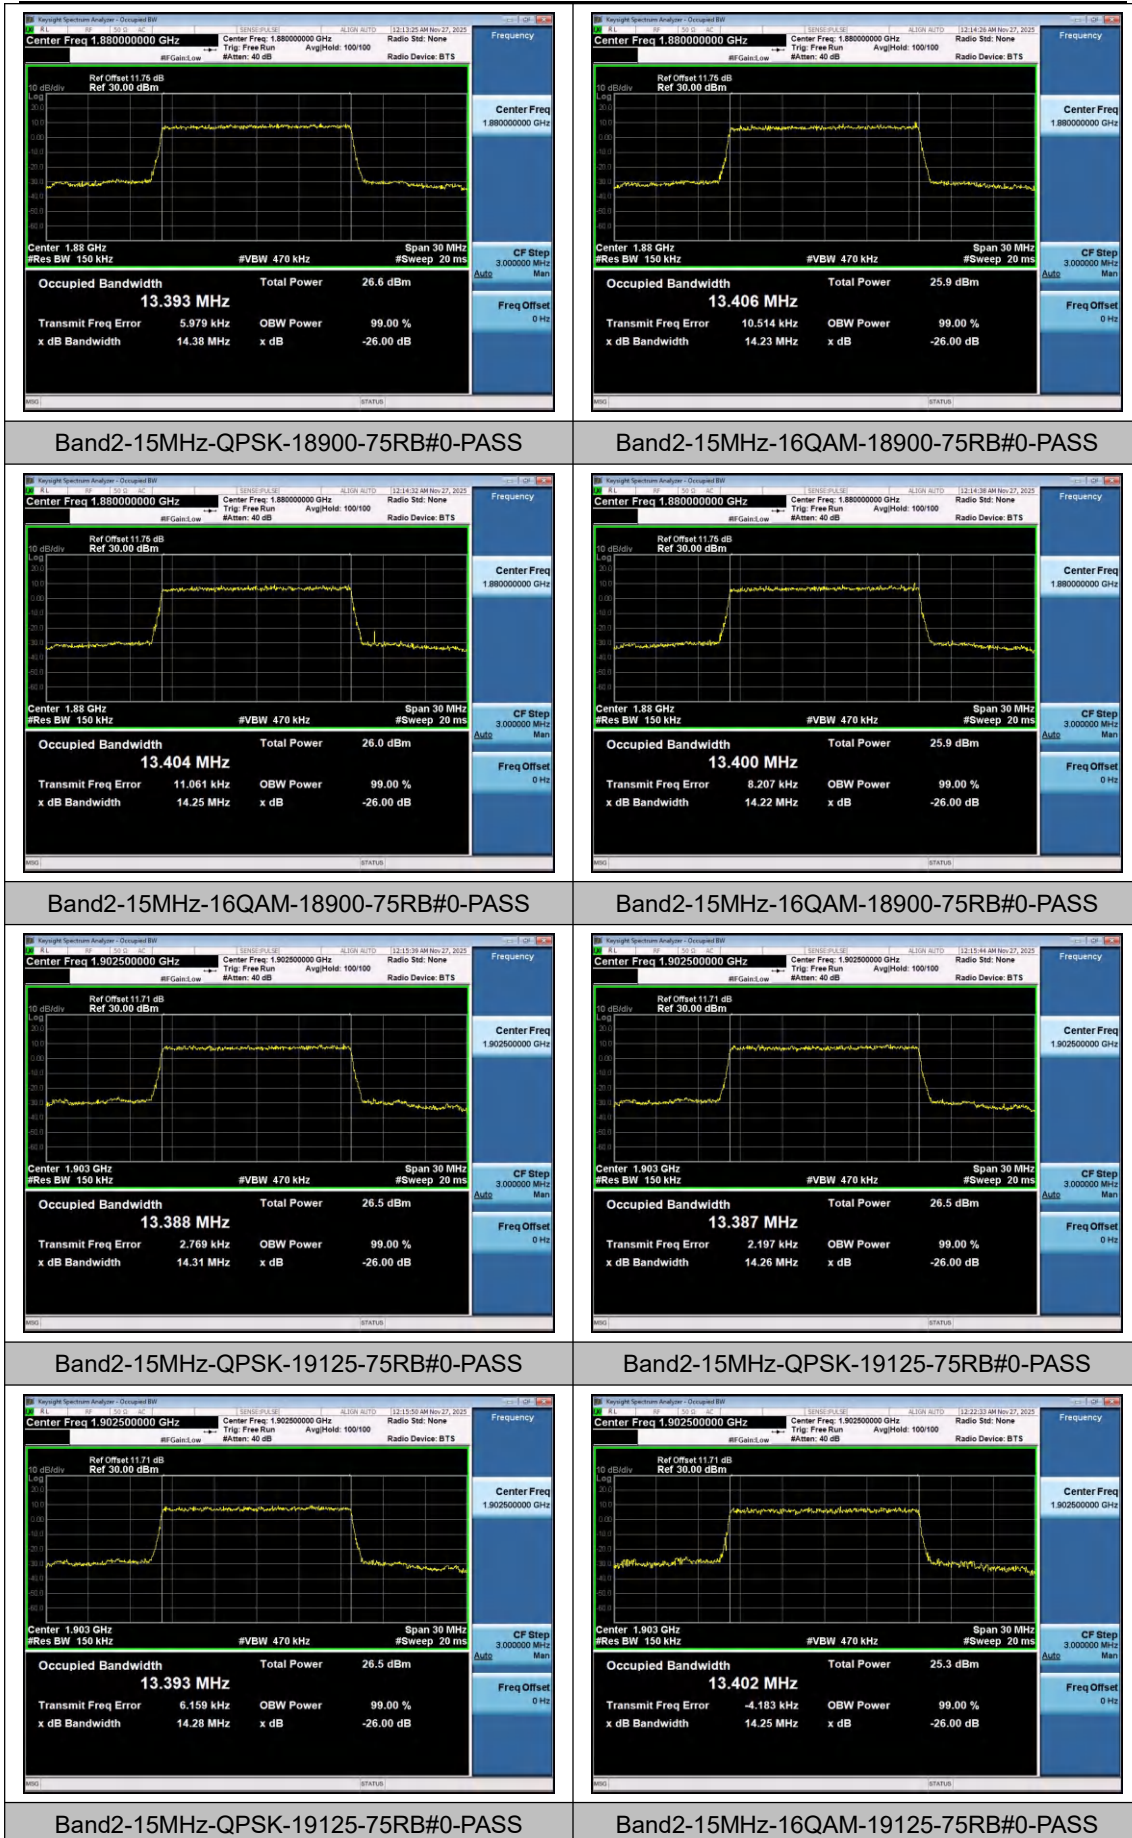

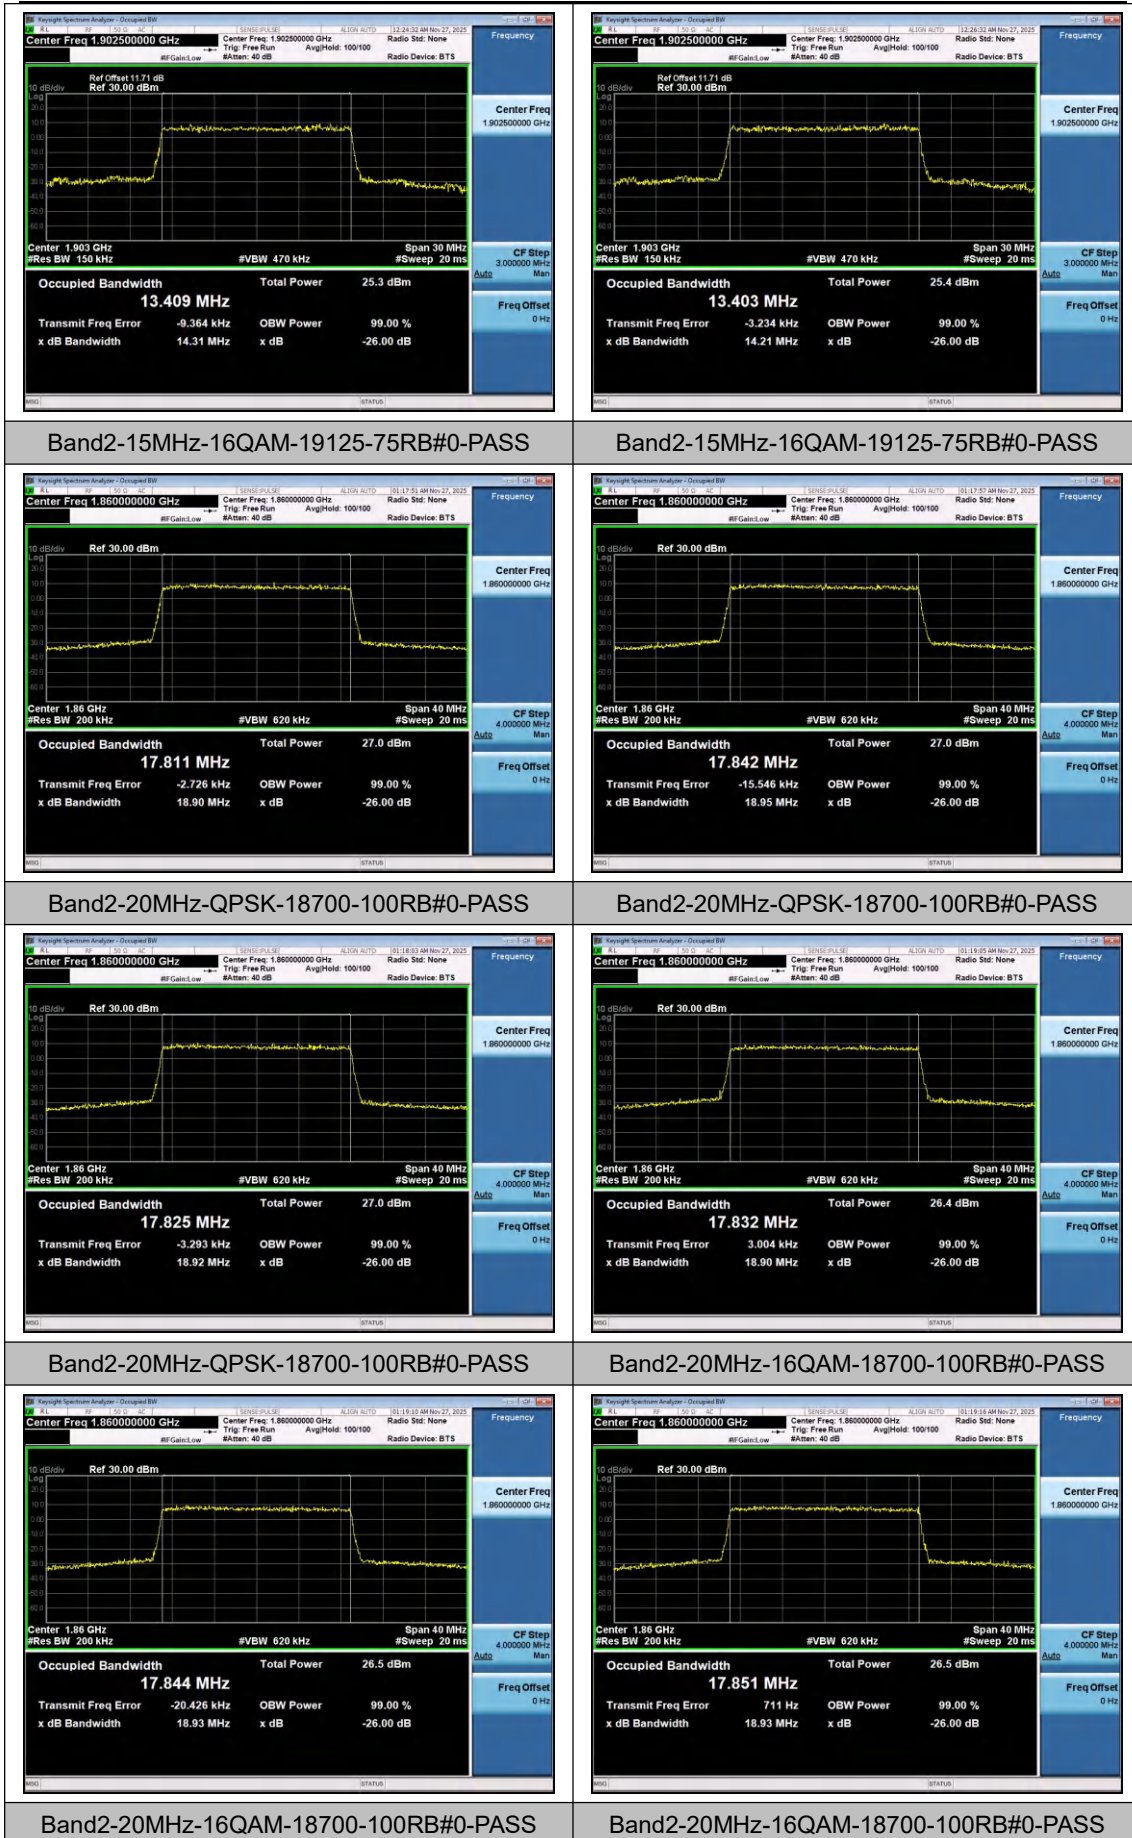


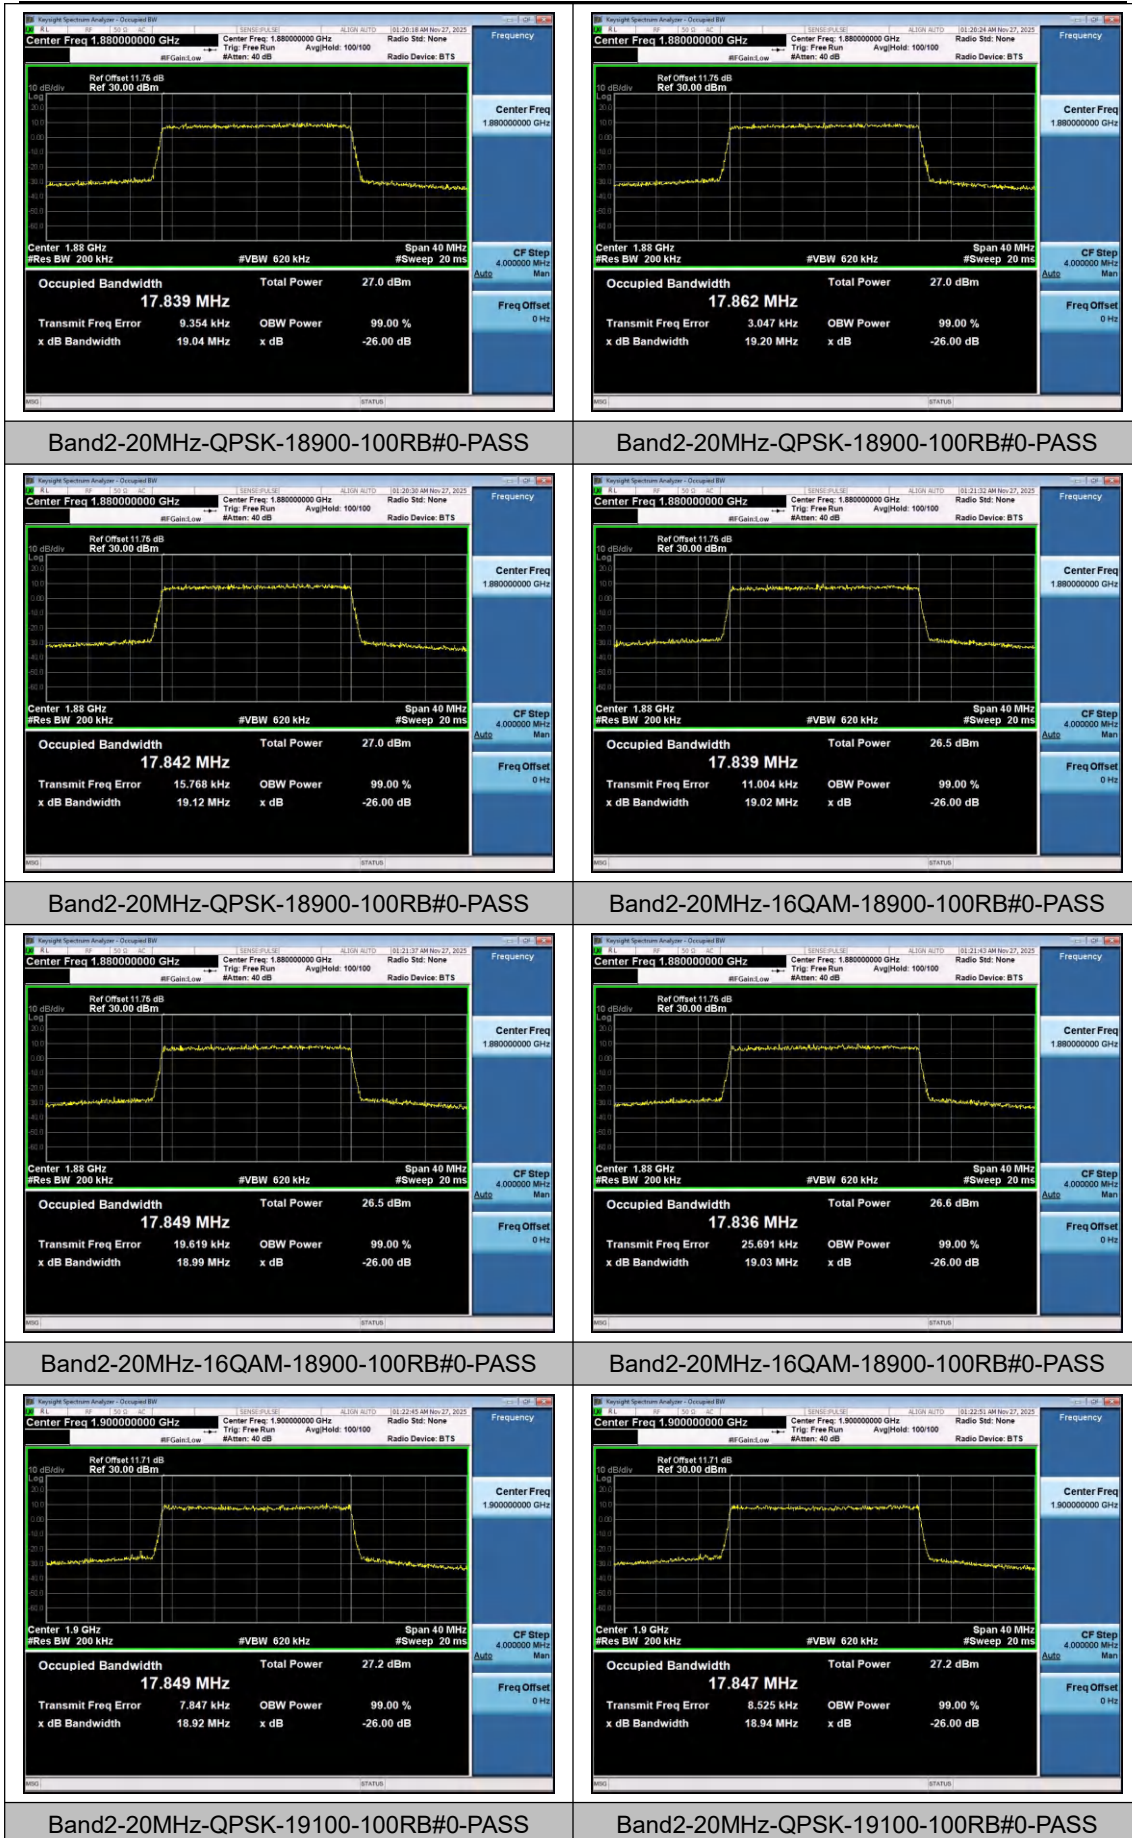

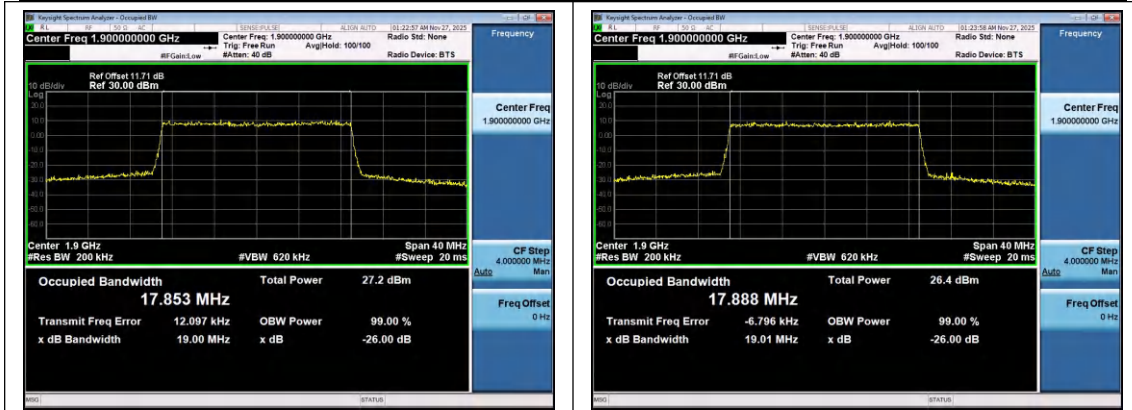

Band2-20MHz-QPSK-19100-100RB#0-PASS


Band2-20MHz-16QAM-19100-100RB#0-PASS

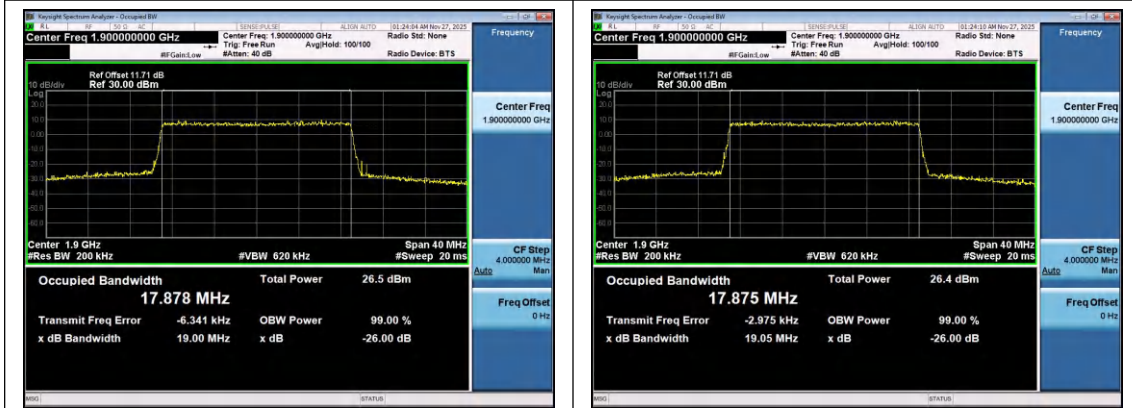

Band2-20MHz-16QAM-19100-100RB#0-PASS


Band2-20MHz-16QAM-19100-100RB#0-PASS


Temperature

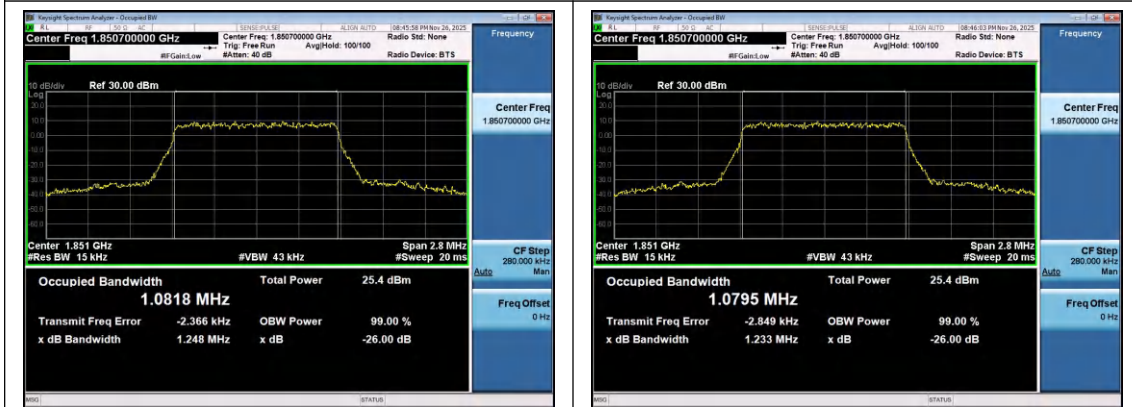



Band2-1.4MHz-QPSK-18607-6RB#0-PASS


Band2-1.4MHz-QPSK-18607-6RB#0-PASS

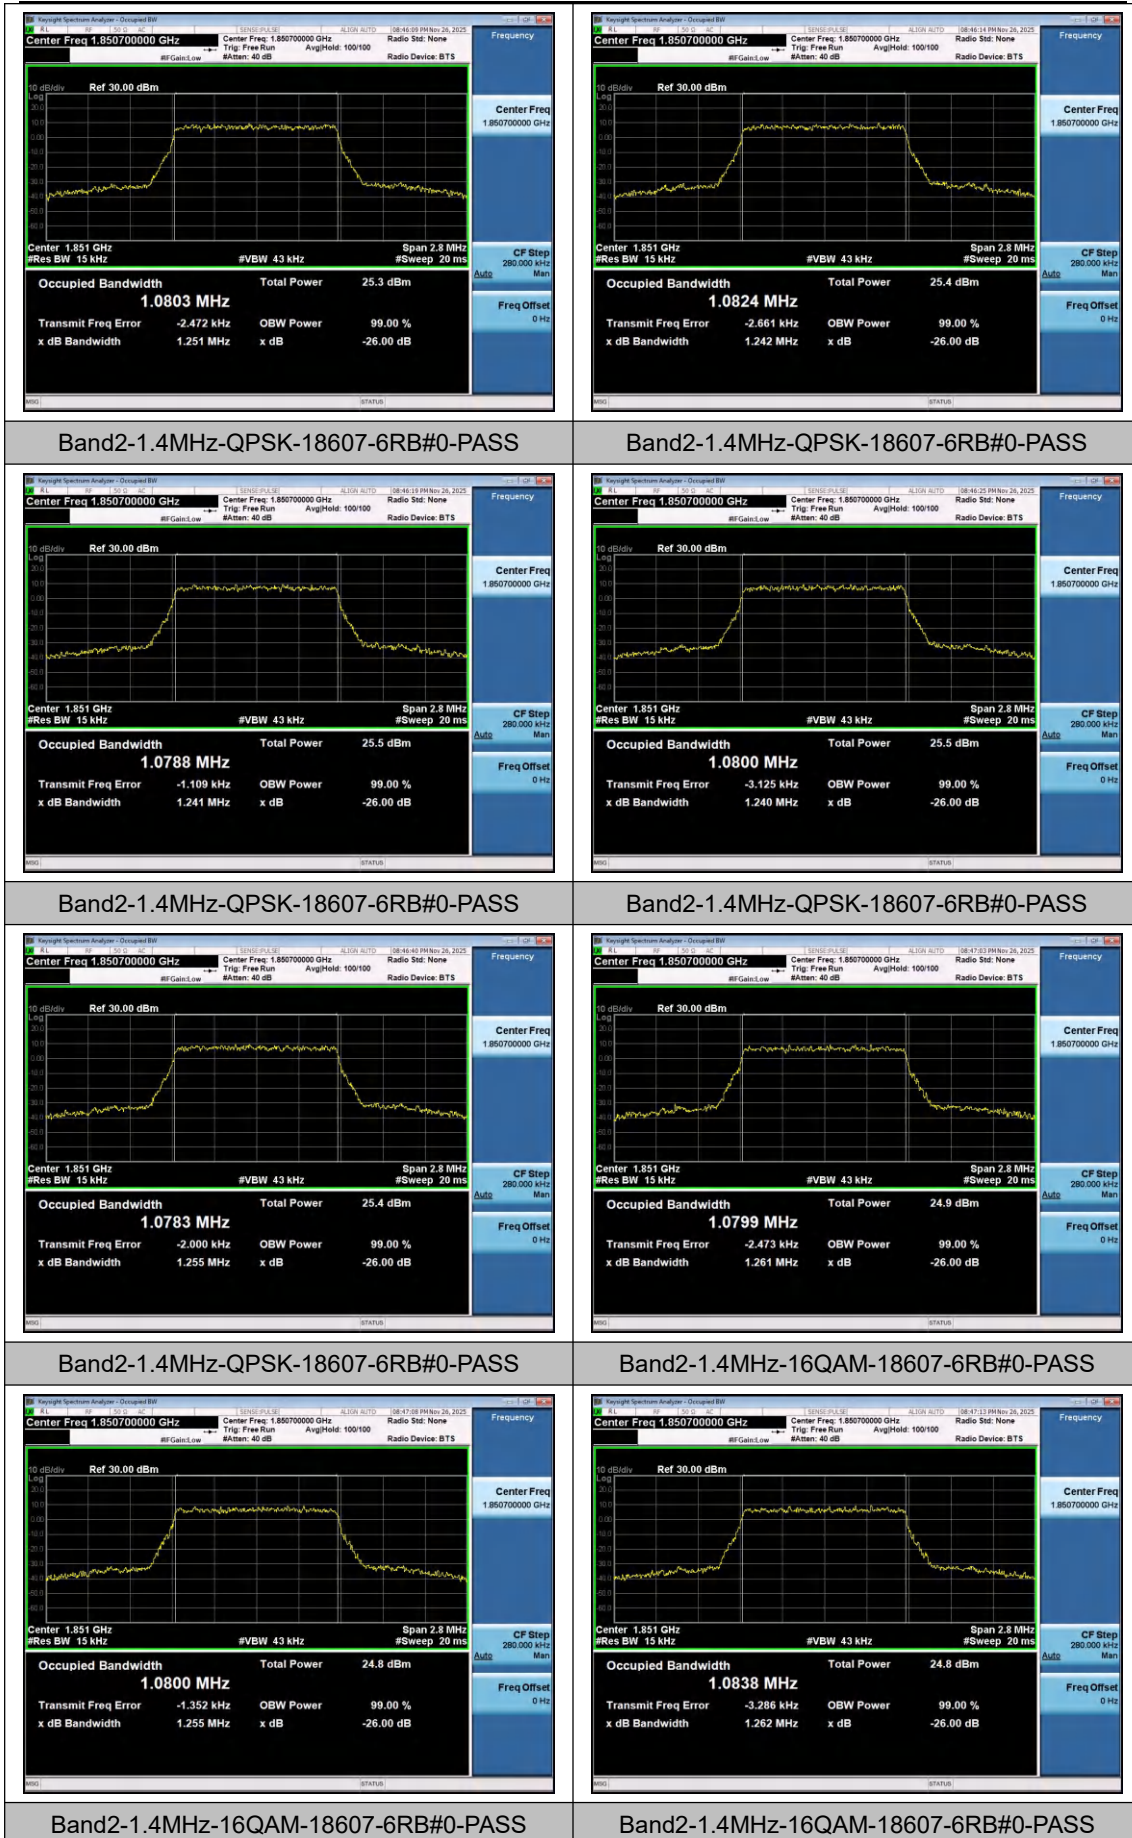


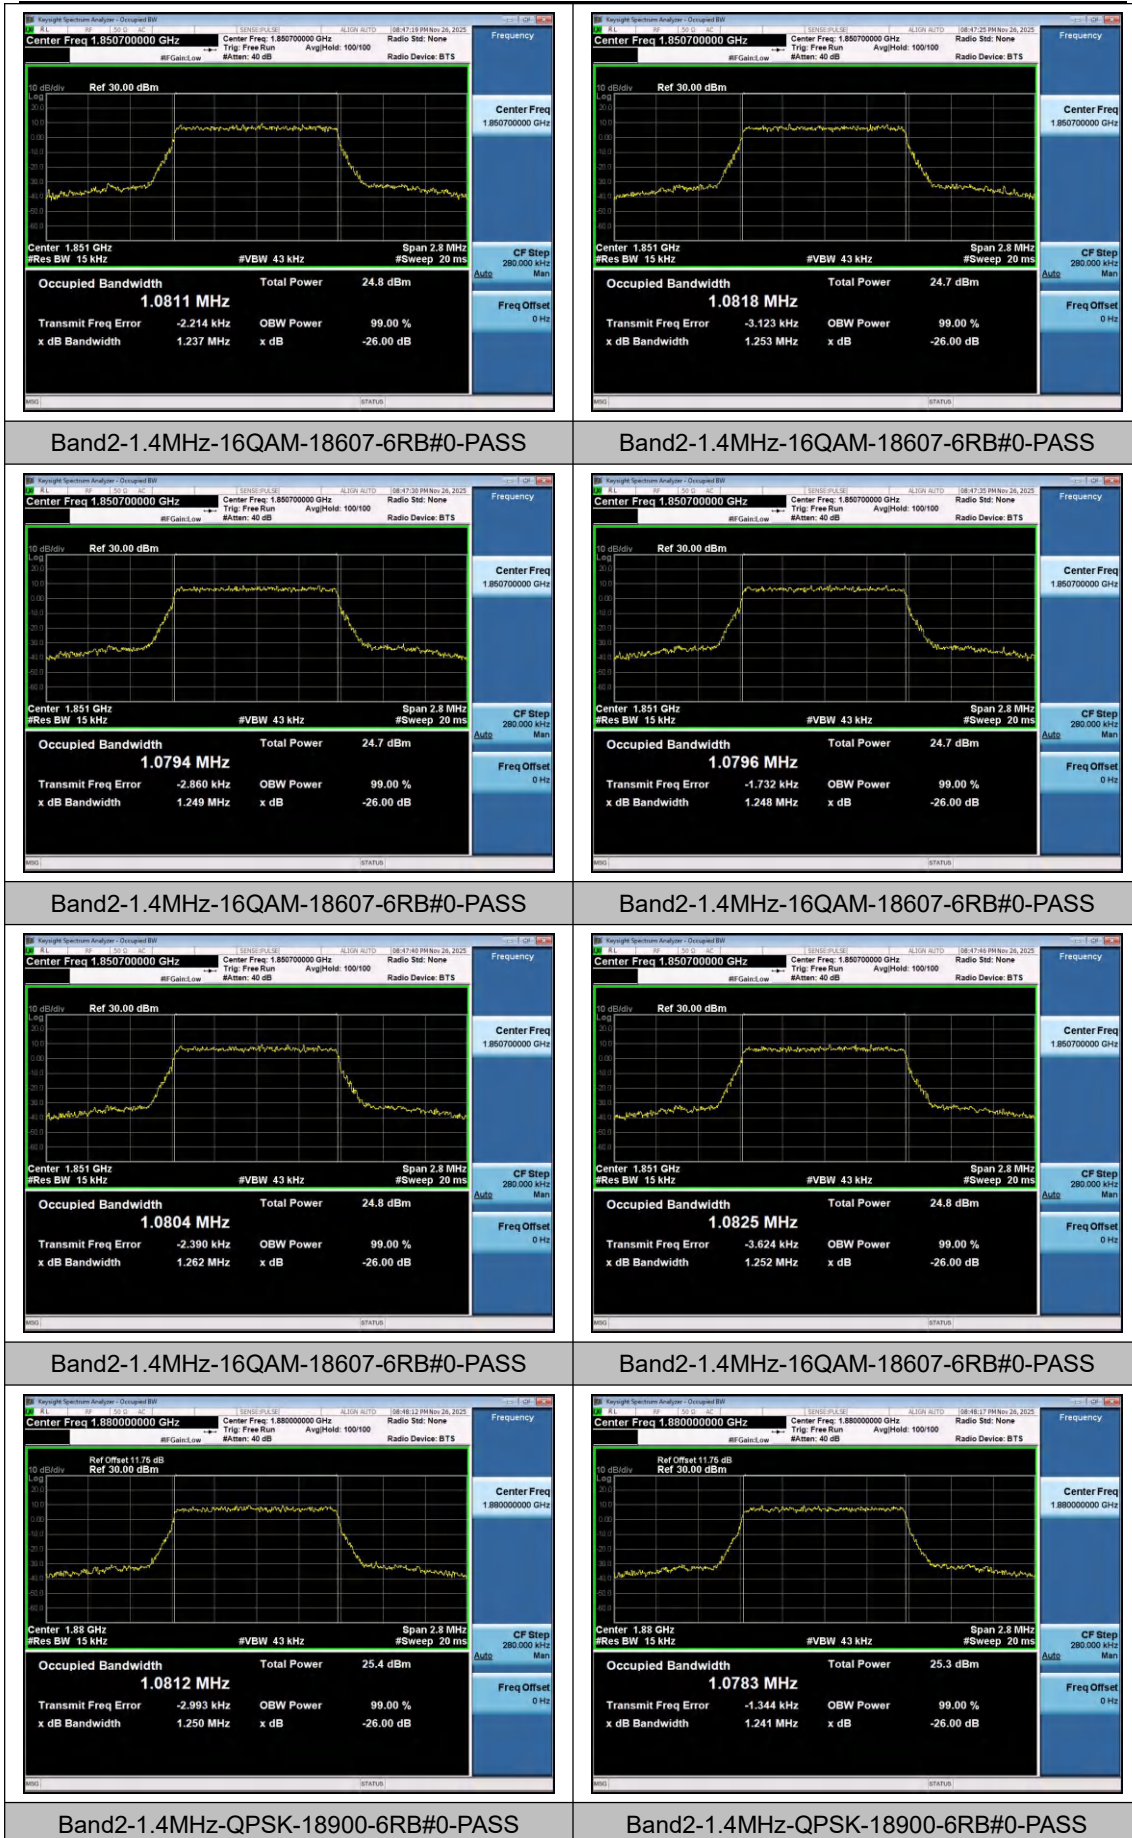


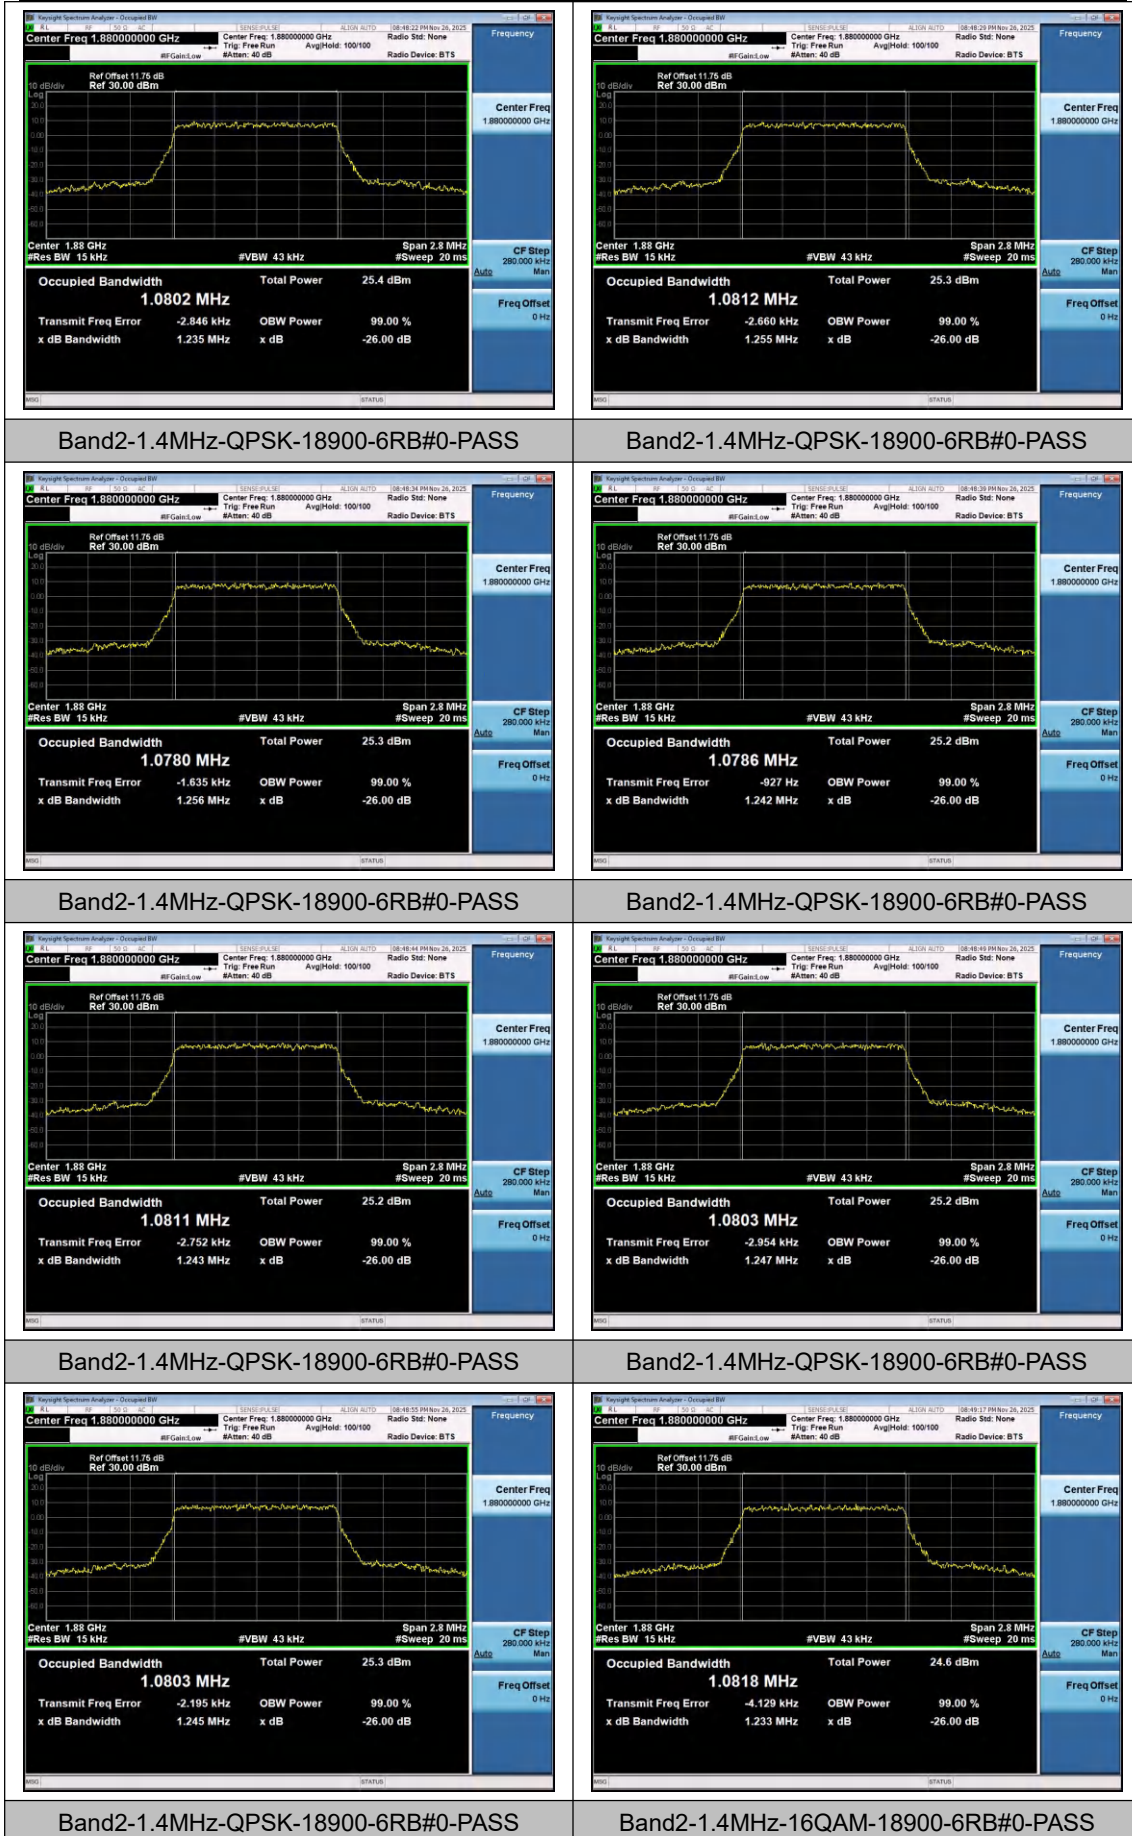


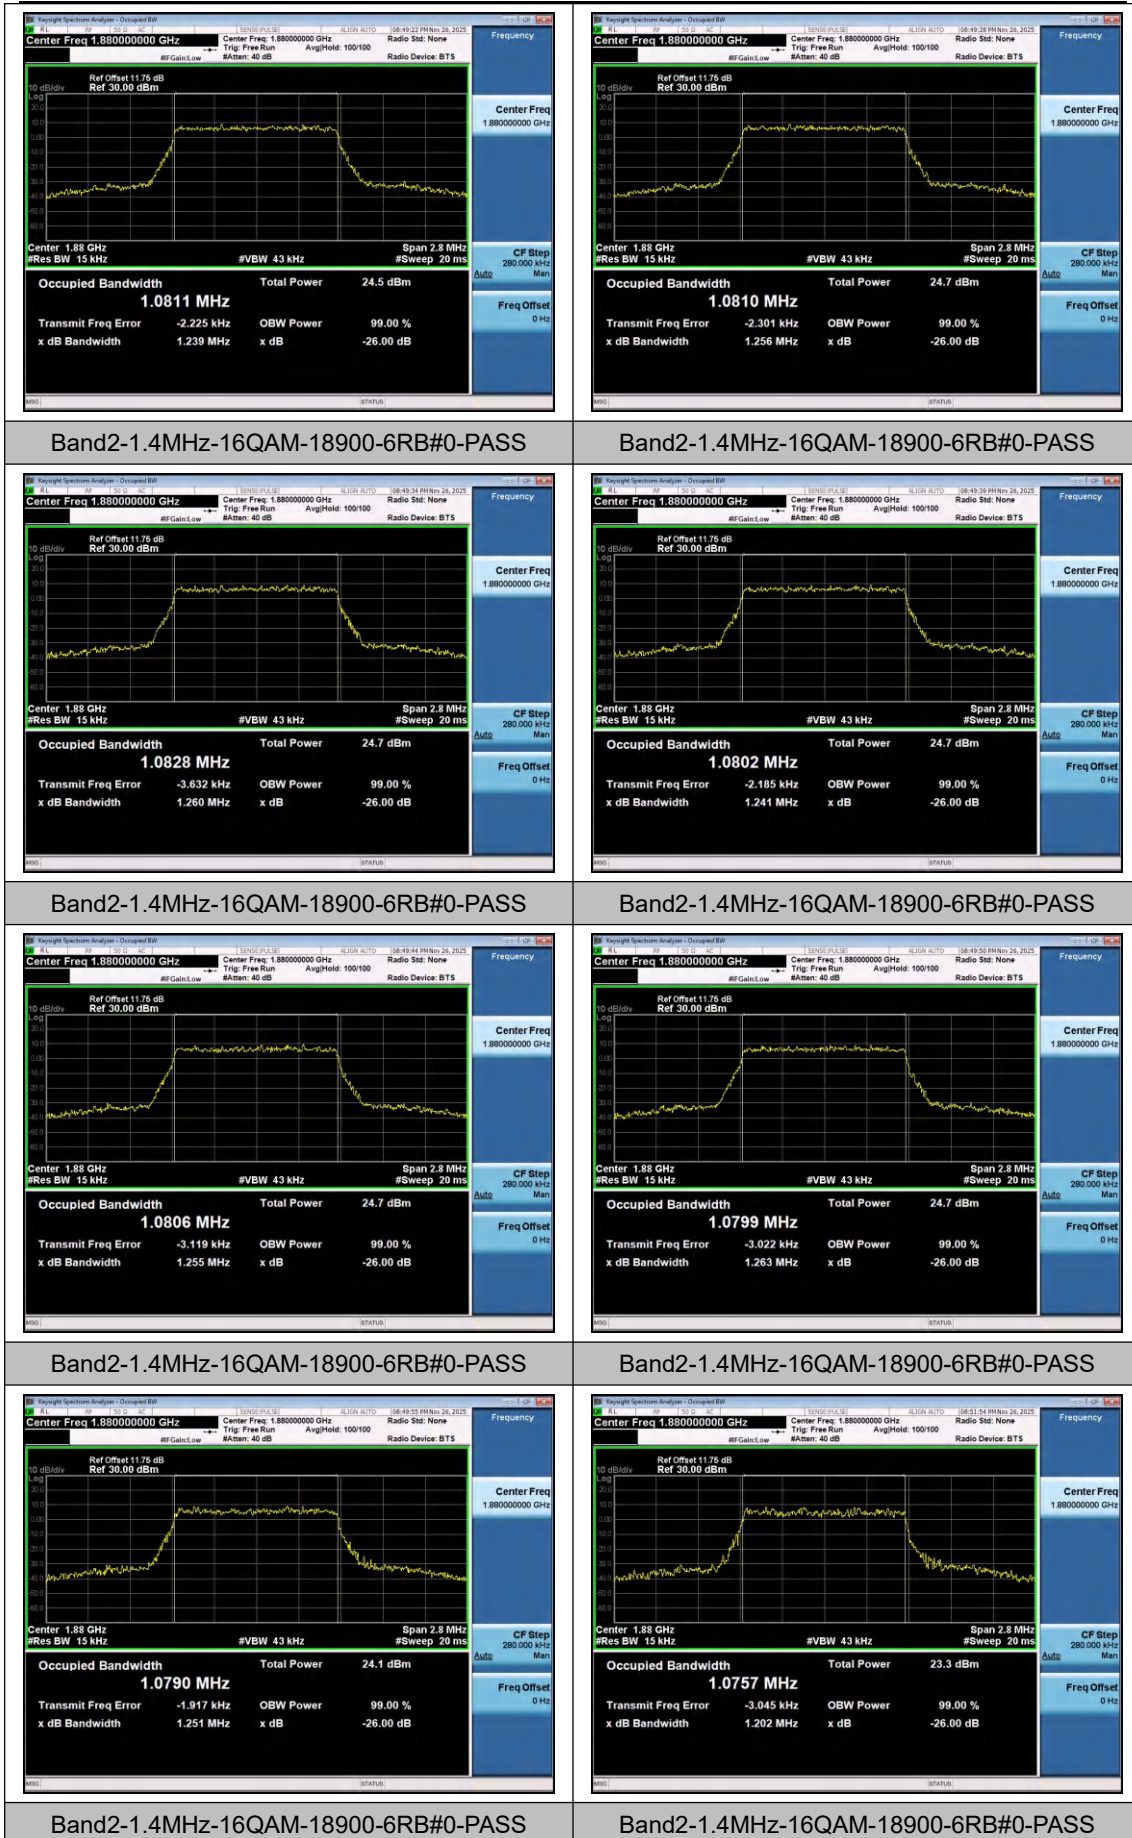

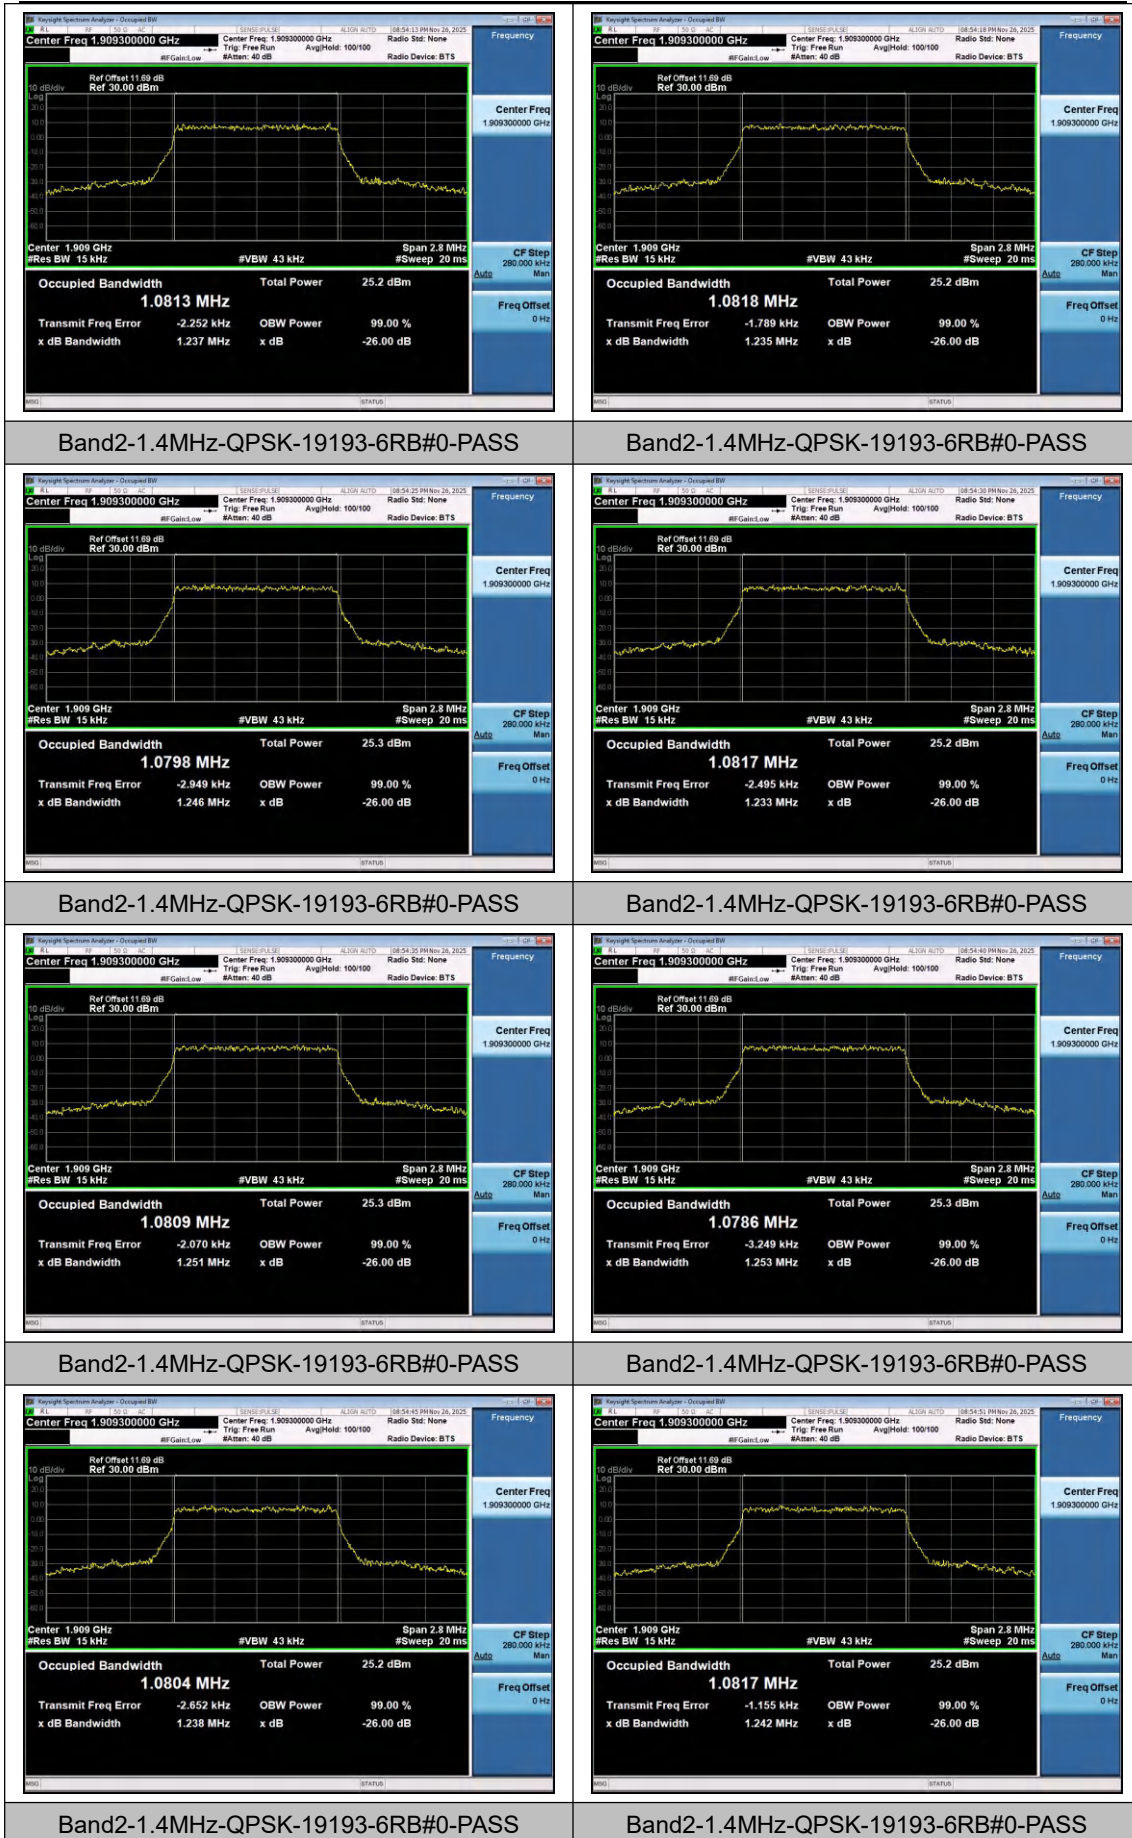

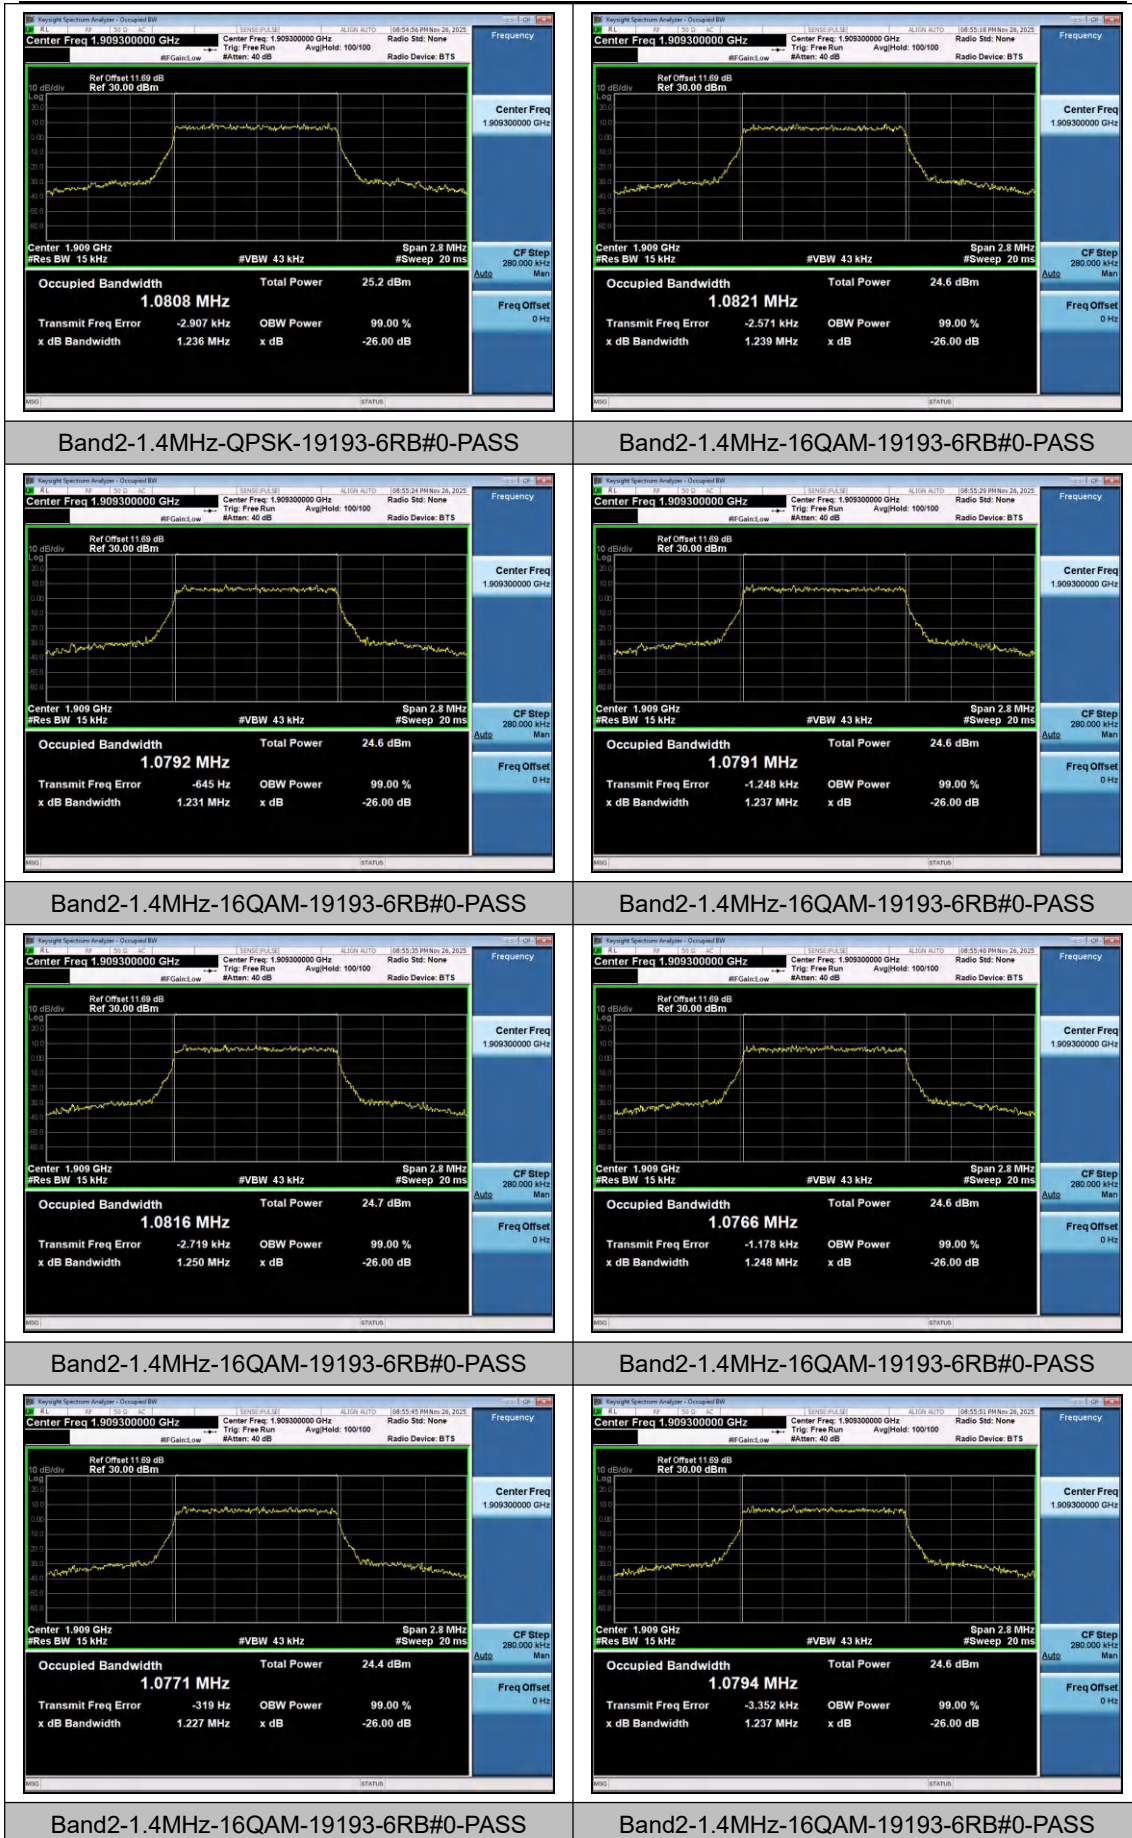


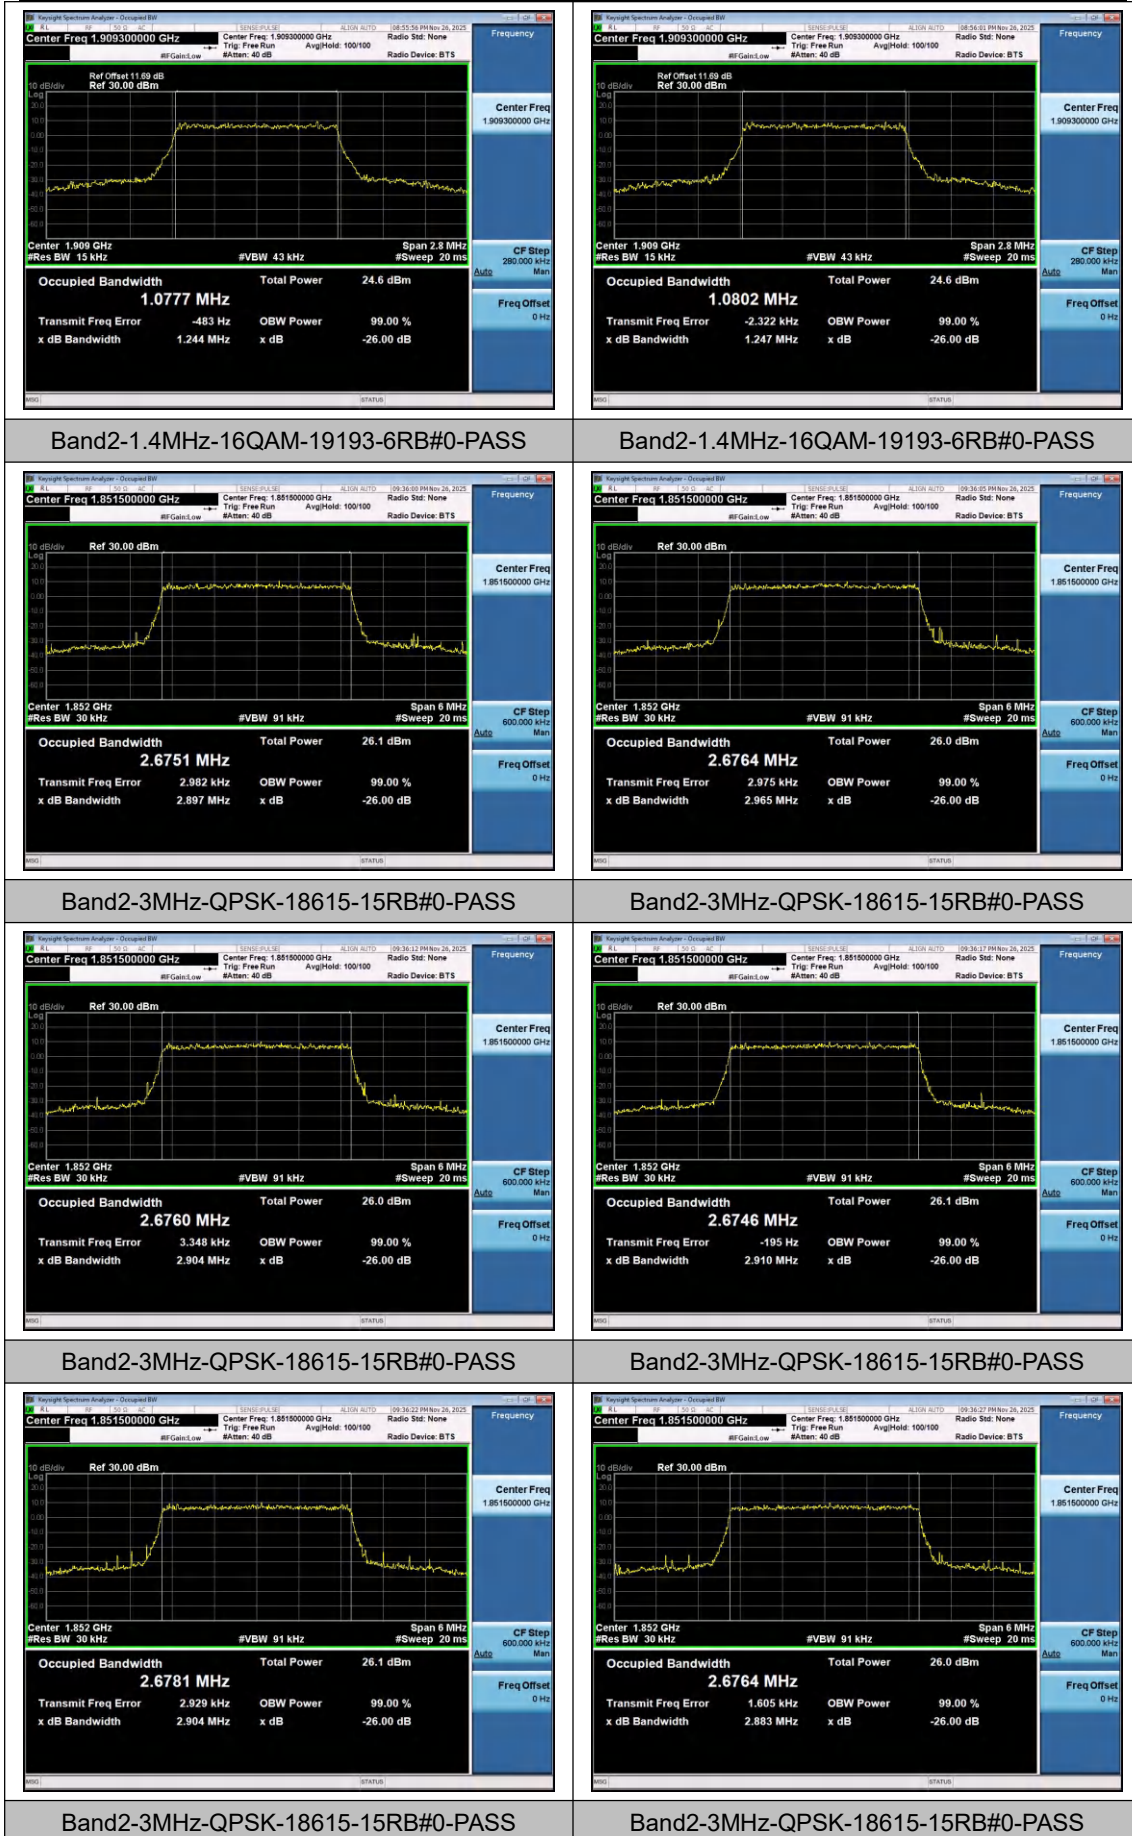

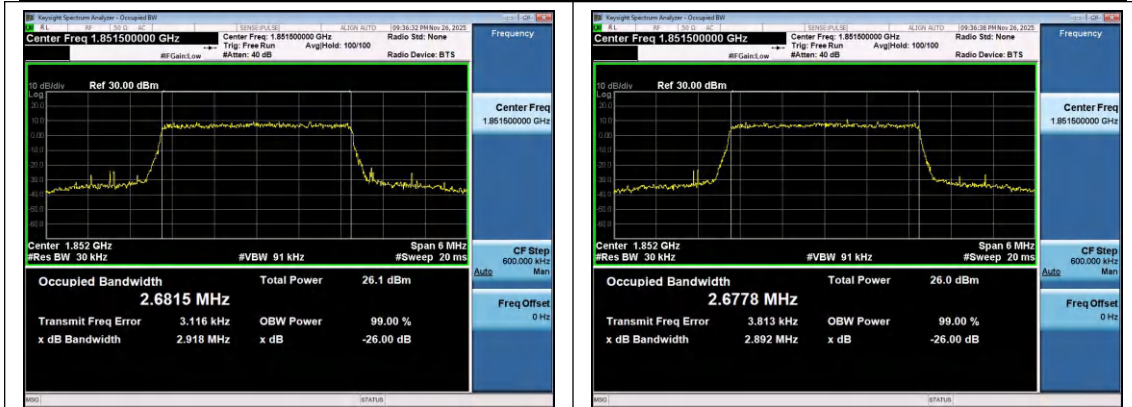


Band2-3MHz-QPSK-18615-15RB#0-PASS

Band2-3MHz-QPSK-18615-15RB#0-PASS

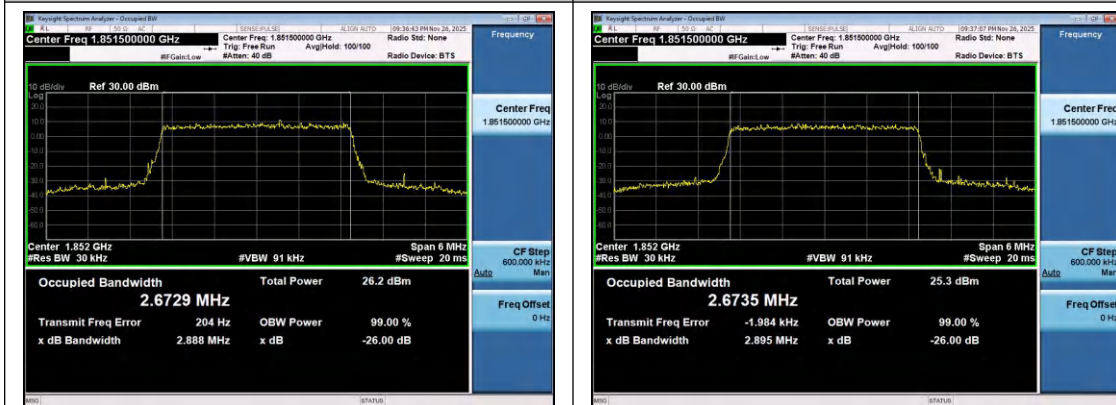


Band2-3MHz-QPSK-18615-15RB#0-PASS

Band2-3MHz-16QAM-18615-15RB#0-PASS

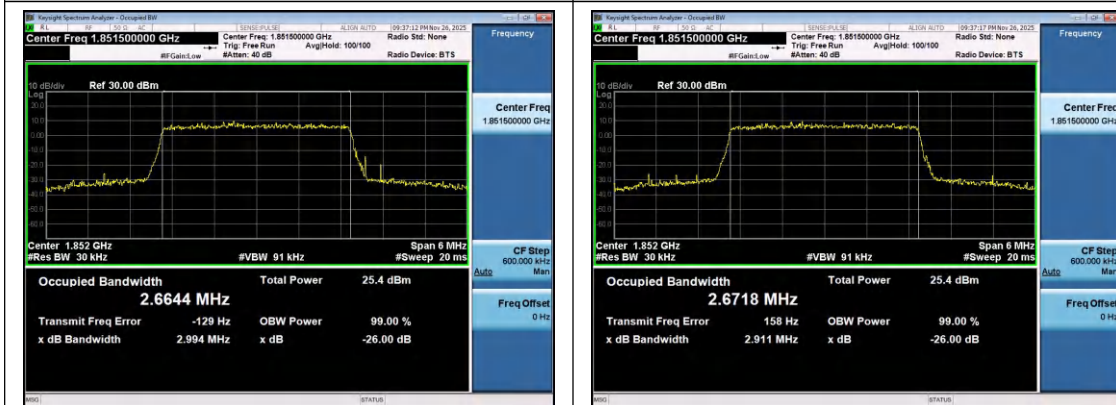


Band2-3MHz-16QAM-18615-15RB#0-PASS


Band2-3MHz-16QAM-18615-15RB#0-PASS

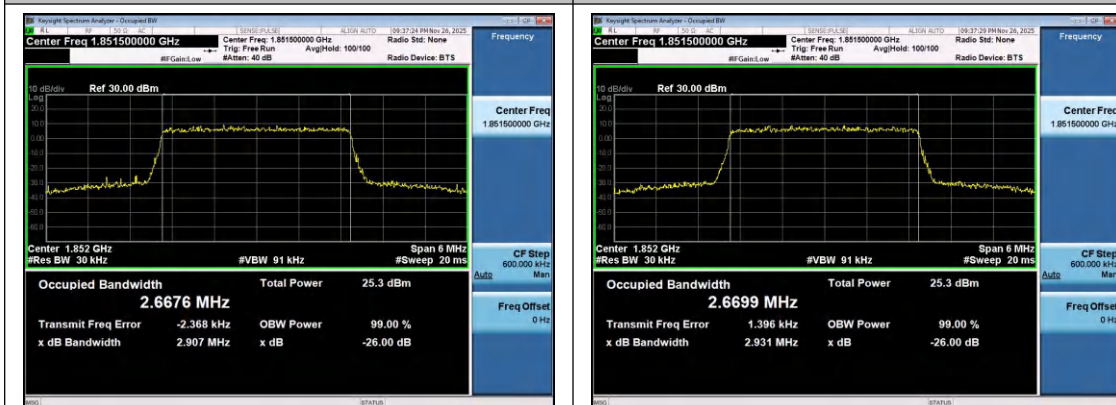

Band2-3MHz-16QAM-18615-15RB#0-PASS

Band2-3MHz-16QAM-18615-15RB#0-PASS

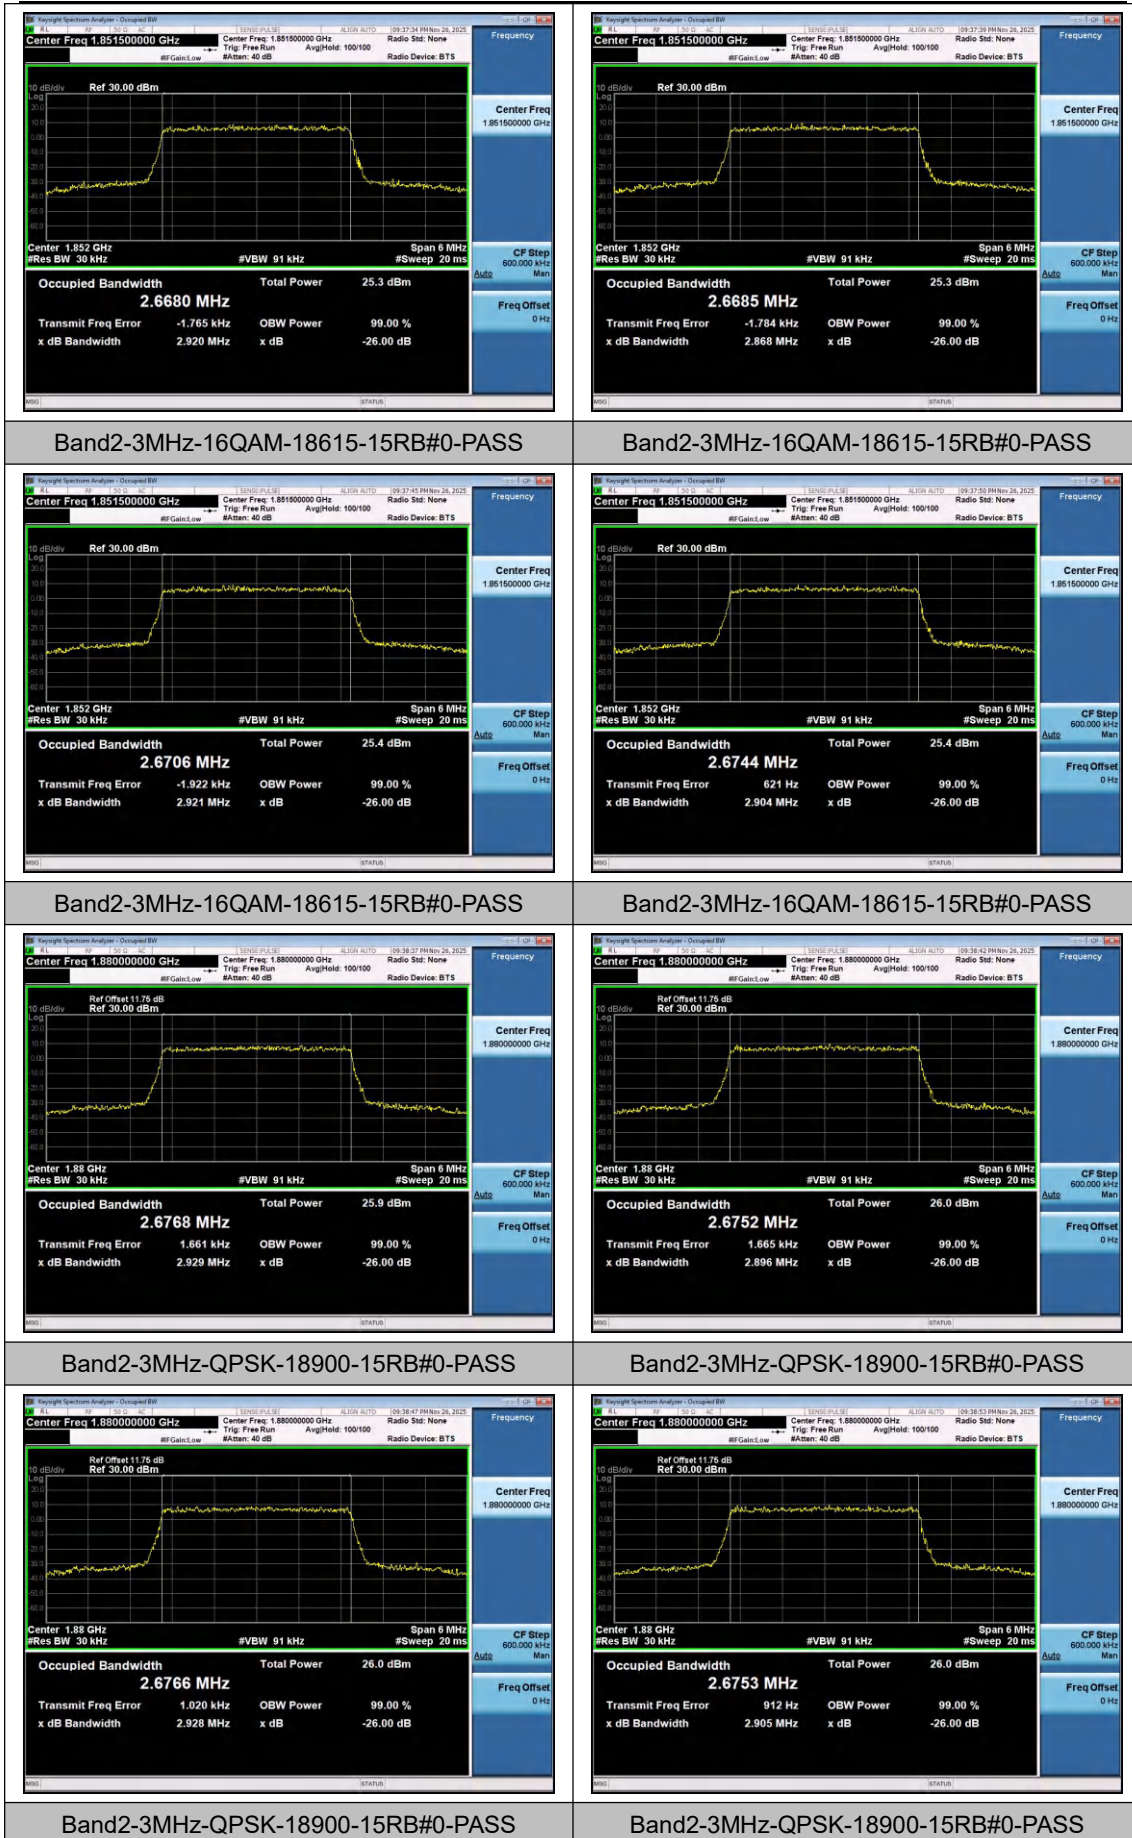

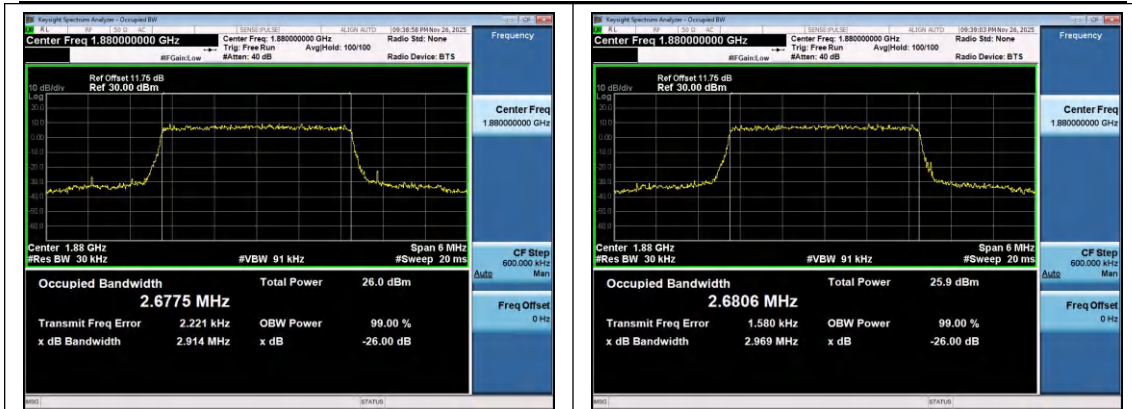


Band2-3MHz-QPSK-18900-15RB#0-PASS

Band2-3MHz-QPSK-18900-15RB#0-PASS




Band2-3MHz-QPSK-18900-15RB#0-PASS

Band2-3MHz-QPSK-18900-15RB#0-PASS

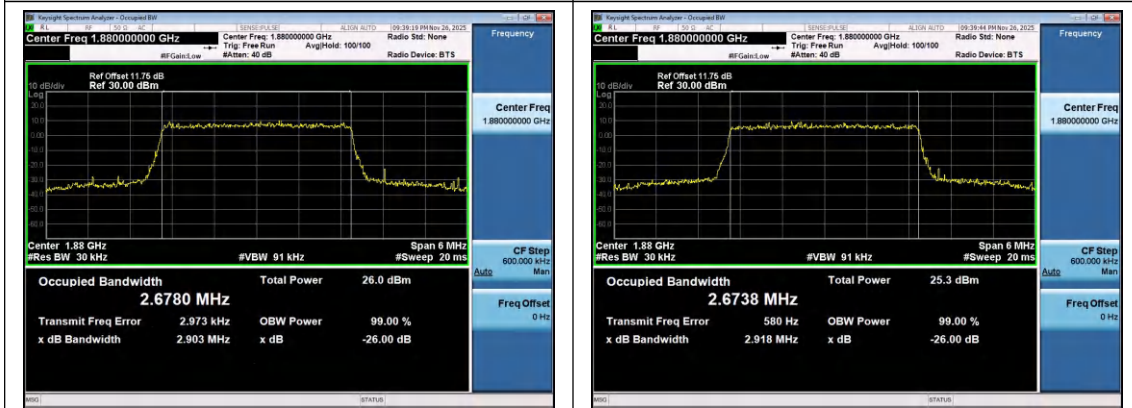

Band2-3MHz-QPSK-18900-15RB#0-PASS

Band2-3MHz-16QAM-18900-15RB#0-PASS

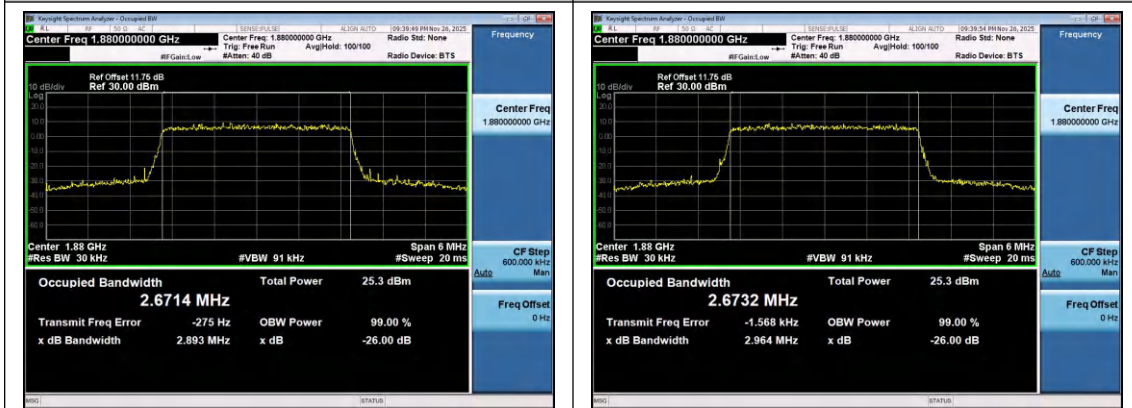

Band2-3MHz-16QAM-18900-15RB#0-PASS

Band2-3MHz-16QAM-18900-15RB#0-PASS

