



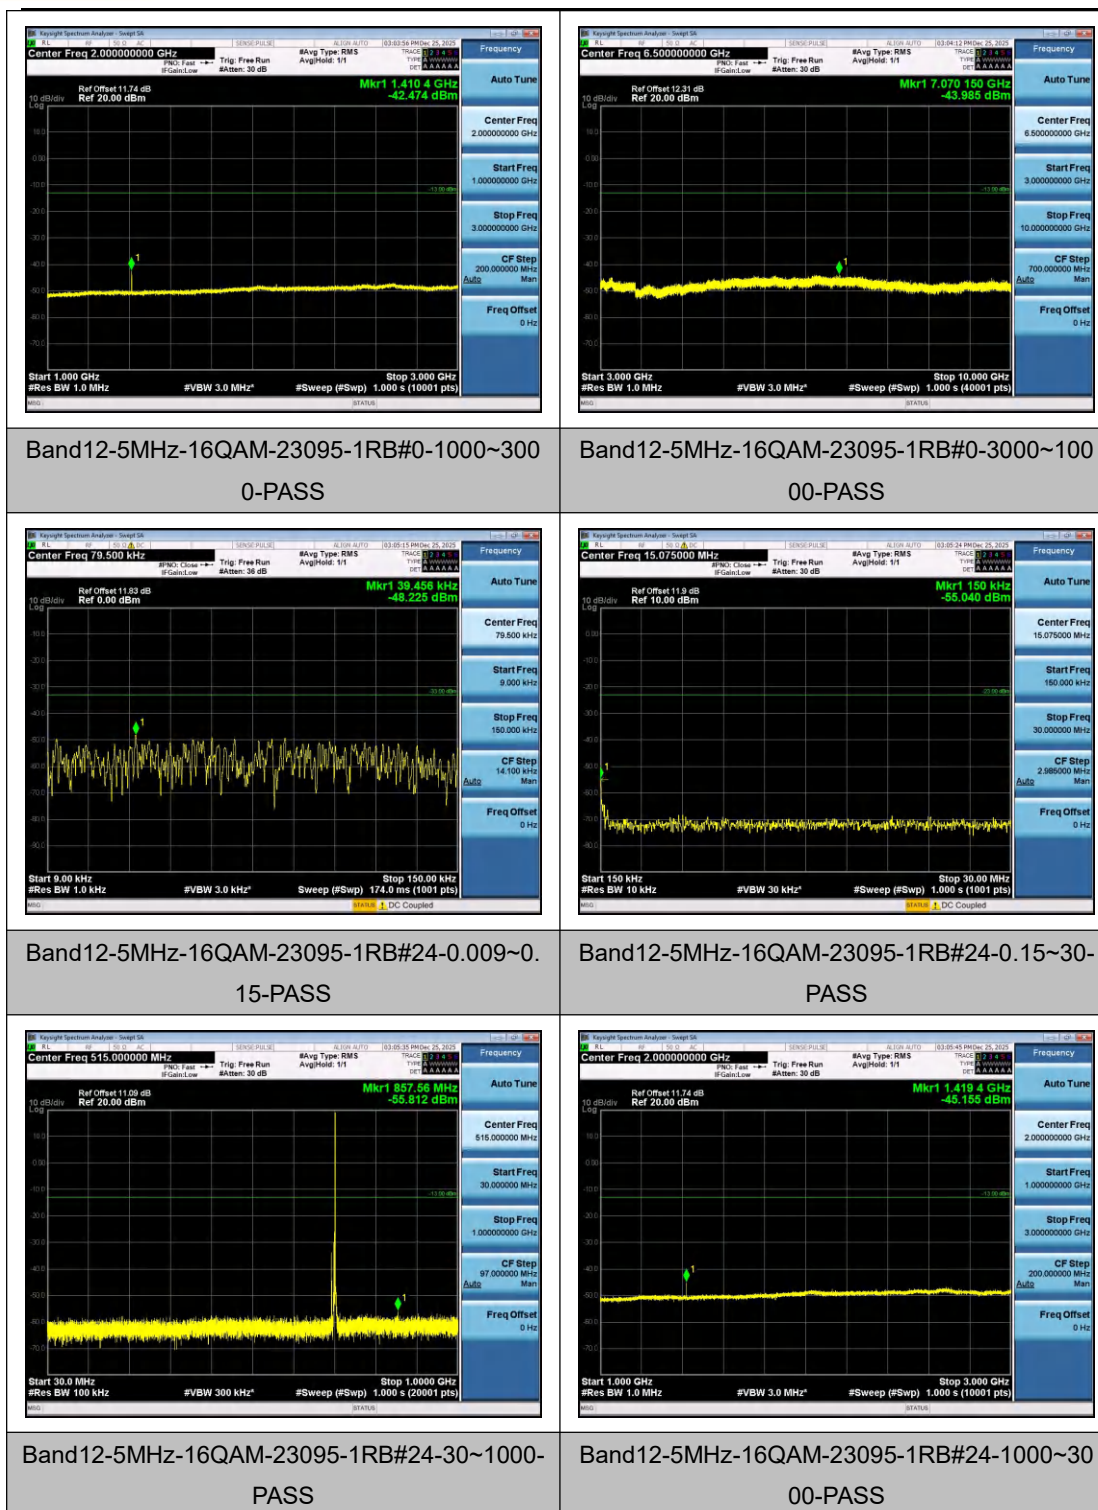
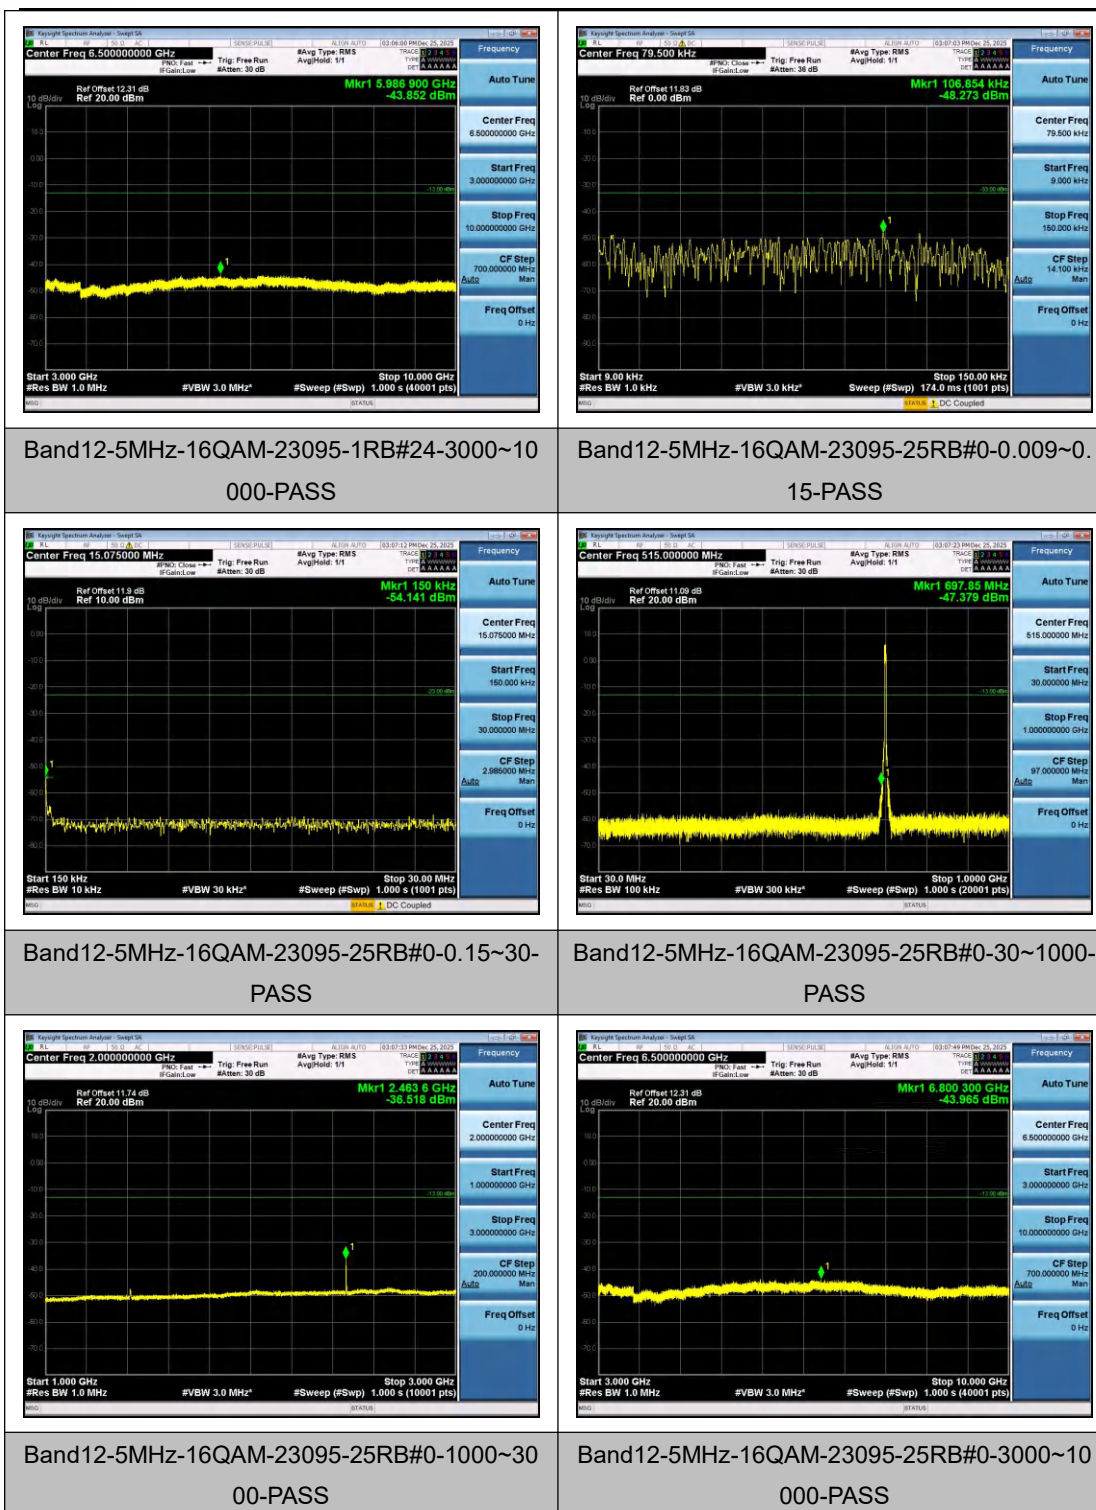
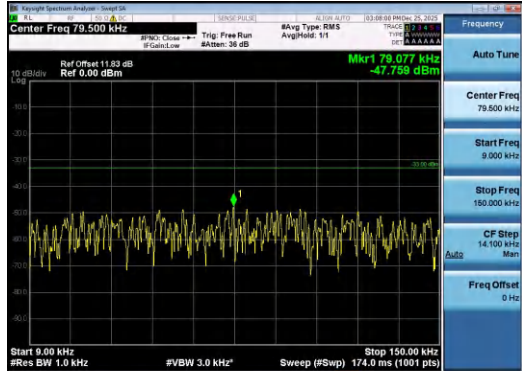
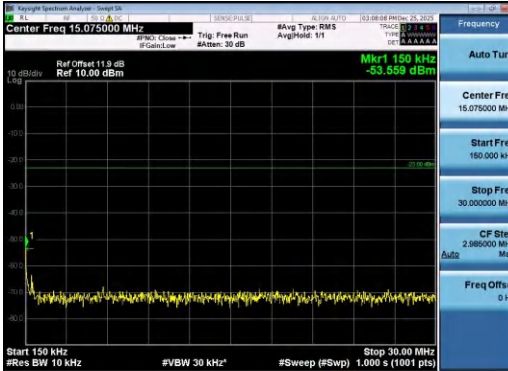
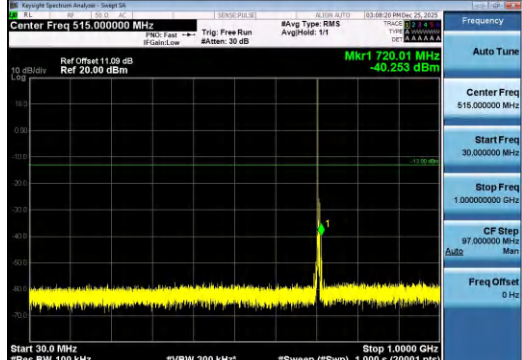


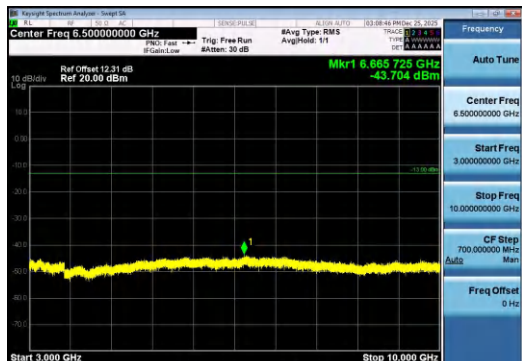


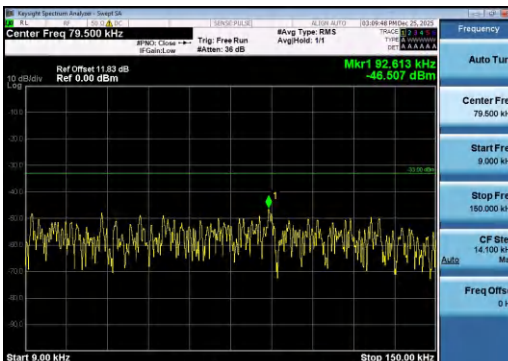



 Center Freq 79.500 kHz Mkr1 79.077 kHz -47.759 dBm	 Center Freq 15.075000 MHz Mkr1 150 kHz -53.559 dBm
Band12-5MHz-QPSK-23155-1RB#0-0.009~0.15- PASS	Band12-5MHz-QPSK-23155-1RB#0-0.15~30-PA SS
 Center Freq 515.000000 MHz Mkr1 720.01 MHz -40.253 dBm	 Center Freq 2.00000000 GHz Mkr1 1.422 GHz -46.103 dBm
Band12-5MHz-QPSK-23155-1RB#0-30~1000-P ASS	Band12-5MHz-QPSK-23155-1RB#0-1000~3000- PASS
 Center Freq 6.50000000 GHz Mkr1 6.665 726 GHz -43.704 dBm	 Center Freq 79.500 kHz Mkr1 82.613 kHz -45.507 dBm
Band12-5MHz-QPSK-23155-1RB#0-3000~1000 0-PASS	Band12-5MHz-QPSK-23155-1RB#24-0.009~0.1 5-PASS

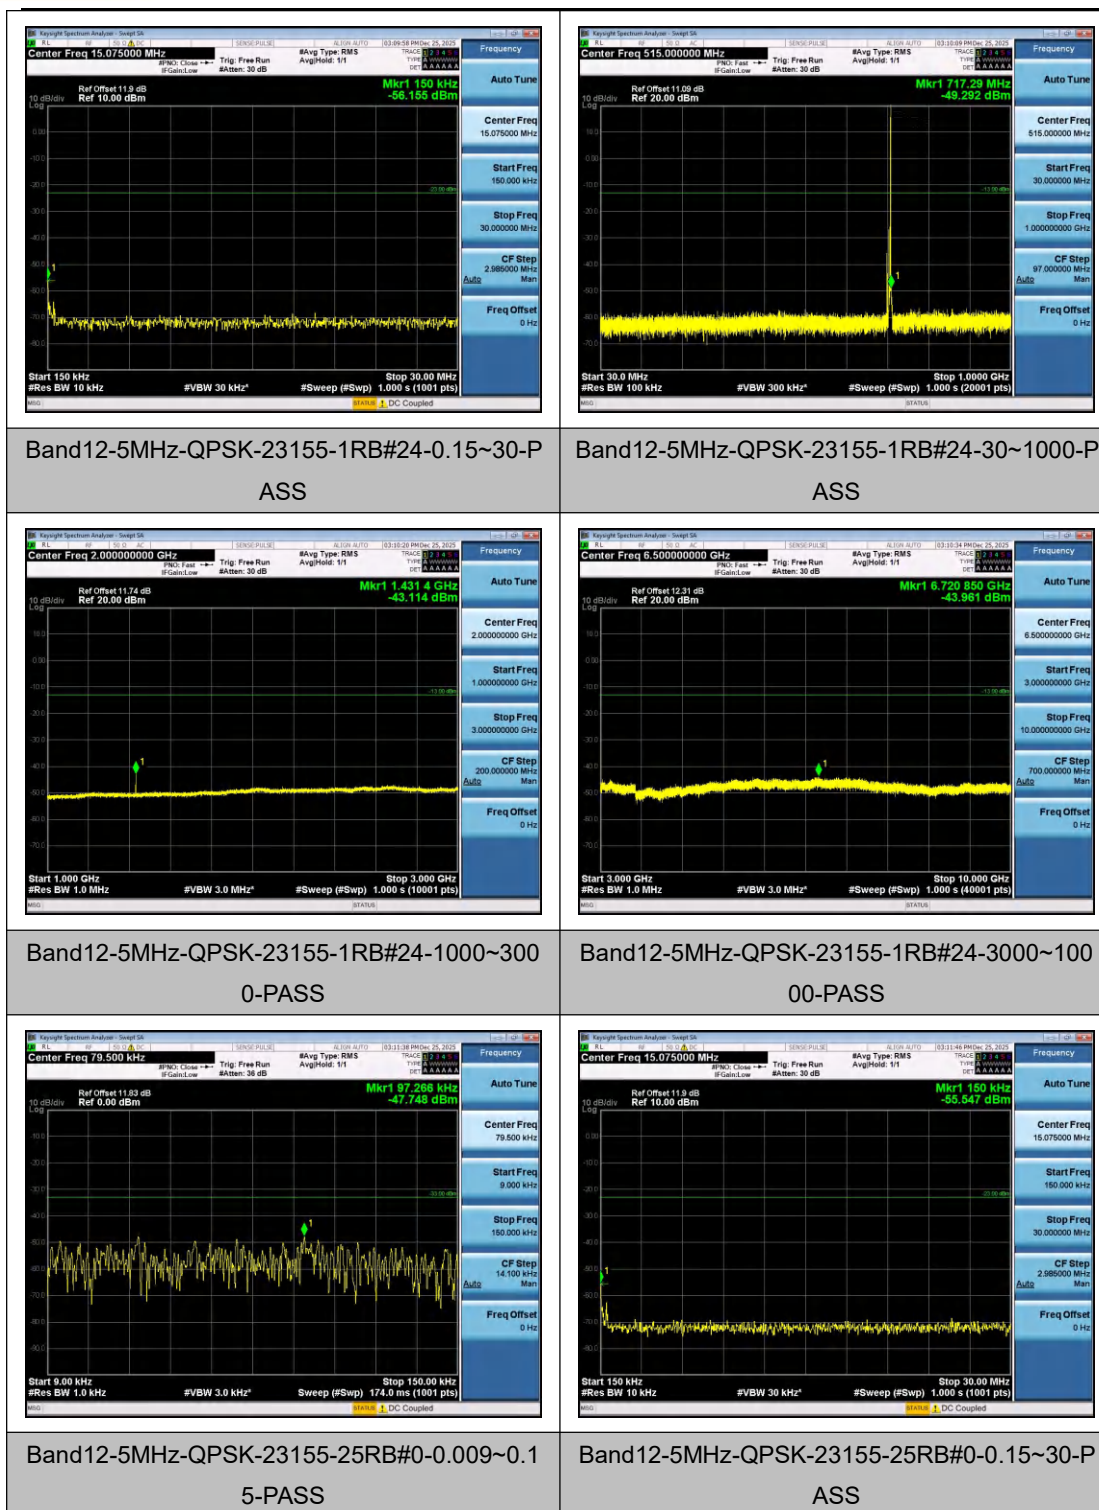


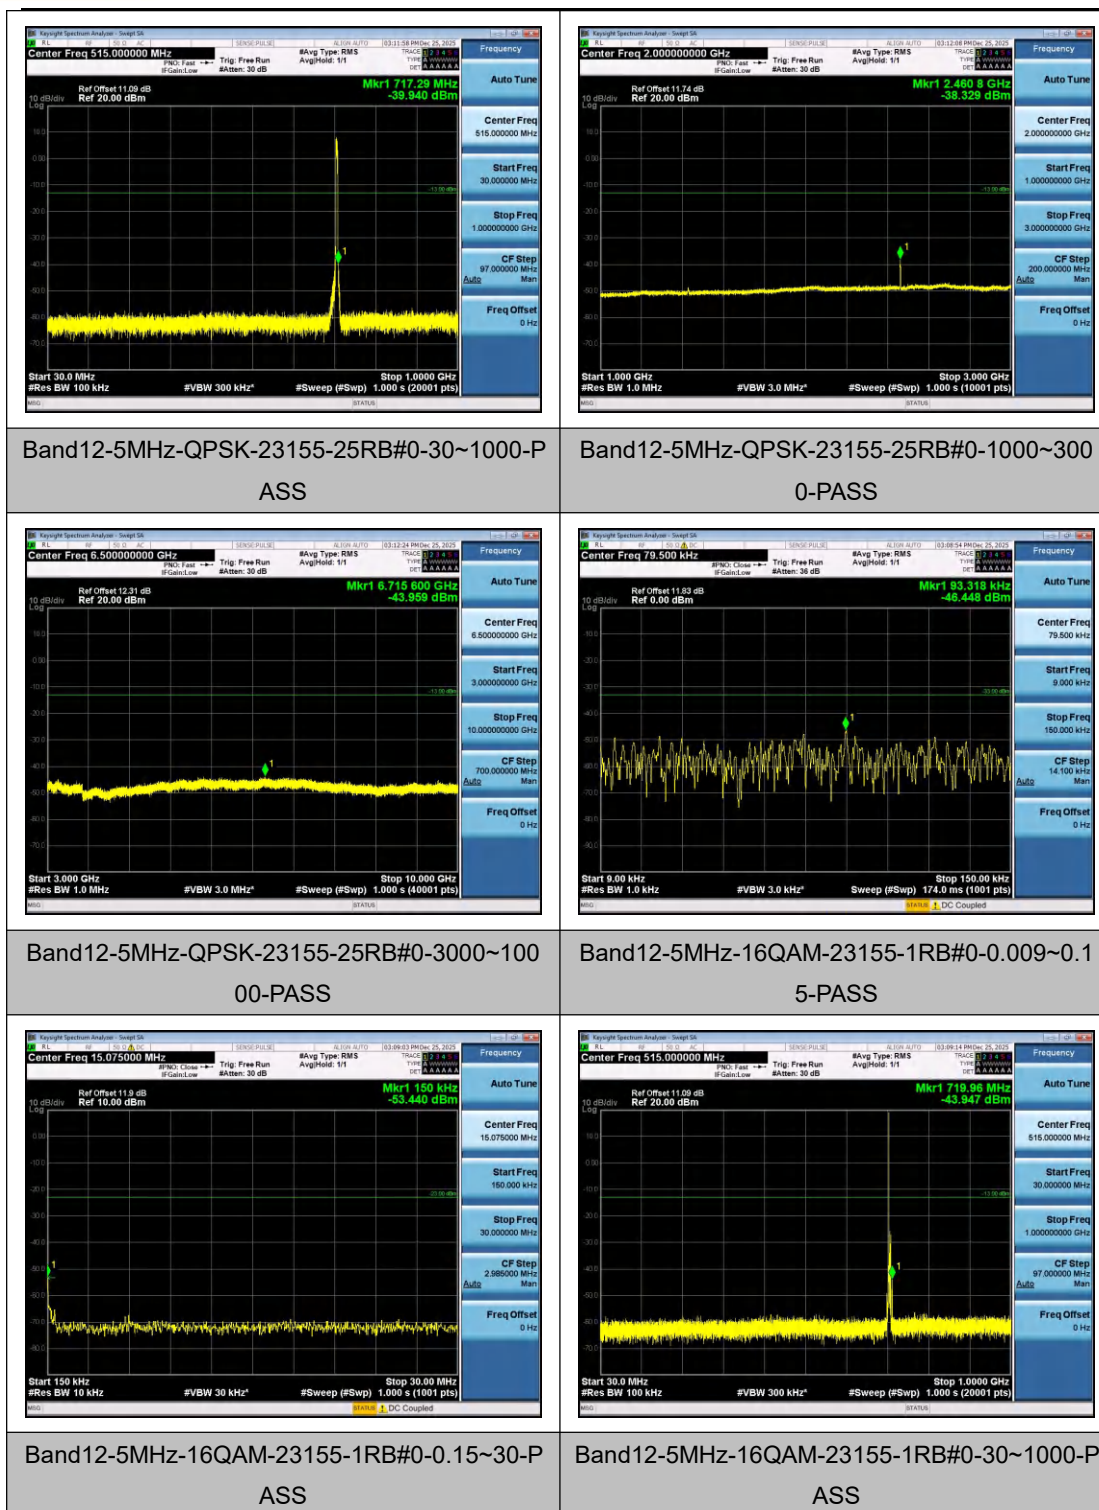


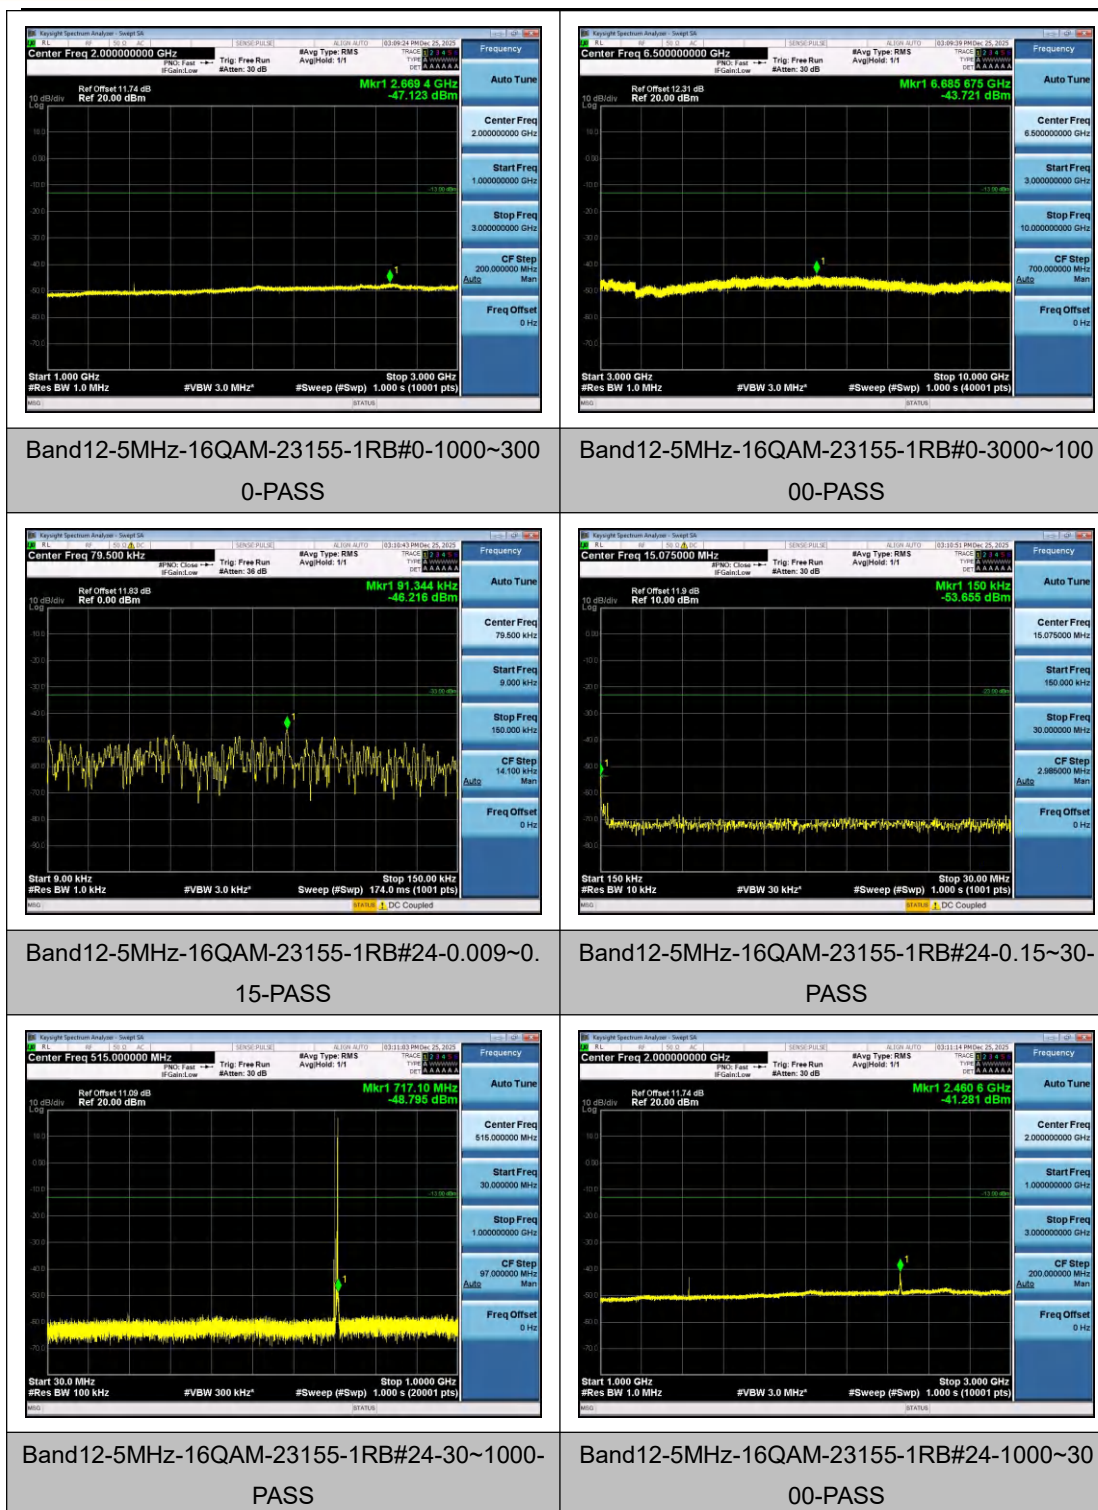


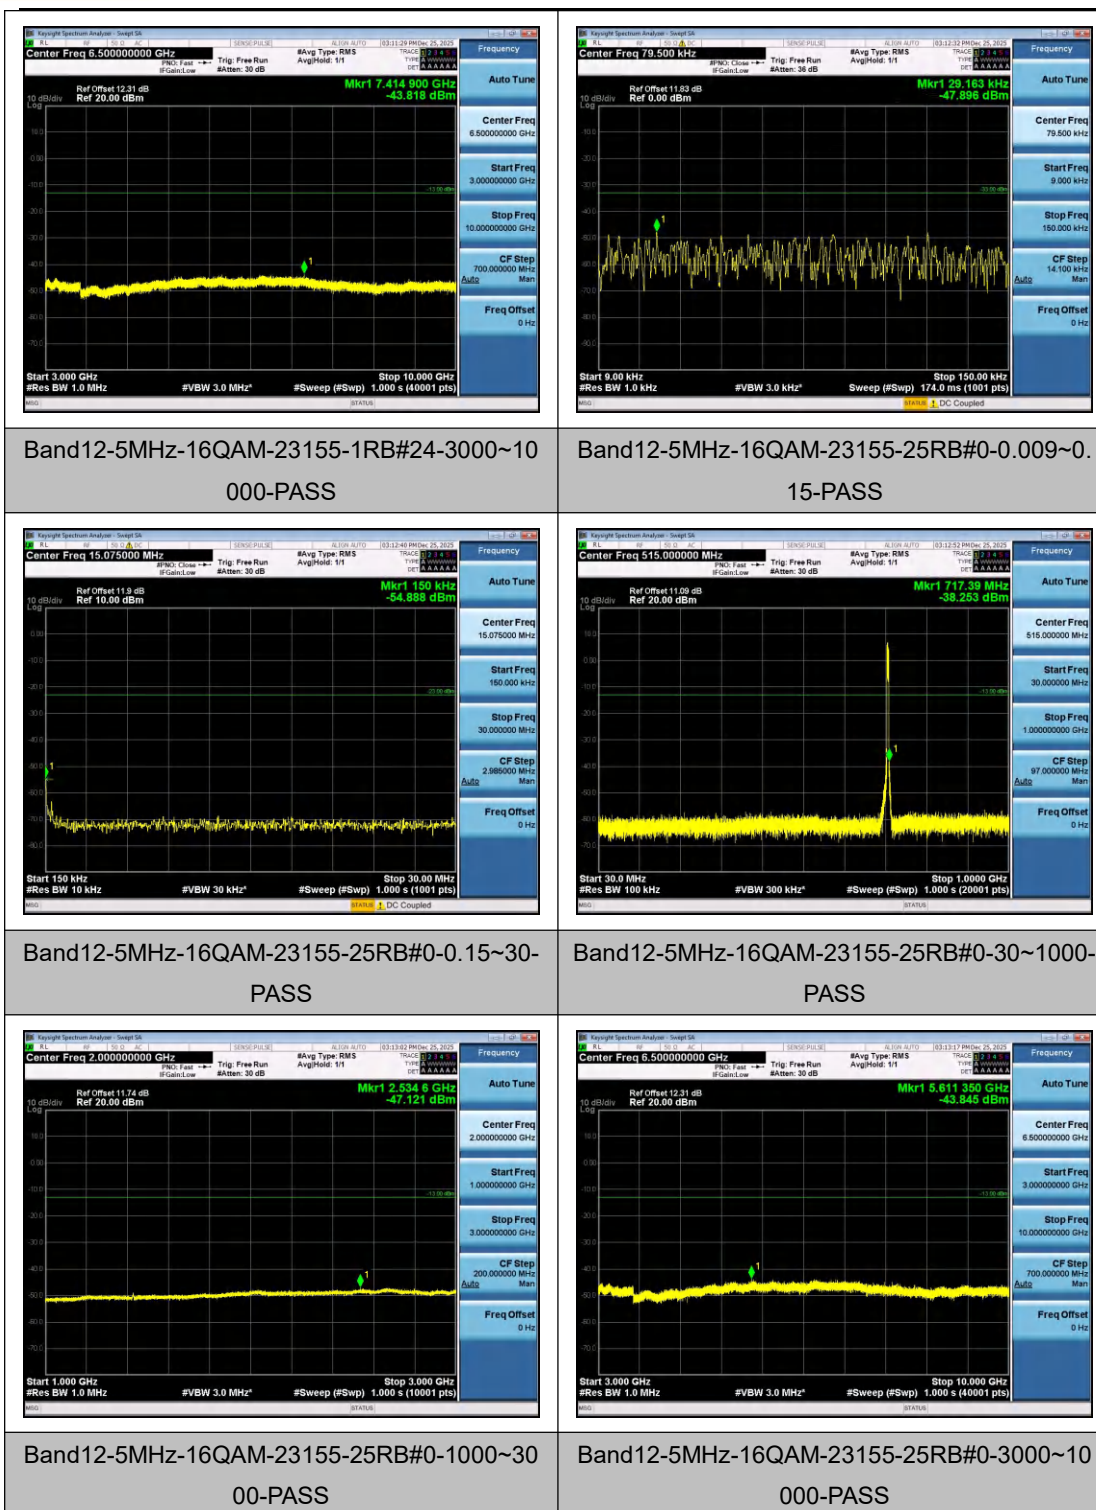


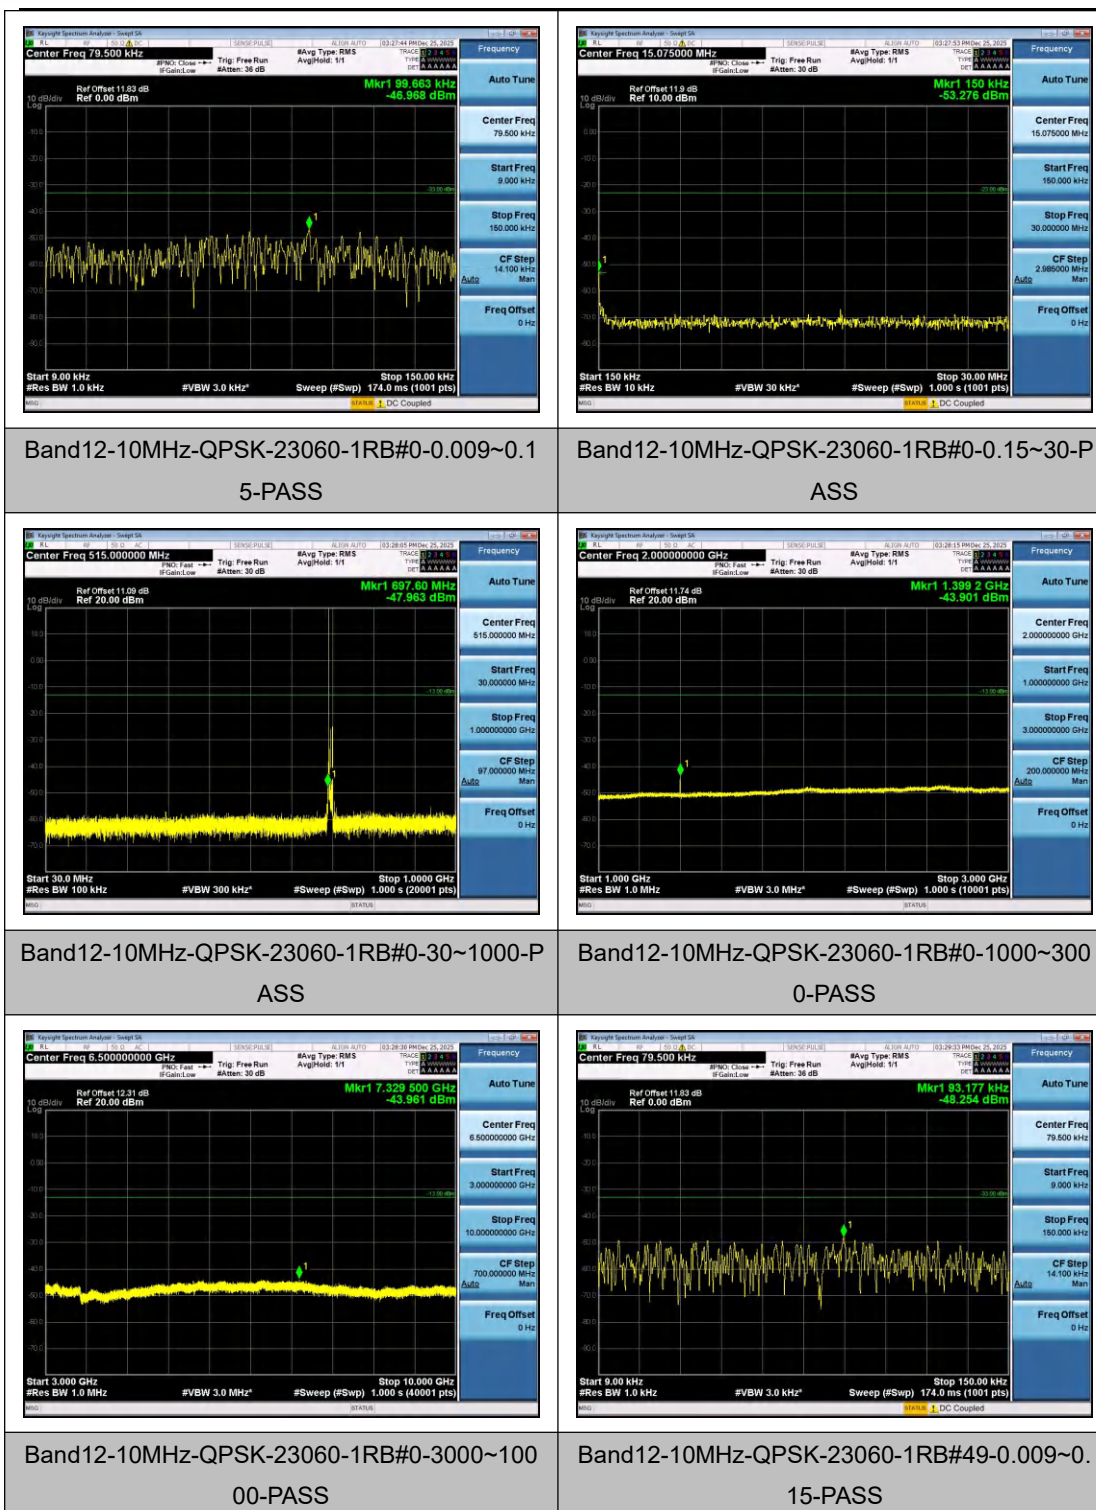


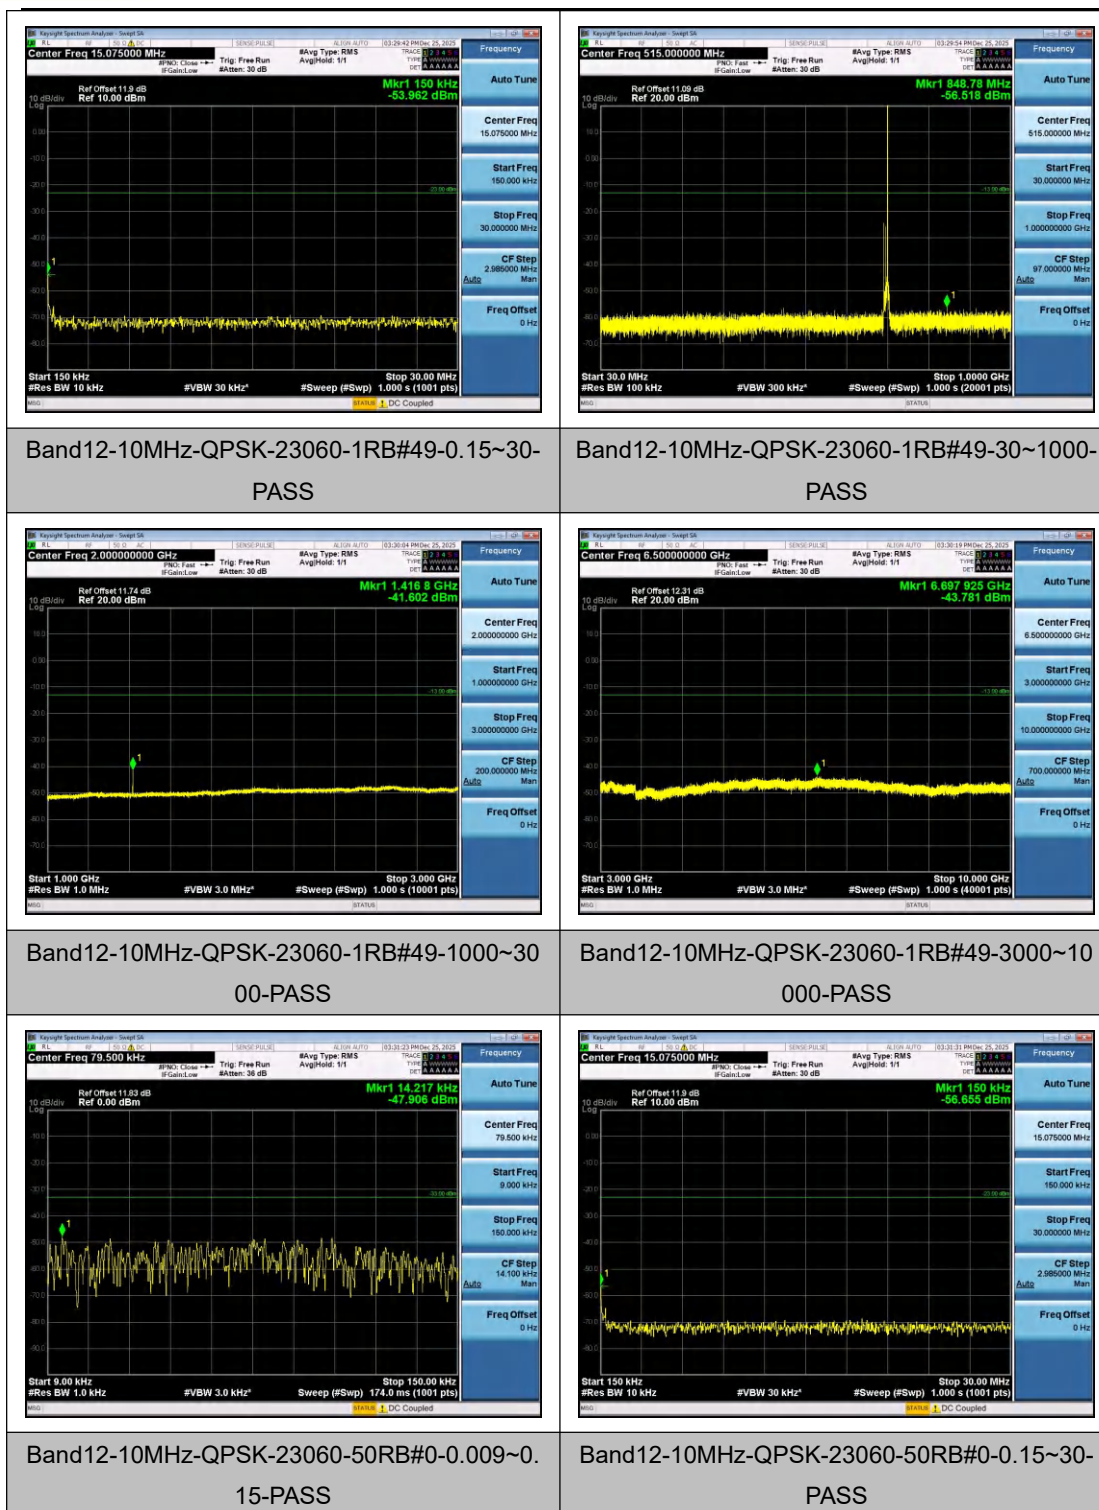


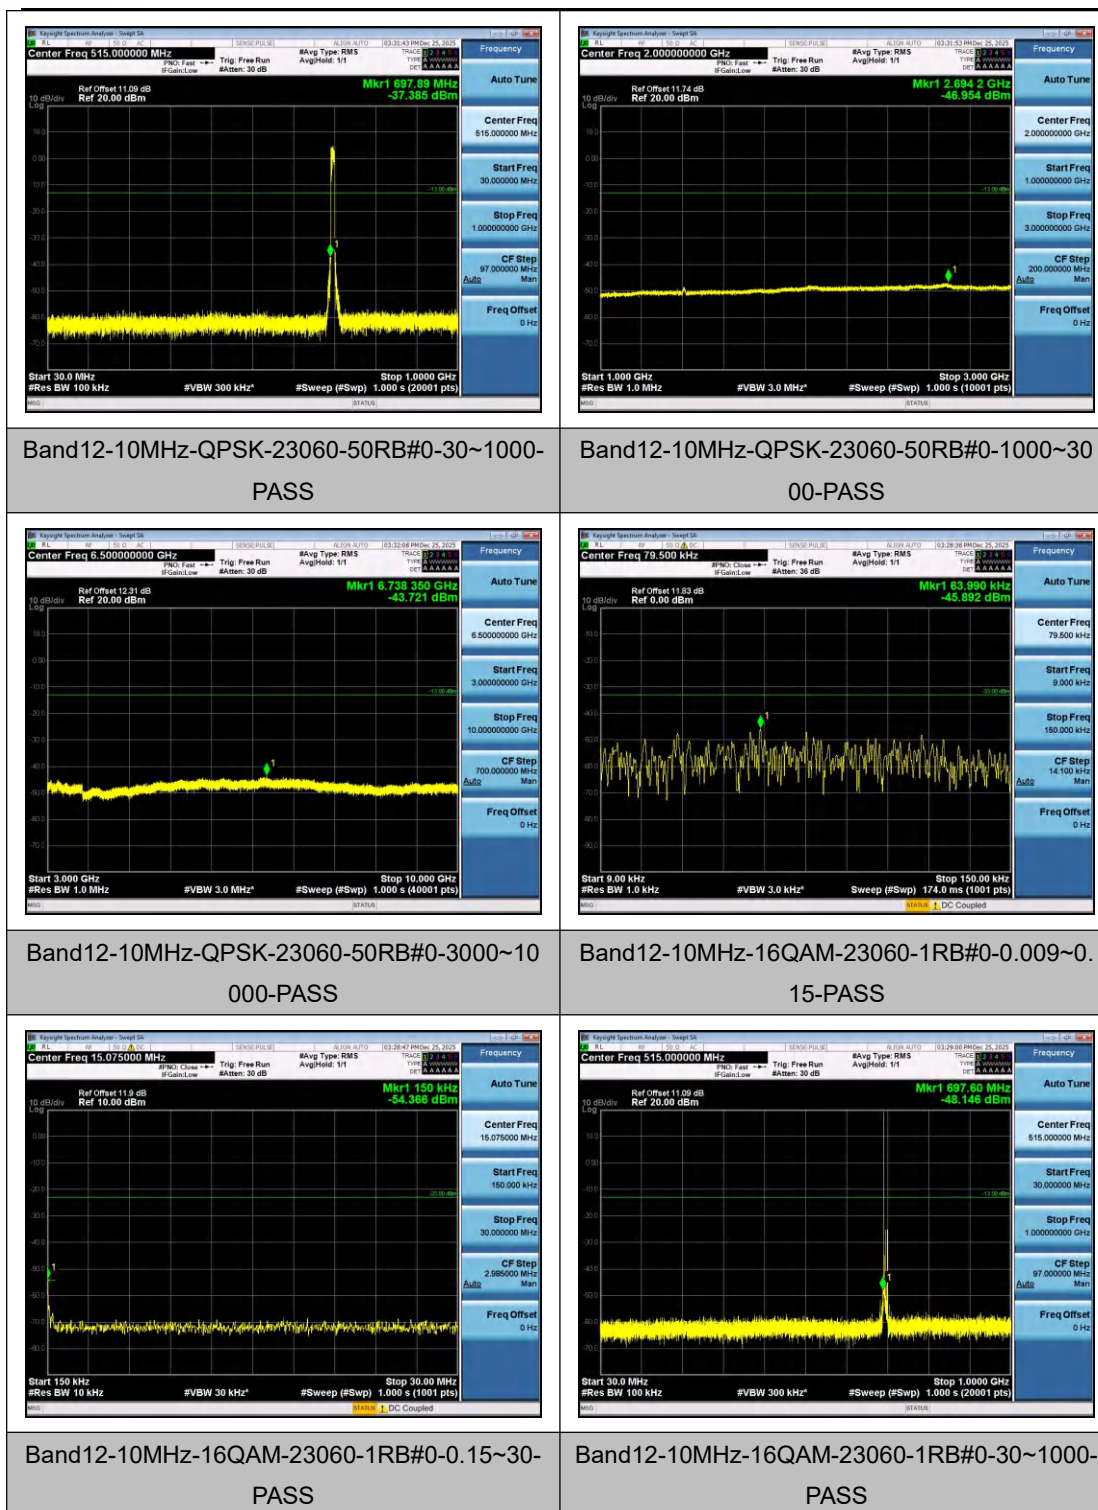

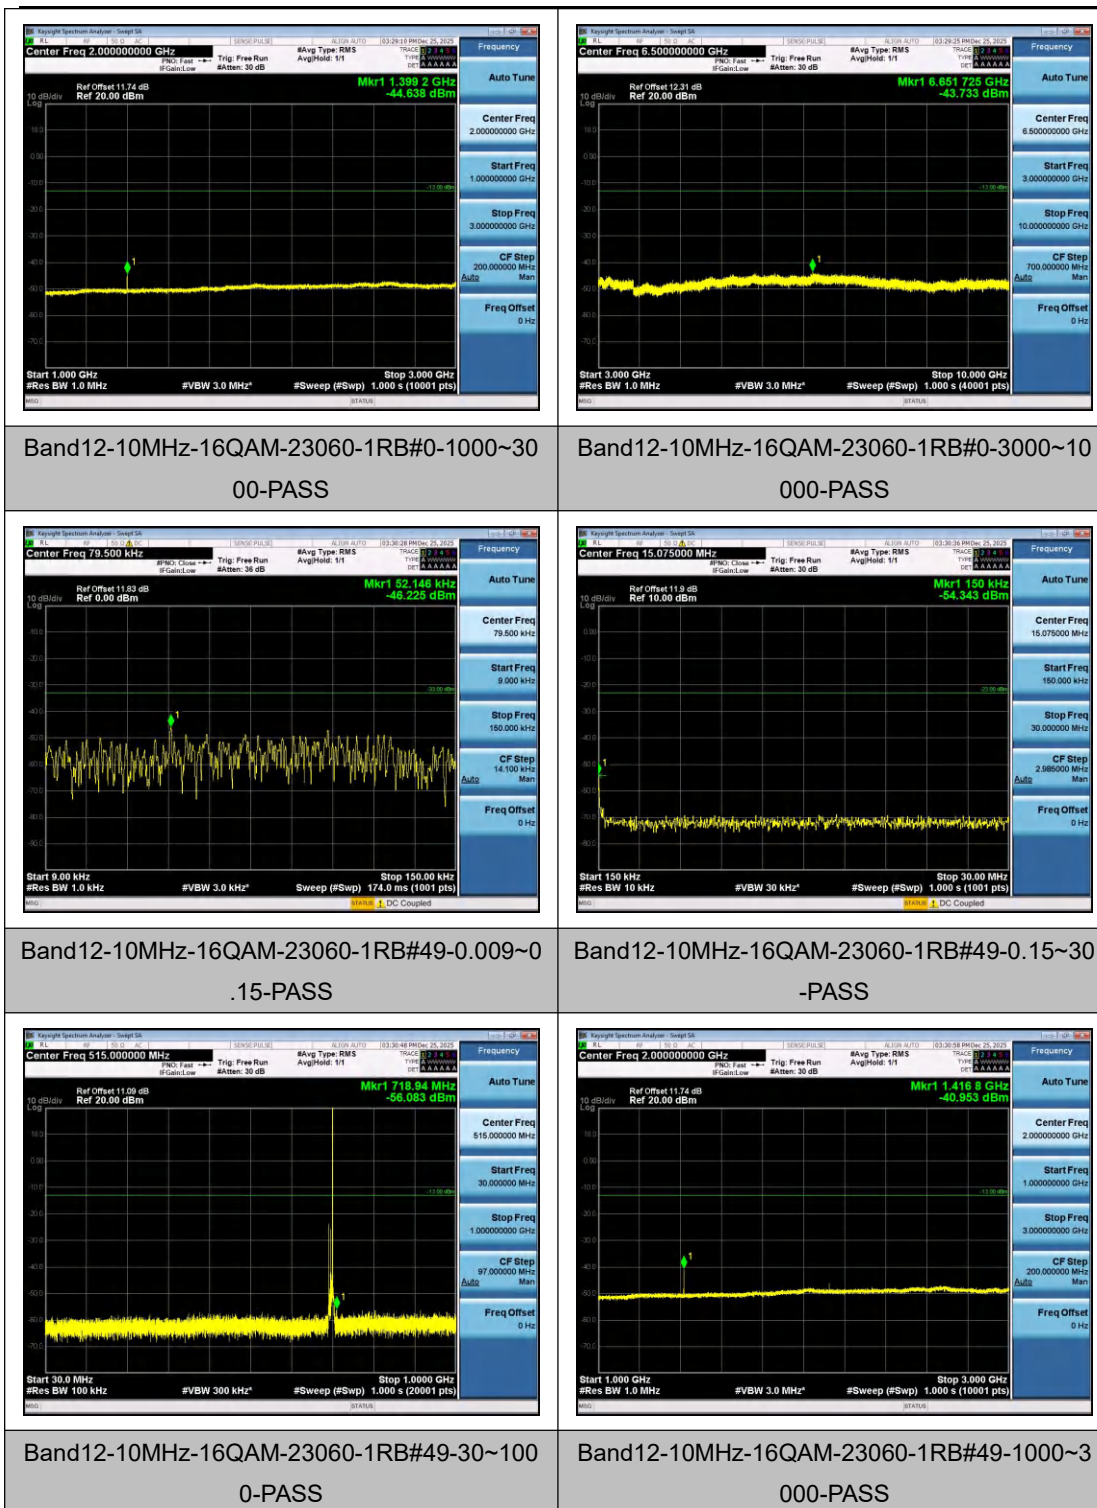


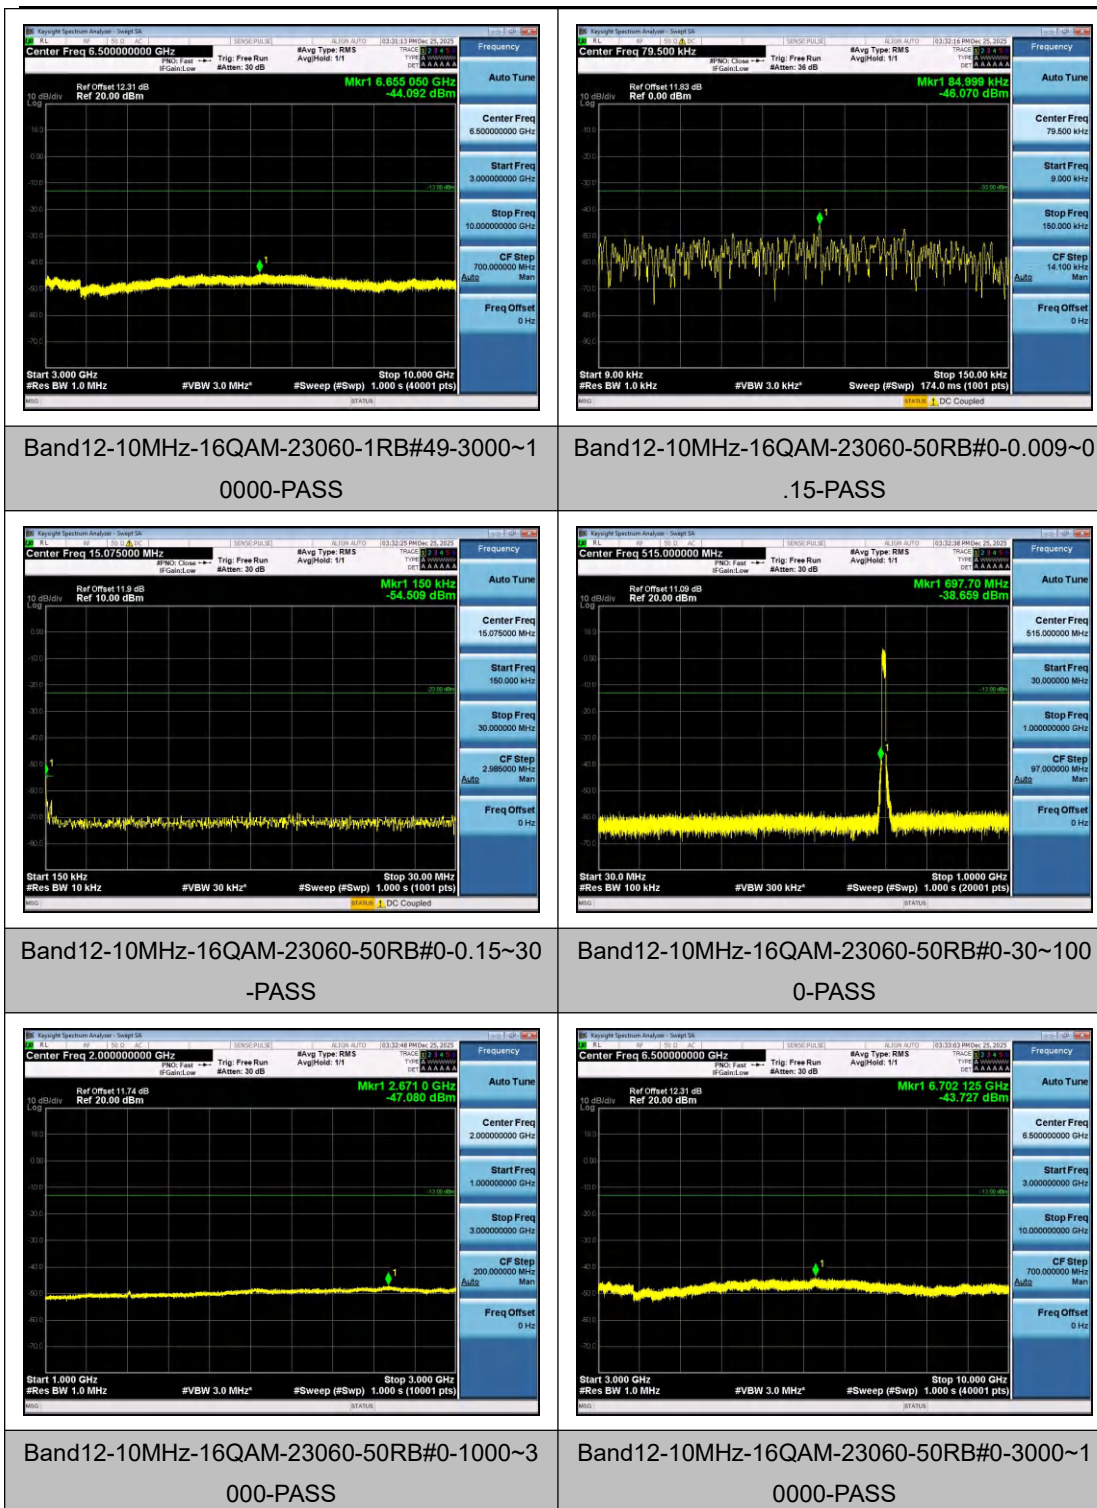


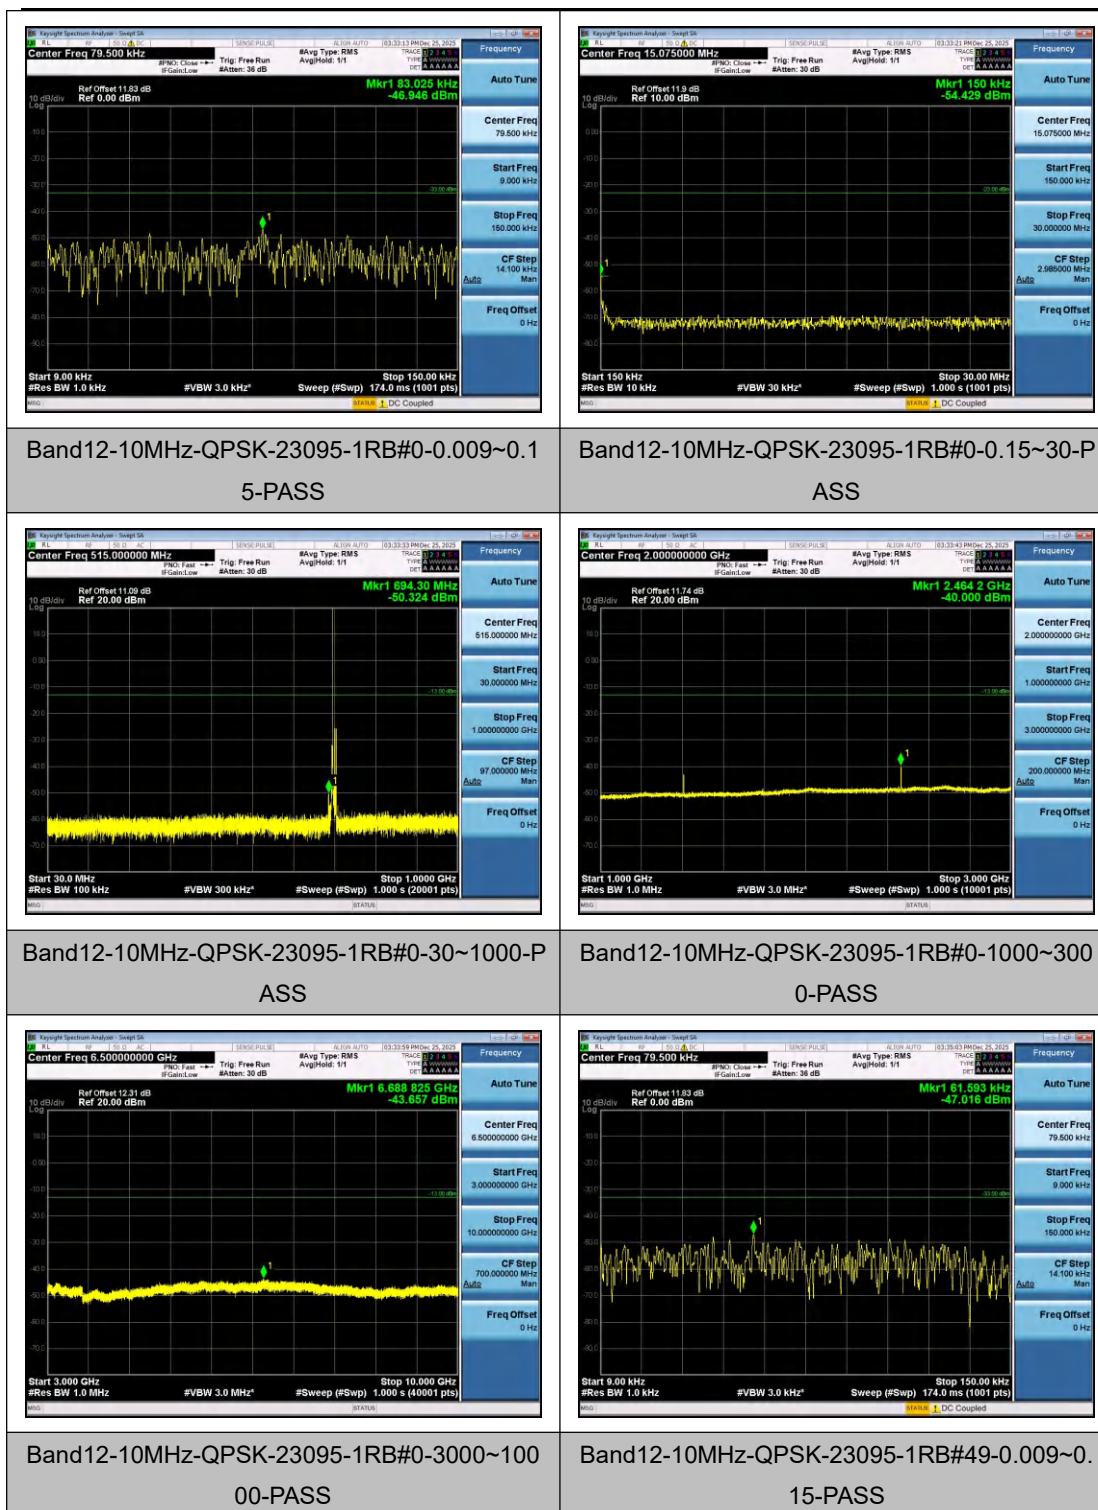


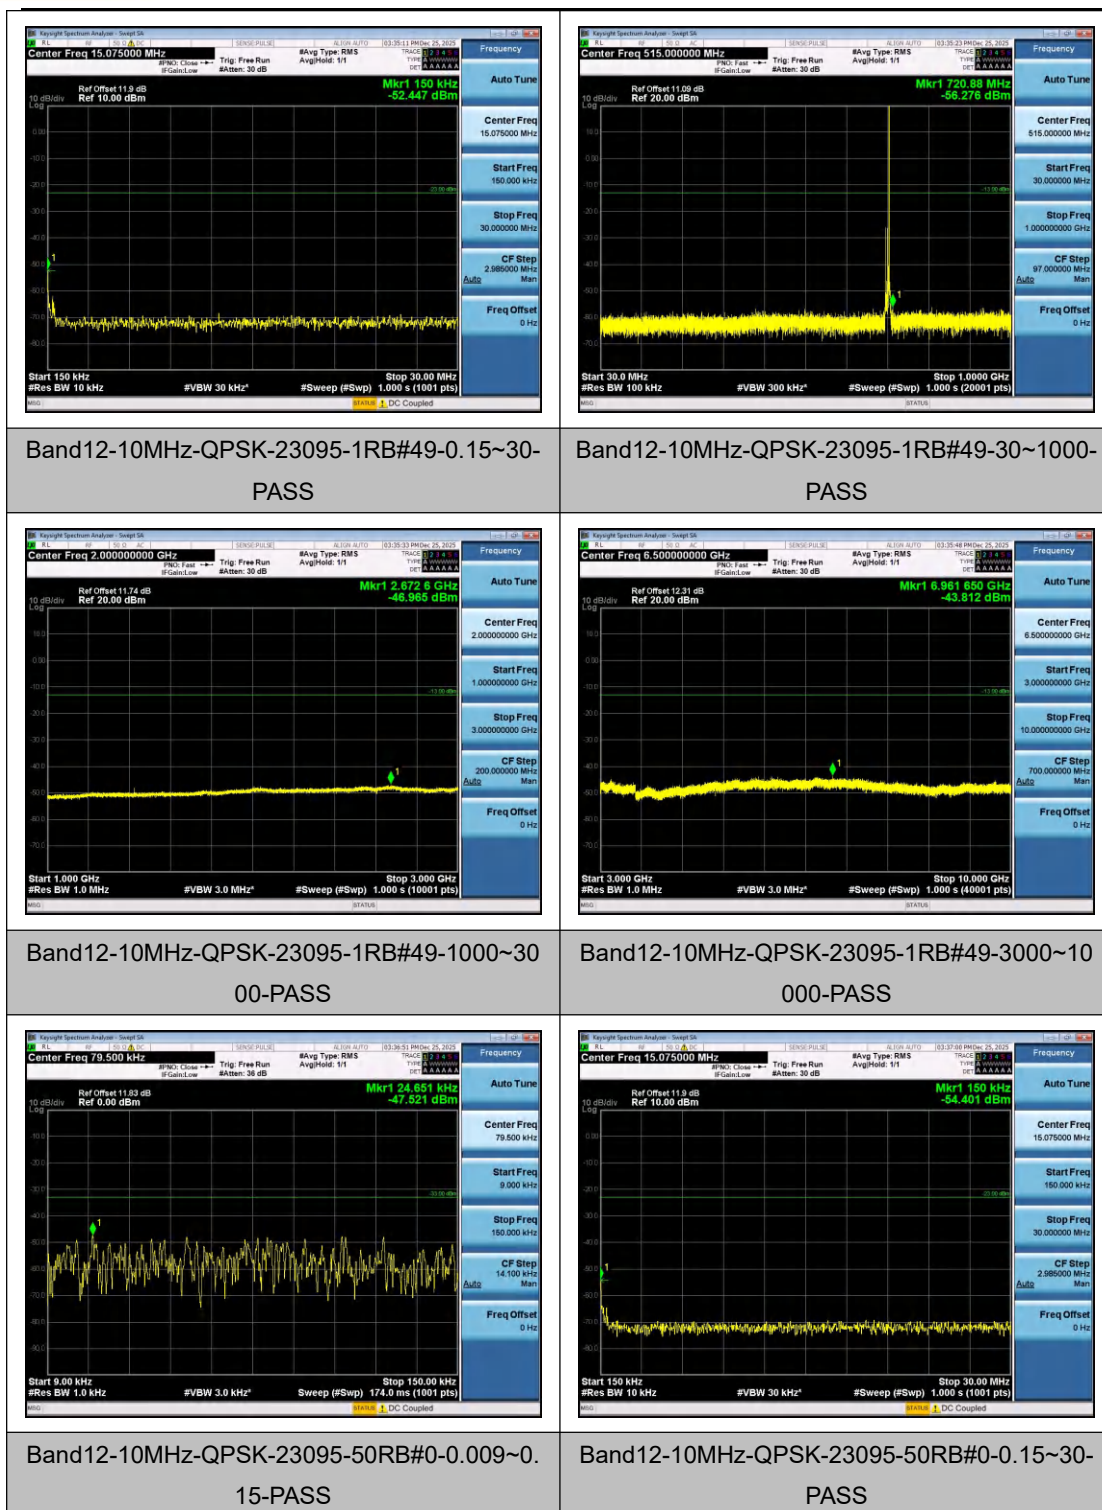





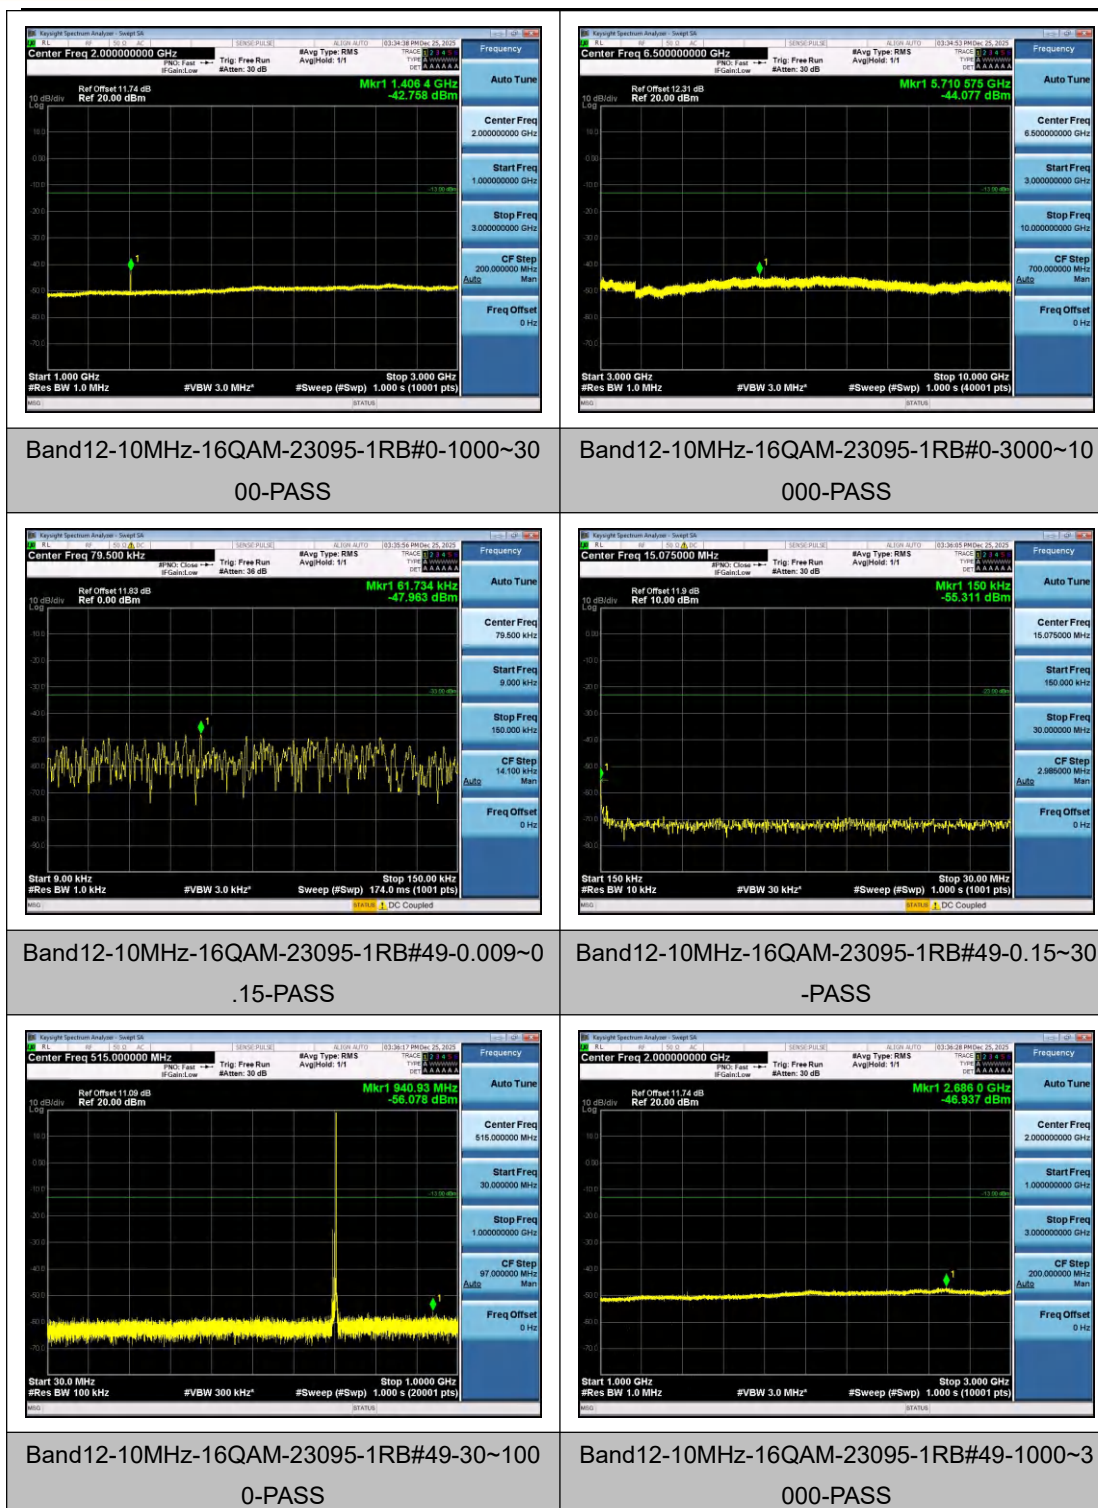


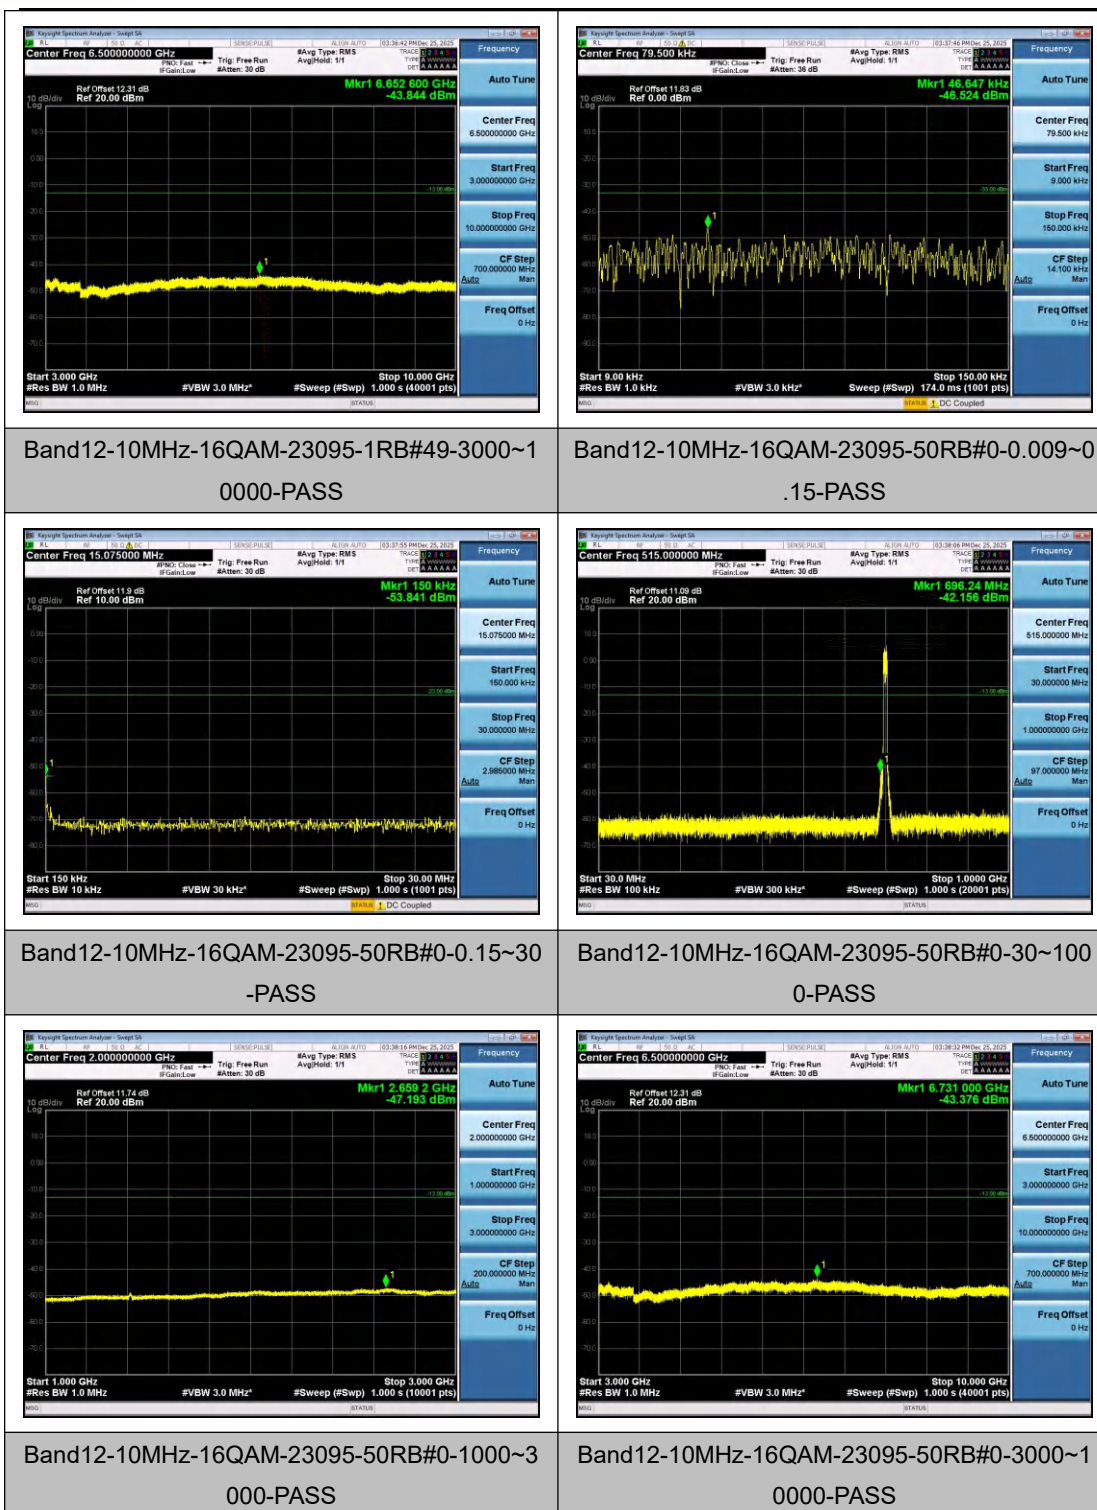


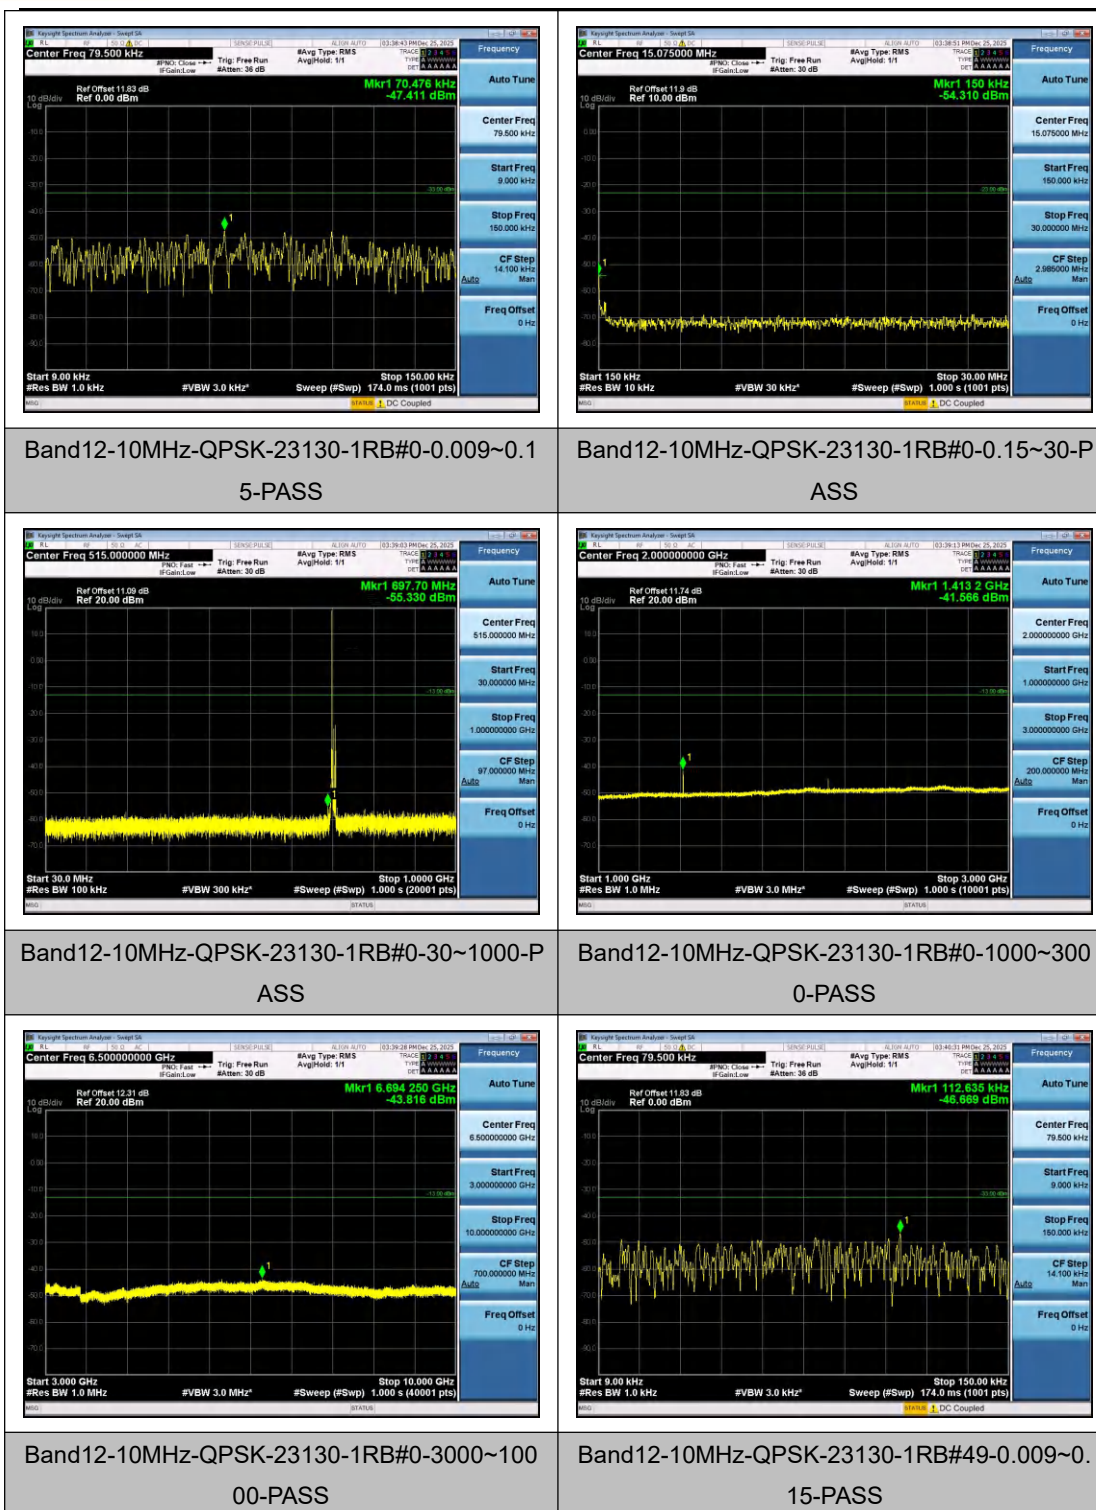

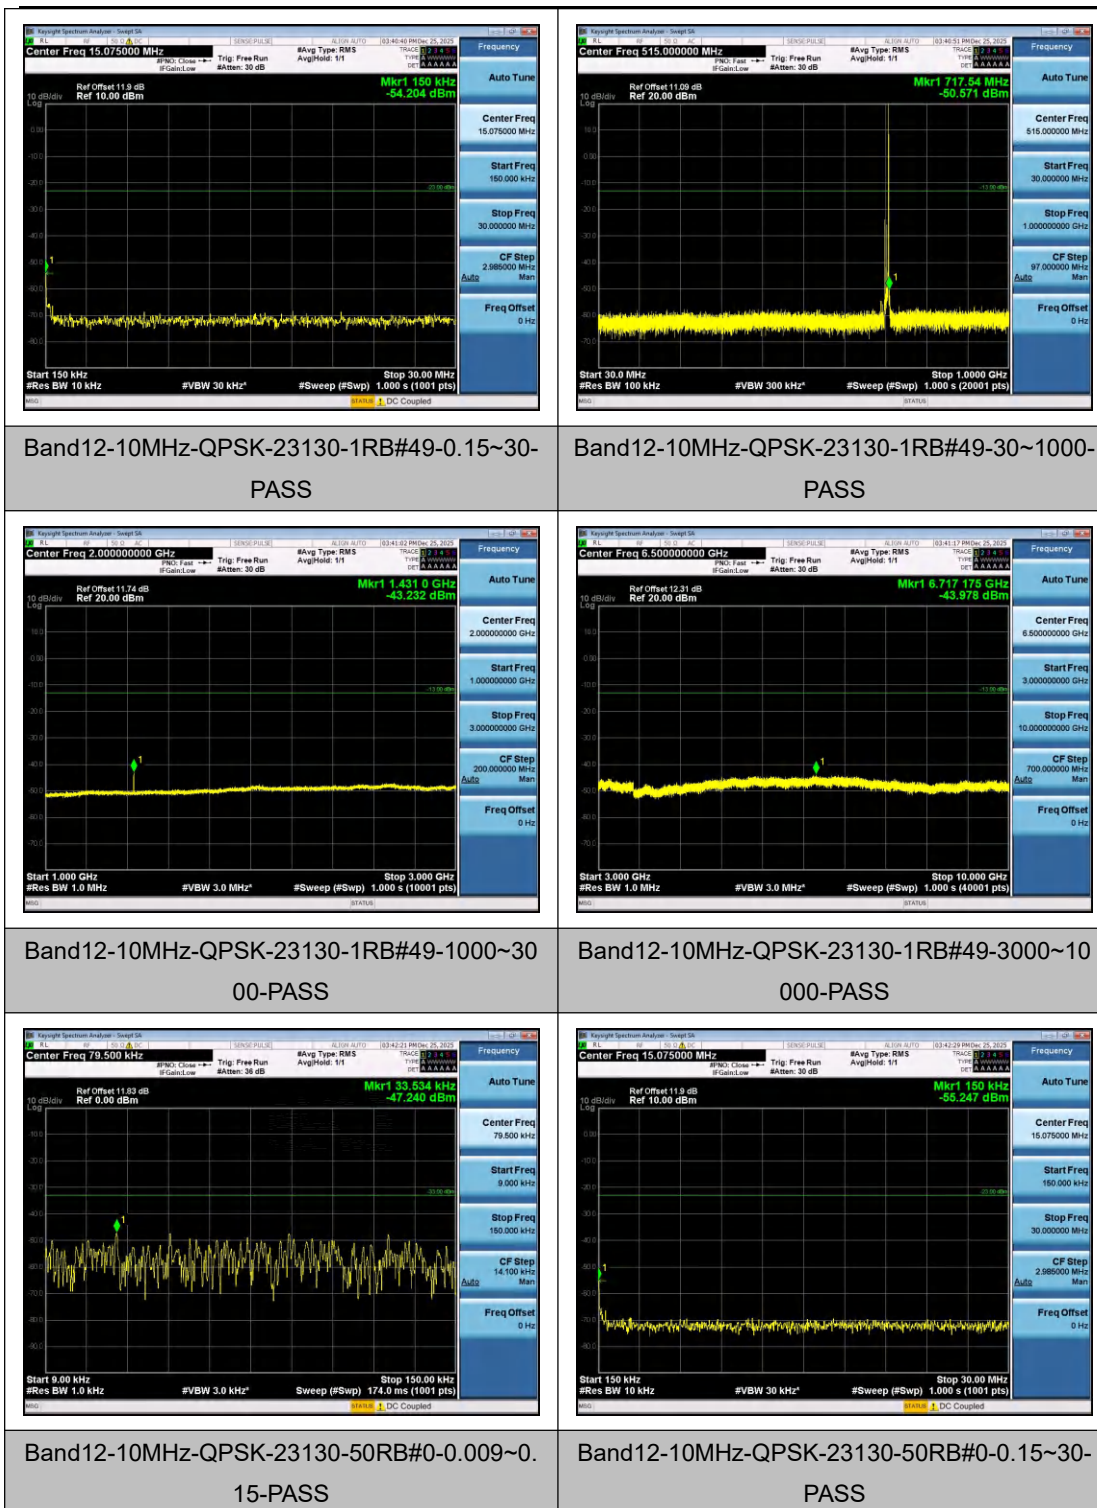

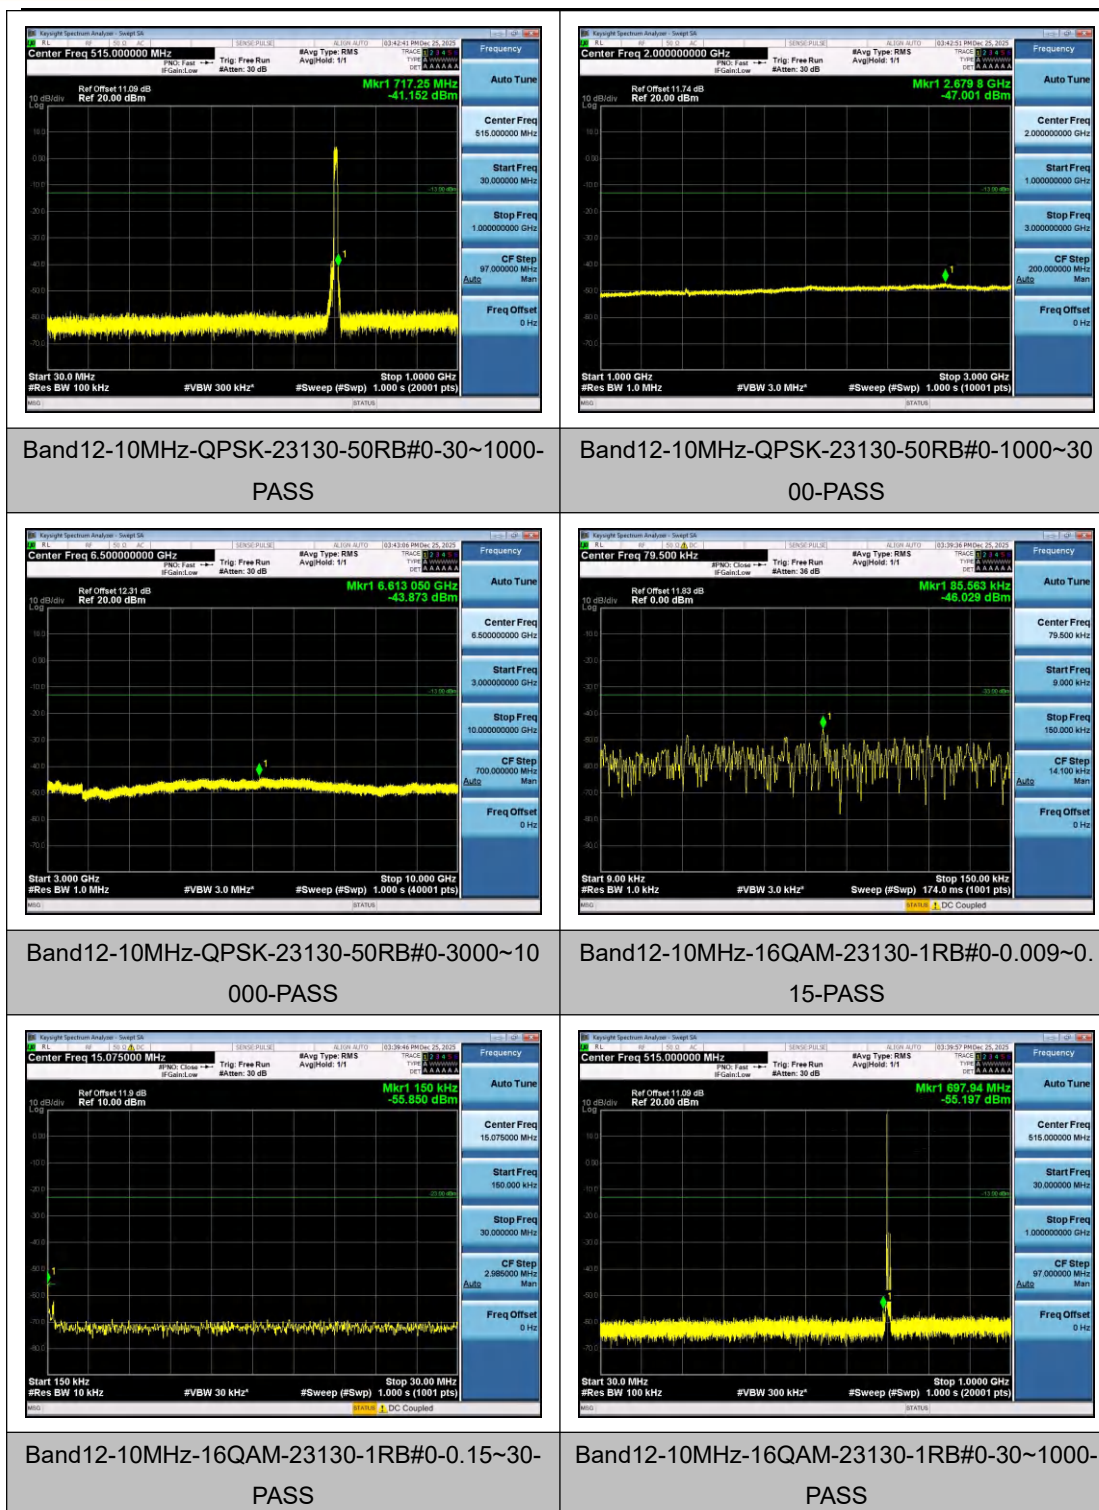

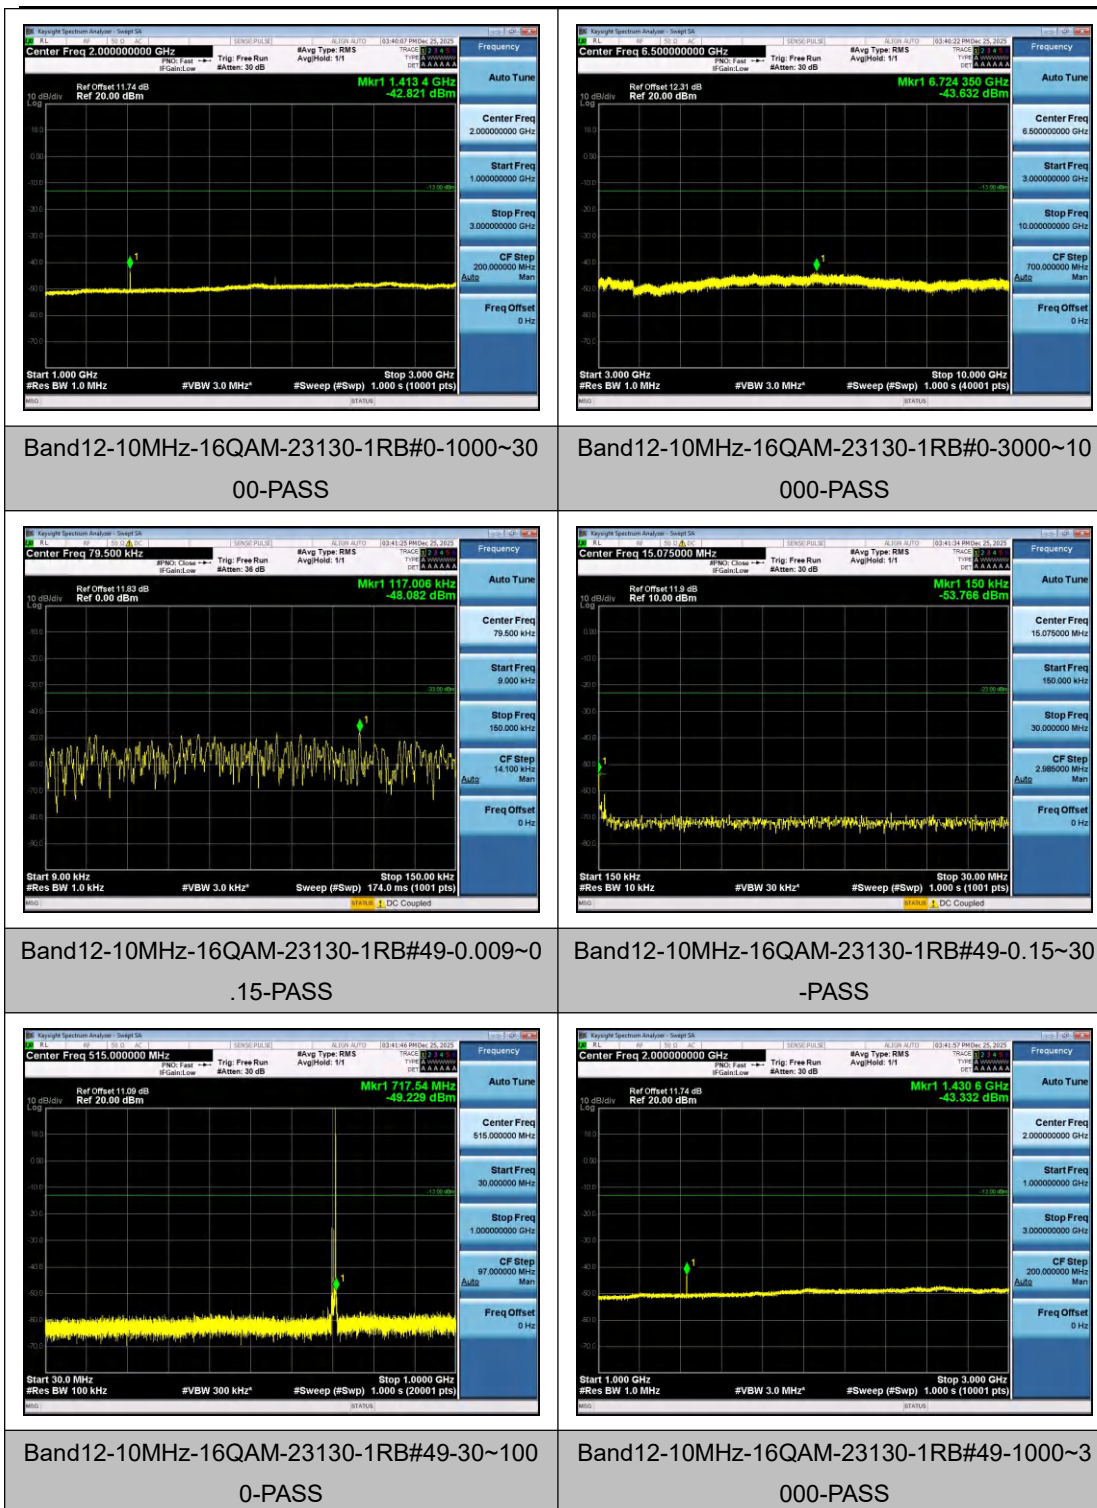

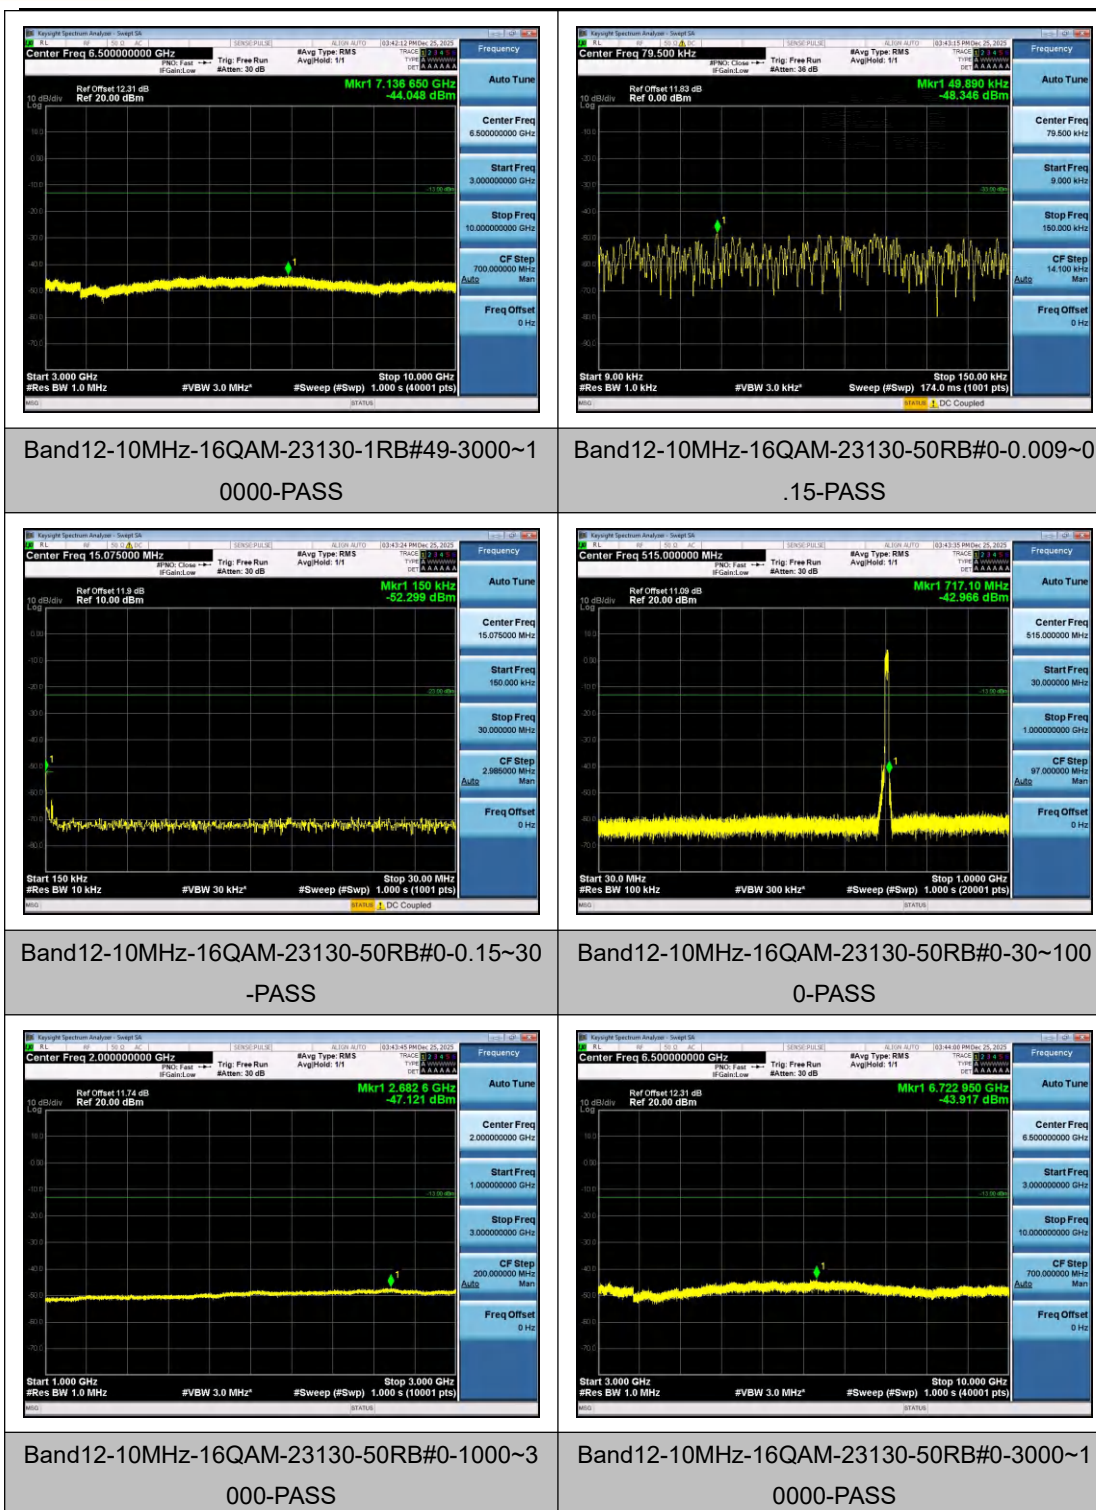

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band12	1.4MHz	QPSK	23017	6RB#0	VN	NT	699.16059	700.24079	699-716	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	VL	NT	699.15939	700.24159	699-716	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	VH	NT	699.15926	700.23826	699-716	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VN	NT	699.16079	700.23889	699-716	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VL	NT	699.16054	700.23824	699-716	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	VH	NT	699.16027	700.23937	699-716	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VN	NT	706.96105	708.03885	699-716	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VL	NT	706.95994	708.03804	699-716	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VH	NT	706.95966	708.03916	699-716	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VN	NT	706.96011	708.03911	699-716	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VL	NT	706.95728	708.03898	699-716	PASS
Band12	1.4MHz	16QAM	23095	6RB#0	VH	NT	706.95842	708.03972	699-716	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VN	NT	714.75797	715.83677	699-716	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VL	NT	714.75823	715.83643	699-716	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	VH	NT	714.75872	715.83782	699-716	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VN	NT	714.75734	715.83904	699-716	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VL	NT	714.75676	715.83816	699-716	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	VH	NT	714.75	715.83	699-716	PASS

							756	686		
Band12	3MHz	QPSK	23025	15RB#0	VN	NT	699.15 75	701.84 58	699-716	PASS
Band12	3MHz	QPSK	23025	15RB#0	VL	NT	699.15 813	701.84 043	699-716	PASS
Band12	3MHz	QPSK	23025	15RB#0	VH	NT	699.16 143	701.84 323	699-716	PASS
Band12	3MHz	16QAM	23025	15RB#0	VN	NT	699.15 603	701.83 843	699-716	PASS
Band12	3MHz	16QAM	23025	15RB#0	VL	NT	699.16 052	701.84 292	699-716	PASS
Band12	3MHz	16QAM	23025	15RB#0	VH	NT	699.15 989	701.84 309	699-716	PASS
Band12	3MHz	QPSK	23095	15RB#0	VN	NT	706.15 819	708.84 719	699-716	PASS
Band12	3MHz	QPSK	23095	15RB#0	VL	NT	706.15 585	708.84 725	699-716	PASS
Band12	3MHz	QPSK	23095	15RB#0	VH	NT	706.15 877	708.84 727	699-716	PASS
Band12	3MHz	16QAM	23095	15RB#0	VN	NT	706.15 92	708.83 99	699-716	PASS
Band12	3MHz	16QAM	23095	15RB#0	VL	NT	706.15 828	708.83 928	699-716	PASS
Band12	3MHz	16QAM	23095	15RB#0	VH	NT	706.15 795	708.83 695	699-716	PASS
Band12	3MHz	QPSK	23165	15RB#0	VN	NT	713.15 608	715.83 928	699-716	PASS
Band12	3MHz	QPSK	23165	15RB#0	VL	NT	713.15 607	715.83 727	699-716	PASS
Band12	3MHz	QPSK	23165	15RB#0	VH	NT	713.15 622	715.83 932	699-716	PASS
Band12	3MHz	16QAM	23165	15RB#0	VN	NT	713.15 589	715.83 669	699-716	PASS
Band12	3MHz	16QAM	23165	15RB#0	VL	NT	713.15 567	715.83 497	699-716	PASS
Band12	3MHz	16QAM	23165	15RB#0	VH	NT	713.15 603	715.83 683	699-716	PASS
Band12	5MHz	QPSK	23035	25RB#0	VN	NT	699.25 589	703.73 249	699-716	PASS
Band12	5MHz	QPSK	23035	25RB#0	VL	NT	699.26 328	703.73 678	699-716	PASS
Band12	5MHz	QPSK	23035	25RB#0	VH	NT	699.26	703.73	699-716	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							541	381		
Band12	5MHz	16QAM	23035	25RB#0	VN	NT	699.25 921	703.73 261	699-716	PASS
Band12	5MHz	16QAM	23035	25RB#0	VL	NT	699.26 455	703.73 135	699-716	PASS
Band12	5MHz	16QAM	23035	25RB#0	VH	NT	699.26 394	703.73 254	699-716	PASS
Band12	5MHz	QPSK	23095	25RB#0	VN	NT	705.25 989	709.73 359	699-716	PASS
Band12	5MHz	QPSK	23095	25RB#0	VL	NT	705.25 751	709.72 991	699-716	PASS
Band12	5MHz	QPSK	23095	25RB#0	VH	NT	705.25 338	709.73 588	699-716	PASS
Band12	5MHz	16QAM	23095	25RB#0	VN	NT	705.26 118	709.73 018	699-716	PASS
Band12	5MHz	16QAM	23095	25RB#0	VL	NT	705.26 007	709.73 157	699-716	PASS
Band12	5MHz	16QAM	23095	25RB#0	VH	NT	705.26 334	709.73 524	699-716	PASS
Band12	5MHz	QPSK	23155	25RB#0	VN	NT	711.26 714	715.72 934	699-716	PASS
Band12	5MHz	QPSK	23155	25RB#0	VL	NT	711.26 677	715.73 277	699-716	PASS
Band12	5MHz	QPSK	23155	25RB#0	VH	NT	711.26 794	715.73 074	699-716	PASS
Band12	5MHz	16QAM	23155	25RB#0	VN	NT	711.26 832	715.72 952	699-716	PASS
Band12	5MHz	16QAM	23155	25RB#0	VL	NT	711.26 646	715.73 406	699-716	PASS
Band12	5MHz	16QAM	23155	25RB#0	VH	NT	711.26 464	715.73 294	699-716	PASS
Band12	10MHz	QPSK	23060	50RB#0	VN	NT	699.54 039	708.44 849	699-716	PASS
Band12	10MHz	QPSK	23060	50RB#0	VL	NT	699.53 644	708.44 724	699-716	PASS
Band12	10MHz	QPSK	23060	50RB#0	VH	NT	699.54 113	708.44 813	699-716	PASS
Band12	10MHz	16QAM	23060	50RB#0	VN	NT	699.54 187	708.44 877	699-716	PASS
Band12	10MHz	16QAM	23060	50RB#0	VL	NT	699.53 962	708.45 482	699-716	PASS
Band12	10MHz	16QAM	23060	50RB#0	VH	NT	699.53	708.45	699-716	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com