




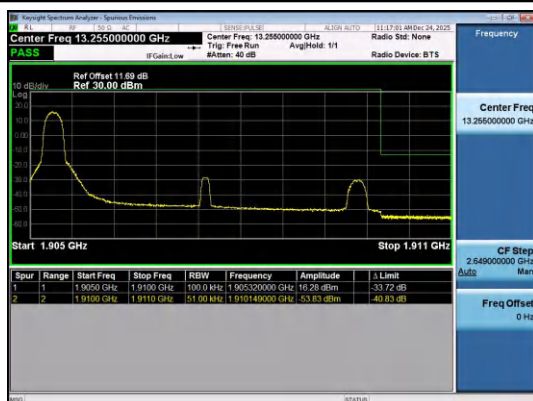


Band2-5MHz-QPSK-19175-1RB#0-PASS

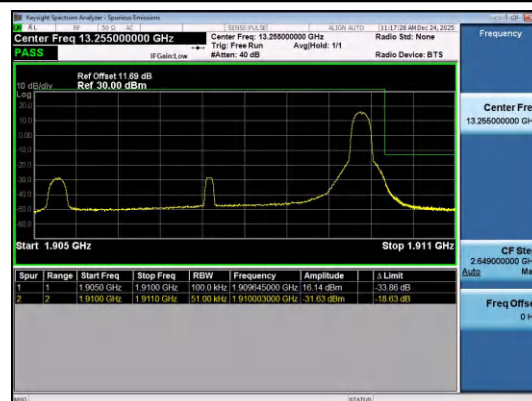


Band2-5MHz-QPSK-19175-1RB#24-PASS

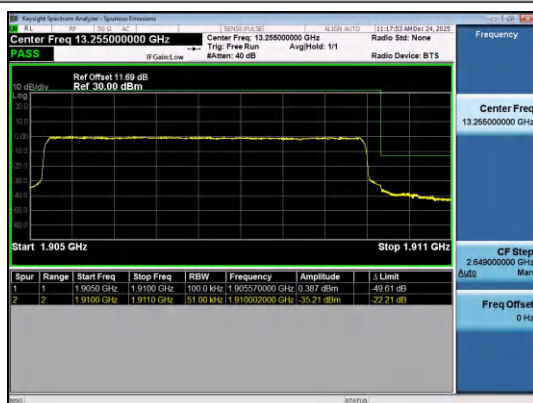


Band2-5MHz-QPSK-19175-25RB#0-PASS

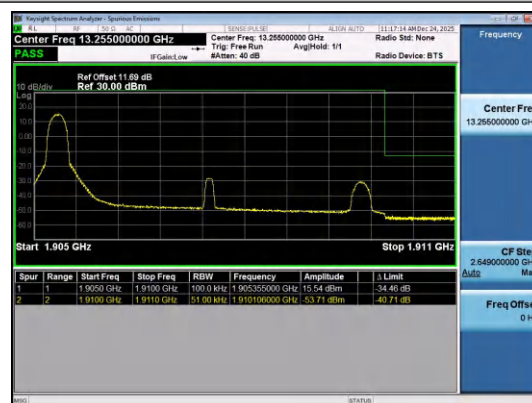


Band2-5MHz-16QAM-19175-1RB#0-PASS

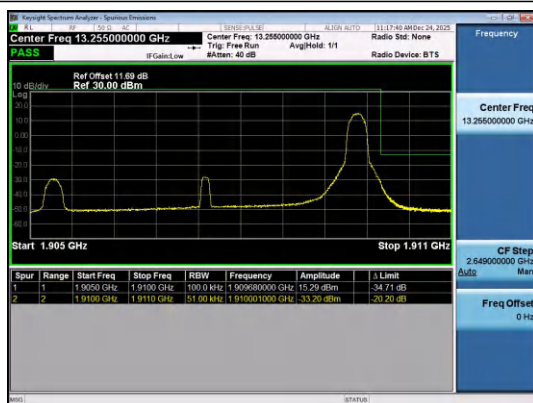


Band2-5MHz-16QAM-19175-1RB#24-PASS

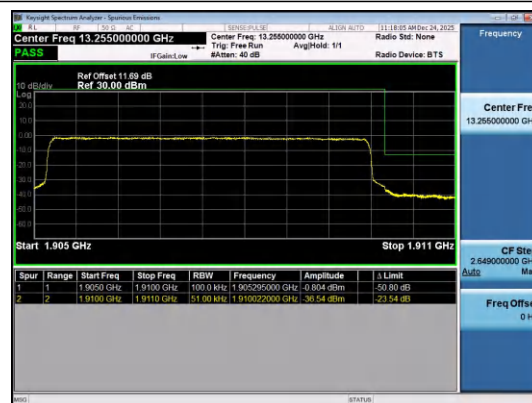


Band2-5MHz-16QAM-19175-25RB#0-PASS

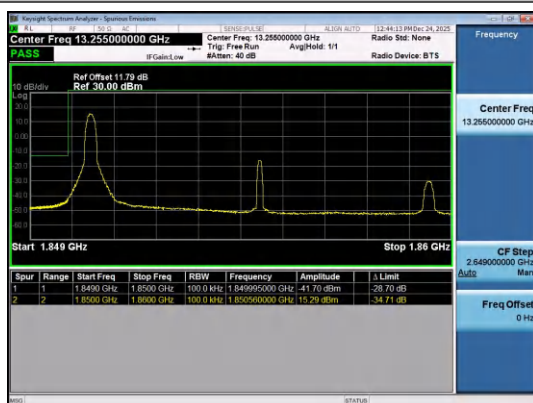


Band2-10MHz-QPSK-18650-1RB#0-PASS

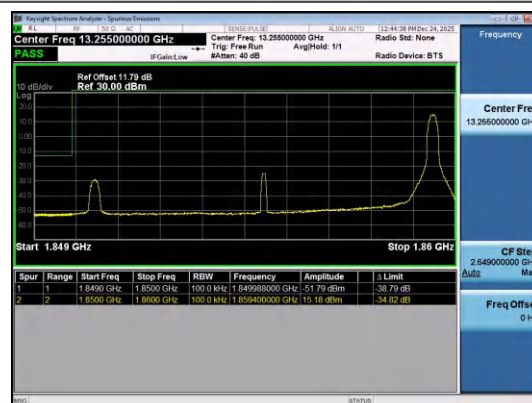


Band2-10MHz-QPSK-18650-1RB#49-PASS

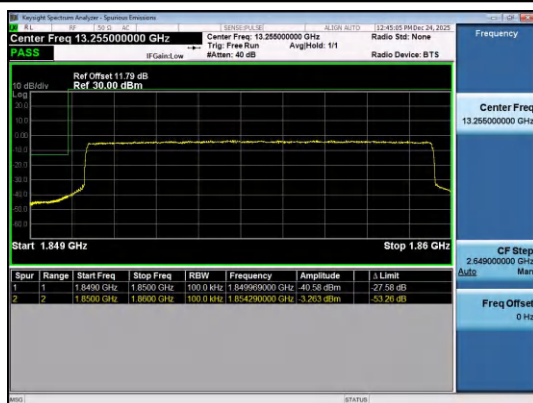


Band2-10MHz-QPSK-18650-50RB#0-PASS

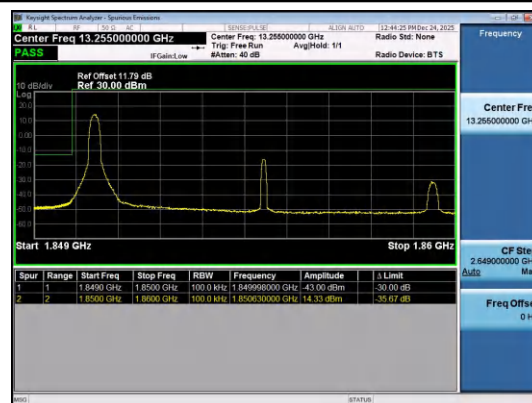


Band2-10MHz-16QAM-18650-1RB#0-PASS

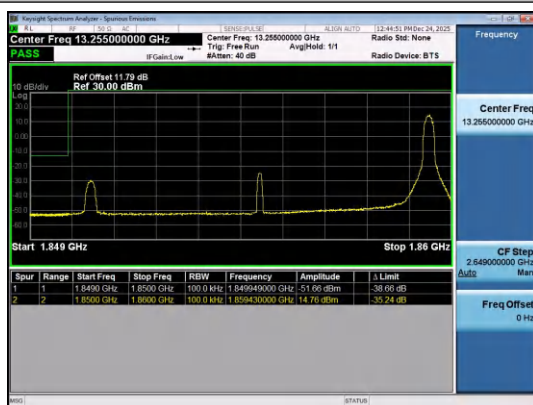


Band2-10MHz-16QAM-18650-1RB#49-PASS

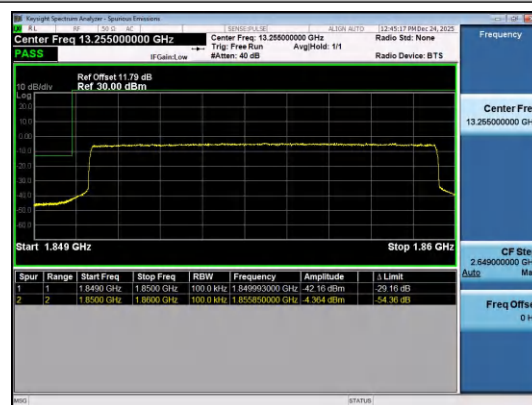


Band2-10MHz-16QAM-18650-50RB#0-PASS

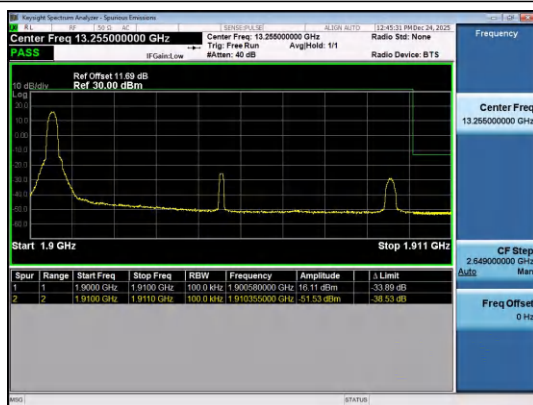


Band2-10MHz-QPSK-19150-1RB#0-PASS

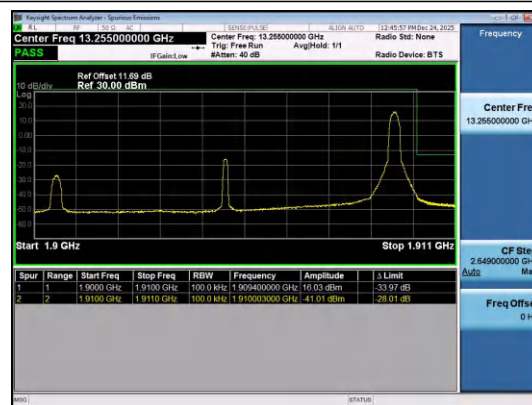


Band2-10MHz-QPSK-19150-1RB#49-PASS

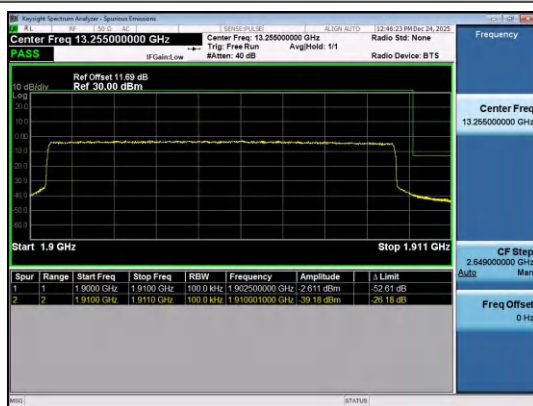


Band2-10MHz-QPSK-19150-50RB#0-PASS

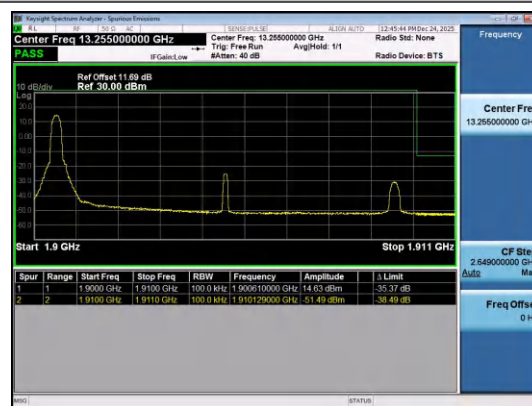


Band2-10MHz-16QAM-19150-1RB#0-PASS

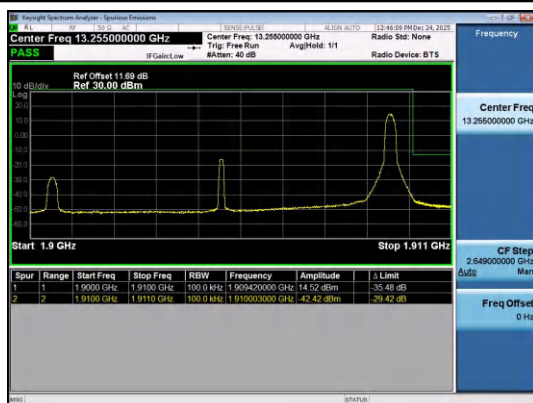


Band2-10MHz-16QAM-19150-1RB#49-PASS

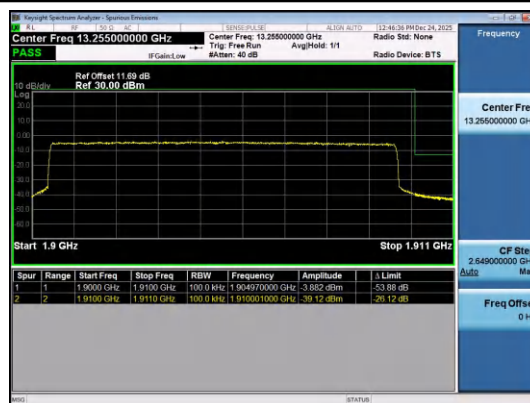


Band2-10MHz-16QAM-19150-50RB#0-PASS

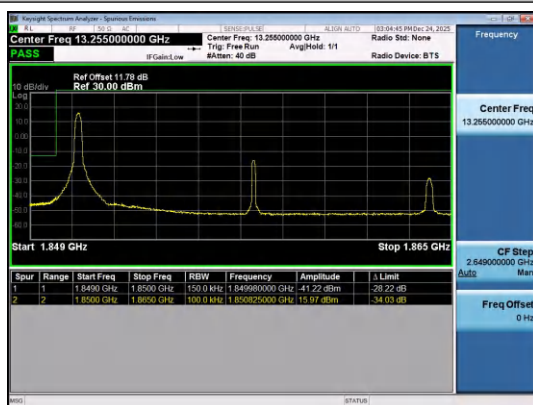


Band2-15MHz-QPSK-18675-1RB#0-PASS

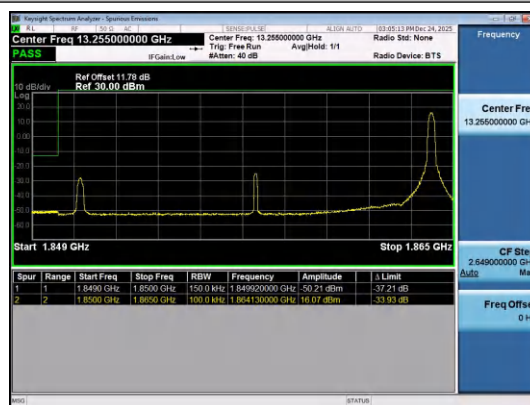


Band2-15MHz-QPSK-18675-1RB#74-PASS

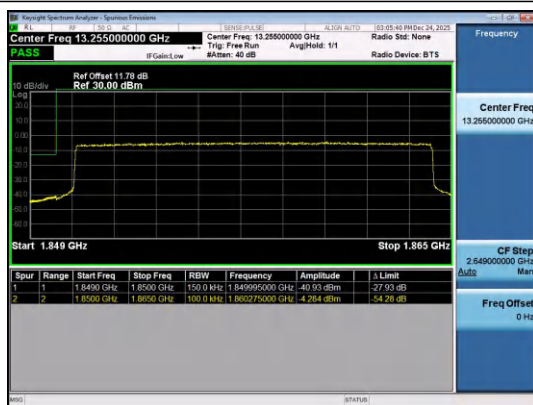


Band2-15MHz-QPSK-18675-75RB#0-PASS

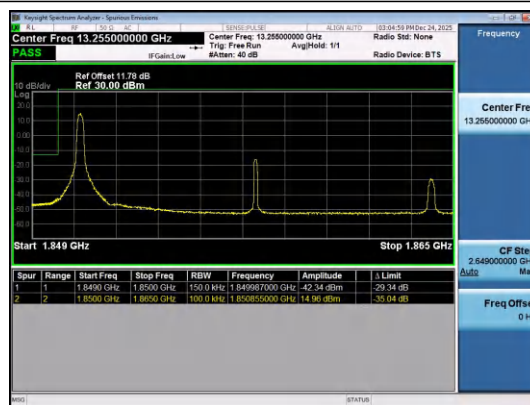

Band2-15MHz-16QAM-18675-1RB#0-PASS

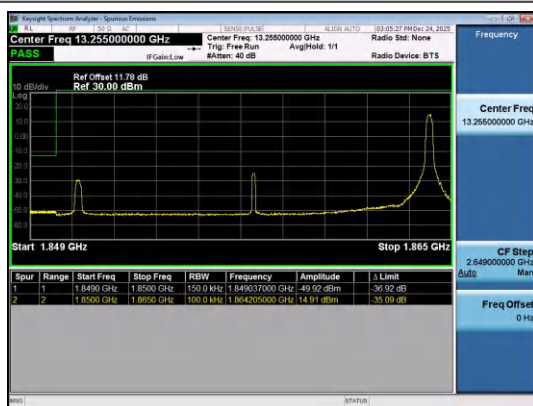


Band2-15MHz-16QAM-18675-1RB#74-PASS

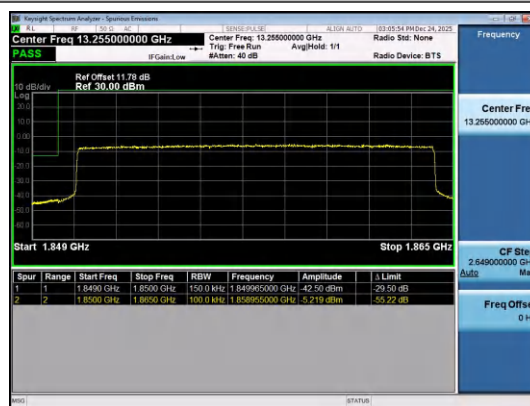

Band2-15MHz-16QAM-18675-75RB#0-PASS



Band2-15MHz-QPSK-19125-1RB#0-PASS

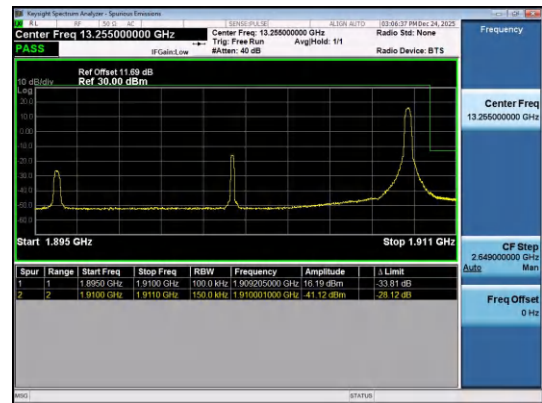


Band2-15MHz-QPSK-19125-1RB#74-PASS




Band2-15MHz-QPSK-19125-75RB#0-PASS




Band2-15MHz-16QAM-19125-1RB#0-PASS

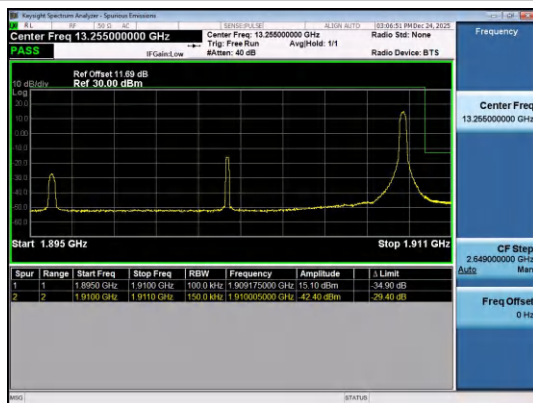


Band2-15MHz-16QAM-19125-1RB#74-PASS

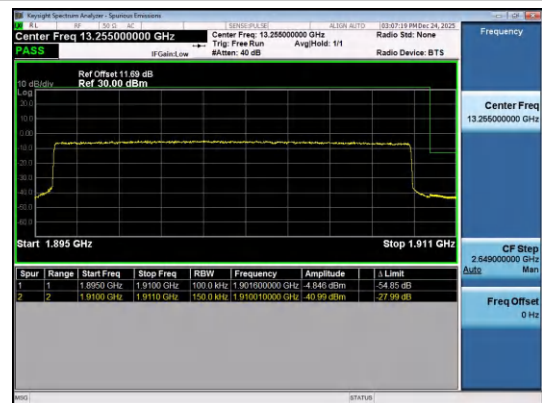


Band2-15MHz-16QAM-19125-75RB#0-PASS

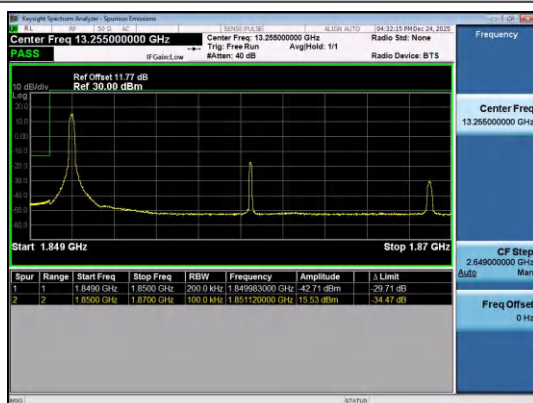


Band2-20MHz-QPSK-18700-1RB#0-PASS

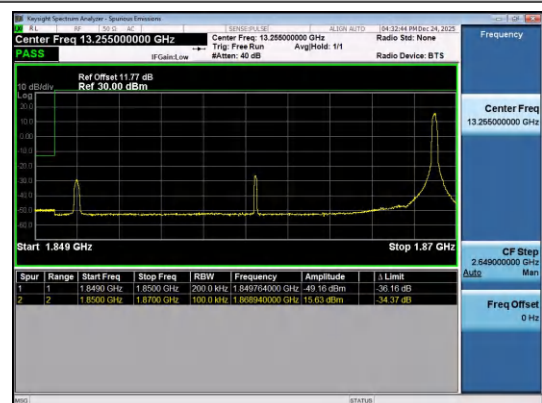

Band2-20MHz-QPSK-18700-1RB#99-PASS

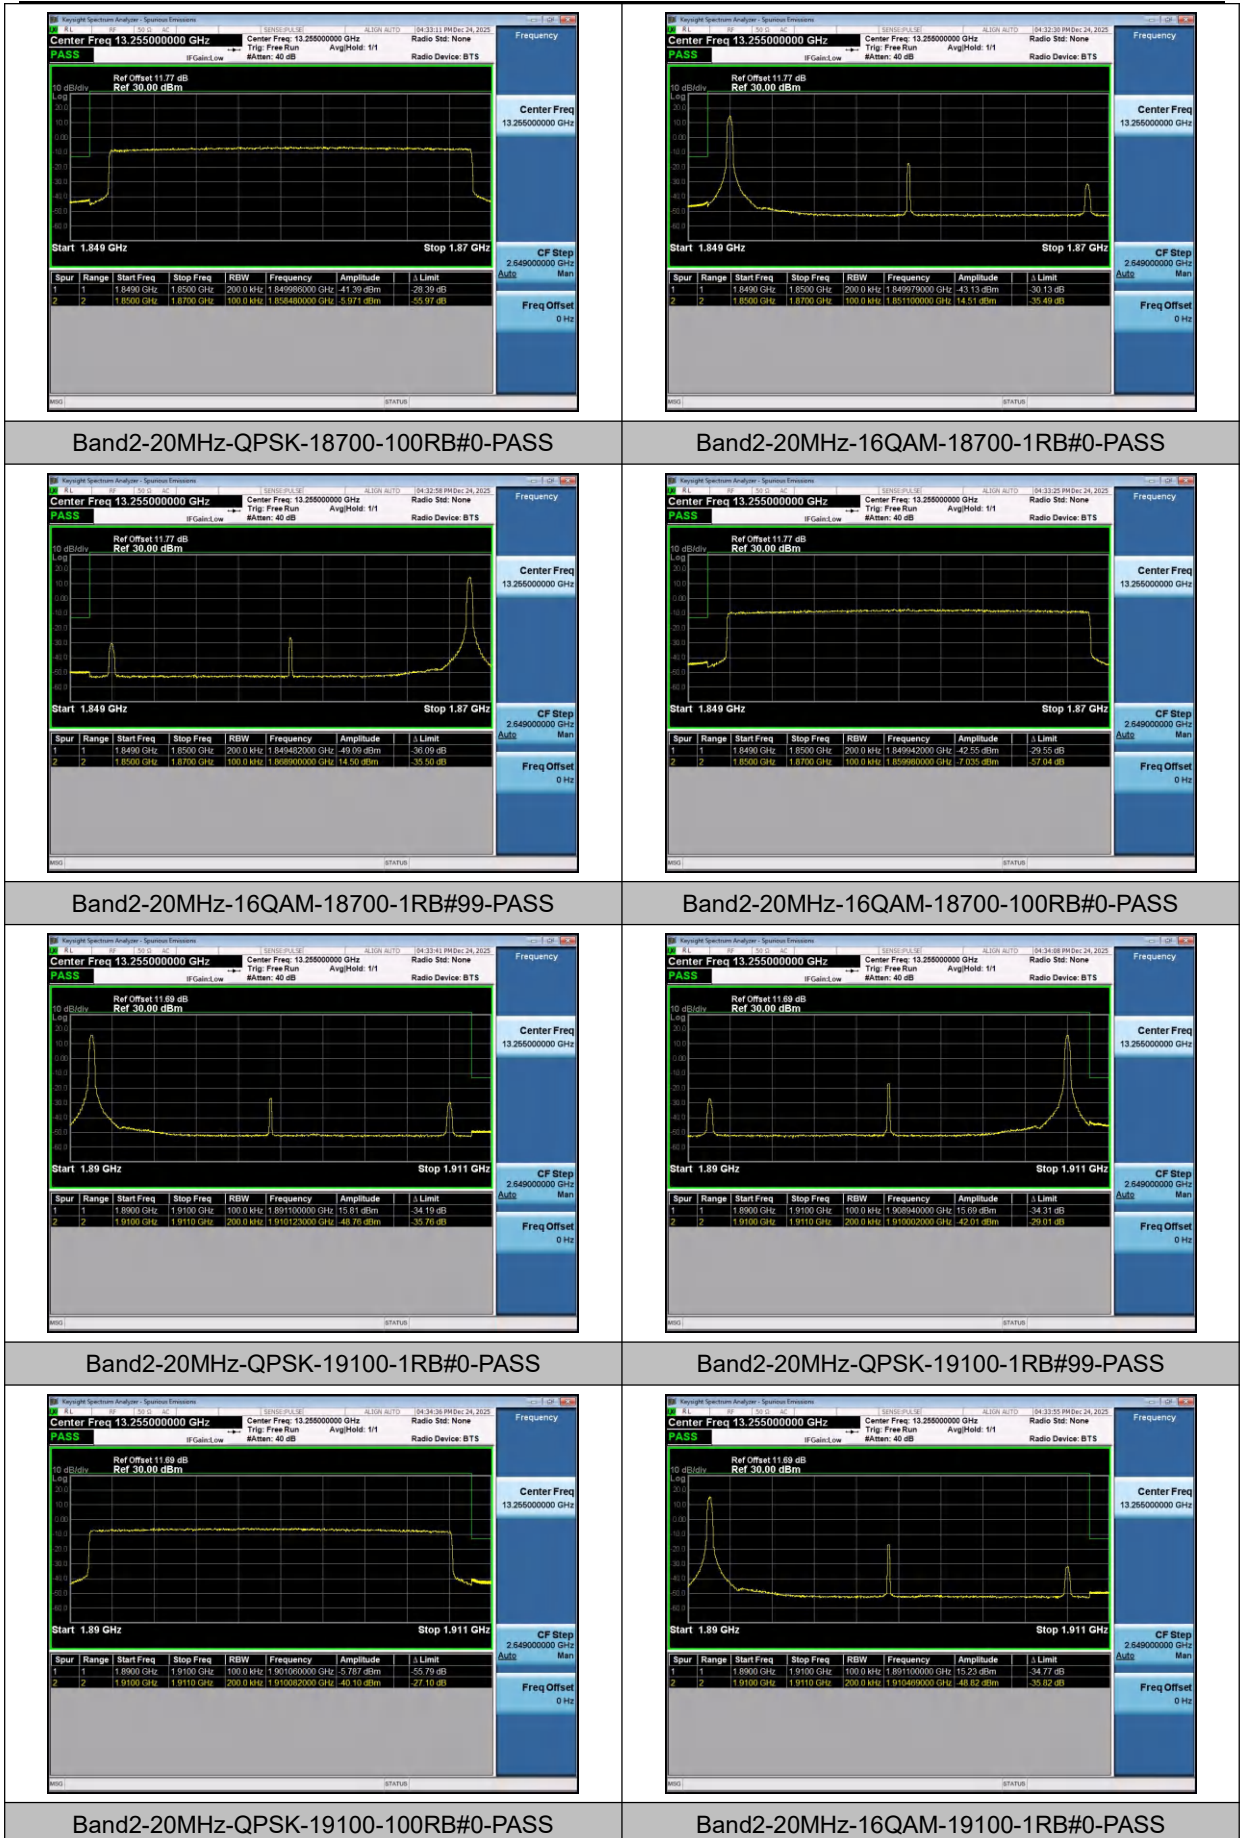

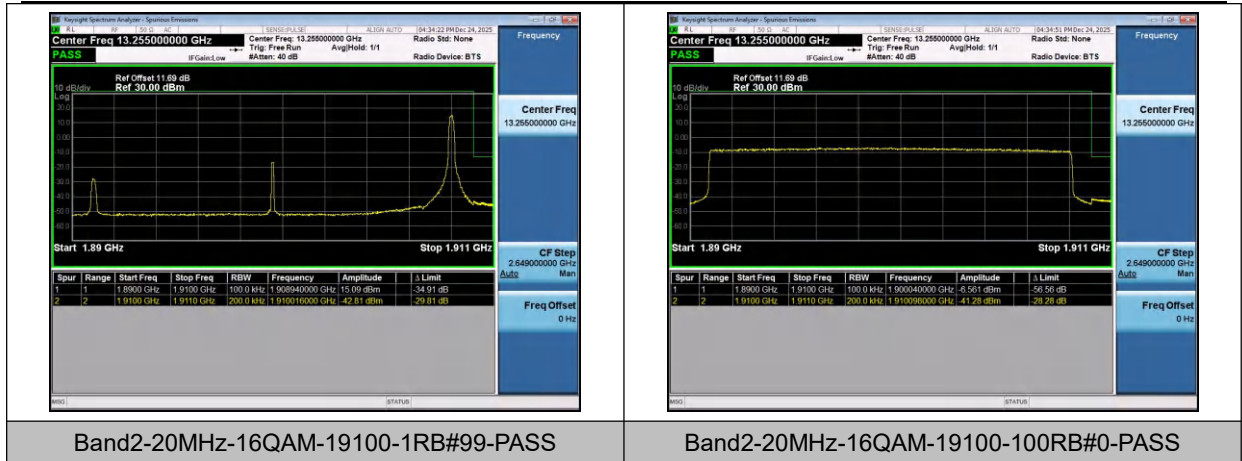

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix E: Conducted Spurious Emission

### Test Result

| Band  | Bandwidth | Modulation | Channel | RB Configuration | Frequency Range | Result (dBm) | Limit (dBm) | Verdict |
|-------|-----------|------------|---------|------------------|-----------------|--------------|-------------|---------|
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#0            | 0.009~0.15      | -46.01       | -43.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#0            | 0.15~30         | -54.59       | -33.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#0            | 30~1000         | -56.80       | -23.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#0            | 1000~3000       | -26.50       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#0            | 3000~20000      | -38.37       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#5            | 0.009~0.15      | -48.43       | -43.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#5            | 0.15~30         | -52.71       | -33.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#5            | 30~1000         | -56.60       | -23.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#5            | 1000~3000       | -38.93       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 1RB#5            | 3000~20000      | -38.35       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 6RB#0            | 0.009~0.15      | -48.02       | -43.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 6RB#0            | 0.15~30         | -54.40       | -33.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 6RB#0            | 30~1000         | -56.92       | -23.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 6RB#0            | 1000~3000       | -30.77       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18607   | 6RB#0            | 3000~20000      | -38.73       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#0            | 0.009~0.15      | -47.37       | -43.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#0            | 0.15~30         | -54.44       | -33.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#0            | 30~1000         | -56.11       | -23.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#0            | 1000~3000       | -29.74       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#0            | 3000~20000      | -38.71       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#5            | 0.009~0.15      | -48.17       | -43.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#5            | 0.15~30         | -55.78       | -33.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#5            | 30~1000         | -56.28       | -23.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#5            | 1000~3000       | -40.49       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 1RB#5            | 3000~20000      | -38.72       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 6RB#0            | 0.009~0.15      | -47.97       | -43.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 6RB#0            | 0.15~30         | -55.57       | -33.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 6RB#0            | 30~1000         | -56.24       | -23.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 6RB#0            | 1000~3000       | -32.91       | -13.0       | PASS    |
| Band2 | 1.4MHz    | 16QAM      | 18607   | 6RB#0            | 3000~20000      | -38.43       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#0            | 0.009~0.15      | -47.45       | -43.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#0            | 0.15~30         | -56.77       | -33.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#0            | 30~1000         | -56.44       | -23.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#0            | 1000~3000       | -47.04       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#0            | 3000~20000      | -38.13       | -13.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#5            | 0.009~0.15      | -46.57       | -43.0       | PASS    |
| Band2 | 1.4MHz    | QPSK       | 18900   | 1RB#5            | 0.15~30         | -55.57       | -33.0       | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |        |       |       |       |            |        |       |      |
|-------|--------|-------|-------|-------|------------|--------|-------|------|
| Band2 | 1.4MHz | QPSK  | 18900 | 1RB#5 | 30~1000    | -56.42 | -23.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 1RB#5 | 1000~3000  | -47.10 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 1RB#5 | 3000~20000 | -38.58 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 6RB#0 | 0.009~0.15 | -47.45 | -43.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 6RB#0 | 0.15~30    | -55.46 | -33.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 6RB#0 | 30~1000    | -56.79 | -23.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 6RB#0 | 1000~3000  | -47.10 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 18900 | 6RB#0 | 3000~20000 | -38.54 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 0.009~0.15 | -48.76 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 0.15~30    | -53.83 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 30~1000    | -56.08 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 1000~3000  | -47.06 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#0 | 3000~20000 | -38.48 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 0.009~0.15 | -47.58 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 0.15~30    | -55.07 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 30~1000    | -56.04 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 1000~3000  | -47.11 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 1RB#5 | 3000~20000 | -38.66 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 0.009~0.15 | -48.53 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 0.15~30    | -55.94 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 30~1000    | -56.73 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 1000~3000  | -47.09 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 18900 | 6RB#0 | 3000~20000 | -37.57 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#0 | 0.009~0.15 | -45.71 | -43.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#0 | 0.15~30    | -57.59 | -33.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#0 | 30~1000    | -56.67 | -23.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#0 | 1000~3000  | -36.25 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#0 | 3000~20000 | -38.23 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#5 | 0.009~0.15 | -46.43 | -43.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#5 | 0.15~30    | -54.31 | -33.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#5 | 30~1000    | -56.75 | -23.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#5 | 1000~3000  | -27.54 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 1RB#5 | 3000~20000 | -38.88 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 6RB#0 | 0.009~0.15 | -47.40 | -43.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 6RB#0 | 0.15~30    | -55.76 | -33.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 6RB#0 | 30~1000    | -56.67 | -23.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 6RB#0 | 1000~3000  | -30.17 | -13.0 | PASS |
| Band2 | 1.4MHz | QPSK  | 19193 | 6RB#0 | 3000~20000 | -38.50 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 0.009~0.15 | -47.15 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 0.15~30    | -54.01 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 30~1000    | -56.47 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0 | 1000~3000  | -36.66 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |        |       |       |        |            |        |       |      |
|-------|--------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#0  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5  | 0.009~0.15 | -48.70 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5  | 0.15~30    | -54.99 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5  | 30~1000    | -56.24 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5  | 1000~3000  | -27.80 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 1RB#5  | 3000~20000 | -38.54 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0  | 0.009~0.15 | -48.21 | -43.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0  | 0.15~30    | -55.37 | -33.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0  | 30~1000    | -56.79 | -23.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0  | 1000~3000  | -32.86 | -13.0 | PASS |
| Band2 | 1.4MHz | 16QAM | 19193 | 6RB#0  | 3000~20000 | -38.73 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#0  | 0.009~0.15 | -46.88 | -43.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#0  | 0.15~30    | -54.81 | -33.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#0  | 30~1000    | -56.50 | -23.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#0  | 1000~3000  | -27.03 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#0  | 3000~20000 | -38.28 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#14 | 0.009~0.15 | -48.51 | -43.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#14 | 0.15~30    | -54.45 | -33.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#14 | 30~1000    | -56.84 | -23.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#14 | 1000~3000  | -37.23 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 1RB#14 | 3000~20000 | -38.59 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 15RB#0 | 0.009~0.15 | -48.17 | -43.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 15RB#0 | 0.15~30    | -54.09 | -33.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 15RB#0 | 30~1000    | -56.70 | -23.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 15RB#0 | 1000~3000  | -31.03 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18615 | 15RB#0 | 3000~20000 | -38.83 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#0  | 0.009~0.15 | -47.65 | -43.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#0  | 0.15~30    | -54.88 | -33.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#0  | 30~1000    | -56.52 | -23.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#0  | 1000~3000  | -29.22 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#0  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#14 | 0.009~0.15 | -46.98 | -43.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#14 | 0.15~30    | -54.06 | -33.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#14 | 30~1000    | -56.47 | -23.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#14 | 1000~3000  | -39.18 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 1RB#14 | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 15RB#0 | 0.009~0.15 | -48.17 | -43.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 15RB#0 | 0.15~30    | -53.96 | -33.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 15RB#0 | 30~1000    | -56.91 | -23.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 15RB#0 | 1000~3000  | -30.63 | -13.0 | PASS |
| Band2 | 3MHz   | 16QAM | 18615 | 15RB#0 | 3000~20000 | -38.29 | -13.0 | PASS |
| Band2 | 3MHz   | QPSK  | 18900 | 1RB#0  | 0.009~0.15 | -48.43 | -43.0 | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |      |       |       |        |            |        |       |      |
|-------|------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 3MHz | QPSK  | 18900 | 1RB#0  | 0.15~30    | -56.00 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#0  | 30~1000    | -56.61 | -23.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#0  | 1000~3000  | -46.82 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#0  | 3000~20000 | -38.81 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#14 | 0.009~0.15 | -48.10 | -43.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#14 | 0.15~30    | -56.47 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#14 | 30~1000    | -56.72 | -23.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#14 | 1000~3000  | -45.56 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 1RB#14 | 3000~20000 | -38.25 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 15RB#0 | 0.009~0.15 | -47.90 | -43.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 15RB#0 | 0.15~30    | -53.19 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 15RB#0 | 30~1000    | -56.37 | -23.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 15RB#0 | 1000~3000  | -46.88 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 18900 | 15RB#0 | 3000~20000 | -38.62 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0  | 0.009~0.15 | -48.04 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0  | 0.15~30    | -53.48 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0  | 30~1000    | -56.40 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0  | 1000~3000  | -45.57 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#0  | 3000~20000 | -38.24 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 0.009~0.15 | -49.27 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 0.15~30    | -56.11 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 30~1000    | -56.56 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 1000~3000  | -47.20 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 1RB#14 | 3000~20000 | -38.21 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 0.009~0.15 | -47.14 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 0.15~30    | -52.66 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 30~1000    | -56.39 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 1000~3000  | -47.10 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 18900 | 15RB#0 | 3000~20000 | -38.64 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#0  | 0.009~0.15 | -46.78 | -43.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#0  | 0.15~30    | -53.13 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#0  | 30~1000    | -56.67 | -23.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#0  | 1000~3000  | -27.64 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#0  | 3000~20000 | -38.50 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#14 | 0.009~0.15 | -48.56 | -43.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#14 | 0.15~30    | -53.56 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#14 | 30~1000    | -56.31 | -23.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#14 | 1000~3000  | -26.42 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 1RB#14 | 3000~20000 | -38.78 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 15RB#0 | 0.009~0.15 | -46.62 | -43.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 15RB#0 | 0.15~30    | -54.23 | -33.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 15RB#0 | 30~1000    | -56.60 | -23.0 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |      |       |       |        |            |        |       |      |
|-------|------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 3MHz | QPSK  | 19185 | 15RB#0 | 1000~3000  | -27.73 | -13.0 | PASS |
| Band2 | 3MHz | QPSK  | 19185 | 15RB#0 | 3000~20000 | -38.43 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0  | 0.009~0.15 | -47.20 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0  | 0.15~30    | -57.15 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0  | 30~1000    | -56.79 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0  | 1000~3000  | -26.30 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#0  | 3000~20000 | -38.77 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 0.009~0.15 | -45.65 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 0.15~30    | -55.91 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 30~1000    | -56.08 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 1000~3000  | -29.57 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 1RB#14 | 3000~20000 | -38.51 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 0.009~0.15 | -48.11 | -43.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 0.15~30    | -53.42 | -33.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 30~1000    | -56.32 | -23.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 1000~3000  | -28.16 | -13.0 | PASS |
| Band2 | 3MHz | 16QAM | 19185 | 15RB#0 | 3000~20000 | -38.61 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#0  | 0.009~0.15 | -47.69 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#0  | 0.15~30    | -54.63 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#0  | 30~1000    | -56.54 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#0  | 1000~3000  | -33.51 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#0  | 3000~20000 | -38.45 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#24 | 0.009~0.15 | -48.67 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#24 | 0.15~30    | -56.85 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#24 | 30~1000    | -56.55 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#24 | 1000~3000  | -40.82 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 1RB#24 | 3000~20000 | -38.71 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 25RB#0 | 0.009~0.15 | -46.87 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 25RB#0 | 0.15~30    | -54.03 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 25RB#0 | 30~1000    | -56.28 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 25RB#0 | 1000~3000  | -32.55 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18625 | 25RB#0 | 3000~20000 | -38.51 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0  | 0.009~0.15 | -47.09 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0  | 0.15~30    | -53.14 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0  | 30~1000    | -56.97 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0  | 1000~3000  | -34.57 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#0  | 3000~20000 | -38.56 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 0.009~0.15 | -48.02 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 0.15~30    | -55.19 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 30~1000    | -56.31 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 1000~3000  | -39.94 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 1RB#24 | 3000~20000 | -38.45 | -13.0 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |      |       |       |        |            |        |       |      |
|-------|------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 0.009~0.15 | -47.51 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 0.15~30    | -54.30 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 30~1000    | -56.34 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 1000~3000  | -32.56 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18625 | 25RB#0 | 3000~20000 | -38.61 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#0  | 0.009~0.15 | -48.34 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#0  | 0.15~30    | -53.68 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#0  | 30~1000    | -56.63 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#0  | 1000~3000  | -46.98 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#0  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#24 | 0.009~0.15 | -46.57 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#24 | 0.15~30    | -56.38 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#24 | 30~1000    | -56.27 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#24 | 1000~3000  | -47.00 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 1RB#24 | 3000~20000 | -38.54 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 25RB#0 | 0.009~0.15 | -46.06 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 25RB#0 | 0.15~30    | -55.13 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 25RB#0 | 30~1000    | -56.86 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 25RB#0 | 1000~3000  | -46.99 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 18900 | 25RB#0 | 3000~20000 | -38.56 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0  | 0.009~0.15 | -47.76 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0  | 0.15~30    | -54.09 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0  | 30~1000    | -56.48 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0  | 1000~3000  | -47.14 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#0  | 3000~20000 | -38.51 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 0.009~0.15 | -47.78 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 0.15~30    | -54.09 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 30~1000    | -56.10 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 1000~3000  | -47.09 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 1RB#24 | 3000~20000 | -38.18 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 0.009~0.15 | -45.68 | -43.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 0.15~30    | -55.81 | -33.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 30~1000    | -57.03 | -23.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 1000~3000  | -47.18 | -13.0 | PASS |
| Band2 | 5MHz | 16QAM | 18900 | 25RB#0 | 3000~20000 | -38.18 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#0  | 0.009~0.15 | -47.43 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#0  | 0.15~30    | -52.73 | -33.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#0  | 30~1000    | -55.44 | -23.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#0  | 1000~3000  | -46.98 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#0  | 3000~20000 | -38.77 | -13.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#24 | 0.009~0.15 | -47.79 | -43.0 | PASS |
| Band2 | 5MHz | QPSK  | 19175 | 1RB#24 | 0.15~30    | -55.76 | -33.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |            |        |       |      |
|-------|-------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 5MHz  | QPSK  | 19175 | 1RB#24 | 30~1000    | -55.61 | -23.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 1RB#24 | 1000~3000  | -31.14 | -13.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 1RB#24 | 3000~20000 | -38.32 | -13.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 25RB#0 | 0.009~0.15 | -48.65 | -43.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 25RB#0 | 0.15~30    | -54.10 | -33.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 25RB#0 | 30~1000    | -56.57 | -23.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 25RB#0 | 1000~3000  | -28.12 | -13.0 | PASS |
| Band2 | 5MHz  | QPSK  | 19175 | 25RB#0 | 3000~20000 | -38.74 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#0  | 0.009~0.15 | -46.74 | -43.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#0  | 0.15~30    | -54.12 | -33.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#0  | 30~1000    | -56.62 | -23.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#0  | 1000~3000  | -28.83 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#0  | 3000~20000 | -38.55 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#24 | 0.009~0.15 | -47.89 | -43.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#24 | 0.15~30    | -53.55 | -33.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#24 | 30~1000    | -56.46 | -23.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#24 | 1000~3000  | -34.37 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 1RB#24 | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 25RB#0 | 0.009~0.15 | -46.70 | -43.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 25RB#0 | 0.15~30    | -54.62 | -33.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 25RB#0 | 30~1000    | -56.90 | -23.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 25RB#0 | 1000~3000  | -28.73 | -13.0 | PASS |
| Band2 | 5MHz  | 16QAM | 19175 | 25RB#0 | 3000~20000 | -38.48 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#0  | 0.009~0.15 | -47.19 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#0  | 0.15~30    | -53.45 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#0  | 30~1000    | -56.83 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#0  | 1000~3000  | -38.61 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#0  | 3000~20000 | -38.09 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#49 | 0.009~0.15 | -46.56 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#49 | 0.15~30    | -53.70 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#49 | 30~1000    | -56.54 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#49 | 1000~3000  | -38.61 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 1RB#49 | 3000~20000 | -38.23 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 50RB#0 | 0.009~0.15 | -48.29 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 50RB#0 | 0.15~30    | -53.11 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 50RB#0 | 30~1000    | -56.70 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 50RB#0 | 1000~3000  | -34.24 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18650 | 50RB#0 | 3000~20000 | -38.32 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0  | 0.009~0.15 | -47.10 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0  | 0.15~30    | -55.55 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0  | 30~1000    | -56.01 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0  | 1000~3000  | -38.34 | -13.0 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |            |        |       |      |
|-------|-------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 10MHz | 16QAM | 18650 | 1RB#0  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 0.009~0.15 | -47.49 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 0.15~30    | -53.55 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 30~1000    | -56.97 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 1000~3000  | -41.03 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 1RB#49 | 3000~20000 | -38.51 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 50RB#0 | 0.009~0.15 | -46.35 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 50RB#0 | 0.15~30    | -53.98 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 50RB#0 | 30~1000    | -56.38 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 50RB#0 | 1000~3000  | -33.63 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18650 | 50RB#0 | 3000~20000 | -38.50 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#0  | 0.009~0.15 | -48.16 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#0  | 0.15~30    | -54.71 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#0  | 30~1000    | -56.57 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#0  | 1000~3000  | -47.09 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#0  | 3000~20000 | -38.38 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#49 | 0.009~0.15 | -48.34 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#49 | 0.15~30    | -54.69 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#49 | 30~1000    | -55.92 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#49 | 1000~3000  | -46.89 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 1RB#49 | 3000~20000 | -38.55 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 50RB#0 | 0.009~0.15 | -47.72 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 50RB#0 | 0.15~30    | -54.16 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 50RB#0 | 30~1000    | -56.13 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 50RB#0 | 1000~3000  | -46.85 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 18900 | 50RB#0 | 3000~20000 | -38.22 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0  | 0.009~0.15 | -49.20 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0  | 0.15~30    | -56.08 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0  | 30~1000    | -56.93 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0  | 1000~3000  | -44.82 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#0  | 3000~20000 | -38.43 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 0.009~0.15 | -47.03 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 0.15~30    | -54.38 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 30~1000    | -56.16 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 1000~3000  | -46.75 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 1RB#49 | 3000~20000 | -38.60 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 50RB#0 | 0.009~0.15 | -46.69 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 50RB#0 | 0.15~30    | -53.07 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 50RB#0 | 30~1000    | -56.70 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 50RB#0 | 1000~3000  | -44.89 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 18900 | 50RB#0 | 3000~20000 | -38.27 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#0  | 0.009~0.15 | -48.15 | -43.0 | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |            |        |       |      |
|-------|-------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 10MHz | QPSK  | 19150 | 1RB#0  | 0.15~30    | -56.82 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#0  | 30~1000    | -56.41 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#0  | 1000~3000  | -33.31 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#0  | 3000~20000 | -38.64 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#49 | 0.009~0.15 | -47.47 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#49 | 0.15~30    | -54.95 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#49 | 30~1000    | -56.28 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#49 | 1000~3000  | -47.10 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 1RB#49 | 3000~20000 | -38.52 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | 0.009~0.15 | -46.67 | -43.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | 0.15~30    | -53.98 | -33.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | 30~1000    | -56.81 | -23.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | 1000~3000  | -30.93 | -13.0 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | 3000~20000 | -38.29 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0  | 0.009~0.15 | -49.29 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0  | 0.15~30    | -54.60 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0  | 30~1000    | -56.62 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0  | 1000~3000  | -46.92 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#0  | 3000~20000 | -38.50 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 0.009~0.15 | -46.56 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 0.15~30    | -54.98 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 30~1000    | -56.17 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 1000~3000  | -44.56 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 1RB#49 | 3000~20000 | -38.19 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | 0.009~0.15 | -47.73 | -43.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | 0.15~30    | -55.96 | -33.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | 30~1000    | -57.19 | -23.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | 1000~3000  | -31.20 | -13.0 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | 3000~20000 | -38.55 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#0  | 0.009~0.15 | -47.60 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#0  | 0.15~30    | -57.08 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#0  | 30~1000    | -56.80 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#0  | 1000~3000  | -37.96 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#0  | 3000~20000 | -38.25 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#74 | 0.009~0.15 | -47.33 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#74 | 0.15~30    | -52.75 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#74 | 30~1000    | -55.84 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#74 | 1000~3000  | -46.32 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 1RB#74 | 3000~20000 | -38.57 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | 0.009~0.15 | -47.64 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | 0.15~30    | -54.91 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | 30~1000    | -55.96 | -23.0 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |            |        |       |      |
|-------|-------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | 1000~3000  | -33.32 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | 3000~20000 | -38.64 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0  | 0.009~0.15 | -47.49 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0  | 0.15~30    | -55.54 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0  | 30~1000    | -56.90 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0  | 1000~3000  | -47.15 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#0  | 3000~20000 | -38.70 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 0.009~0.15 | -48.27 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 0.15~30    | -54.82 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 30~1000    | -56.76 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 1000~3000  | -46.32 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 1RB#74 | 3000~20000 | -38.14 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | 0.009~0.15 | -47.37 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | 0.15~30    | -54.04 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | 30~1000    | -56.21 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | 1000~3000  | -34.33 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | 3000~20000 | -38.13 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#0  | 0.009~0.15 | -47.23 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#0  | 0.15~30    | -57.26 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#0  | 30~1000    | -55.62 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#0  | 1000~3000  | -43.55 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#0  | 3000~20000 | -38.50 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#74 | 0.009~0.15 | -48.08 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#74 | 0.15~30    | -54.05 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#74 | 30~1000    | -56.65 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#74 | 1000~3000  | -42.18 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 1RB#74 | 3000~20000 | -38.75 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | 0.009~0.15 | -47.57 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | 0.15~30    | -55.12 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | 30~1000    | -56.80 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | 1000~3000  | -44.43 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | 3000~20000 | -38.40 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0  | 0.009~0.15 | -47.58 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0  | 0.15~30    | -54.89 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0  | 30~1000    | -56.37 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0  | 1000~3000  | -42.58 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#0  | 3000~20000 | -38.83 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 0.009~0.15 | -48.92 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 0.15~30    | -52.62 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 30~1000    | -56.52 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 1000~3000  | -42.80 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 1RB#74 | 3000~20000 | -38.63 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |            |        |       |      |
|-------|-------|-------|-------|--------|------------|--------|-------|------|
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | 0.009~0.15 | -46.07 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | 0.15~30    | -54.88 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | 30~1000    | -56.66 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | 1000~3000  | -45.61 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | 3000~20000 | -38.01 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#0  | 0.009~0.15 | -46.92 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#0  | 0.15~30    | -54.08 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#0  | 30~1000    | -56.25 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#0  | 1000~3000  | -43.84 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#0  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#74 | 0.009~0.15 | -46.59 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#74 | 0.15~30    | -55.56 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#74 | 30~1000    | -56.10 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#74 | 1000~3000  | -37.37 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 1RB#74 | 3000~20000 | -38.39 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | 0.009~0.15 | -48.59 | -43.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | 0.15~30    | -52.91 | -33.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | 30~1000    | -56.87 | -23.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | 1000~3000  | -33.54 | -13.0 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | 3000~20000 | -38.57 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0  | 0.009~0.15 | -47.87 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0  | 0.15~30    | -54.61 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0  | 30~1000    | -56.92 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0  | 1000~3000  | -46.36 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#0  | 3000~20000 | -38.13 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 0.009~0.15 | -47.73 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 0.15~30    | -54.80 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 30~1000    | -55.82 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 1000~3000  | -38.69 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 1RB#74 | 3000~20000 | -38.55 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | 0.009~0.15 | -48.07 | -43.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | 0.15~30    | -54.16 | -33.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | 30~1000    | -57.07 | -23.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | 1000~3000  | -33.96 | -13.0 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | 3000~20000 | -38.48 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#0  | 0.009~0.15 | -46.91 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#0  | 0.15~30    | -53.95 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#0  | 30~1000    | -56.71 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#0  | 1000~3000  | -39.50 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#0  | 3000~20000 | -37.99 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#99 | 0.009~0.15 | -49.01 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#99 | 0.15~30    | -55.01 | -33.0 | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |         |            |        |       |      |
|-------|-------|-------|-------|---------|------------|--------|-------|------|
| Band2 | 20MHz | QPSK  | 18700 | 1RB#99  | 30~1000    | -56.67 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#99  | 1000~3000  | -47.04 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 1RB#99  | 3000~20000 | -38.23 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | 0.009~0.15 | -46.46 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | 0.15~30    | -56.04 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | 30~1000    | -56.49 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | 1000~3000  | -35.25 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | 3000~20000 | -37.88 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0   | 0.009~0.15 | -46.90 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0   | 0.15~30    | -54.86 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0   | 30~1000    | -55.80 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0   | 1000~3000  | -40.20 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#0   | 3000~20000 | -38.76 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99  | 0.009~0.15 | -48.45 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99  | 0.15~30    | -56.13 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99  | 30~1000    | -56.52 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99  | 1000~3000  | -47.04 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 1RB#99  | 3000~20000 | -38.46 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | 0.009~0.15 | -46.12 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | 0.15~30    | -54.43 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | 30~1000    | -55.44 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | 1000~3000  | -36.14 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | 3000~20000 | -38.63 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#0   | 0.009~0.15 | -48.62 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#0   | 0.15~30    | -56.09 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#0   | 30~1000    | -55.42 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#0   | 1000~3000  | -46.75 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#0   | 3000~20000 | -38.70 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#99  | 0.009~0.15 | -47.29 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#99  | 0.15~30    | -54.15 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#99  | 30~1000    | -56.52 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#99  | 1000~3000  | -46.98 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 1RB#99  | 3000~20000 | -38.58 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | 0.009~0.15 | -47.53 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | 0.15~30    | -53.22 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | 30~1000    | -56.31 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | 1000~3000  | -43.49 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | 3000~20000 | -38.52 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0   | 0.009~0.15 | -46.86 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0   | 0.15~30    | -53.74 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0   | 30~1000    | -56.22 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0   | 1000~3000  | -47.11 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |         |            |        |       |      |
|-------|-------|-------|-------|---------|------------|--------|-------|------|
| Band2 | 20MHz | 16QAM | 18900 | 1RB#0   | 3000~20000 | -38.90 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99  | 0.009~0.15 | -48.25 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99  | 0.15~30    | -53.94 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99  | 30~1000    | -56.54 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99  | 1000~3000  | -47.07 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 1RB#99  | 3000~20000 | -38.59 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | 0.009~0.15 | -46.20 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | 0.15~30    | -55.28 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | 30~1000    | -56.83 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | 1000~3000  | -43.07 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | 3000~20000 | -38.87 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#0   | 0.009~0.15 | -47.45 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#0   | 0.15~30    | -56.63 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#0   | 30~1000    | -56.76 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#0   | 1000~3000  | -47.24 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#0   | 3000~20000 | -38.16 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#99  | 0.009~0.15 | -46.55 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#99  | 0.15~30    | -54.60 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#99  | 30~1000    | -56.25 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#99  | 1000~3000  | -39.14 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 1RB#99  | 3000~20000 | -38.36 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | 0.009~0.15 | -46.26 | -43.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | 0.15~30    | -54.97 | -33.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | 30~1000    | -55.90 | -23.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | 1000~3000  | -33.94 | -13.0 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | 3000~20000 | -38.82 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0   | 0.009~0.15 | -48.95 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0   | 0.15~30    | -54.10 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0   | 30~1000    | -56.37 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0   | 1000~3000  | -47.11 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#0   | 3000~20000 | -38.72 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99  | 0.009~0.15 | -46.98 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99  | 0.15~30    | -55.25 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99  | 30~1000    | -55.94 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99  | 1000~3000  | -38.92 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 1RB#99  | 3000~20000 | -38.17 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | 0.009~0.15 | -46.94 | -43.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | 0.15~30    | -54.36 | -33.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | 30~1000    | -56.43 | -23.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | 1000~3000  | -35.37 | -13.0 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | 3000~20000 | -38.17 | -13.0 | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Test Graphs

