



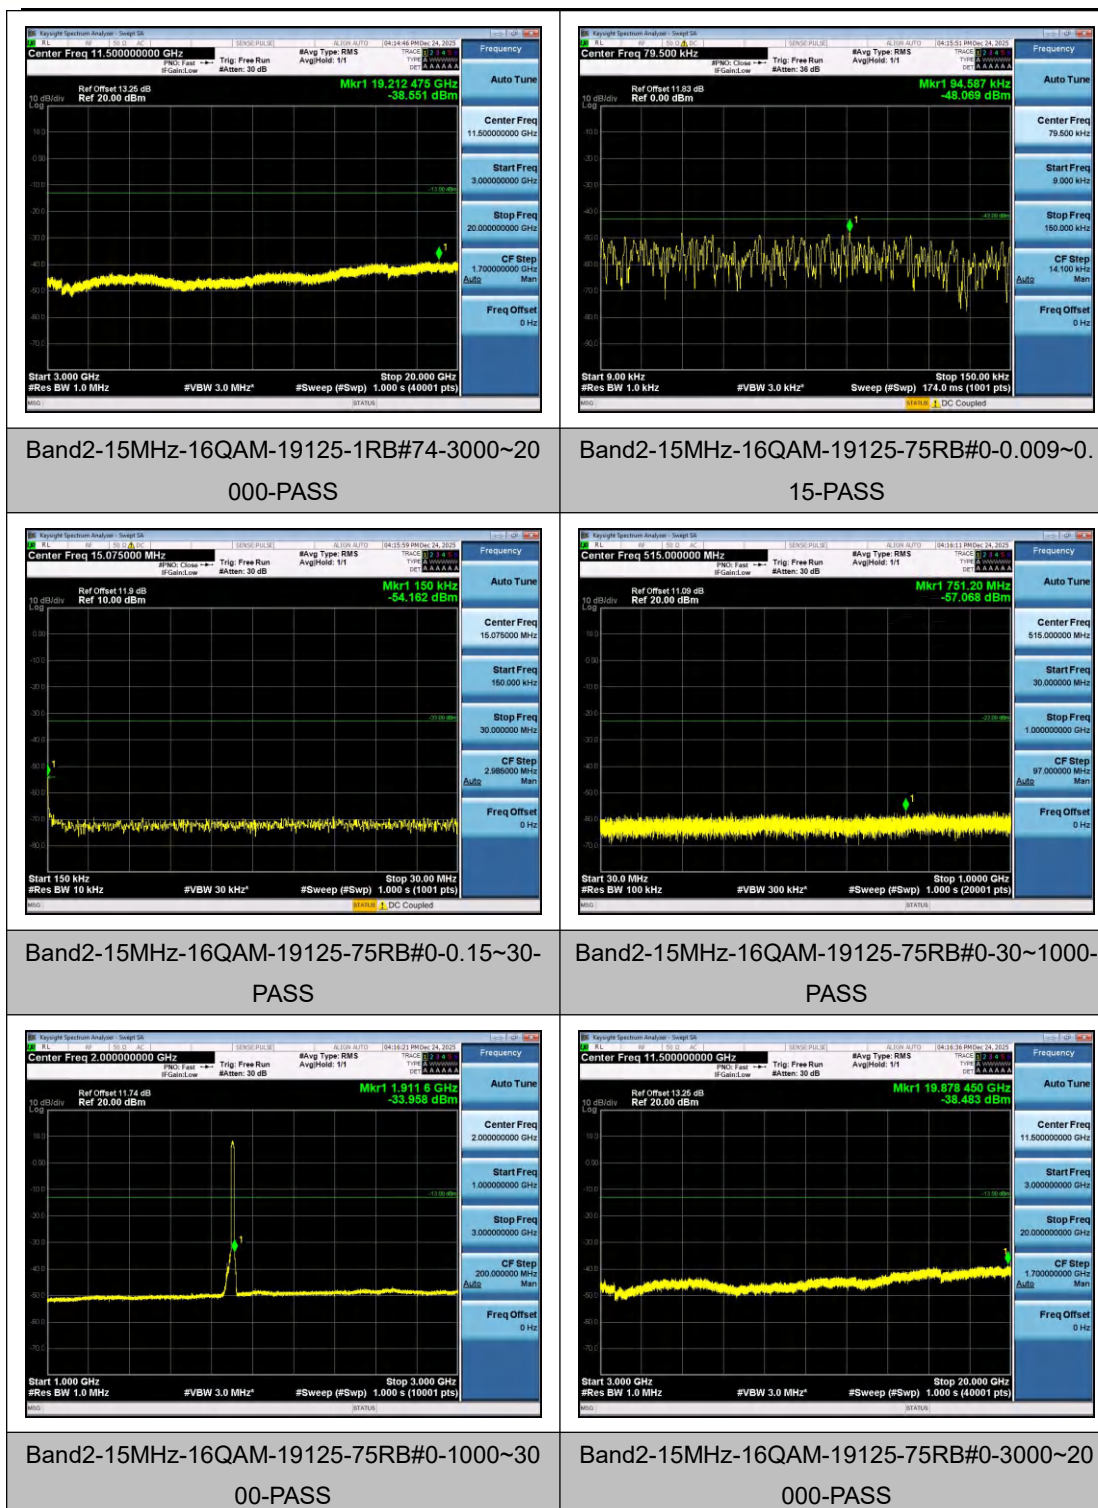
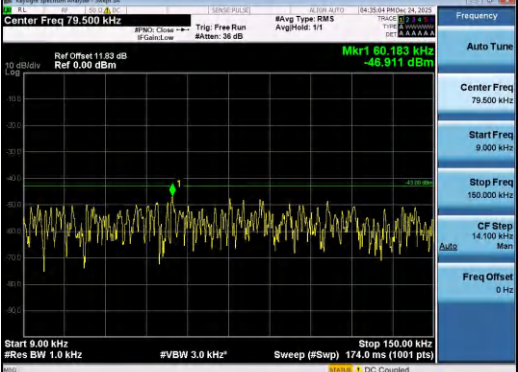
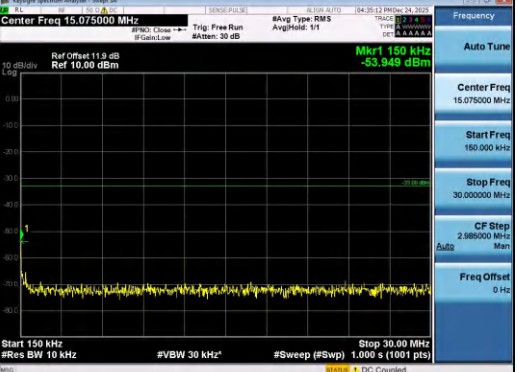
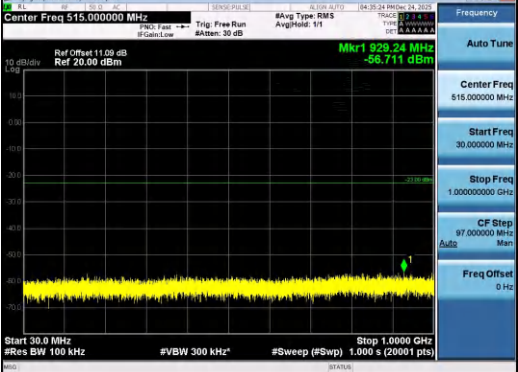
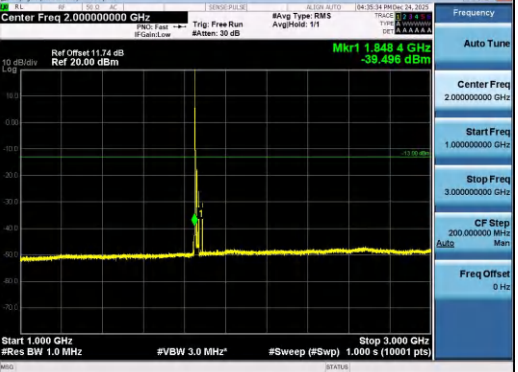


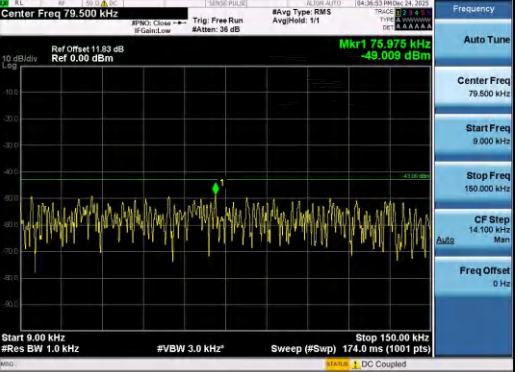



	
Band2-20MHz-QPSK-18700-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-18700-1RB#0-0.15~30-PA SS
	
Band2-20MHz-QPSK-18700-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-18700-1RB#0-1000~3000- PASS
	
Band2-20MHz-QPSK-18700-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-18700-1RB#99-0.009~0.1 5-PASS

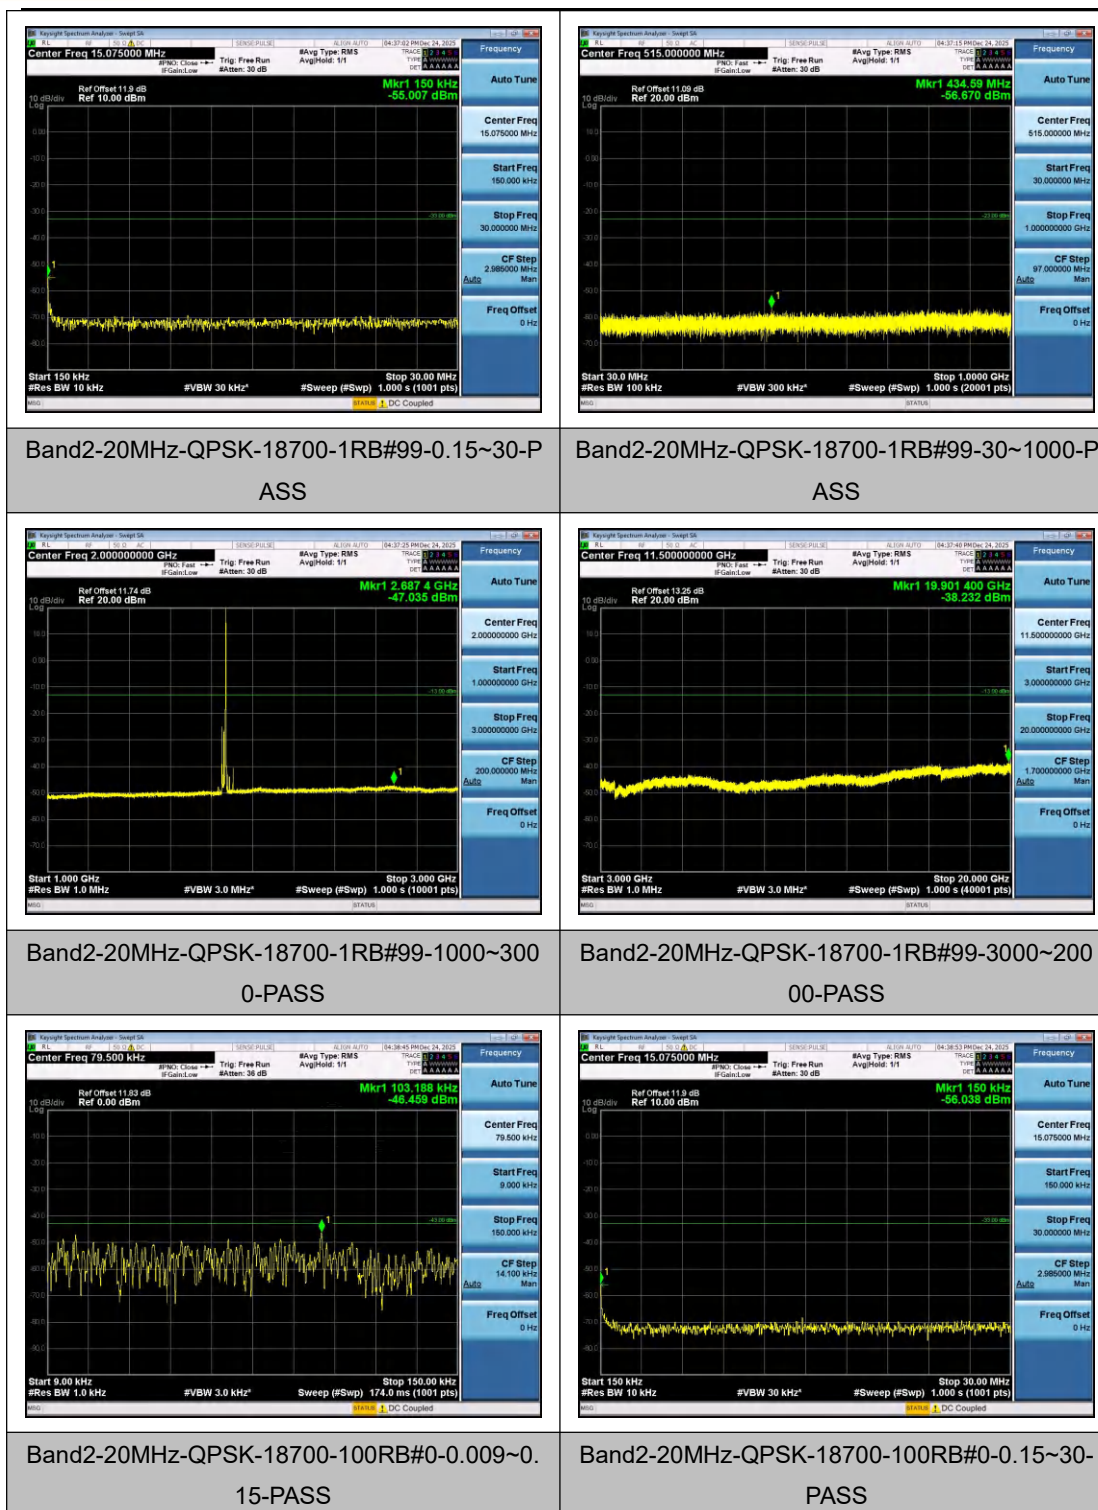


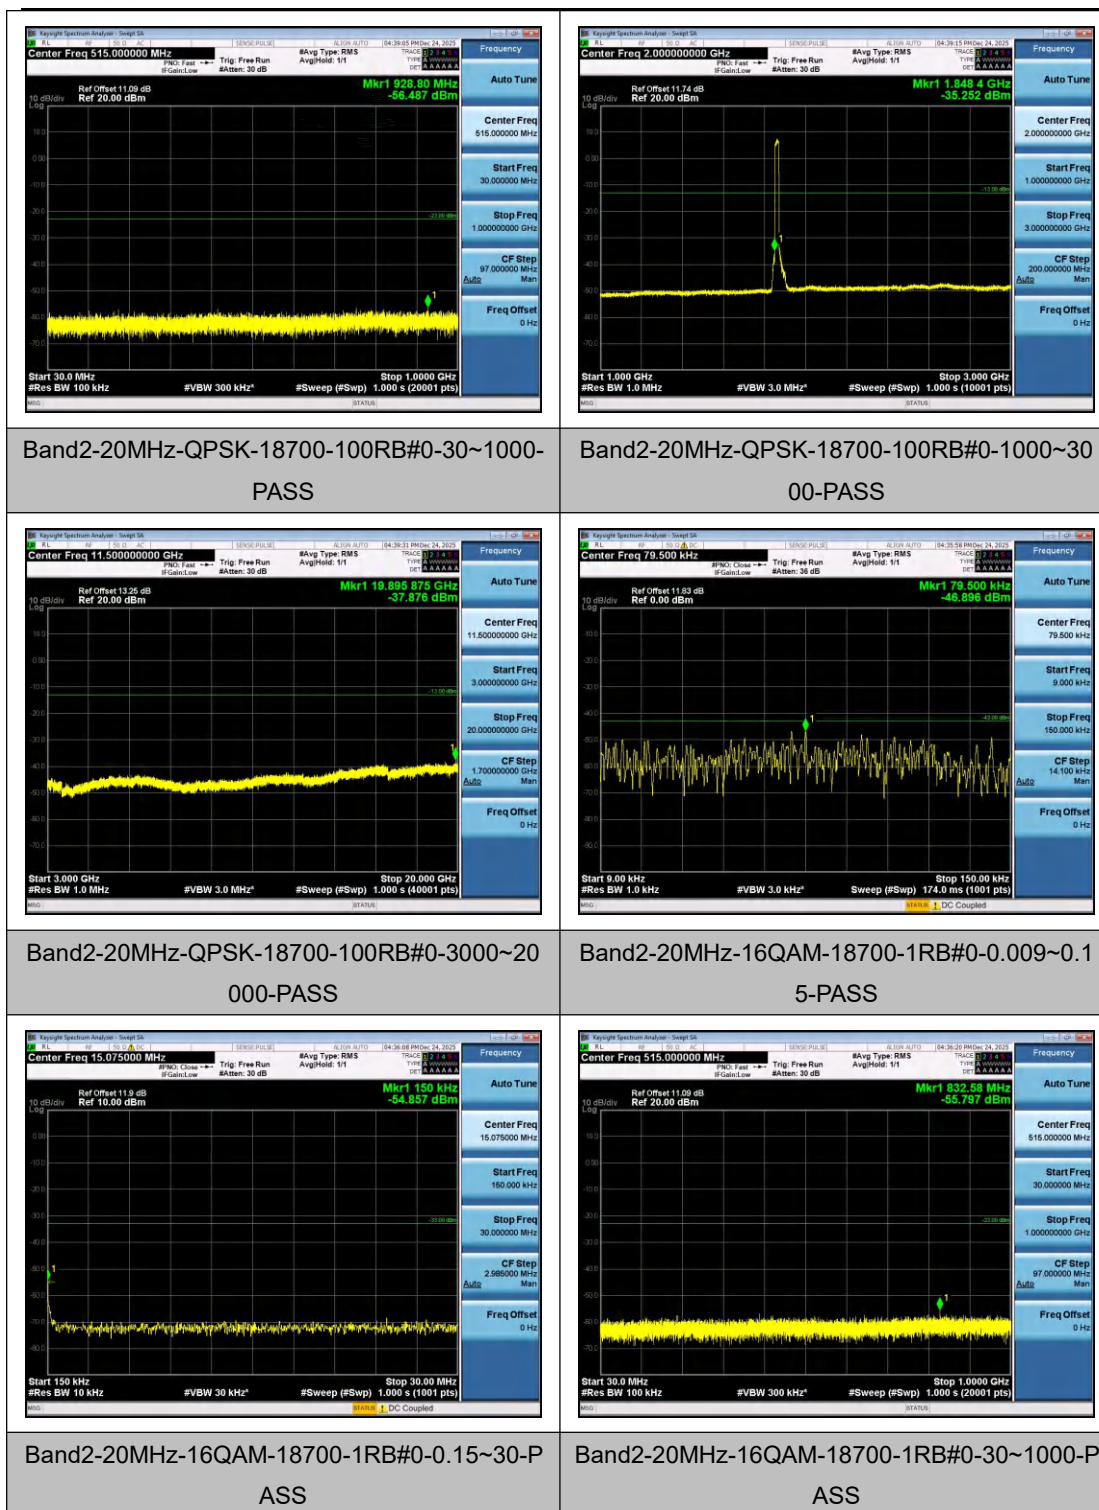


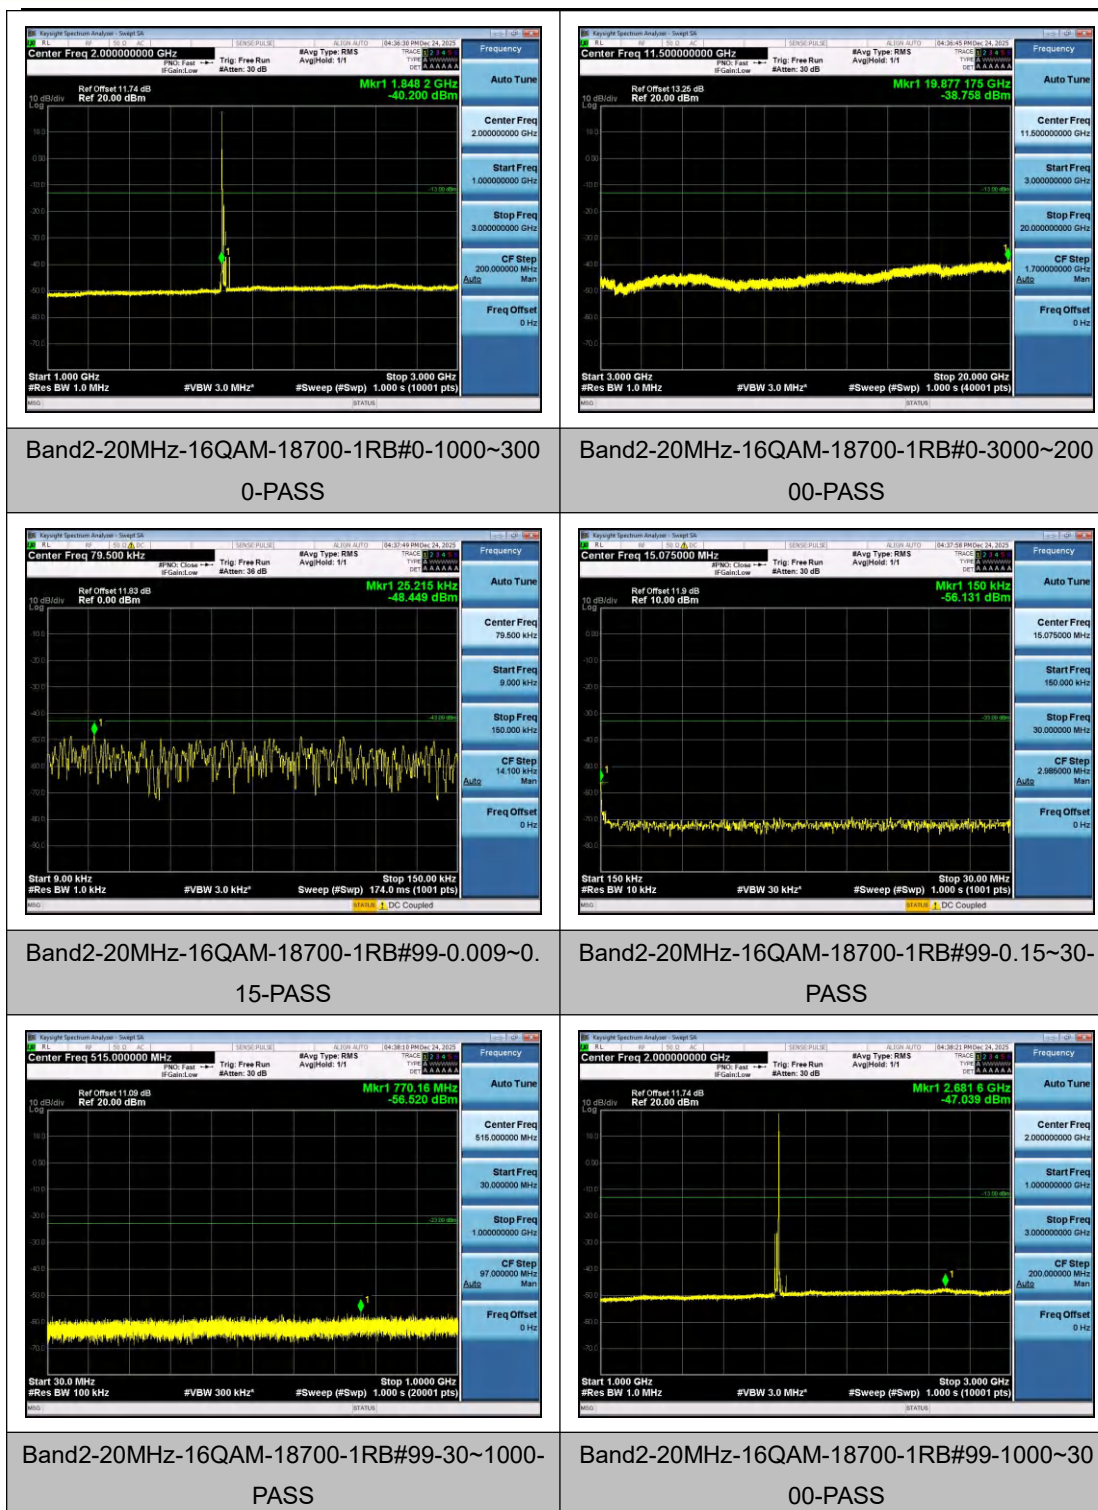


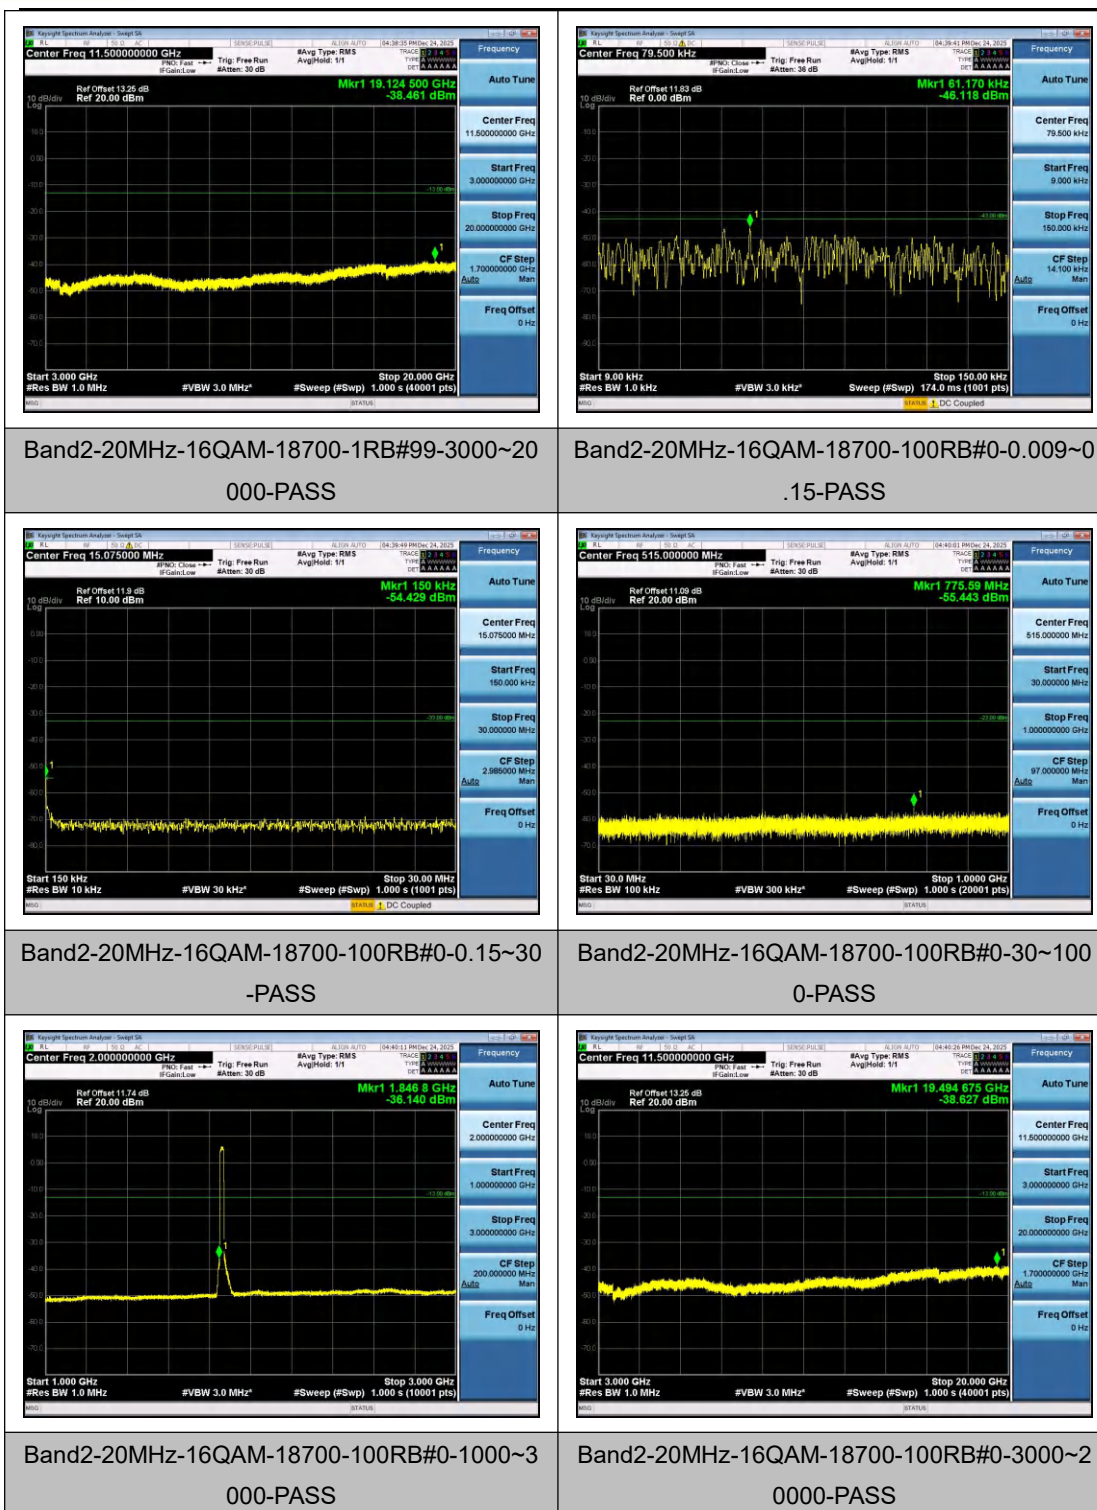


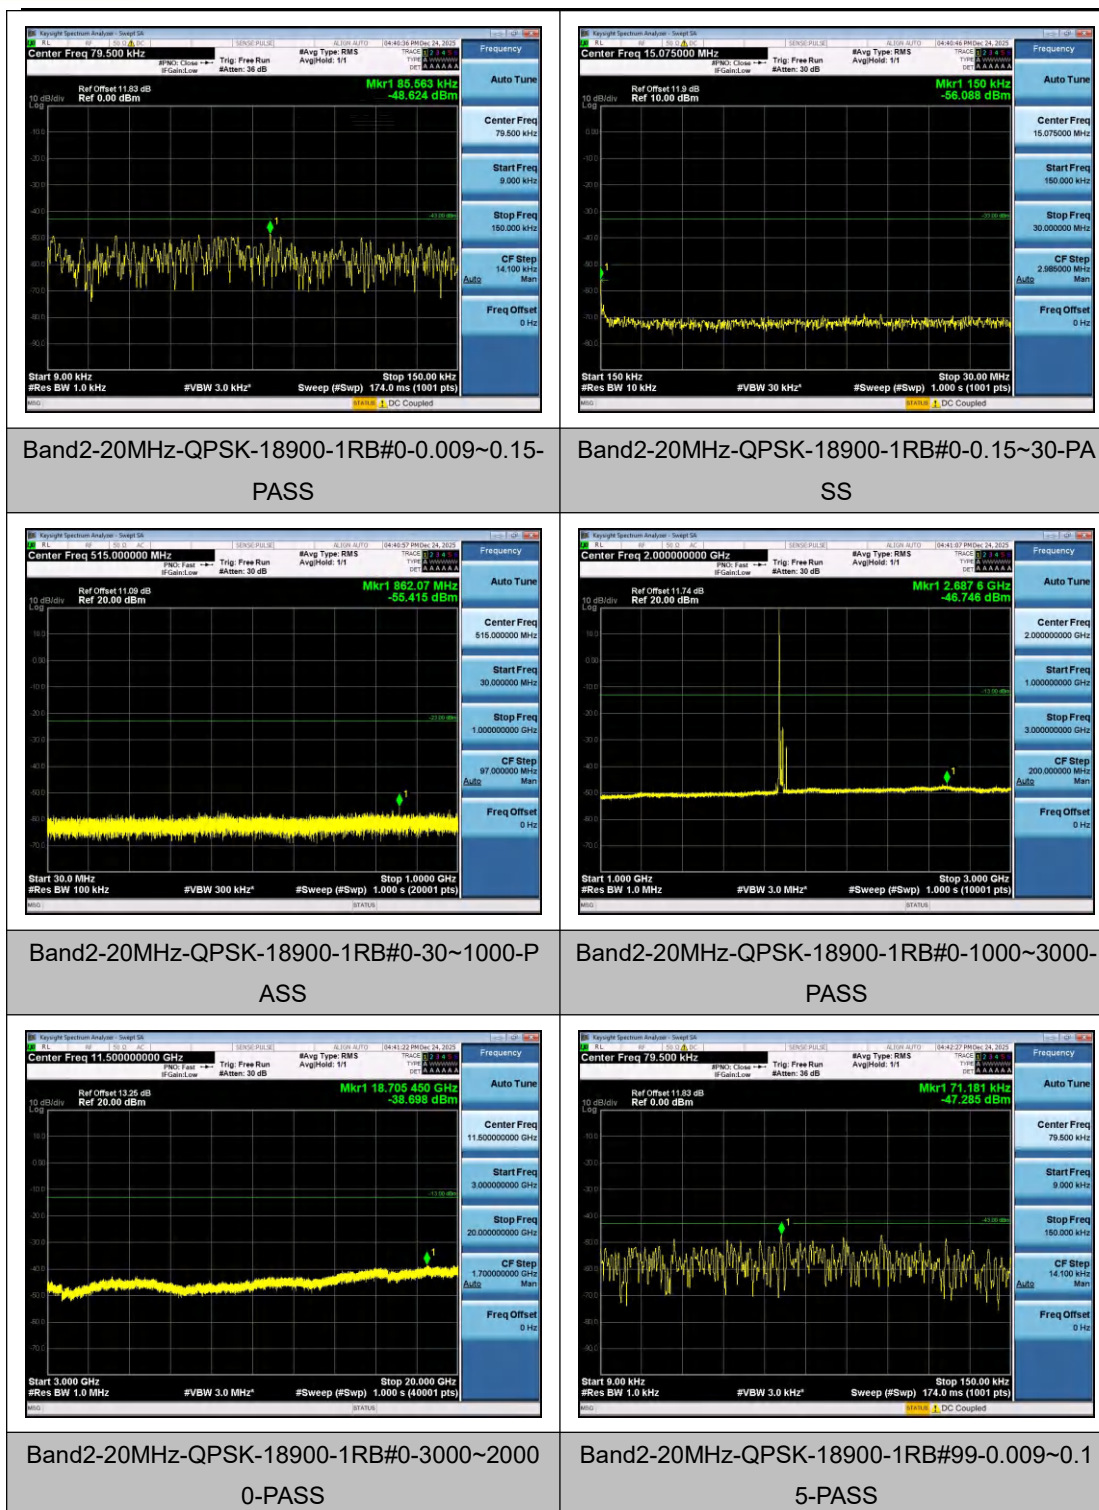

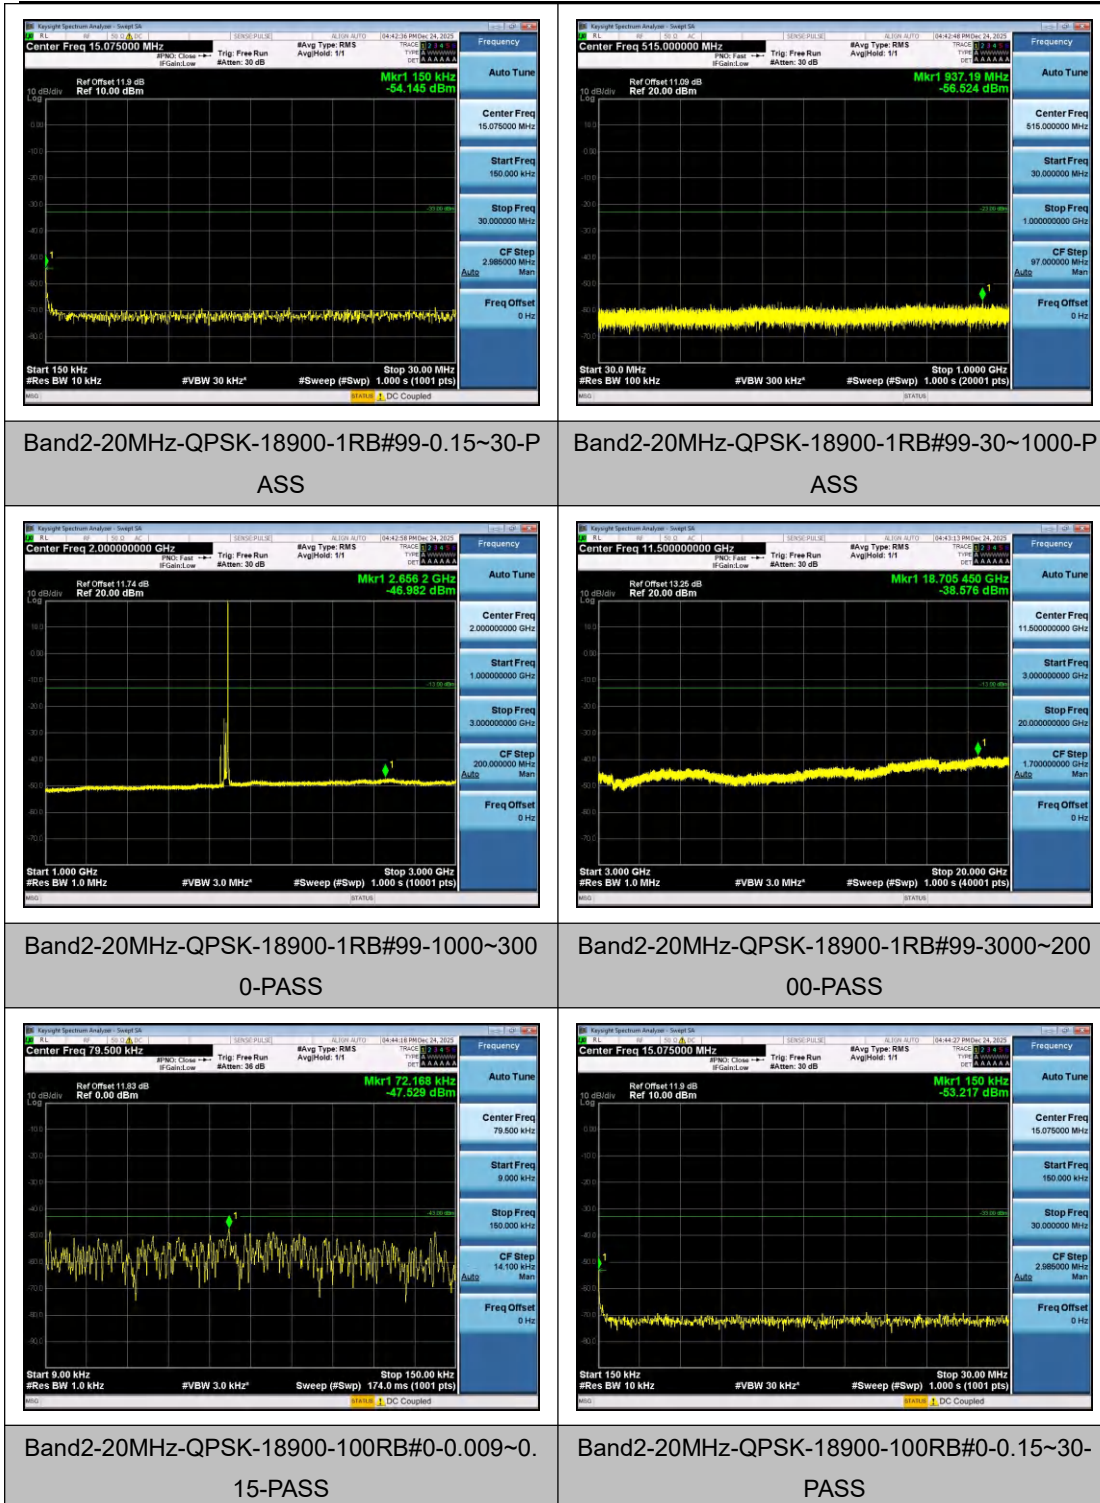


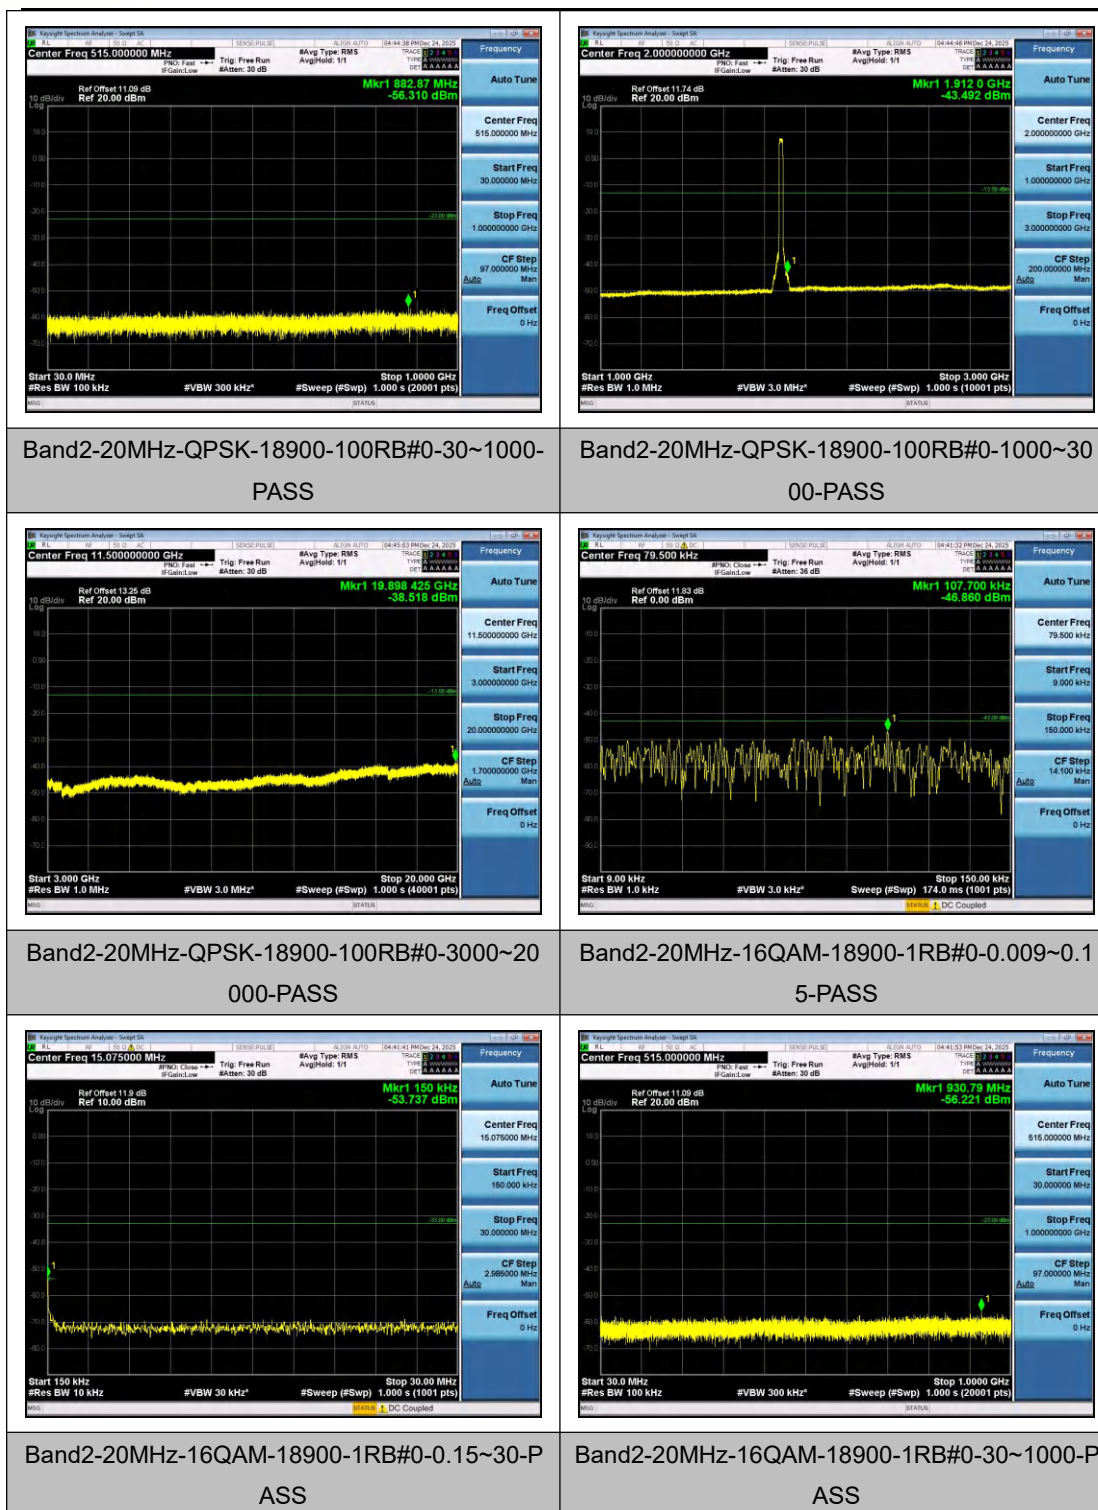

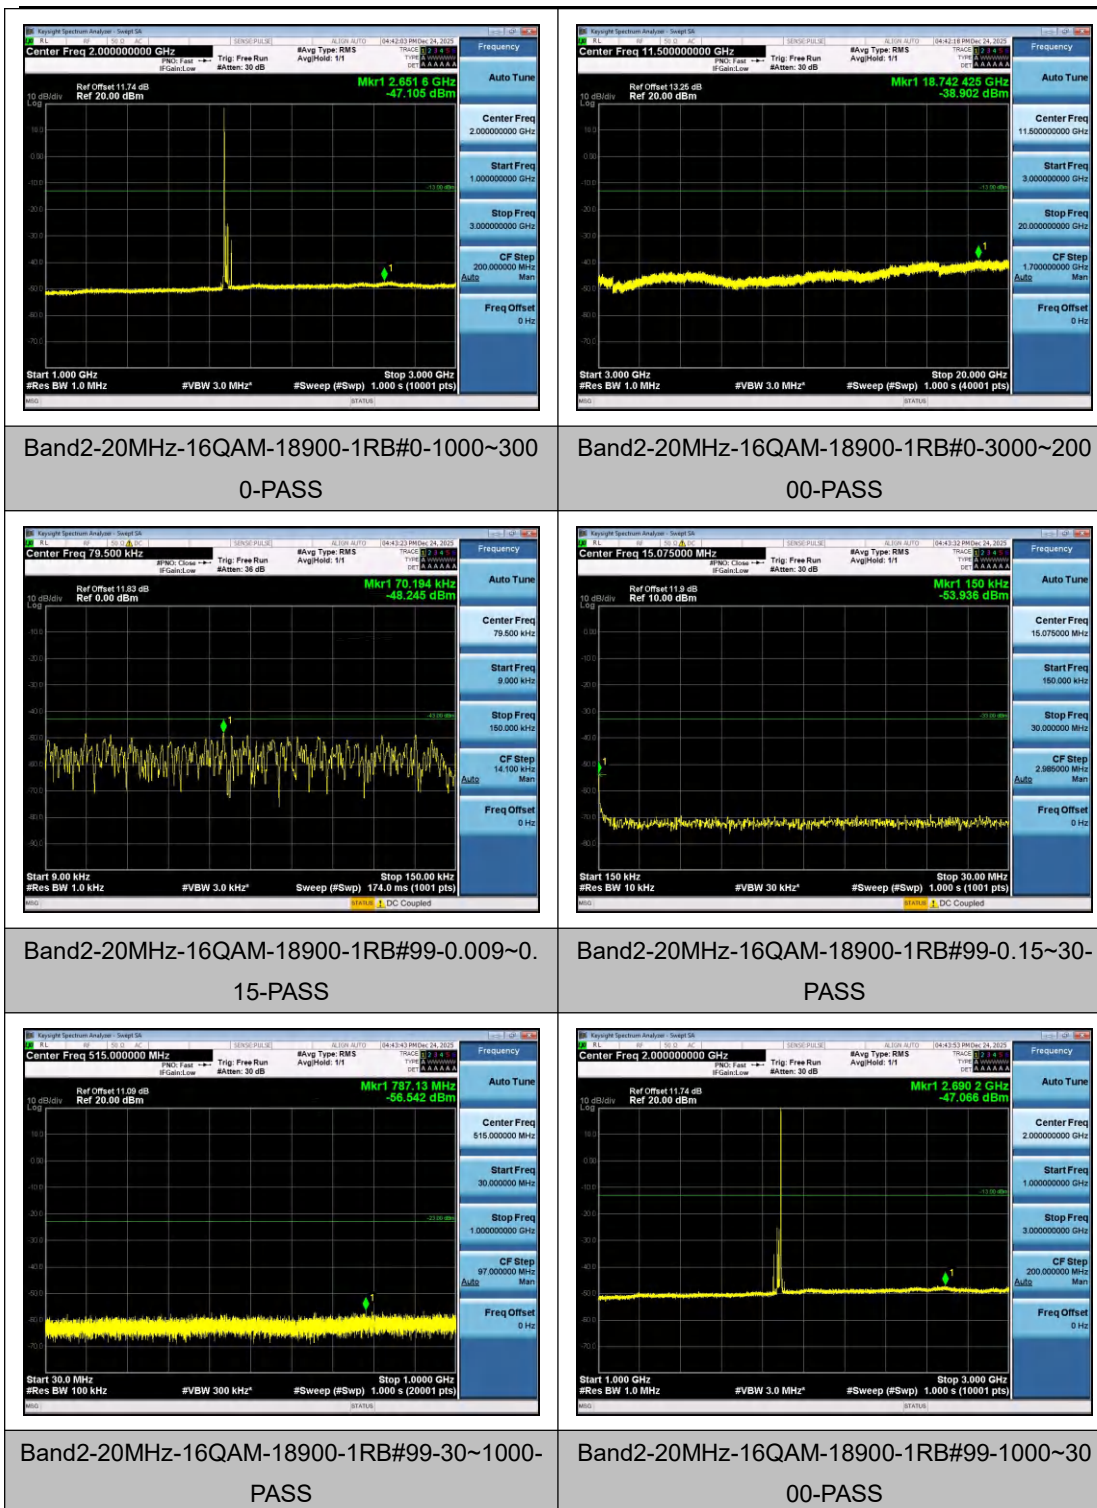


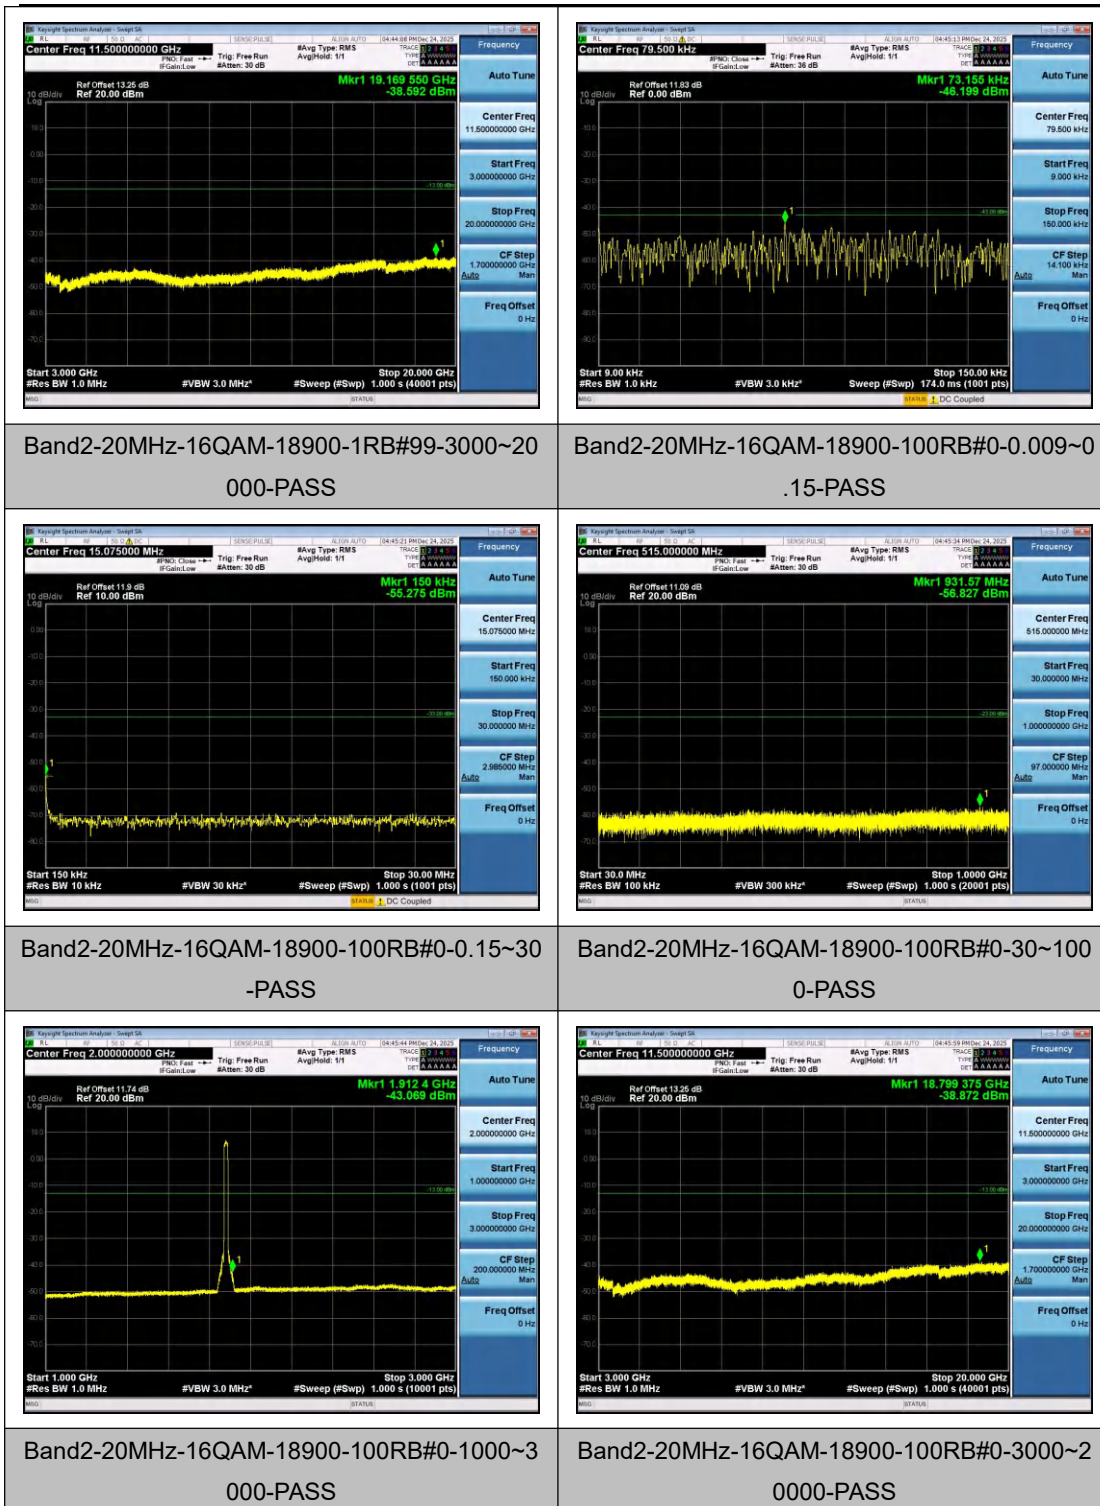


Band2-20MHz-QPSK-19100-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-19100-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-19100-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-19100-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-19100-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-19100-1RB#99-0.009~0.1 5-PASS

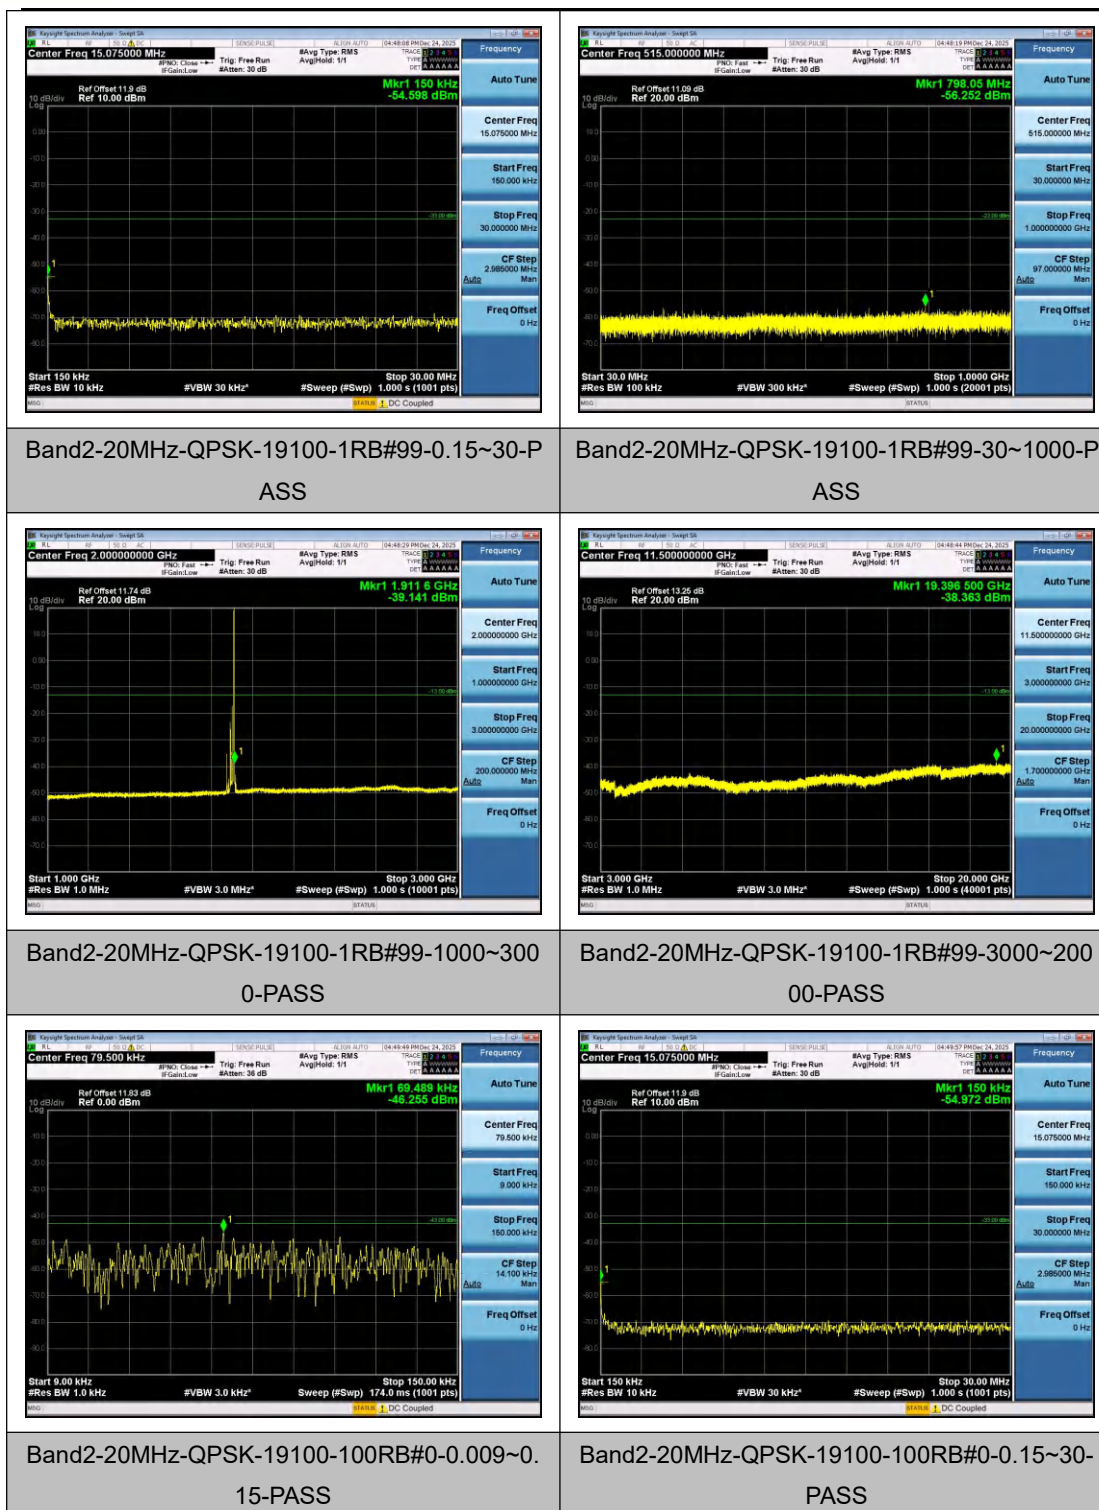

Band2-20MHz-QPSK-19100-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-19100-100RB#0-1000~3000-PASS
Band2-20MHz-QPSK-19100-100RB#0-3000~20000-PASS	Band2-20MHz-16QAM-19100-1RB#0-0.009~0.15-PASS
Band2-20MHz-16QAM-19100-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-19100-1RB#0-30~1000-PASS

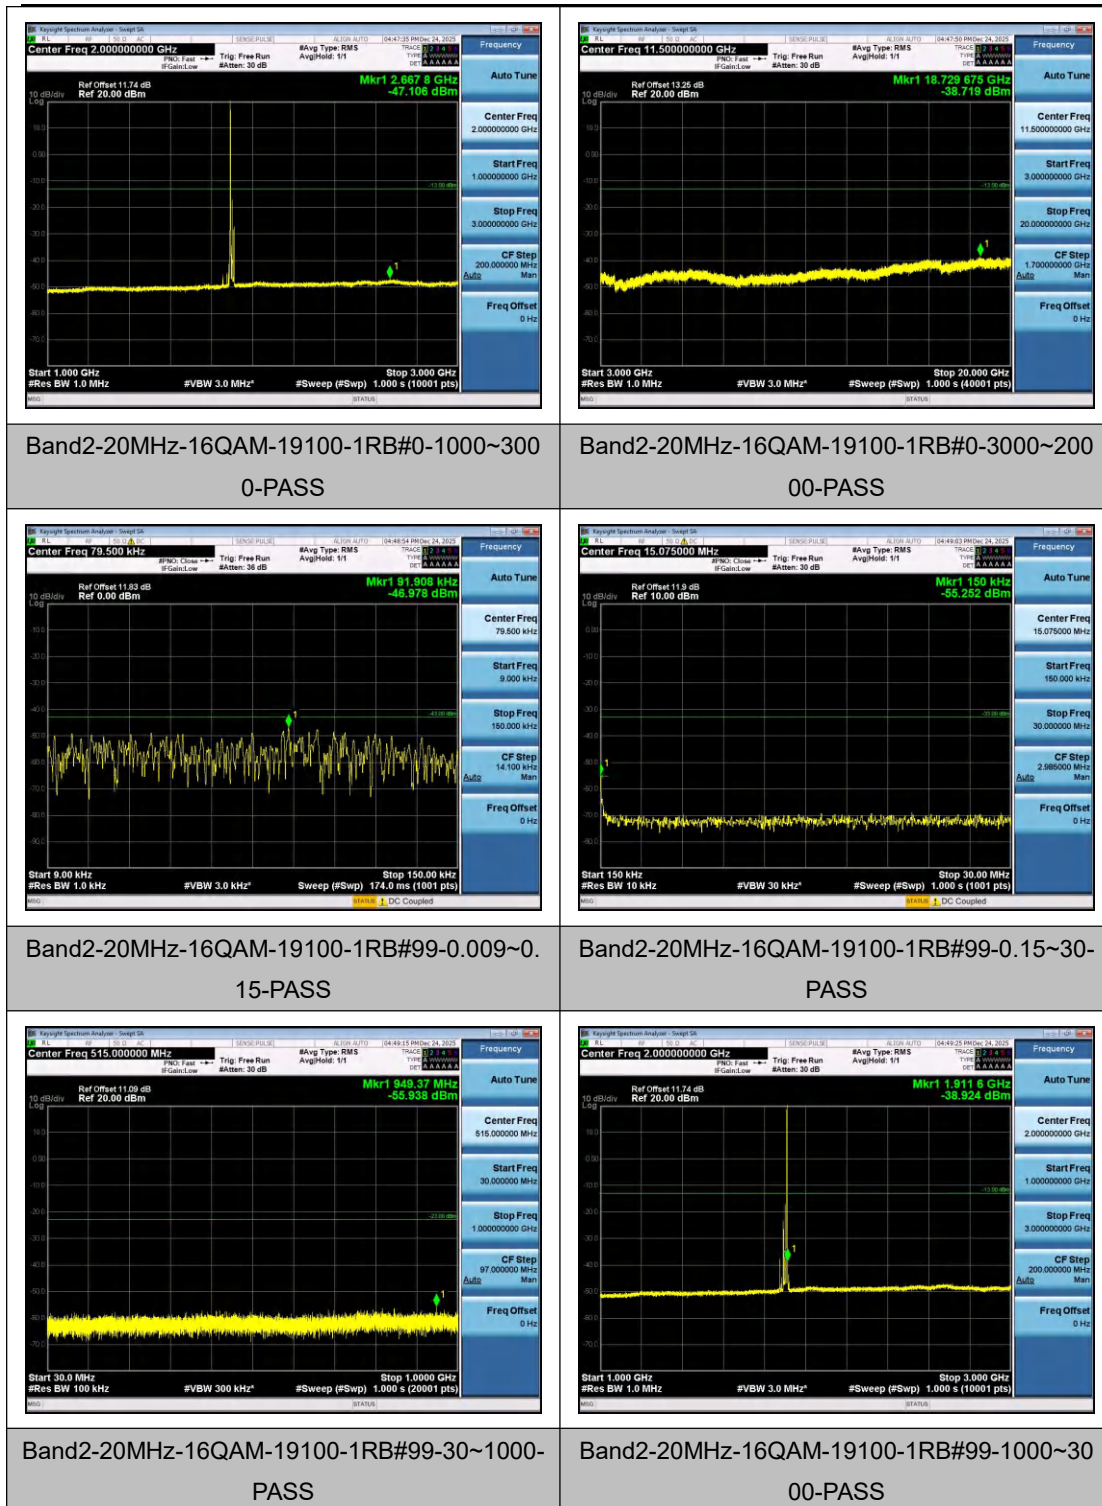

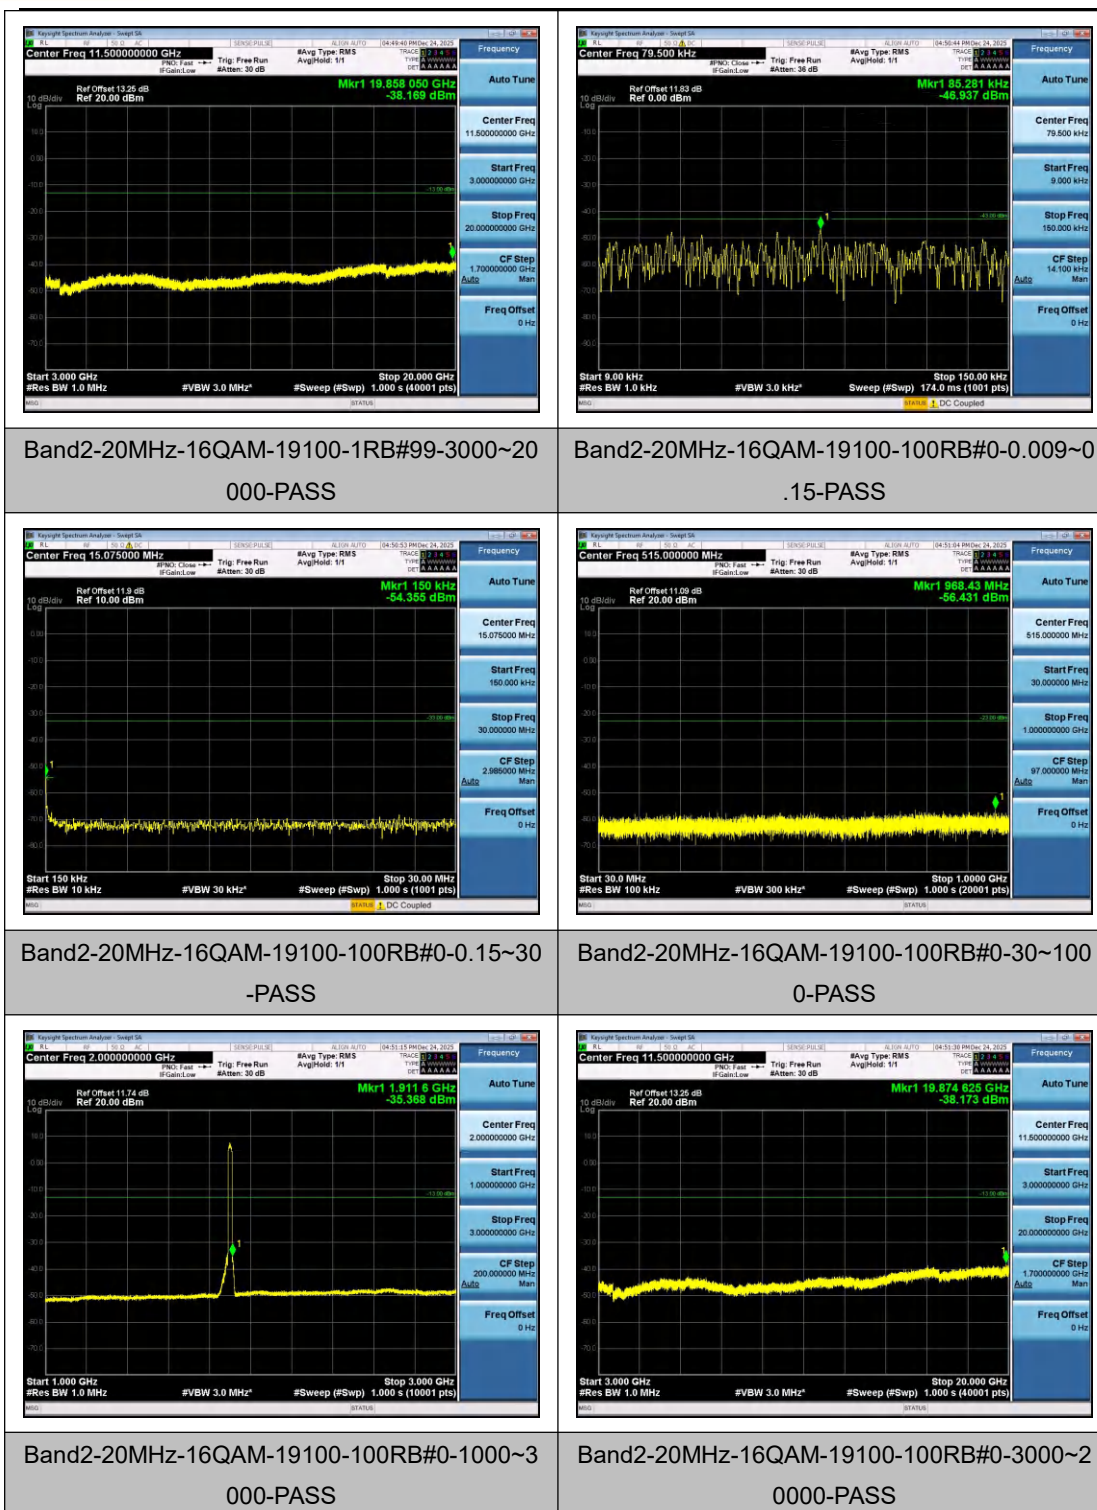

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15 855	1851.23 815	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15 734	1851.23 824	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15 914	1851.23 774	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15 825	1851.23 785	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15 658	1851.23 718	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15 787	1851.23 667	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45 64	1880.53 81	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45 508	1880.53 728	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45 898	1880.53 808	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45 632	1880.53 762	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45 547	1880.53 917	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45 599	1880.53 979	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75 683	1909.83 673	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75 743	1909.83 673	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75 637	1909.83 817	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75 951	1909.83 911	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75 841	1909.83 801	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75	1909.83	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							609	899	10	
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.15 836	1852.84 586	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.15 946	1852.84 206	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 08	1852.84 37	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.15 912	1852.84 062	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.15 81	1852.83 98	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.15 935	1852.84 025	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.65 658	1881.34 078	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.65 973	1881.34 643	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.65 744	1881.34 794	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.65 962	1881.33 852	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.65 85	1881.33 71	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.65 809	1881.33 789	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.15 628	1909.84 338	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.15 556	1909.84 086	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.15 441	1909.84 191	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.15 625	1909.83 985	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15 899	1909.83 839	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.15 635	1909.83 945	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 305	1854.73 445	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.25 584	1854.73 374	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.25	1854.73	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							996	026	10	
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 131	1854.73 401	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26 076	1854.73 816	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.26 473	1854.73 183	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.76 59	1882.23 09	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.76 408	1882.23 558	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.76 504	1882.23 524	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76 314	1882.23 654	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 169	1882.23 749	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 476	1882.23 786	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.25 053	1909.73 563	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.25 973	1909.73 303	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.25 291	1909.73 641	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.25 774	1909.74 184	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26 11	1909.73 01	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.25 54	1909.74 32	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.53 431	1859.46 021	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.53 486	1859.45 846	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.54 497	1859.45 517	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.54 95	1859.45 43	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.53 913	1859.45 983	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.53	1859.46	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							179	139	10	
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.53 641	1884.44 981	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.53 549	1884.46 479	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.54 022	1884.45 532	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.53 82	1884.46 25	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.54 161	1884.45 701	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.54 697	1884.45 887	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.53 023	1909.45 693	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.53 251	1909.45 631	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.53 443	1909.45 593	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.52 931	1909.45 821	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.53 723	1909.45 883	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.53 635	1909.45 925	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.81 084	1864.20 484	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.82 171	1864.19 771	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.81 443	1864.20 343	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.81 89	1864.18 59	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.82 086	1864.19 586	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.81 848	1864.18 948	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.30 675	1886.68 875	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.32 153	1886.67 553	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.31	1886.69	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							487	687	10	
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.30 184	1886.70 084	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.30 888	1886.69 588	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.29 668	1886.68 468	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.81 779	1909.16 279	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.80 774	1909.16 474	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.81 208	1909.16 708	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.80 062	1909.18 662	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.81 195	1909.17 995	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.80 069	1909.16 669	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	1851.12 8	1868.92 5	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	1851.12 427	1868.93 027	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	1851.12 352	1868.92 052	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	1851.10 527	1868.93 727	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	1851.12 689	1868.93 089	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	1851.11 415	1868.93 015	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1871.10 58	1888.90 88	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	1871.08 884	1888.91 684	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	1871.07 283	1888.92 383	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	1871.09 863	1888.93 663	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	1871.10 105	1888.95 605	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	1871.10	1888.93	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							602	602	10	
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	1891.07063	1908.89963	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	1891.0675	1908.9115	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	1891.06655	1908.87855	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	1891.1098	1908.8928	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	1891.09366	1908.90266	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	1891.09316	1908.89416	1850-1910	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.15878	1851.23938	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15858	1851.23698	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15544	1851.23854	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15636	1851.23726	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.15837	1851.23717	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.1562	1851.2386	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15837	1851.23687	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.1585	1851.2386	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.15854	1851.23714	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.15549	1851.23939	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15771	1851.23891	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.1559	1851.2361	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.15	1851.23	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							647	817	10	
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15 634	1851.23 904	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.15 606	1851.23 776	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15 822	1851.23 842	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15 788	1851.23 958	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15 855	1851.23 955	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45 975	1880.53 855	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45 591	1880.53 831	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.45 863	1880.53 893	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45 588	1880.53 778	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45 665	1880.53 675	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45 894	1880.53 714	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45 557	1880.53 757	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.45 44	1880.53 79	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45 921	1880.53 821	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45 583	1880.53 763	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45 548	1880.53 718	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45 65	1880.53 78	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.45 52	1880.53 87	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.45 772	1880.53 792	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45 639	1880.53 779	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45	1880.53	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							661	681	10	
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45 814	1880.53 754	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45 567	1880.53 727	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75 739	1909.83 709	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75 678	1909.83 578	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75 749	1909.83 929	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75 77	1909.83 73	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75 834	1909.83 514	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75 721	1909.83 611	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75 768	1909.83 688	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75 674	1909.83 614	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.75 71	1909.83 63	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75 633	1909.83 923	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75 745	1909.83 825	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.75 767	1909.83 857	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.75 658	1909.83 768	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.75 82	1909.83 85	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.75 813	1909.83 903	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.75 705	1909.83 795	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.76 156	1909.83 846	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.75 567	1909.83 877	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.15	1852.84	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							7	66	10	
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.16 122	1852.84 302	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.15 911	1852.84 511	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.15 826	1852.84 586	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.15 799	1852.84 529	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.15 734	1852.84 214	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.15 942	1852.84 582	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.15 915	1852.84 745	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.15 884	1852.84 064	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.16 046	1852.84 056	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.15 936	1852.84 006	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.15 982	1852.83 942	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.15 949	1852.83 589	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.15 99	1852.84 08	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.16 11	1852.84 04	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.15 807	1852.83 827	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.16 031	1852.84 161	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.16 093	1852.83 543	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.65 664	1881.33 894	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.65 88	1881.34 23	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.65 648	1881.34 318	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.65	1881.34	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							694	674	10	
Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.65 994	1881.34 174	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.65 693	1881.34 563	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.66 077	1881.34 297	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.65 762	1881.34 382	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.65 66	1881.34 69	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.65 943	1881.33 683	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.66 012	1881.33 612	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.65 898	1881.33 738	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.65 78	1881.34 2	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.65 945	1881.33 935	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.65 949	1881.33 959	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.65 757	1881.34 097	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.65 984	1881.33 874	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.65 775	1881.33 915	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.15 696	1909.84 396	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.15 545	1909.84 255	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.15 568	1909.83 778	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.15 614	1909.84 174	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.15 471	1909.84 071	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.15 66	1909.84 31	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.15	1909.84	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							593	093	10	
Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.15 629	1909.83 989	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.15 484	1909.84 204	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.15 352	1909.83 942	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.15 661	1909.83 721	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.15 655	1909.83 875	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.15 694	1909.83 874	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.15 615	1909.83 795	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.15 687	1909.83 897	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.15 817	1909.83 557	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.15 753	1909.83 793	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.15 809	1909.83 699	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.25 897	1854.73 587	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.25 351	1854.73 591	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.25 888	1854.73 368	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.25 434	1854.74 074	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.26 075	1854.73 935	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.26 021	1854.73 871	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.25 887	1854.73 717	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.26 162	1854.73 922	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.25 959	1854.73 479	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.26	1854.73	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							113	483	10	
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.26 523	1854.73 783	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.26 32	1854.73 65	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.25 971	1854.73 171	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.25 998	1854.73 188	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.25 951	1854.73 391	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26 136	1854.73 826	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.26 258	1854.73 598	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.25 937	1854.73 527	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.76 375	1882.23 345	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.76 314	1882.23 584	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.76 569	1882.23 189	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.76 115	1882.23 505	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.76 302	1882.23 462	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.76 694	1882.23 494	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.76 622	1882.23 402	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.76 47	1882.23 46	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.76 528	1882.23 068	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.76 064	1882.23 784	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76 309	1882.23 809	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.76 121	1882.24 091	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.76	1882.23	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							33	85	10	
Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.75 957	1882.23 167	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76 196	1882.24 026	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.75 938	1882.24 158	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.76 44	1882.23 98	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76 145	1882.23 655	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.25 768	1909.73 058	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.25 787	1909.73 517	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.25 897	1909.73 447	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.25 821	1909.73 431	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.25 88	1909.73 05	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.25 752	1909.73 132	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.25 791	1909.73 251	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.25 421	1909.73 551	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.25 889	1909.72 899	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.25 85	1909.73 78	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26 074	1909.73 534	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.25 882	1909.73 152	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.26 057	1909.73 997	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.25 352	1909.74 452	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.25 626	1909.72 696	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.25	1909.73	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							896	786	10	
Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.25 727	1909.73 827	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.25 959	1909.73 209	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.53 196	1859.45 836	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.53 423	1859.46 193	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.53 689	1859.45 909	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.54 017	1859.45 867	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.53 064	1859.46 044	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.53 93	1859.46 54	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.52 721	1859.46 331	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.54 223	1859.46 073	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.54 43	1859.46 55	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.53 507	1859.46 457	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.53 322	1859.45 932	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.53 01	1859.46 14	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.55 021	1859.46 171	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.53 403	1859.45 893	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.53 442	1859.46 112	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.53 85	1859.45 45	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.53 884	1859.45 594	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.52 959	1859.46 069	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.53	1884.45	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							392	602	10	
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.54 001	1884.46 021	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.53 855	1884.45 535	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.54 021	1884.45 711	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.53 893	1884.45 823	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.53 488	1884.45 868	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.53 773	1884.46 193	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.53 922	1884.45 422	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.53 851	1884.45 931	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.54 199	1884.46 259	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.54 462	1884.45 782	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.54 8	1884.46 7	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.53 812	1884.46 002	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.53 894	1884.46 974	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.53 991	1884.45 971	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.53 691	1884.46 391	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.54 245	1884.45 865	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.54 776	1884.46 156	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.52 225	1909.45 975	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.52 709	1909.45 549	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.53 006	1909.45 936	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.52	1909.45	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com