							723	943	10	
Band2	10MHz	QPSK	19150	50RB#0	NV	10	1900.52785	1909.45565	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	1900.52962	1909.46182	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	1900.52677	1909.44807	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	1900.52948	1909.46378	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	1900.53082	1909.46362	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	1900.53091	1909.46261	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	1900.53662	1909.45872	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	1900.53417	1909.45567	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	1900.53585	1909.45915	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	1900.533	1909.4565	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	1900.52761	1909.46411	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	1900.53171	1909.46041	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	1900.53774	1909.45374	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	1900.54009	1909.44939	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	1850.82212	1864.20412	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	1850.81746	1864.20646	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	1850.81662	1864.20262	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	1850.82297	1864.20197	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	1850.81157	1864.21157	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	1850.82003	1864.19603	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	1850.81	1864.21	1850-19	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							974	474	10	
Band2	15MHz	QPSK	18675	75RB#0	NV	40	1850.81984	1864.19784	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	1850.8118	1864.1998	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	1850.81022	1864.18122	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	1850.81815	1864.18515	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	1850.81614	1864.19314	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	1850.81359	1864.19359	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	1850.82206	1864.18606	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	1850.82267	1864.18267	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	1850.81775	1864.18975	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	1850.81376	1864.19976	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	1850.81378	1864.19278	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	1873.31311	1886.68611	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	1873.30662	1886.69462	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	1873.311	1886.673	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	1873.31676	1886.68276	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	1873.31189	1886.68989	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	1873.30932	1886.69632	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	1873.31641	1886.69741	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	1873.30659	1886.69059	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	1873.31697	1886.67997	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	1873.31	1886.69	1850-19	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							346	446	10	
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	1873.29 746	1886.68 846	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	1873.31 302	1886.68 002	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	1873.31 177	1886.68 677	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	1873.30 628	1886.68 828	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	1873.30 228	1886.68 228	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	1873.29 154	1886.69 554	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	1873.31 036	1886.69 336	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	1873.31 332	1886.68 732	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	1895.80 515	1909.16 215	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	1895.80 412	1909.16 412	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	1895.81 246	1909.16 446	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	1895.81 041	1909.16 241	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	1895.82 203	1909.16 203	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	1895.79 536	1909.16 736	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	1895.81 426	1909.17 026	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	1895.81 803	1909.16 603	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	1895.81 651	1909.16 351	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	1895.80 18	1909.17 88	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	1895.80 176	1909.18 876	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	1895.79 578	1909.16 078	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	1895.81	1909.17	1850-19	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							436	136	10	
Band2	15MHz	16QAM	19125	75RB#0	NV	10	1895.81013	1909.17213	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	1895.81038	1909.18438	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	1895.80644	1909.17544	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	1895.79714	1909.17814	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	1895.8115	1909.1795	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	1851.12572	1868.93172	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	1851.13077	1868.92377	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	1851.1205	1868.9135	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	1851.12175	1868.91675	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	1851.11761	1868.92561	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	1851.12595	1868.91295	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	1851.12541	1868.92241	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	1851.11526	1868.92726	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	1851.12198	1868.92398	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	1851.08781	1868.92781	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	1851.11709	1868.92209	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	1851.11638	1868.92738	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	1851.09705	1868.92905	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	1851.07919	1868.92619	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	1851.1181	1868.9181	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	1851.09	1868.91	1850-19	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							105	705	10	
Band2	20MHz	16QAM	18700	100RB#0	NV	40	1851.08 67	1868.91 97	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	1851.09 59	1868.92 19	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	1871.08 647	1888.89 747	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	1871.09 289	1888.91 589	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	1871.07 334	1888.91 634	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	1871.09 573	1888.91 273	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	1871.10 837	1888.91 637	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	1871.08 379	1888.93 379	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	1871.09 203	1888.91 303	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	1871.08 568	1888.92 368	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	1871.10 359	1888.91 759	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	1871.10 562	1888.93 162	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	1871.10 15	1888.95 45	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	1871.10 079	1888.93 579	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	1871.08 553	1888.89 853	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	1871.10 912	1888.90 412	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	1871.08 958	1888.95 058	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	1871.09 445	1888.92 545	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	1871.09 937	1888.94 937	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	1871.09 066	1888.89 866	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	1891.06	1908.87	1850-19	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							819	419	10	
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	1891.04833	1908.88633	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	1891.07983	1908.89583	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	1891.0727	1908.8767	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	1891.06158	1908.88958	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	1891.06997	1908.89697	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	1891.07472	1908.89472	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	1891.0634	1908.9004	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	1891.06025	1908.89525	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	1891.09538	1908.90438	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	1891.08708	1908.90408	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	1891.086	1908.901	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	1891.09433	1908.88433	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	1891.10639	1908.90439	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	1891.09996	1908.91196	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	1891.0929	1908.9029	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	1891.10745	1908.89145	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	1891.09259	1908.89759	1850-1910	PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

Voltage	
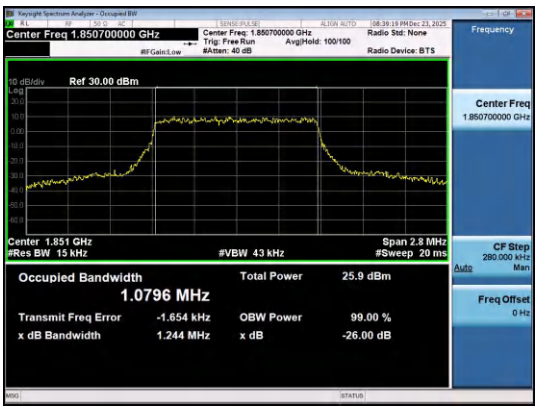	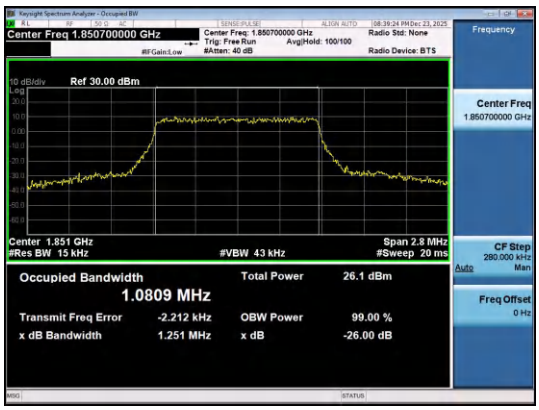
Band2-1.4MHz-QPSK-18607-6RB#0-PASS	Band2-1.4MHz-QPSK-18607-6RB#0-PASS
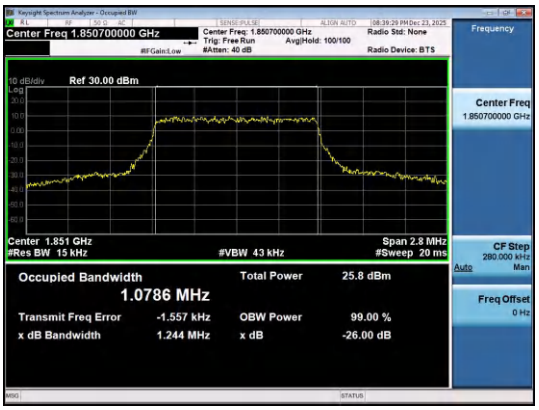	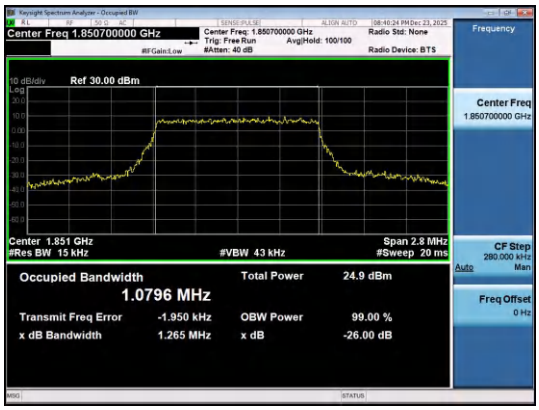
Band2-1.4MHz-QPSK-18607-6RB#0-PASS	Band2-1.4MHz-16QAM-18607-6RB#0-PASS
	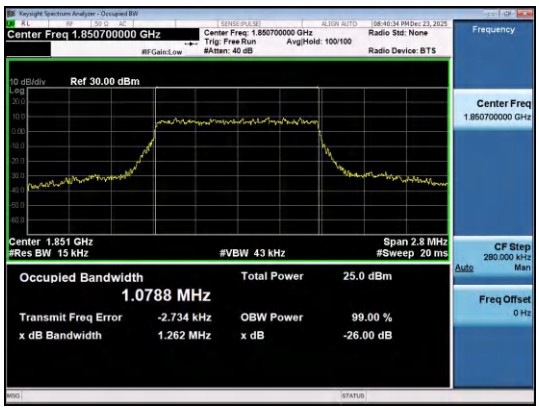
Band2-1.4MHz-16QAM-18607-6RB#0-PASS	Band2-1.4MHz-16QAM-18607-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

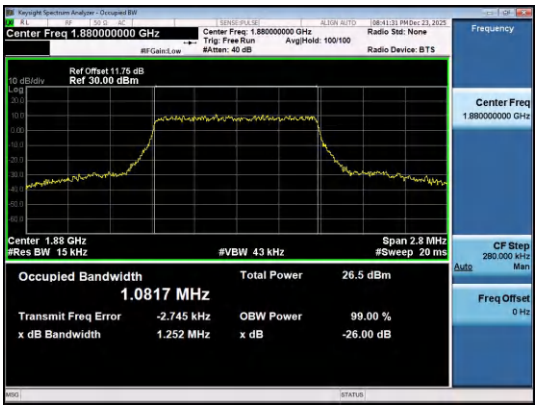

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

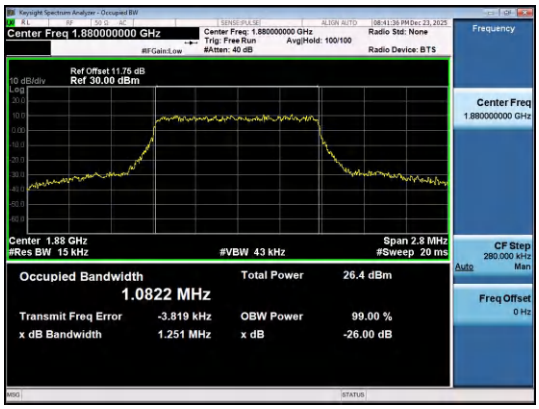

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

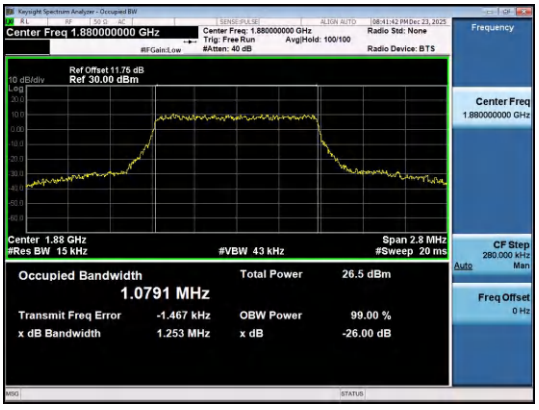

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

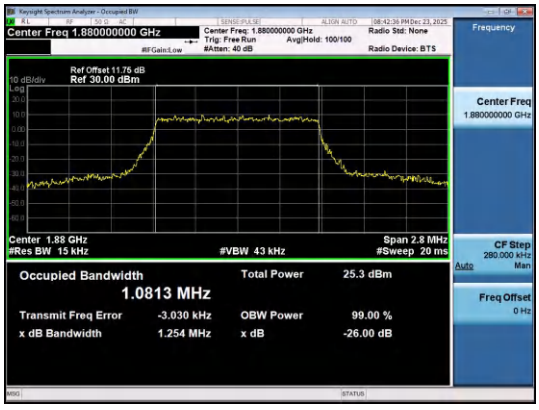

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

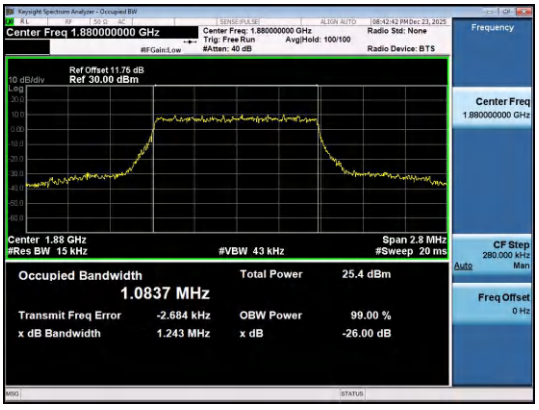

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

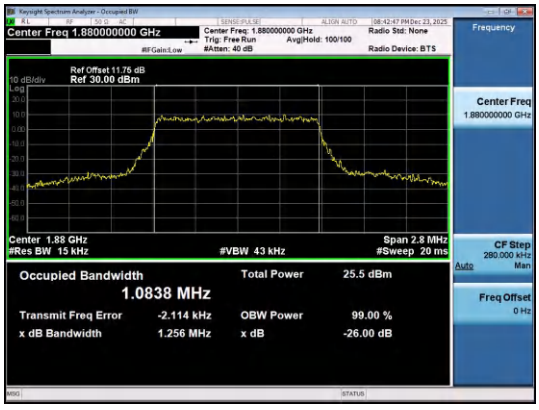

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

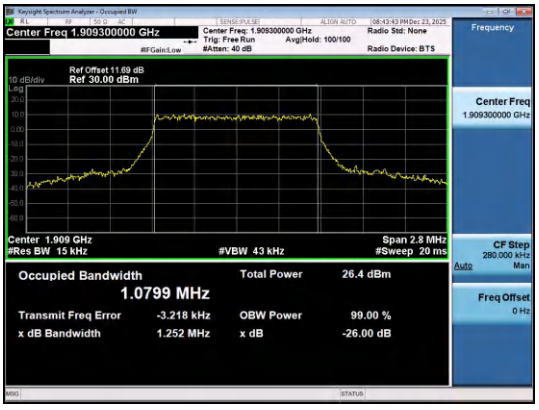

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

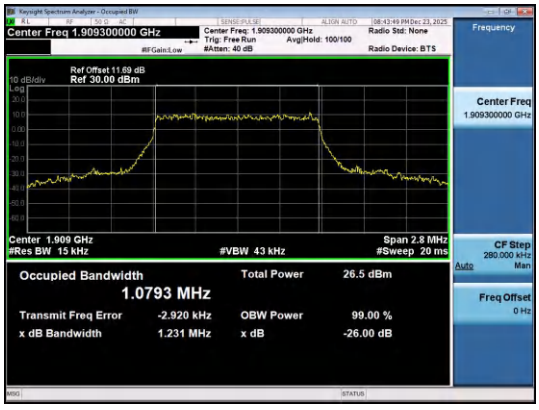

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

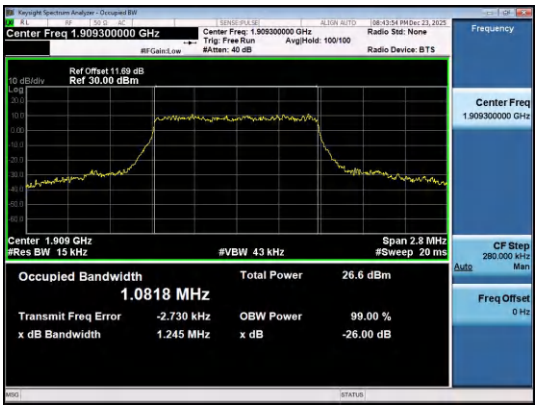

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

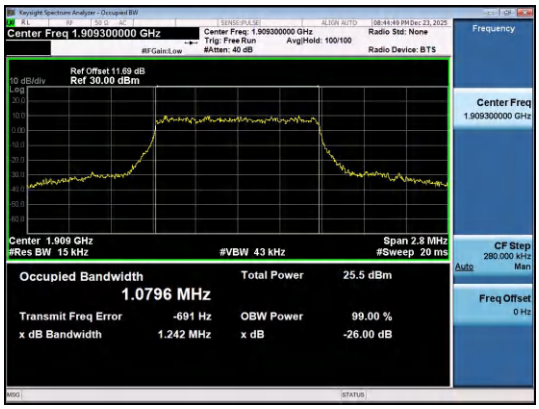

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

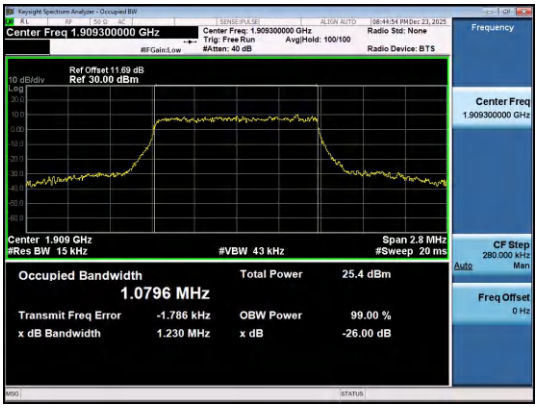

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

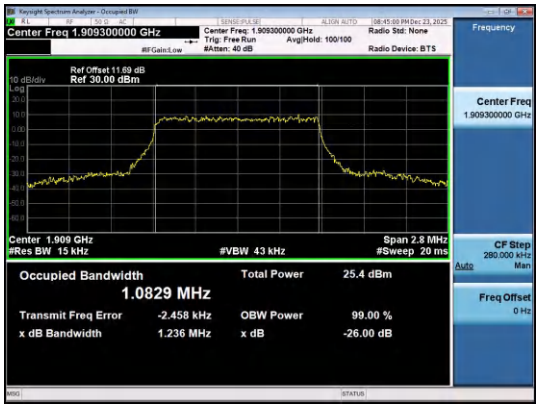

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

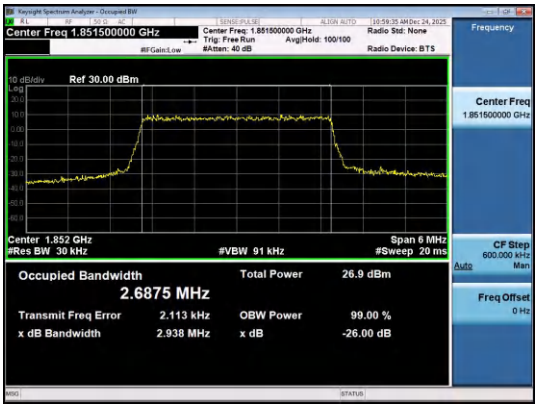

Band2-3MHz-QPSK-18615-15RB#0-PASS

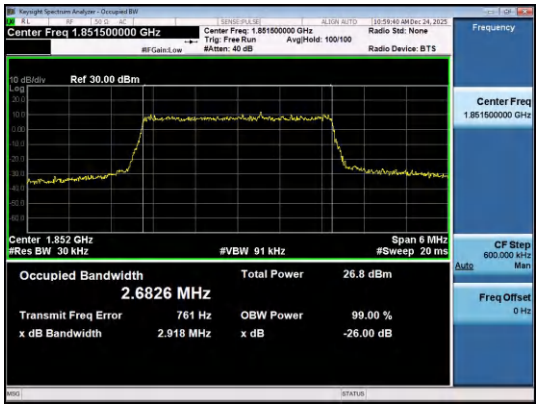

Band2-3MHz-QPSK-18615-15RB#0-PASS

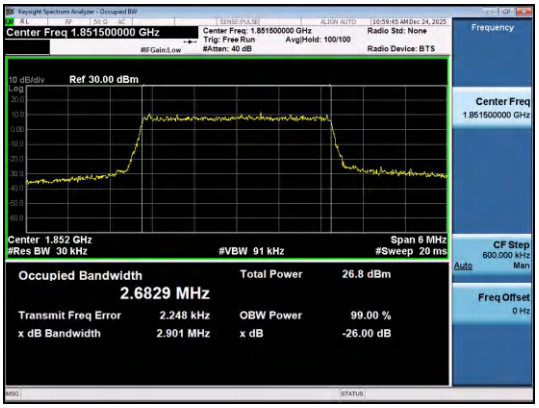

Band2-3MHz-QPSK-18615-15RB#0-PASS

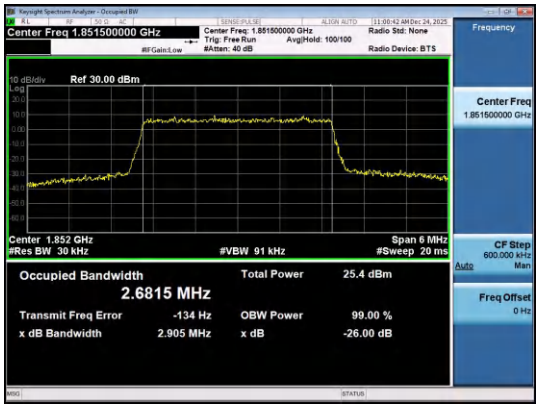

Band2-3MHz-16QAM-18615-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

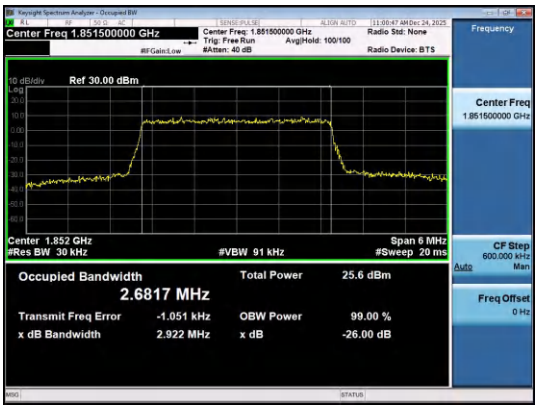

Band2-3MHz-16QAM-18615-15RB#0-PASS

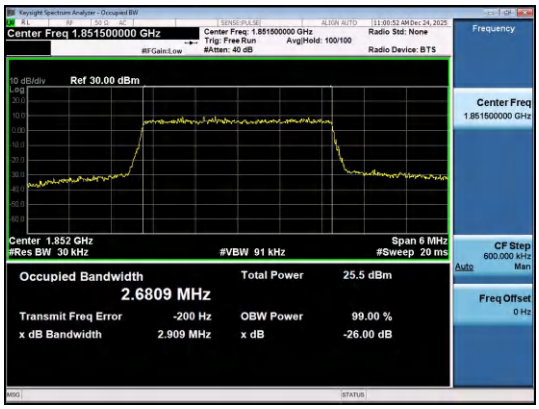

Band2-3MHz-16QAM-18615-15RB#0-PASS

Band2-3MHz-QPSK-18900-15RB#0-PASS

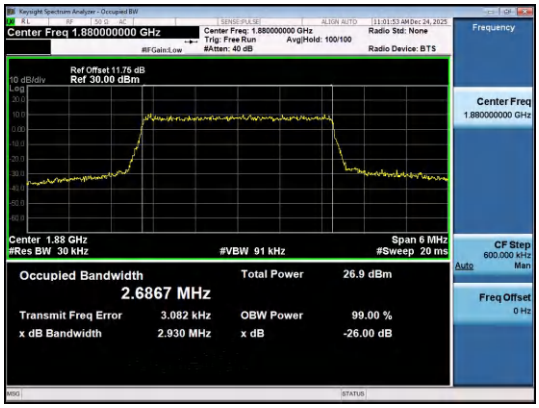

Band2-3MHz-QPSK-18900-15RB#0-PASS

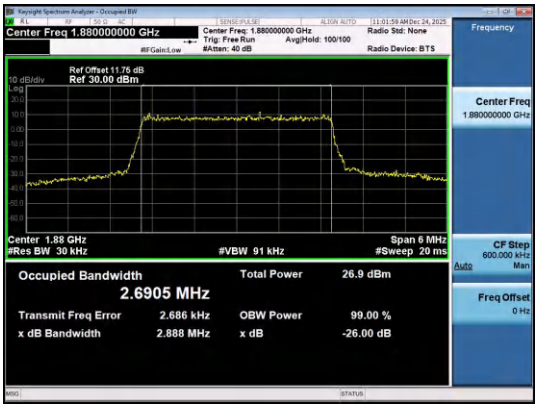

Band2-3MHz-QPSK-18900-15RB#0-PASS

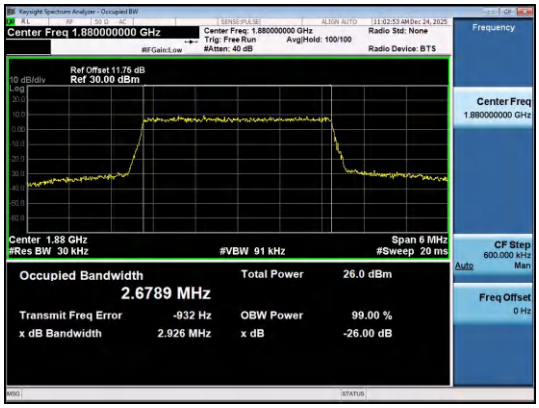

Band2-3MHz-16QAM-18900-15RB#0-PASS

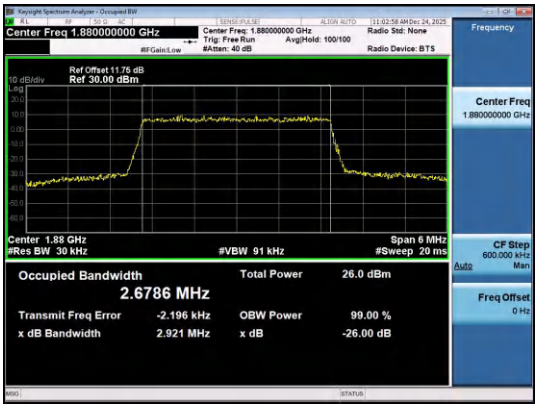

Band2-3MHz-16QAM-18900-15RB#0-PASS

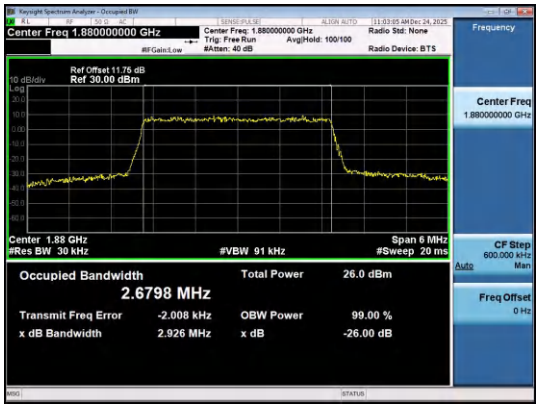

Band2-3MHz-16QAM-18900-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

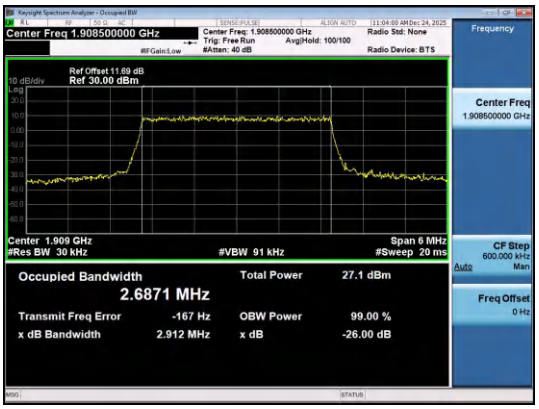

Band2-3MHz-QPSK-19185-15RB#0-PASS

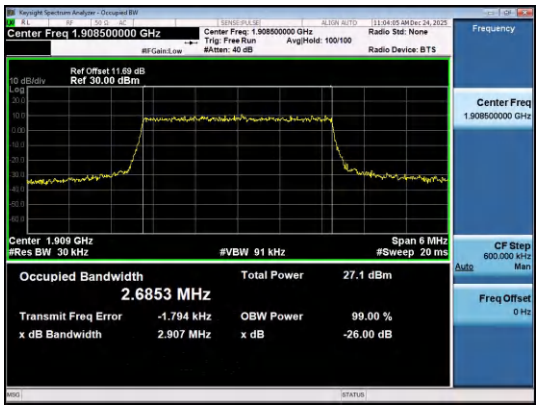

Band2-3MHz-QPSK-19185-15RB#0-PASS

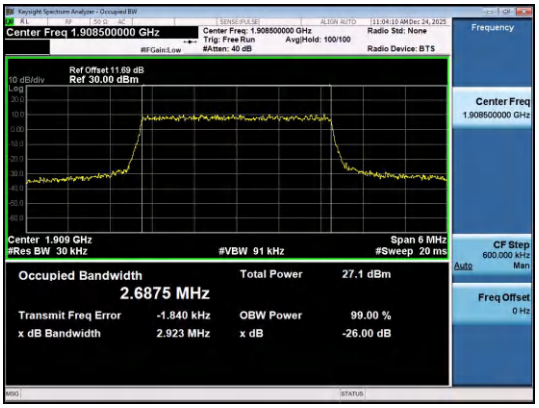

Band2-3MHz-QPSK-19185-15RB#0-PASS

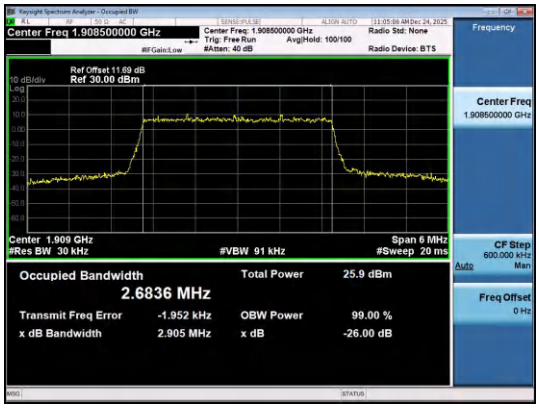

Band2-3MHz-16QAM-19185-15RB#0-PASS

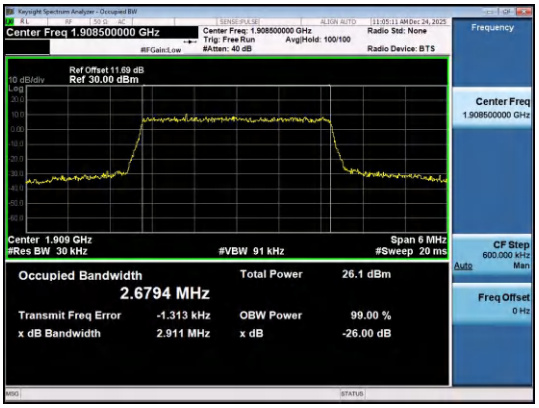

Band2-3MHz-16QAM-19185-15RB#0-PASS

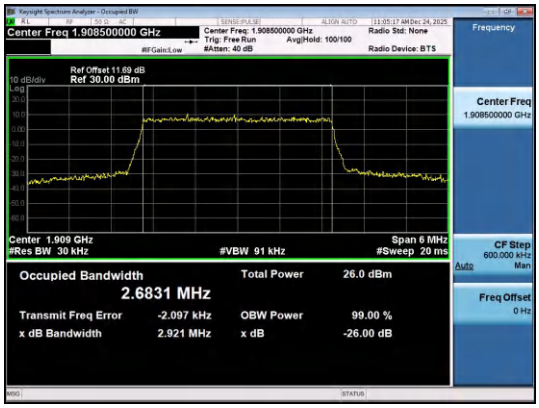

Band2-3MHz-16QAM-19185-15RB#0-PASS

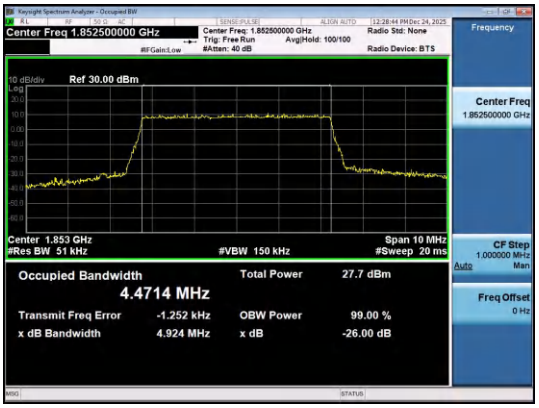

Band2-5MHz-QPSK-18625-25RB#0-PASS

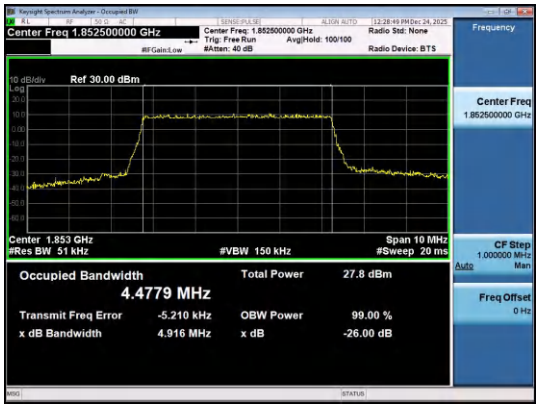

Band2-5MHz-QPSK-18625-25RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

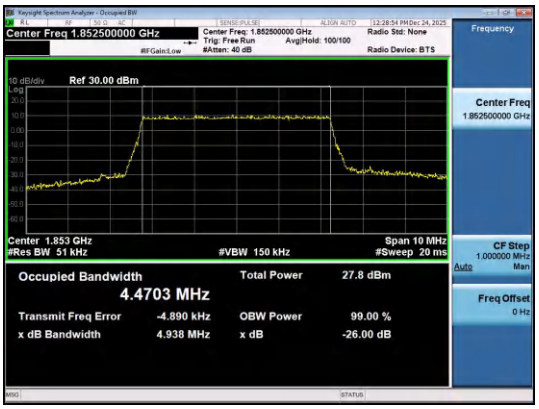

Band2-5MHz-QPSK-18625-25RB#0-PASS

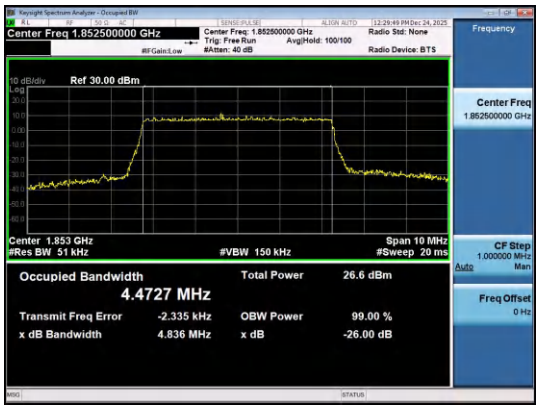

Band2-5MHz-16QAM-18625-25RB#0-PASS

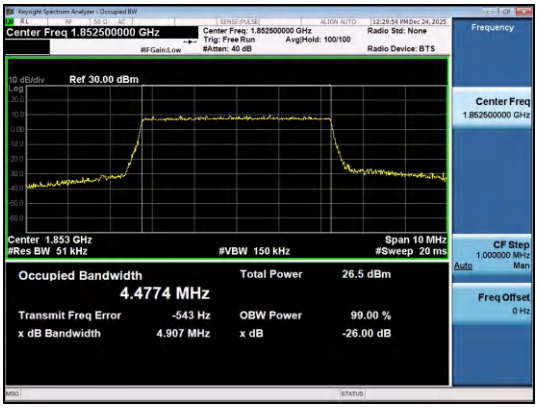

Band2-5MHz-16QAM-18625-25RB#0-PASS

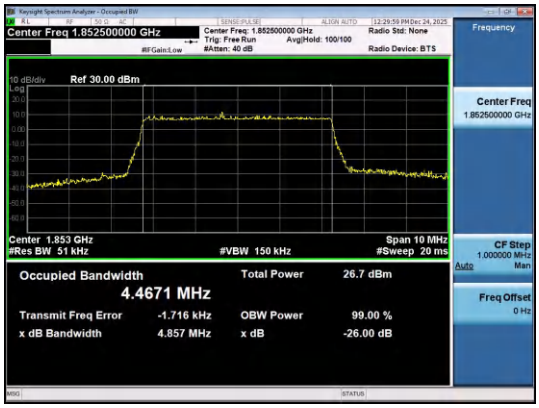

Band2-5MHz-16QAM-18625-25RB#0-PASS

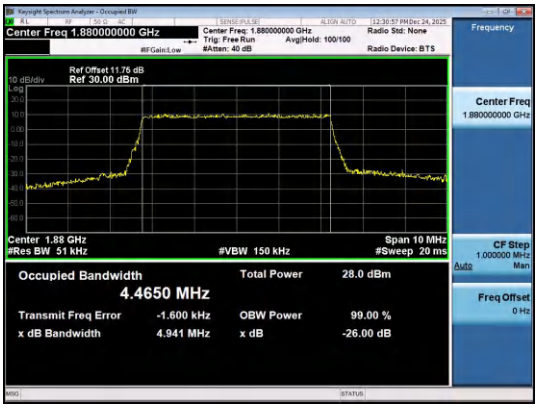

Band2-5MHz-QPSK-18900-25RB#0-PASS

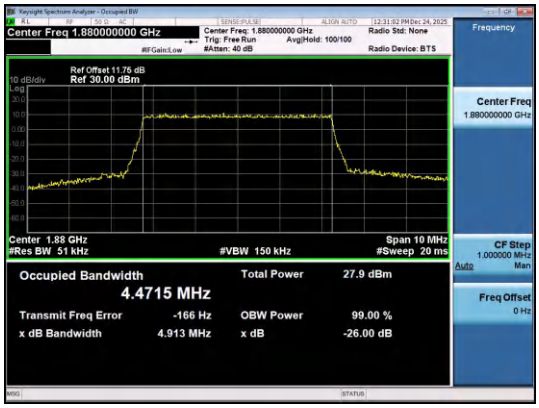

Band2-5MHz-QPSK-18900-25RB#0-PASS

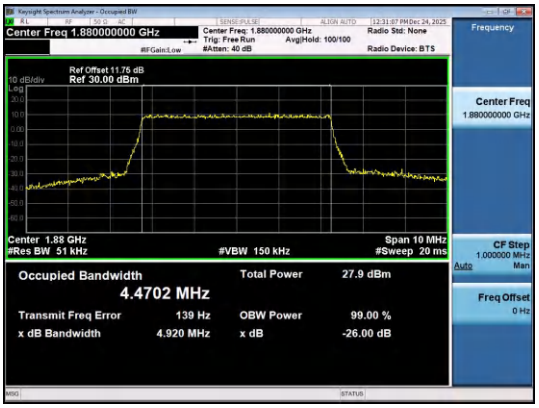

Band2-5MHz-QPSK-18900-25RB#0-PASS

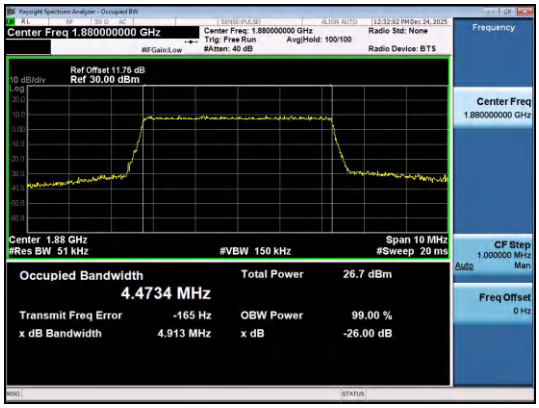

Band2-5MHz-16QAM-18900-25RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

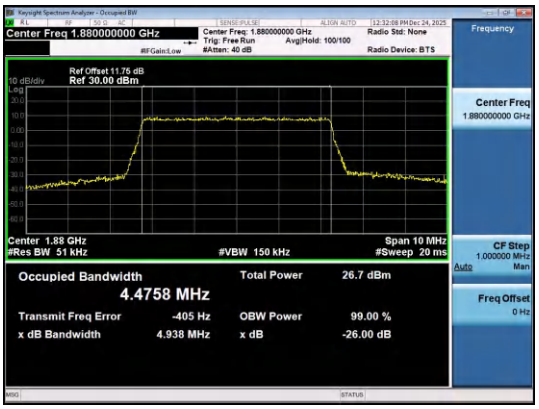

Band2-5MHz-16QAM-18900-25RB#0-PASS

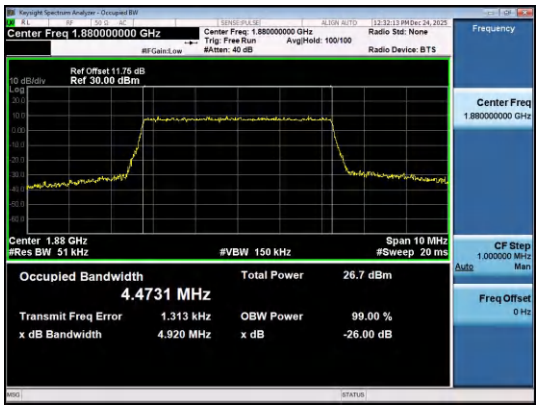

Band2-5MHz-16QAM-18900-25RB#0-PASS

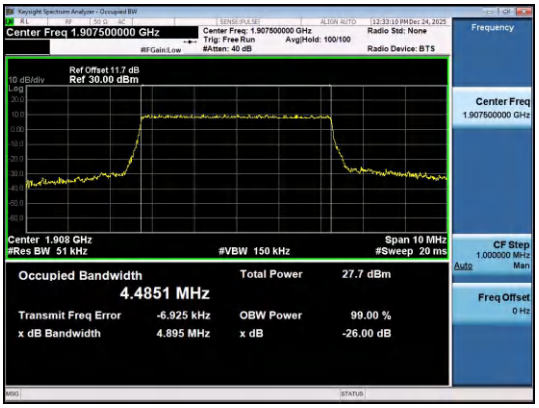

Band2-5MHz-QPSK-19175-25RB#0-PASS

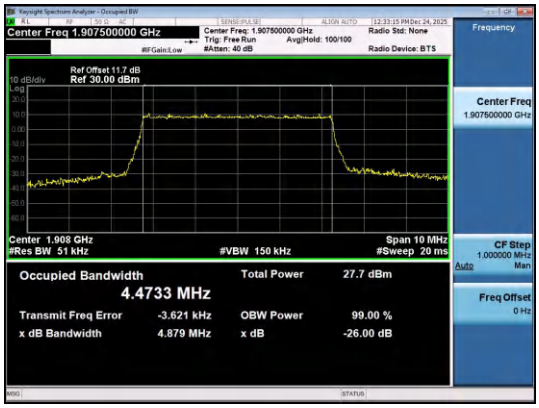

Band2-5MHz-QPSK-19175-25RB#0-PASS

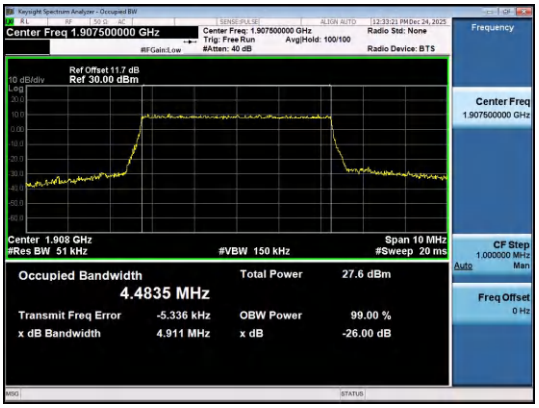

Band2-5MHz-QPSK-19175-25RB#0-PASS

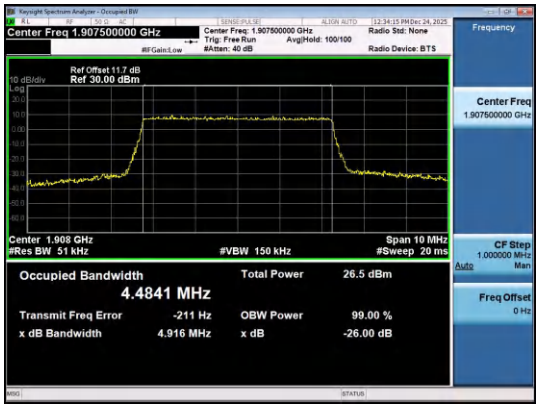

Band2-5MHz-16QAM-19175-25RB#0-PASS

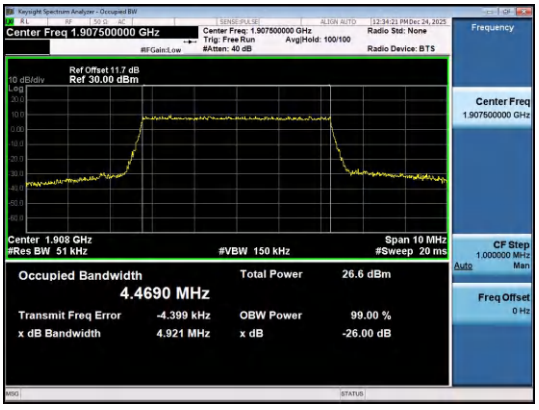

Band2-5MHz-16QAM-19175-25RB#0-PASS

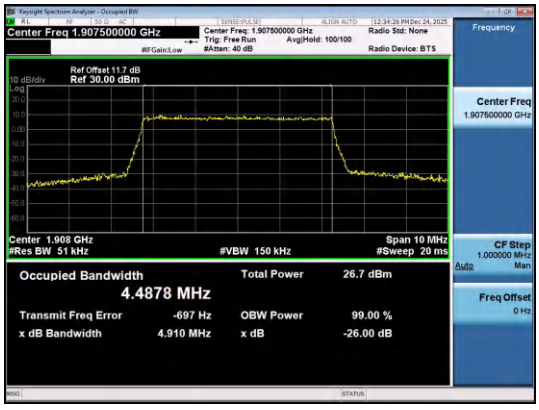

Band2-5MHz-16QAM-19175-25RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

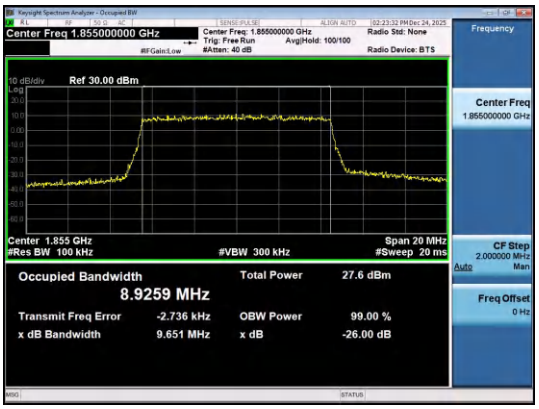

Band2-10MHz-QPSK-18650-50RB#0-PASS

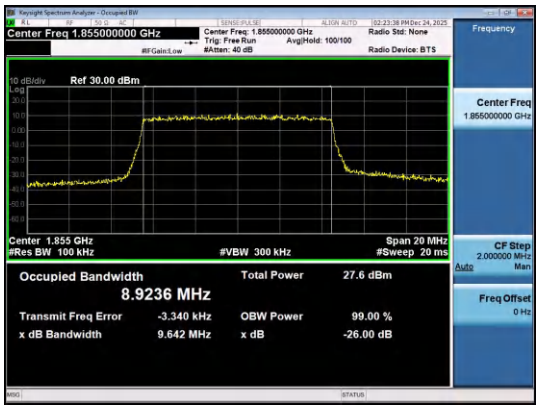

Band2-10MHz-QPSK-18650-50RB#0-PASS

Band2-10MHz-QPSK-18650-50RB#0-PASS

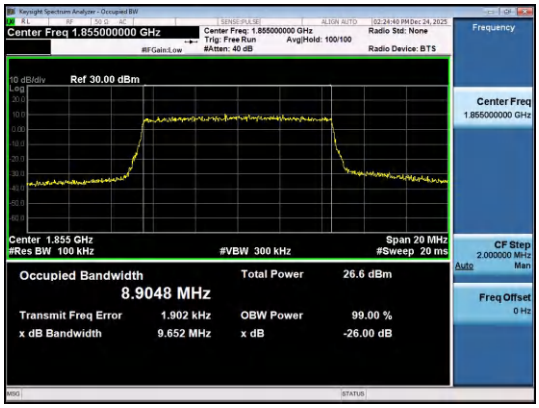

Band2-10MHz-16QAM-18650-50RB#0-PASS

Band2-10MHz-16QAM-18650-50RB#0-PASS

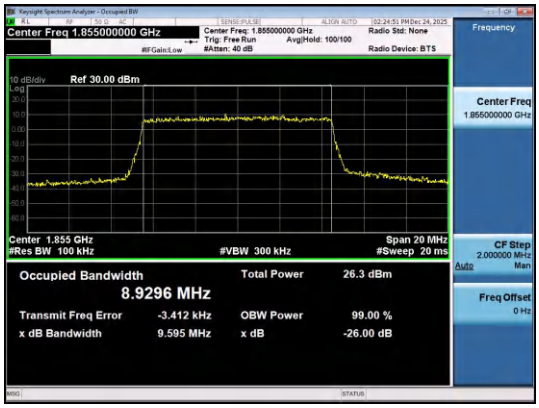

Band2-10MHz-16QAM-18650-50RB#0-PASS

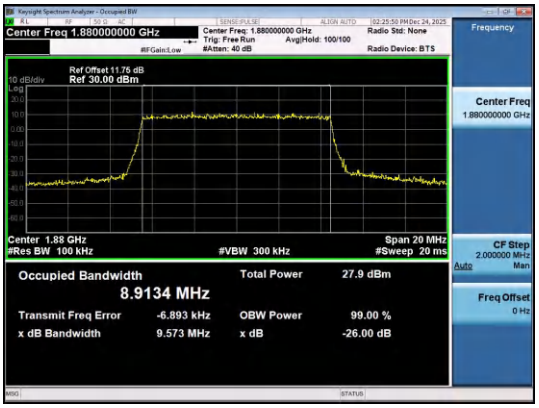

Band2-10MHz-QPSK-18900-50RB#0-PASS

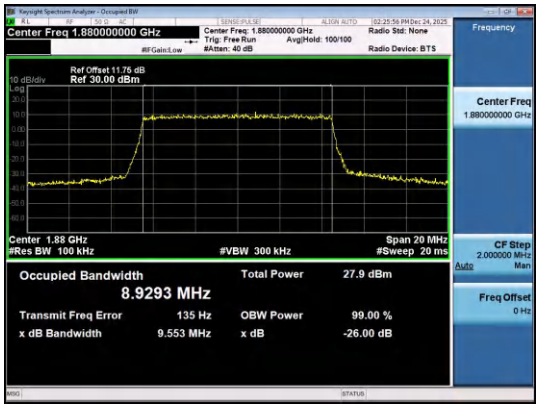

Band2-10MHz-QPSK-18900-50RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2-10MHz-QPSK-18900-50RB#0-PASS

Band2-10MHz-16QAM-18900-50RB#0-PASS

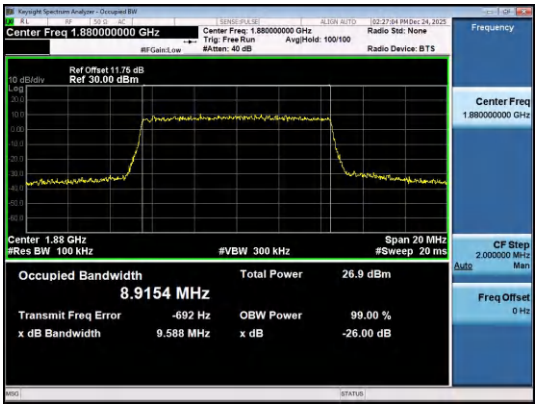

Band2-10MHz-16QAM-18900-50RB#0-PASS

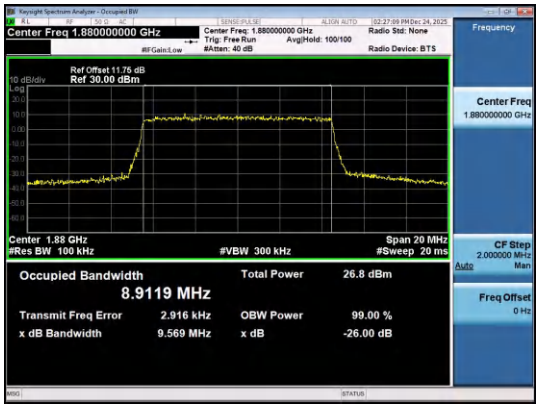

Band2-10MHz-16QAM-18900-50RB#0-PASS

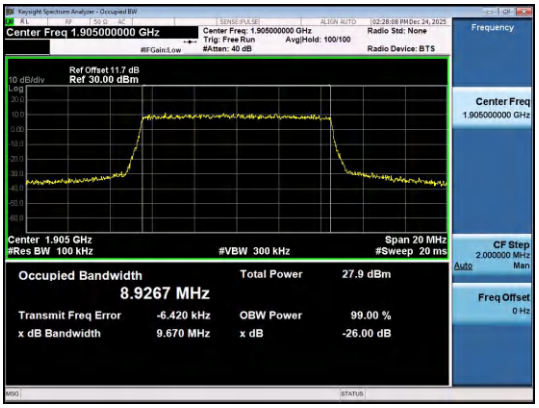

Band2-10MHz-QPSK-19150-50RB#0-PASS

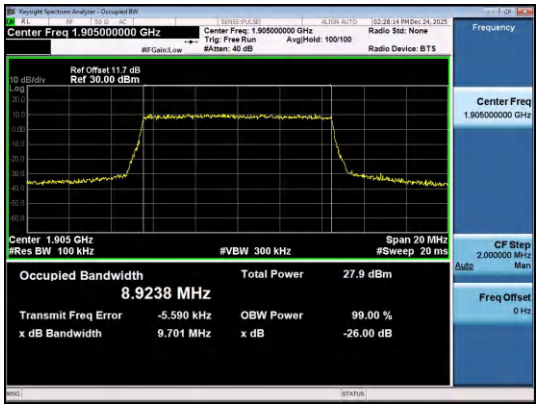

Band2-10MHz-QPSK-19150-50RB#0-PASS

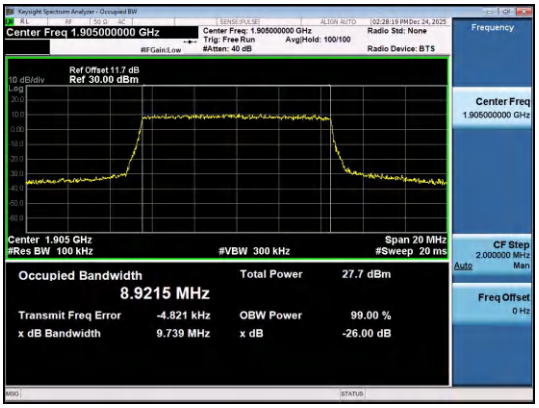

Band2-10MHz-QPSK-19150-50RB#0-PASS

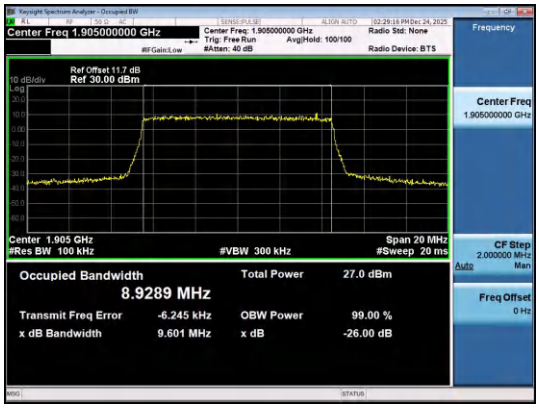

Band2-10MHz-16QAM-19150-50RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

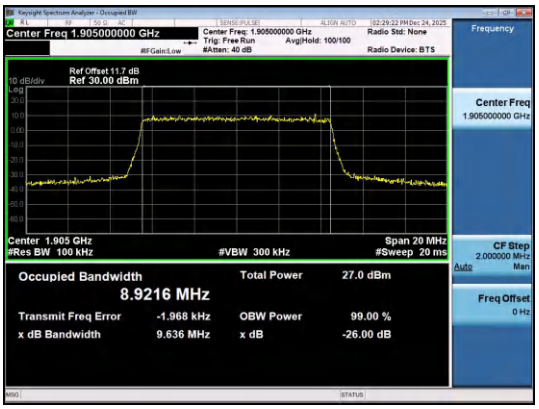

Band2-10MHz-16QAM-19150-50RB#0-PASS

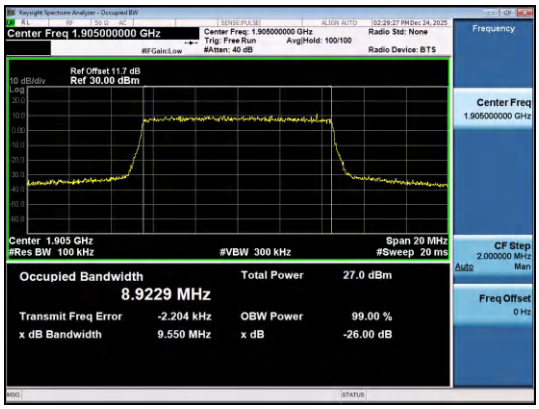

Band2-10MHz-16QAM-19150-50RB#0-PASS

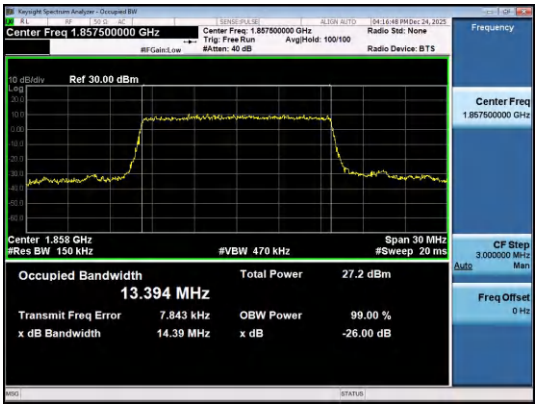

Band2-15MHz-QPSK-18675-75RB#0-PASS

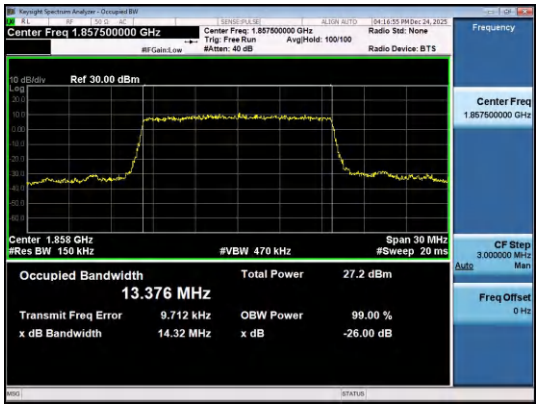

Band2-15MHz-QPSK-18675-75RB#0-PASS

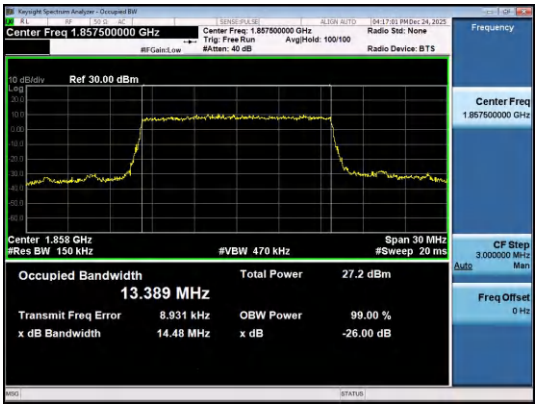

Band2-15MHz-QPSK-18675-75RB#0-PASS

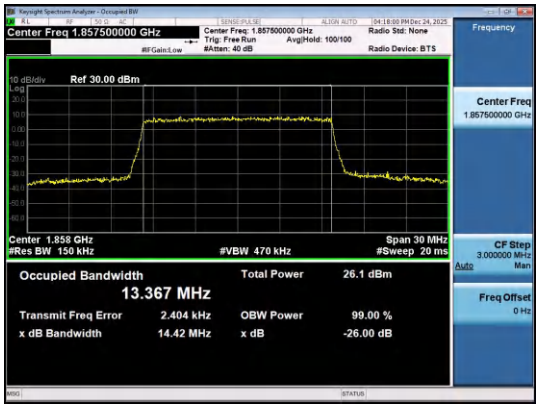

Band2-15MHz-16QAM-18675-75RB#0-PASS

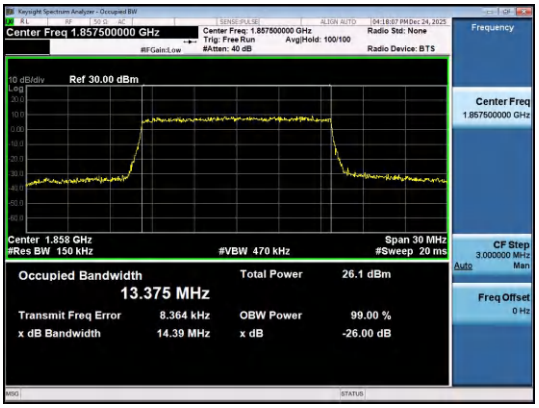

Band2-15MHz-16QAM-18675-75RB#0-PASS

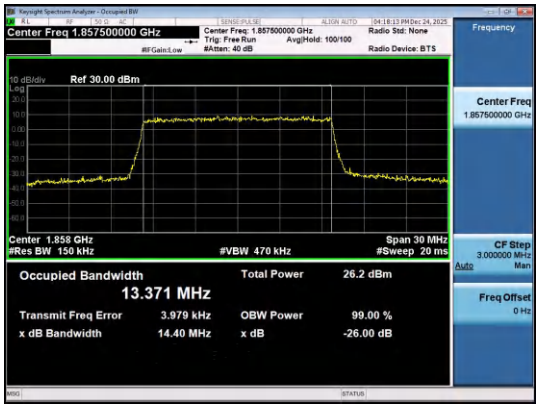

Band2-15MHz-16QAM-18675-75RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

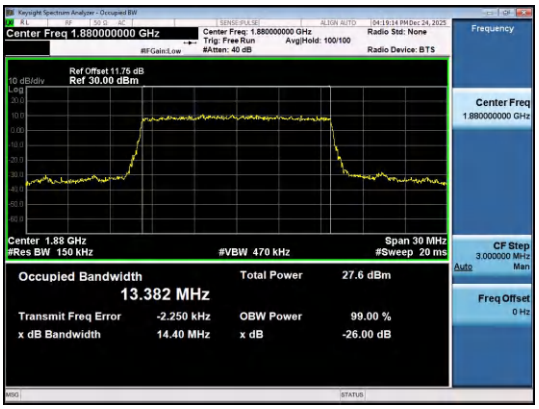

Band2-15MHz-QPSK-18900-75RB#0-PASS

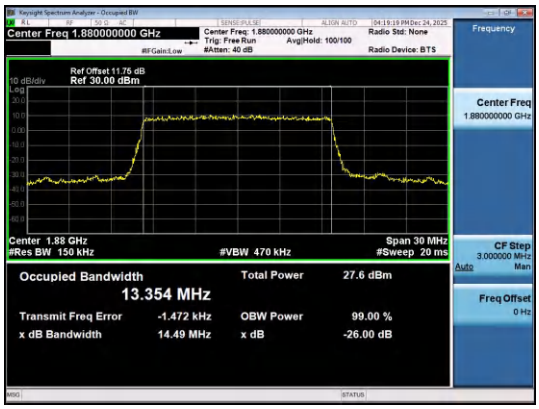

Band2-15MHz-QPSK-18900-75RB#0-PASS

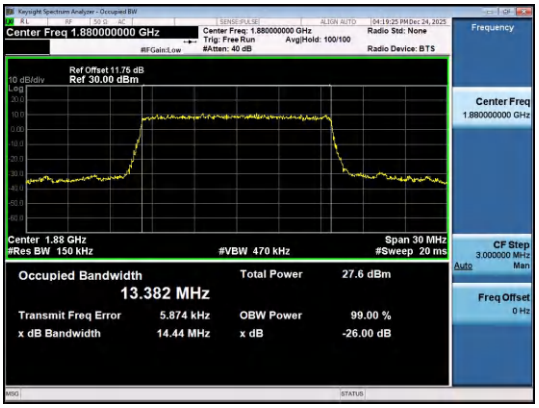

Band2-15MHz-QPSK-18900-75RB#0-PASS

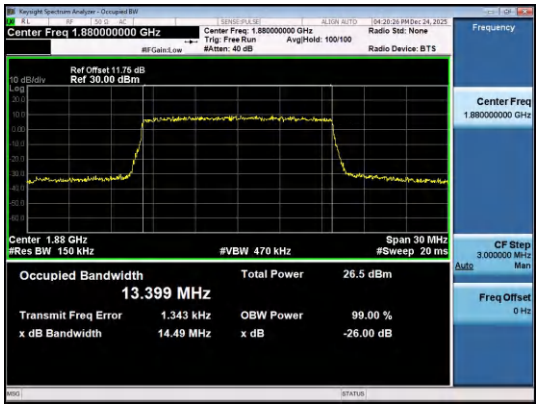

Band2-15MHz-16QAM-18900-75RB#0-PASS

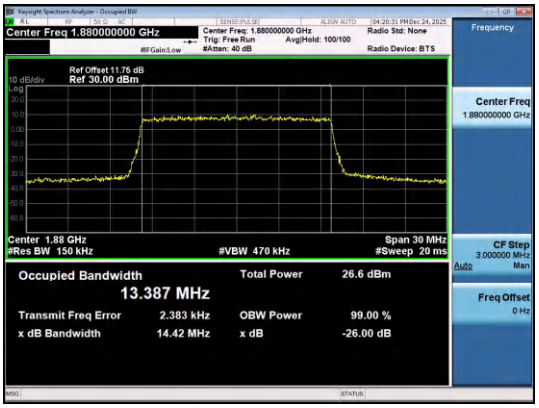

Band2-15MHz-16QAM-18900-75RB#0-PASS

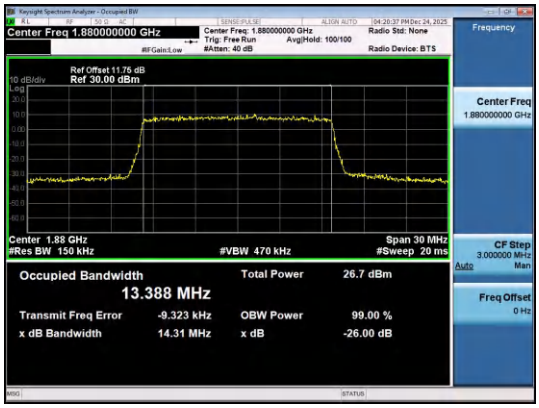

Band2-15MHz-16QAM-18900-75RB#0-PASS

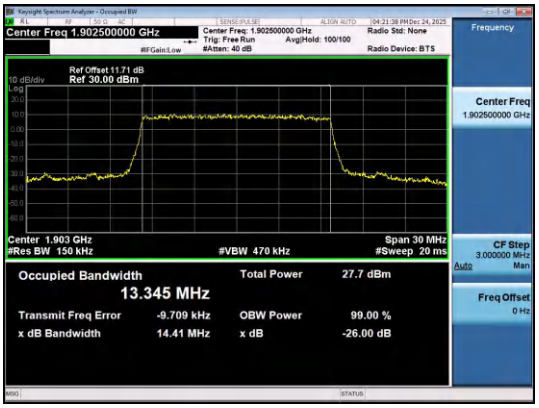

Band2-15MHz-QPSK-19125-75RB#0-PASS

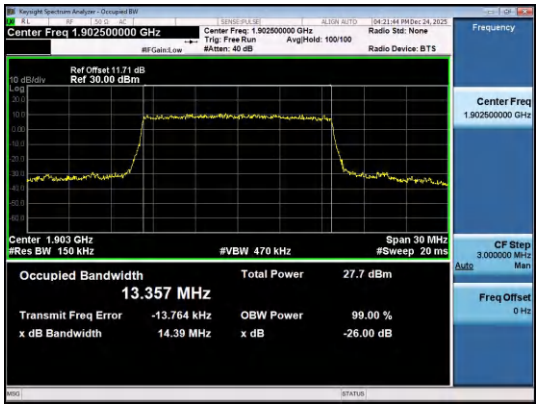

Band2-15MHz-QPSK-19125-75RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

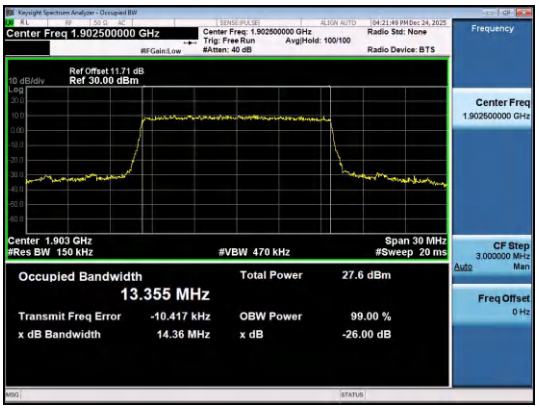

Band2-15MHz-QPSK-19125-75RB#0-PASS

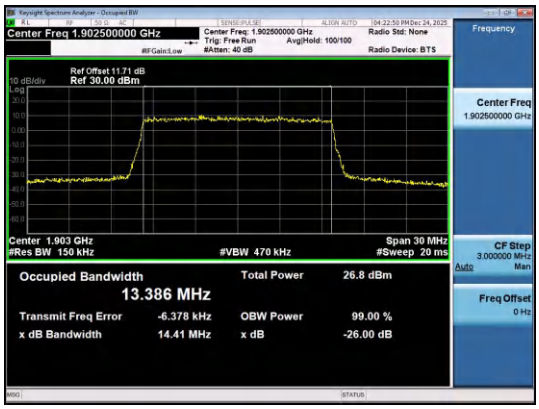

Band2-15MHz-16QAM-19125-75RB#0-PASS

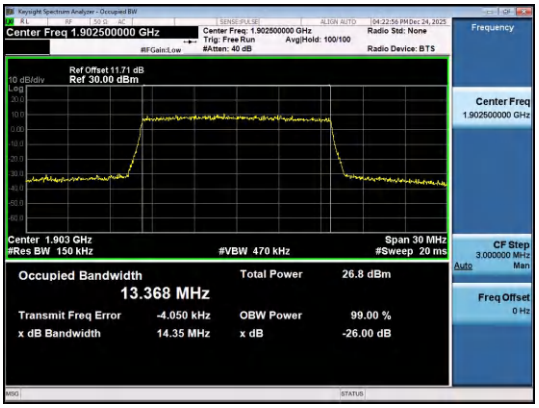

Band2-15MHz-16QAM-19125-75RB#0-PASS

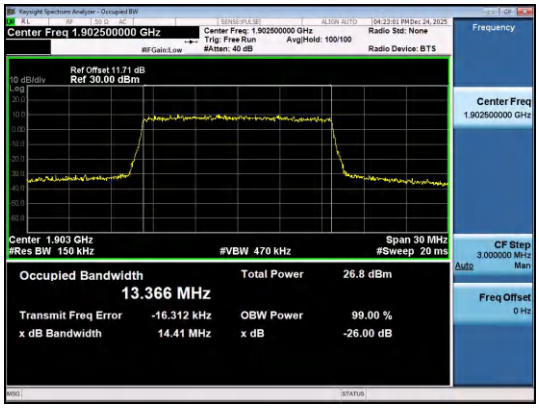

Band2-15MHz-16QAM-19125-75RB#0-PASS

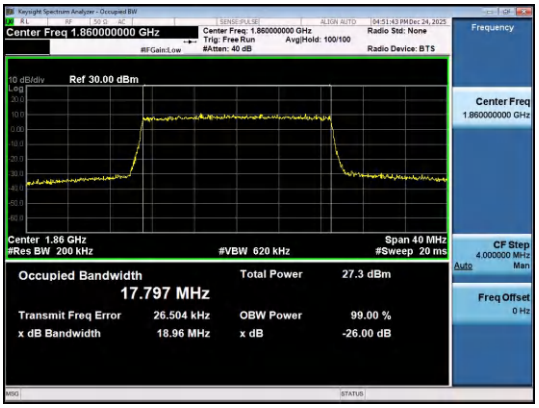

Band2-20MHz-QPSK-18700-100RB#0-PASS

Band2-20MHz-QPSK-18700-100RB#0-PASS

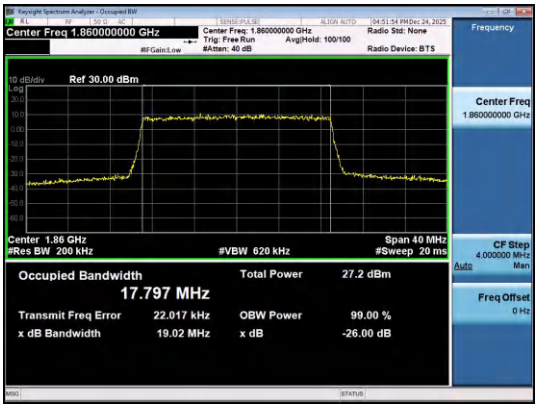

Band2-20MHz-QPSK-18700-100RB#0-PASS

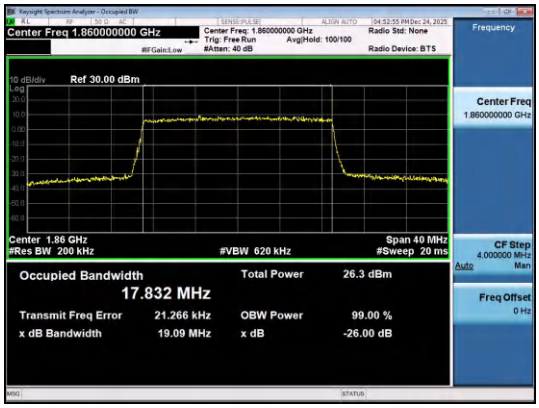

Band2-20MHz-16QAM-18700-100RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

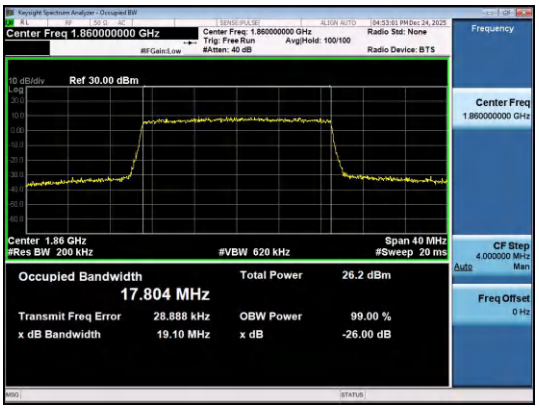

Band2-20MHz-16QAM-18700-100RB#0-PASS

Band2-20MHz-16QAM-18700-100RB#0-PASS

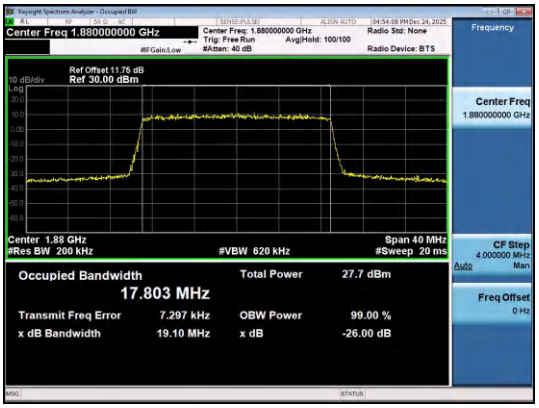

Band2-20MHz-QPSK-18900-100RB#0-PASS

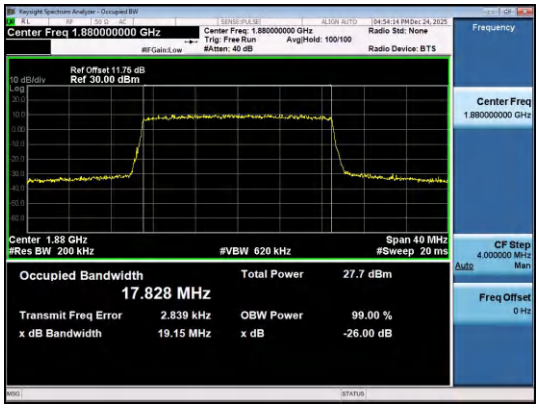

Band2-20MHz-QPSK-18900-100RB#0-PASS

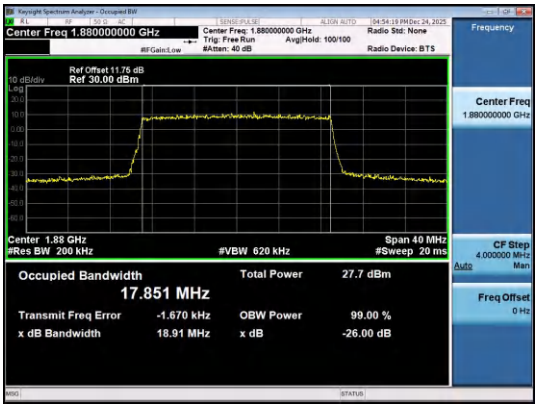

Band2-20MHz-QPSK-18900-100RB#0-PASS

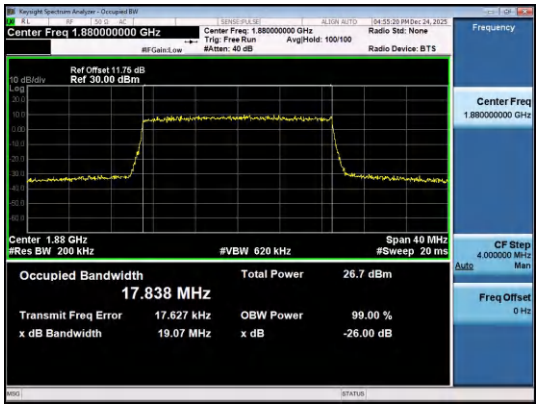

Band2-20MHz-16QAM-18900-100RB#0-PASS

Band2-20MHz-16QAM-18900-100RB#0-PASS

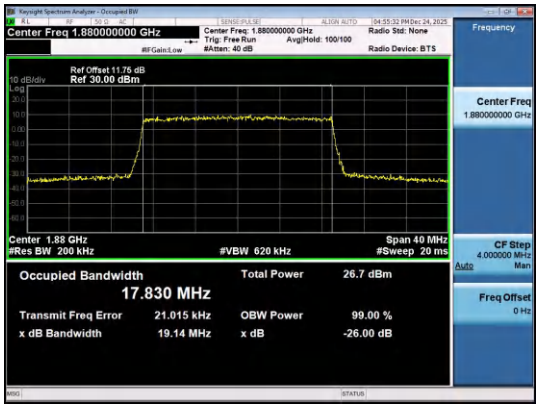

Band2-20MHz-16QAM-18900-100RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2-20MHz-QPSK-19100-100RB#0-PASS

Band2-20MHz-QPSK-19100-100RB#0-PASS

Band2-20MHz-QPSK-19100-100RB#0-PASS

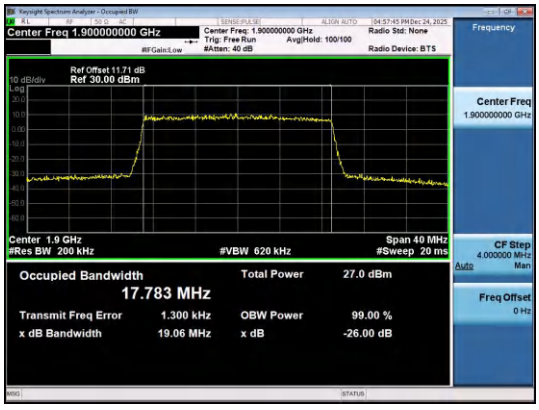

Band2-20MHz-16QAM-19100-100RB#0-PASS

Band2-20MHz-16QAM-19100-100RB#0-PASS

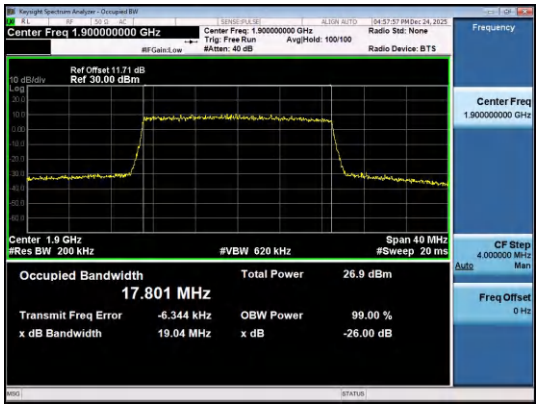

Band2-20MHz-16QAM-19100-100RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Temperature	
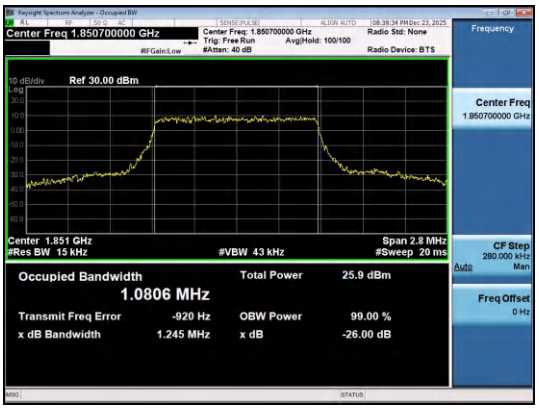	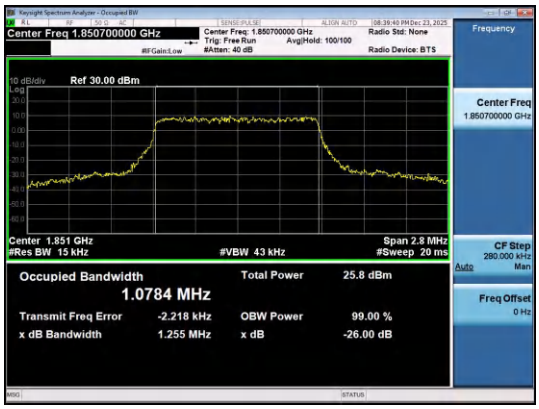
Band2-1.4MHz-QPSK-18607-6RB#0-PASS	Band2-1.4MHz-QPSK-18607-6RB#0-PASS
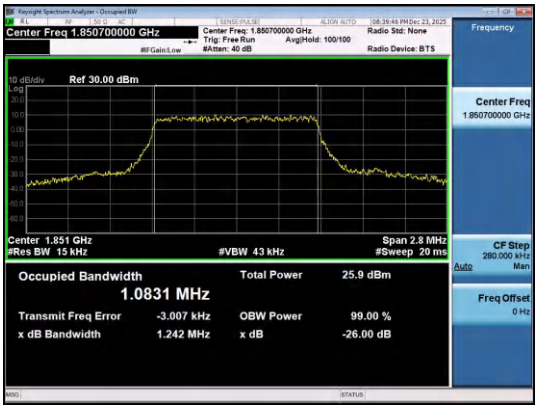	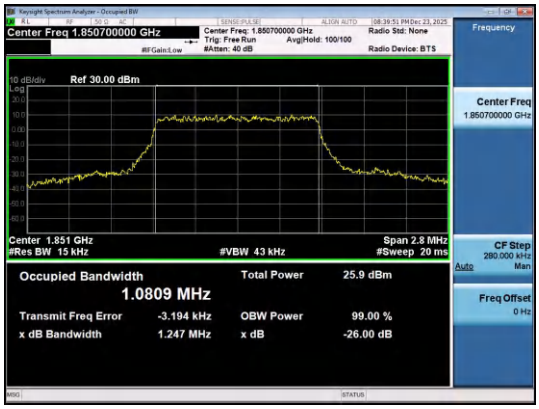
Band2-1.4MHz-QPSK-18607-6RB#0-PASS	Band2-1.4MHz-QPSK-18607-6RB#0-PASS
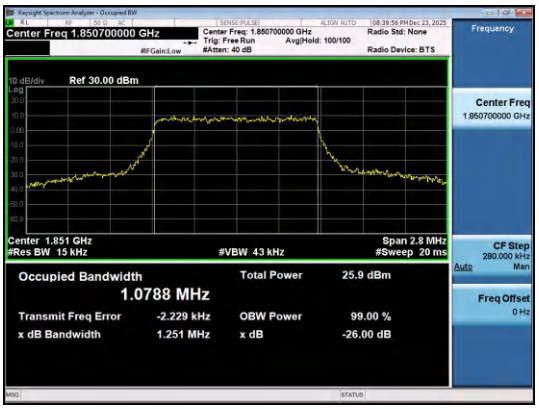	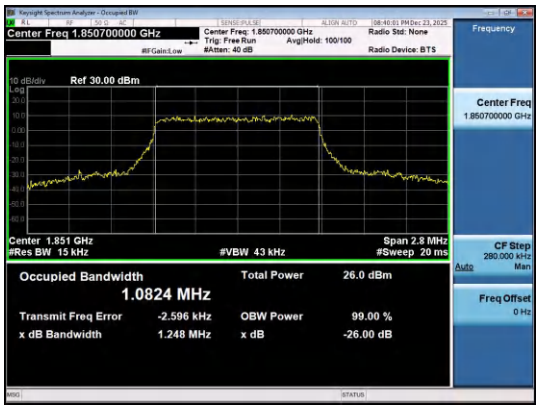
Band2-1.4MHz-QPSK-18607-6RB#0-PASS	Band2-1.4MHz-QPSK-18607-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

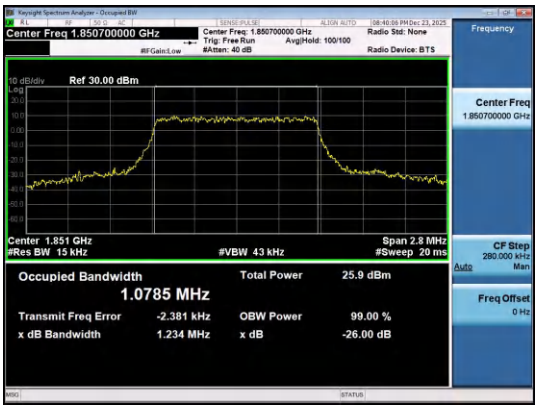

Band2-1.4MHz-QPSK-18607-6RB#0-PASS

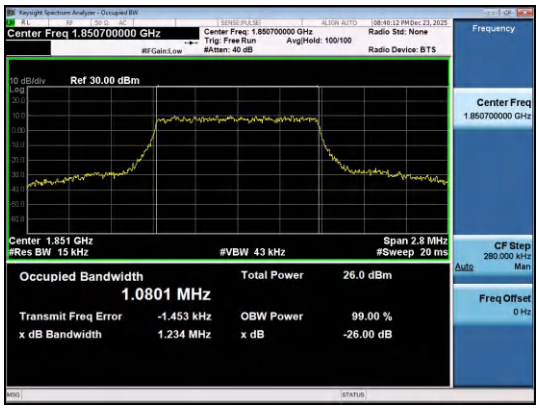

Band2-1.4MHz-QPSK-18607-6RB#0-PASS

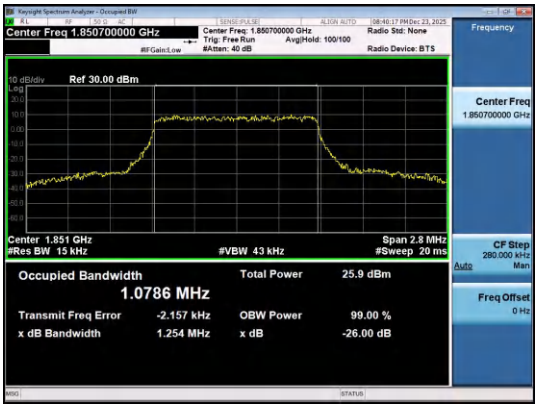

Band2-1.4MHz-QPSK-18607-6RB#0-PASS

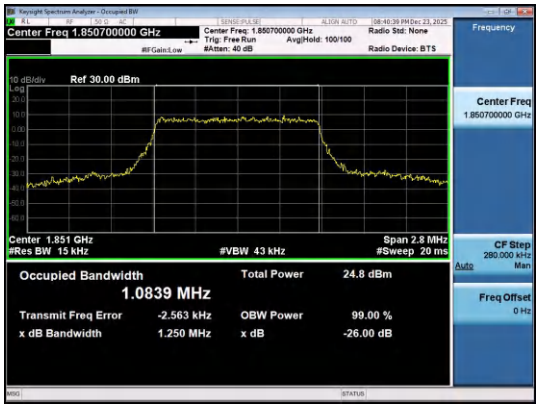

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

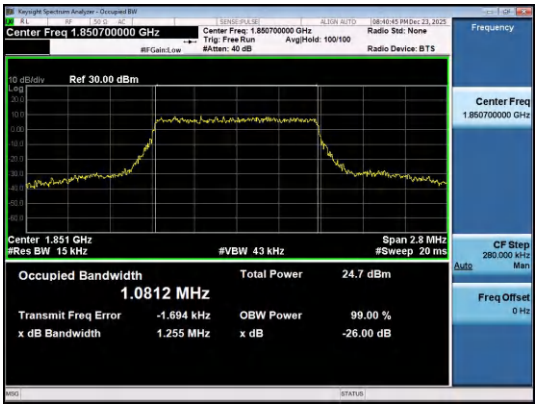

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

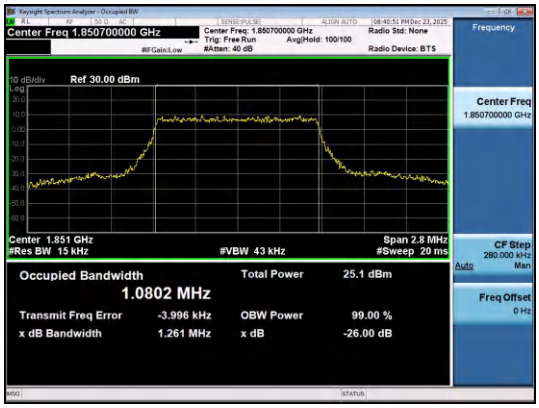

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

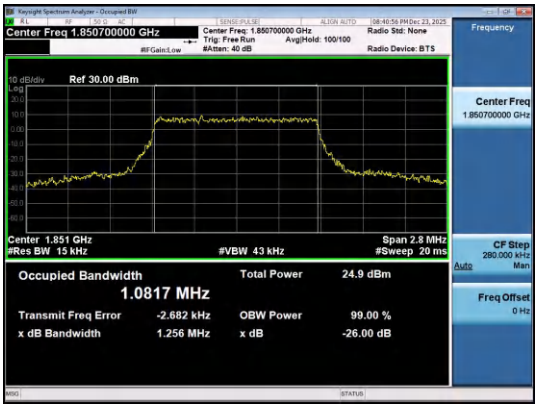

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

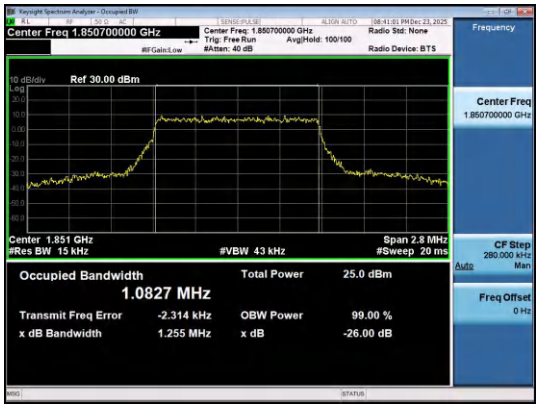

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

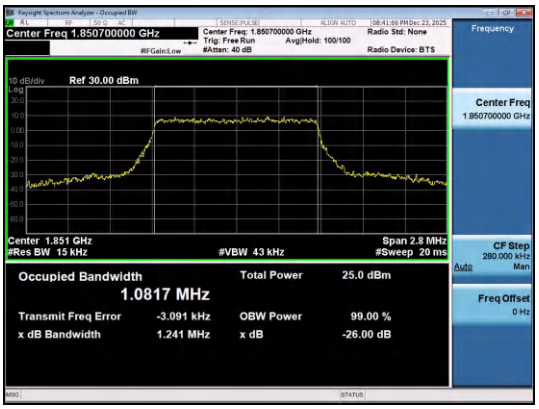

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

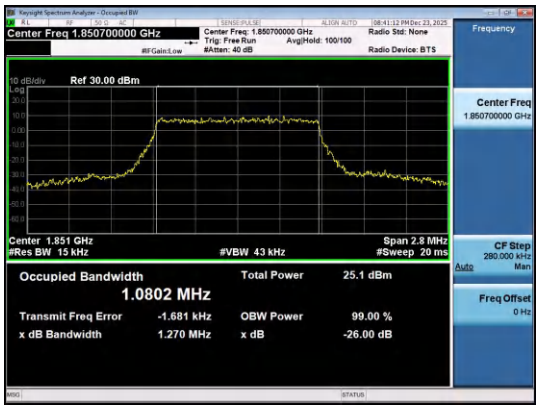

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

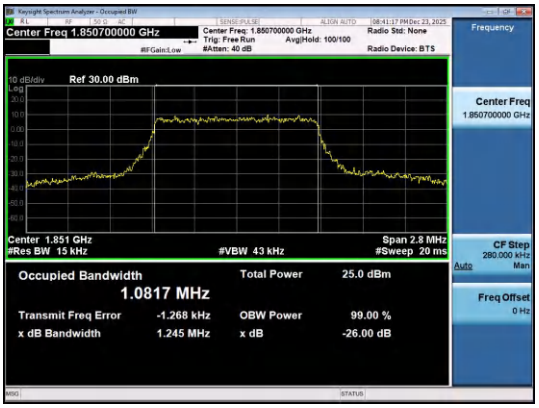

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

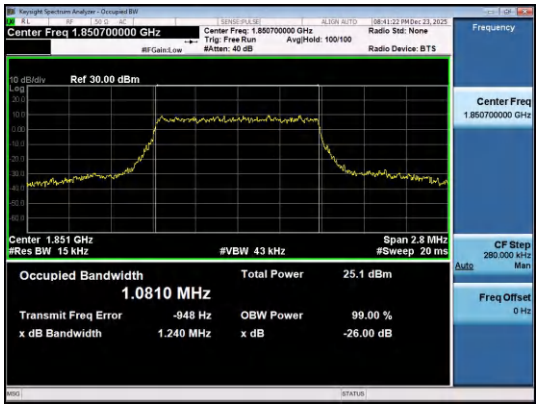

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

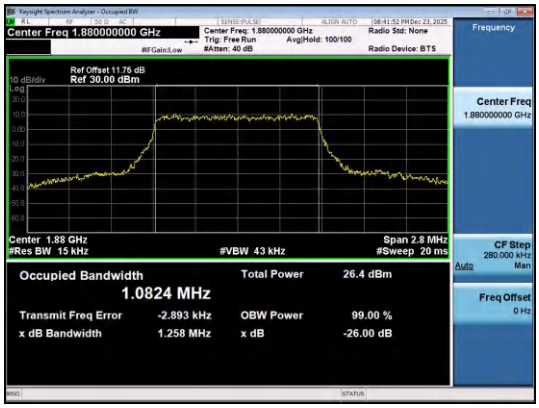

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

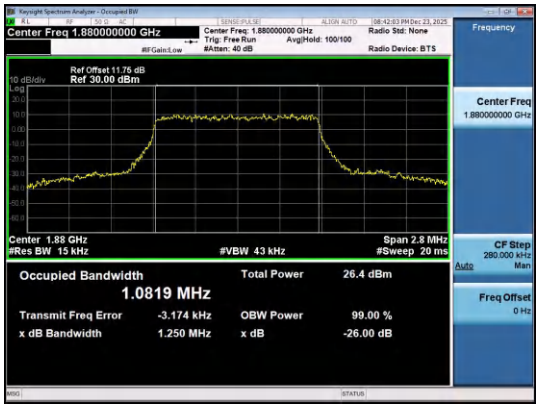

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

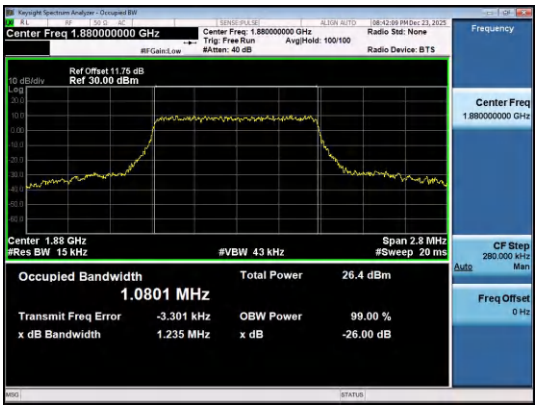

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

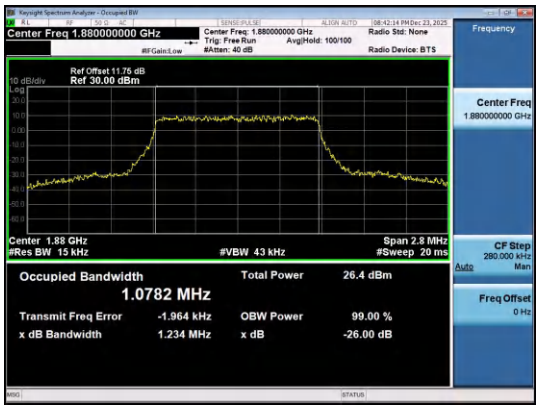

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

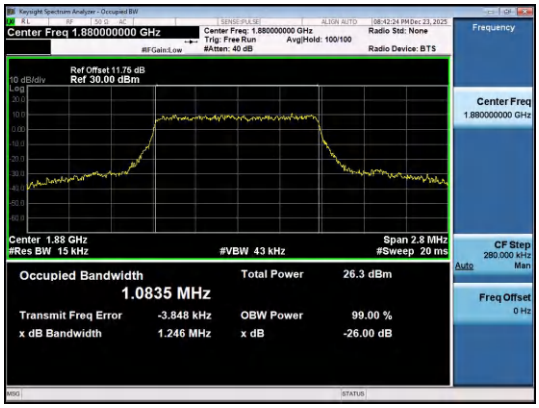

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

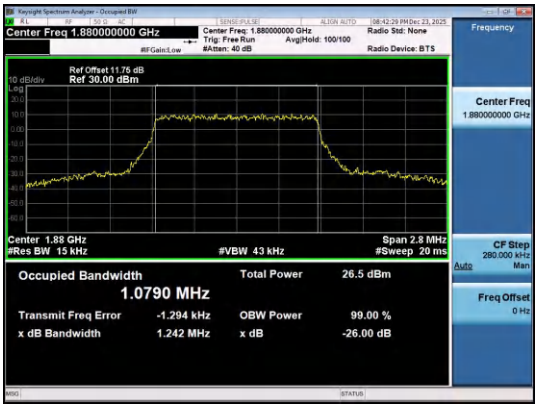

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

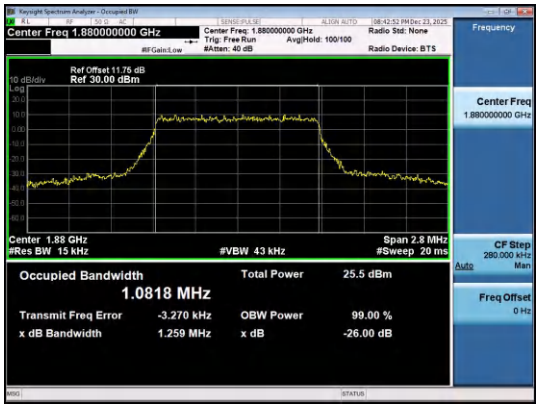

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

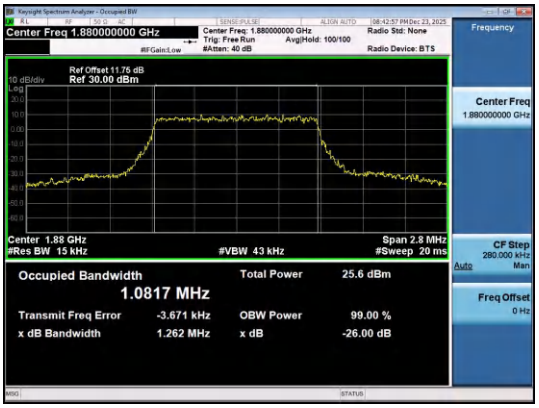

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

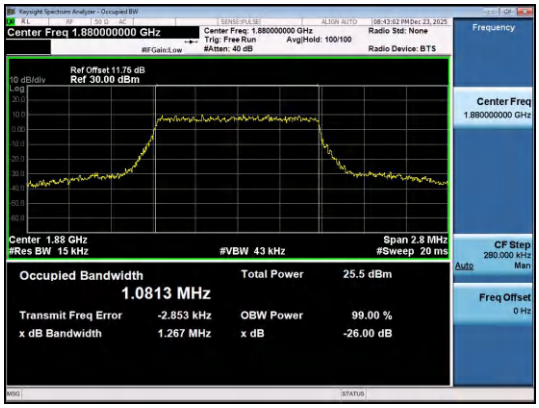

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

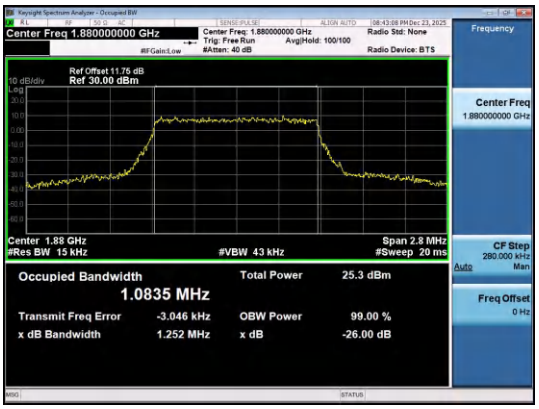

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

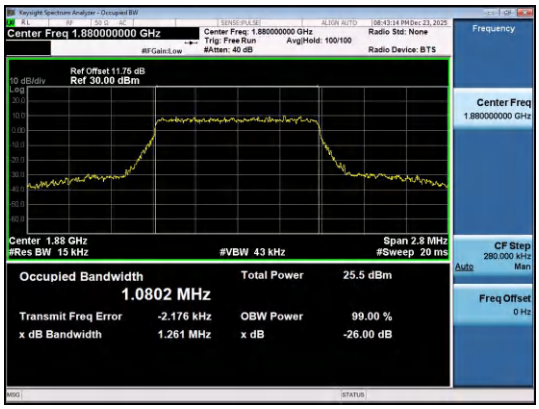

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

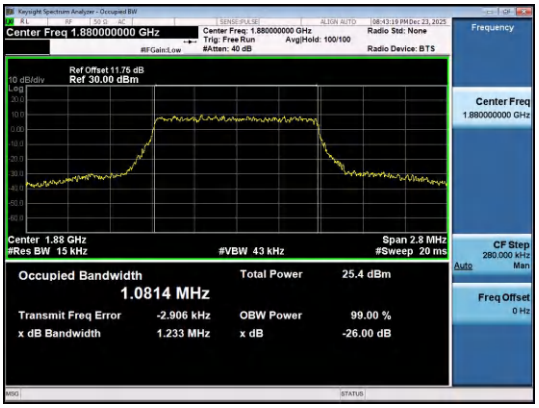

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

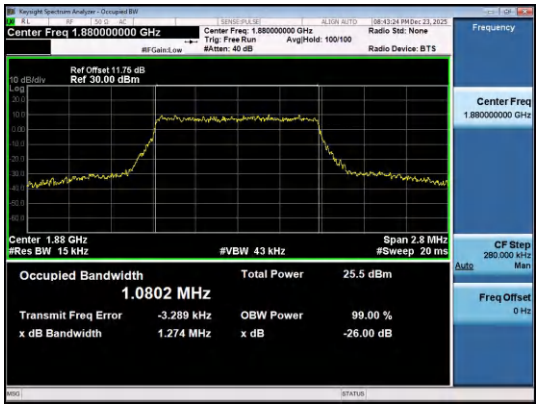

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

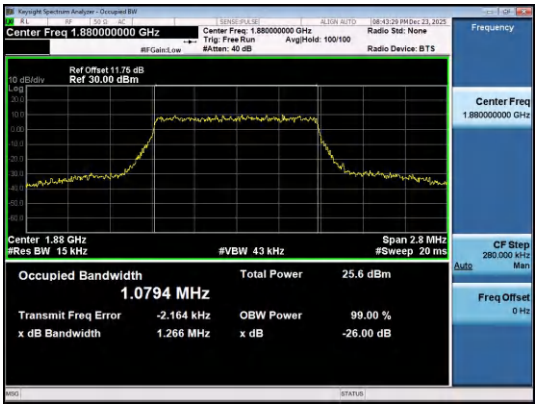

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

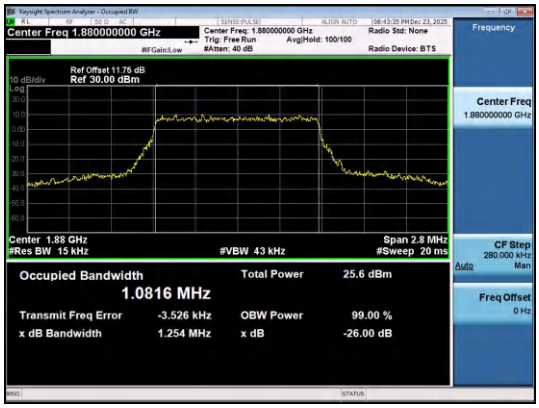

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

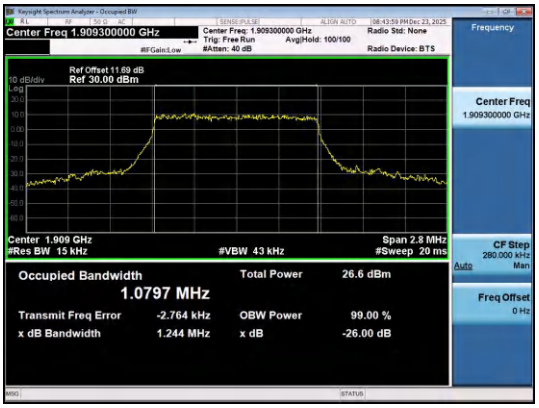

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

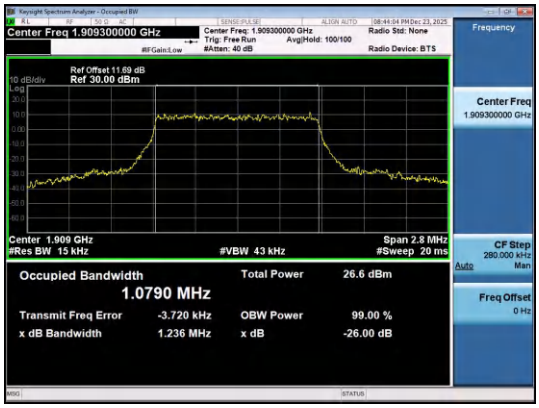

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

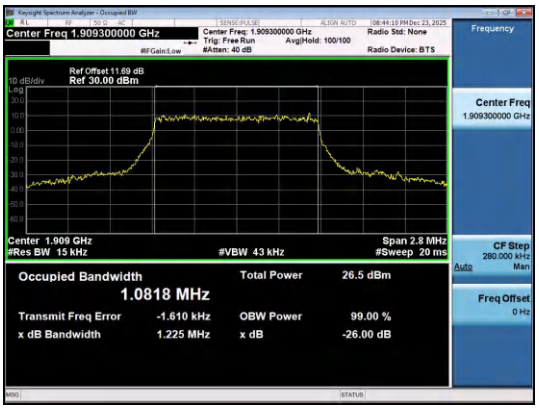

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

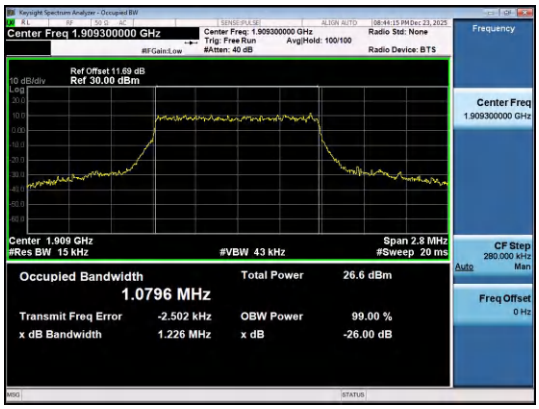

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

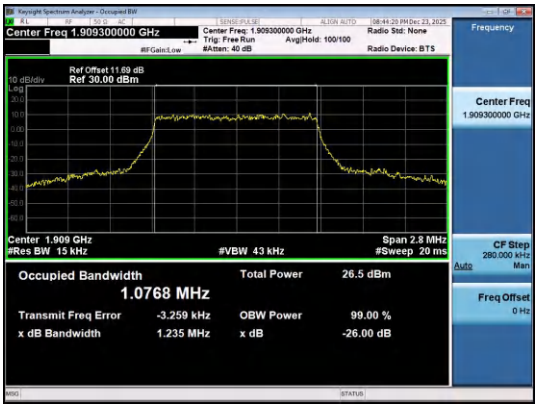

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

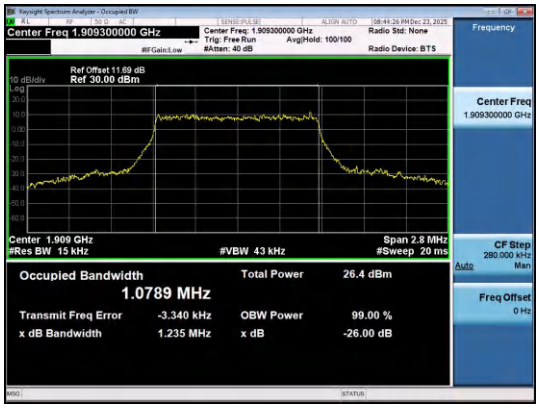

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

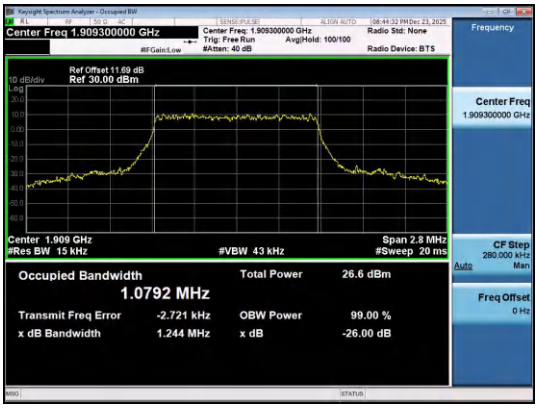

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

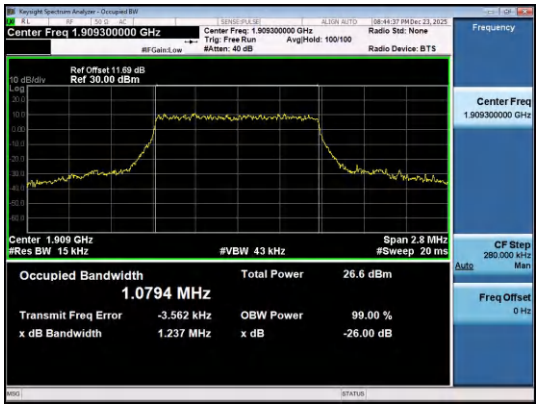

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

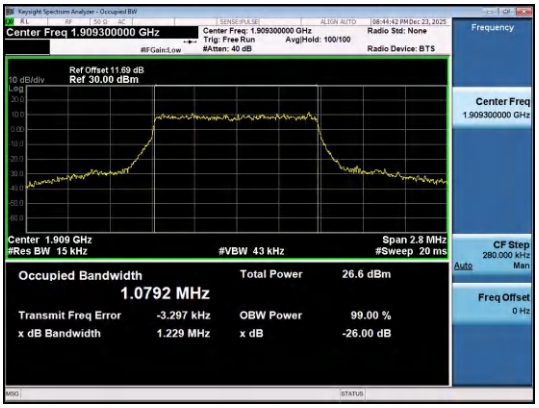

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

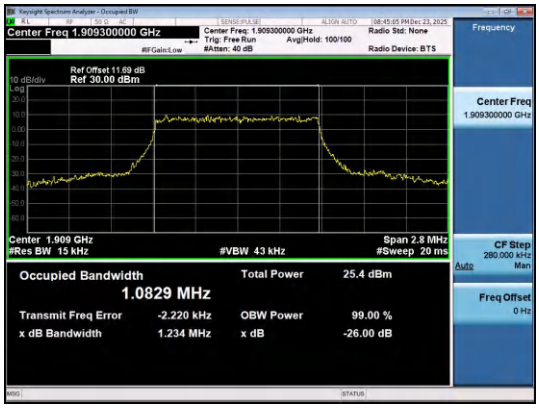

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

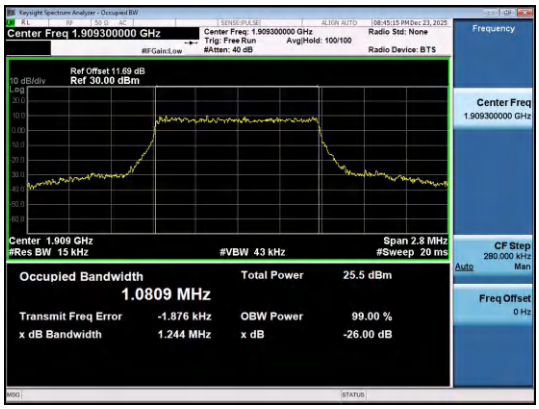

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

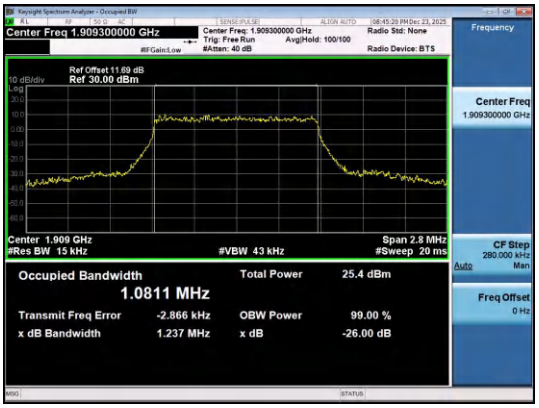

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

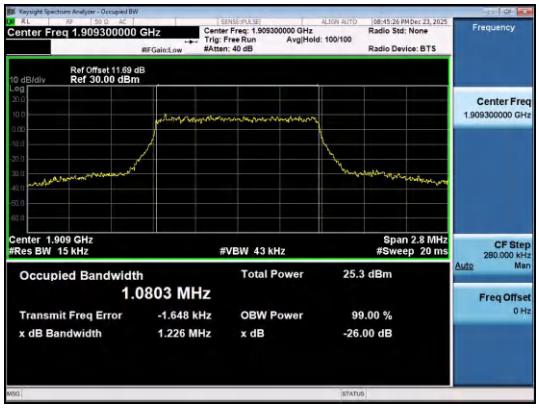

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

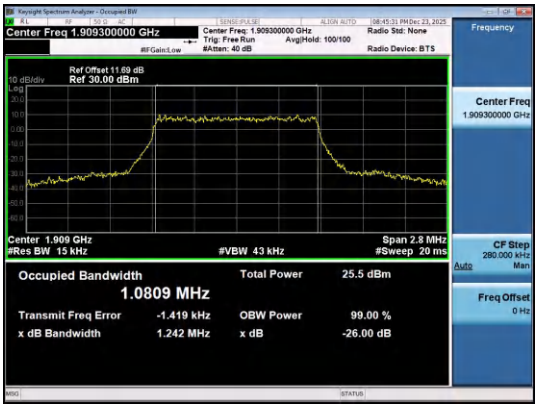

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

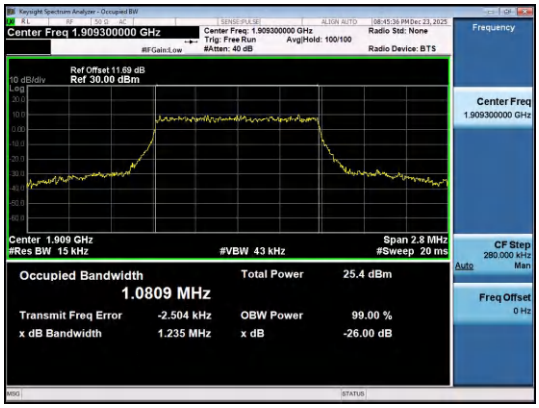

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

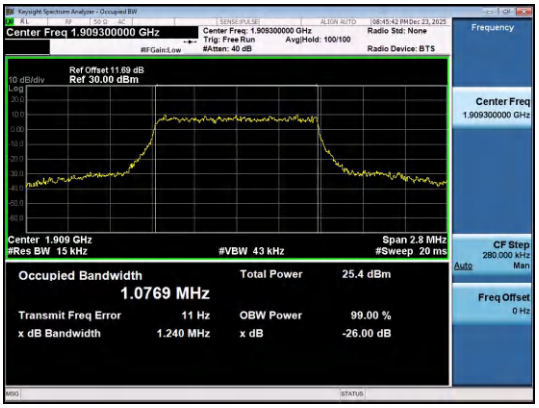

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

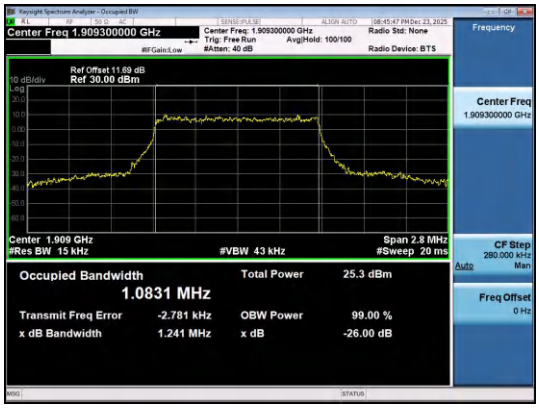

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

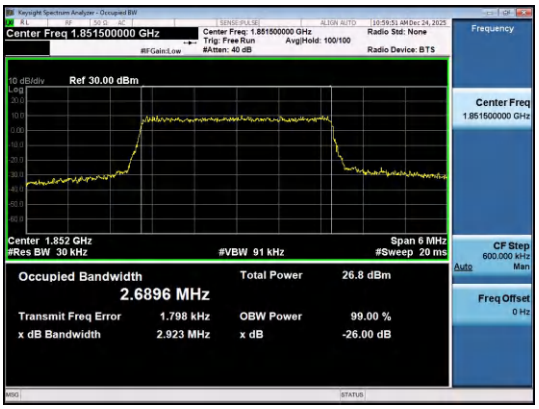

Band2-3MHz-QPSK-18615-15RB#0-PASS

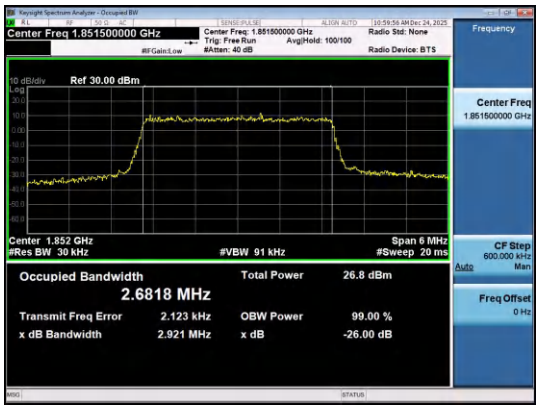

Band2-3MHz-QPSK-18615-15RB#0-PASS

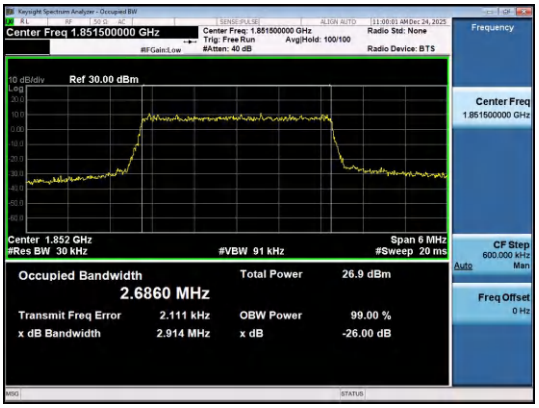

Band2-3MHz-QPSK-18615-15RB#0-PASS

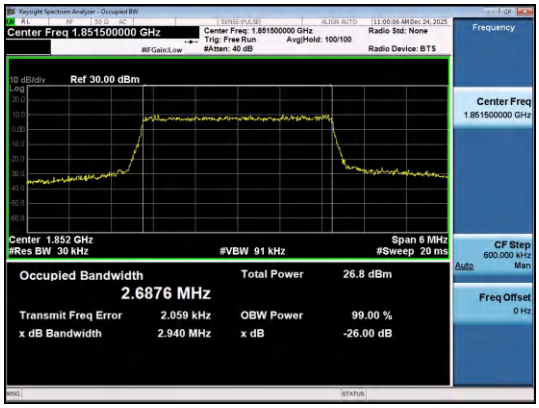

Band2-3MHz-QPSK-18615-15RB#0-PASS

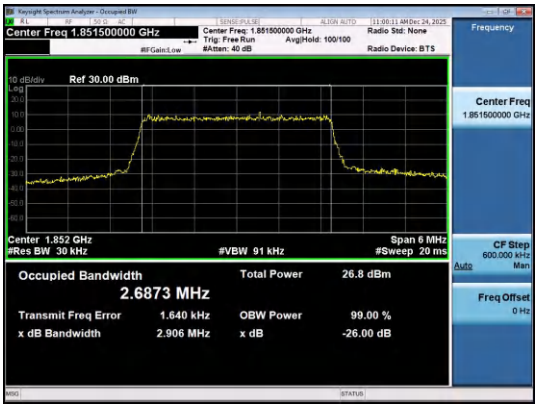

Band2-3MHz-QPSK-18615-15RB#0-PASS

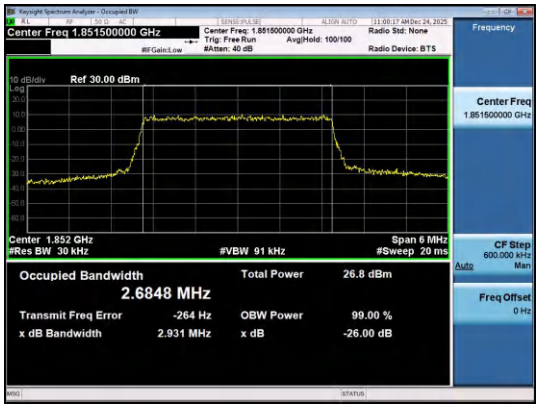

Band2-3MHz-QPSK-18615-15RB#0-PASS

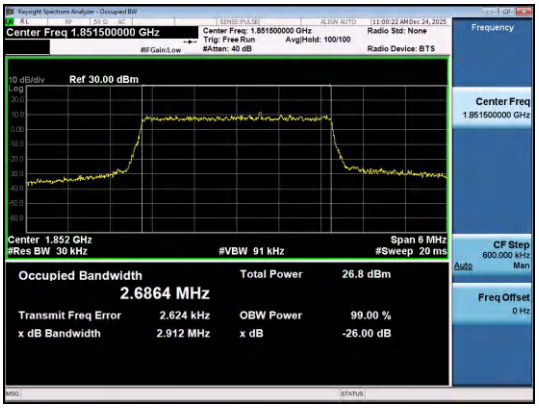

Band2-3MHz-QPSK-18615-15RB#0-PASS

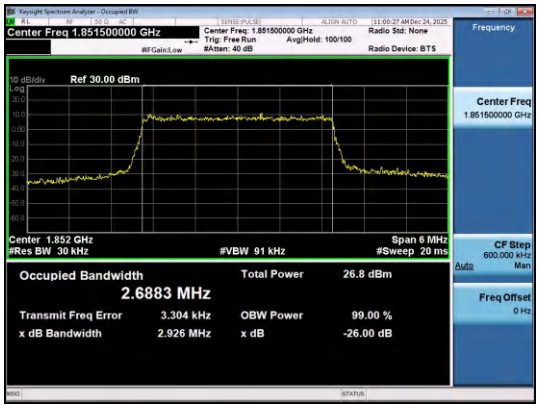

Band2-3MHz-QPSK-18615-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

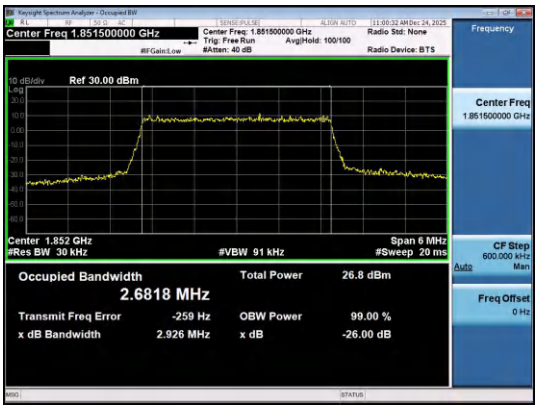

Band2-3MHz-QPSK-18615-15RB#0-PASS

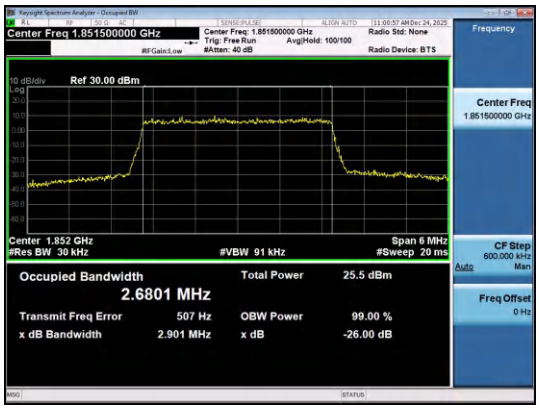

Band2-3MHz-16QAM-18615-15RB#0-PASS

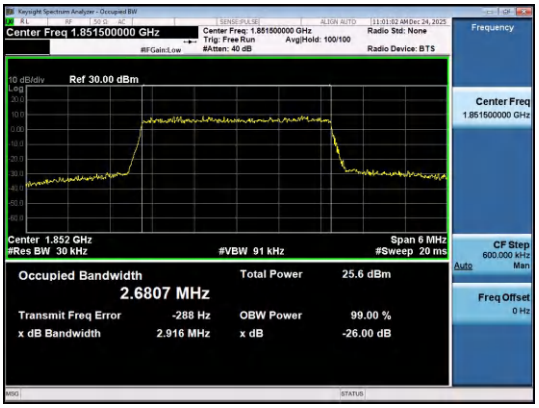

Band2-3MHz-16QAM-18615-15RB#0-PASS

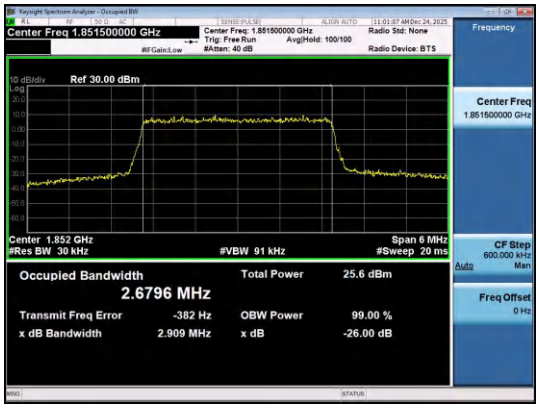

Band2-3MHz-16QAM-18615-15RB#0-PASS

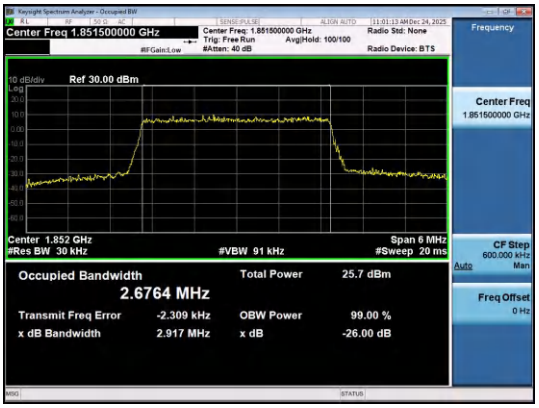

Band2-3MHz-16QAM-18615-15RB#0-PASS

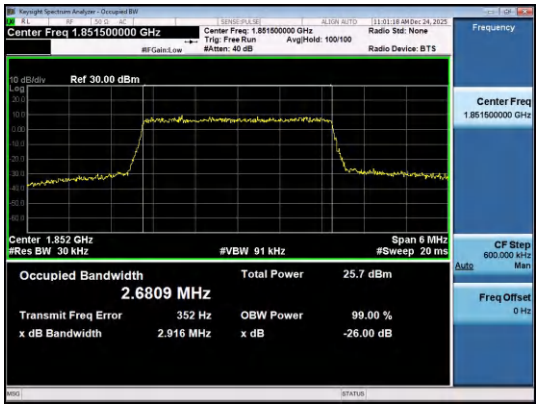

Band2-3MHz-16QAM-18615-15RB#0-PASS

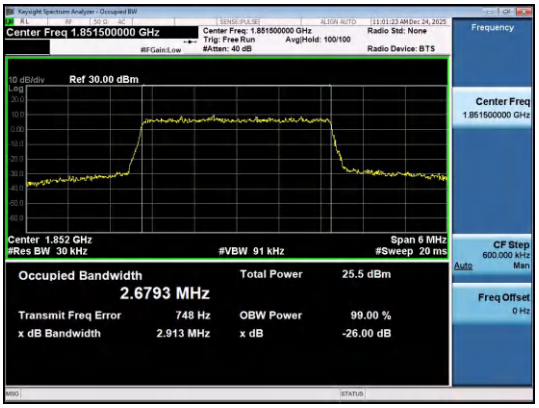

Band2-3MHz-16QAM-18615-15RB#0-PASS

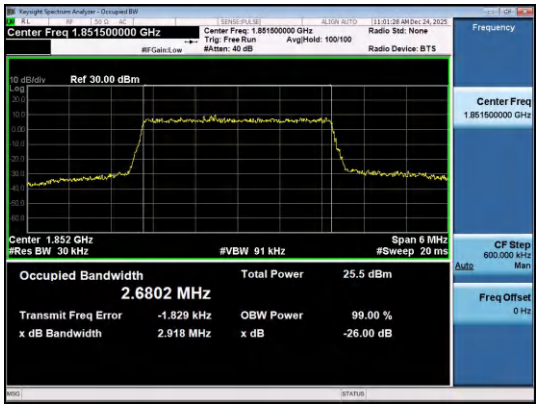

Band2-3MHz-16QAM-18615-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

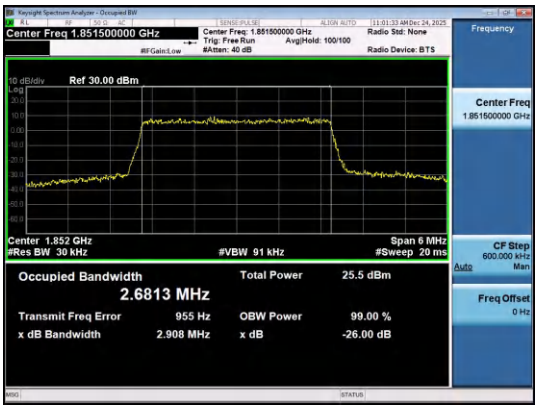

Band2-3MHz-16QAM-18615-15RB#0-PASS

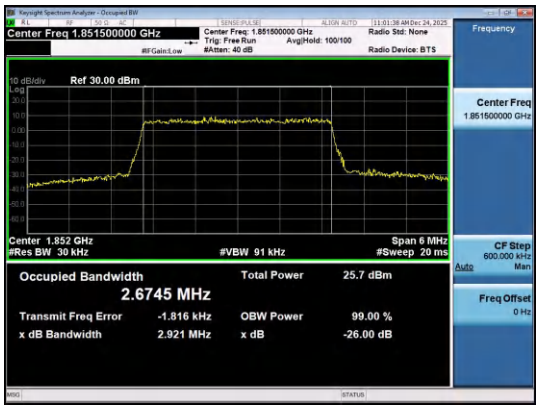

Band2-3MHz-16QAM-18615-15RB#0-PASS

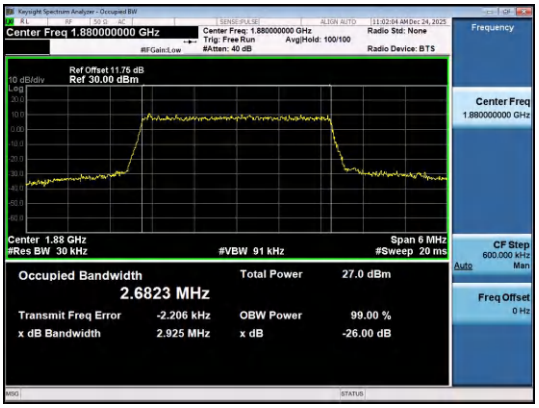

Band2-3MHz-QPSK-18900-15RB#0-PASS

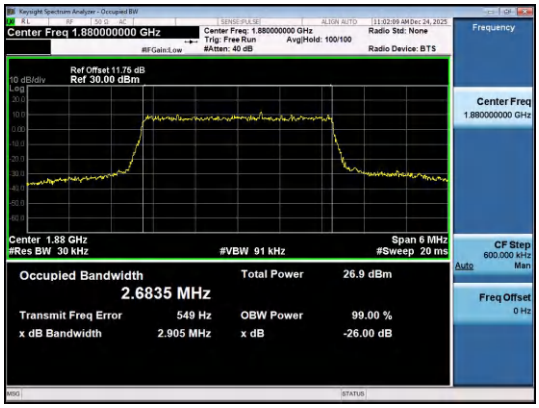

Band2-3MHz-QPSK-18900-15RB#0-PASS

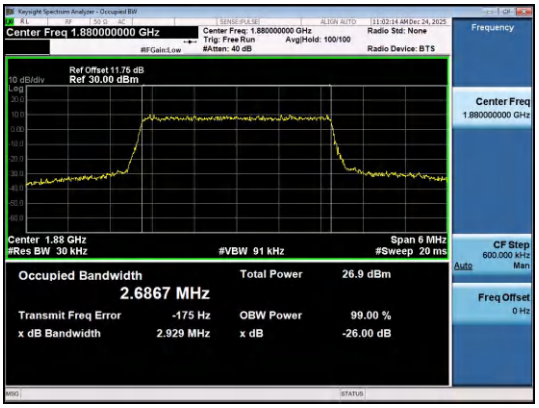

Band2-3MHz-QPSK-18900-15RB#0-PASS

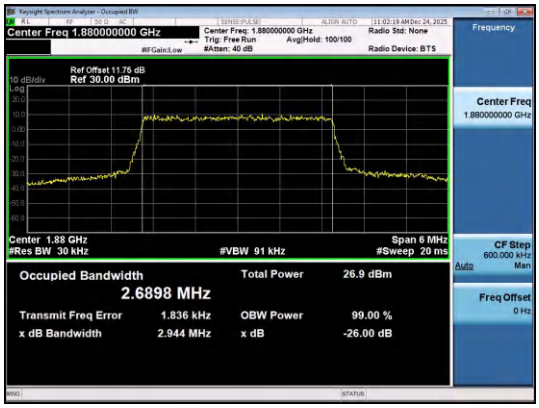

Band2-3MHz-QPSK-18900-15RB#0-PASS

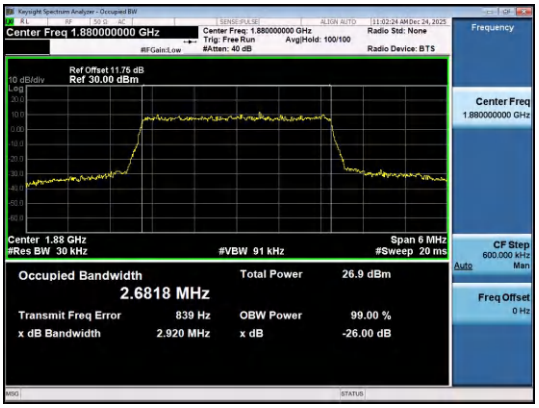

Band2-3MHz-QPSK-18900-15RB#0-PASS

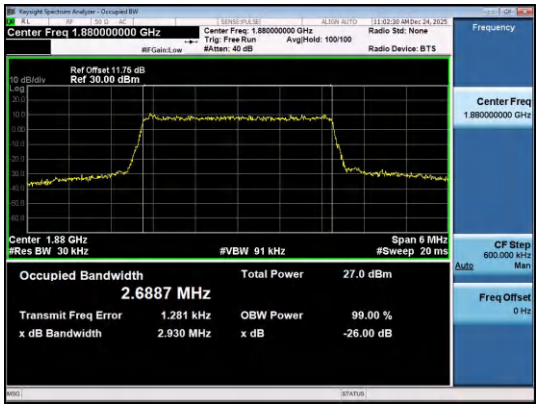

Band2-3MHz-QPSK-18900-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

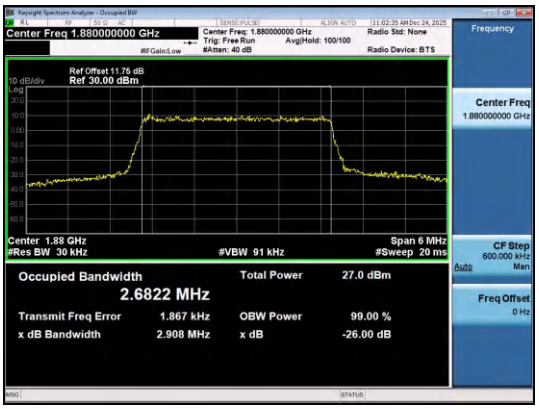

Band2-3MHz-QPSK-18900-15RB#0-PASS

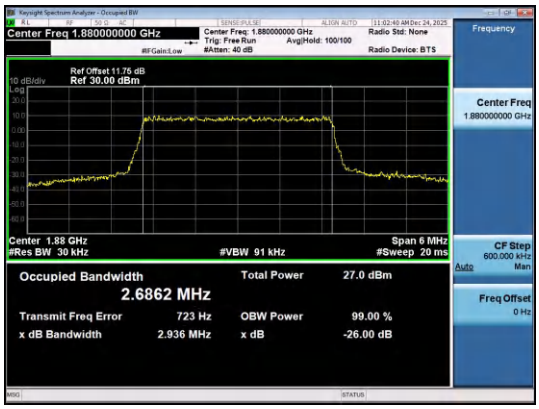

Band2-3MHz-QPSK-18900-15RB#0-PASS

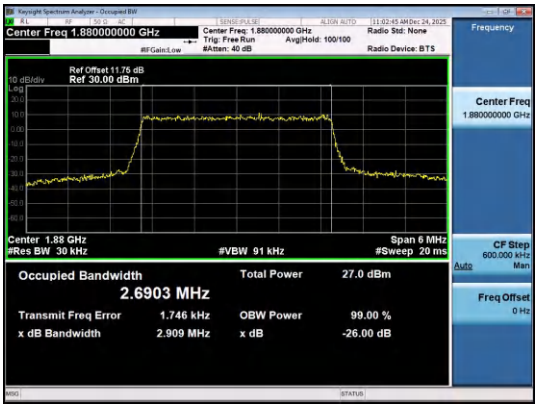

Band2-3MHz-QPSK-18900-15RB#0-PASS

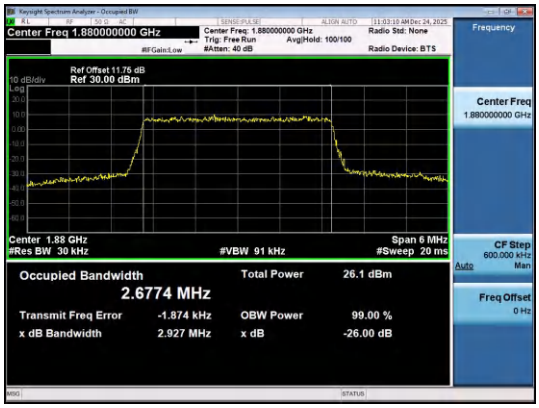

Band2-3MHz-16QAM-18900-15RB#0-PASS

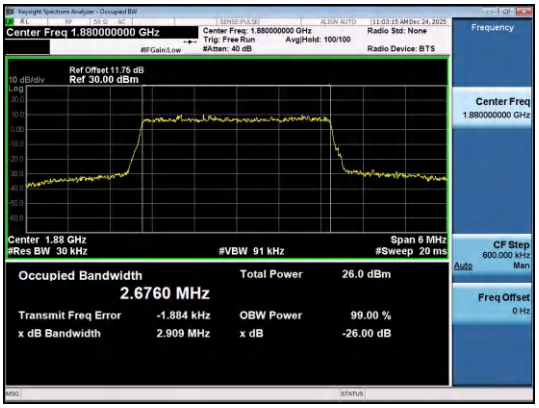

Band2-3MHz-16QAM-18900-15RB#0-PASS

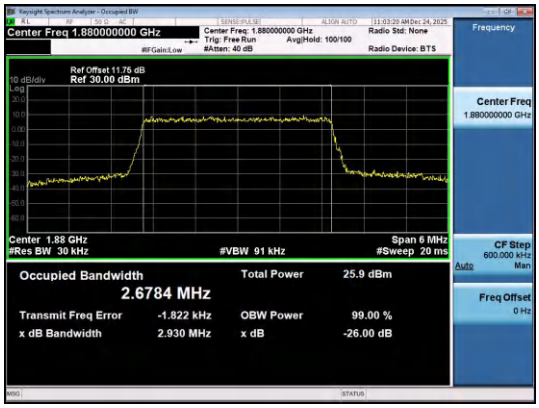

Band2-3MHz-16QAM-18900-15RB#0-PASS

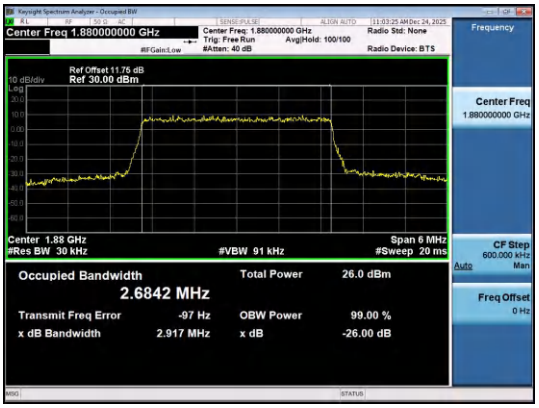

Band2-3MHz-16QAM-18900-15RB#0-PASS

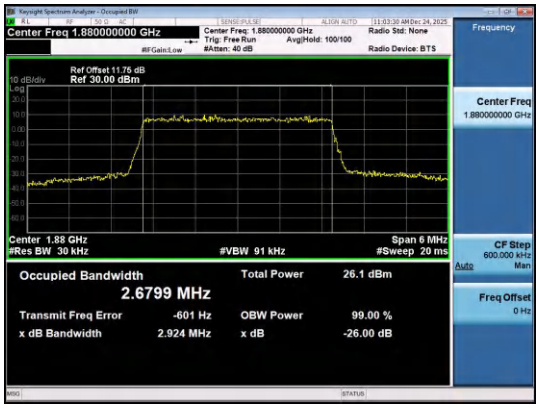

Band2-3MHz-16QAM-18900-15RB#0-PASS

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com