






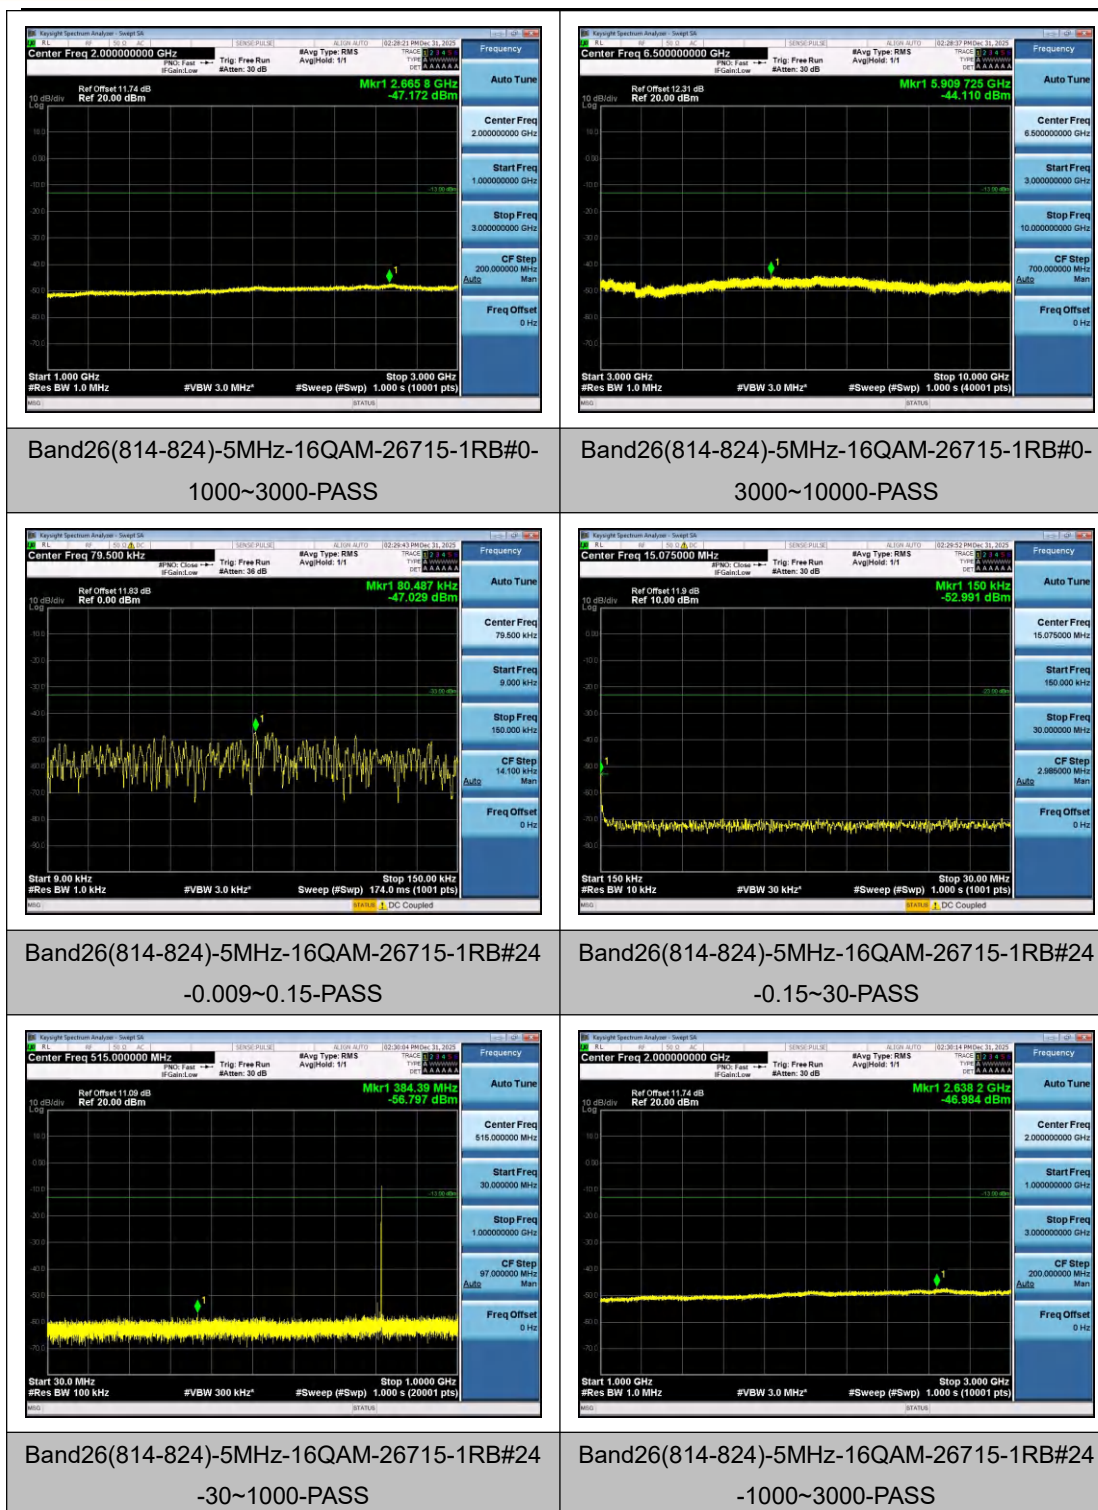


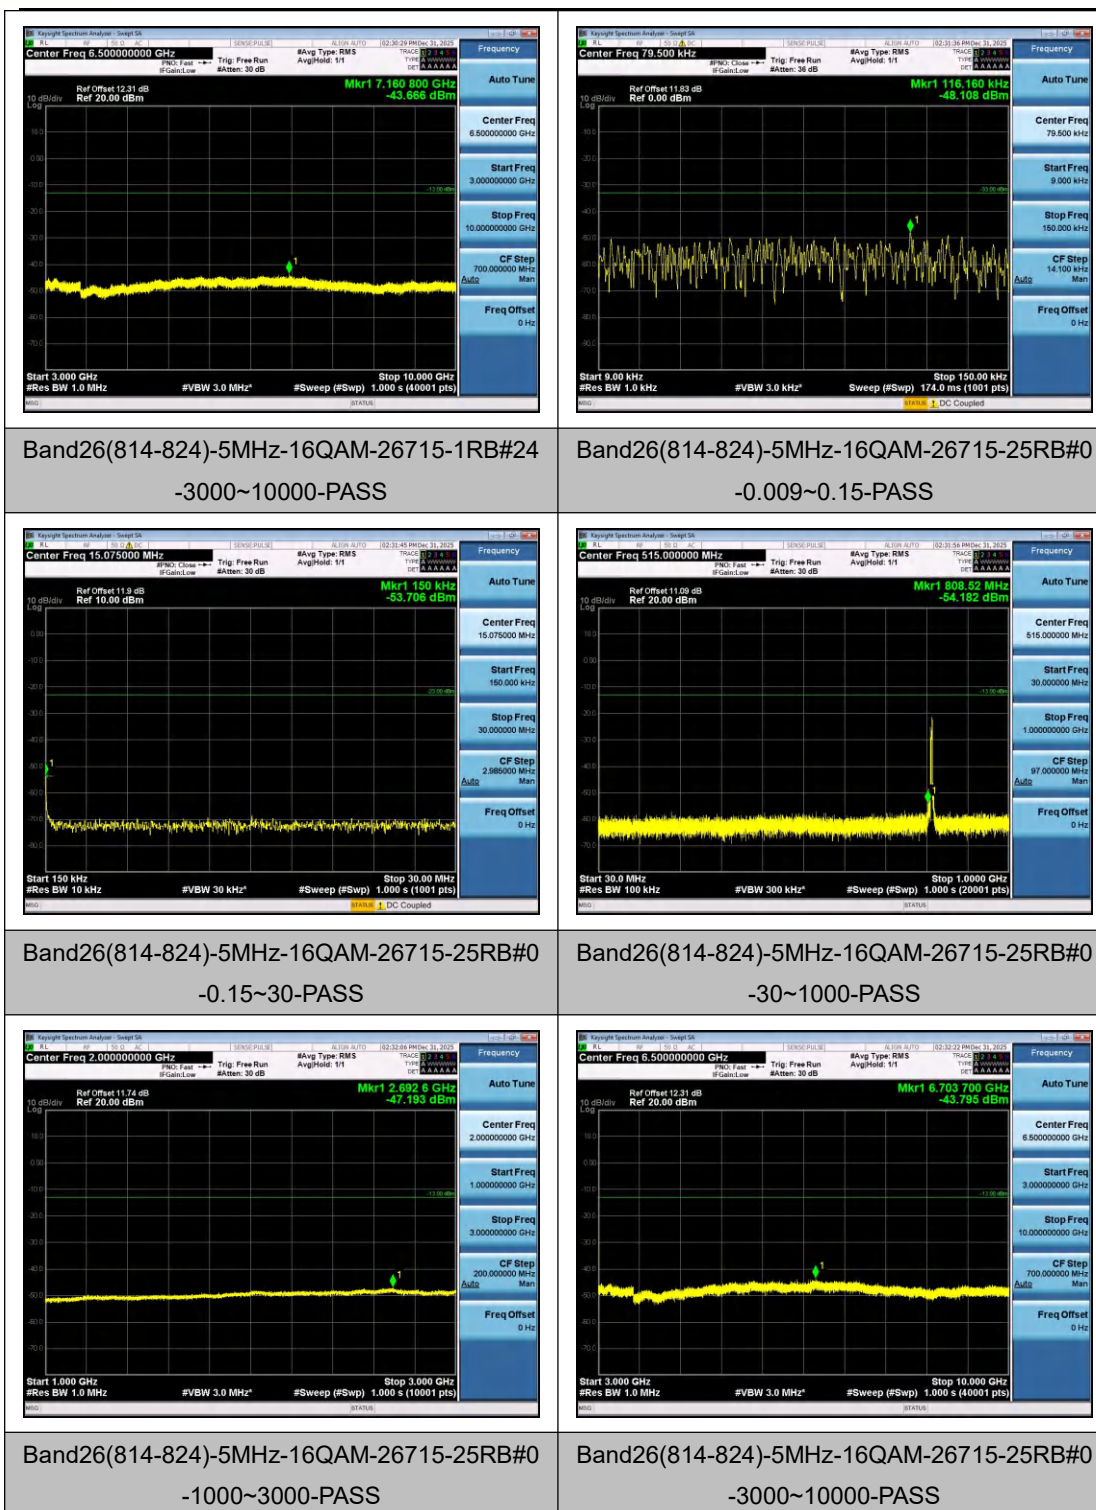


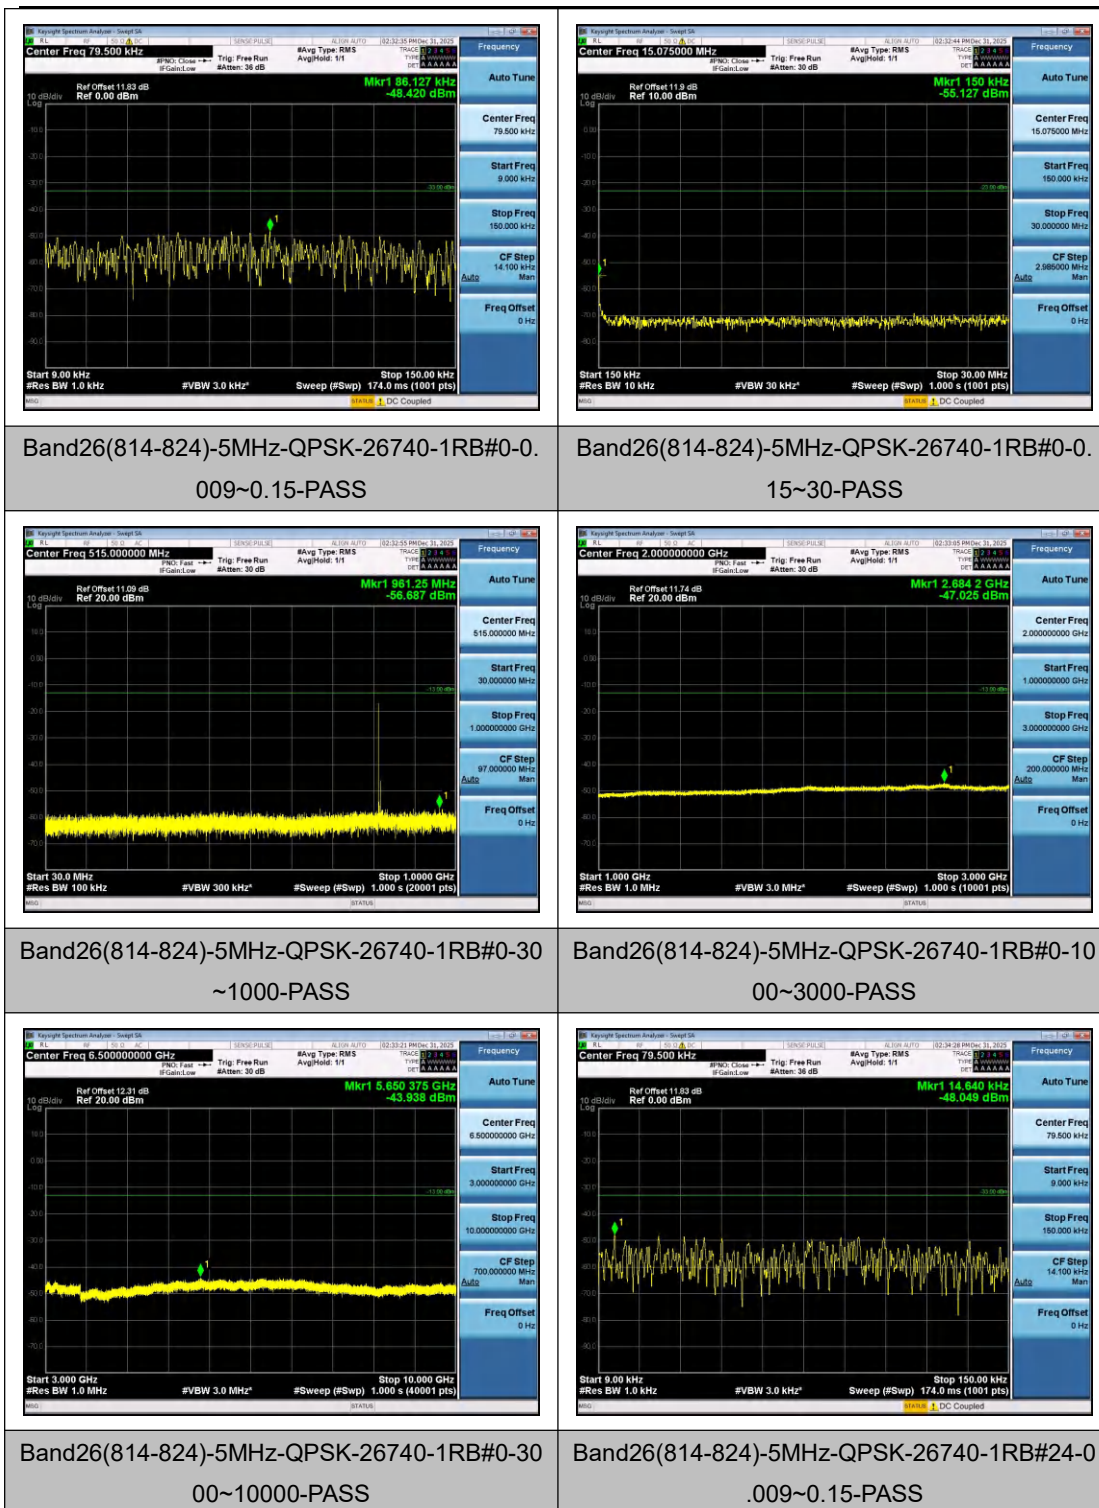


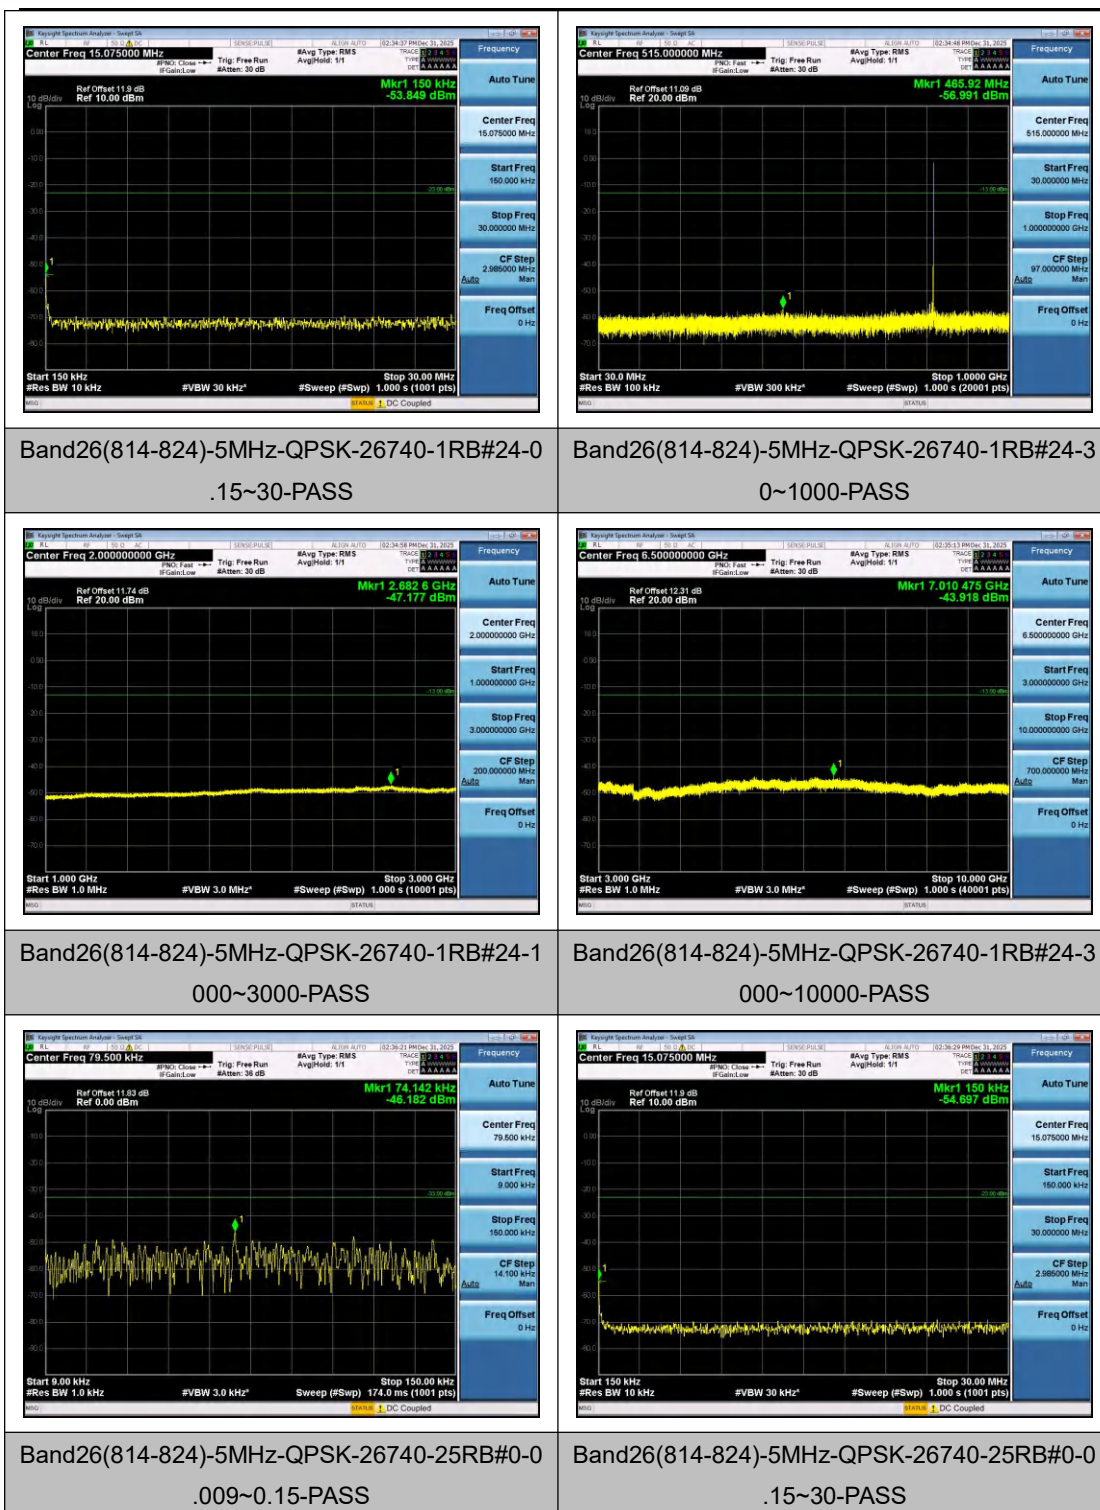


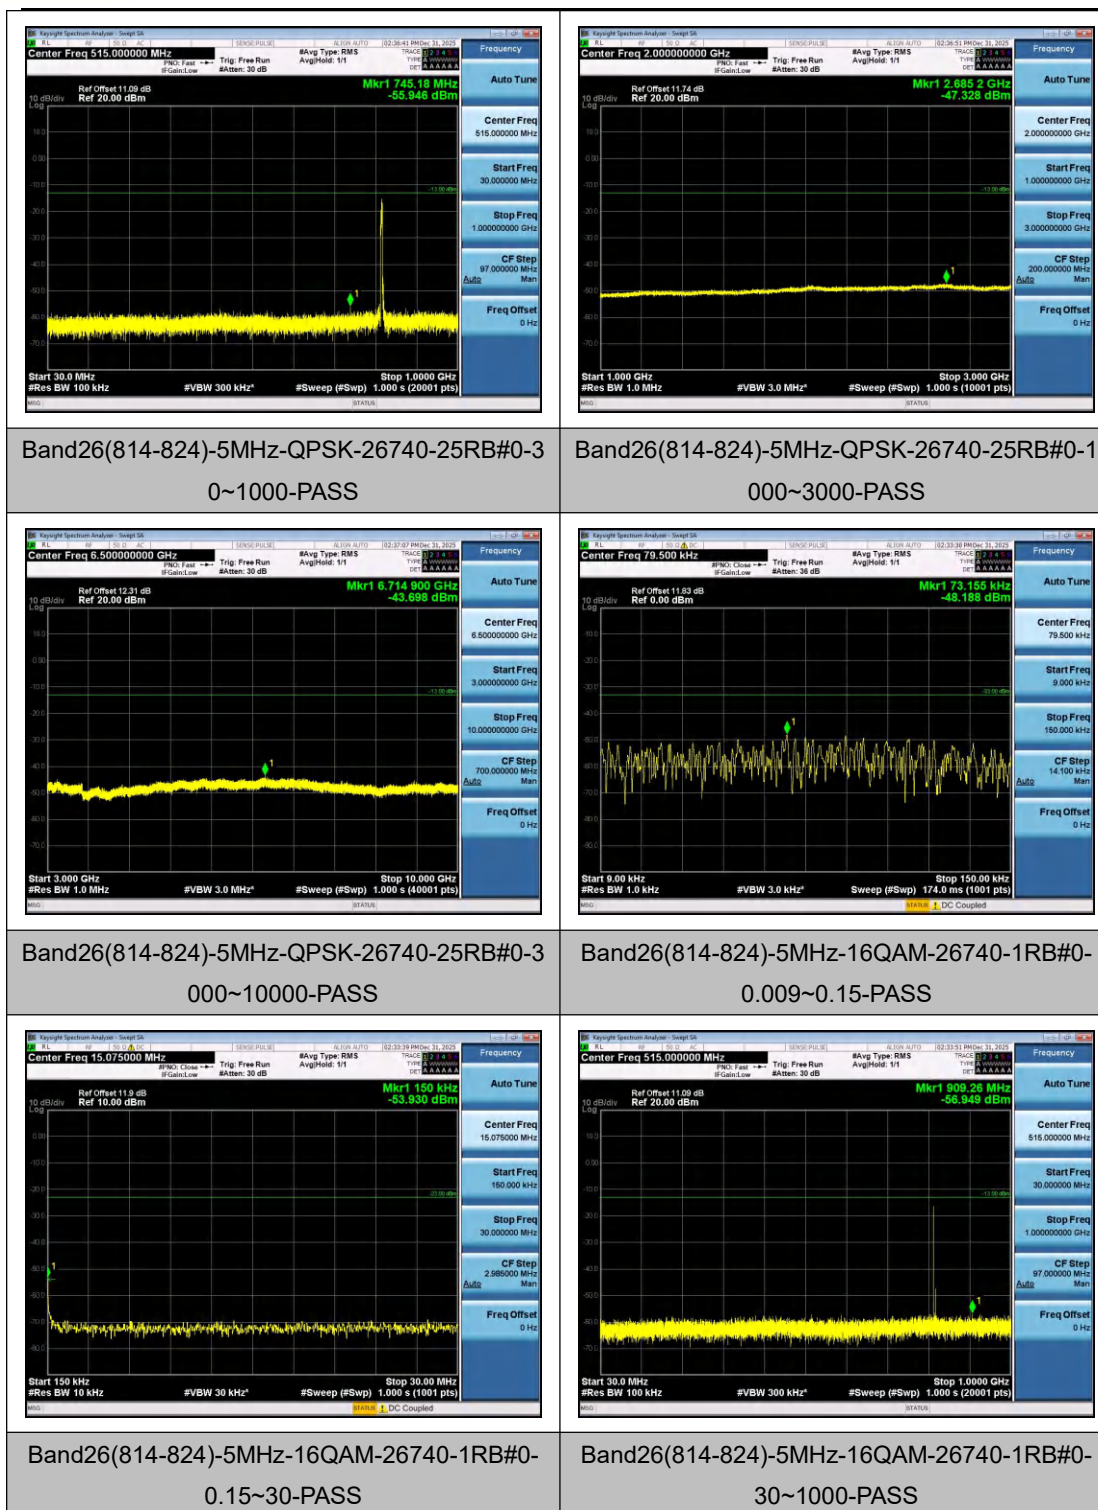


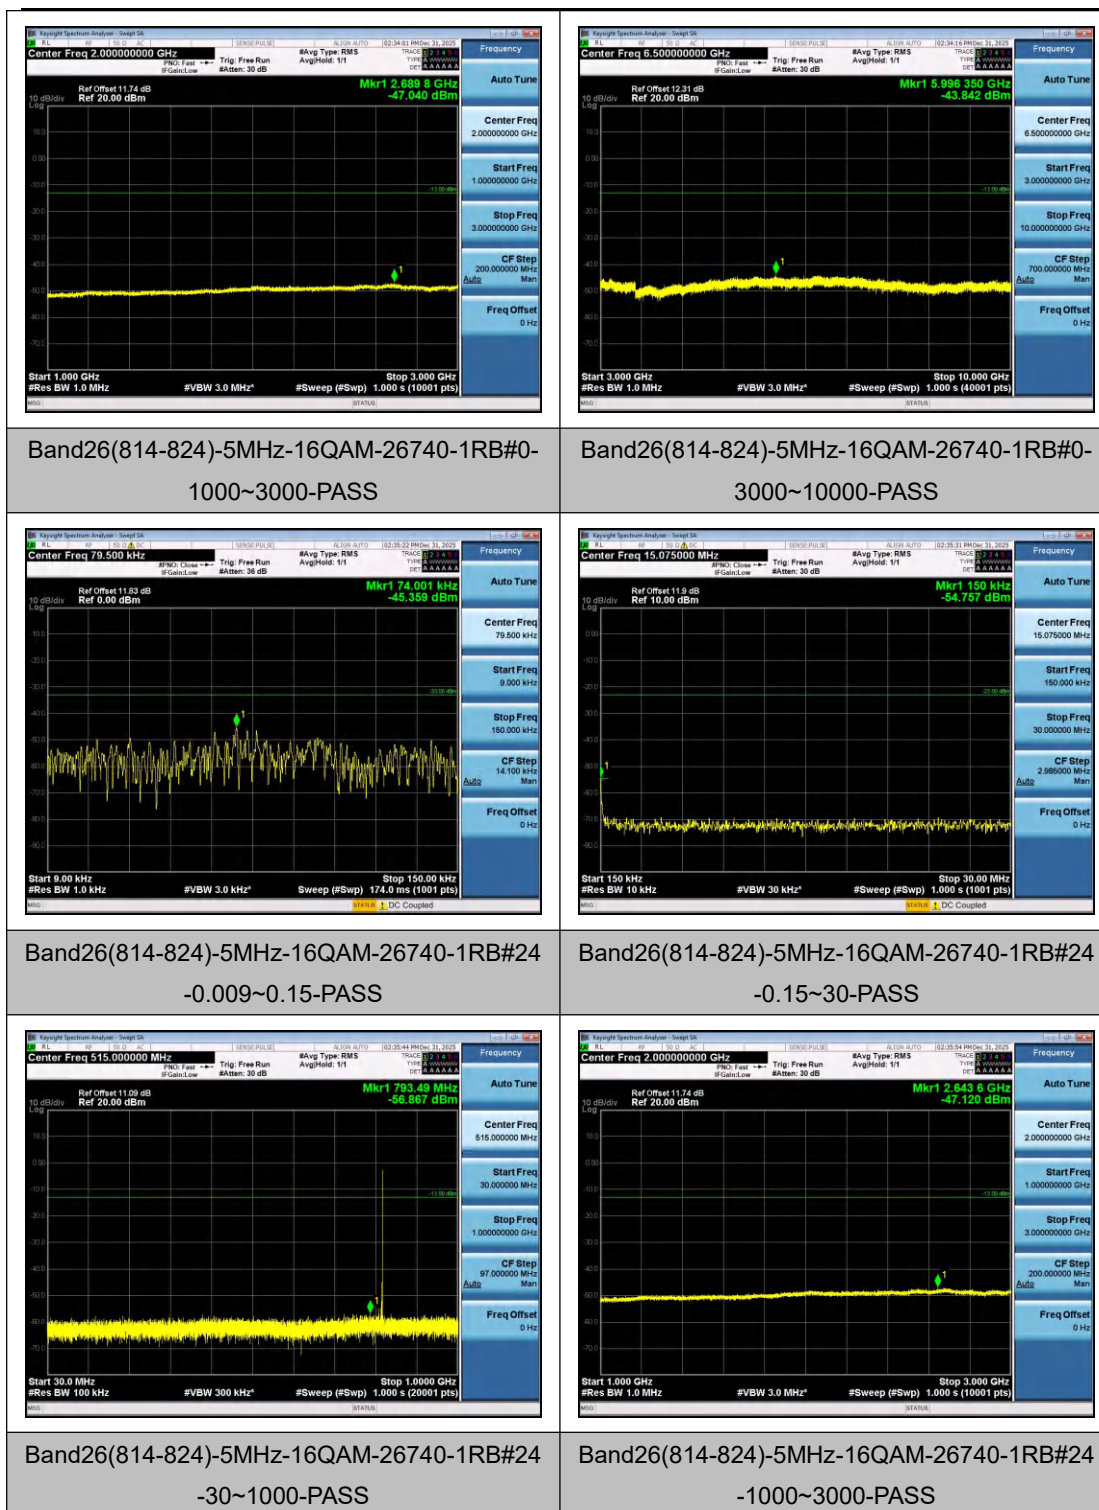


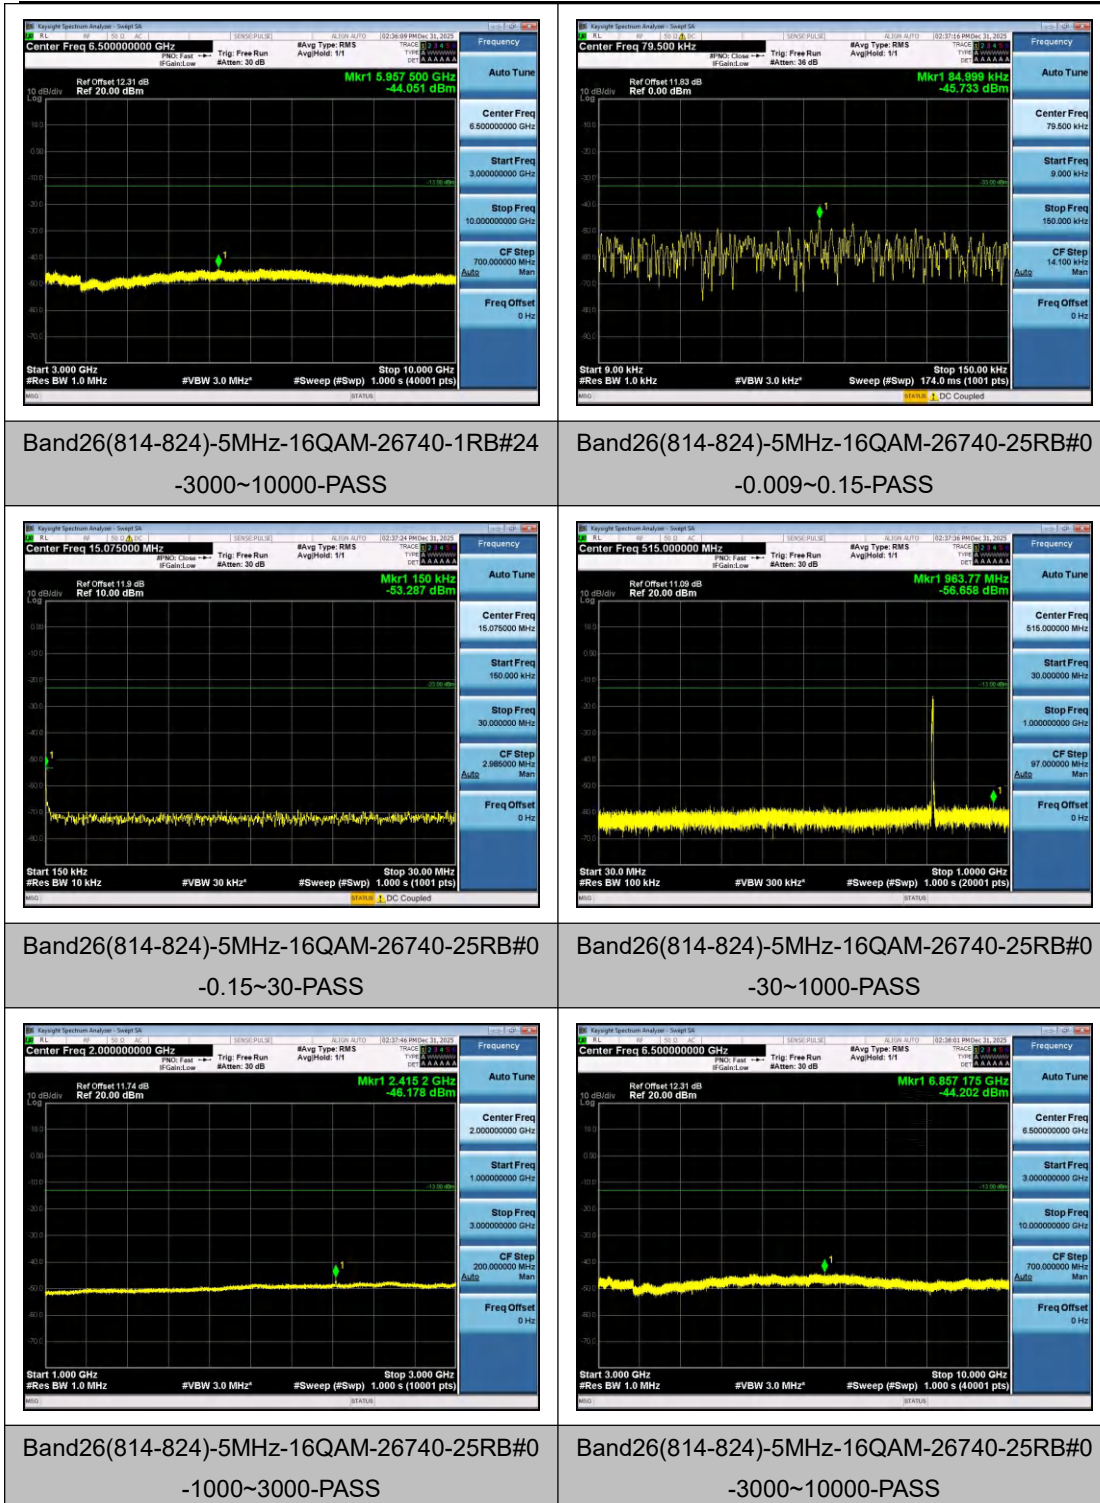


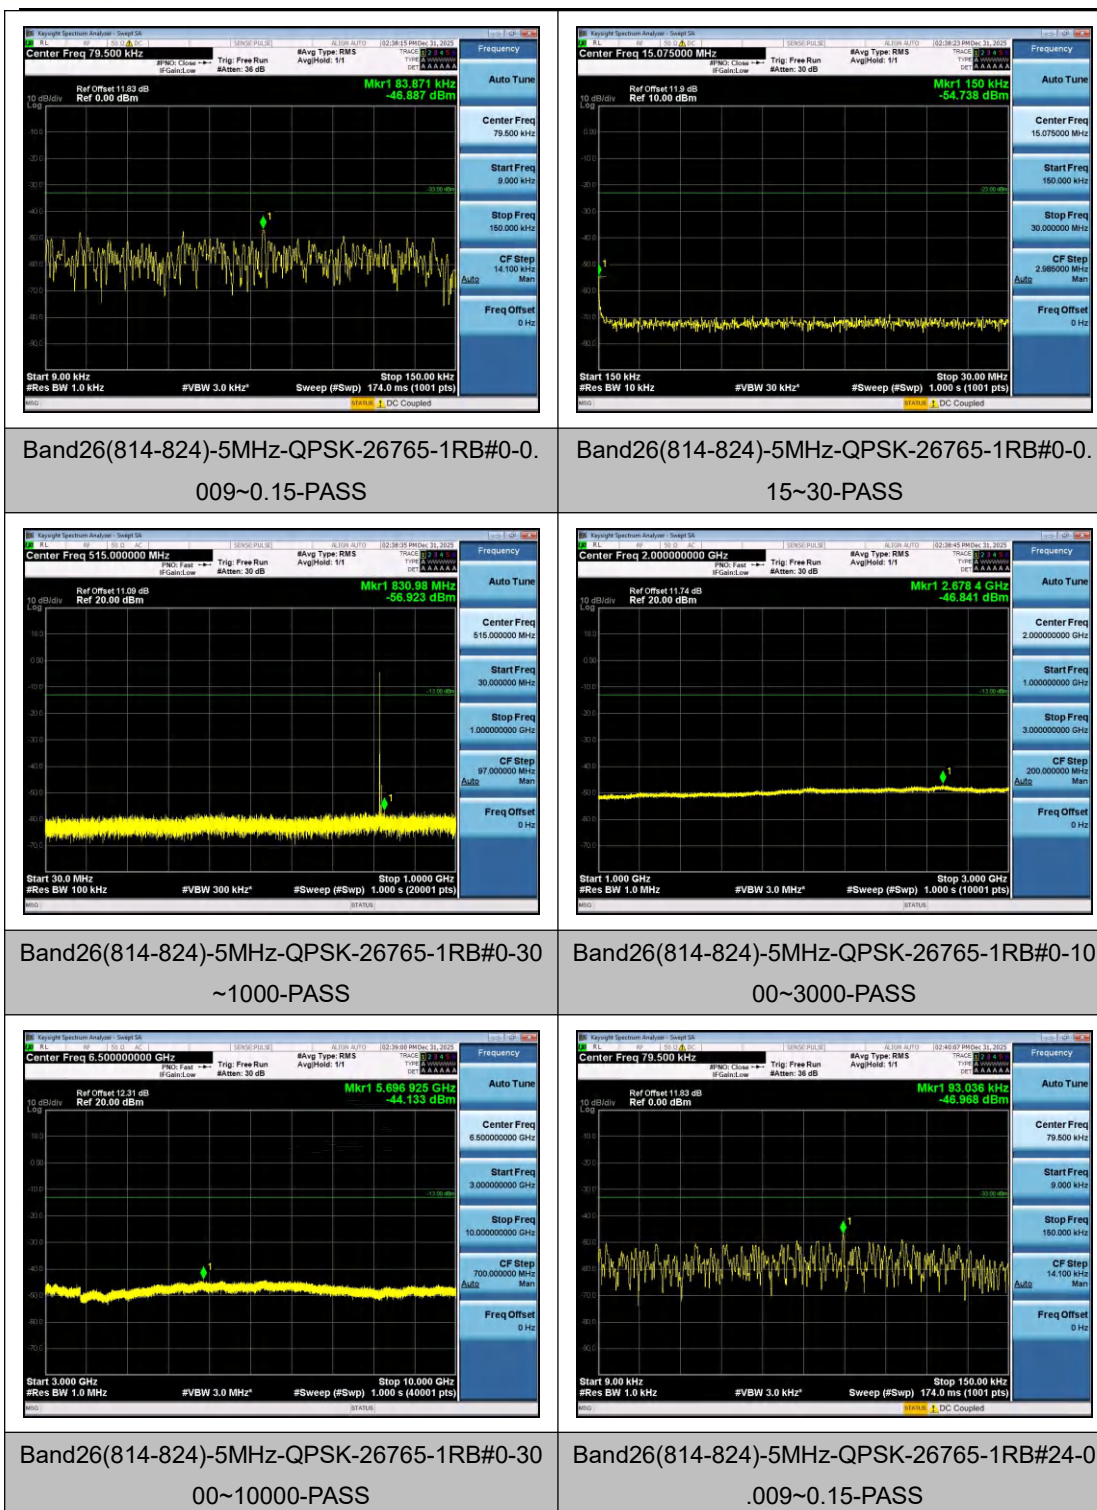


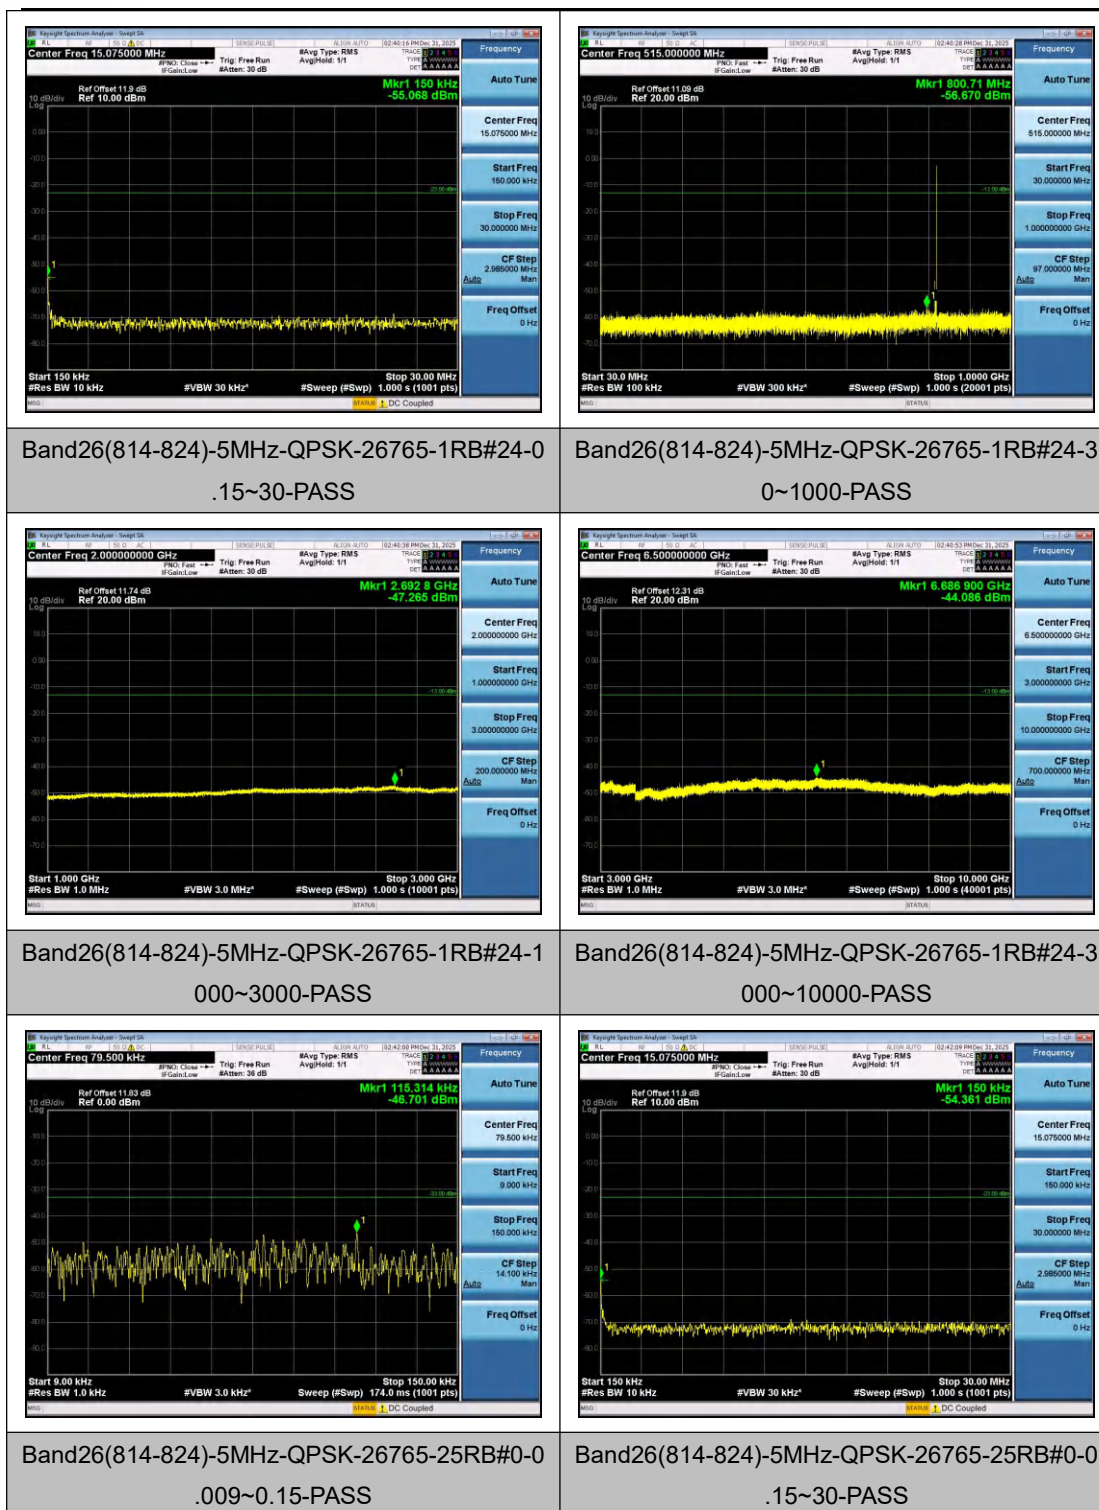


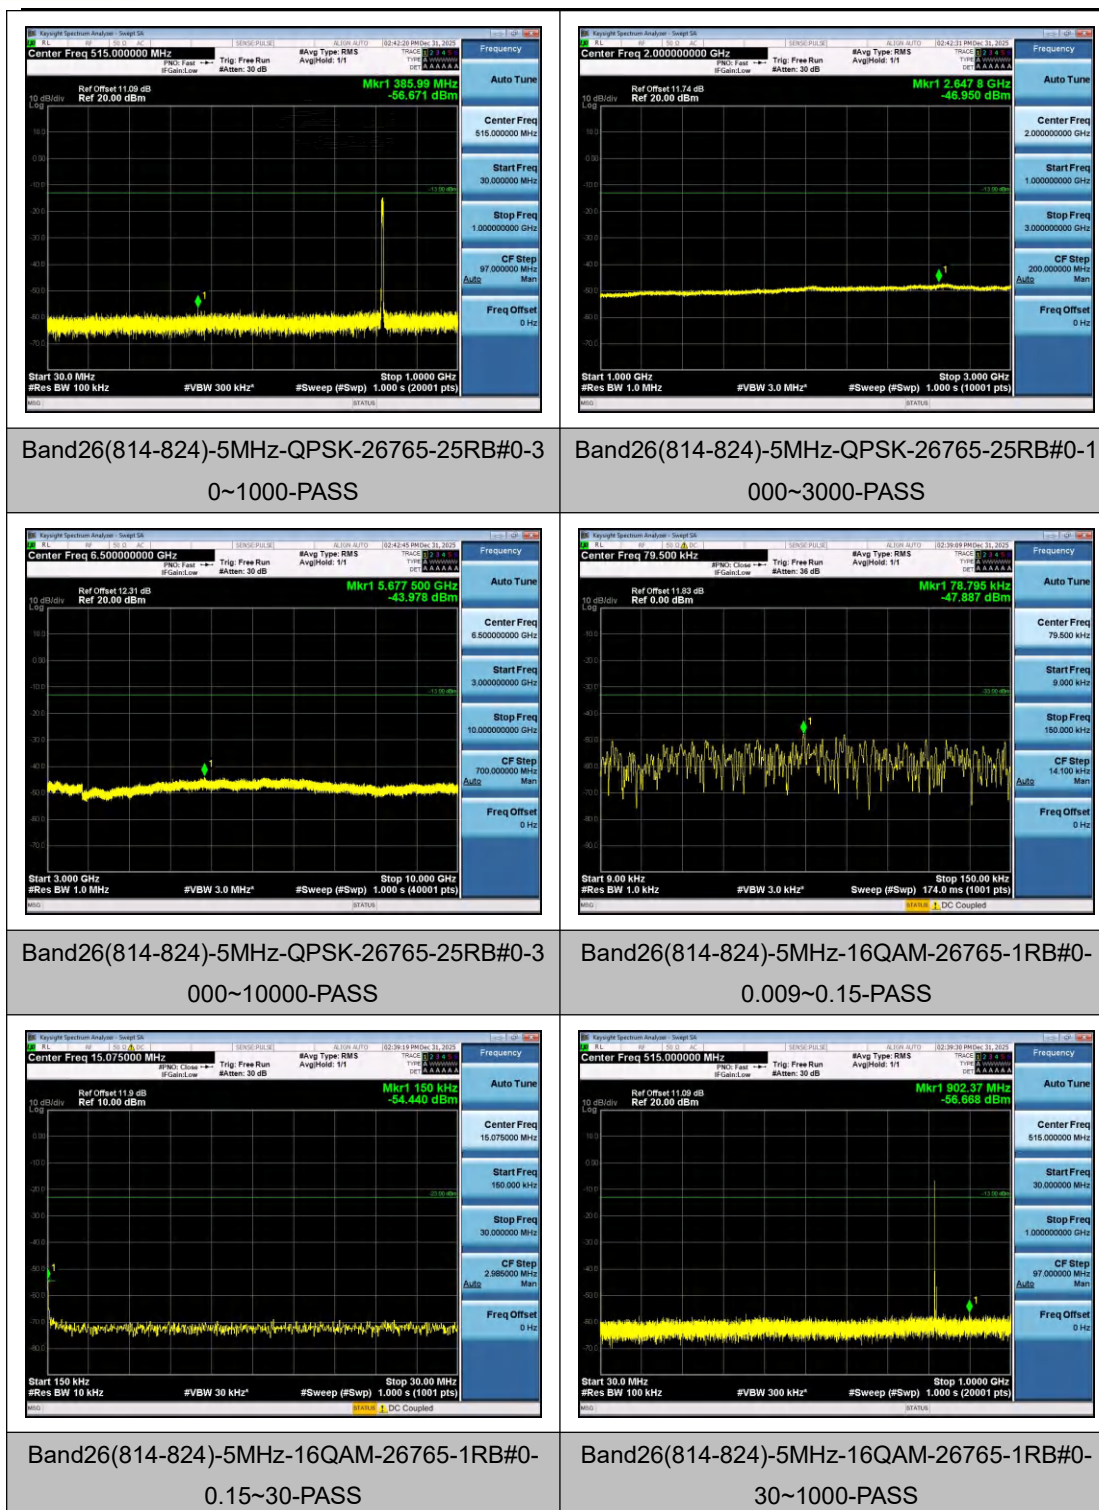


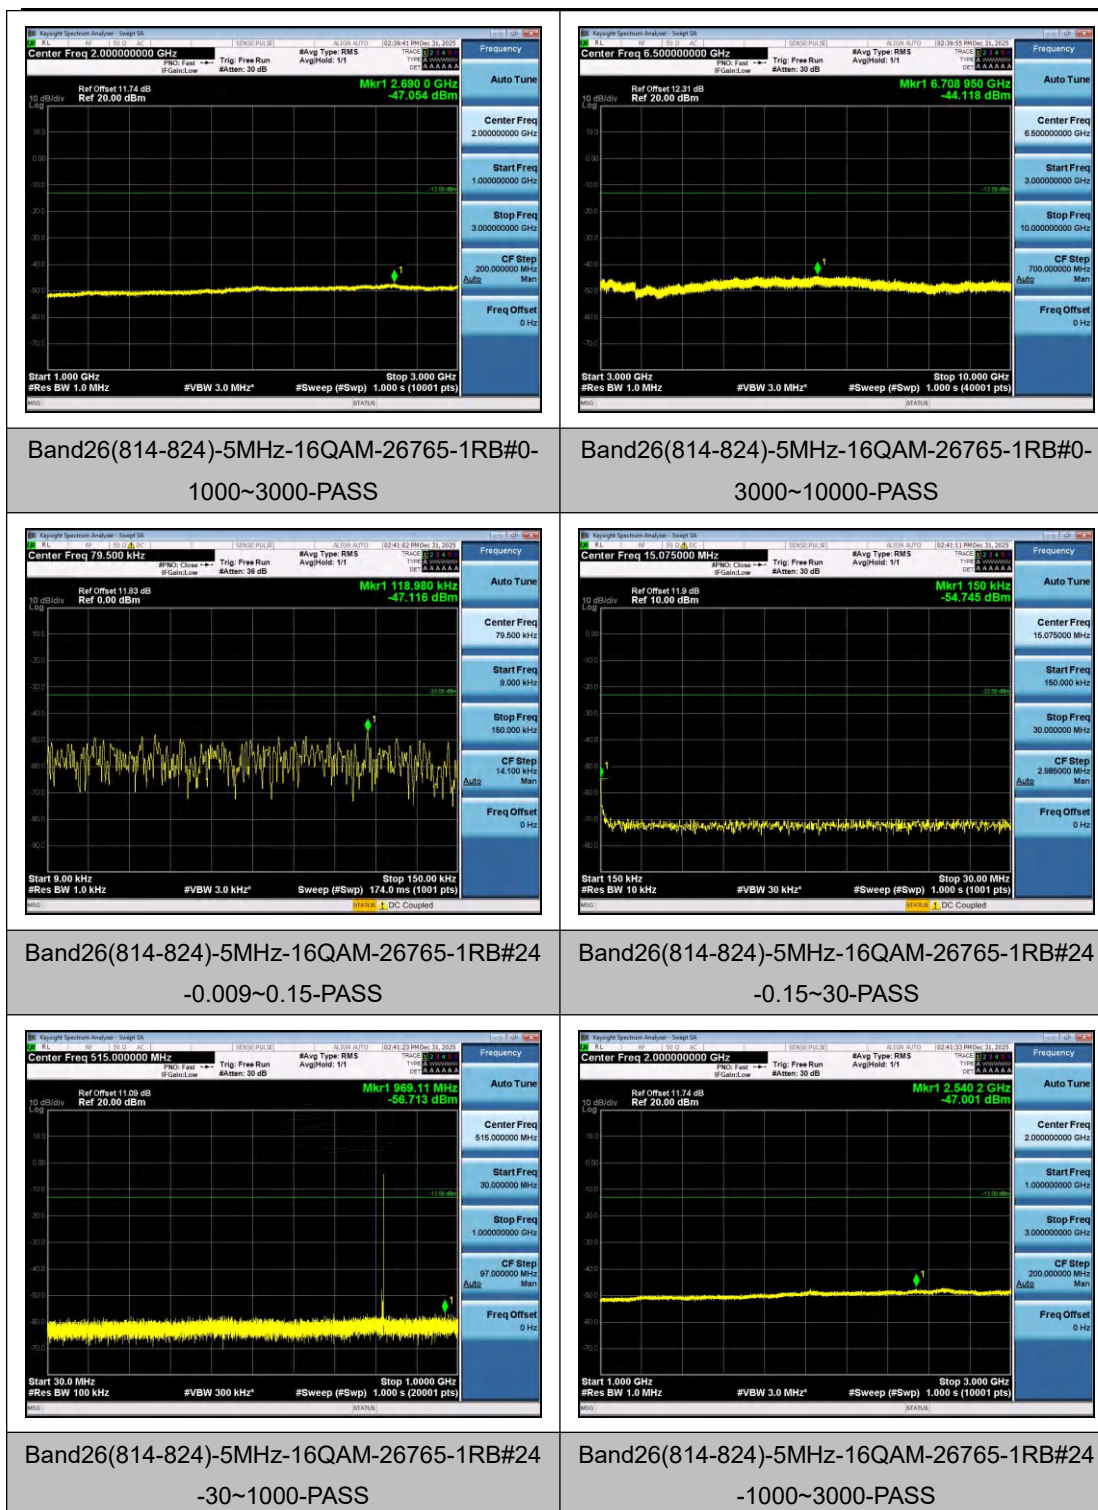


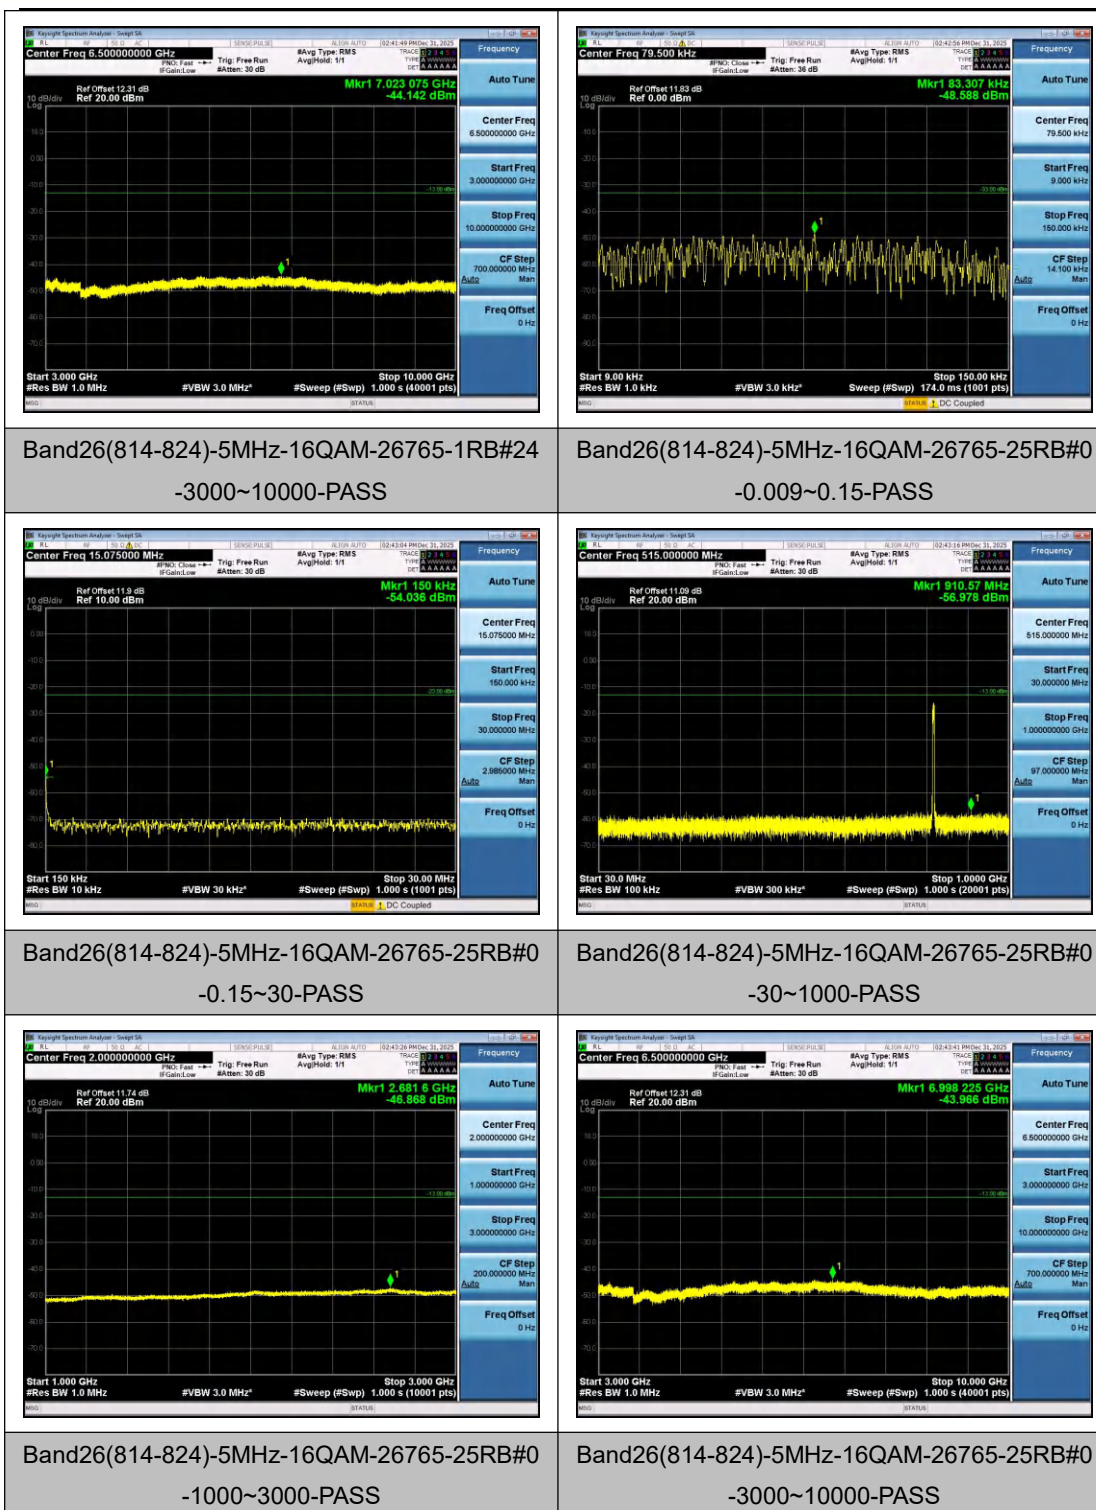


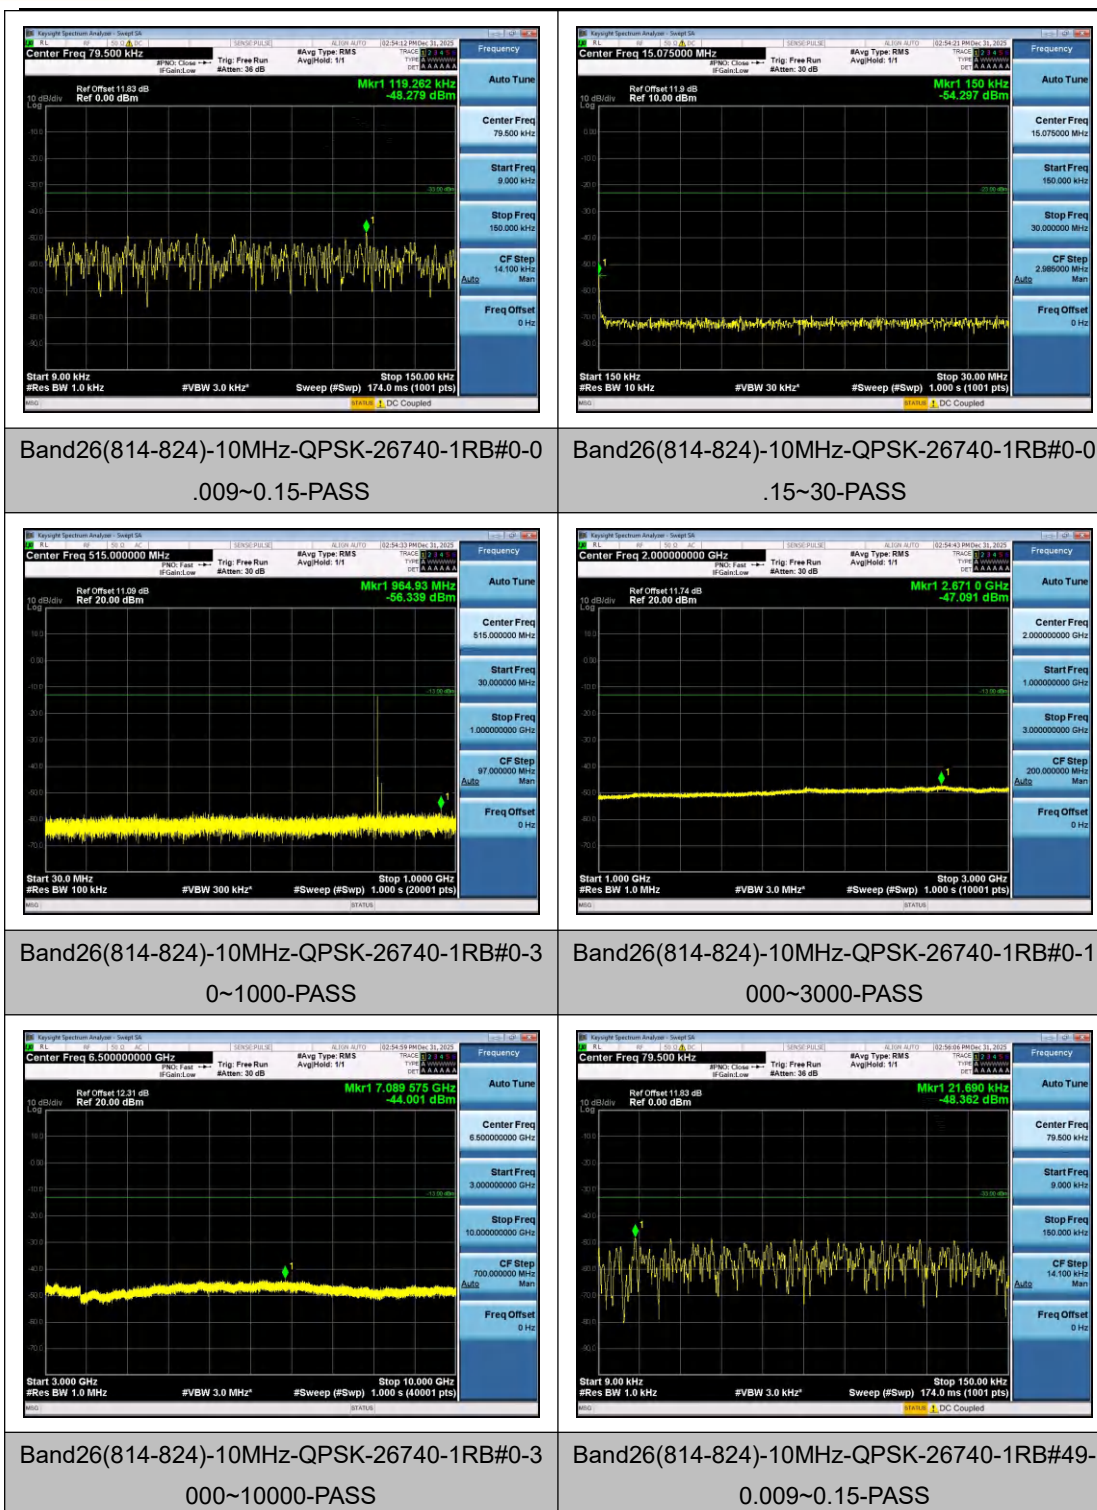


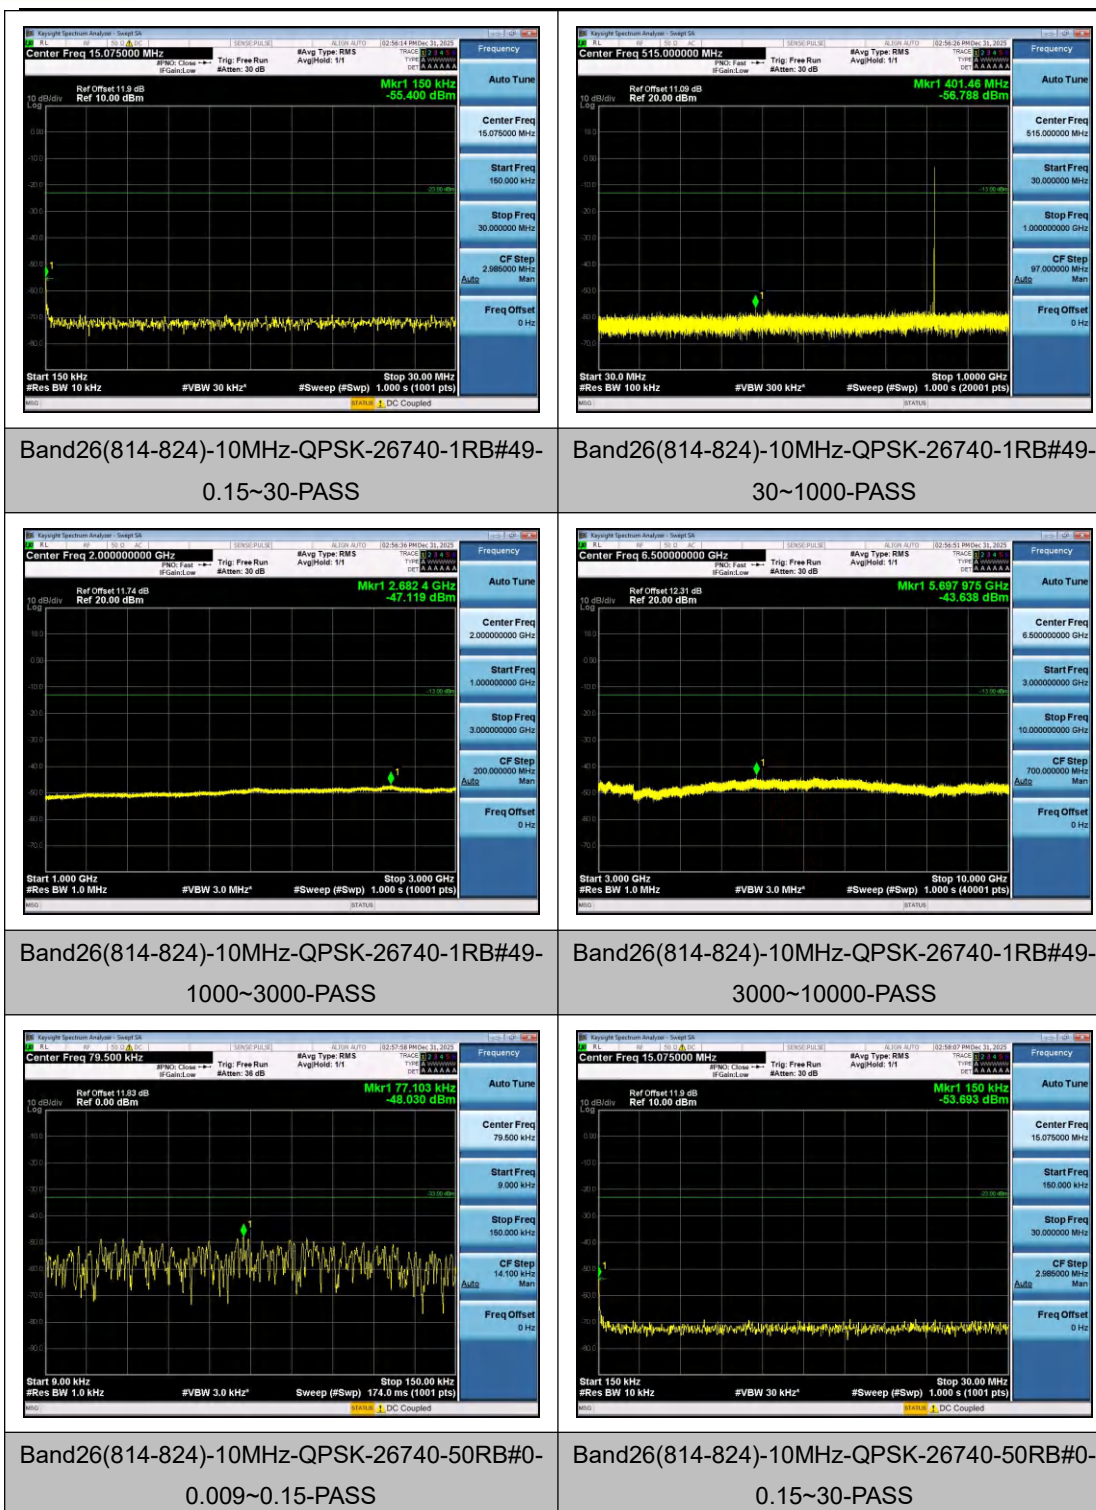


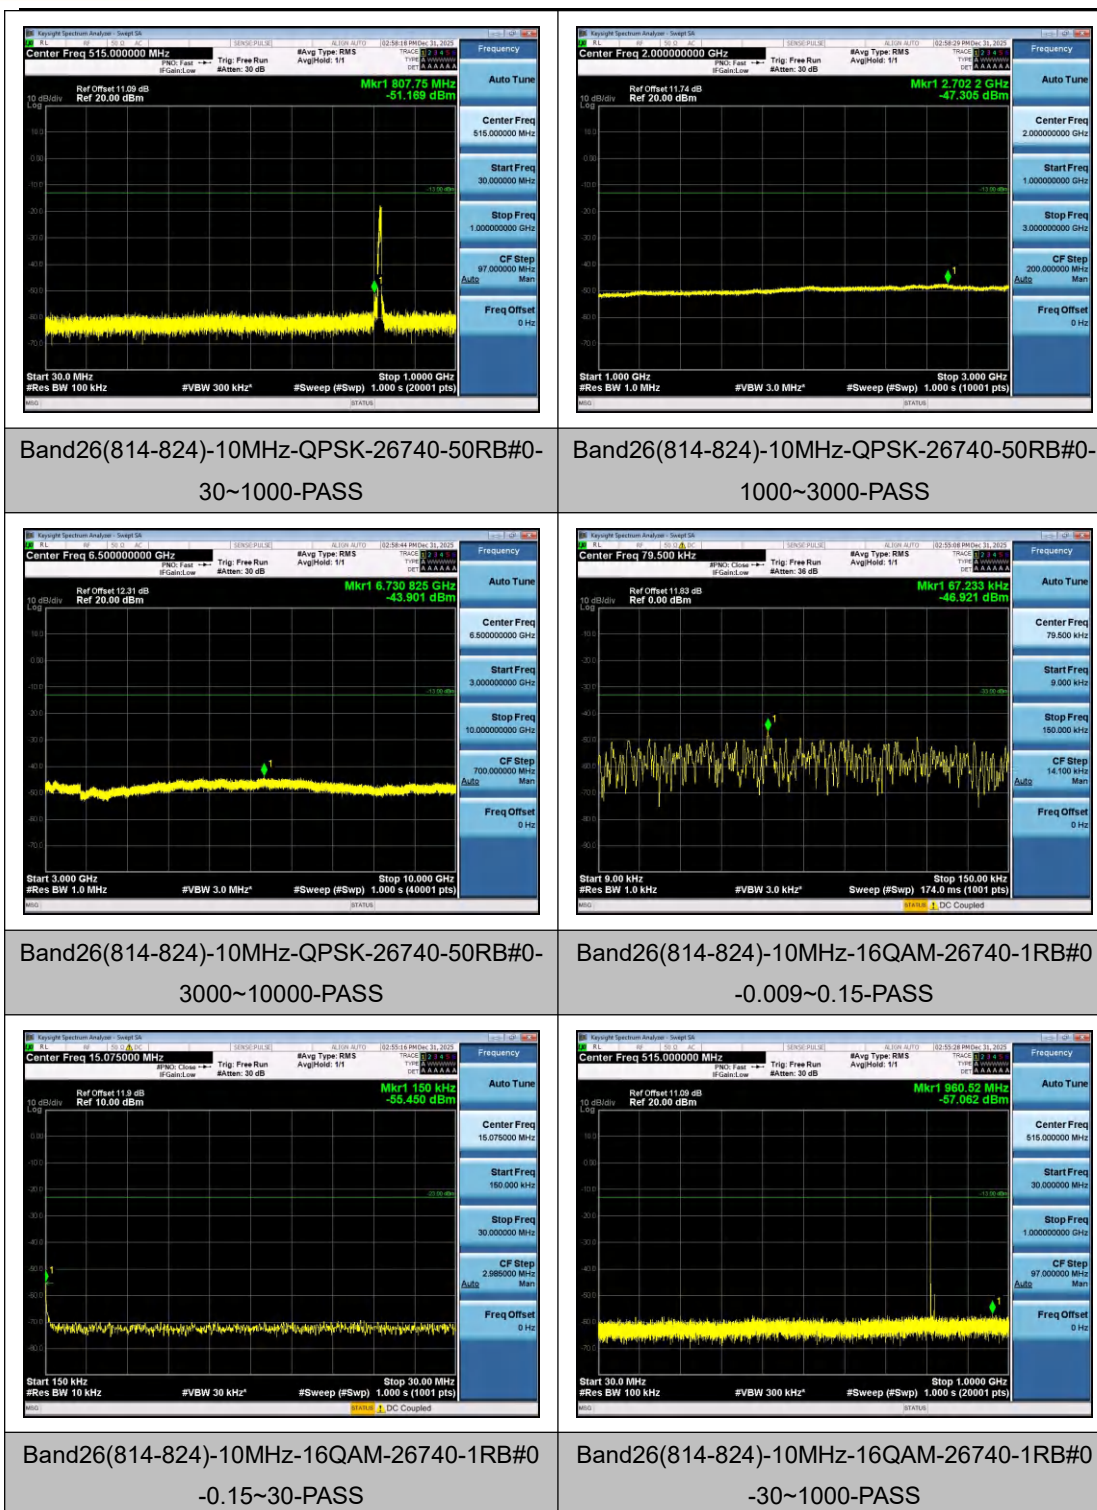


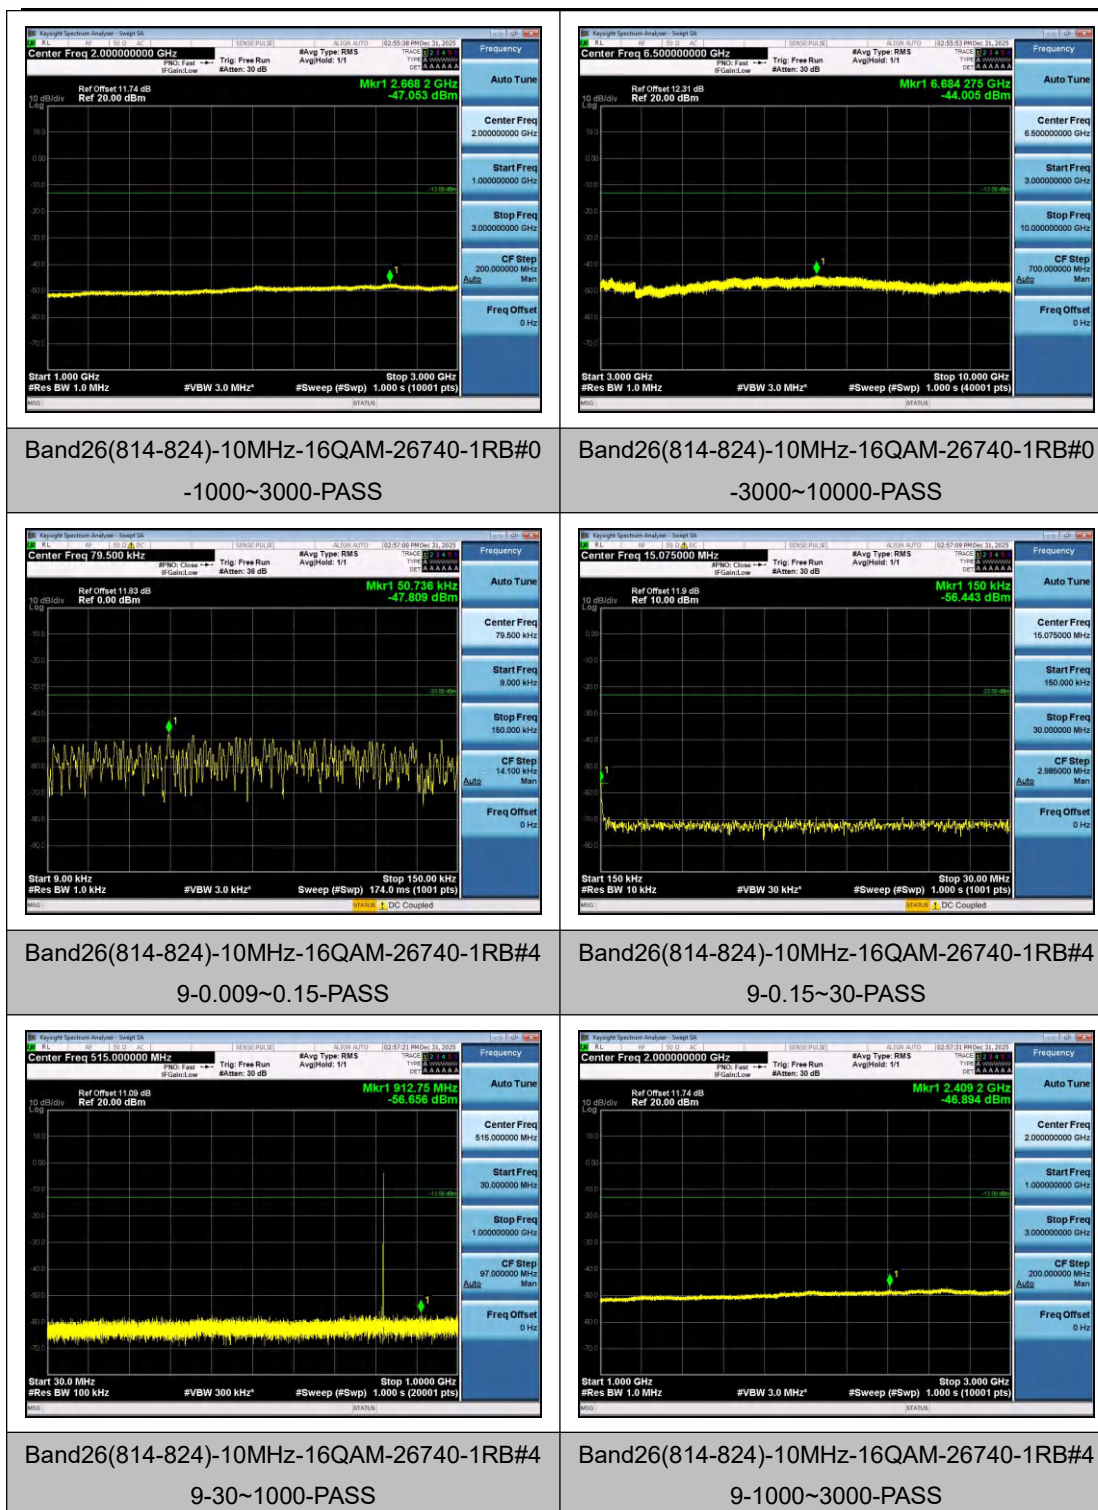


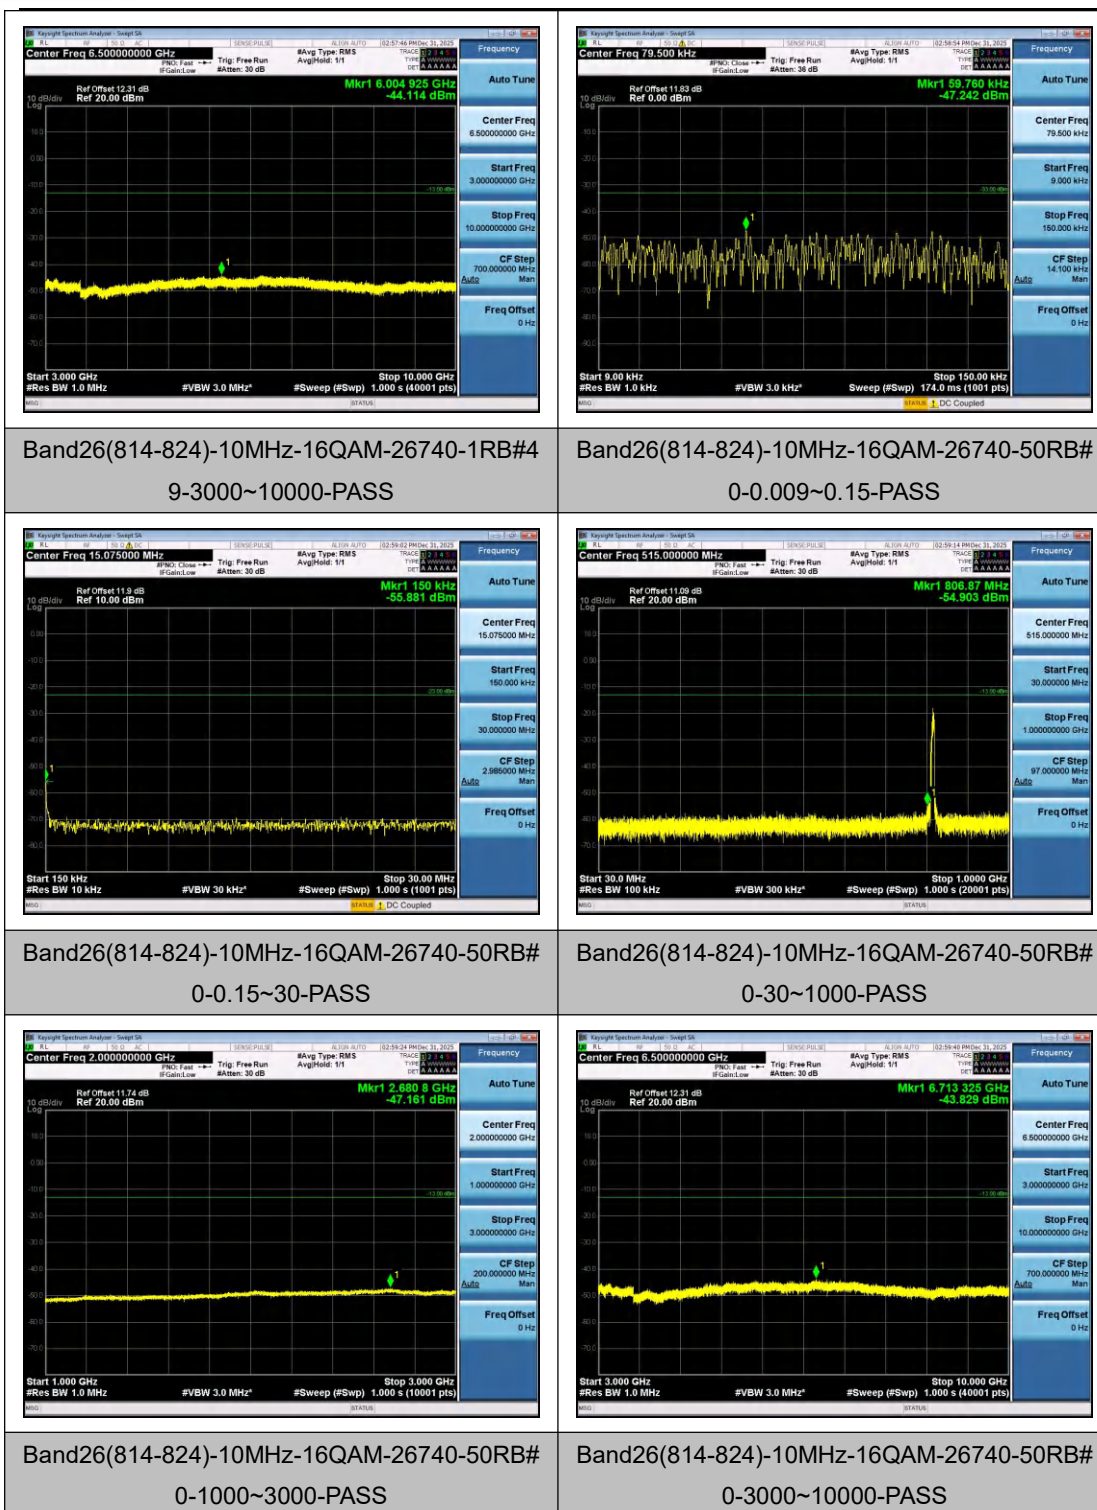


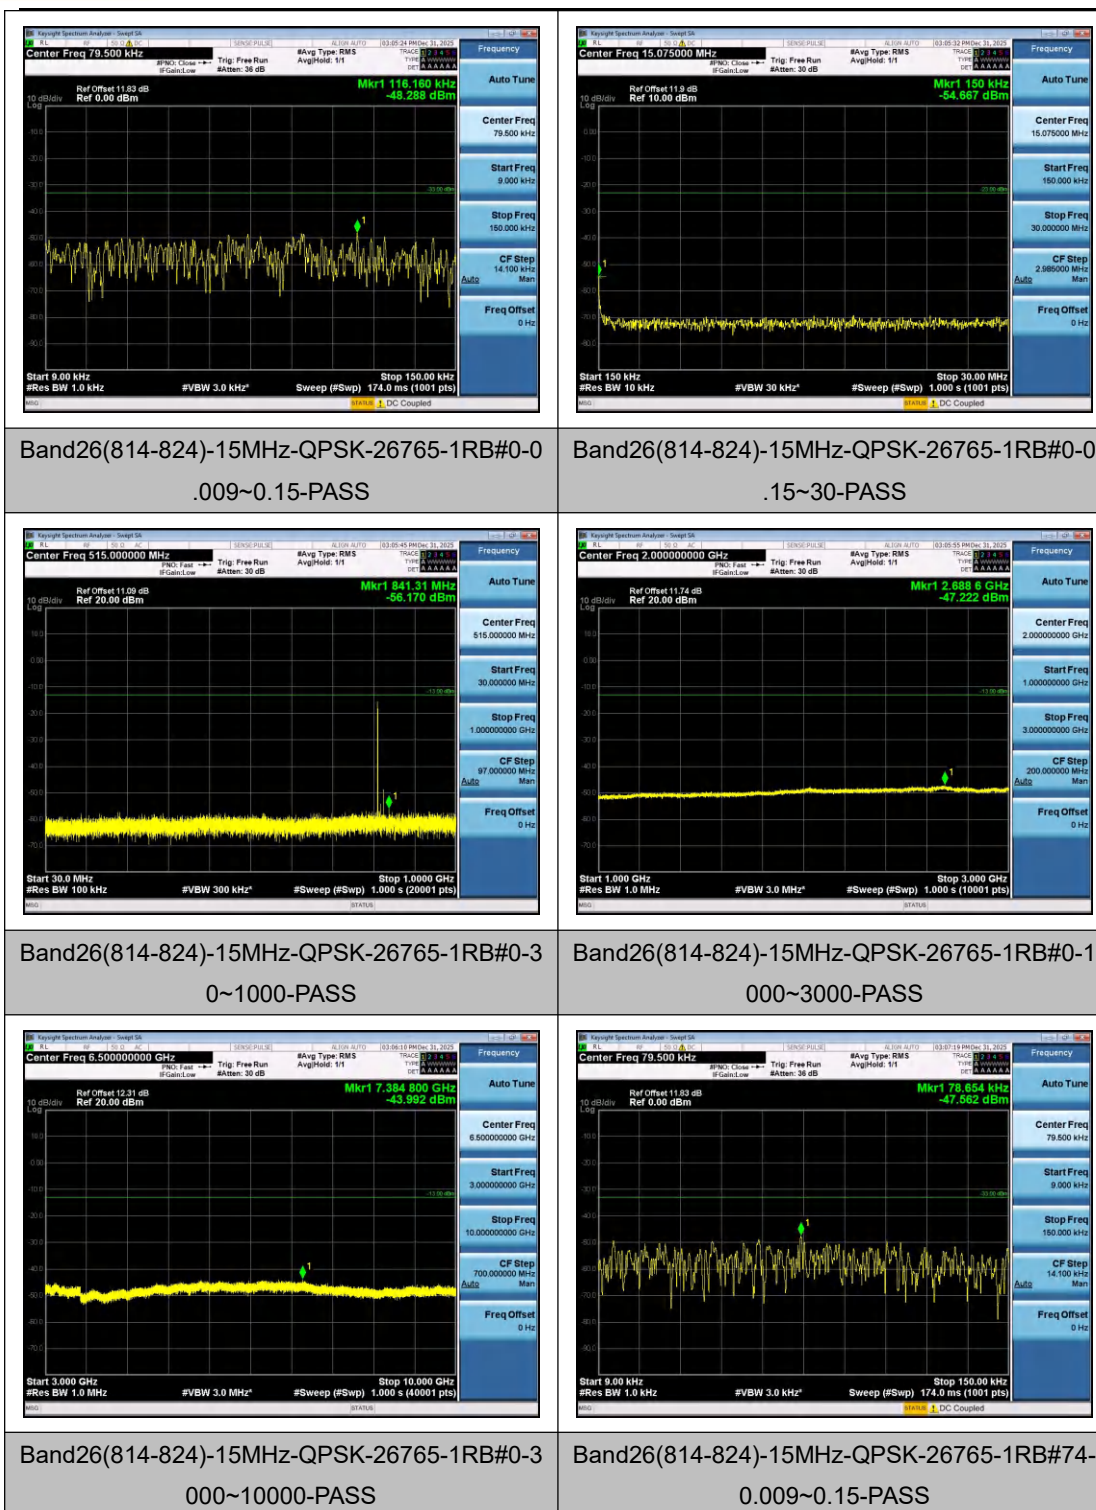

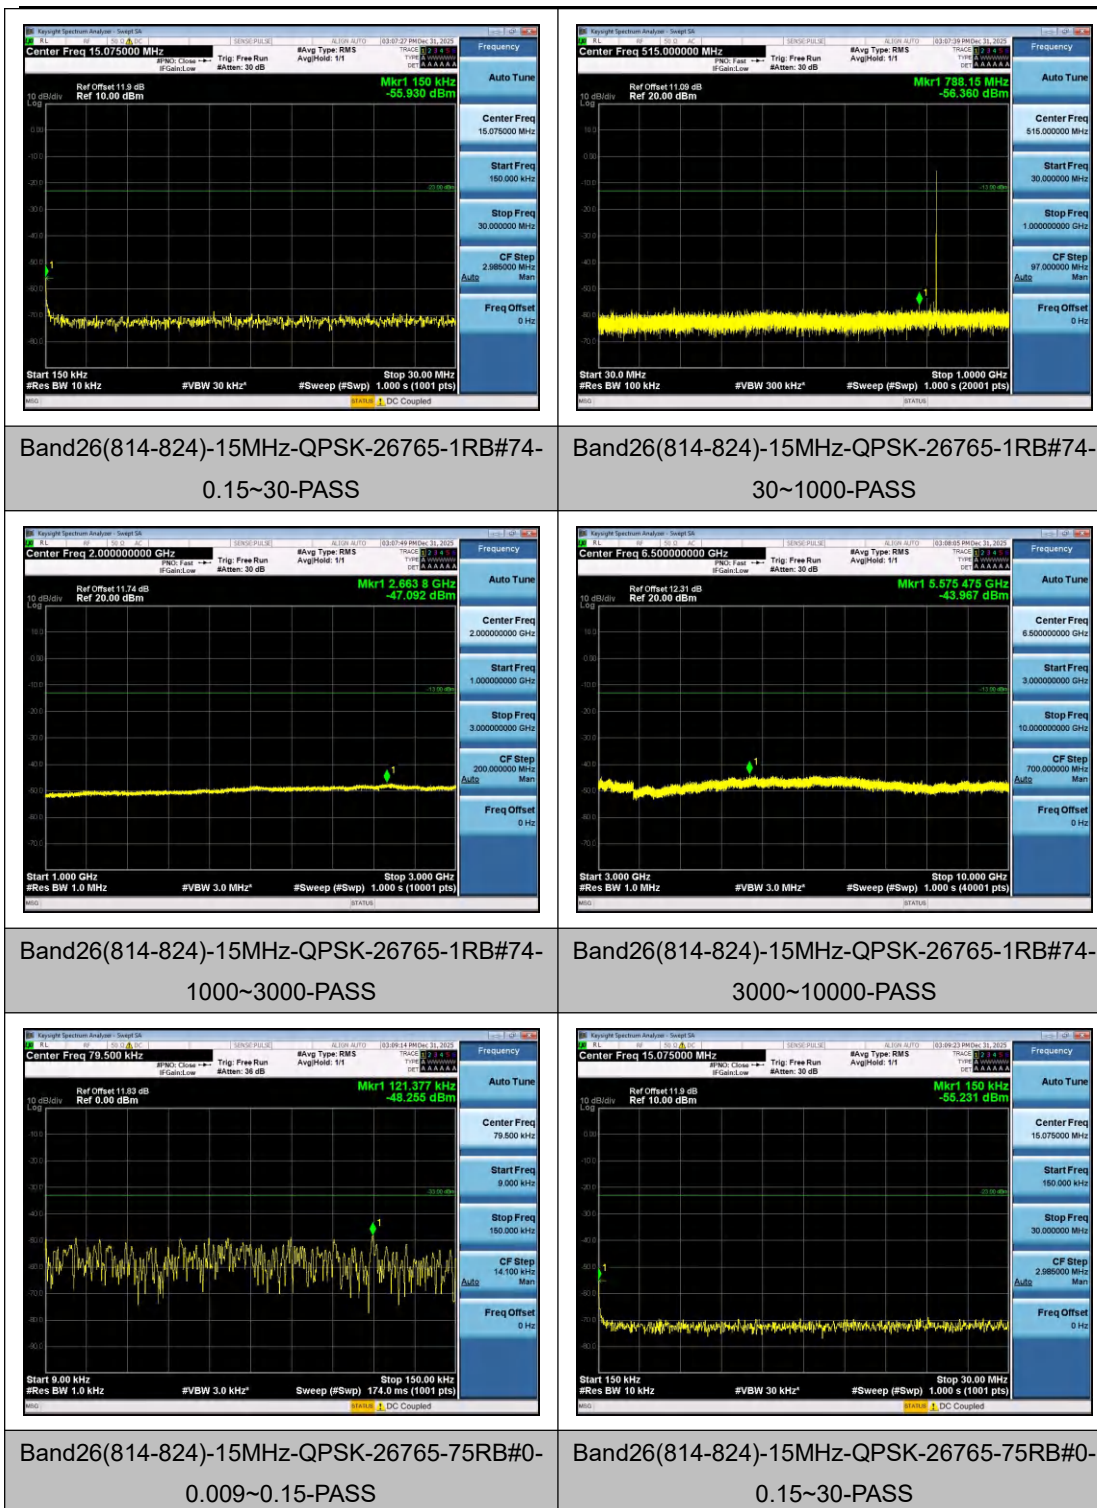

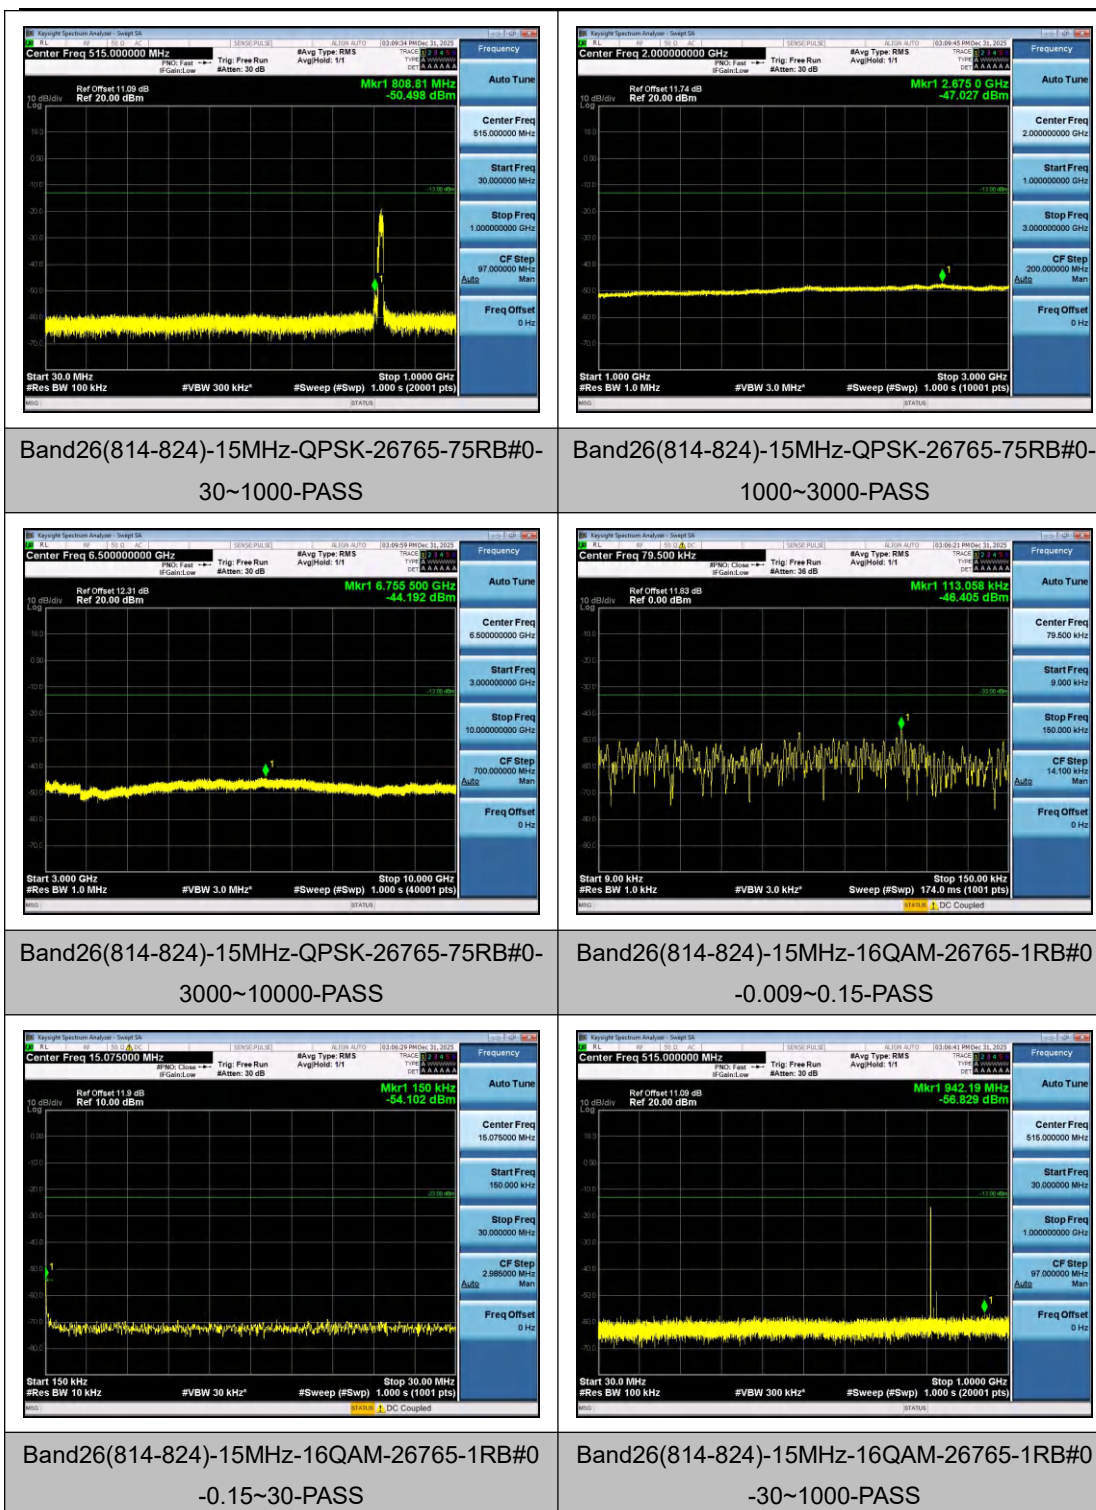

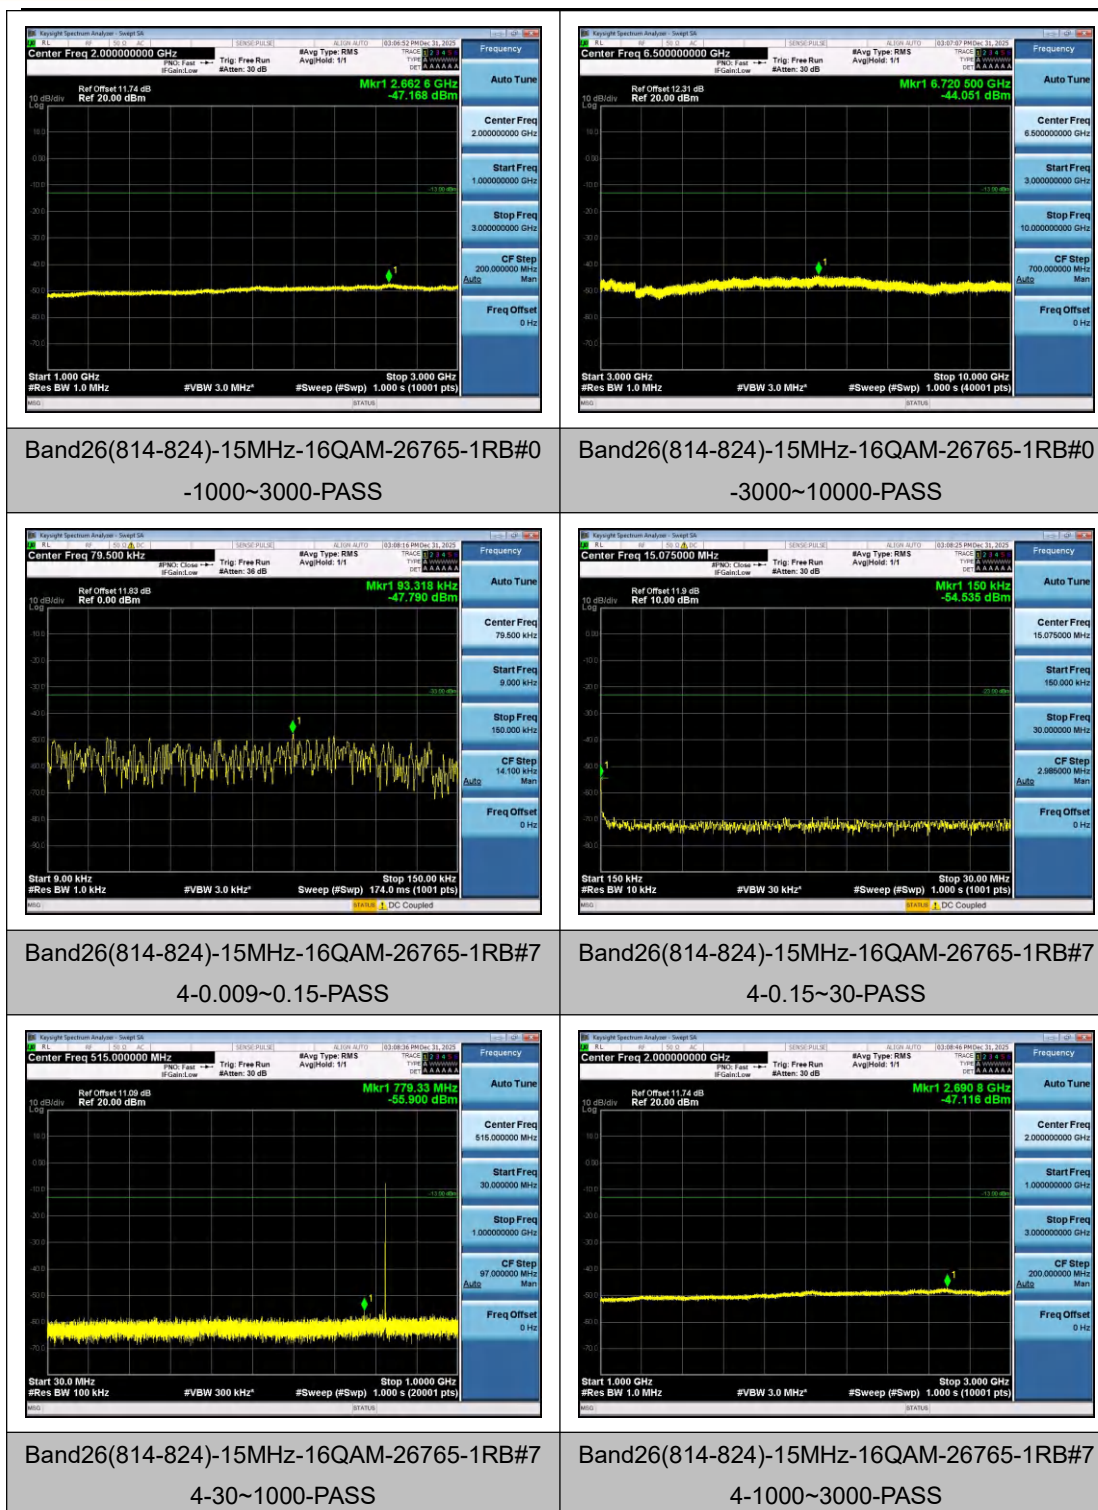

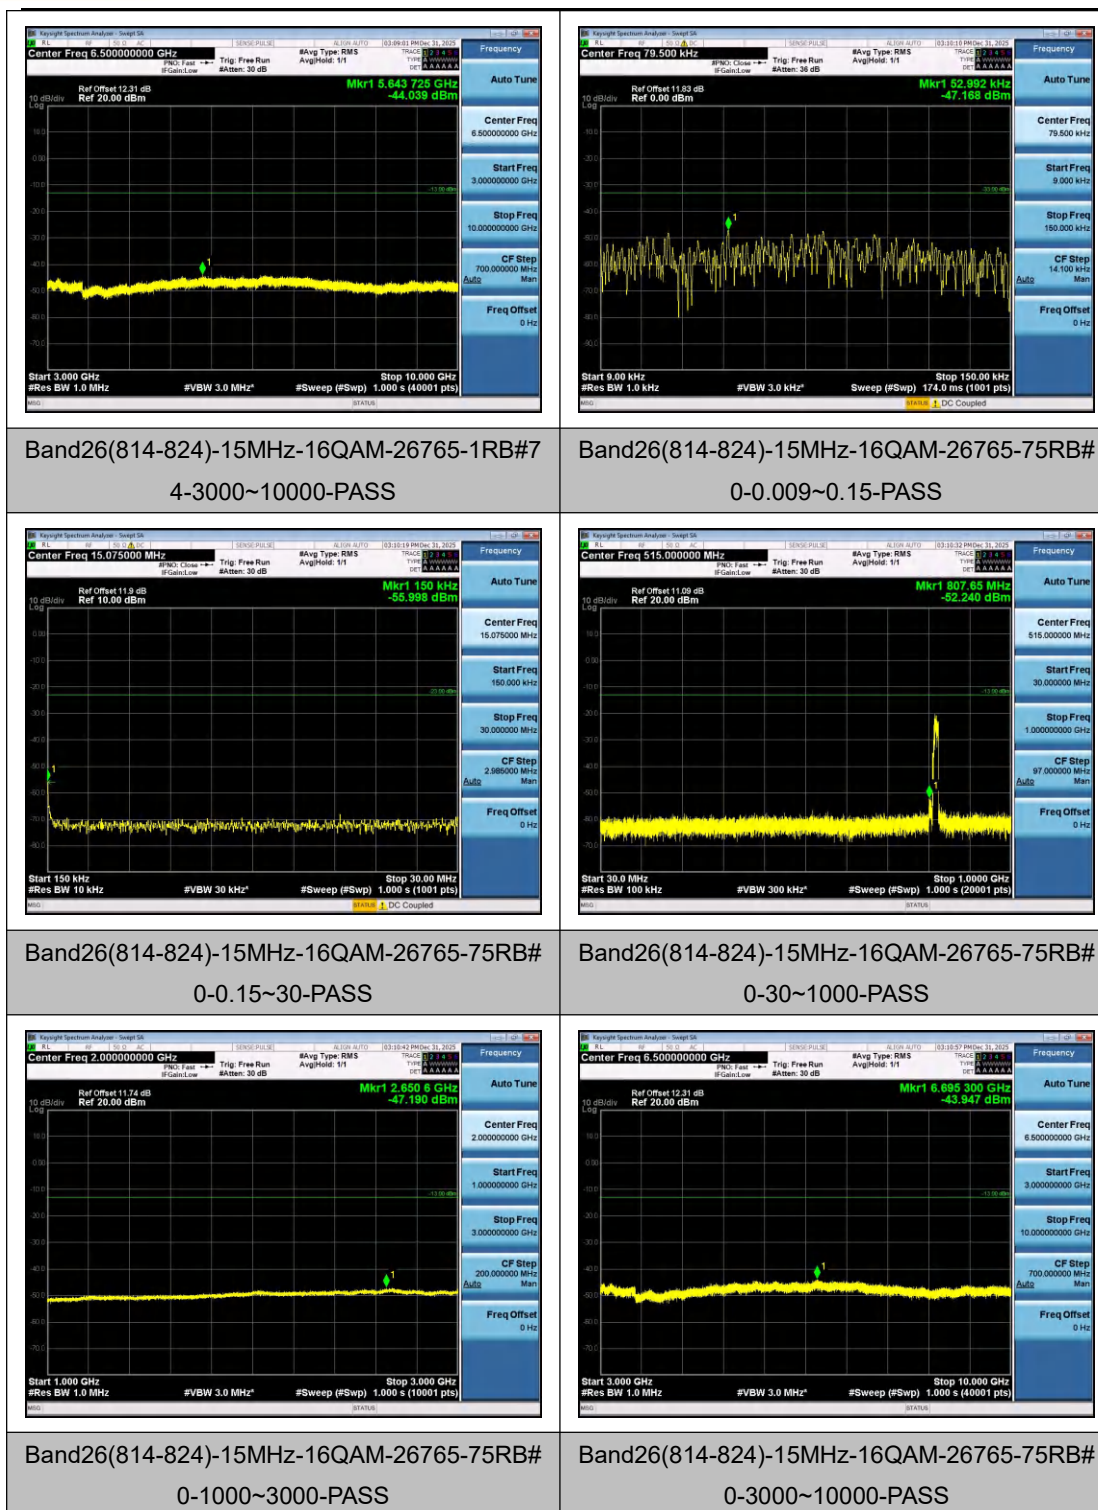

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band26(814-824)	1.4MHz	QPSK	26697	6RB#0	VN	NT	-3.83	-0.004701	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26697	6RB#0	VL	NT	-3.00	-0.003682	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26697	6RB#0	VH	NT	-5.45	-0.006690	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26697	6RB#0	VN	NT	-3.00	-0.003682	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26697	6RB#0	VL	NT	-3.48	-0.004272	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26697	6RB#0	VH	NT	-2.23	-0.002737	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	VN	NT	2.88	0.003516	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	VL	NT	-3.55	-0.004335	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	VH	NT	1.93	0.002357	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26740	6RB#0	VN	NT	-2.79	-0.003407	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26740	6RB#0	VL	NT	-3.86	-0.004713	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26740	6RB#0	VH	NT	-1.85	-0.002259	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26783	6RB#0	VN	NT	-3.78	-0.004591	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26783	6RB#0	VL	NT	-1.89	-0.002296	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26783	6RB#0	VH	NT	-3.20	-0.003887	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26783	6RB#0	VN	NT	2.17	0.002636	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26783	6RB#0	VL	NT	-3.85	-0.004676	±2.5	PASS
Band26(814-824)	1.4MHz	16QAM	26783	6RB#0	VH	NT	-3.05	-0.003705	±2.5	PASS

Band26(814-824)	3MHz	QPSK	26705	15RB#0	VN	NT	-3.95	-0.004844	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26705	15RB#0	VL	NT	-4.13	-0.005064	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26705	15RB#0	VH	NT	-2.86	-0.003507	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26705	15RB#0	VN	NT	-3.12	-0.003826	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26705	15RB#0	VL	NT	-6.14	-0.007529	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26705	15RB#0	VH	NT	-4.75	-0.005825	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	VN	NT	-4.96	-0.006056	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	VL	NT	-2.96	-0.003614	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	VH	NT	-6.42	-0.007839	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26740	15RB#0	VN	NT	-2.79	-0.003407	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26740	15RB#0	VL	NT	3.18	0.003883	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26740	15RB#0	VH	NT	-3.19	-0.003895	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26775	15RB#0	VN	NT	2.05	0.002492	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26775	15RB#0	VL	NT	3.63	0.004413	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26775	15RB#0	VH	NT	2.68	0.003258	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26775	15RB#0	VN	NT	-2.62	-0.003185	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26775	15RB#0	VL	NT	-2.75	-0.003343	±2.5	PASS
Band26(814-824)	3MHz	16QAM	26775	15RB#0	VH	NT	-2.45	-0.002979	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26715	25RB#0	VN	NT	-2.57	-0.003148	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26715	25RB#0	VL	NT	-3.50	-0.004287	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26715	25RB#0	VH	NT	-3.78	-0.004630	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band26(814-824)	5MHz	16QAM	26715	25RB#0	VN	NT	3.78	0.004630	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26715	25RB#0	VL	NT	2.76	0.003380	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26715	25RB#0	VH	NT	2.73	0.003344	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	VN	NT	-3.19	-0.003895	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	VL	NT	-3.48	-0.004249	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	VH	NT	-3.65	-0.004457	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26740	25RB#0	VN	NT	-2.13	-0.002601	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26740	25RB#0	VL	NT	-3.55	-0.004335	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26740	25RB#0	VH	NT	-4.55	-0.005556	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26765	25RB#0	VN	NT	2.86	0.003481	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26765	25RB#0	VL	NT	-2.57	-0.003128	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26765	25RB#0	VH	NT	-1.59	-0.001935	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26765	25RB#0	VN	NT	-1.87	-0.002276	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26765	25RB#0	VL	NT	-3.13	-0.003810	±2.5	PASS
Band26(814-824)	5MHz	16QAM	26765	25RB#0	VH	NT	2.15	0.002617	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	VN	NT	-2.56	-0.003126	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	VL	NT	-4.53	-0.005531	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	VH	NT	-2.73	-0.003333	±2.5	PASS
Band26(814-824)	10MHz	16QAM	26740	50RB#0	VN	NT	-4.42	-0.005397	±2.5	PASS
Band26(814-824)	10MHz	16QAM	26740	50RB#0	VL	NT	-3.02	-0.003687	±2.5	PASS
Band26(814-824)	10MHz	16QAM	26740	50RB#0	VH	NT	-4.26	-0.005201	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com