





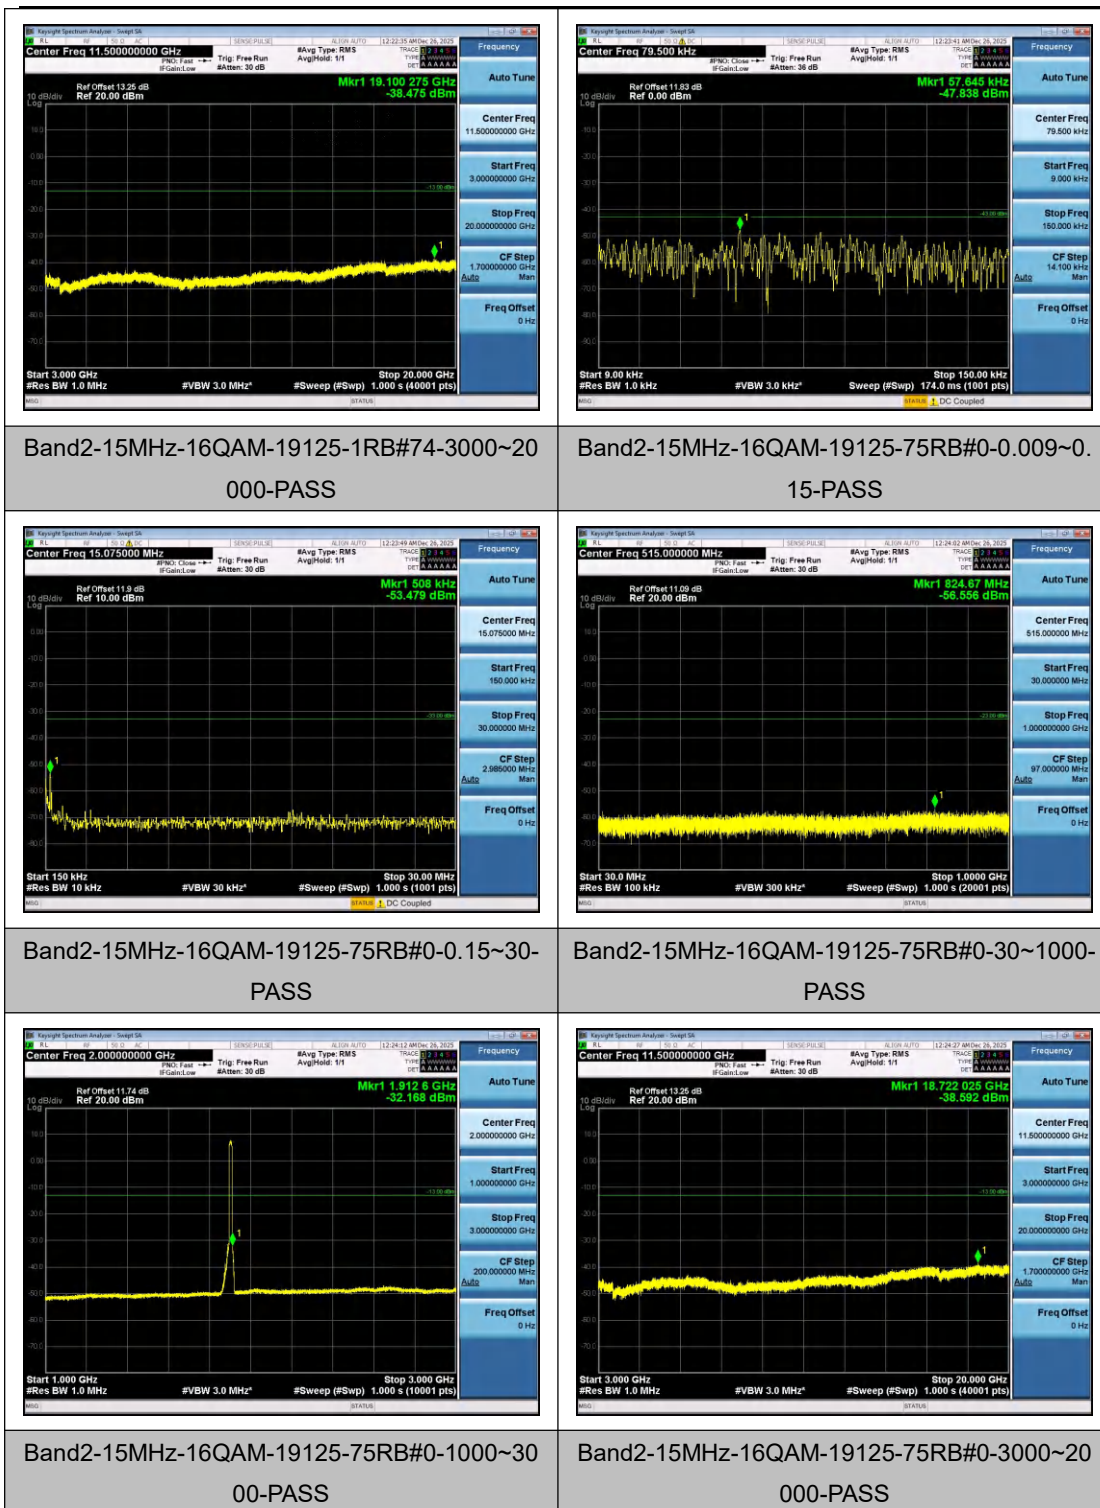


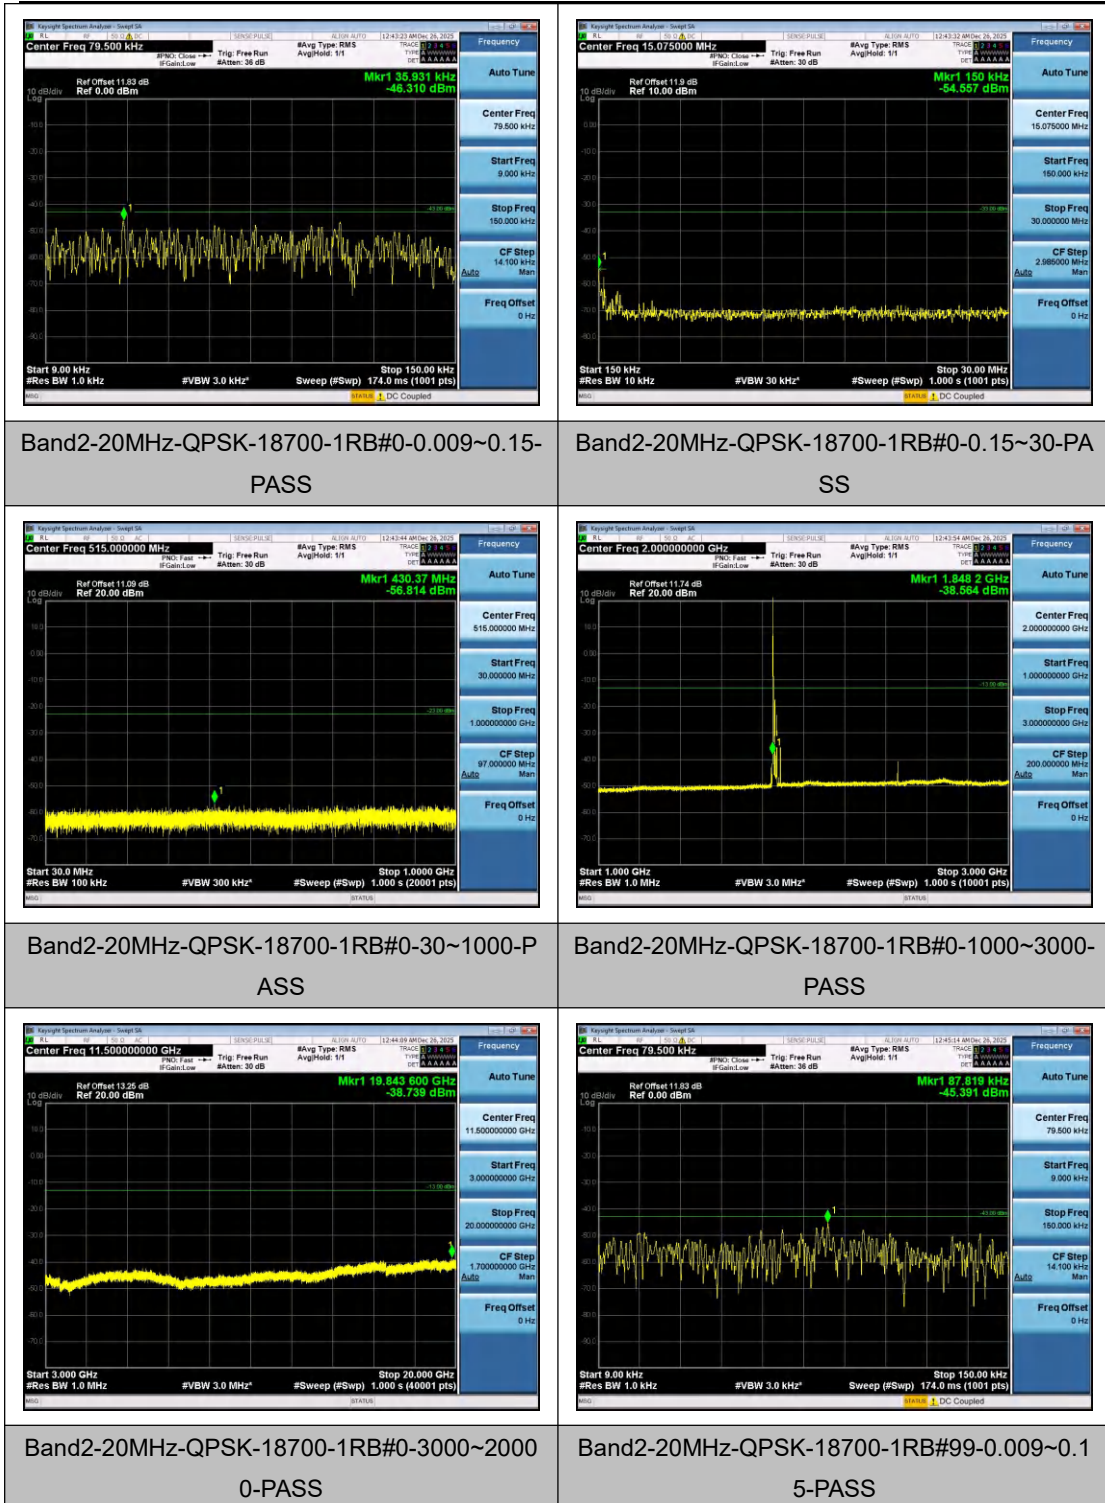

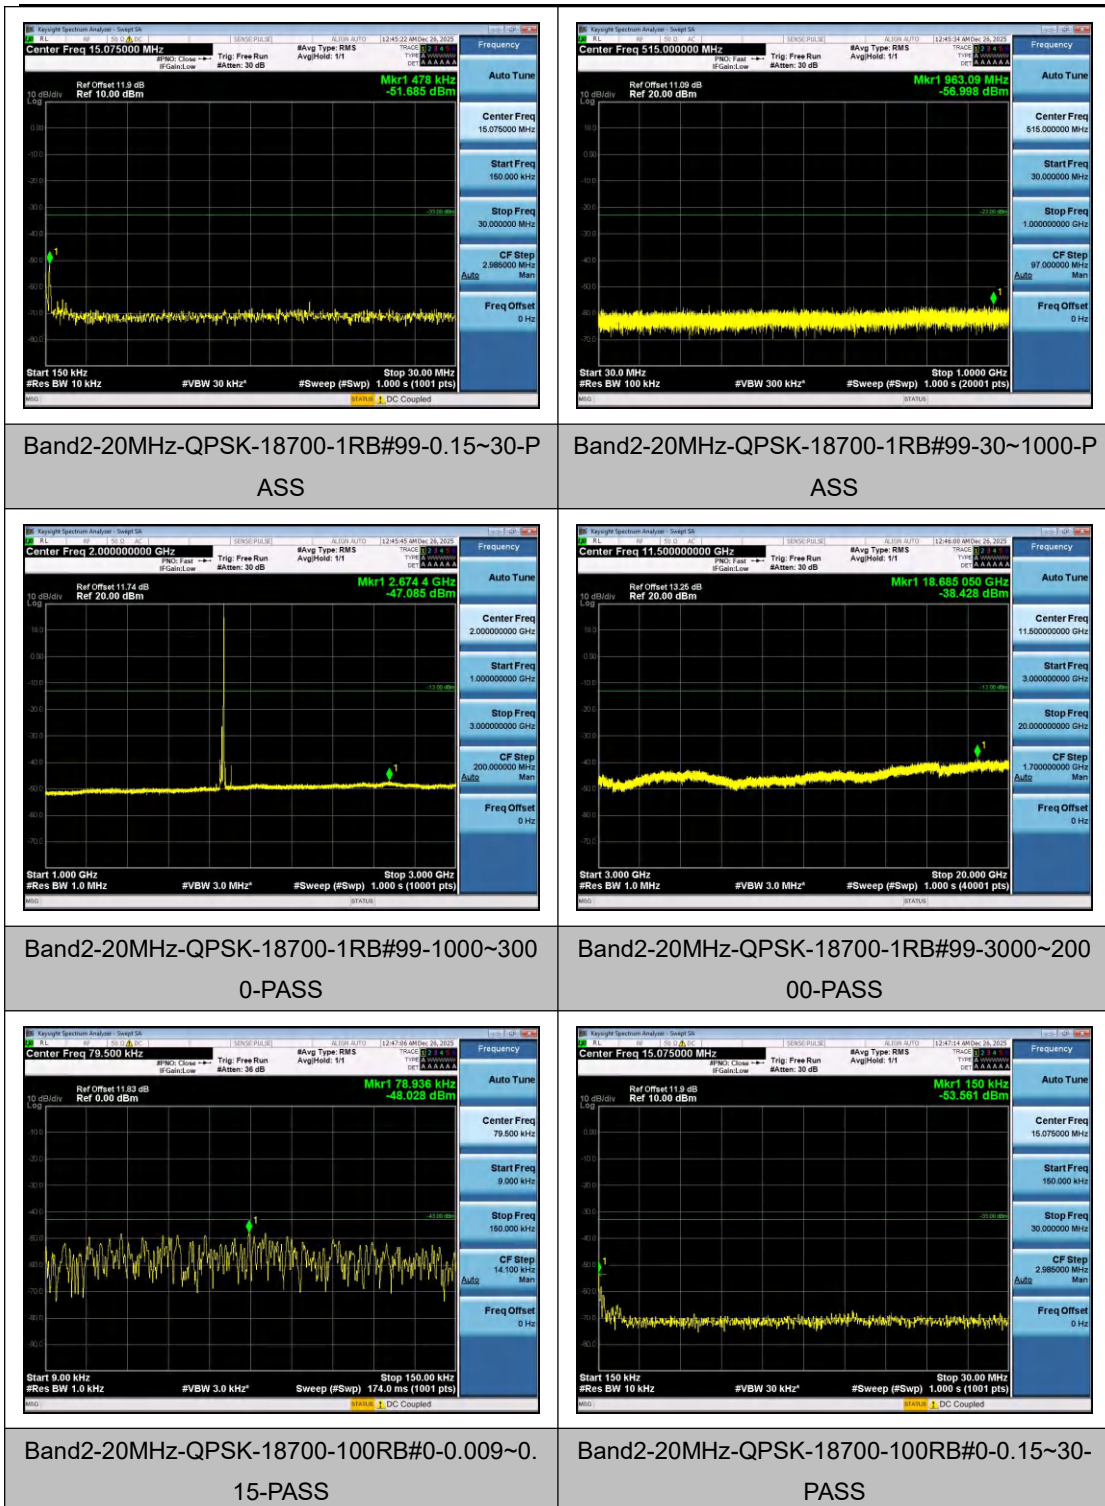


Band2-20MHz-QPSK-18700-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-18700-100RB#0-1000~3000-PASS
Band2-20MHz-QPSK-18700-100RB#0-3000~20000-PASS	Band2-20MHz-16QAM-18700-1RB#0-0.009~0.15-PASS
Band2-20MHz-16QAM-18700-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-18700-1RB#0-30~1000-PASS

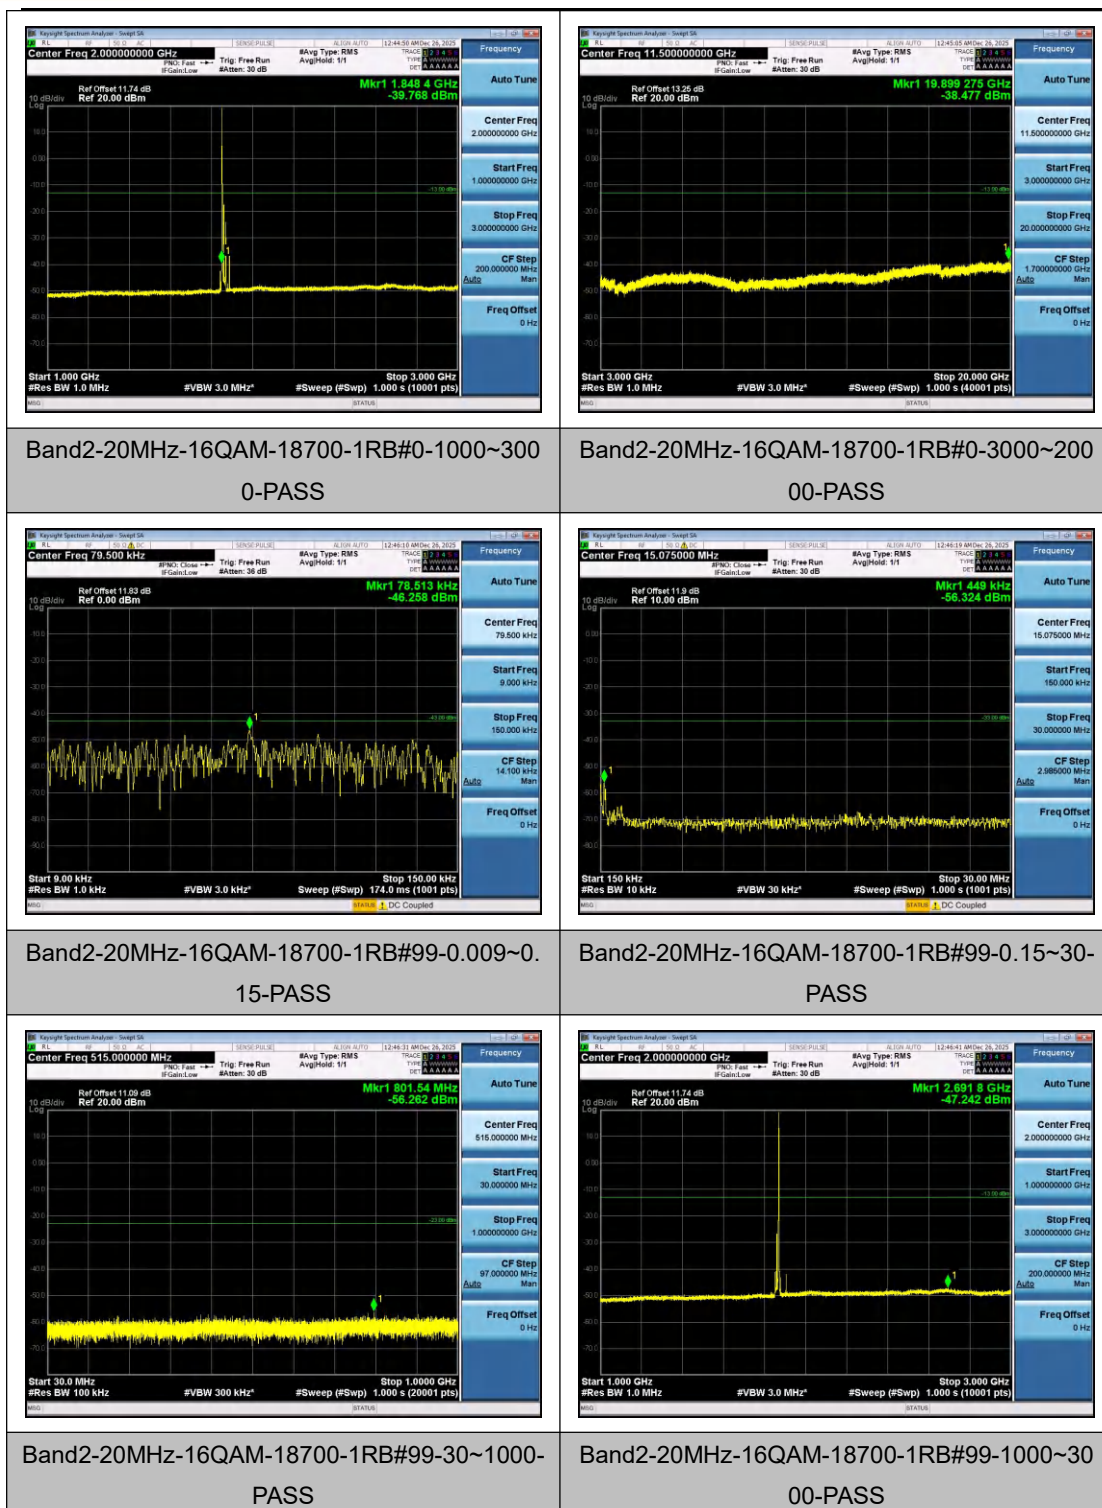


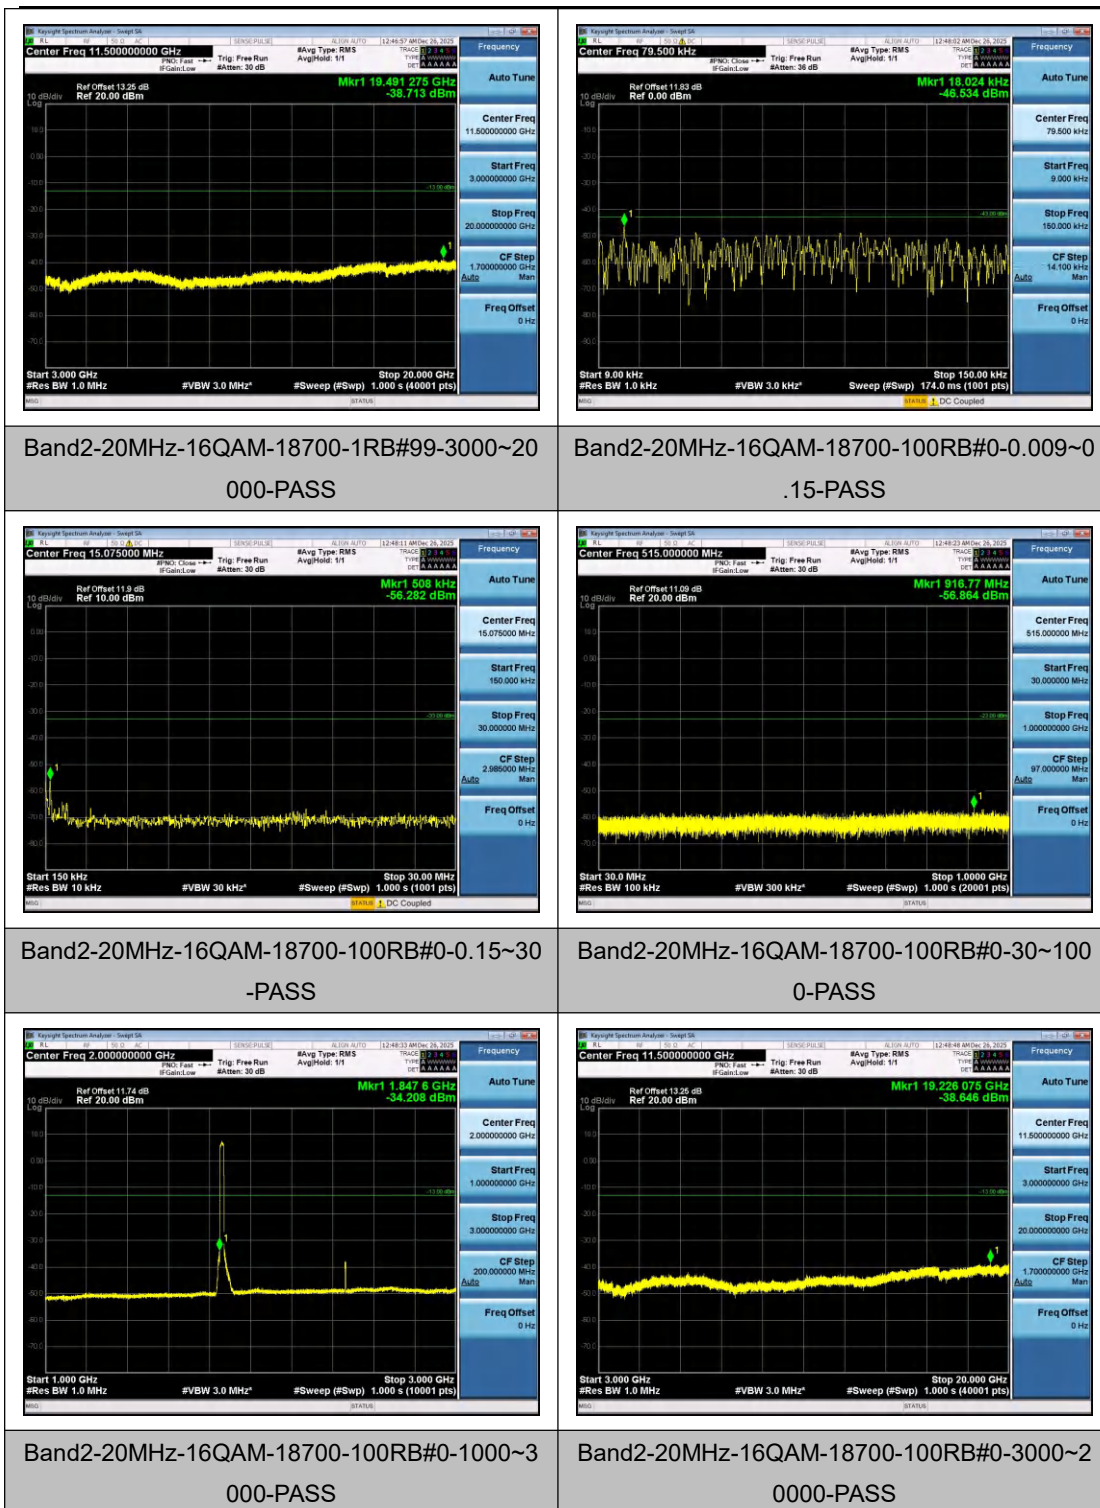


Band2-20MHz-QPSK-18900-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-18900-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-18900-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-18900-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-18900-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-18900-1RB#99-0.009~0.1 5-PASS

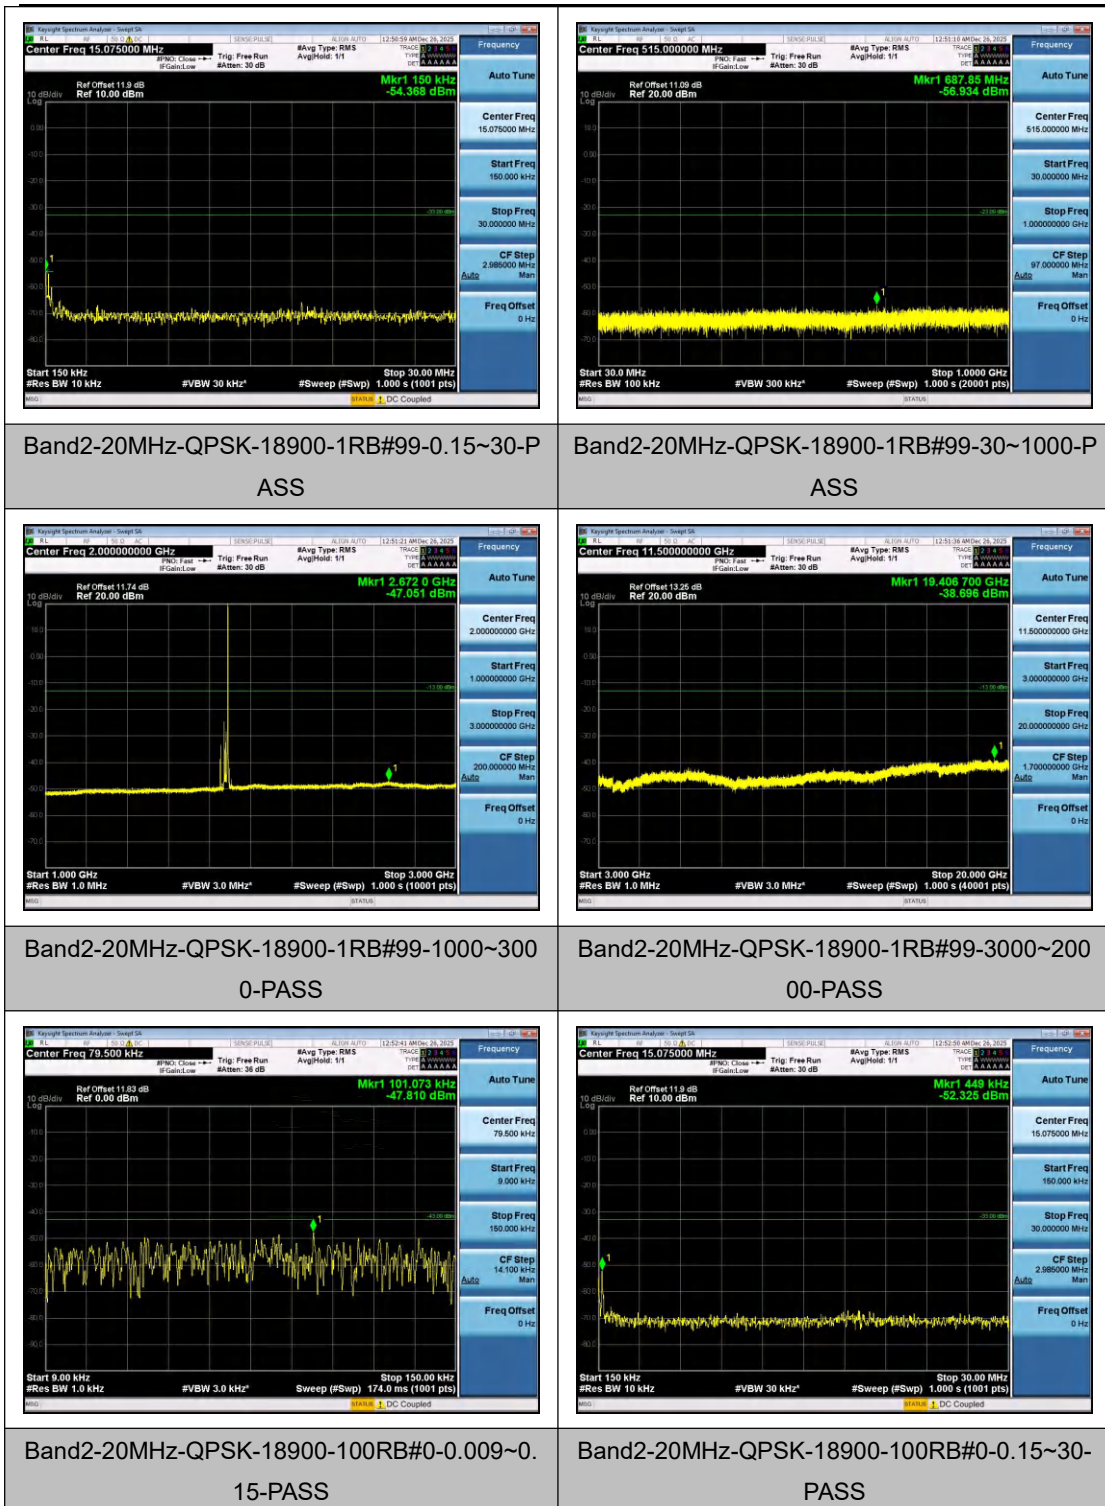



Center Freq 515.000000 MHz Ref Offset 11.00 dB Ref 20.00 dBm Mkr1 925.70 MHz -56.359 dBm Auto Tune Center Freq 515.000000 MHz Start Freq 30.000000 MHz Stop Freq 1.000000000 GHz CF Step 97.000000 MHz Man Freq Offset 0 Hz Start 30.0 MHz #Res BW 100 kHz #VBW 300 kHz* #Sweep (#Swp) 1.000 s (20001 pts)	Center Freq 2.000000000 GHz Ref Offset 11.74 dB Ref 20.00 dBm Mkr1 1.946 8 GHz -43.755 dBm Auto Tune Center Freq 2.000000000 GHz Start Freq 1.000000000 GHz Stop Freq 3.000000000 GHz CF Step 200.000000 MHz Man Freq Offset 0 Hz Start 1.000 GHz #Res BW 1.0 MHz #VBW 3.0 MHz* #Sweep (#Swp) 1.000 s (10001 pts)
Band2-20MHz-QPSK-18900-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-18900-100RB#0-1000~3000-PASS
Center Freq 11.500000000 GHz Ref Offset 13.26 dB Ref 20.00 dBm Mkr1 19.857 625 GHz -38.674 dBm Auto Tune Center Freq 11.500000000 GHz Start Freq 3.000000000 GHz Stop Freq 20.000000000 GHz CF Step 1.700000000 GHz Man Freq Offset 0 Hz Start 3.000 GHz #Res BW 1.0 MHz #VBW 3.0 MHz* #Sweep (#Swp) 1.000 s (40001 pts)	Center Freq 79.500 kHz Ref Offset 11.83 dB Ref 0.00 dBm Mkr1 83.025 kHz -47.955 dBm Auto Tune Center Freq 79.500 kHz Start Freq 9.000 kHz Stop Freq 150.000 kHz CF Step 14.100 kHz Man Freq Offset 0 Hz Start 9.000 kHz #Res BW 1.0 kHz #VBW 3.0 kHz* #Sweep (#Swp) 174.0 ms (10001 pts)
Band2-20MHz-QPSK-18900-100RB#0-3000~20000-PASS	Band2-20MHz-16QAM-18900-1RB#0-0.009~0.15-PASS
Center Freq 15.075000 MHz Ref Offset 11.9 dB Ref 10.00 dBm Mkr1 448 kHz -53.541 dBm Auto Tune Center Freq 15.075000 MHz Start Freq 150.000 kHz Stop Freq 30.000000 MHz CF Step 2.985000 MHz Man Freq Offset 0 Hz Start 150 kHz #Res BW 10 kHz #VBW 30 kHz* #Sweep (#Swp) 1.000 s (10001 pts)	Center Freq 515.000000 MHz Ref Offset 11.00 dB Ref 20.00 dBm Mkr1 936.41 MHz -56.513 dBm Auto Tune Center Freq 515.000000 MHz Start Freq 30.000000 MHz Stop Freq 1.000000000 GHz CF Step 97.000000 MHz Man Freq Offset 0 Hz Start 30.0 MHz #Res BW 100 kHz #VBW 300 kHz* #Sweep (#Swp) 1.000 s (20001 pts)
Band2-20MHz-16QAM-18900-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-18900-1RB#0-30~1000-PASS

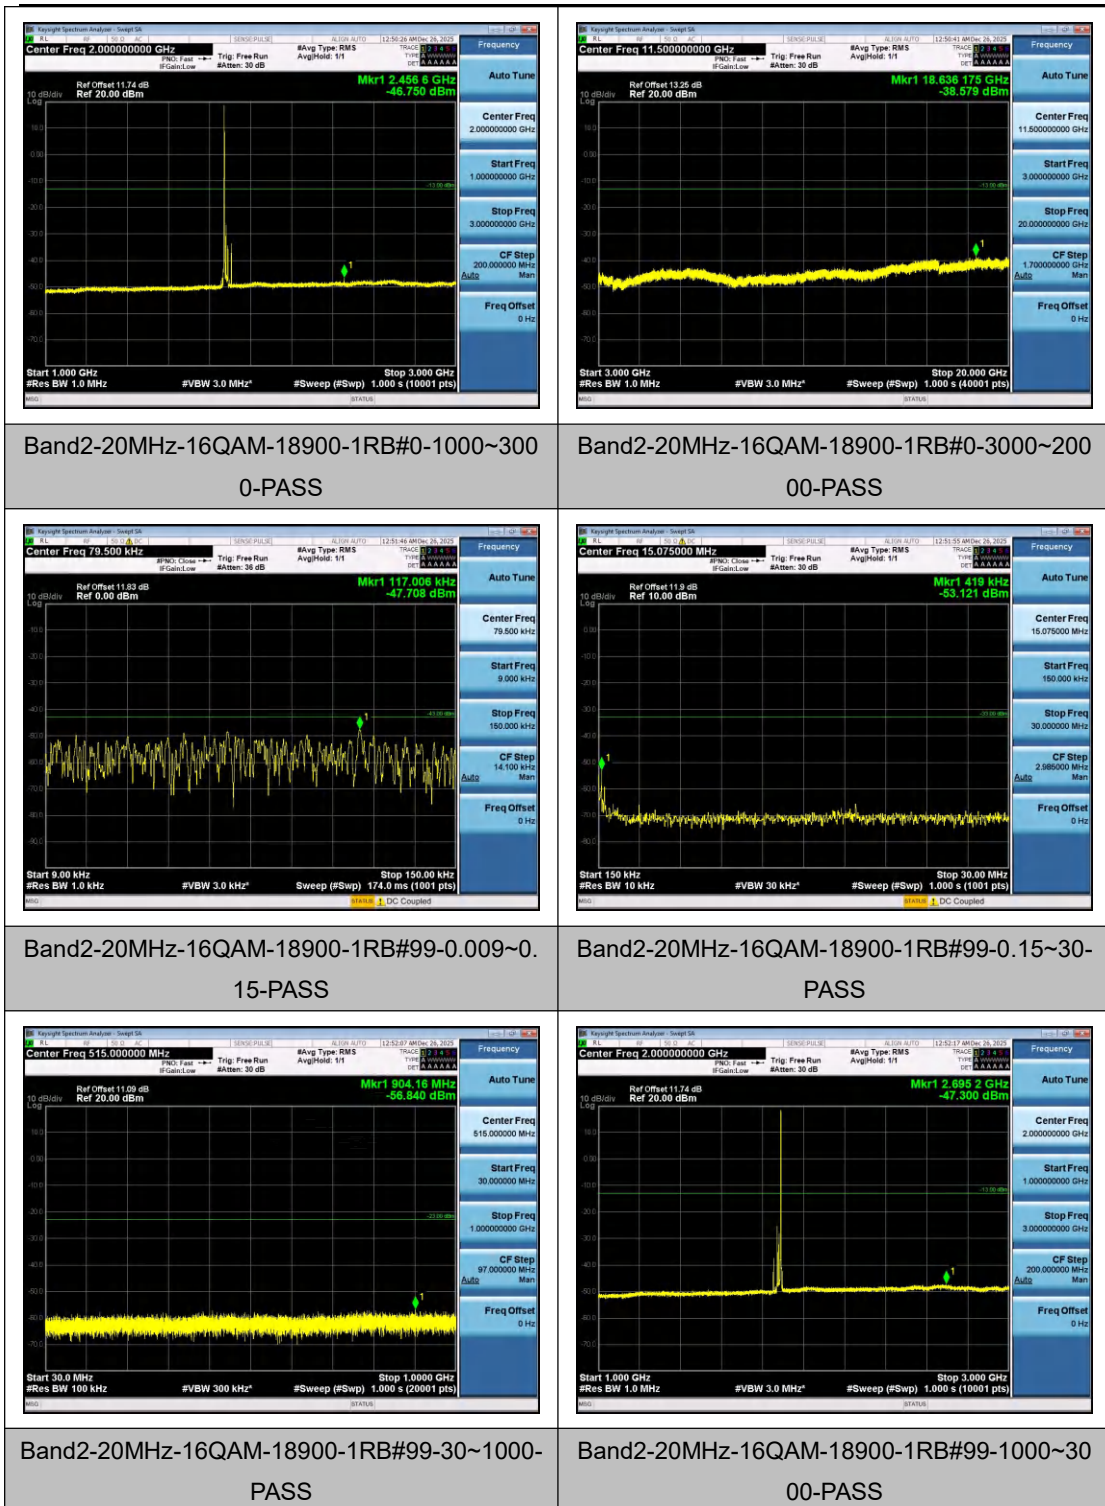


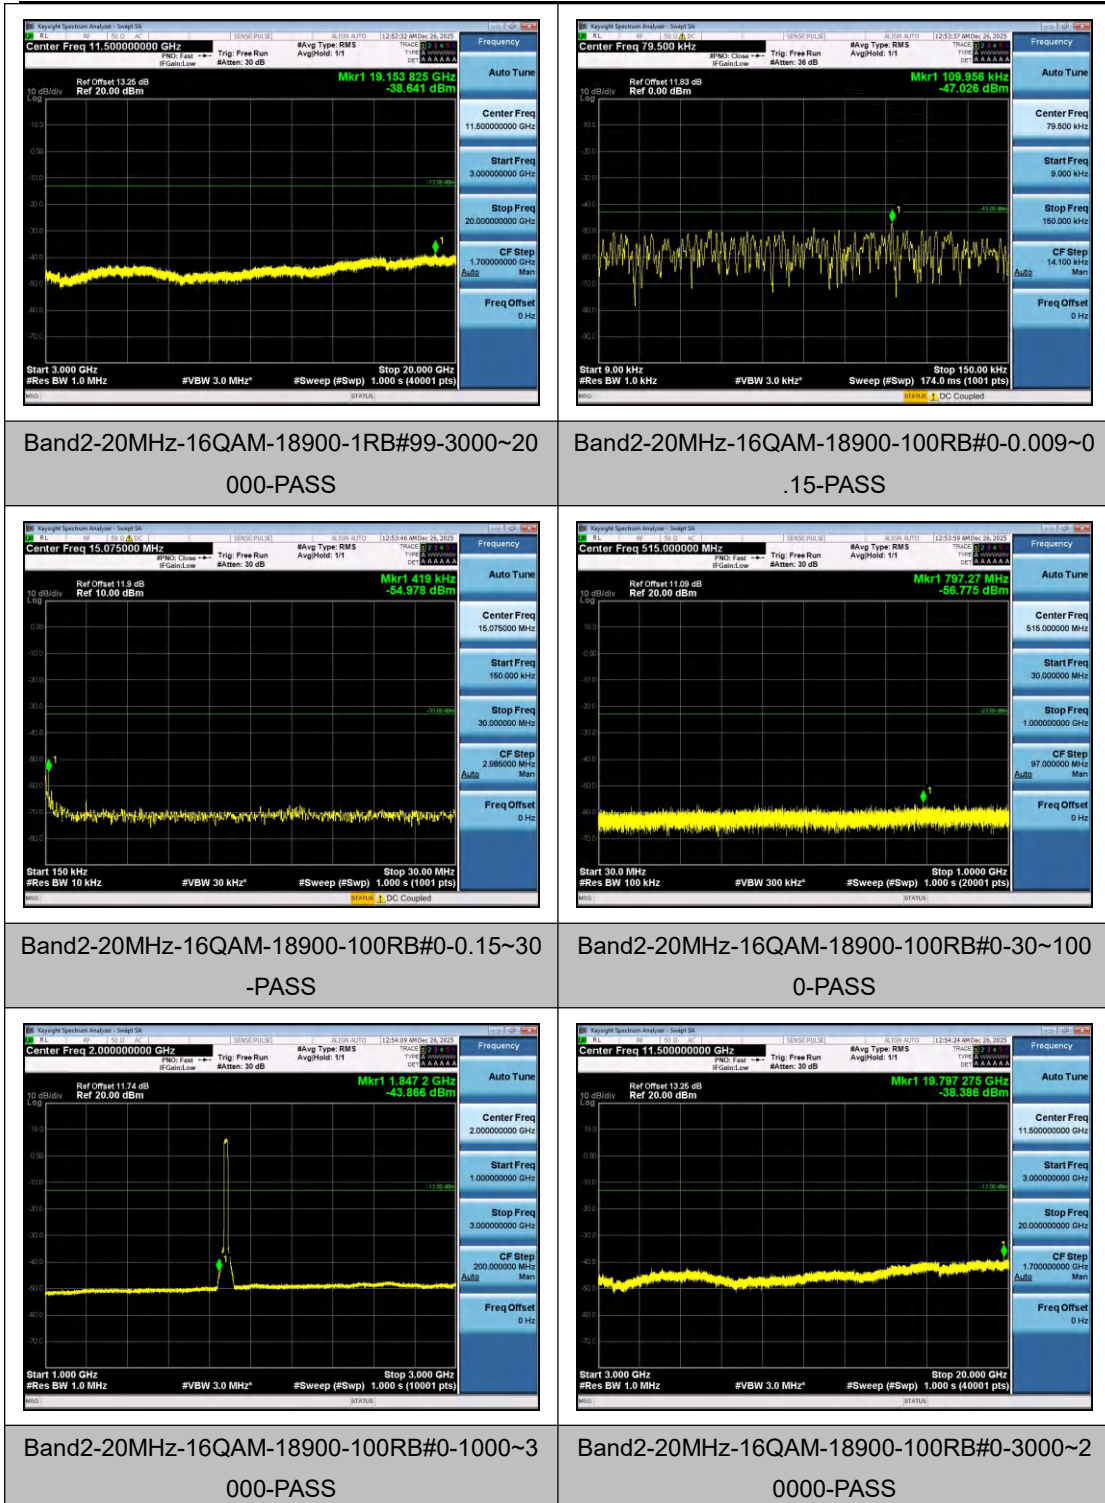


Band2-20MHz-QPSK-19100-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-19100-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-19100-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-19100-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-19100-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-19100-1RB#99-0.009~0.1 5-PASS

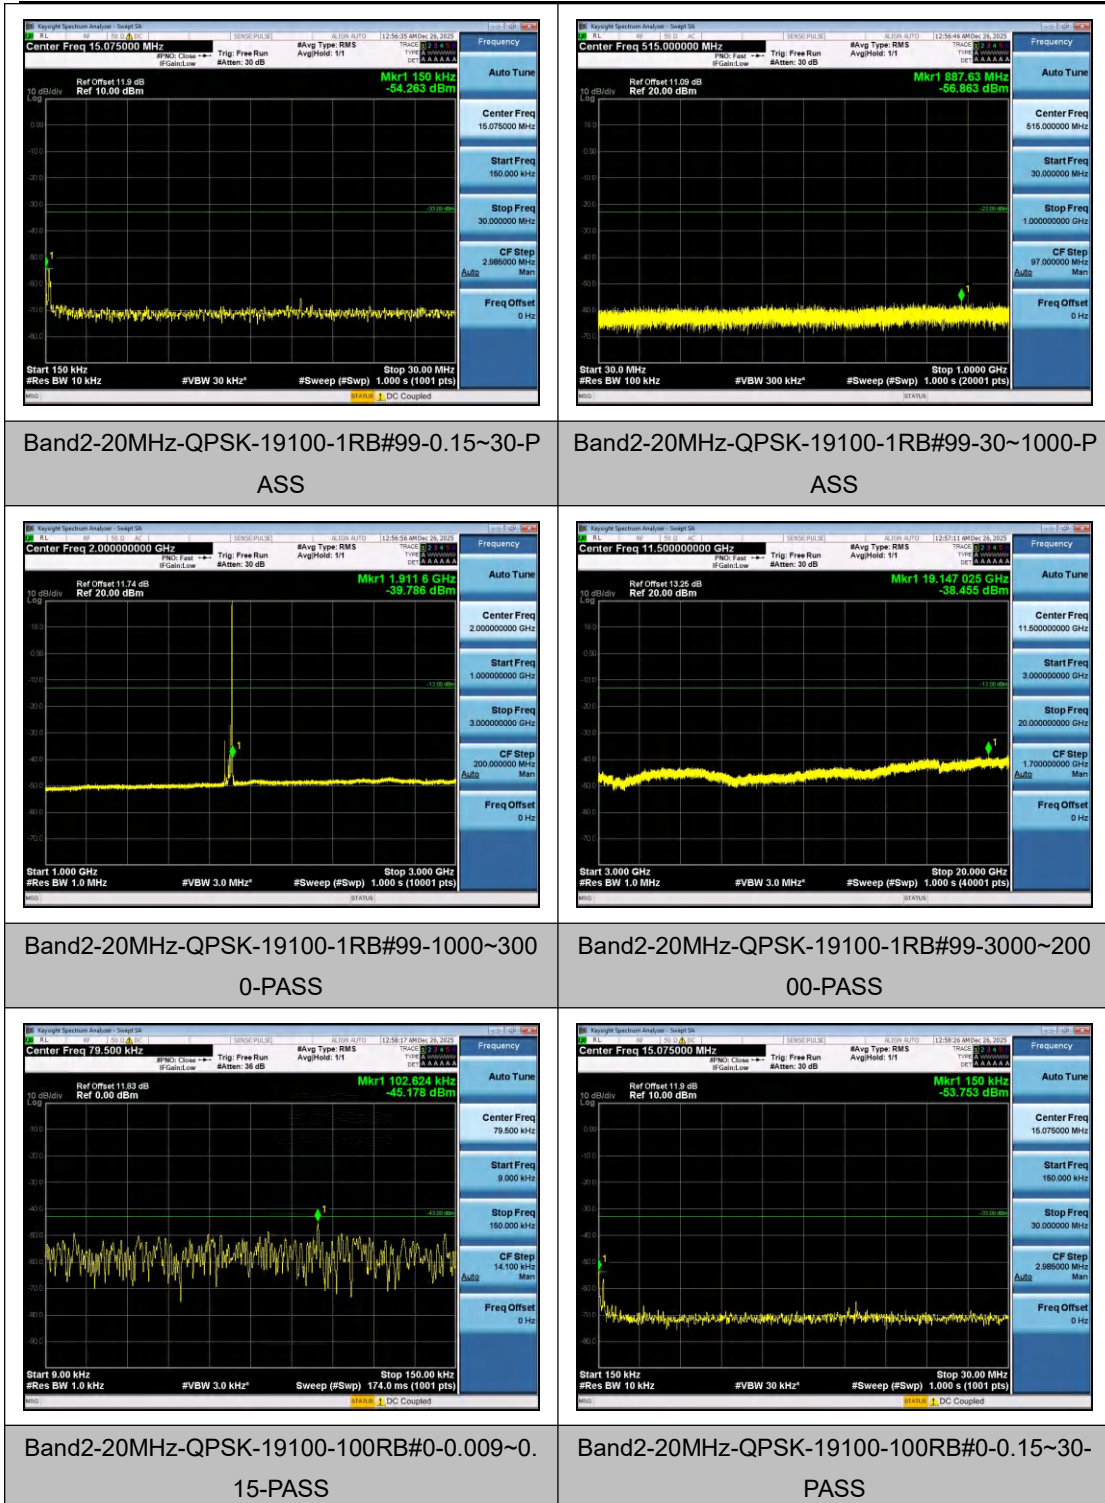

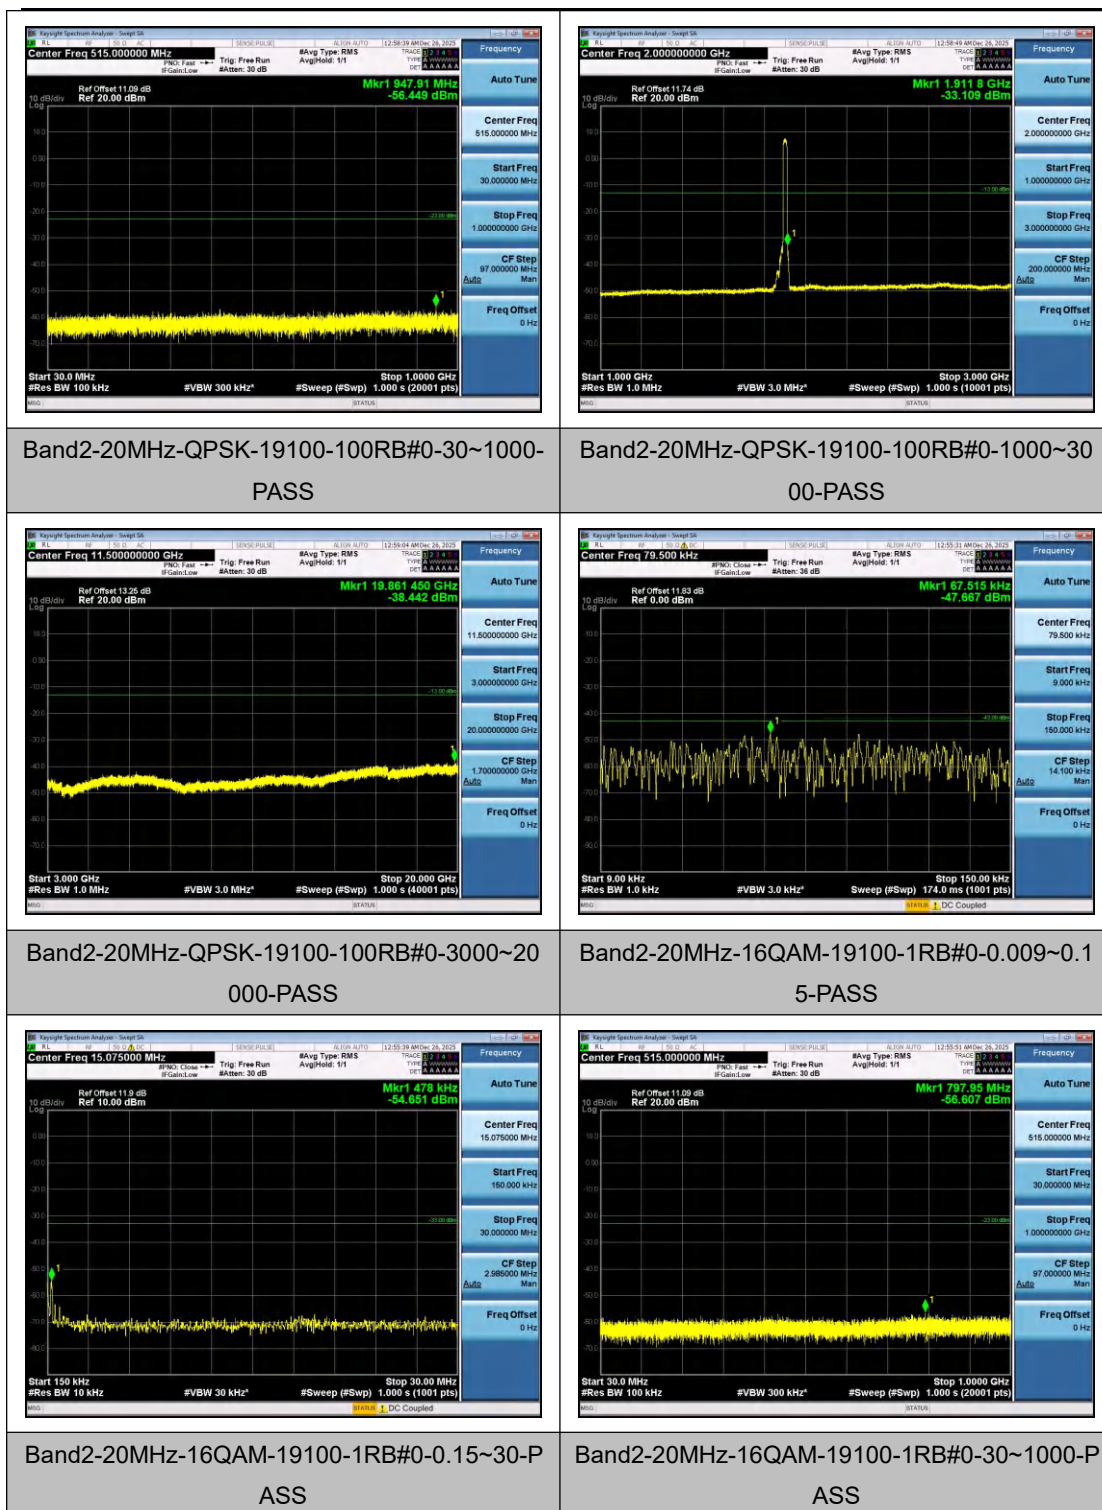

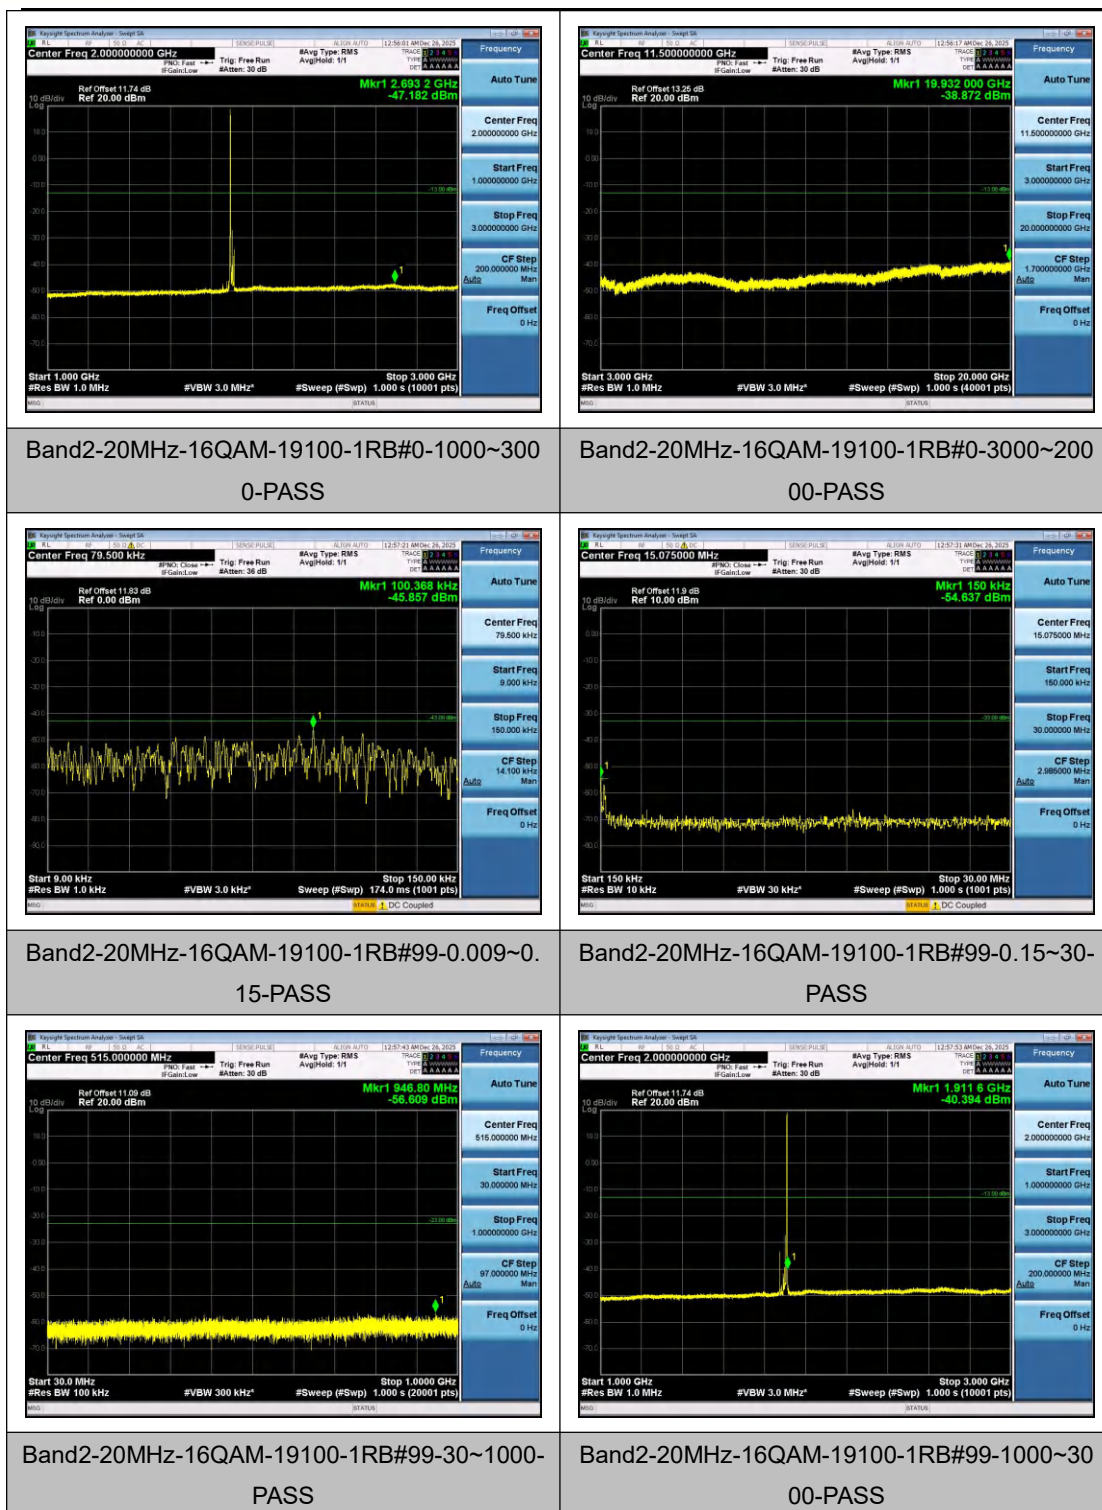

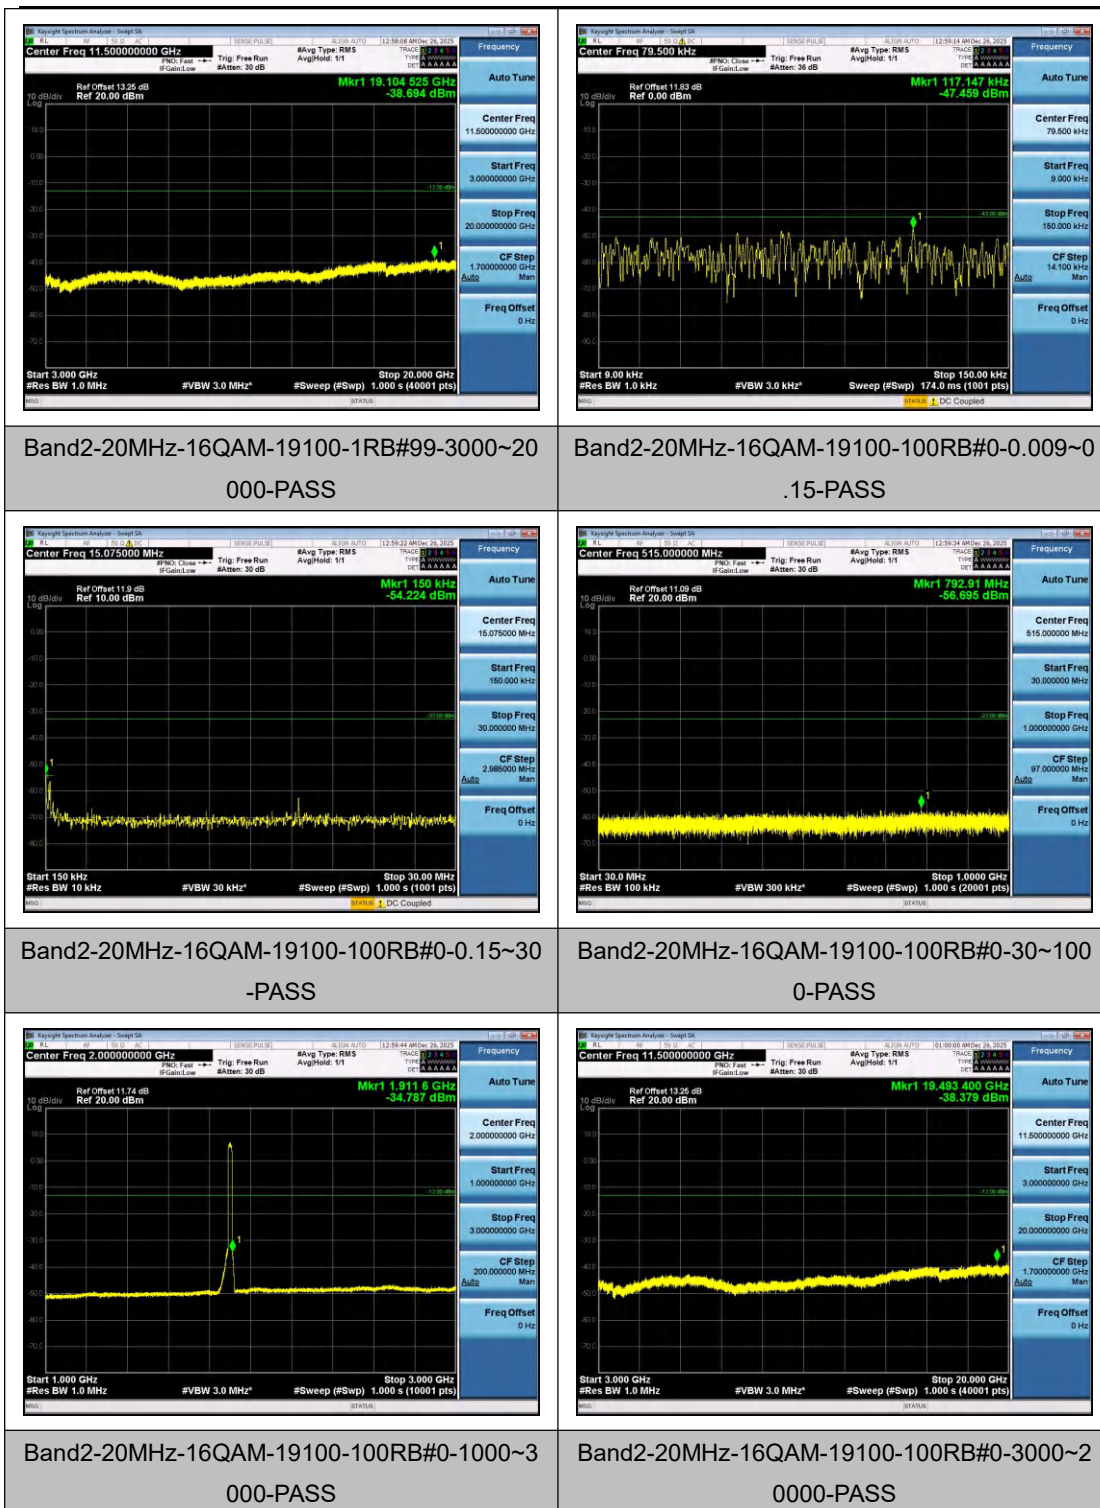

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15871	1851.23891	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15962	1851.23792	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.1592	1851.2373	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15684	1851.23814	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15549	1851.23809	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15763	1851.23733	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45877	1880.53797	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45634	1880.53644	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45769	1880.53789	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45653	1880.53523	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45744	1880.53864	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45758	1880.53768	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75794	1909.83884	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75642	1909.83932	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75736	1909.83756	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75508	1909.83848	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75637	1909.83837	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75863	1909.83813	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.15 841	1852.84 371	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.15 716	1852.84 406	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 035	1852.83 775	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.15 966	1852.83 856	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.16 074	1852.83 714	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.15 913	1852.83 843	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.65 628	1881.34 308	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.65 796	1881.34 236	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.65 58	1881.34 53	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.65 828	1881.34 148	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.65 911	1881.34 091	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.65 815	1881.33 685	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.15 679	1909.84 159	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.15 496	1909.84 166	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.15 699	1909.84 319	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.15 674	1909.83 844	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15 521	1909.83 951	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.15 543	1909.83 683	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 161	1854.73 991	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.25 768	1854.73 858	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.25 68	1854.73 68	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 291	1854.74 241	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26 504	1854.74 164	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.26 2	1854.74 03	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.76 481	1882.23 721	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.76 062	1882.23 582	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.75 639	1882.23 489	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.75 88	1882.23 34	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 135	1882.23 785	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 232	1882.23 522	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.26 408	1909.73 358	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26 312	1909.73 142	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.26 33	1909.73 39	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.26 22	1909.73 42	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26 498	1909.73 278	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.26 143	1909.73 493	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.54 395	1859.47 115	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.54 778	1859.45 758	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.54 423	1859.45 993	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.54 68	1859.46 6	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.54 666	1859.47 046	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.54 796	1859.46 216	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.52 769	1884.46 739	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.53 852	1884.45 672	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.52 991	1884.46 141	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.53 848	1884.47 008	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.53 247	1884.46 587	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.54 208	1884.45 448	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.52 762	1909.45 262	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.53 064	1909.44 904	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.52 191	1909.44 641	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.52 818	1909.44 608	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.52 495	1909.45 115	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.52 387	1909.44 557	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.83 006	1864.18 206	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.83 625	1864.18 425	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.83 661	1864.17 761	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.83 077	1864.18 077	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.81 3	1864.19 8	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.82 042	1864.18 542	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.29 7	1886.69 5	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.31 292	1886.68 592	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.31 121	1886.69 621	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.30 481	1886.68 181	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.30 415	1886.68 915	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.30 28	1886.68 98	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.80 405	1909.17 805	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.80 186	1909.17 786	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.80 615	1909.18 015	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.79 502	1909.17 102	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.79 108	1909.17 508	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.80 631	1909.18 731	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VN	NT	1851.10 878	1868.92 878	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VL	NT	1851.11 086	1868.92 586	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VH	NT	1851.12 199	1868.91 099	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VN	NT	1851.09 398	1868.92 798	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VL	NT	1851.10 97	1868.91 27	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VH	NT	1851.10 242	1868.92 442	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VN	NT	1871.09 83	1888.90 63	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VL	NT	1871.06 882	1888.91 782	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VH	NT	1871.08 772	1888.90 572	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB# 0	VN	NT	1871.08 497	1888.93 597	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB# 0	VL	NT	1871.08 98	1888.92 58	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB# 0	VH	NT	1871.10 423	1888.92 023	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB# 0	VN	NT	1891.06 714	1908.89 514	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB# 0	VL	NT	1891.08 037	1908.89 737	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB# 0	VH	NT	1891.07 5	1908.89 3	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VN	NT	1891.10 261	1908.90 161	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VL	NT	1891.08 112	1908.90 712	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VH	NT	1891.10 06	1908.90 66	1850-19 10	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.15 632	1851.23 852	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15 771	1851.23 851	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15 736	1851.23 636	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15 879	1851.23 729	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.15 718	1851.23 838	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.15 914	1851.23 894	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15 639	1851.23 859	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.15 794	1851.23 874	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.15 84	1851.23 91	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.15 493	1851.23 763	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15 822	1851.23 942	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.15 63	1851.23 86	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.15 626	1851.23 736	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15 588	1851.23 618	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.15 68	1851.23 75	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15 656	1851.23 746	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15 725	1851.23 835	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15 668	1851.23 648	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45 712	1880.53 682	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45 741	1880.53 931	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.46 071	1880.53 921	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45 887	1880.53 917	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45 877	1880.53 737	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45 814	1880.53 834	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45 898	1880.53 608	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.45 669	1880.53 789	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45 778	1880.53 748	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45 753	1880.53 653	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45 594	1880.53 744	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45 625	1880.53 825	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.45 66	1880.53 72	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.45 651	1880.53 761	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45 563	1880.53 843	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45 502	1880.53 852	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45 642	1880.53 952	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45 55	1880.53 72	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75 711	1909.83 551	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75 7	1909.83 78	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75 672	1909.83 842	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75 78	1909.83 93	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75 723	1909.83 513	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75 808	1909.83 818	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75 777	1909.83 717	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75 78	1909.83 81	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.75 825	1909.83 605	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75 92	1909.83 85	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75 645	1909.83 765	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.75 928	1909.83 918	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.75 697	1909.83 897	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.75 795	1909.83 855	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.75 853	1909.83 783	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.75 722	1909.83 852	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.75 553	1909.83 603	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.76 086	1909.83 866	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.15 749	1852.84 419	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.16 005	1852.84 885	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.15 75	1852.84 83	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.15 806	1852.84 266	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.15 871	1852.84 211	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.15 895	1852.84 595	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.15 977	1852.84 447	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.15 807	1852.84 137	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.15 847	1852.84 497	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.15 956	1852.83 876	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.16 026	1852.83 966	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.15 764	1852.84 054	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.16 032	1852.83 672	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.15 824	1852.83 994	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.15 837	1852.84 097	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.15 945	1852.84 005	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.15 873	1852.84 113	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.15 918	1852.83 938	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.65 72	1881.34 03	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.65 77	1881.34 47	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.65 876	1881.34 756	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.65 918	1881.34 488	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.65 797	1881.34 657	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.65 684	1881.34 004	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.65 756	1881.34 066	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.65 828	1881.34 148	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.65 877	1881.34 687	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.66 004	1881.34 124	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.65 854	1881.34 014	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.65 931	1881.33 961	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.65 959	1881.34 059	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.65 819	1881.34 069	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.65 807	1881.33 637	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.65 869	1881.33 999	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.65 927	1881.34 077	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.65 874	1881.33 794	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.15 462	1909.84 202	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.15 52	1909.84 04	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.15 682	1909.83 902	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.15 53	1909.84 24	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.15 404	1909.83 824	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.15 514	1909.84 214	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.15 676	1909.84 036	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.15 73	1909.84 44	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.15 65	1909.84 27	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.15 681	1909.83 731	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.15 449	1909.83 929	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.15 582	1909.83 642	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.15 488	1909.83 968	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.15 586	1909.83 966	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.15 739	1909.83 809	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.15 662	1909.83 812	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.15 563	1909.83 973	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.15 587	1909.83 687	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.26 168	1854.73 458	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.26 364	1854.73 764	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.25 327	1854.73 247	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.26 097	1854.73 767	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.25 437	1854.74 057	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.25 064	1854.73 344	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.25 967	1854.73 287	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.25 505	1854.73 835	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.26 178	1854.73 868	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.26 547	1854.73 367	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.26 114	1854.73 554	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.25 752	1854.74 022	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.26 256	1854.74 296	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.26 413	1854.73 113	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.25 934	1854.74 204	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26 047	1854.73 437	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.26 568	1854.73 458	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.26 362	1854.73 252	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.75 974	1882.23 824	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.75 813	1882.23 303	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.75 582	1882.23 342	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.75 589	1882.23 759	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.76 162	1882.23 682	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.75 734	1882.23 764	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.75 638	1882.23 108	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.75 53	1882.23 55	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.75 971	1882.23 921	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.76 034	1882.23 374	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76 099	1882.23 419	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.75 929	1882.23 889	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.75 723	1882.23 503	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.75 934	1882.23 444	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76 041	1882.23 591	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.76 173	1882.23 583	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.76 082	1882.23 522	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76 142	1882.23 282	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.26 221	1909.73 041	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.26 376	1909.73 566	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.26 31	1909.73	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.26 405	1909.72 975	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.26 212	1909.72 982	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.26 324	1909.73 254	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.25 952	1909.73 592	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.26 515	1909.73 285	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.26 478	1909.73 268	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.26 135	1909.73 655	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26 327	1909.73 887	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.25 84	1909.73 33	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.25 805	1909.73 525	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.26 102	1909.73 672	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.25 792	1909.73 382	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.26 634	1909.73 414	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.26 012	1909.73 482	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.26 054	1909.73 494	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.54 554	1859.46 254	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.54 227	1859.45 987	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.54 466	1859.45 786	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.54 114	1859.46 064	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.54 891	1859.46 061	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.53 822	1859.45 772	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.54 238	1859.46 838	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.54 883	1859.46 323	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.54 155	1859.46 705	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.54 597	1859.46 057	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.55 145	1859.47 135	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.54 214	1859.46 684	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.54 658	1859.46 698	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.54 629	1859.46 809	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.54 705	1859.46 755	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.54 63	1859.46 3	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.54 961	1859.46 071	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.54 537	1859.47 017	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.53 413	1884.46 893	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.53 903	1884.46 623	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.53 738	1884.47 218	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.52 994	1884.47 074	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.52 991	1884.46 811	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.53 455	1884.46 455	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.53 545	1884.46 335	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.53 534	1884.46 874	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.53 259	1884.46 709	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.54 262	1884.46 492	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.54 107	1884.46 617	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.54 098	1884.46 968	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.53 07	1884.45 7	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.53 406	1884.46 006	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.53 282	1884.46 802	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.53 939	1884.46 329	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.54 024	1884.47 184	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.54 353	1884.45 543	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.51 58	1909.45 62	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.52 193	1909.45 303	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.52 366	1909.45 876	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.52 785	1909.45 215	1850-19 10	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com