

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 10  | 1900.51<br>768 | 1909.45<br>478 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 20  | 1900.52<br>635 | 1909.45<br>265 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 30  | 1900.52<br>677 | 1909.45<br>257 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 40  | 1900.53<br>213 | 1909.44<br>983 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 50  | 1900.52<br>063 | 1909.45<br>223 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -30 | 1900.53<br>602 | 1909.44<br>562 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -20 | 1900.51<br>528 | 1909.44<br>958 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -10 | 1900.52<br>199 | 1909.44<br>679 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 0   | 1900.53<br>14  | 1909.44<br>75  | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 10  | 1900.52<br>345 | 1909.44<br>715 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 20  | 1900.53<br>159 | 1909.45<br>049 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 30  | 1900.51<br>864 | 1909.44<br>804 | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 40  | 1900.53<br>09  | 1909.44<br>73  | 1850-19<br>10 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 50  | 1900.52<br>072 | 1909.44<br>732 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -30 | 1850.82<br>652 | 1864.18<br>352 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -20 | 1850.82<br>366 | 1864.18<br>066 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -10 | 1850.81<br>691 | 1864.18<br>291 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 0   | 1850.83<br>052 | 1864.17<br>752 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 10  | 1850.82<br>521 | 1864.18<br>021 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 20  | 1850.82<br>96  | 1864.17<br>76  | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 30  | 1850.81<br>407 | 1864.18<br>007 | 1850-19<br>10 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 40  | 1850.82<br>149 | 1864.18<br>449 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 50  | 1850.83<br>669 | 1864.18<br>369 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -30 | 1850.82<br>238 | 1864.18<br>438 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -20 | 1850.82<br>434 | 1864.19<br>934 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -10 | 1850.81<br>094 | 1864.19<br>894 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 0   | 1850.82<br>846 | 1864.19<br>646 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 10  | 1850.83<br>181 | 1864.17<br>481 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 20  | 1850.82<br>649 | 1864.18<br>849 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 30  | 1850.81<br>942 | 1864.18<br>942 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 40  | 1850.82<br>13  | 1864.18<br>03  | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 50  | 1850.82<br>868 | 1864.18<br>468 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -30 | 1873.30<br>044 | 1886.69<br>544 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -20 | 1873.30<br>457 | 1886.69<br>257 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -10 | 1873.29<br>087 | 1886.69<br>087 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 0   | 1873.30<br>449 | 1886.69<br>149 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 10  | 1873.31<br>547 | 1886.70<br>247 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 20  | 1873.30<br>025 | 1886.69<br>725 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 30  | 1873.30<br>888 | 1886.70<br>688 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 40  | 1873.29<br>762 | 1886.70<br>562 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 50  | 1873.30<br>263 | 1886.69<br>163 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -30 | 1873.31<br>108 | 1886.68<br>508 | 1850-19<br>10 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -20 | 1873.31<br>747 | 1886.68<br>447 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -10 | 1873.31<br>014 | 1886.67<br>714 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 0   | 1873.30<br>772 | 1886.69<br>072 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 10  | 1873.31<br>708 | 1886.69<br>108 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 20  | 1873.30<br>465 | 1886.69<br>365 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 30  | 1873.30<br>728 | 1886.68<br>728 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 40  | 1873.30<br>546 | 1886.68<br>846 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 50  | 1873.29<br>596 | 1886.67<br>896 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -30 | 1895.80<br>073 | 1909.17<br>173 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -20 | 1895.80<br>758 | 1909.18<br>458 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -10 | 1895.80<br>043 | 1909.16<br>743 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 0   | 1895.79<br>871 | 1909.18<br>271 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 10  | 1895.80<br>308 | 1909.17<br>508 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 20  | 1895.80<br>098 | 1909.18<br>398 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 30  | 1895.80<br>133 | 1909.16<br>633 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 40  | 1895.79<br>544 | 1909.17<br>144 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 50  | 1895.80<br>748 | 1909.17<br>948 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -30 | 1895.81<br>54  | 1909.18<br>24  | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -20 | 1895.79<br>396 | 1909.17<br>396 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -10 | 1895.81<br>757 | 1909.18<br>357 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | 0   | 1895.80<br>704 | 1909.18<br>604 | 1850-19<br>10 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0      | NV | 10  | 1895.80<br>037 | 1909.18<br>637 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0      | NV | 20  | 1895.80<br>584 | 1909.18<br>784 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0      | NV | 30  | 1895.82<br>115 | 1909.18<br>615 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0      | NV | 40  | 1895.79<br>522 | 1909.18<br>122 | 1850-19<br>10 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0      | NV | 50  | 1895.81<br>518 | 1909.17<br>518 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | -30 | 1851.12<br>39  | 1868.91<br>89  | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | -20 | 1851.09<br>632 | 1868.92<br>432 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | -10 | 1851.11<br>969 | 1868.91<br>969 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 0   | 1851.12<br>828 | 1868.92<br>628 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 10  | 1851.11<br>495 | 1868.92<br>195 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 20  | 1851.11<br>784 | 1868.92<br>384 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 30  | 1851.11<br>418 | 1868.93<br>218 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 40  | 1851.12<br>162 | 1868.93<br>662 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#<br>0 | NV | 50  | 1851.11<br>451 | 1868.92<br>451 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | -30 | 1851.11<br>622 | 1868.92<br>522 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | -20 | 1851.09<br>413 | 1868.92<br>613 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | -10 | 1851.09<br>154 | 1868.93<br>254 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 0   | 1851.09<br>327 | 1868.92<br>127 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 10  | 1851.09<br>316 | 1868.92<br>016 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 20  | 1851.08<br>468 | 1868.91<br>868 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 30  | 1851.08<br>126 | 1868.92<br>826 | 1850-19<br>10 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 40  | 1851.09<br>72  | 1868.92<br>12  | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#<br>0 | NV | 50  | 1851.09<br>075 | 1868.93<br>075 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | -30 | 1871.08<br>061 | 1888.90<br>461 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | -20 | 1871.06<br>684 | 1888.88<br>884 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | -10 | 1871.07<br>519 | 1888.89<br>719 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 0   | 1871.10<br>454 | 1888.89<br>454 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 10  | 1871.07<br>157 | 1888.90<br>657 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 20  | 1871.09<br>972 | 1888.90<br>372 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 30  | 1871.08<br>343 | 1888.91<br>143 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 40  | 1871.05<br>951 | 1888.91<br>251 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#<br>0 | NV | 50  | 1871.09<br>323 | 1888.90<br>023 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | -30 | 1871.09<br>338 | 1888.89<br>938 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | -20 | 1871.08<br>426 | 1888.92<br>826 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | -10 | 1871.07<br>698 | 1888.93<br>998 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 0   | 1871.08<br>166 | 1888.90<br>166 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 10  | 1871.09<br>69  | 1888.92<br>59  | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 20  | 1871.10<br>079 | 1888.93<br>479 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 30  | 1871.09<br>523 | 1888.94<br>223 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 40  | 1871.09<br>629 | 1888.92<br>929 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#<br>0 | NV | 50  | 1871.09<br>392 | 1888.94<br>492 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | -30 | 1891.07<br>057 | 1908.89<br>557 | 1850-19<br>10 | PASS |


**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | -20 | 1891.06<br>093 | 1908.89<br>093 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | -10 | 1891.07<br>882 | 1908.89<br>582 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 0   | 1891.06<br>394 | 1908.88<br>494 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 10  | 1891.08<br>143 | 1908.88<br>343 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 20  | 1891.07<br>437 | 1908.89<br>637 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 30  | 1891.07<br>089 | 1908.88<br>889 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 40  | 1891.07<br>539 | 1908.89<br>539 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#<br>0 | NV | 50  | 1891.06<br>058 | 1908.88<br>658 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | -30 | 1891.10<br>036 | 1908.88<br>936 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | -20 | 1891.09<br>186 | 1908.91<br>386 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | -10 | 1891.10<br>165 | 1908.89<br>865 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 0   | 1891.08<br>664 | 1908.91<br>564 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 10  | 1891.11<br>102 | 1908.89<br>402 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 20  | 1891.10<br>505 | 1908.89<br>005 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 30  | 1891.10<br>333 | 1908.89<br>733 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 40  | 1891.08<br>655 | 1908.90<br>955 | 1850-19<br>10 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#<br>0 | NV | 50  | 1891.10<br>081 | 1908.89<br>081 | 1850-19<br>10 | PASS |


## Test Graphs

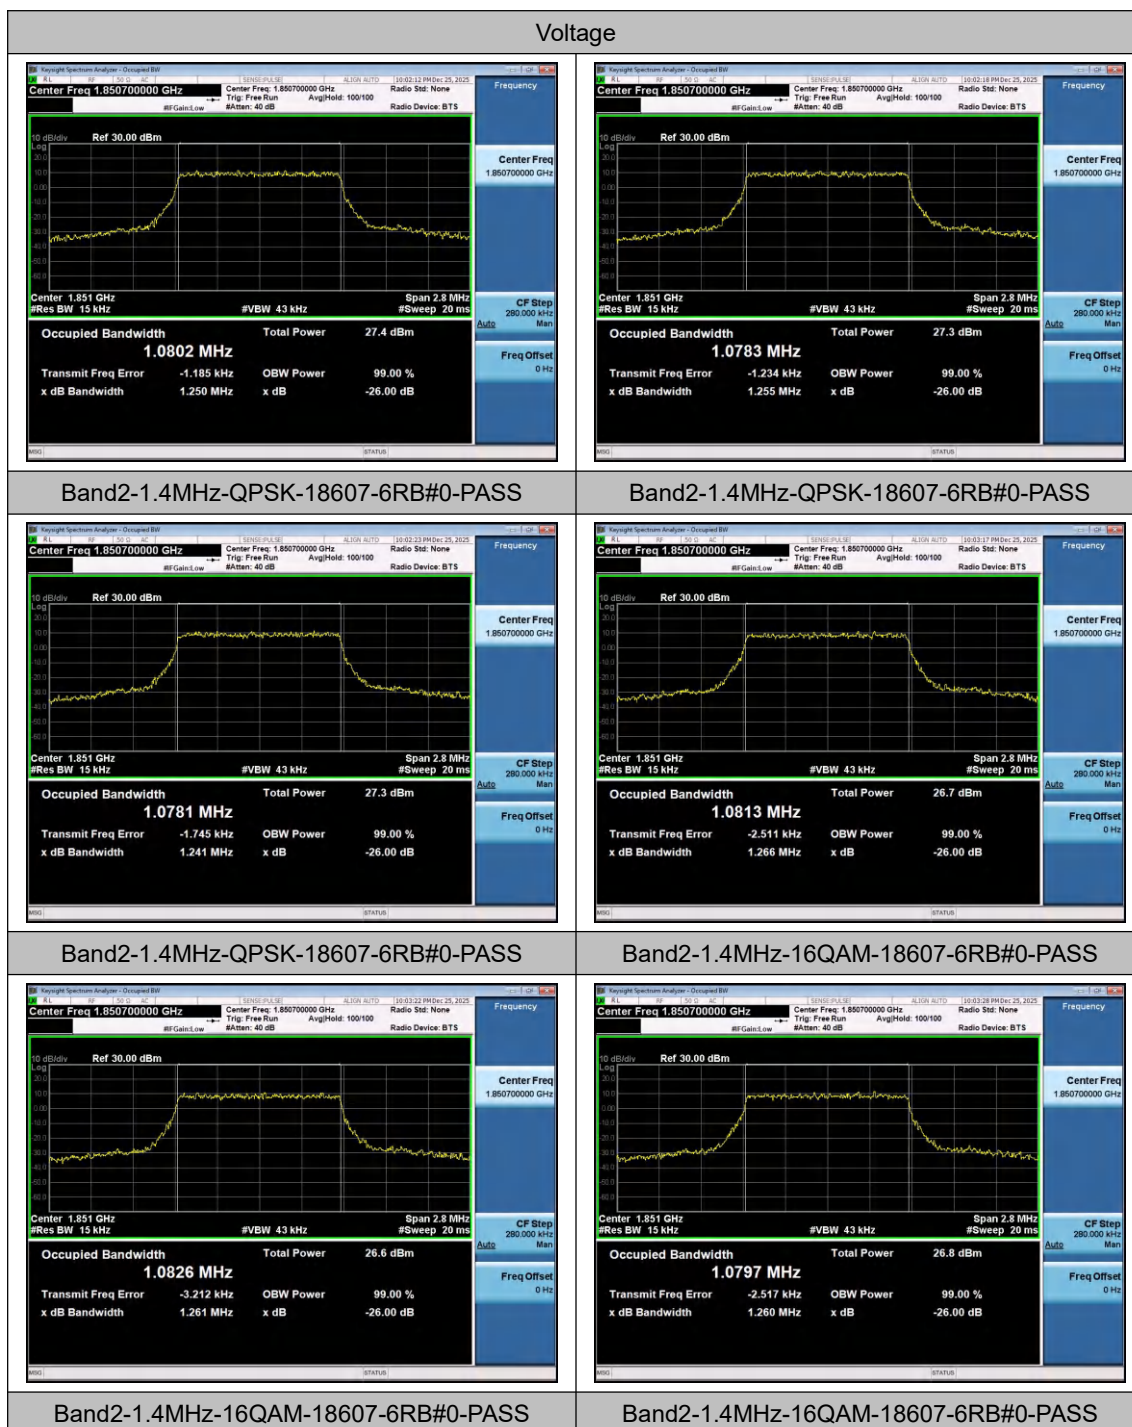

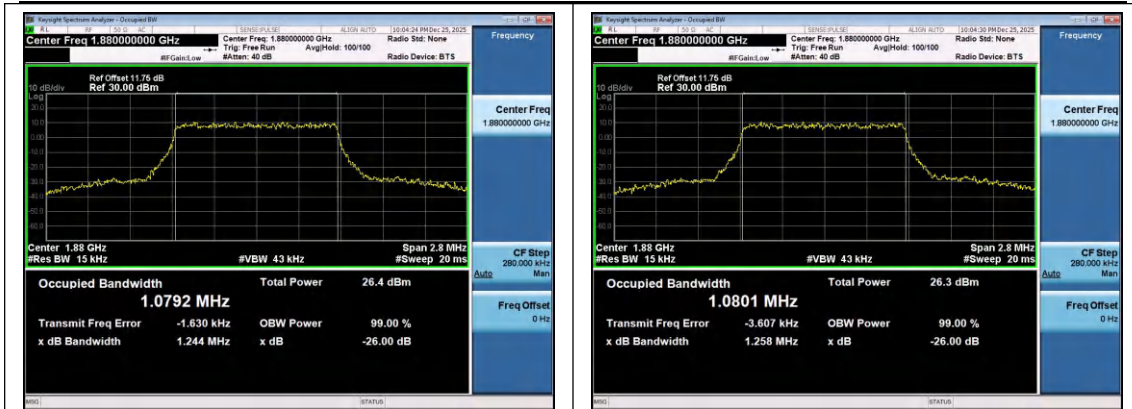


Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

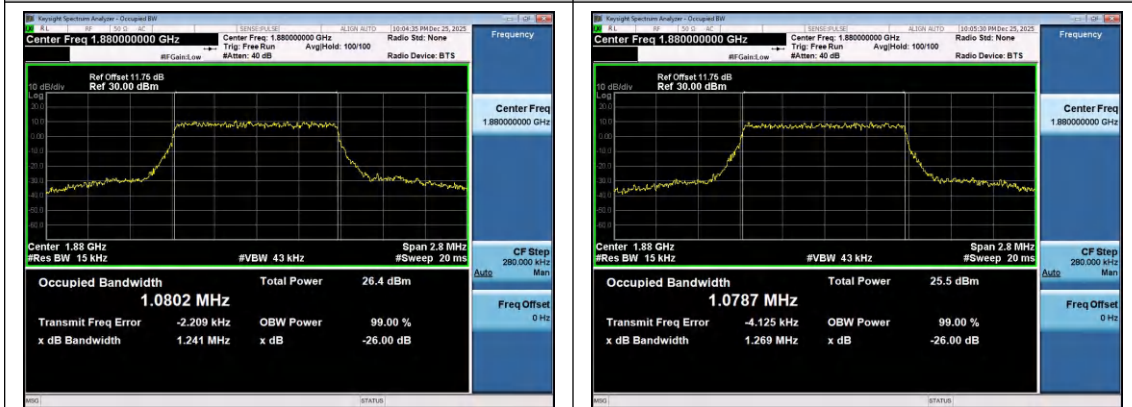


Band2-1.4MHz-QPSK-18900-6RB#0-PASS

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

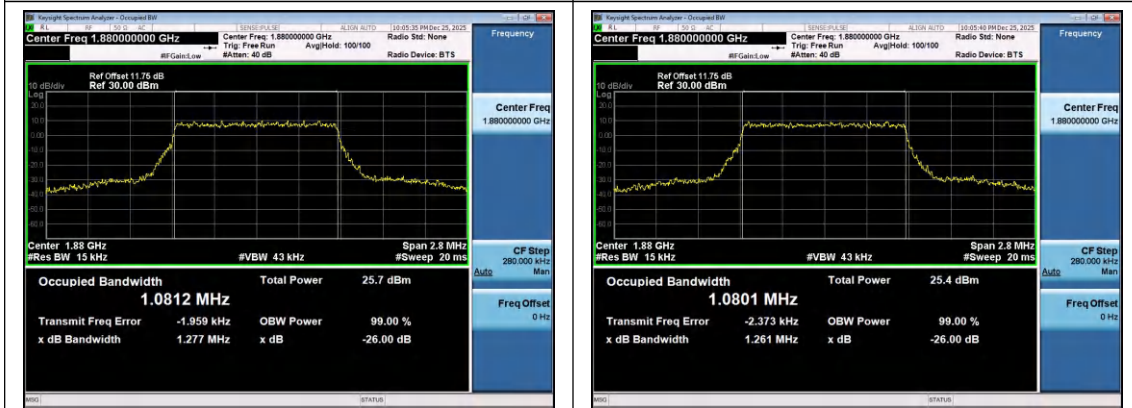


Band2-1.4MHz-16QAM-18900-6RB#0-PASS


Band2-1.4MHz-16QAM-18900-6RB#0-PASS

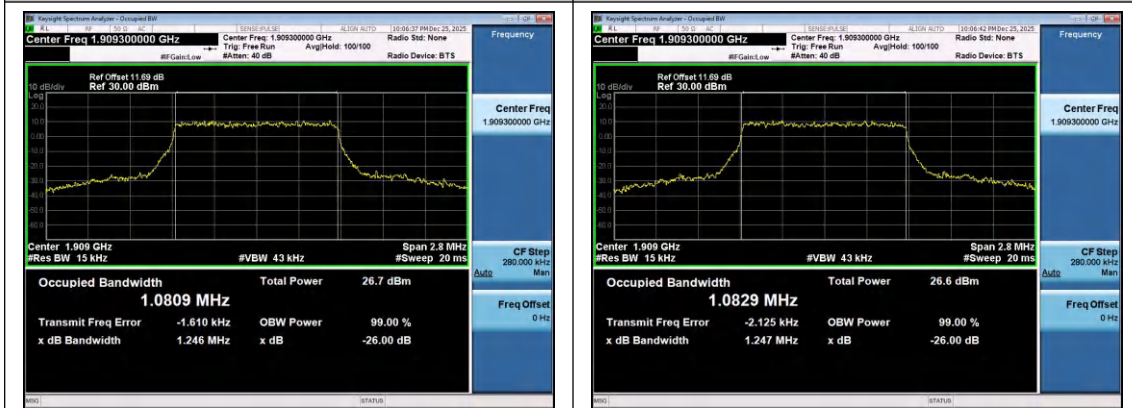



Band2-1.4MHz-QPSK-19193-6RB#0-PASS


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

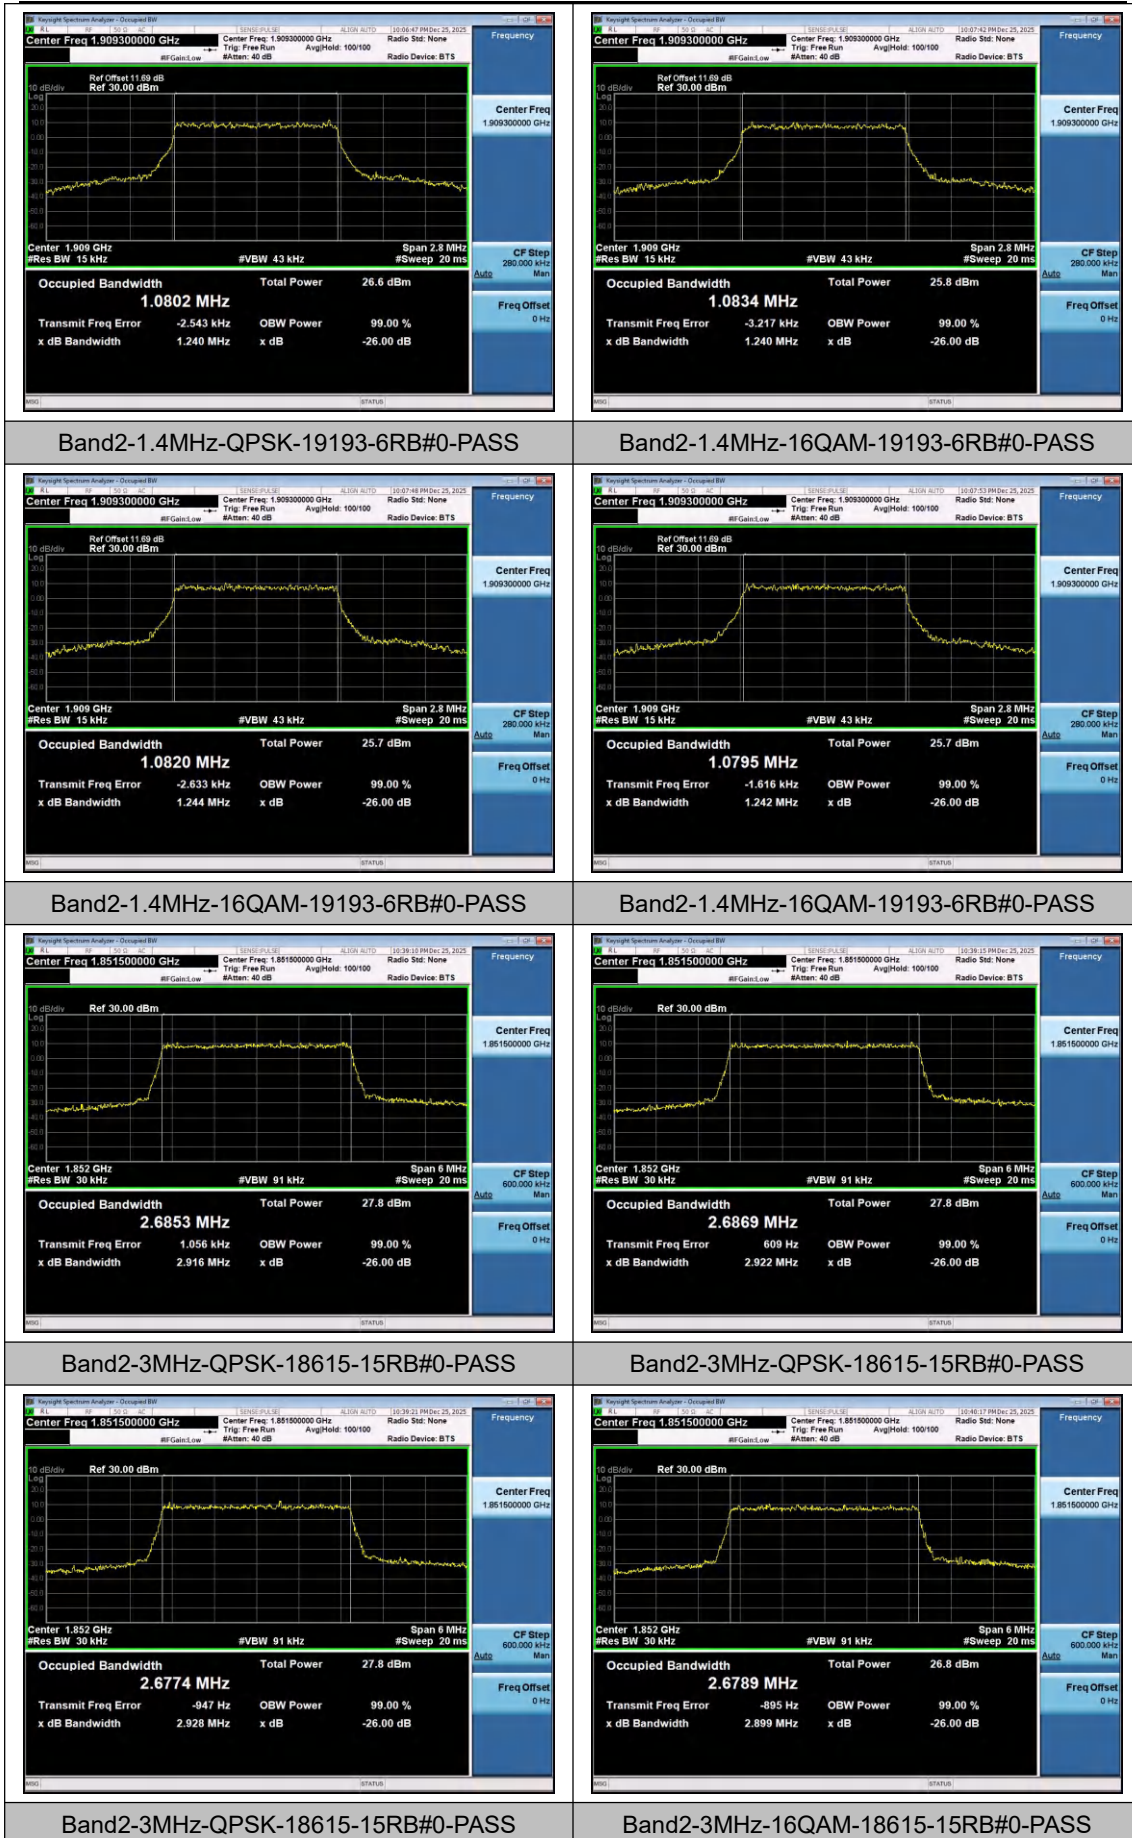


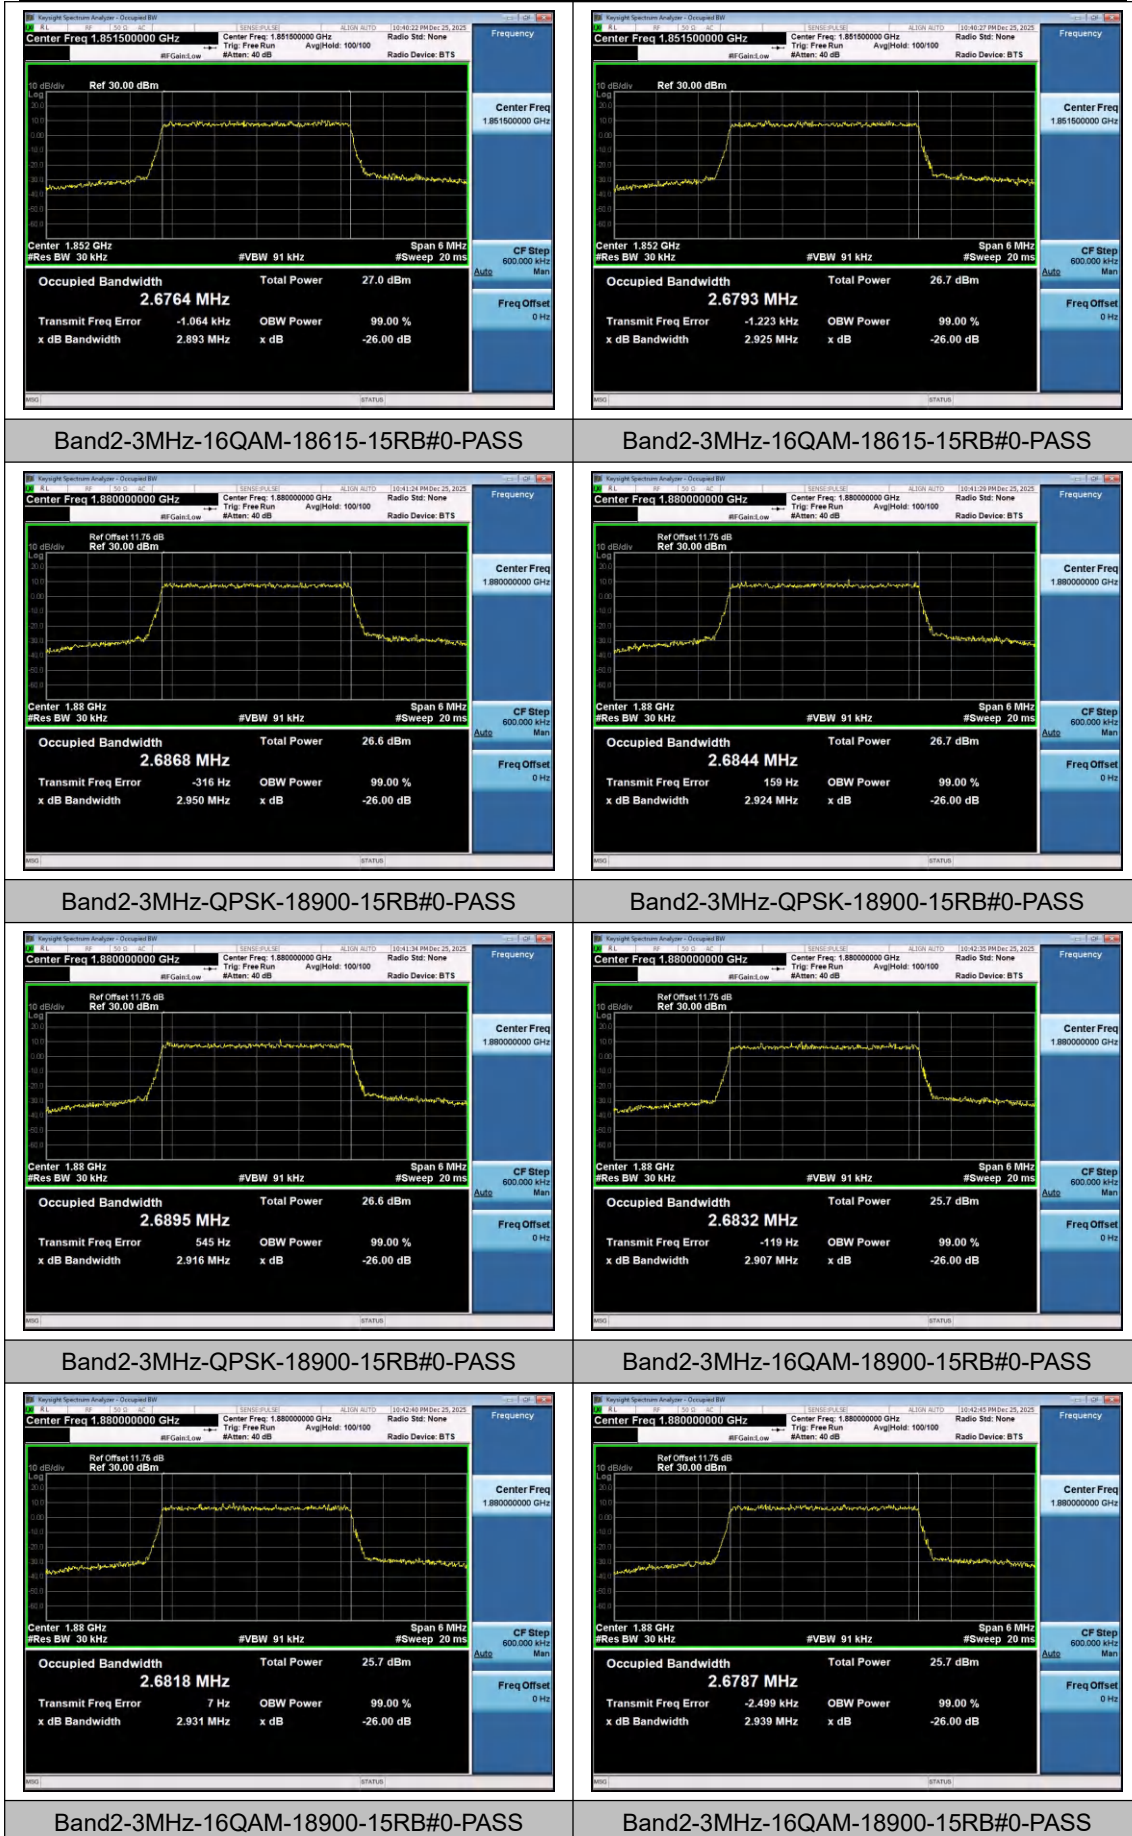


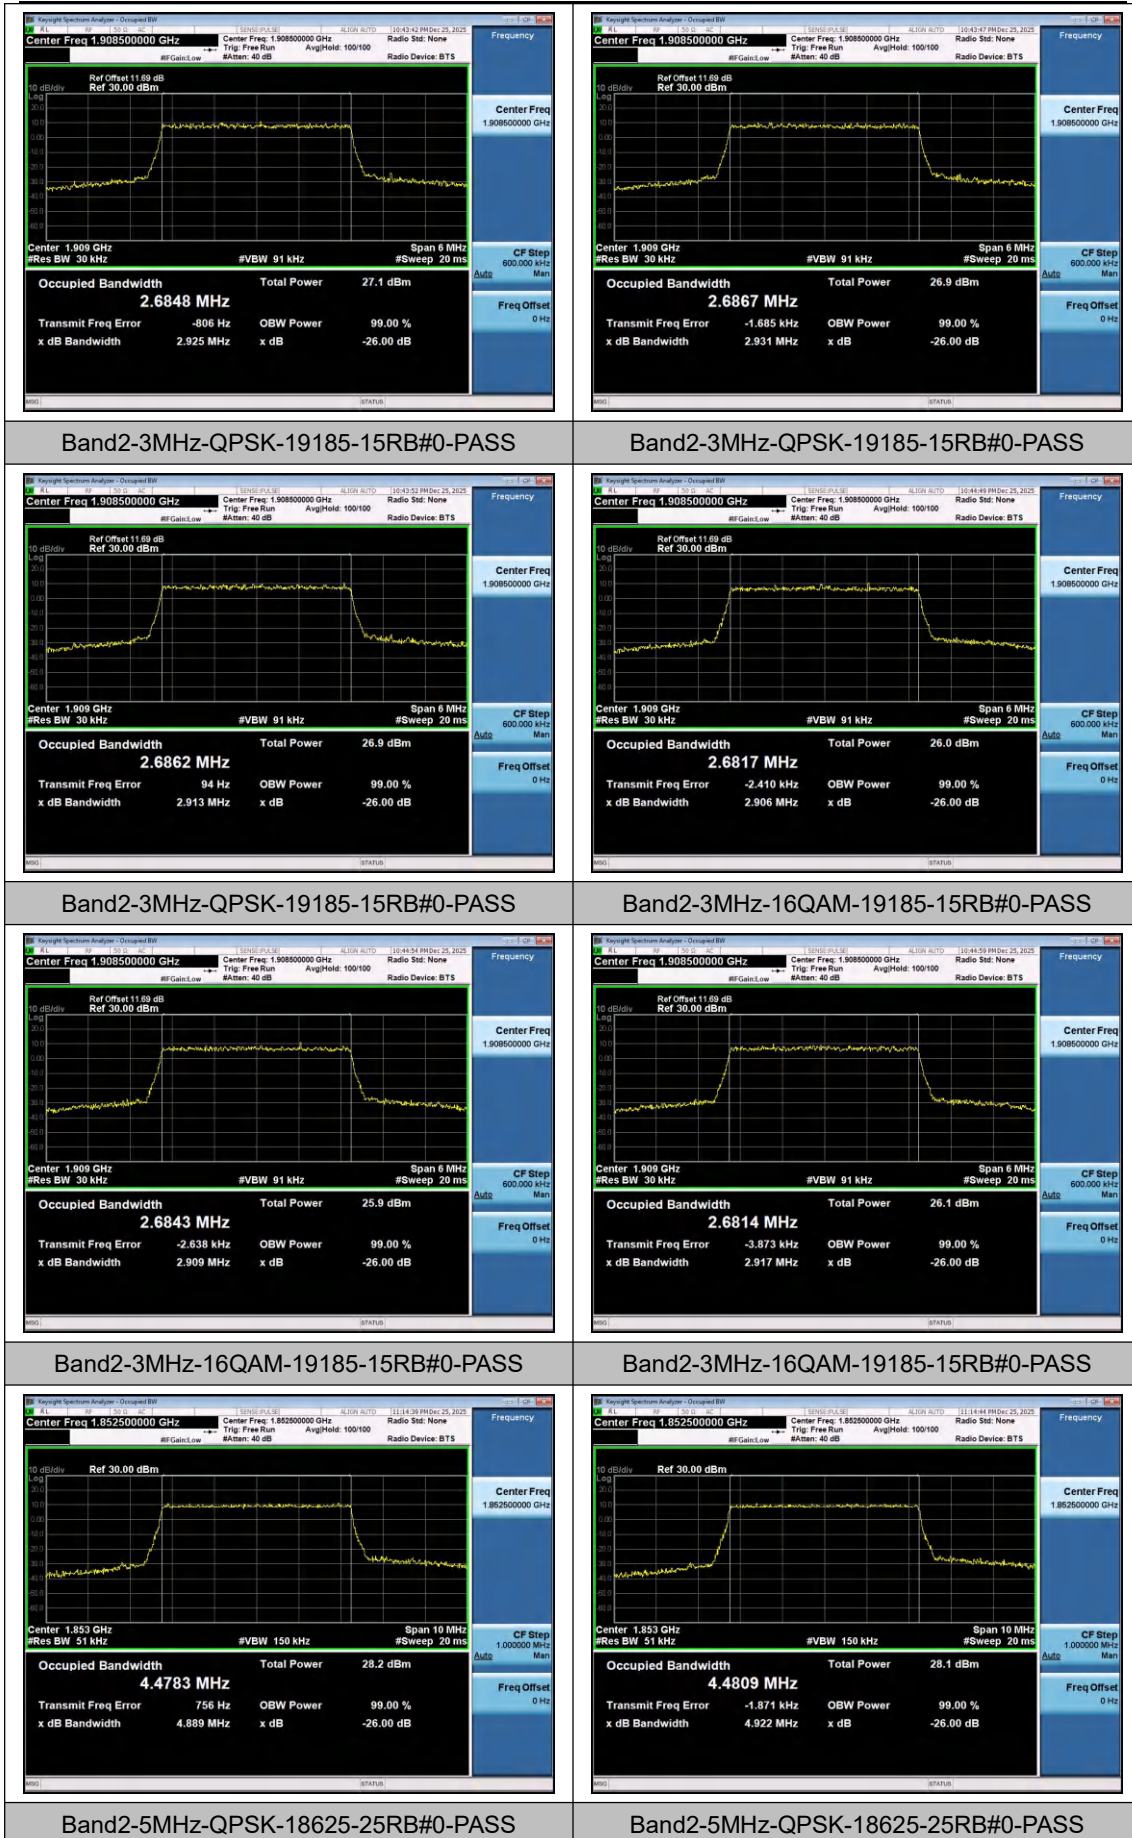


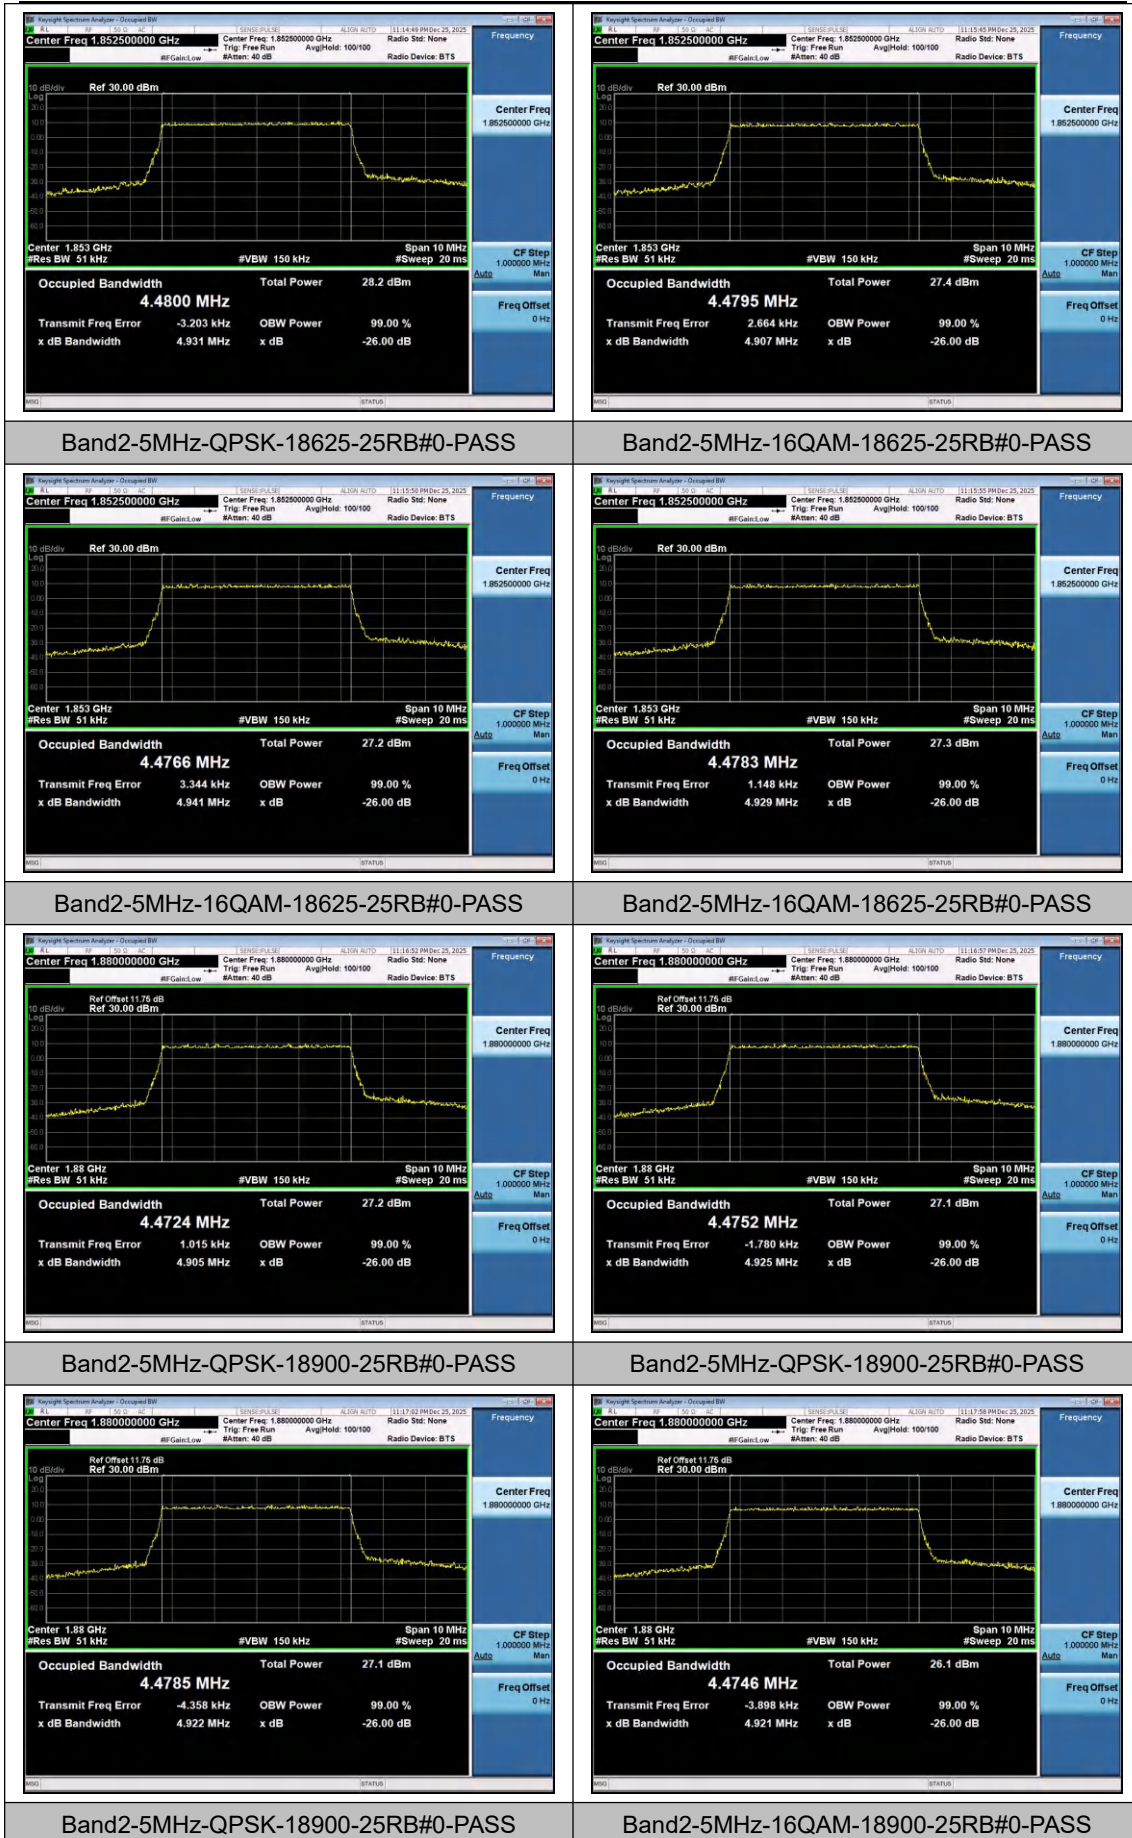

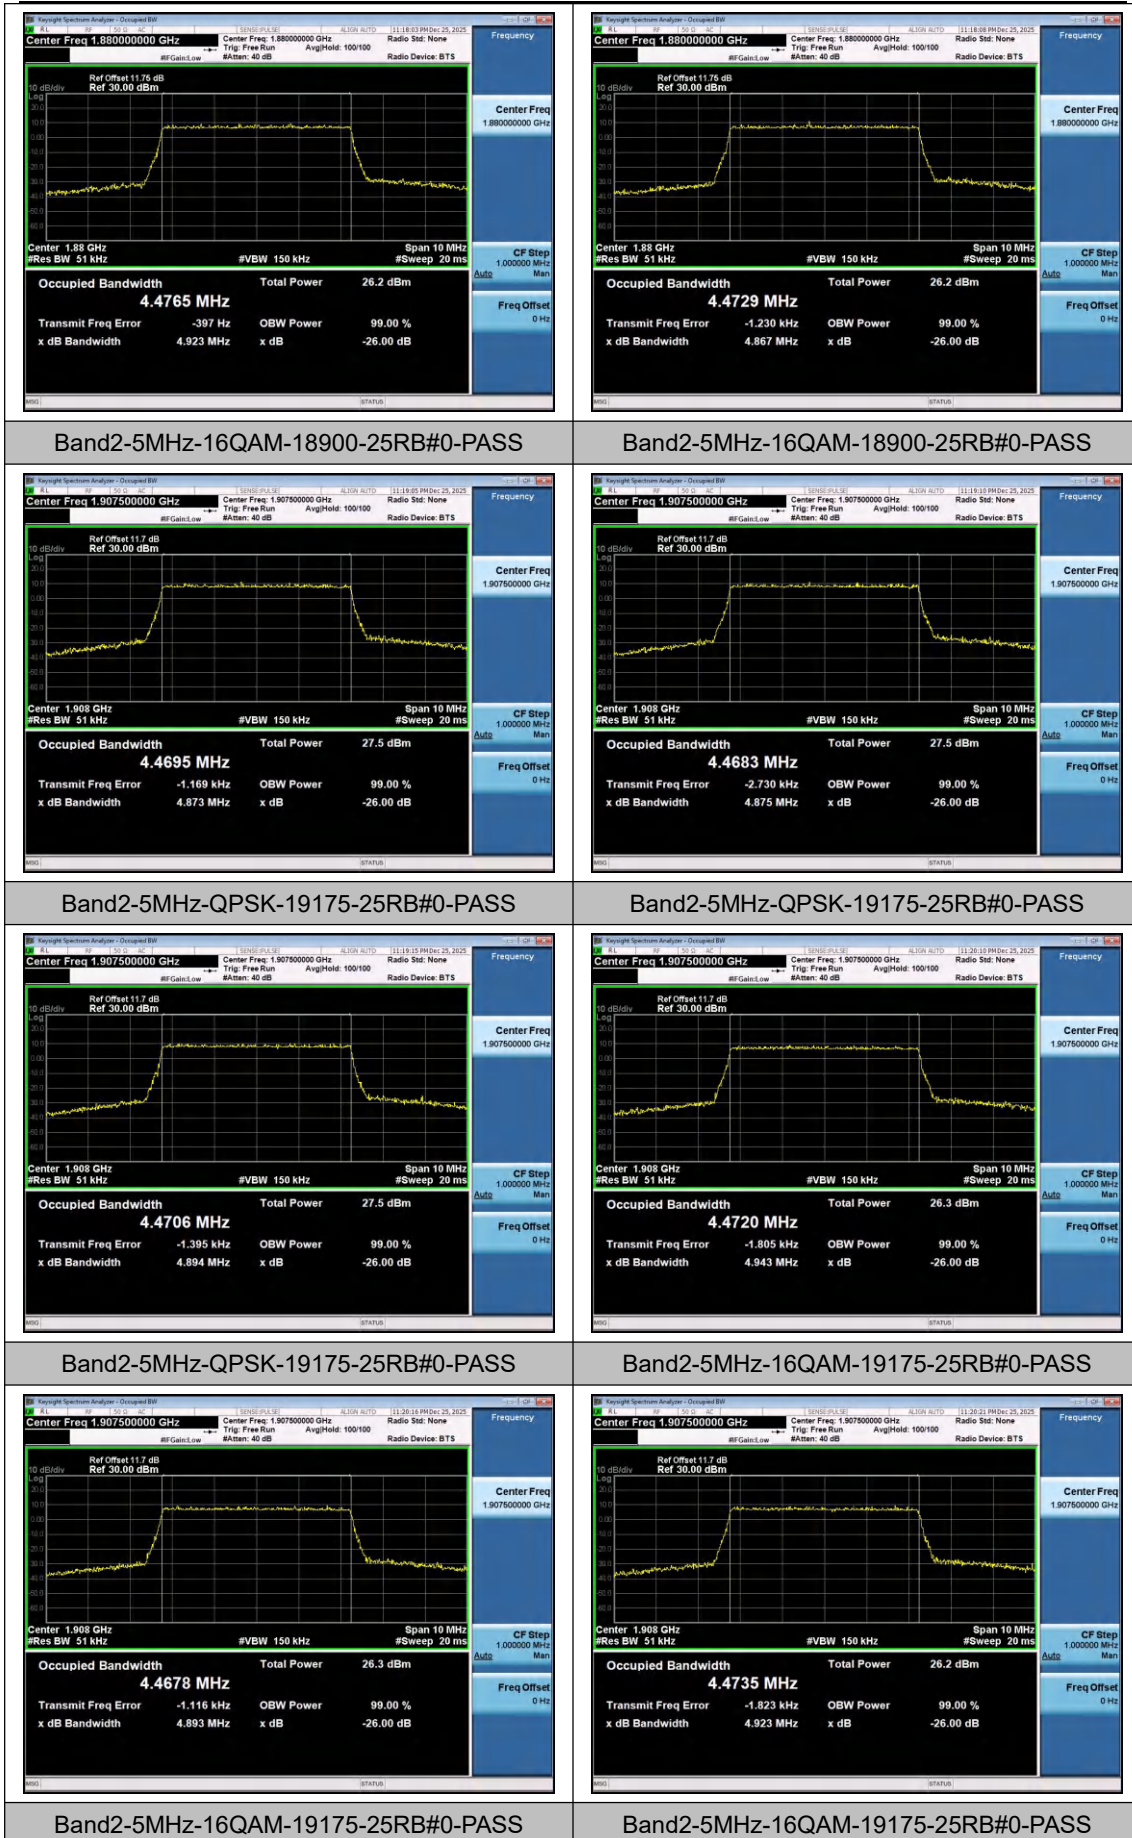


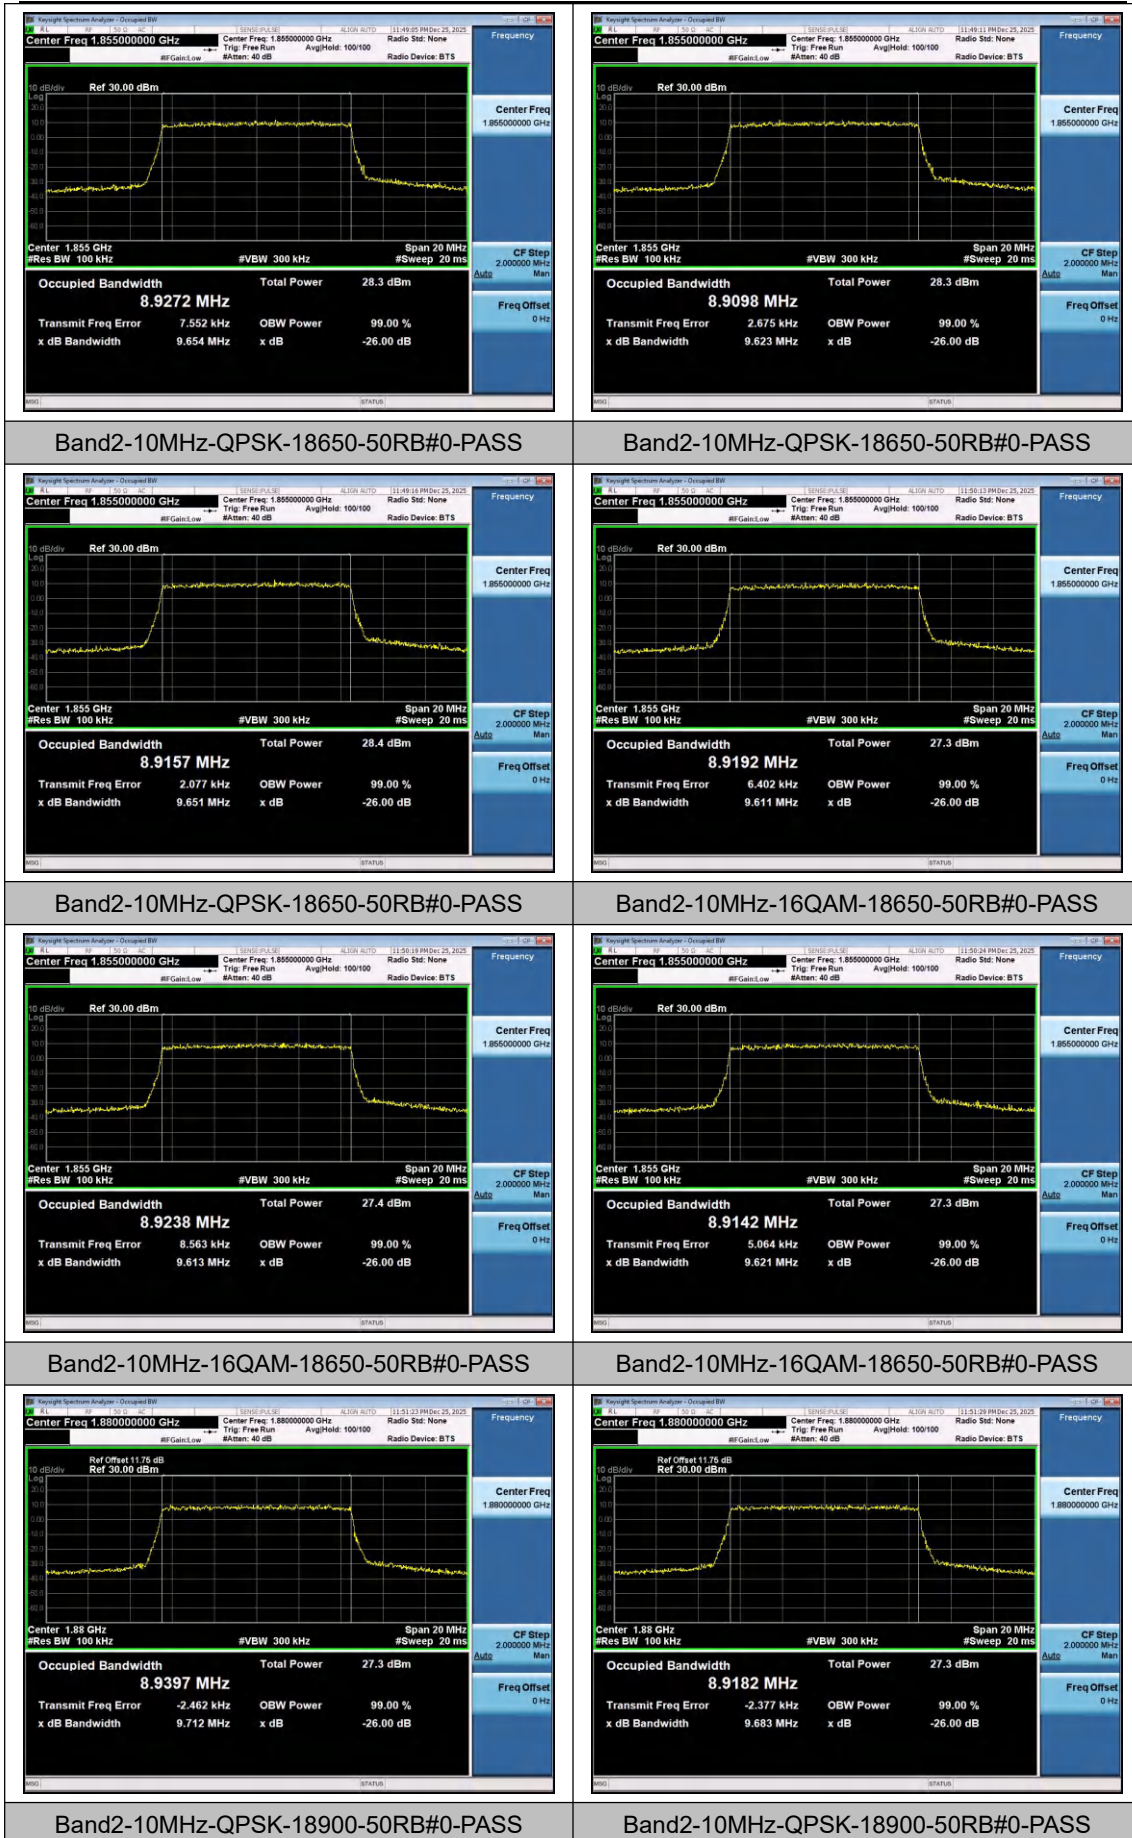


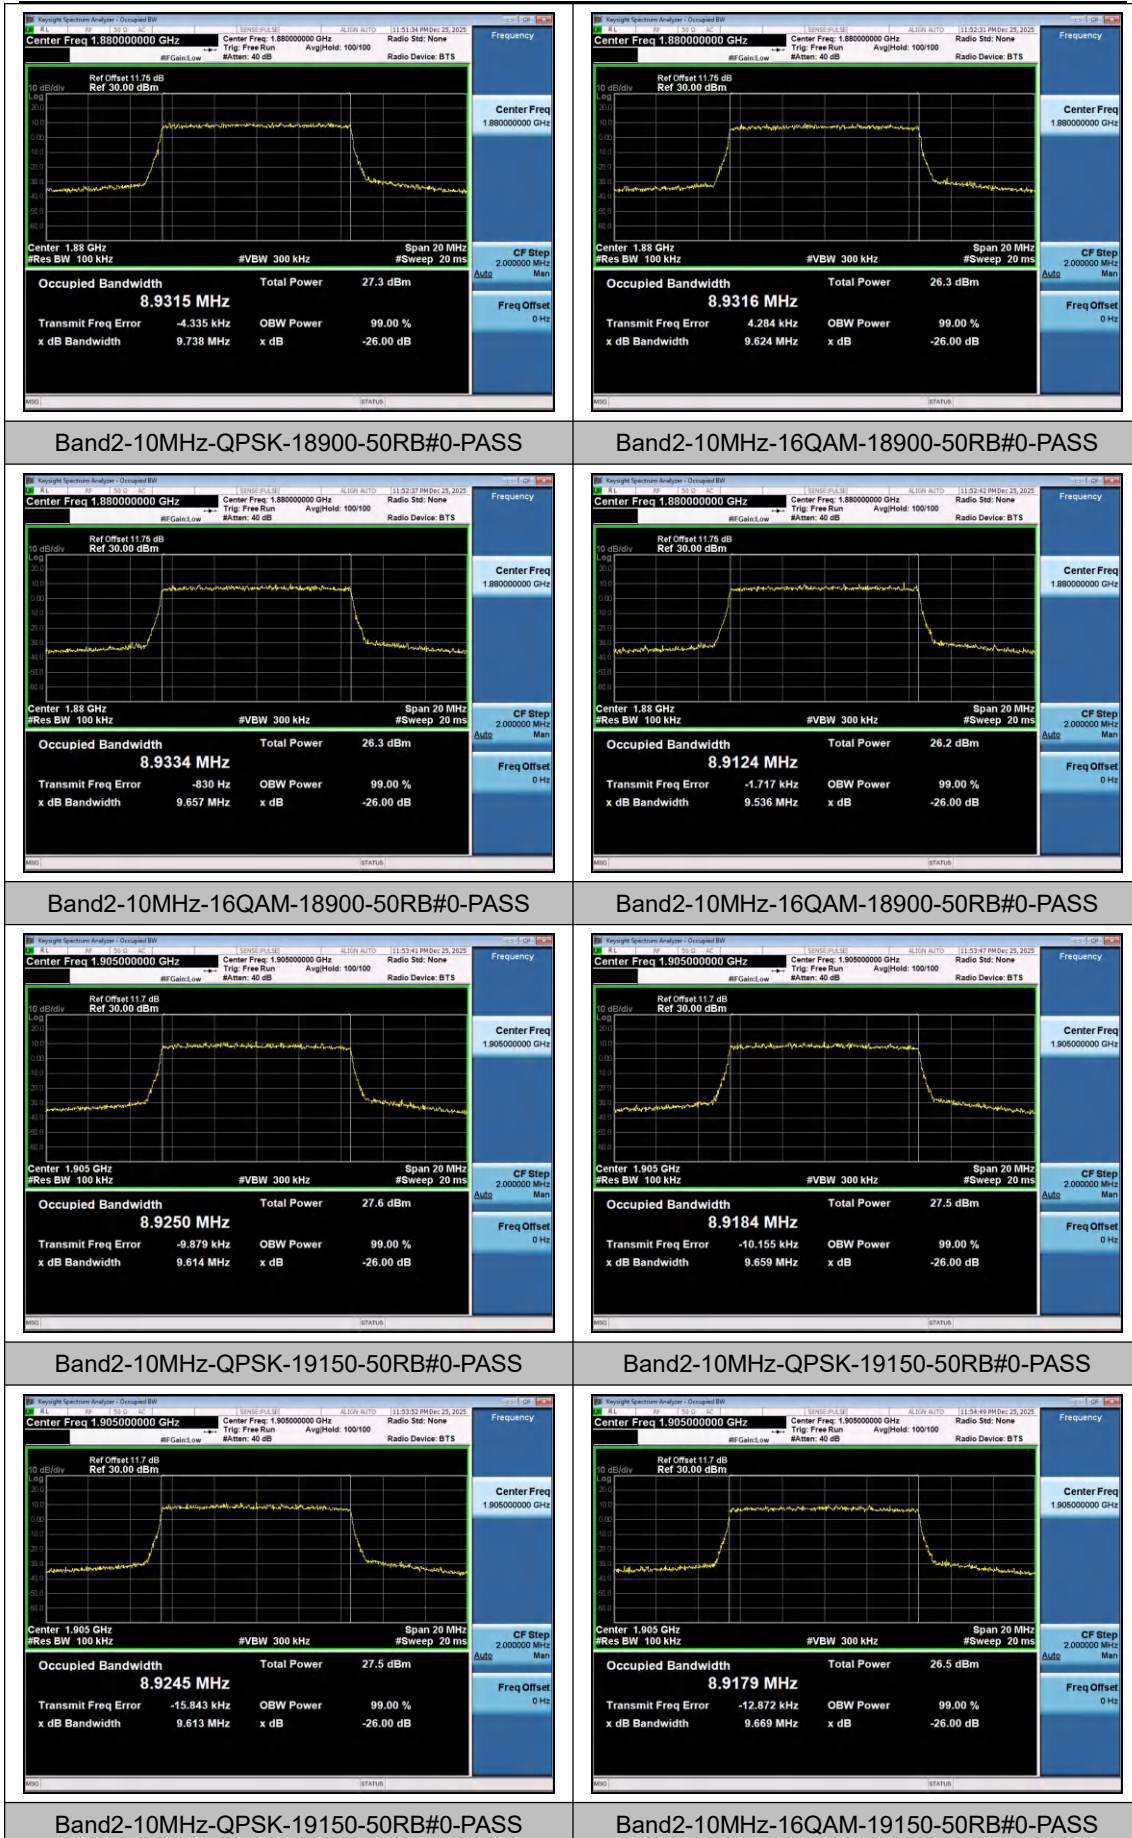


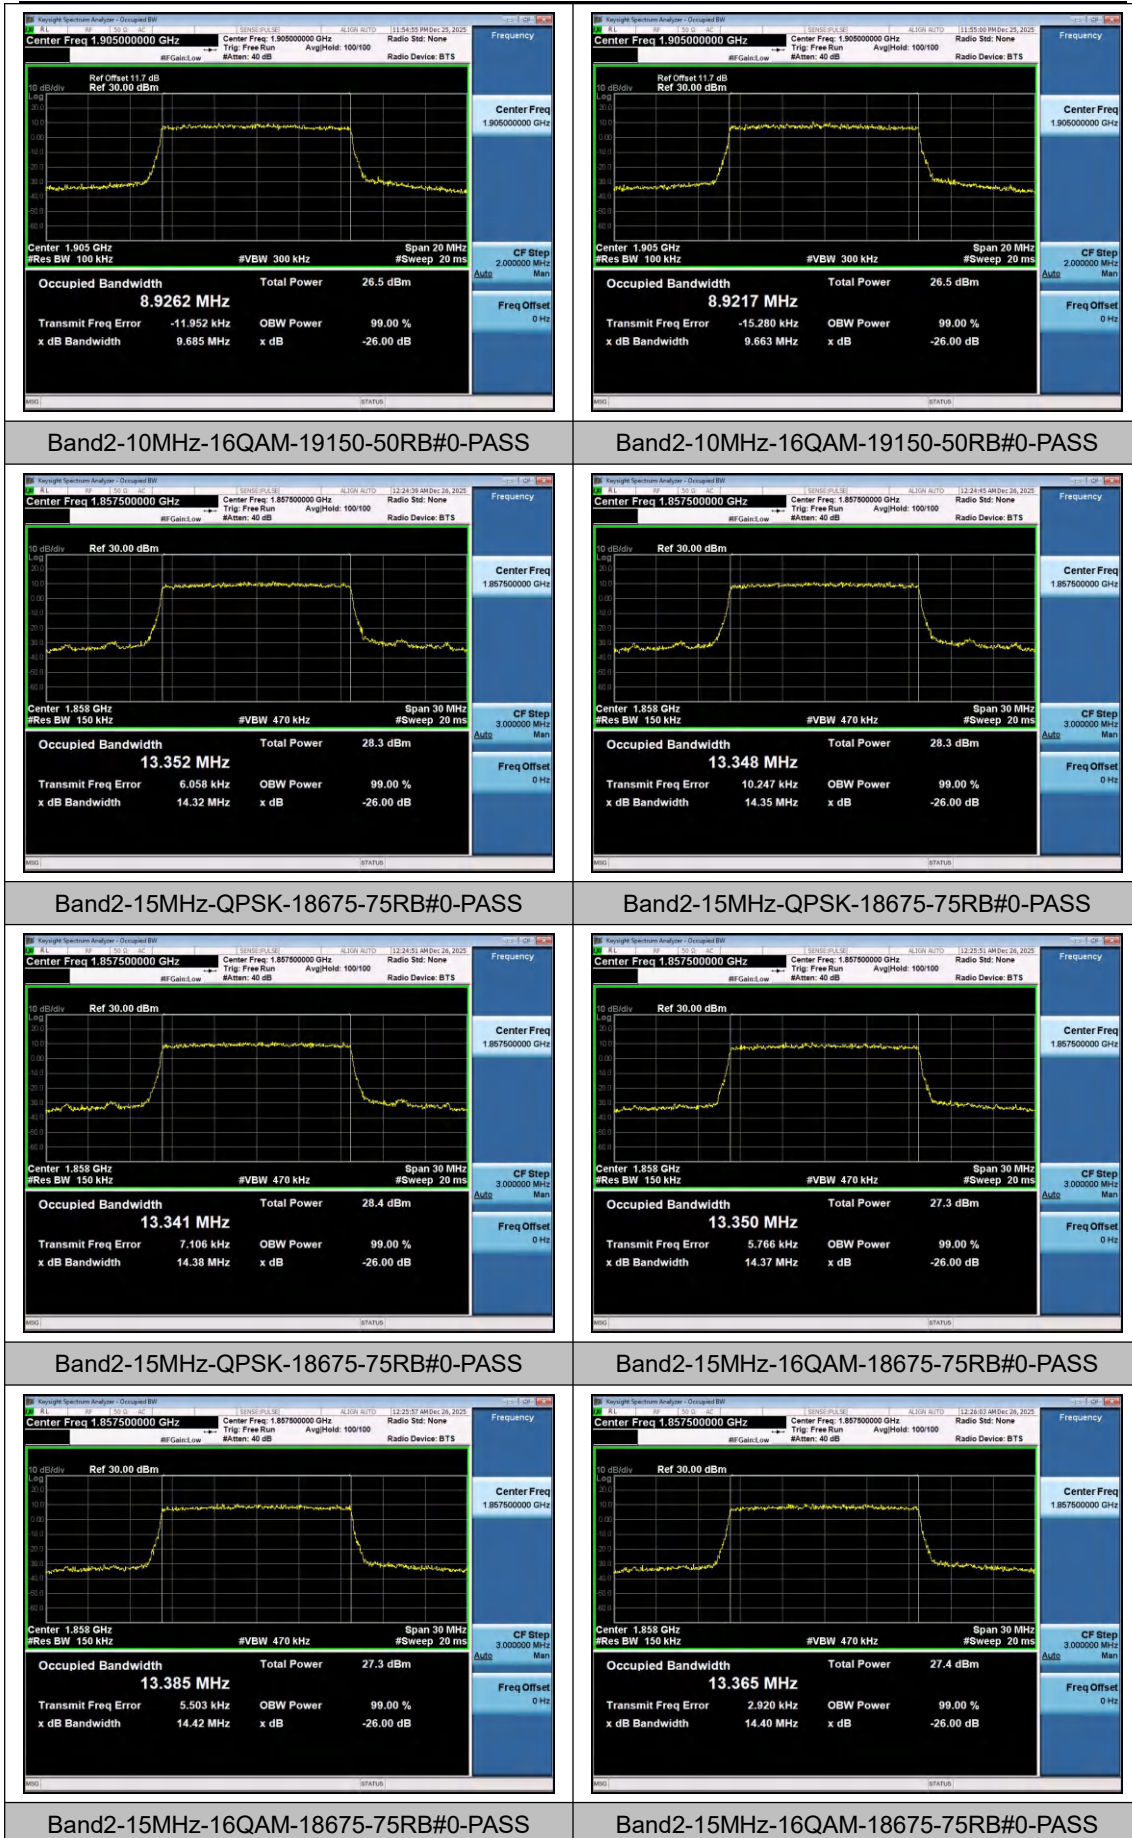





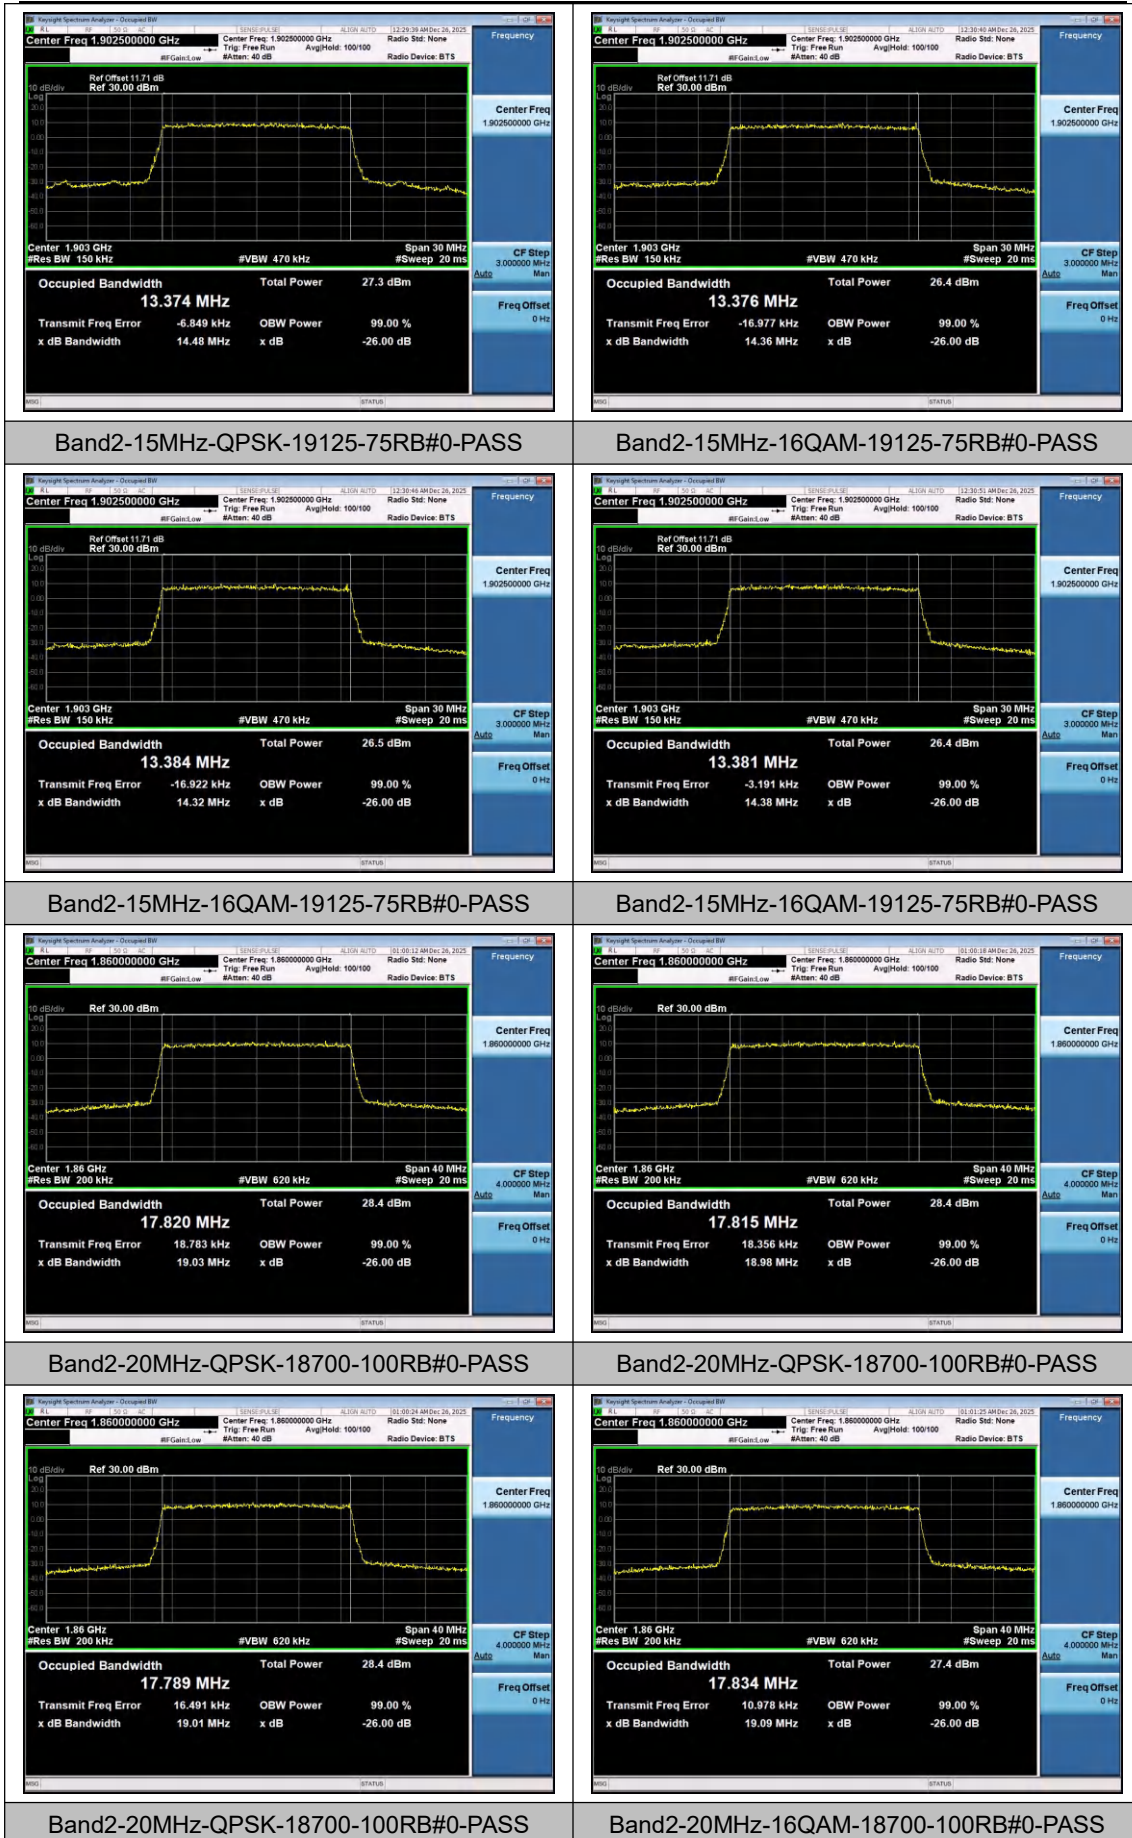

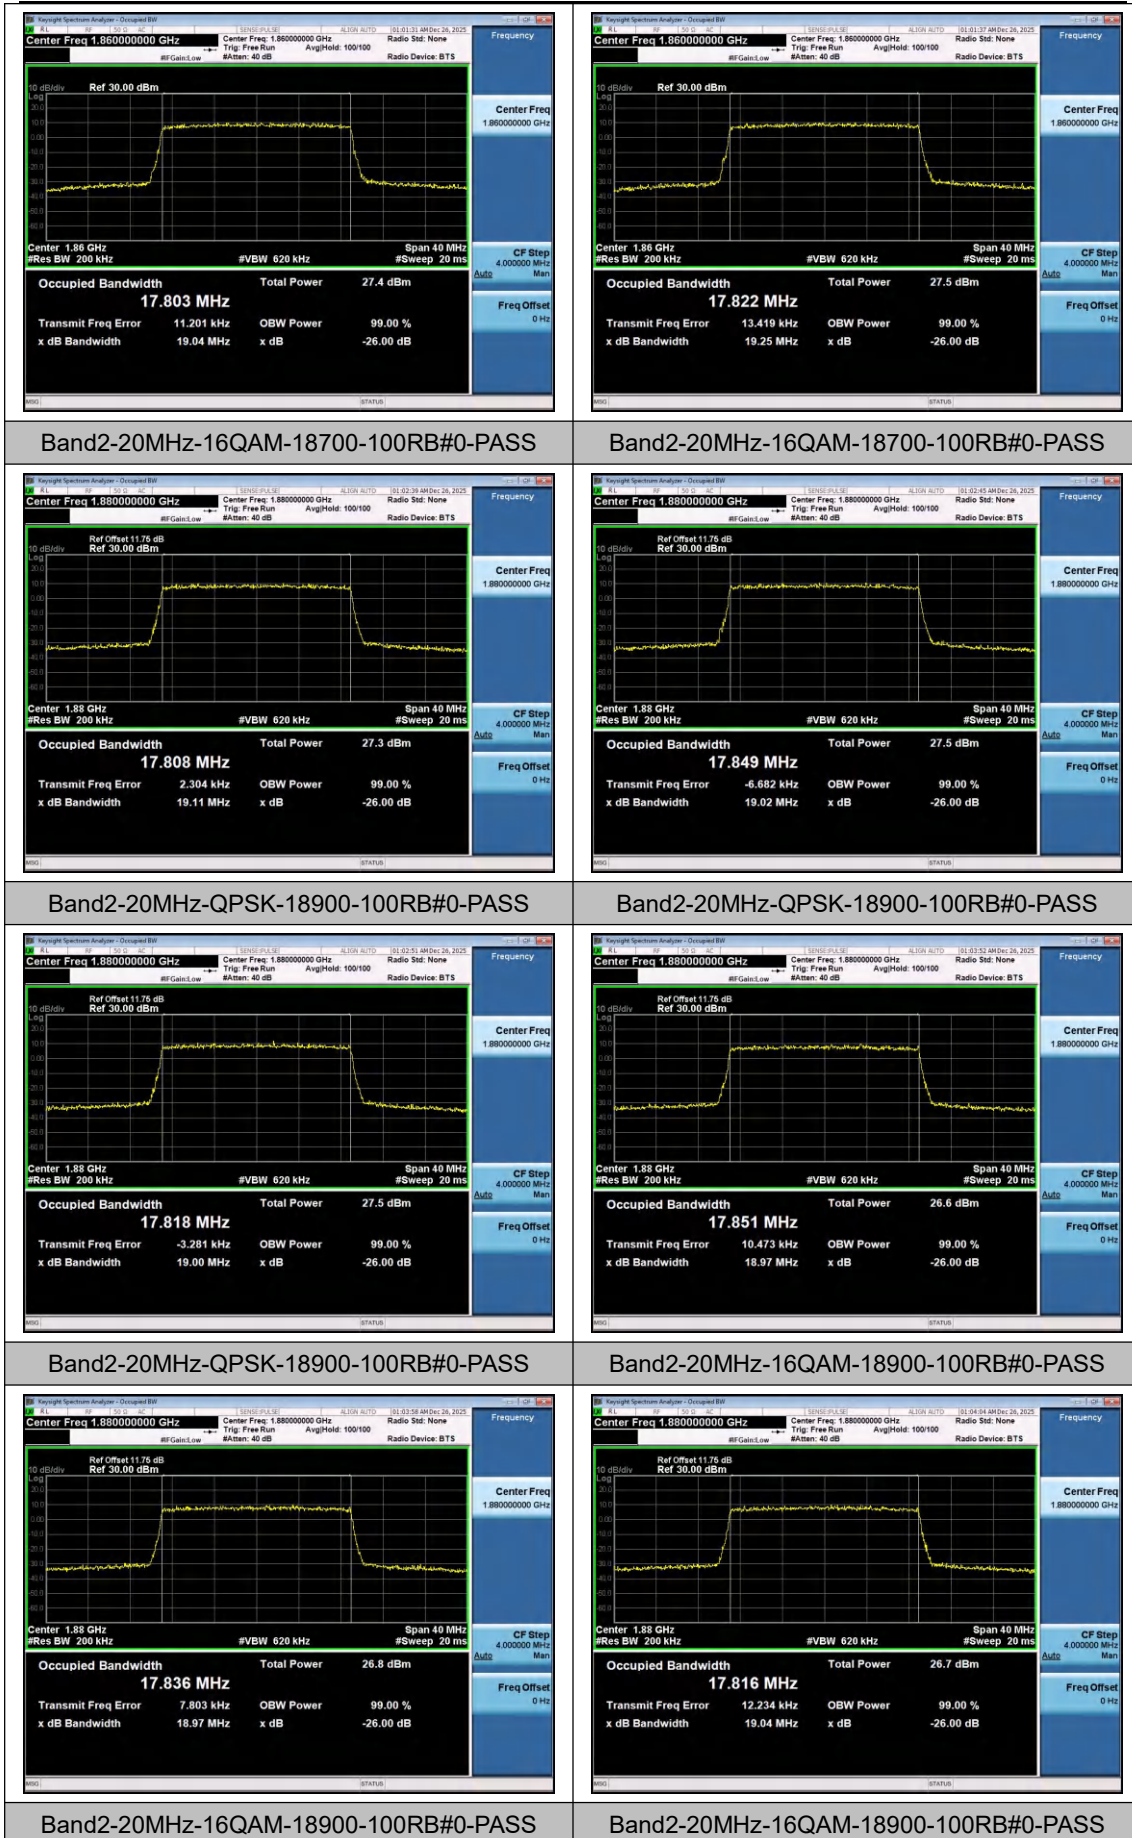

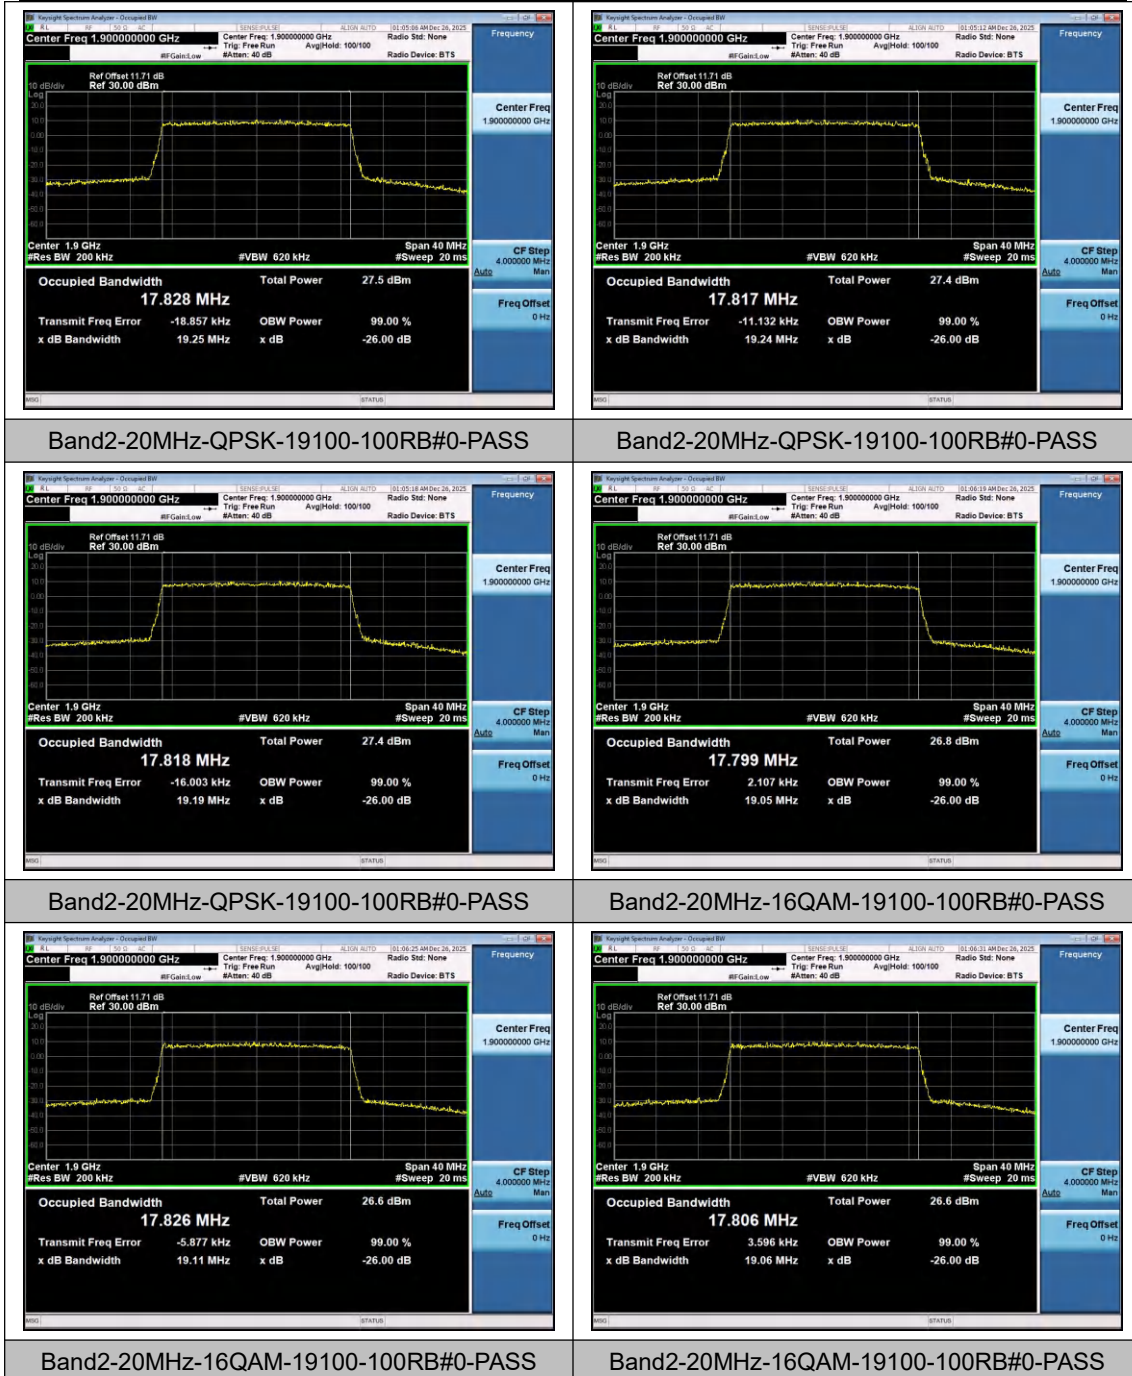


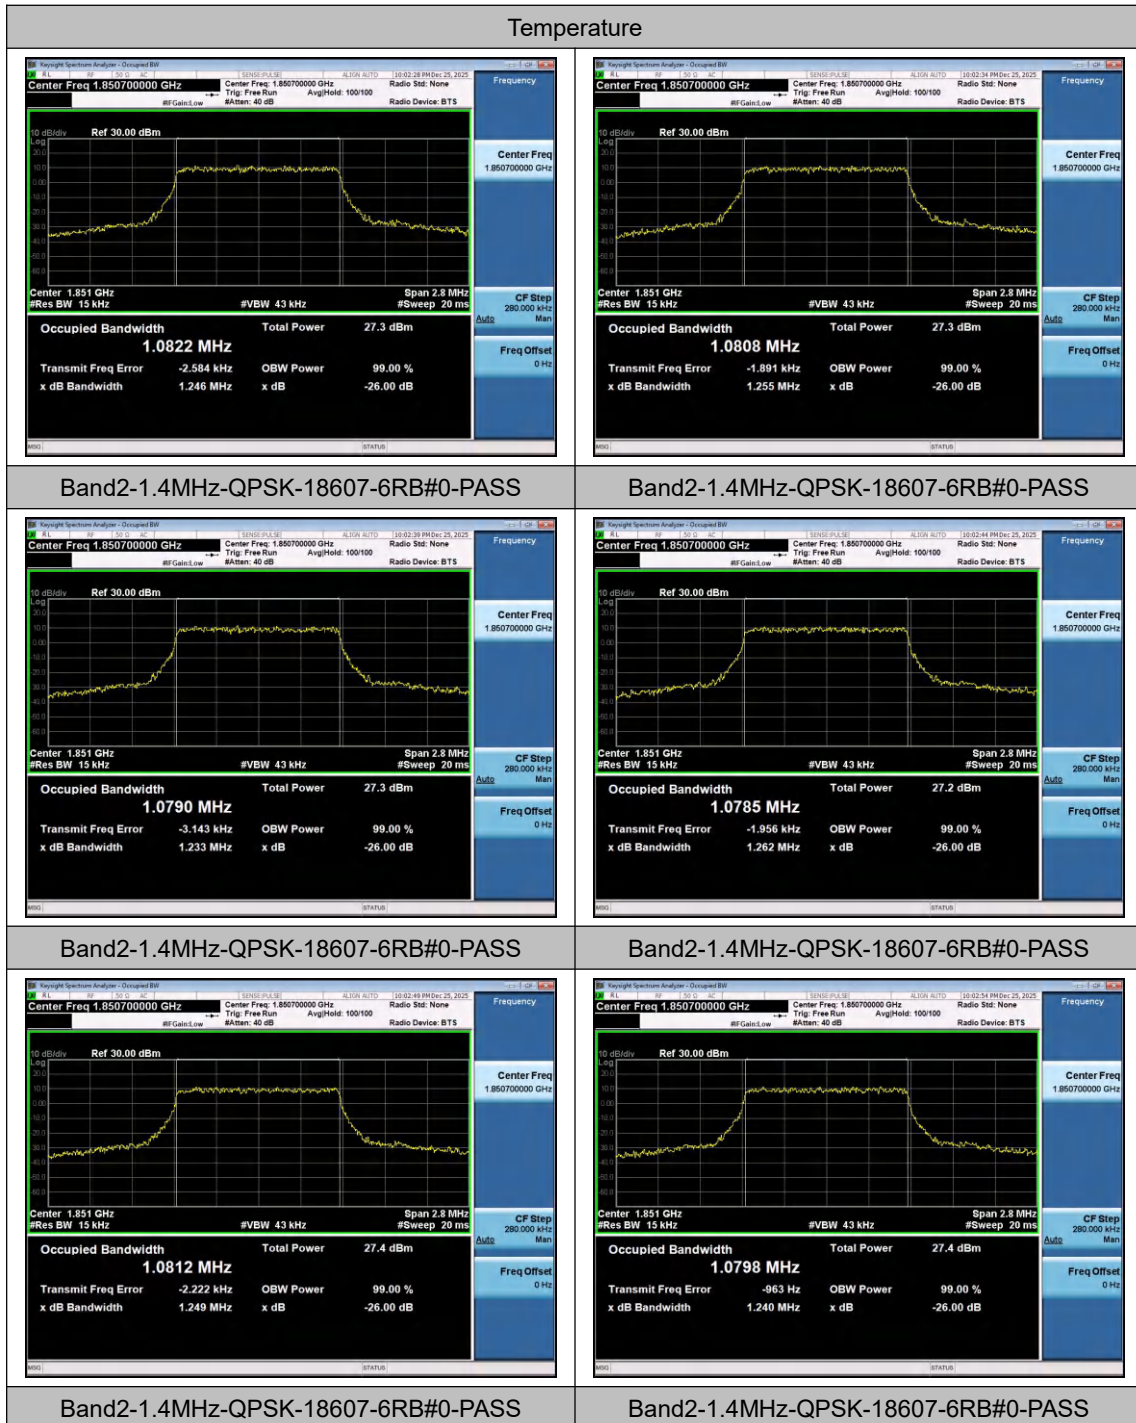

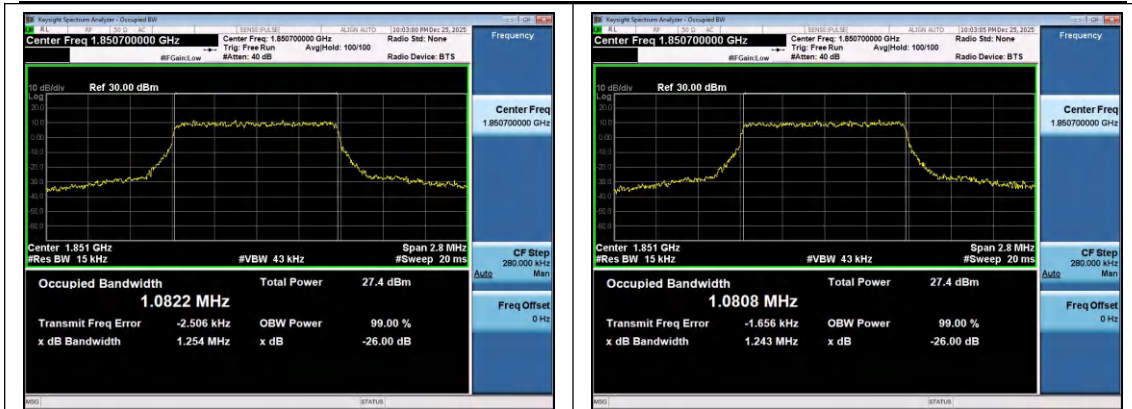


Band2-1.4MHz-QPSK-18607-6RB#0-PASS

Band2-1.4MHz-QPSK-18607-6RB#0-PASS

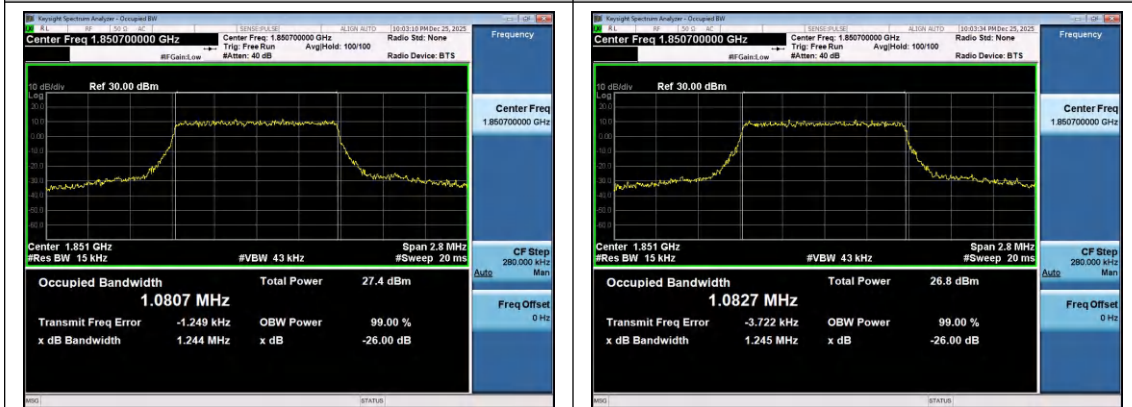


Band2-1.4MHz-QPSK-18607-6RB#0-PASS

Band2-1.4MHz-16QAM-18607-6RB#0-PASS

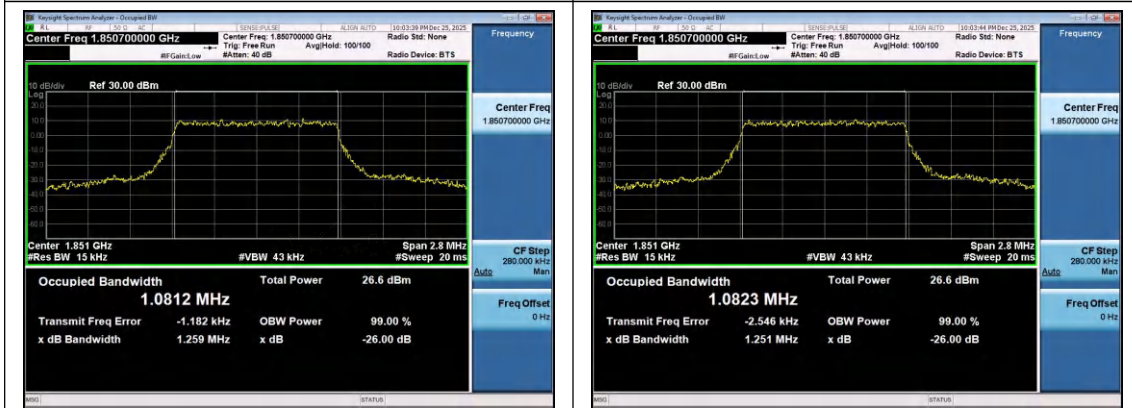


Band2-1.4MHz-16QAM-18607-6RB#0-PASS


Band2-1.4MHz-16QAM-18607-6RB#0-PASS

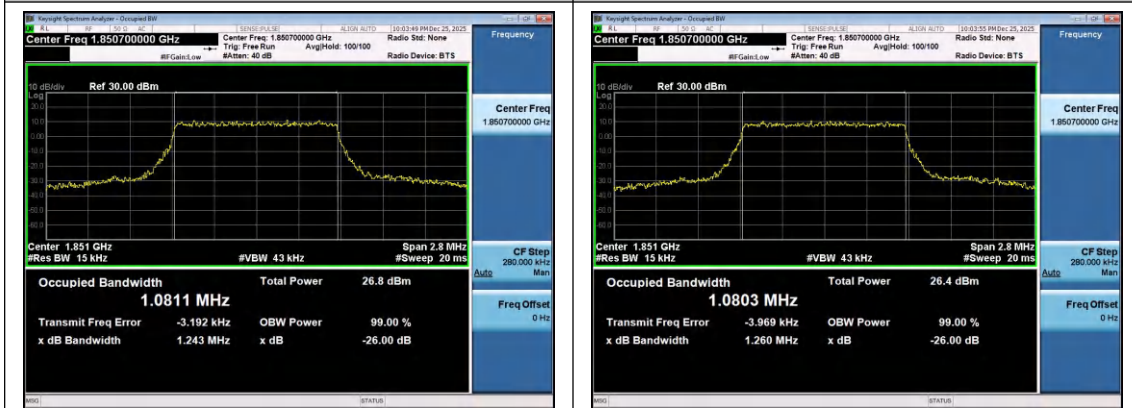



Band2-1.4MHz-16QAM-18607-6RB#0-PASS


Band2-1.4MHz-16QAM-18607-6RB#0-PASS

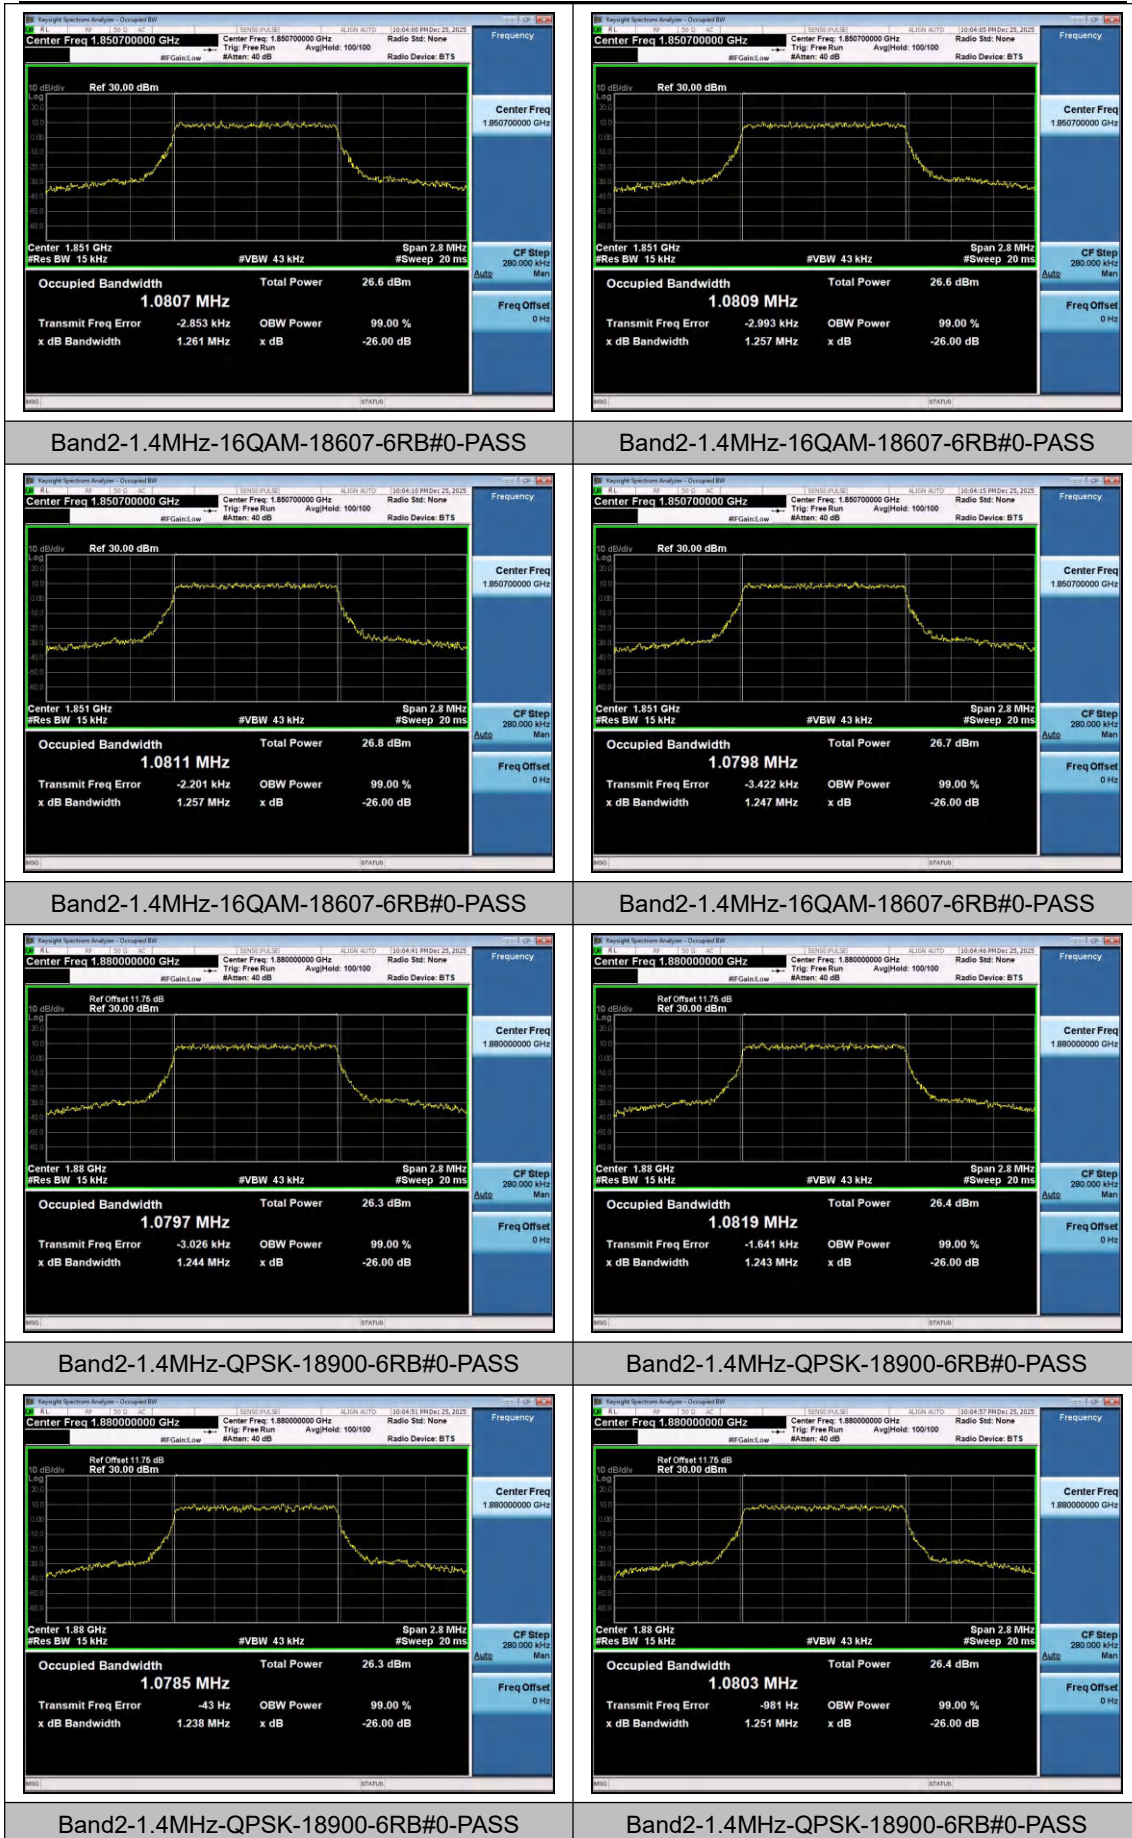


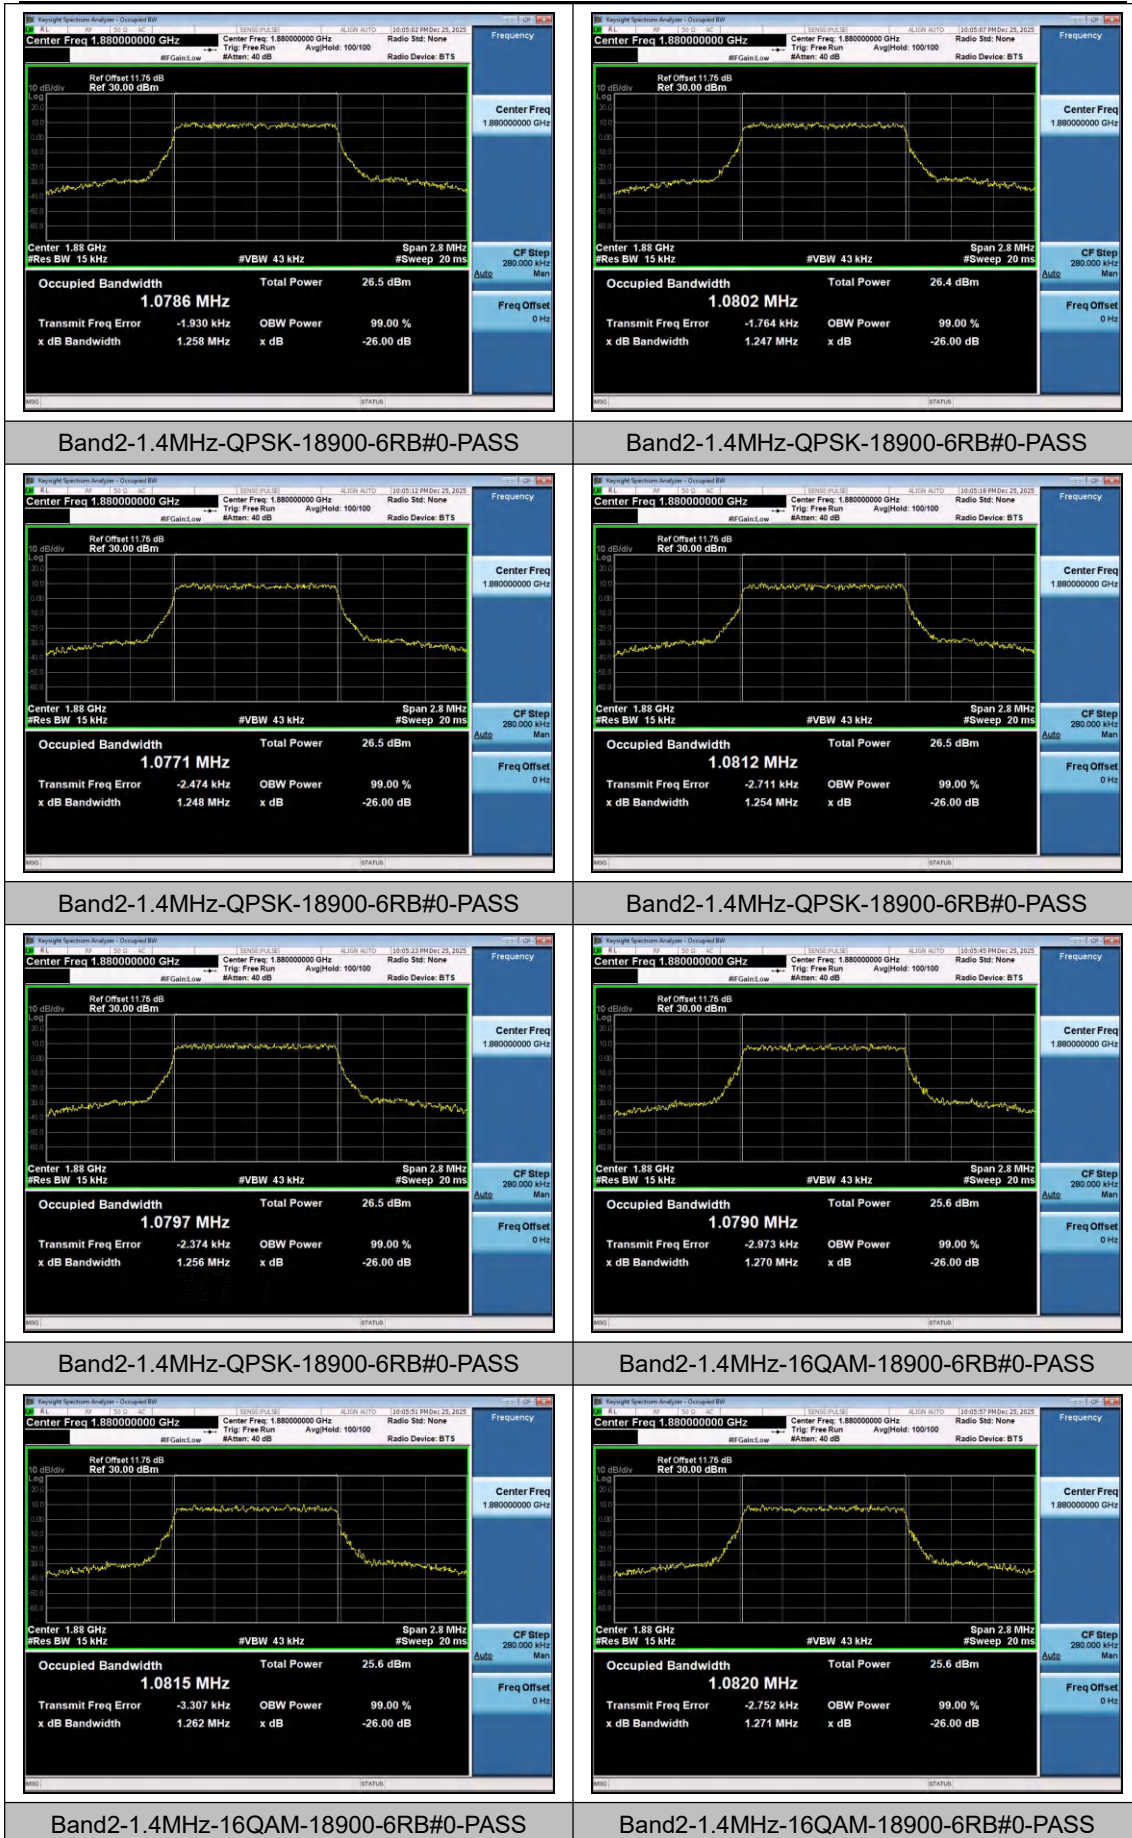


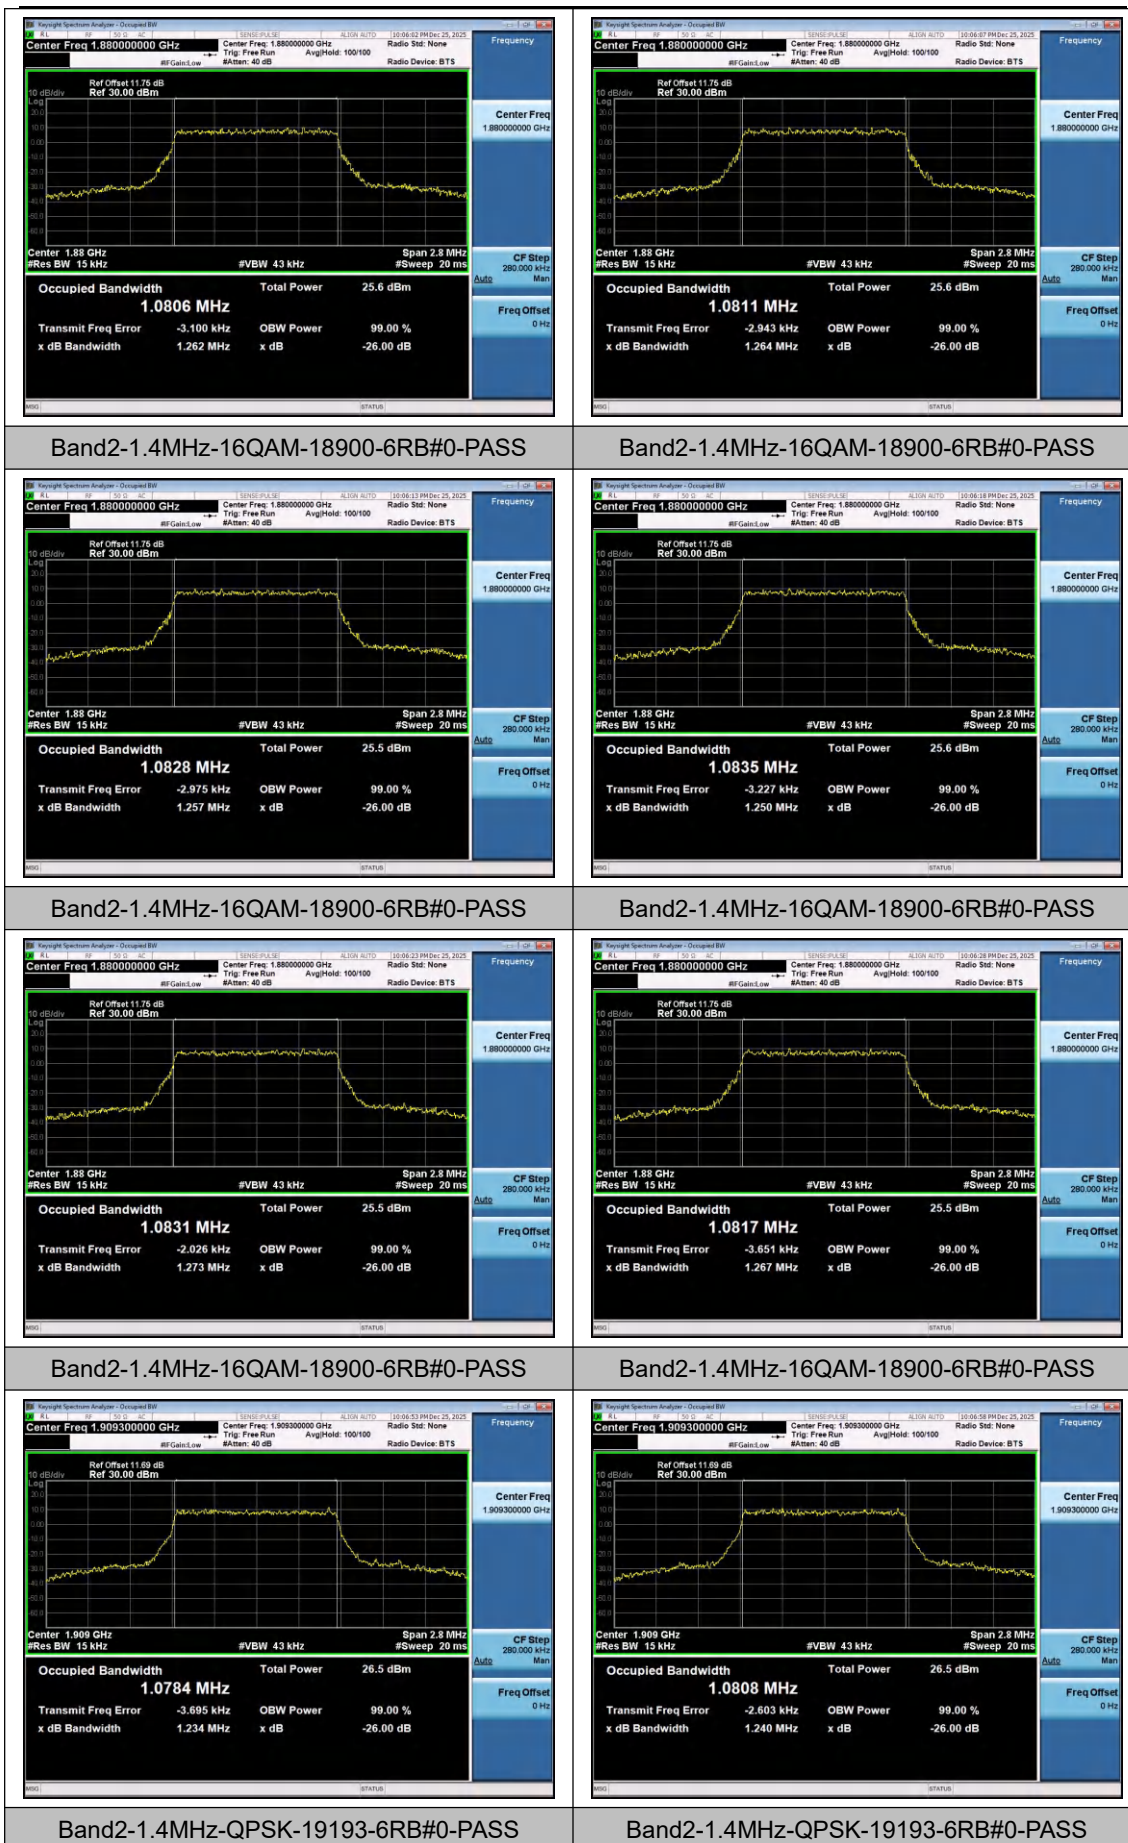

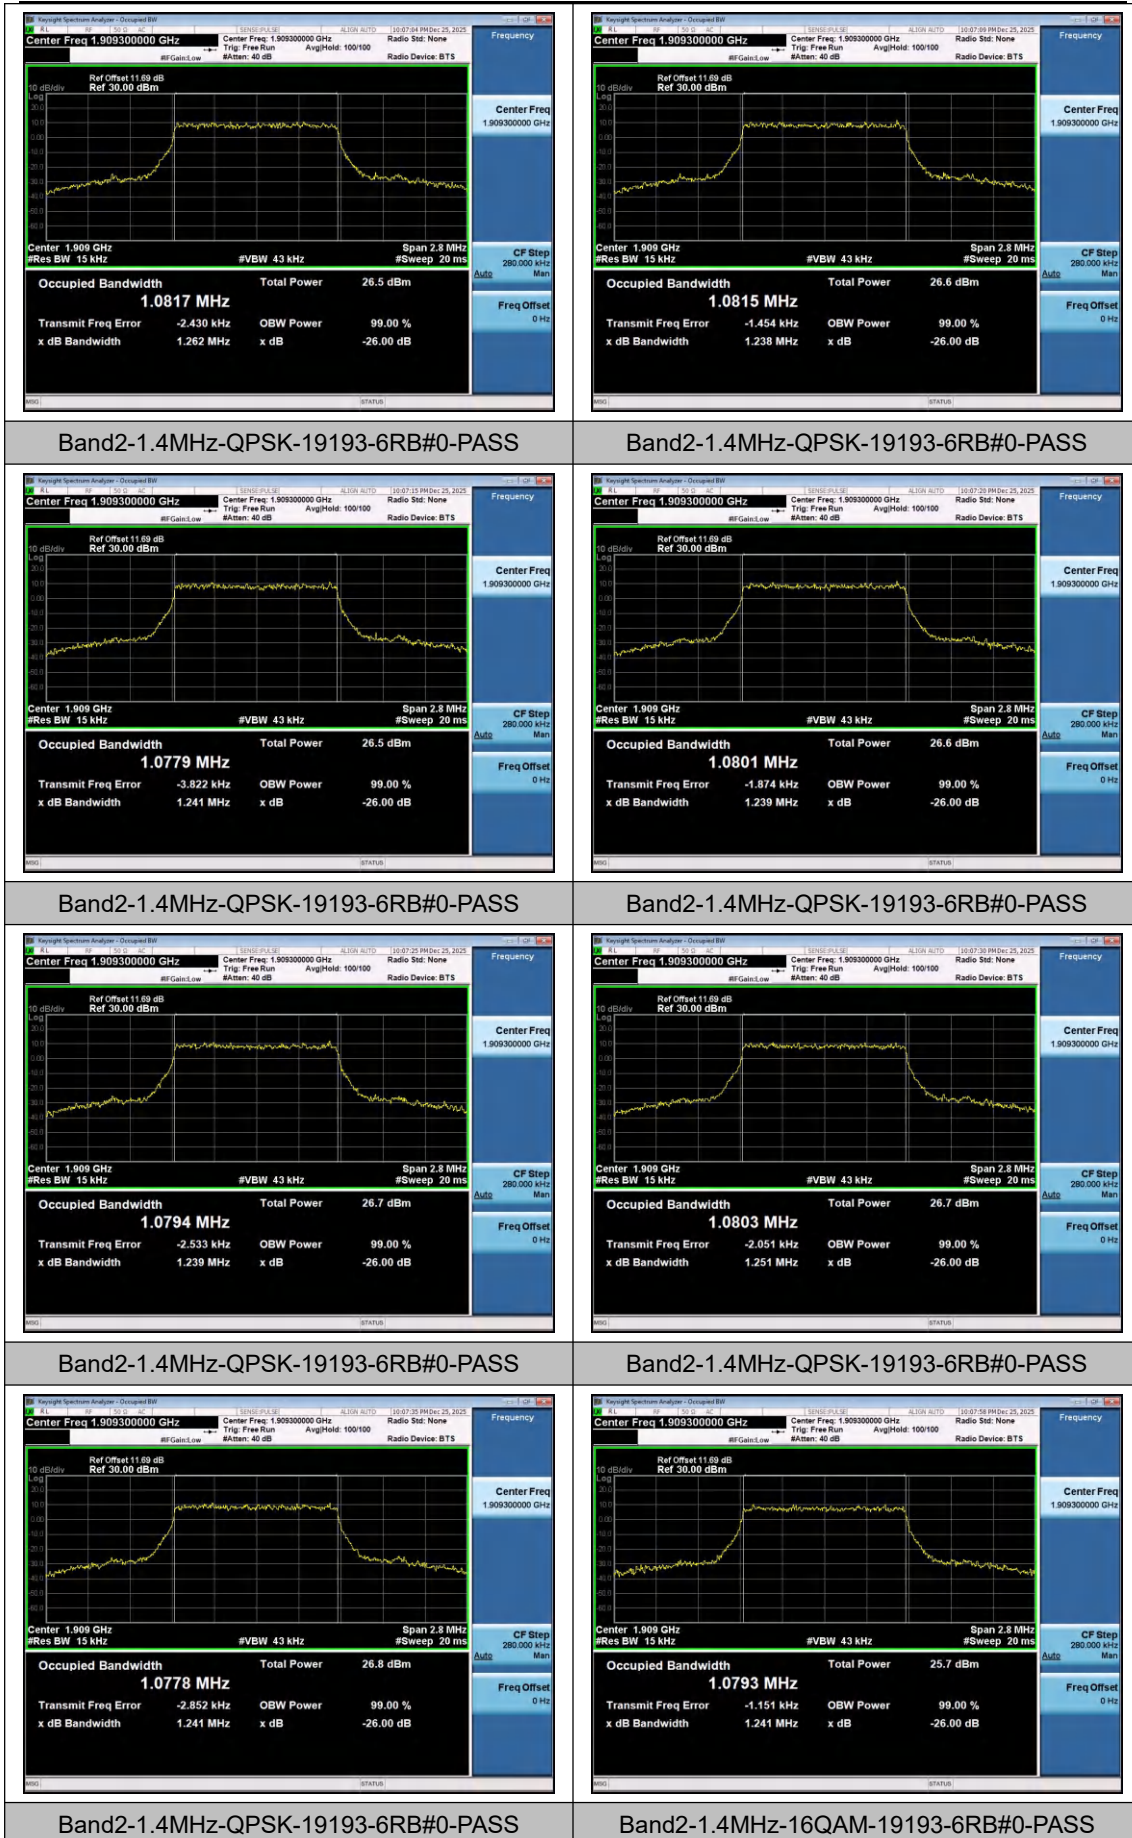

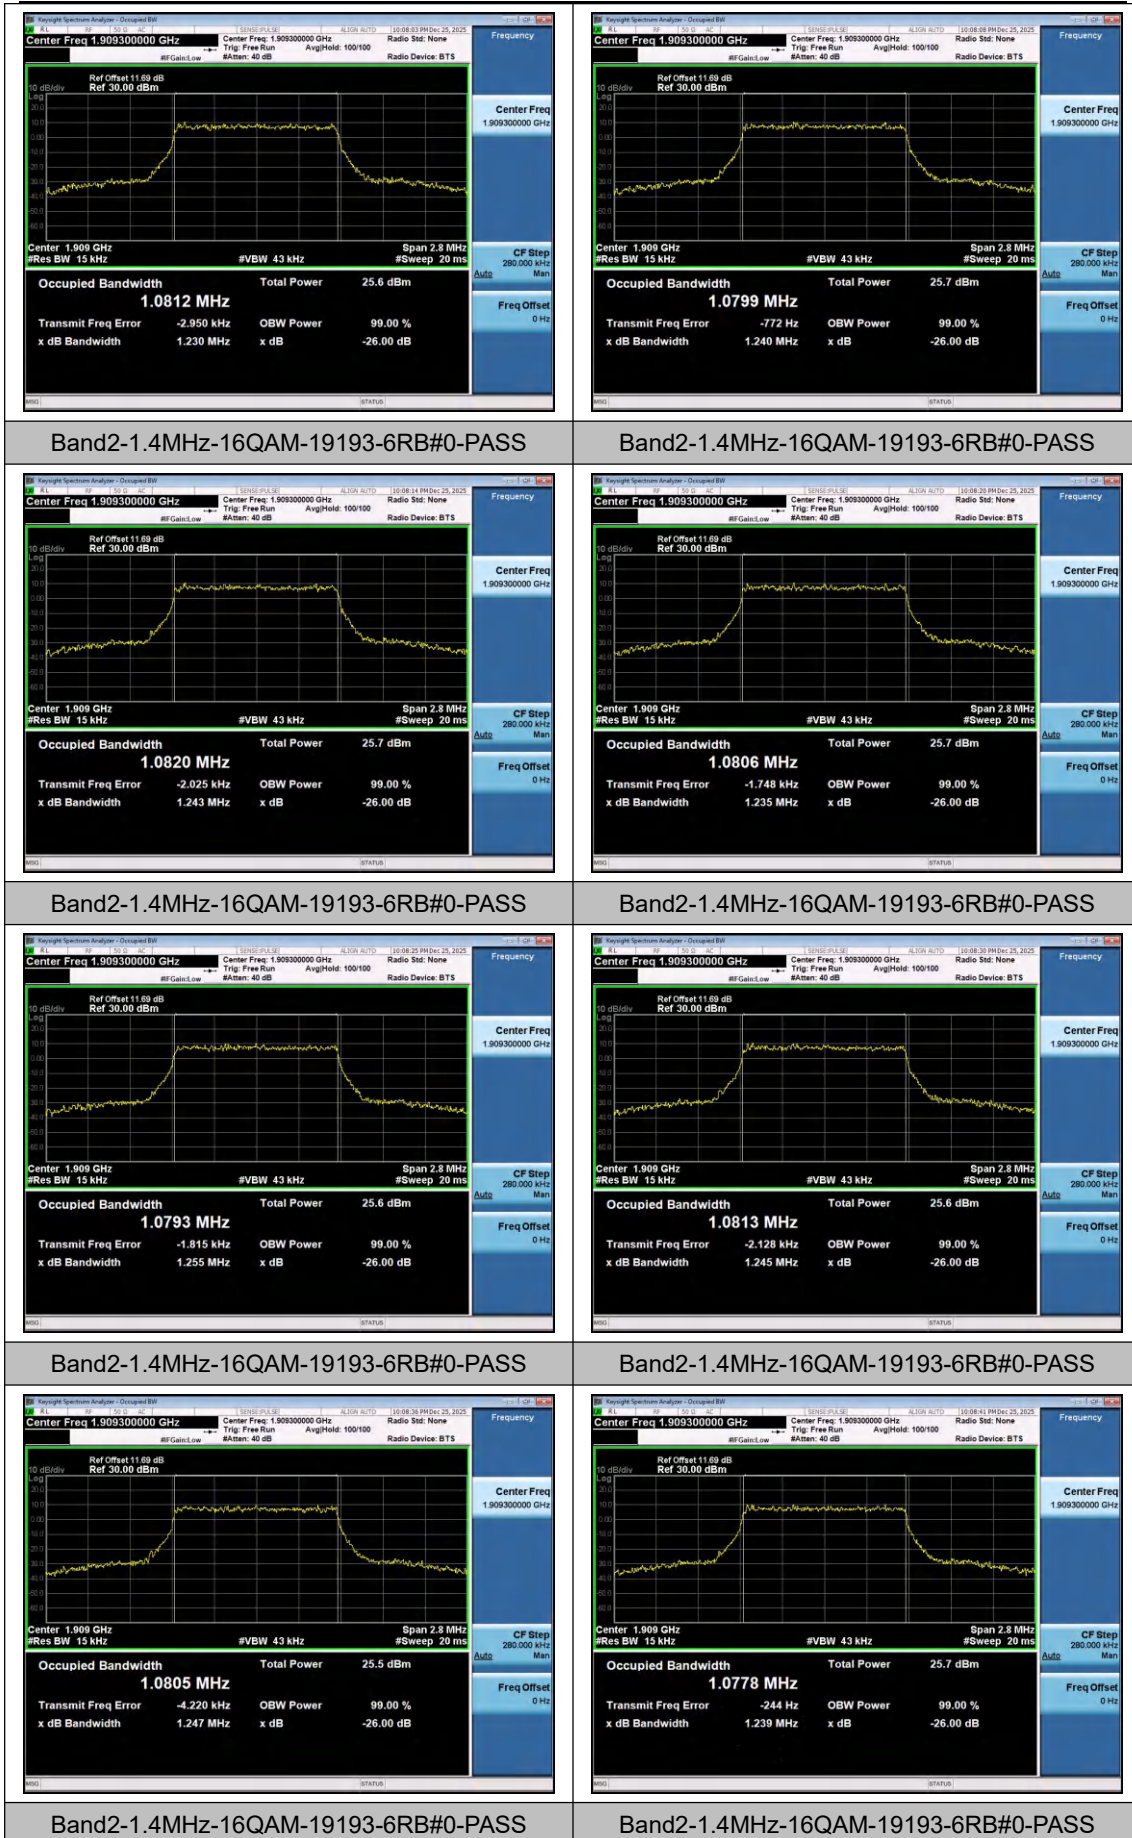


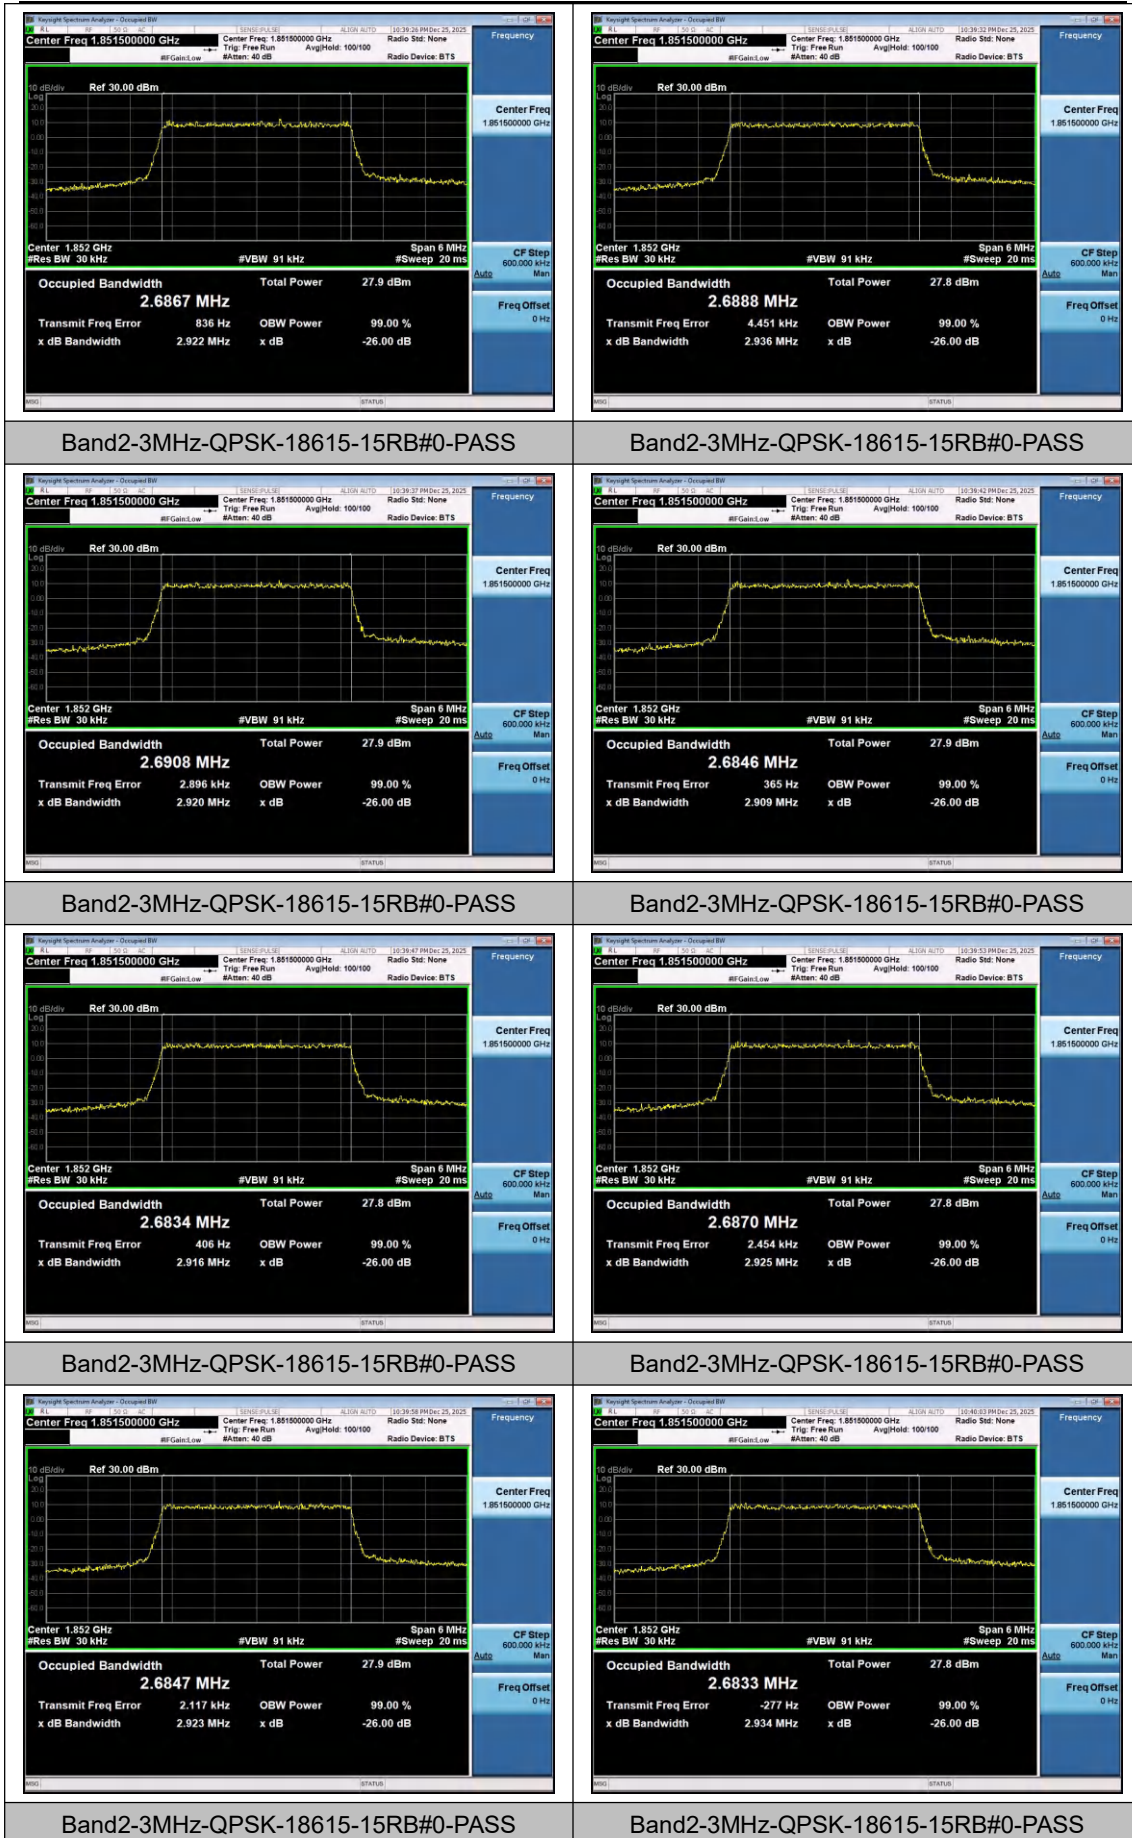

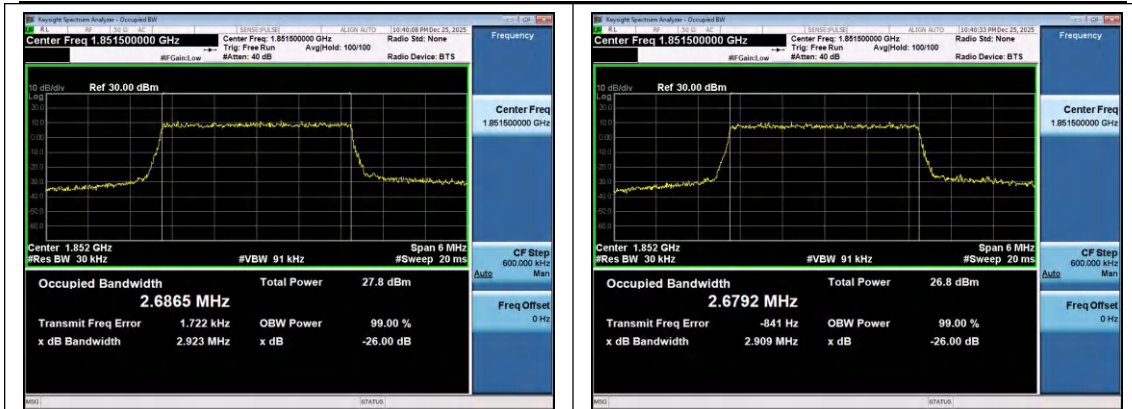


Band2-3MHz-QPSK-18615-15RB#0-PASS

Band2-3MHz-16QAM-18615-15RB#0-PASS

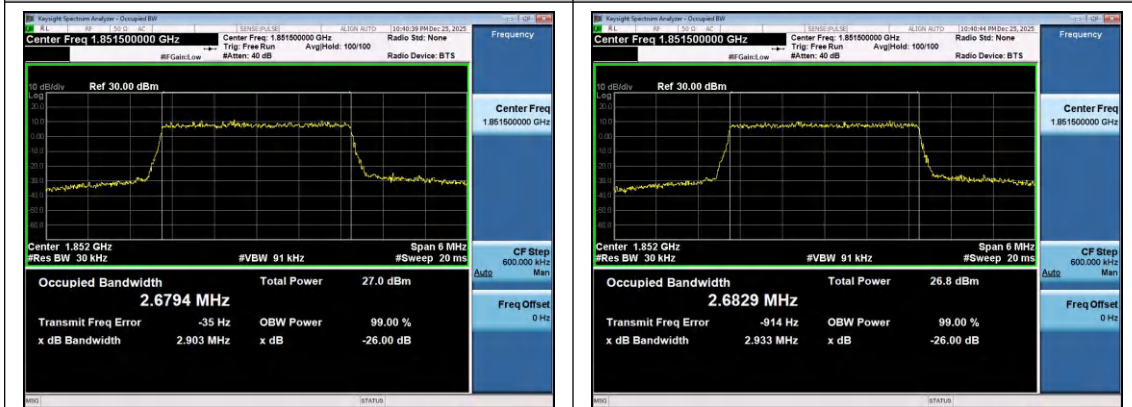


Band2-3MHz-16QAM-18615-15RB#0-PASS

Band2-3MHz-16QAM-18615-15RB#0-PASS

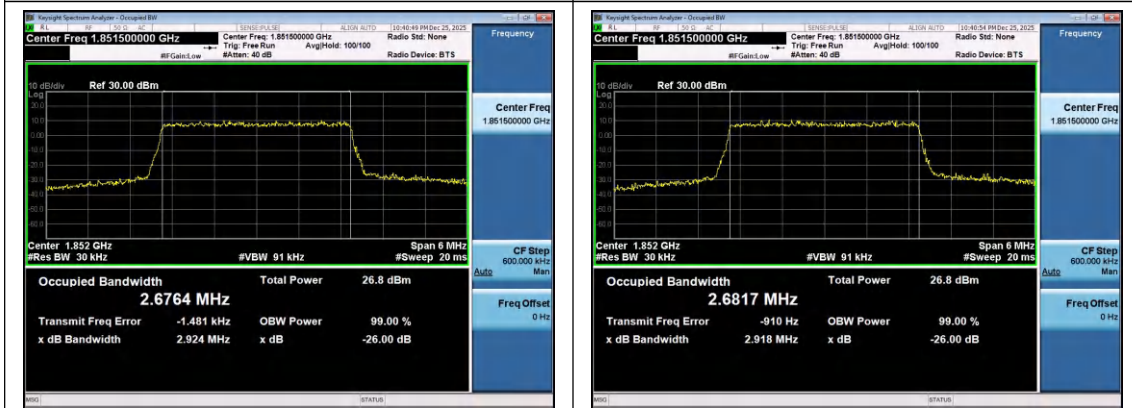


Band2-3MHz-16QAM-18615-15RB#0-PASS


Band2-3MHz-16QAM-18615-15RB#0-PASS

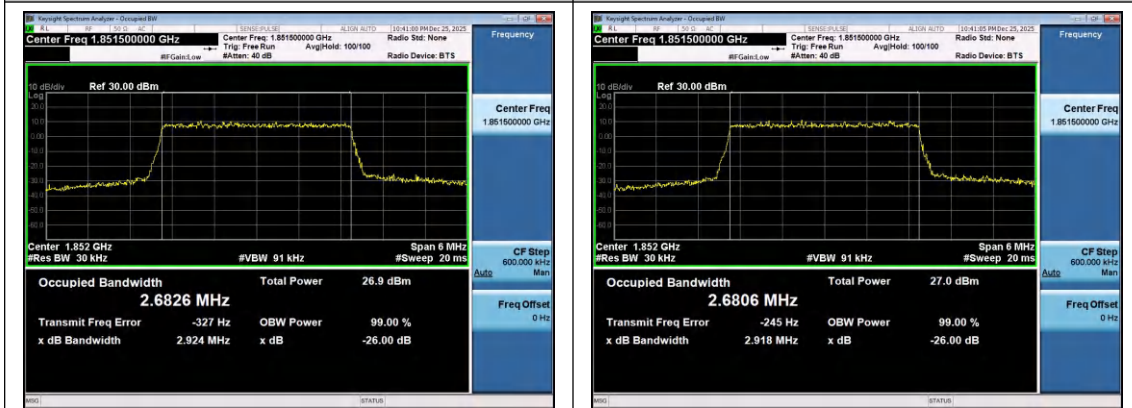

Band2-3MHz-16QAM-18615-15RB#0-PASS


Band2-3MHz-16QAM-18615-15RB#0-PASS

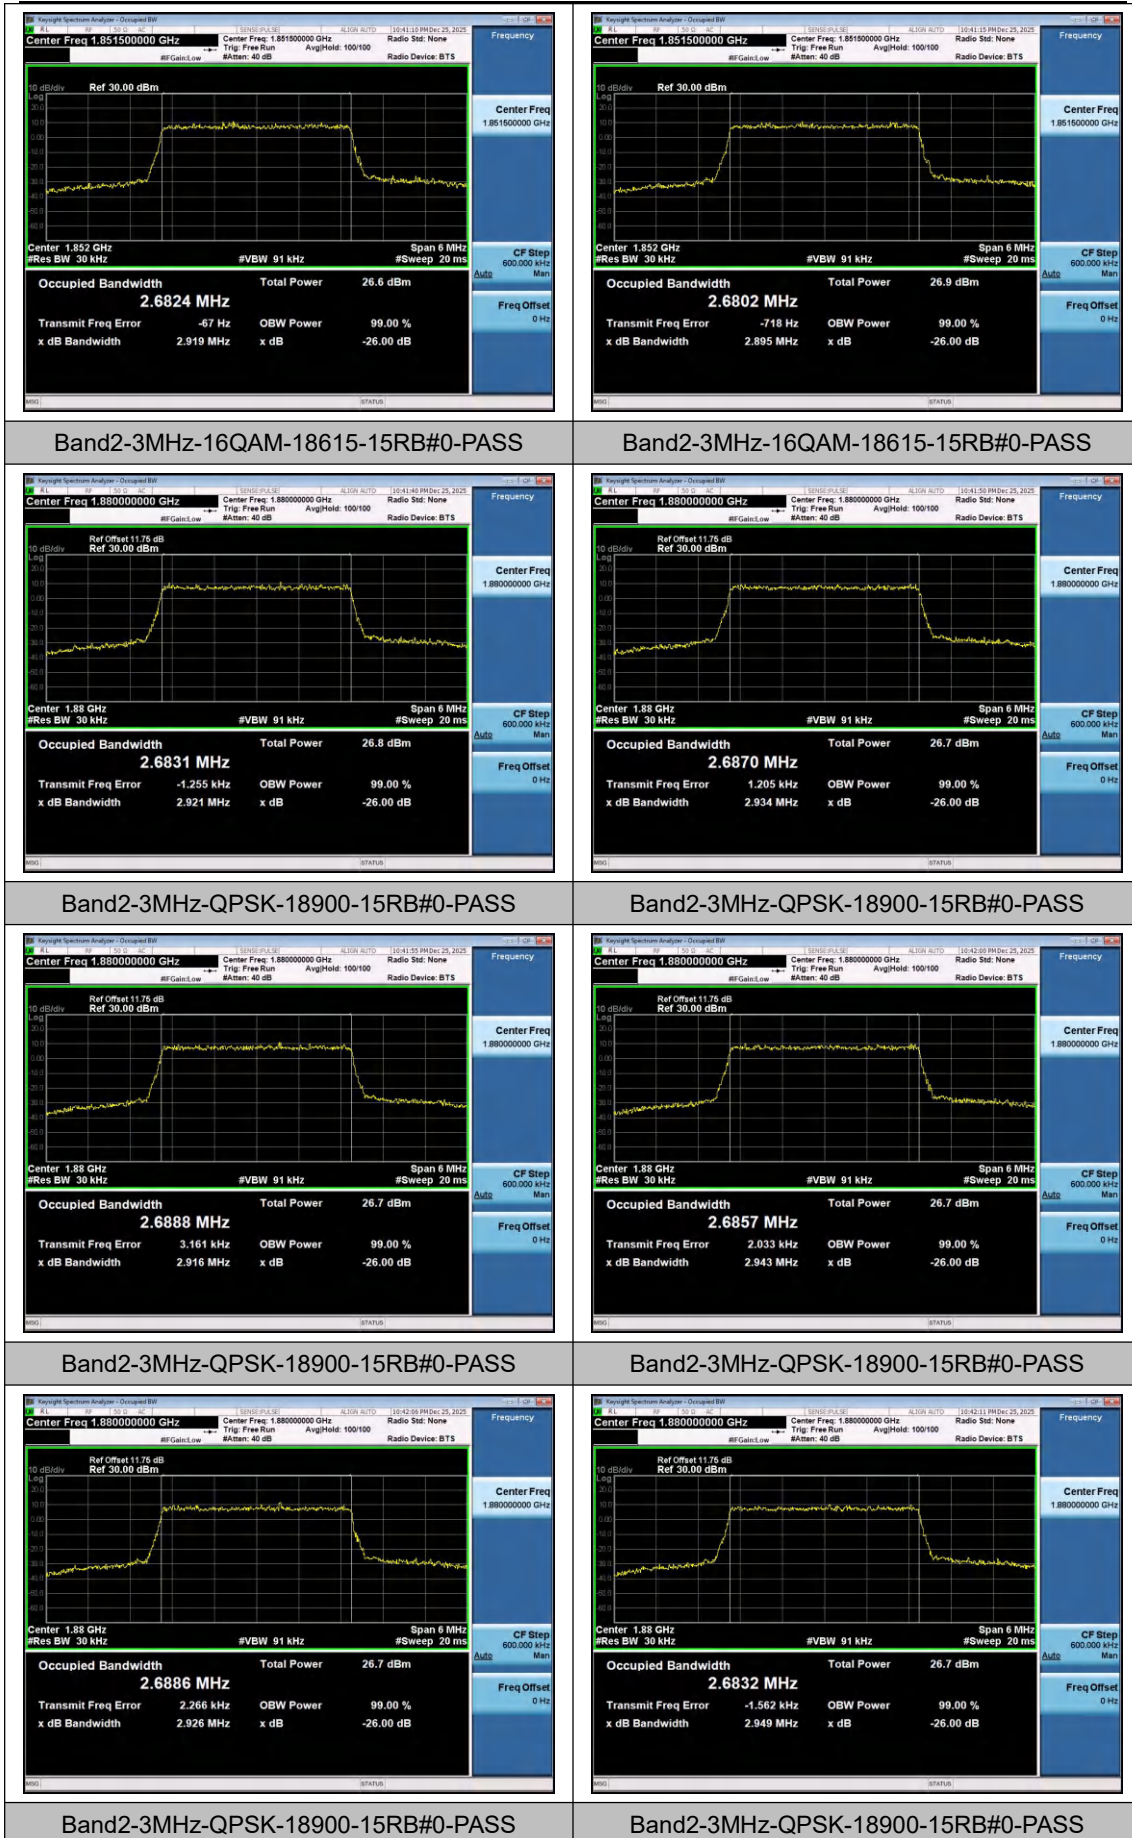

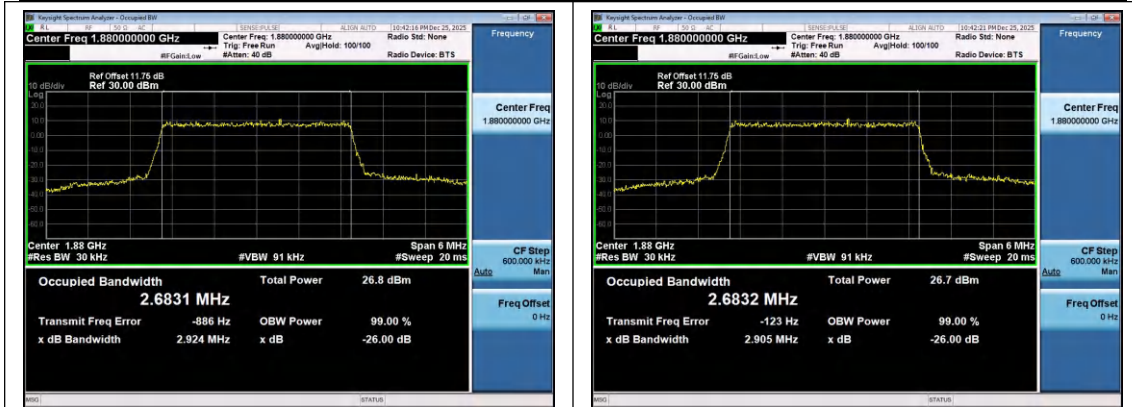


Band2-3MHz-QPSK-18900-15RB#0-PASS

Band2-3MHz-QPSK-18900-15RB#0-PASS

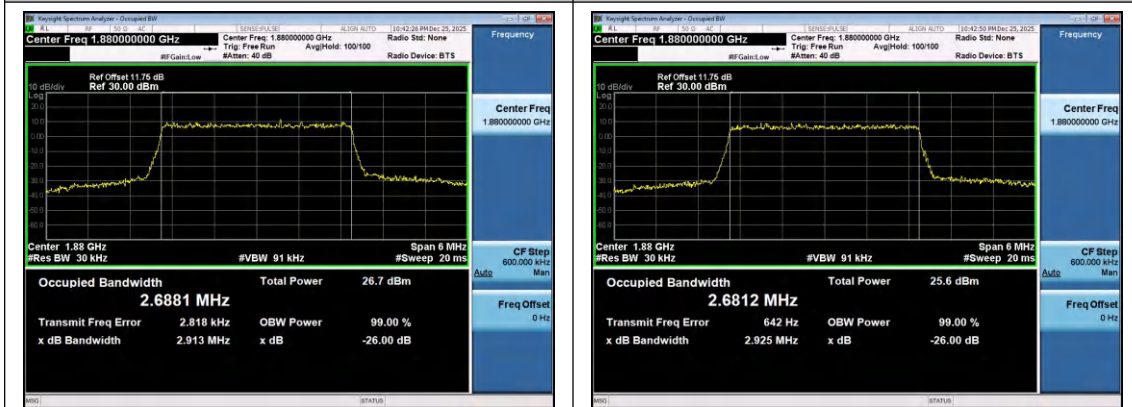


Band2-3MHz-QPSK-18900-15RB#0-PASS

Band2-3MHz-16QAM-18900-15RB#0-PASS

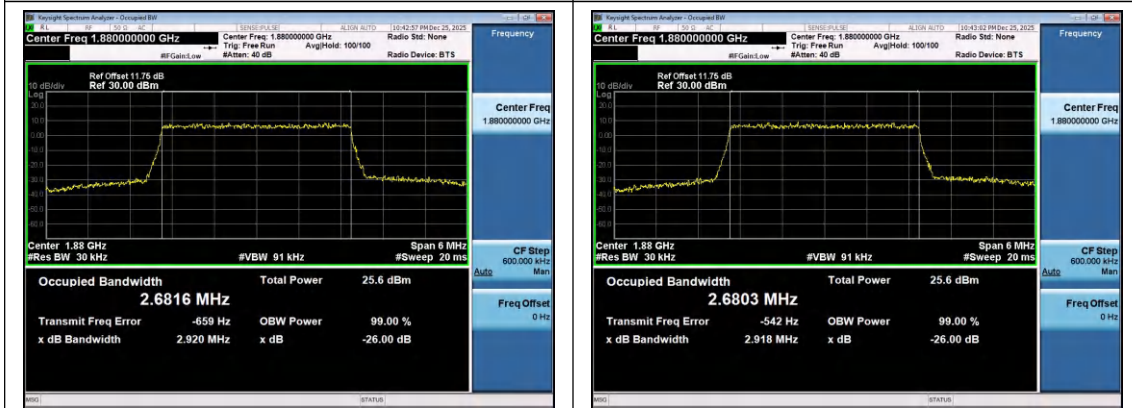

Band2-3MHz-16QAM-18900-15RB#0-PASS

Band2-3MHz-16QAM-18900-15RB#0-PASS

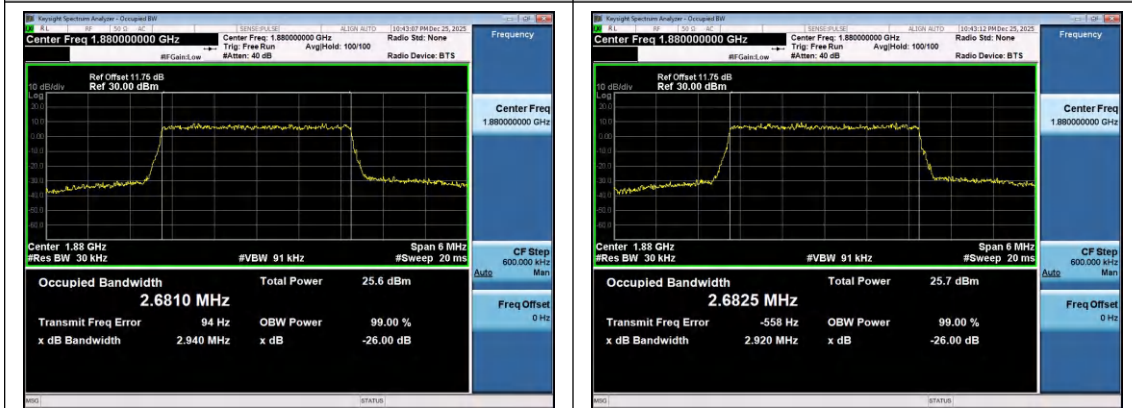

Band2-3MHz-16QAM-18900-15RB#0-PASS

Band2-3MHz-16QAM-18900-15RB#0-PASS