





Band2-20MHz-QPSK-19100-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-19100-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-19100-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-19100-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-19100-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-19100-1RB#99-0.009~0.1 5-PASS

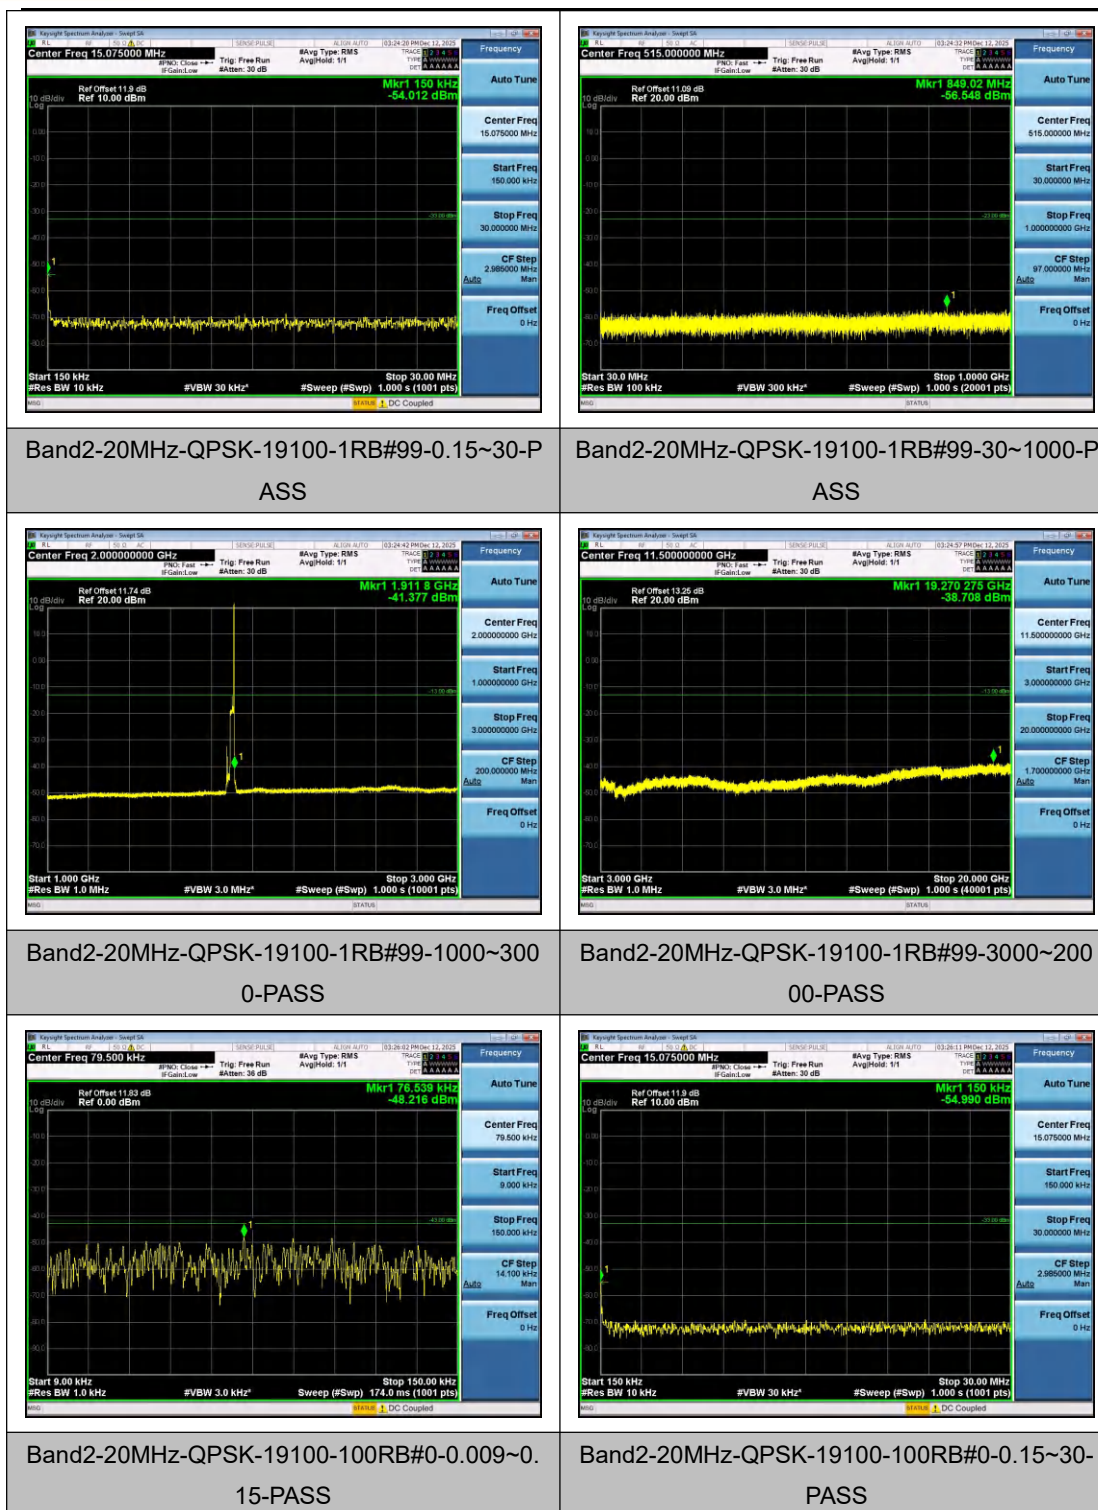

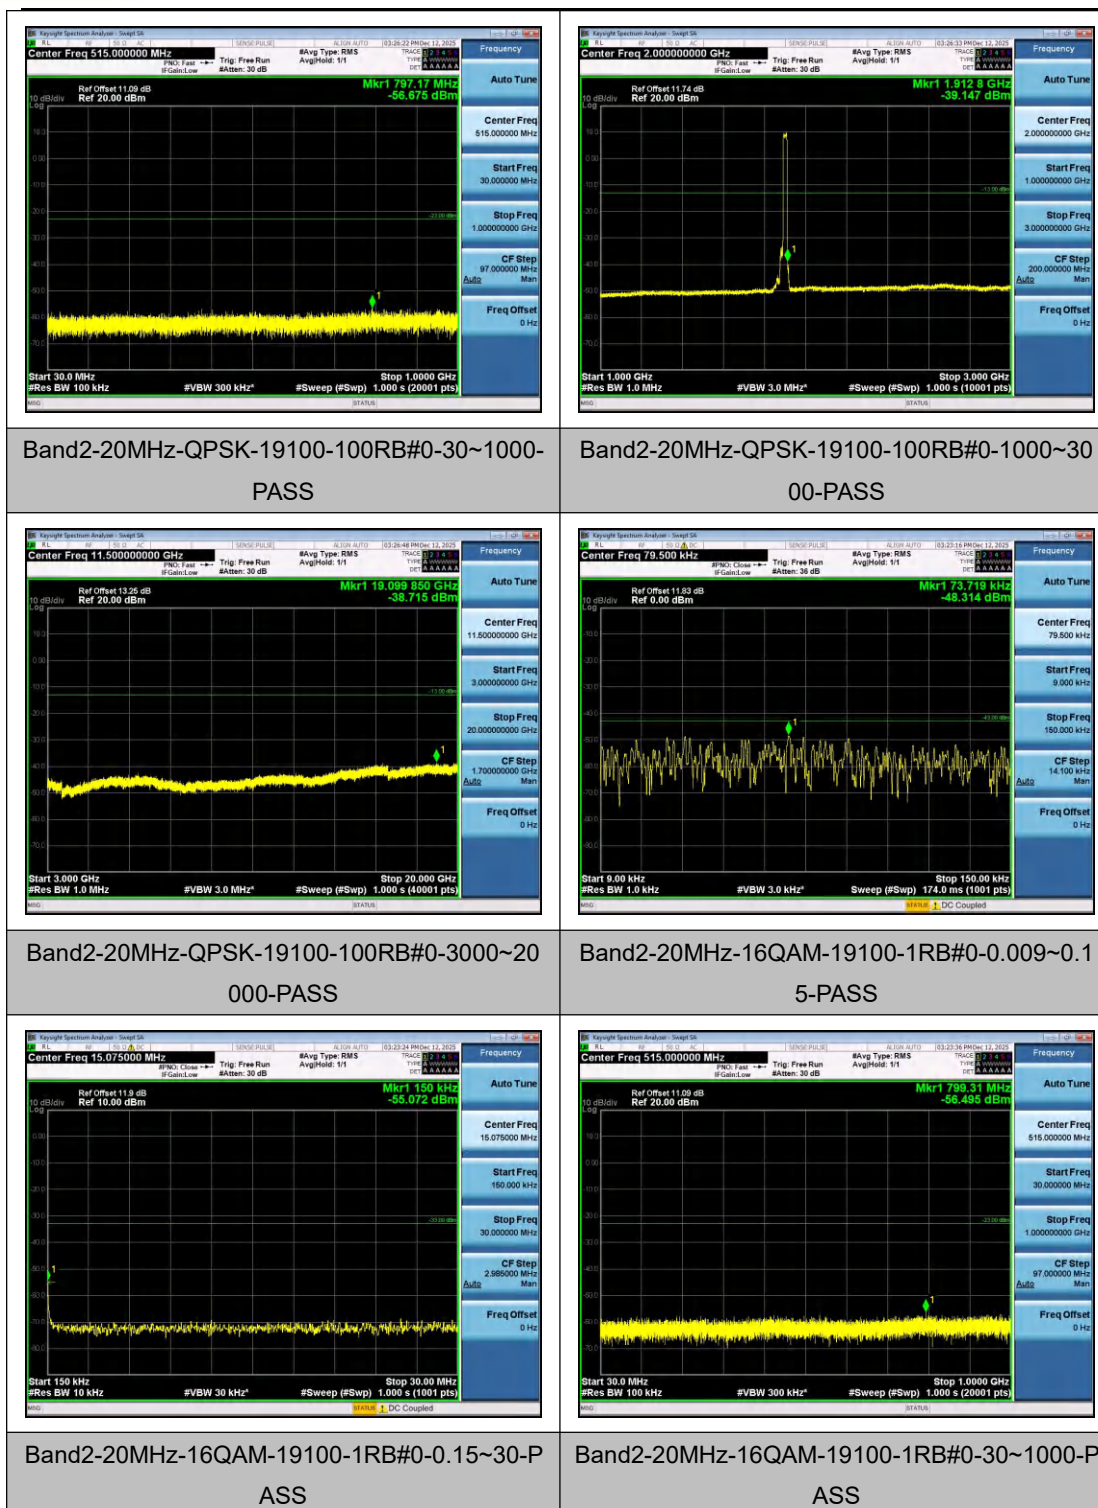

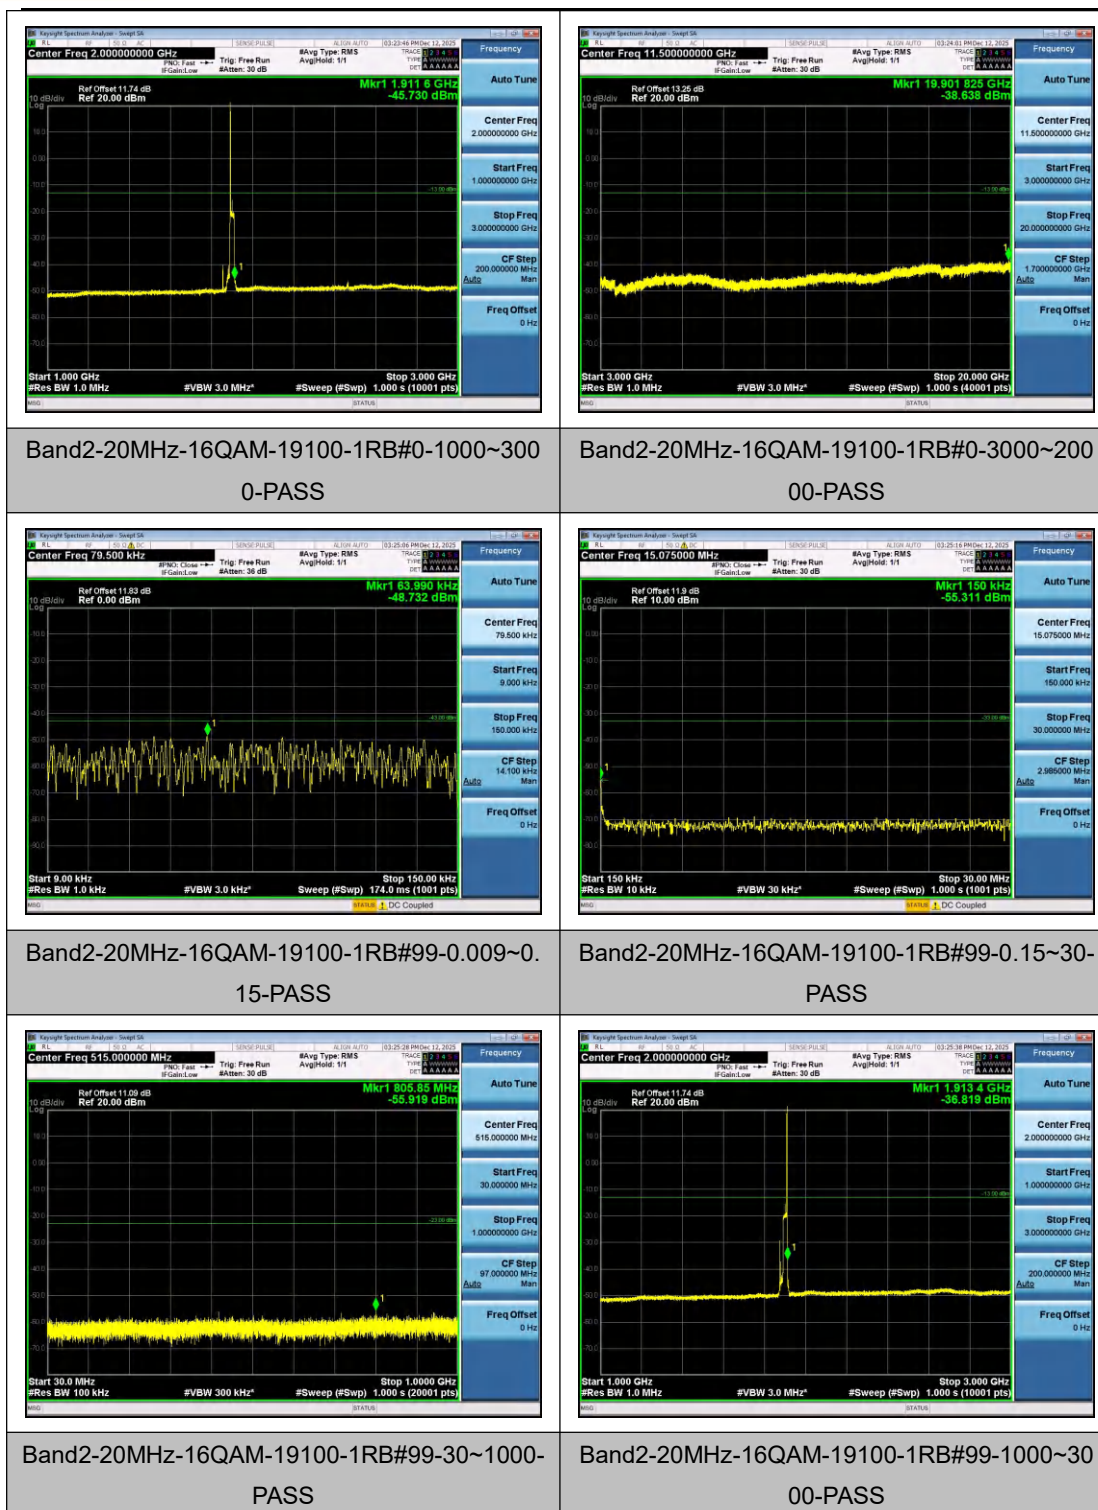

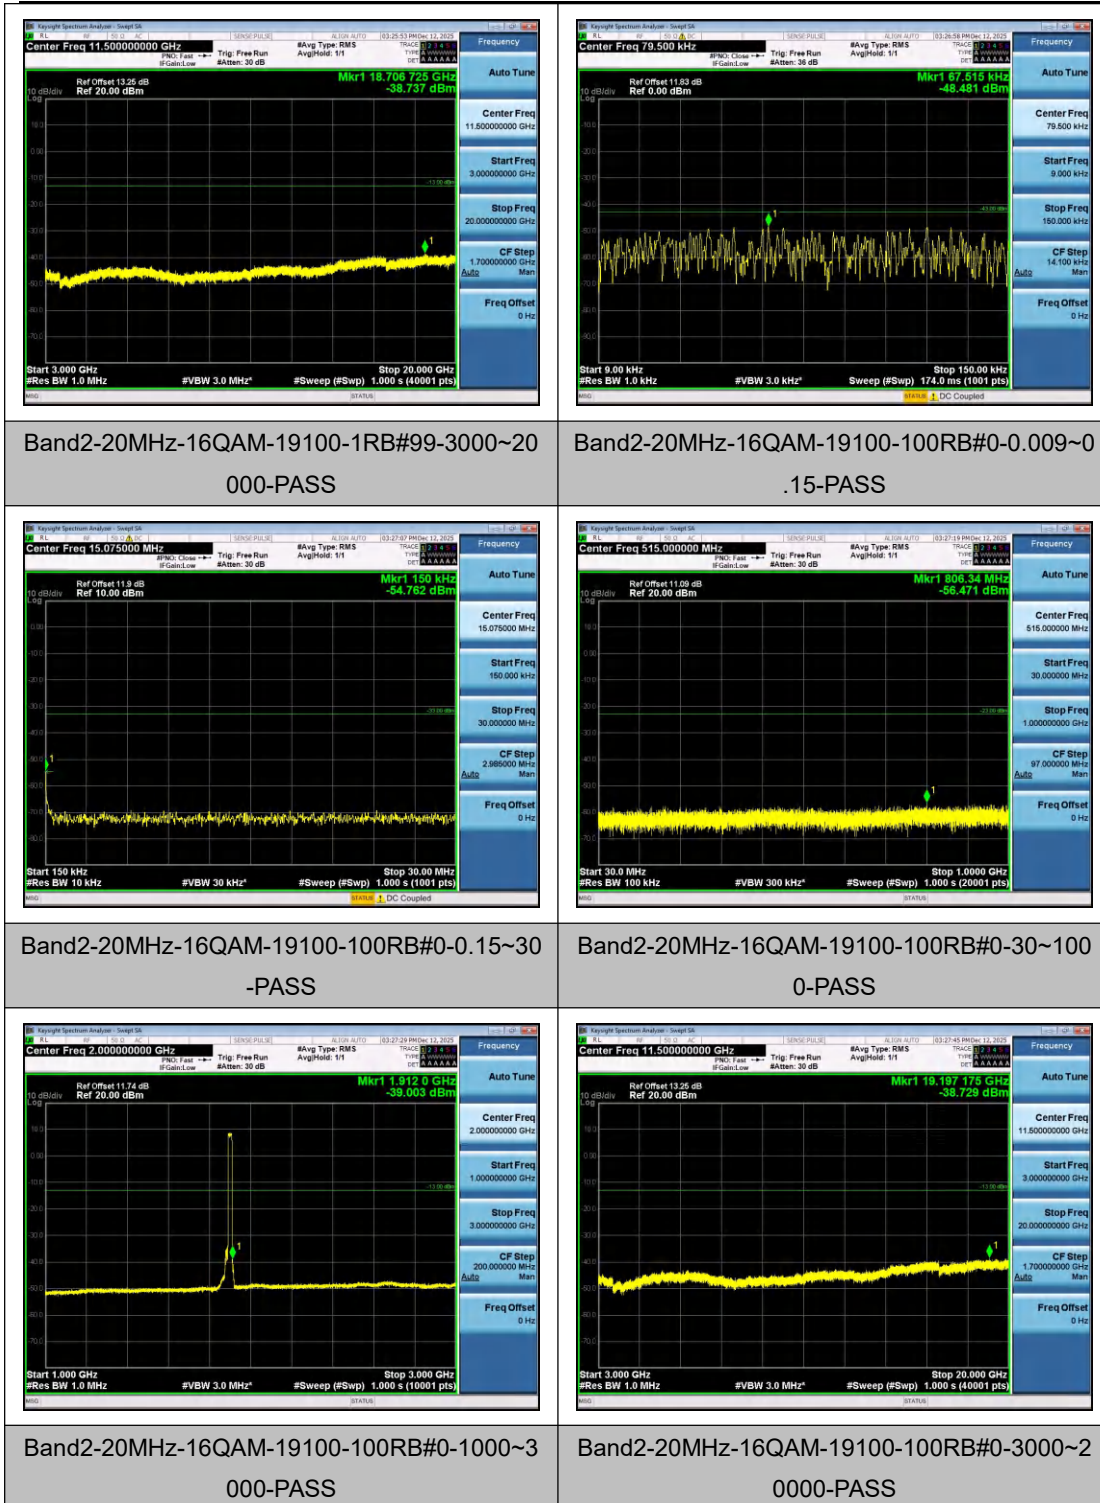

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage[Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15 977	1851.23 947	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15 807	1851.23 997	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15 775	1851.23 855	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15 914	1851.23 744	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15 896	1851.23 696	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15 943	1851.23 743	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45 7	1880.53 67	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45 829	1880.53 769	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45 904	1880.53 784	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45 593	1880.53 593	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45 744	1880.53 844	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45 551	1880.53 821	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75 816	1909.83 846	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75 689	1909.83 829	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75 644	1909.83 544	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75 966	1909.83 826	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75 781	1909.83 721	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75	1909.83	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							902	632	10	
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.16 624	1852.83 994	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.16 401	1852.83 481	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 362	1852.83 972	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.16 76	1852.83 73	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.16 639	1852.83 059	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.16 77	1852.83 12	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.66 484	1881.34 254	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.66 505	1881.33 685	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.66 6	1881.33 78	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.66 604	1881.33 364	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.66 801	1881.33 091	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.66 55	1881.33 38	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.15 885	1909.83 155	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.16 019	1909.83 879	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.16 022	1909.83 432	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.16 096	1909.83 156	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15 926	1909.83 216	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.16 042	1909.83 392	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 605	1854.73 195	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.26 104	1854.73 244	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.26	1854.72	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							557	927	10	
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 94	1854.73 24	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26 835	1854.73 785	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.26 834	1854.74 054	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.76 411	1882.23 551	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.76 137	1882.23 447	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.76 029	1882.23 019	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76 658	1882.23 528	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 383	1882.23 263	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 492	1882.22 952	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.26 762	1909.72 872	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26 225	1909.72 775	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.26 583	1909.72 893	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.26 23	1909.72 77	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26 477	1909.72 887	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.25 919	1909.73 119	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.54 939	1859.45 589	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.54 869	1859.46 409	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.54 735	1859.46 765	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.55 532	1859.46 382	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.54 532	1859.46 682	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.55	1859.46	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							02	88	10	
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.54 322	1884.47 472	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.54 476	1884.47 636	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.54 176	1884.47 496	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.55 003	1884.46 573	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.54 558	1884.47 318	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.54 355	1884.47 105	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.53 429	1909.44 909	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.52 454	1909.45 124	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.52 163	1909.45 263	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.53 122	1909.45 532	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.52 665	1909.44 995	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.53 672	1909.44 942	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.81 256	1864.17 656	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.82 181	1864.17 881	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.82 278	1864.17 778	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.82 864	1864.18 564	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.81 103	1864.19 703	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.82 004	1864.19 504	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.30 346	1886.71 146	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.32 234	1886.71 834	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.31	1886.71	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							285	285	10	
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.31 207	1886.69 907	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.31 742	1886.70 142	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.31 585	1886.70 685	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.80 033	1909.17 533	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.80 195	1909.16 895	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.80 128	1909.19 528	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.80 691	1909.19 791	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.80 81	1909.19 01	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.80 66	1909.18 76	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	1851.09 186	1868.90 486	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	1851.10 145	1868.89 845	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	1851.09 581	1868.91 681	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	1851.08 379	1868.91 379	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	1851.08 544	1868.91 344	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	1851.08 989	1868.91 289	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1871.09 752	1888.93 652	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	1871.06 551	1888.94 951	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	1871.07 223	1888.93 223	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	1871.11 641	1888.97 541	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	1871.11 498	1888.94 898	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	1871.10	1888.93	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							739	239	10	
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	1891.05 369	1908.90 469	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	1891.05 854	1908.91 254	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	1891.04 517	1908.89 717	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	1891.07 351	1908.91 551	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	1891.07 811	1908.92 711	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	1891.08 955	1908.92 755	1850-19 10	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.15 789	1851.23 979	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15 91	1851.23 84	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15 822	1851.23 872	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15 848	1851.23 948	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.16	1851.24	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.15 842	1851.24 022	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15 858	1851.23 878	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.15 826	1851.23 956	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.15 811	1851.23 761	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.16 012	1851.23 592	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15 942	1851.23 682	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.16 009	1851.23 589	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.15	1851.23	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							932	782	10	
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15 974	1851.23 584	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.16 06	1851.23 69	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15 917	1851.23 587	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15 995	1851.23 665	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15 992	1851.23 592	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45 912	1880.53 752	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45 638	1880.53 698	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.45 71	1880.53 68	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45 891	1880.53 621	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45 63	1880.53 83	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45 787	1880.53 757	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45 761	1880.53 701	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.45 615	1880.53 855	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45 849	1880.53 699	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45 827	1880.53 697	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45 738	1880.53 698	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45 63	1880.53 72	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.45 921	1880.53 741	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.45 976	1880.53 926	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45 746	1880.53 836	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45	1880.53	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							687	687	10	
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45 654	1880.53 564	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45 639	1880.53 689	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75 725	1909.83 645	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75 635	1909.83 895	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75 81	1909.83 57	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75 669	1909.83 799	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75 668	1909.83 768	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75 727	1909.83 667	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75 746	1909.83 606	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75 731	1909.83 681	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.75 792	1909.83 682	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75 653	1909.83 783	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75 939	1909.83 599	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.75 76	1909.83 81	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.76 02	1909.83 75	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.75 718	1909.83 758	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.75 942	1909.83 732	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.76 043	1909.83 743	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.76 112	1909.83 632	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.75 896	1909.83 686	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.16	1852.83	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							652	892	10	
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.16 362	1852.83 652	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.16 625	1852.84 285	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.16 335	1852.83 895	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.16 364	1852.84 304	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.16 423	1852.84 303	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.16 709	1852.83 829	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.16 423	1852.83 873	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.16 832	1852.83 922	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.16 666	1852.83 626	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.16 821	1852.83 391	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.16 712	1852.83 482	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.16 478	1852.83 648	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.16 757	1852.83 477	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.16 472	1852.83 542	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.16 626	1852.83 456	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.16 364	1852.83 634	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.16 646	1852.83 726	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.66 427	1881.33 647	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.66 403	1881.33 983	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.66 674	1881.34 134	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.66	1881.34	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							397	117	10	
Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.66 37	1881.33 57	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.66 558	1881.34 358	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.66 552	1881.34 102	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.66 407	1881.34 207	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.66 493	1881.33 953	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.66 452	1881.33 672	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.66 657	1881.33 527	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.66 372	1881.33 262	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.66 795	1881.33 725	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.66 332	1881.33 682	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.66 562	1881.33 512	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.66 464	1881.33 174	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.66 52	1881.33 72	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.66 581	1881.33 451	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.15 825	1909.83 415	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.15 885	1909.83 365	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.16 082	1909.83 692	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.15 828	1909.83 498	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.15 946	1909.83 556	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.15 932	1909.82 982	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.16	1909.83	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							131	341	10	
Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.16 039	1909.83 759	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.15 926	1909.83 326	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.15 999	1909.83 219	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.16 14	1909.83 16	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.15 909	1909.83 329	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.15 943	1909.83 193	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.16 055	1909.82 825	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.16 034	1909.83 224	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.16 184	1909.83 284	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.16 101	1909.83 101	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.16 337	1909.82 797	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.26 248	1854.73 138	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.26 469	1854.73 469	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.25 856	1854.73 836	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.26 228	1854.73 498	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.25 939	1854.73 649	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.26 58	1854.73 49	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.26 534	1854.73 494	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.26 272	1854.73 482	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.26 656	1854.73 146	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.26	1854.74	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							85	65	10	
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.26 882	1854.73 892	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.26 793	1854.74 543	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.26 44	1854.74 69	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.26 268	1854.74 348	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.26 493	1854.73 303	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26 629	1854.73 439	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.26 654	1854.73 434	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.26 42	1854.73 72	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.76 137	1882.23 147	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.75 802	1882.23 522	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.76 025	1882.23 355	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.76 156	1882.23 426	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.76 543	1882.23 473	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.76 211	1882.23 311	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.75 99	1882.23 41	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.76 168	1882.23 608	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.76 267	1882.23 187	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.76 844	1882.23 134	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76 57	1882.23 87	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.76 588	1882.23 608	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.76	1882.23	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							796	076	10	
Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.76 455	1882.23 035	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76 623	1882.23 033	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.76 749	1882.23 339	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.76 387	1882.23 657	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76 841	1882.23 411	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.26 67	1909.73 04	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.26 78	1909.72 93	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.26 332	1909.73 152	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.26 475	1909.72 955	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.26 547	1909.72 637	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.26 727	1909.72 797	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.26 467	1909.72 947	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.26 275	1909.72 965	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.26 692	1909.73 072	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.26 325	1909.73 205	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26 367	1909.72 877	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.26 567	1909.73 177	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.26 326	1909.73 096	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.26 191	1909.73 101	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.26 117	1909.72 617	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.26	1909.73	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							23	19	10	
Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.26 642	1909.73 122	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.26 266	1909.72 846	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.54 621	1859.46 161	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.54 254	1859.46 914	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.55 006	1859.46 706	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.54 563	1859.46 643	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.54 326	1859.45 996	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.54 51	1859.46 64	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.55 151	1859.46 001	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.54 623	1859.46 243	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.54 784	1859.46 474	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.54 778	1859.46 538	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.54 667	1859.47 547	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.54 544	1859.46 484	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.54 842	1859.46 952	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.55 24	1859.46 14	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.54 627	1859.46 977	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.55 34	1859.47 02	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.55 131	1859.46 731	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.54 608	1859.46 858	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.53	1884.47	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							976	896	10	
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.54 331	1884.47 281	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.54 293	1884.47 143	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.53 92	1884.47 3	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.54 325	1884.47 995	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.54 411	1884.47 541	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.54 018	1884.47 788	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.54 22	1884.47 63	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.54 219	1884.47 829	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.54 853	1884.46 613	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.54 781	1884.47 061	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.54 184	1884.46 894	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.53 744	1884.47 274	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.54 853	1884.47 273	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.54 732	1884.47 502	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.54 472	1884.46 802	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.54 373	1884.46 903	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.54 807	1884.47 567	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.53 239	1909.45 179	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.52 097	1909.45 317	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.53 283	1909.45 313	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.53	1909.45	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							367	147	10	
Band2	10MHz	QPSK	19150	50RB#0	NV	10	1900.54 268	1909.45 038	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	1900.52 202	1909.45 142	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	1900.53 24	1909.45 25	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	1900.52 921	1909.44 601	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	1900.52 139	1909.44 849	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	1900.51 963	1909.45 653	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	1900.51 956	1909.45 116	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	1900.52 968	1909.44 698	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	1900.53 148	1909.44 948	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	1900.53 467	1909.45 037	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	1900.52 752	1909.45 042	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	1900.52 186	1909.45 216	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	1900.52 749	1909.44 629	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	1900.53 461	1909.45 641	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	1850.81 805	1864.18 005	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	1850.82 082	1864.17 882	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	1850.82 205	1864.17 505	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	1850.83 329	1864.17 729	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	1850.80 973	1864.17 073	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	1850.82 034	1864.16 734	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	1850.82	1864.18	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							824	024	10	
Band2	15MHz	QPSK	18675	75RB#0	NV	40	1850.82 006	1864.17 006	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	1850.81 572	1864.17 572	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	1850.811 16	1864.18 916	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	1850.81 208	1864.18 508	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	1850.81 044	1864.19 444	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	1850.81 299	1864.18 599	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	1850.82 089	1864.19 089	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	1850.81 944	1864.19 644	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	1850.81 175	1864.19 575	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	1850.80 42	1864.17 82	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	1850.80 794	1864.19 794	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	1873.31 273	1886.71 373	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	1873.31 386	1886.72 386	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	1873.30 806	1886.73 006	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	1873.31 924	1886.72 124	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	1873.30 734	1886.71 534	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	1873.31 191	1886.71 491	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	1873.31 532	1886.72 332	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	1873.29 914	1886.71 214	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	1873.31 29	1886.72 49	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	1873.32	1886.70	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							331	531	10	
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	1873.30 708	1886.70 708	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	1873.31 997	1886.70 797	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	1873.30 8	1886.70 5	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	1873.31 172	1886.70 872	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	1873.31 517	1886.70 617	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	1873.31 842	1886.70 742	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	1873.31 475	1886.70 475	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	1873.30 889	1886.70 189	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	1895.79 569	1909.18 169	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	1895.79 239	1909.17 639	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	1895.78 943	1909.17 843	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	1895.79 891	1909.18 391	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	1895.80 608	1909.19 808	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	1895.79 933	1909.18 533	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	1895.79 695	1909.18 195	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	1895.79 545	1909.18 645	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	1895.80 2	1909.19 7	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	1895.78 659	1909.18 859	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	1895.80 489	1909.18 589	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	1895.80 034	1909.19 034	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	1895.79	1909.19	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							733	433	10	
Band2	15MHz	16QAM	19125	75RB#0	NV	10	1895.80 012	1909.18 612	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	1895.79 736	1909.19 636	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	1895.79 589	1909.18 489	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	1895.80 447	1909.18 447	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	1895.80 906	1909.18 806	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	1851.10 297	1868.89 897	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	1851.09 756	1868.92 156	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	1851.09 924	1868.90 924	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	1851.09 865	1868.90 065	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	1851.10 081	1868.90 881	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	1851.09 442	1868.92 042	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	1851.10 317	1868.90 917	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	1851.10 612	1868.89 812	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	1851.09 668	1868.90 768	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	1851.08 46	1868.92 06	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	1851.08 164	1868.91 764	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	1851.09 46	1868.91 26	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	1851.05 597	1868.90 697	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	1851.08 833	1868.91 133	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	1851.07 511	1868.91 211	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	1851.07	1868.90	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							945	845	10	
Band2	20MHz	16QAM	18700	100RB#0	NV	40	1851.07 008	1868.91 608	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	1851.08 156	1868.89 756	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	1871.10 477	1888.94 177	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	1871.09 91	1888.93 21	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	1871.08 452	1888.92 952	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	1871.08 026	1888.94 226	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	1871.09 451	1888.96 051	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	1871.10 106	1888.95 706	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	1871.08 694	1888.94 494	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	1871.08 137	1888.93 737	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	1871.10 763	1888.94 963	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	1871.10 749	1888.93 749	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	1871.10 094	1888.95 894	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	1871.10 592	1888.97 192	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	1871.10 294	1888.97 494	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	1871.10 309	1888.93 809	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	1871.09 599	1888.94 099	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	1871.10 005	1888.93 805	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	1871.10 323	1888.93 623	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	1871.10 029	1888.94 629	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	1891.06	1908.92	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							252	952	10	
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	1891.05 279	1908.90 979	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	1891.05 88	1908.91 38	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	1891.06 908	1908.90 208	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	1891.06 829	1908.90 129	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	1891.06 42	1908.89 32	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	1891.04 987	1908.91 687	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	1891.06 335	1908.90 835	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	1891.07 926	1908.90 226	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	1891.07 955	1908.90 055	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	1891.07 865	1908.91 065	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	1891.08 648	1908.92 748	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	1891.07 304	1908.91 404	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	1891.07 975	1908.91 275	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	1891.08 405	1908.91 805	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	1891.09 046	1908.92 146	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	1891.07 347	1908.91 447	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	1891.07 099	1908.92 599	1850-19 10	PASS

Test Graphs

