

Appendix Test Data

Report No:	1812C50618812505-07	Test Sample NO:	1-2-2
Start Test Date:	2025-11-21	Finish Test Date:	2025-12-22
Test Engineer:	<i>Joker Wang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.1°C	Relative Humidity:	49%
Pressure:	101 kPa		



Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	22.22	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#12	22.40	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	22.34	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#0	21.16	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#6	21.24	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#13	21.17	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	21.17	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	21.53	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#12	21.79	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	21.48	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#0	20.19	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#6	20.19	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#13	20.23	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	20.25	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#0	22.79	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#12	22.98	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#24	22.85	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#0	21.92	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#6	21.96	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#13	21.98	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	21.99	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#0	21.94	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#12	22.09	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#24	22.00	PASS
Band41(2535-2655)	5MHz	16QAM	40640	12RB#0	21.01	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	5MHz	16QAM	40640	12RB#6	20.96	PASS
Band41(2535-2655)	5MHz	16QAM	40640	12RB#13	21.04	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	20.99	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	23.62	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#12	23.67	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	23.68	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#0	22.56	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#6	22.68	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#13	22.68	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	22.65	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	22.61	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#12	22.72	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	22.65	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#0	21.60	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#6	21.63	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#13	21.63	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	21.64	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	22.29	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#24	22.36	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	22.43	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#0	21.30	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#12	21.41	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#25	21.39	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	21.38	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	21.47	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#24	21.55	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	21.65	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#0	20.36	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#12	20.43	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#25	20.49	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	20.34	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#0	23.02	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#24	23.11	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#49	23.21	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#0	22.00	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#12	22.10	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#25	22.14	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	22.10	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#0	21.72	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#24	21.70	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#49	21.88	PASS
Band41(2535-2655)	10MHz	16QAM	40640	25RB#0	21.02	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	10MHz	16QAM	40640	25RB#12	21.12	PASS
Band41(2535-2655)	10MHz	16QAM	40640	25RB#25	21.18	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	21.14	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	23.71	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#24	23.69	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	23.81	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#0	22.72	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#12	22.74	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#25	22.72	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	22.75	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	22.63	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#24	22.61	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	22.71	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#0	21.77	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#12	21.78	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#25	21.79	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	21.77	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	22.25	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#38	22.47	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	22.51	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#0	21.44	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#18	21.47	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#37	21.44	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	21.44	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	21.43	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#38	21.67	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	21.79	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#0	21.44	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#18	20.51	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#37	21.44	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	20.45	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#0	23.04	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#38	23.19	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#74	23.24	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#0	22.10	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#18	22.09	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#37	22.09	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	22.09	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#0	21.87	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#38	22.07	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#74	22.04	PASS
Band41(2535-2655)	15MHz	16QAM	40640	38RB#0	22.11	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	15MHz	16QAM	40640	38RB#18	21.09	PASS
Band41(2535-2655)	15MHz	16QAM	40640	38RB#37	22.11	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	21.13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	23.64	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#38	23.76	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	23.79	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#0	22.77	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#18	22.81	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#37	22.80	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	22.81	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	22.58	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#38	22.73	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	22.73	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#0	22.79	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#18	21.84	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#37	22.79	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	21.77	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	22.19	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#49	22.54	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	22.56	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#0	21.39	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#25	21.59	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#50	21.58	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	21.46	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	21.21	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#49	21.64	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	21.64	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#0	20.39	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#25	20.64	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#50	20.66	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	20.51	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#0	22.81	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#49	23.22	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#99	23.11	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#0	22.03	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#25	22.26	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#50	22.29	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	22.11	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#0	21.47	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#49	22.18	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#99	21.75	PASS
Band41(2535-2655)	20MHz	16QAM	40640	50RB#0	21.02	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	20MHz	16QAM	40640	50RB#25	21.29	PASS
Band41(2535-2655)	20MHz	16QAM	40640	50RB#50	21.34	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	21.13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	23.55	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#49	23.80	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	23.84	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#0	22.78	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#25	22.85	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#50	22.73	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	22.78	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	22.22	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#49	22.82	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	22.50	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#0	21.75	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#25	21.80	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#50	21.76	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	21.81	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	4.24	13	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	5.70	13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	5.06	13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	8.76	13	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#0	4.85	13	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	5.96	13	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#0	5.63	13	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	6.59	13	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	4.25	13	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	5.59	13	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	4.94	13	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	8.40	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	4.34	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	5.63	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	5.83	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	6.32	13	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#0	5.58	13	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	5.88	13	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#0	6.11	13	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	6.65	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	4.50	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	5.59	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	5.47	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	6.36	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	4.45	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	6.01	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	5.93	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	6.47	13	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#0	5.72	13	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	6.18	13	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#0	6.24	13	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	6.74	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	4.91	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	5.86	13	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	5.47	13	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	6.42	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	4.71	13	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	5.73	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	5.12	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	6.39	13	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#0	5.17	13	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	5.61	13	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#0	5.81	13	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	6.49	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	4.86	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	5.55	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	5.48	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	6.39	13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

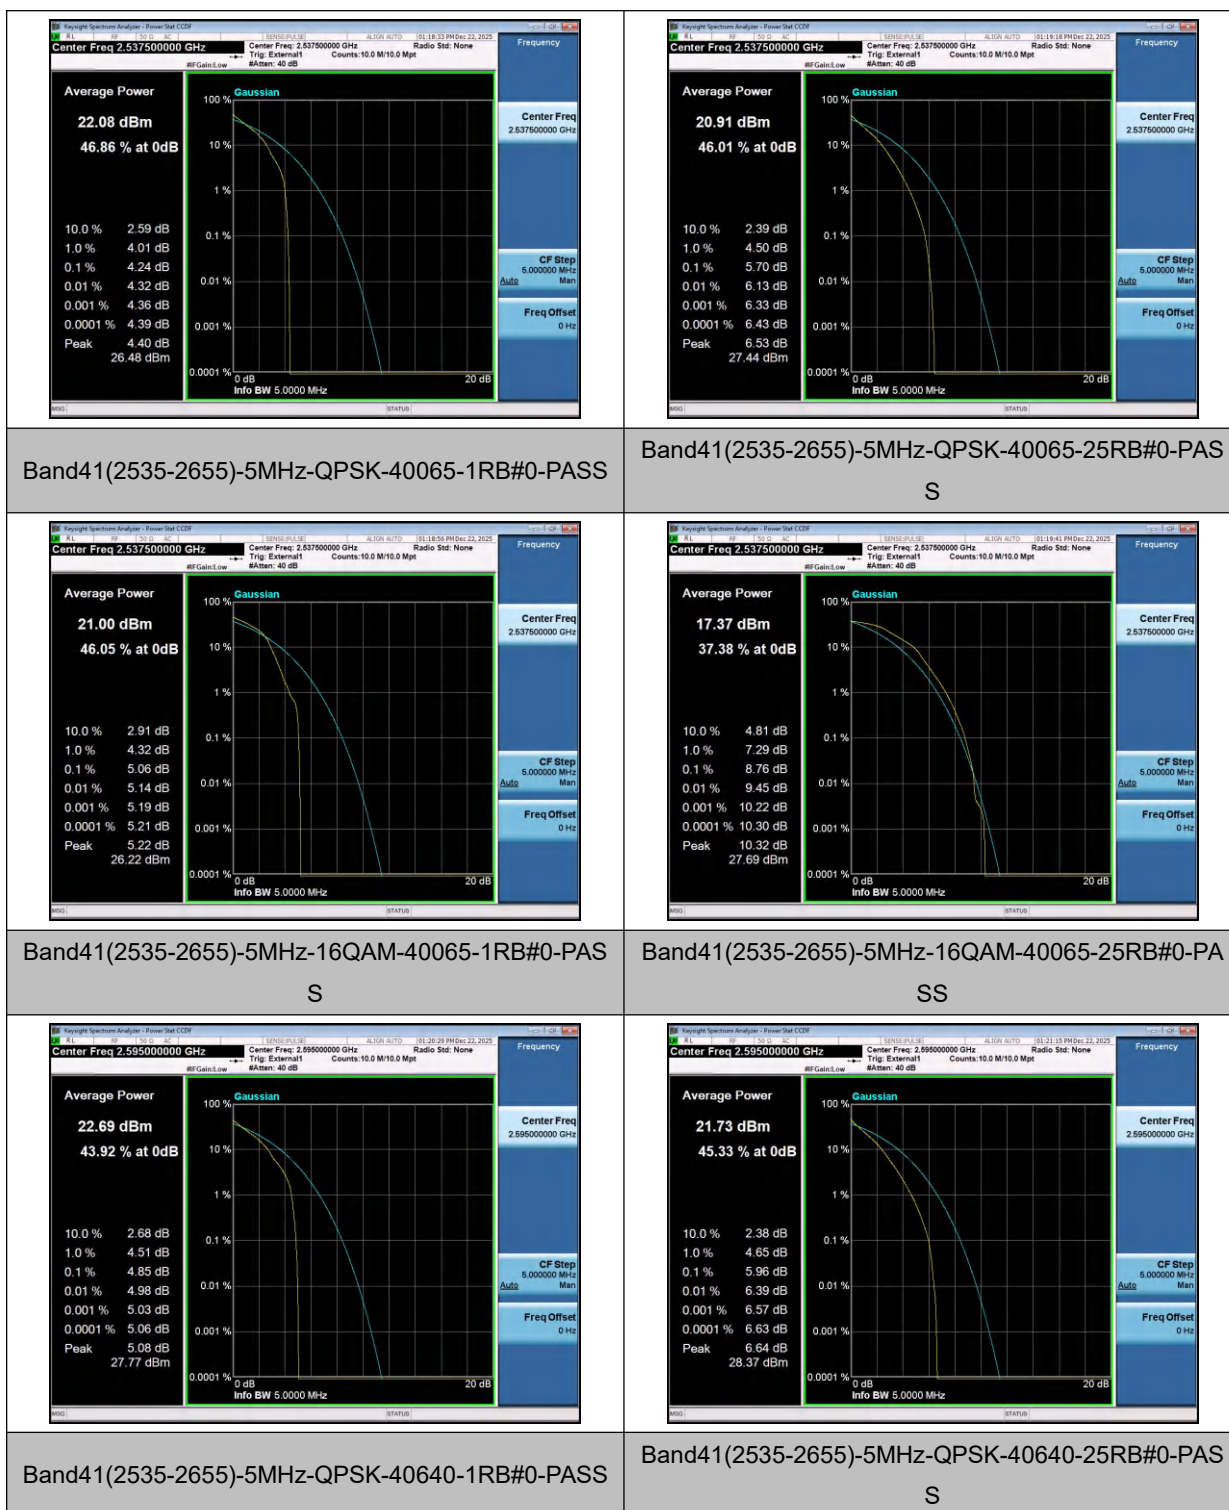


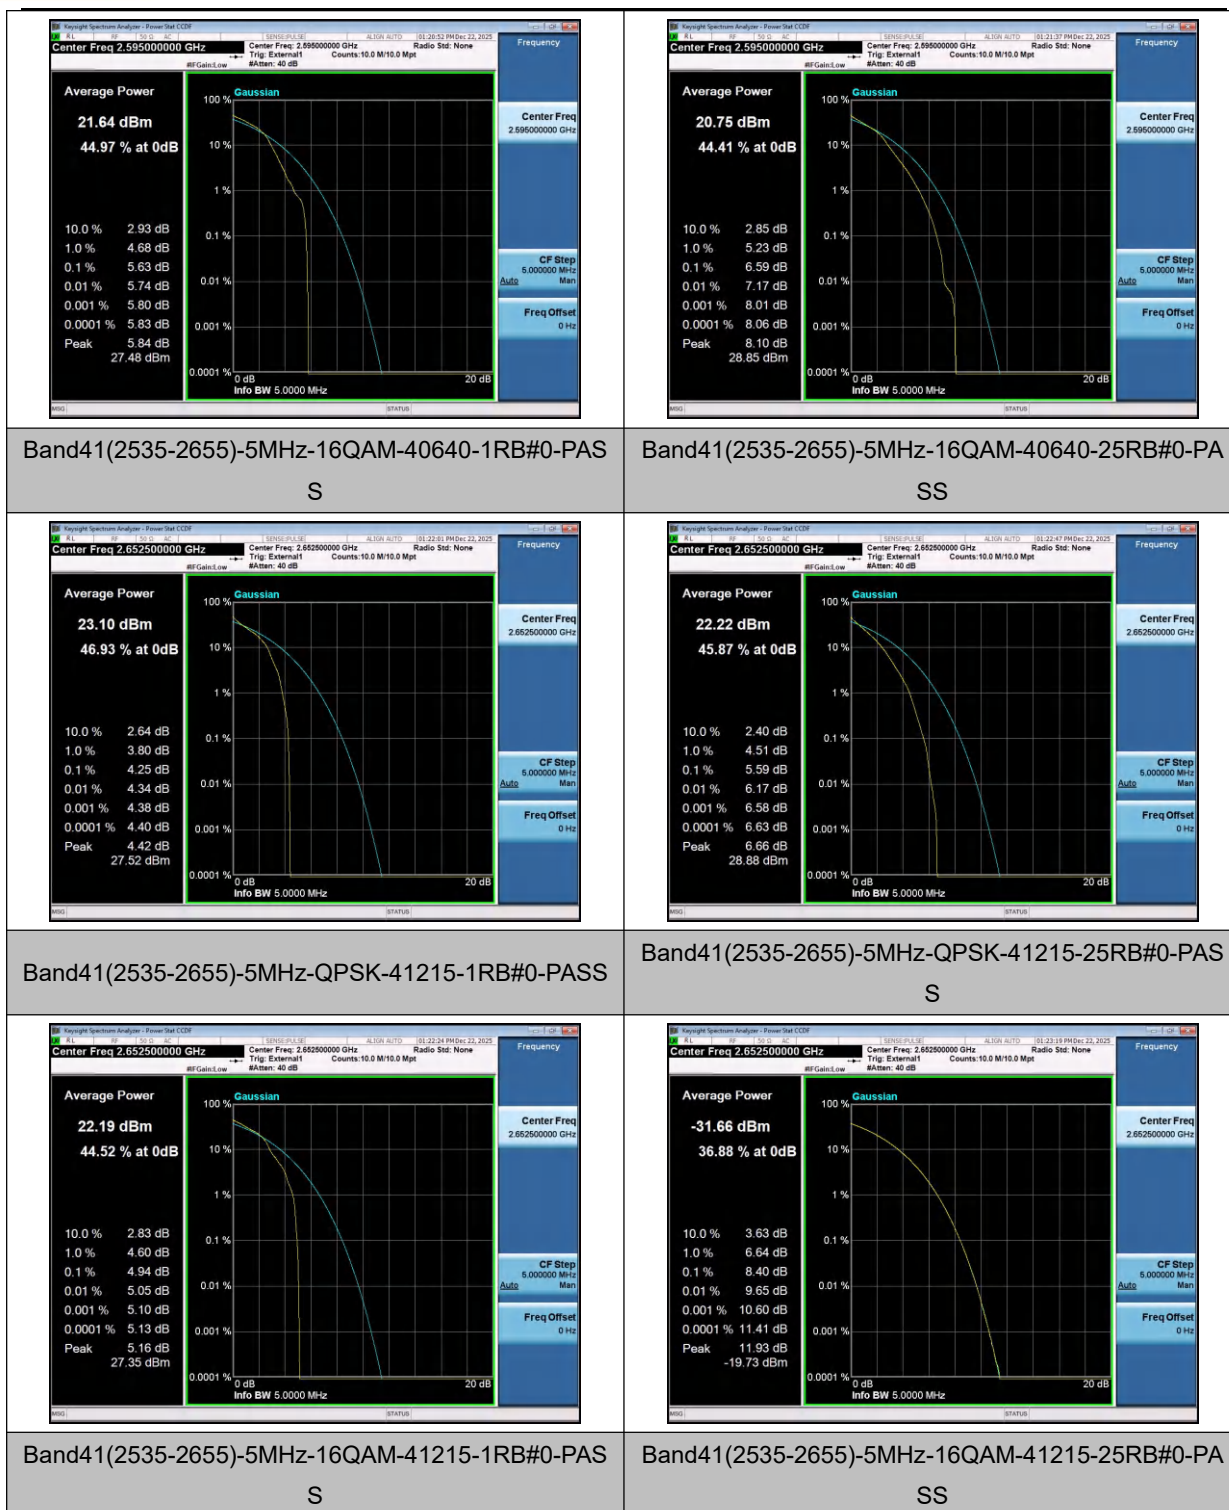


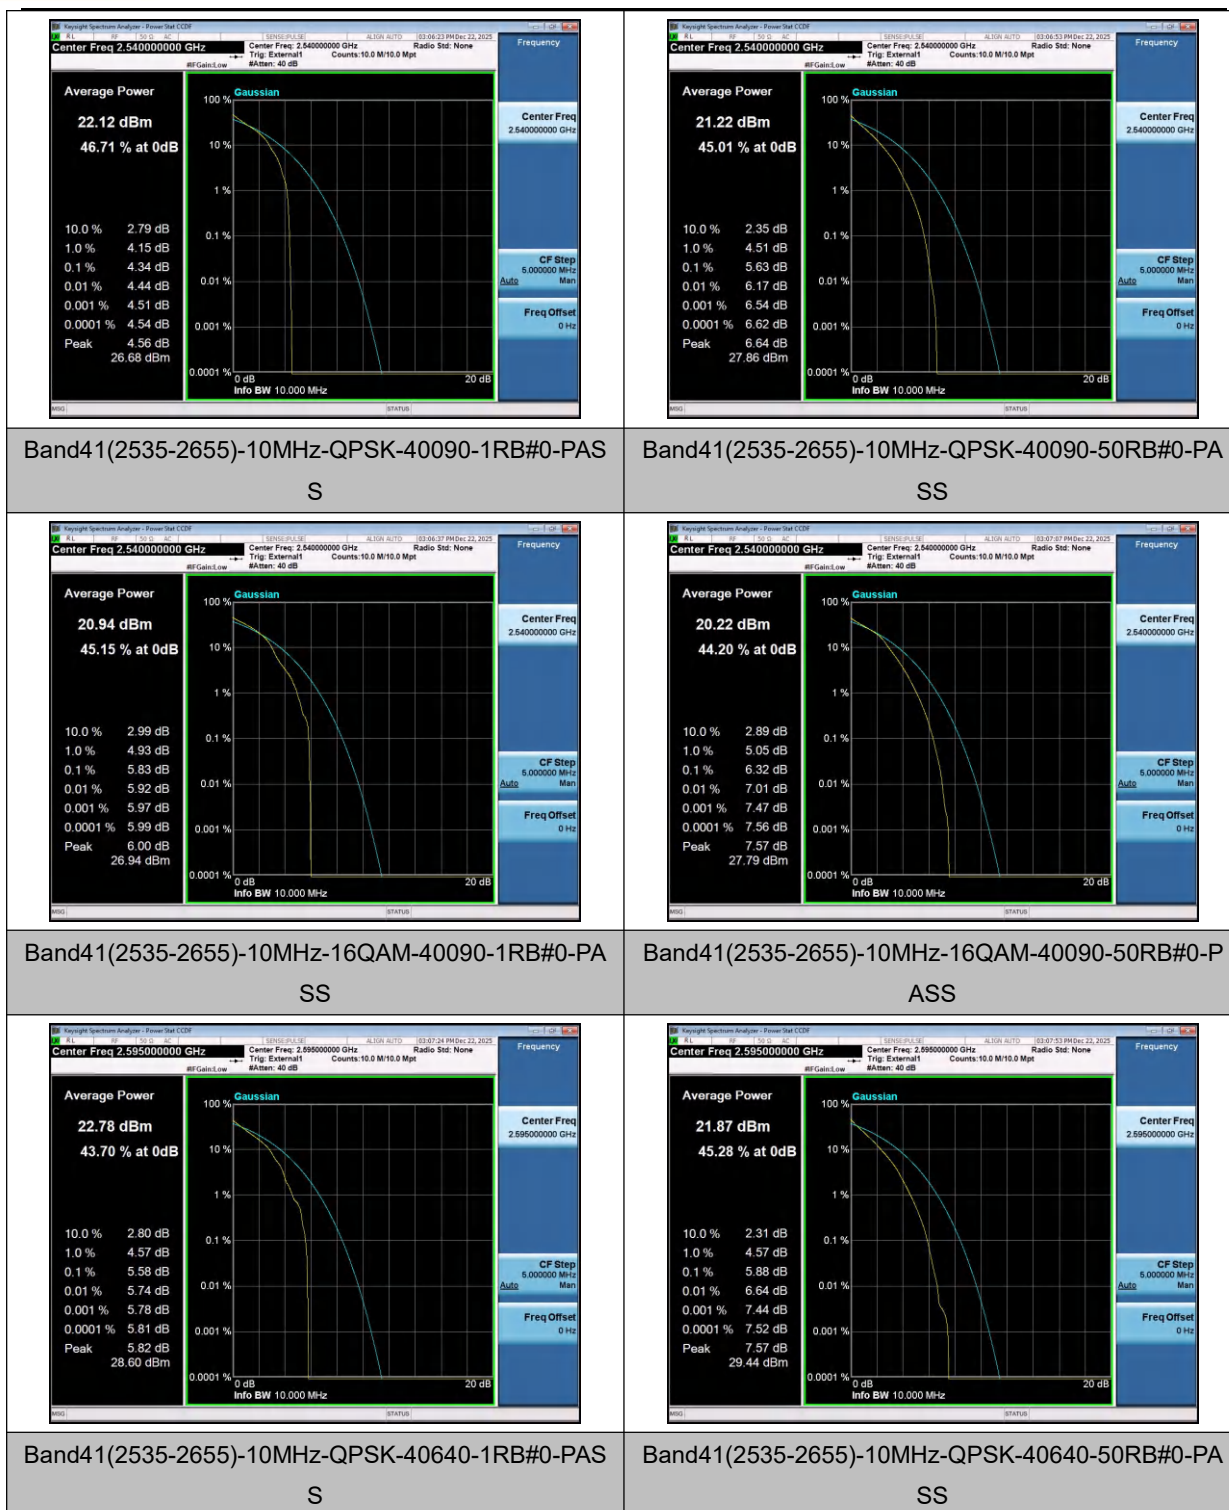


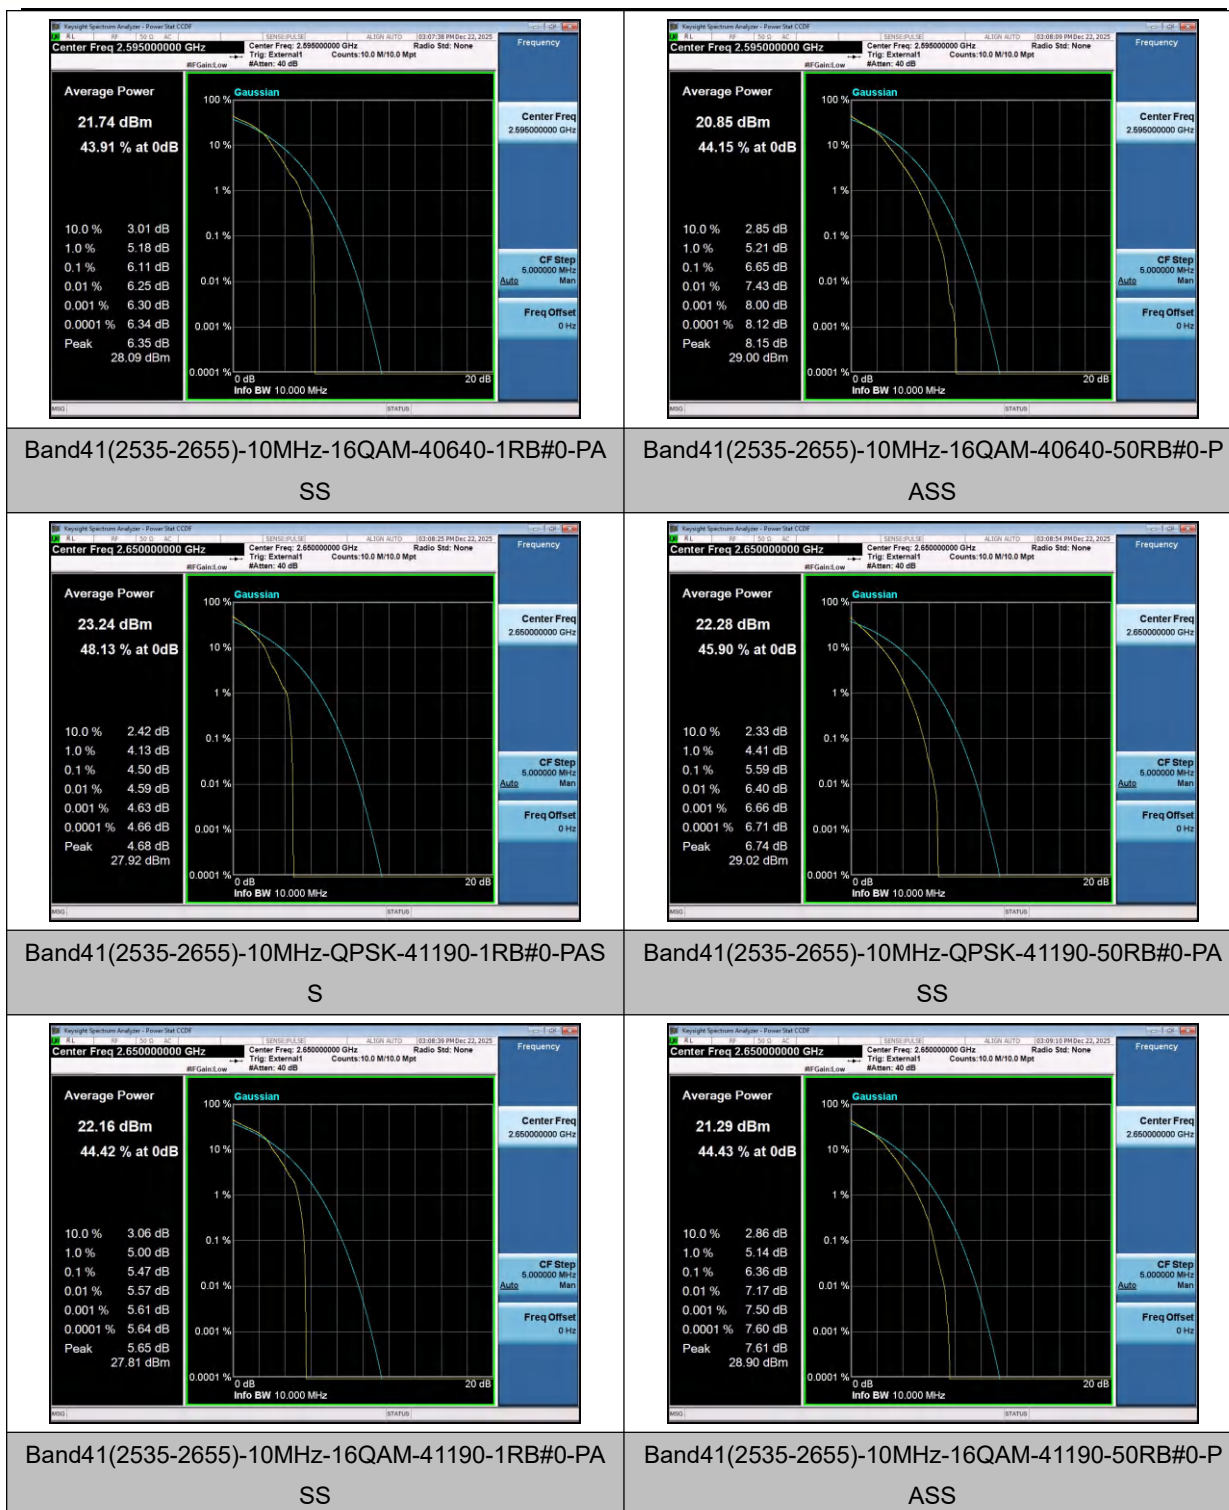

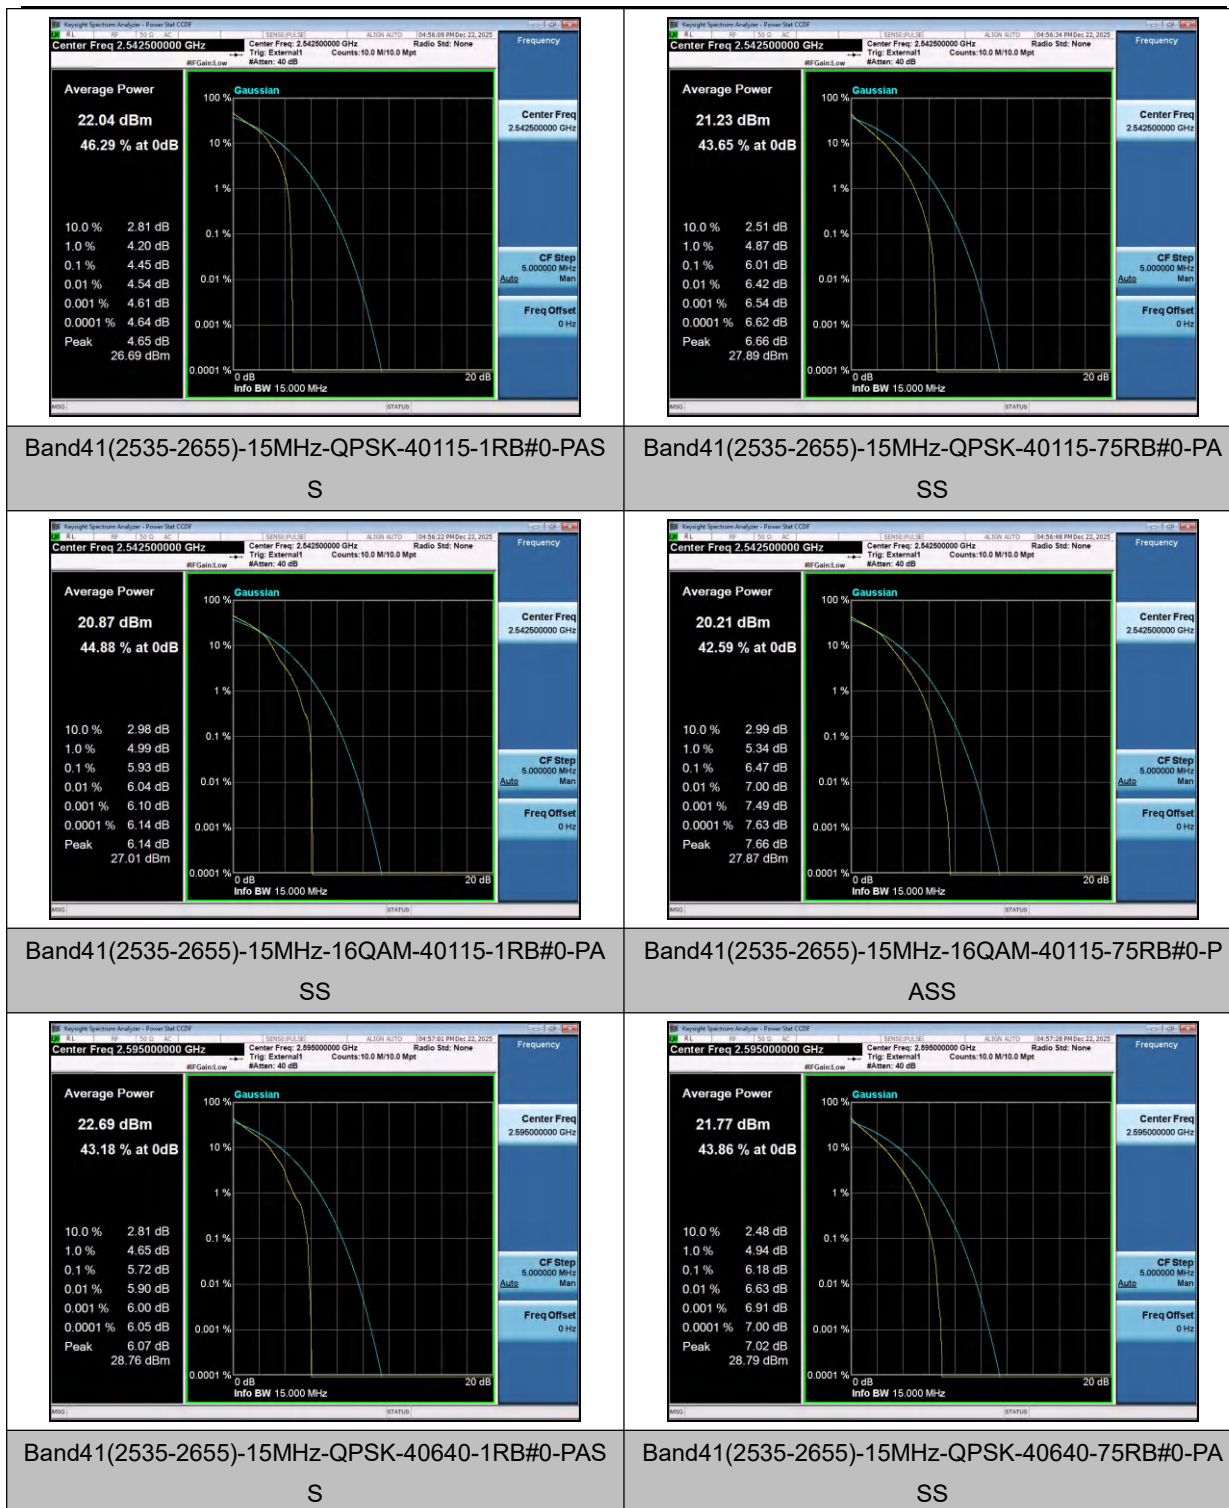

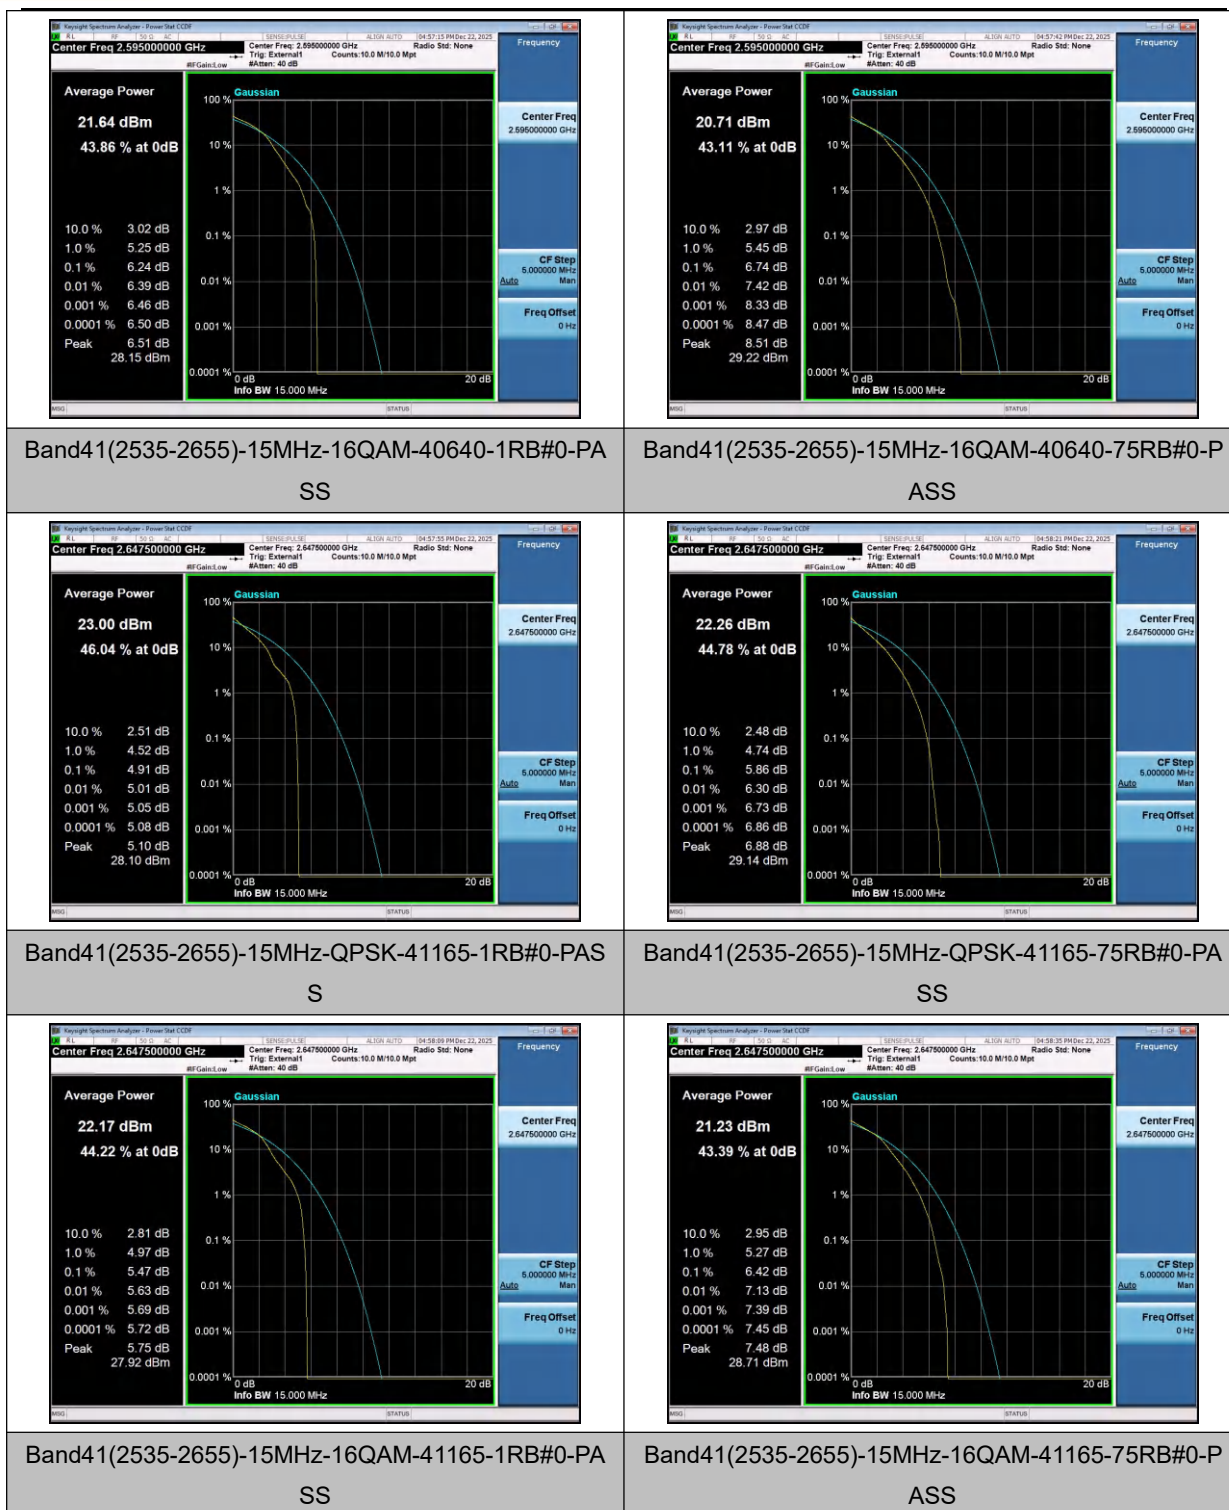

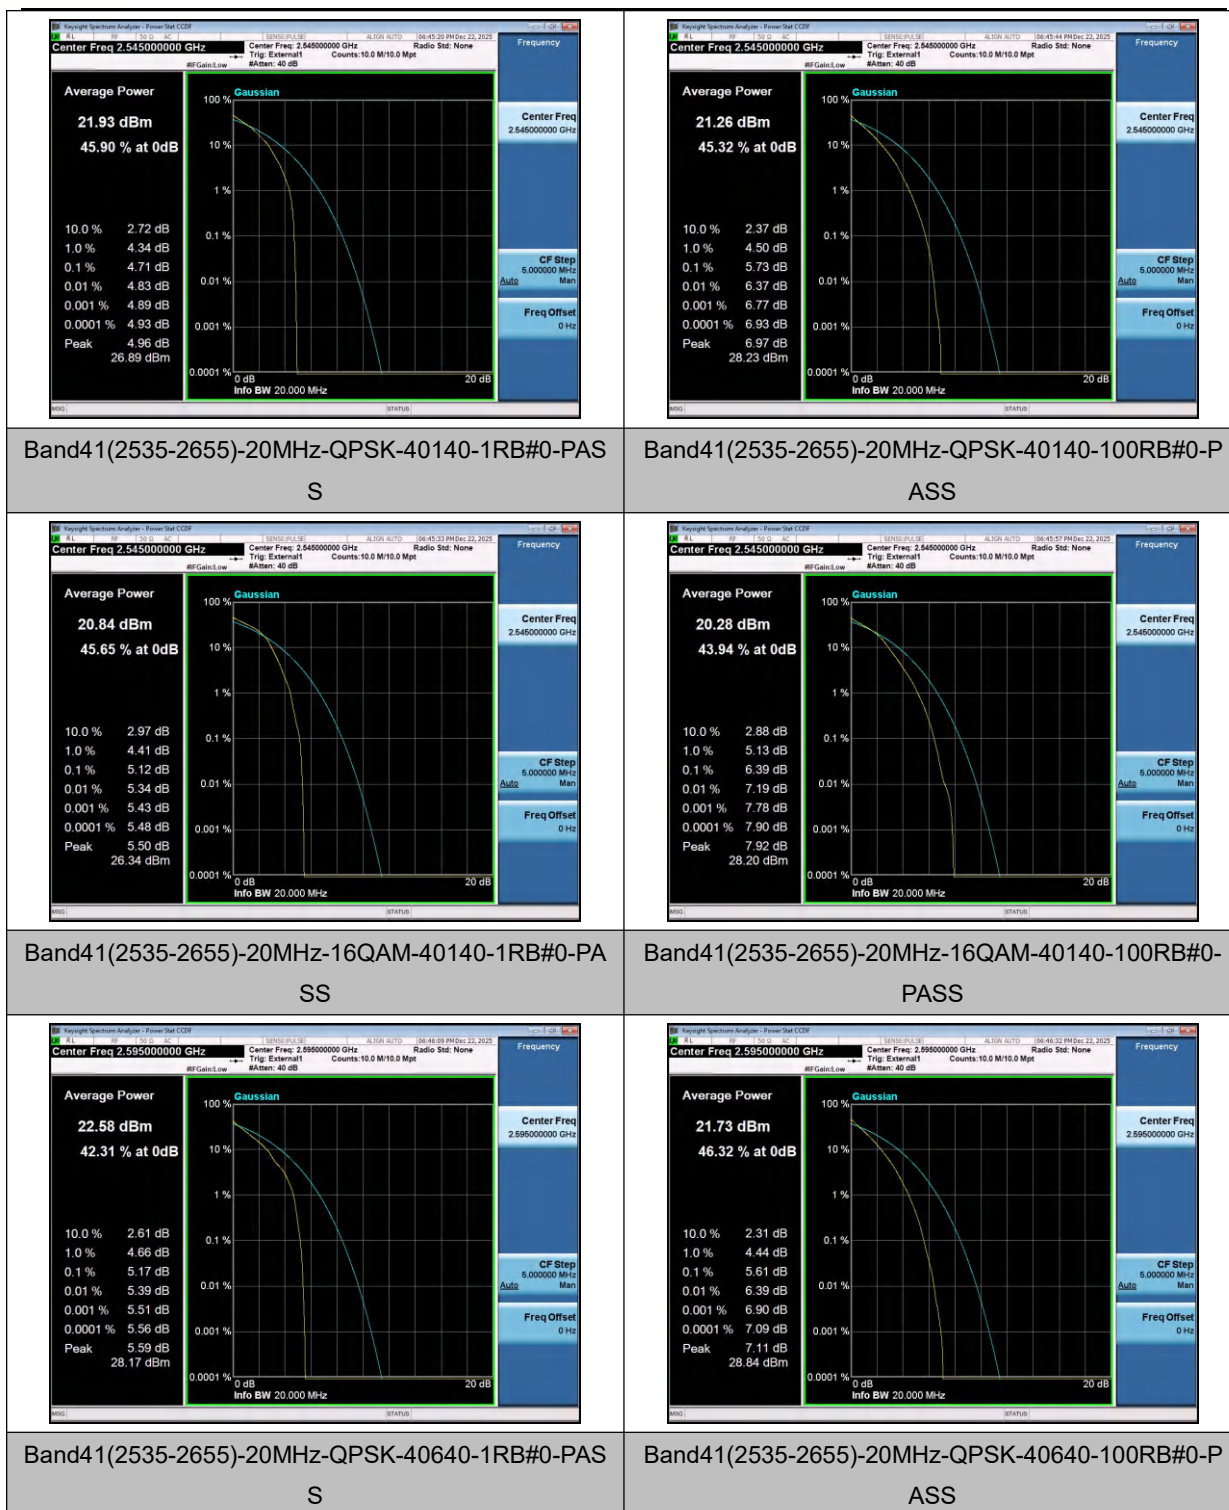

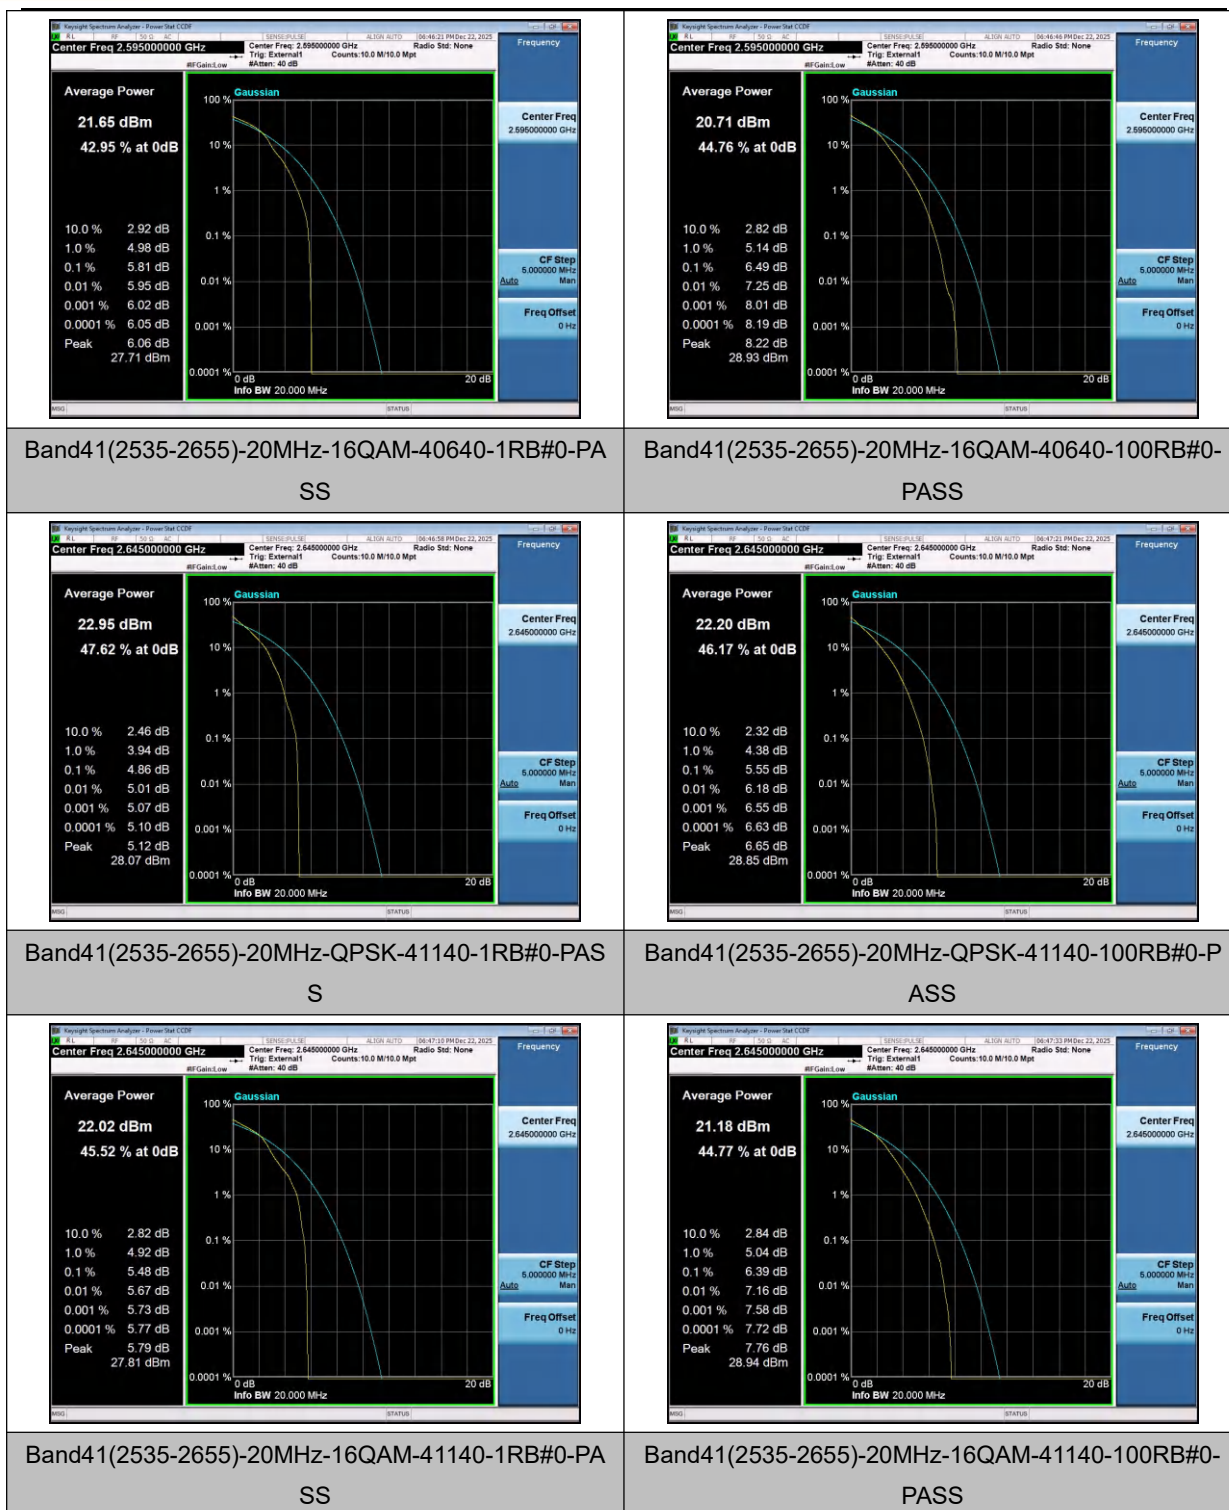


Appendix C: 26dB Bandwidth and Occupied Bandwidth


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	4.4939	4.899	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	4.4918	4.946	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	4.4939	5.033	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	4.4887	4.881	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	4.5006	4.892	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	4.4876	4.898	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	8.9877	9.714	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	8.9747	9.708	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	8.9812	9.664	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	8.9659	10.54	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	8.9711	9.771	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	8.9575	9.710	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	13.472	14.61	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	13.452	14.58	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	13.409	14.61	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	13.483	15.01	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	13.433	14.58	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	13.515	14.76	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	17.965	19.22	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	17.902	19.45	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	17.907	19.29	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	17.888	19.24	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	17.924	19.22	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	17.924	19.55	PASS

Test Graphs

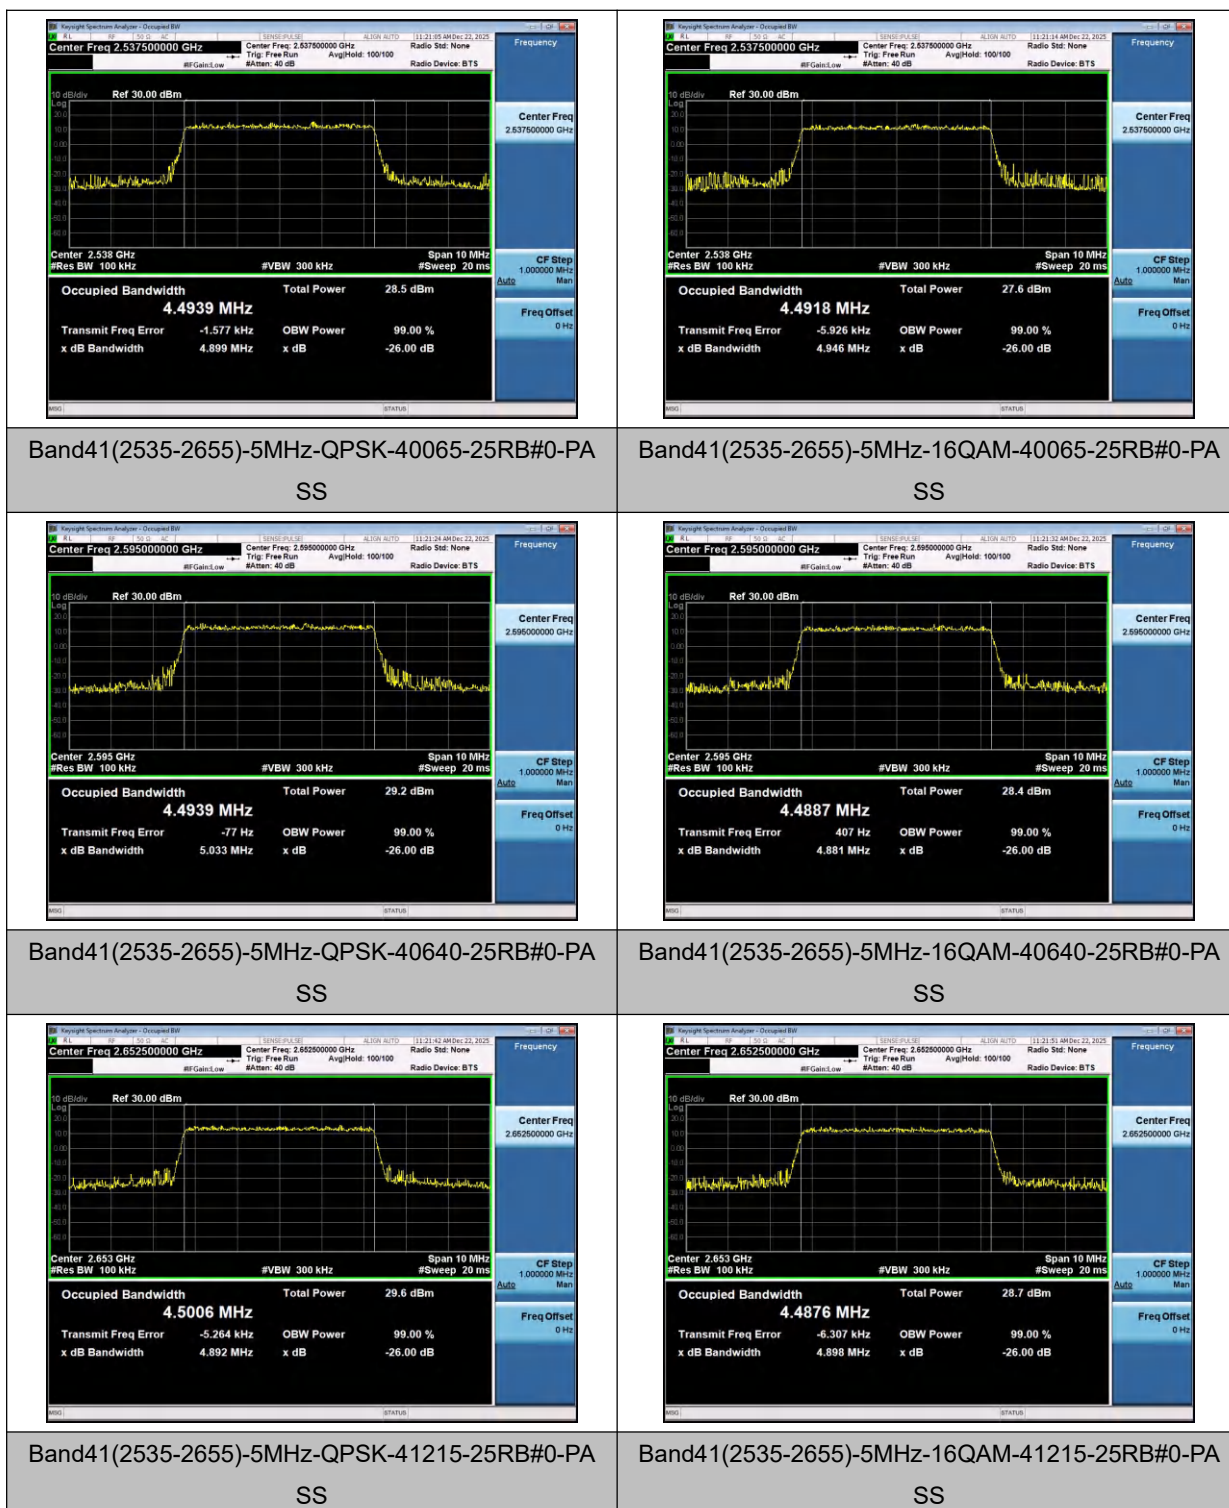




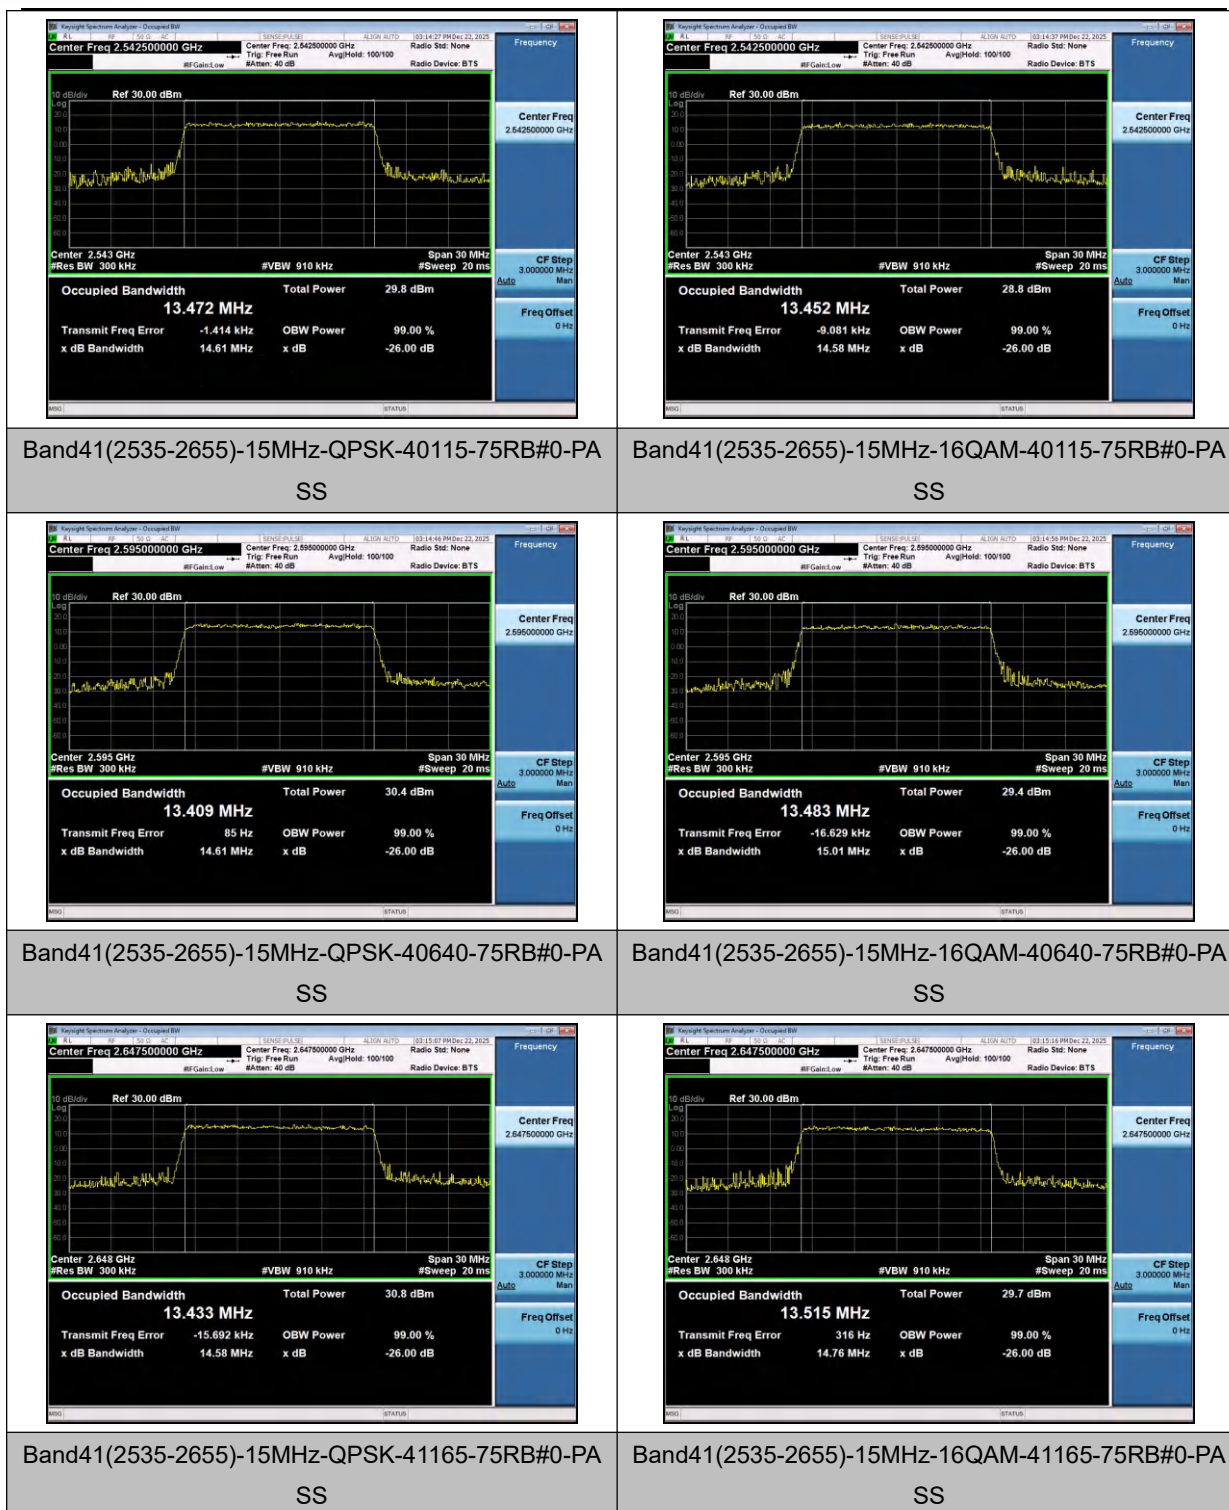


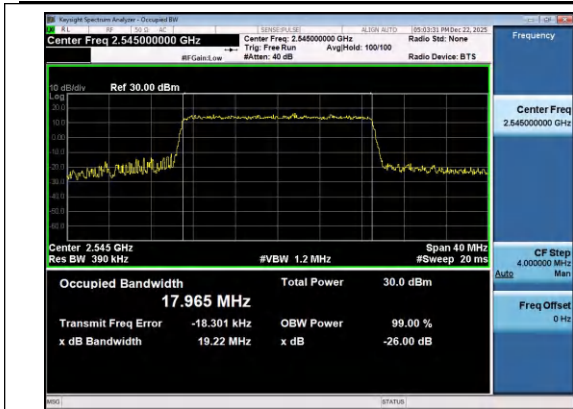


Band41(2535-2655)-20MHz-QPSK-40140-100RB#0-P
ASS

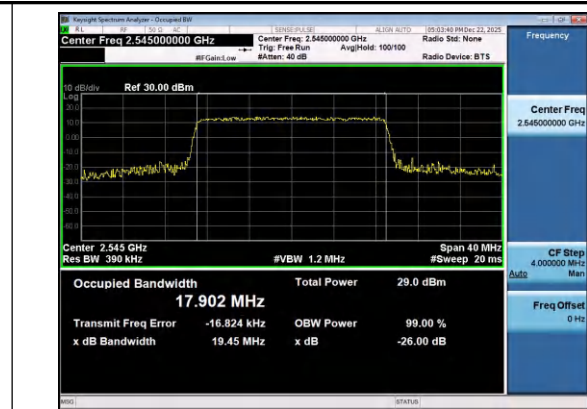


Band41(2535-2655)-20MHz-16QAM-40140-100RB#0-P
ASS

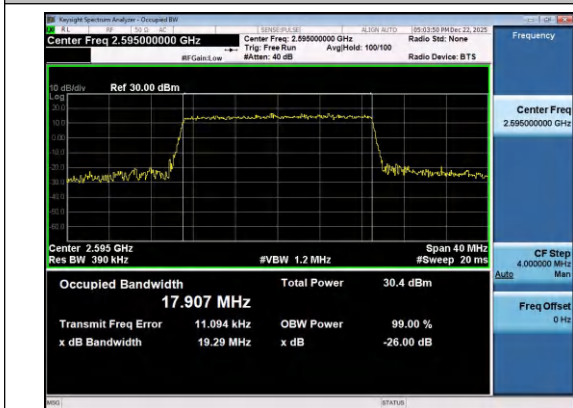


Band41(2535-2655)-20MHz-QPSK-40640-100RB#0-P
ASS

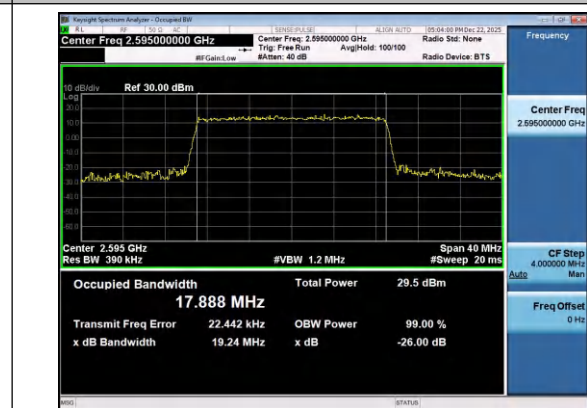

Band41(2535-2655)-20MHz-16QAM-40640-100RB#0-P
ASS

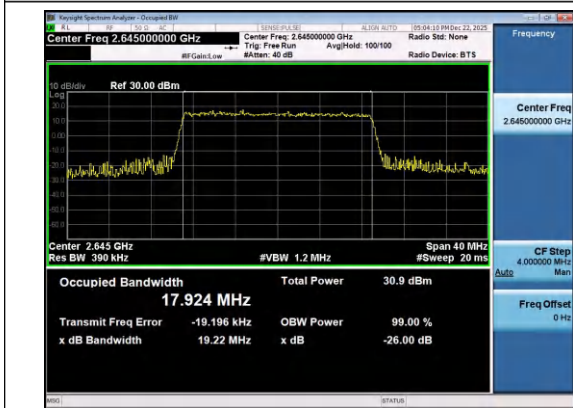

Band41(2535-2655)-20MHz-QPSK-41140-100RB#0-P
ASS

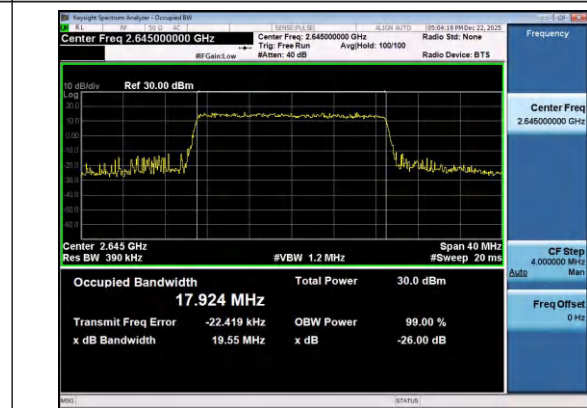

Band41(2535-2655)-20MHz-16QAM-41140-100RB#0-P
ASS

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Margin (dB)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	-27.98	17.98	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	-44.89	19.89	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	-39.75	14.75	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	-44.61	19.61	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	-44.86	19.86	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	-41.40	16.40	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	-40.63	15.63	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	-24.36	14.36	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	-34.15	9.15	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	-40.62	15.62	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	-40.22	15.22	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	-36.07	11.07	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	-43.64	18.64	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	-44.67	19.67	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	-41.04	16.04	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	-43.91	18.91	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	-44.58	19.58	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	-41.66	16.66	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	-40.40	15.40	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	-39.95	14.95	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	-35.69	10.69	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	-40.36	15.36	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	-40.22	15.22	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	-36.51	11.51	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	-44.75	19.75	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	-44.48	19.48	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	-41.33	16.33	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	-44.53	19.53	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	-44.65	19.65	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	-42.08	17.08	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	-40.38	15.38	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	-40.24	15.24	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	-36.48	11.48	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	-40.36	15.36	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	-40.28	15.28	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	-37.01	12.01	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	-44.80	19.80	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	-45.07	20.07	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	-43.75	18.75	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	-45.05	20.05	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	-45.07	20.07	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	-43.69	18.69	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	-40.37	15.37	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	-40.33	15.33	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	-38.11	13.11	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	-40.42	15.42	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	-40.38	15.38	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	-38.11	13.11	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

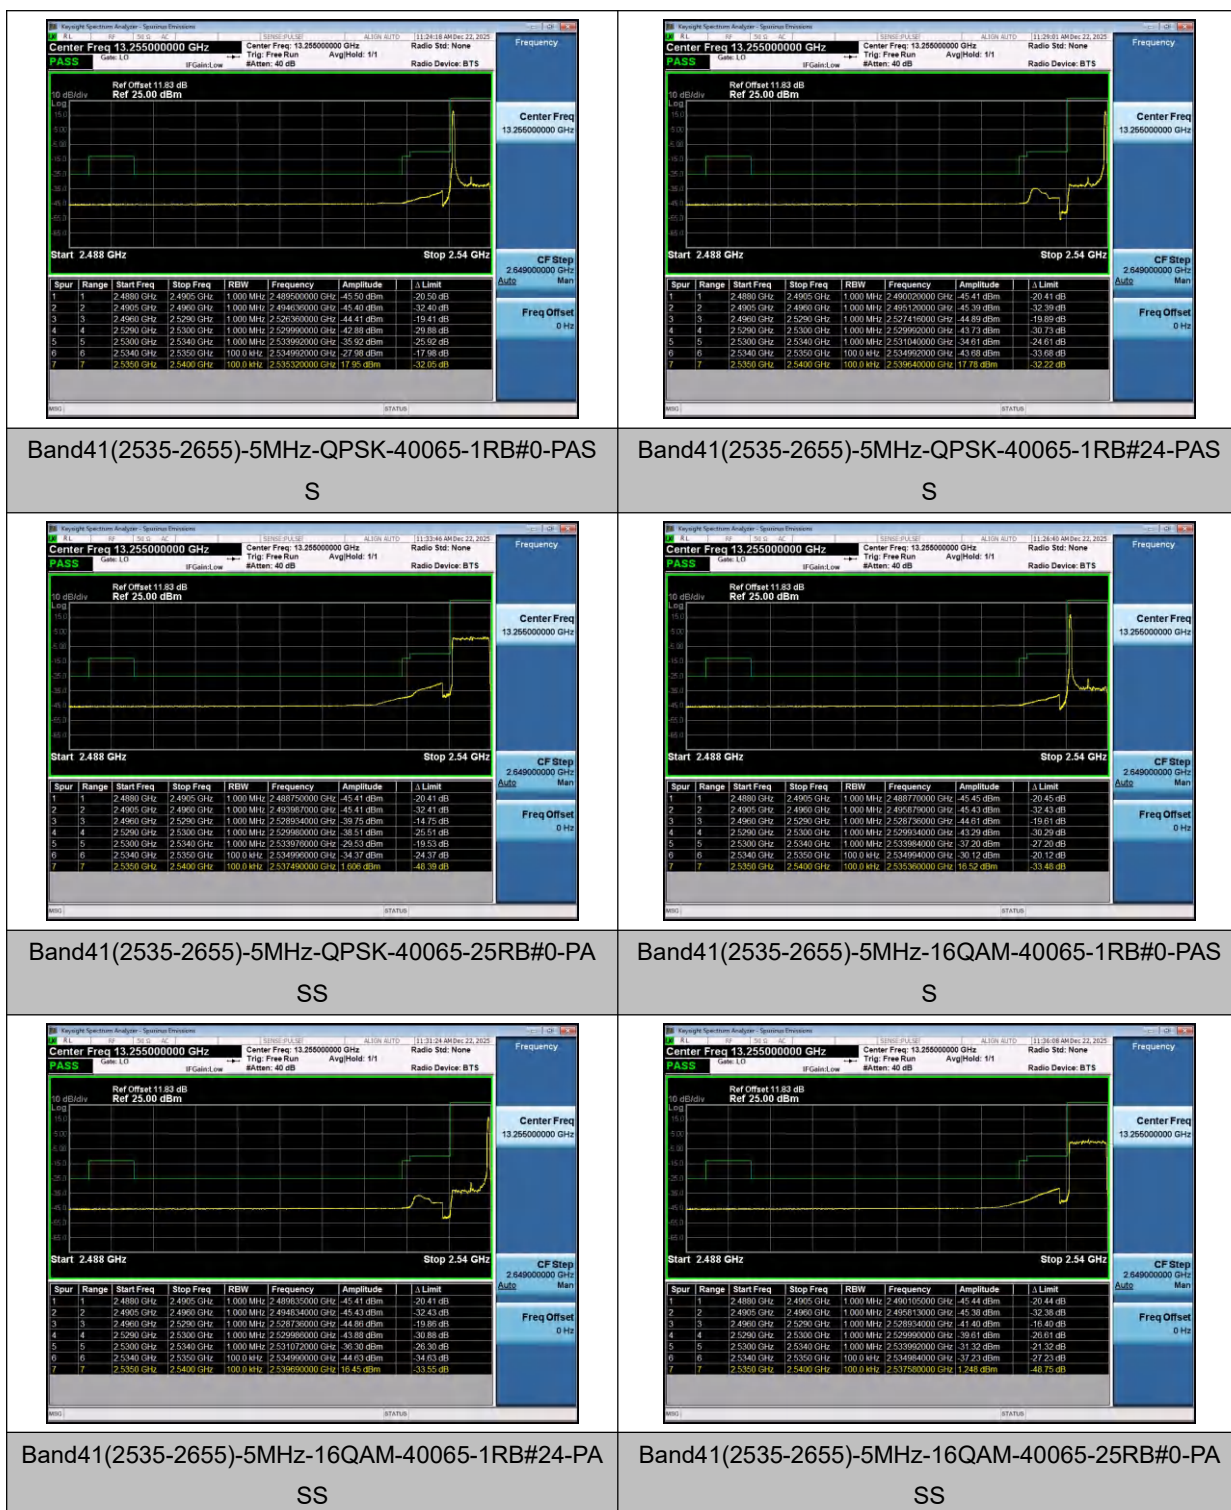



Band41(2535-2655)-5MHz-QPSK-41215-1RB#0-PAS

S



Band41(2535-2655)-5MHz-QPSK-41215-1RB#24-PAS

S



Band41(2535-2655)-5MHz-QPSK-41215-25RB#0-PA

SS



Band41(2535-2655)-5MHz-16QAM-41215-1RB#0-PAS

S




Band41(2535-2655)-5MHz-16QAM-41215-1RB#24-PA

SS




Band41(2535-2655)-5MHz-16QAM-41215-25RB#0-PA

SS

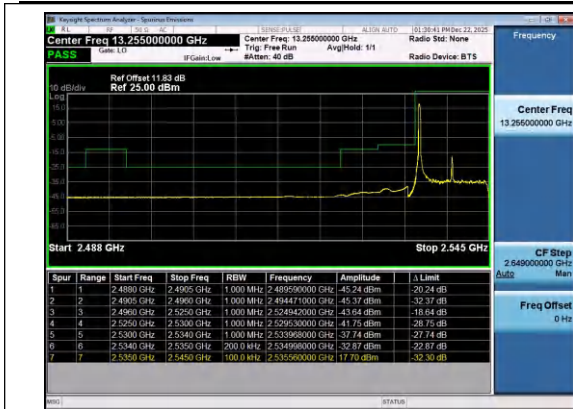

Band41(2535-2655)-10MHz-QPSK-40090-1RB#0-PA

SS

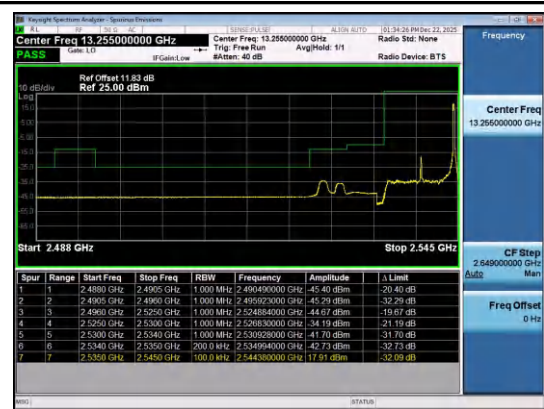


Band41(2535-2655)-10MHz-QPSK-40090-1RB#49-PA

SS




Band41(2535-2655)-10MHz-QPSK-40090-50RB#0-PA

SS

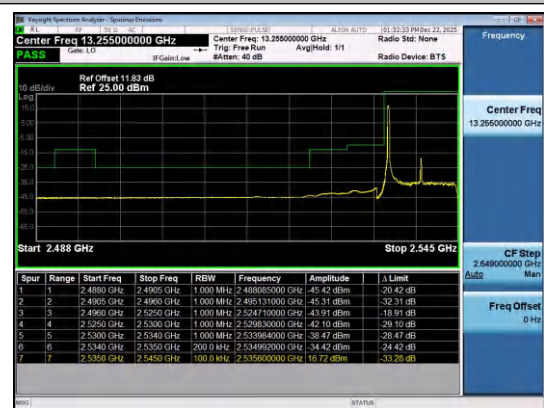


Band41(2535-2655)-10MHz-16QAM-40090-1RB#0-PA

SS

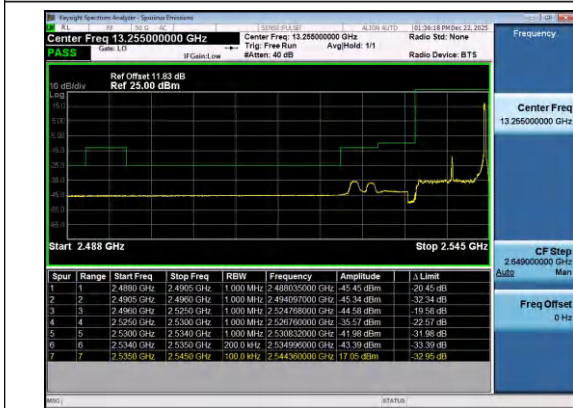

Band41(2535-2655)-10MHz-16QAM-40090-1RB#49-P

ASS

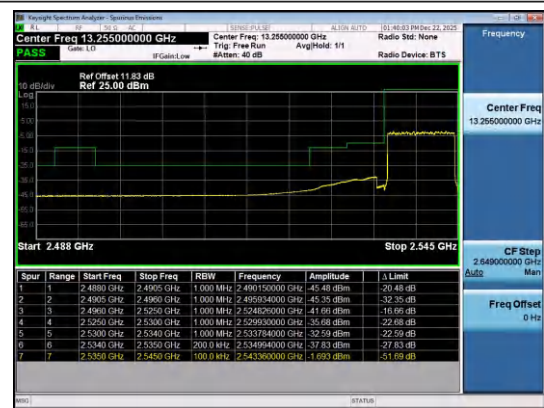

Band41(2535-2655)-10MHz-16QAM-40090-50RB#0-P

ASS