




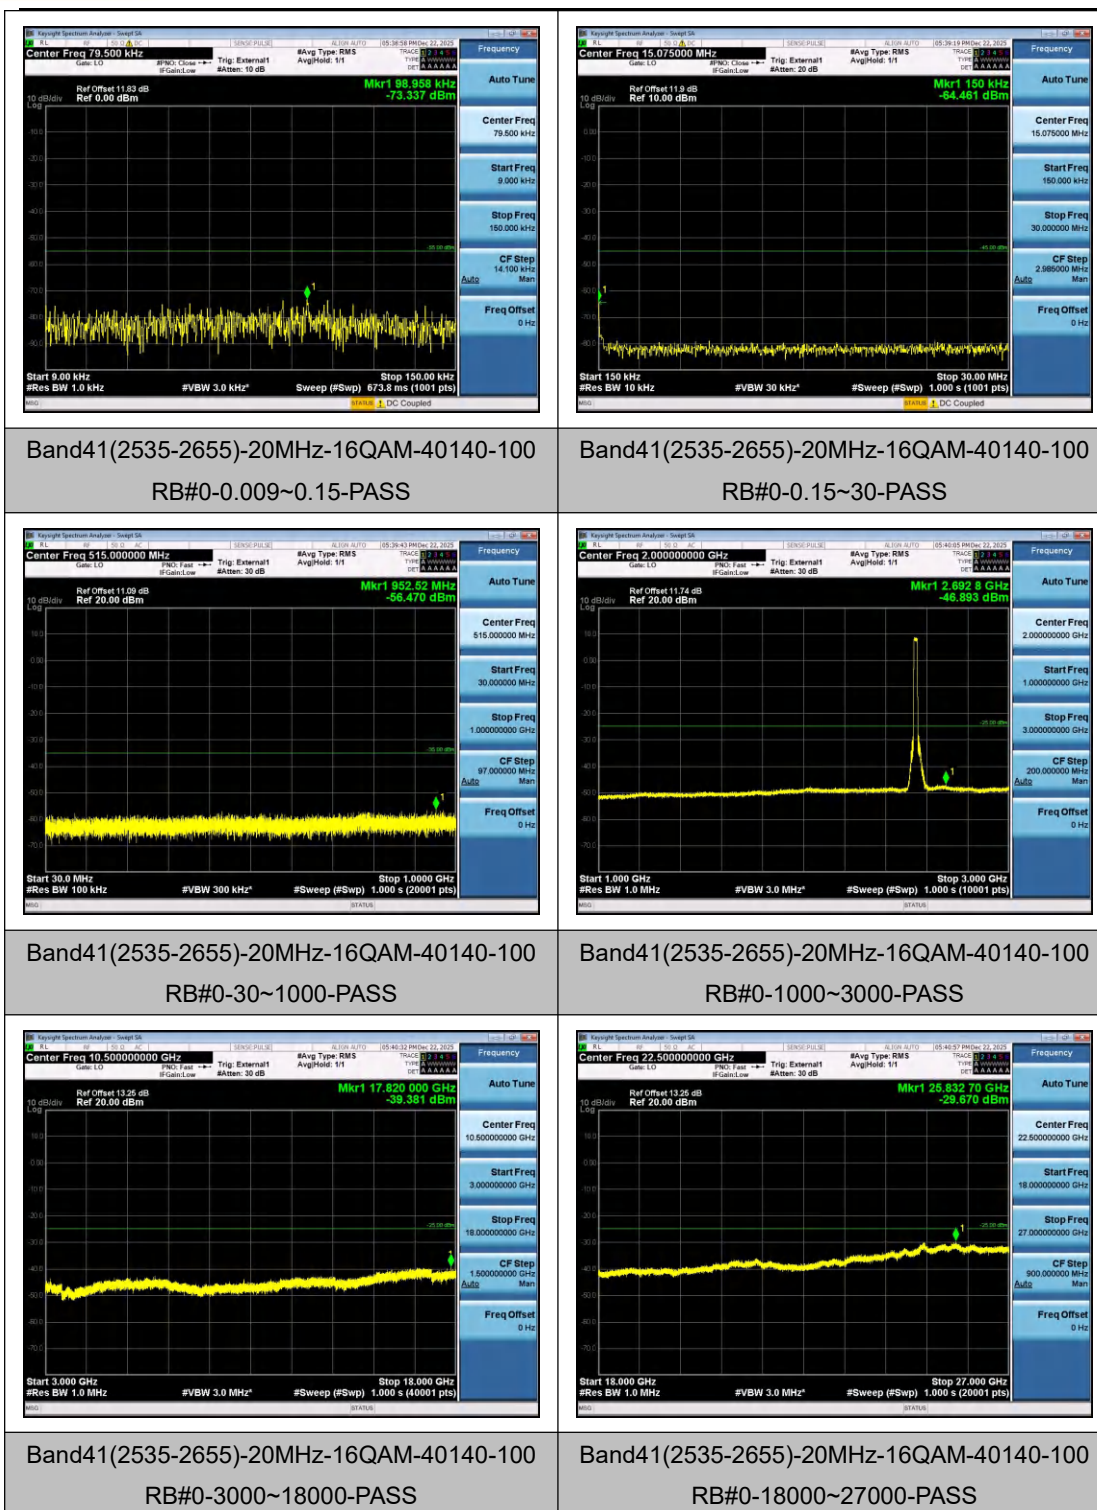


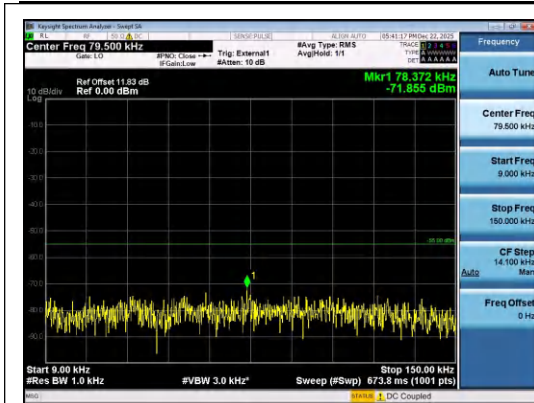


Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-0.009~0.15-PASS

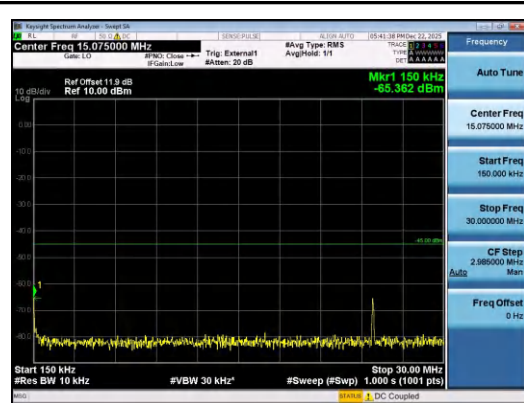


Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-0.15~30-PASS

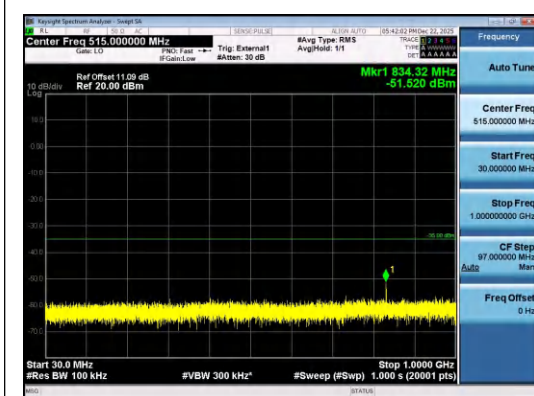


Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-30~1000-PASS

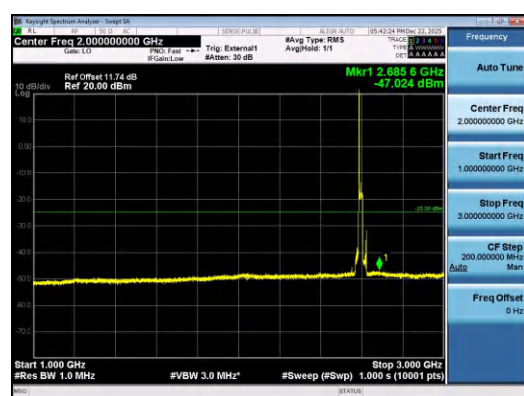


Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-1000~3000-PASS

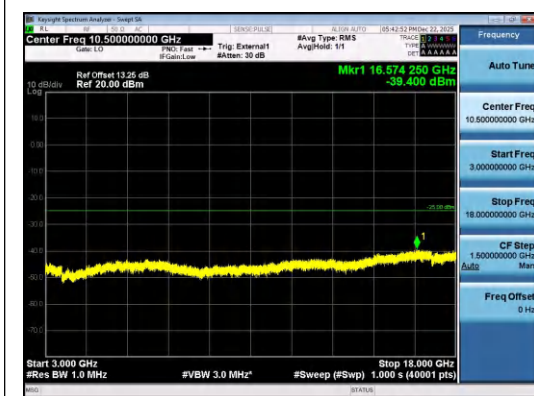



Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-3000~18000-PASS

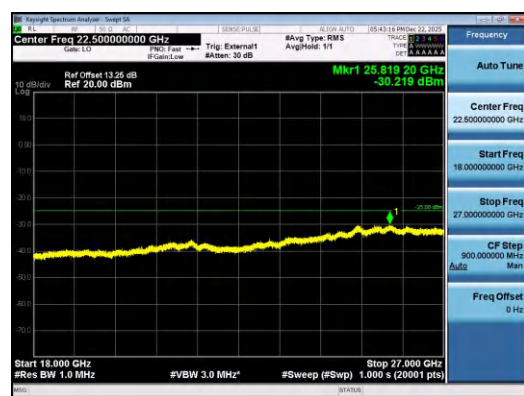



Band41(2535-2655)-20MHz-QPSK-40640-1RB#
0-18000~27000-PASS

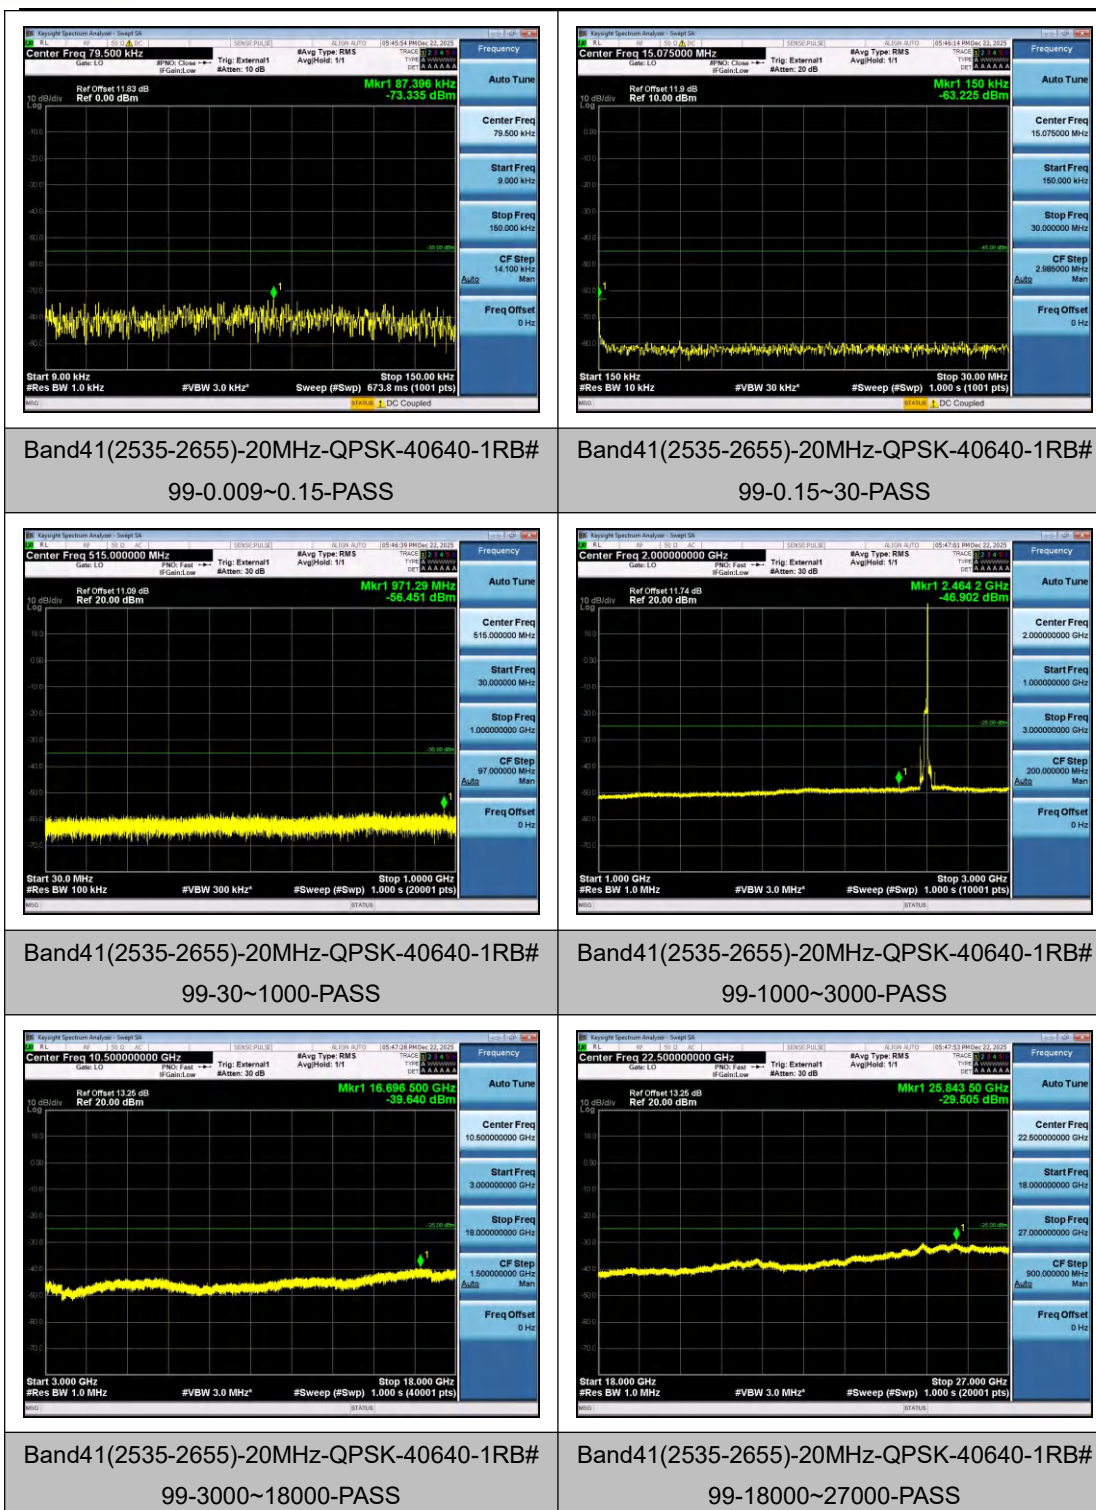


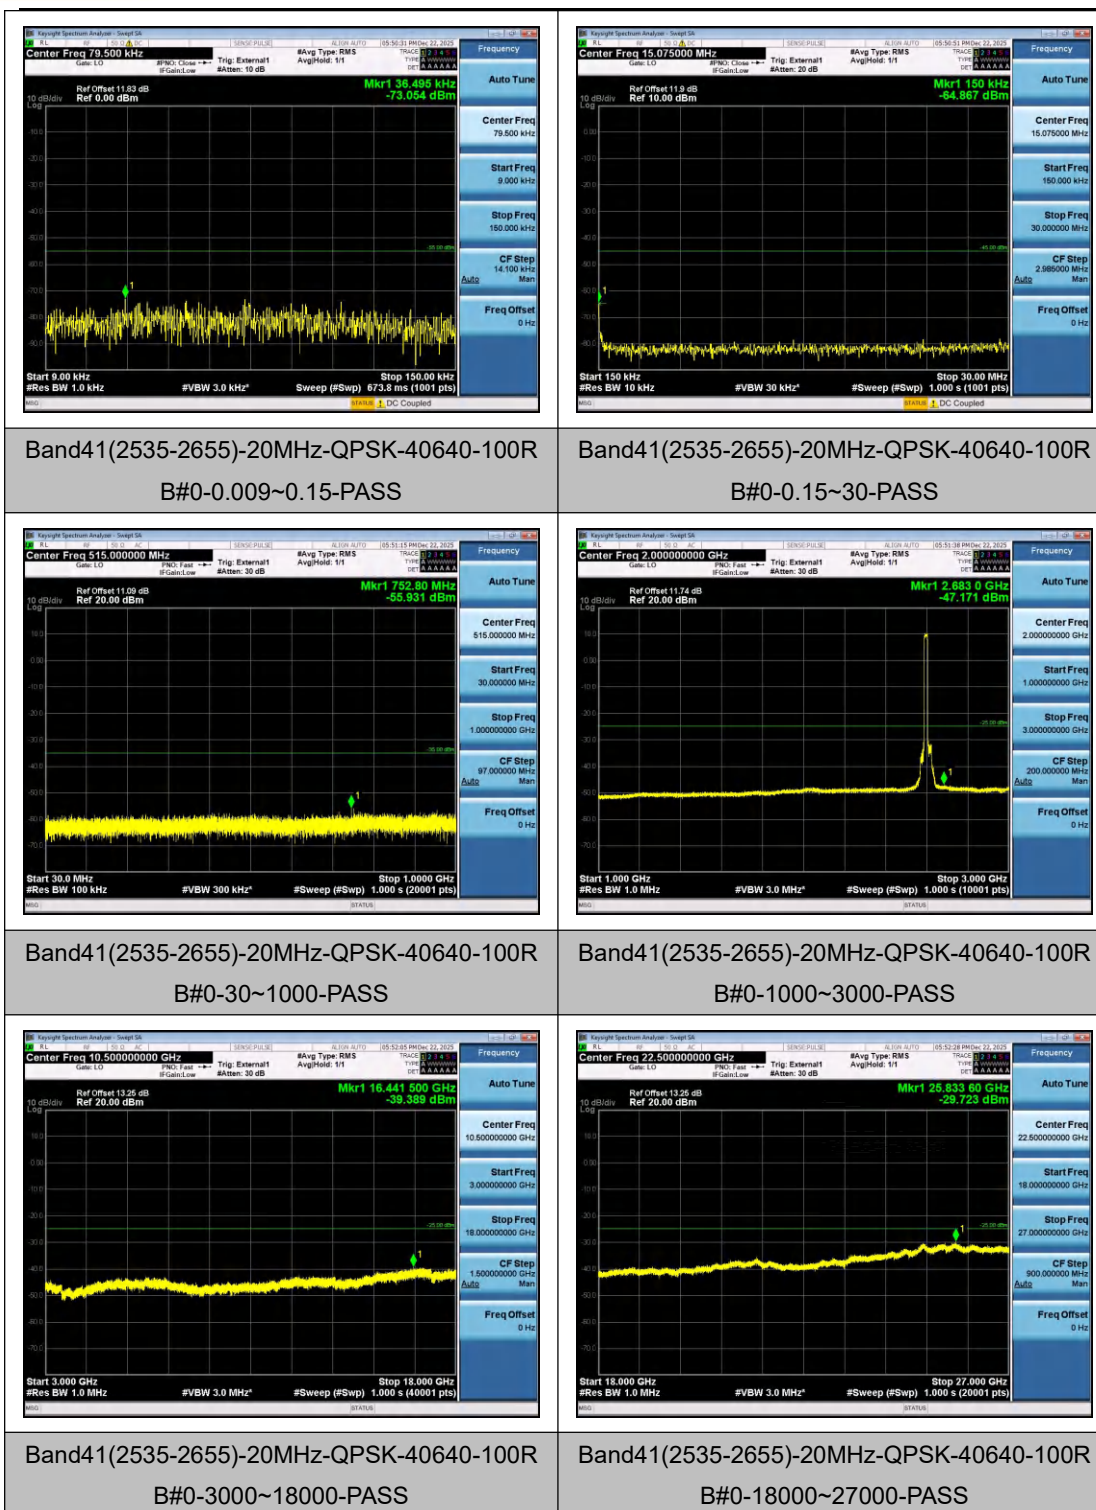


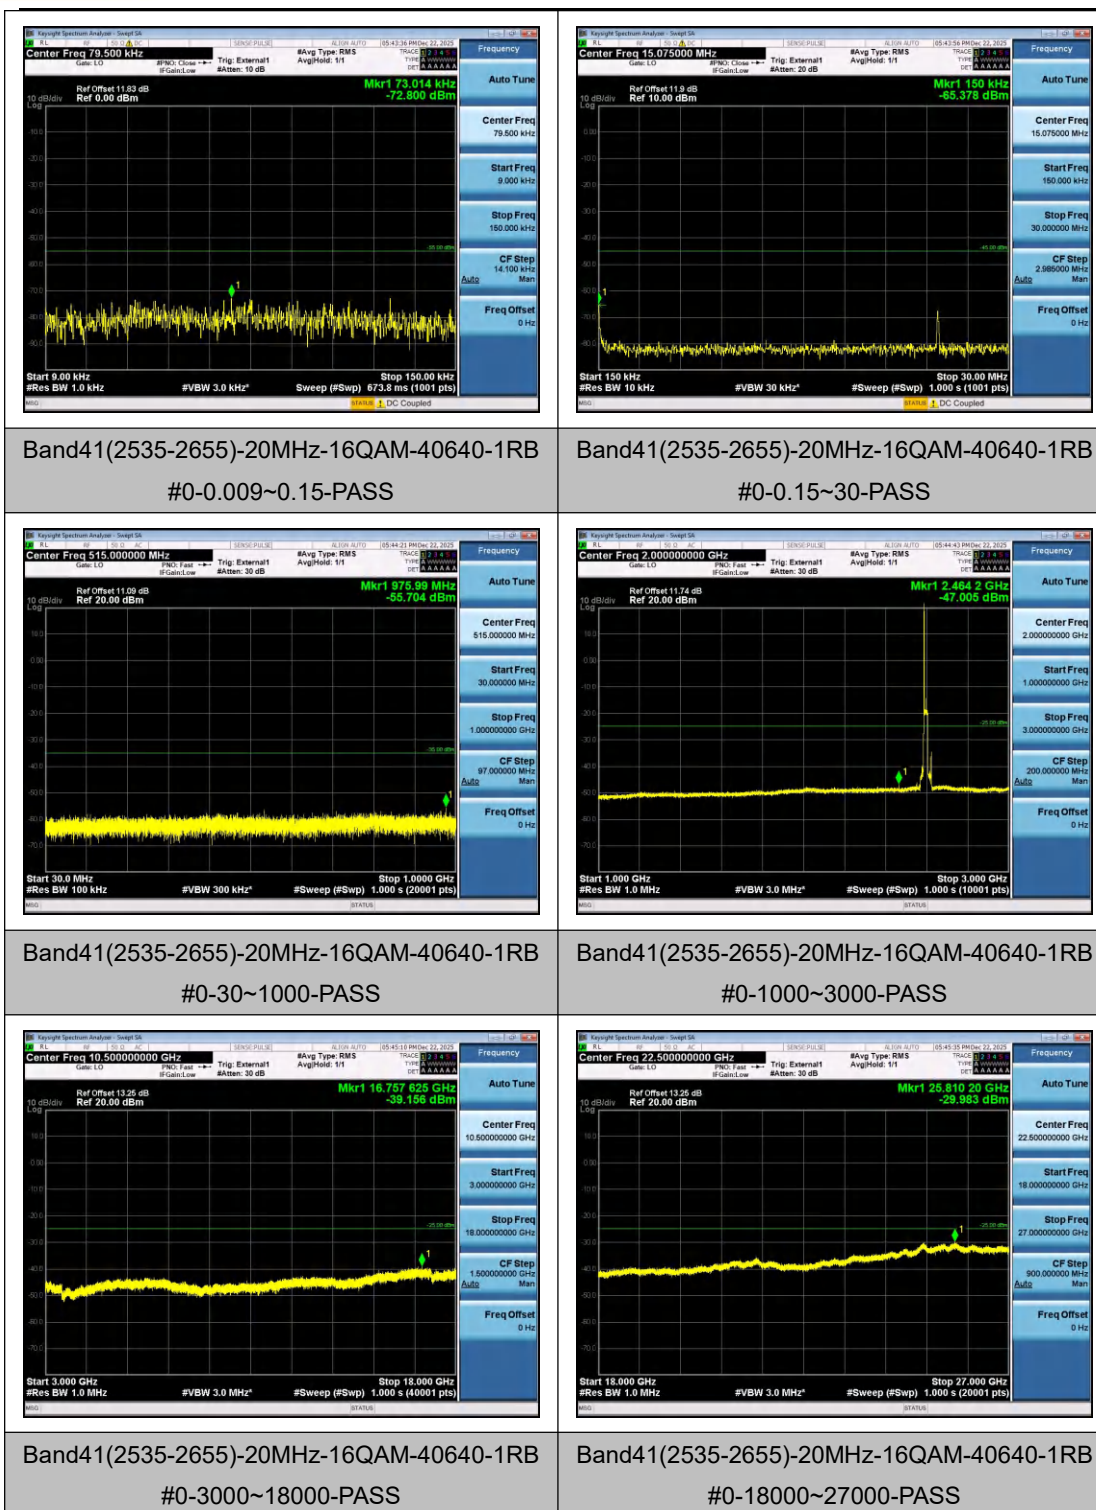


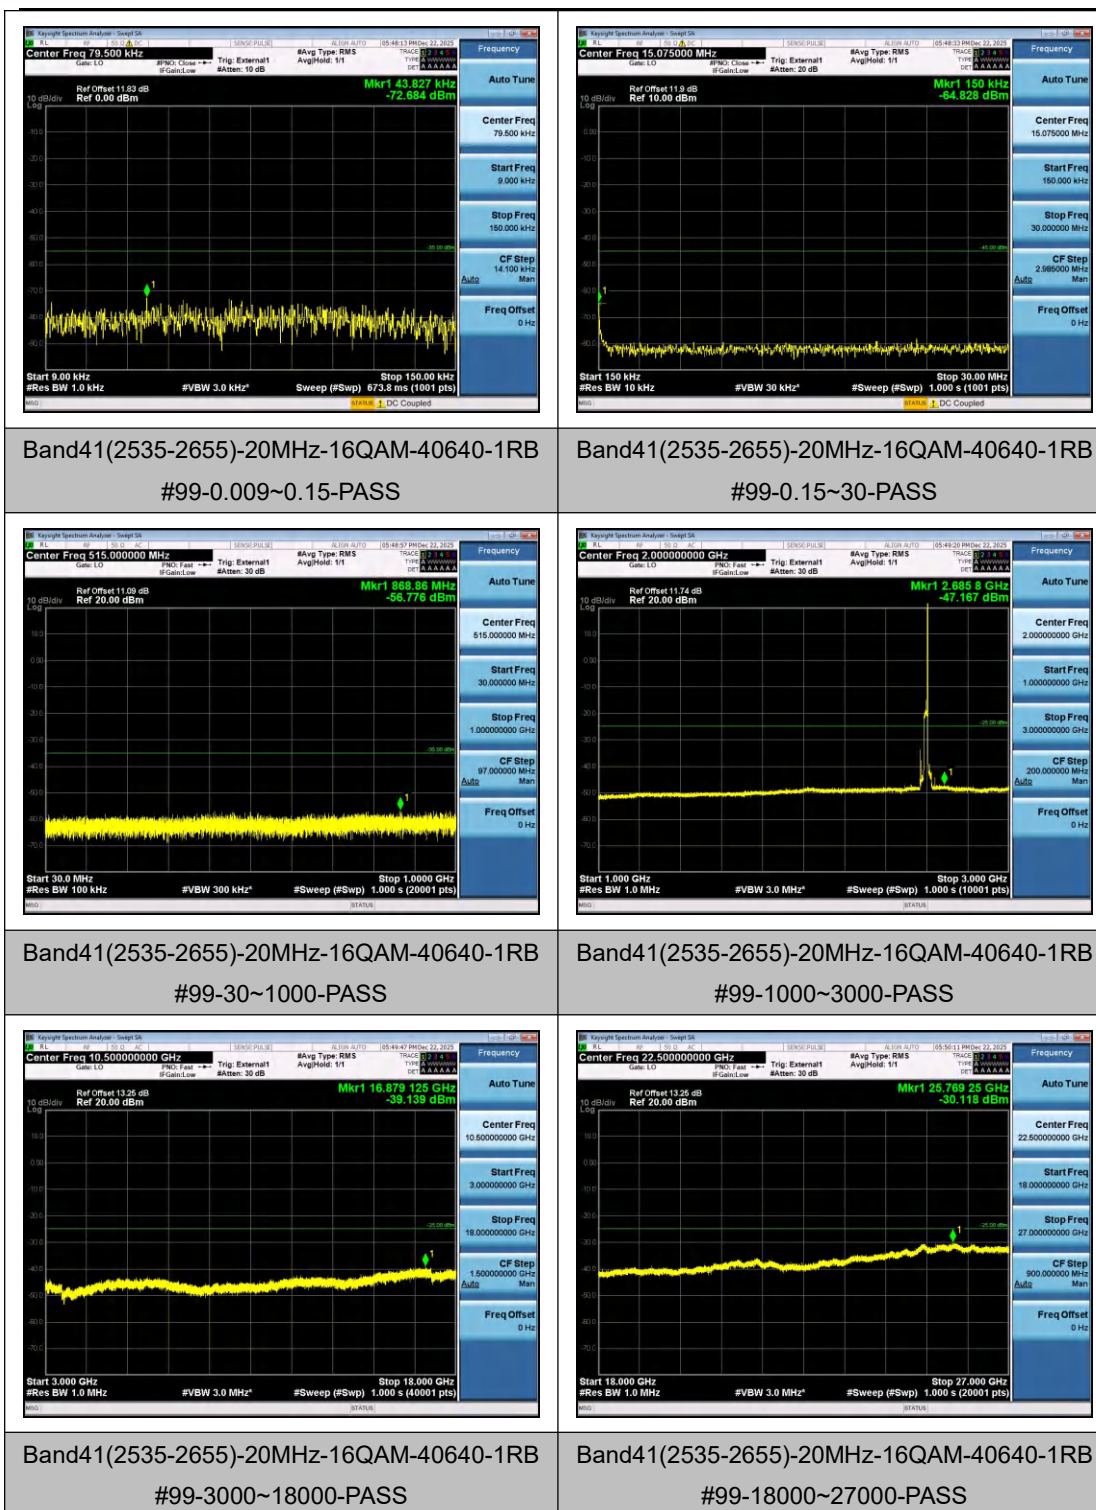


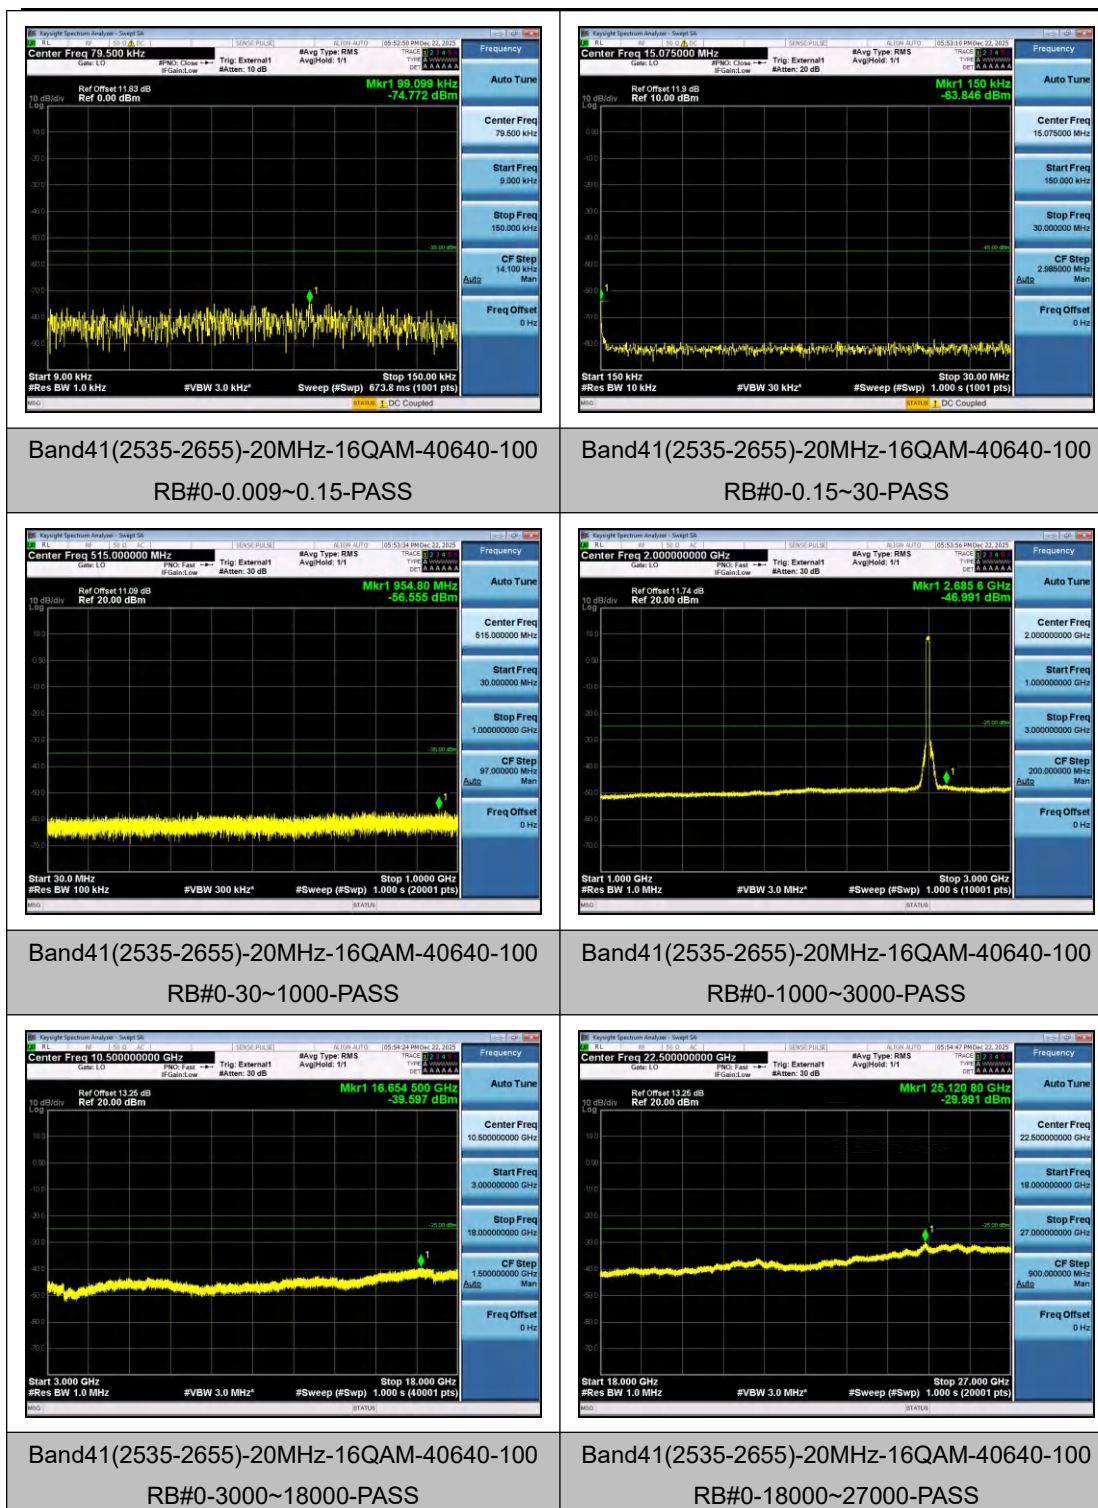

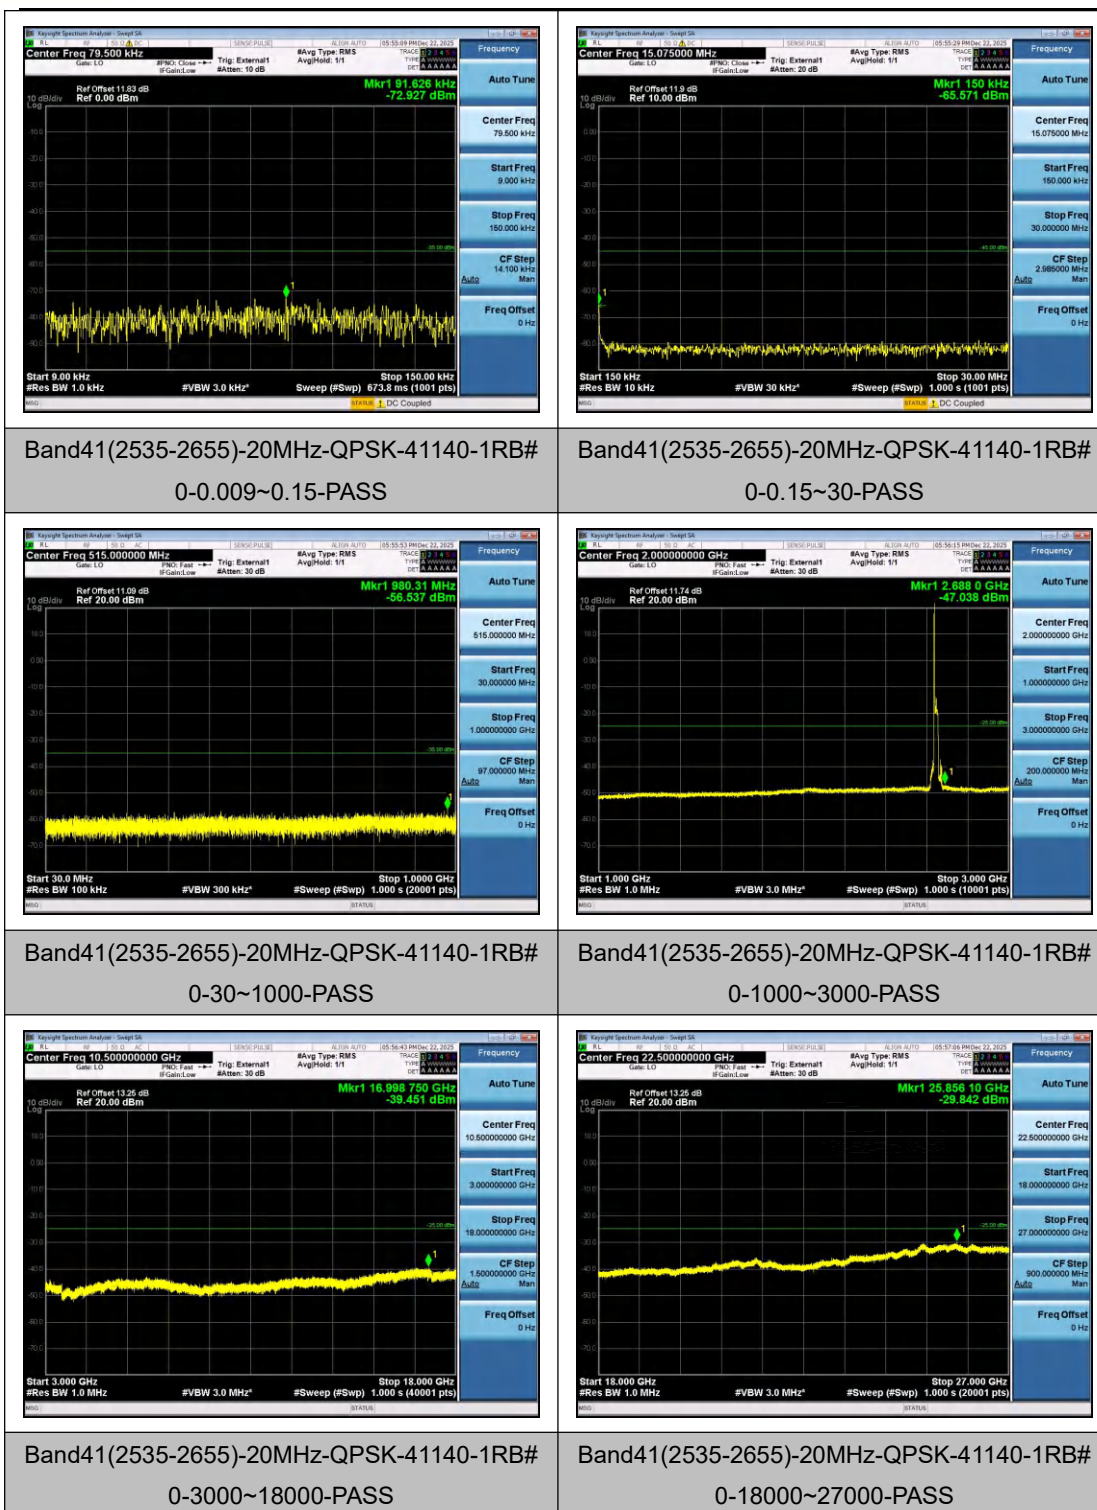


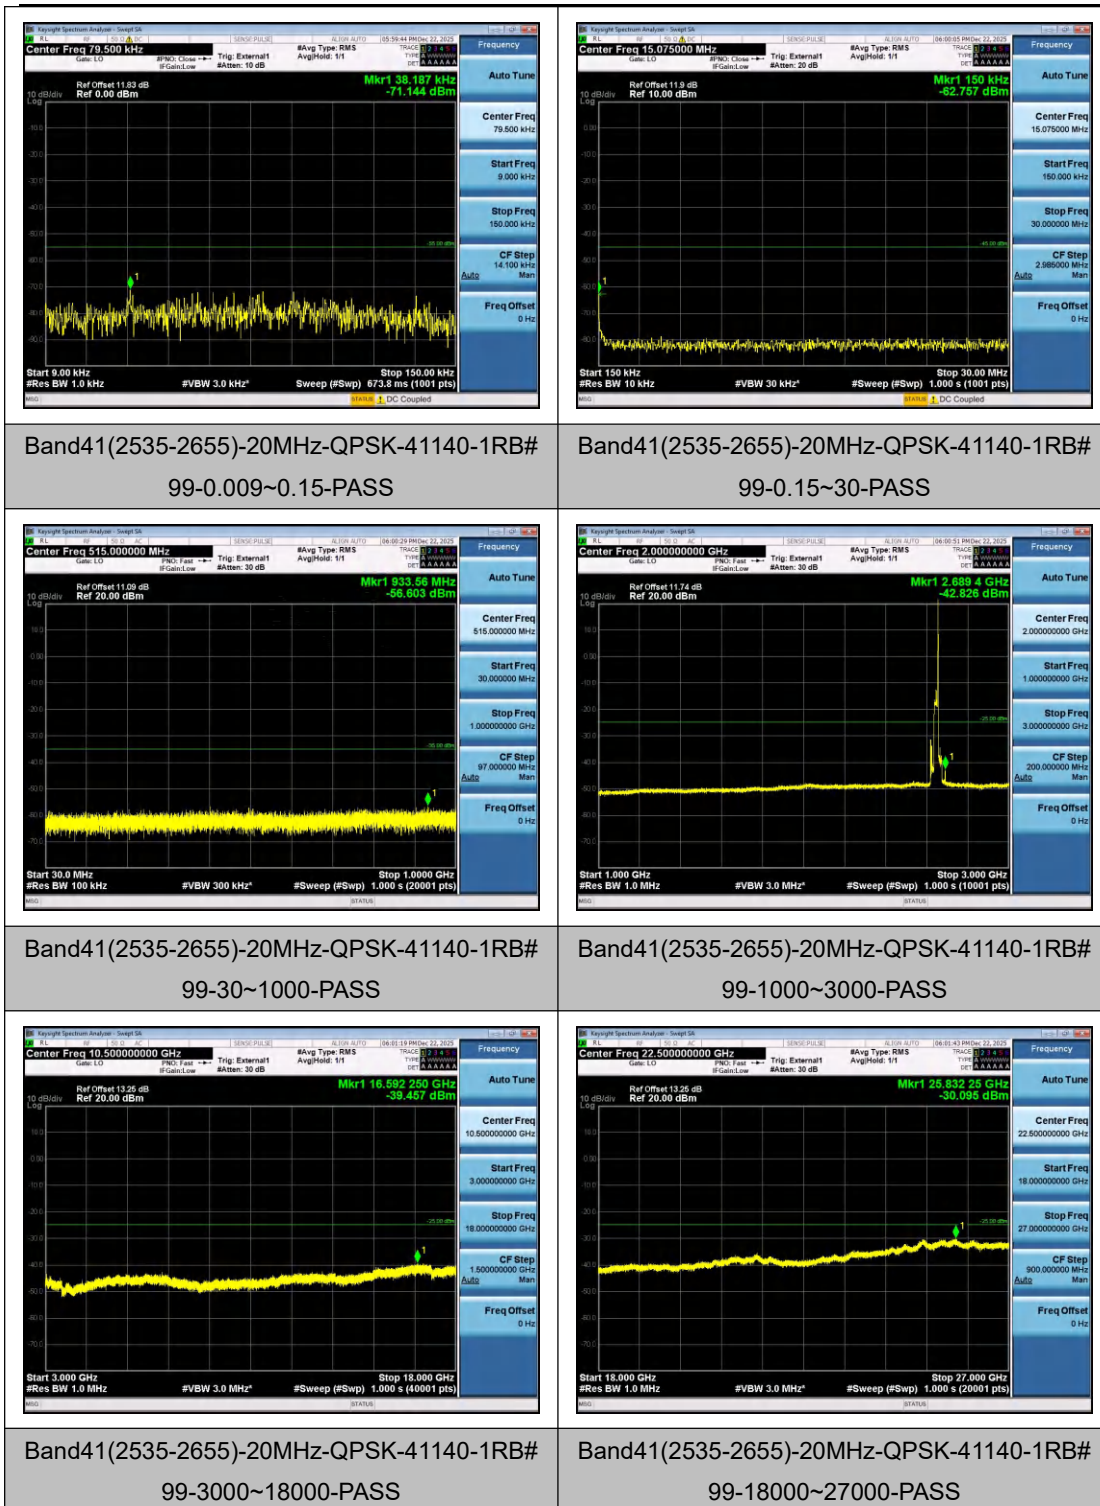

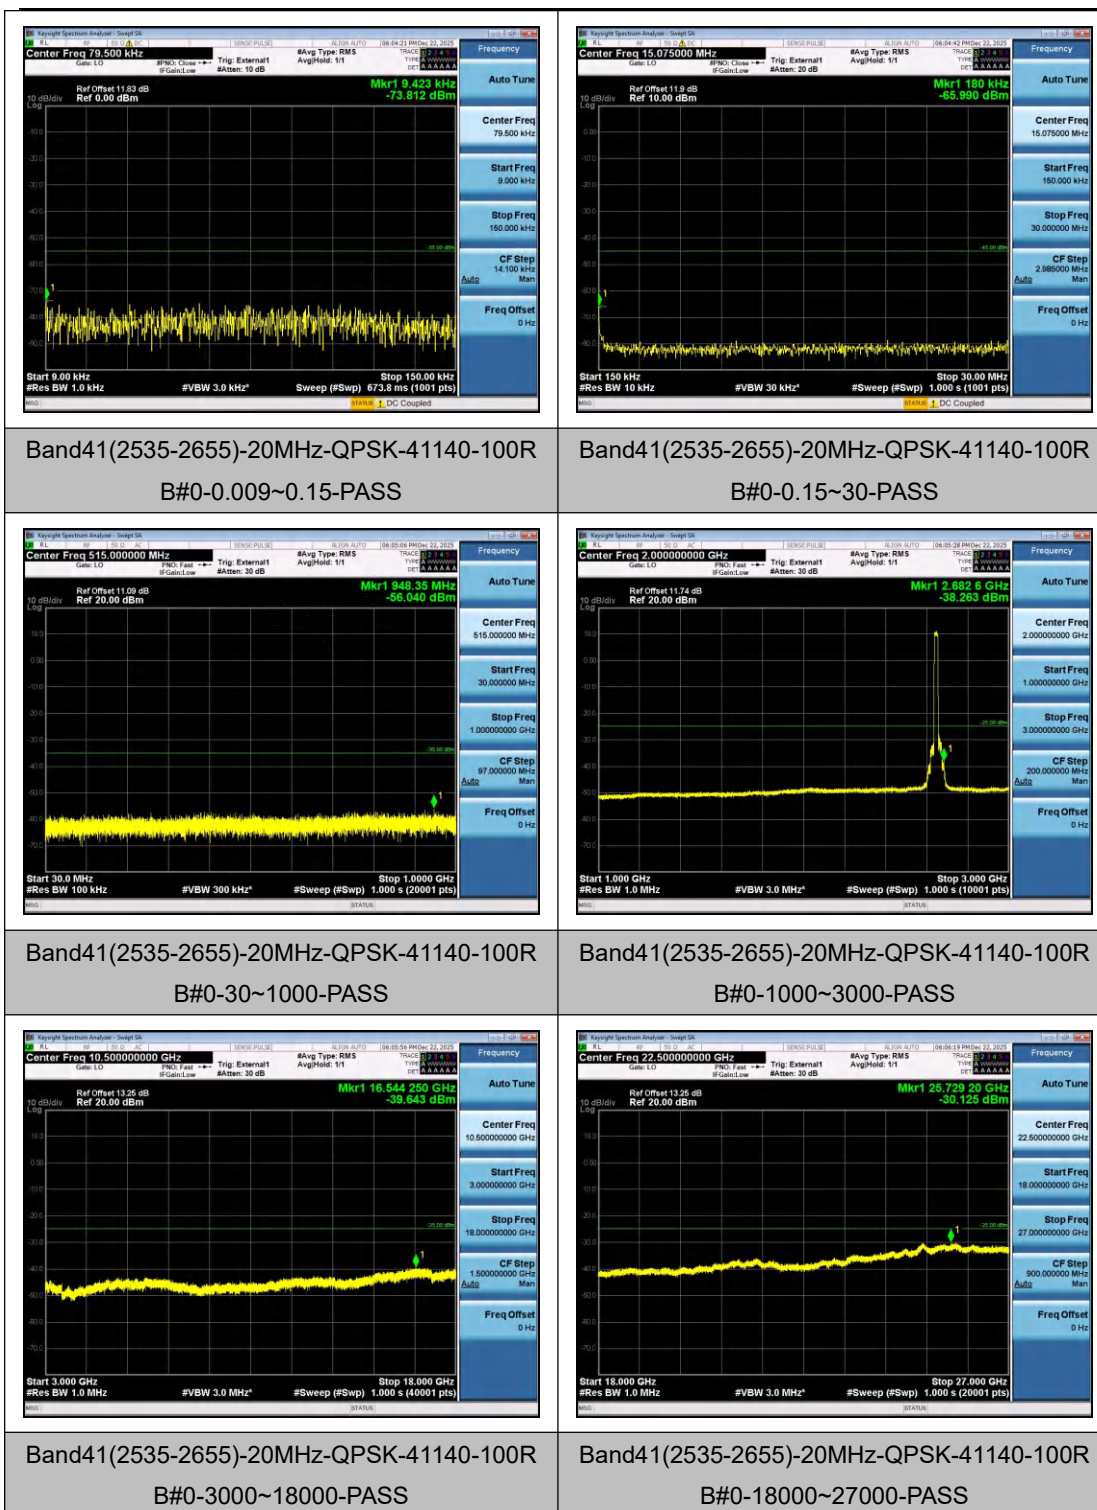


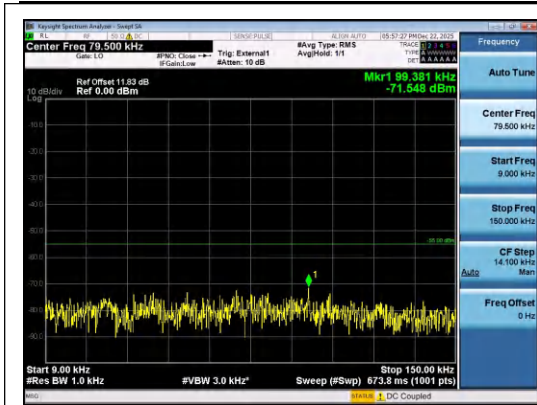


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-0.009~0.15-PASS

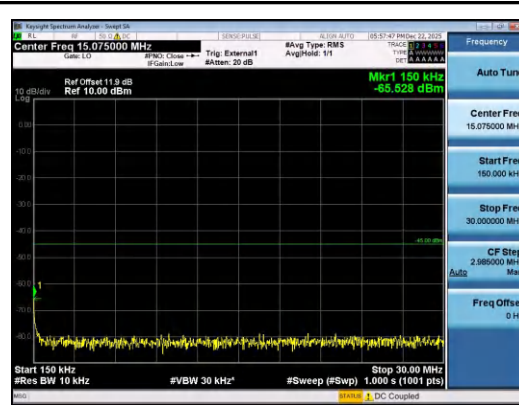


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-0.15~30-PASS

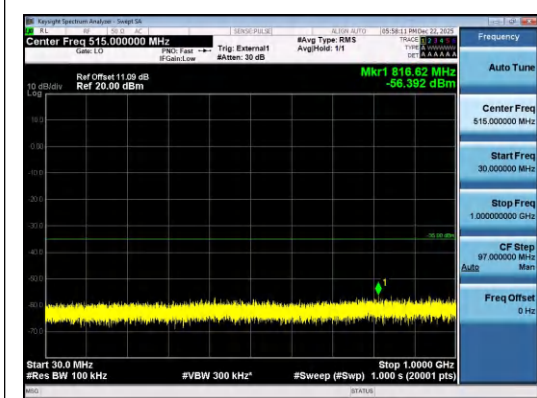


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-30~1000-PASS

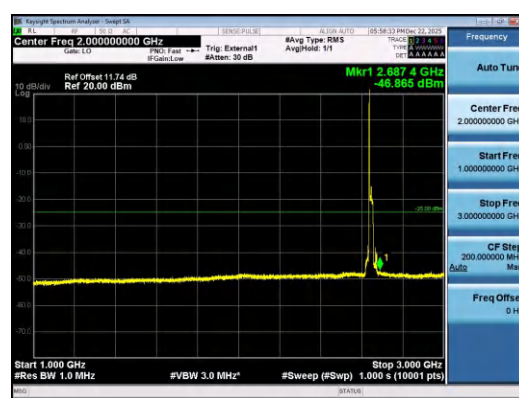


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-1000~3000-PASS

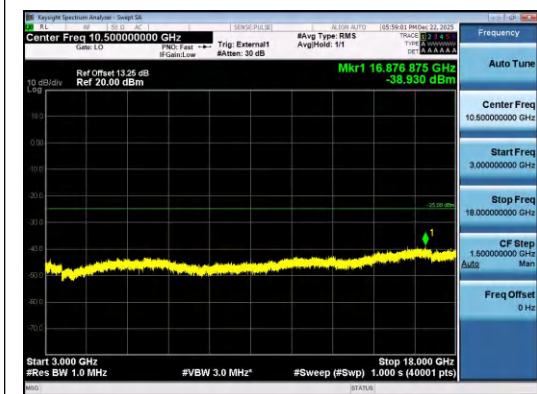


Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-3000~18000-PASS

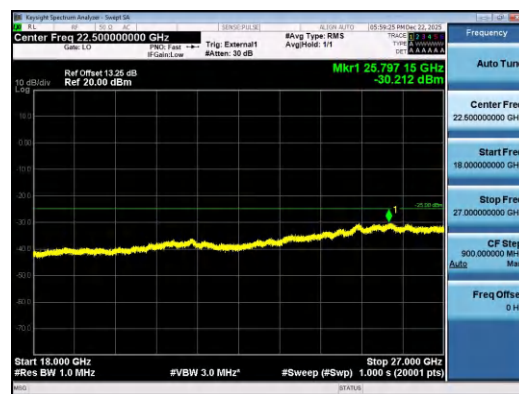

Band41(2535-2655)-20MHz-16QAM-41140-1RB
#0-18000~27000-PASS

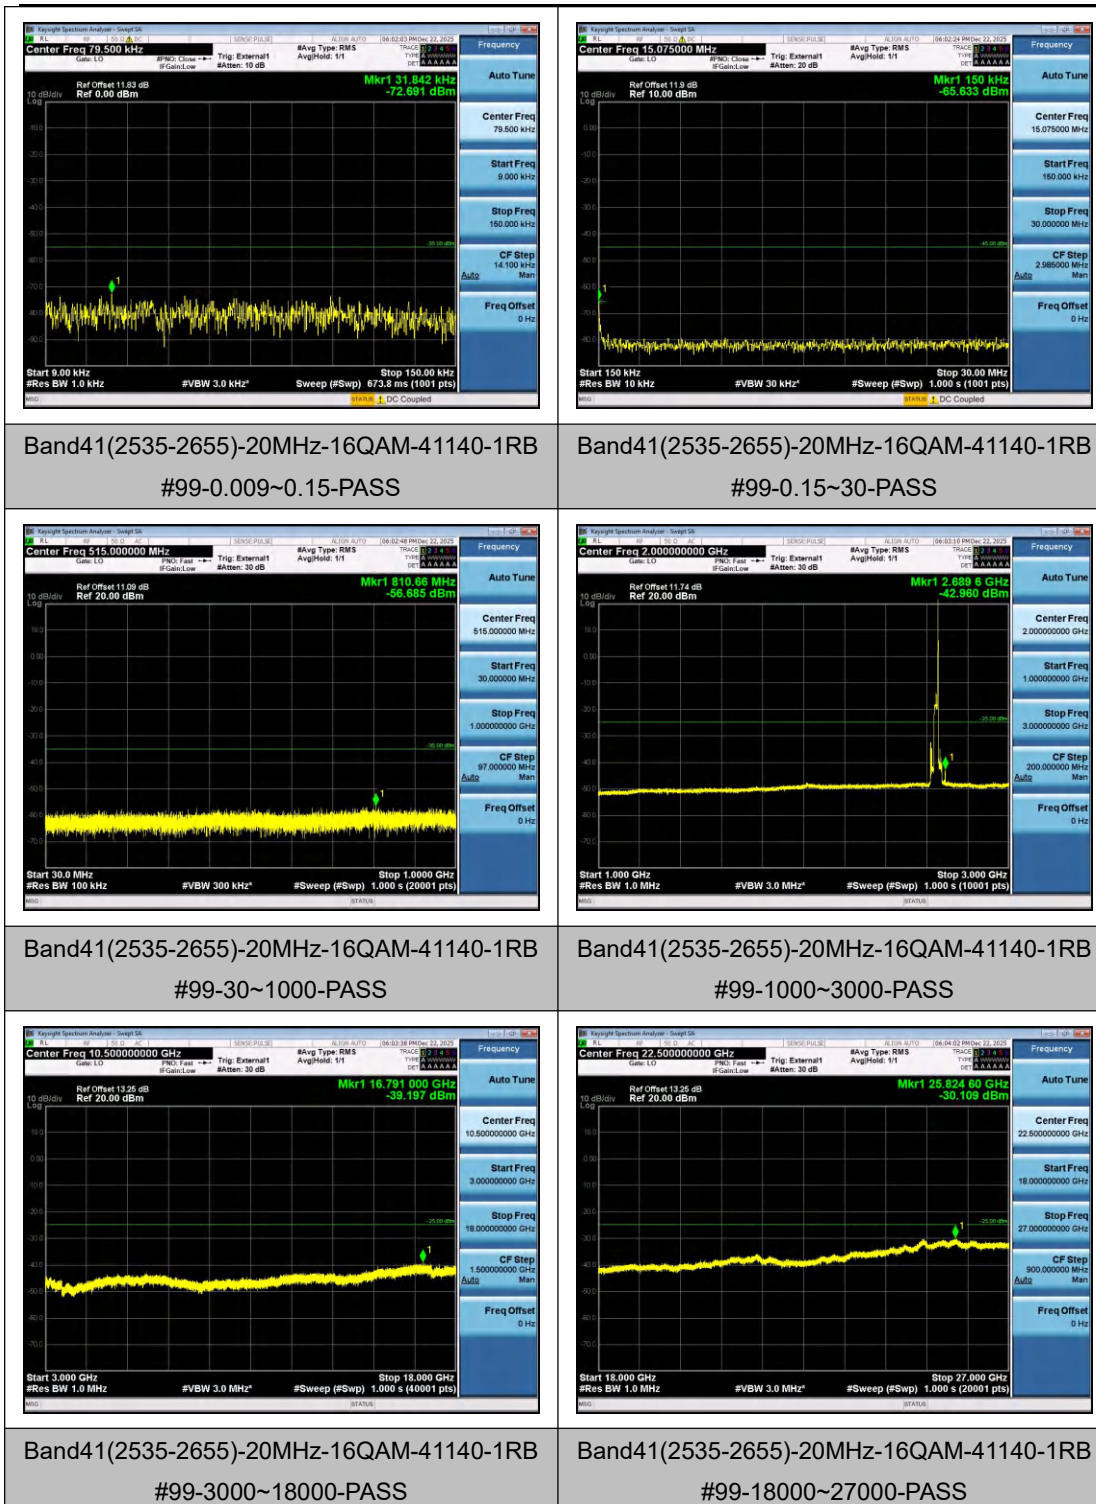

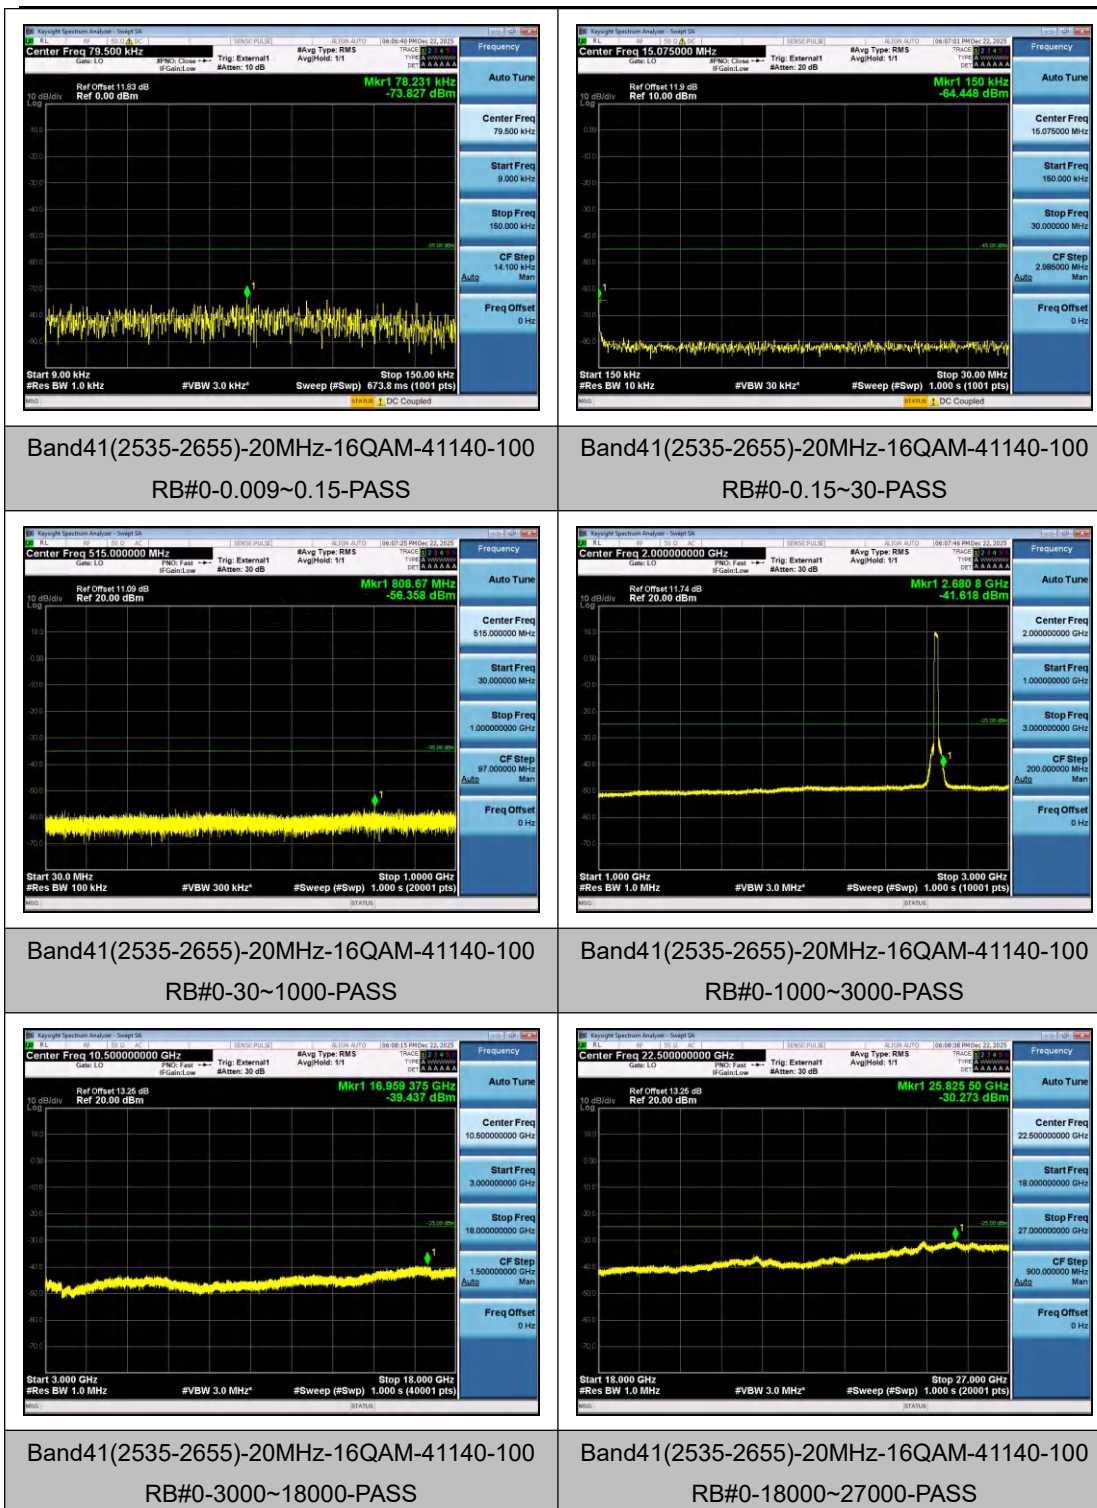

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	VN	NT	2535.27 734	2539.73 104	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	VL	NT	2535.27 726	2539.73 106	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	VH	NT	2535.28 337	2539.69 777	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	VN	NT	2535.26 606	2539.71 596	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	VL	NT	2535.26 593	2539.71 583	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	VH	NT	2535.26 597	2539.71 587	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	VN	NT	2592.78 269	2597.23 679	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	VL	NT	2592.78 285	2597.23 655	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	VH	NT	2592.77 85	2597.23 11	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	VN	NT	2592.76 991	2597.22 081	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	VL	NT	2592.76 993	2597.22 093	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	VH	NT	2592.76 997	2597.22 087	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	VN	NT	2650.27 404	2654.73 054	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	VL	NT	2650.27 399	2654.73 049	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	VH	NT	2650.27 403	2654.73 043	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	VN	NT	2650.26 958	2654.72 088	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	VL	NT	2650.26 96	2654.72 08	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	VH	NT	2650.26 965	2654.72 075	2496-26 90	PASS

Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VN	NT	2535.51 55	2544.46 56	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VL	NT	2535.51 536	2544.46 536	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VH	NT	2535.51 551	2544.46 551	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VN	NT	2535.52 348	2544.43 748	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VL	NT	2535.52 368	2544.43 758	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VH	NT	2535.52 367	2544.43 747	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VN	NT	2590.52 355	2599.46 655	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VL	NT	2590.52 359	2599.46 659	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VH	NT	2590.52 375	2599.46 675	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VN	NT	2590.52 592	2599.43 072	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VL	NT	2590.52 592	2599.43 102	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VH	NT	2590.52 598	2599.43 118	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VN	NT	2645.52 371	2654.45 771	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VL	NT	2645.52 377	2654.45 767	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VH	NT	2645.52 372	2654.45 792	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VN	NT	2645.52 359	2654.43 129	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VL	NT	2645.52 35	2654.43 11	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VH	NT	2645.52 359	2654.43 129	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VN	NT	2535.84 819	2549.17 719	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VL	NT	2535.84 806	2549.17 706	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VH	NT	2535.84 831	2549.17 731	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VN	NT	2535.80 22	2549.17 22	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VL	NT	2535.80 152	2549.17 252	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VH	NT	2535.80 16	2549.17 26	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VN	NT	2588.33 388	2601.68 688	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VL	NT	2588.33 444	2601.68 644	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VH	NT	2588.33 476	2601.68 676	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VN	NT	2588.29 879	2601.70 479	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VL	NT	2588.29 893	2601.70 493	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VH	NT	2588.29 893	2601.70 493	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VN	NT	2640.76 687	2654.17 287	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VL	NT	2640.76 68	2654.17 28	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VH	NT	2640.76 655	2654.17 255	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VN	NT	2640.83 652	2654.18 152	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VL	NT	2640.83 659	2654.18 159	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VH	NT	2640.83 527	2654.18 127	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VN	NT	2536.10 908	2553.91 308	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VL	NT	2536.10 925	2553.91 325	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VH	NT	2536.10 917	2553.91 317	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	VN	NT	2536.08 777	2553.93 477	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	VL	NT	2536.08 757	2553.93 457	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	VH	NT	2536.08 699	2553.93 499	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VN	NT	2586.12 715	2603.85 215	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VL	NT	2586.12 691	2603.85 191	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VH	NT	2586.12 696	2603.85 196	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VN	NT	2586.08 329	2603.90 629	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VL	NT	2586.08 39	2603.90 59	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VH	NT	2586.08 404	2603.90 604	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VN	NT	2636.11 696	2653.90 396	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VL	NT	2636.11 663	2653.90 363	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VH	NT	2636.11 671	2653.90 371	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VN	NT	2636.07 146	2653.90 046	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VL	NT	2636.07 171	2653.90 071	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VH	NT	2636.07 184	2653.89 984	2496-26 90	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	2535.28 315	2539.69 785	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	2535.28 321	2539.69 791	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	2535.28 338	2539.69 788	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	0	2535.28 302	2539.69 782	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	10	2535.28 341	2539.69 791	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	20	2535.28 338	2539.69 778	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	30	2535.28 304	2539.69 784	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	40	2535.28 341	2539.69 781	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	50	2535.28 323	2539.69 783	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	2535.26 605	2539.71 595	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	2535.26 603	2539.71 603	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	2535.26 419	2539.71 969	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	0	2535.27 064	2539.72 154	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	10	2535.27 086	2539.72 146	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	20	2535.27 062	2539.72 152	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	30	2535.27 067	2539.72 147	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	40	2535.27 079	2539.72 159	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	50	2535.27 075	2539.72 135	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-30	2592.77 86	2597.23 1	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-20	2592.77 841	2597.23 111	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-10	2592.77 803	2597.23 113	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	0	2592.77 785	2597.23 095	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	10	2592.77 763	2597.23 093	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	20	2592.77 77	2597.23 09	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	30	2592.77 737	2597.23 087	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	40	2592.77 721	2597.23 081	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	50	2592.77 683	2597.23 083	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-30	2592.76 999	2597.22 099	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-20	2592.77 003	2597.22 093	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-10	2592.76 994	2597.22 094	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	0	2592.77 01	2597.22 1	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	10	2592.77 01	2597.22 1	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	20	2592.77 609	2597.21 869	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	30	2592.78 294	2597.21 104	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	40	2592.78 312	2597.21 092	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	50	2592.78 299	2597.21 099	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	2650.27 41	2654.73 05	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	2650.27 392	2654.73 052	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	2650.27 396	2654.73 056	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	0	2650.27 385	2654.73 055	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	10	2650.27 368	2654.73 058	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	20	2650.27 373	2654.73 053	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	30	2650.27 422	2654.73 052	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	40	2650.27 402	2654.73 052	2496-26 90	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	50	2650.27 36	2654.73 05	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	2650.26 969	2654.72 089	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	2650.26 974	2654.72 074	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	2650.26 966	2654.72 076	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	0	2650.26 953	2654.72 083	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	10	2650.26 948	2654.72 078	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	20	2650.26 964	2654.72 084	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	30	2650.26 956	2654.72 086	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	40	2650.26 953	2654.72 083	2496-26 90	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	50	2650.26 952	2654.72 092	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	2535.51 549	2544.46 549	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	2535.51 564	2544.46 554	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	2535.51 554	2544.46 544	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	0	2535.51 544	2544.46 534	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	10	2535.51 559	2544.46 519	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	20	2535.51 548	2544.46 548	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	30	2535.51 54	2544.46 54	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	40	2535.51 54	2544.46 53	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	50	2535.51 542	2544.46 542	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-30	2535.52 348	2544.43 738	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-20	2535.52 345	2544.43 755	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-10	2535.52 345	2544.43 745	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	0	2535.52 334	2544.43 744	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	10	2535.52 352	2544.43 762	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	20	2535.52 346	2544.43 746	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	30	2535.52 346	2544.43 746	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	40	2535.52 349	2544.43 739	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	50	2535.52 345	2544.43 745	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-30	2590.52 358	2599.46 698	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-20	2590.52 359	2599.46 659	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-10	2590.52 345	2599.46 675	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	0	2590.52 366	2599.46 706	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	10	2590.52 356	2599.46 686	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	20	2590.52 37	2599.46 67	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	30	2590.52 368	2599.46 668	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	40	2590.52 37	2599.46 68	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	50	2590.52 358	2599.46 668	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-30	2590.52 593	2599.43 103	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-20	2590.52 595	2599.43 095	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-10	2590.52 594	2599.43 104	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	0	2590.52 606	2599.43 126	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	10	2590.52 609	2599.43 099	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	20	2590.52 599	2599.43 109	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	30	2590.52 618	2599.43 118	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	40	2590.52 617	2599.43 127	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	50	2590.52 599	2599.43 119	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	-30	2645.52 384	2654.45 774	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	2645.52 375	2654.45 775	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	2645.52 383	2654.45 763	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	0	2645.52 386	2654.45 766	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	10	2645.52 382	2654.45 772	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	20	2645.52 381	2654.45 751	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	30	2645.52 37	2654.45 75	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	40	2645.52 389	2654.45 759	2496-26 90	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	50	2645.52 379	2654.45 759	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-30	2645.52 355	2654.43 115	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-20	2645.52 352	2654.43 112	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-10	2645.52 343	2654.43 113	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	0	2645.52 348	2654.43 098	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	10	2645.52 342	2654.43 132	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	20	2645.52 359	2654.43 079	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	30	2645.52 351	2654.43 091	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	40	2645.52 344	2654.43 094	2496-26 90	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	50	2645.52 355	2654.43 095	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	2535.84 834	2549.17 734	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	2535.84 852	2549.17 652	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	2535.84 814	2549.17 714	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	0	2535.84 808	2549.17 708	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	10	2535.84 775	2549.17 775	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	20	2535.84 8	2549.17 7	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	30	2535.84 864	2549.17 664	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	40	2535.84 803	2549.17 703	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	50	2535.84 814	2549.17 714	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-30	2535.80 171	2549.17 271	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-20	2535.80 145	2549.17 245	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-10	2535.80 193	2549.17 193	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	0	2535.80 151	2549.17 251	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	10	2535.80 15	2549.17 25	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	20	2535.80 147	2549.17 247	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	30	2535.80 198	2549.17 198	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	40	2535.80 153	2549.17 253	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	50	2535.80 159	2549.17 259	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-30	2588.33 452	2601.68 652	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-20	2588.33 486	2601.68 686	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-10	2588.33 407	2601.68 707	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	0	2588.33 469	2601.68 669	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	10	2588.33 454	2601.68 654	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	20	2588.33 493	2601.68 693	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	30	2588.33 482	2601.68 682	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	40	2588.33 453	2601.68 653	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	50	2588.33 464	2601.68 664	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-30	2588.29 946	2601.70 446	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-20	2588.29 938	2601.70 438	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-10	2588.29 928	2601.70 428	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	0	2588.29 933	2601.70 433	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	10	2588.29 938	2601.70 438	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	20	2588.29 947	2601.70 447	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	30	2588.29 904	2601.70 504	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	40	2588.29 948	2601.70 448	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	50	2588.29 892	2601.70 492	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	2640.76 689	2654.17 289	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	2640.76 694	2654.17 294	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	2640.76 679	2654.17 279	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	0	2640.76 688	2654.17 288	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	10	2640.76 681	2654.17 281	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	20	2640.76 692	2654.17 292	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	30	2640.76 684	2654.17 284	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	40	2640.76 679	2654.17 279	2496-26 90	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	50	2640.76 694	2654.17 294	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	-30	2640.83 597	2654.18 097	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	-20	2640.83 589	2654.18 189	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	-10	2640.83 597	2654.18 197	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	0	2640.83 57	2654.18 17	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	10	2640.83 598	2654.18 198	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	20	2640.83 577	2654.18 177	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	30	2640.83 577	2654.18 177	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	40	2640.83 668	2654.18 068	2496-26 90	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	50	2640.83 576	2654.18 176	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	2536.10 884	2553.91 384	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	2536.10 881	2553.91 381	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	2536.10 929	2553.91 329	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	0	2536.10 951	2553.91 351	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	10	2536.10 888	2553.91 288	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	20	2536.10 941	2553.91 341	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	30	2536.10 927	2553.91 327	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	40	2536.10 927	2553.91 327	2496-26 90	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	50	2536.10 932	2553.91 332	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-30	2536.08 786	2553.93 486	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-20	2536.08 743	2553.93 543	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-10	2536.08 778	2553.93 378	2496-26 90	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	0	2536.08 757	2553.93 457	2496-26 90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com