






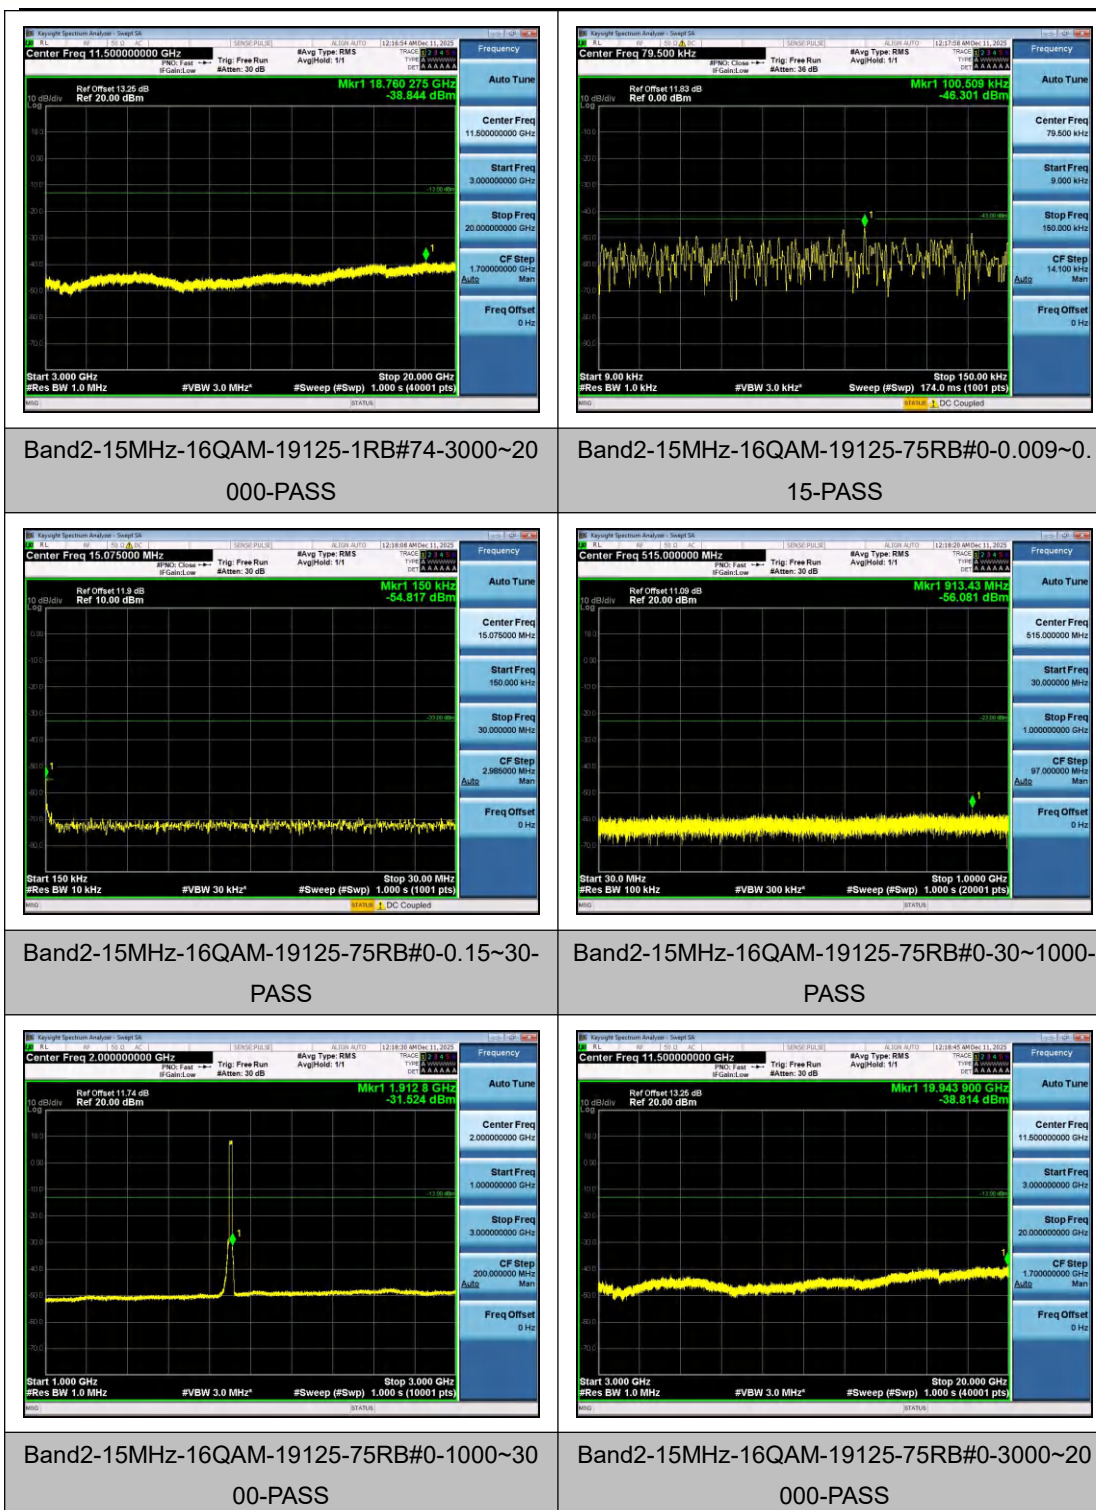


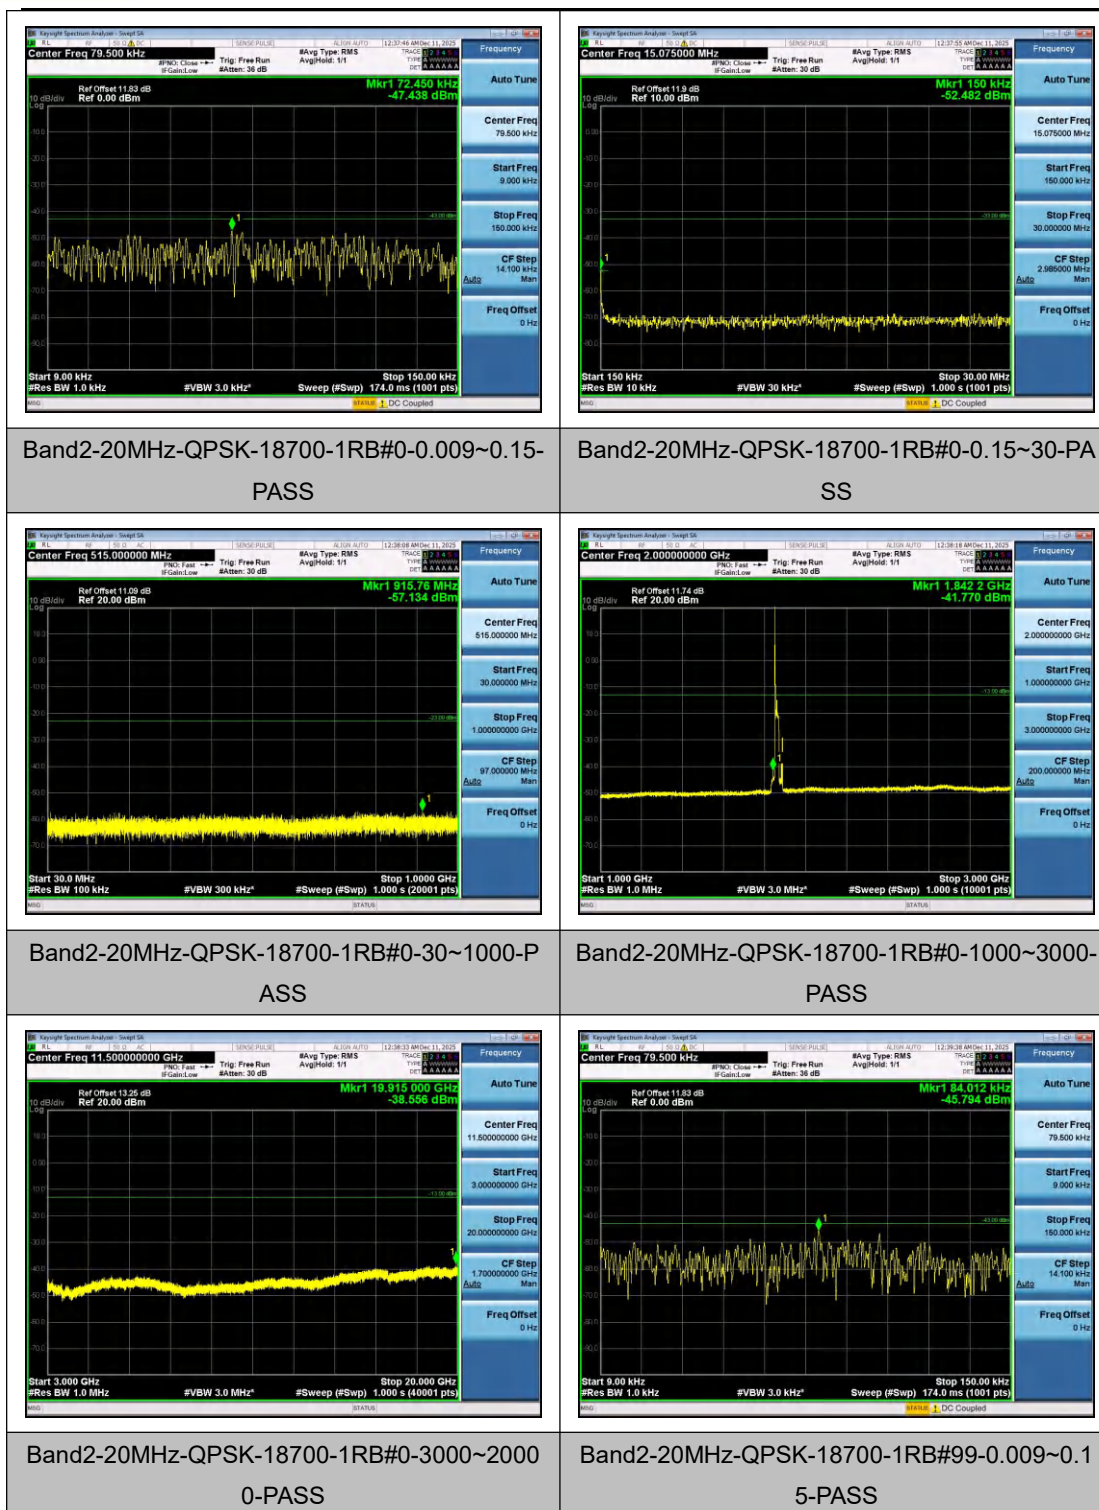

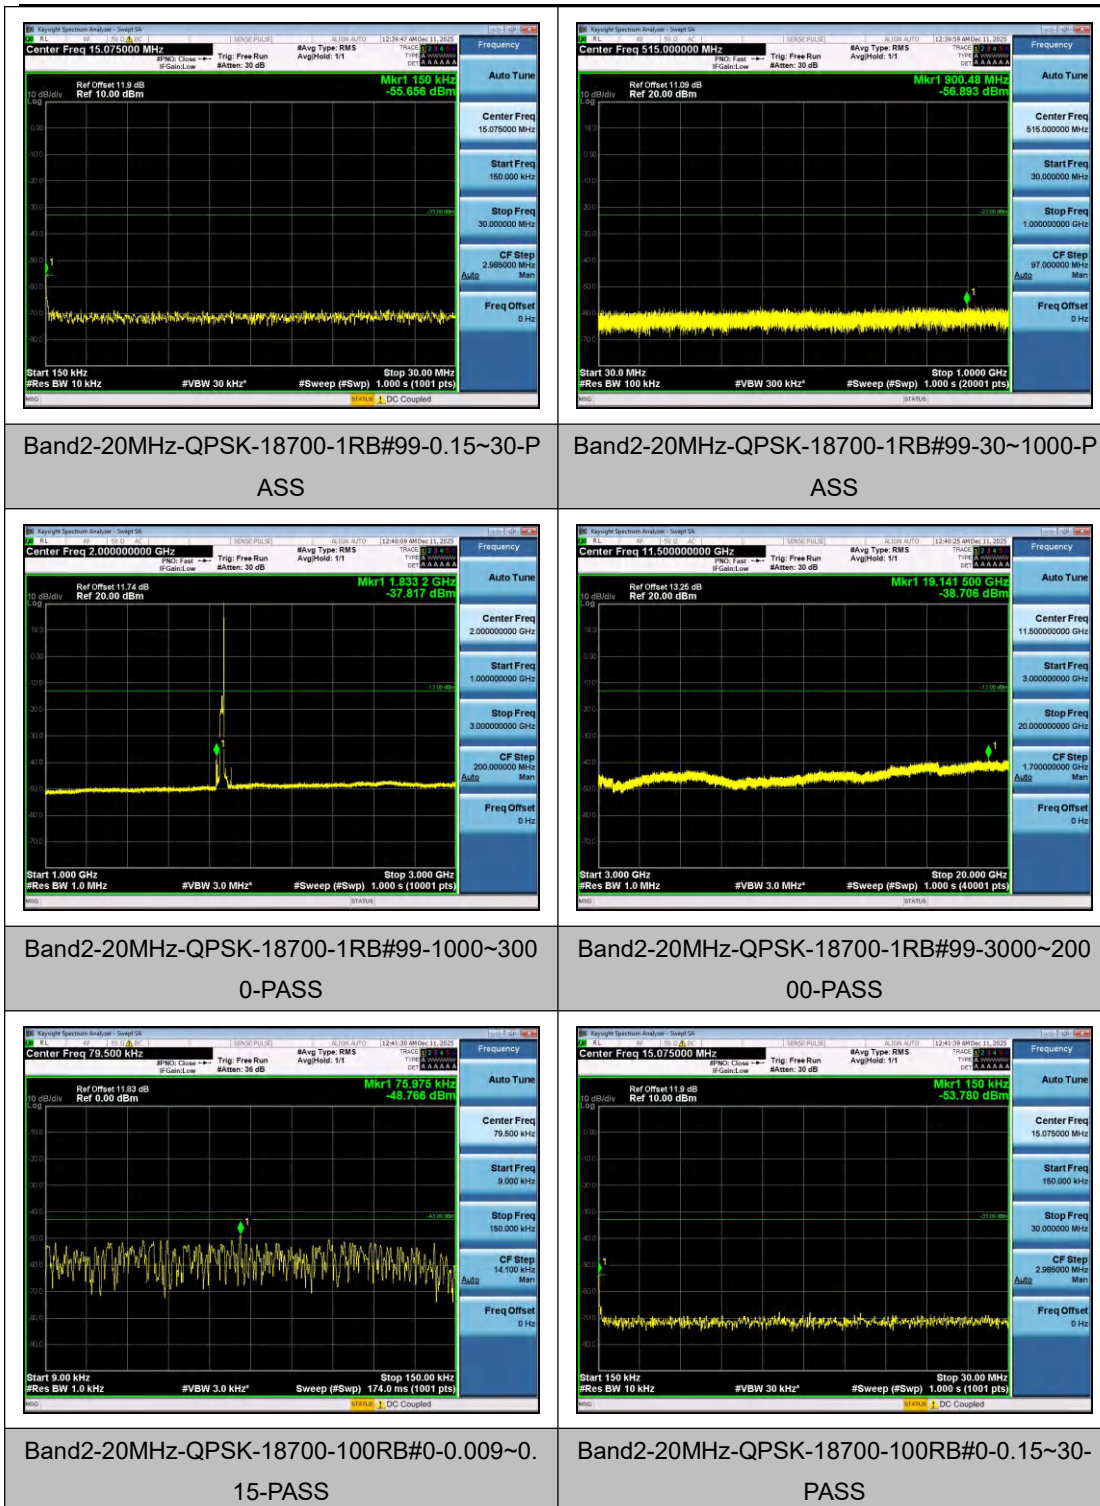


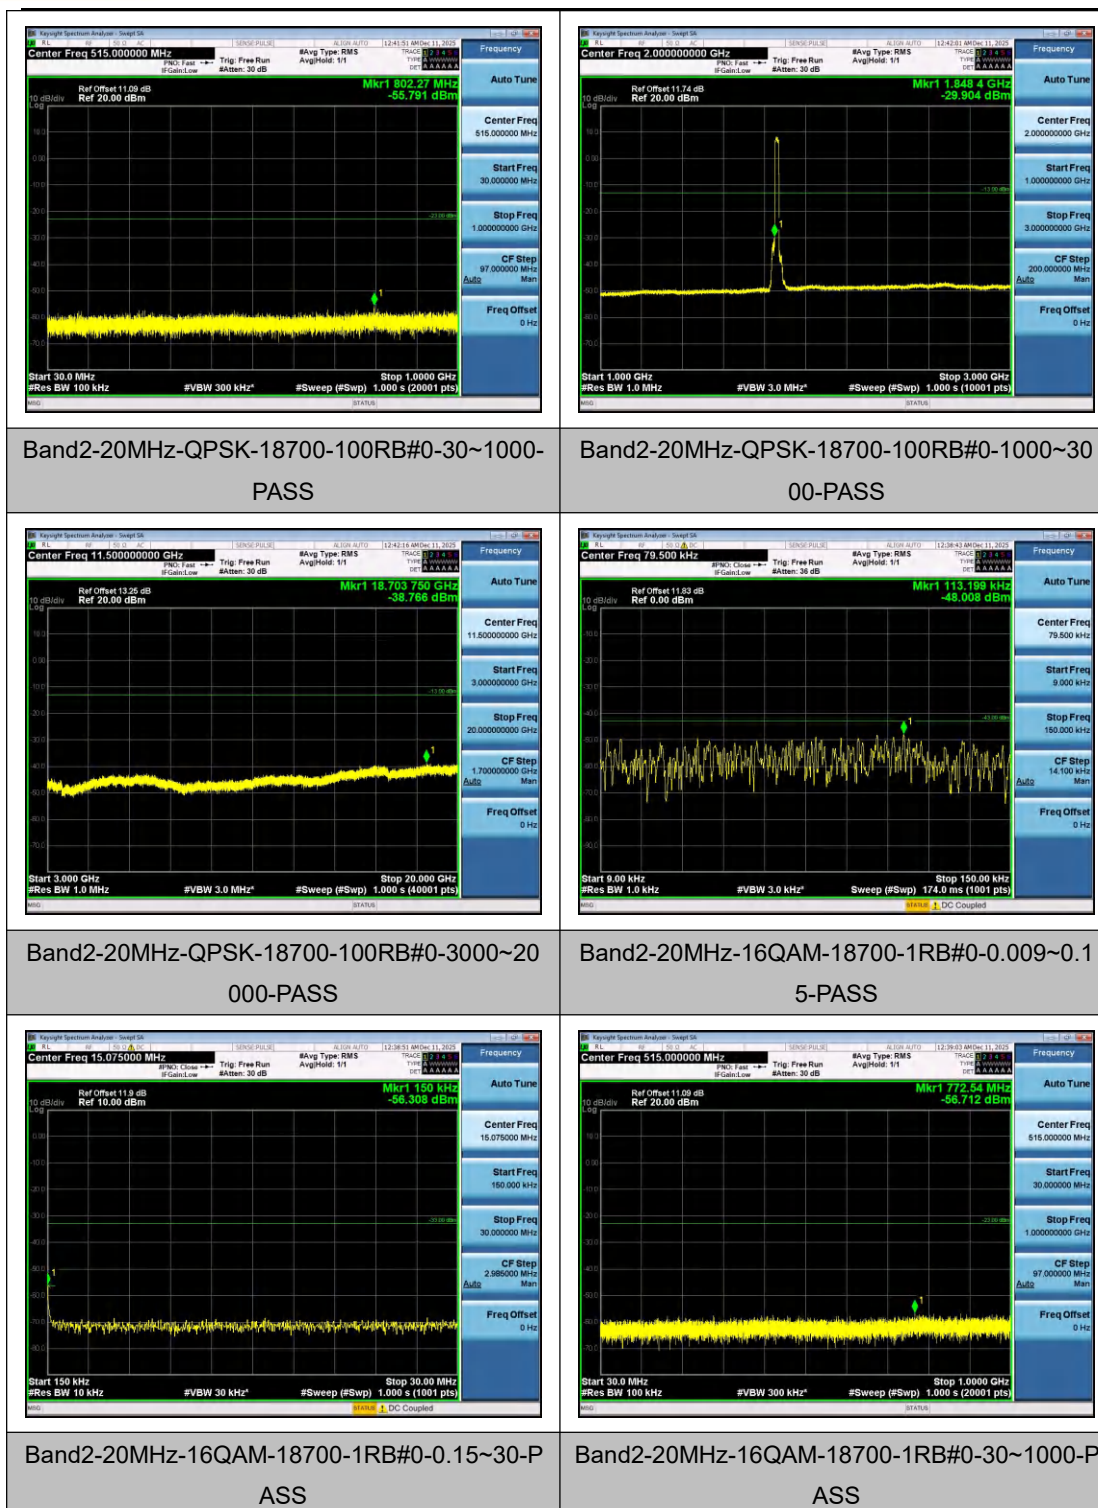

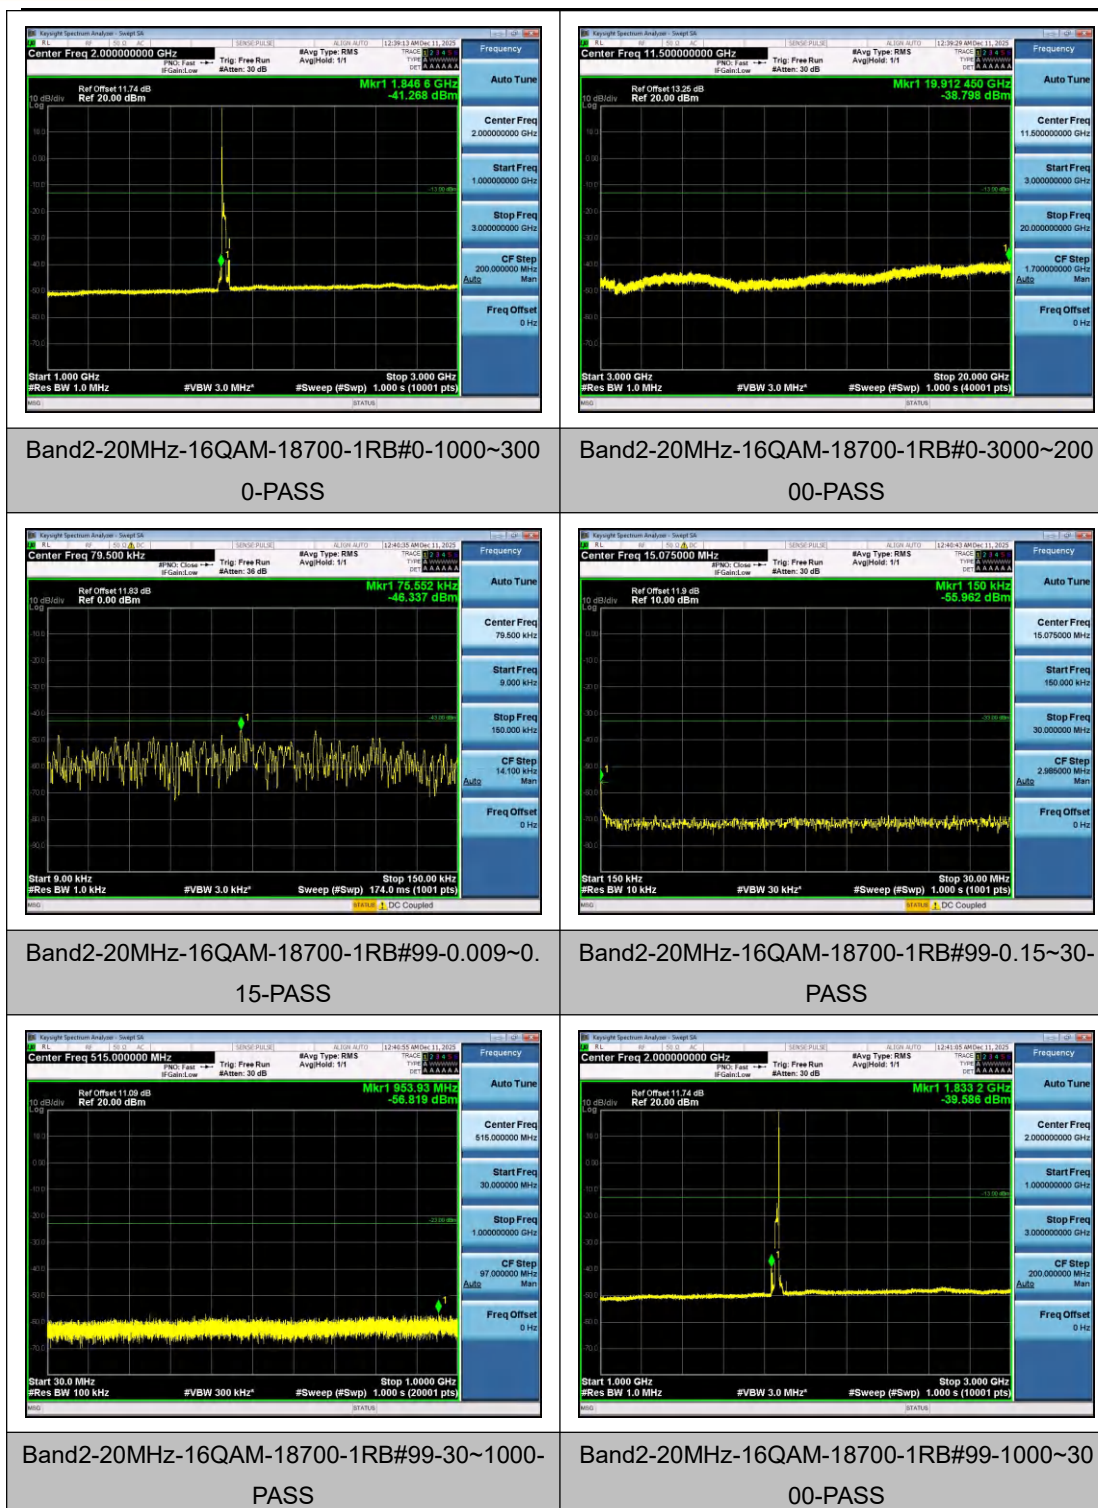


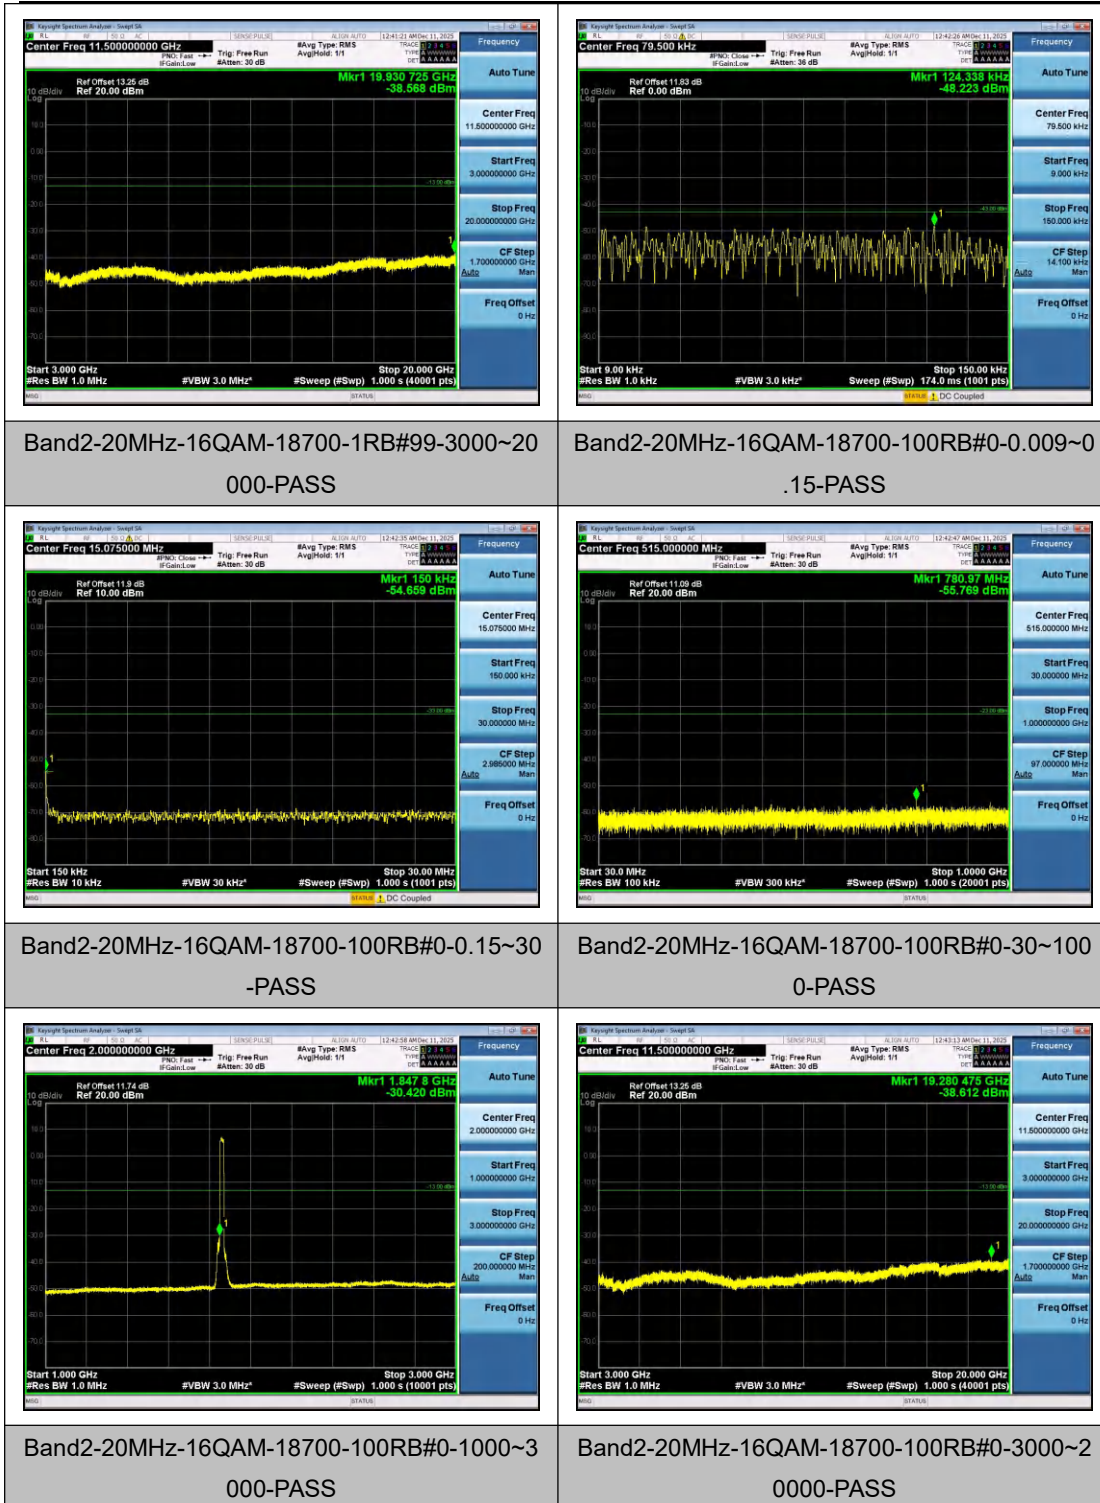



Band2-20MHz-QPSK-18900-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-18900-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-18900-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-18900-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-18900-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-18900-1RB#99-0.009~0.1 5-PASS

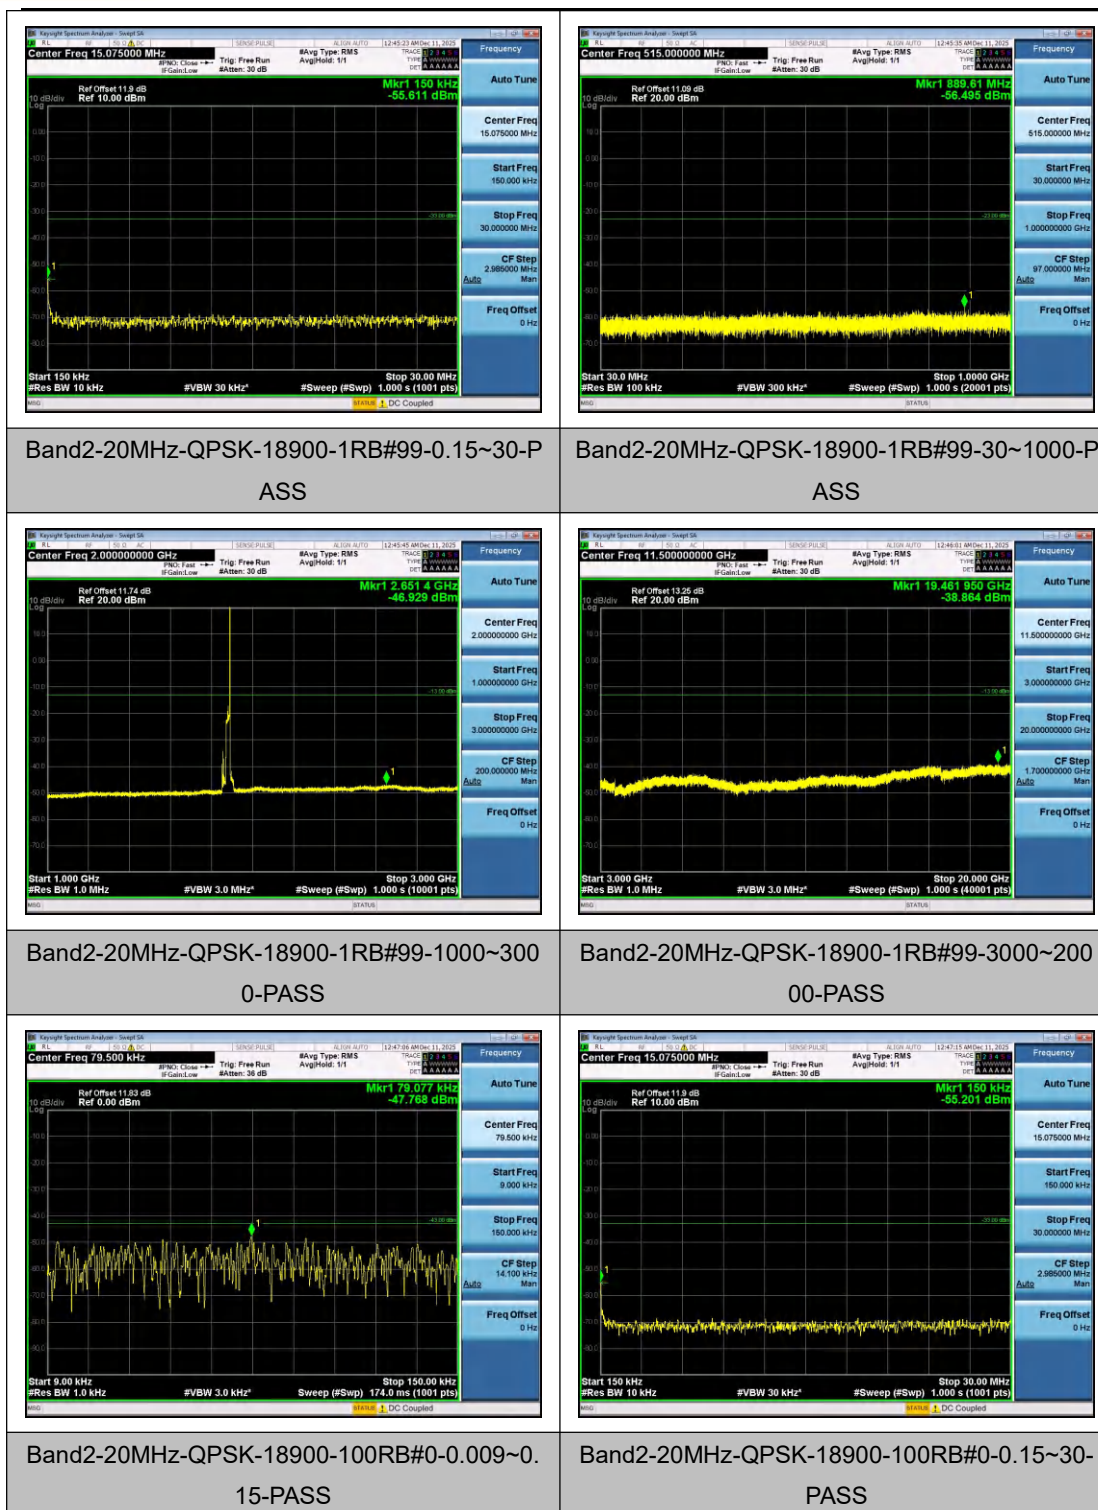



Band2-20MHz-QPSK-18900-100RB#0-30~1000-PASS	Band2-20MHz-QPSK-18900-100RB#0-1000~3000-PASS
Band2-20MHz-QPSK-18900-100RB#0-3000~20000-PASS	Band2-20MHz-16QAM-18900-1RB#0-0.009~0.15-PASS
Band2-20MHz-16QAM-18900-1RB#0-0.15~30-PASS	Band2-20MHz-16QAM-18900-1RB#0-30~1000-PASS

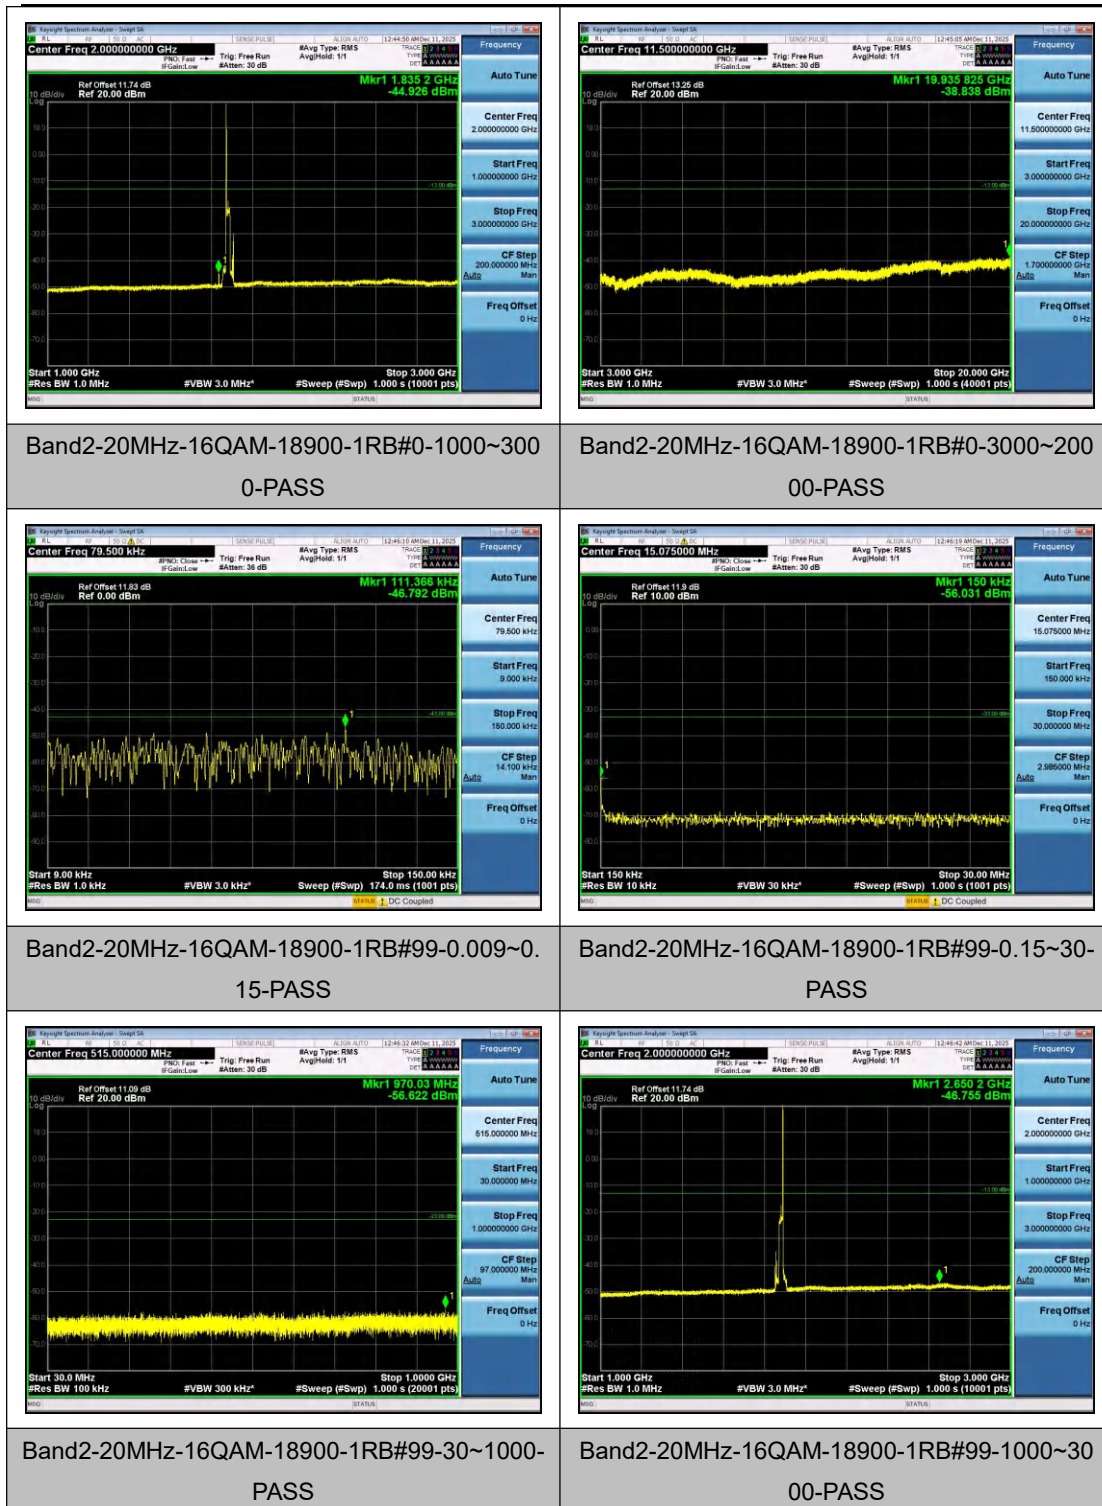


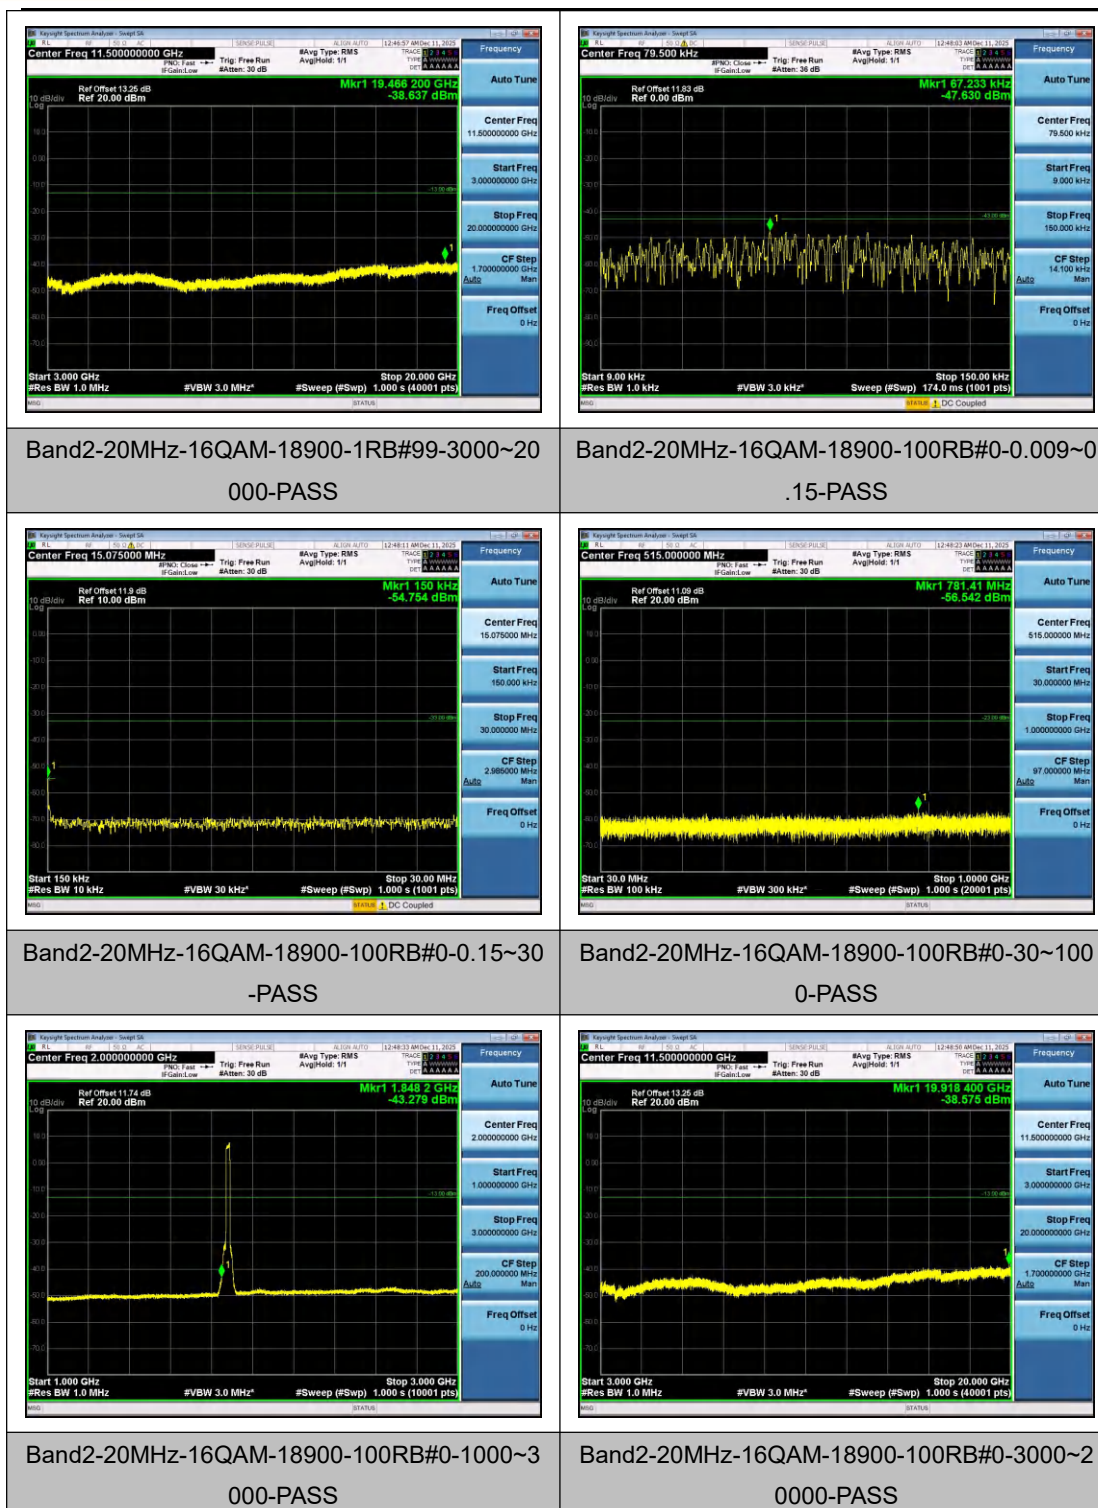


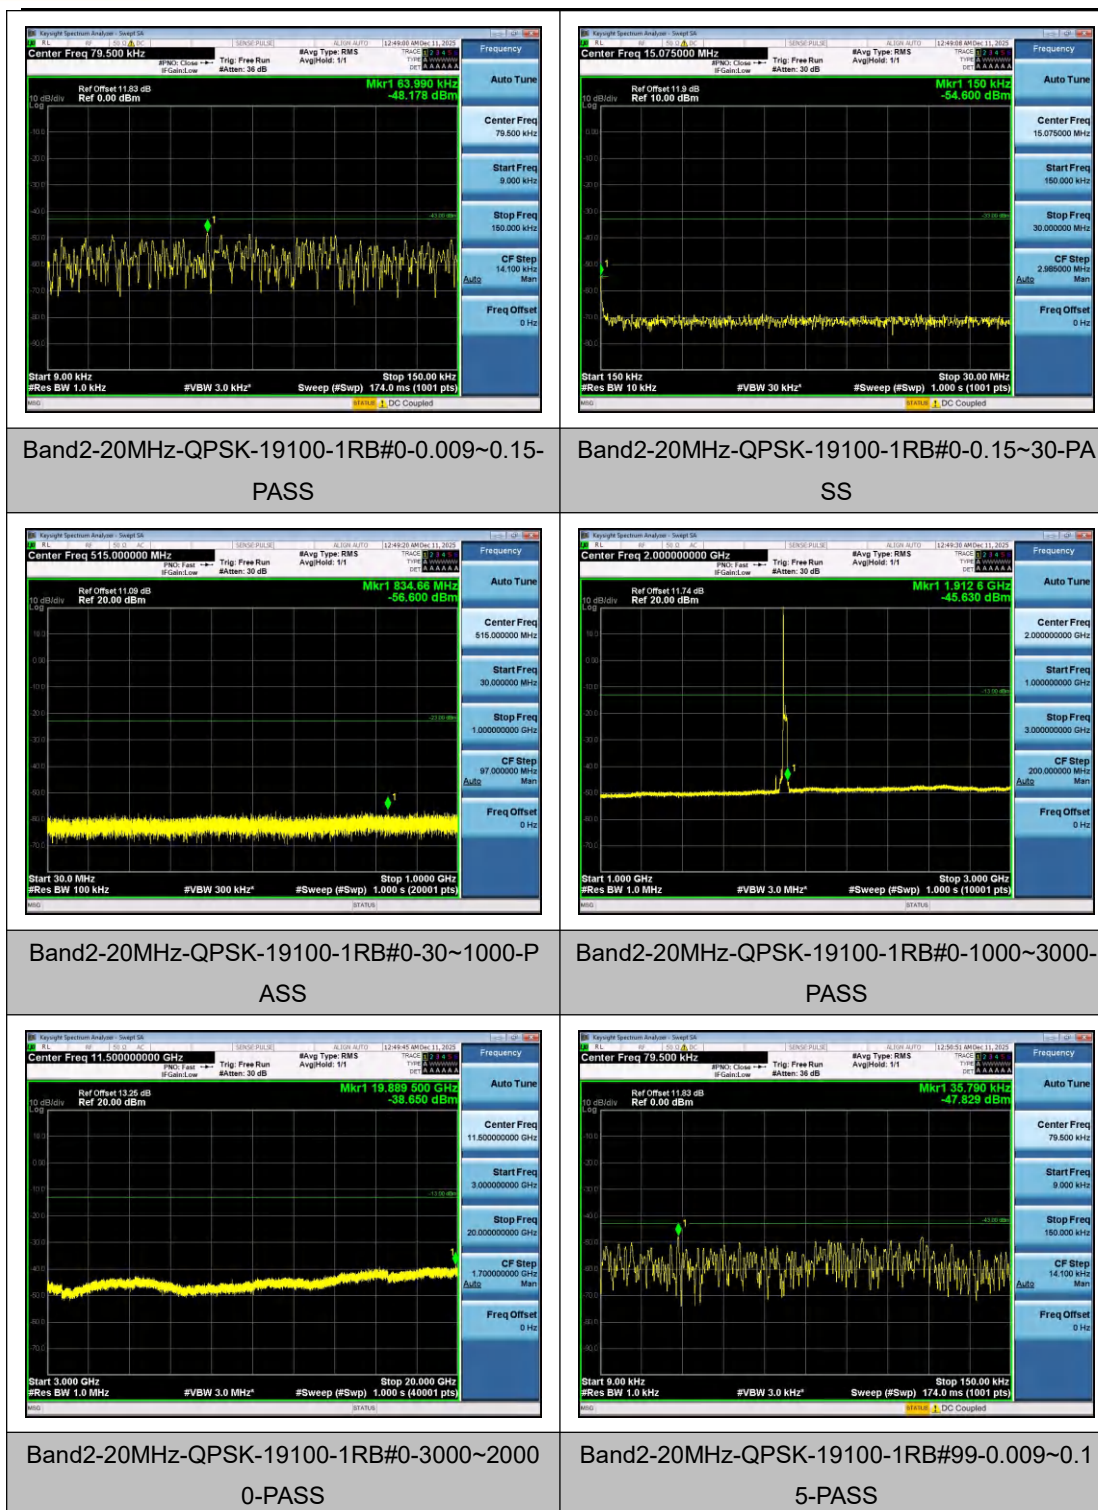

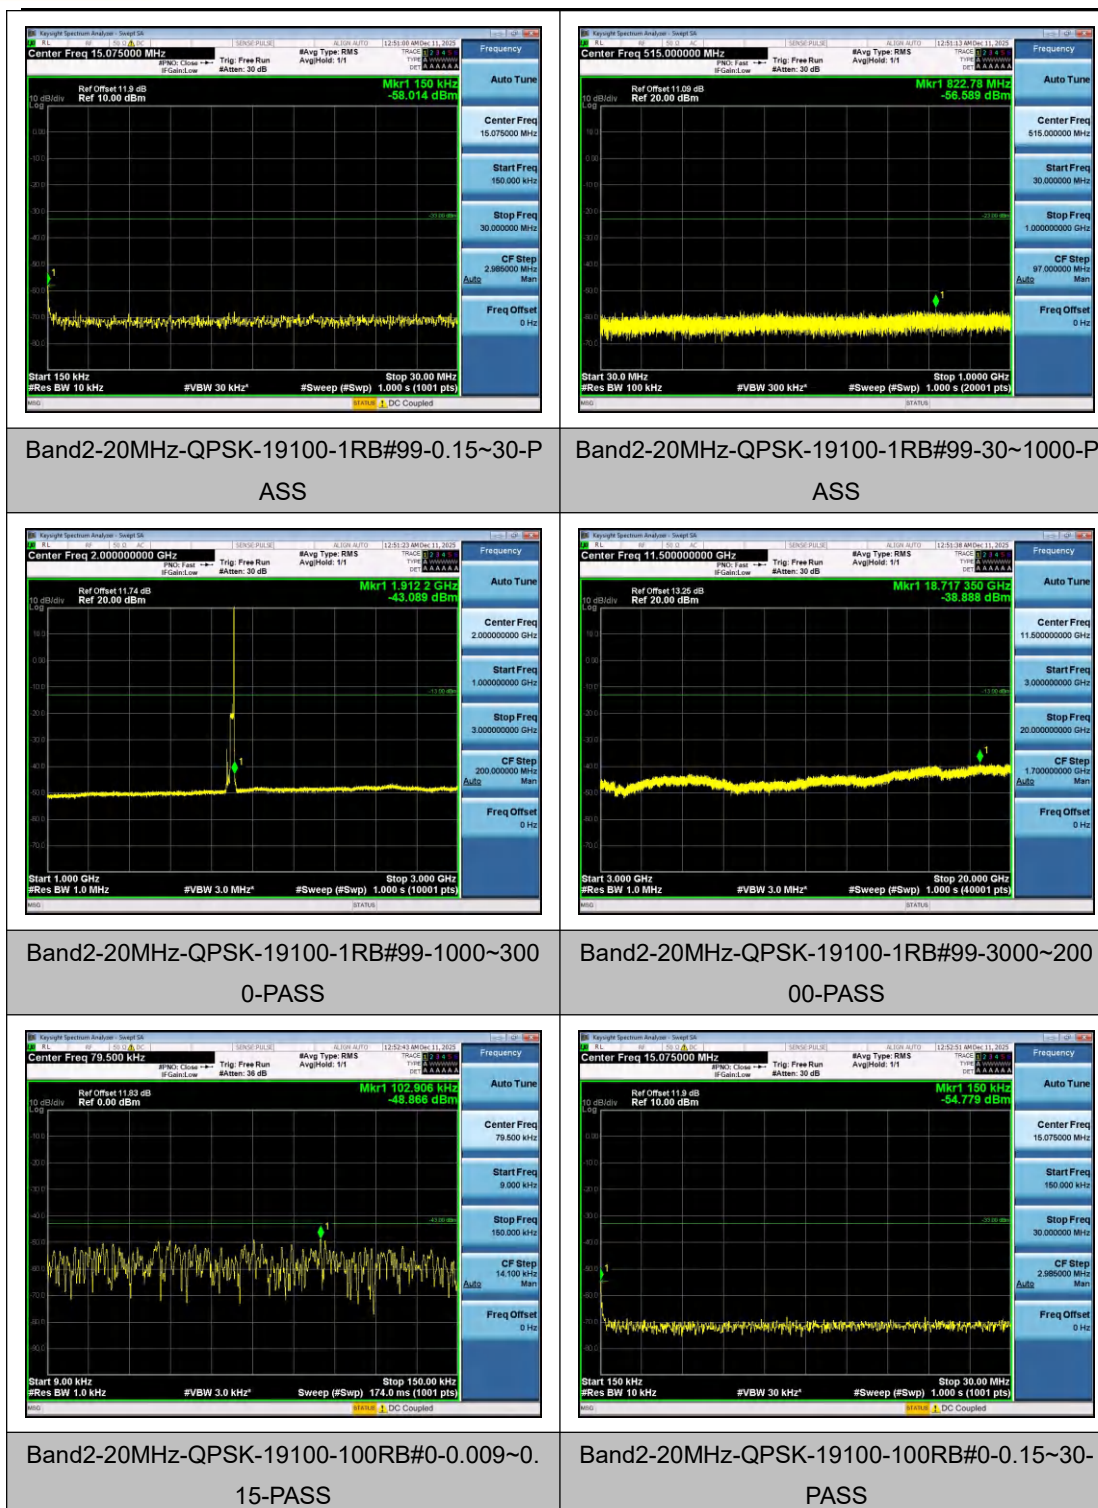

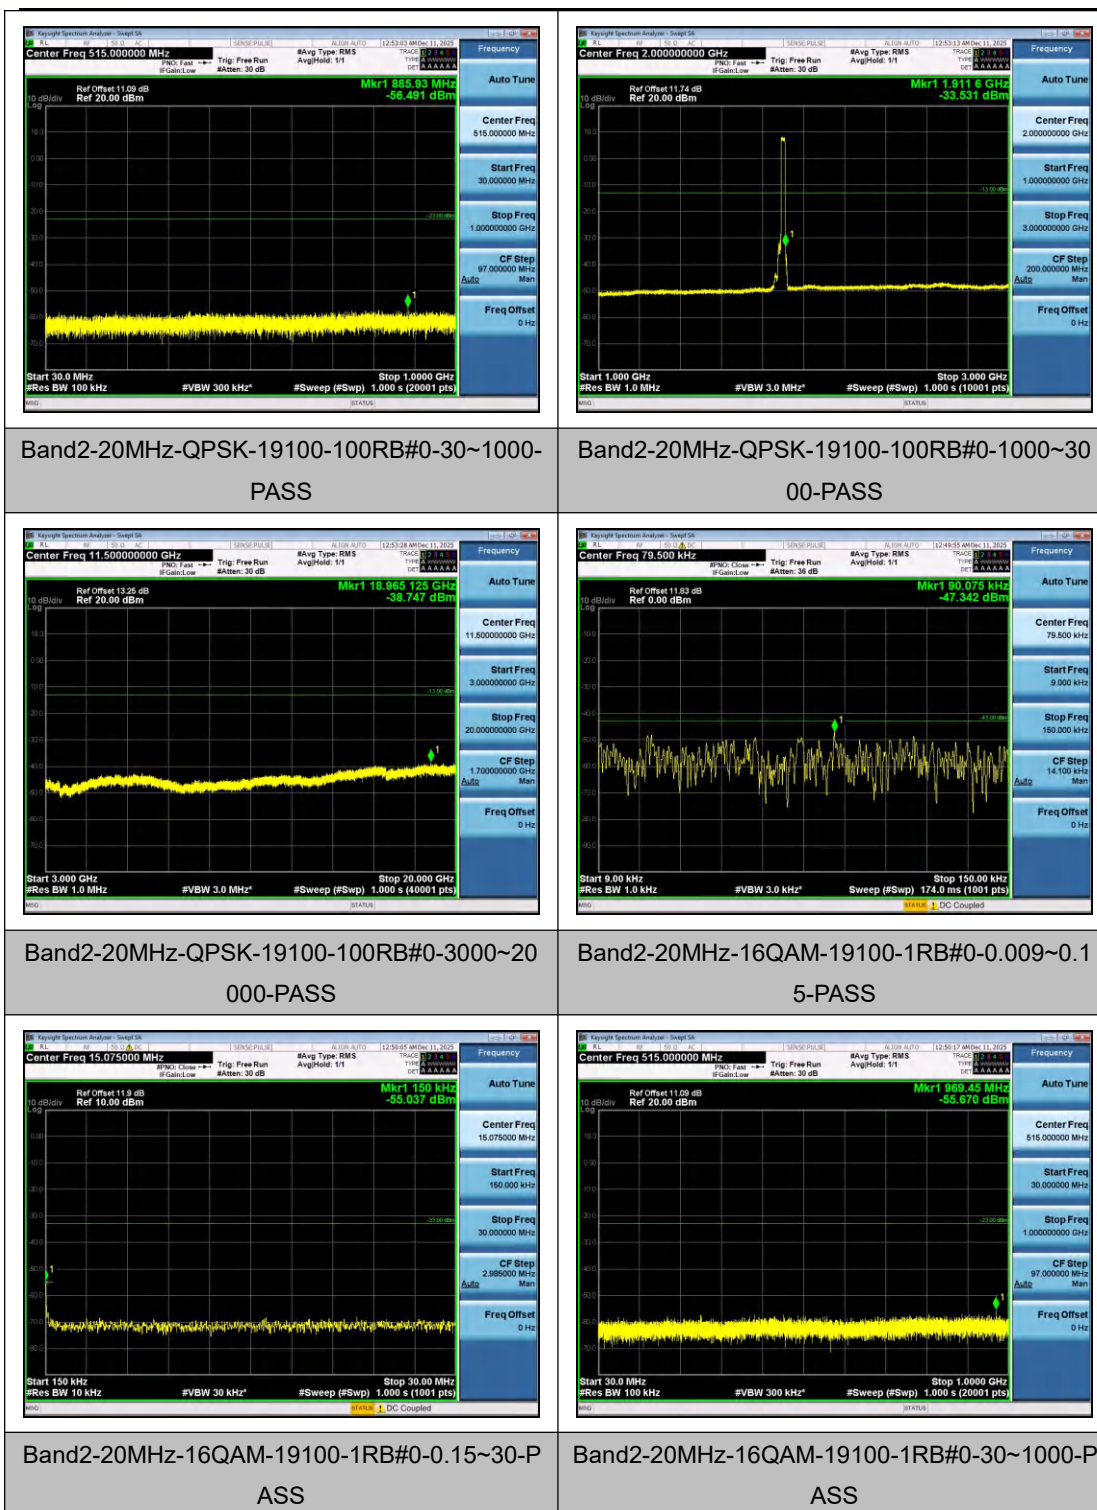

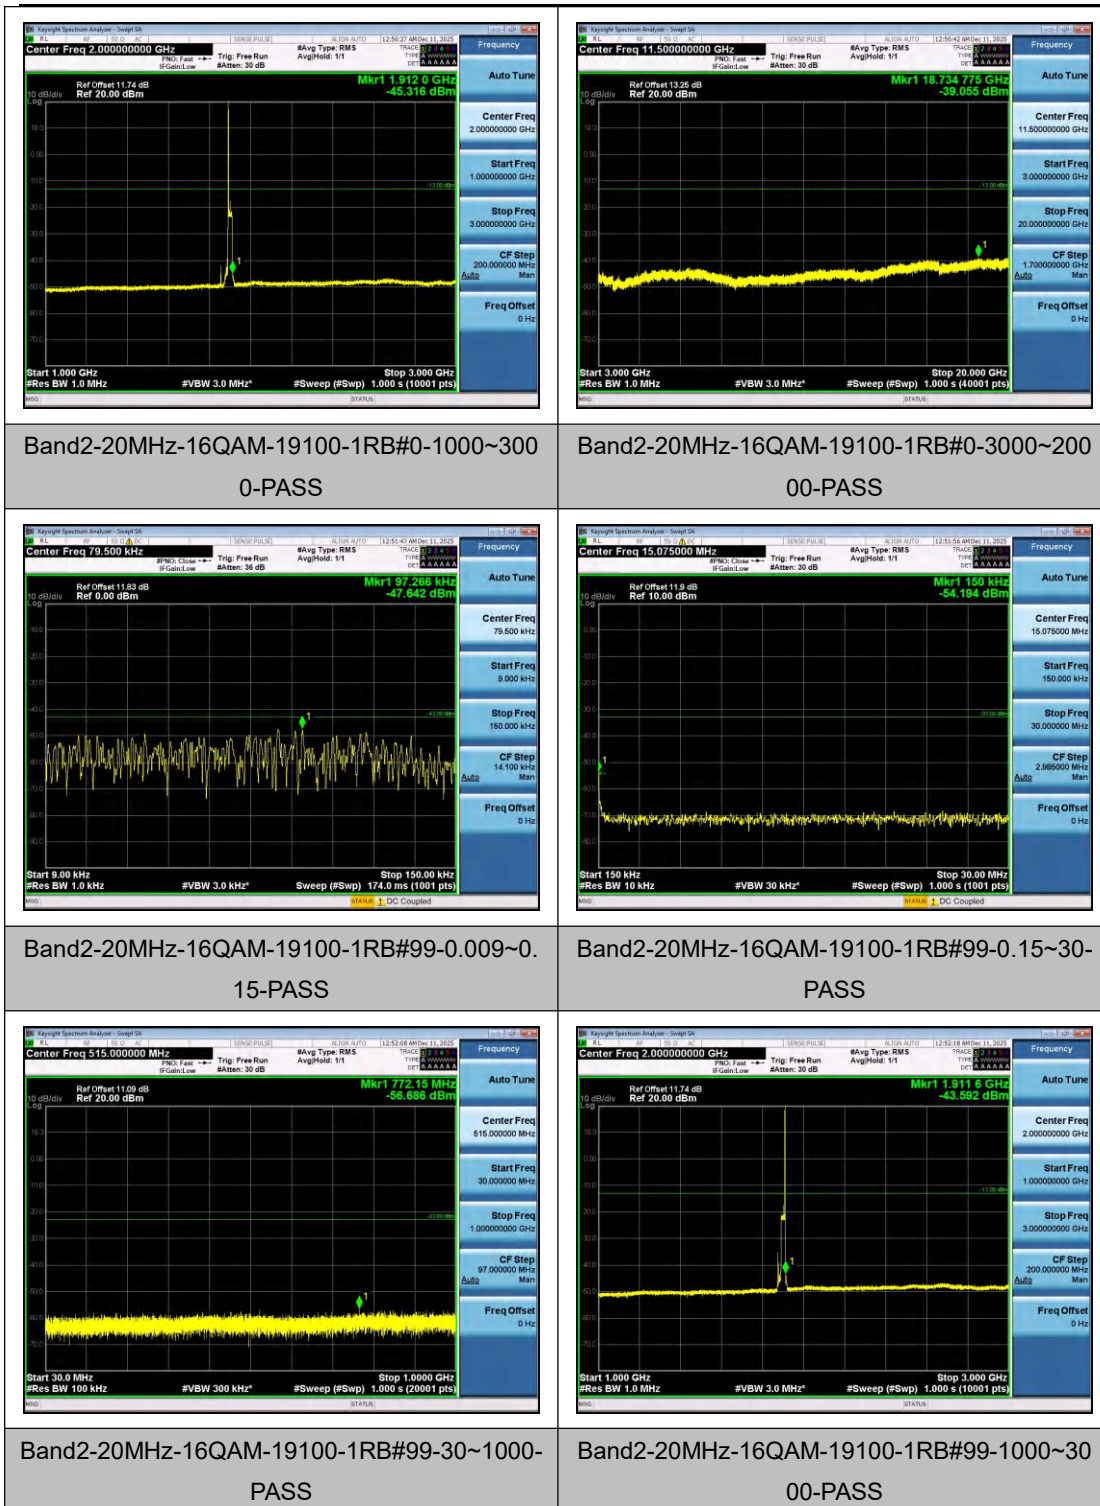

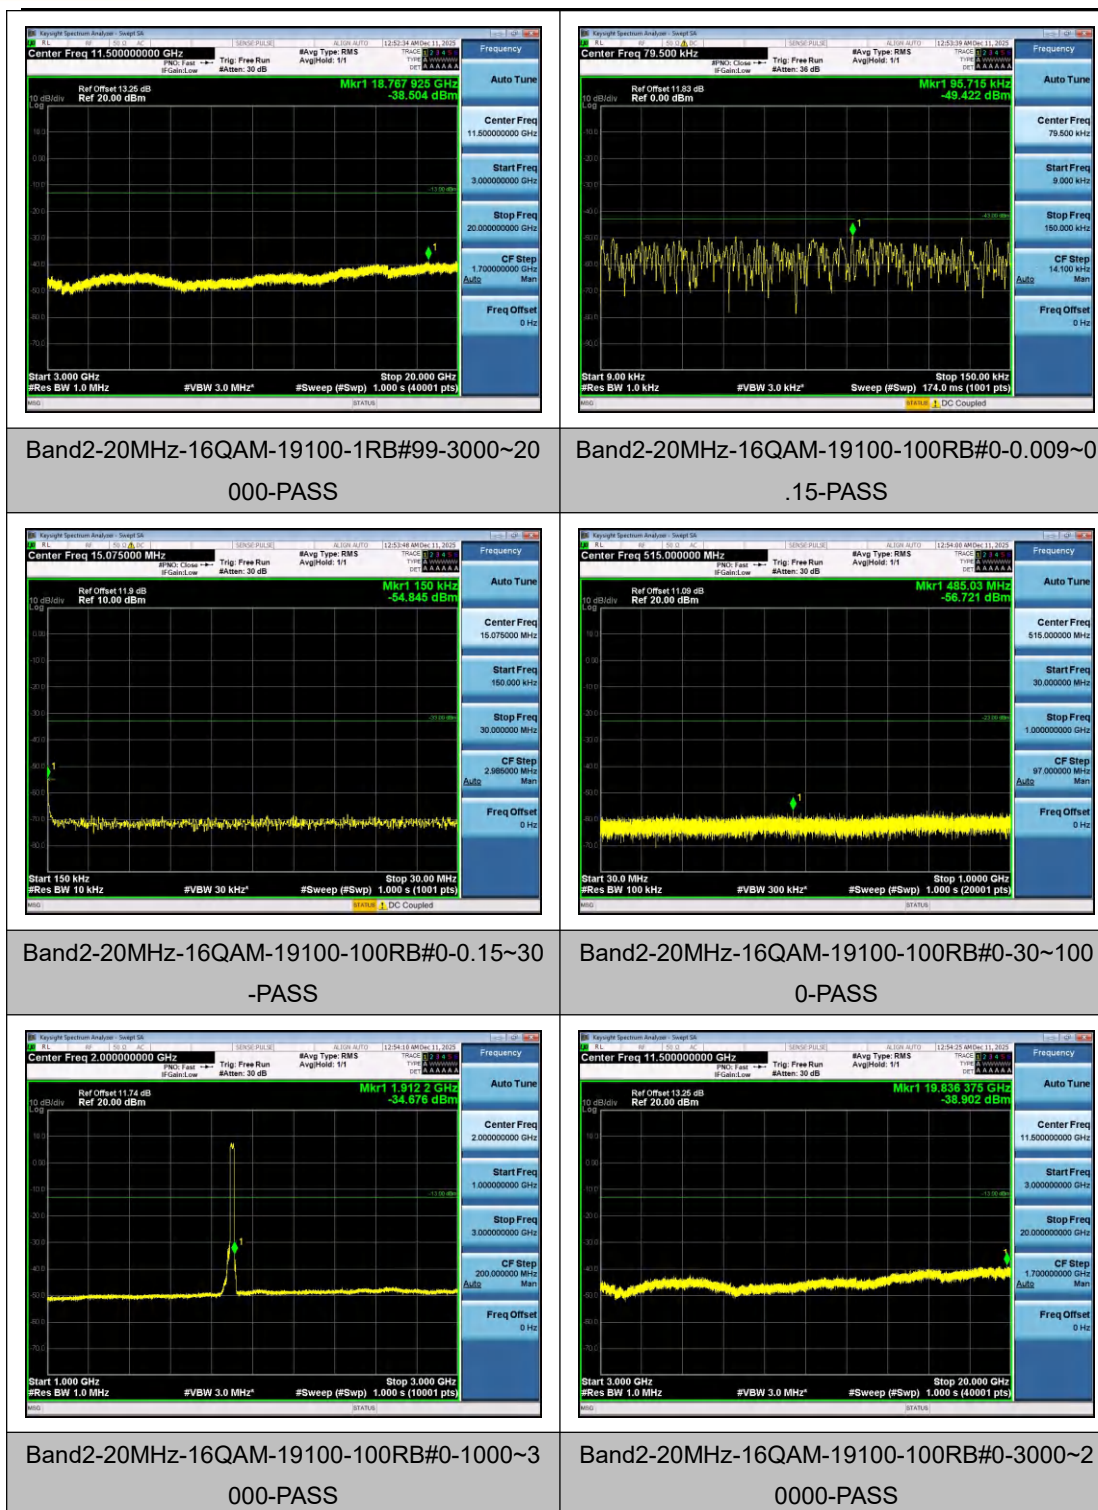

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15617	1851.23727	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15819	1851.23579	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15843	1851.23743	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15854	1851.23824	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15681	1851.23781	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15746	1851.23646	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45794	1880.53724	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45675	1880.53675	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45552	1880.53672	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45572	1880.53882	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45731	1880.53621	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45753	1880.53763	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75735	1909.83815	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75644	1909.83844	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75674	1909.83824	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.7617	1909.8379	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.7574	1909.8369	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.76161	1909.83731	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.16 492	1852.84 282	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.16 396	1852.83 916	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 375	1852.84 165	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.16 519	1852.83 439	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.16 534	1852.83 684	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.16 852	1852.83 352	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.66 433	1881.33 773	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.66 361	1881.34 431	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.66 349	1881.33 829	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.66 327	1881.33 447	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.66 698	1881.33 458	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.66 349	1881.33 409	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.15 996	1909.83 676	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.16 048	1909.83 988	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.16 173	1909.83 543	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.16 262	1909.83 462	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.16 072	1909.83 282	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.16 155	1909.83 305	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 255	1854.73 545	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.25 778	1854.73 978	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.25 719	1854.73 759	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 975	1854.74 595	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.27 015	1854.73 735	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.26 968	1854.73 268	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.76 419	1882.23 589	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.76 11	1882.23 45	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.75 747	1882.23 477	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76 433	1882.23 453	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 734	1882.23 474	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 771	1882.23 461	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.26 58	1909.73 55	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26 686	1909.73 266	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.26 652	1909.73 082	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.26 62	1909.73 49	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26 568	1909.73 308	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.26 352	1909.73 592	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.55 222	1859.46 892	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.55 37	1859.46 81	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.54 6	1859.46 64	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.54 883	1859.47 703	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.54 888	1859.47 418	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.55 267	1859.47 667	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.54 215	1884.46 815	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.53 758	1884.47 748	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.53 735	1884.48 005	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.54 304	1884.47 354	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.54 09	1884.46 88	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.54 32	1884.47 52	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.52 374	1909.46 064	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.53 782	1909.45 962	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.53 631	1909.45 821	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.52 699	1909.46 429	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.53 76	1909.46 01	1850-1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.53 257	1909.46 157	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.84 321	1864.18 321	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.81 768	1864.18 568	1850-1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.82 116	1864.17 816	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.82 725	1864.19 025	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.82 62	1864.19 92	1850-1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.81 41	1864.20 11	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.30 275	1886.72 775	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.30 083	1886.71 583	1850-1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.30 589	1886.71 789	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.31 282	1886.71 582	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.30 686	1886.71 386	1850-1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.31 79	1886.71 49	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.78 48	1909.19 78	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.78 82	1909.20 52	1850-1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.78 427	1909.19 827	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.80 227	1909.19 527	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.77 439	1909.20 039	1850-1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.79 869	1909.20 269	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	1851.11 234	1868.90 434	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	1851.10 29	1868.92 19	1850-1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	1851.11 32	1868.91 62	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	1851.10 08	1868.90 68	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	1851.08 096	1868.91 496	1850-1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	1851.10 089	1868.91 389	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1871.09 993	1888.95 293	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	1871.07 39	1888.95 59	1850-1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	1871.07 825	1888.94 125	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	1871.07 498	1888.94 398	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	1871.09 446	1888.95 846	1850-1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	1871.07 966	1888.97 766	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB#0	VN	NT	1891.06 979	1908.92 179	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	1891.04 045	1908.91 845	1850-1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	1891.04 559	1908.92 359	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	1891.07 459	1908.90 759	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	1891.09 51	1908.92 41	1850-1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	1891.07 579	1908.93 179	1850-1910	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature(°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.16 01	1851.23 77	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15 913	1851.23 843	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15 959	1851.23 799	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15 71	1851.23 81	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.15 761	1851.23 681	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.16 009	1851.23 519	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15 668	1851.23 668	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.15 98	1851.23 89	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.15 817	1851.23 637	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.15 562	1851.23 812	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15 693	1851.23 913	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.15 755	1851.23 815	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.15 754	1851.23 874	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15 643	1851.23 803	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.15 892	1851.23 862	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15 823	1851.23 883	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15 856	1851.23 906	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15 631	1851.23 771	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45 557	1880.53 787	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45 847	1880.53 777	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.45 76	1880.53 6	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45 766	1880.53 766	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45 743	1880.53 763	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45 657	1880.53 577	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45 607	1880.53 757	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.45 821	1880.53 881	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45 78	1880.53 72	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45 543	1880.53 843	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45 755	1880.53 845	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45 621	1880.53 731	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.45 55	1880.53 8	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.45 615	1880.53 955	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45 617	1880.53 667	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45 689	1880.53 759	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45 797	1880.53 807	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45 583	1880.53 873	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75 774	1909.83 734	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75 808	1909.83 798	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75 824	1909.83 714	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75 653	1909.83 713	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75 733	1909.83 833	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75 588	1909.83 858	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75 721	1909.83 831	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75 676	1909.83 736	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.75 897	1909.83 657	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75 984	1909.83 644	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75 852	1909.83 862	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.76 028	1909.83 778	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.75 906	1909.83 706	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.75 88	1909.83 8	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.75 59	1909.83 9	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.75 706	1909.83 756	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.76 097	1909.83 797	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.75 622	1909.83 762	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.16 46	1852.83 93	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.16 6	1852.83 8	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.16 472	1852.84 142	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.16 618	1852.84 018	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.16 449	1852.84 509	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.16 422	1852.84 082	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.16 521	1852.84 001	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.16 437	1852.84 157	1850-1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.16 569	1852.84 279	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.16 441	1852.83 781	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.16 723	1852.83 563	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.17 04	1852.83 79	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.16 795	1852.83 365	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.16 627	1852.83 907	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.16 727	1852.83 807	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.16 907	1852.83 857	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.16 536	1852.83 736	1850-1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.16 747	1852.83 547	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.66 362	1881.33 662	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.66 516	1881.33 806	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.66 552	1881.33 692	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.66 481	1881.33 971	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.66 383	1881.34 023	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.66 292	1881.33 922	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.66 291	1881.34 401	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.66 541	1881.33 681	1850-1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.66 473	1881.33 623	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.66 368	1881.33 428	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.66 525	1881.33 465	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.66 477	1881.33 277	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.66 646	1881.32 976	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.66 519	1881.33 469	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.66 536	1881.33 756	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.66 394	1881.33 654	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.66 309	1881.33 209	1850-1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.66 513	1881.33 133	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.16 031	1909.83 891	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.16 11	1909.83 86	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.15 981	1909.83 301	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.16 222	1909.83 512	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.16 199	1909.83 569	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.16 099	1909.83 579	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.16 367	1909.83 647	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.15 856	1909.83 416	1850-1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.16 229	1909.83 769	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.16 198	1909.83 178	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.16 296	1909.83 076	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.16 213	1909.83 543	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.16 315	1909.83 295	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.15 985	1909.83 445	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.16 093	1909.83 393	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.15 966	1909.83 626	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.16 515	1909.82 975	1850-1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.16 1	1909.83 36	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.26 724	1854.73 494	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.25 777	1854.73 777	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.26 14	1854.73 6	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.26 238	1854.74 178	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.25 834	1854.73 744	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.26 414	1854.73 534	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.25 712	1854.73 432	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.26 711	1854.73 331	1850-1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.26 148	1854.73 848	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.27 418	1854.74 048	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.26 816	1854.74 196	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.27 01	1854.73 63	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.26 706	1854.73 946	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.26 854	1854.73 464	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.27 012	1854.74 022	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26 697	1854.73 847	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.26 888	1854.74 198	1850-1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.26 542	1854.74 092	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.76 328	1882.23 448	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.76 497	1882.23 587	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.76 525	1882.23 445	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.75 989	1882.23 339	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.76 321	1882.23 251	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.76 355	1882.23 845	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.76 424	1882.22 814	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.76 145	1882.23 435	1850-1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.76 155	1882.23 365	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.76 437	1882.23 447	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76 367	1882.23 197	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.76 259	1882.23 419	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.77 047	1882.23 867	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.76 422	1882.23 872	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76 737	1882.23 157	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.76 537	1882.23 577	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.76 588	1882.23 198	1850-1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76 578	1882.23 688	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.26 614	1909.73 384	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.26 603	1909.72 923	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.26 582	1909.72 832	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.26 584	1909.73 134	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.26 719	1909.73 099	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.26 769	1909.73 309	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.26 569	1909.73 489	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.26 771	1909.73 341	1850-1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.26 572	1909.73 172	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.26 318	1909.73 218	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26 794	1909.73 514	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.27 066	1909.73 046	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.26 509	1909.73 339	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.26 565	1909.73 545	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.26 491	1909.73 131	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.26 664	1909.73 334	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.26 523	1909.73 153	1850-1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.26 685	1909.73 415	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.55 13	1859.46 94	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.55 158	1859.46 748	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.55 416	1859.47 186	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.54 722	1859.46 572	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.55 423	1859.46 693	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.55 538	1859.46 438	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.55 318	1859.47 288	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.55 071	1859.47 591	1850-1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.55 736	1859.46 866	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.55 217	1859.46 897	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.55 672	1859.47 532	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.55 649	1859.46 839	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.55 374	1859.47 274	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.54 69	1859.46 93	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.55 391	1859.47 291	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.55 36	1859.46 71	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.55 431	1859.47 251	1850-1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.55 452	1859.47 442	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.54 669	1884.47 769	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.53 936	1884.47 906	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.53 839	1884.47 099	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.53 81	1884.47 18	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.54 357	1884.47 877	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.53 927	1884.47 137	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.53 138	1884.47 608	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.54 135	1884.48 245	1850-1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.53 84	1884.48 02	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.54 31	1884.47 08	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.54 828	1884.47 638	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.54 75	1884.46 98	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.54 428	1884.48 048	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.54 901	1884.46 851	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.54 2	1884.47 49	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.53 759	1884.47 299	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.54 566	1884.48 166	1850-1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.53 646	1884.47 026	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.53 633	1909.46 053	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.52 879	1909.46 599	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.52 413	1909.46 663	1850-1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.53 156	1909.45 976	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com