

|       |       |       |       |        |    |     |                |                |           |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|-----------|------|
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 10  | 1900.52<br>744 | 1909.45<br>834 | 1850-1910 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 20  | 1900.53<br>387 | 1909.46<br>497 | 1850-1910 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 30  | 1900.53<br>385 | 1909.46<br>245 | 1850-1910 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 40  | 1900.52<br>859 | 1909.46<br>099 | 1850-1910 | PASS |
| Band2 | 10MHz | QPSK  | 19150 | 50RB#0 | NV | 50  | 1900.52<br>27  | 1909.45<br>96  | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -30 | 1900.53<br>72  | 1909.46<br>37  | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -20 | 1900.53<br>634 | 1909.46<br>674 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | -10 | 1900.52<br>909 | 1909.46<br>239 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 0   | 1900.53<br>091 | 1909.45<br>861 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 10  | 1900.53<br>586 | 1909.45<br>836 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 20  | 1900.52<br>482 | 1909.46<br>072 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 30  | 1900.53<br>406 | 1909.46<br>016 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 40  | 1900.53<br>153 | 1909.46<br>533 | 1850-1910 | PASS |
| Band2 | 10MHz | 16QAM | 19150 | 50RB#0 | NV | 50  | 1900.53<br>516 | 1909.45<br>816 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -30 | 1850.83<br>48  | 1864.18<br>08  | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -20 | 1850.83<br>677 | 1864.18<br>677 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | -10 | 1850.83<br>023 | 1864.18<br>123 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 0   | 1850.83<br>172 | 1864.18<br>072 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 10  | 1850.82<br>891 | 1864.18<br>091 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 20  | 1850.82<br>444 | 1864.17<br>744 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 30  | 1850.82<br>598 | 1864.17<br>998 | 1850-1910 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |           |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|-----------|------|
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 40  | 1850.83<br>235 | 1864.18<br>035 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18675 | 75RB#0 | NV | 50  | 1850.81<br>428 | 1864.18<br>128 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -30 | 1850.82<br>071 | 1864.18<br>871 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -20 | 1850.82<br>068 | 1864.19<br>068 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | -10 | 1850.82<br>758 | 1864.18<br>958 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 0   | 1850.81<br>148 | 1864.19<br>348 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 10  | 1850.83<br>438 | 1864.18<br>938 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 20  | 1850.82<br>615 | 1864.20<br>115 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 30  | 1850.80<br>867 | 1864.19<br>567 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 40  | 1850.82<br>132 | 1864.18<br>632 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18675 | 75RB#0 | NV | 50  | 1850.83<br>384 | 1864.18<br>684 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -30 | 1873.30<br>448 | 1886.73<br>148 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -20 | 1873.30<br>618 | 1886.72<br>318 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | -10 | 1873.30<br>904 | 1886.72<br>104 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 0   | 1873.30<br>124 | 1886.72<br>624 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 10  | 1873.30<br>536 | 1886.72<br>736 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 20  | 1873.30<br>661 | 1886.71<br>561 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 30  | 1873.30<br>142 | 1886.71<br>642 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 40  | 1873.31<br>954 | 1886.72<br>254 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 18900 | 75RB#0 | NV | 50  | 1873.30<br>676 | 1886.71<br>276 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -30 | 1873.30<br>56  | 1886.70<br>46  | 1850-1910 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |           |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|-----------|------|
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -20 | 1873.29<br>888 | 1886.70<br>988 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | -10 | 1873.30<br>383 | 1886.70<br>583 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 0   | 1873.30<br>804 | 1886.71<br>404 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 10  | 1873.31<br>401 | 1886.72<br>201 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 20  | 1873.30<br>663 | 1886.71<br>863 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 30  | 1873.31<br>699 | 1886.70<br>299 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 40  | 1873.30<br>852 | 1886.70<br>552 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 18900 | 75RB#0 | NV | 50  | 1873.30<br>937 | 1886.70<br>537 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -30 | 1895.79<br>142 | 1909.19<br>342 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -20 | 1895.78<br>724 | 1909.19<br>424 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | -10 | 1895.78<br>628 | 1909.19<br>528 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 0   | 1895.78<br>818 | 1909.19<br>318 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 10  | 1895.78<br>765 | 1909.20<br>165 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 20  | 1895.78<br>819 | 1909.20<br>319 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 30  | 1895.77<br>995 | 1909.20<br>395 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 40  | 1895.80<br>329 | 1909.20<br>329 | 1850-1910 | PASS |
| Band2 | 15MHz | QPSK  | 19125 | 75RB#0 | NV | 50  | 1895.79<br>94  | 1909.20<br>34  | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -30 | 1895.79<br>211 | 1909.19<br>211 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -20 | 1895.78<br>422 | 1909.19<br>722 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | -10 | 1895.78<br>86  | 1909.20<br>36  | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0 | NV | 0   | 1895.77<br>839 | 1909.20<br>439 | 1850-1910 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |         |    |     |                |                |           |      |
|-------|-------|-------|-------|---------|----|-----|----------------|----------------|-----------|------|
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0  | NV | 10  | 1895.76<br>712 | 1909.19<br>512 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0  | NV | 20  | 1895.78<br>605 | 1909.19<br>705 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0  | NV | 30  | 1895.78<br>165 | 1909.20<br>265 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0  | NV | 40  | 1895.80<br>499 | 1909.20<br>099 | 1850-1910 | PASS |
| Band2 | 15MHz | 16QAM | 19125 | 75RB#0  | NV | 50  | 1895.78<br>532 | 1909.19<br>932 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | -30 | 1851.10<br>262 | 1868.91<br>262 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | -20 | 1851.10<br>882 | 1868.89<br>082 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | -10 | 1851.10<br>819 | 1868.91<br>619 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 0   | 1851.11<br>531 | 1868.90<br>931 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 10  | 1851.10<br>606 | 1868.92<br>406 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 20  | 1851.10<br>948 | 1868.90<br>548 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 30  | 1851.11<br>283 | 1868.90<br>983 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 40  | 1851.10<br>659 | 1868.91<br>459 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18700 | 100RB#0 | NV | 50  | 1851.10<br>797 | 1868.91<br>497 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | -30 | 1851.09<br>608 | 1868.91<br>208 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | -20 | 1851.09<br>193 | 1868.90<br>893 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | -10 | 1851.09<br>469 | 1868.91<br>069 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 0   | 1851.10<br>412 | 1868.92<br>012 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 10  | 1851.10<br>451 | 1868.91<br>151 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 20  | 1851.09<br>682 | 1868.92<br>482 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 30  | 1851.09<br>877 | 1868.91<br>277 | 1850-1910 | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |         |    |     |                |                |           |      |
|-------|-------|-------|-------|---------|----|-----|----------------|----------------|-----------|------|
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 40  | 1851.09<br>381 | 1868.88<br>881 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18700 | 100RB#0 | NV | 50  | 1851.08<br>883 | 1868.90<br>883 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | -30 | 1871.09<br>531 | 1888.95<br>831 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | -20 | 1871.08<br>051 | 1888.95<br>151 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | -10 | 1871.06<br>742 | 1888.96<br>242 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 0   | 1871.07<br>648 | 1888.95<br>848 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 10  | 1871.09<br>855 | 1888.95<br>055 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 20  | 1871.07<br>793 | 1888.95<br>993 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 30  | 1871.07<br>593 | 1888.95<br>293 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 40  | 1871.06<br>917 | 1888.96<br>817 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 18900 | 100RB#0 | NV | 50  | 1871.07<br>895 | 1888.94<br>995 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | -30 | 1871.10<br>005 | 1888.94<br>505 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | -20 | 1871.08<br>54  | 1888.96<br>74  | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | -10 | 1871.08<br>799 | 1888.95<br>899 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 0   | 1871.09<br>758 | 1888.94<br>458 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 10  | 1871.07<br>507 | 1888.96<br>907 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 20  | 1871.09<br>43  | 1888.97<br>83  | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 30  | 1871.10<br>262 | 1888.97<br>062 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 40  | 1871.10<br>009 | 1888.97<br>709 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 18900 | 100RB#0 | NV | 50  | 1871.09<br>179 | 1888.94<br>479 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | -30 | 1891.07<br>062 | 1908.92<br>562 | 1850-1910 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|       |       |       |       |         |    |     |                |                |           |      |
|-------|-------|-------|-------|---------|----|-----|----------------|----------------|-----------|------|
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | -20 | 1891.07<br>38  | 1908.91<br>18  | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | -10 | 1891.05<br>674 | 1908.91<br>974 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 0   | 1891.04<br>816 | 1908.92<br>416 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 10  | 1891.06<br>37  | 1908.93<br>07  | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 20  | 1891.06<br>312 | 1908.93<br>412 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 30  | 1891.05<br>8   | 1908.92<br>4   | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 40  | 1891.04<br>734 | 1908.92<br>434 | 1850-1910 | PASS |
| Band2 | 20MHz | QPSK  | 19100 | 100RB#0 | NV | 50  | 1891.05<br>853 | 1908.92<br>053 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | -30 | 1891.05<br>714 | 1908.911<br>14 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | -20 | 1891.08<br>381 | 1908.90<br>781 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | -10 | 1891.07<br>562 | 1908.93<br>362 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 0   | 1891.07<br>987 | 1908.92<br>487 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 10  | 1891.06<br>524 | 1908.94<br>824 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 20  | 1891.07<br>612 | 1908.93<br>212 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 30  | 1891.07<br>669 | 1908.93<br>569 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 40  | 1891.06<br>645 | 1908.93<br>845 | 1850-1910 | PASS |
| Band2 | 20MHz | 16QAM | 19100 | 100RB#0 | NV | 50  | 1891.07<br>504 | 1908.92<br>204 | 1850-1910 | PASS |


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Test Graphs

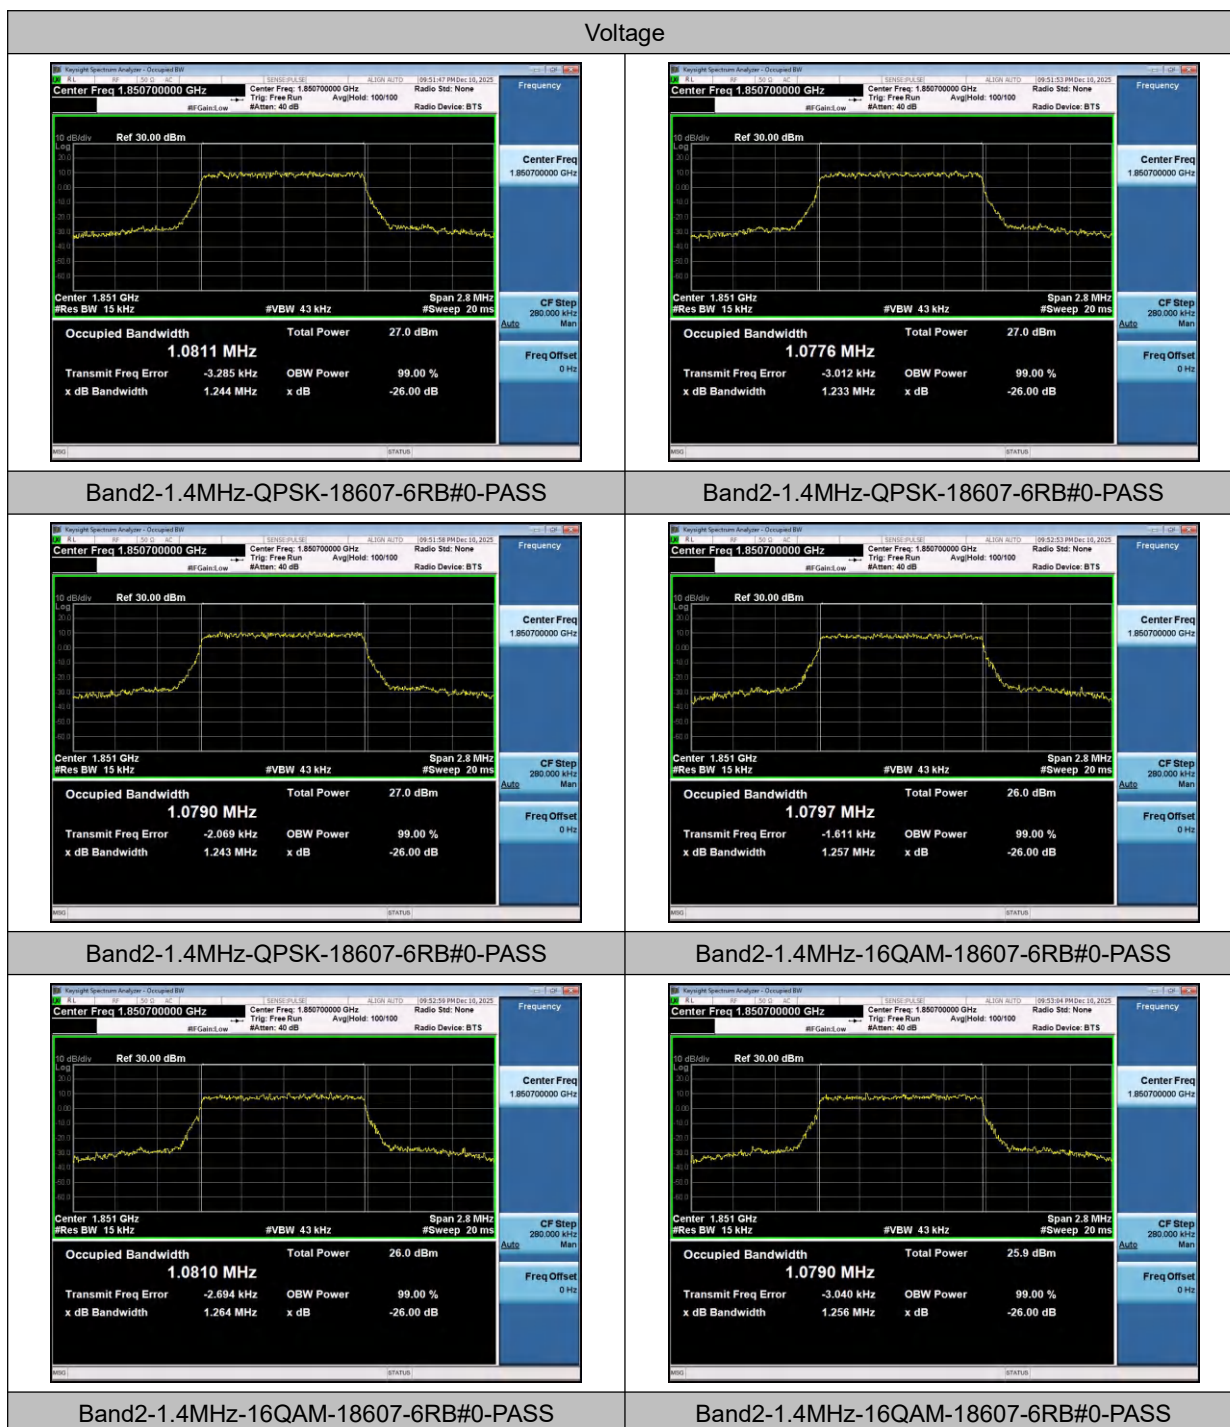

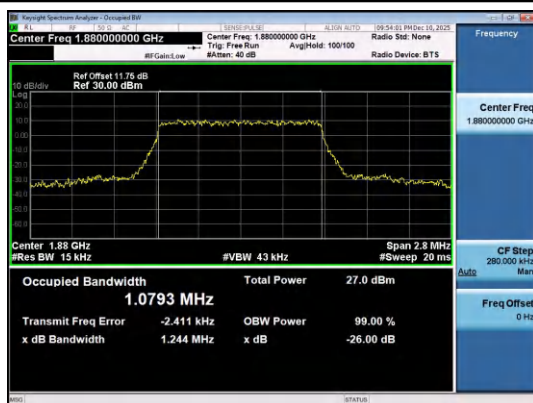

Band2-1.4MHz-QPSK-18900-6RB#0-PASS

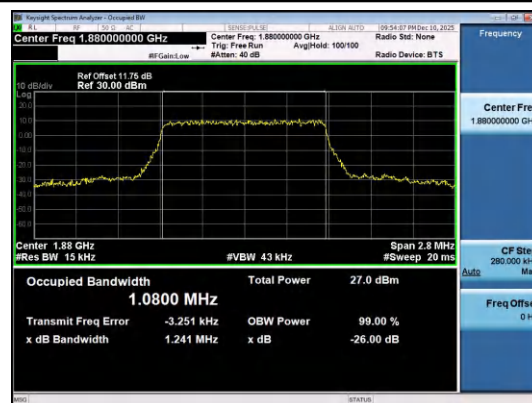


Band2-1.4MHz-QPSK-18900-6RB#0-PASS




Band2-1.4MHz-QPSK-18900-6RB#0-PASS



Band2-1.4MHz-16QAM-18900-6RB#0-PASS

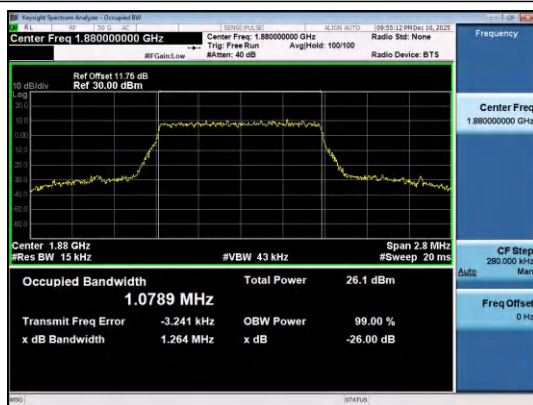

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

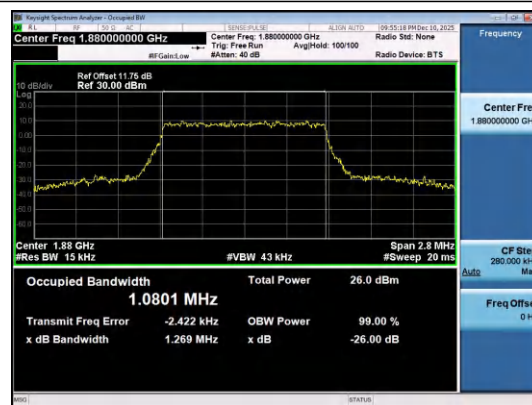


Band2-1.4MHz-16QAM-18900-6RB#0-PASS




Band2-1.4MHz-QPSK-19193-6RB#0-PASS




Band2-1.4MHz-QPSK-19193-6RB#0-PASS

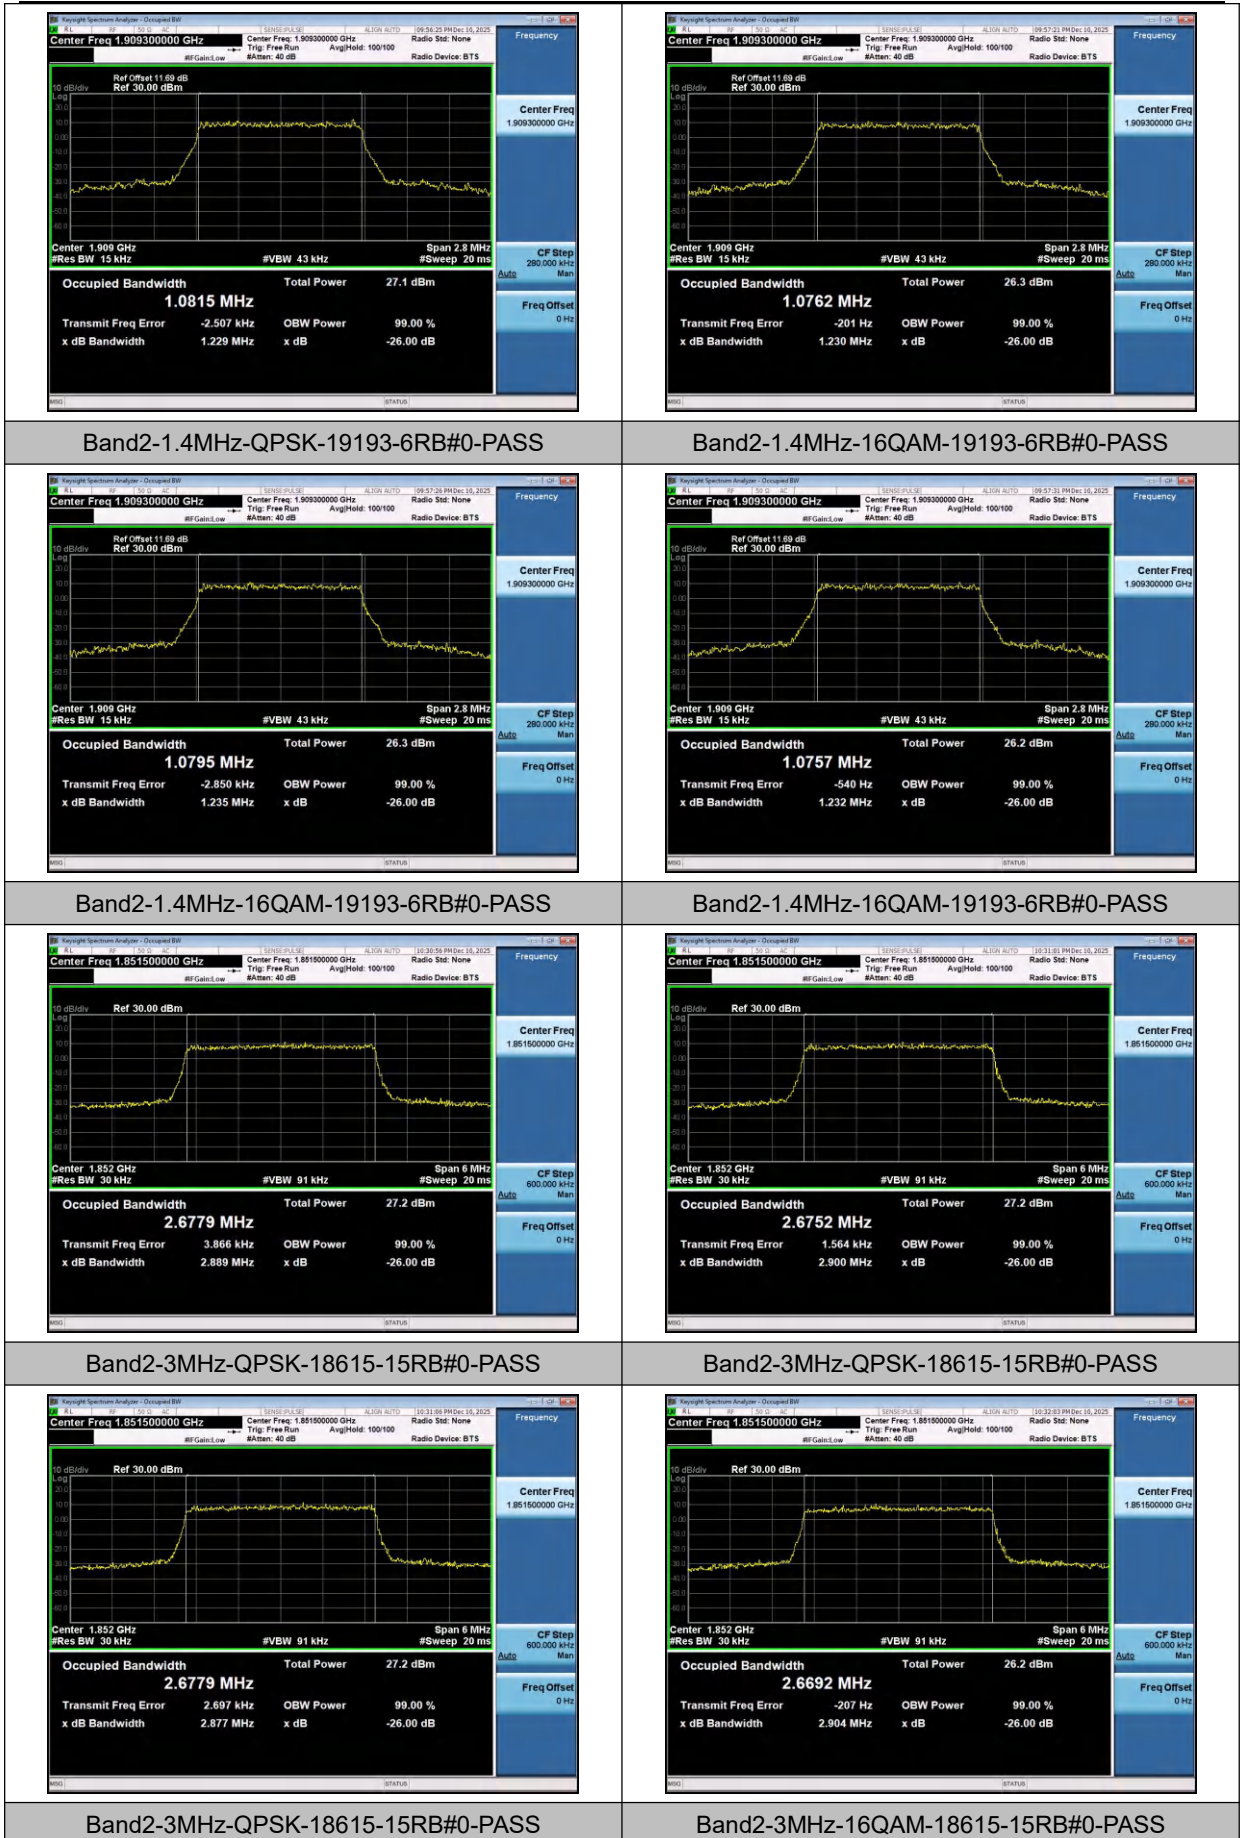


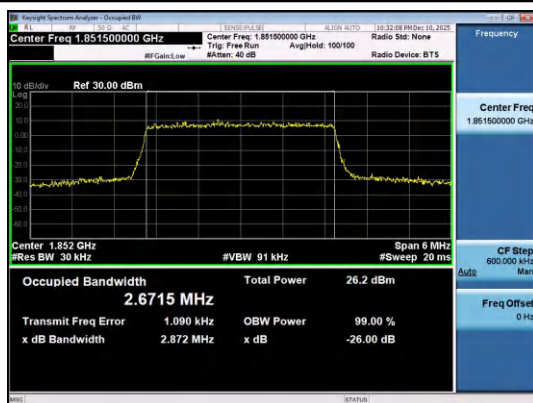

Band2-3MHz-16QAM-18615-15RB#0-PASS

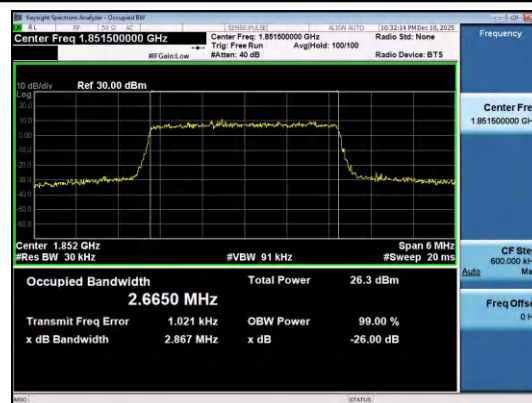


Band2-3MHz-16QAM-18615-15RB#0-PASS

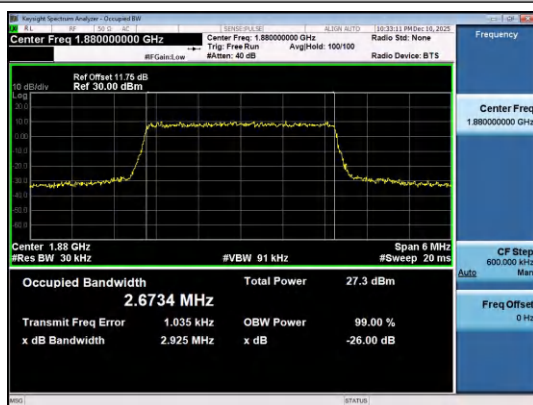


Band2-3MHz-QPSK-18900-15RB#0-PASS




Band2-3MHz-QPSK-18900-15RB#0-PASS

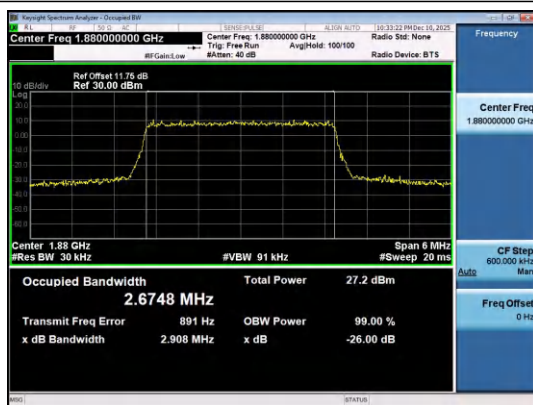

Band2-3MHz-QPSK-18900-15RB#0-PASS

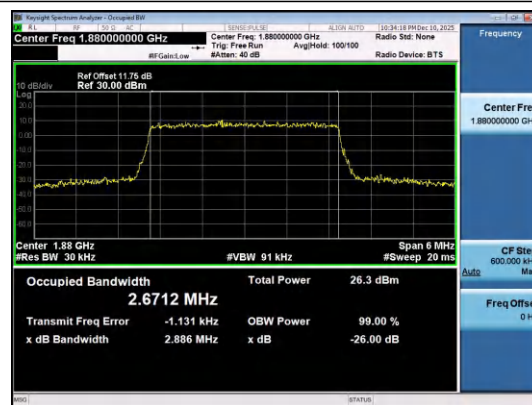


Band2-3MHz-16QAM-18900-15RB#0-PASS

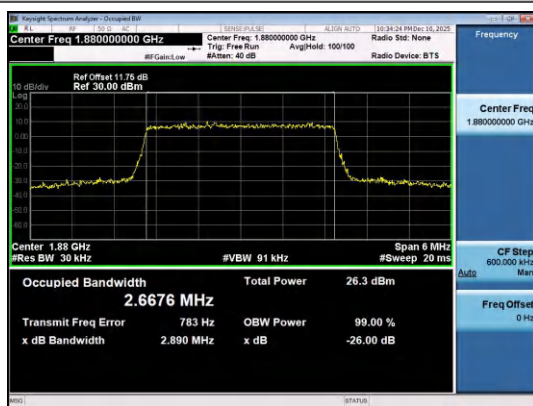


Band2-3MHz-16QAM-18900-15RB#0-PASS




Band2-3MHz-16QAM-18900-15RB#0-PASS

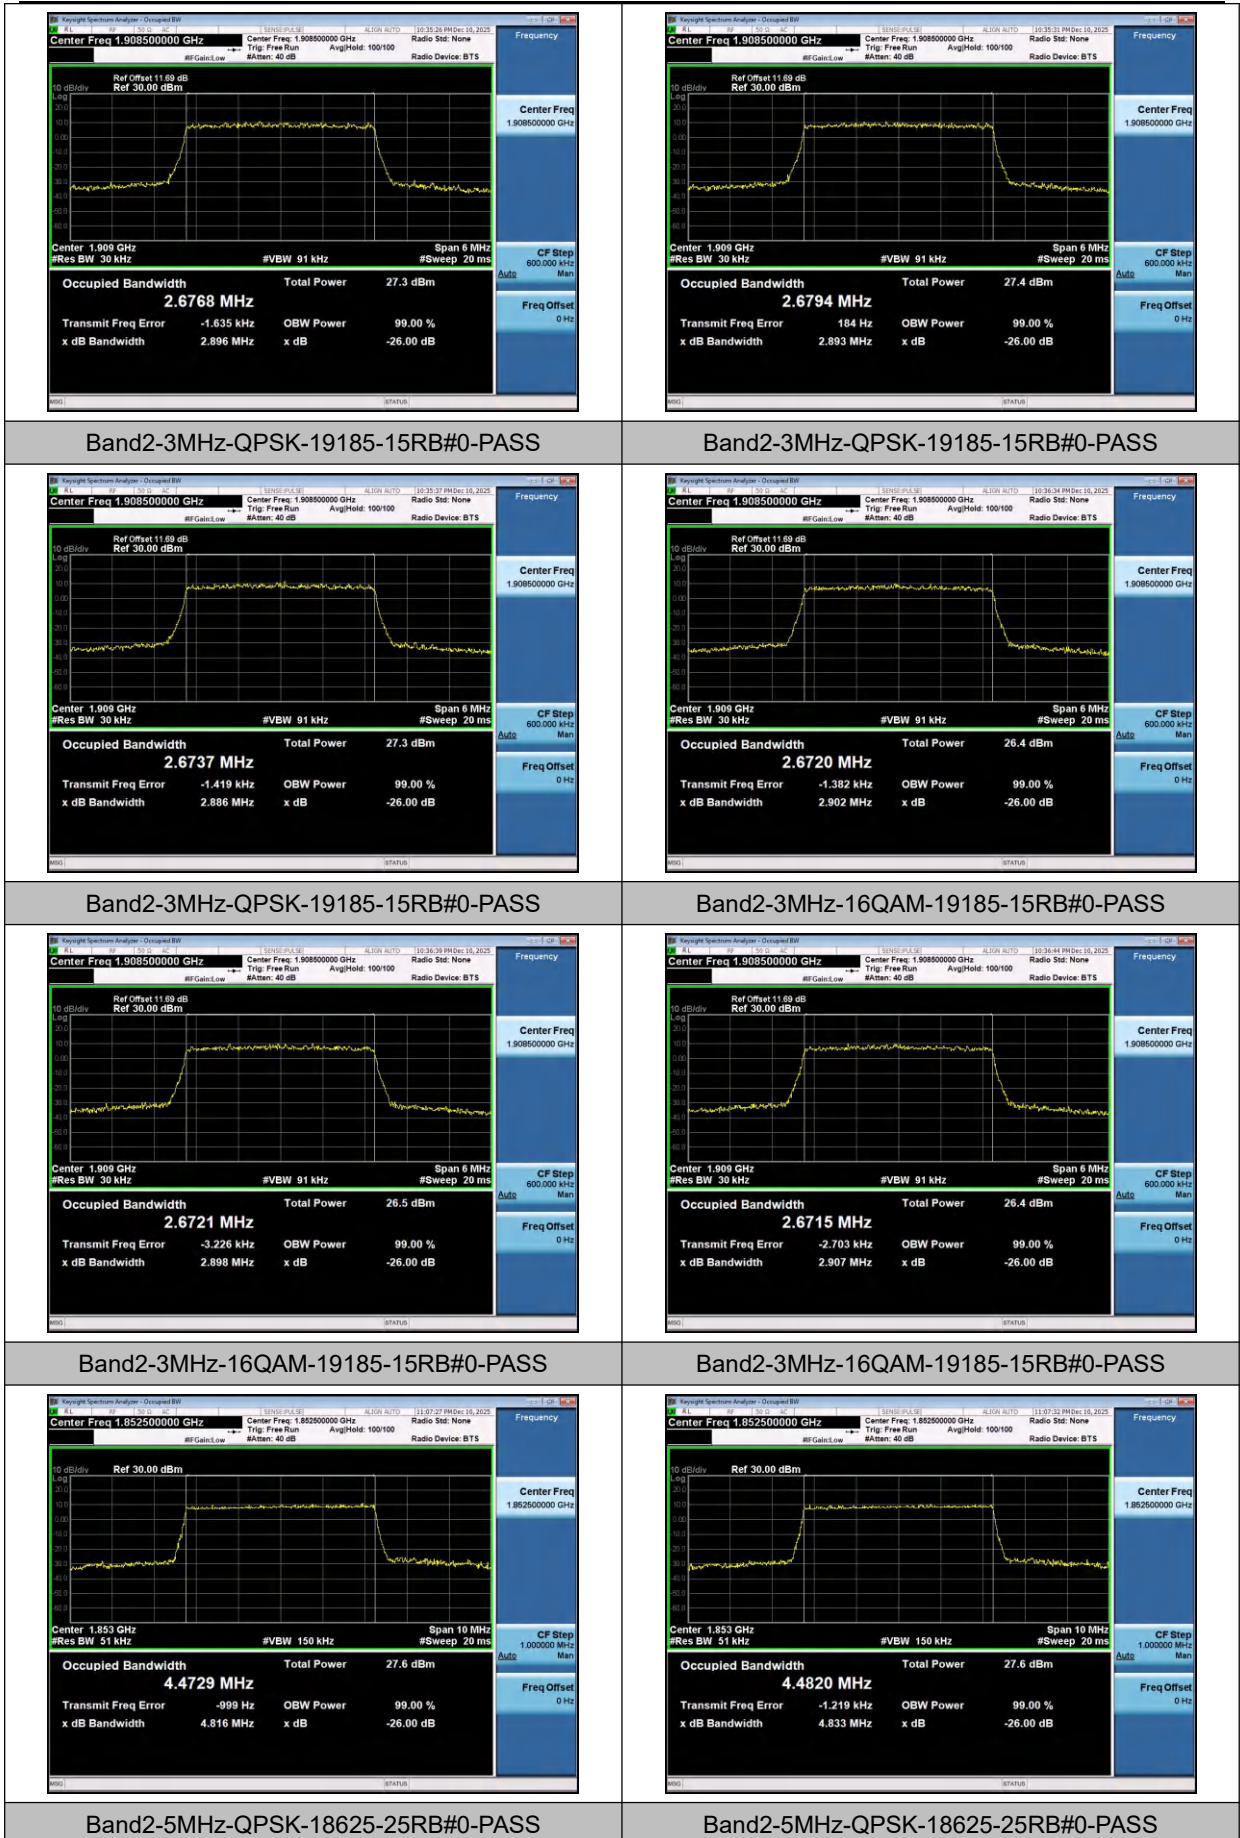


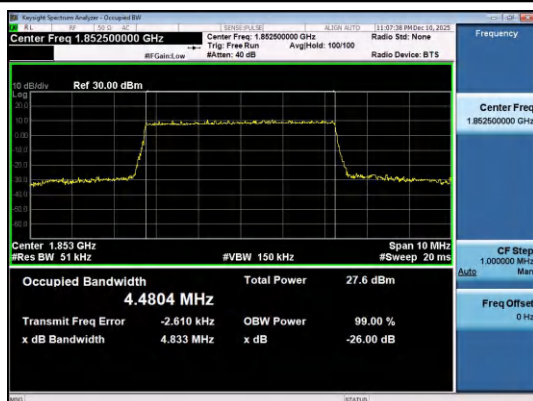

Band2-5MHz-QPSK-18625-25RB#0-PASS

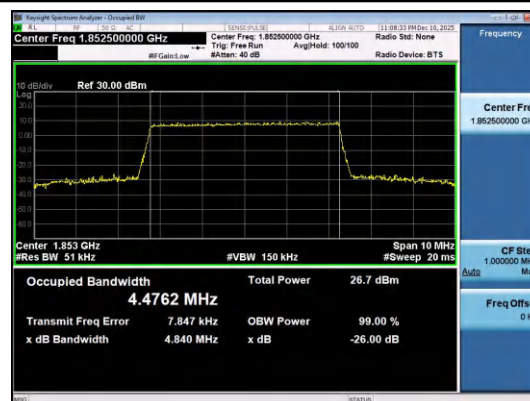


Band2-5MHz-16QAM-18625-25RB#0-PASS

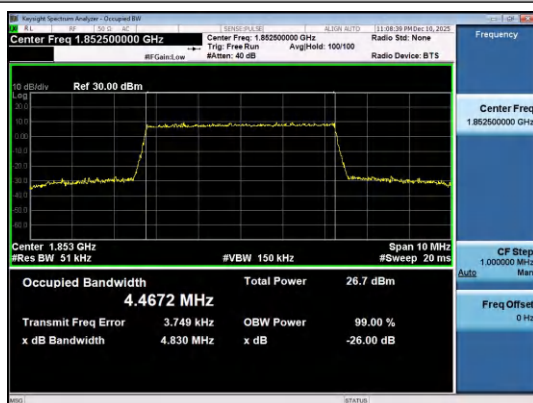


Band2-5MHz-16QAM-18625-25RB#0-PASS




Band2-5MHz-16QAM-18625-25RB#0-PASS

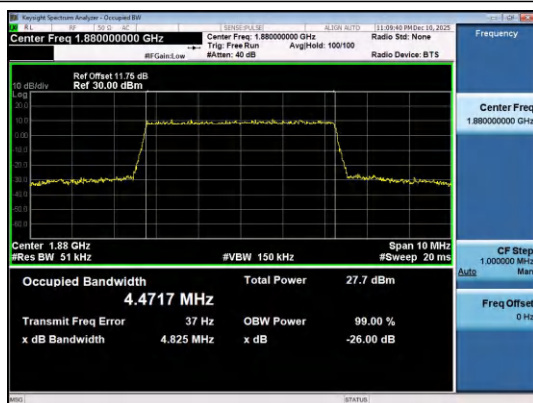


Band2-5MHz-QPSK-18900-25RB#0-PASS

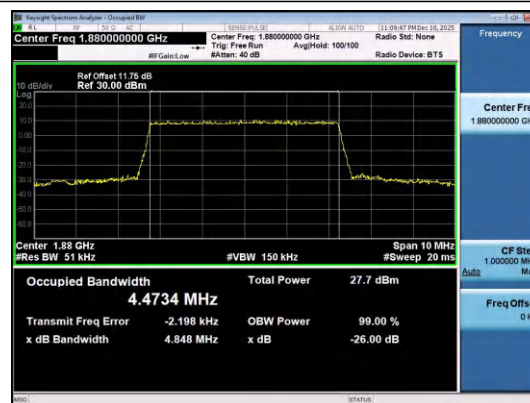


Band2-5MHz-QPSK-18900-25RB#0-PASS

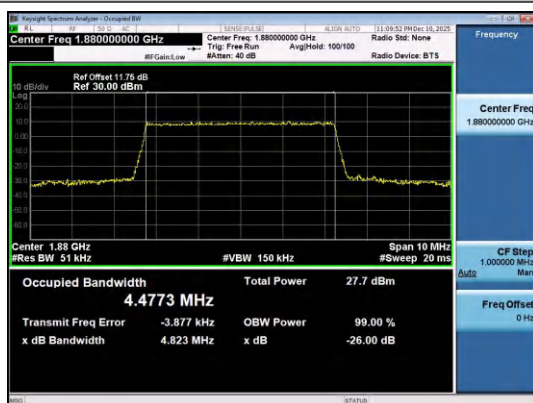


Band2-5MHz-QPSK-18900-25RB#0-PASS

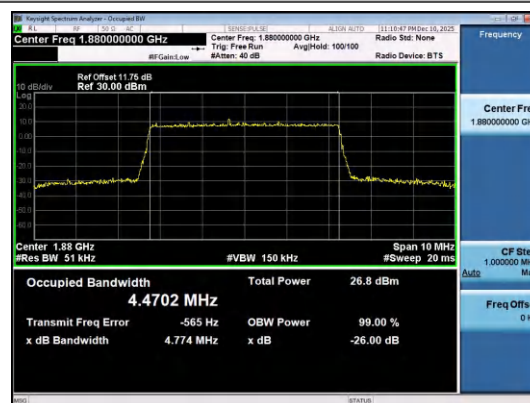


Band2-5MHz-16QAM-18900-25RB#0-PASS

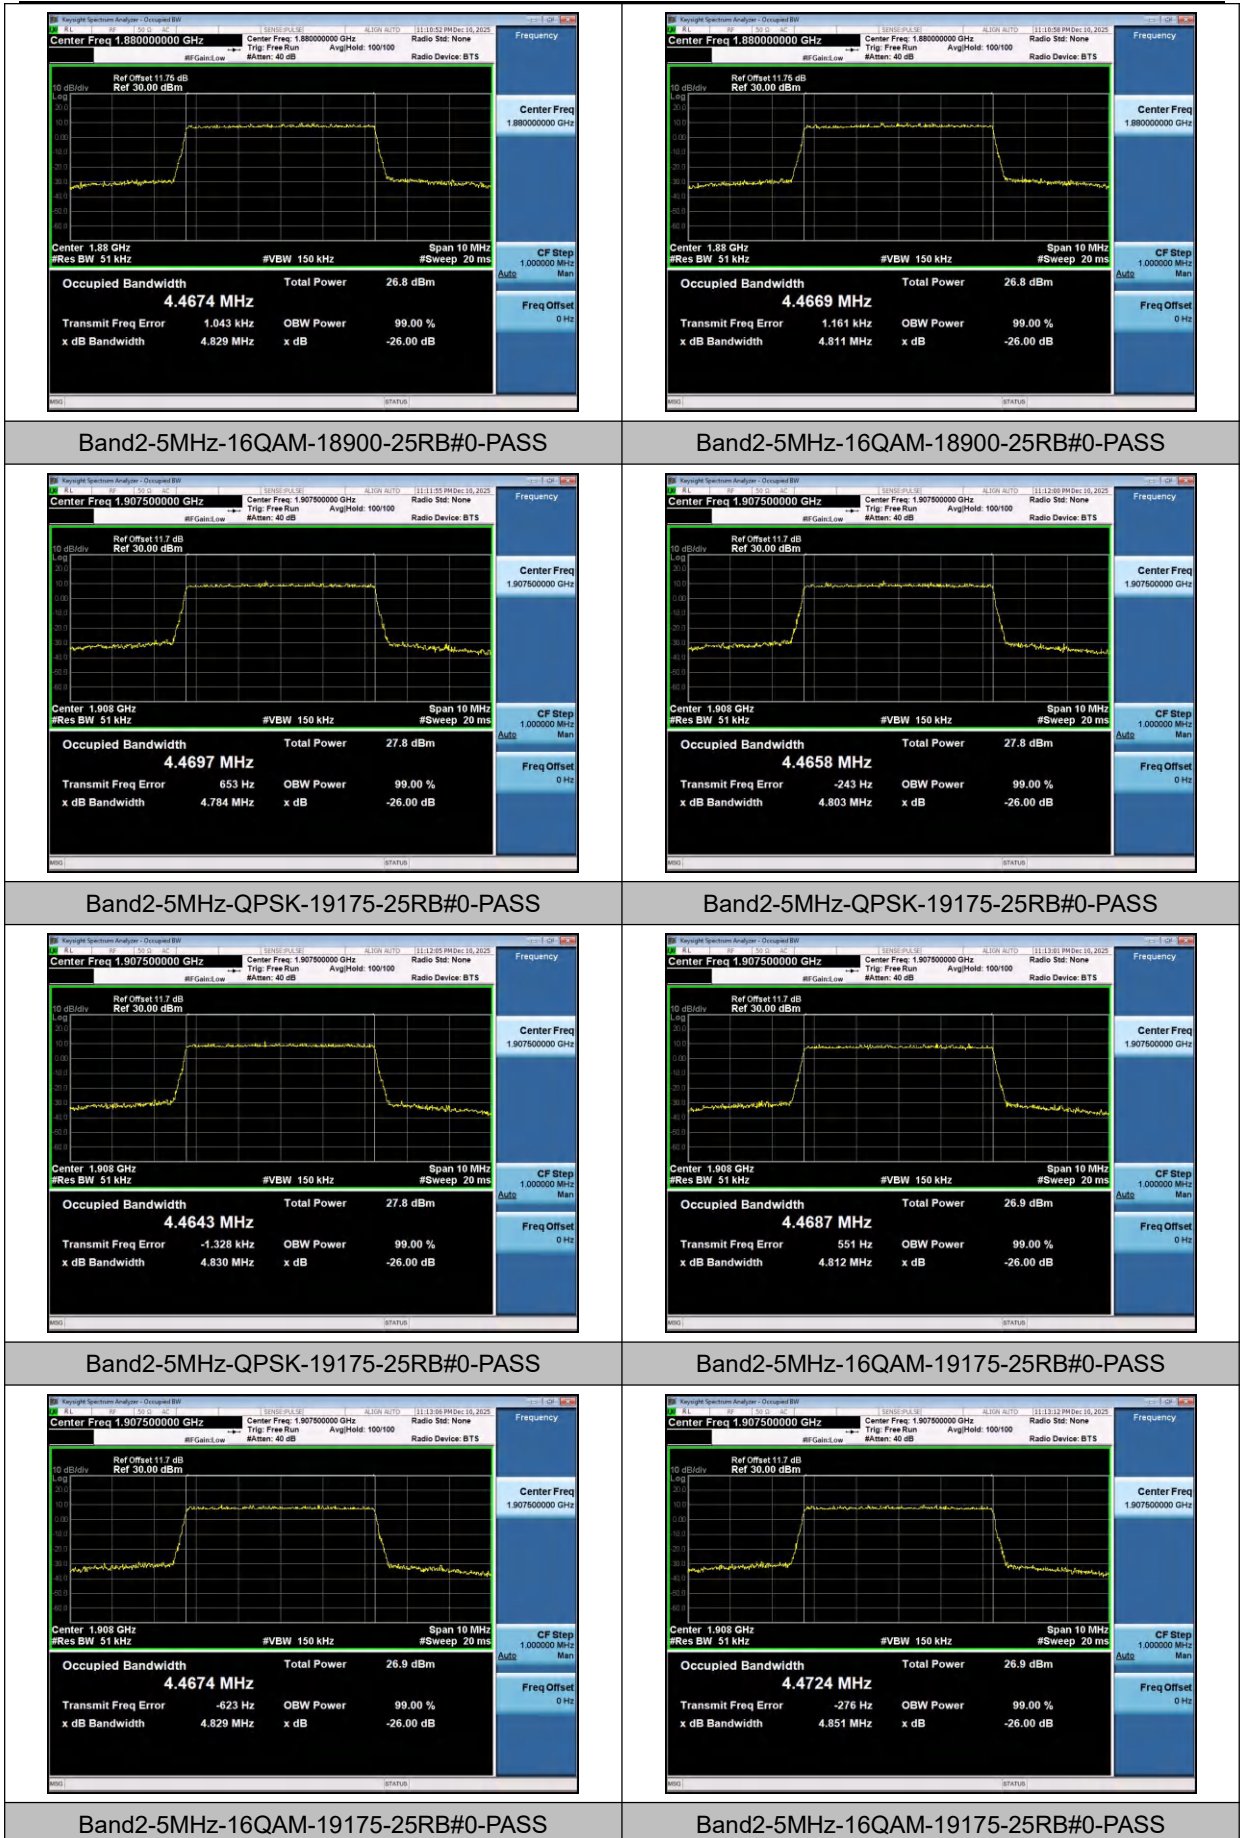


|                                                                                                                                                                                                                                                                                                                              |                                                                                                                                                                                                                                                                                                                              |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9167 MHz</p> <p>Total Power 27.6 dBm</p> <p>Transmit Freq Error 10.565 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.507 MHz</p> <p>x dB -26.00 dB</p> | <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9144 MHz</p> <p>Total Power 27.6 dBm</p> <p>Transmit Freq Error 10.895 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.516 MHz</p> <p>x dB -26.00 dB</p> |
| <p>Band2-10MHz-QPSK-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                    | <p>Band2-10MHz-QPSK-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                    |
| <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9204 MHz</p> <p>Total Power 27.6 dBm</p> <p>Transmit Freq Error 6.198 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.528 MHz</p> <p>x dB -26.00 dB</p>  | <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9282 MHz</p> <p>Total Power 26.7 dBm</p> <p>Transmit Freq Error 12.934 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.502 MHz</p> <p>x dB -26.00 dB</p> |
| <p>Band2-10MHz-QPSK-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                    | <p>Band2-10MHz-16QAM-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                   |
| <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9253 MHz</p> <p>Total Power 26.7 dBm</p> <p>Transmit Freq Error 11.528 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.482 MHz</p> <p>x dB -26.00 dB</p> | <p>Center Freq 1.855000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.855 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9240 MHz</p> <p>Total Power 26.7 dBm</p> <p>Transmit Freq Error 14.670 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.535 MHz</p> <p>x dB -26.00 dB</p> |
| <p>Band2-10MHz-16QAM-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                   | <p>Band2-10MHz-16QAM-18650-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                   |
| <p>Center Freq 1.880000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.88 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9260 MHz</p> <p>Total Power 27.8 dBm</p> <p>Transmit Freq Error 5.151 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.568 MHz</p> <p>x dB -26.00 dB</p>   | <p>Center Freq 1.880000000 GHz</p> <p>Ref 30.00 dBm</p> <p>Center 1.88 GHz #Res BW 100 kHz #VBW 300 kHz #Span 20 MHz #Sweep 20 ms</p> <p>Occupied Bandwidth 8.9399 MHz</p> <p>Total Power 27.8 dBm</p> <p>Transmit Freq Error 7.525 kHz</p> <p>OBW Power 99.00 %</p> <p>x dB Bandwidth 9.550 MHz</p> <p>x dB -26.00 dB</p>   |
| <p>Band2-10MHz-QPSK-18900-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                    | <p>Band2-10MHz-QPSK-18900-50RB#0-PASS</p>                                                                                                                                                                                                                                                                                    |

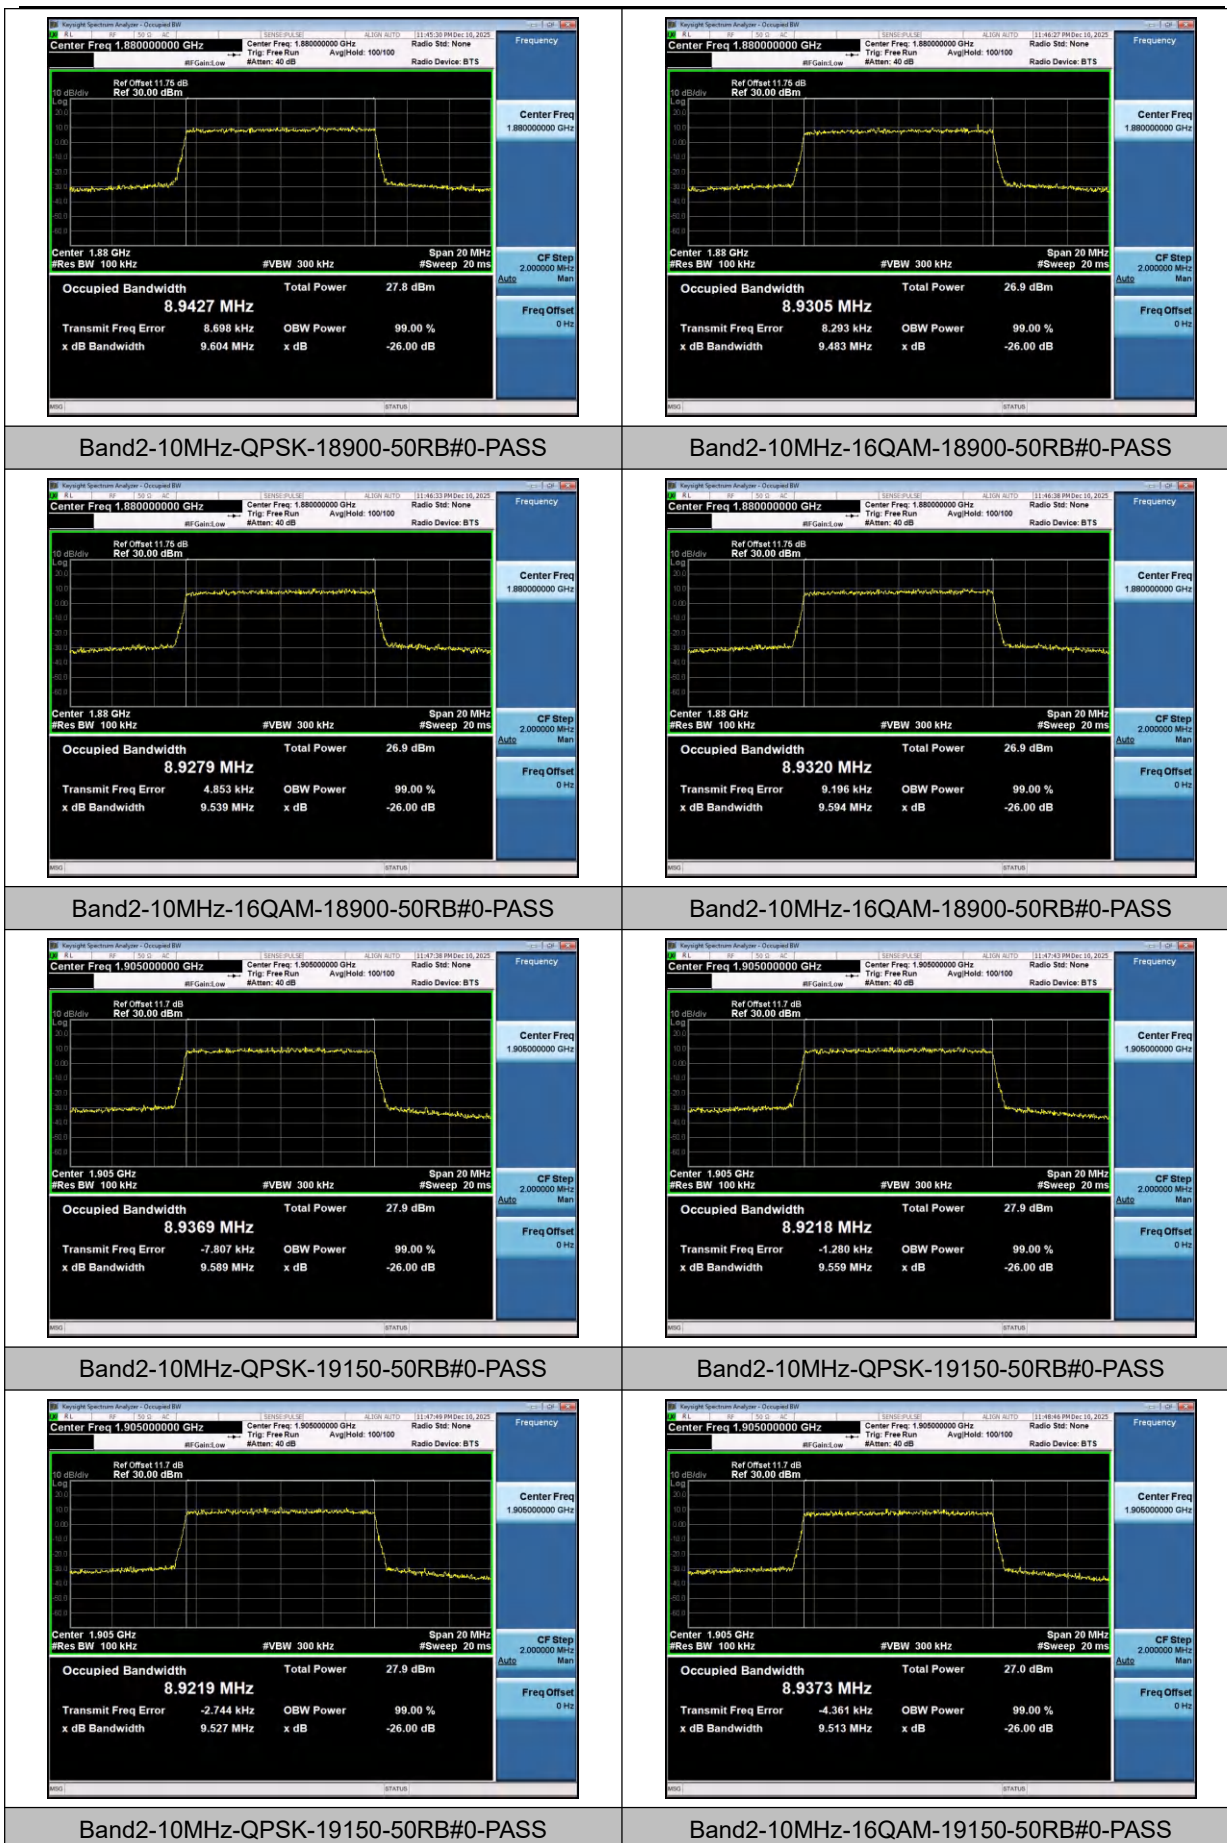


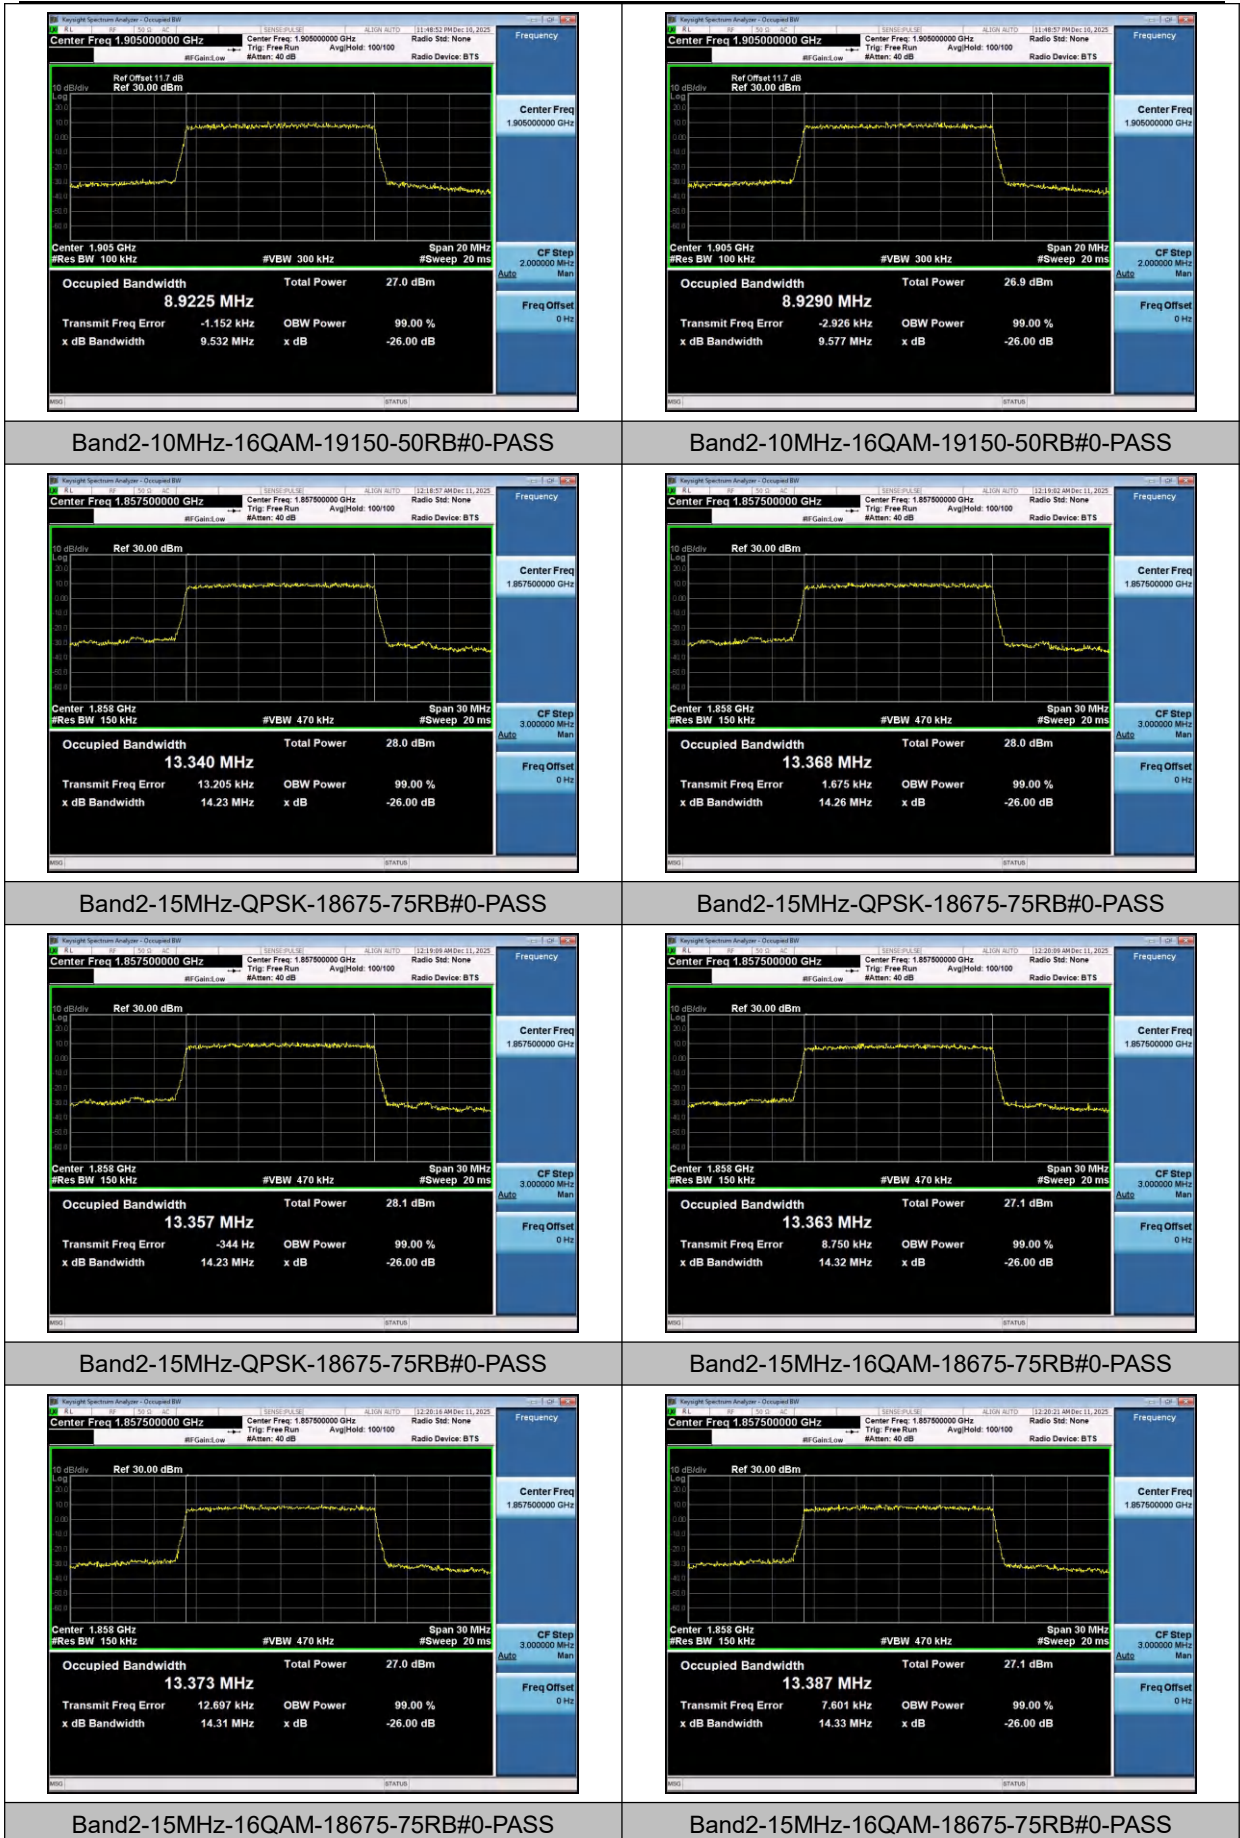




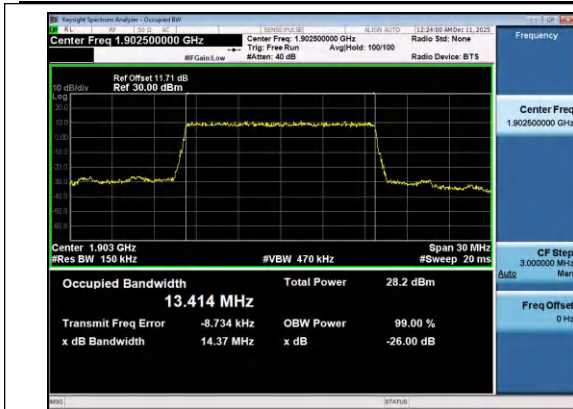


Band2-15MHz-QPSK-19125-75RB#0-PASS

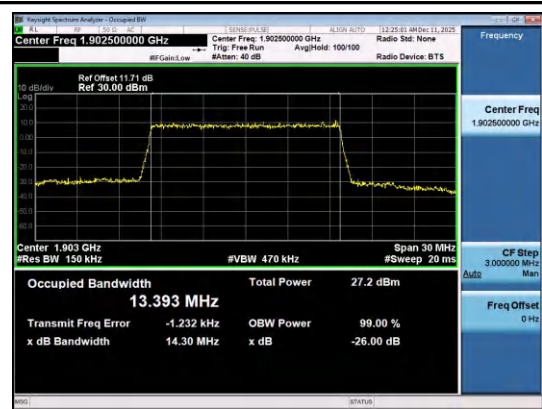


Band2-15MHz-16QAM-19125-75RB#0-PASS

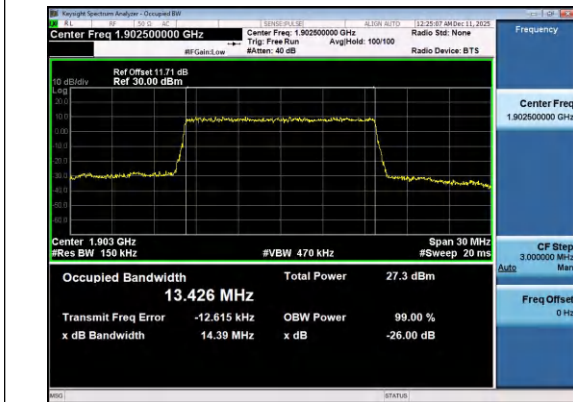

Band2-15MHz-16QAM-19125-75RB#0-PASS

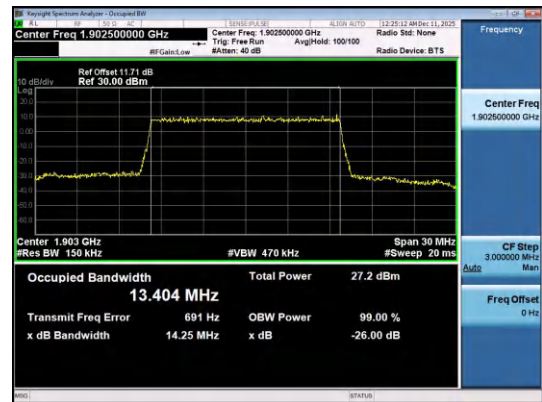


Band2-15MHz-16QAM-19125-75RB#0-PASS

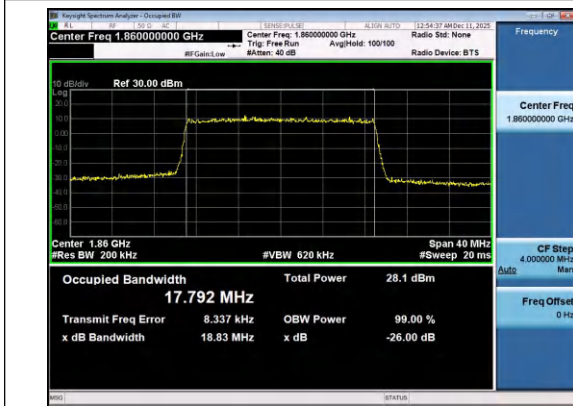

Band2-20MHz-QPSK-18700-100RB#0-PASS




Band2-20MHz-QPSK-18700-100RB#0-PASS

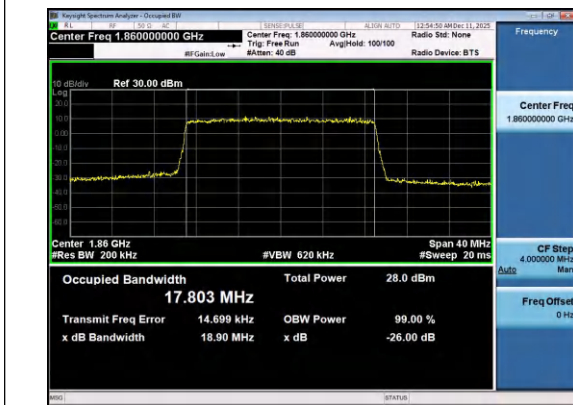


Band2-20MHz-QPSK-18700-100RB#0-PASS



Band2-20MHz-16QAM-18700-100RB#0-PASS

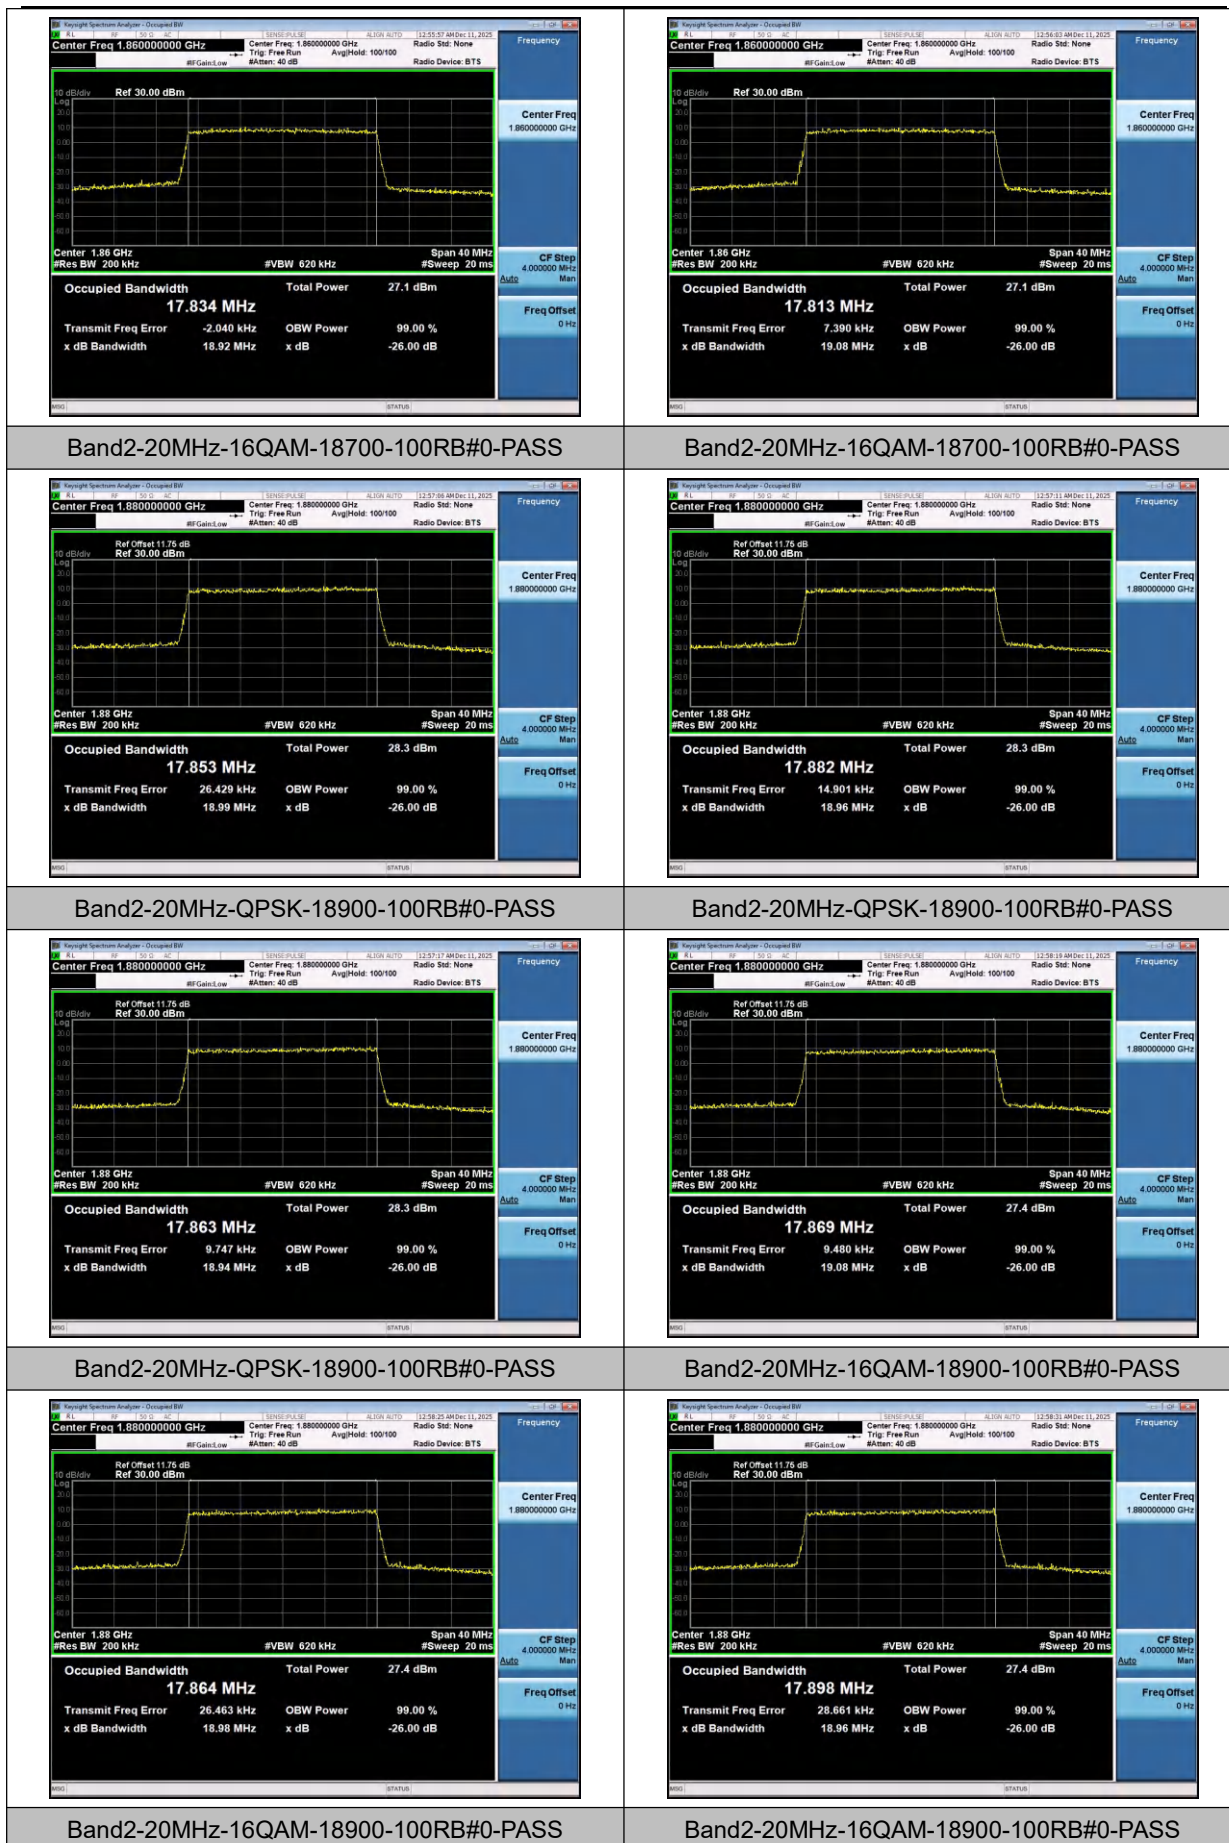



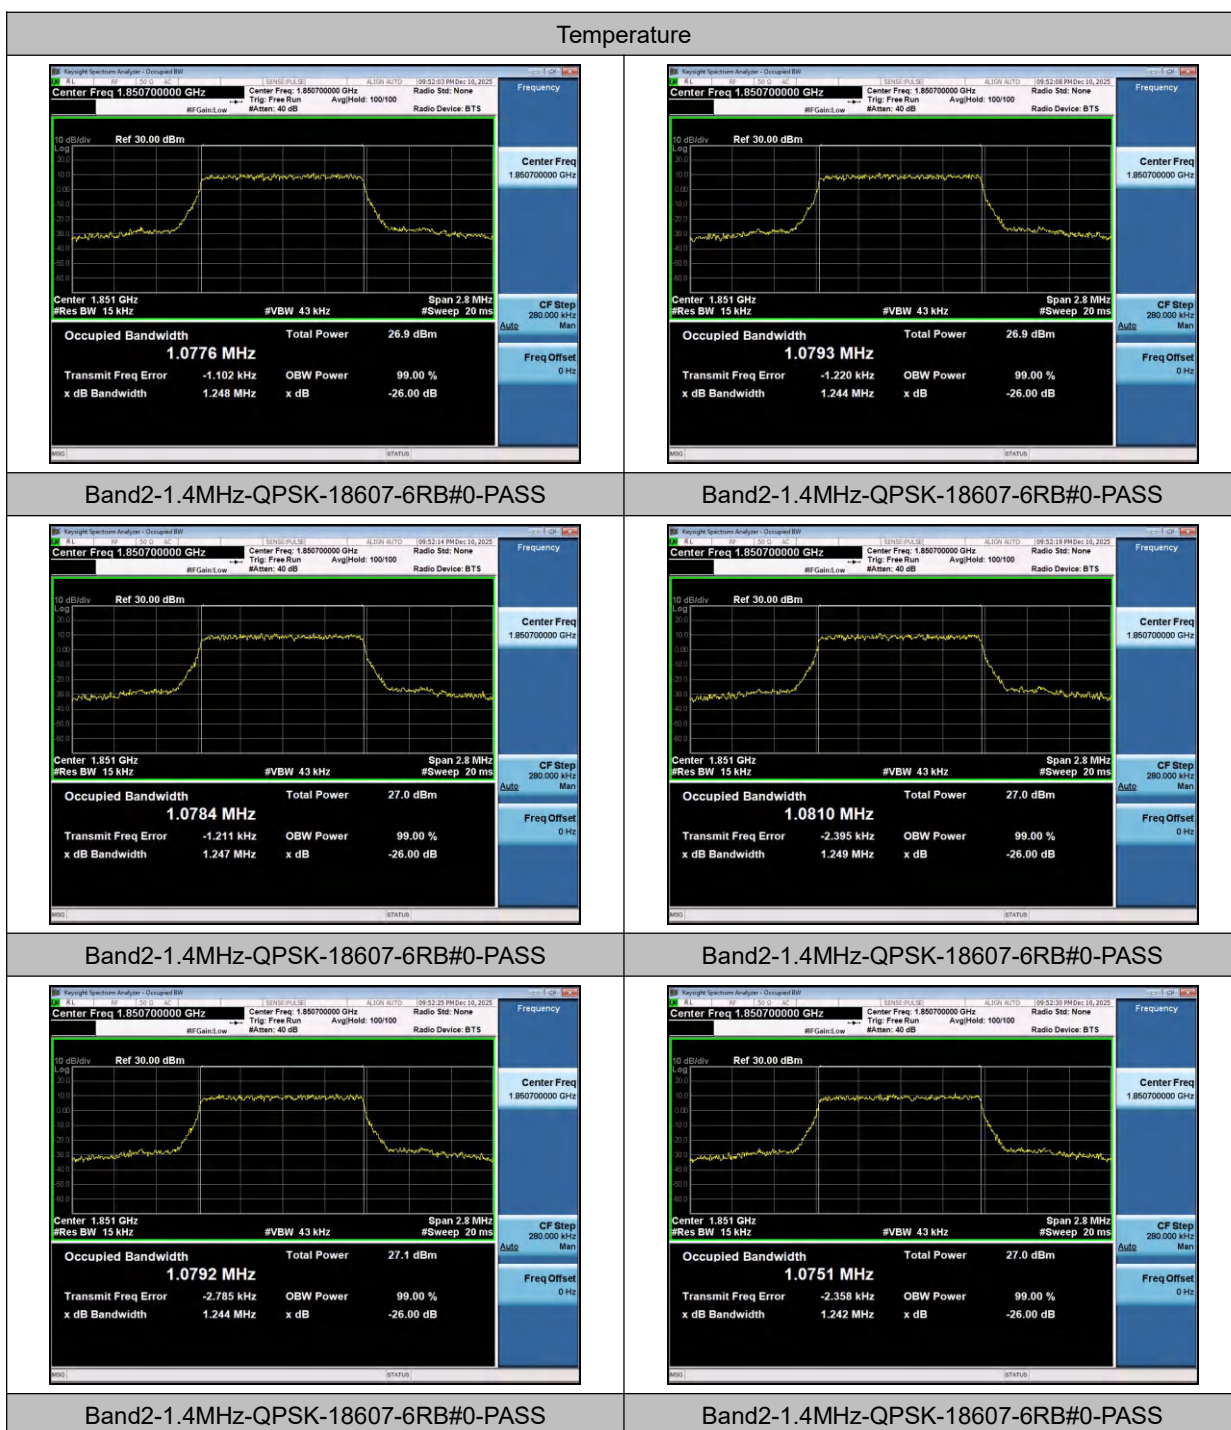




Band2-1.4MHz-QPSK-18607-6RB#0-PASS



Band2-1.4MHz-QPSK-18607-6RB#0-PASS

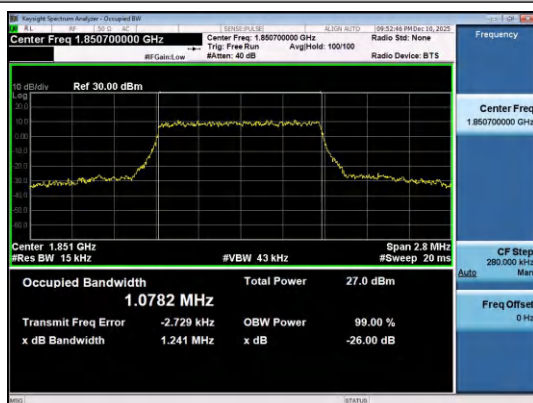

Band2-1.4MHz-QPSK-18607-6RB#0-PASS




Band2-1.4MHz-16QAM-18607-6RB#0-PASS



Band2-1.4MHz-16QAM-18607-6RB#0-PASS




Band2-1.4MHz-16QAM-18607-6RB#0-PASS

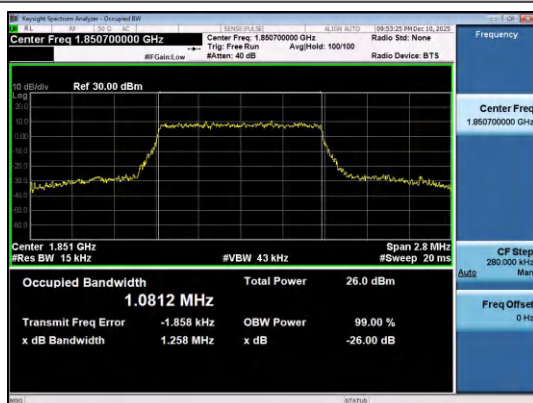



Band2-1.4MHz-16QAM-18607-6RB#0-PASS




Band2-1.4MHz-16QAM-18607-6RB#0-PASS

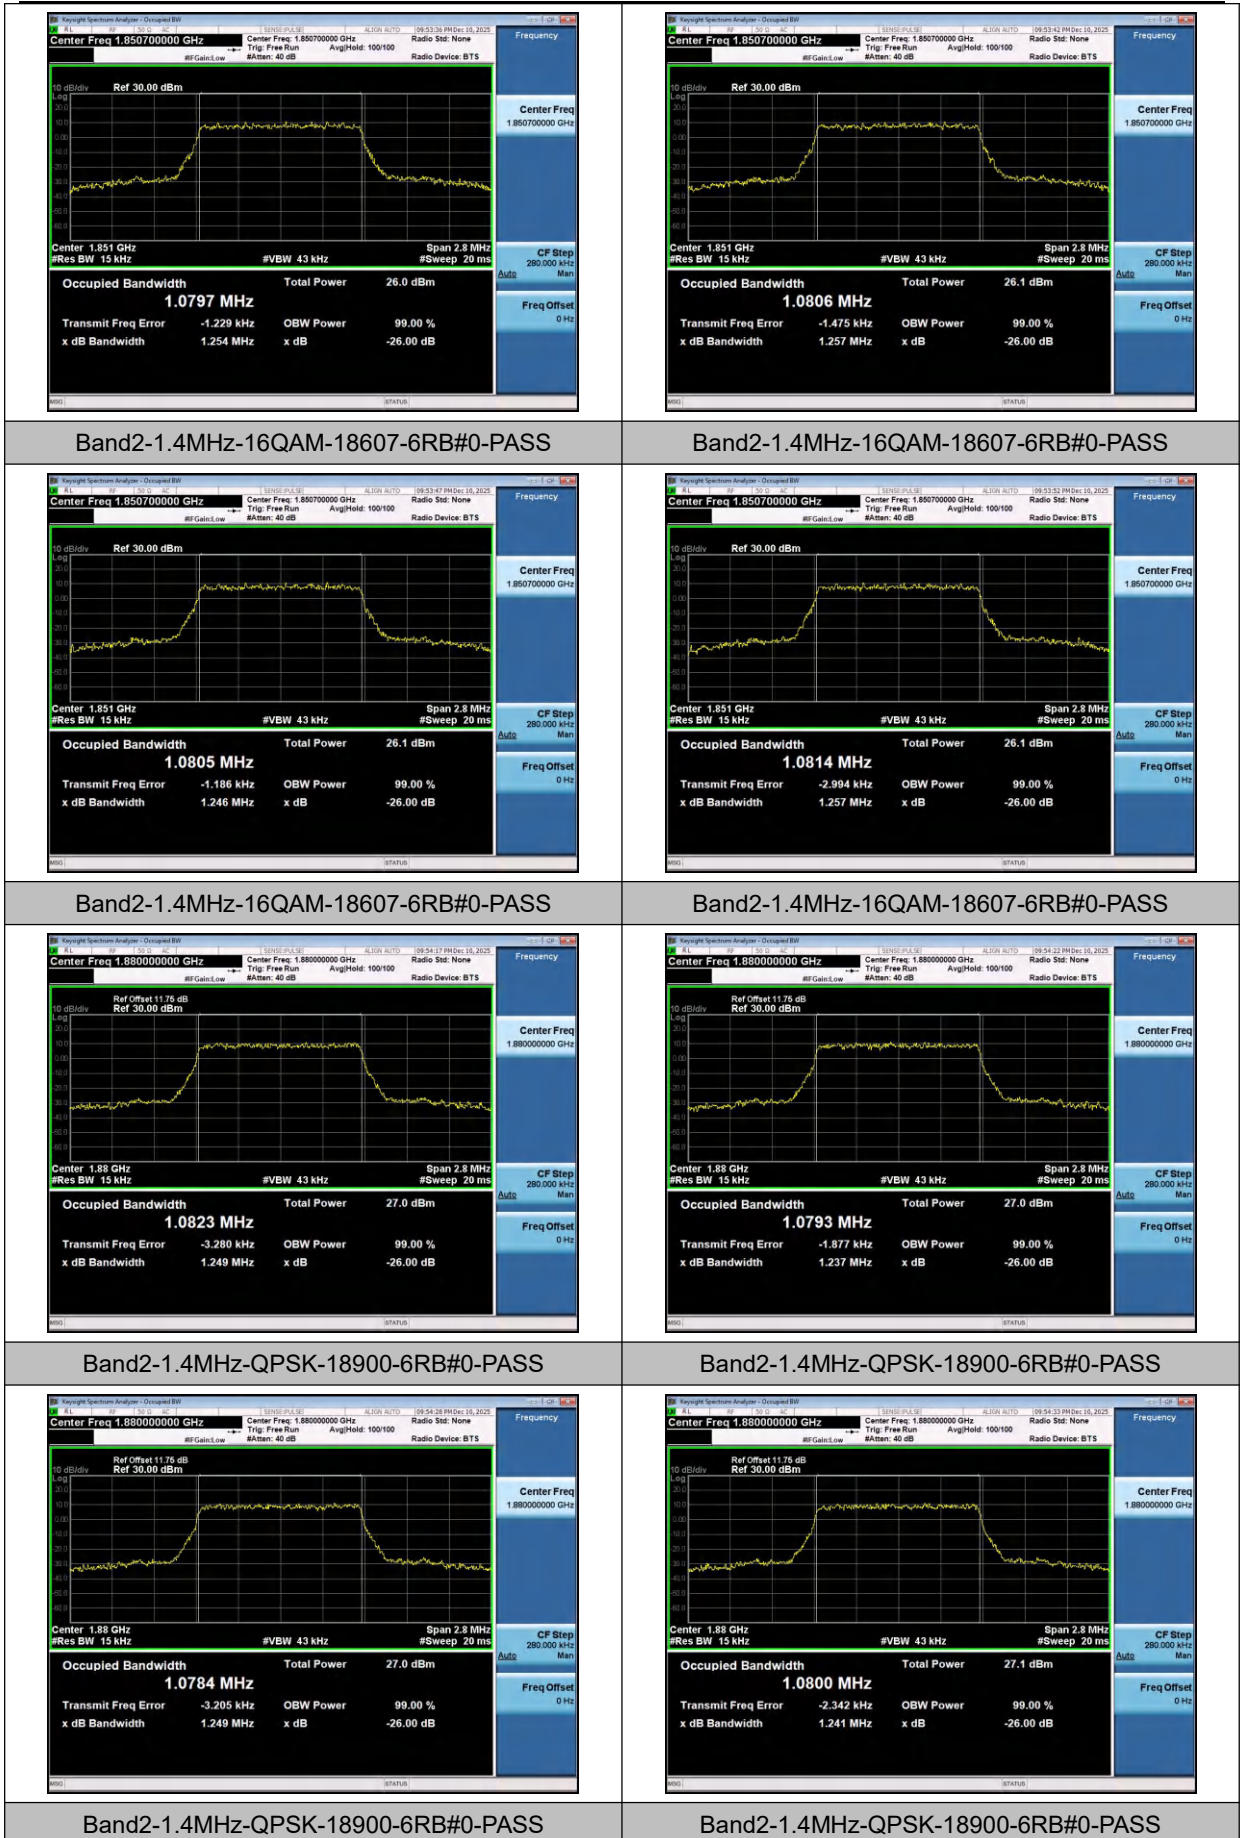

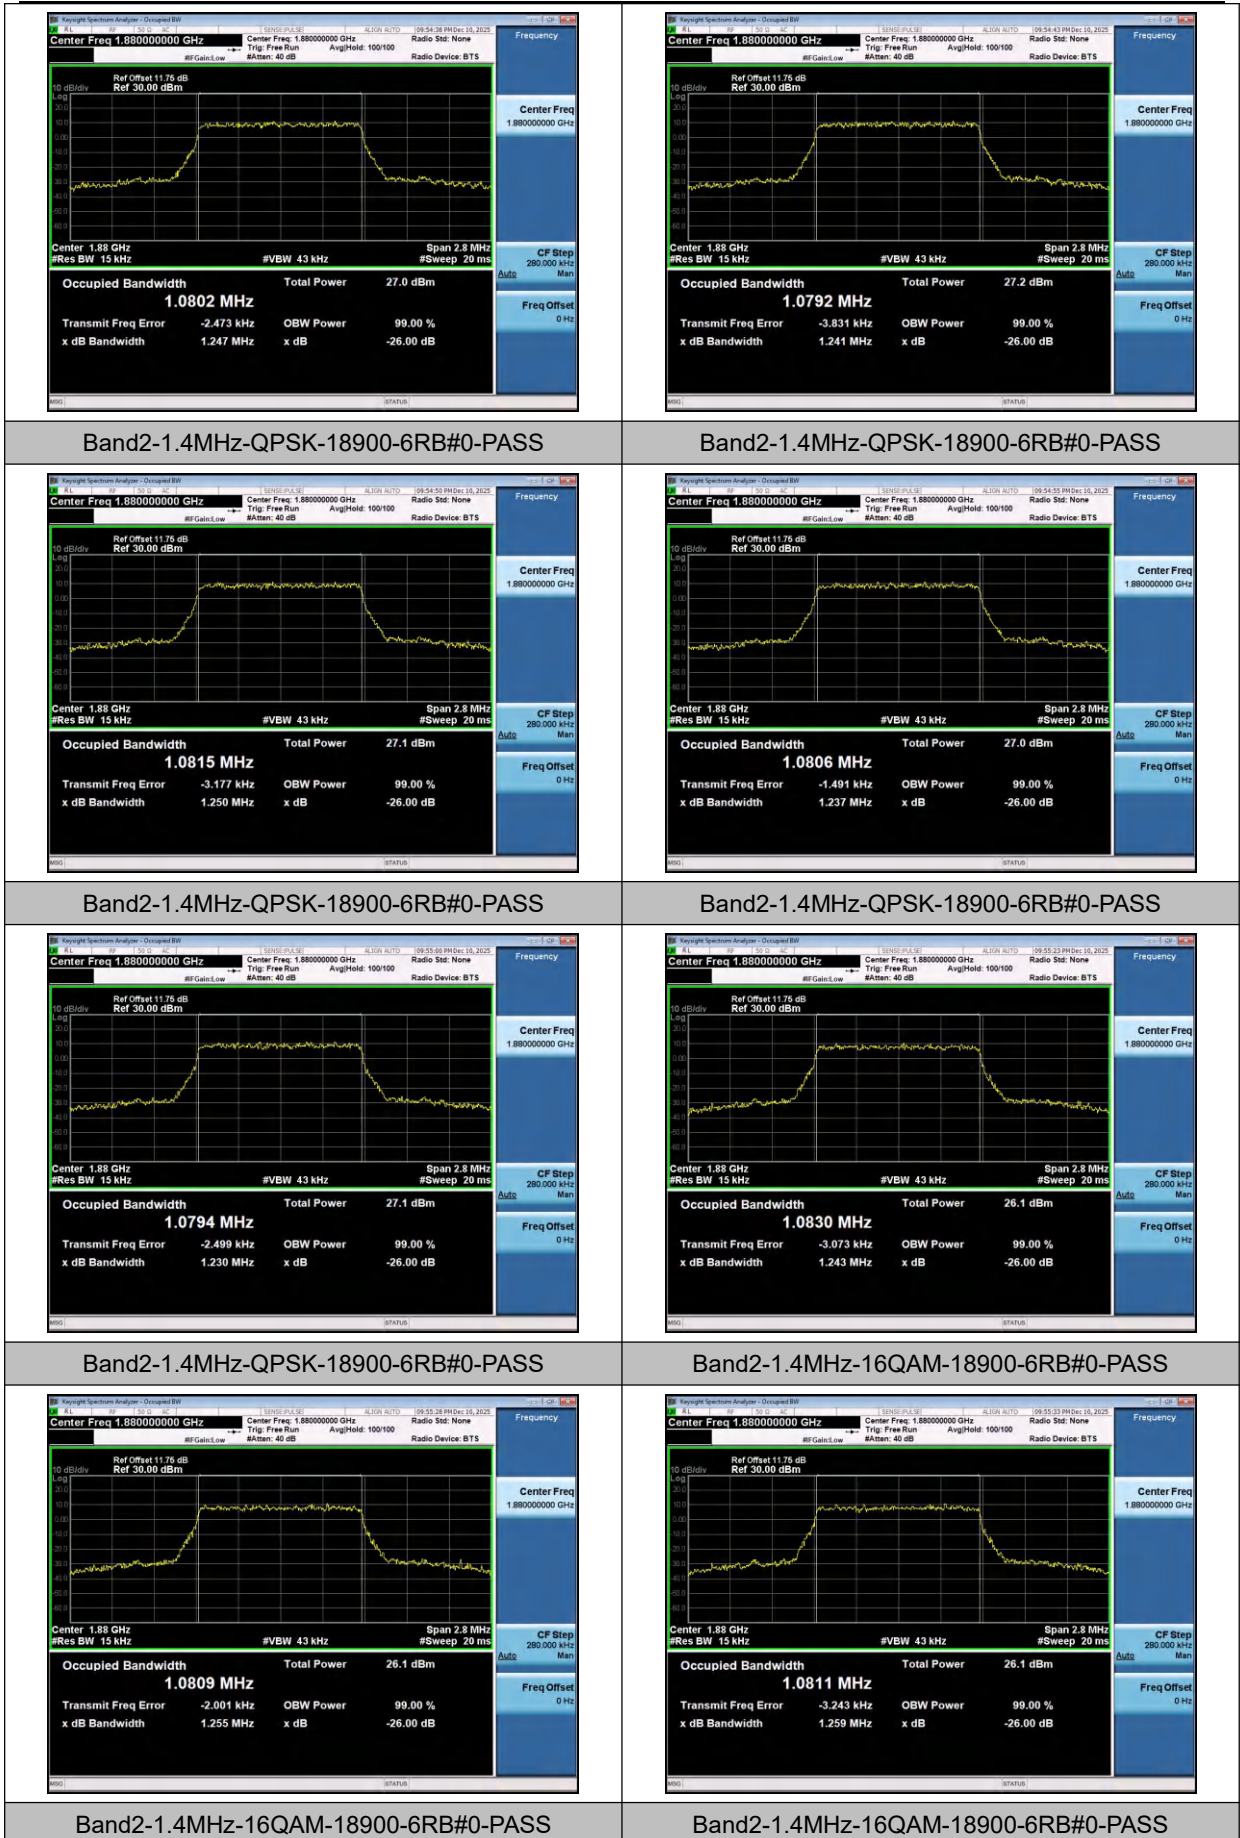

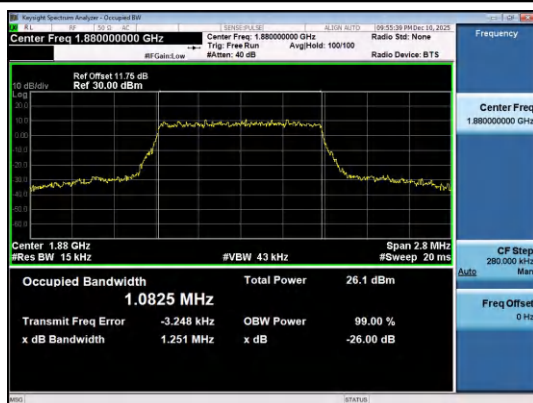

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

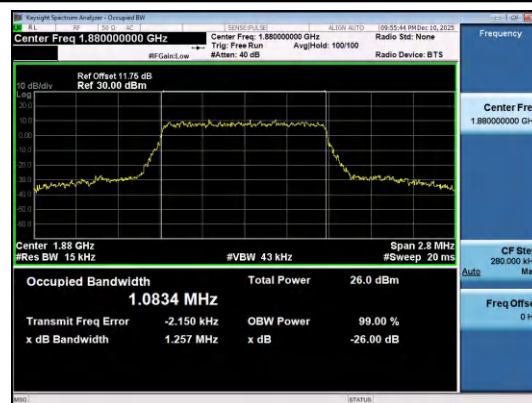


Band2-1.4MHz-16QAM-18900-6RB#0-PASS




Band2-1.4MHz-16QAM-18900-6RB#0-PASS




Band2-1.4MHz-16QAM-18900-6RB#0-PASS

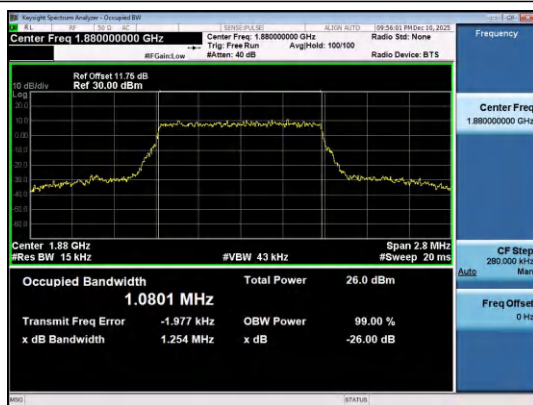

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

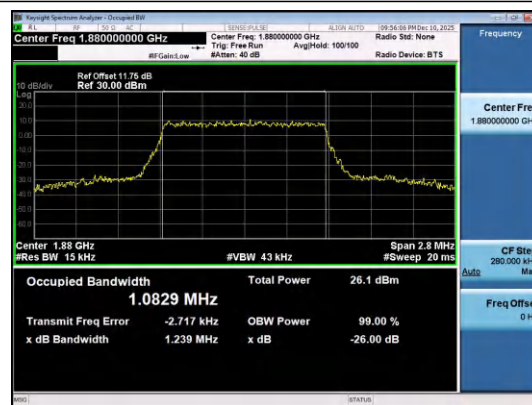


Band2-1.4MHz-16QAM-18900-6RB#0-PASS

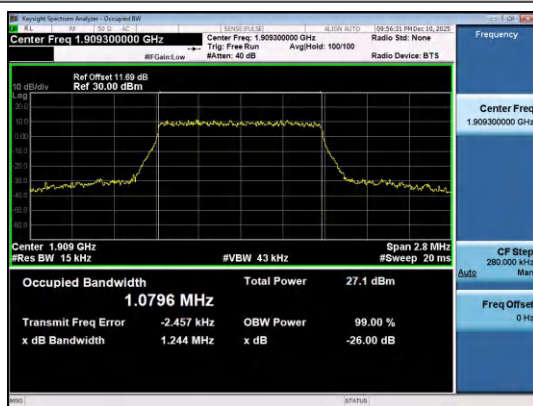


Band2-1.4MHz-QPSK-19193-6RB#0-PASS




Band2-1.4MHz-QPSK-19193-6RB#0-PASS

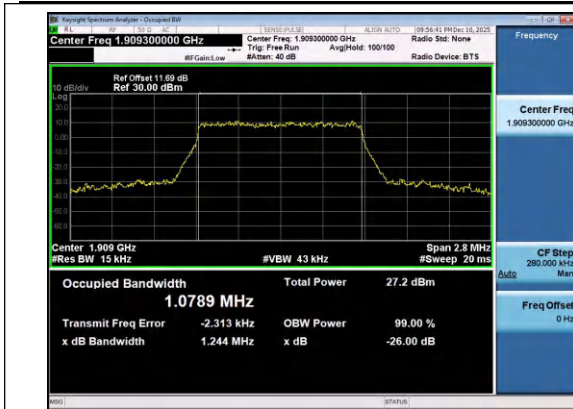


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

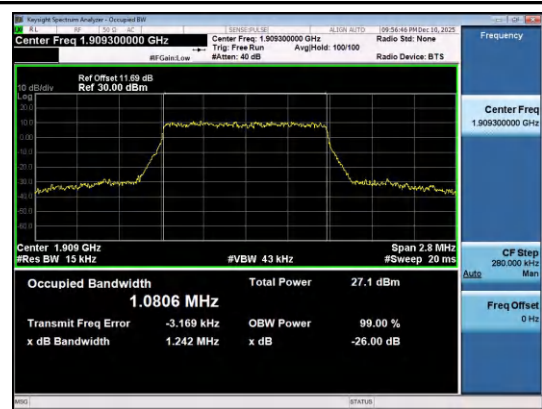


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

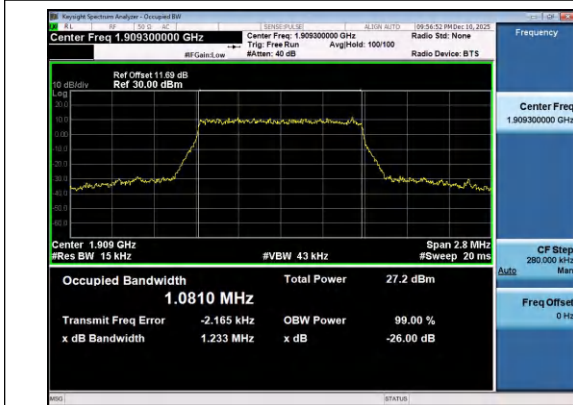


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

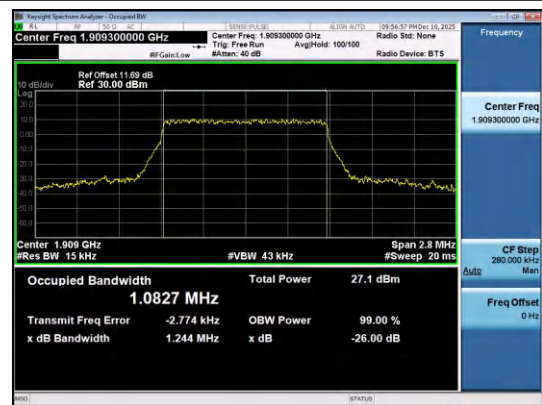


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

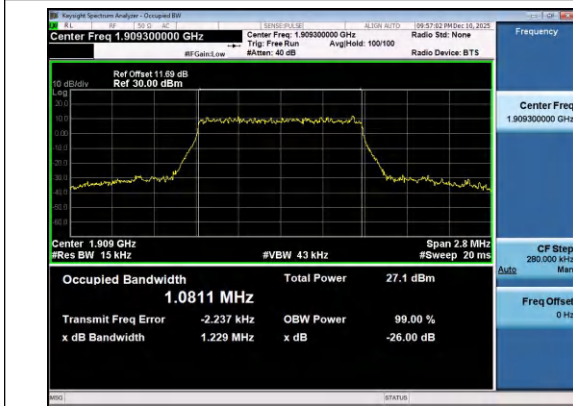

Band2-1.4MHz-QPSK-19193-6RB#0-PASS

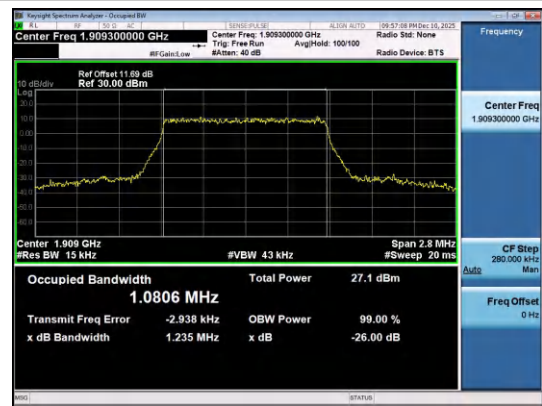


Band2-1.4MHz-QPSK-19193-6RB#0-PASS

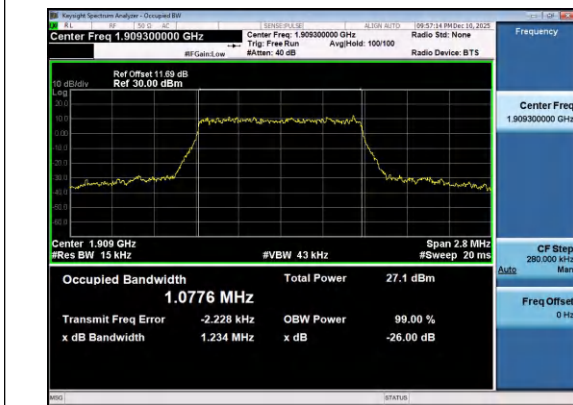


Band2-1.4MHz-QPSK-19193-6RB#0-PASS




Band2-1.4MHz-16QAM-19193-6RB#0-PASS

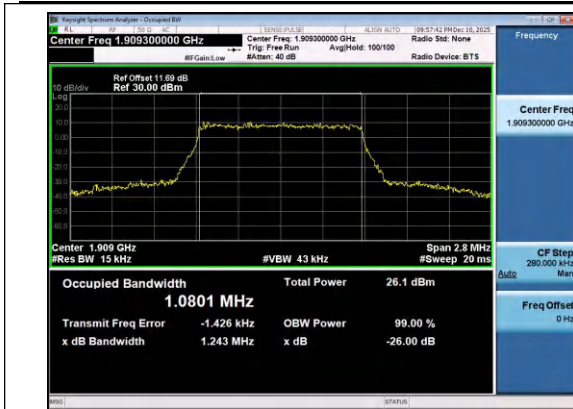


Band2-1.4MHz-16QAM-19193-6RB#0-PASS

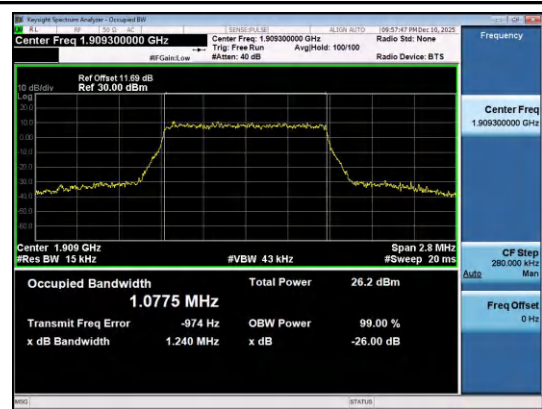


Band2-1.4MHz-16QAM-19193-6RB#0-PASS

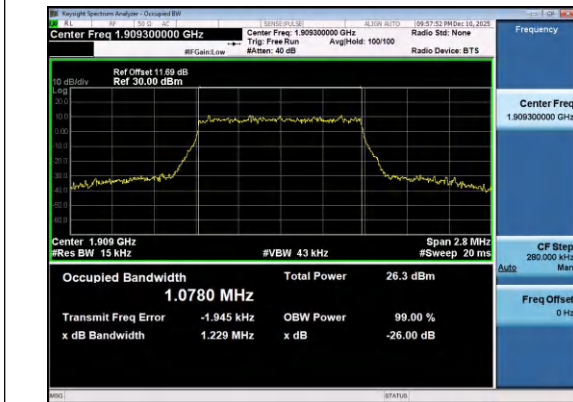

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

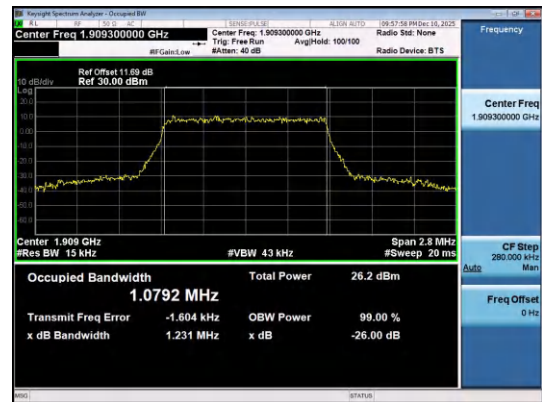


Band2-1.4MHz-16QAM-19193-6RB#0-PASS

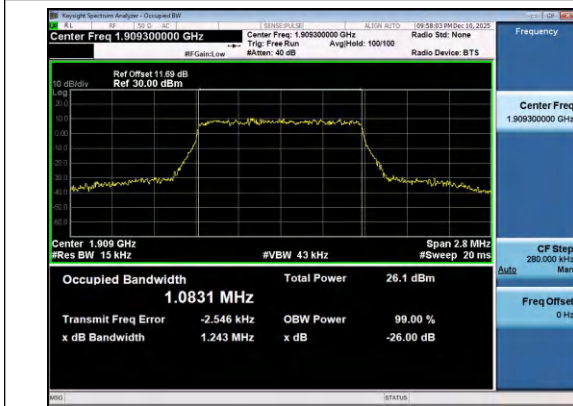


Band2-1.4MHz-16QAM-19193-6RB#0-PASS




Band2-1.4MHz-16QAM-19193-6RB#0-PASS

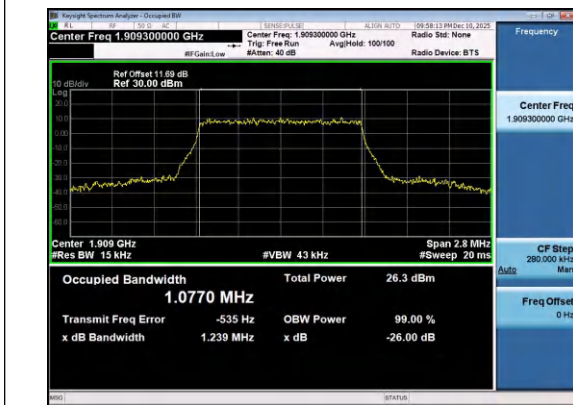


Band2-1.4MHz-16QAM-19193-6RB#0-PASS

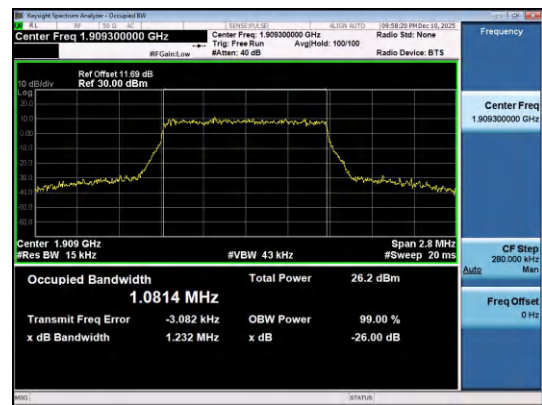

Band2-1.4MHz-16QAM-19193-6RB#0-PASS

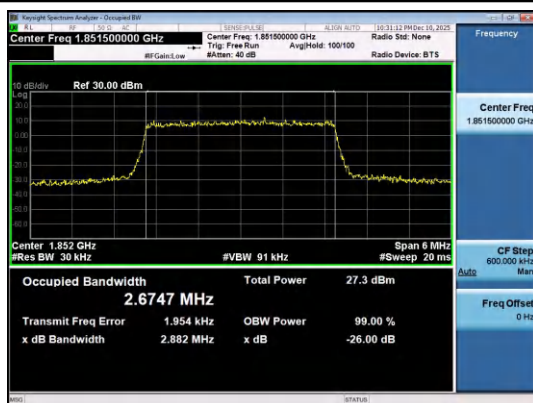

Band2-3MHz-QPSK-18615-15RB#0-PASS

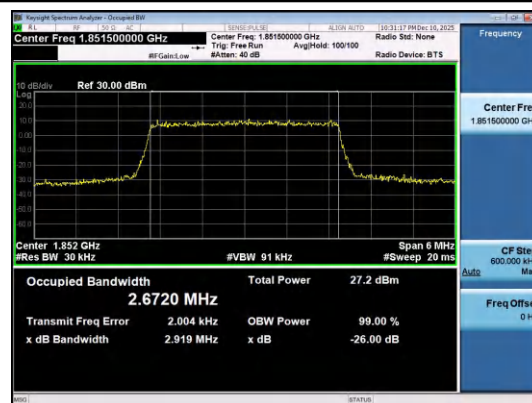


Band2-3MHz-QPSK-18615-15RB#0-PASS




Band2-3MHz-QPSK-18615-15RB#0-PASS




Band2-3MHz-QPSK-18615-15RB#0-PASS

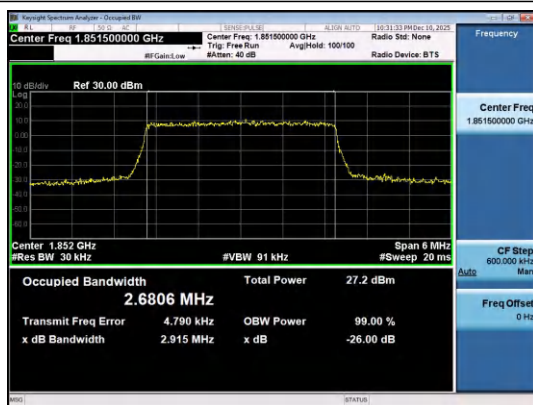

Band2-3MHz-QPSK-18615-15RB#0-PASS

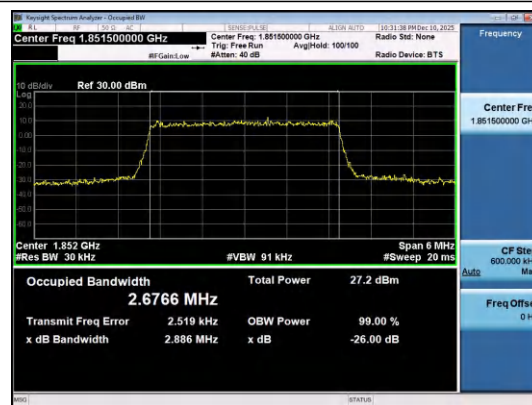


Band2-3MHz-QPSK-18615-15RB#0-PASS

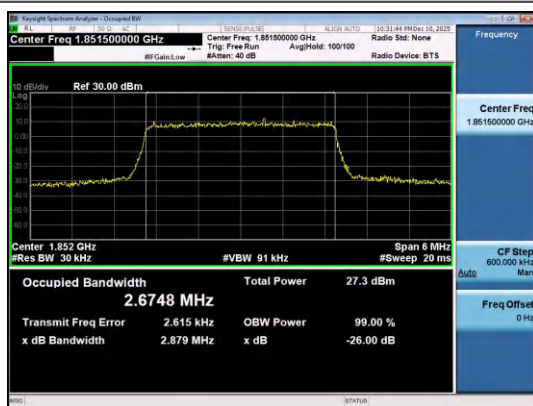


Band2-3MHz-QPSK-18615-15RB#0-PASS




Band2-3MHz-QPSK-18615-15RB#0-PASS

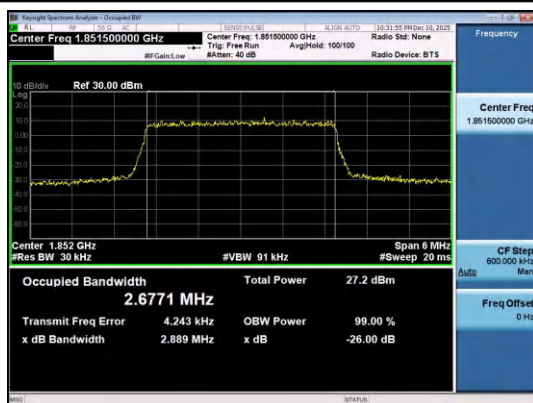


Band2-3MHz-QPSK-18615-15RB#0-PASS

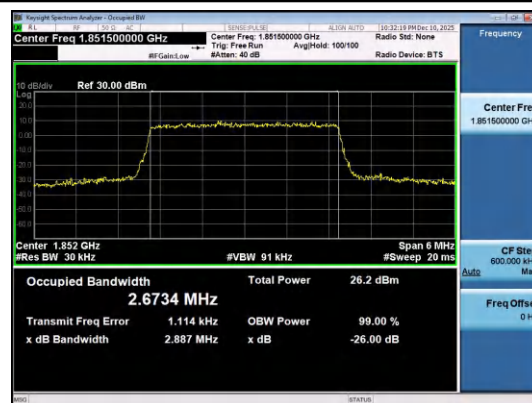


Band2-3MHz-16QAM-18615-15RB#0-PASS

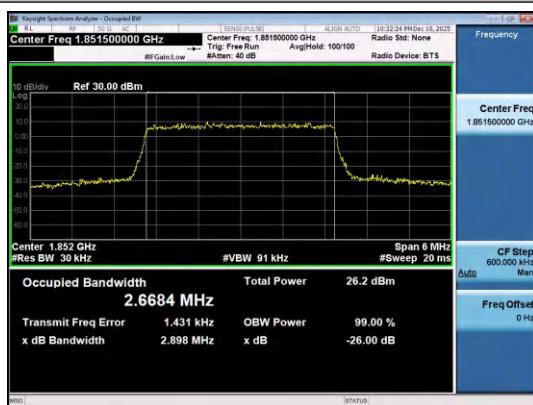


Band2-3MHz-16QAM-18615-15RB#0-PASS

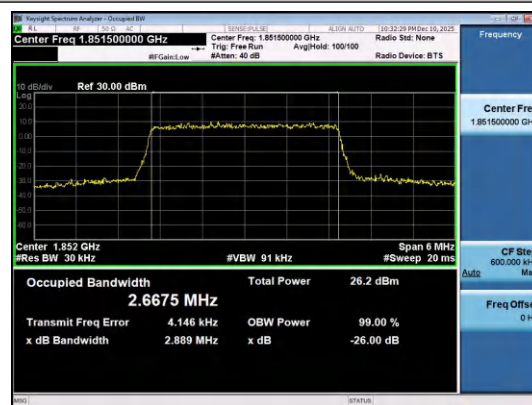


Band2-3MHz-16QAM-18615-15RB#0-PASS

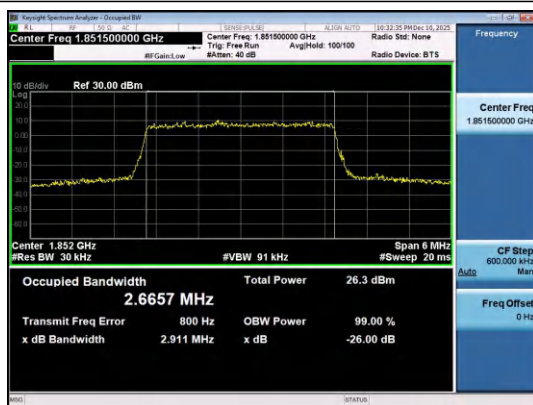

Band2-3MHz-16QAM-18615-15RB#0-PASS

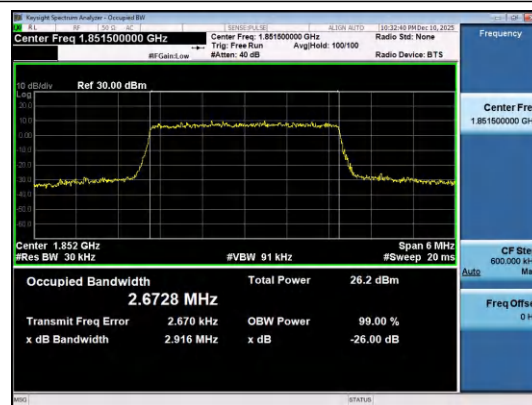


Band2-3MHz-16QAM-18615-15RB#0-PASS

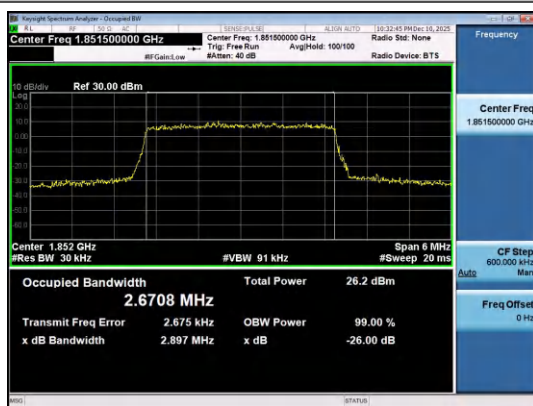


Band2-3MHz-16QAM-18615-15RB#0-PASS




Band2-3MHz-16QAM-18615-15RB#0-PASS

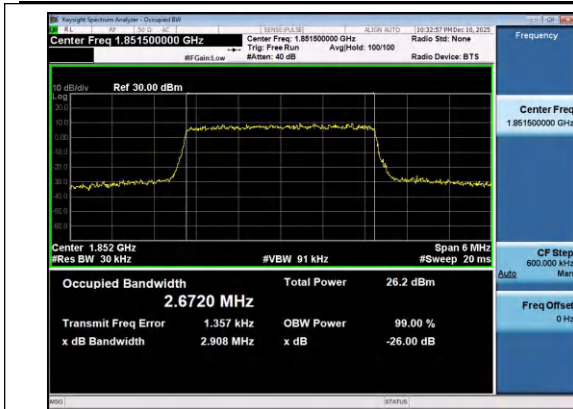


Band2-3MHz-16QAM-18615-15RB#0-PASS

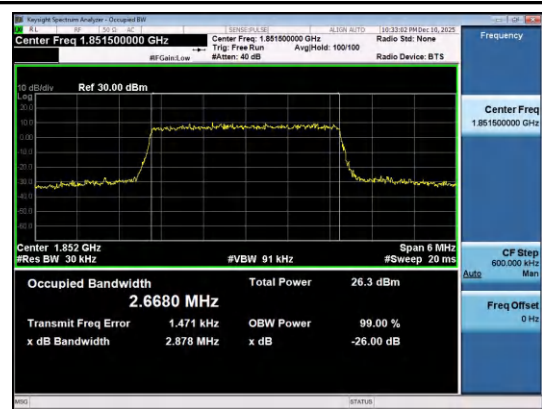


Band2-3MHz-16QAM-18615-15RB#0-PASS

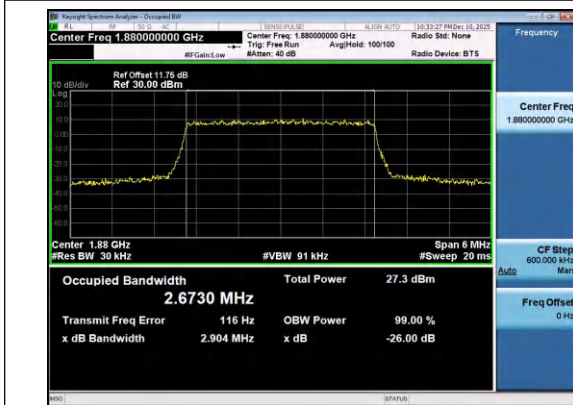


Band2-3MHz-QPSK-18900-15RB#0-PASS

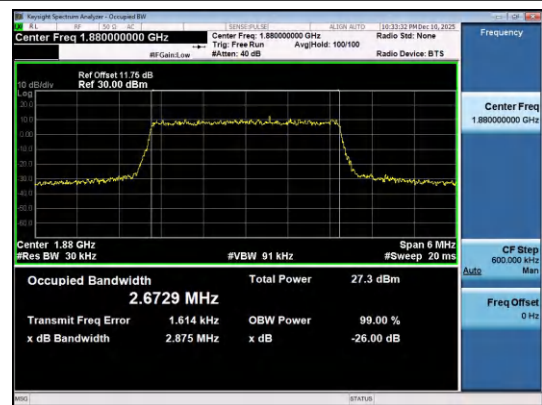


Band2-3MHz-QPSK-18900-15RB#0-PASS

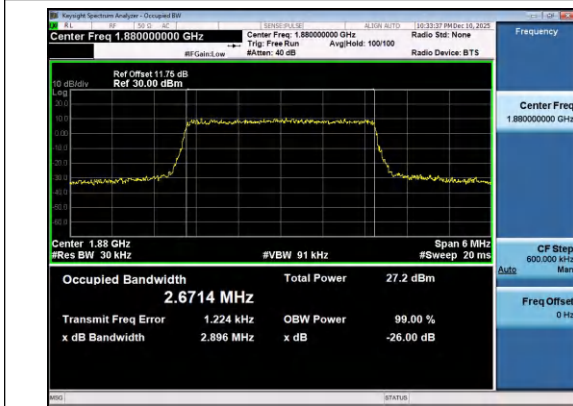


Band2-3MHz-QPSK-18900-15RB#0-PASS

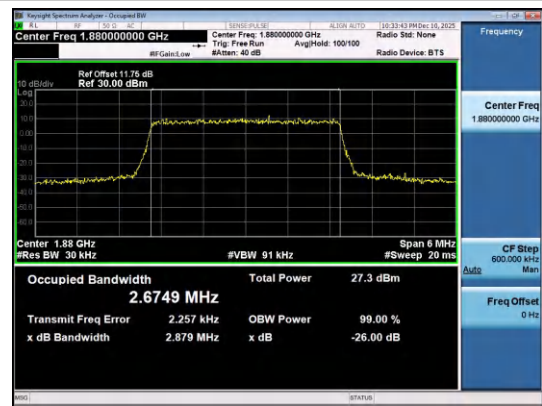


Band2-3MHz-QPSK-18900-15RB#0-PASS

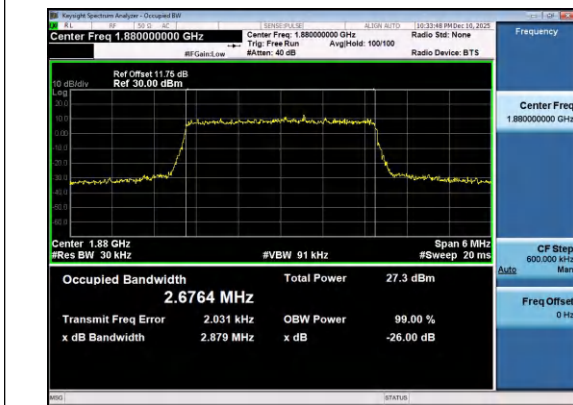


Band2-3MHz-QPSK-18900-15RB#0-PASS

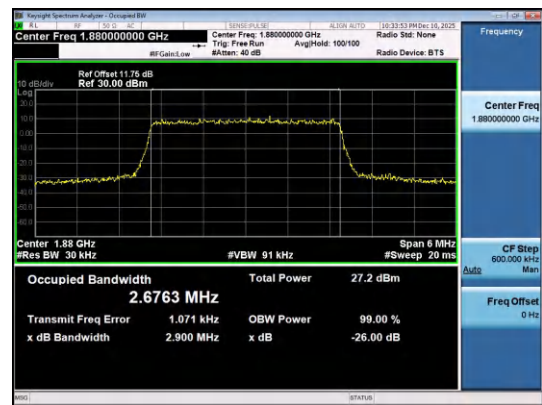


Band2-3MHz-QPSK-18900-15RB#0-PASS

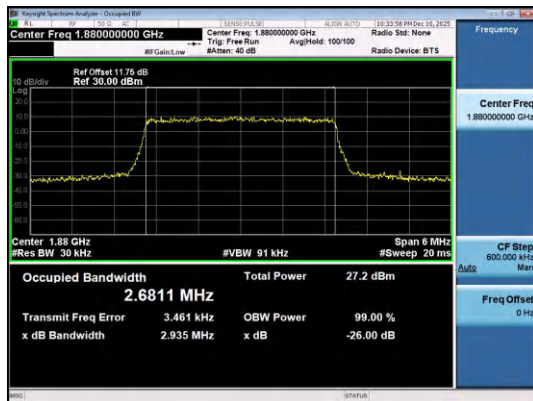


Band2-3MHz-QPSK-18900-15RB#0-PASS

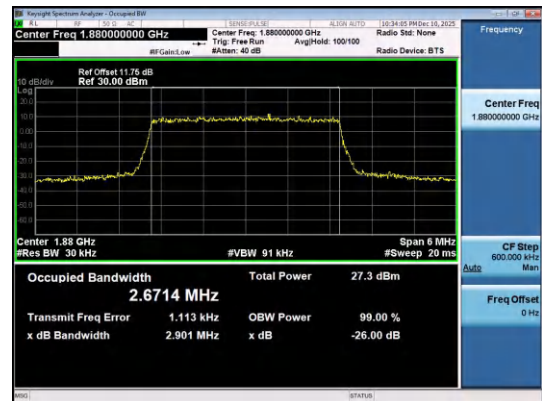


Band2-3MHz-QPSK-18900-15RB#0-PASS

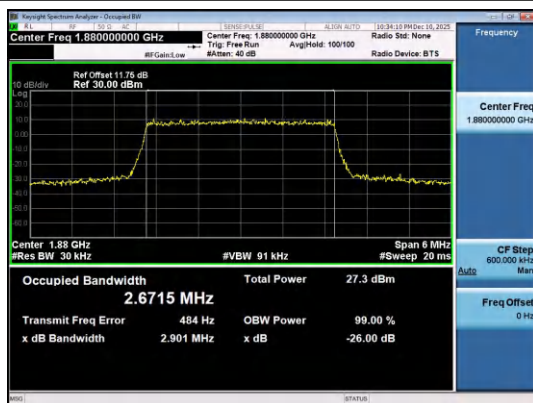


Band2-3MHz-QPSK-18900-15RB#0-PASS

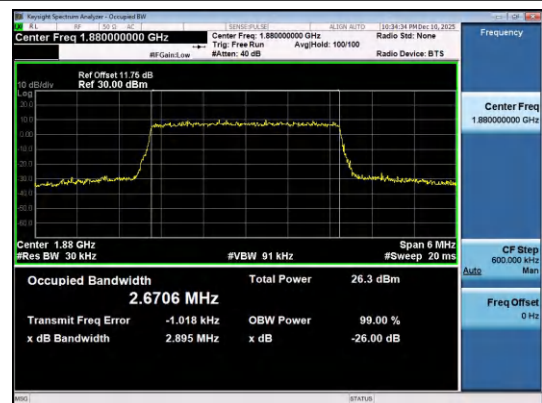


Band2-3MHz-16QAM-18900-15RB#0-PASS

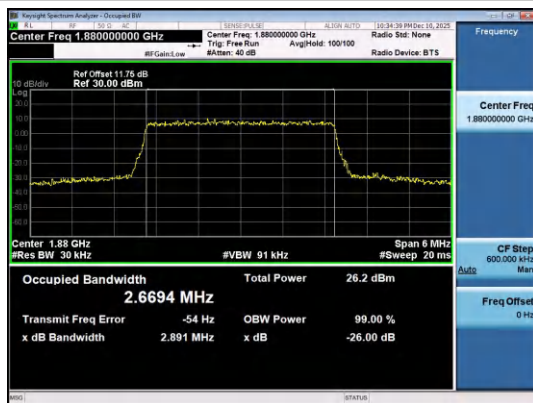


Band2-3MHz-16QAM-18900-15RB#0-PASS

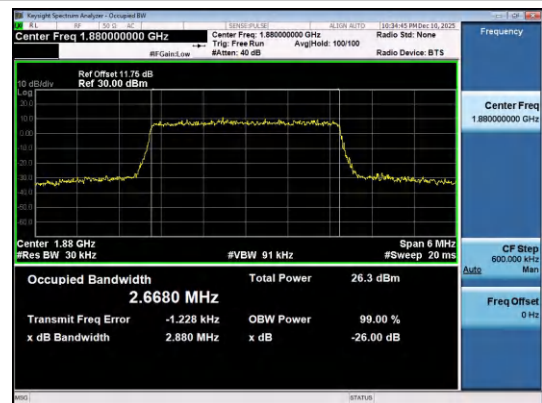

Band2-3MHz-16QAM-18900-15RB#0-PASS

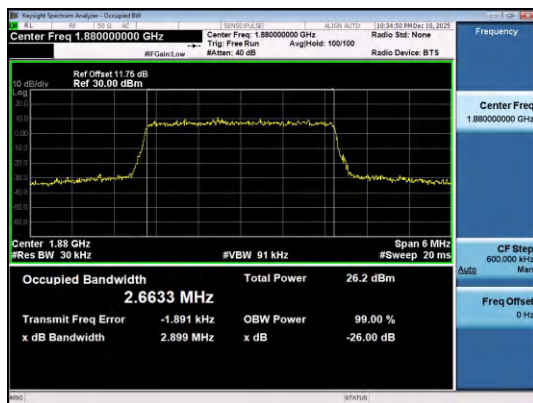

Band2-3MHz-16QAM-18900-15RB#0-PASS

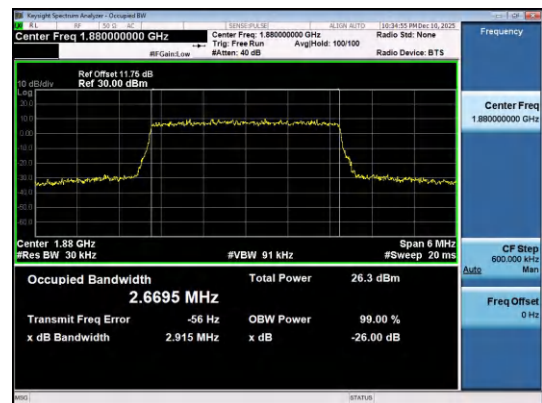

Band2-3MHz-16QAM-18900-15RB#0-PASS