




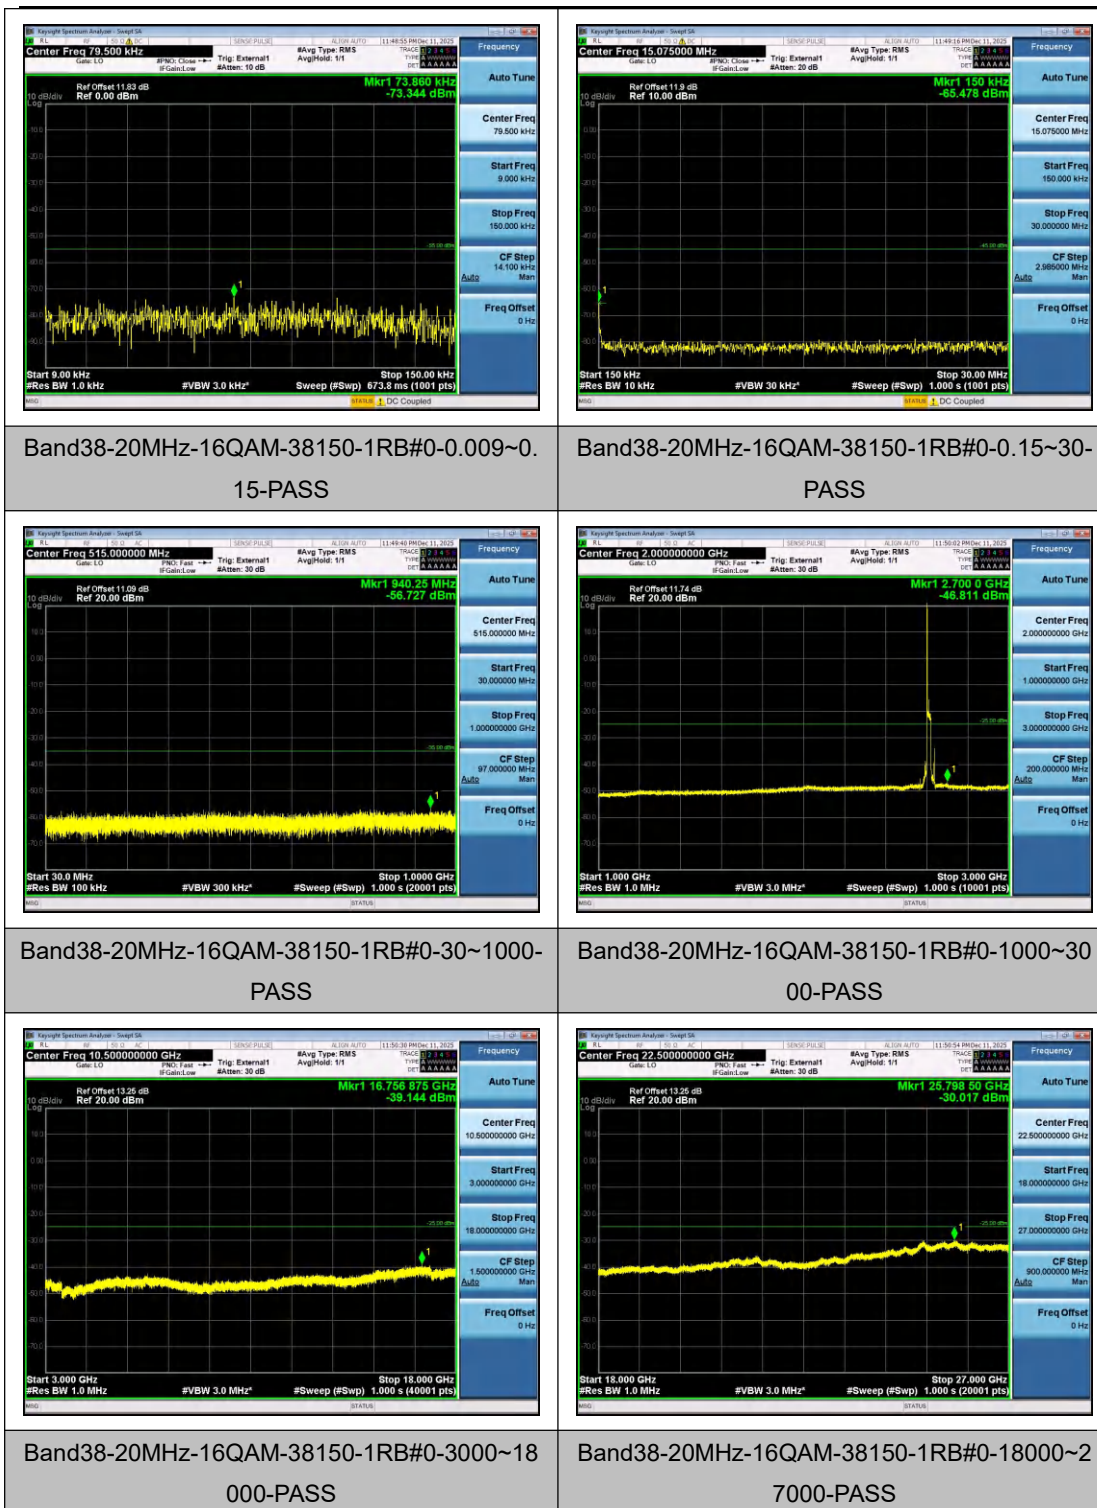

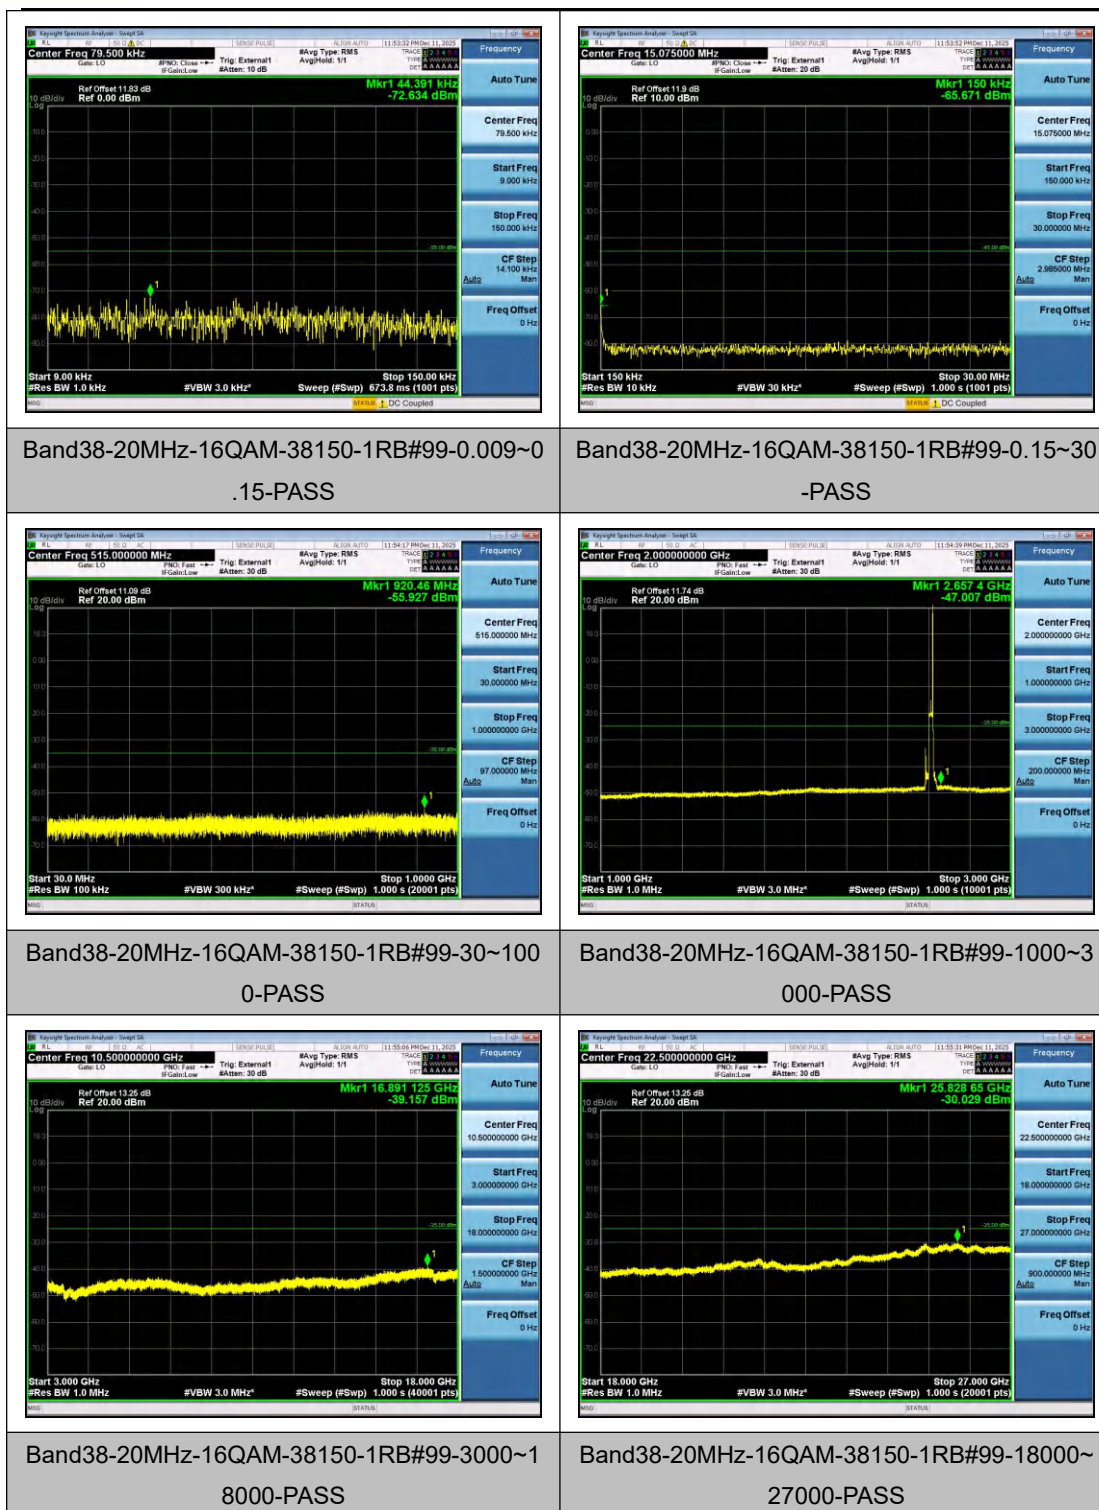

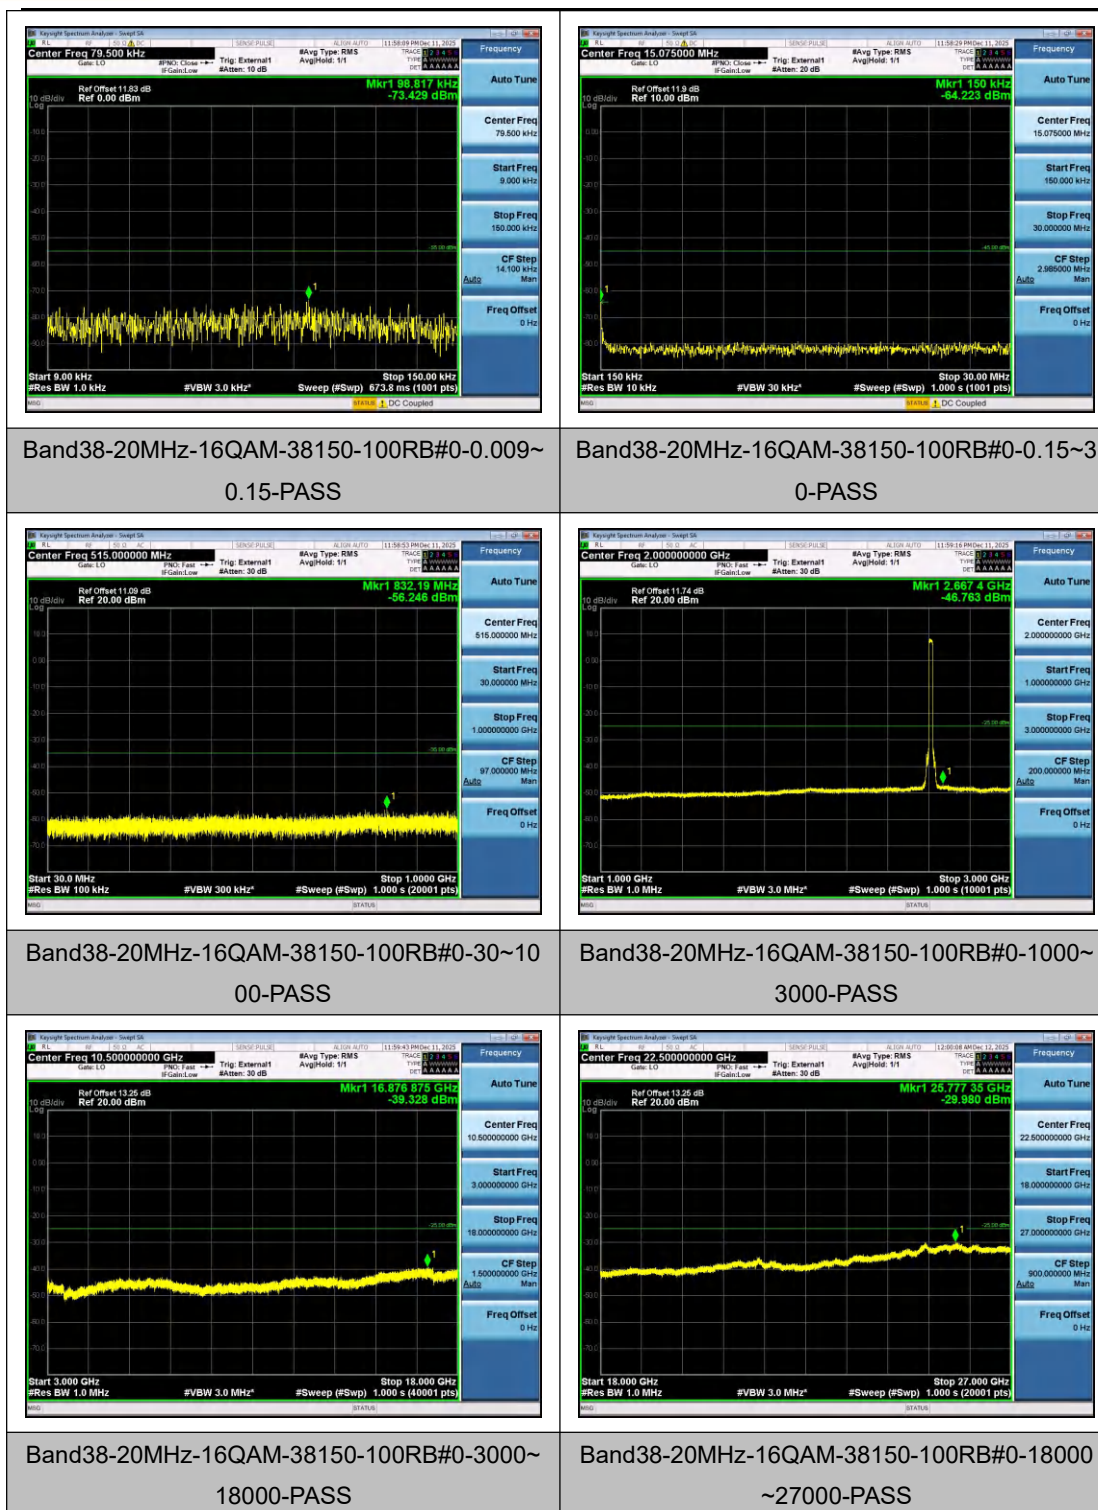

Appendix F: Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature(°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	2570.28689	2574.69849	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	2570.28737	2574.69837	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	2570.28755	2574.69845	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	2570.27086	2574.72206	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	2570.27029	2574.72149	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	2570.27045	2574.72145	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	2592.78405	2597.23625	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	2592.78375	2597.23625	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	2592.78388	2597.23618	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	2592.78209	2597.20989	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	2592.78305	2597.20865	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	2592.78226	2597.20976	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	2615.27672	2619.73052	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	2615.27675	2619.73045	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	2615.27681	2619.73051	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	2615.26999	2619.72079	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	2615.26998	2619.72078	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	2615.26	2619.72	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							987	077		
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	2570.51 721	2579.46 751	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	2570.51 723	2579.46 723	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	2570.51 722	2579.46 752	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	2570.52 546	2579.43 886	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	2570.52 538	2579.43 888	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	2570.52 551	2579.43 881	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	2590.52 126	2599.46 286	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	2590.52 126	2599.46 296	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	2590.52 133	2599.46 293	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	2590.52 312	2599.42 802	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	2590.52 311	2599.42 791	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	2590.52 338	2599.42 798	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	2610.52 46	2619.45 87	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	2610.52 468	2619.45 868	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	2610.52 472	2619.45 872	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	2610.52 402	2619.43 102	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	2610.52 419	2619.43 109	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	VH	NT	2610.52 415	2619.43 095	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	2570.85 768	2584.18 068	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	2570.85 794	2584.17 994	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	2570.85	2584.18	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							801	001		
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	2570.80 951	2584.17 351	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	2570.80 932	2584.17 332	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	2570.80 919	2584.17 319	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	2588.32 495	2601.67 695	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	2588.32 508	2601.67 708	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	2588.32 423	2601.67 723	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	2588.29 133	2601.69 633	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	2588.29 134	2601.69 634	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	2588.29 096	2601.69 596	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	2605.77 066	2619.17 366	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	2605.77 084	2619.17 384	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	2605.77 078	2619.17 378	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	2605.84 694	2619.18 394	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	2605.84 597	2619.18 397	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	2605.84 601	2619.18 301	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	2571.11 833	2588.90 733	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	2571.11 836	2588.90 736	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	2571.11 864	2588.90 664	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	2571.09 735	2588.93 035	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	2571.09 78	2588.92 98	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	2571.09	2588.93	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							711	111		
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	2586.10 182	2603.84 682	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	2586.10 264	2603.84 664	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	2586.10 331	2603.84 631	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	2586.07 031	2603.89 331	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	2586.07 08	2603.89 28	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	2586.07 033	2603.89 333	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	2601.11 797	2618.90 597	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	2601.11 794	2618.90 594	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	2601.11 781	2618.90 581	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	2601.07 243	2618.90 543	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	2601.07 258	2618.90 558	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	2601.07 211	2618.90 711	2570-2620	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature(°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	NV	-30	2570.28 727	2574.69 837	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	2570.28 752	2574.69 842	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	2570.28 753	2574.69 843	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	2570.28 715	2574.69 835	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	2570.28 768	2574.69 838	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	2570.28 701	2574.69 841	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	2570.28	2574.69	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							758	848		
Band38	5MHz	QPSK	37775	25RB#0	NV	40	2570.28 741	2574.69 841	2570-2620	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	2570.29 213	2574.74 263	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	2570.27 044	2574.72 144	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	2570.27 044	2574.72 144	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	2570.27 037	2574.72 137	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	2570.27 024	2574.72 144	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	2570.27 033	2574.72 143	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	2570.27 039	2574.72 149	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	2570.27 037	2574.72 147	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	2570.27 035	2574.72 145	2570-2620	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	50	2570.27 037	2574.72 147	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	2592.78 383	2597.23 623	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	2592.78 362	2597.23 632	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	2592.78 375	2597.23 625	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	2592.78 382	2597.23 622	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	2592.78 371	2597.23 631	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	2592.78 373	2597.23 623	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	2592.78 359	2597.23 619	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	2592.78 389	2597.23 619	2570-2620	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	2592.78 354	2597.23 624	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	2592.78	2597.20	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							219	989		
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	2592.78 211	2597.20 991	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	2592.78 218	2597.20 998	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	2592.78 245	2597.21 035	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	2592.78 295	2597.21 035	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	2592.76 545	2597.21 405	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	2592.76 559	2597.21 539	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	2592.76 568	2597.21 548	2570-2620	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	2592.76 555	2597.21 545	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	2615.27 672	2619.73 052	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	2615.27 677	2619.73 047	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	2615.27 656	2619.73 046	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	2615.27 661	2619.73 041	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	2615.27 658	2619.73 048	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	20	2615.27 648	2619.73 048	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	2615.27 681	2619.73 051	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	2615.27 684	2619.73 044	2570-2620	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	2615.27 673	2619.73 053	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	2615.26 99	2619.72 07	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	2615.26 985	2619.72 075	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	2615.26 994	2619.72 084	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	2615.26	2619.72	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							994	074		
Band38	5MHz	16QAM	38225	25RB#0	NV	10	2615.26 992	2619.72 072	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	2615.26 99	2619.72 08	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	2615.26 993	2619.72 083	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	2615.26 986	2619.72 076	2570-2620	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	2615.26 988	2619.72 078	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	2570.51 721	2579.46 751	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	2570.51 723	2579.46 713	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	2570.51 709	2579.46 699	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	2570.51 724	2579.46 724	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	2570.51 719	2579.46 719	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	2570.51 721	2579.46 761	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	2570.51 726	2579.46 716	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	2570.51 719	2579.46 719	2570-2620	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	2570.51 718	2579.46 718	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	2570.52 546	2579.43 866	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	2570.52 537	2579.43 917	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	2570.52 535	2579.43 885	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	2570.52 542	2579.43 872	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	2570.52 539	2579.43 899	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	2570.52 547	2579.43 907	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	2570.52	2579.43	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							551	881		
Band38	10MHz	16QAM	37800	50RB#0	NV	40	2570.52 554	2579.43 884	2570-2620	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	2570.52 542	2579.43 882	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	2590.52 135	2599.46 275	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	2590.52 13	2599.46 27	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	2590.52 115	2599.46 285	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	2590.52 134	2599.46 274	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	2590.52 125	2599.46 275	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	2590.52 135	2599.46 295	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	2590.52 123	2599.46 273	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	2590.52 114	2599.46 264	2570-2620	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	2590.52 135	2599.46 295	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	2590.52 333	2599.42 793	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-20	2590.52 332	2599.42 812	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	2590.52 341	2599.42 811	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	2590.52 332	2599.42 802	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	2590.52 339	2599.42 819	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	2590.52 333	2599.42 803	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	2590.52 318	2599.42 798	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	2590.52 318	2599.42 808	2570-2620	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	2590.52 327	2599.42 797	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	2610.52	2619.45	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							473	873		
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	2610.52 453	2619.45 893	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	2610.52 479	2619.45 889	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	2610.52 468	2619.45 878	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	2610.52 482	2619.45 862	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	2610.52 479	2619.45 869	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	2610.52 471	2619.45 871	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	2610.52 468	2619.45 868	2570-2620	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	2610.52 469	2619.45 879	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	2610.52 413	2619.43 093	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	2610.52 409	2619.43 139	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	2610.52 413	2619.43 113	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	2610.52 402	2619.43 092	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	2610.52 41	2619.43 12	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	2610.52 413	2619.43 103	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	2610.52 419	2619.43 139	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	2610.52 412	2619.43 132	2570-2620	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	2610.52 413	2619.43 143	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	2570.85 8	2584.18	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	2570.85 825	2584.18 025	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	2570.85 769	2584.18 069	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	2570.85	2584.18	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							802	002		
Band38	15MHz	QPSK	37825	75RB#0	NV	10	2570.85 769	2584.17 969	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	2570.85 747	2584.18 047	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	30	2570.85 8	2584.18	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	2570.85 78	2584.17 98	2570-2620	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	2570.85 794	2584.17 994	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	2570.80 953	2584.17 353	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	2570.80 966	2584.17 366	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	2570.80 92	2584.17 32	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	2570.80 971	2584.17 371	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	2570.80 946	2584.17 346	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	2570.80 947	2584.17 347	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	30	2570.80 948	2584.17 348	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	2570.80 97	2584.17 37	2570-2620	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	2570.80 929	2584.17 329	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	2588.32 509	2601.67 709	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	2588.32 494	2601.67 694	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	2588.32 492	2601.67 692	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	2588.32 509	2601.67 709	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	2588.32 498	2601.67 698	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	2588.32 502	2601.67 702	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	2588.32	2601.67	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							5	7		
Band38	15MHz	QPSK	38000	75RB#0	NV	40	2588.32 536	2601.67 736	2570-2620	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	2588.32 508	2601.67 708	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	2588.29 202	2601.69 602	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	2588.29 132	2601.69 632	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	2588.29 115	2601.69 615	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	2588.29 153	2601.69 653	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	2588.29 124	2601.69 624	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	2588.29 215	2601.69 615	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	2588.29 154	2601.69 654	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	2588.29 15	2601.69 65	2570-2620	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	2588.29 175	2601.69 575	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	2605.77 06	2619.17 36	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	2605.77 073	2619.17 373	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	2605.77 075	2619.17 375	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	2605.77 074	2619.17 374	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	2605.77 076	2619.17 376	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	2605.77 065	2619.17 365	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	2605.77 074	2619.17 374	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	2605.77 074	2619.17 374	2570-2620	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	2605.77 065	2619.17 365	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	2605.84	2619.18	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							623	323		
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	2605.84 611	2619.18 411	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-10	2605.84 651	2619.18 251	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	2605.84 598	2619.18 398	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	2605.84 57	2619.18 37	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	2605.84 56	2619.18 26	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	2605.84 636	2619.18 336	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	2605.84 604	2619.18 304	2570-2620	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	2605.84 556	2619.18 356	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	2571.11 809	2588.90 709	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	2571.11 838	2588.90 638	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-10	2571.11 861	2588.90 661	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	2571.11 875	2588.90 675	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	2571.11 797	2588.90 697	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	2571.11 835	2588.90 635	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	2571.11 853	2588.90 653	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	2571.11 839	2588.90 639	2570-2620	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	2571.11 862	2588.90 662	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	2571.09 778	2588.92 978	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	2571.09 645	2588.93 045	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	2571.09 764	2588.93 064	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	2571.09	2588.93	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							749	049		
Band38	20MHz	16QAM	37850	100RB#0	NV	10	2571.09 698	2588.92 998	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	2571.09 677	2588.92 977	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	2571.09 745	2588.93 045	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	2571.09 706	2588.93 006	2570-2620	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	2571.09 735	2588.93 035	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	2586.10 268	2603.84 668	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	2586.10 353	2603.84 653	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	2586.10 33	2603.84 63	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	2586.10 289	2603.84 689	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	2586.10 278	2603.84 678	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	2586.10 269	2603.84 669	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	2586.10 194	2603.84 694	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	2586.10 275	2603.84 675	2570-2620	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	2586.10 349	2603.84 649	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	2586.07 095	2603.89 295	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	2586.07 041	2603.89 341	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	2586.07 101	2603.89 301	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	2586.07 107	2603.89 307	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	2586.07 017	2603.89 317	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	2586.07 111	2603.89 311	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	2586.07	2603.89	2570-2620	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


							113	313		
Band38	20MHz	16QAM	38000	100RB#0	NV	40	2586.07 058	2603.89 358	2570-2620	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	2586.07 052	2603.89 352	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	2601.11 794	2618.90 594	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	2601.11 794	2618.90 594	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	2601.11 83	2618.90 53	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	2601.11 787	2618.90 587	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	2601.11 798	2618.90 598	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	2601.11 794	2618.90 594	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	2601.11 79	2618.90 59	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	40	2601.11 83	2618.90 63	2570-2620	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	2601.11 816	2618.90 616	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	2601.07 251	2618.90 651	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	2601.07 223	2618.90 623	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	2601.07 276	2618.90 576	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	2601.07 263	2618.90 463	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	2601.07 243	2618.90 543	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	2601.07 233	2618.90 733	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	2601.07 269	2618.90 669	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	2601.07 3	2618.90 7	2570-2620	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	2601.07 252	2618.90 552	2570-2620	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

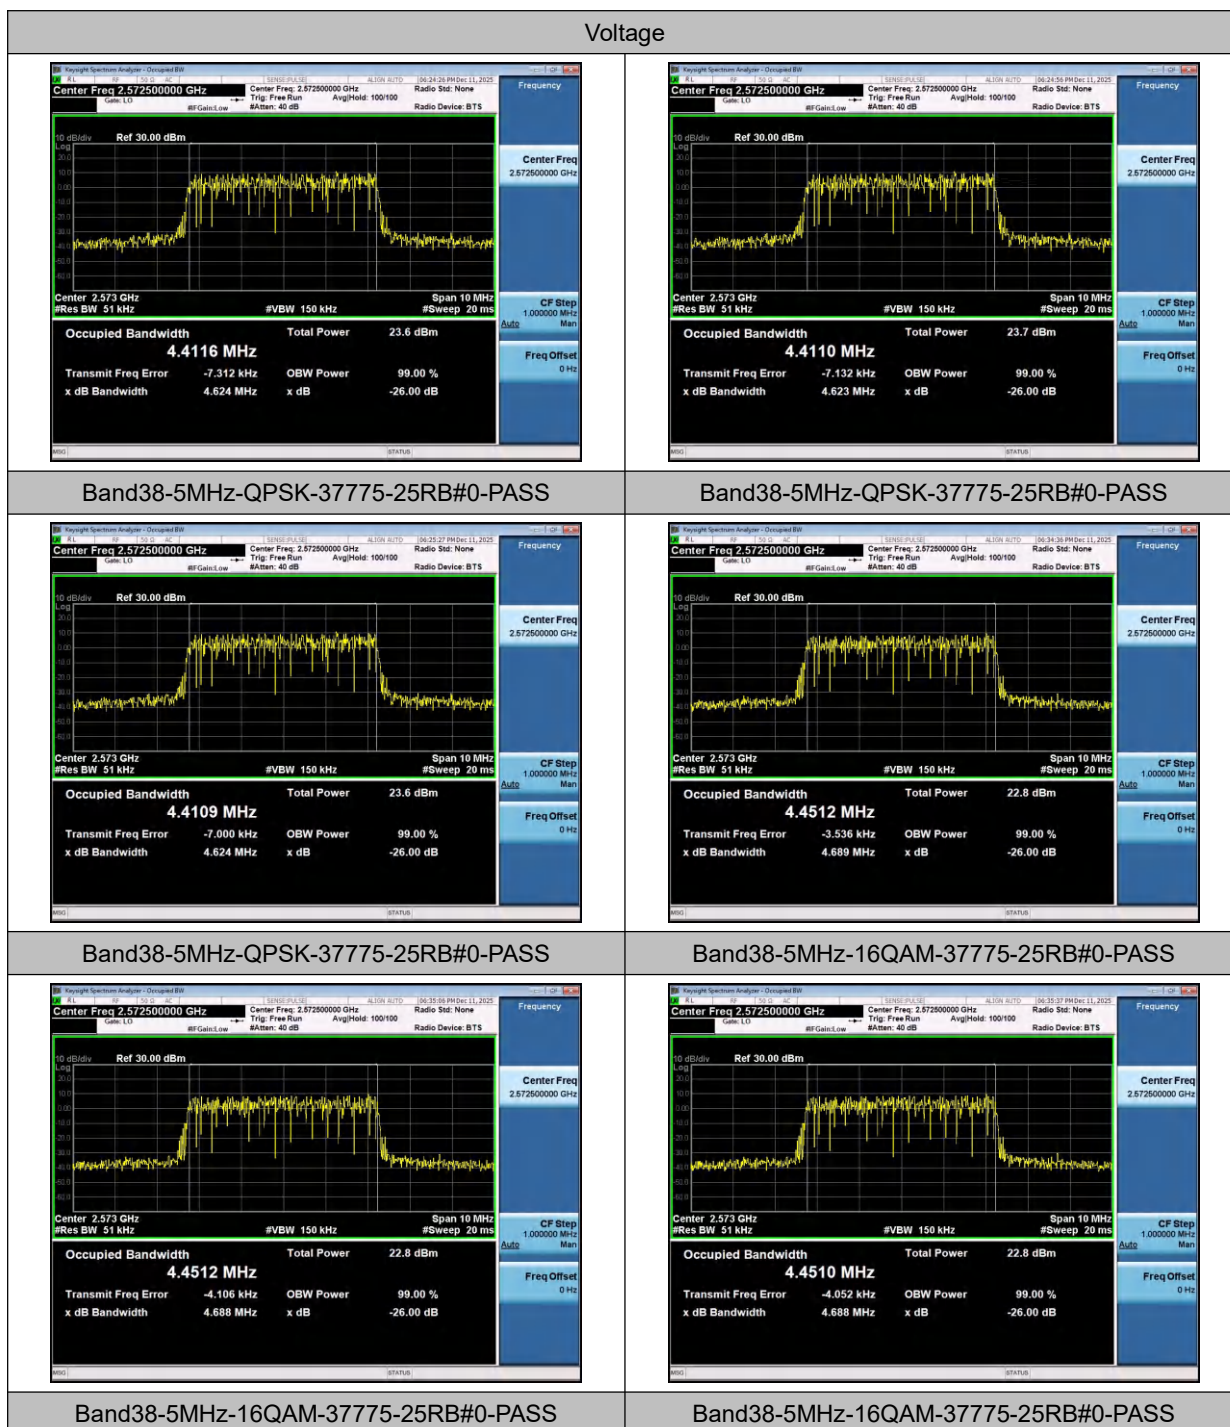


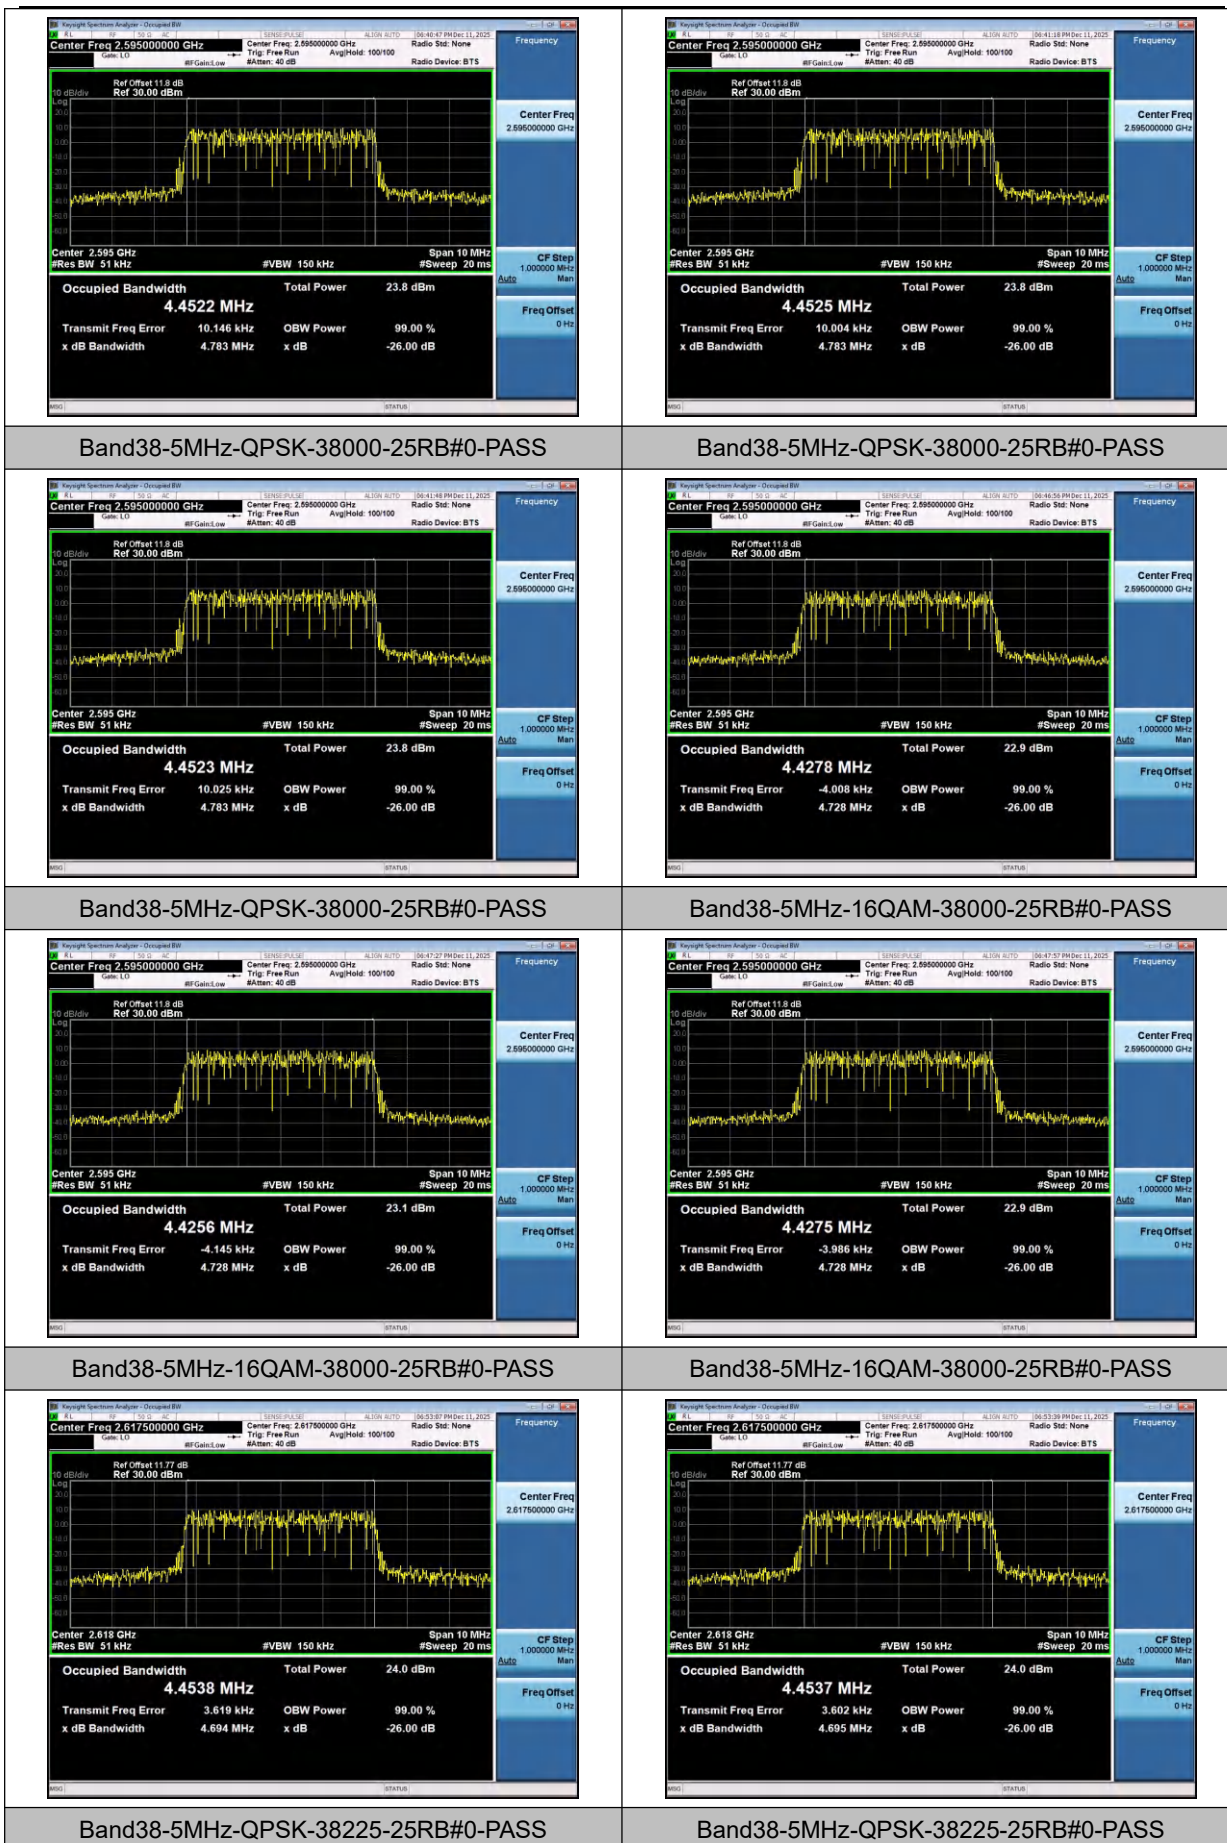


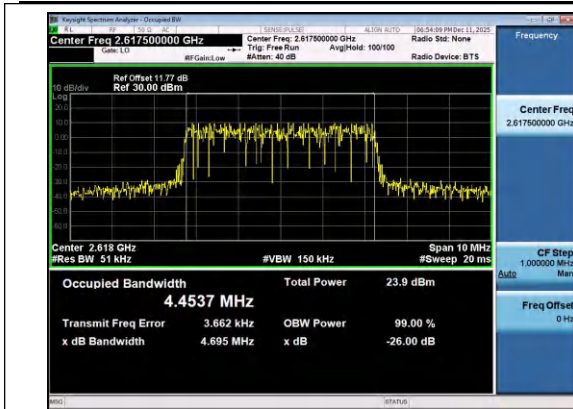

Band38-5MHz-QPSK-38225-25RB#0-PASS


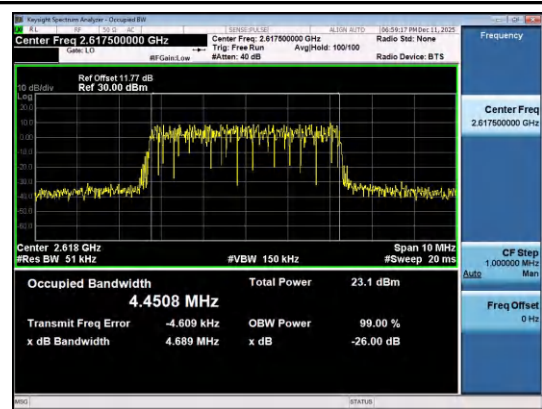


Band38-5MHz-16QAM-38225-25RB#0-PASS

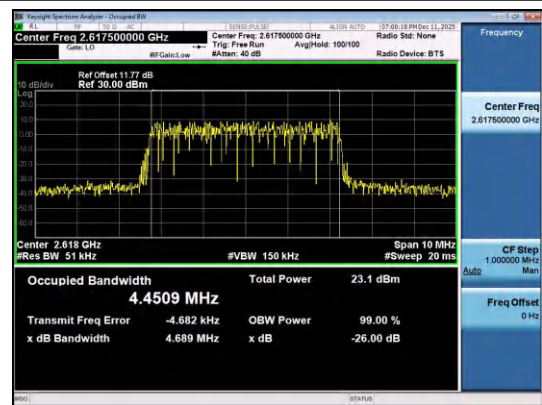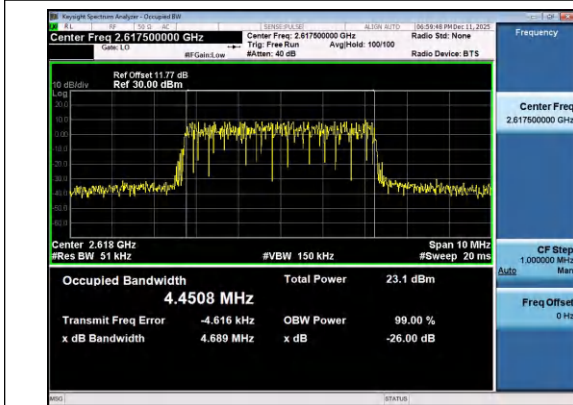



Band38-5MHz-16QAM-38225-25RB#0-PASS

Band38-5MHz-16QAM-38225-25RB#0-PASS

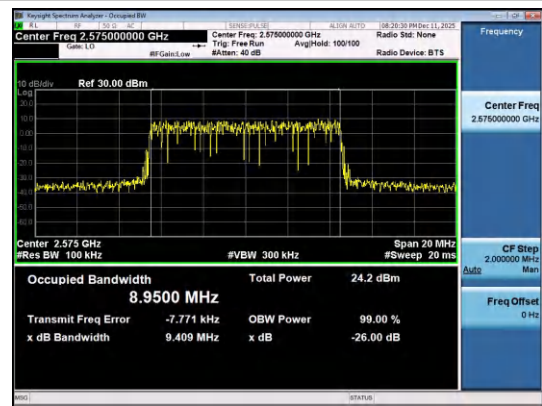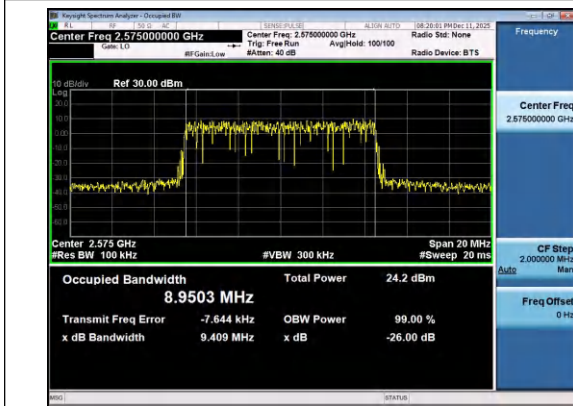


Band38-10MHz-QPSK-37800-50RB#0-PASS


Band38-10MHz-QPSK-37800-50RB#0-PASS

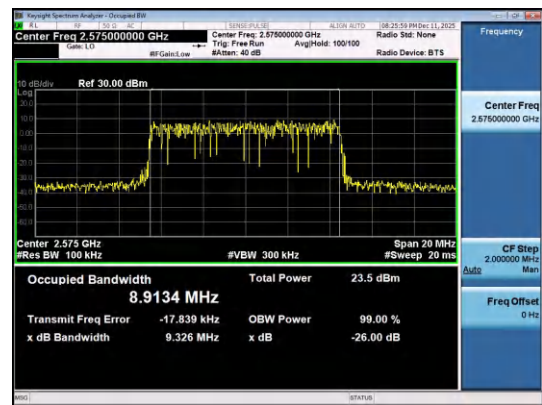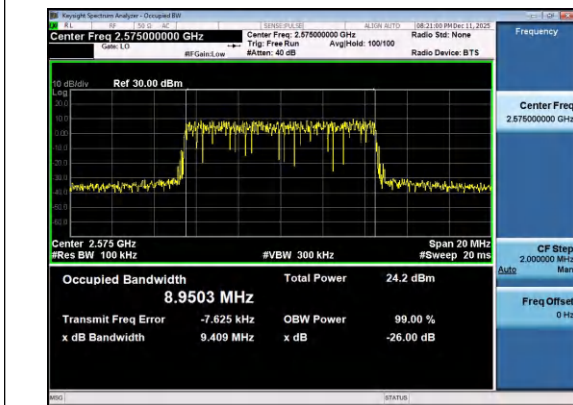


Band38-10MHz-QPSK-37800-50RB#0-PASS

Band38-10MHz-16QAM-37800-50RB#0-PASS

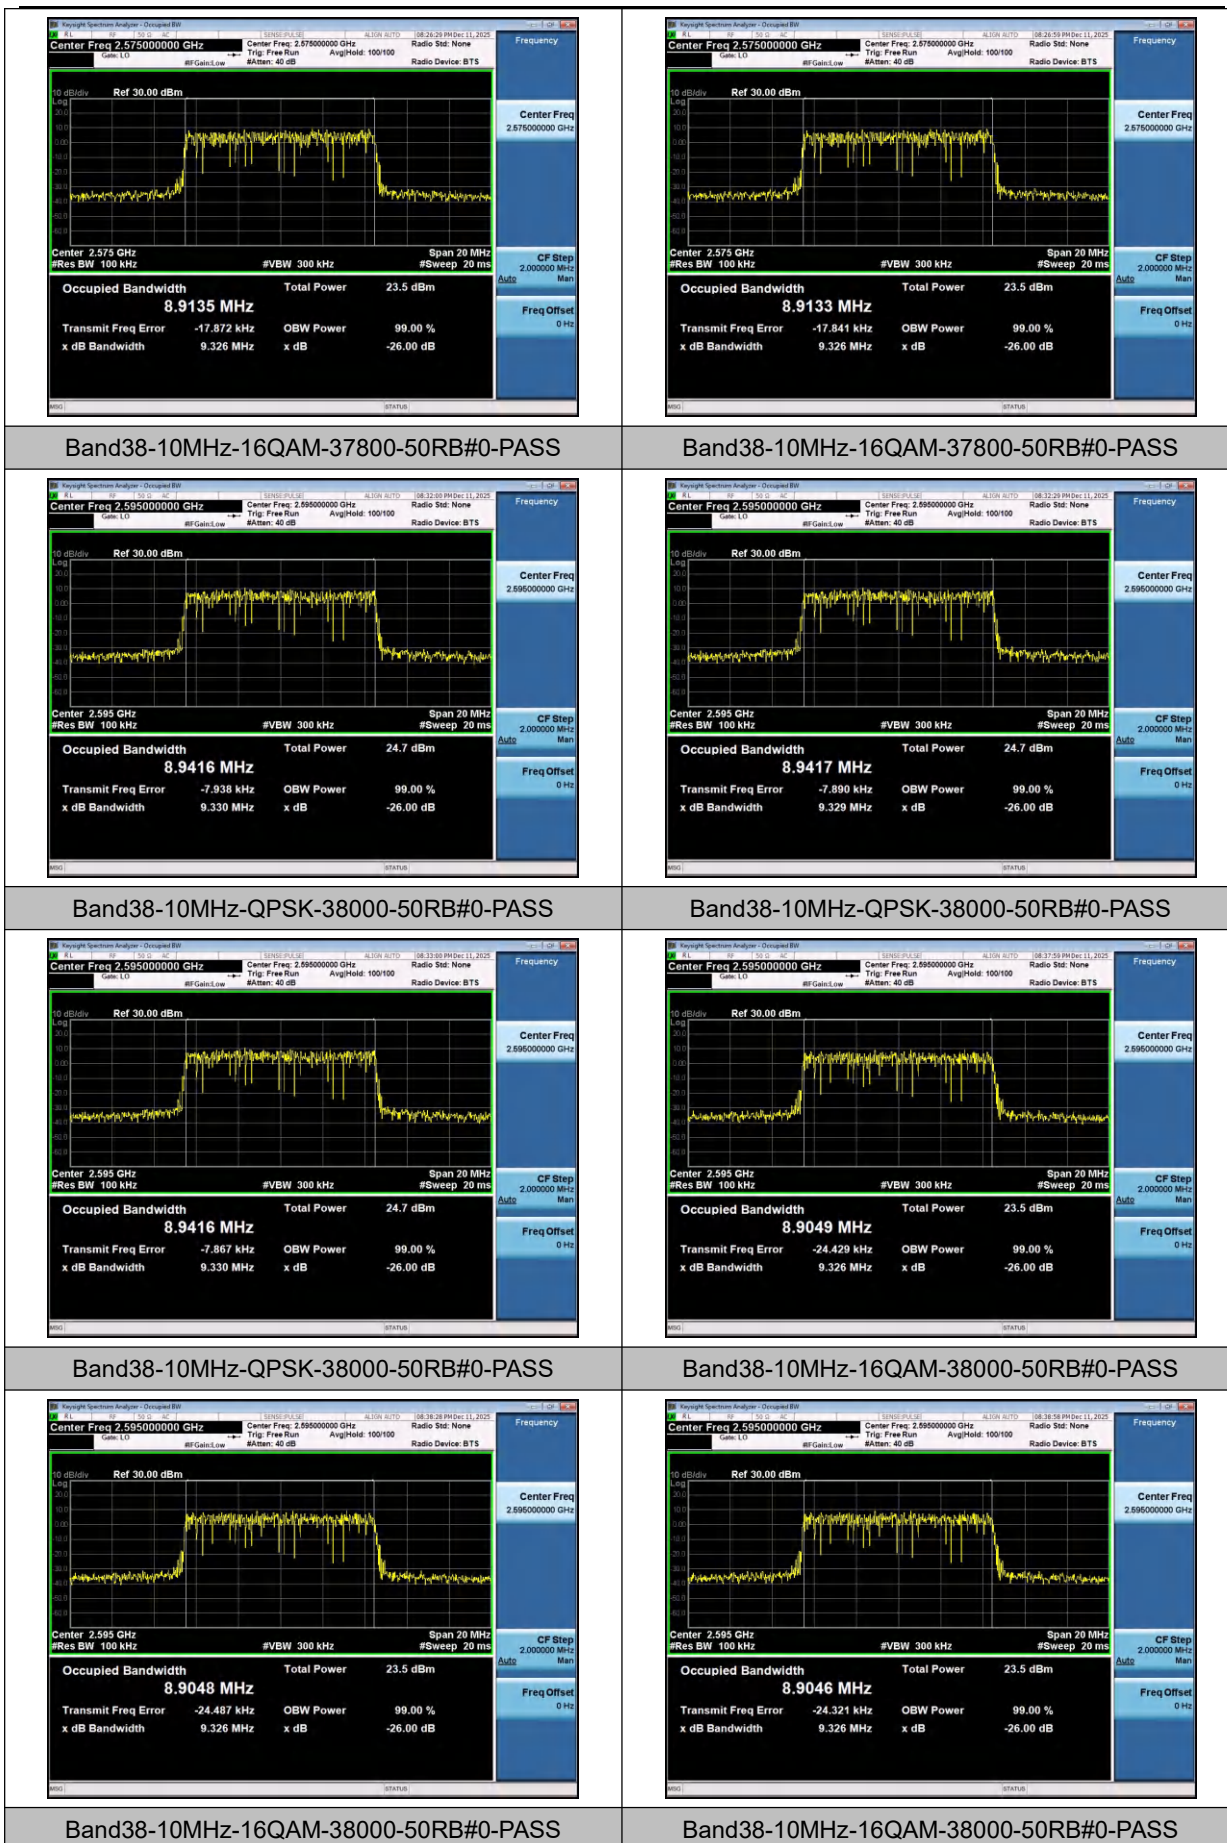


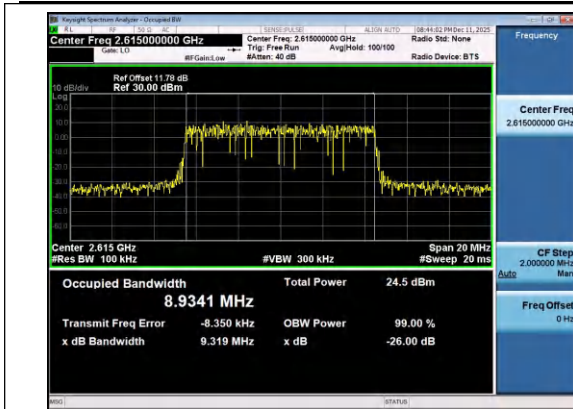


Band38-10MHz-QPSK-38200-50RB#0-PASS

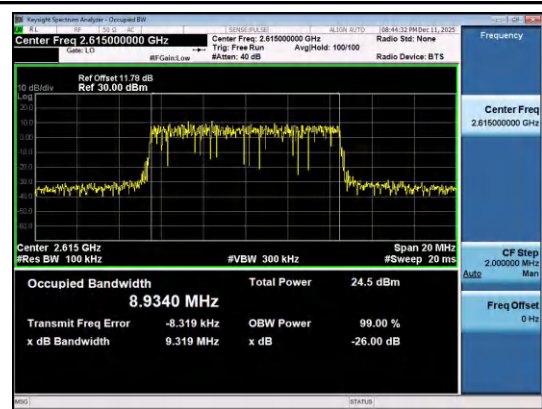


Band38-10MHz-QPSK-38200-50RB#0-PASS

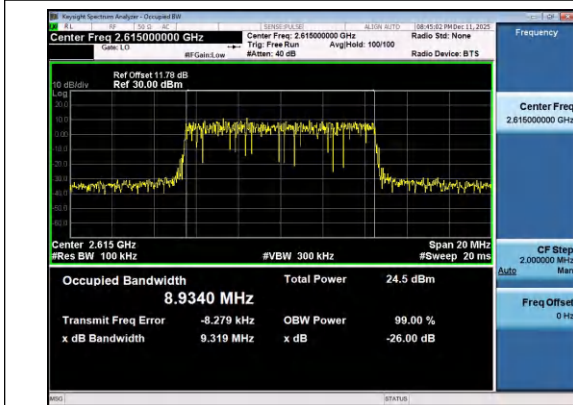


Band38-10MHz-QPSK-38200-50RB#0-PASS

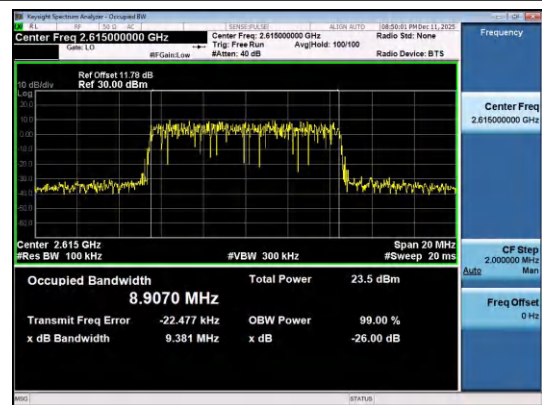


Band38-10MHz-16QAM-38200-50RB#0-PASS

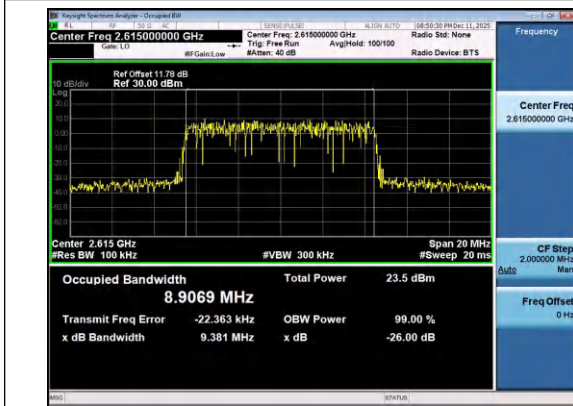


Band38-10MHz-16QAM-38200-50RB#0-PASS

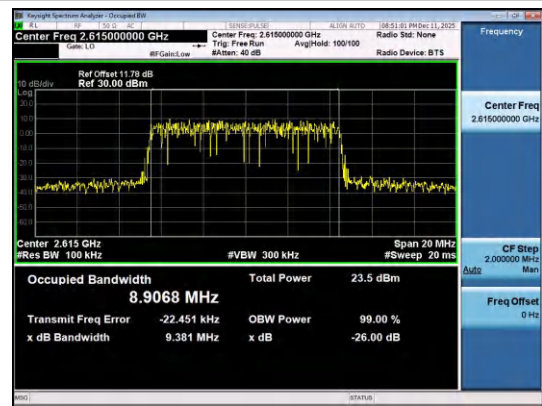


Band38-10MHz-16QAM-38200-50RB#0-PASS

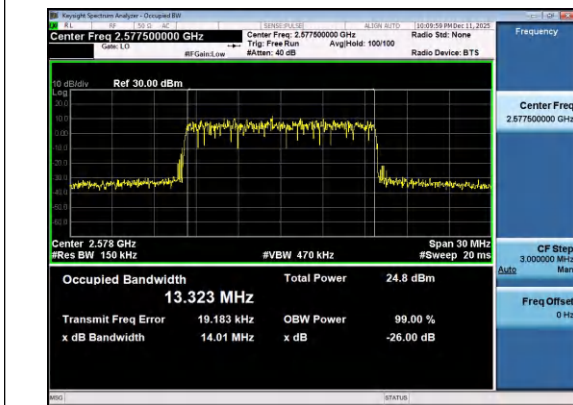


Band38-15MHz-QPSK-37825-75RB#0-PASS

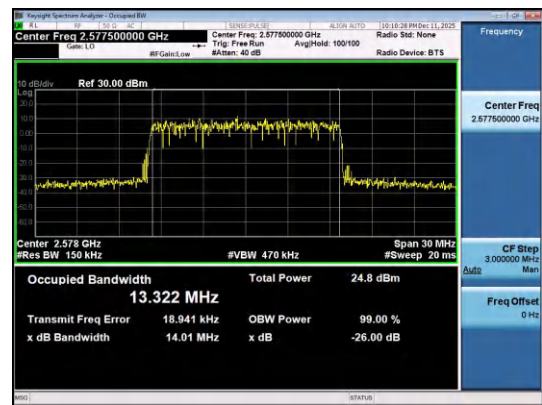


Band38-15MHz-QPSK-37825-75RB#0-PASS

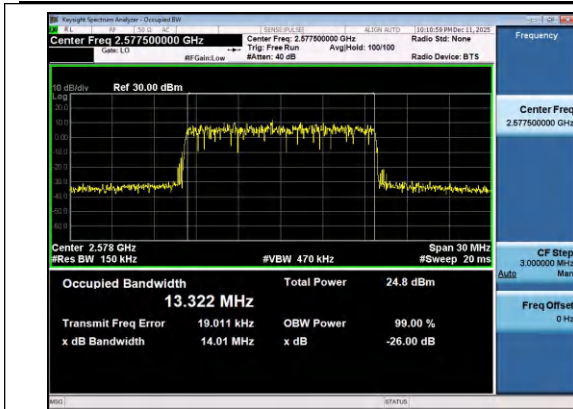


Band38-15MHz-QPSK-37825-75RB#0-PASS

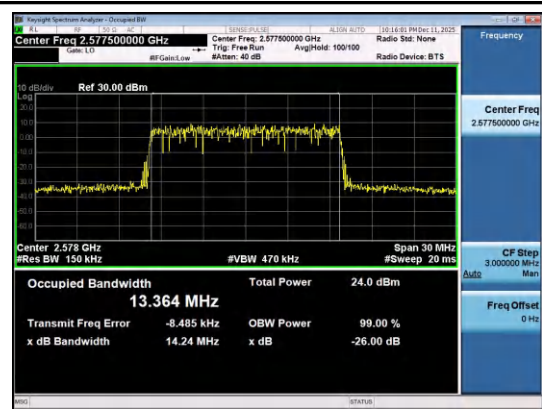


Band38-15MHz-16QAM-37825-75RB#0-PASS

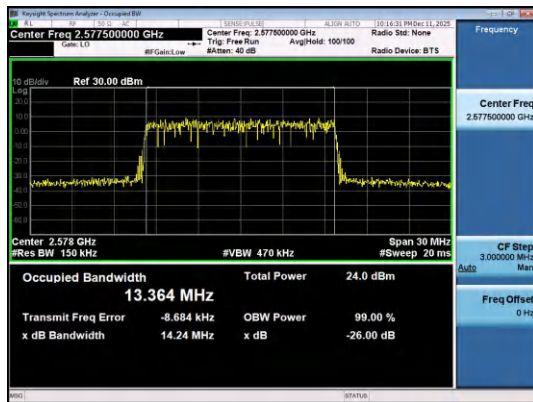


Band38-15MHz-16QAM-37825-75RB#0-PASS

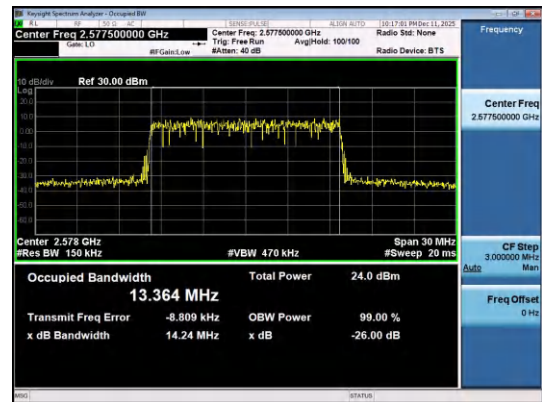


Band38-15MHz-16QAM-37825-75RB#0-PASS

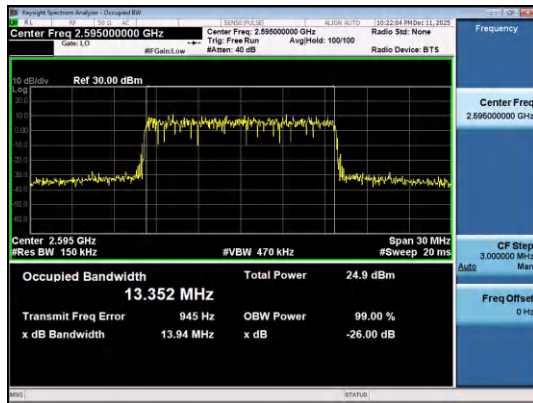


Band38-15MHz-QPSK-38000-75RB#0-PASS

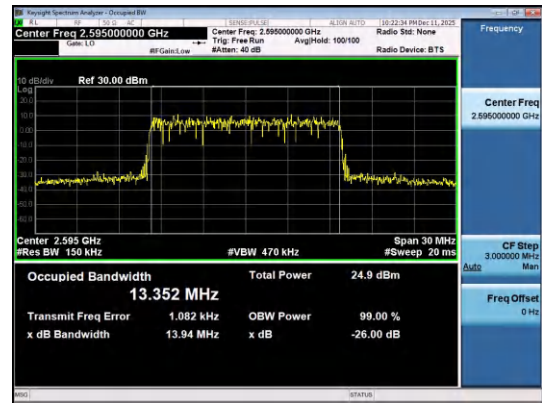


Band38-15MHz-QPSK-38000-75RB#0-PASS

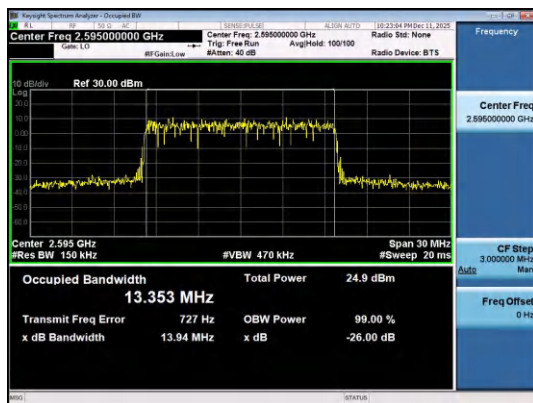


Band38-15MHz-QPSK-38000-75RB#0-PASS

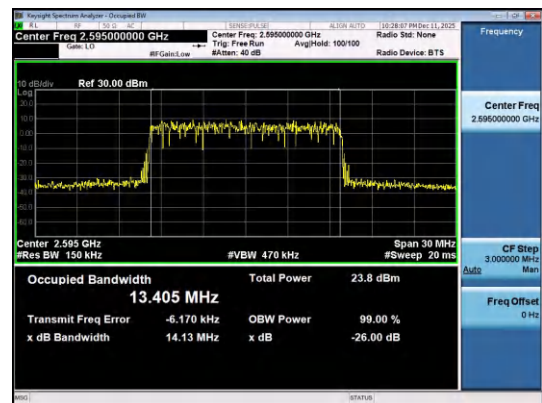


Band38-15MHz-16QAM-38000-75RB#0-PASS

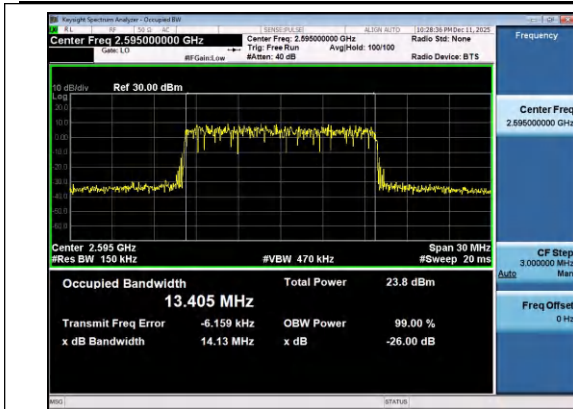


Band38-15MHz-16QAM-38000-75RB#0-PASS

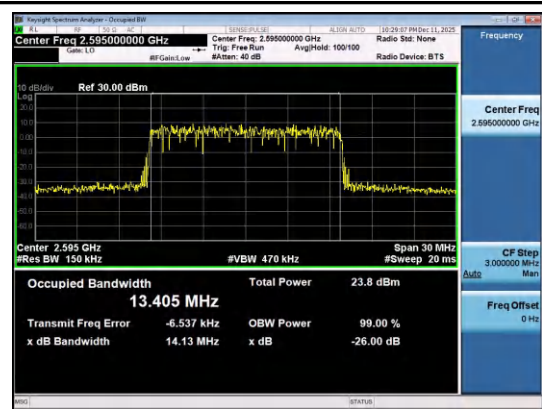


Band38-15MHz-16QAM-38000-75RB#0-PASS

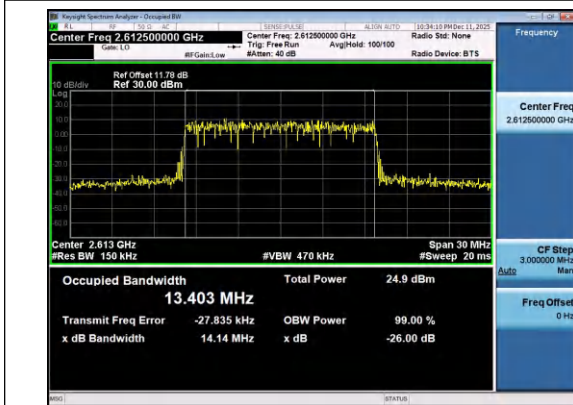


Band38-15MHz-QPSK-38175-75RB#0-PASS

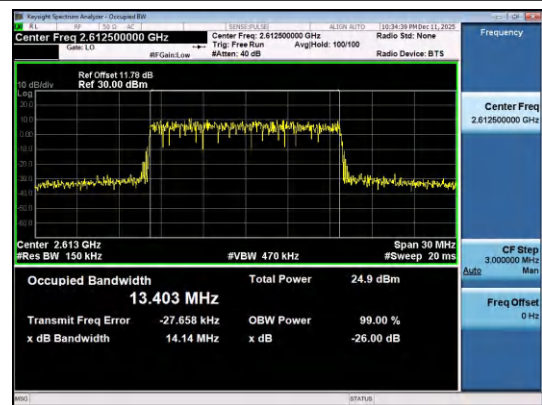


Band38-15MHz-QPSK-38175-75RB#0-PASS

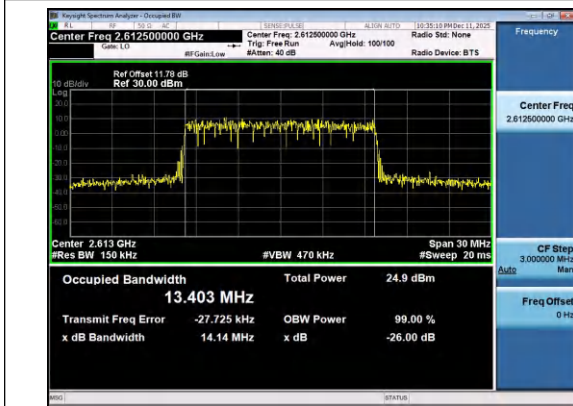


Band38-15MHz-QPSK-38175-75RB#0-PASS

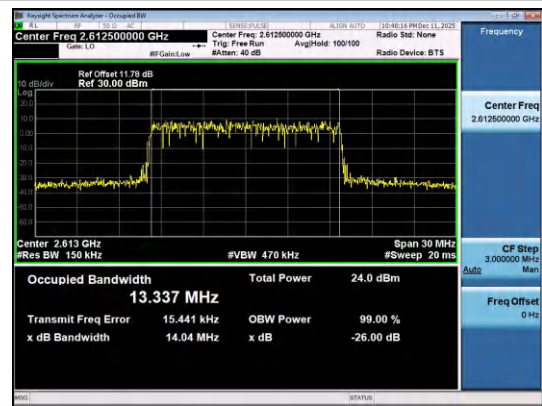


Band38-15MHz-16QAM-38175-75RB#0-PASS

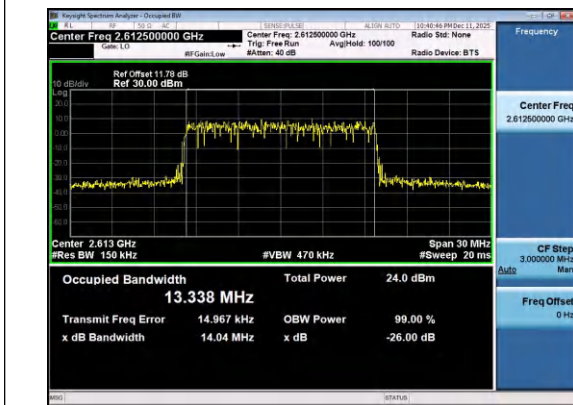


Band38-15MHz-16QAM-38175-75RB#0-PASS

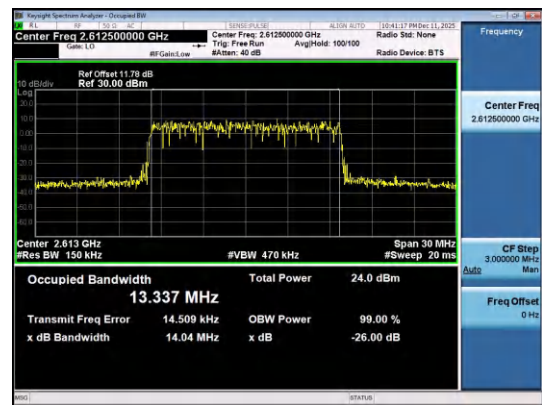


Band38-15MHz-16QAM-38175-75RB#0-PASS

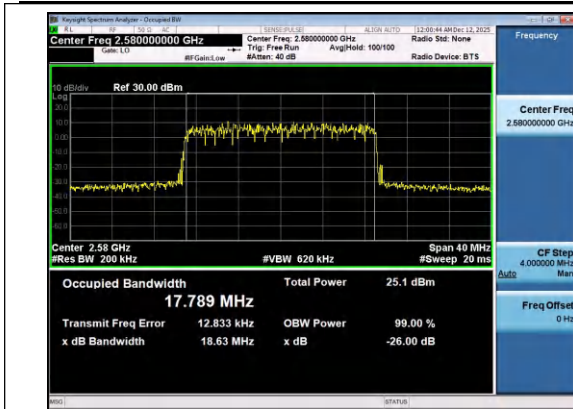


Band38-20MHz-QPSK-37850-100RB#0-PASS

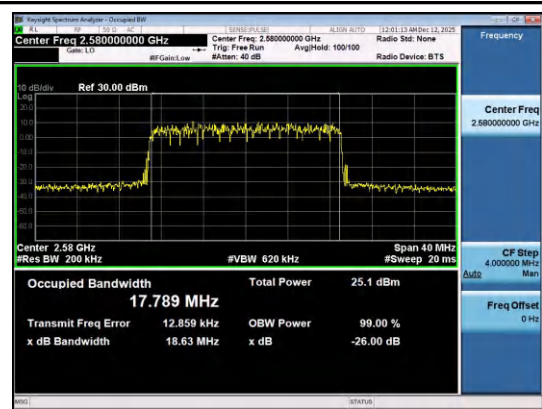


Band38-20MHz-QPSK-37850-100RB#0-PASS

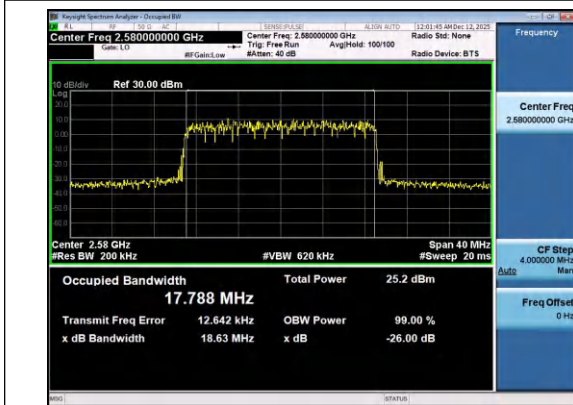


Band38-20MHz-QPSK-37850-100RB#0-PASS

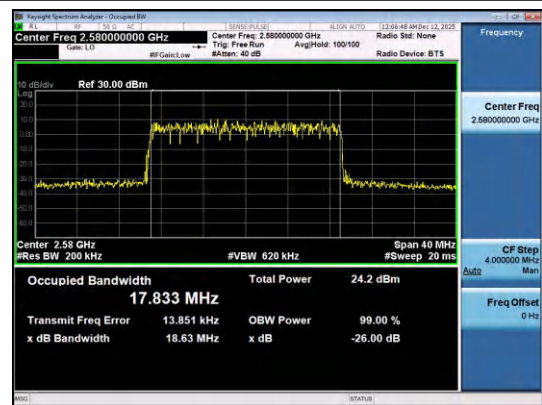


Band38-20MHz-16QAM-37850-100RB#0-PASS

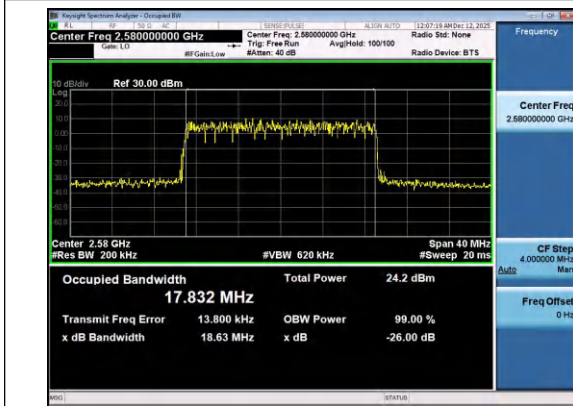


Band38-20MHz-16QAM-37850-100RB#0-PASS

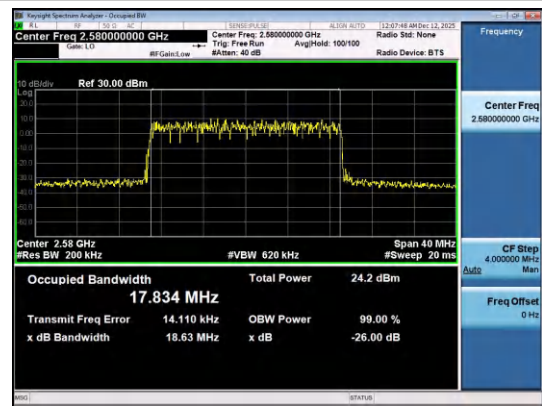

Band38-20MHz-16QAM-37850-100RB#0-PASS

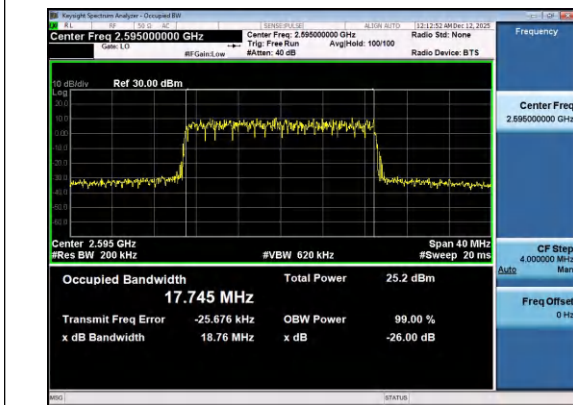

Band38-20MHz-QPSK-38000-100RB#0-PASS

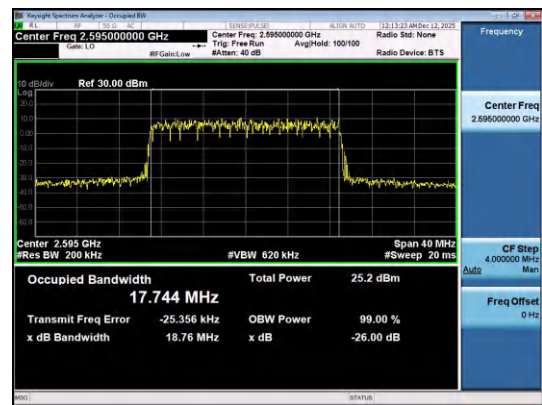

Band38-20MHz-QPSK-38000-100RB#0-PASS

