

Appendix Test Data

Report No:	1812C50617312505-07	Test Sample NO:	1-2-2
Start Test Date:	2025-11-21	Finish Test Date:	2025-12-23
Test Engineer:	<i>Joker Wang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.4°C	Relative Humidity:	47%
Pressure:	101 kPa		



Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	21.02	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#12	21.28	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	21.11	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#0	20.14	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#6	20.21	PASS
Band41(2535-2655)	5MHz	QPSK	40065	12RB#13	20.17	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	20.14	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	20.18	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#12	20.38	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	20.26	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#0	19.13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#6	19.17	PASS
Band41(2535-2655)	5MHz	16QAM	40065	12RB#13	19.19	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	19.17	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#0	21.89	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#12	22.01	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#24	21.94	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#0	20.89	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#6	20.93	PASS
Band41(2535-2655)	5MHz	QPSK	40640	12RB#13	20.94	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	20.90	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#0	20.86	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#12	21.06	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#24	20.97	PASS
Band41(2535-2655)	5MHz	16QAM	40640	12RB#0	19.78	PASS

Band41(2535-2655)	5MHz	16QAM	40640	12RB#6	19.85	PASS
Band41(2535-2655)	5MHz	16QAM	40640	12RB#13	19.84	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	19.79	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	22.49	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#12	22.69	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	22.53	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#0	21.54	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#6	21.65	PASS
Band41(2535-2655)	5MHz	QPSK	41215	12RB#13	21.54	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	21.58	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	21.89	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#12	22.10	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	21.93	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#0	20.57	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#6	20.63	PASS
Band41(2535-2655)	5MHz	16QAM	41215	12RB#13	20.55	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	20.61	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	21.12	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#24	21.25	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	21.33	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#0	20.16	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#12	20.22	PASS
Band41(2535-2655)	10MHz	QPSK	40090	25RB#25	20.27	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	20.23	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	20.39	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#24	20.49	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	20.56	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#0	19.21	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#12	19.28	PASS
Band41(2535-2655)	10MHz	16QAM	40090	25RB#25	19.39	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	19.24	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#0	21.88	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#24	22.02	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#49	22.07	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#0	20.89	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#12	20.89	PASS
Band41(2535-2655)	10MHz	QPSK	40640	25RB#25	20.92	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	20.89	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#0	20.58	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#24	20.62	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#49	20.76	PASS
Band41(2535-2655)	10MHz	16QAM	40640	25RB#0	19.80	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	10MHz	16QAM	40640	25RB#12	19.85	PASS
Band41(2535-2655)	10MHz	16QAM	40640	25RB#25	19.89	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	19.84	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	22.59	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#24	22.54	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	22.72	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#0	21.54	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#12	21.62	PASS
Band41(2535-2655)	10MHz	QPSK	41190	25RB#25	21.63	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	21.62	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	21.52	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#24	21.49	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	21.63	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#0	20.56	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#12	20.62	PASS
Band41(2535-2655)	10MHz	16QAM	41190	25RB#25	20.60	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	20.54	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	21.11	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#38	21.37	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	21.40	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#0	20.29	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#18	20.30	PASS
Band41(2535-2655)	15MHz	QPSK	40115	38RB#37	20.27	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	20.28	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	20.35	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#38	20.55	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	20.66	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#0	20.24	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#18	19.34	PASS
Band41(2535-2655)	15MHz	16QAM	40115	38RB#37	20.30	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	19.27	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#0	21.88	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#38	22.13	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#74	22.14	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#0	20.98	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#18	20.97	PASS
Band41(2535-2655)	15MHz	QPSK	40640	38RB#37	20.98	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	20.97	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#0	20.68	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#38	20.94	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#74	20.93	PASS
Band41(2535-2655)	15MHz	16QAM	40640	38RB#0	20.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	15MHz	16QAM	40640	38RB#18	19.92	PASS
Band41(2535-2655)	15MHz	16QAM	40640	38RB#37	20.97	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	19.93	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	22.53	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#38	22.62	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	22.68	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#0	21.57	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#18	21.58	PASS
Band41(2535-2655)	15MHz	QPSK	41165	38RB#37	21.56	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	21.56	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	21.51	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#38	21.62	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	21.68	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#0	21.57	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#18	20.68	PASS
Band41(2535-2655)	15MHz	16QAM	41165	38RB#37	21.57	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	20.59	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	20.88	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#49	21.24	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	21.25	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#0	20.03	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#25	20.22	PASS
Band41(2535-2655)	20MHz	QPSK	40140	50RB#50	20.24	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	20.16	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	19.94	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#49	20.32	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	20.28	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#0	19.04	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#25	19.30	PASS
Band41(2535-2655)	20MHz	16QAM	40140	50RB#50	19.27	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	19.17	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#0	21.50	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#49	21.93	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#99	21.82	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#0	20.75	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#25	20.86	PASS
Band41(2535-2655)	20MHz	QPSK	40640	50RB#50	20.85	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	20.79	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#0	20.08	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#49	20.85	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#99	20.42	PASS
Band41(2535-2655)	20MHz	16QAM	40640	50RB#0	19.70	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2535-2655)	20MHz	16QAM	40640	50RB#25	19.88	PASS
Band41(2535-2655)	20MHz	16QAM	40640	50RB#50	19.84	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	19.73	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	22.26	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#49	22.54	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	22.52	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#0	21.46	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#25	21.54	PASS
Band41(2535-2655)	20MHz	QPSK	41140	50RB#50	21.52	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	21.48	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	20.95	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#49	21.58	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	21.28	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#0	20.42	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#25	20.51	PASS
Band41(2535-2655)	20MHz	16QAM	41140	50RB#50	20.45	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	20.43	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result (dB)	Limit(dB)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	5.22	13	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	6.02	13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	5.91	13	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	6.49	13	PASS
Band41(2535-2655)	5MHz	QPSK	40640	1RB#0	4.90	13	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	5.73	13	PASS
Band41(2535-2655)	5MHz	16QAM	40640	1RB#0	5.51	13	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	6.27	13	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	5.30	13	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	6.01	13	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	5.67	13	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	8.39	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	5.26	13	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	5.81	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	7.21	13	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	6.46	13	PASS
Band41(2535-2655)	10MHz	QPSK	40640	1RB#0	5.83	13	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	5.60	13	PASS
Band41(2535-2655)	10MHz	16QAM	40640	1RB#0	6.02	13	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	6.34	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	5.61	13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	5.94	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	6.33	13	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	6.67	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	6.07	13	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	6.22	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	6.34	13	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	6.74	13	PASS
Band41(2535-2655)	15MHz	QPSK	40640	1RB#0	5.72	13	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	5.99	13	PASS
Band41(2535-2655)	15MHz	16QAM	40640	1RB#0	6.03	13	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	6.43	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	5.28	13	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	6.28	13	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	7.15	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	6.61	13	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	5.81	13	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	5.85	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	5.84	13	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	6.48	13	PASS
Band41(2535-2655)	20MHz	QPSK	40640	1RB#0	4.95	13	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	5.46	13	PASS
Band41(2535-2655)	20MHz	16QAM	40640	1RB#0	5.72	13	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	6.29	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	5.68	13	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	5.87	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	6.17	13	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	6.71	13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

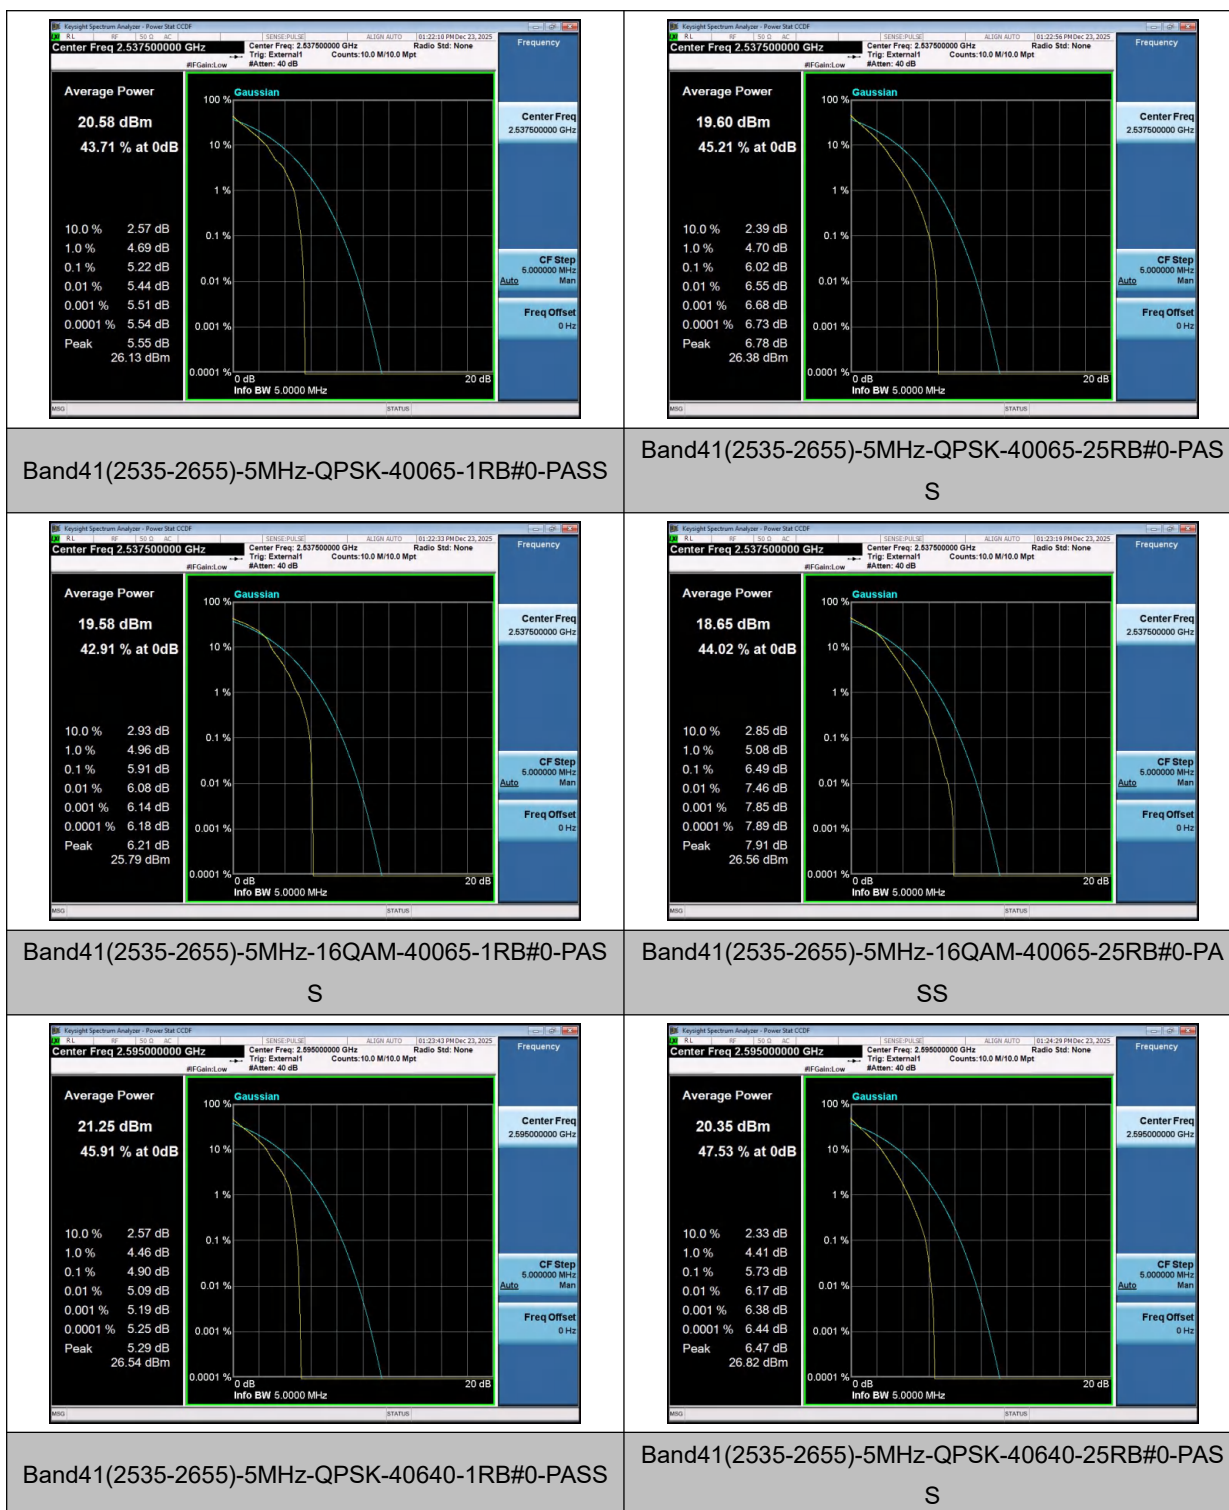


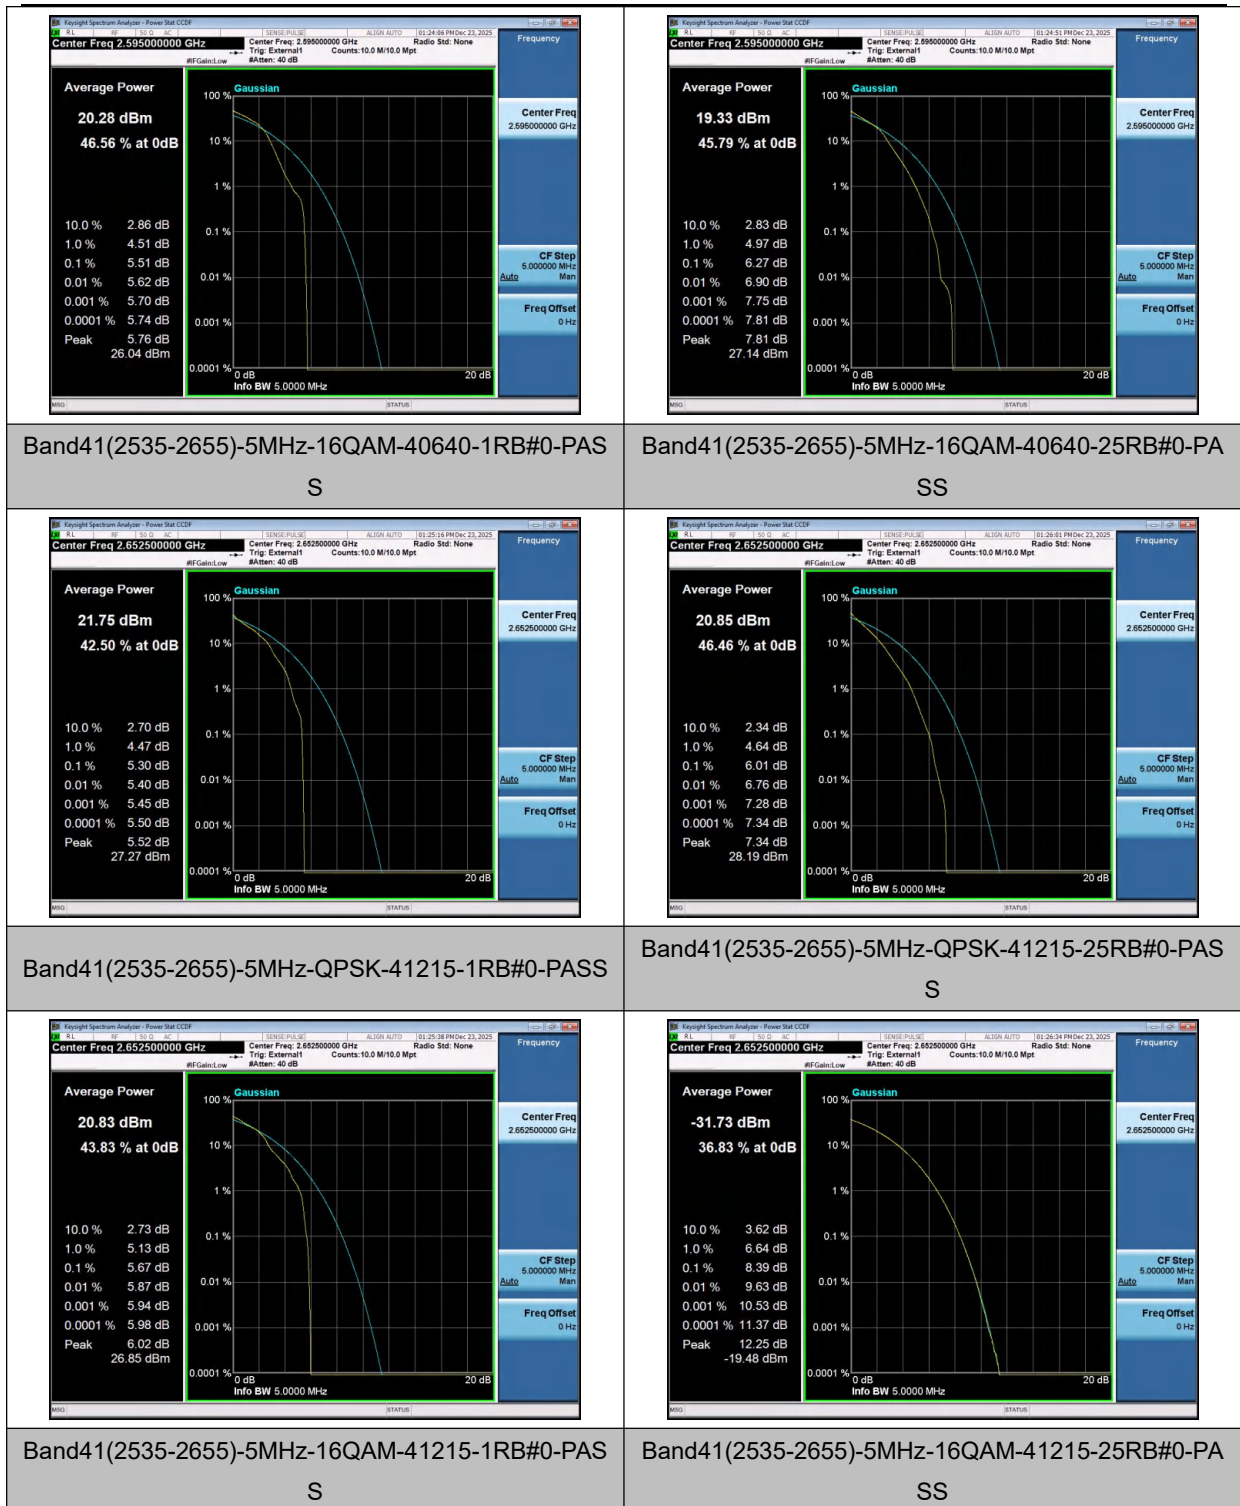


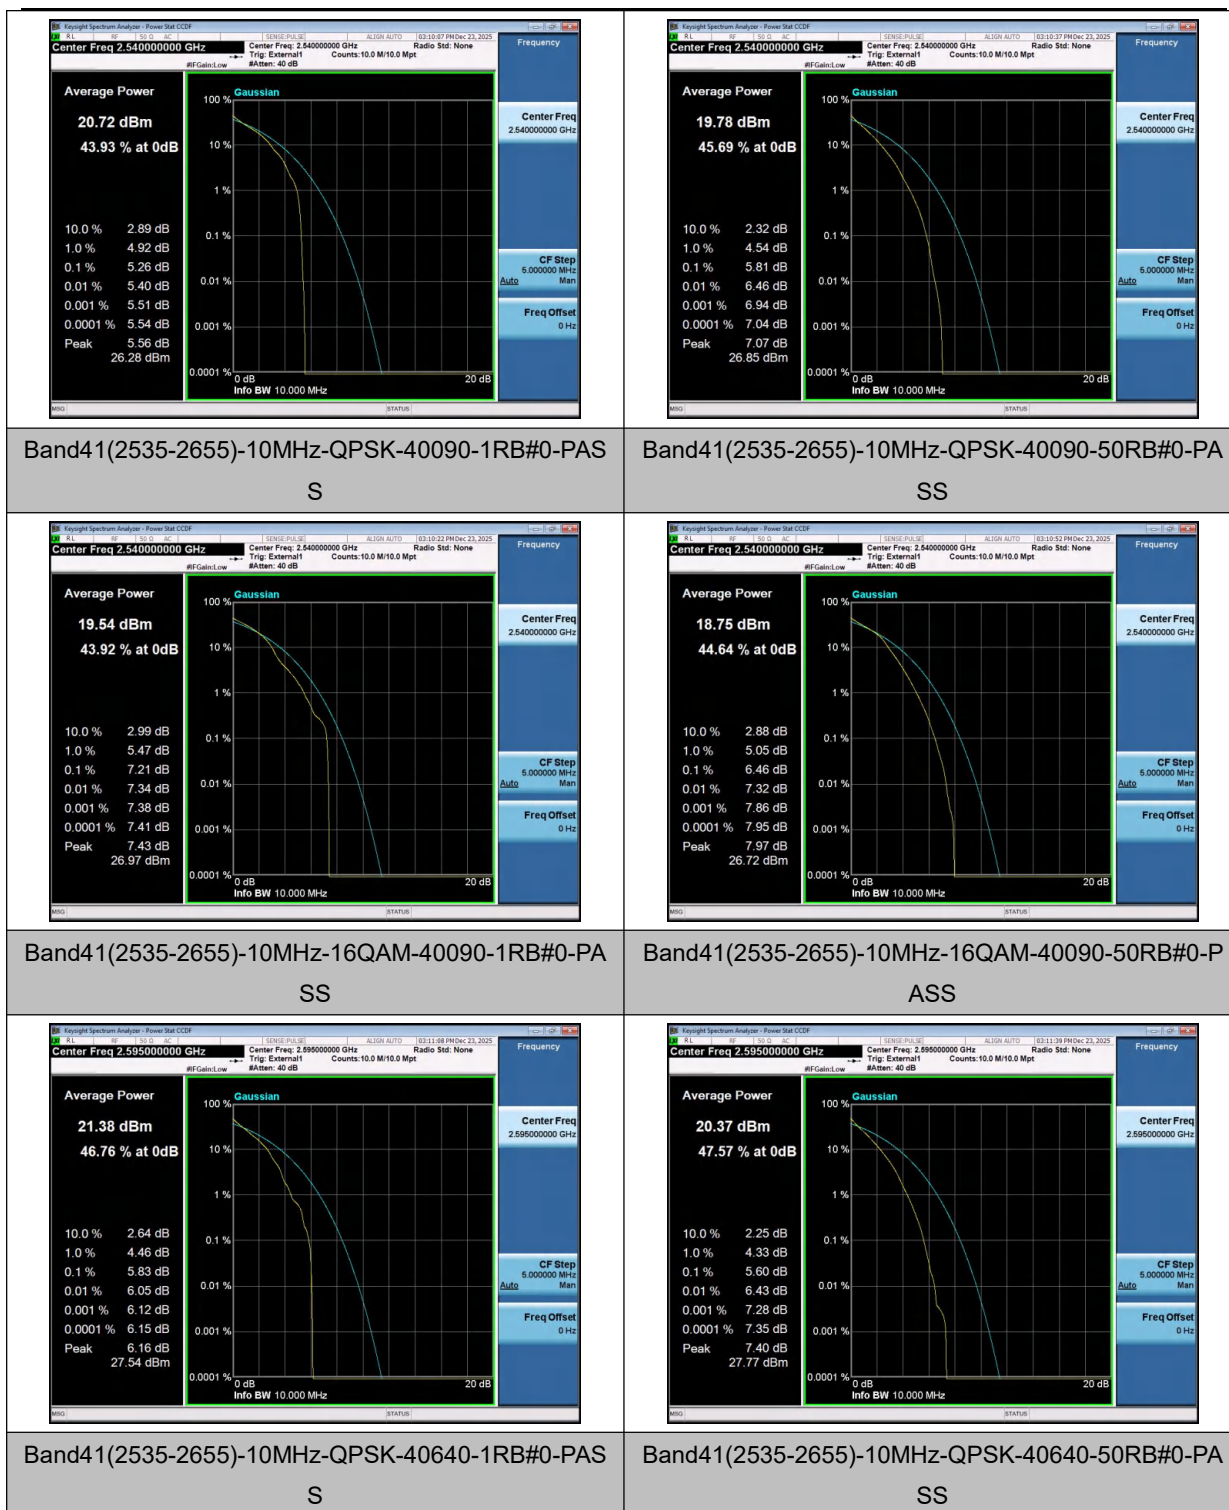


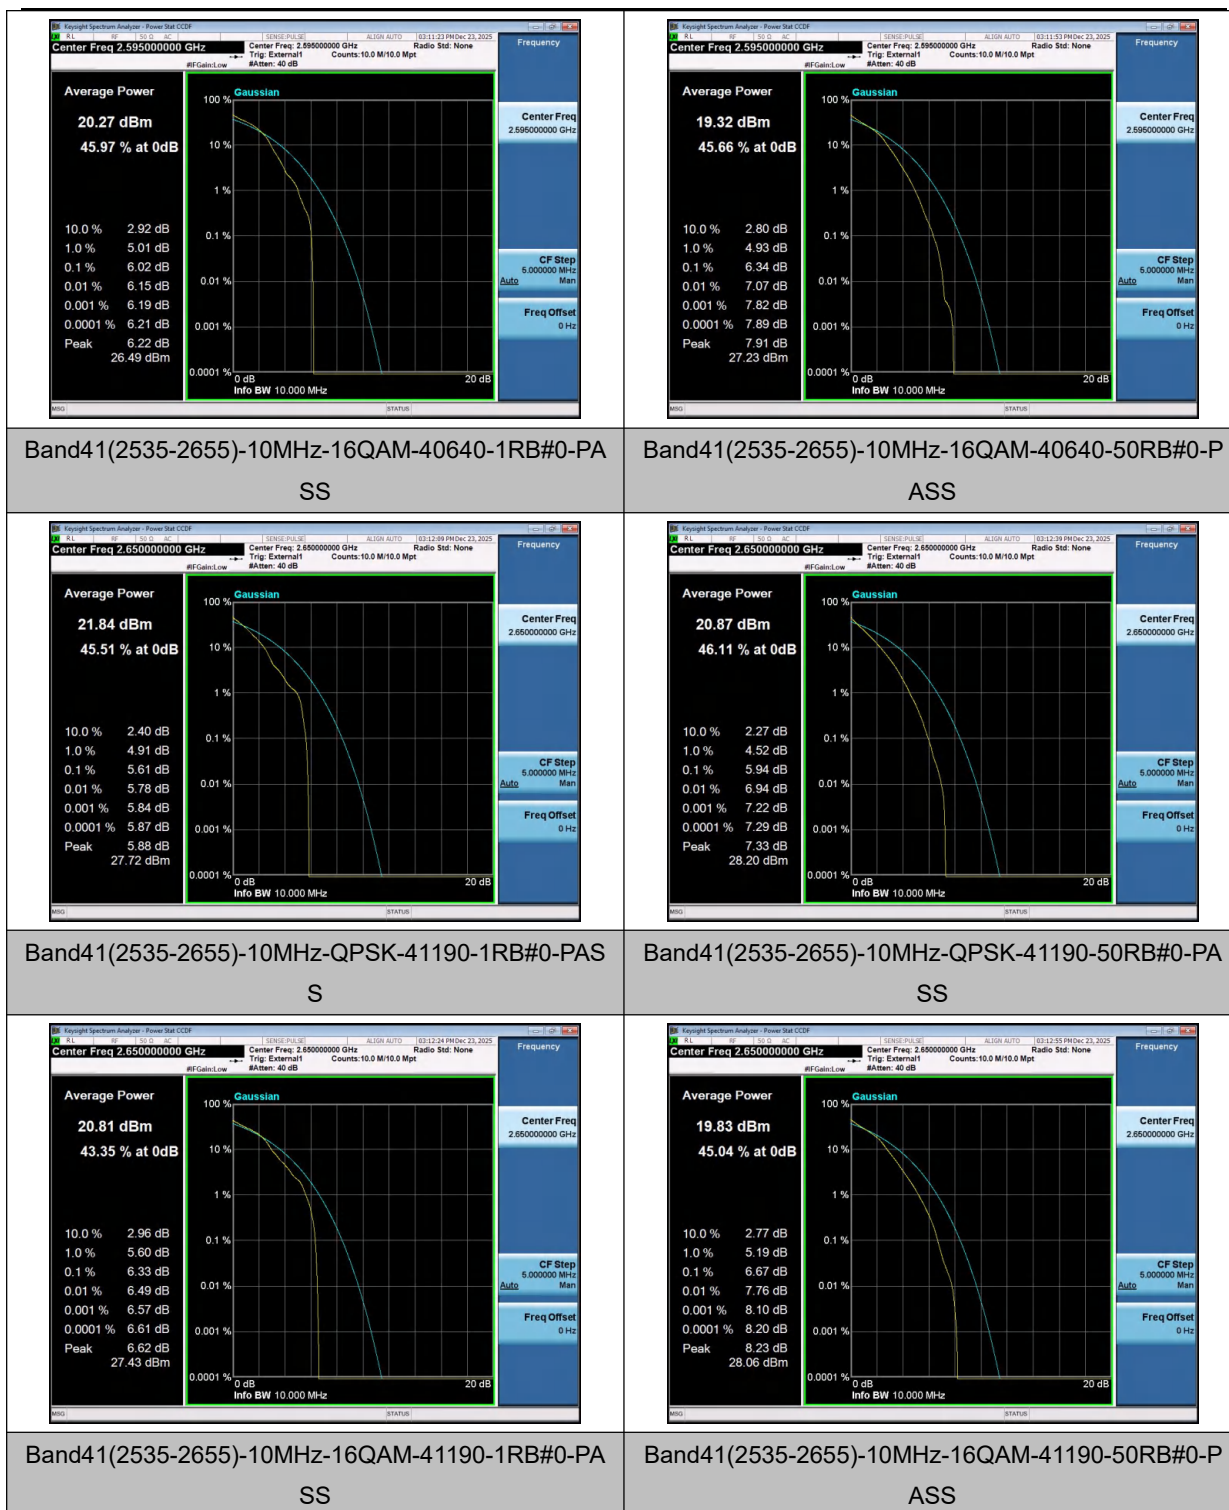

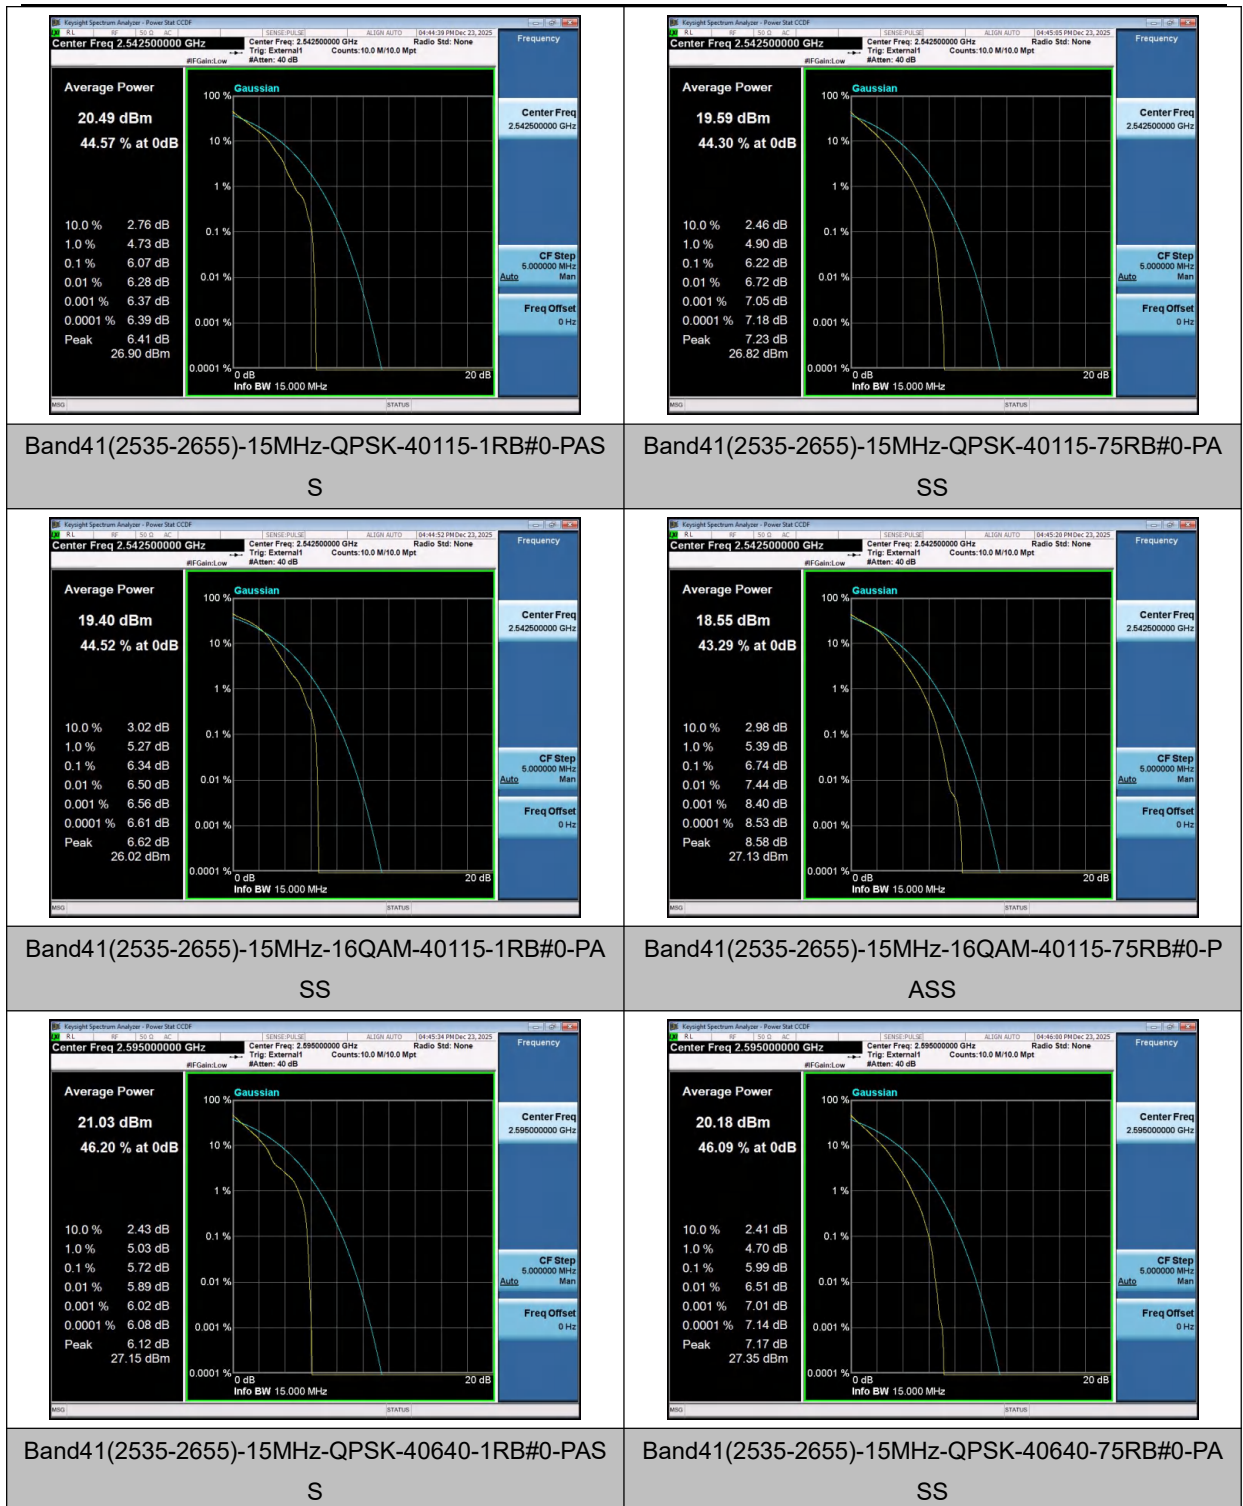

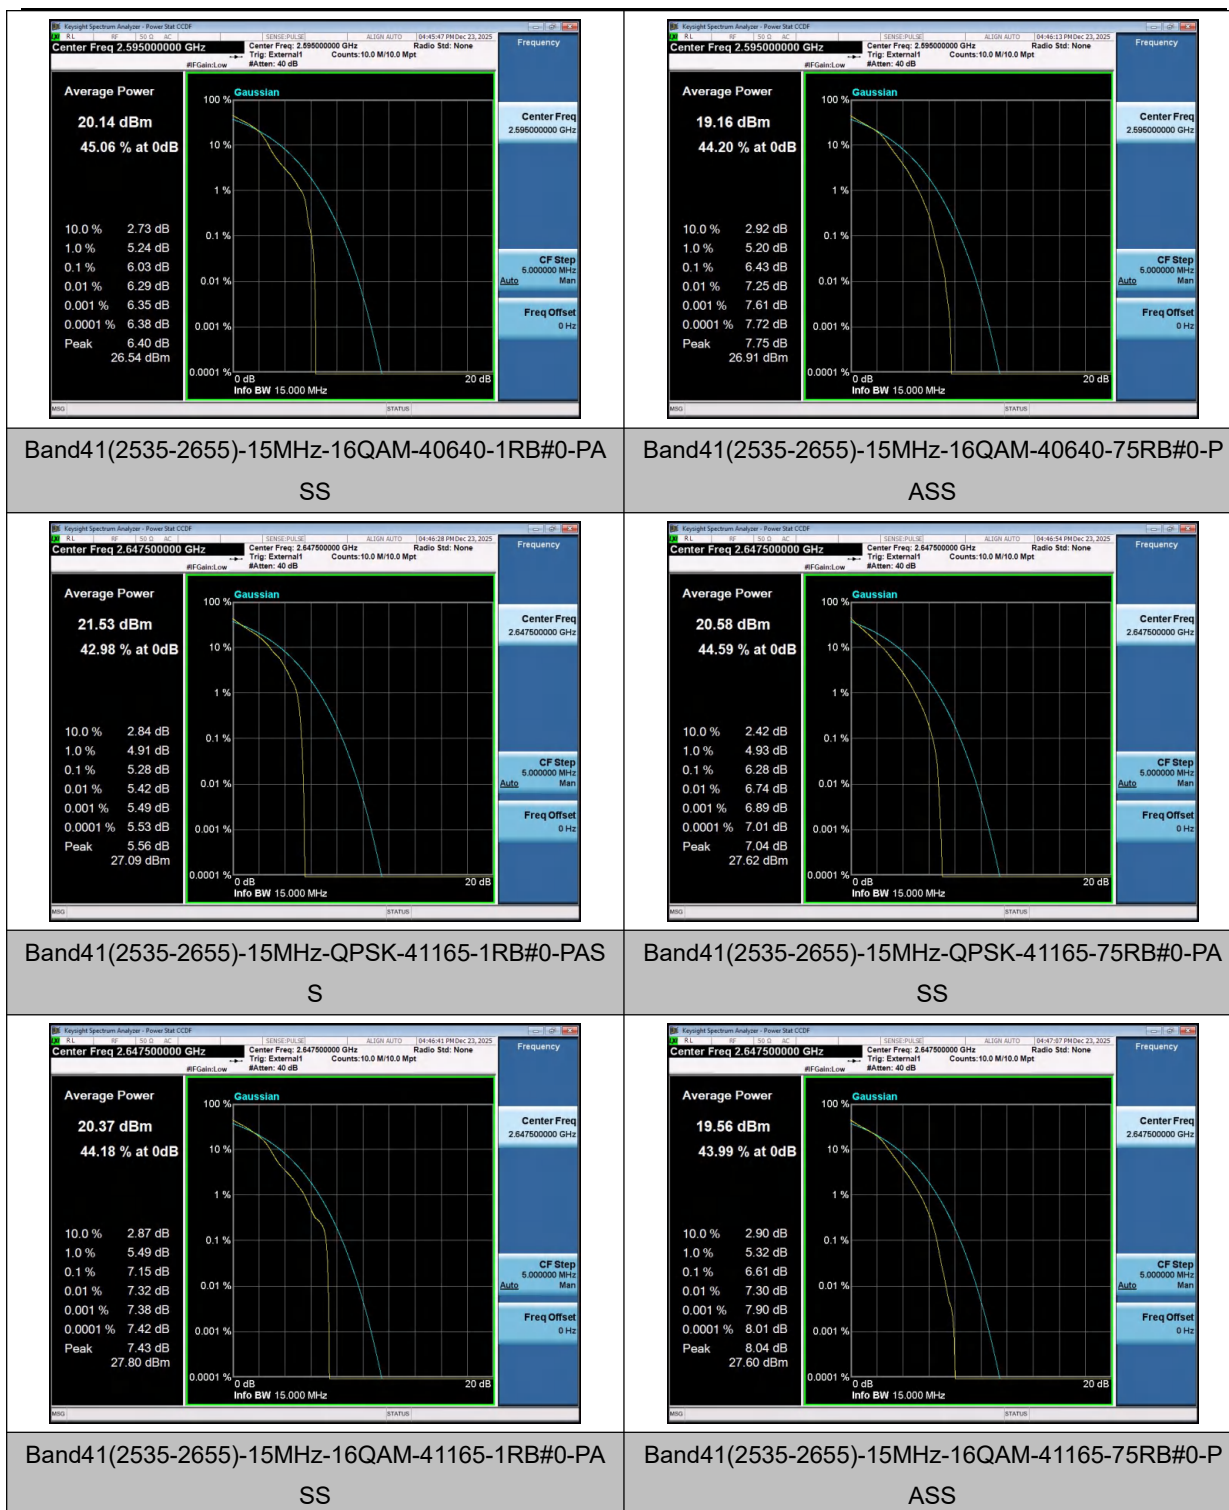

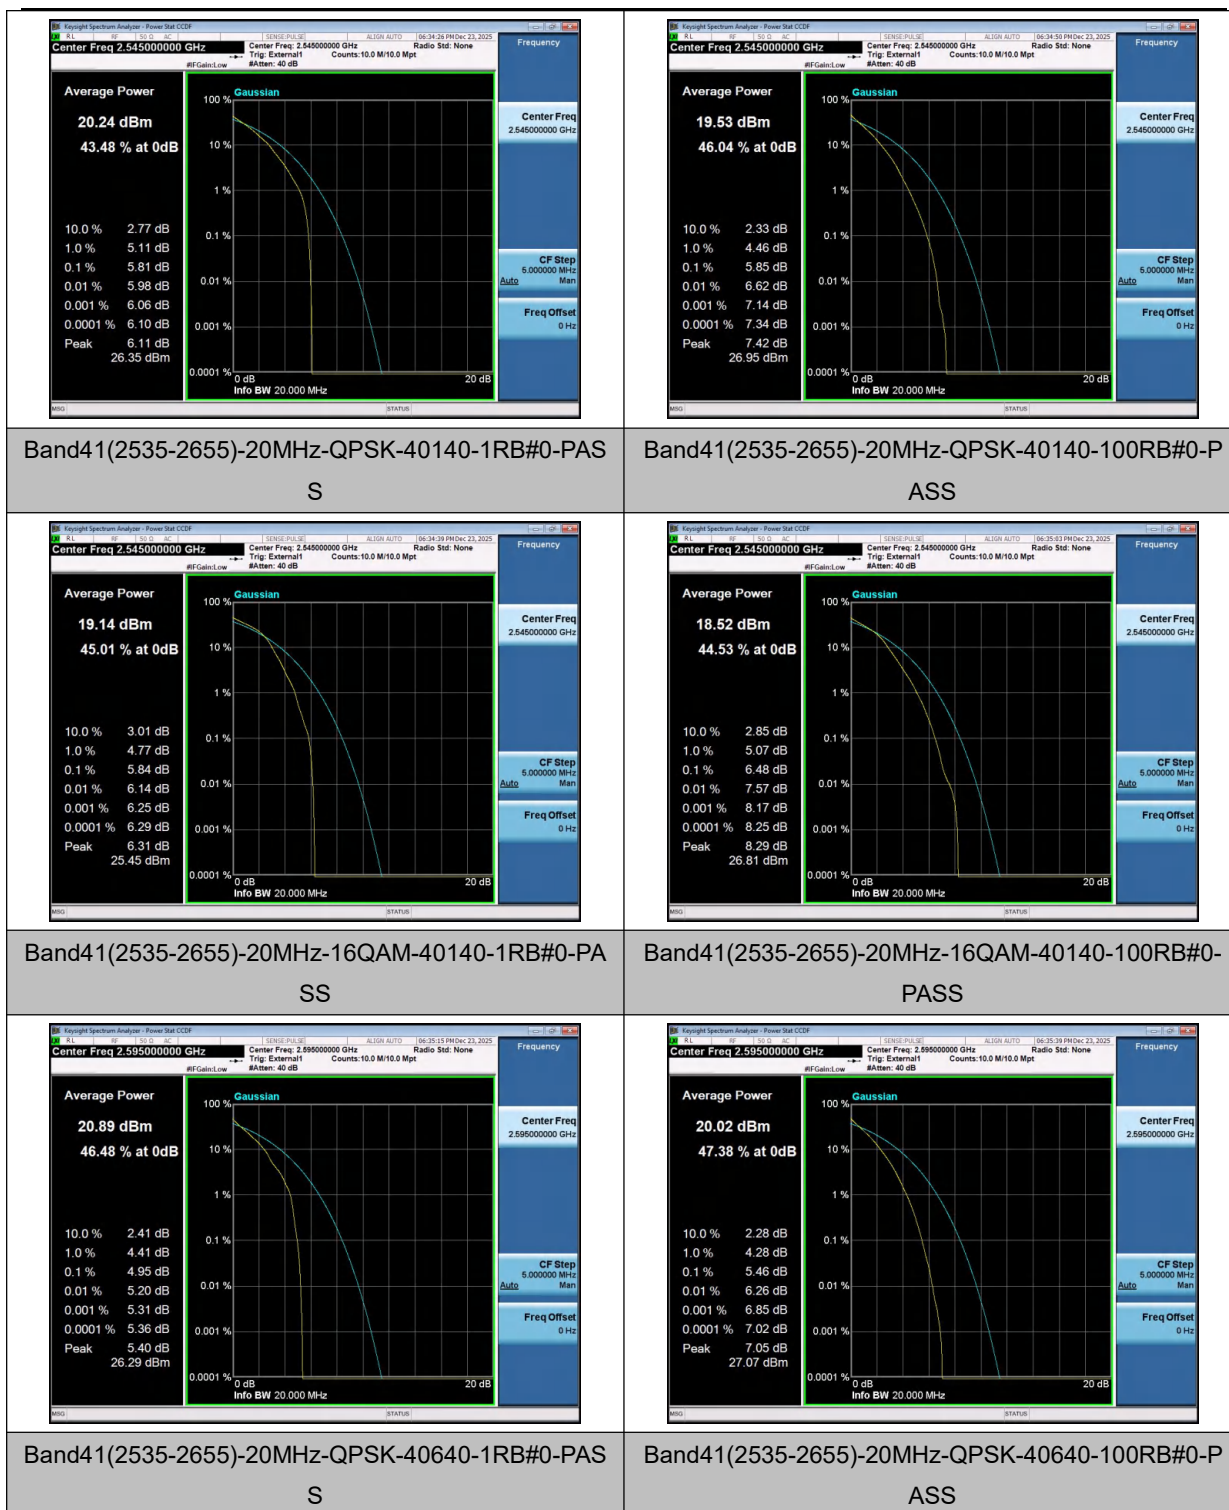

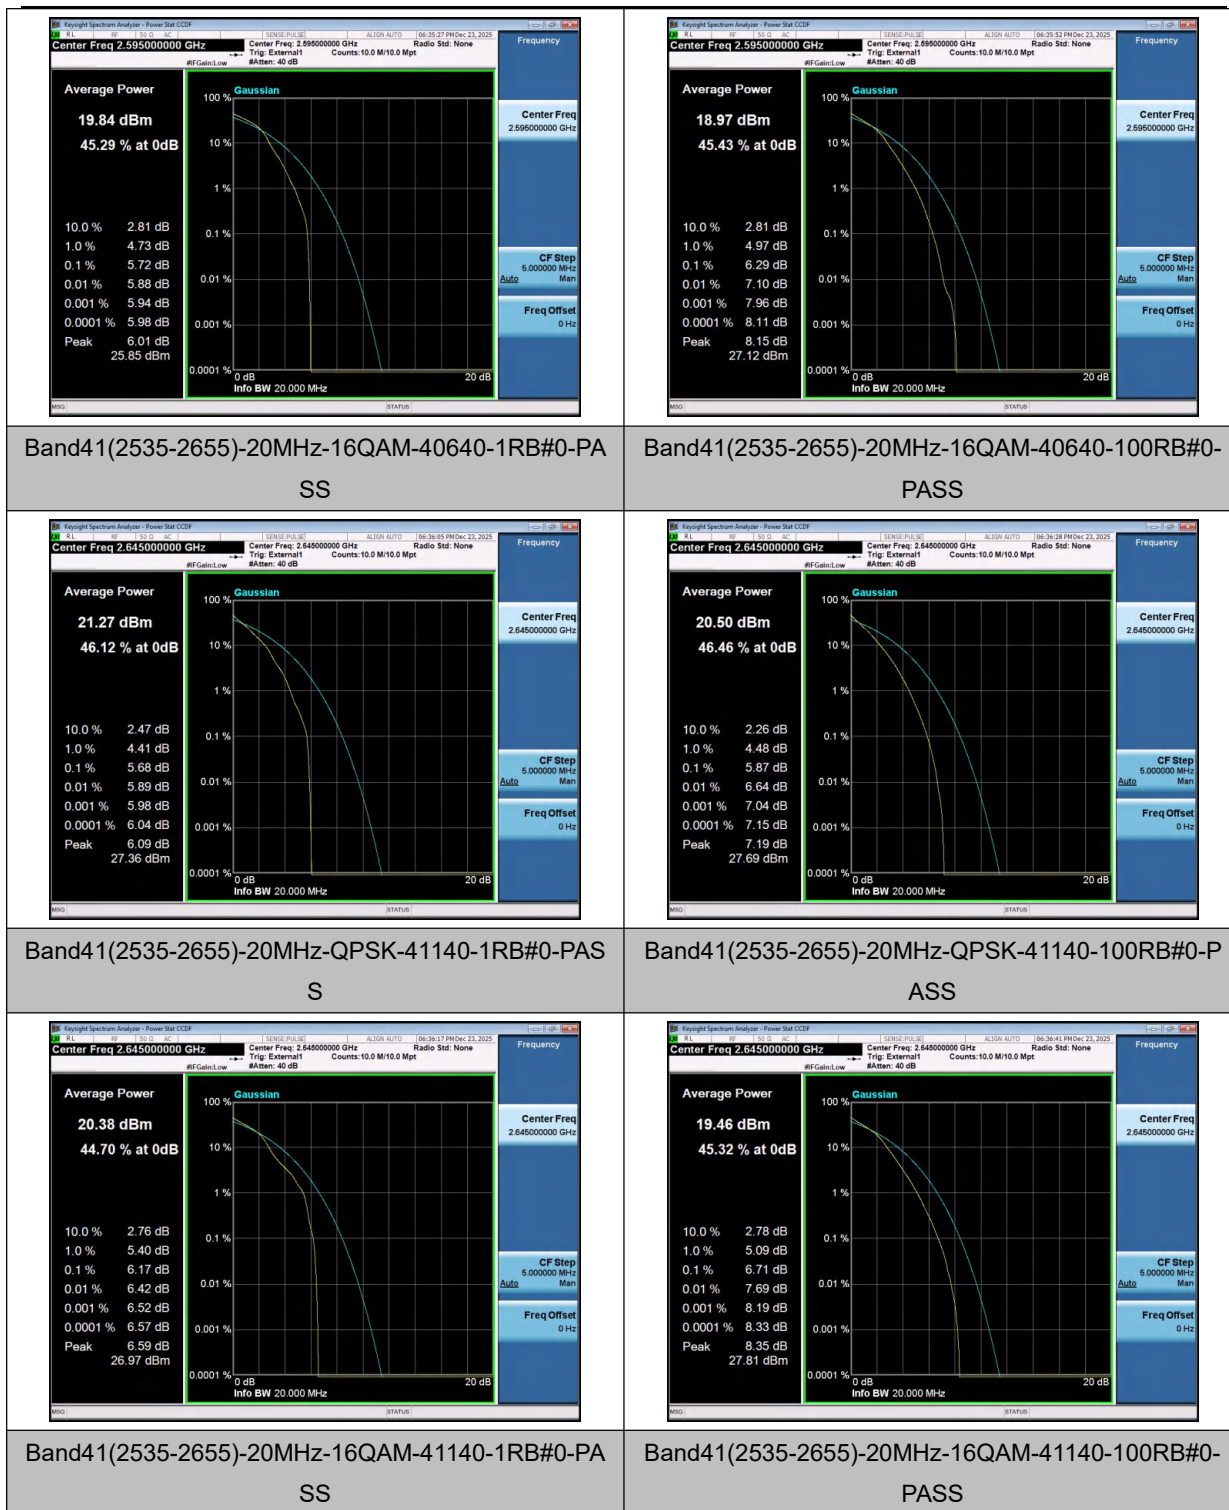



Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	4.4929	4.873	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	4.4908	4.895	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	4.4881	4.901	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	4.4864	4.912	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	4.4940	4.907	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	4.4934	4.926	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	8.9865	9.720	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	8.9666	9.642	PASS
Band41(2535-2655)	10MHz	QPSK	40640	50RB#0	8.9785	9.996	PASS
Band41(2535-2655)	10MHz	16QAM	40640	50RB#0	8.9607	10.13	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	8.9721	9.741	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	8.9652	9.706	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	13.500	14.57	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	13.467	14.83	PASS
Band41(2535-2655)	15MHz	QPSK	40640	75RB#0	13.418	14.60	PASS
Band41(2535-2655)	15MHz	16QAM	40640	75RB#0	13.450	14.74	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	13.436	14.68	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	13.476	14.79	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	17.944	19.31	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	17.917	19.37	PASS
Band41(2535-2655)	20MHz	QPSK	40640	100RB#0	17.900	19.25	PASS
Band41(2535-2655)	20MHz	16QAM	40640	100RB#0	17.867	19.21	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	17.906	19.24	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	17.921	19.94	PASS

Test Graphs

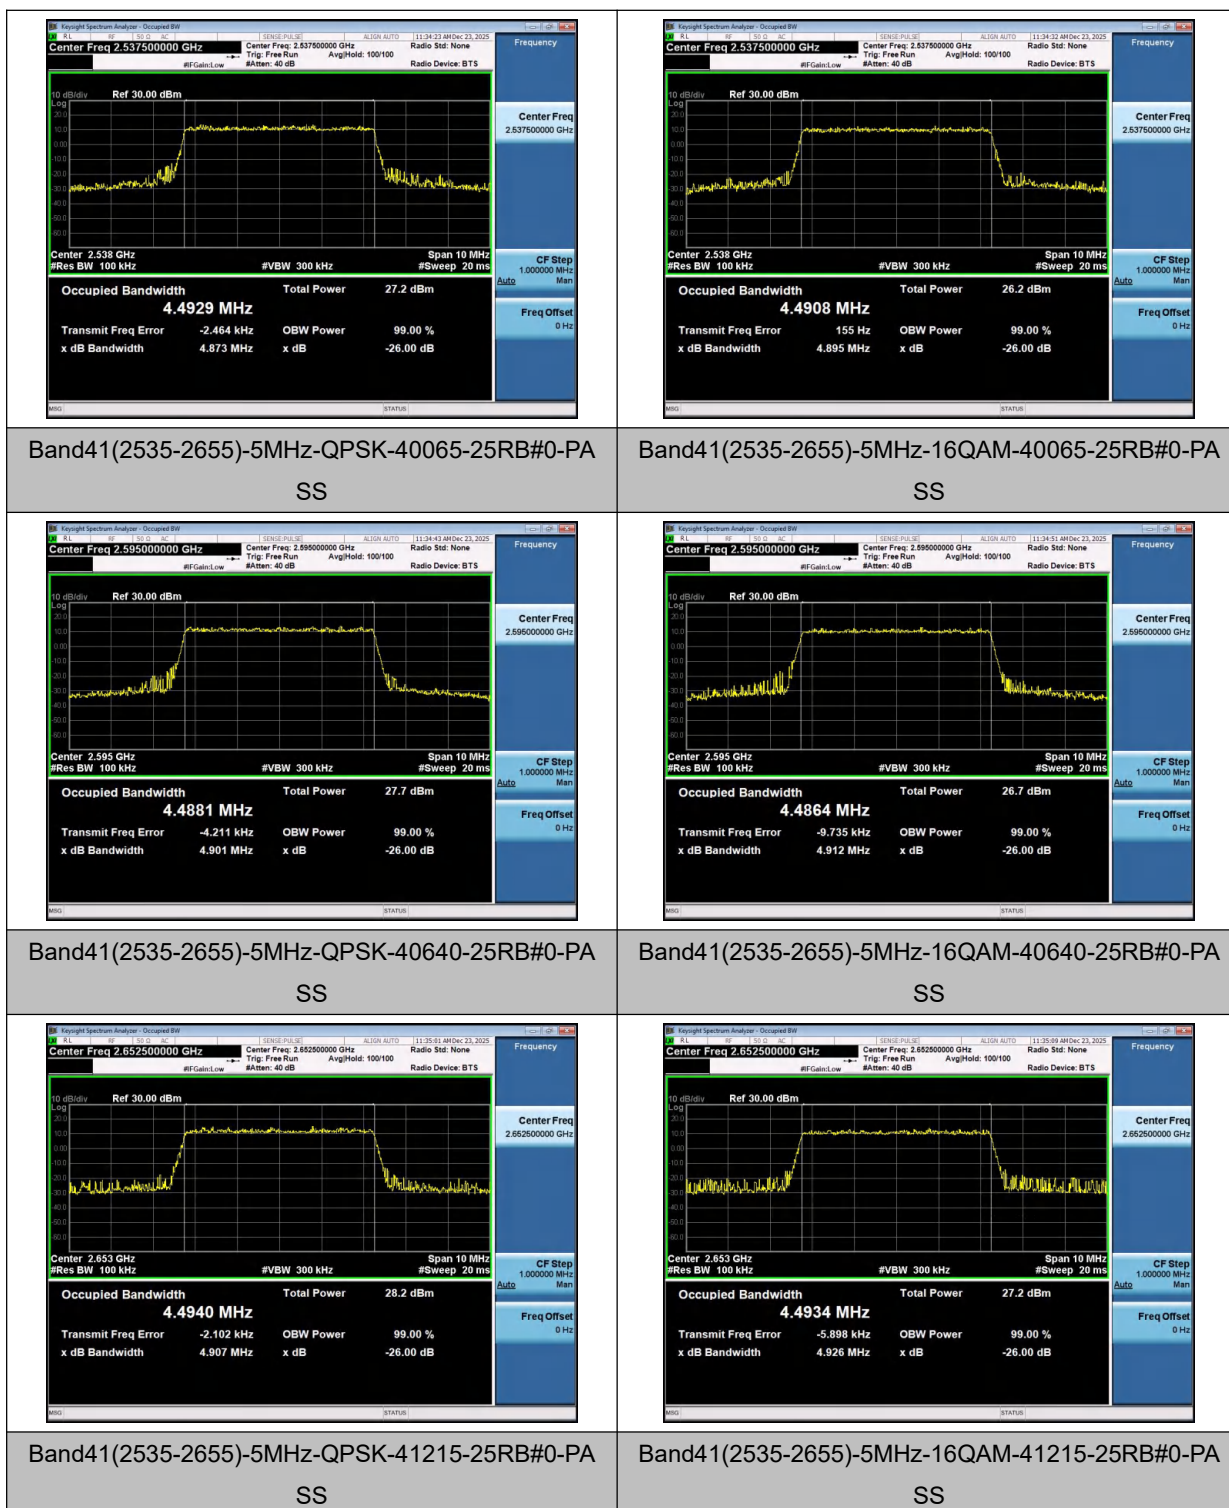

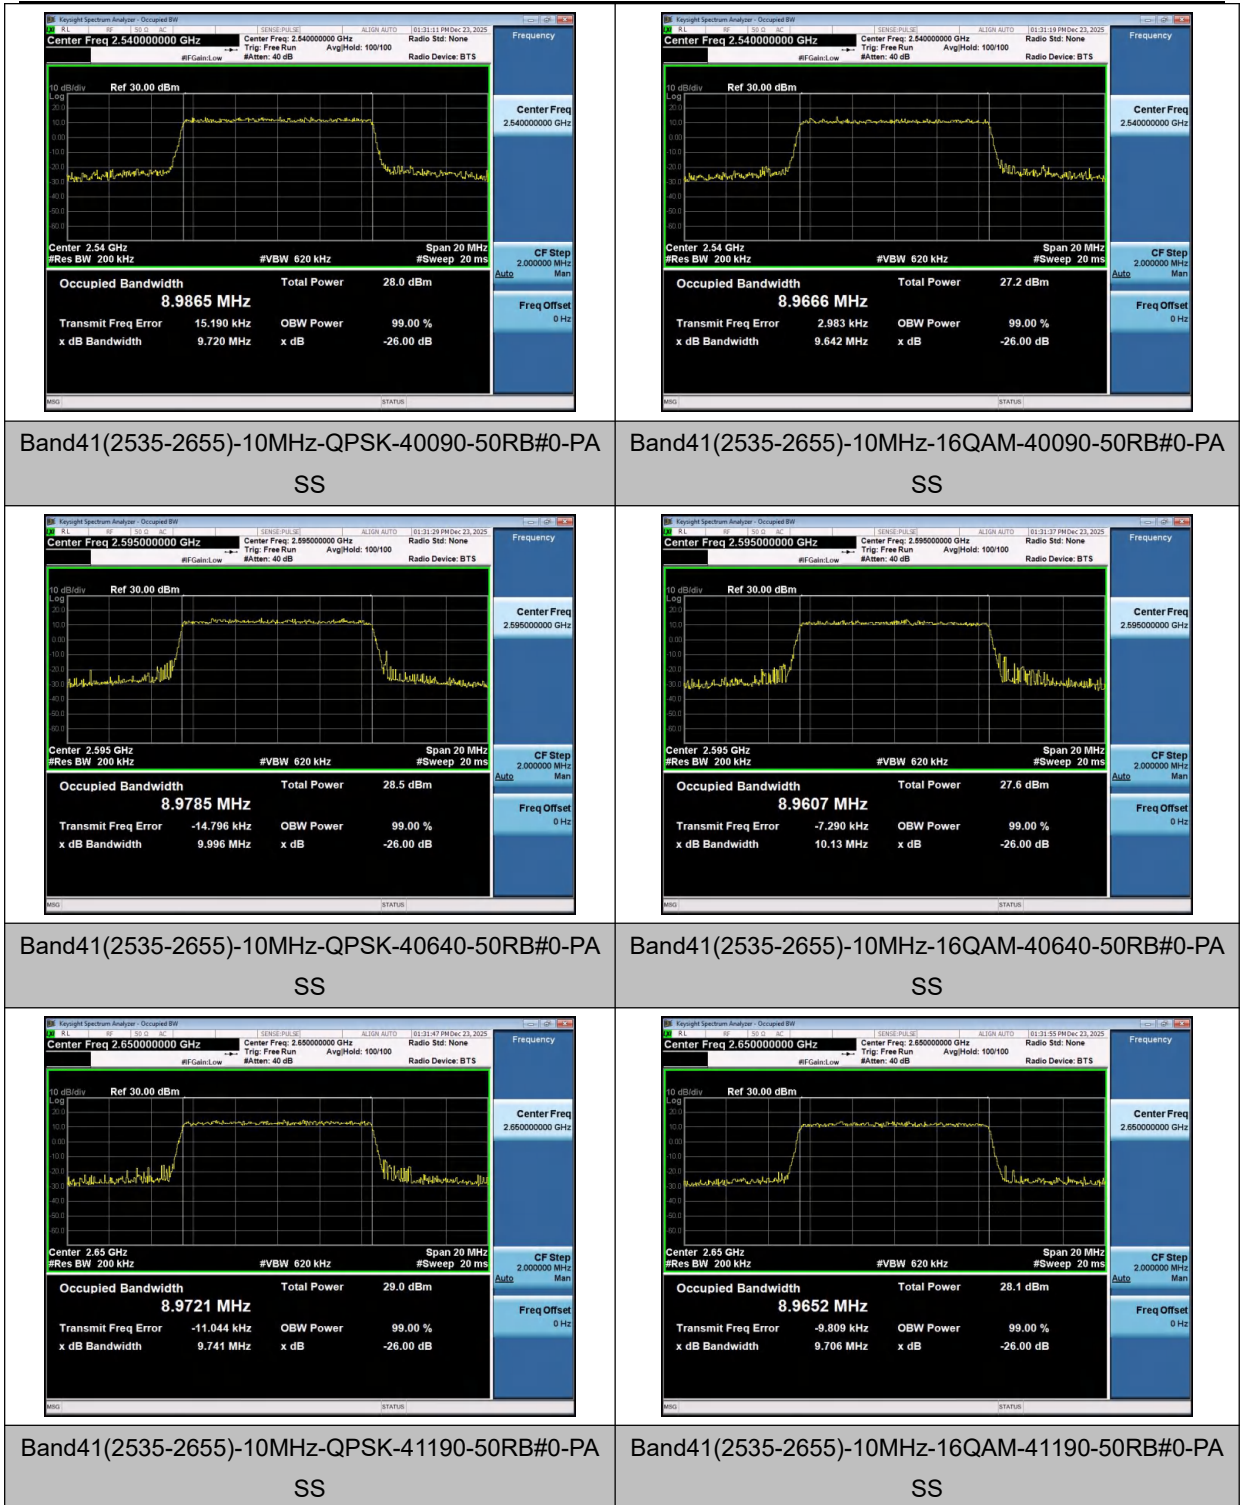


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



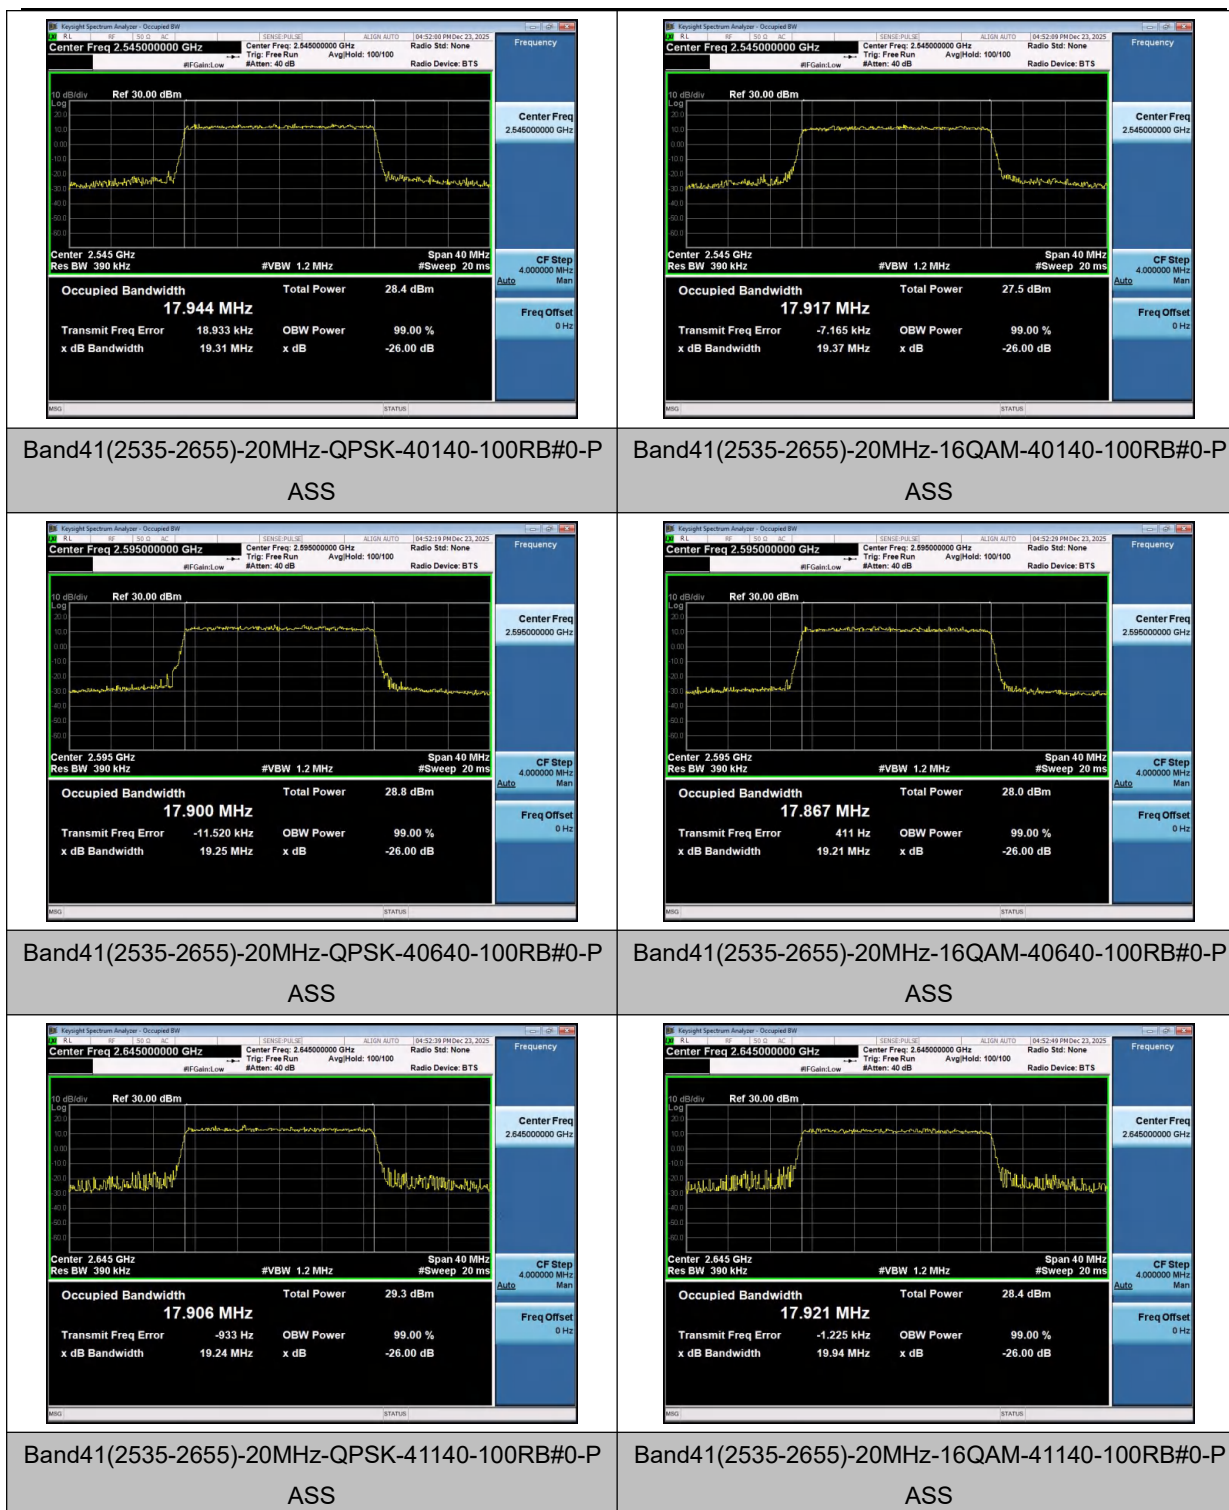

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Margin (dB)	Verdict
Band41(2535-2655)	5MHz	QPSK	40065	1RB#0	-44.49	19.49	PASS
Band41(2535-2655)	5MHz	QPSK	40065	1RB#24	-45.02	20.02	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	-43.54	18.54	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#0	-44.75	19.75	PASS
Band41(2535-2655)	5MHz	16QAM	40065	1RB#24	-45.10	20.10	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	-28.34	18.34	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#0	-40.65	15.65	PASS
Band41(2535-2655)	5MHz	QPSK	41215	1RB#24	-40.44	15.44	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	-37.22	12.22	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#0	-40.70	15.70	PASS
Band41(2535-2655)	5MHz	16QAM	41215	1RB#24	-40.48	15.48	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	-38.16	13.16	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#0	-43.98	18.98	PASS
Band41(2535-2655)	10MHz	QPSK	40090	1RB#49	-44.85	19.85	PASS
Band41(2535-2655)	10MHz	QPSK	40090	50RB#0	-43.45	18.45	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#0	-44.05	19.05	PASS
Band41(2535-2655)	10MHz	16QAM	40090	1RB#49	-44.87	19.87	PASS
Band41(2535-2655)	10MHz	16QAM	40090	50RB#0	-44.05	19.05	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#0	-40.47	15.47	PASS
Band41(2535-2655)	10MHz	QPSK	41190	1RB#49	-39.99	14.99	PASS
Band41(2535-2655)	10MHz	QPSK	41190	50RB#0	-37.81	12.81	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#0	-40.51	15.51	PASS
Band41(2535-2655)	10MHz	16QAM	41190	1RB#49	-40.11	15.11	PASS
Band41(2535-2655)	10MHz	16QAM	41190	50RB#0	-37.82	12.82	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#0	-44.74	19.74	PASS
Band41(2535-2655)	15MHz	QPSK	40115	1RB#74	-44.79	19.79	PASS
Band41(2535-2655)	15MHz	QPSK	40115	75RB#0	-43.24	18.24	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#0	-44.72	19.72	PASS
Band41(2535-2655)	15MHz	16QAM	40115	1RB#74	-44.66	19.66	PASS
Band41(2535-2655)	15MHz	16QAM	40115	75RB#0	-43.97	18.97	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#0	-40.39	15.39	PASS
Band41(2535-2655)	15MHz	QPSK	41165	1RB#74	-40.32	15.32	PASS
Band41(2535-2655)	15MHz	QPSK	41165	75RB#0	-37.71	12.71	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#0	-40.26	15.26	PASS
Band41(2535-2655)	15MHz	16QAM	41165	1RB#74	-40.24	15.24	PASS
Band41(2535-2655)	15MHz	16QAM	41165	75RB#0	-38.22	13.22	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band41(2535-2655)	20MHz	QPSK	40140	1RB#0	-45.02	20.02	PASS
Band41(2535-2655)	20MHz	QPSK	40140	1RB#99	-45.09	20.09	PASS
Band41(2535-2655)	20MHz	QPSK	40140	100RB#0	-44.69	19.69	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#0	-45.00	20.00	PASS
Band41(2535-2655)	20MHz	16QAM	40140	1RB#99	-45.12	20.12	PASS
Band41(2535-2655)	20MHz	16QAM	40140	100RB#0	-44.81	19.81	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#0	-40.40	15.40	PASS
Band41(2535-2655)	20MHz	QPSK	41140	1RB#99	-40.39	15.39	PASS
Band41(2535-2655)	20MHz	QPSK	41140	100RB#0	-39.08	14.08	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#0	-40.40	15.40	PASS
Band41(2535-2655)	20MHz	16QAM	41140	1RB#99	-40.42	15.42	PASS
Band41(2535-2655)	20MHz	16QAM	41140	100RB#0	-39.41	14.41	PASS

Test Graphs

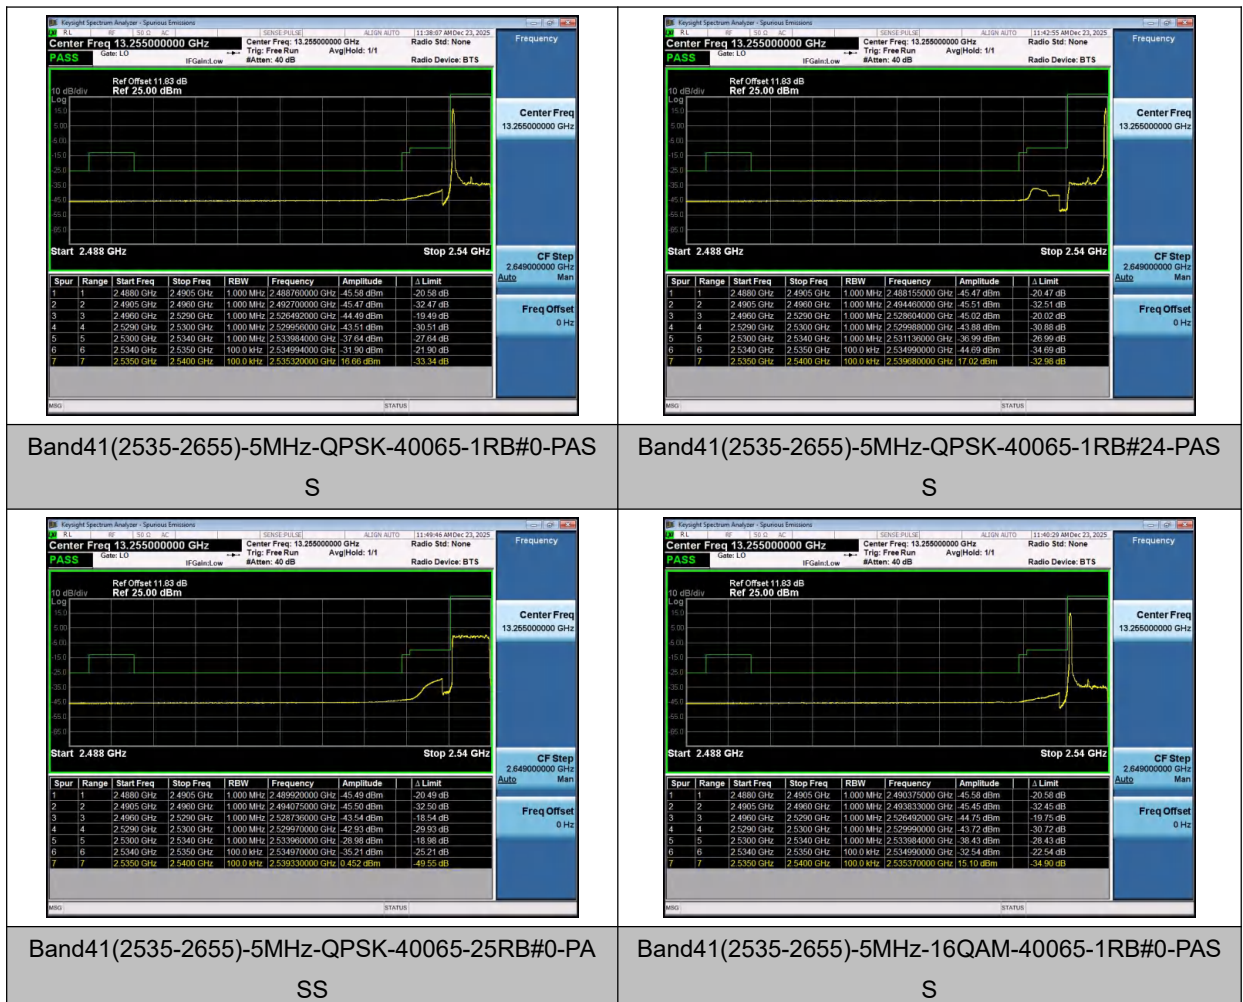

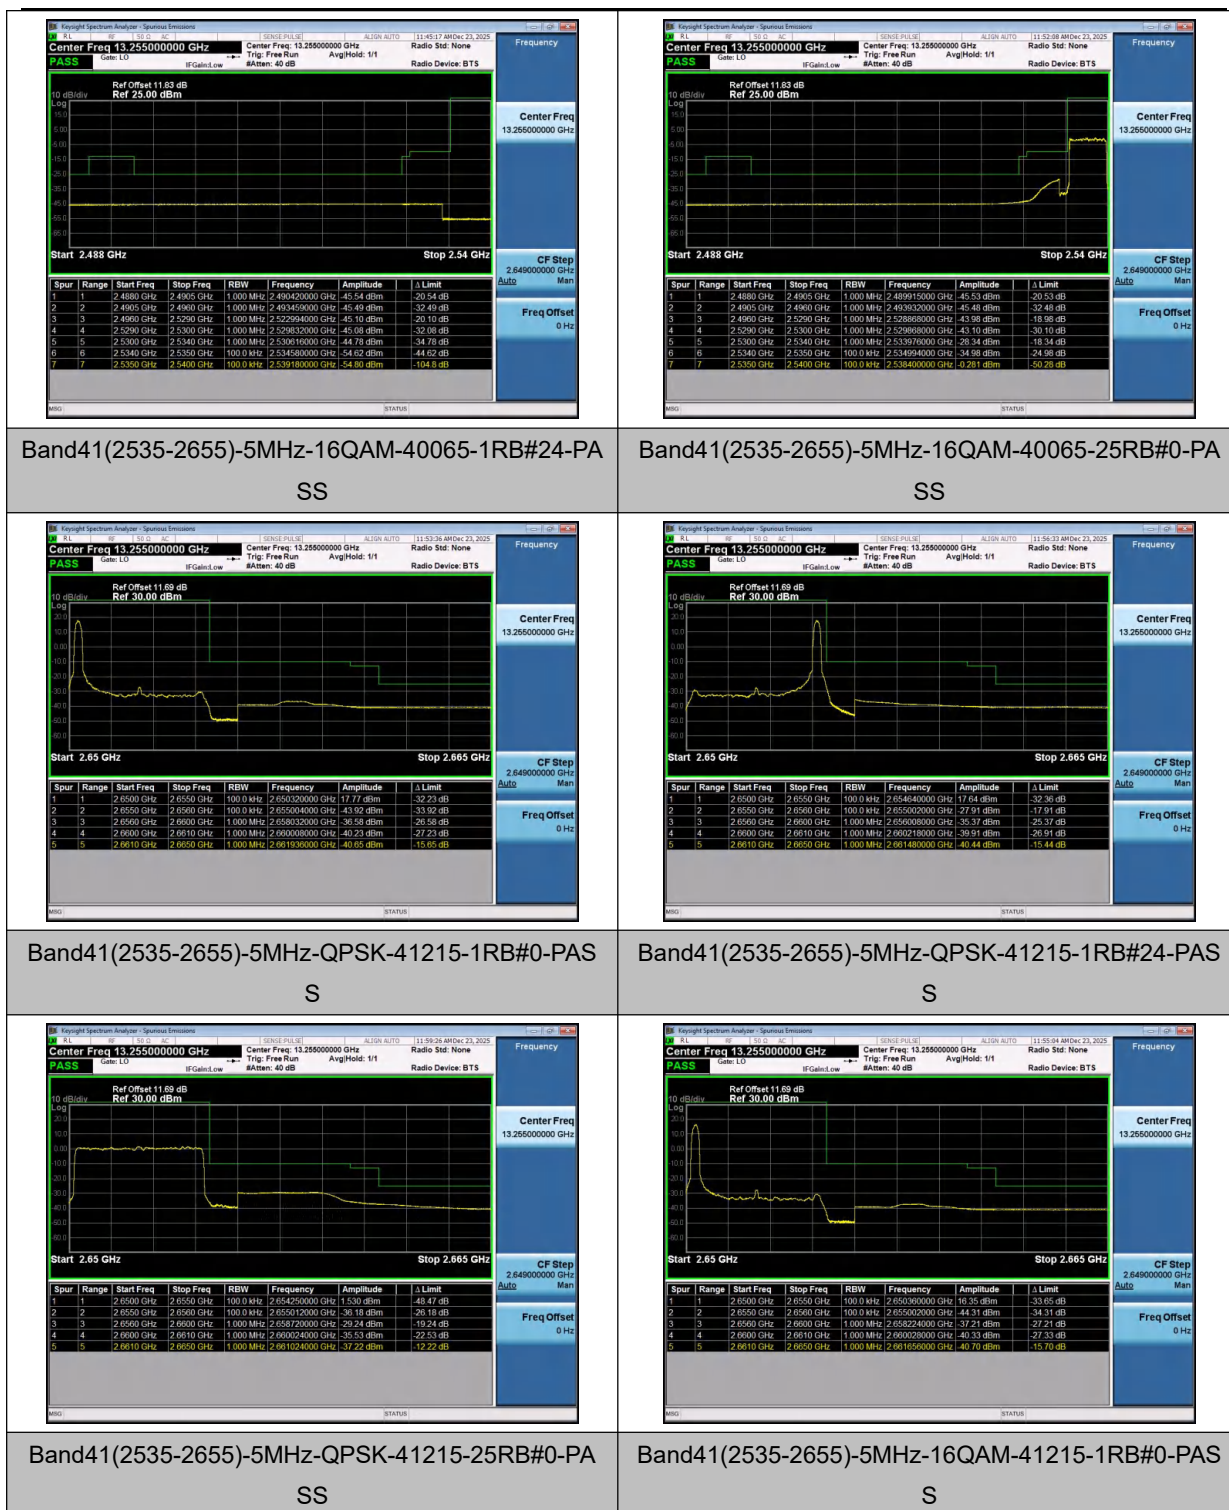


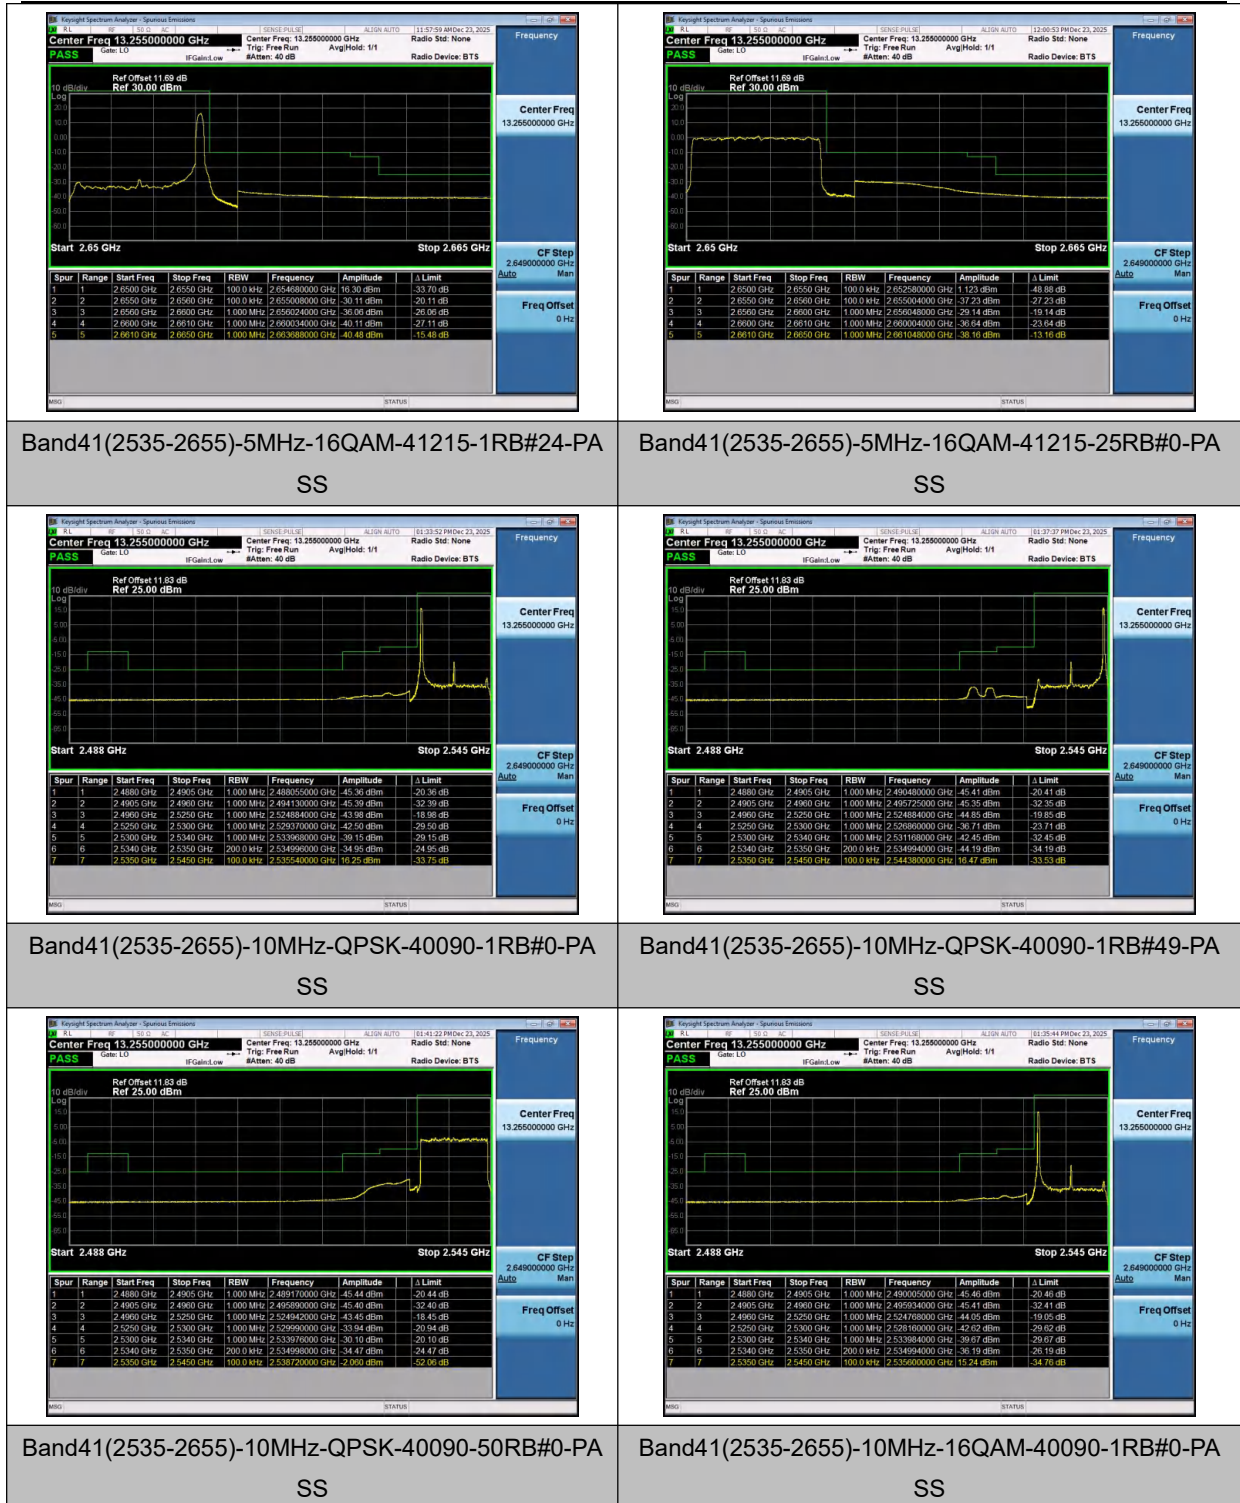

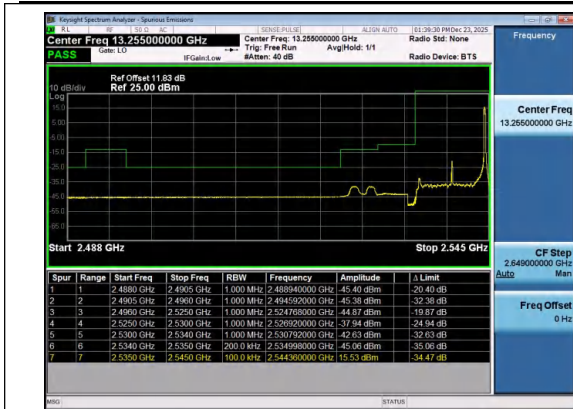


Band41(2535-2655)-10MHz-16QAM-40090-1RB#49-P

ASS

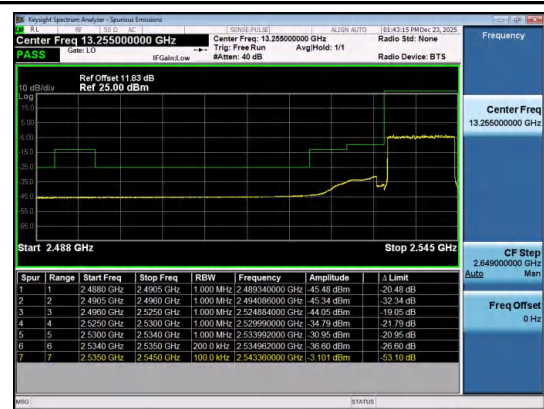


Band41(2535-2655)-10MHz-16QAM-40090-50RB#0-P

ASS

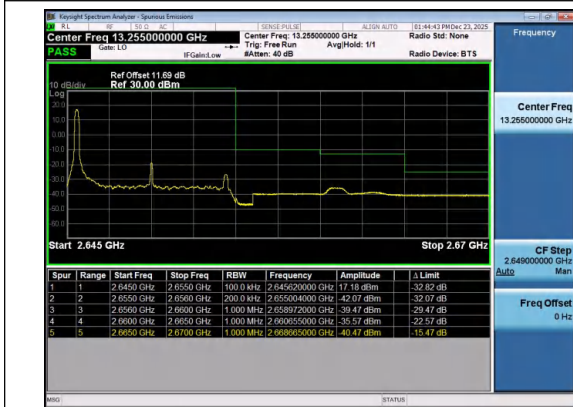


Band41(2535-2655)-10MHz-QPSK-41190-1RB#0-PAS

S

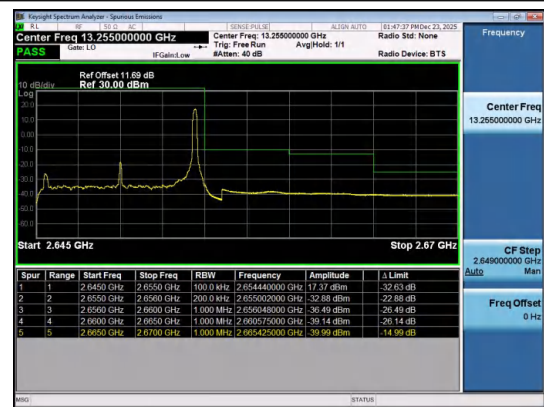


Band41(2535-2655)-10MHz-QPSK-41190-1RB#49-PAS

S

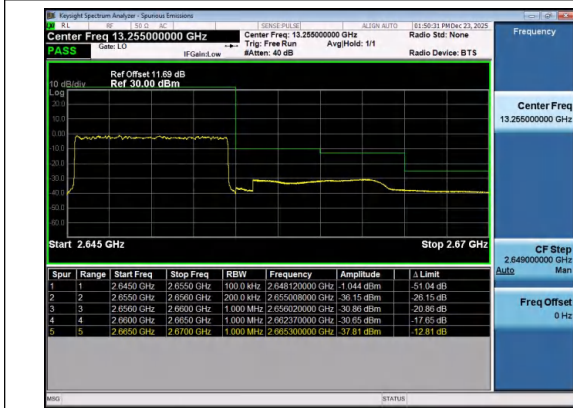


Band41(2535-2655)-10MHz-QPSK-41190-50RB#0-PA


SS

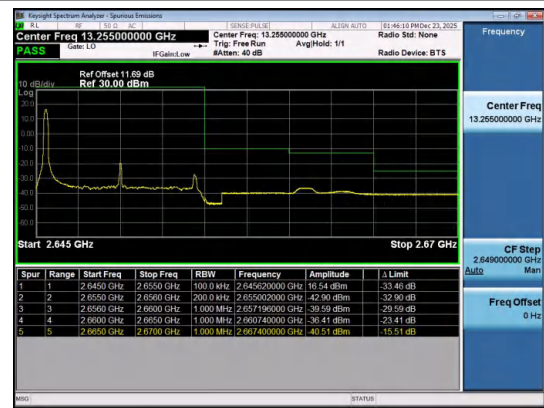

Band41(2535-2655)-10MHz-16QAM-41190-1RB#0-PA


SS

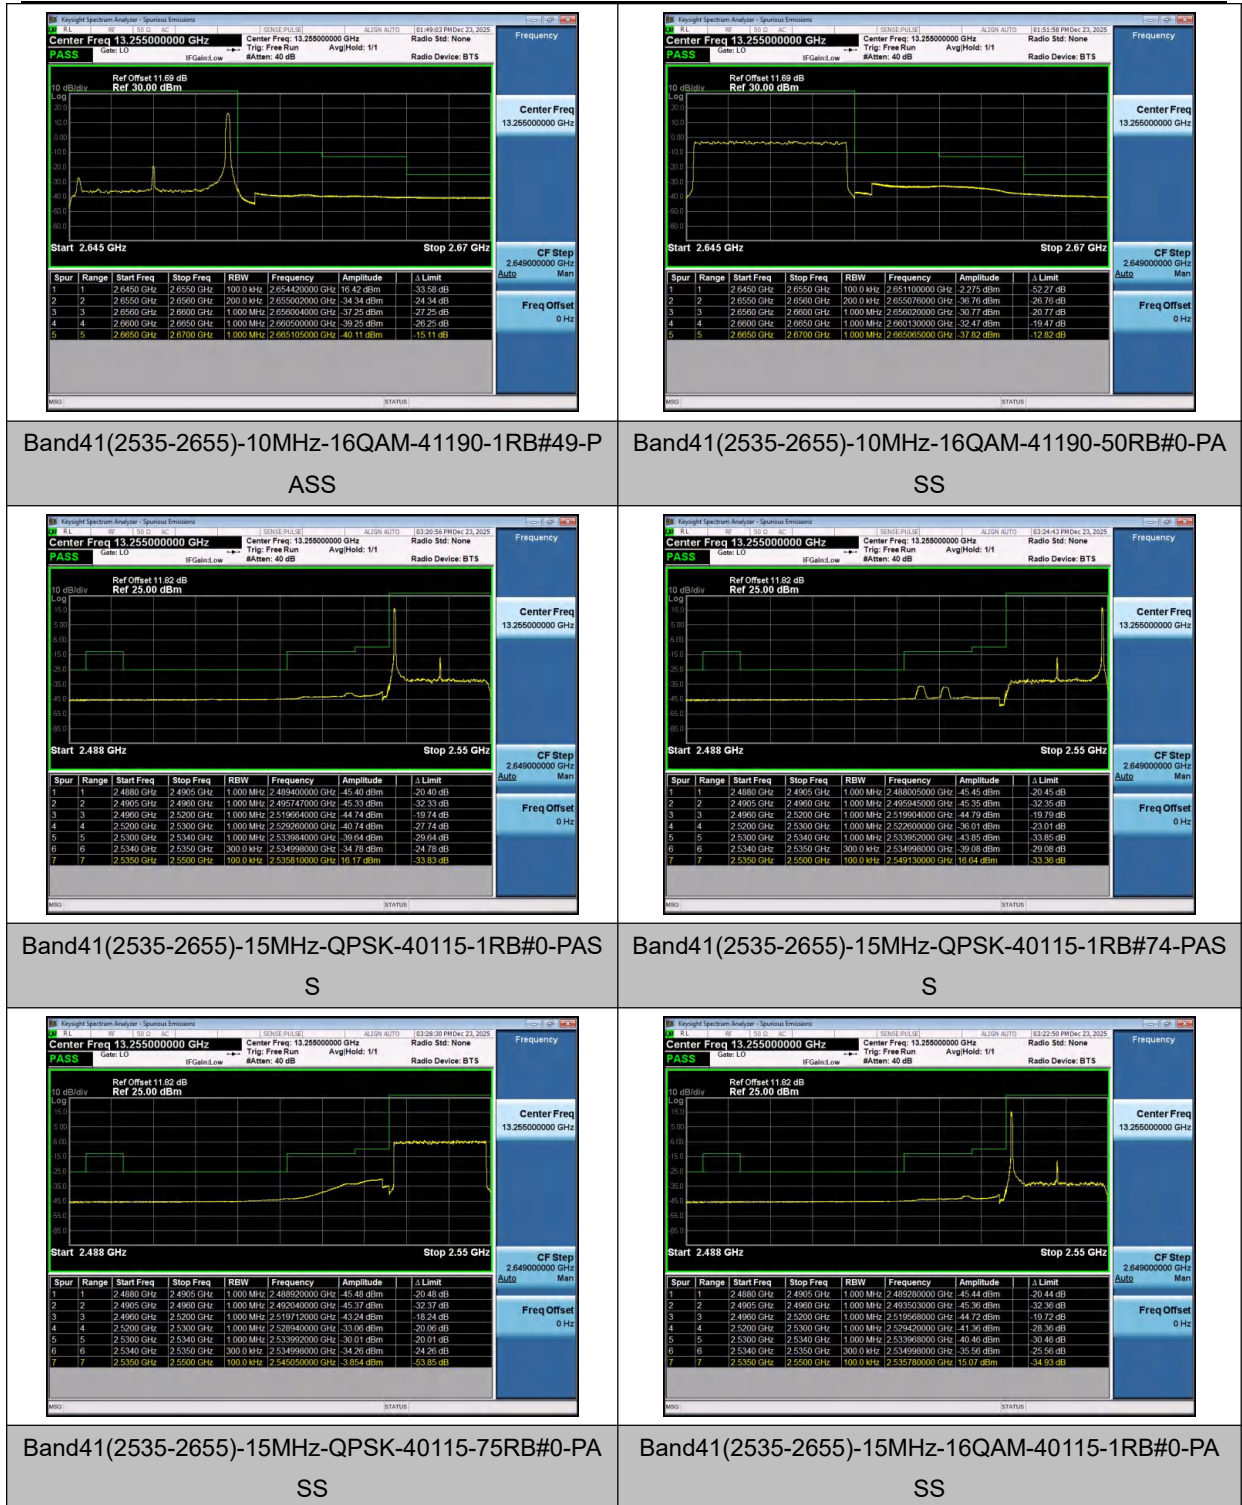

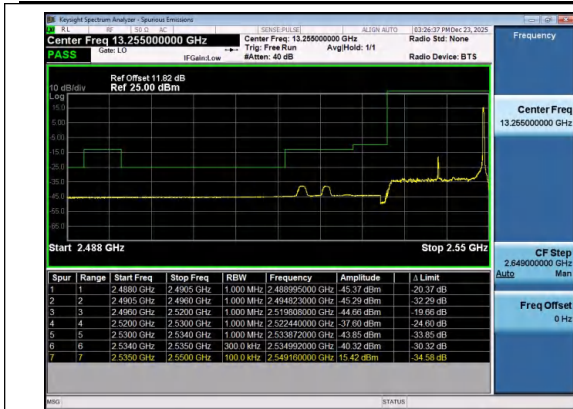


Band41(2535-2655)-15MHz-16QAM-40115-1RB#74-P

ASS

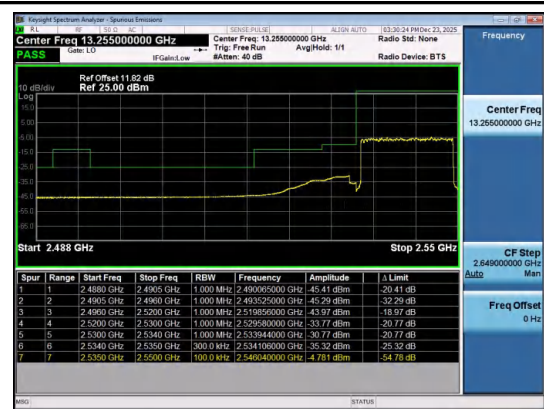


Band41(2535-2655)-15MHz-16QAM-40115-75RB#0-PA

SS

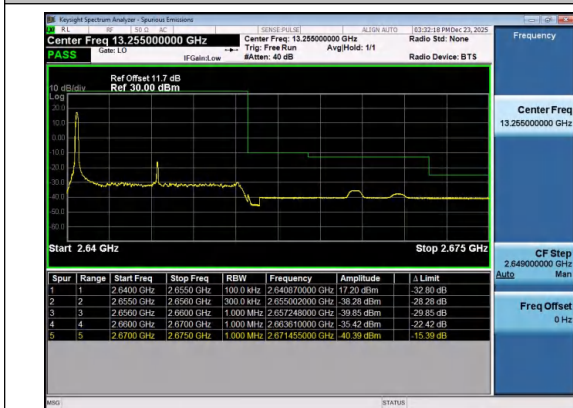

Band41(2535-2655)-15MHz-QPSK-41165-1RB#0-PAS

S

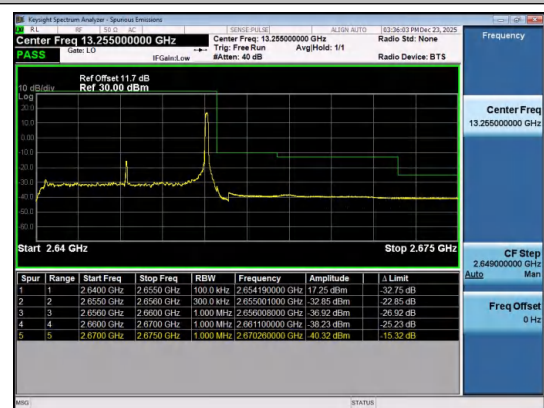


Band41(2535-2655)-15MHz-QPSK-41165-1RB#74-PAS

S




Band41(2535-2655)-15MHz-QPSK-41165-75RB#0-PA

SS

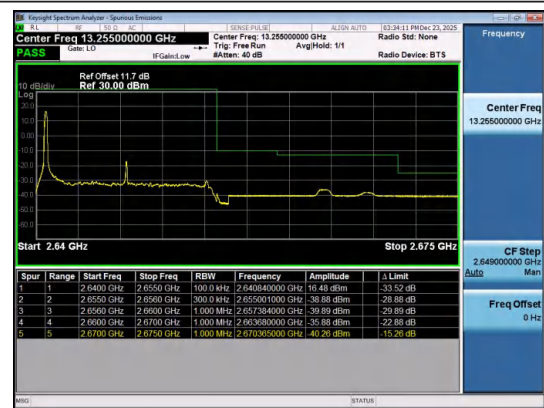

Band41(2535-2655)-15MHz-16QAM-41165-1RB#0-PA

SS

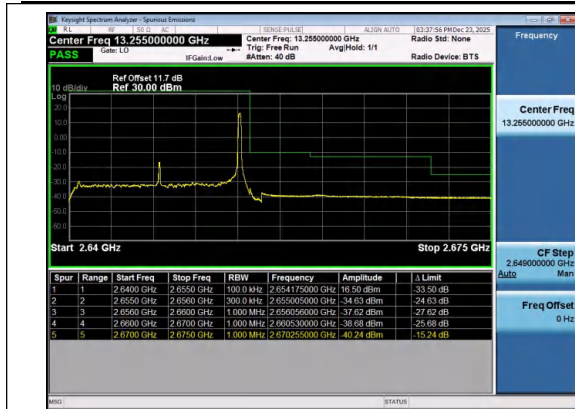


Band41(2535-2655)-15MHz-16QAM-41165-1RB#74-P

ASS




Band41(2535-2655)-15MHz-16QAM-41165-75RB#0-PA

SS

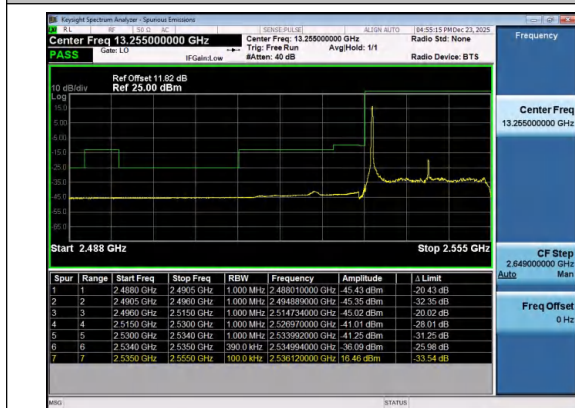


Band41(2535-2655)-20MHz-QPSK-40140-1RB#0-PA

SS

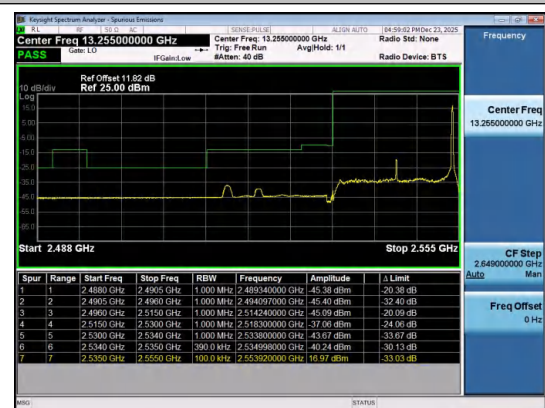


Band41(2535-2655)-20MHz-QPSK-40140-1RB#99-PA

SS

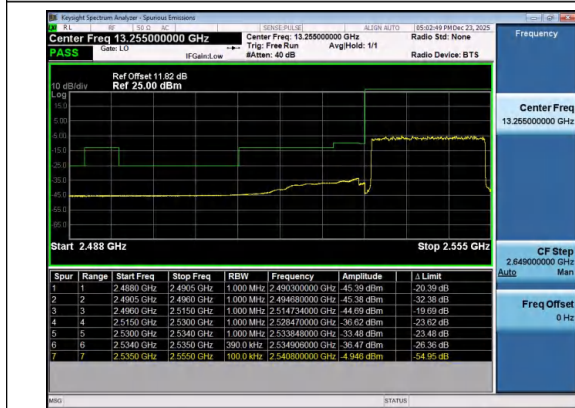


Band41(2535-2655)-20MHz-QPSK-40140-100RB#0-P

ASS

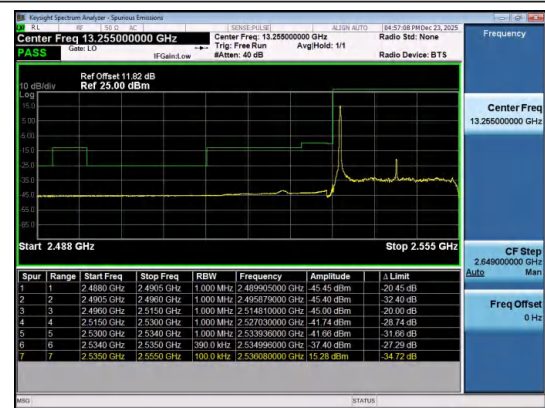


Band41(2535-2655)-20MHz-16QAM-40140-1RB#0-PA

SS

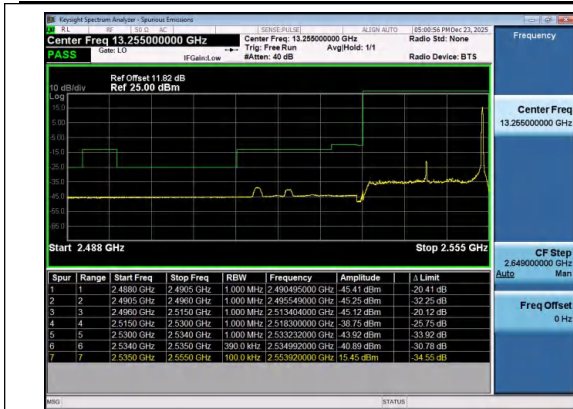


Band41(2535-2655)-20MHz-16QAM-40140-1RB#99-P

ASS

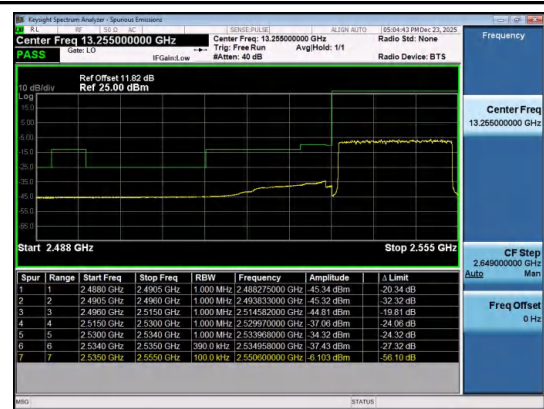


Band41(2535-2655)-20MHz-16QAM-40140-100RB#0-P

ASS

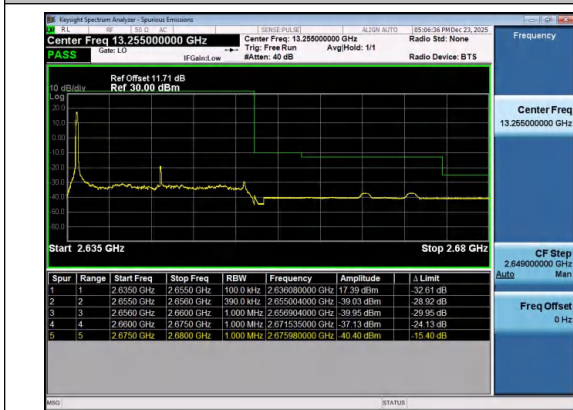


Band41(2535-2655)-20MHz-QPSK-41140-1RB#0-PAS

S

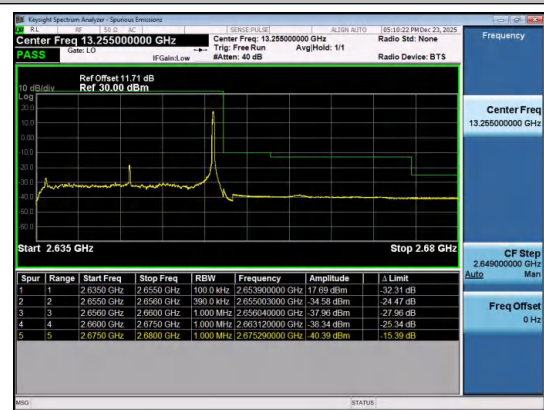


Band41(2535-2655)-20MHz-QPSK-41140-1RB#99-PAS

S

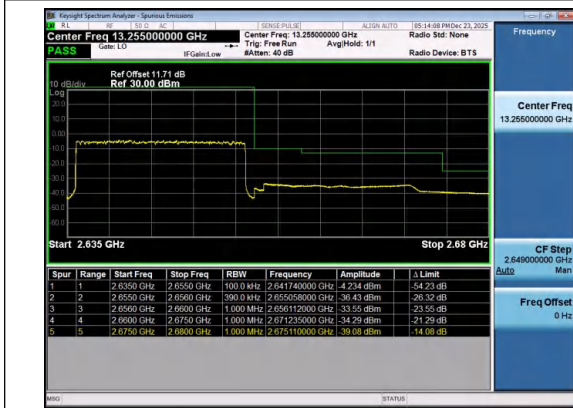


Band41(2535-2655)-20MHz-QPSK-41140-100RB#0-P

ASS

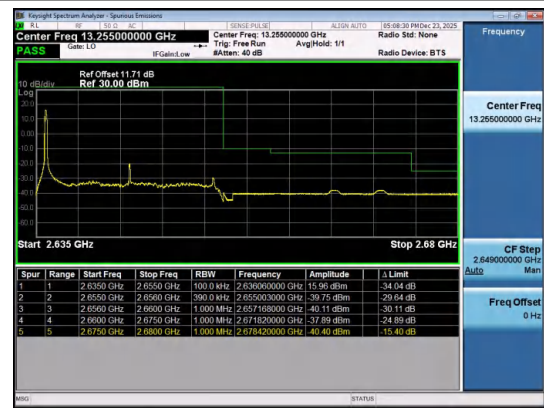

Band41(2535-2655)-20MHz-16QAM-41140-1RB#0-PA

SS

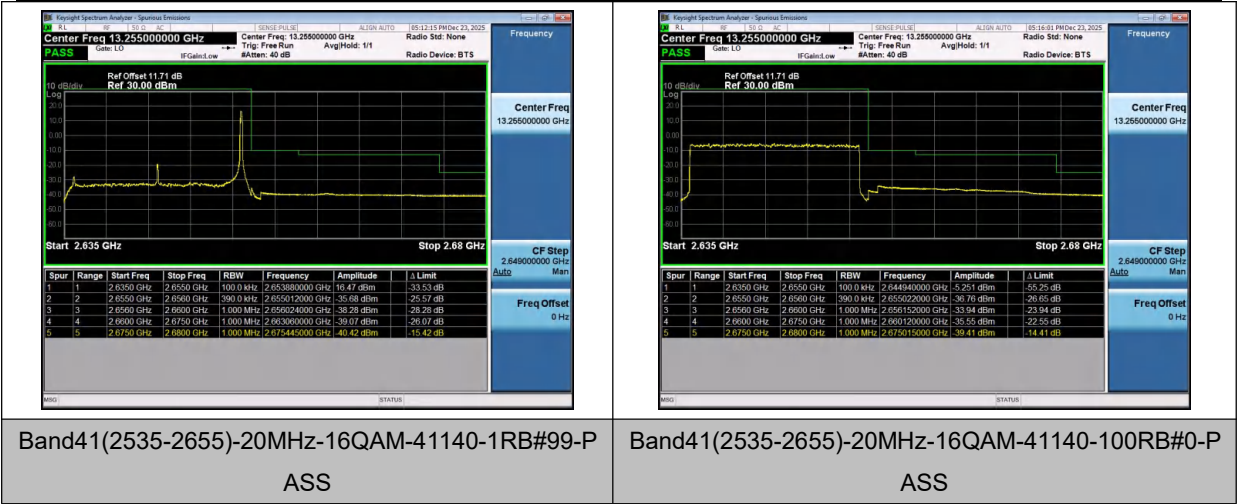

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Limit (dBm)	Verdict
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	0.009~0.15	-69.23	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	0.15~30	-64.17	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	30~1000	-56.42	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	1000~3000	-46.93	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	3000~18000	-39.51	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#0	18000~27000	-30.45	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	0.009~0.15	-74.12	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	0.15~30	-65.02	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	30~1000	-56.98	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	1000~3000	-46.42	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	3000~18000	-39.41	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	1RB#24	18000~27000	-30.31	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	0.009~0.15	-73.21	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	0.15~30	-65.74	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	30~1000	-56.49	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	1000~3000	-46.91	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	3000~18000	-39.68	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	18000~27000	-30.23	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	0.009~0.15	-67.78	-55.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)								
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	0.15~30	-66.43	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	30~1000	-57.19	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	1000~3000	-47.23	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	3000~18000	-39.32	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#0	18000~27000	-30.27	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	0.009~0.15	-74.45	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	0.15~30	-65.13	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	30~1000	-56.67	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	1000~3000	-44.47	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	3000~18000	-39.14	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	1RB#24	18000~27000	-30.20	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	0.009~0.15	-66.81	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	0.15~30	-65.53	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	30~1000	-56.87	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	1000~3000	-44.98	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	3000~18000	-39.64	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	18000~27000	-30.39	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	0.009~0.15	-62.49	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	0.15~30	-64.35	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	30~1000	-56.56	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	1000~3000	-47.05	-25.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	3000~18000	-39.45	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#0	18000~27000	-30.41	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	0.009~0.15	-66.92	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	0.15~30	-65.55	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	30~1000	-56.69	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	1000~3000	-46.99	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	3000~18000	-39.71	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	1RB#24	18000~27000	-30.05	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	0.009~0.15	-74.56	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	0.15~30	-62.01	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	30~1000	-56.63	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	1000~3000	-47.20	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	3000~18000	-39.41	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	18000~27000	-30.14	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	0.009~0.15	-68.91	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	0.15~30	-66.03	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	30~1000	-56.28	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	1000~3000	-47.07	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	3000~18000	-39.37	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#0	18000~27000	-30.21	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	0.009~0.15	-68.36	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	0.15~30	-64.45	-45.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)								
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	30~1000	-56.27	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	1000~3000	-47.17	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	3000~18000	-39.58	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	1RB#24	18000~27000	-30.37	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	0.009~0.15	-73.70	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	0.15~30	-65.35	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	30~1000	-56.76	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	1000~3000	-46.99	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	3000~18000	-39.79	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	18000~27000	-30.45	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	0.009~0.15	-72.15	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	0.15~30	-64.45	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	30~1000	-55.75	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	1000~3000	-47.08	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	3000~18000	-39.59	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#0	18000~27000	-30.32	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	0.009~0.15	-62.87	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	0.15~30	-64.93	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	30~1000	-56.30	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	1000~3000	-46.77	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	3000~18000	-39.70	-25.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	5MHz	QPSK	41215	1RB#24	18000~27000	-30.29	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	0.009~0.15	-68.69	-55.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	0.15~30	-65.28	-45.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	30~1000	-55.81	-35.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	1000~3000	-45.76	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	3000~18000	-39.39	-25.0	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	18000~27000	-30.59	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	0.009~0.15	-66.44	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	0.15~30	-67.36	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	30~1000	-56.29	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	1000~3000	-47.05	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	3000~18000	-39.70	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#0	18000~27000	-30.34	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	0.009~0.15	-69.32	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	0.15~30	-64.16	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	30~1000	-56.02	-35.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	1000~3000	-47.03	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	3000~18000	-38.89	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	1RB#24	18000~27000	-30.00	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	0.009~0.15	-69.90	-55.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	0.15~30	-64.49	-45.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	30~1000	-55.55	-35.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)								
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	1000~3000	-46.67	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	3000~18000	-39.64	-25.0	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	18000~27000	-29.96	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	0.009~0.15	-62.72	-55.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	0.15~30	-65.83	-45.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	30~1000	-56.52	-35.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	1000~3000	-47.12	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	3000~18000	-39.04	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#0	18000~27000	-29.95	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	0.009~0.15	-74.77	-55.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	0.15~30	-65.75	-45.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	30~1000	-56.28	-35.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	1000~3000	-47.16	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	3000~18000	-39.27	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	1RB#49	18000~27000	-30.20	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	0.009~0.15	-56.63	-55.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	0.15~30	-66.71	-45.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	30~1000	-55.81	-35.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	1000~3000	-47.19	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	3000~18000	-39.58	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	18000~27000	-30.19	-25.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	0.009~0.15	-68.04	-55.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	0.15~30	-64.75	-45.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	30~1000	-56.25	-35.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	1000~3000	-47.11	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	3000~18000	-39.52	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#0	18000~27000	-30.19	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	0.009~0.15	-70.19	-55.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	0.15~30	-65.95	-45.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	30~1000	-56.56	-35.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	1000~3000	-47.21	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	3000~18000	-39.58	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	1RB#49	18000~27000	-30.41	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	0.009~0.15	-79.38	-55.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	0.15~30	-64.40	-45.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	30~1000	-56.07	-35.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	1000~3000	-47.14	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	3000~18000	-39.31	-25.0	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	18000~27000	-30.13	-25.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	1RB#0	0.009~0.15	-59.26	-55.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	1RB#0	0.15~30	-63.56	-45.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	1RB#0	30~1000	-56.74	-35.0	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	1RB#0	1000~3000	-46.97	-25.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com