






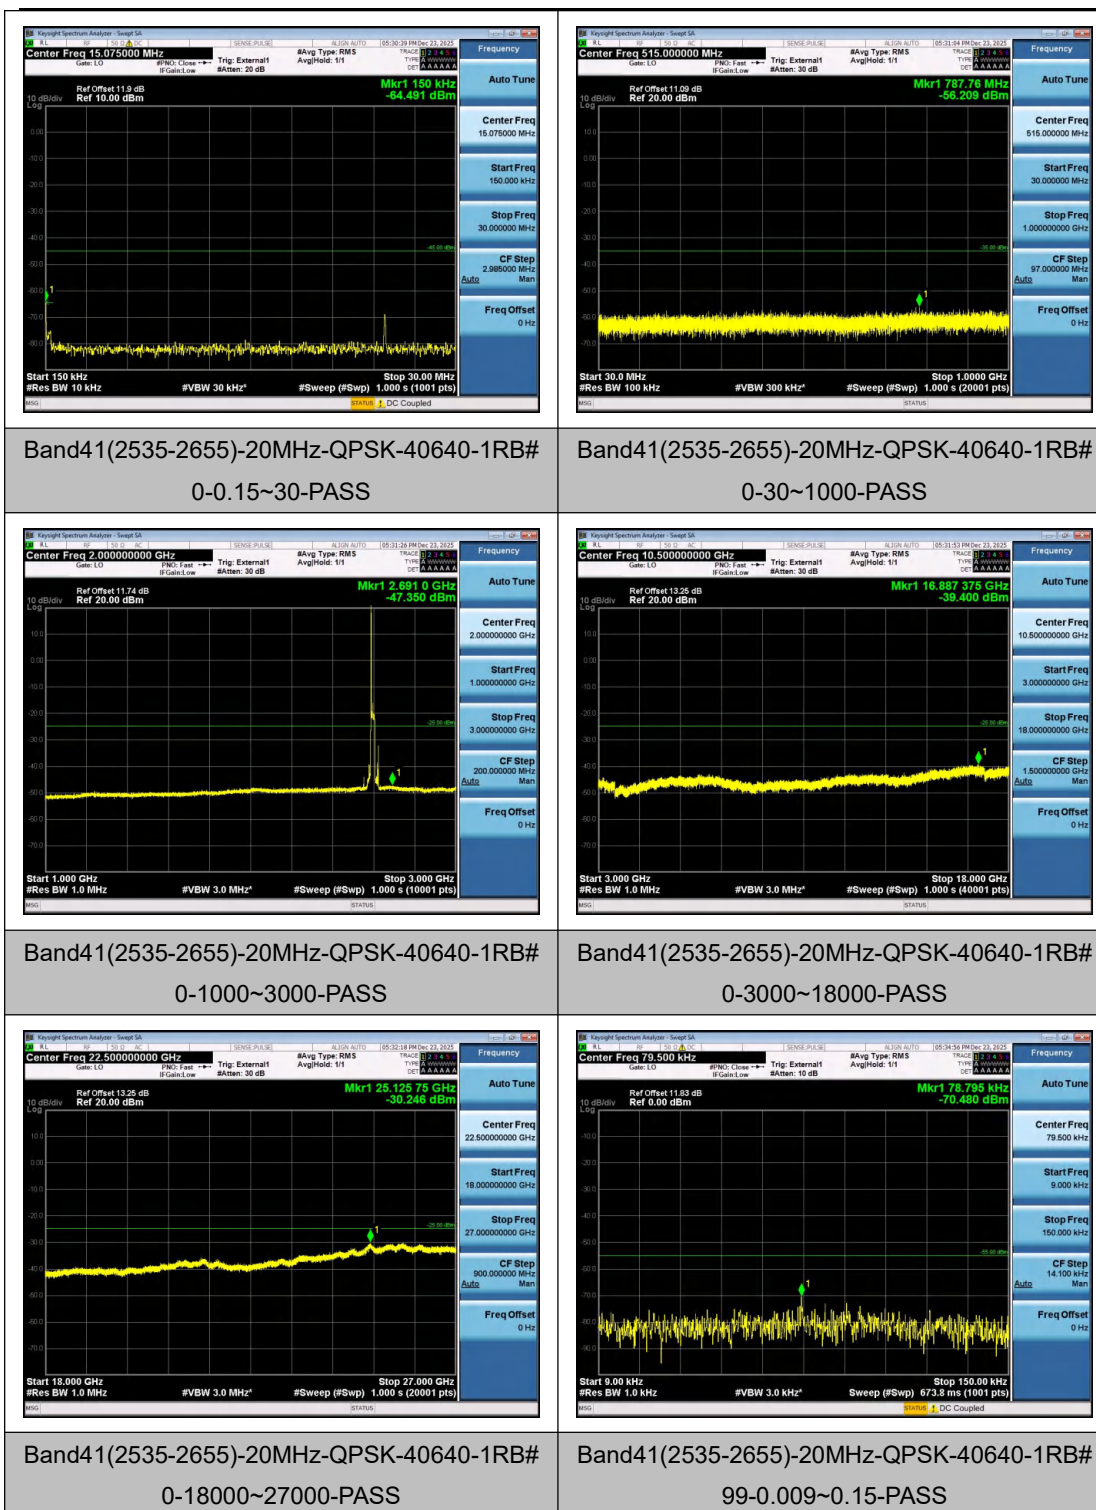


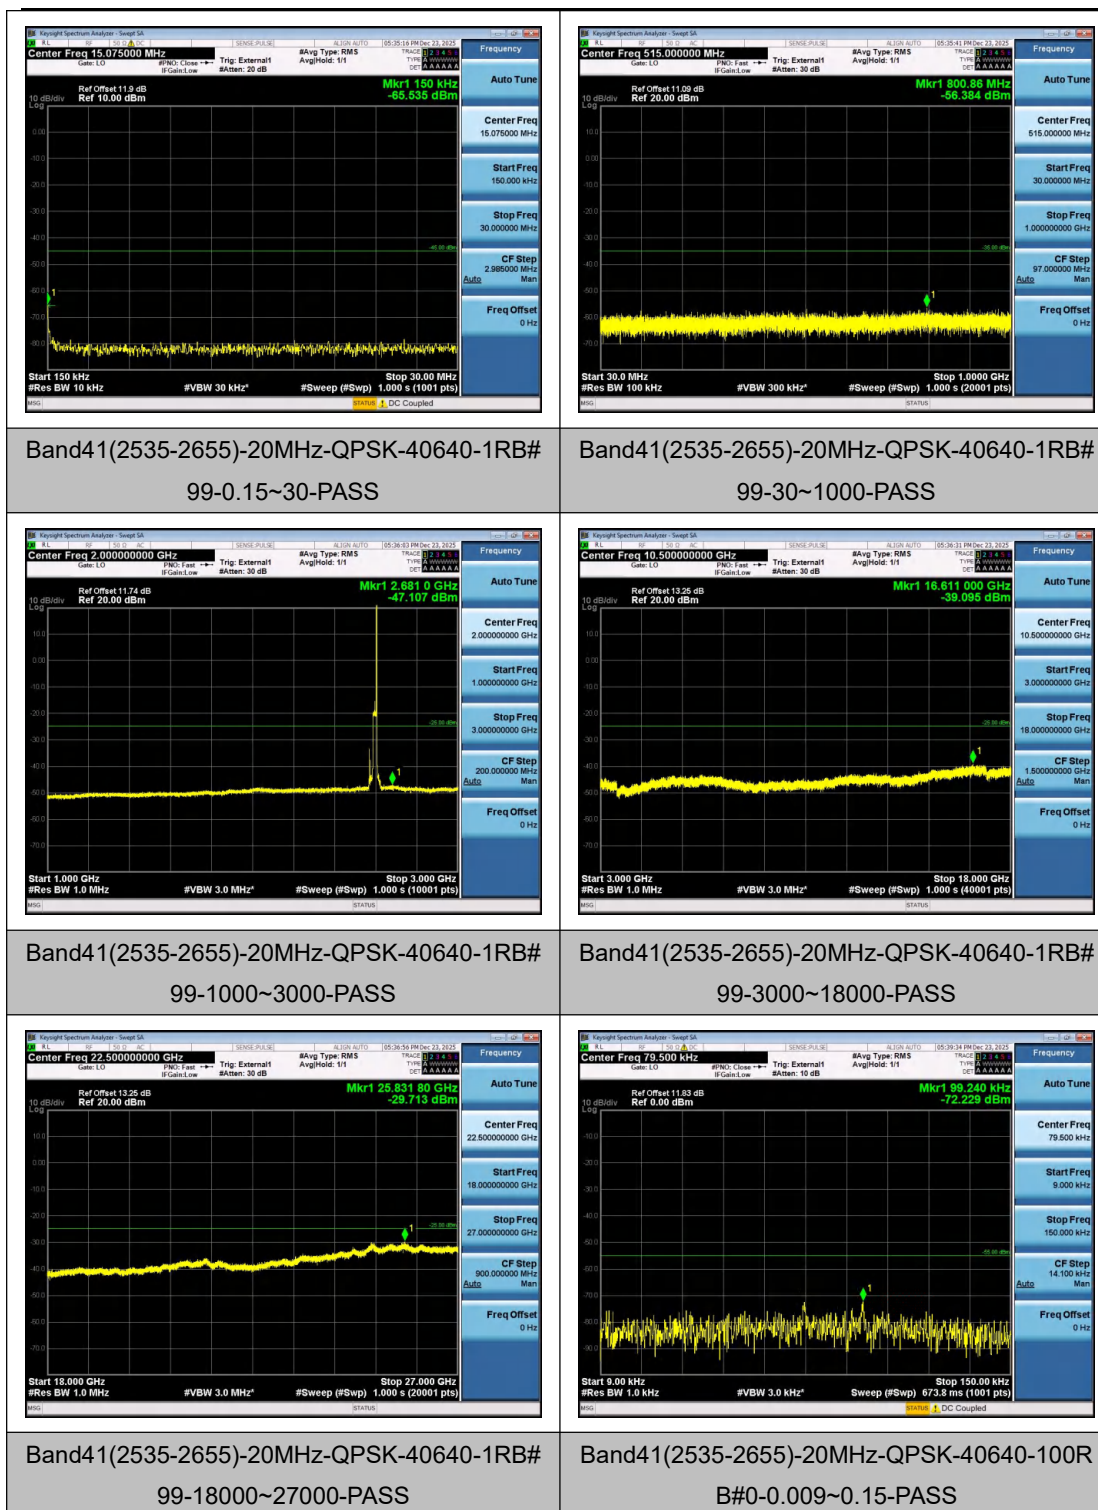


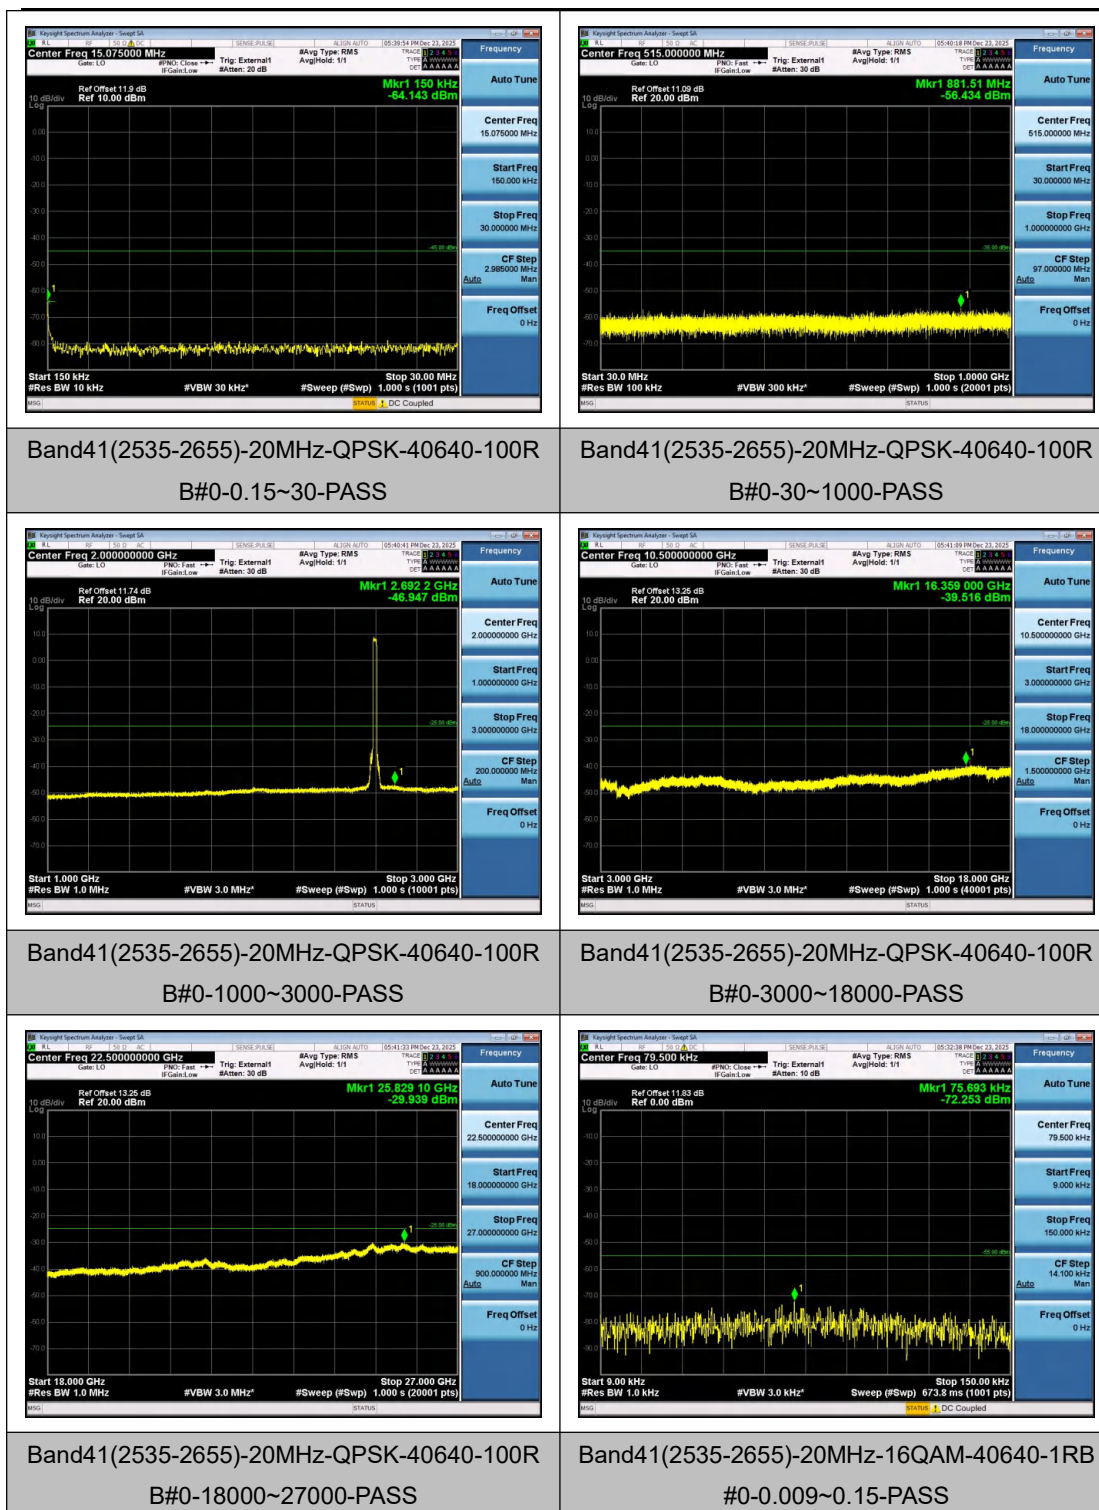


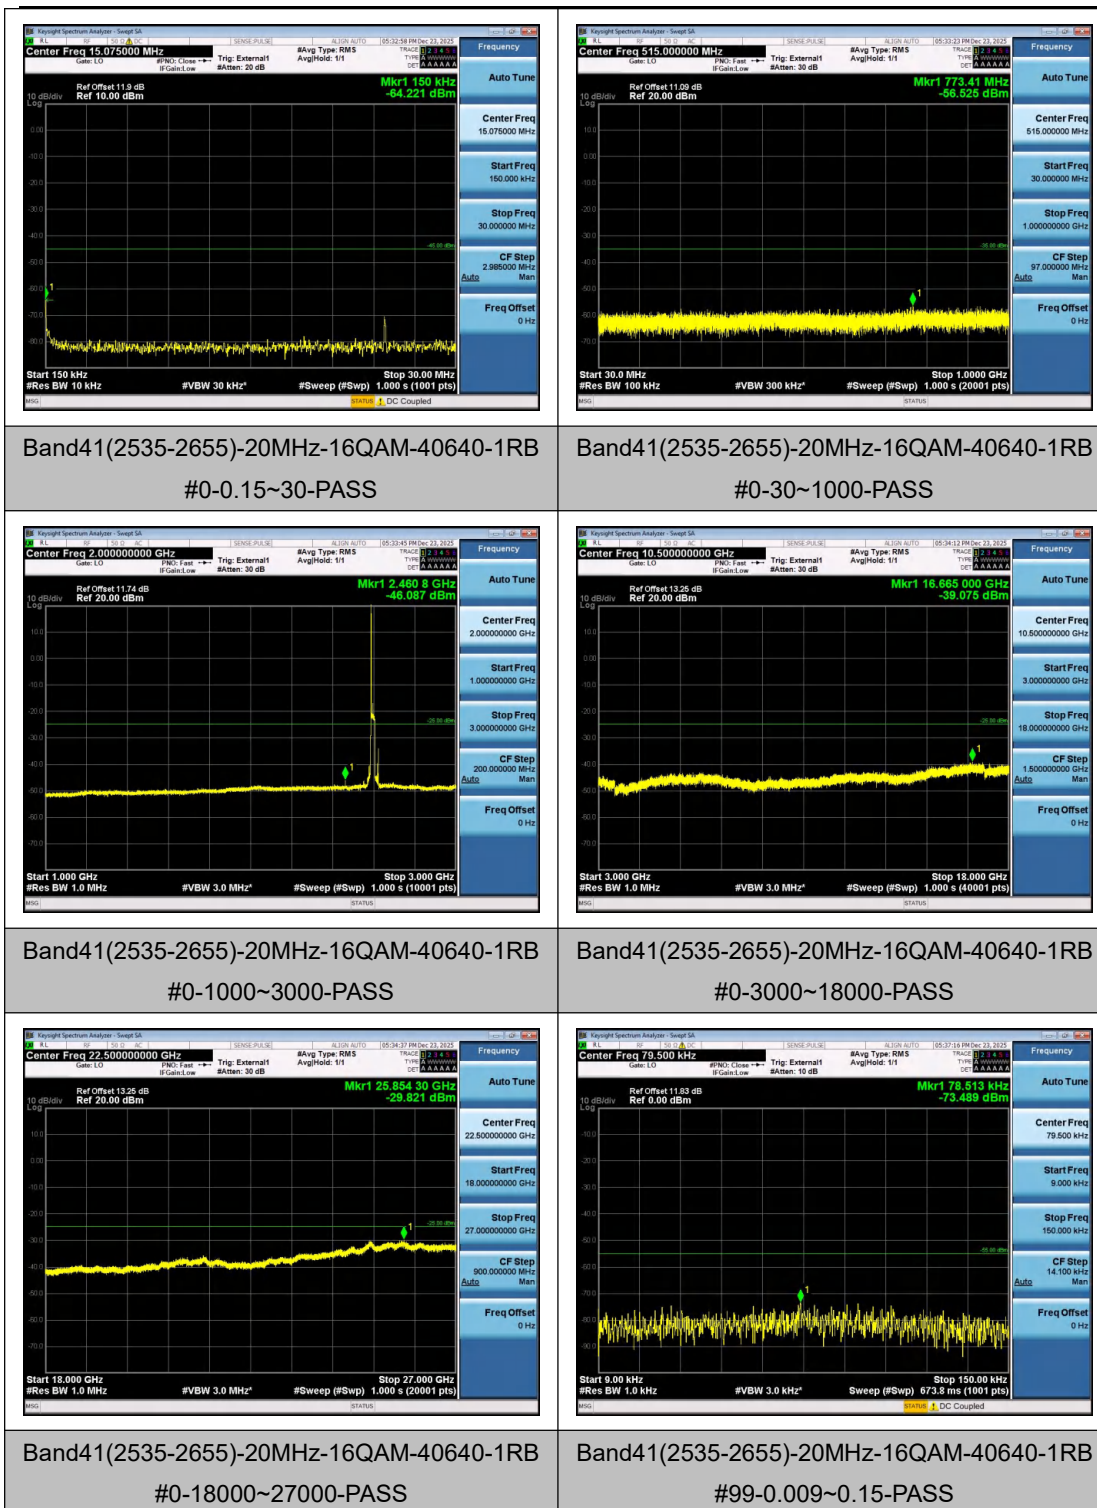


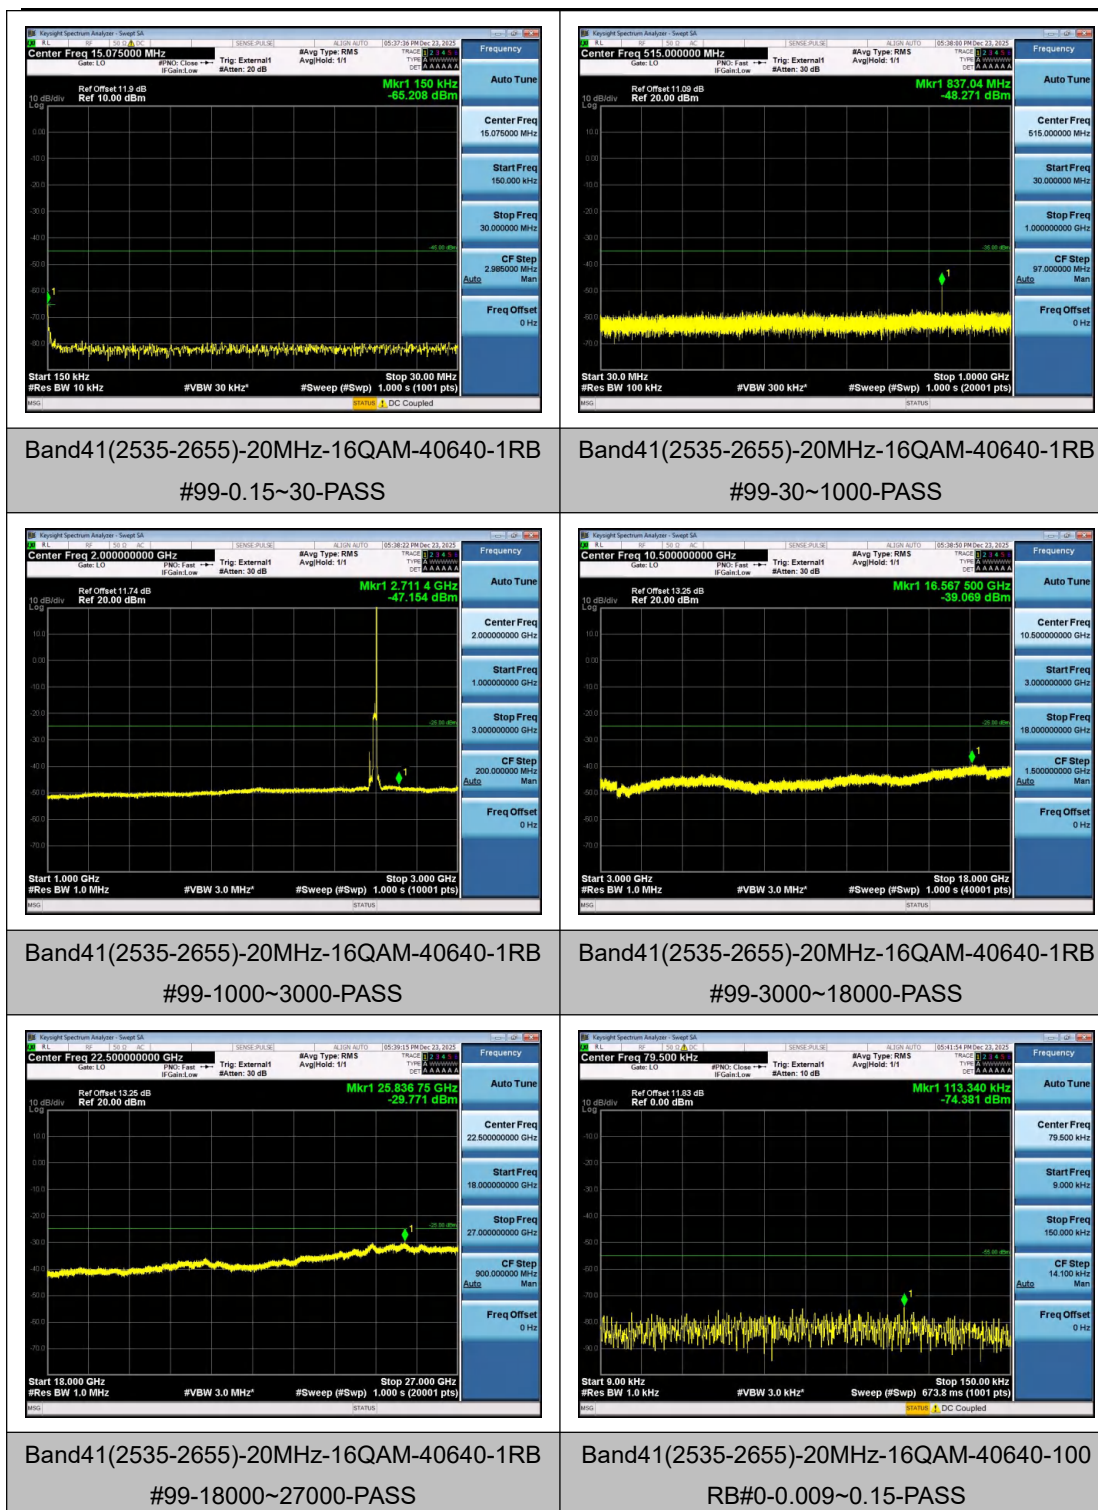


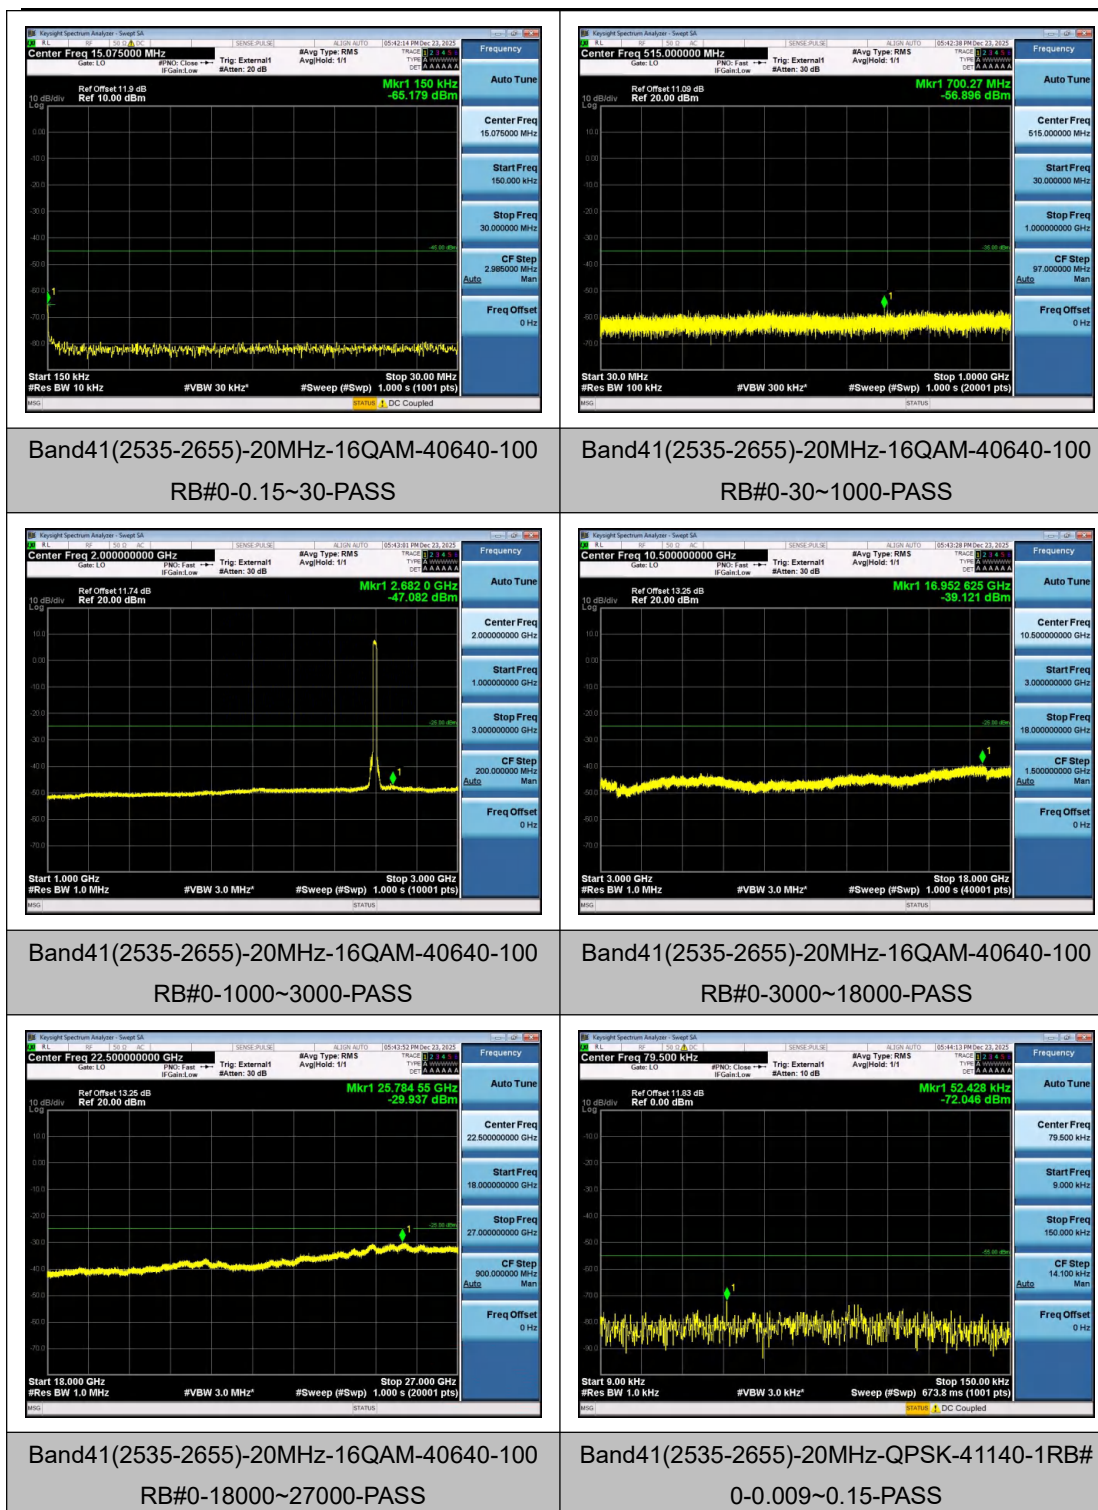


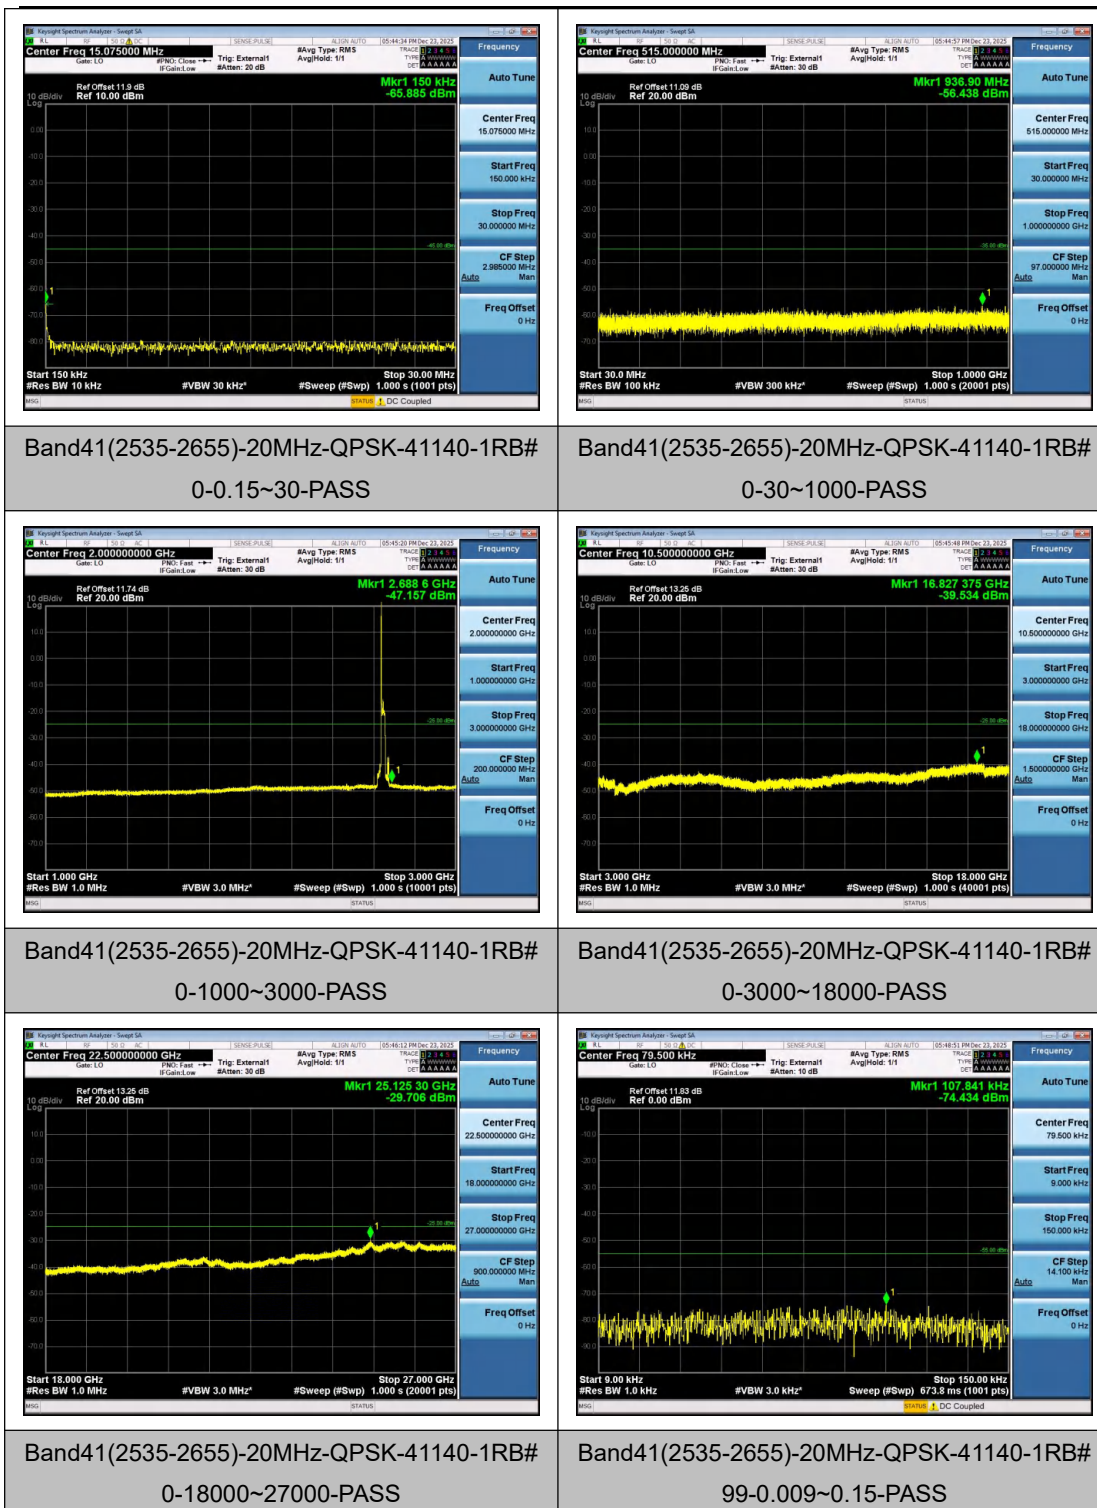


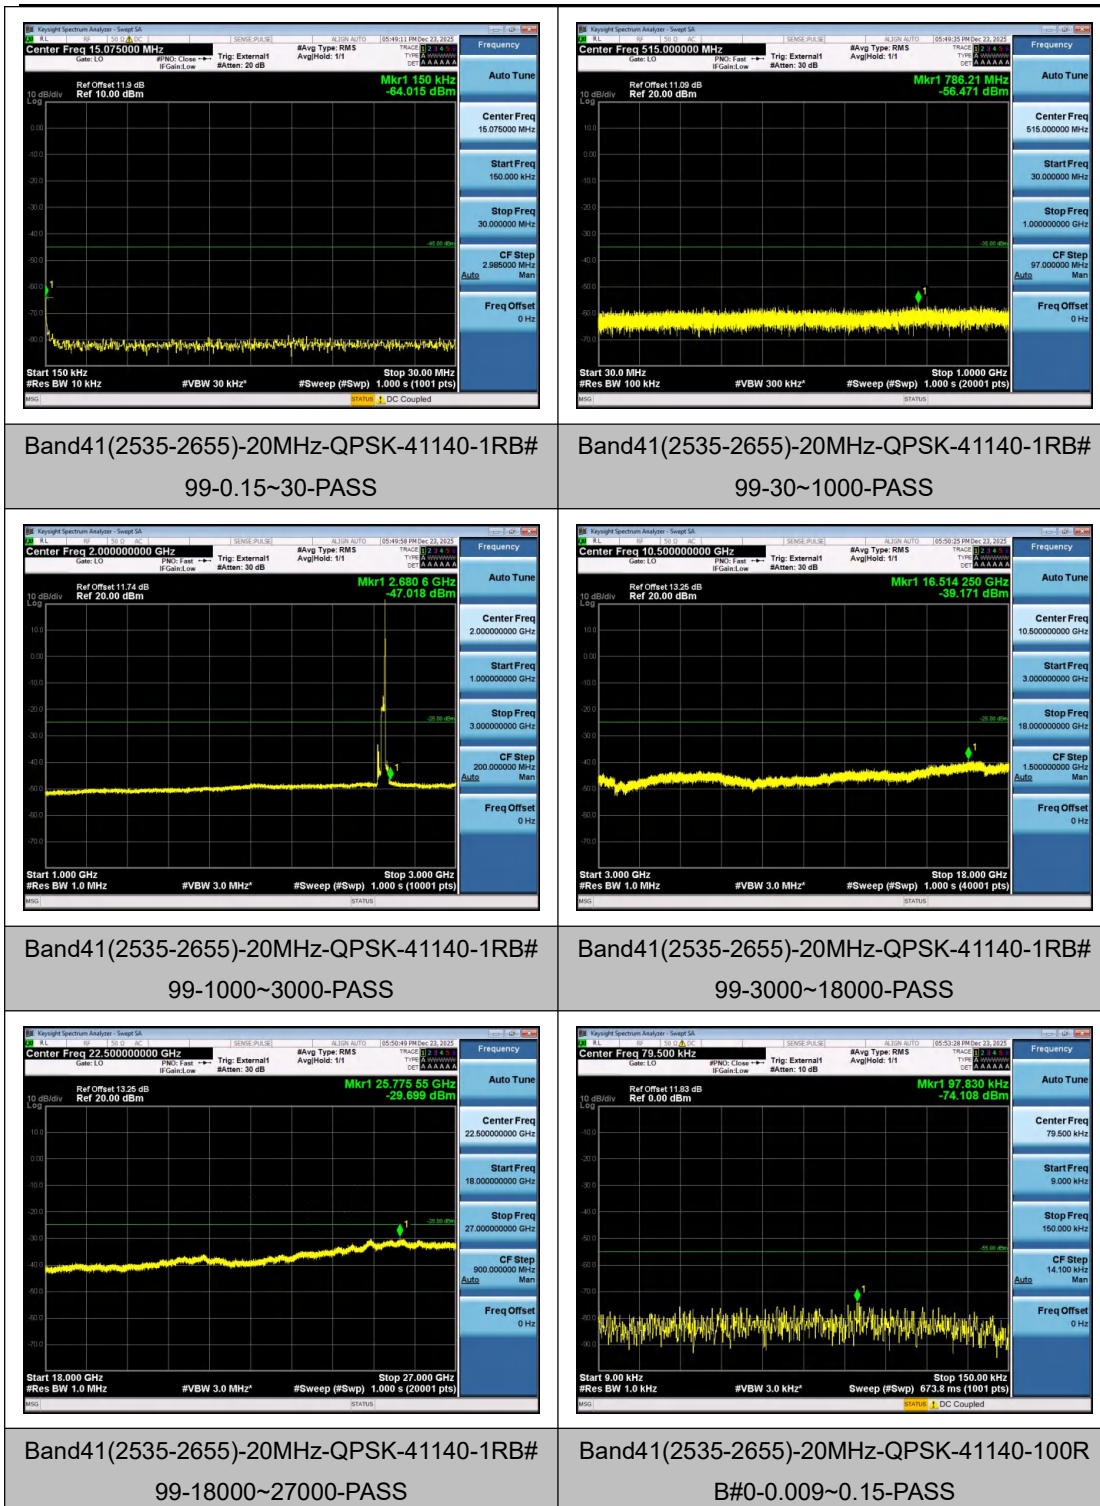

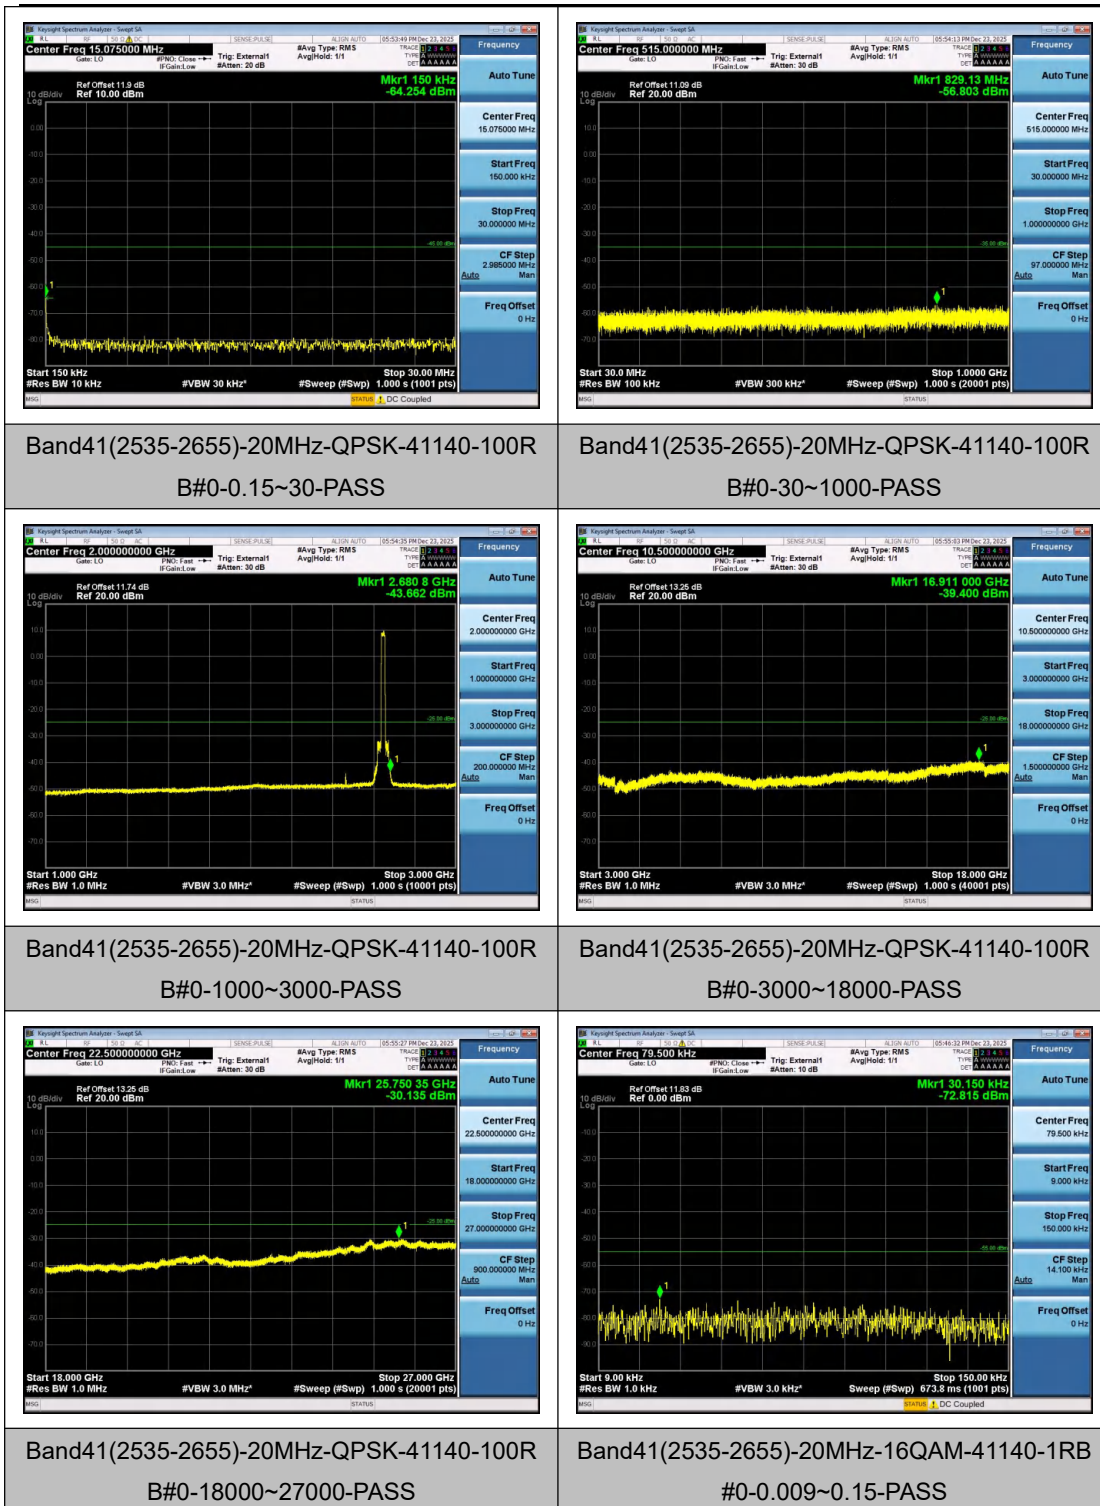

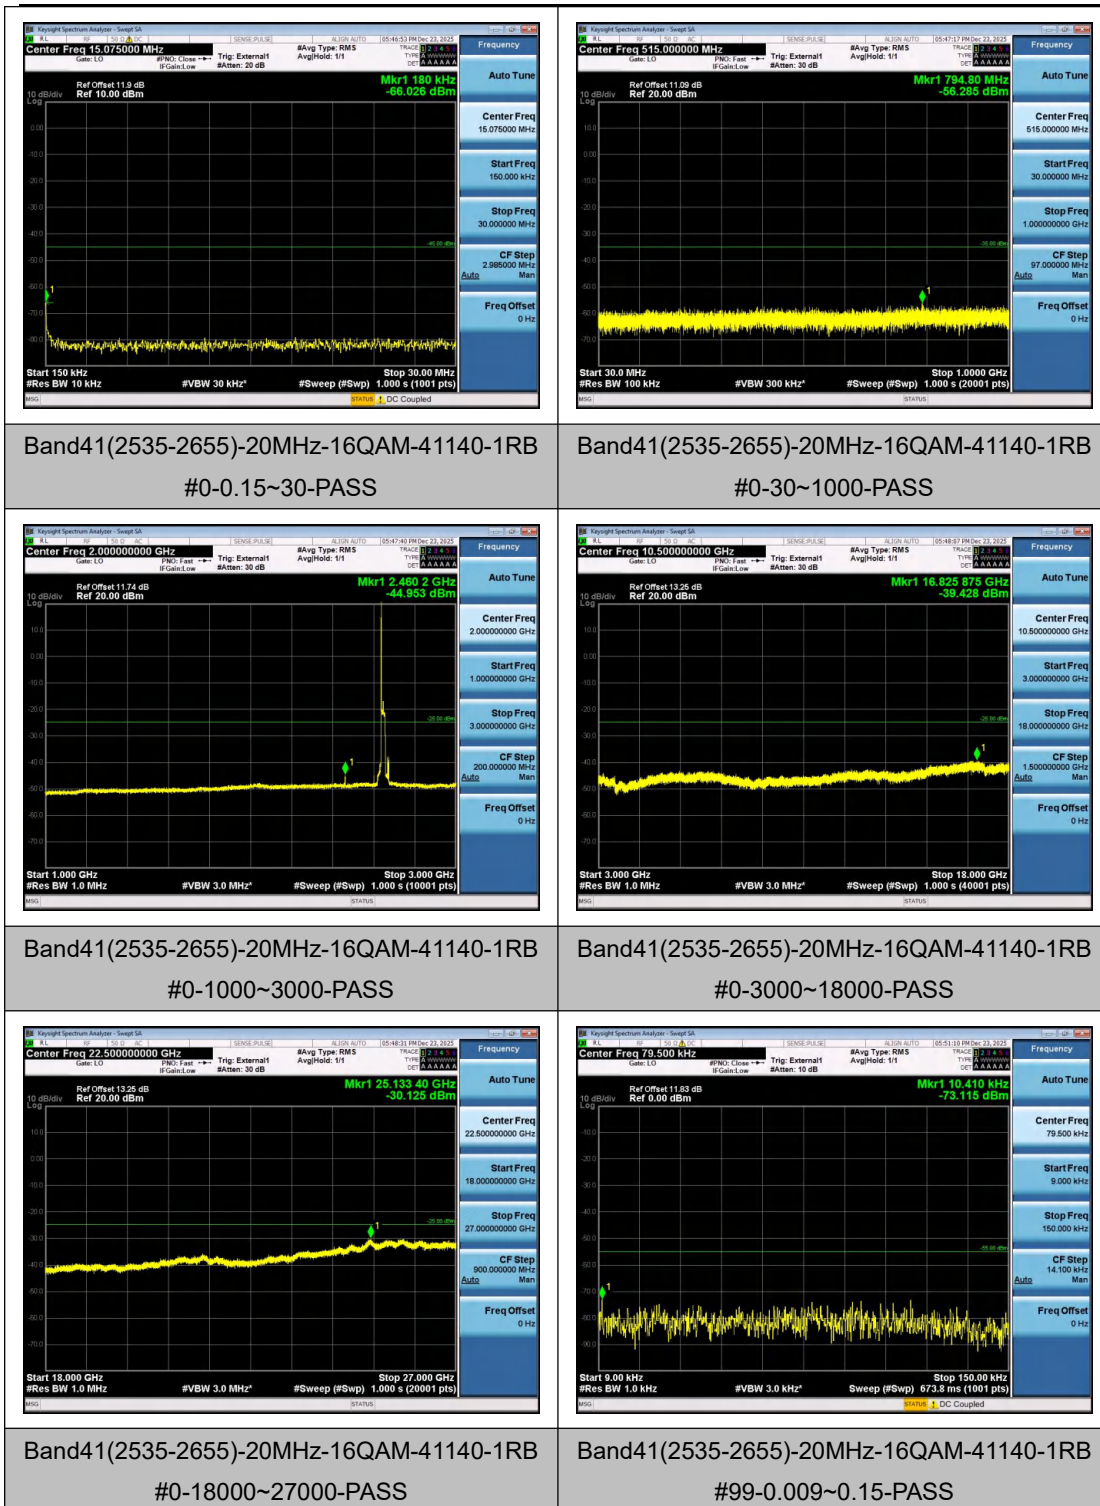

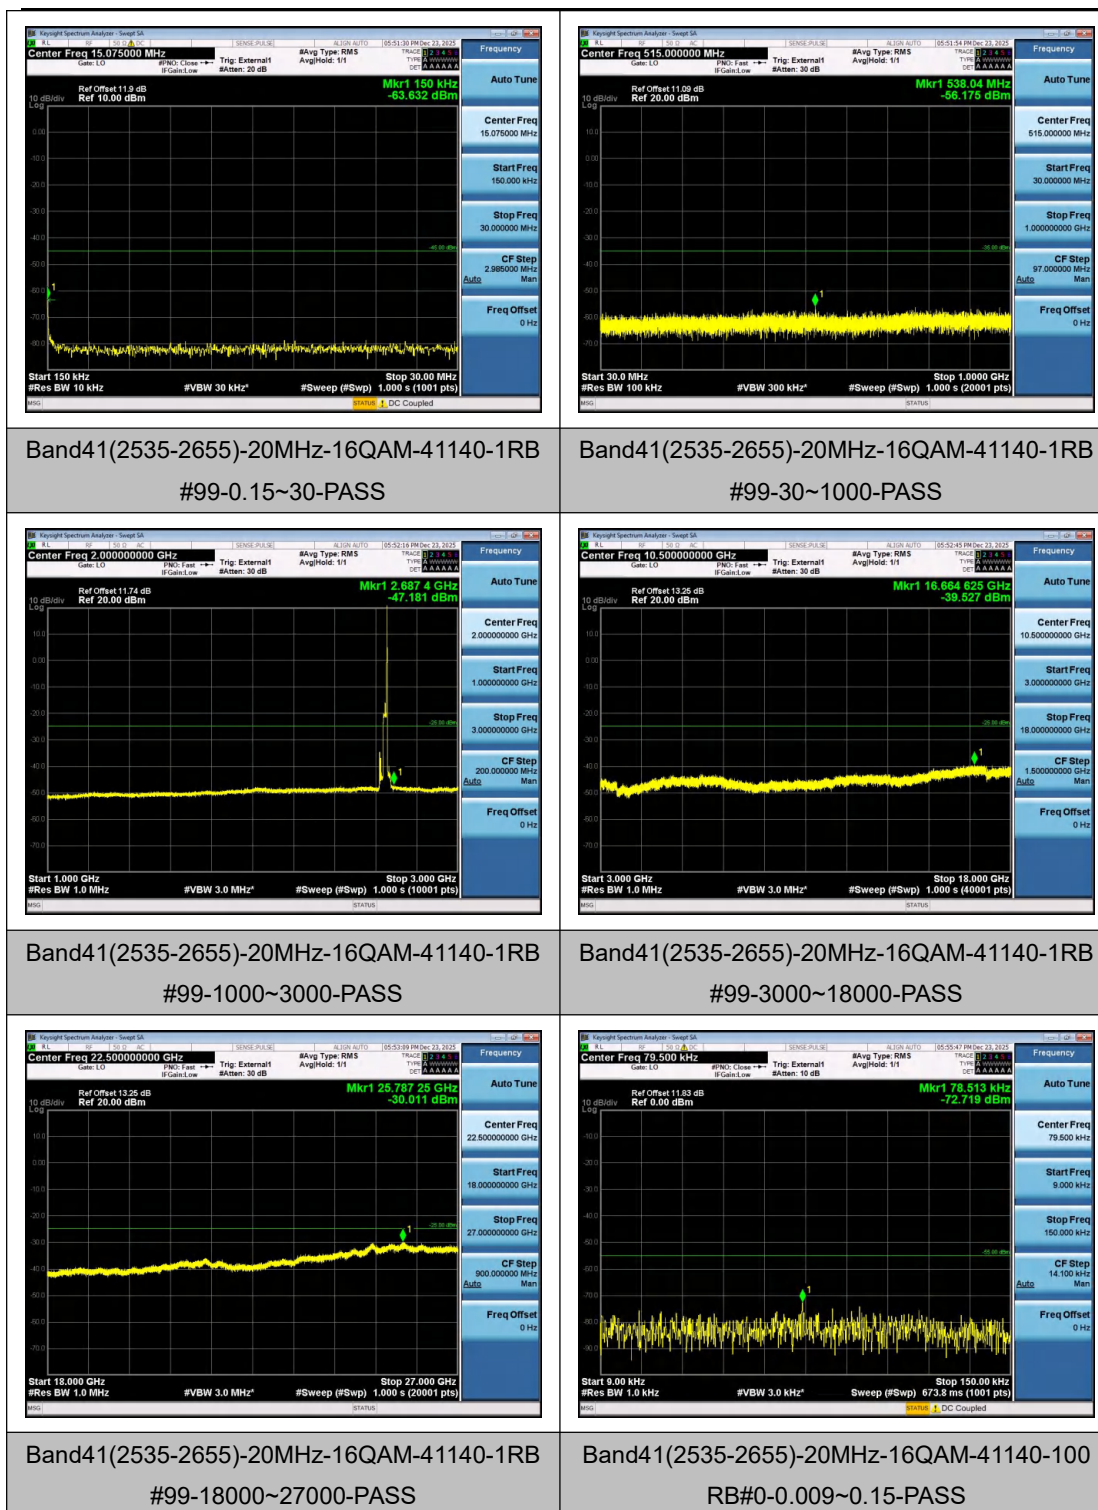

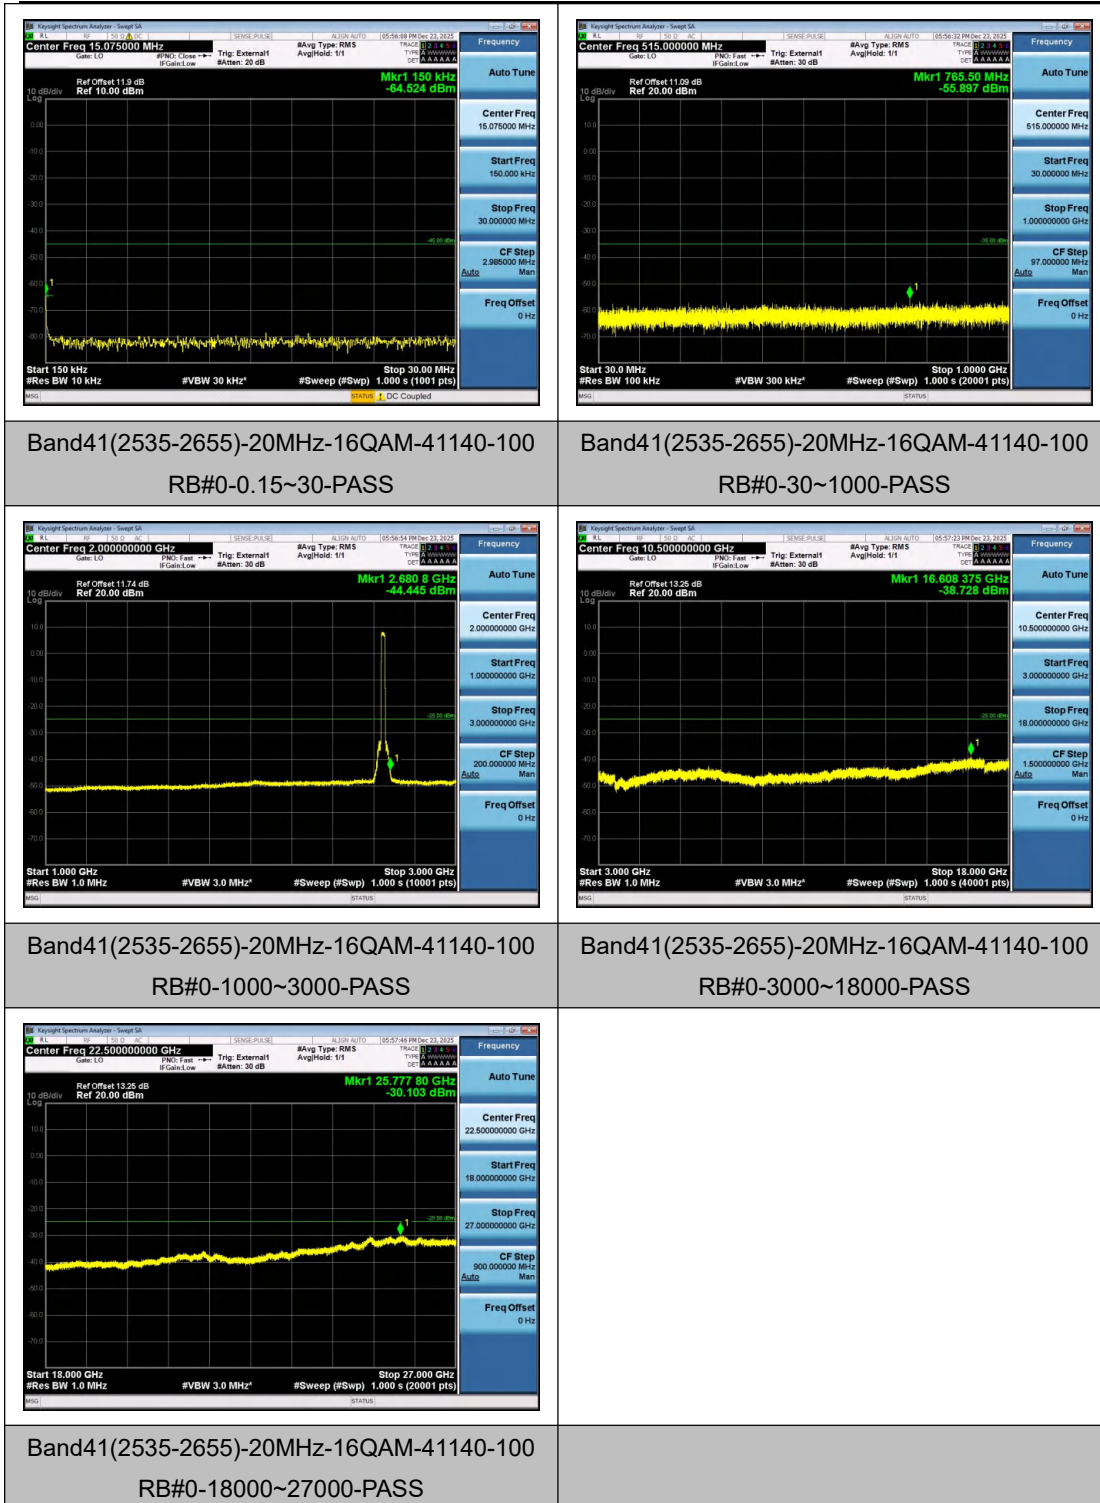

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage[Vdc]	Temperature(°C)				
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VN	NT	2535.28237	2539.69827	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VL	NT	2535.28232	2539.69822	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	40065	25RB#0	VH	NT	2535.2822	2539.6983	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VN	NT	2535.26517	2539.71737	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VL	NT	2535.26521	2539.71731	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40065	25RB#0	VH	NT	2535.26508	2539.71748	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VN	NT	2592.77661	2597.23031	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VL	NT	2592.77693	2597.23033	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	40640	25RB#0	VH	NT	2592.77618	2597.23038	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VN	NT	2592.76997	2597.22067	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VL	NT	2592.77033	2597.22073	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	40640	25RB#0	VH	NT	2592.77027	2597.22077	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VN	NT	2650.28178	2654.73638	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VL	NT	2650.28159	2654.73639	2496-2690	PASS
Band41(2535-2655)	5MHz	QPSK	41215	25RB#0	VH	NT	2650.28178	2654.73638	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VN	NT	2650.26525	2654.71595	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VL	NT	2650.26536	2654.71616	2496-2690	PASS
Band41(2535-2655)	5MHz	16QAM	41215	25RB#0	VH	NT	2650.26	2654.71	2496-2690	PASS

535-2655)							525	625		
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VN	NT	2535.51 561	2544.46 851	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VL	NT	2535.51 558	2544.46 868	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	VH	NT	2535.51 555	2544.46 855	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VN	NT	2535.52 367	2544.43 977	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VL	NT	2535.52 365	2544.43 995	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	VH	NT	2535.52 359	2544.43 979	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VN	NT	2590.52 085	2599.46 225	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VL	NT	2590.52 091	2599.46 221	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	VH	NT	2590.52 096	2599.46 196	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VN	NT	2590.52 294	2599.42 694	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VL	NT	2590.52 292	2599.42 702	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	VH	NT	2590.52 291	2599.42 711	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VN	NT	2645.52 543	2654.46 013	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VL	NT	2645.52 561	2654.46 011	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	VH	NT	2645.52 55	2654.46 02	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VN	NT	2645.52 508	2654.43 388	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VL	NT	2645.52 494	2654.43 404	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	VH	NT	2645.52 494	2654.43 374	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VN	NT	2535.79 909	2549.21 109	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VL	NT	2535.81 358	2549.20 358	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	VH	NT	2535.80	2549.20	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							514	314		
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VN	NT	2535.79 112	2549.19 112	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VL	NT	2535.79 146	2549.19 646	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	VH	NT	2535.79 05	2549.21 05	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VN	NT	2588.30 017	2601.68 117	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VL	NT	2588.29 905	2601.68 105	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	VH	NT	2588.32 015	2601.67 915	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VN	NT	2588.28 699	2601.68 699	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VL	NT	2588.29 32	2601.68 42	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	VH	NT	2588.29 145	2601.68 045	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VN	NT	2640.80 853	2654.18 453	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VL	NT	2640.80 64	2654.19 54	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	VH	NT	2640.80 333	2654.19 233	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VN	NT	2640.80 148	2654.18 648	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VL	NT	2640.79 919	2654.19 219	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	VH	NT	2640.78 712	2654.21 012	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VN	NT	2536.11 535	2553.92 035	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VL	NT	2536.11 494	2553.91 994	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	VH	NT	2536.11 512	2553.92 012	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	VN	NT	2536.09 421	2553.94 121	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	VL	NT	2536.09 345	2553.94 145	2496-2690	PASS
Band41(2	20MHz	16QAM	40140	100RB#0	VH	NT	2536.09	2553.94	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							425	125		
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VN	NT	2586.10 438	2603.84 638	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VL	NT	2586.10 443	2603.84 643	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	VH	NT	2586.10 454	2603.84 654	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VN	NT	2586.07 168	2603.89 268	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VL	NT	2586.07 136	2603.89 336	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	VH	NT	2586.07 103	2603.89 303	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VN	NT	2636.11 975	2653.91 275	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VL	NT	2636.11 936	2653.91 336	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	VH	NT	2636.11 941	2653.91 341	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VN	NT	2636.07 841	2653.93 041	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VL	NT	2636.07 808	2653.93 108	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	VH	NT	2636.07 786	2653.92 986	2496-2690	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage[Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-30	2535.28 219	2539.69 829	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-20	2535.28 224	2539.69 834	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	-10	2535.28 21	2539.69 82	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	0	2535.28 201	2539.69 831	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	10	2535.28 237	2539.69 817	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	20	2535.28 199	2539.69 829	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	30	2535.28	2539.69	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							212	832		
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	40	2535.28 212	2539.69 822	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40065	25RB#0	NV	50	2535.28 188	2539.69 828	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-30	2535.26 512	2539.71 742	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-20	2535.26 51	2539.71 74	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	-10	2535.26 505	2539.71 745	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	0	2535.26 511	2539.71 741	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	10	2535.26 514	2539.71 744	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	20	2535.26 499	2539.71 749	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	30	2535.26 51	2539.71 73	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	40	2535.26 511	2539.71 751	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40065	25RB#0	NV	50	2535.26 521	2539.71 741	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-30	2592.77 667	2597.23 037	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-20	2592.77 658	2597.23 038	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	-10	2592.77 68	2597.23 03	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	0	2592.77 669	2597.23 039	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	10	2592.77 661	2597.23 041	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	20	2592.77 666	2597.23 036	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	30	2592.77 682	2597.23 032	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	40	2592.77 689	2597.23 039	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	40640	25RB#0	NV	50	2592.77 685	2597.23 045	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-30	2592.77	2597.22	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							015	075		
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-20	2592.77 034	2597.22 084	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	-10	2592.77 042	2597.22 072	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	0	2592.77 045	2597.22 085	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	10	2592.77 019	2597.22 069	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	20	2592.77 048	2597.22 068	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	30	2592.77 031	2597.22 071	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	40	2592.77 015	2597.22 075	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	40640	25RB#0	NV	50	2592.77 028	2597.22 078	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-30	2650.28 181	2654.73 641	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-20	2650.28 16	2654.73 64	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	-10	2650.28 186	2654.73 636	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	0	2650.28 169	2654.73 649	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	10	2650.28 166	2654.73 636	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	20	2650.28 197	2654.73 647	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	30	2650.28 169	2654.73 649	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	40	2650.27 977	2654.72 487	2496-2690	PASS
Band41(2 535-2655)	5MHz	QPSK	41215	25RB#0	NV	50	2650.28 087	2654.69 807	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-30	2650.26 52	2654.71 61	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-20	2650.26 545	2654.71 585	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	-10	2650.26 53	2654.71 59	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	0	2650.26	2654.71	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							532	602		
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	10	2650.26 531	2654.71 601	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	20	2650.26 542	2654.71 602	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	30	2650.26 538	2654.71 598	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	40	2650.26 536	2654.71 596	2496-2690	PASS
Band41(2 535-2655)	5MHz	16QAM	41215	25RB#0	NV	50	2650.26 536	2654.71 596	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-30	2535.51 566	2544.46 856	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-20	2535.51 56	2544.46 86	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	-10	2535.51 558	2544.46 848	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	0	2535.51 566	2544.46 886	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	10	2535.51 573	2544.46 883	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	20	2535.51 562	2544.46 912	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	30	2535.51 553	2544.46 873	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	40	2535.51 555	2544.46 875	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40090	50RB#0	NV	50	2535.51 559	2544.46 839	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-30	2535.52 345	2544.43 975	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-20	2535.52 35	2544.43 97	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	-10	2535.52 357	2544.43 977	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	0	2535.52 354	2544.44 014	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	10	2535.52 383	2544.43 983	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	20	2535.52 357	2544.43 987	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	30	2535.52	2544.43	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							367	977		
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	40	2535.52 34	2544.44	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40090	50RB#0	NV	50	2535.52 359	2544.43 999	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-30	2590.52 085	2599.46 185	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-20	2590.52 1	2599.46 18	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	-10	2590.52 1	2599.46 21	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	0	2590.52 092	2599.46 192	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	10	2590.52 086	2599.46 206	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	20	2590.52 083	2599.46 203	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	30	2590.52 088	2599.46 198	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	40	2590.52 094	2599.46 164	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	40640	50RB#0	NV	50	2590.52 096	2599.46 186	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-30	2590.52 305	2599.42 705	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-20	2590.52 299	2599.42 699	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	-10	2590.52 296	2599.42 716	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	0	2590.52 28	2599.42 72	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	10	2590.52 291	2599.42 711	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	20	2590.52 298	2599.42 708	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	30	2590.52 299	2599.42 709	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	40	2590.52 302	2599.42 722	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	40640	50RB#0	NV	50	2590.52 295	2599.42 725	2496-2690	PASS
Band41(2	10MHz	QPSK	41190	50RB#0	NV	-30	2645.52	2654.46	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							541	031		
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	-20	2645.52 541	2654.46 011	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	-10	2645.52 532	2654.46 012	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	0	2645.52 535	2654.46 025	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	10	2645.52 556	2654.46 016	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	20	2645.52 531	2654.46 031	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	30	2645.52 549	2654.46 029	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	40	2645.52 539	2654.46 019	2496-2690	PASS
Band41(2 535-2655)	10MHz	QPSK	41190	50RB#0	NV	50	2645.52 545	2654.46 035	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-30	2645.52 491	2654.43 371	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-20	2645.52 487	2654.43 417	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	-10	2645.52 497	2654.43 407	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	0	2645.52 494	2654.43 404	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	10	2645.52 495	2654.43 385	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	20	2645.52 505	2654.43 415	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	30	2645.52 508	2654.43 388	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	40	2645.52 498	2654.43 408	2496-2690	PASS
Band41(2 535-2655)	10MHz	16QAM	41190	50RB#0	NV	50	2645.52 496	2654.43 436	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-30	2535.80 252	2549.20 952	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-20	2535.80 738	2549.20 138	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	-10	2535.80 125	2549.20 325	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	0	2535.81	2549.19	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							655	155		
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	10	2535.80 404	2549.20 004	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	20	2535.79 498	2549.20 098	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	30	2535.80 276	2549.20 076	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	40	2535.79 783	2549.20 083	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40115	75RB#0	NV	50	2535.79 952	2549.21 052	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-30	2535.78 957	2549.20 157	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-20	2535.79 466	2549.20 766	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	-10	2535.79 5	2549.19 7	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	0	2535.80 272	2549.19 972	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	10	2535.78 837	2549.19 737	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	20	2535.78 975	2549.21 375	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	30	2535.79 499	2549.20 499	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	40	2535.79 507	2549.19 507	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40115	75RB#0	NV	50	2535.79 403	2549.20 003	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-30	2588.31 125	2601.67 225	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-20	2588.29 569	2601.67 969	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	-10	2588.31 092	2601.67 592	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	0	2588.31 163	2601.68 363	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	10	2588.31 279	2601.68 979	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	20	2588.30 907	2601.67 907	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	30	2588.31	2601.68	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							453	153		
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	40	2588.30 724	2601.68 724	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	40640	75RB#0	NV	50	2588.30 751	2601.67 851	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-30	2588.29 216	2601.68 916	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-20	2588.29 12	2601.68 72	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	-10	2588.27 724	2601.68 524	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	0	2588.27 01	2601.67 51	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	10	2588.28 295	2601.68 695	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	20	2588.28 016	2601.68 416	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	30	2588.29 255	2601.68 055	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	40	2588.27 567	2601.67 967	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	40640	75RB#0	NV	50	2588.28 561	2601.68 461	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-30	2640.80 076	2654.19 376	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-20	2640.80 924	2654.18 824	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	-10	2640.78 813	2654.18 013	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	0	2640.80 243	2654.17 843	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	10	2640.81 077	2654.18 877	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	20	2640.80 72	2654.18 52	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	30	2640.78 649	2654.19 049	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	40	2640.79 067	2654.18 867	2496-2690	PASS
Band41(2 535-2655)	15MHz	QPSK	41165	75RB#0	NV	50	2640.80 09	2654.18 19	2496-2690	PASS
Band41(2	15MHz	16QAM	41165	75RB#0	NV	-30	2640.79	2654.19	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							205	505		
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	-20	2640.79 521	2654.20 021	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	-10	2640.79 213	2654.20 213	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	0	2640.79 963	2654.19 663	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	10	2640.79 946	2654.20 246	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	20	2640.78 915	2654.19 915	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	30	2640.79 622	2654.20 722	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	40	2640.78 615	2654.20 315	2496-2690	PASS
Band41(2 535-2655)	15MHz	16QAM	41165	75RB#0	NV	50	2640.81 158	2654.20 358	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-30	2536.11 501	2553.91 901	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-20	2536.11 533	2553.92 033	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	-10	2536.11 571	2553.91 971	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	0	2536.11 555	2553.91 955	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	10	2536.11 459	2553.91 959	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	20	2536.11 578	2553.91 978	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	30	2536.11 569	2553.91 969	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	40	2536.11 467	2553.91 967	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40140	100RB#0	NV	50	2536.11 482	2553.91 982	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-30	2536.09 479	2553.94 079	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-20	2536.09 325	2553.94 025	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	-10	2536.09 425	2553.94 125	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	0	2536.09	2553.94	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

535-2655)							438	038		
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	10	2536.09 396	2553.94 096	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	20	2536.09 456	2553.94 056	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	30	2536.09 408	2553.94 008	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	40	2536.09 412	2553.94 112	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40140	100RB#0	NV	50	2536.09 385	2553.94 085	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	-30	2586.10 422	2603.84 622	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	-20	2586.10 434	2603.84 634	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	-10	2586.10 45	2603.84 65	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	0	2586.10 463	2603.84 663	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	10	2586.10 445	2603.84 645	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	20	2586.10 445	2603.84 645	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	30	2586.10 431	2603.84 631	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	40	2586.10 427	2603.84 627	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	40640	100RB#0	NV	50	2586.10 454	2603.84 654	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	-30	2586.07 157	2603.89 257	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	-20	2586.07 168	2603.89 268	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	-10	2586.07 103	2603.89 303	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	0	2586.07 196	2603.89 296	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	10	2586.07 168	2603.89 268	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	20	2586.07 183	2603.89 283	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	30	2586.07	2603.89	2496-2690	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


535-2655)							189	289		
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	40	2586.07 173	2603.89 273	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	40640	100RB#0	NV	50	2586.07 173	2603.89 273	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	-30	2636.11 933	2653.91 333	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	-20	2636.11 94	2653.91 34	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	-10	2636.11 958	2653.91 358	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	0	2636.11 976	2653.91 276	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	10	2636.11 944	2653.91 344	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	20	2636.11 947	2653.91 347	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	30	2636.11 941	2653.91 341	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	40	2636.11 936	2653.91 336	2496-2690	PASS
Band41(2 535-2655)	20MHz	QPSK	41140	100RB#0	NV	50	2636.11 964	2653.91 364	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	-30	2636.07 845	2653.92 945	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	-20	2636.07 83	2653.93 13	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	-10	2636.07 814	2653.93 014	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	0	2636.07 833	2653.93 033	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	10	2636.07 805	2653.93 105	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	20	2636.07 822	2653.93 022	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	30	2636.07 795	2653.93 095	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	40	2636.07 826	2653.93 026	2496-2690	PASS
Band41(2 535-2655)	20MHz	16QAM	41140	100RB#0	NV	50	2636.07 83	2653.93 03	2496-2690	PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

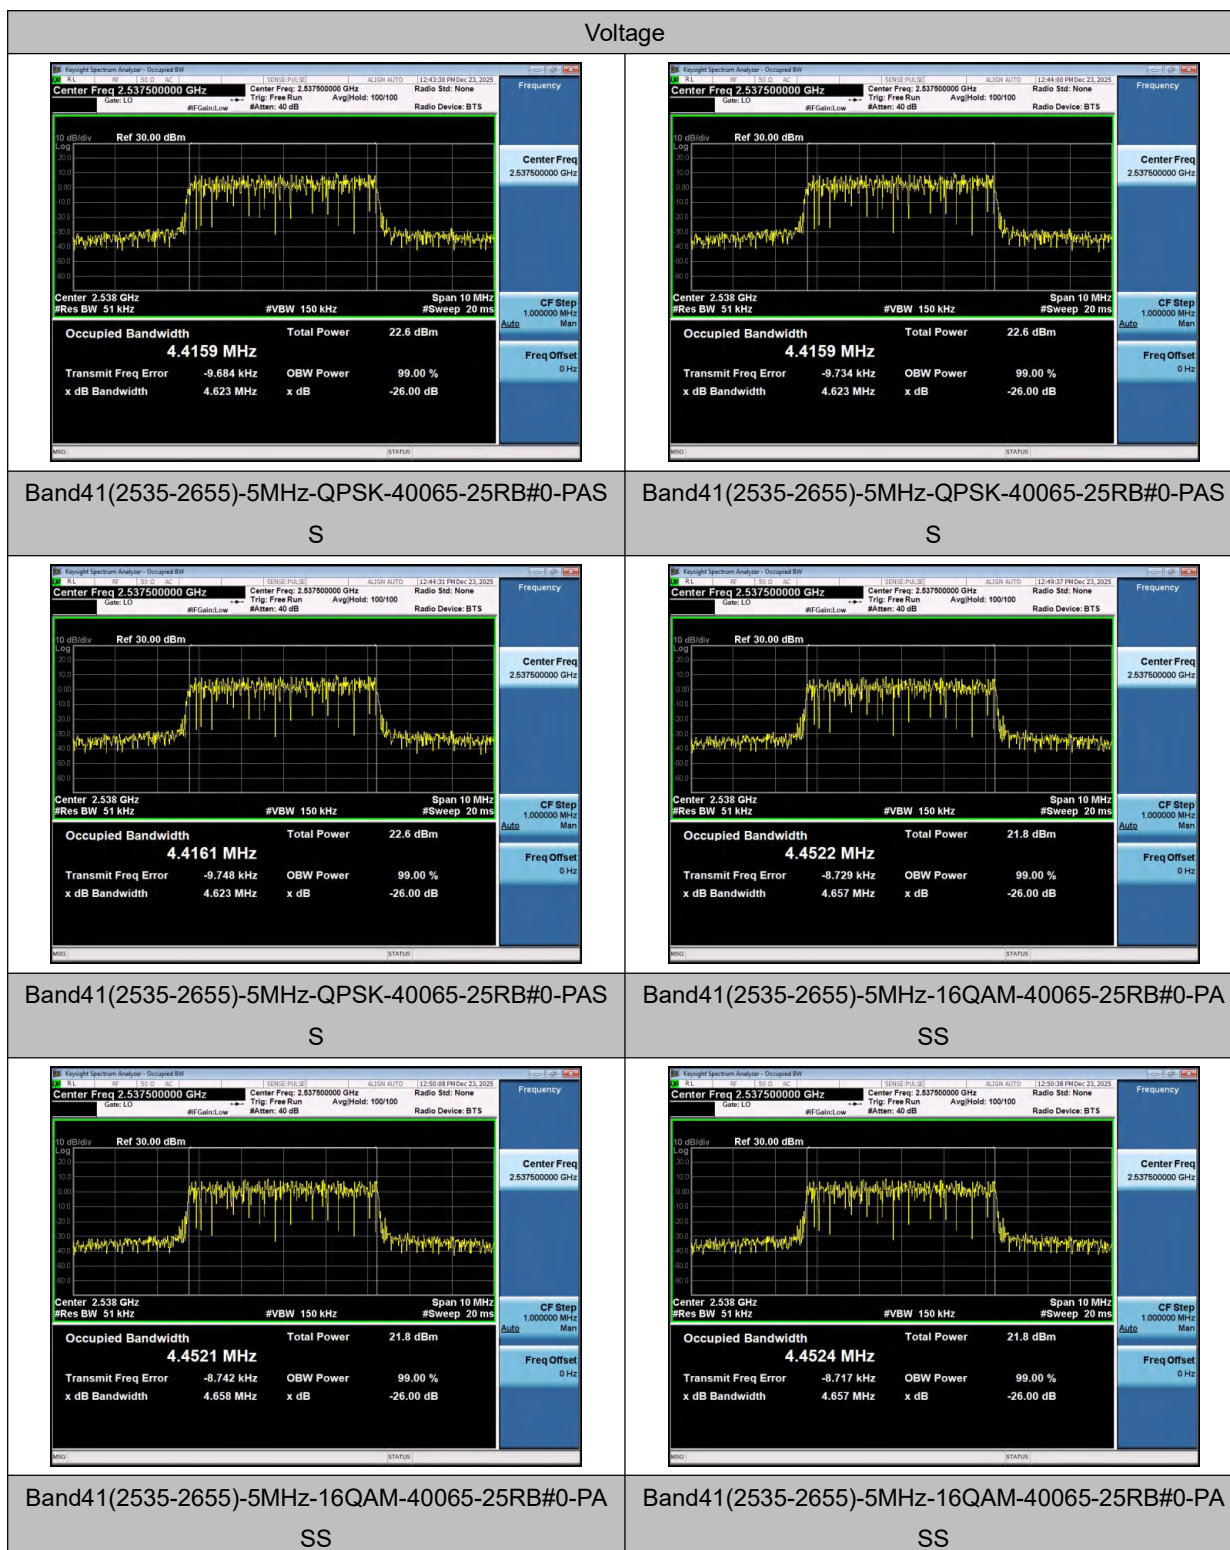

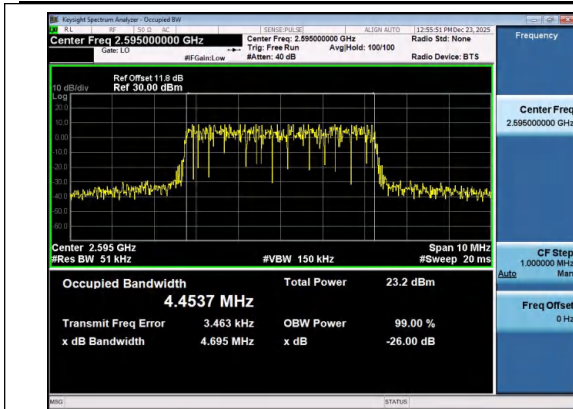


Band41(2535-2655)-5MHz-QPSK-40640-25RB#0-PAS

S

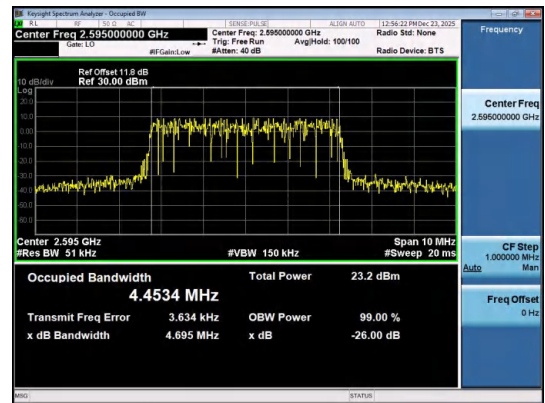


Band41(2535-2655)-5MHz-QPSK-40640-25RB#0-PAS

S

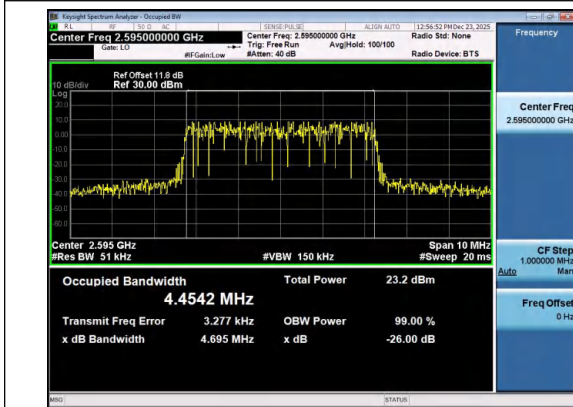


Band41(2535-2655)-5MHz-QPSK-40640-25RB#0-PAS

S

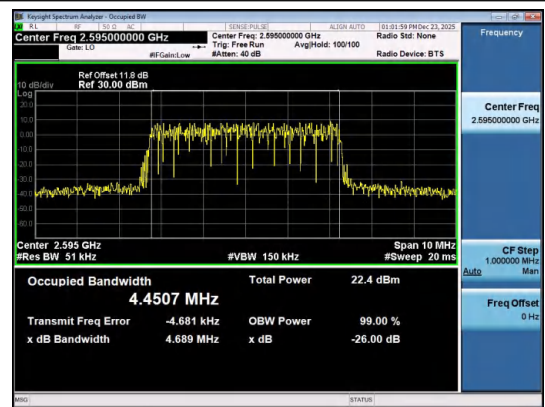


Band41(2535-2655)-5MHz-16QAM-40640-25RB#0-PA

SS

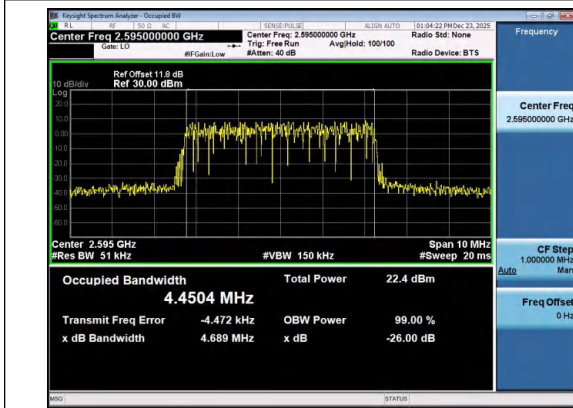


Band41(2535-2655)-5MHz-16QAM-40640-25RB#0-PA

SS

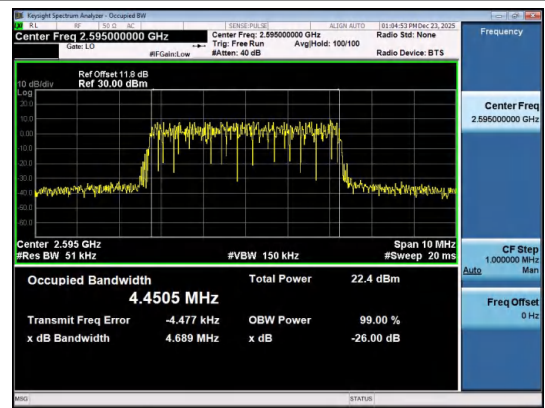


Band41(2535-2655)-5MHz-16QAM-40640-25RB#0-PA

SS

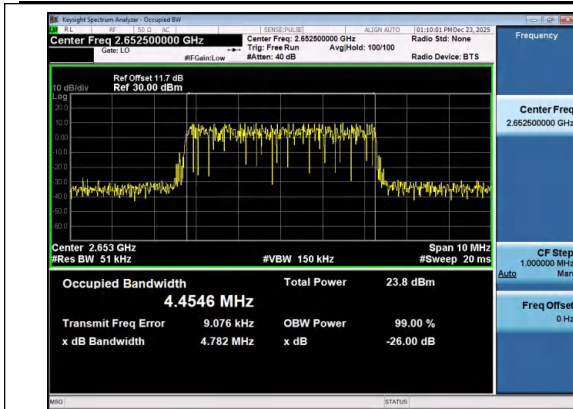


Band41(2535-2655)-5MHz-QPSK-41215-25RB#0-PAS

S

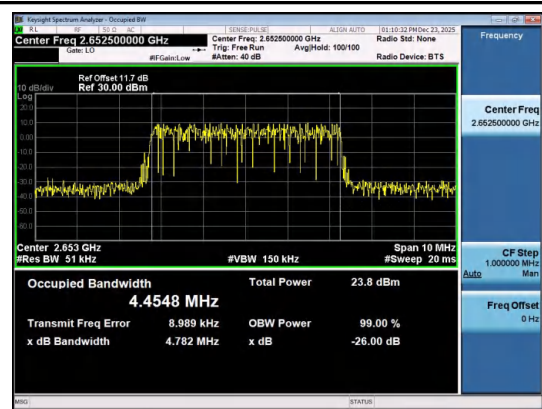


Band41(2535-2655)-5MHz-QPSK-41215-25RB#0-PAS

S

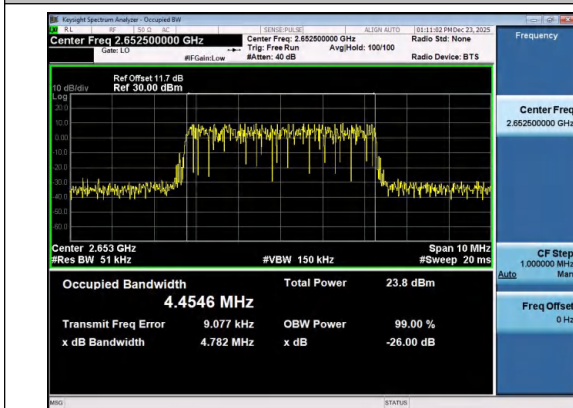


Band41(2535-2655)-5MHz-QPSK-41215-25RB#0-PAS

S

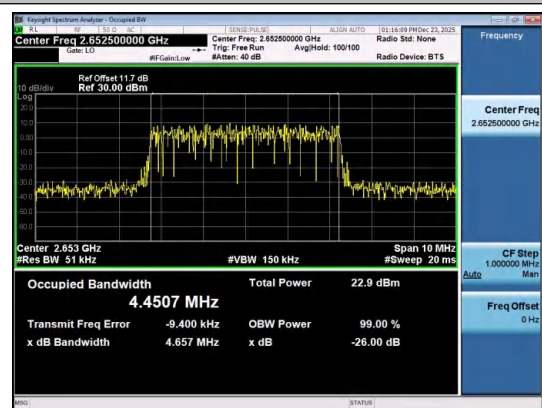


Band41(2535-2655)-5MHz-16QAM-41215-25RB#0-PA

SS

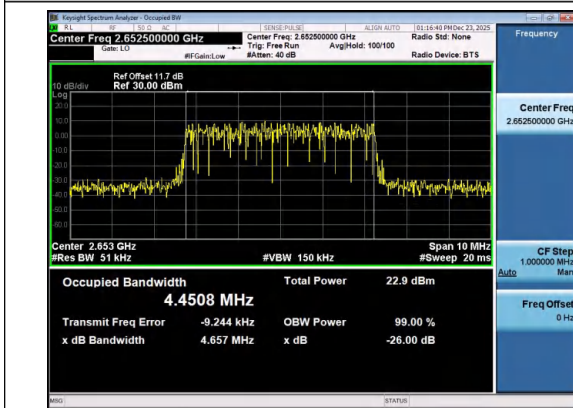

Band41(2535-2655)-5MHz-16QAM-41215-25RB#0-PA

SS

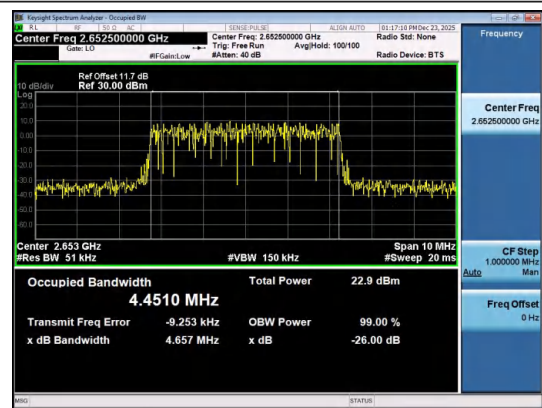

Band41(2535-2655)-5MHz-16QAM-41215-25RB#0-PA

SS

