

Appendix Test Data

Report No:	1812C50616812505-06	Test Sample NO:	1-2-2
Start Test Date:	2025-11-21	Finish Test Date:	2025-12-8
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24°C	Relative Humidity:	44%
Pressure:	101 kPa		



Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band17	5MHz	QPSK	23755	1RB#0	24.67	PASS
Band17	5MHz	QPSK	23755	1RB#12	24.75	PASS
Band17	5MHz	QPSK	23755	1RB#24	24.67	PASS
Band17	5MHz	QPSK	23755	12RB#0	23.64	PASS
Band17	5MHz	QPSK	23755	12RB#6	23.72	PASS
Band17	5MHz	QPSK	23755	12RB#13	23.67	PASS
Band17	5MHz	QPSK	23755	25RB#0	23.66	PASS
Band17	5MHz	16QAM	23755	1RB#0	23.76	PASS
Band17	5MHz	16QAM	23755	1RB#12	23.82	PASS
Band17	5MHz	16QAM	23755	1RB#24	23.72	PASS
Band17	5MHz	16QAM	23755	12RB#0	22.65	PASS
Band17	5MHz	16QAM	23755	12RB#6	22.82	PASS
Band17	5MHz	16QAM	23755	12RB#13	22.78	PASS
Band17	5MHz	16QAM	23755	25RB#0	22.71	PASS
Band17	5MHz	QPSK	23790	1RB#0	24.69	PASS
Band17	5MHz	QPSK	23790	1RB#12	24.66	PASS
Band17	5MHz	QPSK	23790	1RB#24	24.61	PASS
Band17	5MHz	QPSK	23790	12RB#0	23.58	PASS
Band17	5MHz	QPSK	23790	12RB#6	23.68	PASS
Band17	5MHz	QPSK	23790	12RB#13	23.62	PASS
Band17	5MHz	QPSK	23790	25RB#0	23.66	PASS
Band17	5MHz	16QAM	23790	1RB#0	23.63	PASS
Band17	5MHz	16QAM	23790	1RB#12	23.64	PASS
Band17	5MHz	16QAM	23790	1RB#24	23.55	PASS
Band17	5MHz	16QAM	23790	12RB#0	22.56	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band17	5MHz	16QAM	23790	12RB#6	22.65	PASS
Band17	5MHz	16QAM	23790	12RB#13	22.68	PASS
Band17	5MHz	16QAM	23790	25RB#0	22.71	PASS
Band17	5MHz	QPSK	23825	1RB#0	24.67	PASS
Band17	5MHz	QPSK	23825	1RB#12	24.61	PASS
Band17	5MHz	QPSK	23825	1RB#24	24.67	PASS
Band17	5MHz	QPSK	23825	12RB#0	23.68	PASS
Band17	5MHz	QPSK	23825	12RB#6	23.71	PASS
Band17	5MHz	QPSK	23825	12RB#13	23.55	PASS
Band17	5MHz	QPSK	23825	25RB#0	23.61	PASS
Band17	5MHz	16QAM	23825	1RB#0	23.60	PASS
Band17	5MHz	16QAM	23825	1RB#12	23.58	PASS
Band17	5MHz	16QAM	23825	1RB#24	23.64	PASS
Band17	5MHz	16QAM	23825	12RB#0	22.69	PASS
Band17	5MHz	16QAM	23825	12RB#6	22.71	PASS
Band17	5MHz	16QAM	23825	12RB#13	22.62	PASS
Band17	5MHz	16QAM	23825	25RB#0	22.68	PASS
Band17	10MHz	QPSK	23780	1RB#0	24.82	PASS
Band17	10MHz	QPSK	23780	1RB#24	24.87	PASS
Band17	10MHz	QPSK	23780	1RB#49	24.89	PASS
Band17	10MHz	QPSK	23780	25RB#0	23.75	PASS
Band17	10MHz	QPSK	23780	25RB#12	23.90	PASS
Band17	10MHz	QPSK	23780	25RB#25	23.82	PASS
Band17	10MHz	QPSK	23780	50RB#0	23.82	PASS
Band17	10MHz	16QAM	23780	1RB#0	23.82	PASS
Band17	10MHz	16QAM	23780	1RB#24	23.89	PASS
Band17	10MHz	16QAM	23780	1RB#49	23.89	PASS
Band17	10MHz	16QAM	23780	25RB#0	22.79	PASS
Band17	10MHz	16QAM	23780	25RB#12	22.92	PASS
Band17	10MHz	16QAM	23780	25RB#25	22.88	PASS
Band17	10MHz	16QAM	23780	50RB#0	22.87	PASS
Band17	10MHz	QPSK	23790	1RB#0	24.86	PASS
Band17	10MHz	QPSK	23790	1RB#24	24.98	PASS
Band17	10MHz	QPSK	23790	1RB#49	24.89	PASS
Band17	10MHz	QPSK	23790	25RB#0	23.67	PASS
Band17	10MHz	QPSK	23790	25RB#12	23.86	PASS
Band17	10MHz	QPSK	23790	25RB#25	23.79	PASS
Band17	10MHz	QPSK	23790	50RB#0	23.75	PASS
Band17	10MHz	16QAM	23790	1RB#0	23.72	PASS
Band17	10MHz	16QAM	23790	1RB#24	24.05	PASS
Band17	10MHz	16QAM	23790	1RB#49	23.81	PASS
Band17	10MHz	16QAM	23790	25RB#0	22.74	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band17	10MHz	16QAM	23790	25RB#12	22.95	PASS
Band17	10MHz	16QAM	23790	25RB#25	22.83	PASS
Band17	10MHz	16QAM	23790	50RB#0	22.77	PASS
Band17	10MHz	QPSK	23800	1RB#0	24.89	PASS
Band17	10MHz	QPSK	23800	1RB#24	24.91	PASS
Band17	10MHz	QPSK	23800	1RB#49	24.96	PASS
Band17	10MHz	QPSK	23800	25RB#0	23.66	PASS
Band17	10MHz	QPSK	23800	25RB#12	23.88	PASS
Band17	10MHz	QPSK	23800	25RB#25	23.73	PASS
Band17	10MHz	QPSK	23800	50RB#0	23.77	PASS
Band17	10MHz	16QAM	23800	1RB#0	23.59	PASS
Band17	10MHz	16QAM	23800	1RB#24	23.85	PASS
Band17	10MHz	16QAM	23800	1RB#49	23.64	PASS
Band17	10MHz	16QAM	23800	25RB#0	22.73	PASS
Band17	10MHz	16QAM	23800	25RB#12	22.96	PASS
Band17	10MHz	16QAM	23800	25RB#25	22.87	PASS
Band17	10MHz	16QAM	23800	50RB#0	22.81	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band17	5MHz	QPSK	23755	1RB#0	5.51	13	PASS
Band17	5MHz	QPSK	23755	25RB#0	5.98	13	PASS
Band17	5MHz	16QAM	23755	1RB#0	6.13	13	PASS
Band17	5MHz	16QAM	23755	25RB#0	6.70	13	PASS
Band17	5MHz	QPSK	23790	1RB#0	5.29	13	PASS
Band17	5MHz	QPSK	23790	25RB#0	5.82	13	PASS
Band17	5MHz	16QAM	23790	1RB#0	6.05	13	PASS
Band17	5MHz	16QAM	23790	25RB#0	6.55	13	PASS
Band17	5MHz	QPSK	23825	1RB#0	4.88	13	PASS
Band17	5MHz	QPSK	23825	25RB#0	5.75	13	PASS
Band17	5MHz	16QAM	23825	1RB#0	5.63	13	PASS
Band17	5MHz	16QAM	23825	25RB#0	6.51	13	PASS
Band17	10MHz	QPSK	23780	1RB#0	5.29	13	PASS
Band17	10MHz	QPSK	23780	50RB#0	5.75	13	PASS
Band17	10MHz	16QAM	23780	1RB#0	6.45	13	PASS
Band17	10MHz	16QAM	23780	50RB#0	6.61	13	PASS
Band17	10MHz	QPSK	23790	1RB#0	5.38	13	PASS
Band17	10MHz	QPSK	23790	50RB#0	5.74	13	PASS
Band17	10MHz	16QAM	23790	1RB#0	6.28	13	PASS
Band17	10MHz	16QAM	23790	50RB#0	6.57	13	PASS
Band17	10MHz	QPSK	23800	1RB#0	5.28	13	PASS
Band17	10MHz	QPSK	23800	50RB#0	5.68	13	PASS
Band17	10MHz	16QAM	23800	1RB#0	6.14	13	PASS
Band17	10MHz	16QAM	23800	50RB#0	6.56	13	PASS


Test Graphs

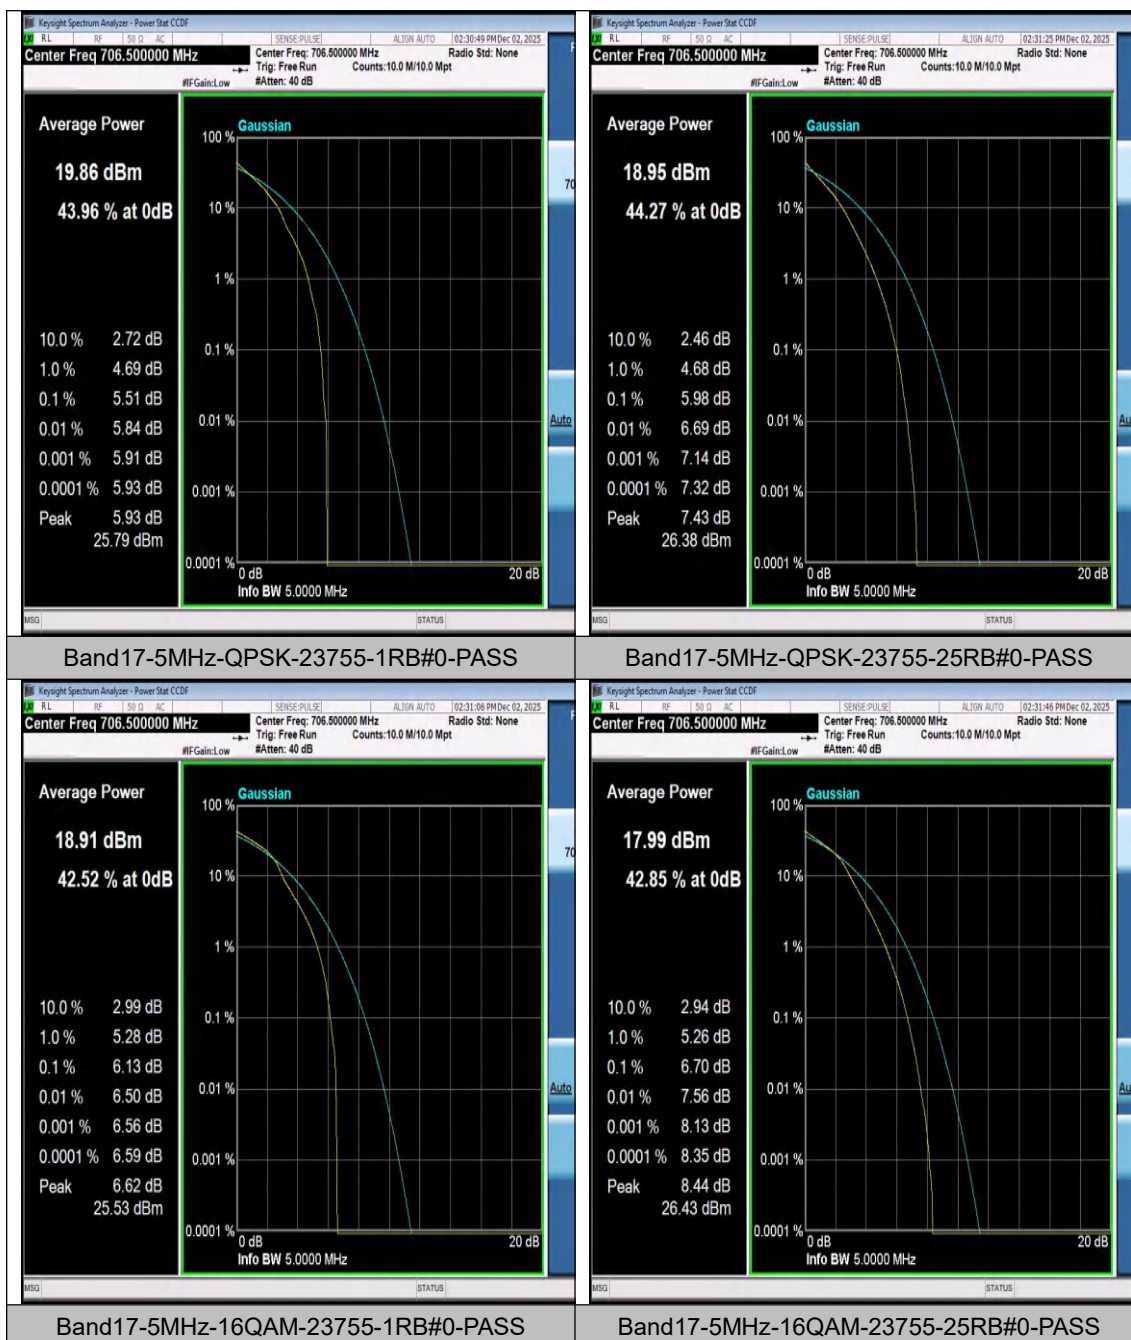

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

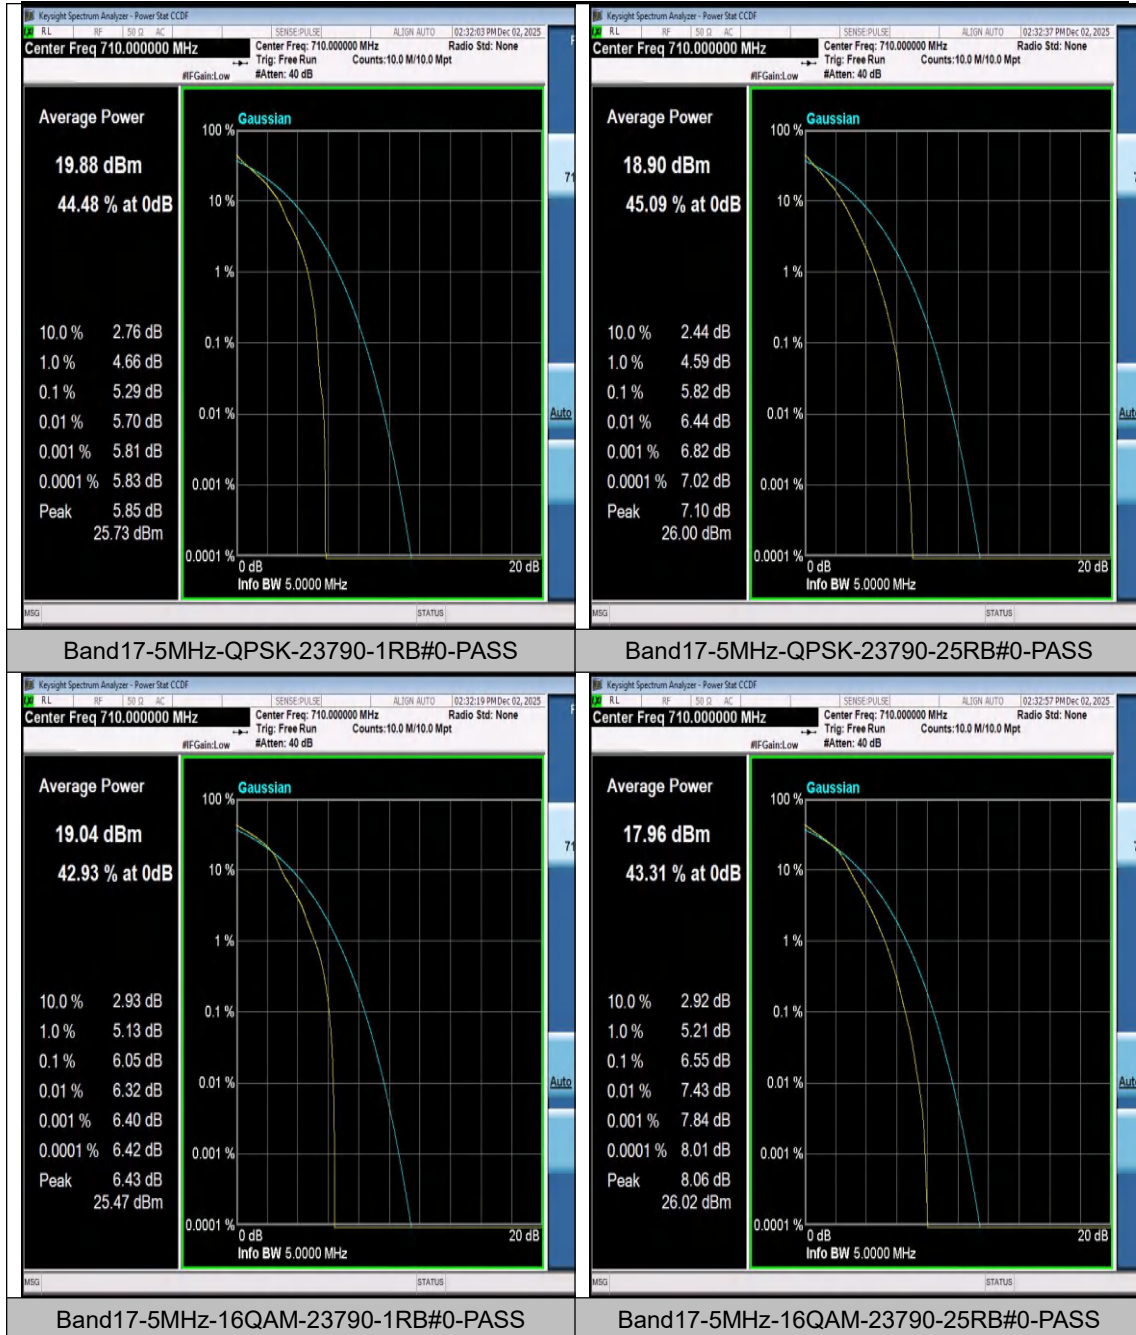

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

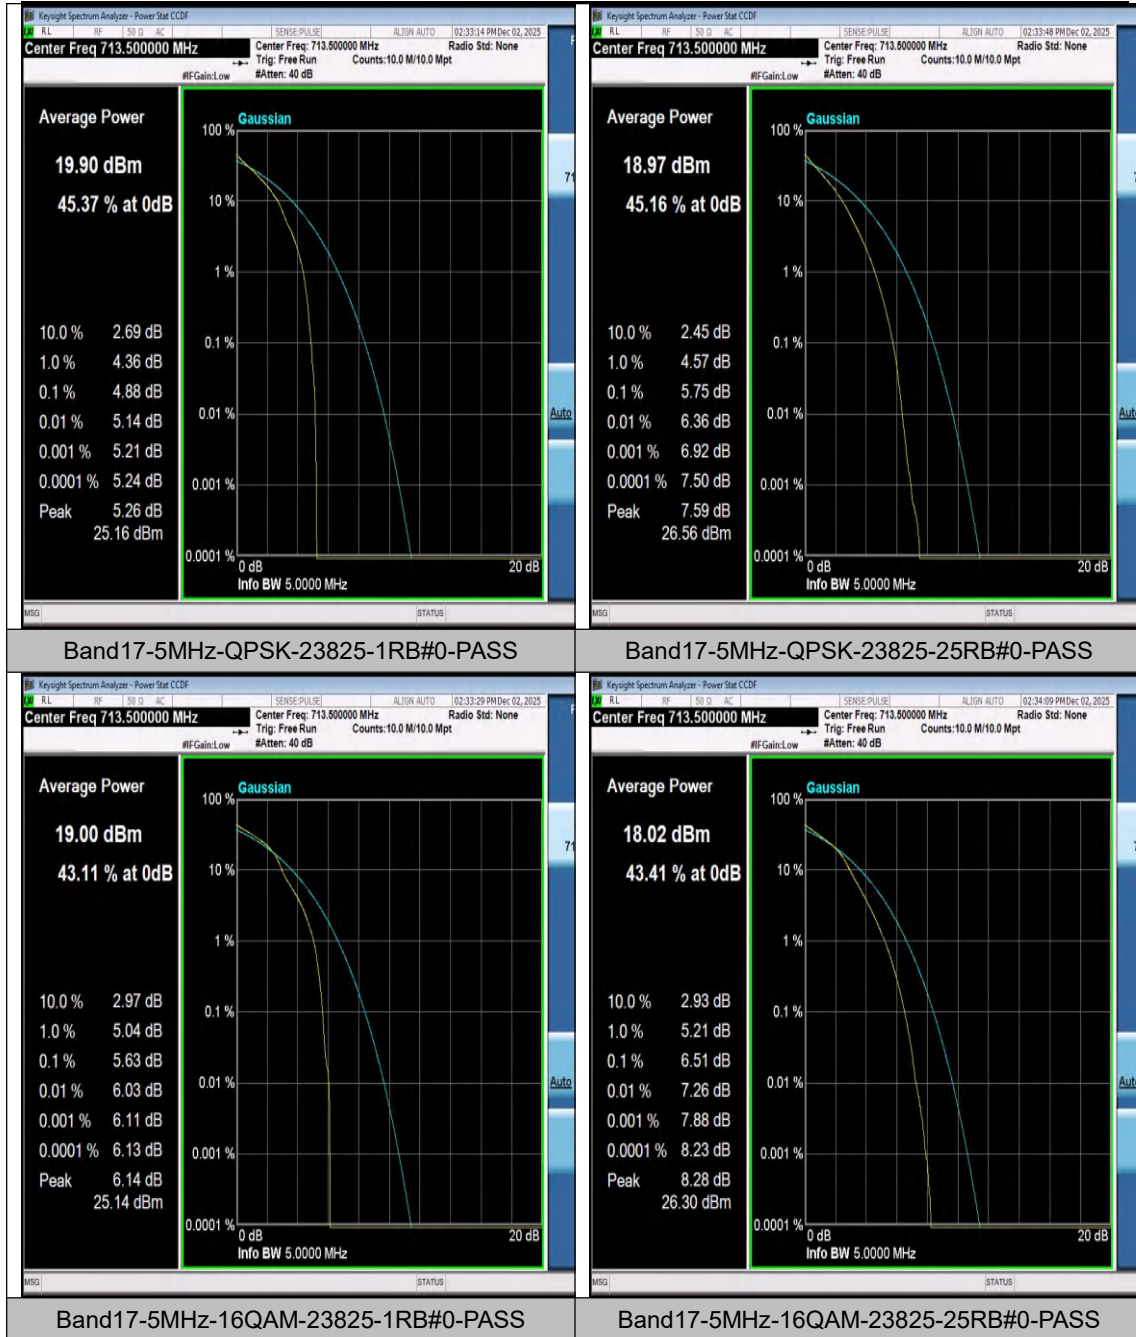

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

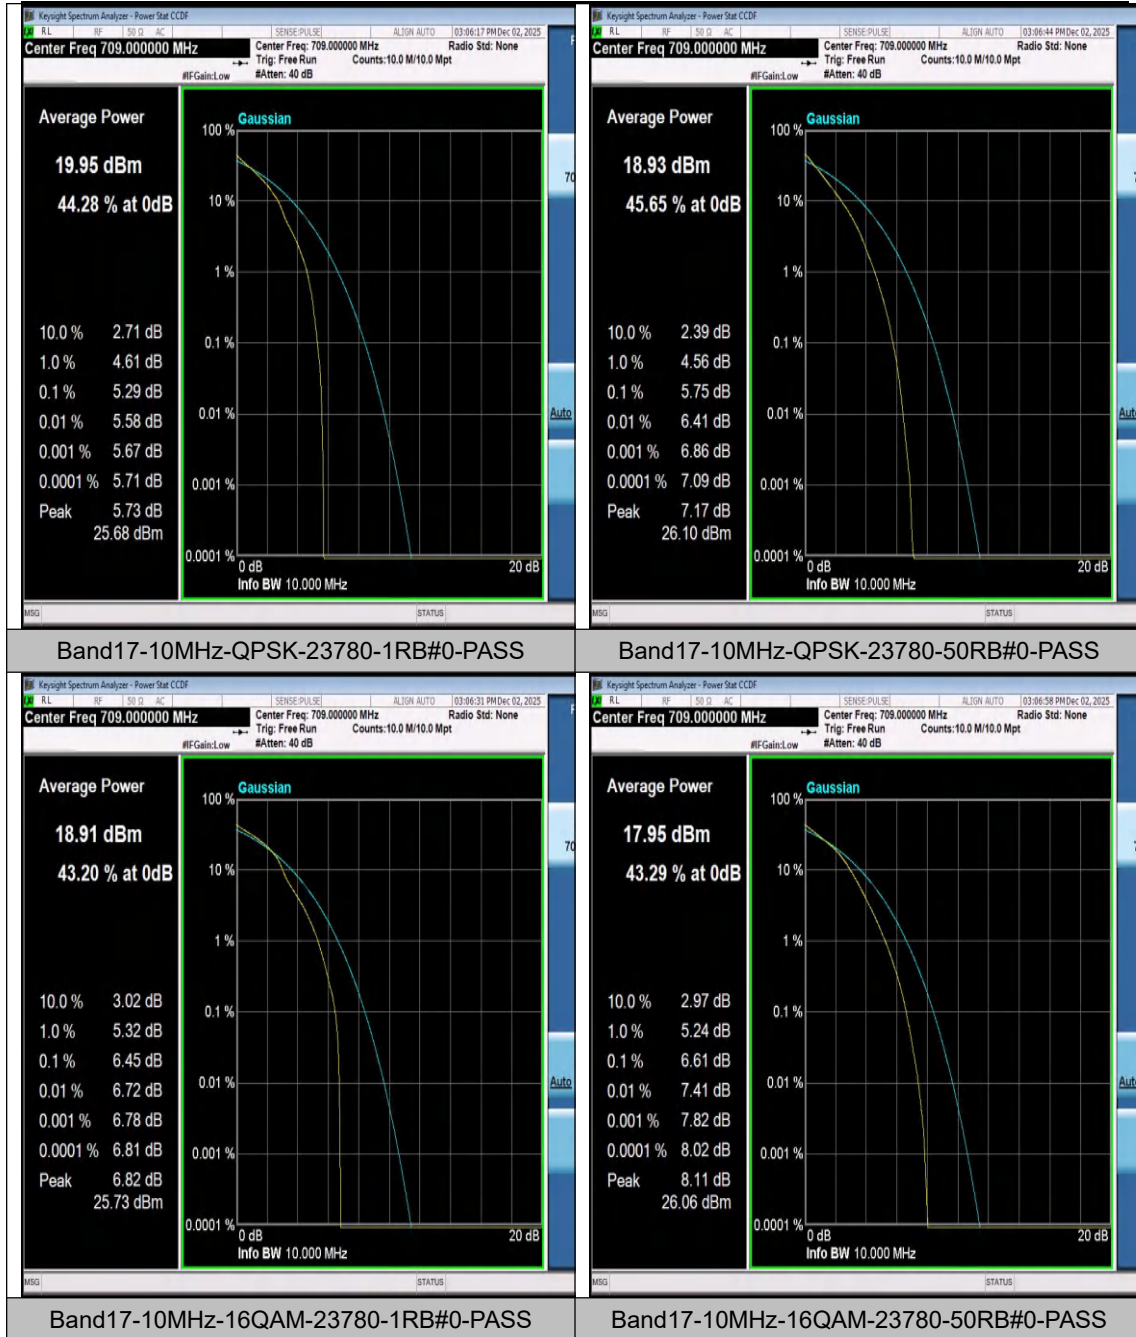

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

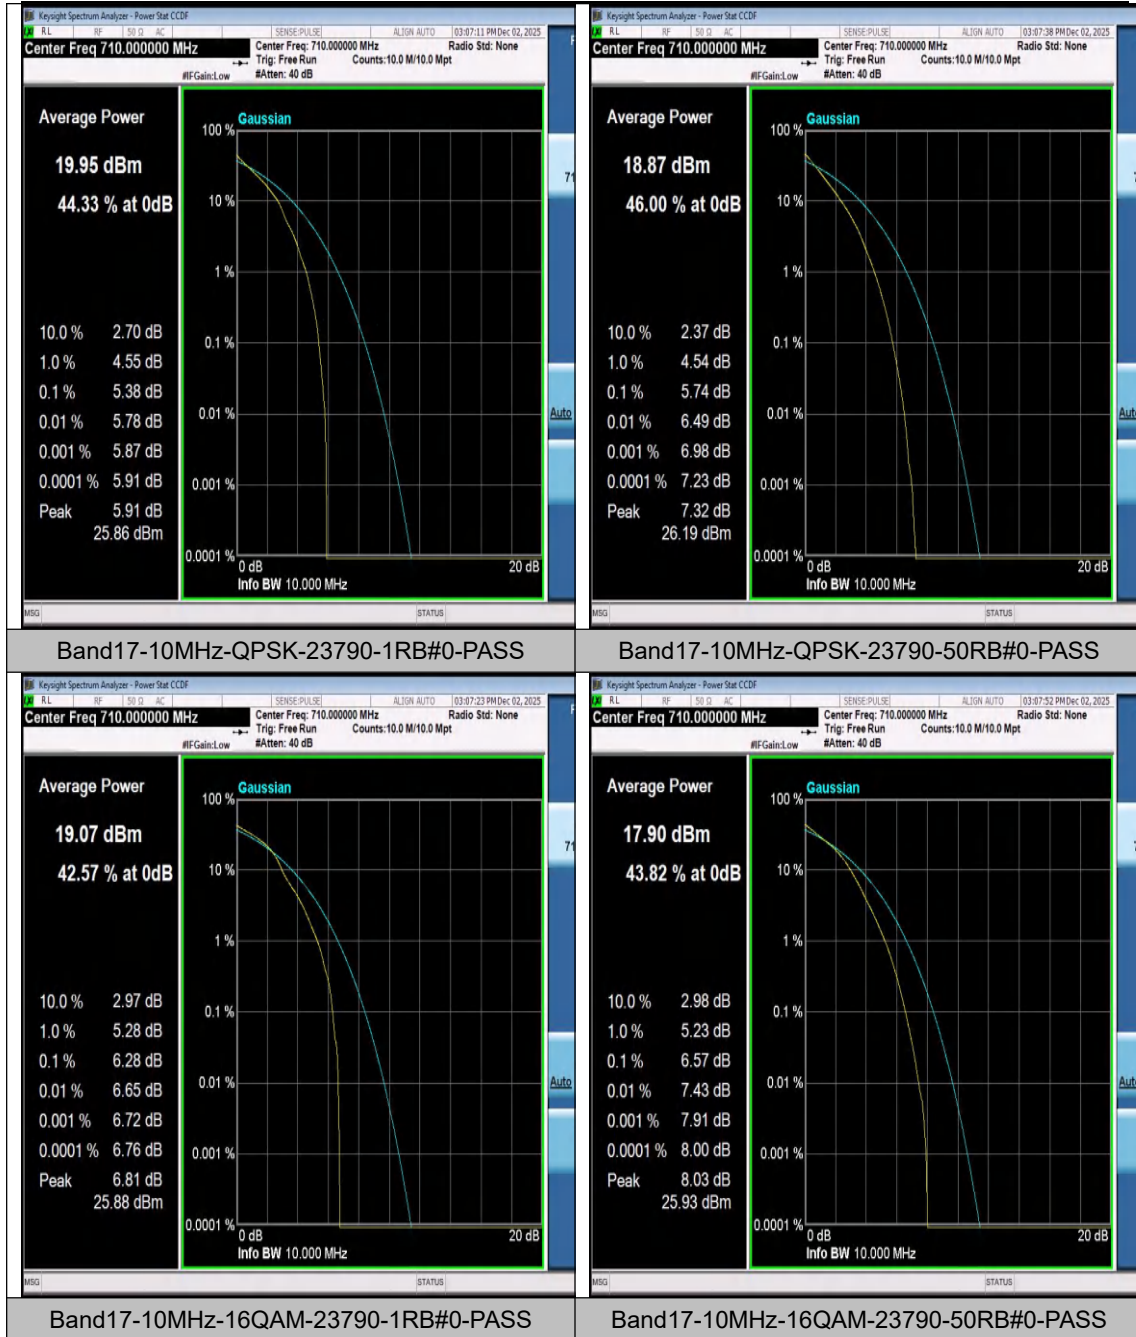

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

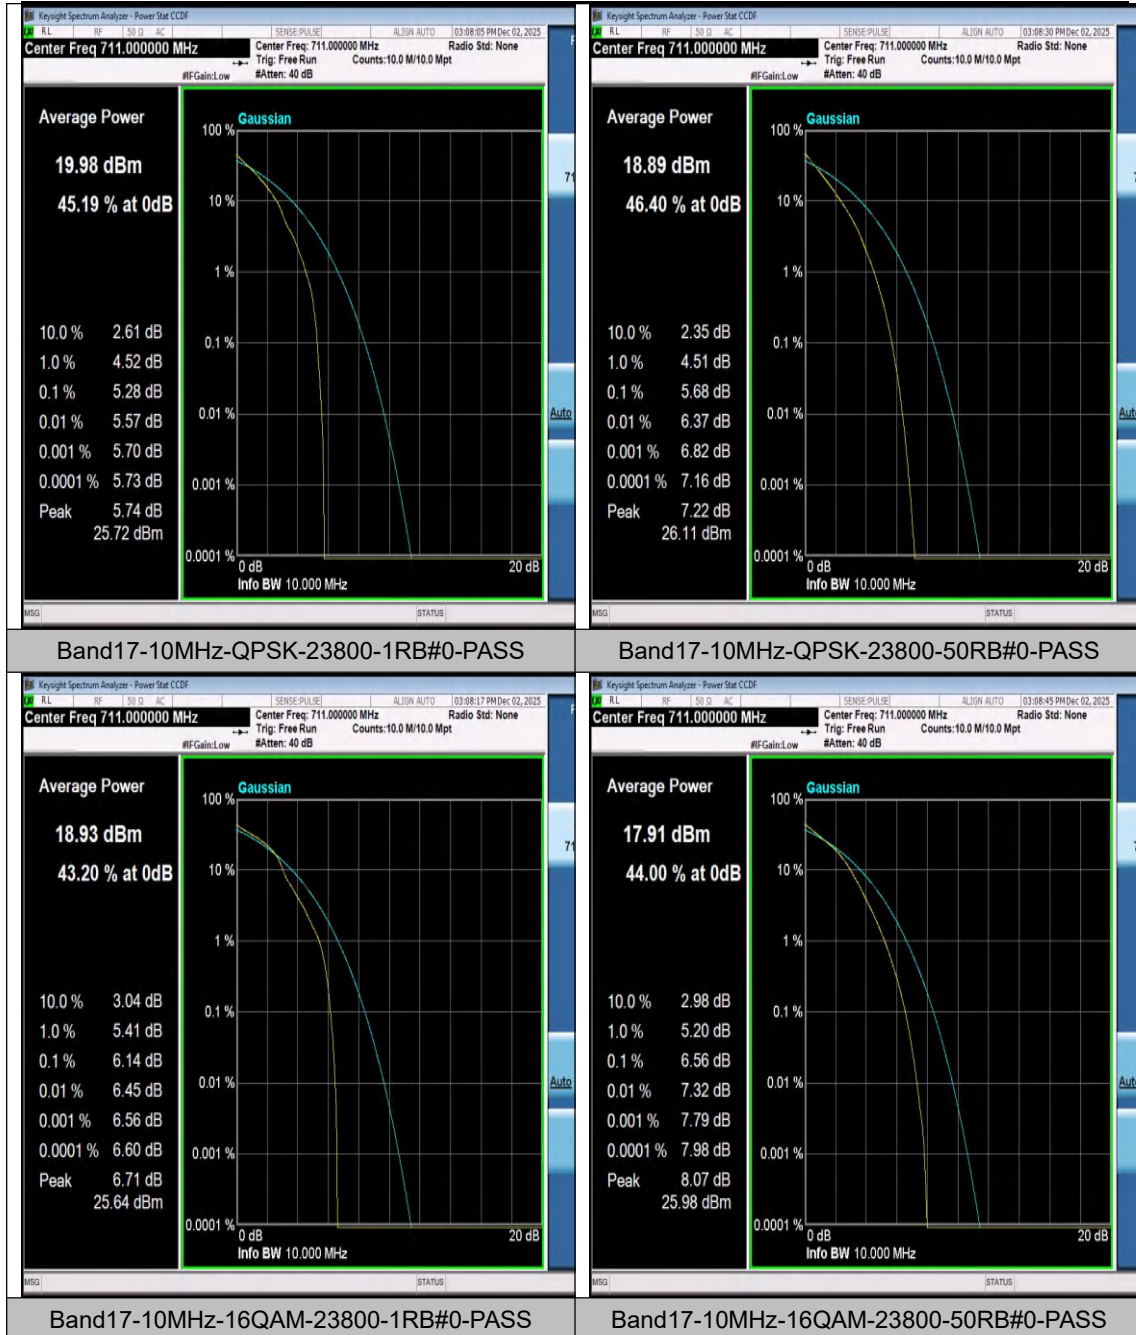

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band17	5MHz	QPSK	23755	25RB#0	4.4958	4.902	PASS
Band17	5MHz	16QAM	23755	25RB#0	4.5048	4.919	PASS
Band17	5MHz	QPSK	23790	25RB#0	4.4942	4.915	PASS
Band17	5MHz	16QAM	23790	25RB#0	4.4967	4.908	PASS
Band17	5MHz	QPSK	23825	25RB#0	4.5006	4.897	PASS
Band17	5MHz	16QAM	23825	25RB#0	4.4967	4.879	PASS
Band17	10MHz	QPSK	23780	50RB#0	8.9653	9.748	PASS
Band17	10MHz	16QAM	23780	50RB#0	8.9708	9.752	PASS
Band17	10MHz	QPSK	23790	50RB#0	8.9594	9.735	PASS
Band17	10MHz	16QAM	23790	50RB#0	8.9610	9.687	PASS
Band17	10MHz	QPSK	23800	50RB#0	8.9421	9.677	PASS
Band17	10MHz	16QAM	23800	50RB#0	8.9603	9.744	PASS

Test Graphs

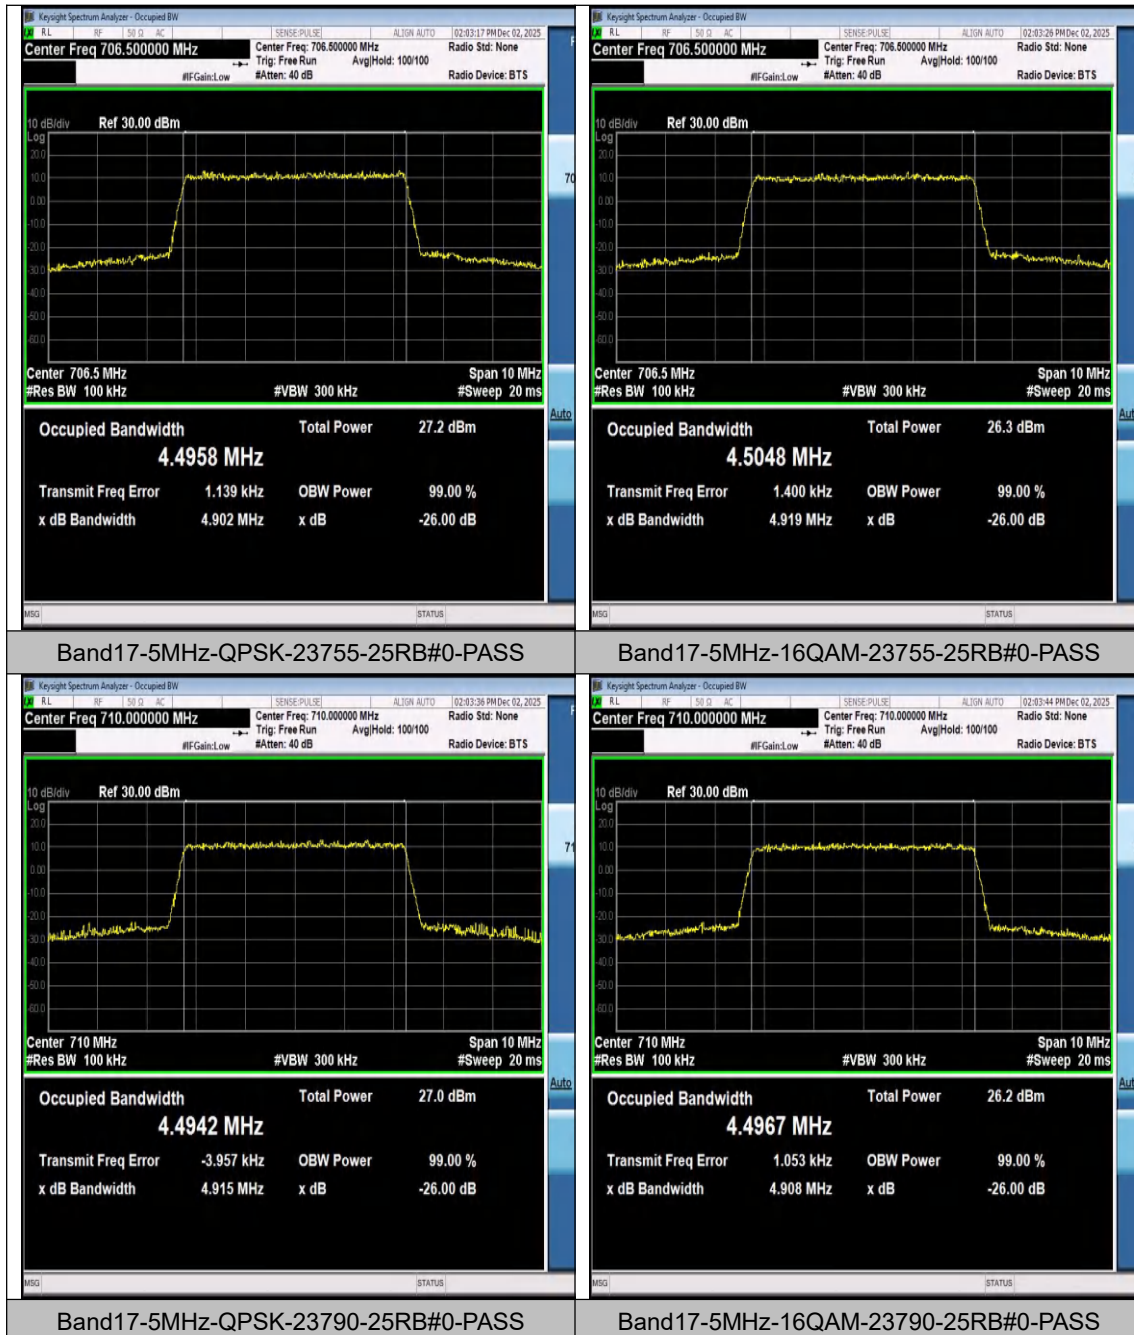


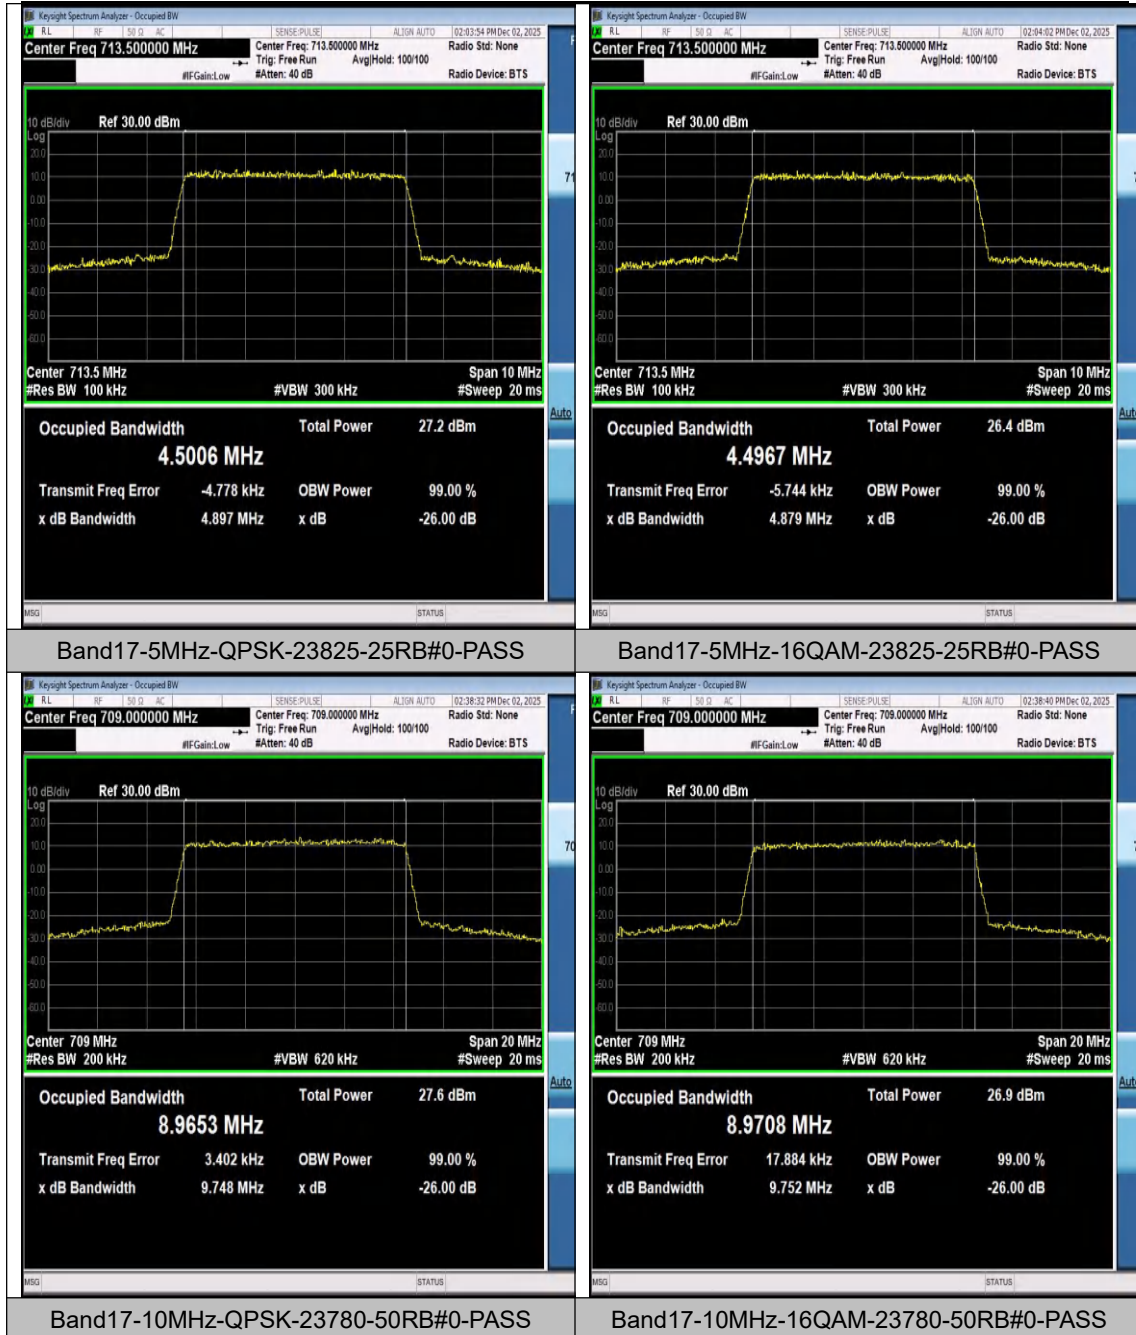

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

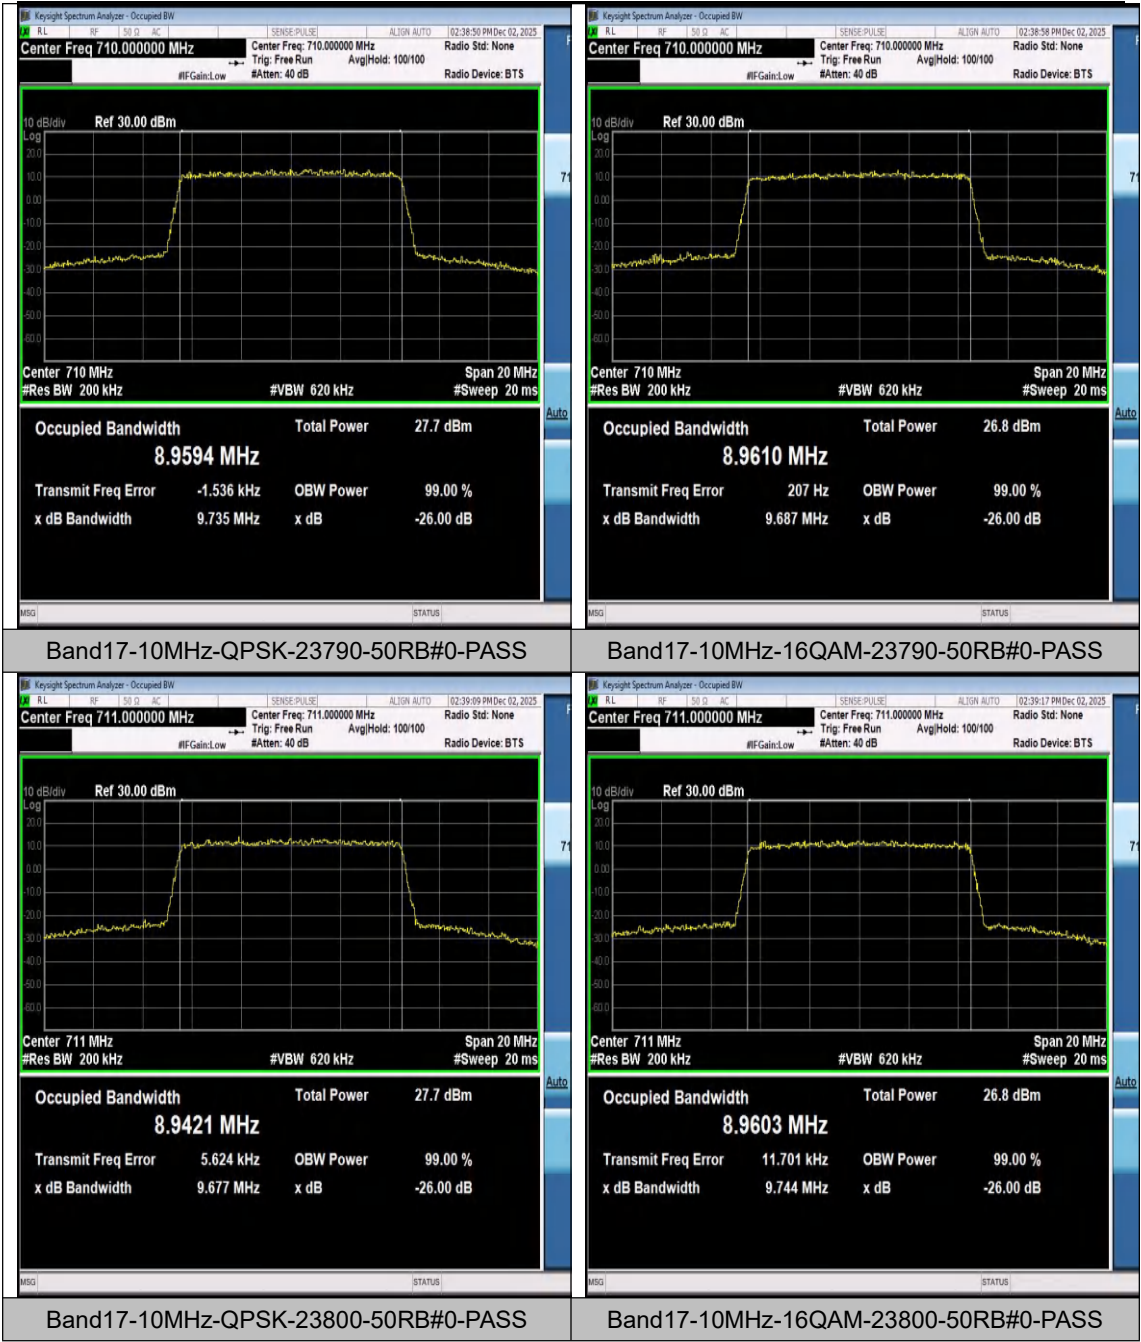


Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Margin (dB)	Verdict
Band17	5MHz	QPSK	23755	1RB#0	-33.05	20.05	PASS
Band17	5MHz	QPSK	23755	1RB#24	-51.15	38.15	PASS
Band17	5MHz	QPSK	23755	25RB#0	-34.95	21.95	PASS
Band17	5MHz	16QAM	23755	1RB#0	-35.28	22.28	PASS
Band17	5MHz	16QAM	23755	1RB#24	-52.15	39.15	PASS
Band17	5MHz	16QAM	23755	25RB#0	-35.21	22.21	PASS
Band17	5MHz	QPSK	23825	1RB#0	-51.22	38.22	PASS
Band17	5MHz	QPSK	23825	1RB#24	-32.52	19.52	PASS
Band17	5MHz	QPSK	23825	25RB#0	-36.51	23.51	PASS
Band17	5MHz	16QAM	23825	1RB#0	-52.34	39.34	PASS
Band17	5MHz	16QAM	23825	1RB#24	-33.59	20.59	PASS
Band17	5MHz	16QAM	23825	25RB#0	-36.71	23.71	PASS
Band17	10MHz	QPSK	23780	1RB#0	-40.54	27.54	PASS
Band17	10MHz	QPSK	23780	1RB#49	-52.96	39.96	PASS
Band17	10MHz	QPSK	23780	50RB#0	-38.08	25.08	PASS
Band17	10MHz	16QAM	23780	1RB#0	-41.80	28.80	PASS
Band17	10MHz	16QAM	23780	1RB#49	-53.56	40.56	PASS
Band17	10MHz	16QAM	23780	50RB#0	-38.66	25.66	PASS
Band17	10MHz	QPSK	23800	1RB#0	-52.06	39.06	PASS
Band17	10MHz	QPSK	23800	1RB#49	-40.55	27.55	PASS
Band17	10MHz	QPSK	23800	50RB#0	-38.87	25.87	PASS
Band17	10MHz	16QAM	23800	1RB#0	-52.88	39.88	PASS
Band17	10MHz	16QAM	23800	1RB#49	-41.57	28.57	PASS
Band17	10MHz	16QAM	23800	50RB#0	-39.33	26.33	PASS


Test Graphs

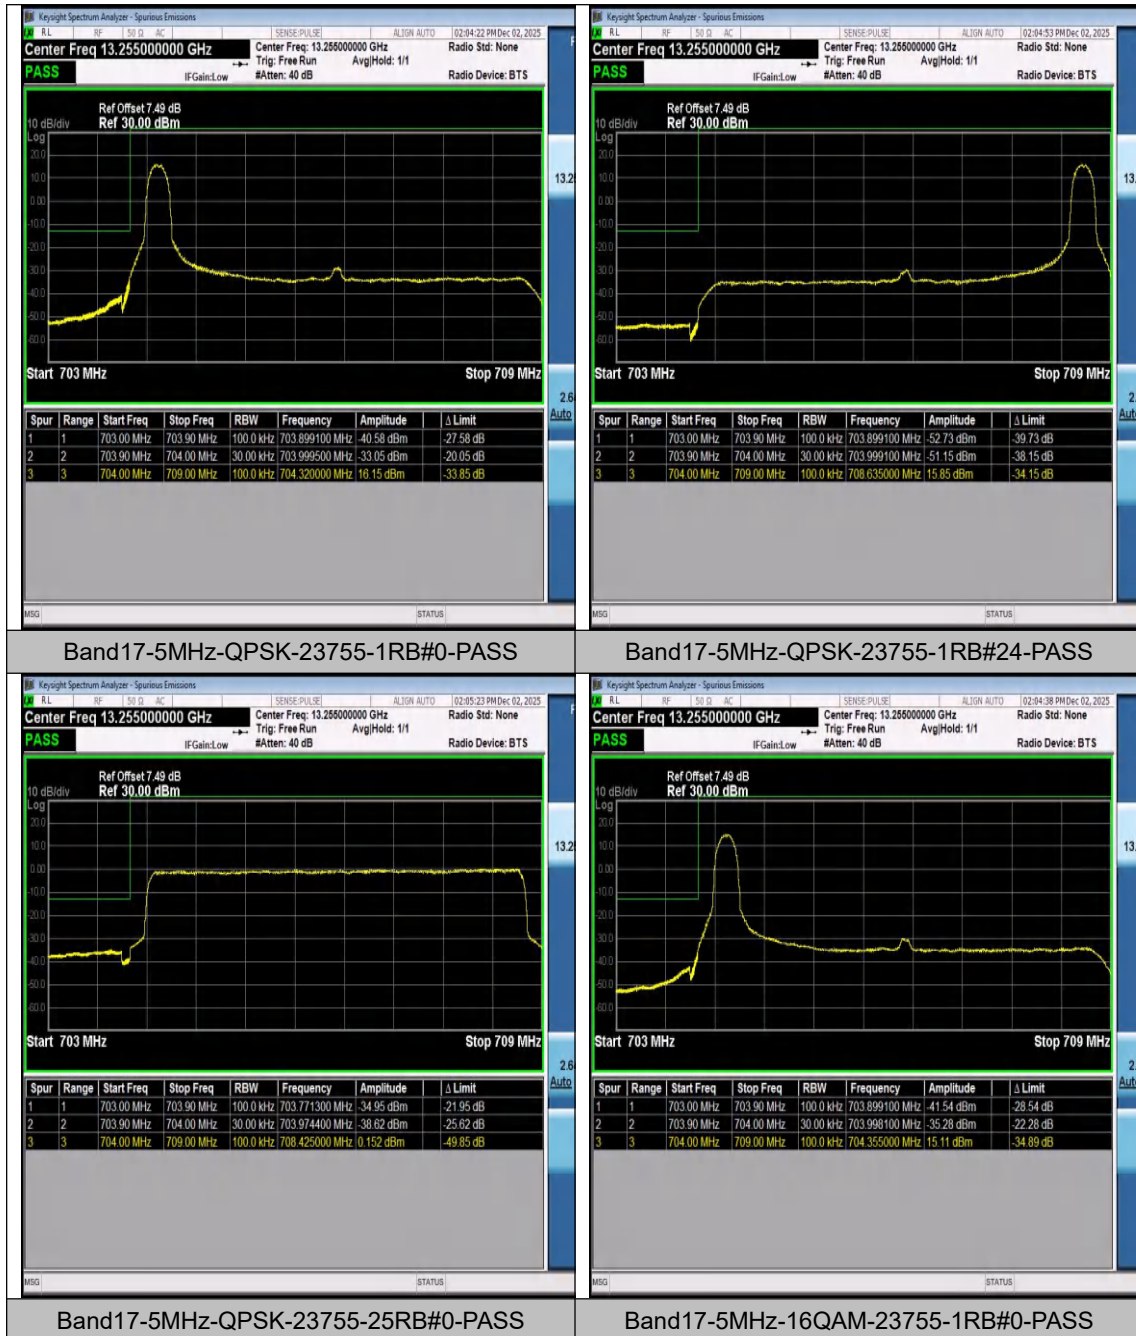



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

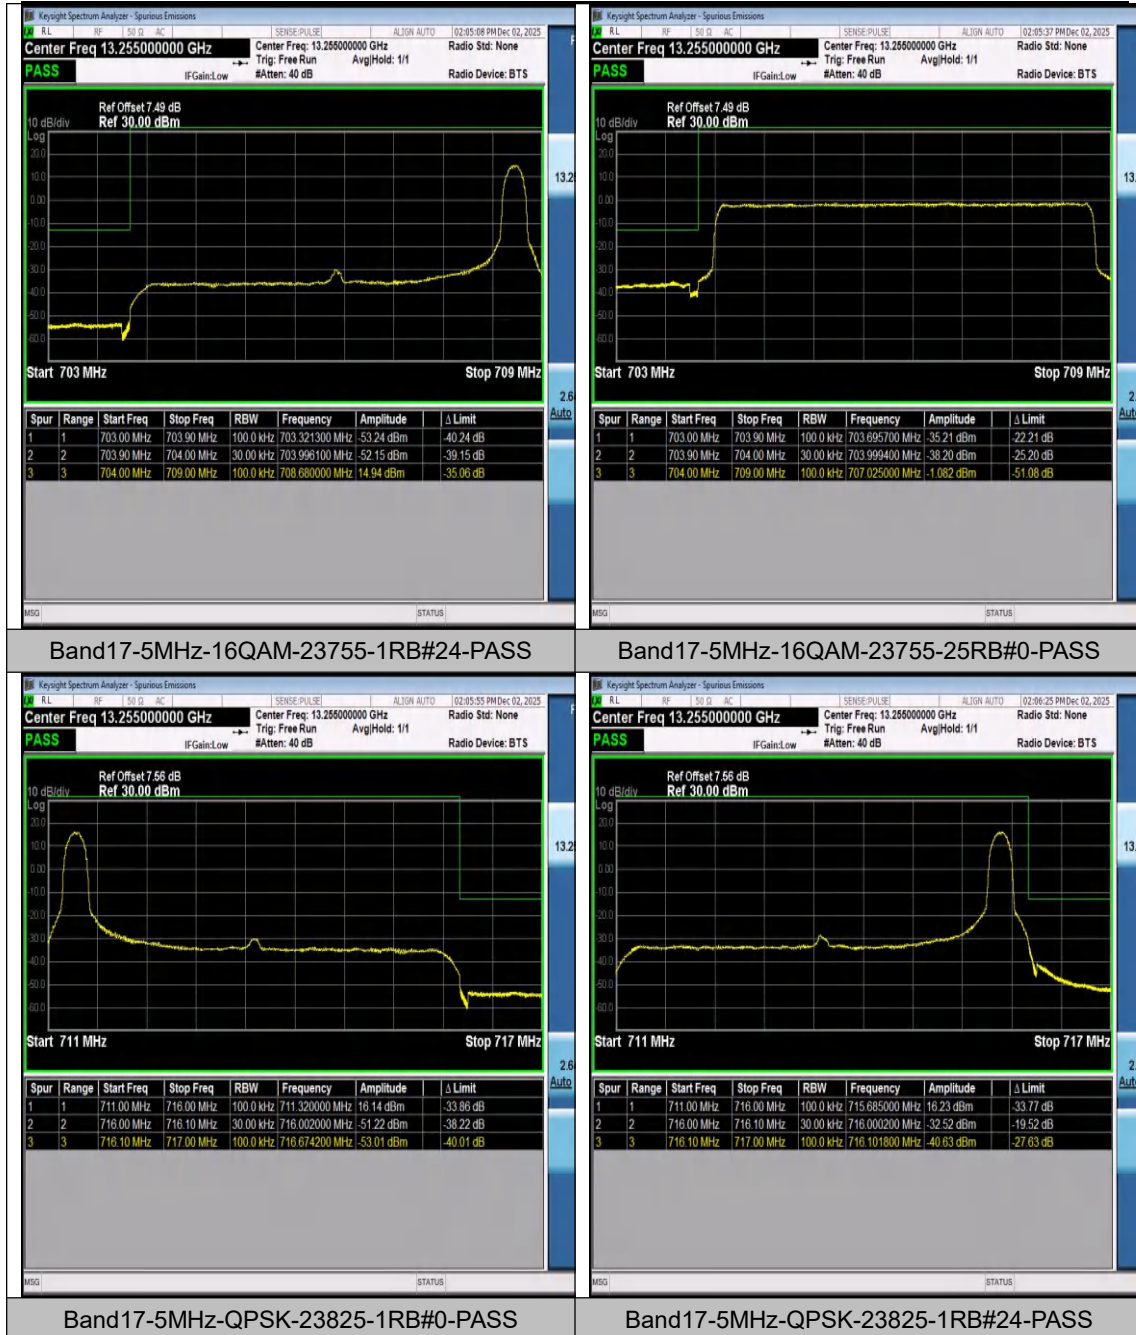

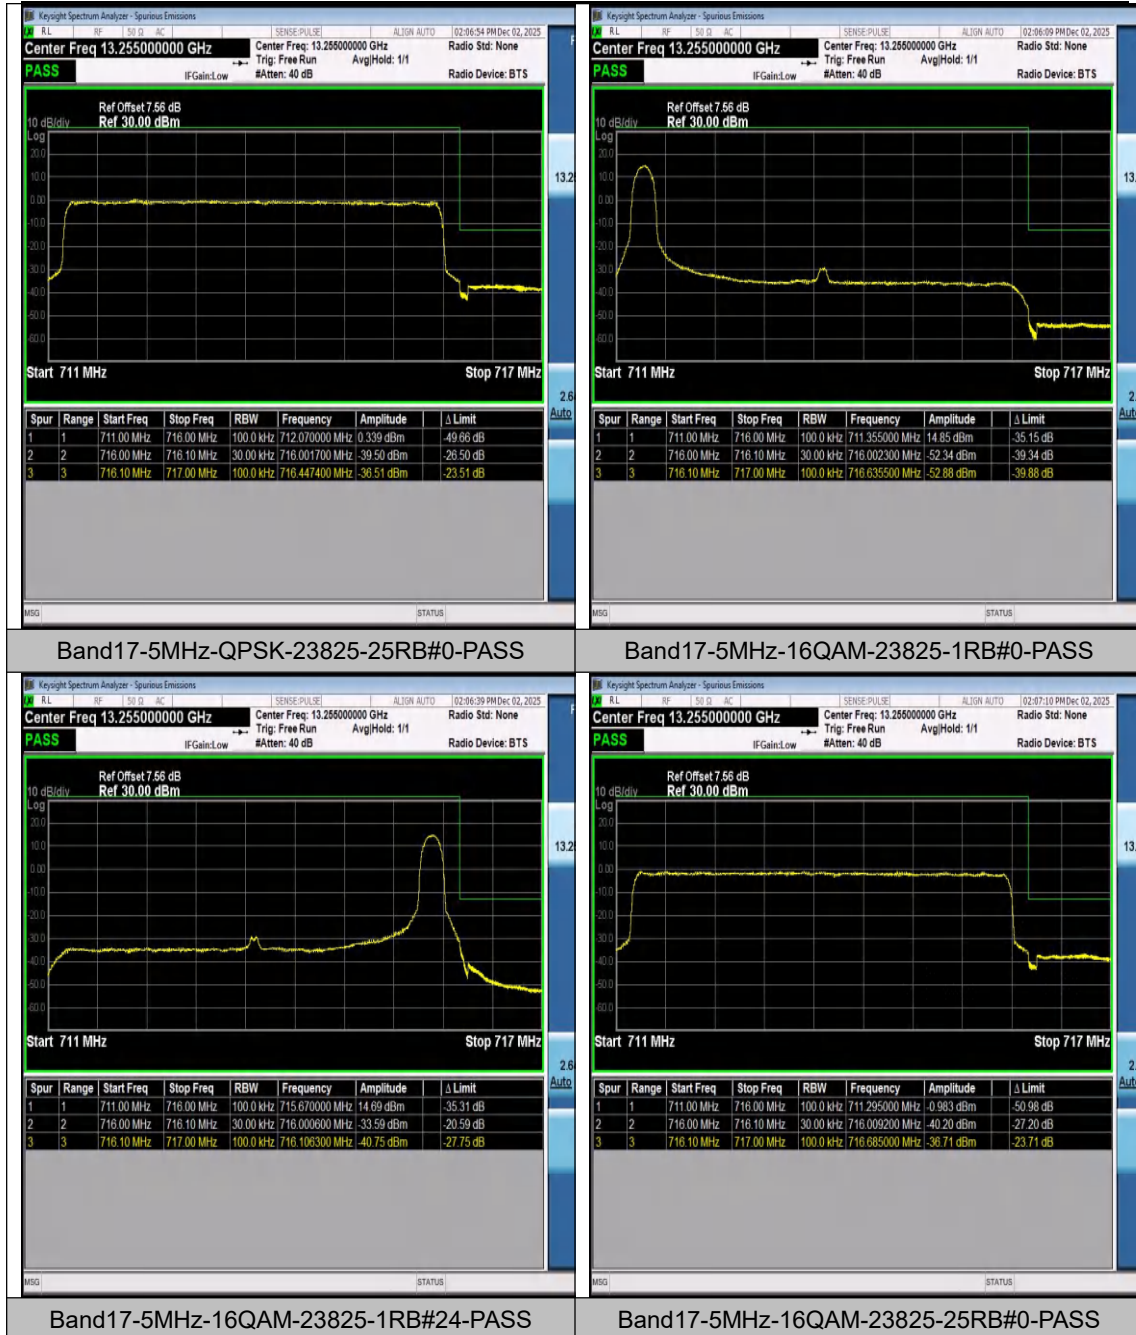


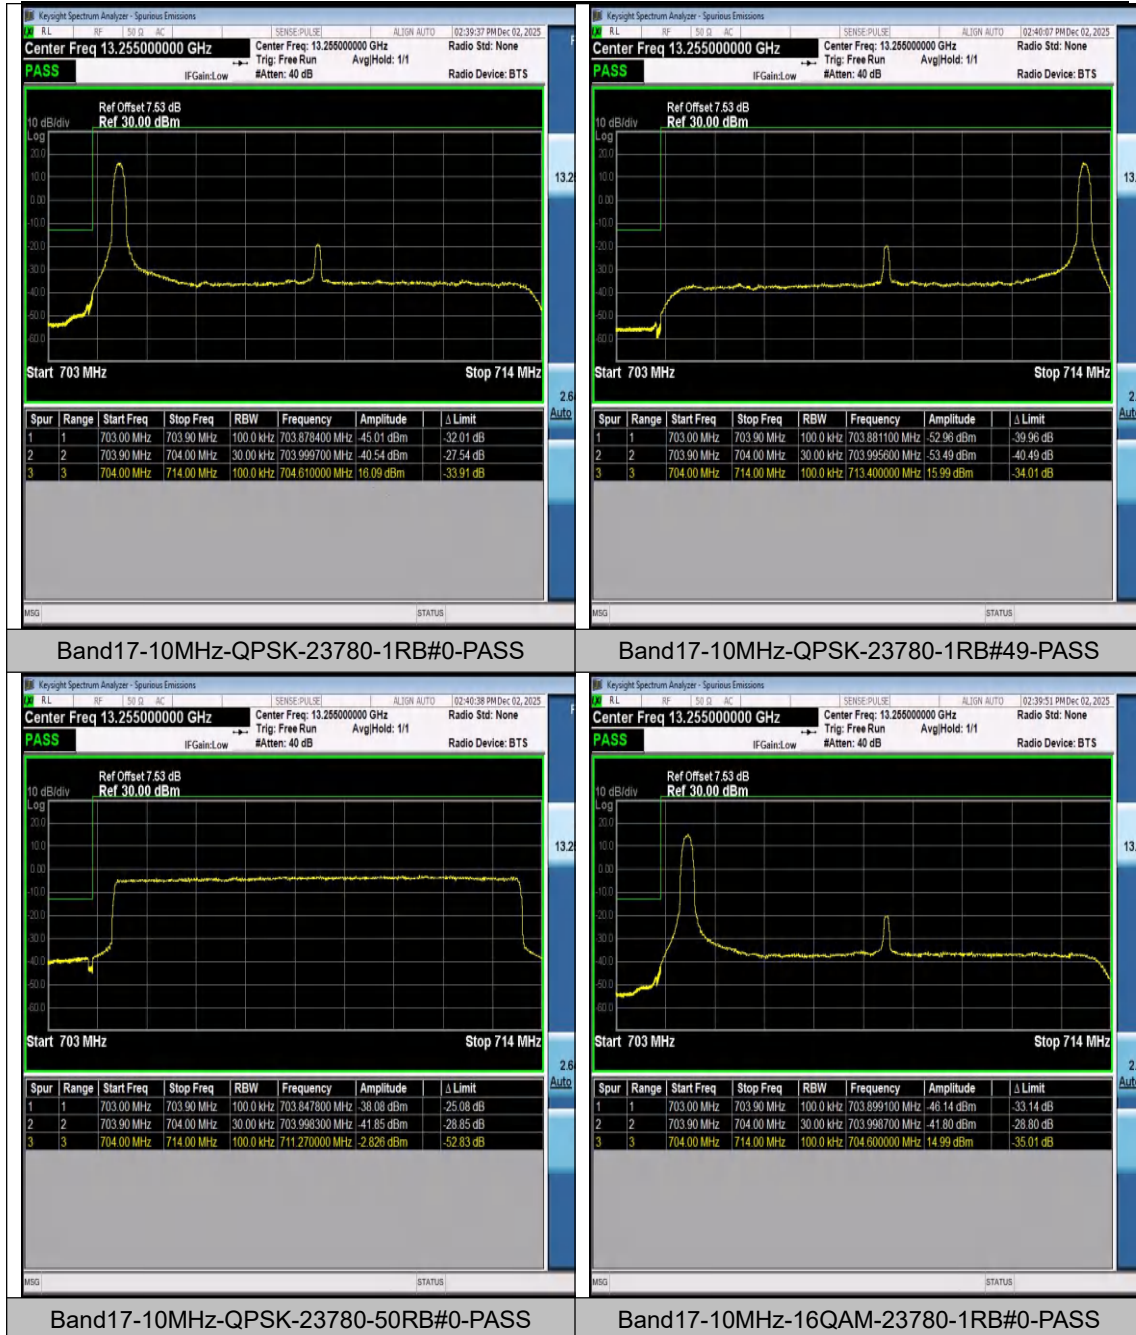


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

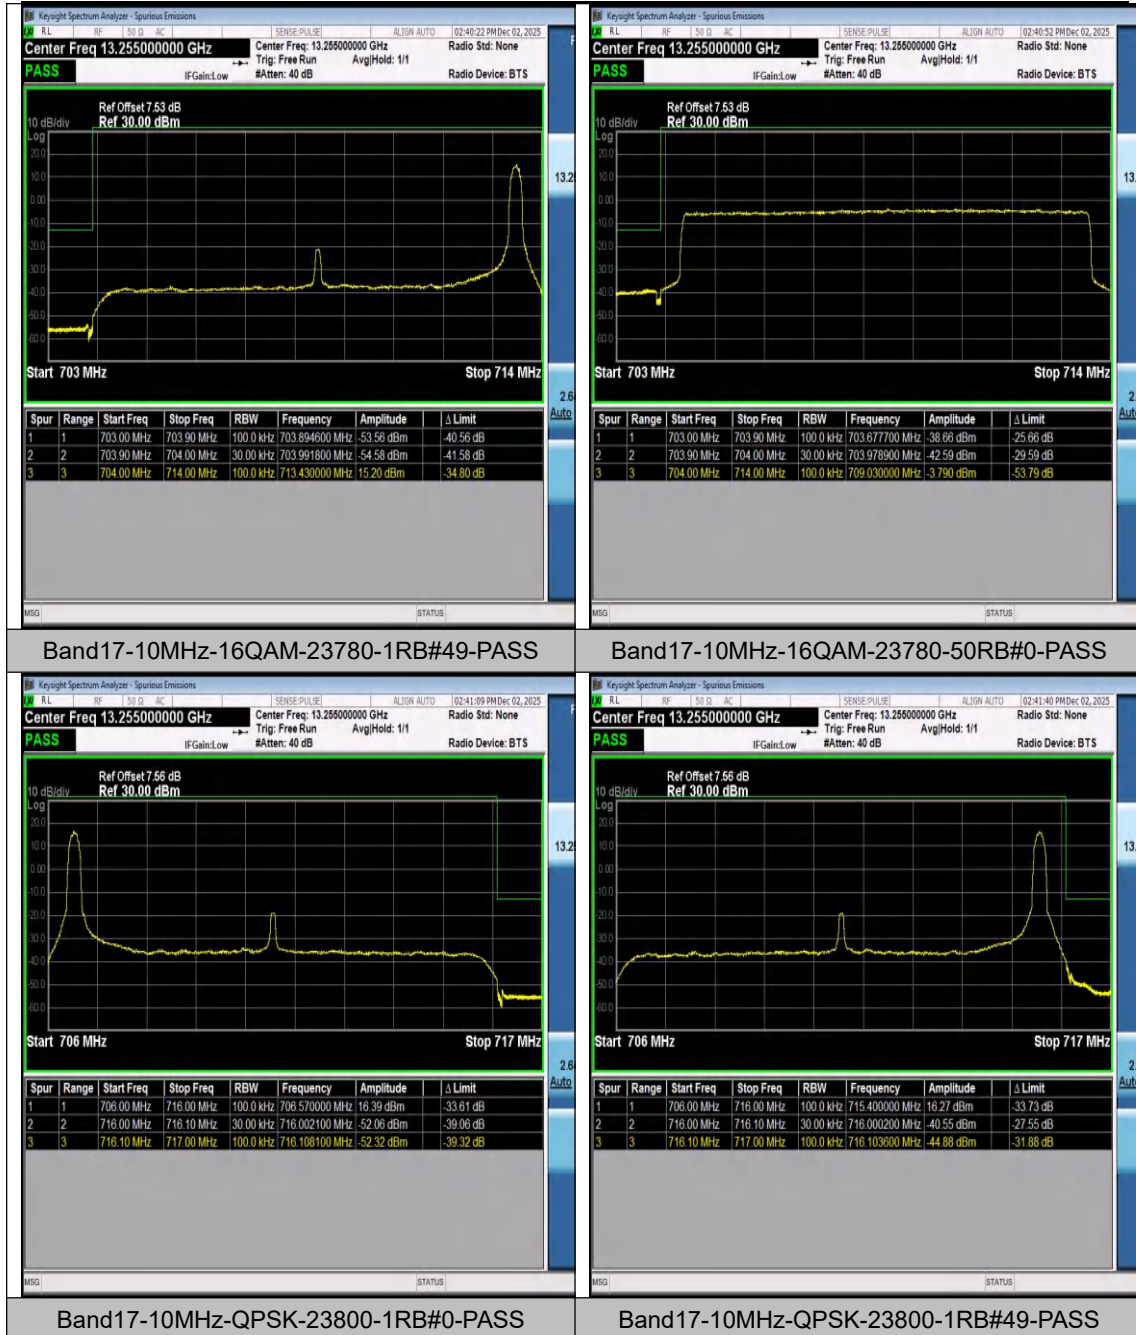

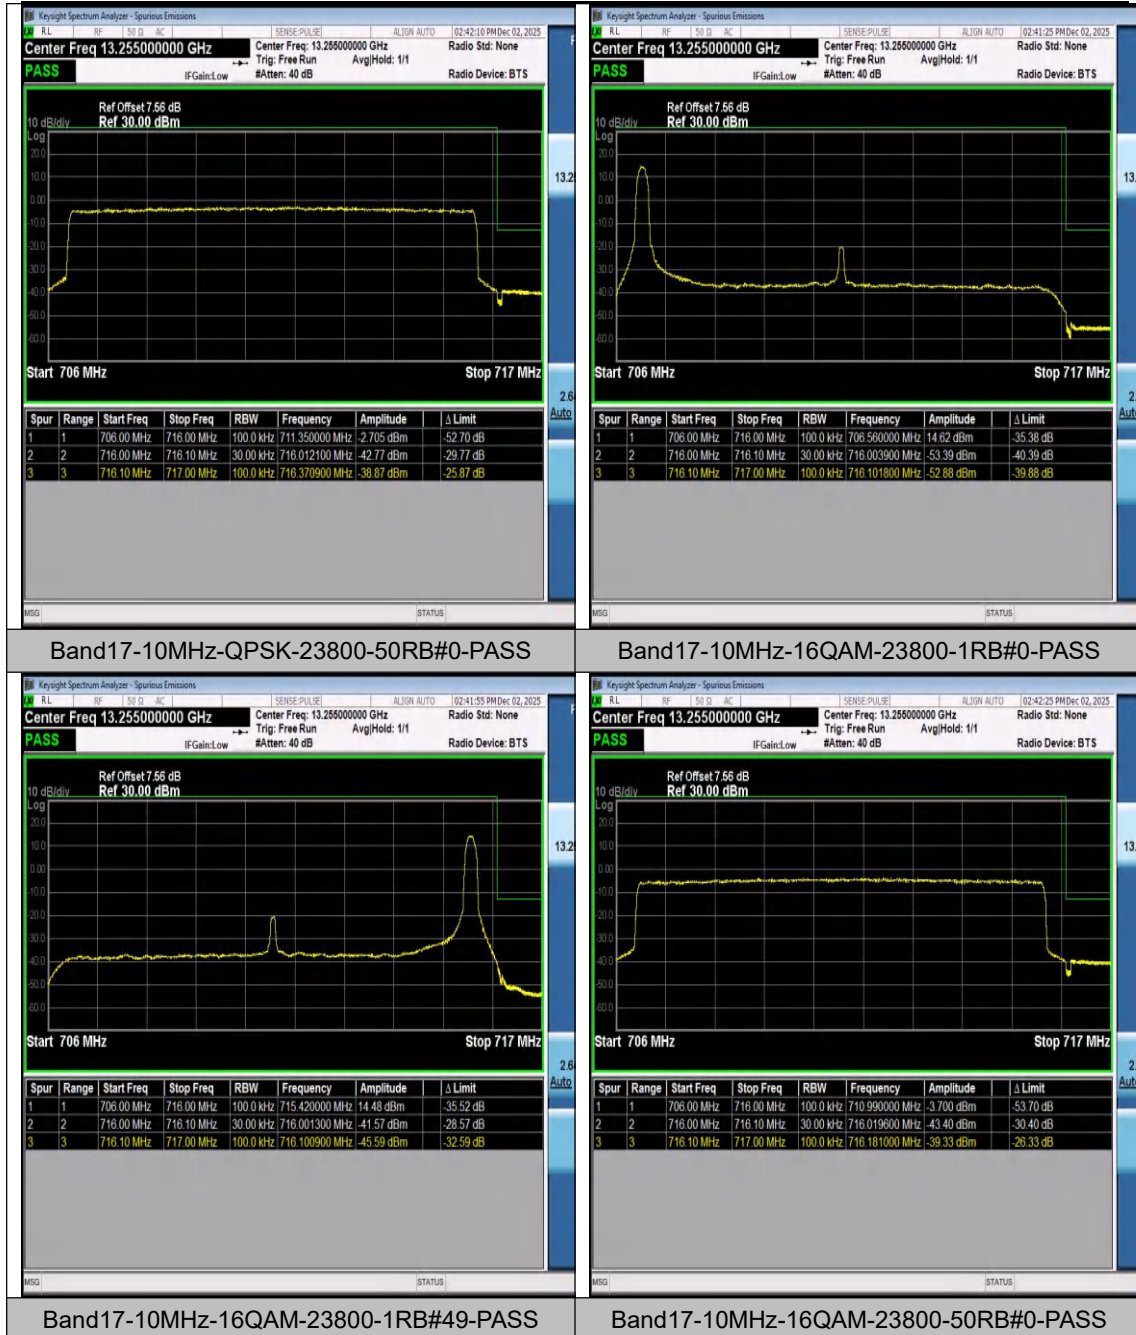

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Limit (dBm)	Verdict
Band17	5MHz	QPSK	23755	1RB#0	0.009~0.15	-46.28	-33.0	PASS
Band17	5MHz	QPSK	23755	1RB#0	0.15~30	-56.29	-23.0	PASS
Band17	5MHz	QPSK	23755	1RB#0	30~1000	-41.59	-13.0	PASS
Band17	5MHz	QPSK	23755	1RB#0	1000~3000	-40.33	-13.0	PASS
Band17	5MHz	QPSK	23755	1RB#0	3000~10000	-43.14	-13.0	PASS
Band17	5MHz	QPSK	23755	1RB#24	0.009~0.15	-47.82	-33.0	PASS
Band17	5MHz	QPSK	23755	1RB#24	0.15~30	-55.24	-23.0	PASS
Band17	5MHz	QPSK	23755	1RB#24	30~1000	-38.07	-13.0	PASS
Band17	5MHz	QPSK	23755	1RB#24	1000~3000	-47.00	-13.0	PASS
Band17	5MHz	QPSK	23755	1RB#24	3000~10000	-43.82	-13.0	PASS
Band17	5MHz	QPSK	23755	25RB#0	0.009~0.15	-48.03	-33.0	PASS
Band17	5MHz	QPSK	23755	25RB#0	0.15~30	-56.96	-23.0	PASS
Band17	5MHz	QPSK	23755	25RB#0	30~1000	-29.64	-13.0	PASS
Band17	5MHz	QPSK	23755	25RB#0	1000~3000	-47.04	-13.0	PASS
Band17	5MHz	QPSK	23755	25RB#0	3000~10000	-43.62	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#0	0.009~0.15	-47.72	-33.0	PASS
Band17	5MHz	16QAM	23755	1RB#0	0.15~30	-55.95	-23.0	PASS
Band17	5MHz	16QAM	23755	1RB#0	30~1000	-40.28	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#0	1000~3000	-45.74	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#0	3000~10000	-43.71	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#24	0.009~0.15	-48.62	-33.0	PASS
Band17	5MHz	16QAM	23755	1RB#24	0.15~30	-53.62	-23.0	PASS
Band17	5MHz	16QAM	23755	1RB#24	30~1000	-39.07	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#24	1000~3000	-47.12	-13.0	PASS
Band17	5MHz	16QAM	23755	1RB#24	3000~10000	-43.95	-13.0	PASS
Band17	5MHz	16QAM	23755	25RB#0	0.009~0.15	-47.71	-33.0	PASS
Band17	5MHz	16QAM	23755	25RB#0	0.15~30	-56.59	-23.0	PASS
Band17	5MHz	16QAM	23755	25RB#0	30~1000	-29.69	-13.0	PASS
Band17	5MHz	16QAM	23755	25RB#0	1000~3000	-40.42	-13.0	PASS
Band17	5MHz	16QAM	23755	25RB#0	3000~10000	-43.77	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#0	0.009~0.15	-47.16	-33.0	PASS
Band17	5MHz	QPSK	23790	1RB#0	0.15~30	-55.46	-23.0	PASS
Band17	5MHz	QPSK	23790	1RB#0	30~1000	-48.80	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#0	1000~3000	-46.71	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#0	3000~10000	-43.25	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#24	0.009~0.15	-47.99	-33.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band17	5MHz	QPSK	23790	1RB#24	0.15~30	-53.93	-23.0	PASS
Band17	5MHz	QPSK	23790	1RB#24	30~1000	-50.47	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#24	1000~3000	-45.34	-13.0	PASS
Band17	5MHz	QPSK	23790	1RB#24	3000~10000	-42.07	-13.0	PASS
Band17	5MHz	QPSK	23790	25RB#0	0.009~0.15	-48.62	-33.0	PASS
Band17	5MHz	QPSK	23790	25RB#0	0.15~30	-56.11	-23.0	PASS
Band17	5MHz	QPSK	23790	25RB#0	30~1000	-39.33	-13.0	PASS
Band17	5MHz	QPSK	23790	25RB#0	1000~3000	-46.94	-13.0	PASS
Band17	5MHz	QPSK	23790	25RB#0	3000~10000	-43.75	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#0	0.009~0.15	-46.88	-33.0	PASS
Band17	5MHz	16QAM	23790	1RB#0	0.15~30	-54.27	-23.0	PASS
Band17	5MHz	16QAM	23790	1RB#0	30~1000	-46.23	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#0	1000~3000	-47.05	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#0	3000~10000	-43.88	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#24	0.009~0.15	-47.91	-33.0	PASS
Band17	5MHz	16QAM	23790	1RB#24	0.15~30	-55.55	-23.0	PASS
Band17	5MHz	16QAM	23790	1RB#24	30~1000	-48.88	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#24	1000~3000	-46.43	-13.0	PASS
Band17	5MHz	16QAM	23790	1RB#24	3000~10000	-43.99	-13.0	PASS
Band17	5MHz	16QAM	23790	25RB#0	0.009~0.15	-48.10	-33.0	PASS
Band17	5MHz	16QAM	23790	25RB#0	0.15~30	-54.53	-23.0	PASS
Band17	5MHz	16QAM	23790	25RB#0	30~1000	-39.01	-13.0	PASS
Band17	5MHz	16QAM	23790	25RB#0	1000~3000	-46.82	-13.0	PASS
Band17	5MHz	16QAM	23790	25RB#0	3000~10000	-43.72	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#0	0.009~0.15	-48.19	-33.0	PASS
Band17	5MHz	QPSK	23825	1RB#0	0.15~30	-53.78	-23.0	PASS
Band17	5MHz	QPSK	23825	1RB#0	30~1000	-38.61	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#0	1000~3000	-40.25	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#0	3000~10000	-43.70	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#24	0.009~0.15	-48.82	-33.0	PASS
Band17	5MHz	QPSK	23825	1RB#24	0.15~30	-52.73	-23.0	PASS
Band17	5MHz	QPSK	23825	1RB#24	30~1000	-43.58	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#24	1000~3000	-41.76	-13.0	PASS
Band17	5MHz	QPSK	23825	1RB#24	3000~10000	-42.94	-13.0	PASS
Band17	5MHz	QPSK	23825	25RB#0	0.009~0.15	-47.72	-33.0	PASS
Band17	5MHz	QPSK	23825	25RB#0	0.15~30	-56.81	-23.0	PASS
Band17	5MHz	QPSK	23825	25RB#0	30~1000	-29.48	-13.0	PASS
Band17	5MHz	QPSK	23825	25RB#0	1000~3000	-47.16	-13.0	PASS
Band17	5MHz	QPSK	23825	25RB#0	3000~10000	-43.83	-13.0	PASS
Band17	5MHz	16QAM	23825	1RB#0	0.009~0.15	-46.15	-33.0	PASS
Band17	5MHz	16QAM	23825	1RB#0	0.15~30	-56.61	-23.0	PASS
Band17	5MHz	16QAM	23825	1RB#0	30~1000	-40.20	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band17	5MHz	16QAM	23825	1RB#0	1000~3000	-41.77	-13.0	PASS
Band17	5MHz	16QAM	23825	1RB#0	3000~10000	-43.52	-13.0	PASS
Band17	5MHz	16QAM	23825	1RB#24	0.009~0.15	-47.75	-33.0	PASS
Band17	5MHz	16QAM	23825	1RB#24	0.15~30	-56.74	-23.0	PASS
Band17	5MHz	16QAM	23825	1RB#24	30~1000	-44.25	-13.0	PASS
Band17	5MHz	16QAM	23825	1RB#24	1000~3000	-47.08	-13.0	PASS
Band17	5MHz	16QAM	23825	1RB#24	3000~10000	-43.02	-13.0	PASS
Band17	5MHz	16QAM	23825	25RB#0	0.009~0.15	-47.07	-33.0	PASS
Band17	5MHz	16QAM	23825	25RB#0	0.15~30	-54.29	-23.0	PASS
Band17	5MHz	16QAM	23825	25RB#0	30~1000	-29.54	-13.0	PASS
Band17	5MHz	16QAM	23825	25RB#0	1000~3000	-45.17	-13.0	PASS
Band17	5MHz	16QAM	23825	25RB#0	3000~10000	-43.78	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#0	0.009~0.15	-47.19	-33.0	PASS
Band17	10MHz	QPSK	23780	1RB#0	0.15~30	-53.45	-23.0	PASS
Band17	10MHz	QPSK	23780	1RB#0	30~1000	-38.93	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#0	1000~3000	-39.34	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#0	3000~10000	-43.51	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#49	0.009~0.15	-47.90	-33.0	PASS
Band17	10MHz	QPSK	23780	1RB#49	0.15~30	-55.47	-23.0	PASS
Band17	10MHz	QPSK	23780	1RB#49	30~1000	-36.76	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#49	1000~3000	-44.77	-13.0	PASS
Band17	10MHz	QPSK	23780	1RB#49	3000~10000	-43.45	-13.0	PASS
Band17	10MHz	QPSK	23780	50RB#0	0.009~0.15	-47.83	-33.0	PASS
Band17	10MHz	QPSK	23780	50RB#0	0.15~30	-54.83	-23.0	PASS
Band17	10MHz	QPSK	23780	50RB#0	30~1000	-30.15	-13.0	PASS
Band17	10MHz	QPSK	23780	50RB#0	1000~3000	-45.44	-13.0	PASS
Band17	10MHz	QPSK	23780	50RB#0	3000~10000	-43.45	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#0	0.009~0.15	-46.72	-33.0	PASS
Band17	10MHz	16QAM	23780	1RB#0	0.15~30	-55.37	-23.0	PASS
Band17	10MHz	16QAM	23780	1RB#0	30~1000	-39.19	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#0	1000~3000	-46.53	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#0	3000~10000	-43.67	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#49	0.009~0.15	-47.90	-33.0	PASS
Band17	10MHz	16QAM	23780	1RB#49	0.15~30	-54.49	-23.0	PASS
Band17	10MHz	16QAM	23780	1RB#49	30~1000	-38.38	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#49	1000~3000	-46.44	-13.0	PASS
Band17	10MHz	16QAM	23780	1RB#49	3000~10000	-43.83	-13.0	PASS
Band17	10MHz	16QAM	23780	50RB#0	0.009~0.15	-47.83	-33.0	PASS
Band17	10MHz	16QAM	23780	50RB#0	0.15~30	-54.81	-23.0	PASS
Band17	10MHz	16QAM	23780	50RB#0	30~1000	-29.91	-13.0	PASS
Band17	10MHz	16QAM	23780	50RB#0	1000~3000	-47.21	-13.0	PASS
Band17	10MHz	16QAM	23780	50RB#0	3000~10000	-43.63	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band17	10MHz	QPSK	23790	1RB#0	0.009~0.15	-46.87	-33.0	PASS
Band17	10MHz	QPSK	23790	1RB#0	0.15~30	-54.50	-23.0	PASS
Band17	10MHz	QPSK	23790	1RB#0	30~1000	-40.13	-13.0	PASS
Band17	10MHz	QPSK	23790	1RB#0	1000~3000	-46.55	-13.0	PASS
Band17	10MHz	QPSK	23790	1RB#0	3000~10000	-43.94	-13.0	PASS
Band17	10MHz	QPSK	23790	1RB#49	0.009~0.15	-47.68	-33.0	PASS
Band17	10MHz	QPSK	23790	1RB#49	0.15~30	-55.86	-23.0	PASS
Band17	10MHz	QPSK	23790	1RB#49	30~1000	-37.43	-13.0	PASS
Band17	10MHz	QPSK	23790	1RB#49	1000~3000	-44.82	-13.0	PASS
Band17	10MHz	QPSK	23790	1RB#49	3000~10000	-43.93	-13.0	PASS
Band17	10MHz	QPSK	23790	50RB#0	0.009~0.15	-47.33	-33.0	PASS
Band17	10MHz	QPSK	23790	50RB#0	0.15~30	-55.67	-23.0	PASS
Band17	10MHz	QPSK	23790	50RB#0	30~1000	-32.01	-13.0	PASS
Band17	10MHz	QPSK	23790	50RB#0	1000~3000	-45.51	-13.0	PASS
Band17	10MHz	QPSK	23790	50RB#0	3000~10000	-43.80	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#0	0.009~0.15	-47.82	-33.0	PASS
Band17	10MHz	16QAM	23790	1RB#0	0.15~30	-57.31	-23.0	PASS
Band17	10MHz	16QAM	23790	1RB#0	30~1000	-40.21	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#0	1000~3000	-46.87	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#0	3000~10000	-43.53	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#49	0.009~0.15	-47.40	-33.0	PASS
Band17	10MHz	16QAM	23790	1RB#49	0.15~30	-54.06	-23.0	PASS
Band17	10MHz	16QAM	23790	1RB#49	30~1000	-38.29	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#49	1000~3000	-47.00	-13.0	PASS
Band17	10MHz	16QAM	23790	1RB#49	3000~10000	-43.85	-13.0	PASS
Band17	10MHz	16QAM	23790	50RB#0	0.009~0.15	-47.49	-33.0	PASS
Band17	10MHz	16QAM	23790	50RB#0	0.15~30	-54.95	-23.0	PASS
Band17	10MHz	16QAM	23790	50RB#0	30~1000	-32.28	-13.0	PASS
Band17	10MHz	16QAM	23790	50RB#0	1000~3000	-43.11	-13.0	PASS
Band17	10MHz	16QAM	23790	50RB#0	3000~10000	-43.69	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#0	0.009~0.15	-47.92	-33.0	PASS
Band17	10MHz	QPSK	23800	1RB#0	0.15~30	-55.65	-23.0	PASS
Band17	10MHz	QPSK	23800	1RB#0	30~1000	-42.63	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#0	1000~3000	-46.87	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#0	3000~10000	-43.60	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#49	0.009~0.15	-47.90	-33.0	PASS
Band17	10MHz	QPSK	23800	1RB#49	0.15~30	-53.92	-23.0	PASS
Band17	10MHz	QPSK	23800	1RB#49	30~1000	-37.72	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#49	1000~3000	-44.90	-13.0	PASS
Band17	10MHz	QPSK	23800	1RB#49	3000~10000	-43.57	-13.0	PASS
Band17	10MHz	QPSK	23800	50RB#0	0.009~0.15	-44.43	-33.0	PASS
Band17	10MHz	QPSK	23800	50RB#0	0.15~30	-53.83	-23.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band17	10MHz	QPSK	23800	50RB#0	30~1000	-32.24	-13.0	PASS
Band17	10MHz	QPSK	23800	50RB#0	1000~3000	-40.20	-13.0	PASS
Band17	10MHz	QPSK	23800	50RB#0	3000~10000	-43.80	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#0	0.009~0.15	-46.34	-33.0	PASS
Band17	10MHz	16QAM	23800	1RB#0	0.15~30	-53.13	-23.0	PASS
Band17	10MHz	16QAM	23800	1RB#0	30~1000	-42.29	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#0	1000~3000	-47.00	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#0	3000~10000	-43.73	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#49	0.009~0.15	-47.30	-33.0	PASS
Band17	10MHz	16QAM	23800	1RB#49	0.15~30	-54.13	-23.0	PASS
Band17	10MHz	16QAM	23800	1RB#49	30~1000	-37.78	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#49	1000~3000	-43.53	-13.0	PASS
Band17	10MHz	16QAM	23800	1RB#49	3000~10000	-43.50	-13.0	PASS
Band17	10MHz	16QAM	23800	50RB#0	0.009~0.15	-49.06	-33.0	PASS
Band17	10MHz	16QAM	23800	50RB#0	0.15~30	-54.96	-23.0	PASS
Band17	10MHz	16QAM	23800	50RB#0	30~1000	-30.79	-13.0	PASS
Band17	10MHz	16QAM	23800	50RB#0	1000~3000	-47.01	-13.0	PASS
Band17	10MHz	16QAM	23800	50RB#0	3000~10000	-43.81	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

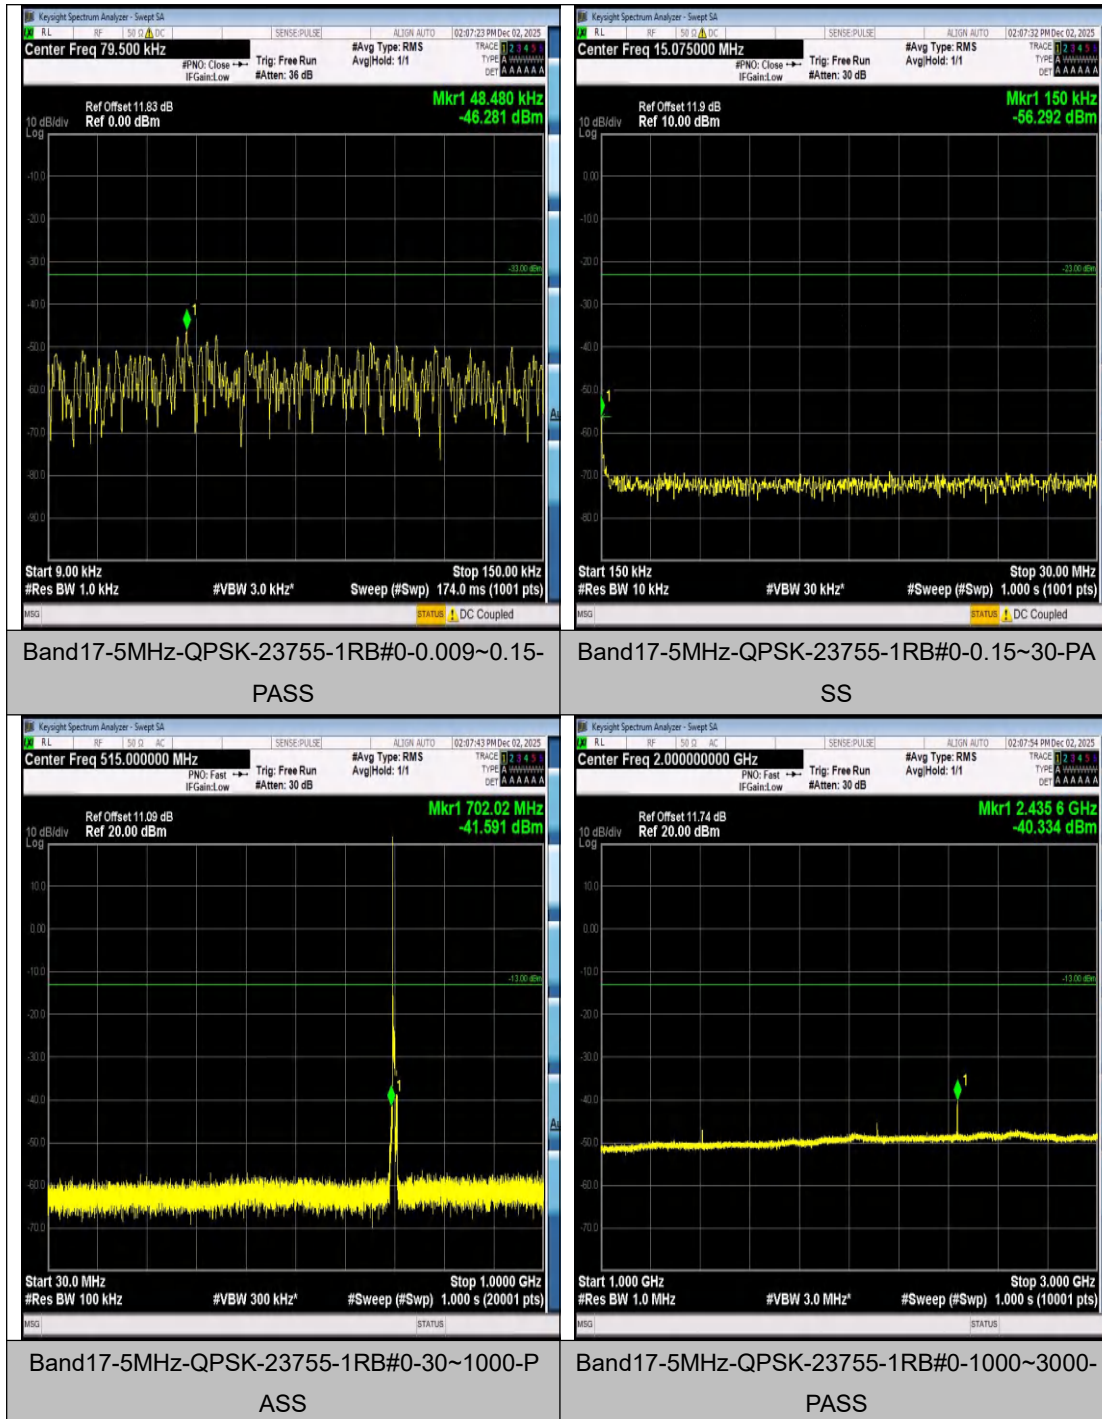

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

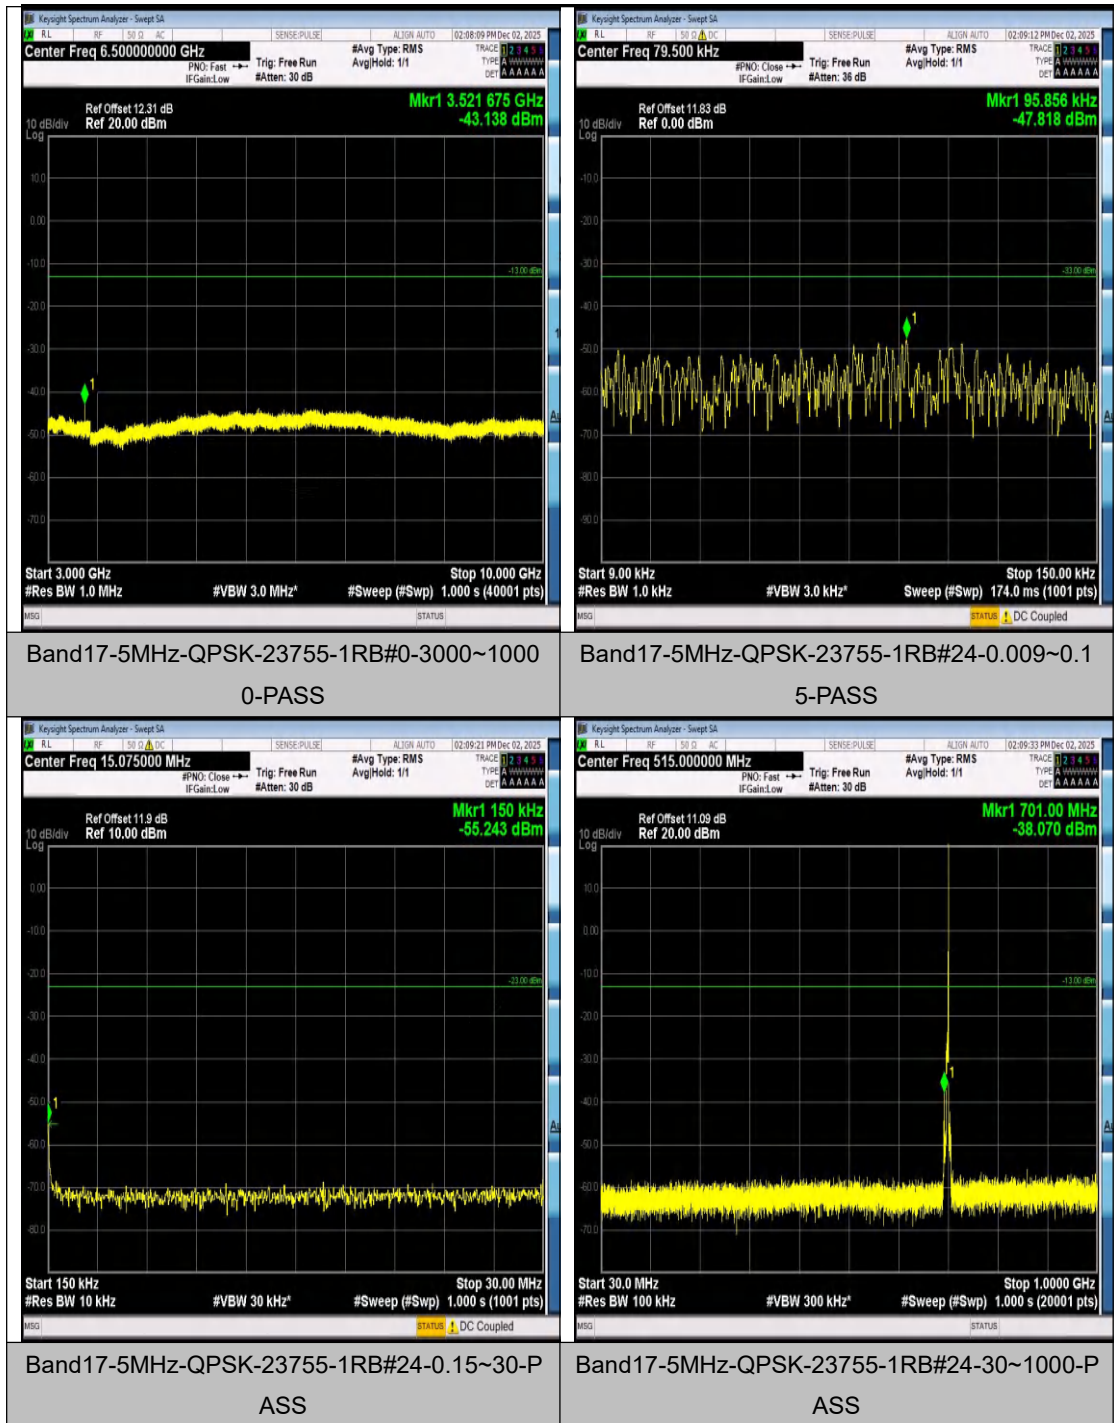

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

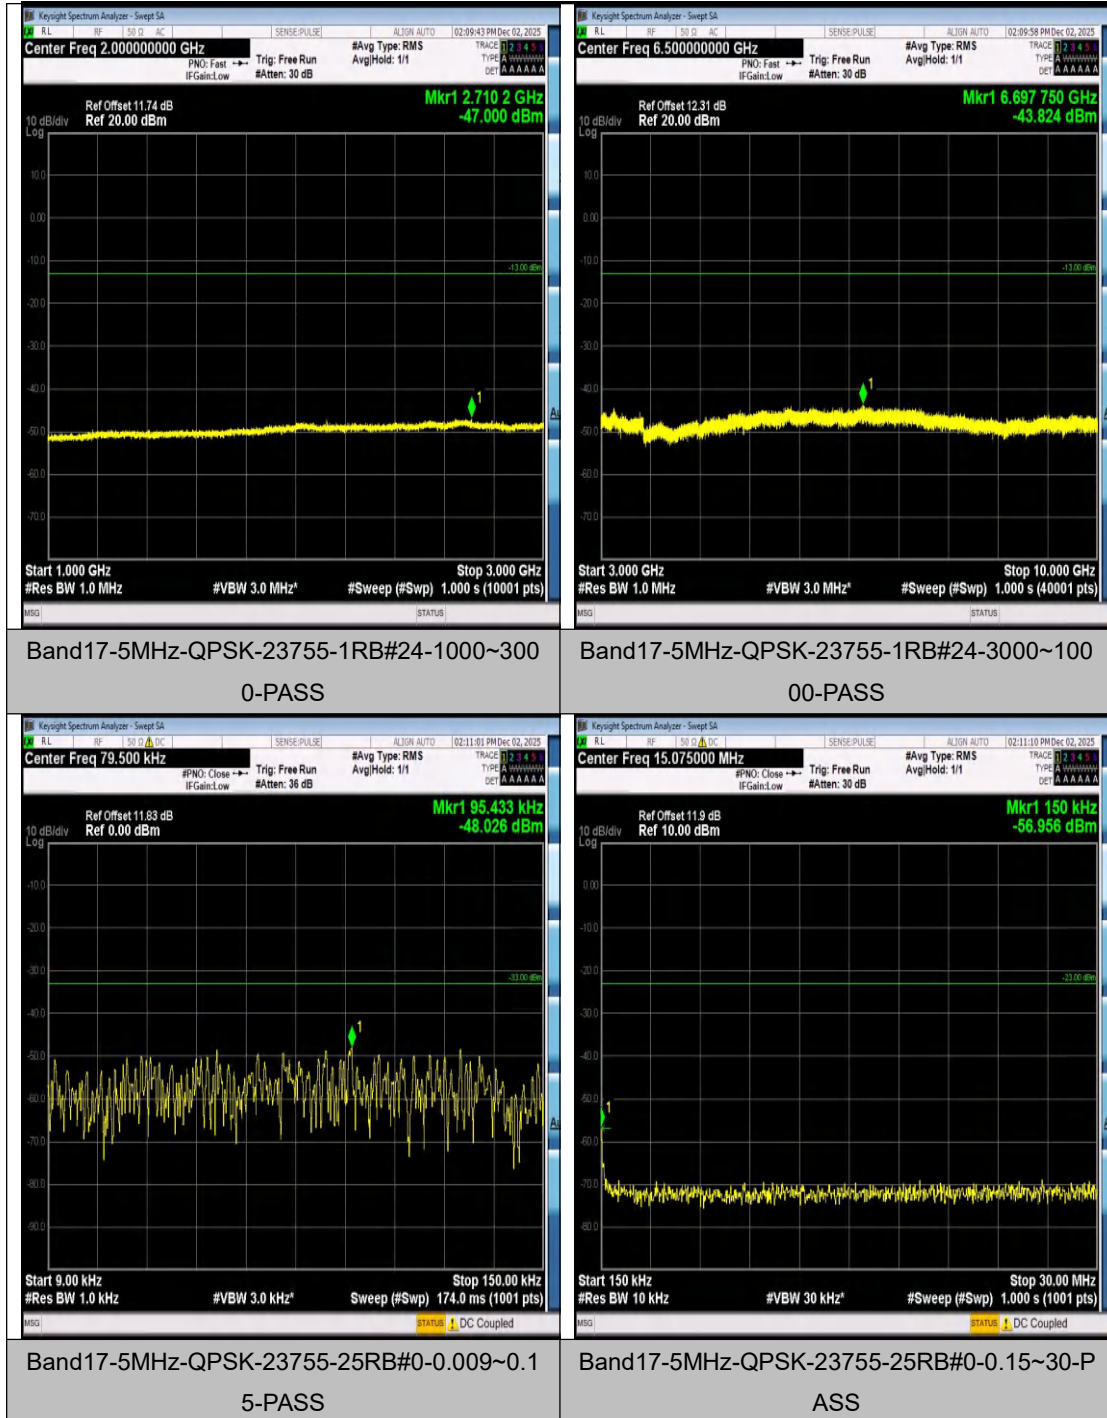

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

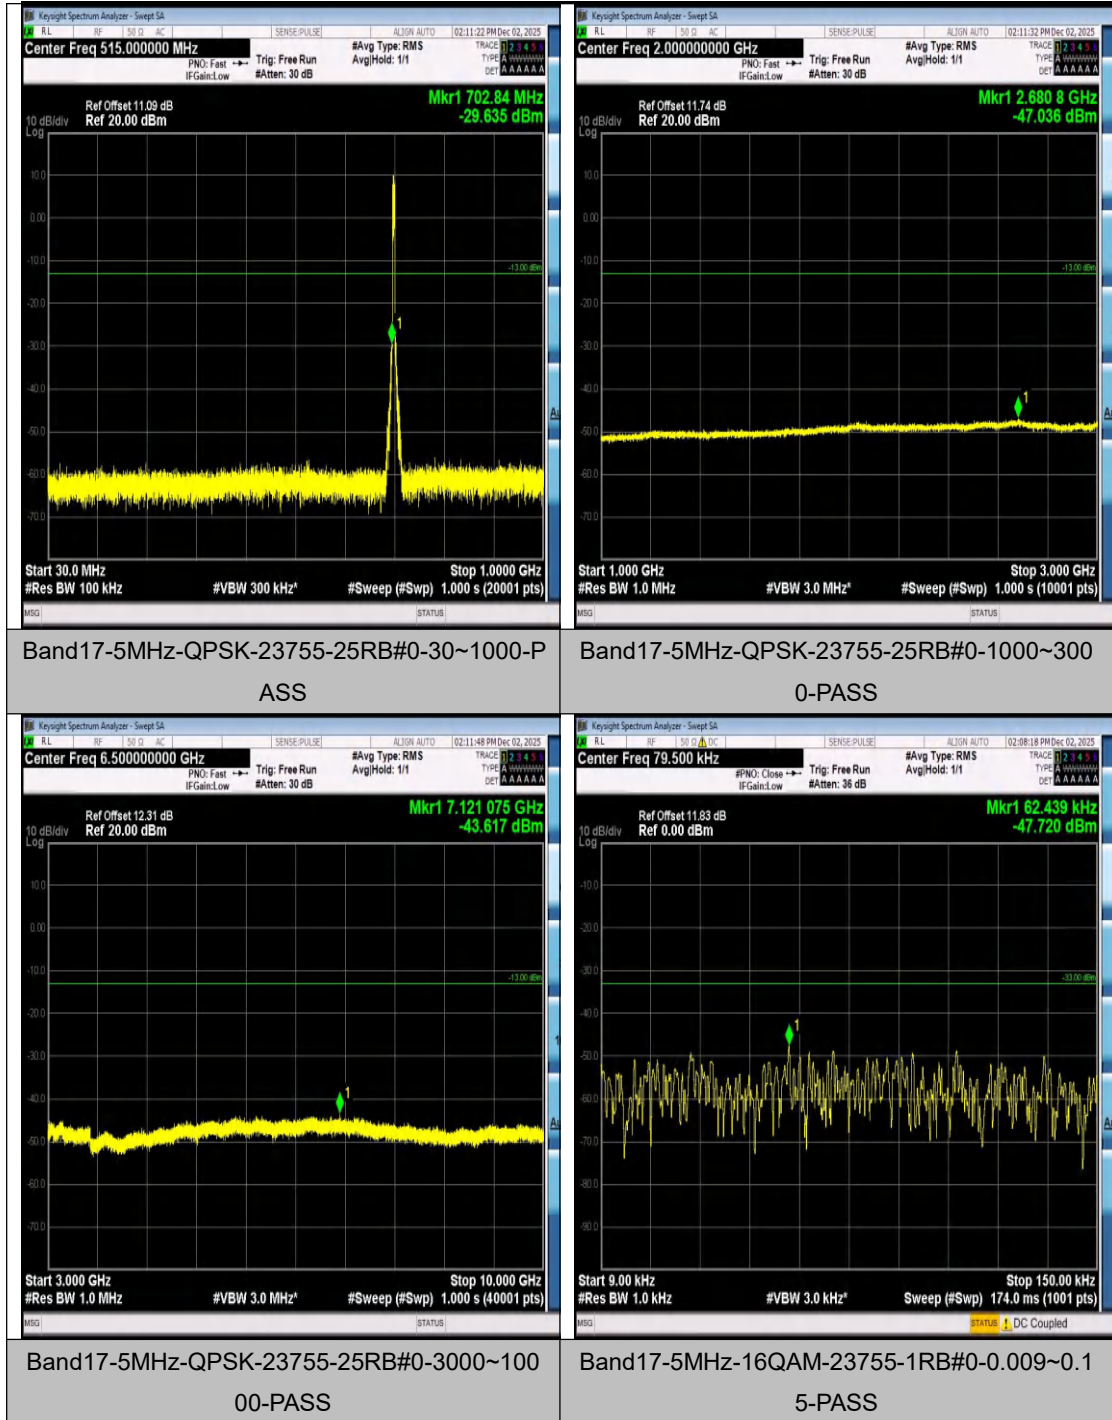

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

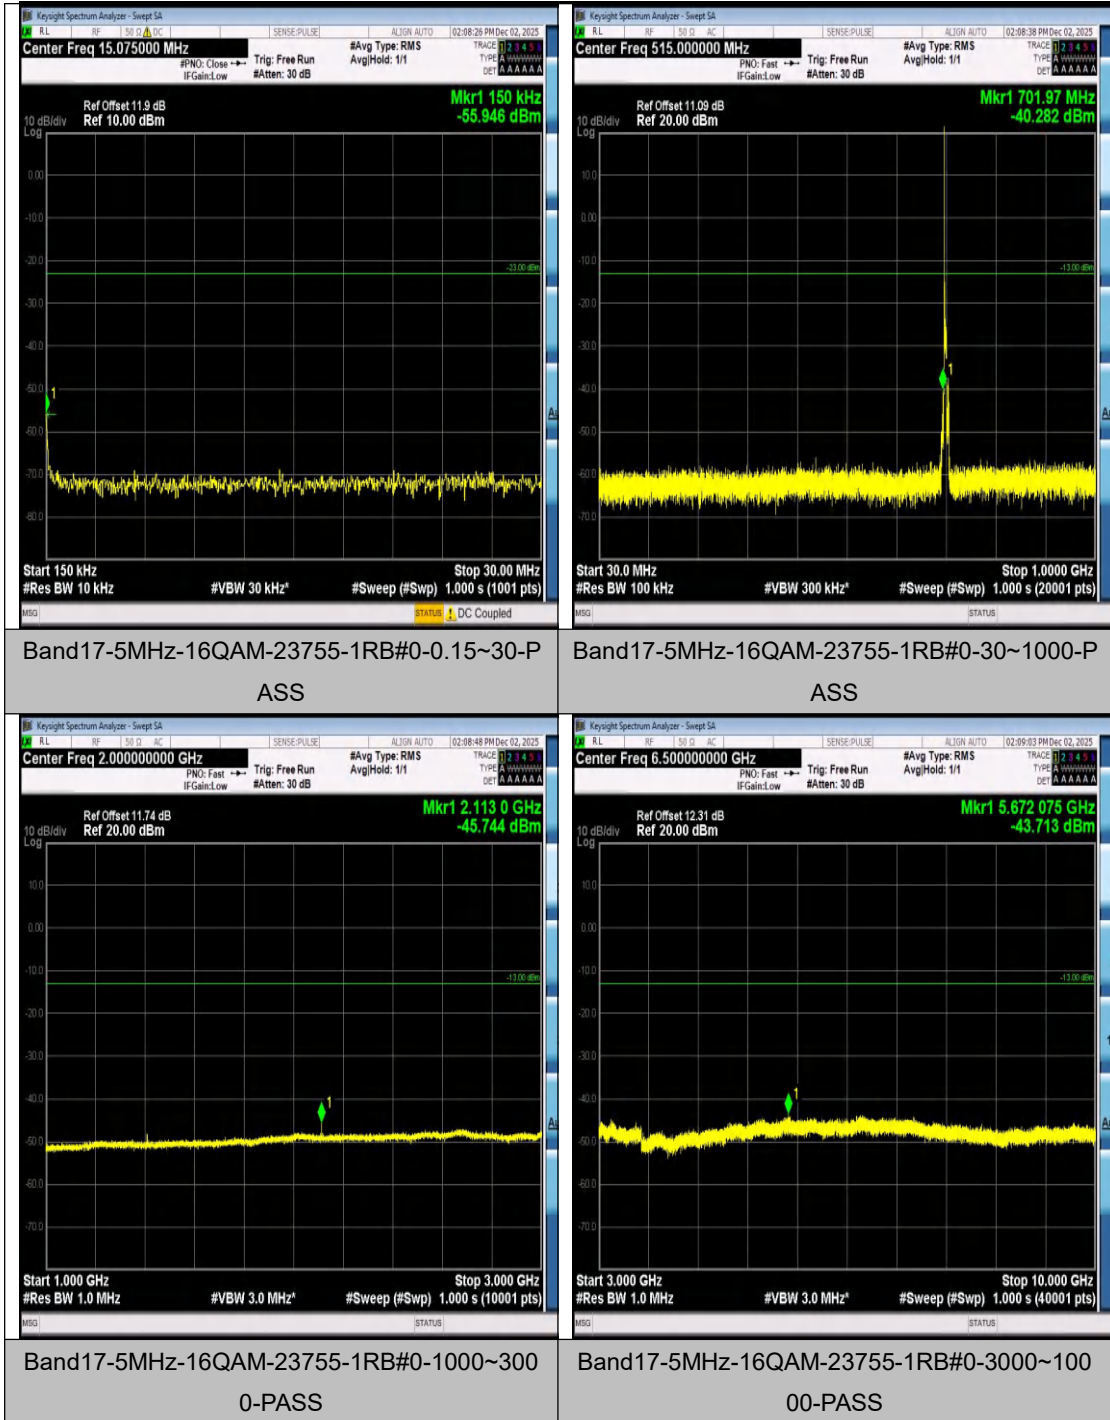

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

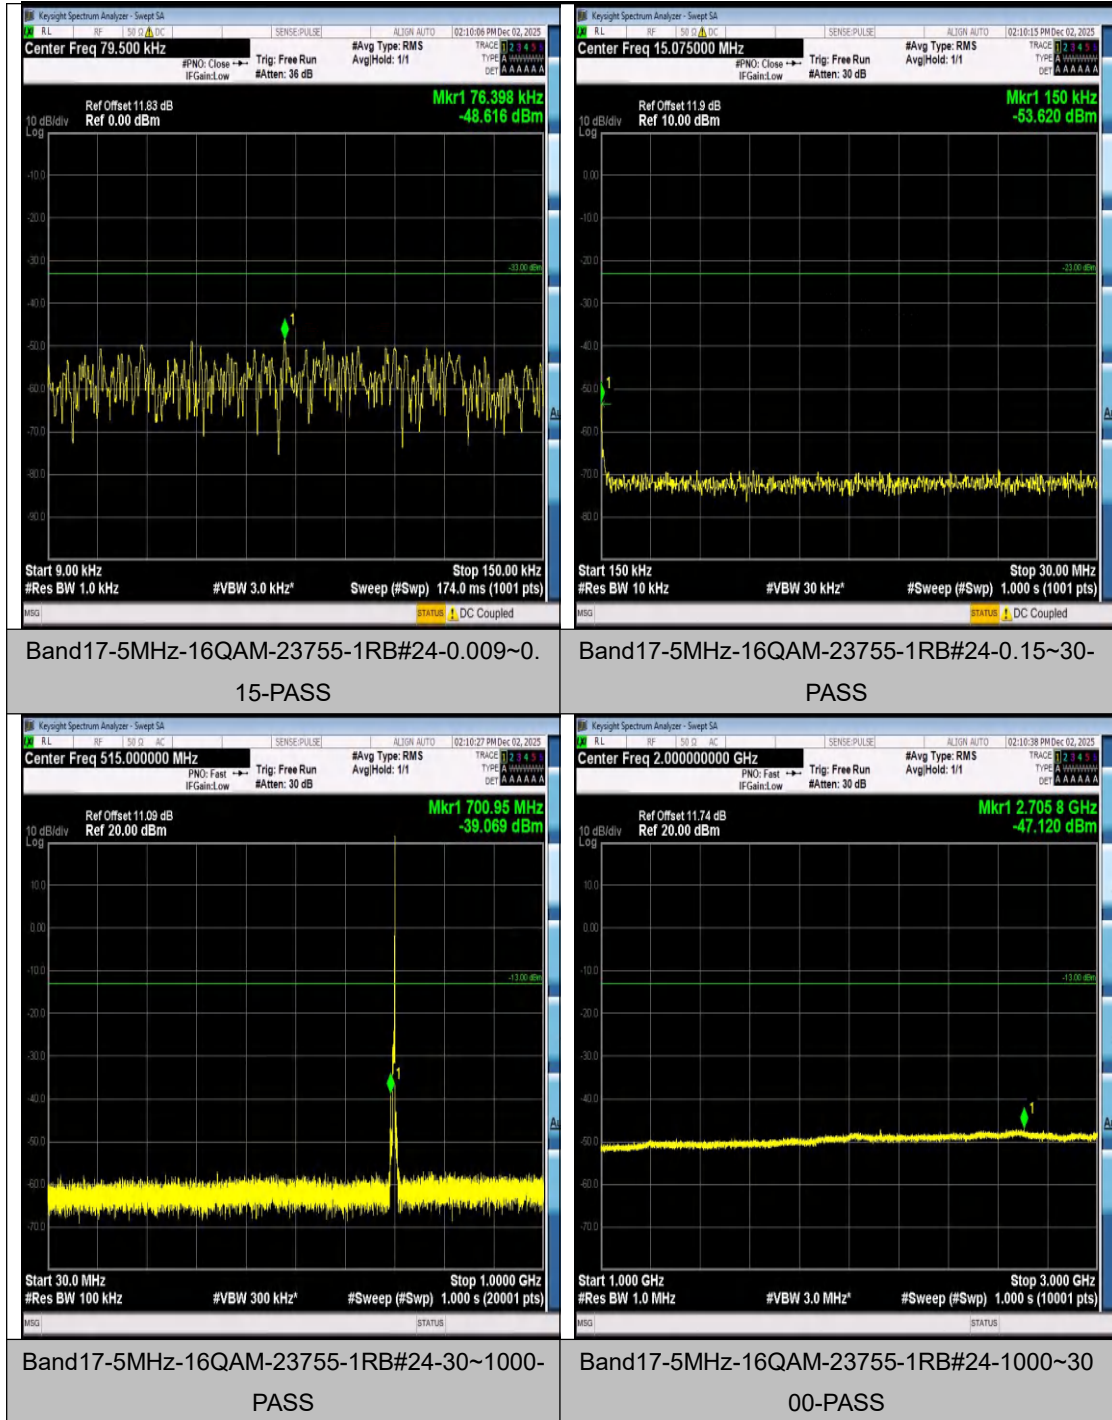

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

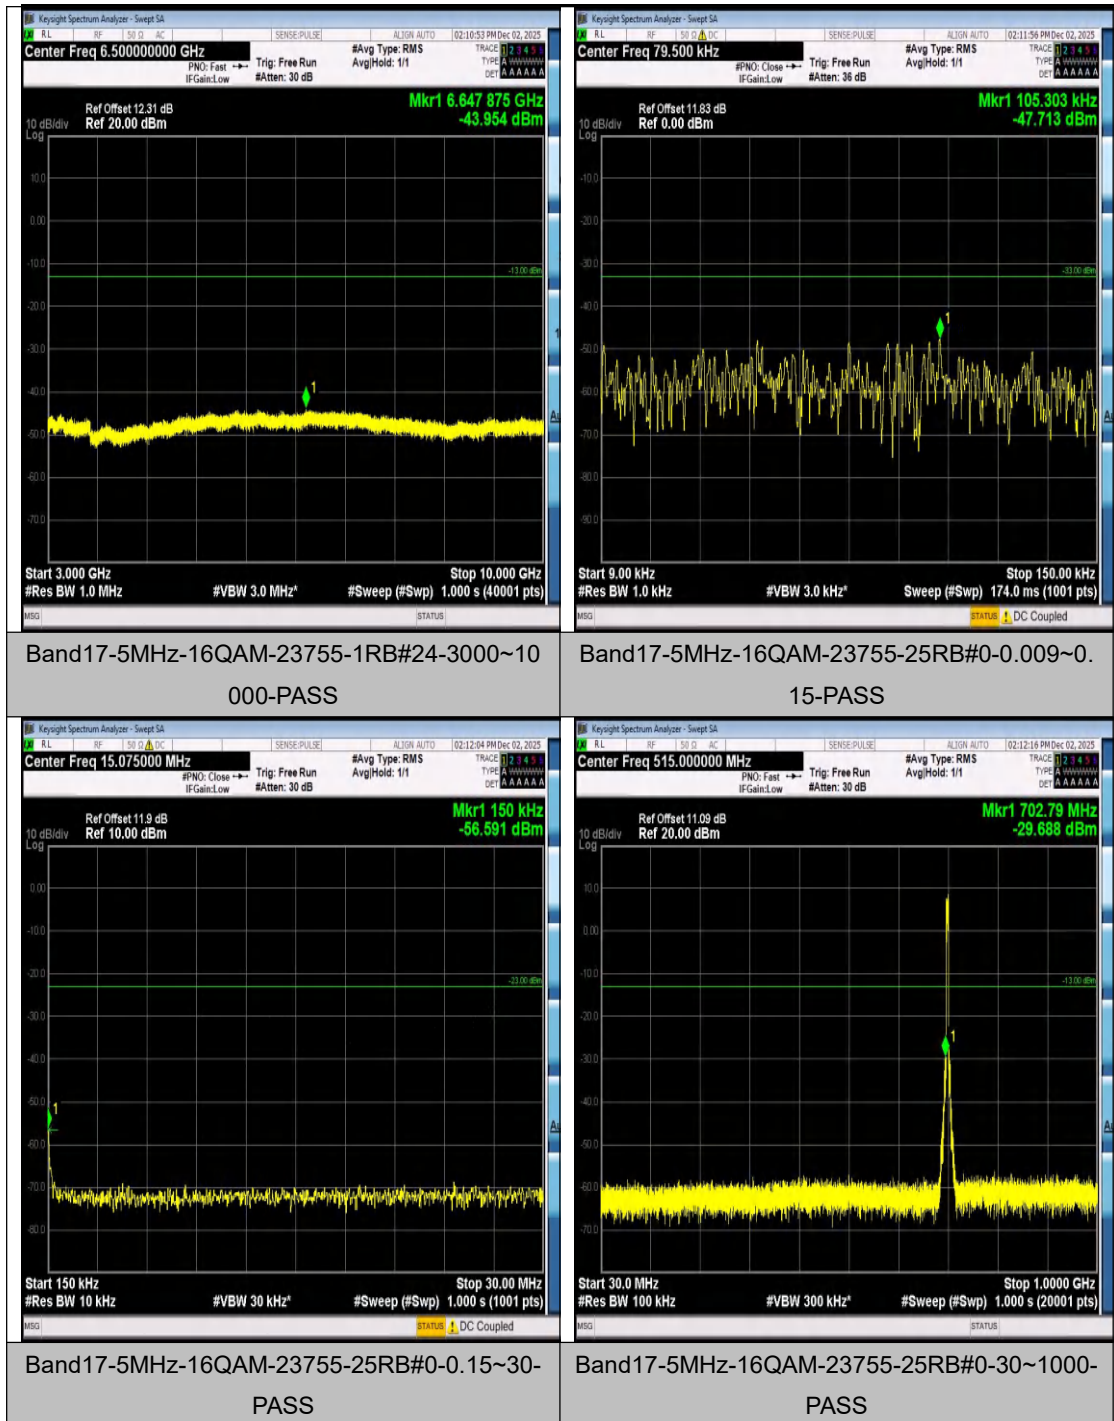

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

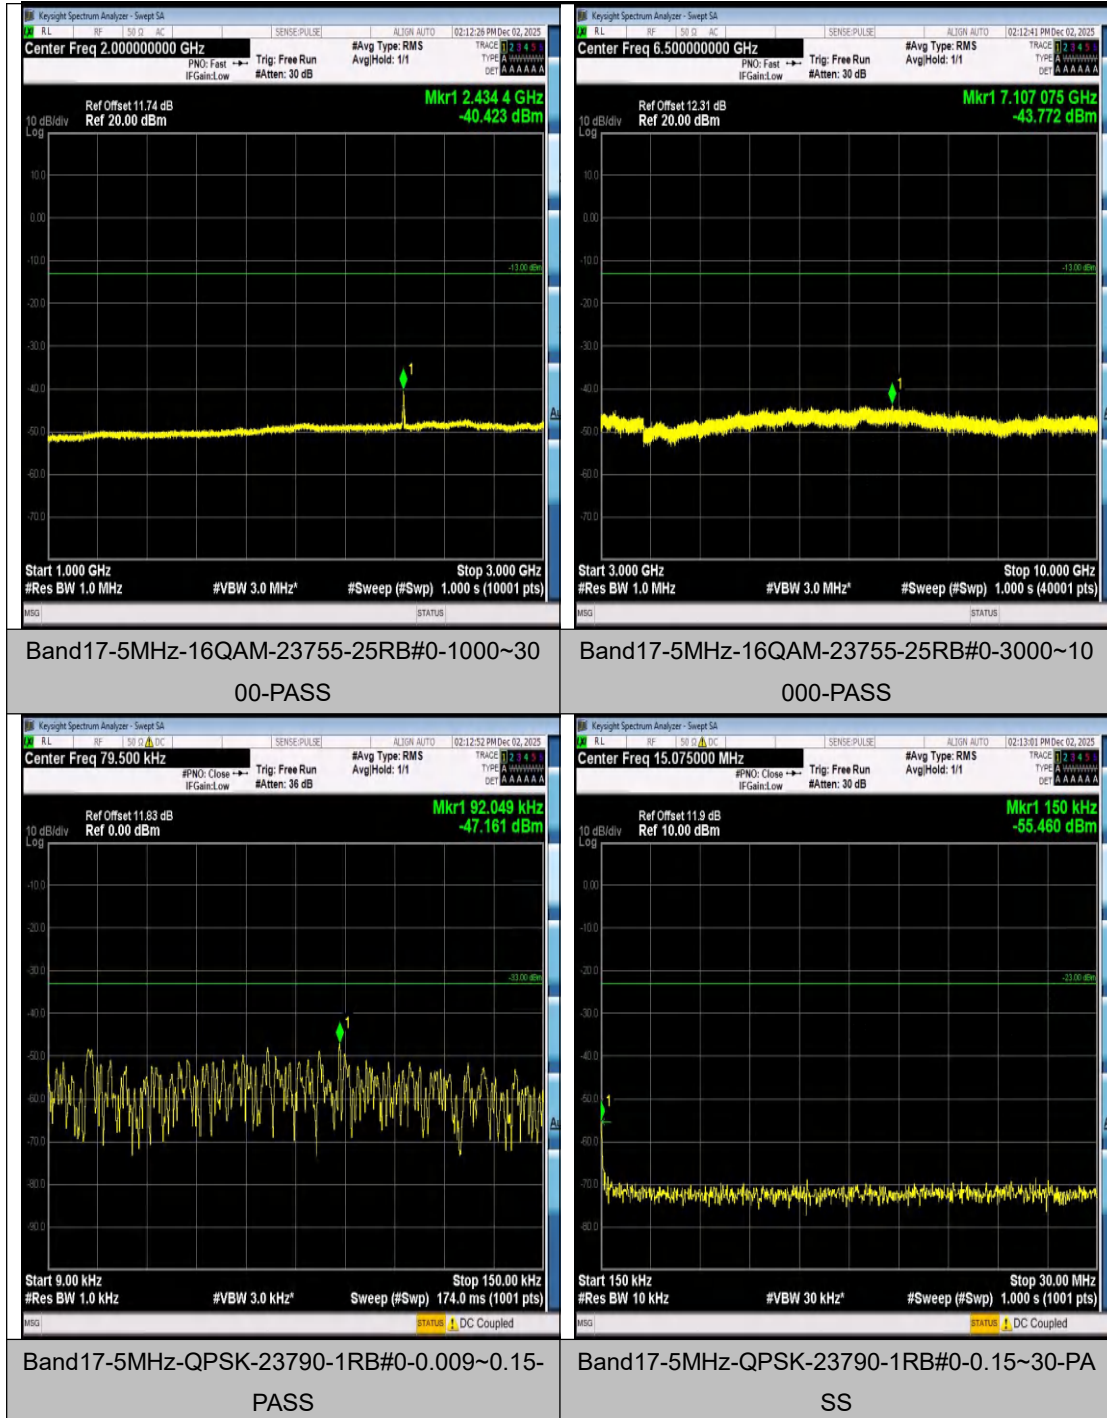

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

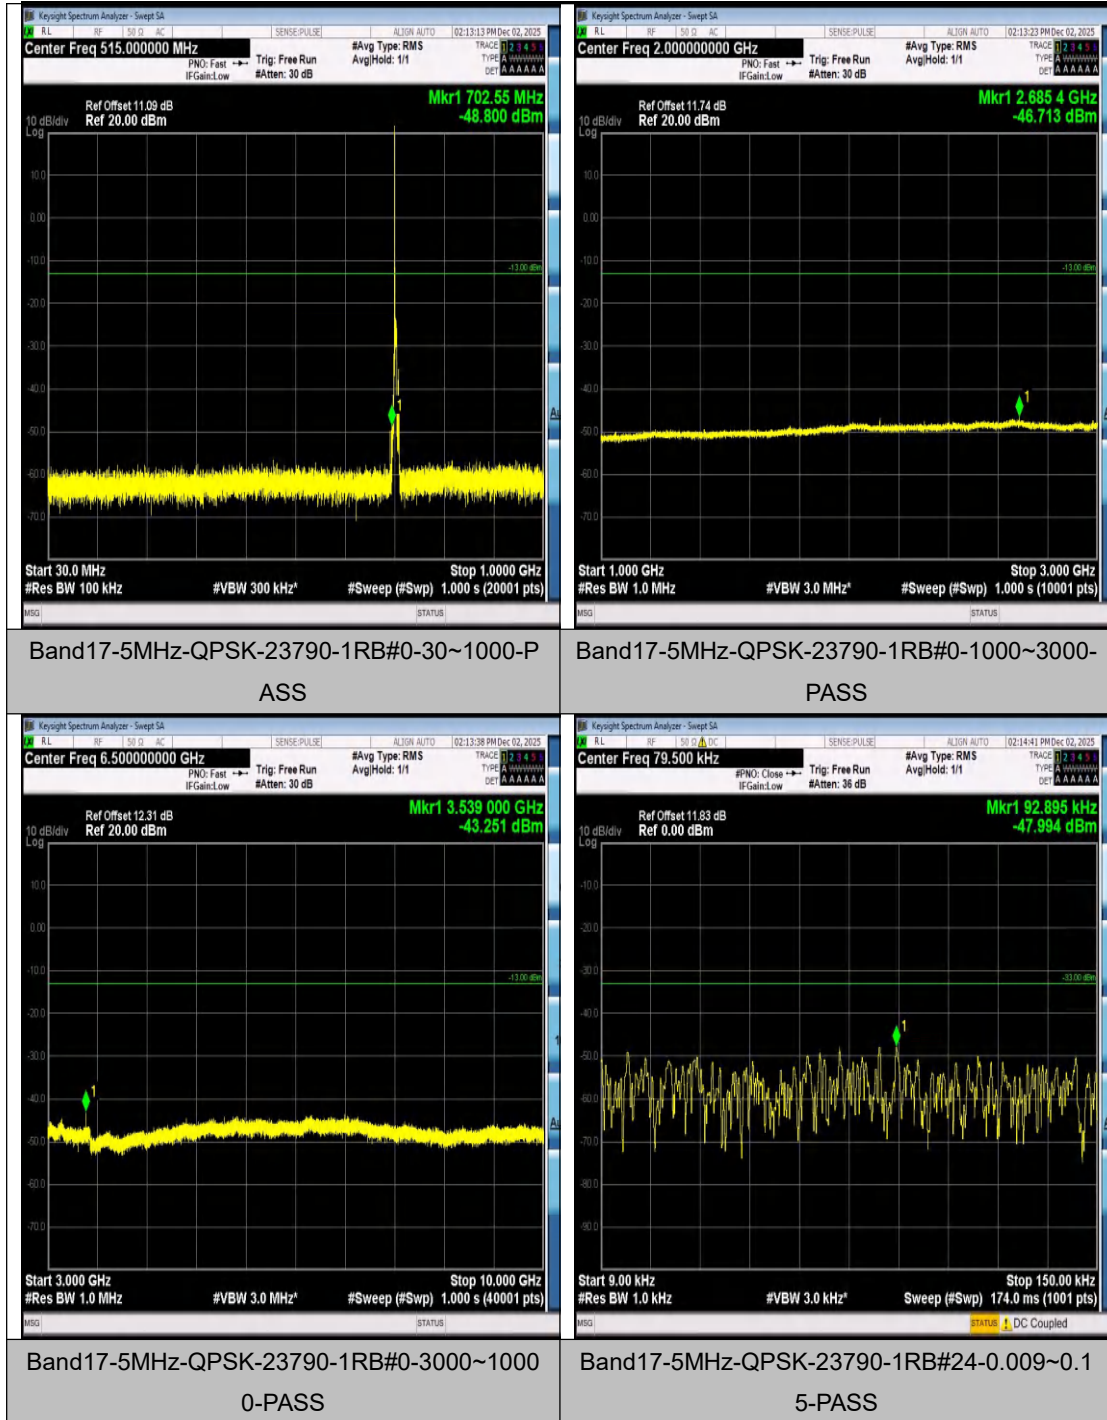

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

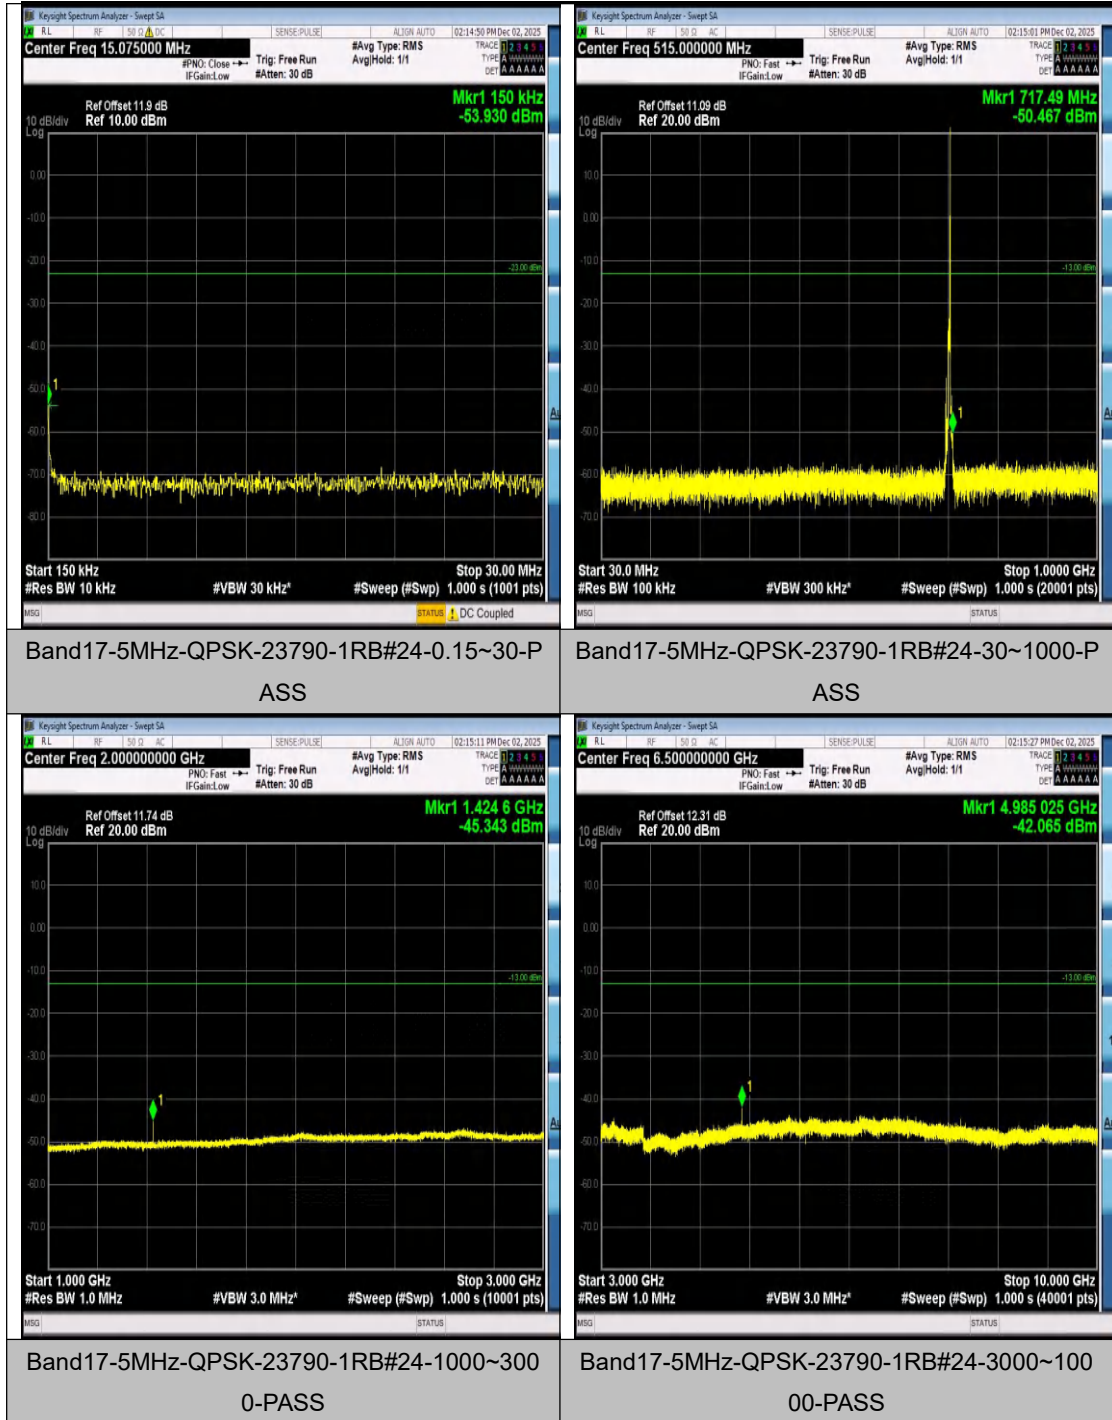

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

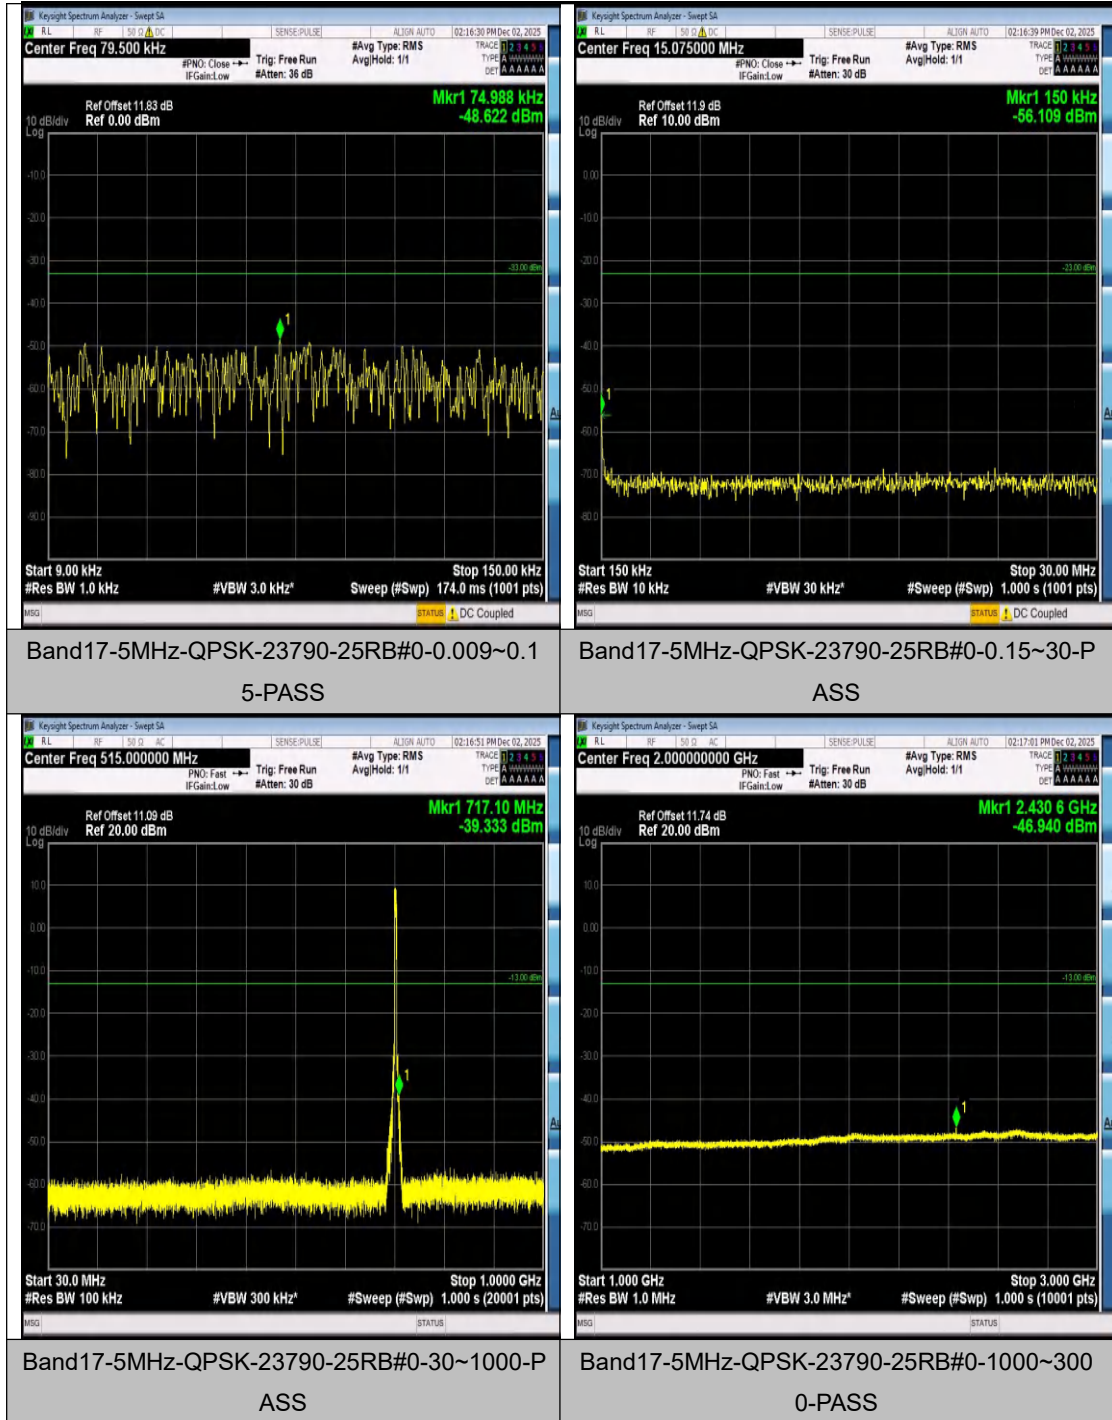

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

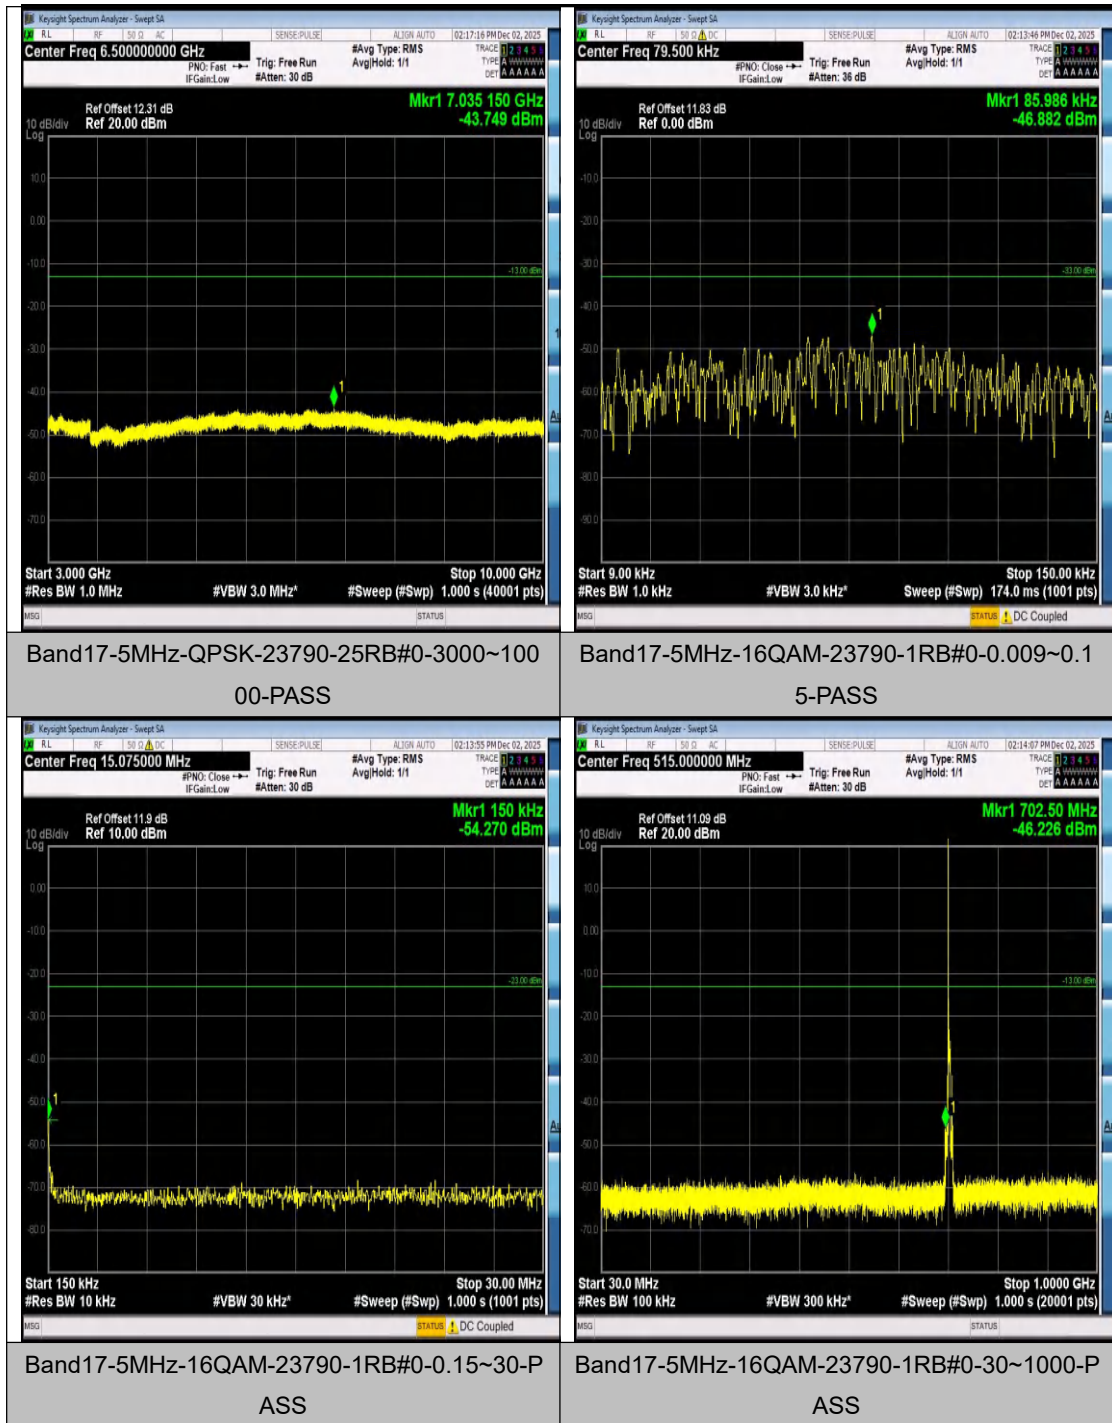

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

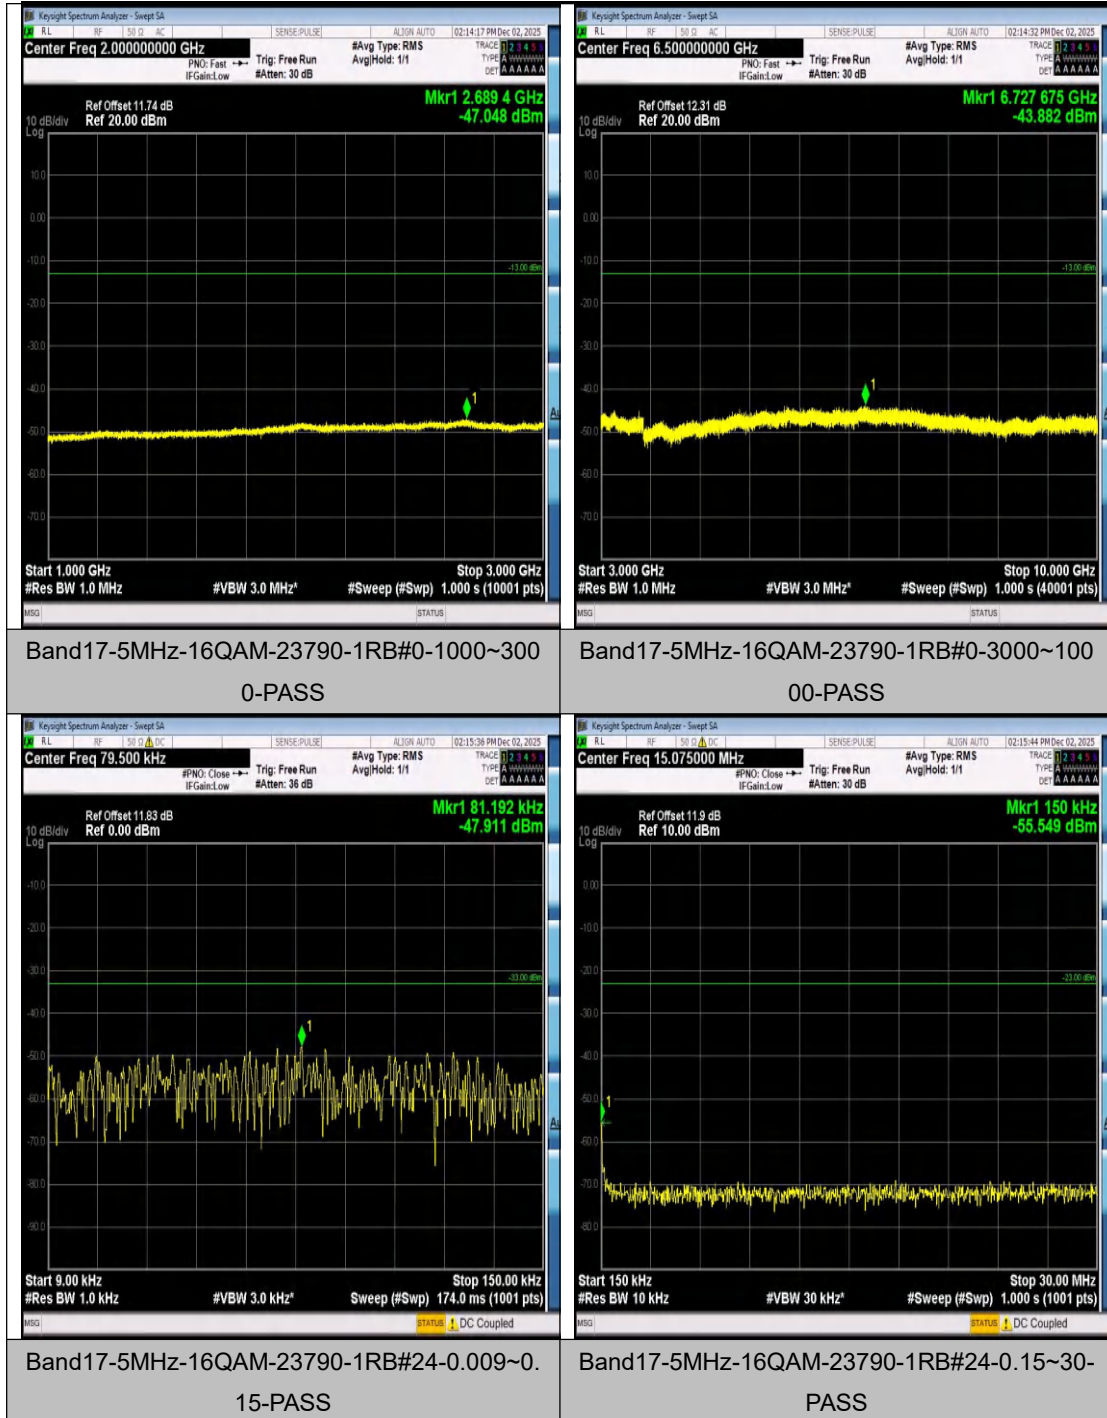

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com