

## Appendix Test Data

|                  |                     |                    |                    |
|------------------|---------------------|--------------------|--------------------|
| Report No:       | 1812C50616812505-07 | Test Sample NO:    | 1-2-2              |
| Start Test Date: | 2025-11-21          | Finish Test Date:  | 2025-12-8          |
| Test Engineer:   | <i>Joker Huang</i>  | Auditor:           | <i>Justin Feng</i> |
| Temperature:     | 24°C                | Relative Humidity: | 44%                |
| Pressure:        | 101 kPa             |                    |                    |



## Appendix A:Conducted Output Power

### Test Result

| Band            | Bandwidth | Modulation | Channel | RB Configuration | Power(dBm) | Verdict |
|-----------------|-----------|------------|---------|------------------|------------|---------|
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 23.58      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#12           | 23.67      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 23.59      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 12RB#0           | 22.48      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 12RB#6           | 22.62      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 12RB#13          | 22.55      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 22.61      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | 22.66      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#12           | 22.50      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#24           | 22.52      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 12RB#0           | 21.49      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 12RB#6           | 21.58      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 12RB#13          | 21.51      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 25RB#0           | 21.63      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 1RB#0            | 23.47      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 1RB#12           | 23.64      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 1RB#24           | 23.70      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 12RB#0           | 22.65      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 12RB#6           | 22.73      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 12RB#13          | 22.80      | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 25RB#0           | 22.76      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 1RB#0            | 22.63      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 1RB#12           | 22.95      | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 1RB#24           | 22.98      | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                 |       |       |       |         |       |      |
|-----------------|-------|-------|-------|---------|-------|------|
| Band18(815-824) | 5MHz  | 16QAM | 23895 | 12RB#0  | 21.60 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23895 | 12RB#6  | 21.84 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23895 | 12RB#13 | 21.64 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23895 | 25RB#0  | 21.67 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 1RB#0   | 23.54 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 1RB#12  | 23.80 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 1RB#24  | 23.51 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 12RB#0  | 22.78 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 12RB#6  | 22.82 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 12RB#13 | 22.70 | PASS |
| Band18(815-824) | 5MHz  | QPSK  | 23915 | 25RB#0  | 22.65 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#0   | 22.73 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#12  | 23.11 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#24  | 22.55 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 12RB#0  | 21.74 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 12RB#6  | 21.87 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 12RB#13 | 21.73 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0  | 21.71 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0   | 23.57 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#24  | 23.74 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49  | 23.61 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 25RB#0  | 22.61 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 25RB#12 | 22.78 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 25RB#25 | 22.76 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0  | 22.69 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0   | 22.44 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#24  | 22.78 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49  | 22.50 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 25RB#0  | 21.65 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 25RB#12 | 21.68 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 25RB#25 | 21.70 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0  | 21.70 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix B: Peak-to-Average Ratio(CCDF)


### Test Result

| Band            | Bandwidth | Modulation | Channel | RB Configuration | Result(dB) | Limit(dB) | Verdict |
|-----------------|-----------|------------|---------|------------------|------------|-----------|---------|
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 4.63       | 13        | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 5.33       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | 5.66       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 25RB#0           | 6.17       | 13        | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 1RB#0            | 4.76       | 13        | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 25RB#0           | 5.34       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 1RB#0            | 5.77       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 25RB#0           | 6.18       | 13        | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 1RB#0            | 4.80       | 13        | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 25RB#0           | 5.36       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 1RB#0            | 5.82       | 13        | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 25RB#0           | 6.20       | 13        | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 1RB#0            | 4.62       | 13        | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 50RB#0           | 5.39       | 13        | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 1RB#0            | 5.64       | 13        | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 50RB#0           | 6.18       | 13        | PASS    |

## Test Graphs

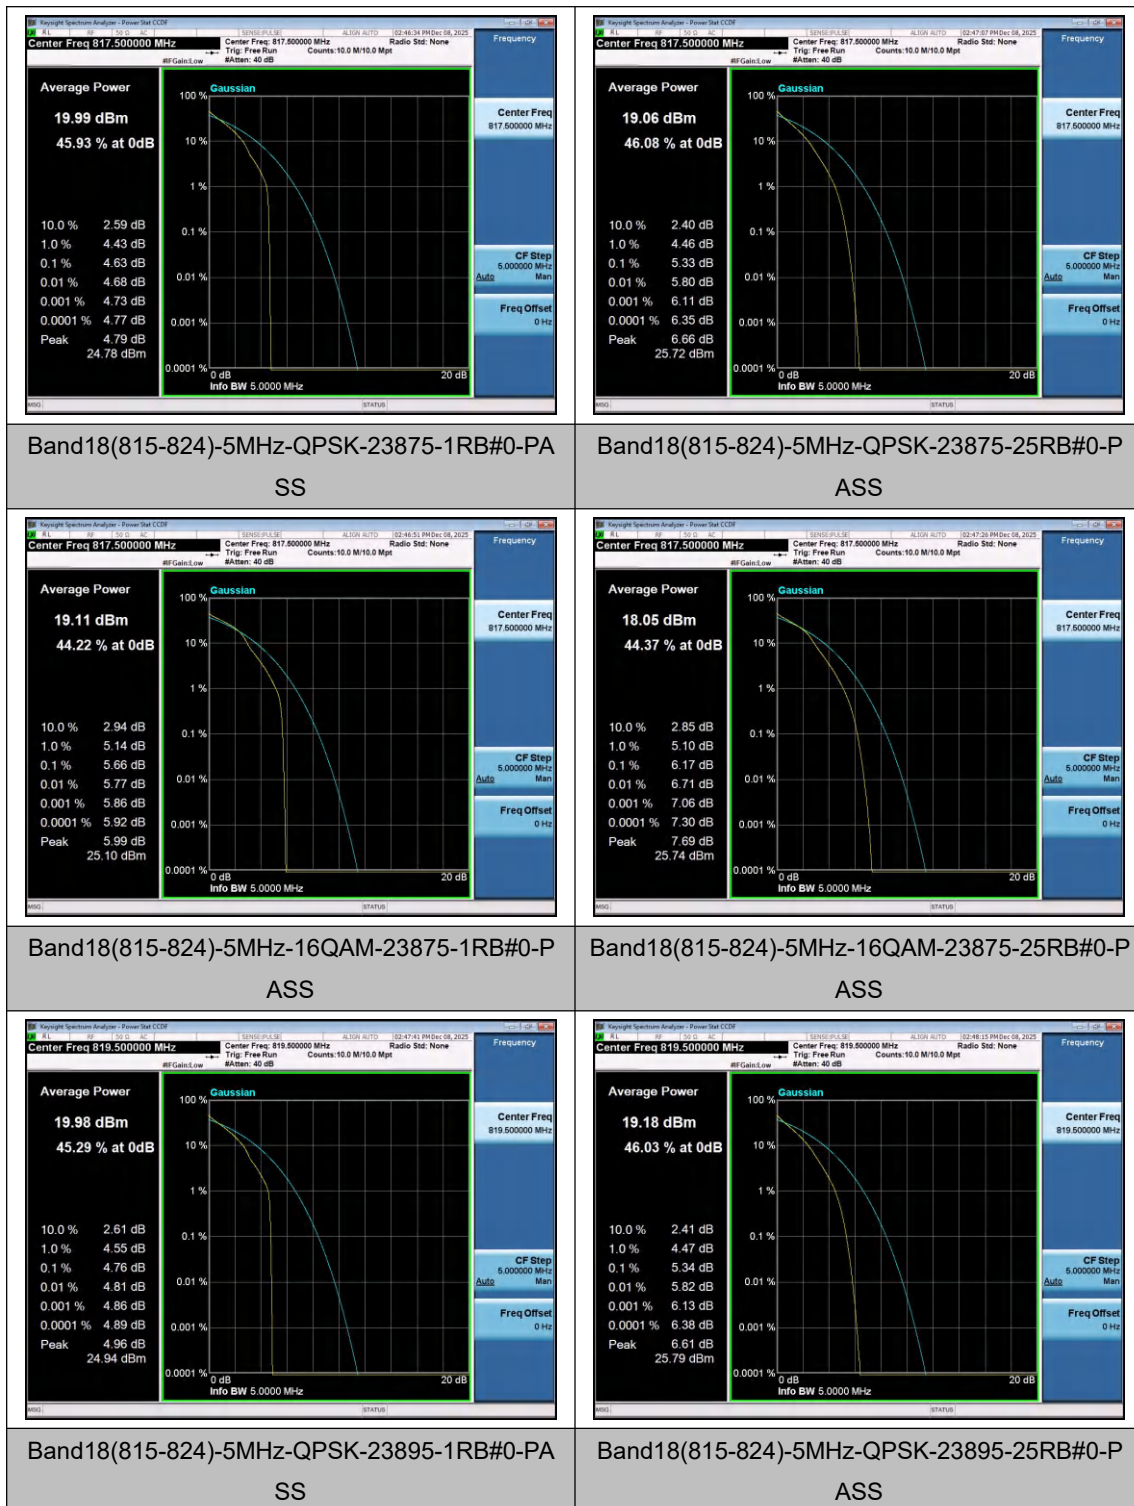

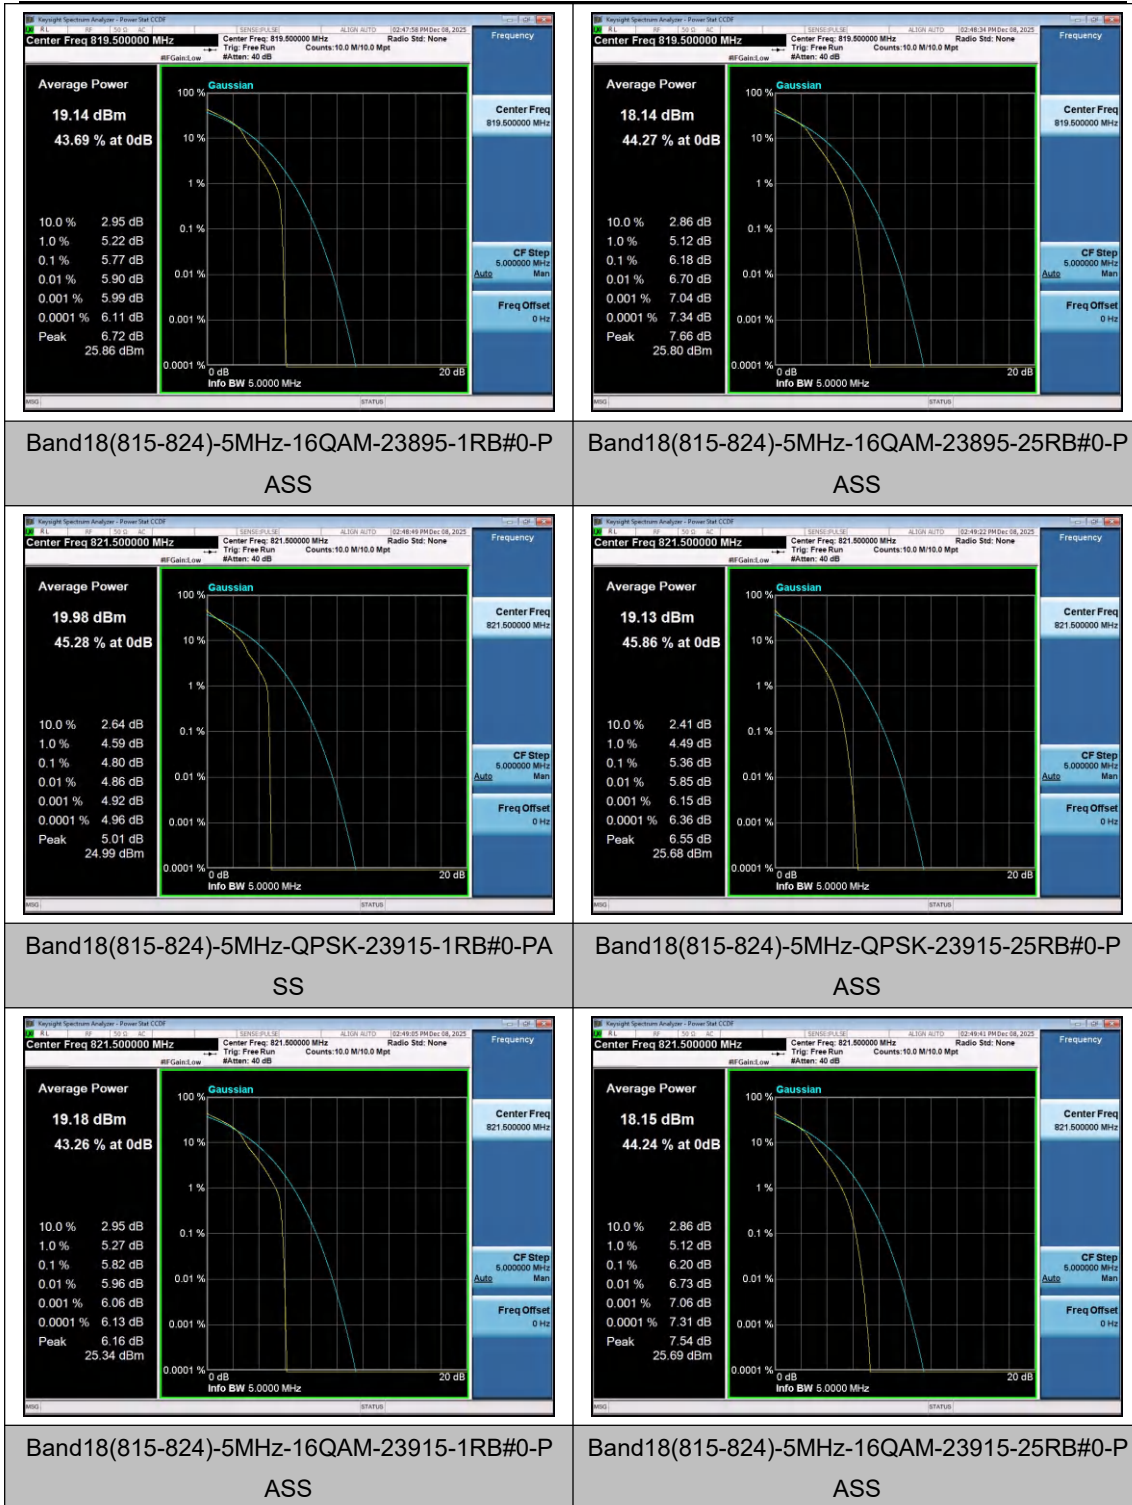

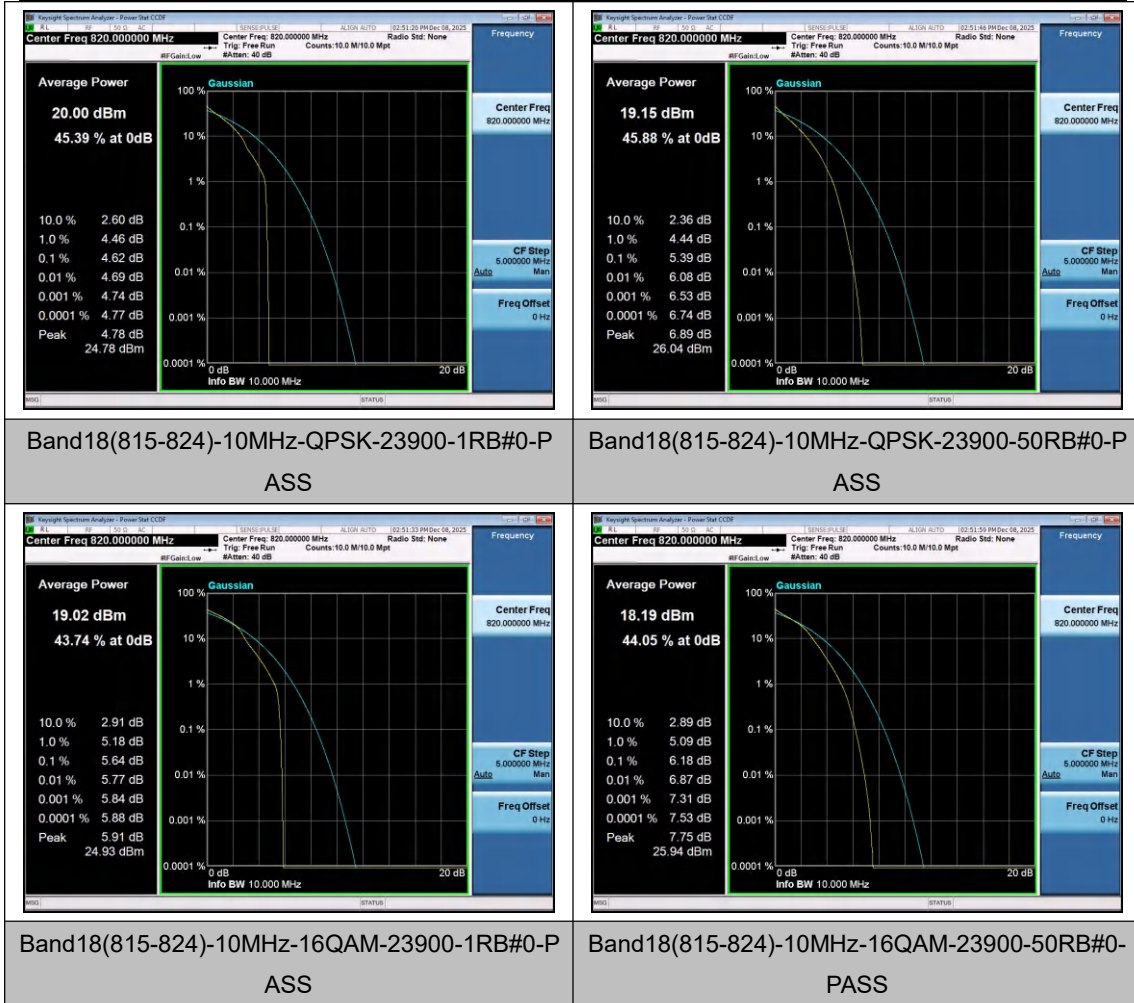

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix C: 26dB Bandwidth and Occupied Bandwidth

### Test Result

| Band            | Bandwidth | Modulation | Channel | RB Configuration | Occupied Bandwidth (MHz) | 26dB Bandwidth (MHz) | Verdict |
|-----------------|-----------|------------|---------|------------------|--------------------------|----------------------|---------|
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 4.5030                   | 4.987                | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 25RB#0           | 4.4998                   | 4.989                | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23895   | 25RB#0           | 4.5015                   | 4.978                | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23895   | 25RB#0           | 4.5059                   | 4.977                | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 25RB#0           | 4.5109                   | 4.990                | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 25RB#0           | 4.5056                   | 4.973                | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 50RB#0           | 8.9851                   | 9.870                | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 50RB#0           | 8.9843                   | 9.885                | PASS    |

## Test Graphs

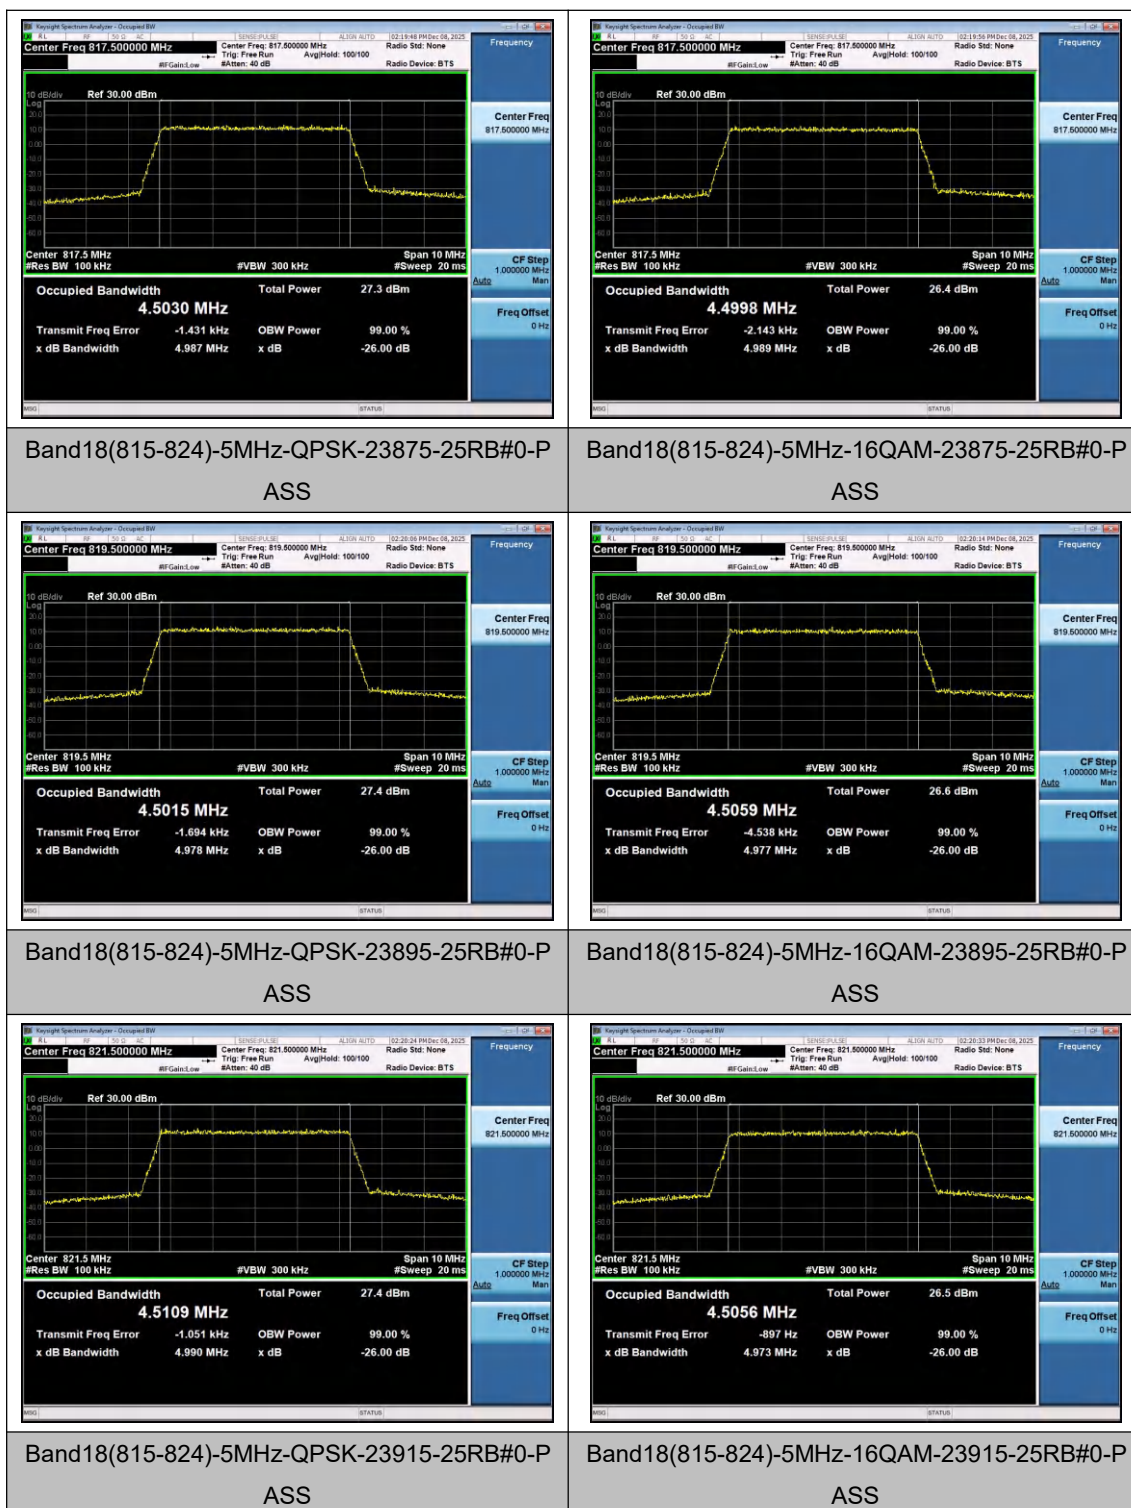

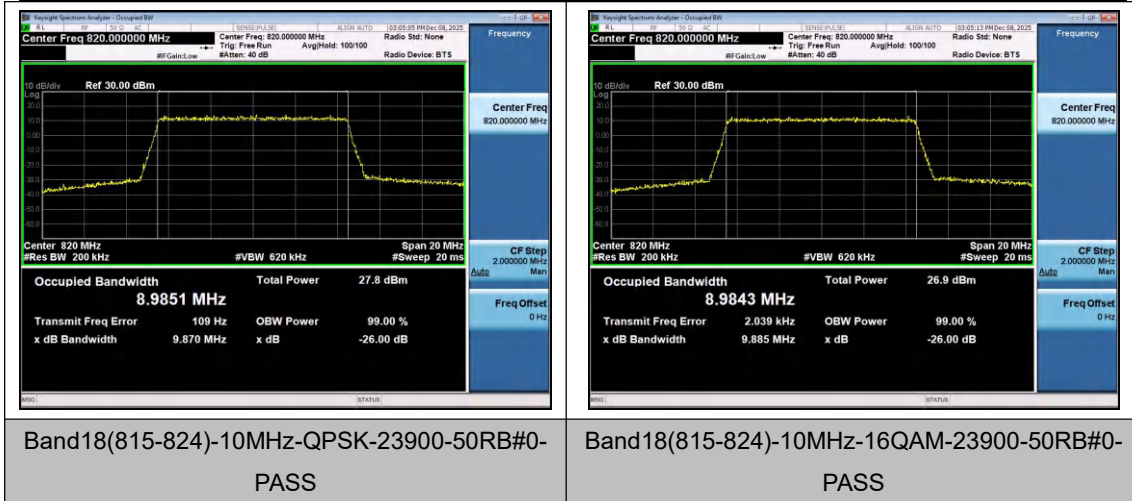

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix D: Band Edge

### Test Result

| Band            | Bandwidth | Modulation | Channel | RB Configuration | Result (dBm) | Margin (dB) | Verdict |
|-----------------|-----------|------------|---------|------------------|--------------|-------------|---------|
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | -40.14       | 20.14       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | -39.23       | 19.23       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | -39.97       | 26.97       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | -43.73       | 23.73       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#24           | -41.08       | 21.08       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 25RB#0           | -40.49       | 27.49       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 1RB#0            | -41.51       | 21.51       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 1RB#24           | -41.10       | 21.10       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23915   | 25RB#0           | -38.43       | 25.43       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 1RB#0            | -43.63       | 23.63       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 1RB#24           | -45.33       | 25.33       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23915   | 25RB#0           | -39.12       | 26.12       | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 1RB#0            | -47.29       | 34.29       | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 1RB#49           | -47.09       | 34.09       | PASS    |
| Band18(815-824) | 10MHz     | QPSK       | 23900   | 50RB#0           | -40.97       | 27.97       | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 1RB#0            | -47.84       | 34.84       | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 1RB#49           | -55.89       | 42.89       | PASS    |
| Band18(815-824) | 10MHz     | 16QAM      | 23900   | 50RB#0           | -42.18       | 29.18       | PASS    |


## Test Graphs

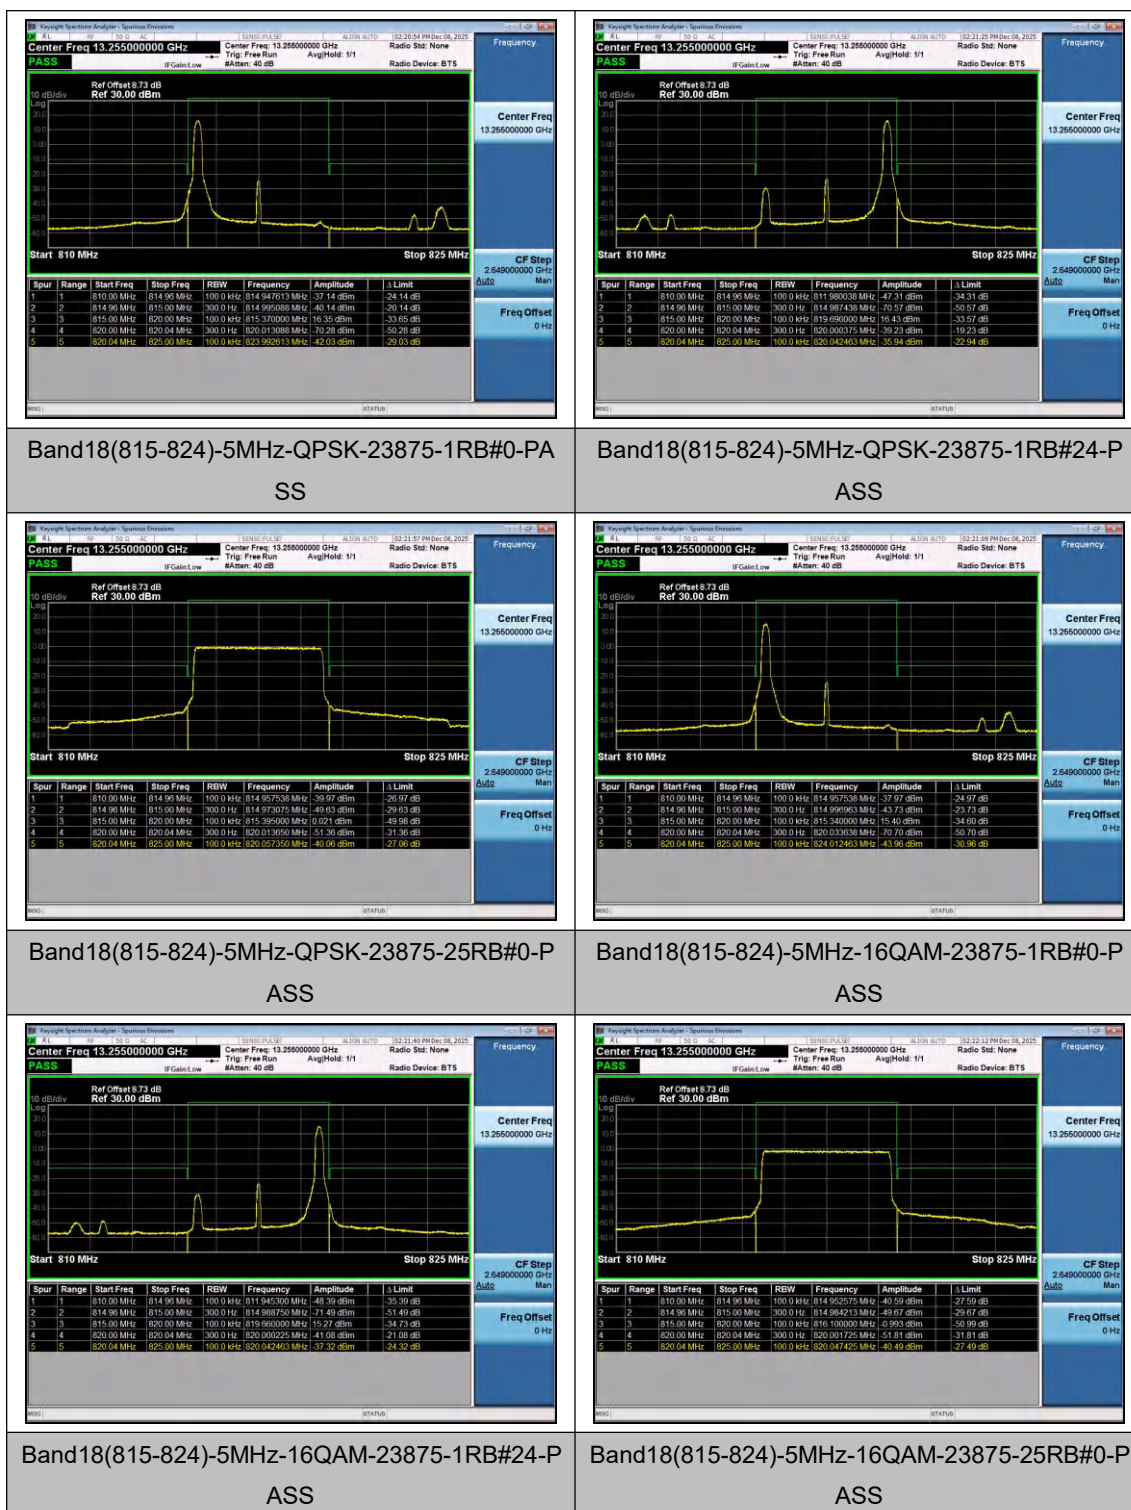


## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

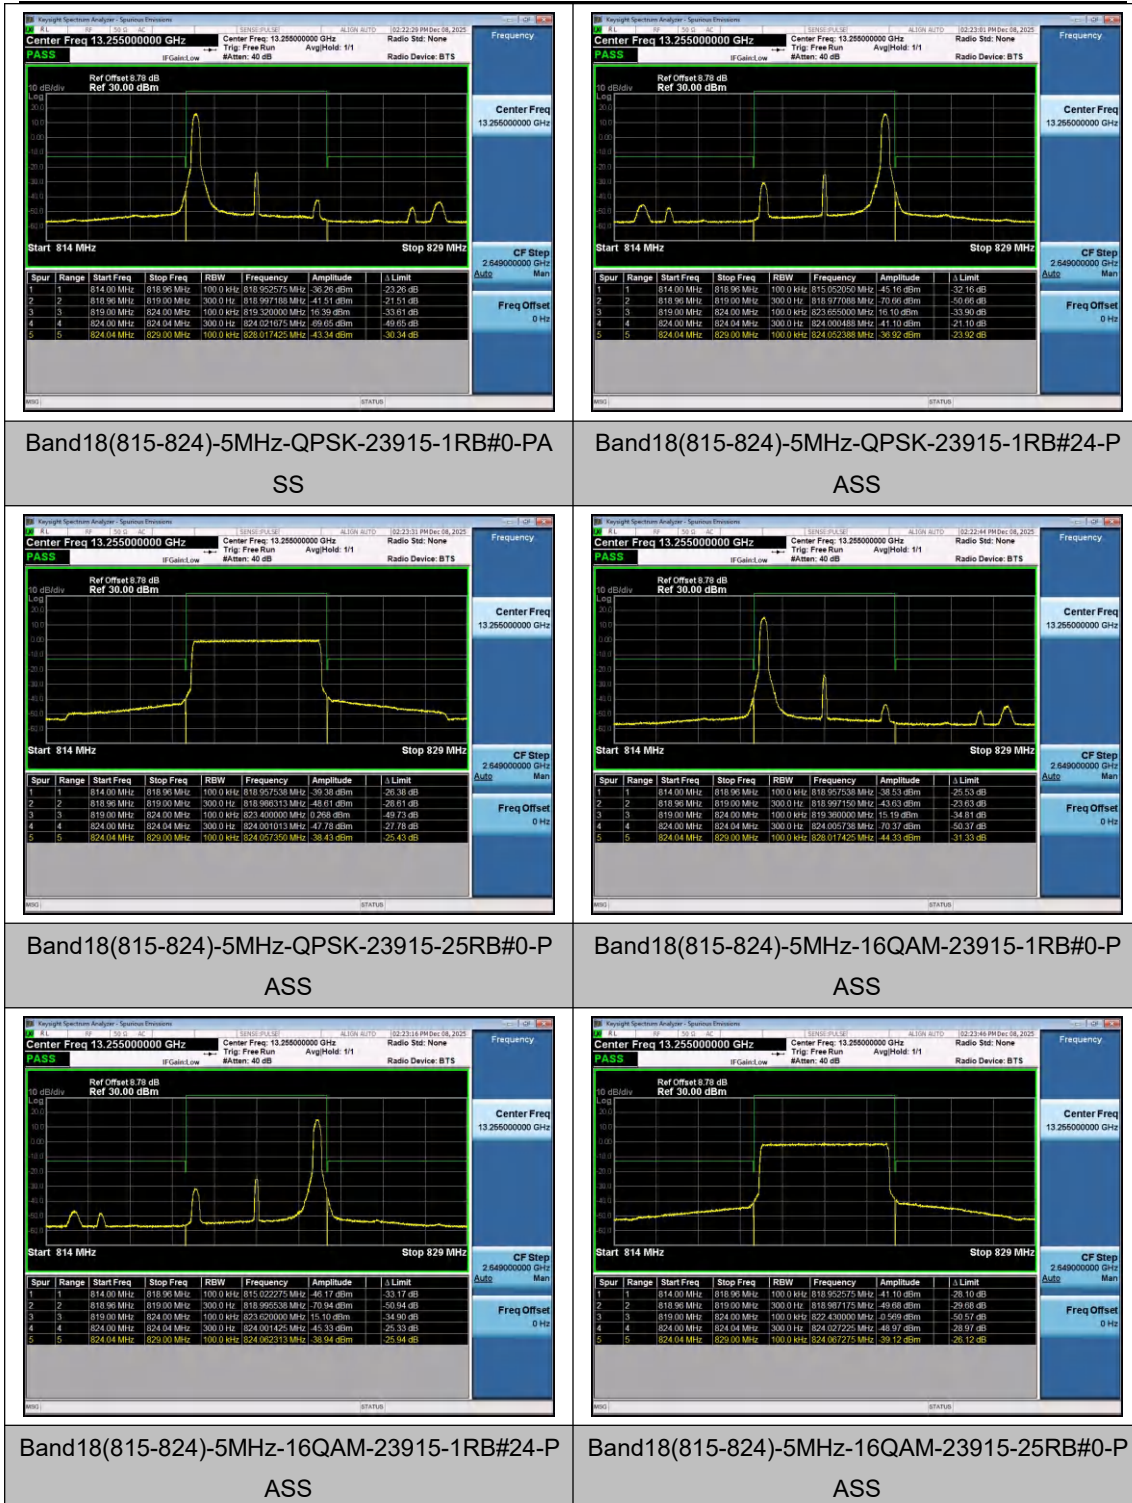

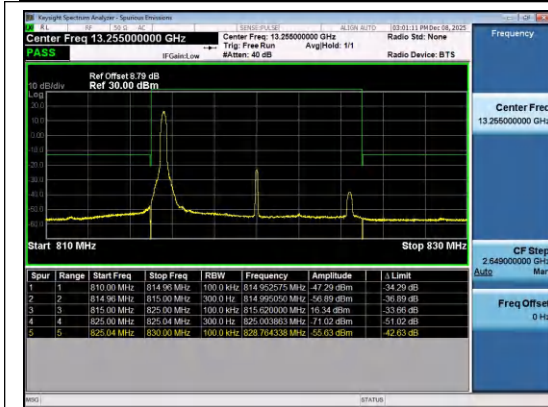

Band18(815-824)-10MHz-QPSK-23900-1RB#0-P

ASS

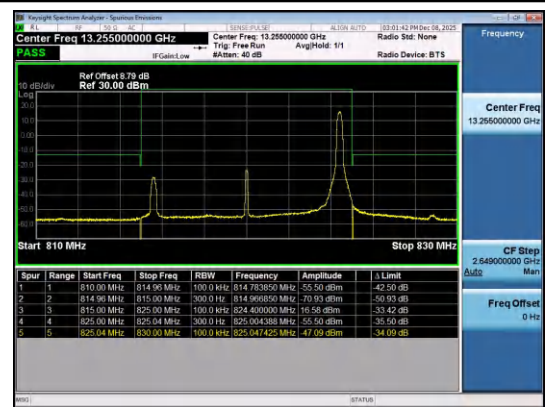

Band18(815-824)-10MHz-QPSK-23900-1RB#49-P

ASS




Band18(815-824)-10MHz-QPSK-23900-50RB#0-P

ASS



Band18(815-824)-10MHz-16QAM-23900-1RB#0-P

ASS

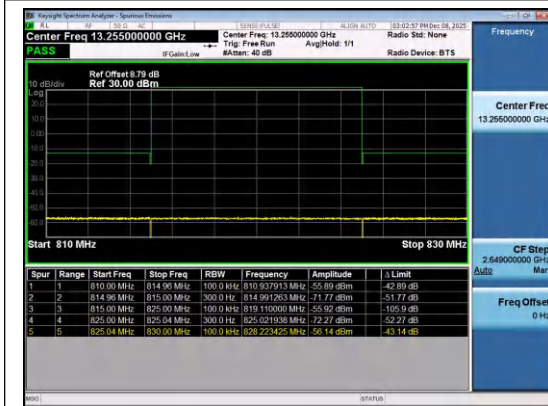

Band18(815-824)-10MHz-16QAM-23900-1RB#49-P

PASS



Band18(815-824)-10MHz-16QAM-23900-50RB#0-P

PASS

## Appendix E: Conducted Spurious Emission

### Test Result

| Band            | Bandwidth | Modulation | Channel | RB Configuration | Frequency Range | Result (dBm) | Limit (dBm) | Verdict |
|-----------------|-----------|------------|---------|------------------|-----------------|--------------|-------------|---------|
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 0.009~0.15      | -46.99       | -33.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 0.15~30         | -53.97       | -23.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 30~1000         | -56.25       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 1000~3000       | -46.87       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#0            | 3000~10000      | -43.68       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 0.009~0.15      | -46.99       | -33.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 0.15~30         | -54.65       | -23.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 30~1000         | -55.85       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 1000~3000       | -47.14       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 1RB#24           | 3000~10000      | -43.84       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 0.009~0.15      | -46.98       | -33.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 0.15~30         | -55.06       | -23.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 30~1000         | -49.27       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 1000~3000       | -46.89       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | QPSK       | 23875   | 25RB#0           | 3000~10000      | -44.04       | -13.0       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | 0.009~0.15      | -46.91       | -33.0       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | 0.15~30         | -56.44       | -23.0       | PASS    |
| Band18(815-824) | 5MHz      | 16QAM      | 23875   | 1RB#0            | 30~1000         | -55.41       | -13.0       | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                 |      |       |       |        |            |        |       |      |
|-----------------|------|-------|-------|--------|------------|--------|-------|------|
| 815-824)        |      |       |       |        |            |        |       |      |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#0  | 1000~3000  | -46.89 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#0  | 3000~10000 | -43.77 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#24 | 0.009~0.15 | -46.09 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#24 | 0.15~30    | -56.68 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#24 | 30~1000    | -56.51 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#24 | 1000~3000  | -47.13 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 1RB#24 | 3000~10000 | -43.79 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 25RB#0 | 0.009~0.15 | -45.31 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 25RB#0 | 0.15~30    | -53.18 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 25RB#0 | 30~1000    | -50.94 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 25RB#0 | 1000~3000  | -47.15 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23875 | 25RB#0 | 3000~10000 | -43.71 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#0  | 0.009~0.15 | -46.46 | -33.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#0  | 0.15~30    | -55.81 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#0  | 30~1000    | -56.38 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#0  | 1000~3000  | -47.04 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#0  | 3000~10000 | -43.74 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#24 | 0.009~0.15 | -47.59 | -33.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#24 | 0.15~30    | -56.09 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#24 | 30~1000    | -52.14 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#24 | 1000~3000  | -47.08 | -13.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                 |      |       |       |        |            |        |       |      |
|-----------------|------|-------|-------|--------|------------|--------|-------|------|
| Band18(815-824) | 5MHz | QPSK  | 23895 | 1RB#24 | 3000~10000 | -43.78 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 25RB#0 | 0.009~0.15 | -46.51 | -33.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 25RB#0 | 0.15~30    | -54.74 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 25RB#0 | 30~1000    | -47.69 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 25RB#0 | 1000~3000  | -47.13 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23895 | 25RB#0 | 3000~10000 | -43.68 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#0  | 0.009~0.15 | -45.65 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#0  | 0.15~30    | -54.90 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#0  | 30~1000    | -56.62 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#0  | 1000~3000  | -47.03 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#0  | 3000~10000 | -43.64 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#24 | 0.009~0.15 | -47.51 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#24 | 0.15~30    | -54.77 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#24 | 30~1000    | -56.40 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#24 | 1000~3000  | -46.99 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 1RB#24 | 3000~10000 | -43.85 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 25RB#0 | 0.009~0.15 | -47.62 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 25RB#0 | 0.15~30    | -55.77 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 25RB#0 | 30~1000    | -48.34 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 25RB#0 | 1000~3000  | -47.10 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23895 | 25RB#0 | 3000~10000 | -43.67 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#0  | 0.009~0.15 | -46.03 | -33.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                 |      |       |       |        |            |        |       |      |
|-----------------|------|-------|-------|--------|------------|--------|-------|------|
| 815-824)        |      |       |       |        |            |        |       |      |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#0  | 0.15~30    | -53.35 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#0  | 30~1000    | -56.56 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#0  | 1000~3000  | -47.00 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#0  | 3000~10000 | -44.07 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#24 | 0.009~0.15 | -48.26 | -33.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#24 | 0.15~30    | -56.36 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#24 | 30~1000    | -52.44 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#24 | 1000~3000  | -46.84 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 1RB#24 | 3000~10000 | -43.49 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 25RB#0 | 0.009~0.15 | -47.59 | -33.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 25RB#0 | 0.15~30    | -54.45 | -23.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 25RB#0 | 30~1000    | -45.55 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 25RB#0 | 1000~3000  | -46.82 | -13.0 | PASS |
| Band18(815-824) | 5MHz | QPSK  | 23915 | 25RB#0 | 3000~10000 | -43.55 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#0  | 0.009~0.15 | -47.42 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#0  | 0.15~30    | -56.12 | -23.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#0  | 30~1000    | -56.25 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#0  | 1000~3000  | -47.16 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#0  | 3000~10000 | -43.80 | -13.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#24 | 0.009~0.15 | -46.68 | -33.0 | PASS |
| Band18(815-824) | 5MHz | 16QAM | 23915 | 1RB#24 | 0.15~30    | -55.14 | -23.0 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                 |       |       |       |        |            |        |       |      |
|-----------------|-------|-------|-------|--------|------------|--------|-------|------|
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#24 | 30~1000    | -55.03 | -13.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#24 | 1000~3000  | -46.87 | -13.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 1RB#24 | 3000~10000 | -43.73 | -13.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | 0.009~0.15 | -47.29 | -33.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | 0.15~30    | -55.15 | -23.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | 30~1000    | -46.21 | -13.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | 1000~3000  | -46.89 | -13.0 | PASS |
| Band18(815-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | 3000~10000 | -43.96 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0  | 0.009~0.15 | -47.61 | -33.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0  | 0.15~30    | -52.97 | -23.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0  | 30~1000    | -48.44 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0  | 1000~3000  | -47.15 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#0  | 3000~10000 | -43.85 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49 | 0.009~0.15 | -47.97 | -33.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49 | 0.15~30    | -55.12 | -23.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49 | 30~1000    | -53.66 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49 | 1000~3000  | -47.04 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 1RB#49 | 3000~10000 | -43.44 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0 | 0.009~0.15 | -47.27 | -33.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0 | 0.15~30    | -53.98 | -23.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0 | 30~1000    | -39.26 | -13.0 | PASS |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0 | 1000~3000  | -47.05 | -13.0 | PASS |


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|                 |       |       |       |        |            |        |       |      |
|-----------------|-------|-------|-------|--------|------------|--------|-------|------|
| 815-824)        |       |       |       |        |            |        |       |      |
| Band18(815-824) | 10MHz | QPSK  | 23900 | 50RB#0 | 3000~10000 | -44.00 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0  | 0.009~0.15 | -47.45 | -33.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0  | 0.15~30    | -54.23 | -23.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0  | 30~1000    | -56.30 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0  | 1000~3000  | -47.05 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#0  | 3000~10000 | -43.93 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49 | 0.009~0.15 | -48.09 | -33.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49 | 0.15~30    | -55.25 | -23.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49 | 30~1000    | -53.76 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49 | 1000~3000  | -47.22 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 1RB#49 | 3000~10000 | -43.87 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0 | 0.009~0.15 | -48.30 | -33.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0 | 0.15~30    | -53.93 | -23.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0 | 30~1000    | -40.76 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0 | 1000~3000  | -46.29 | -13.0 | PASS |
| Band18(815-824) | 10MHz | 16QAM | 23900 | 50RB#0 | 3000~10000 | -43.85 | -13.0 | PASS |


## Test Graphs

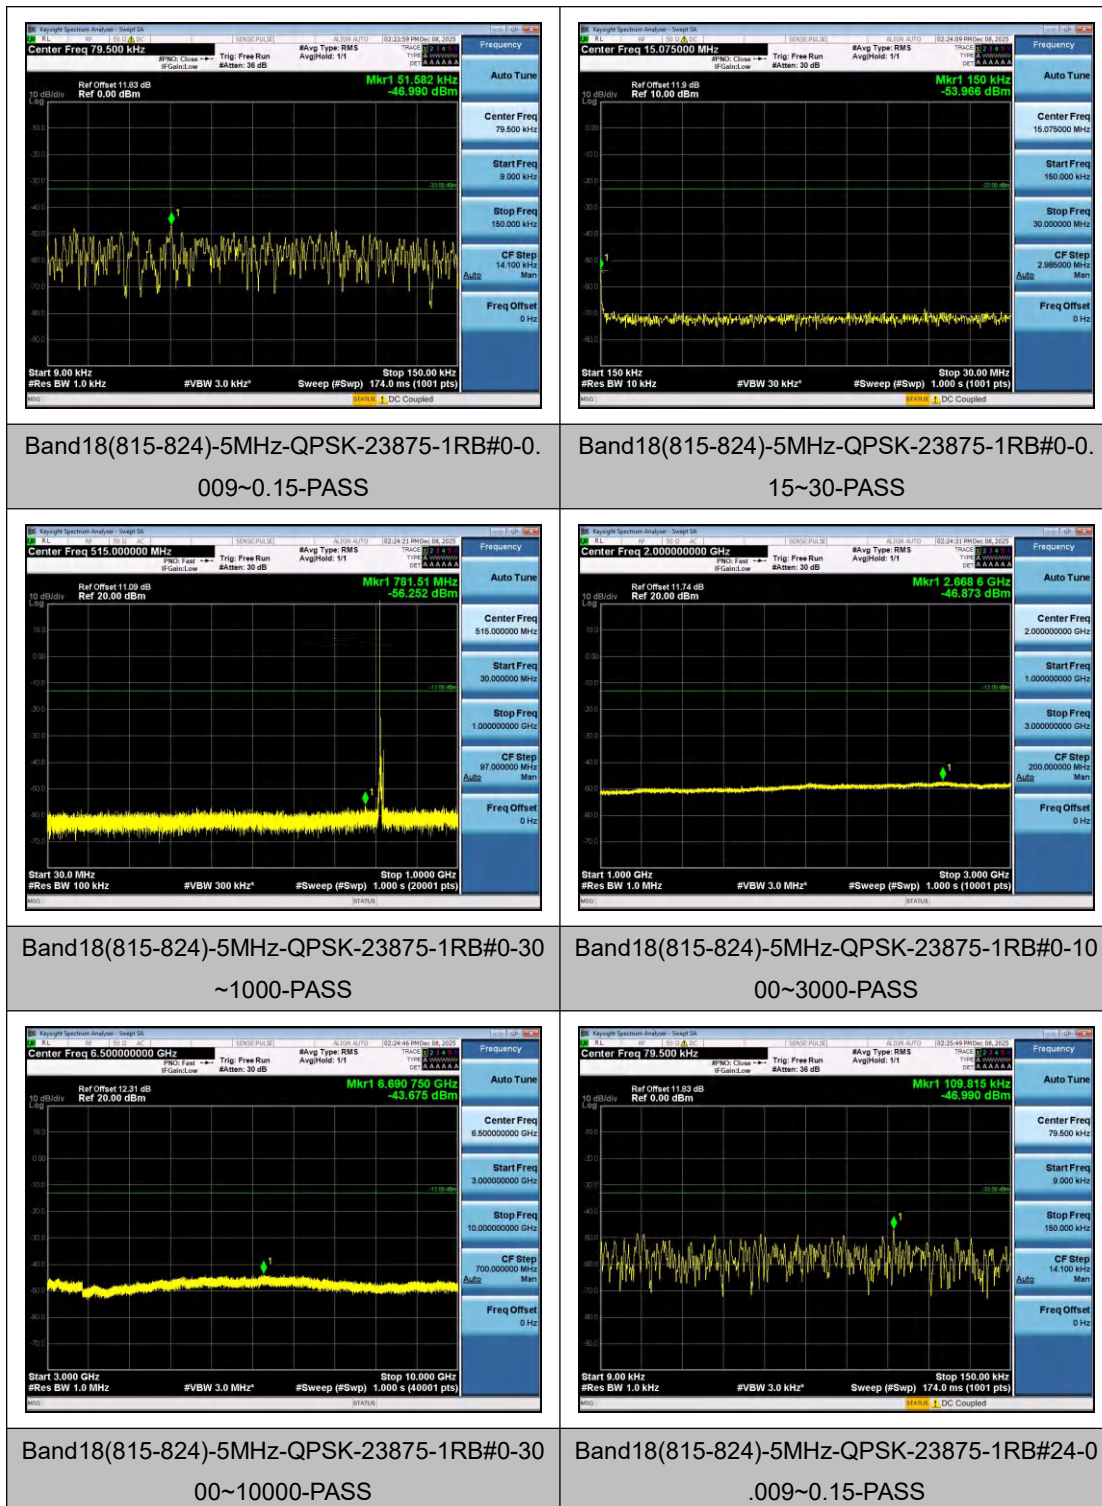


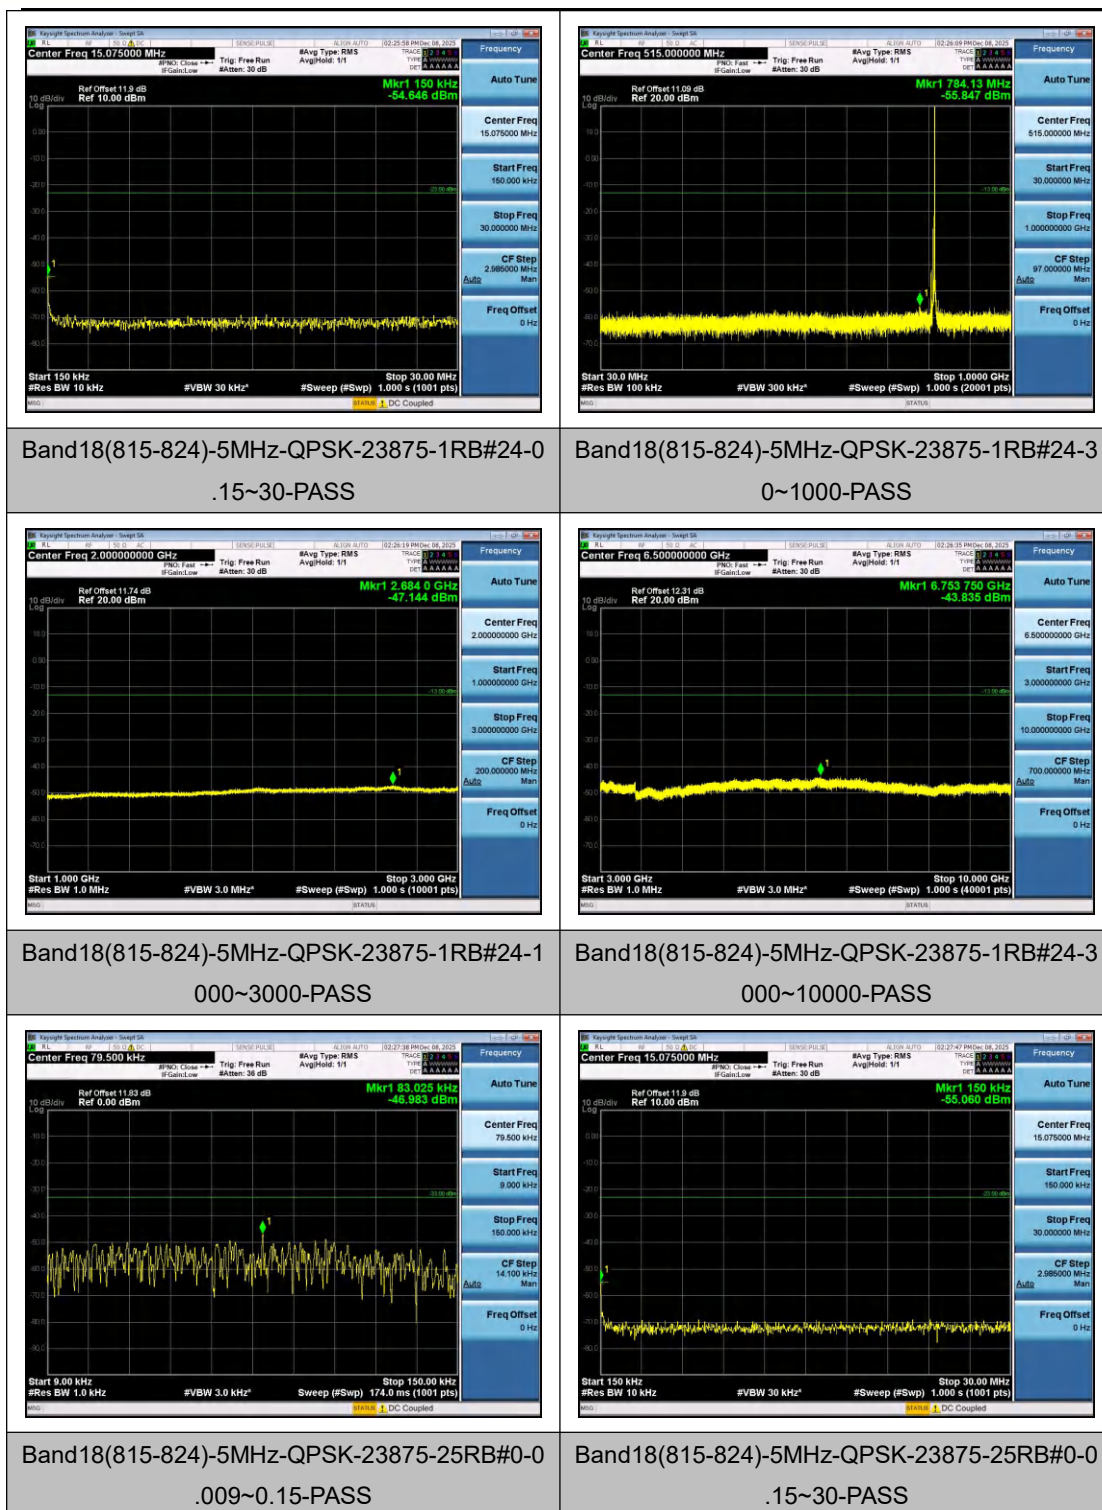

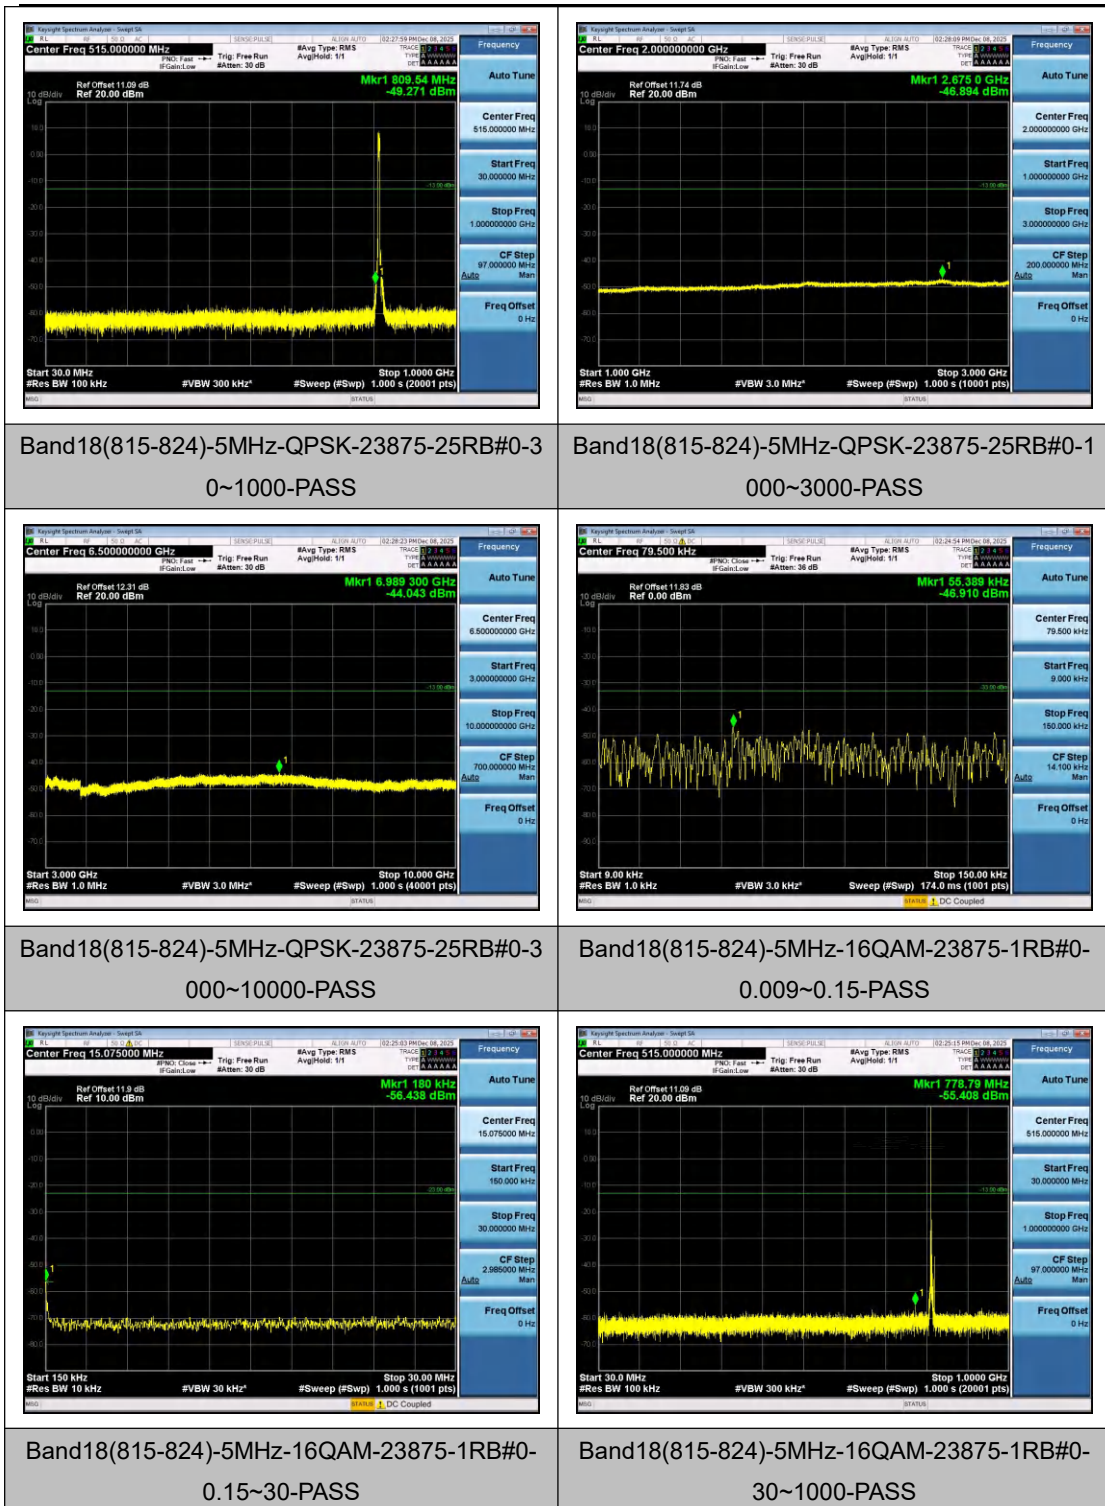


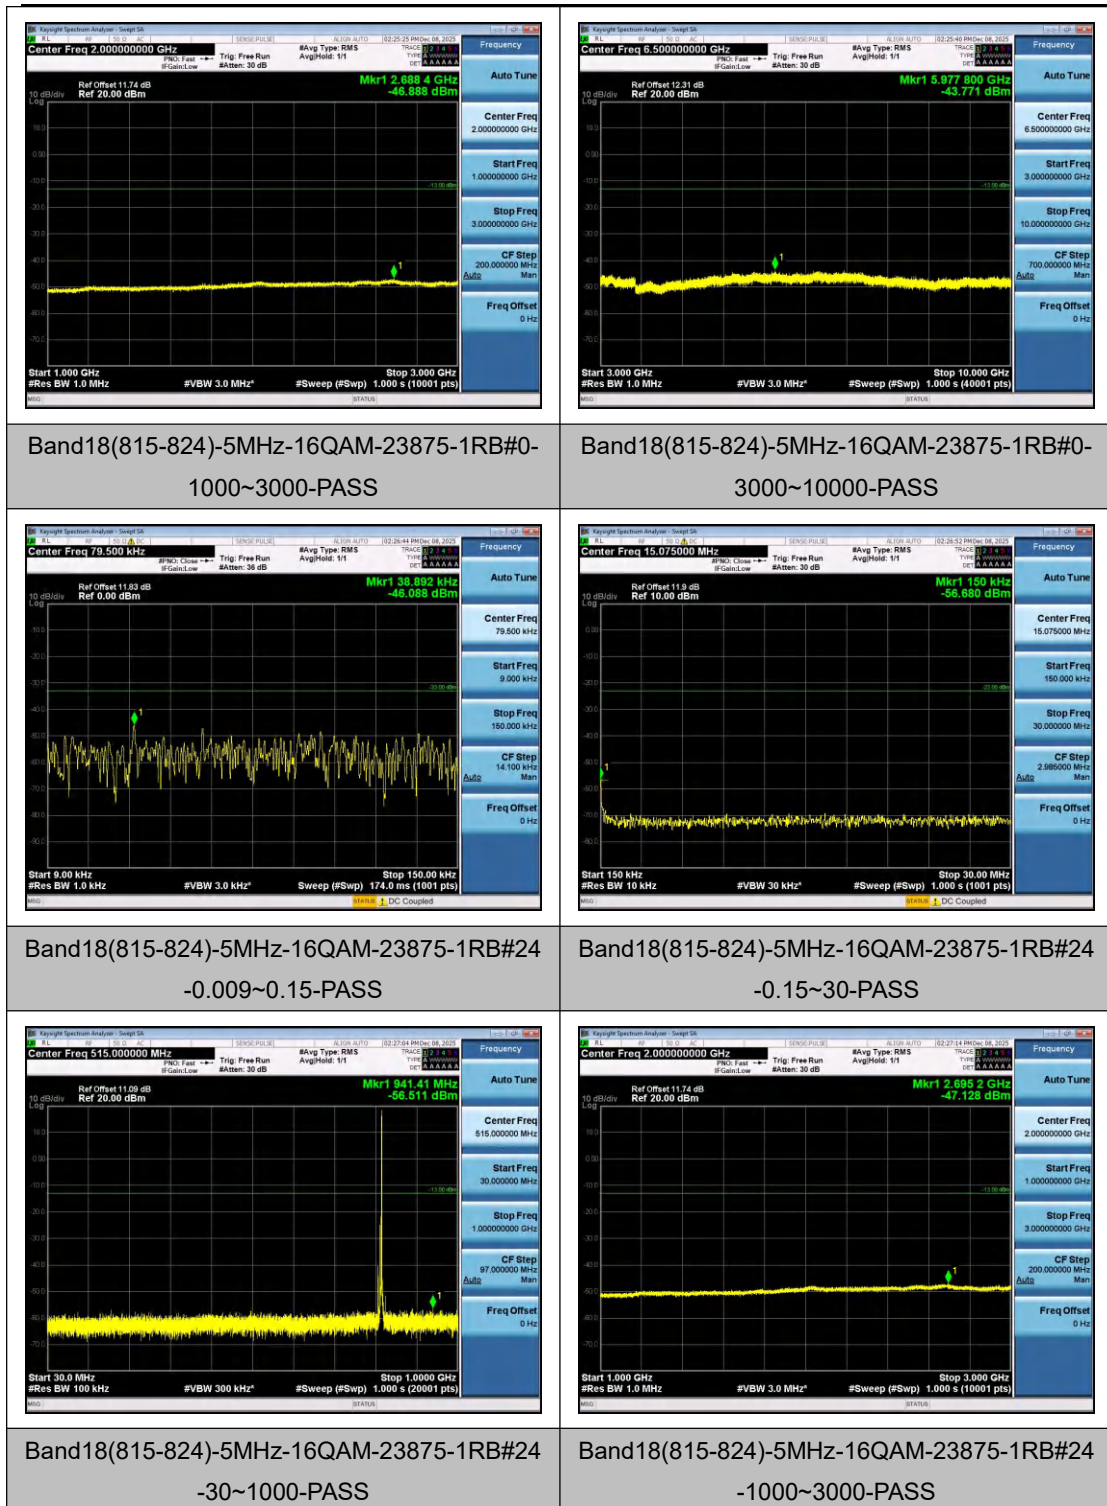

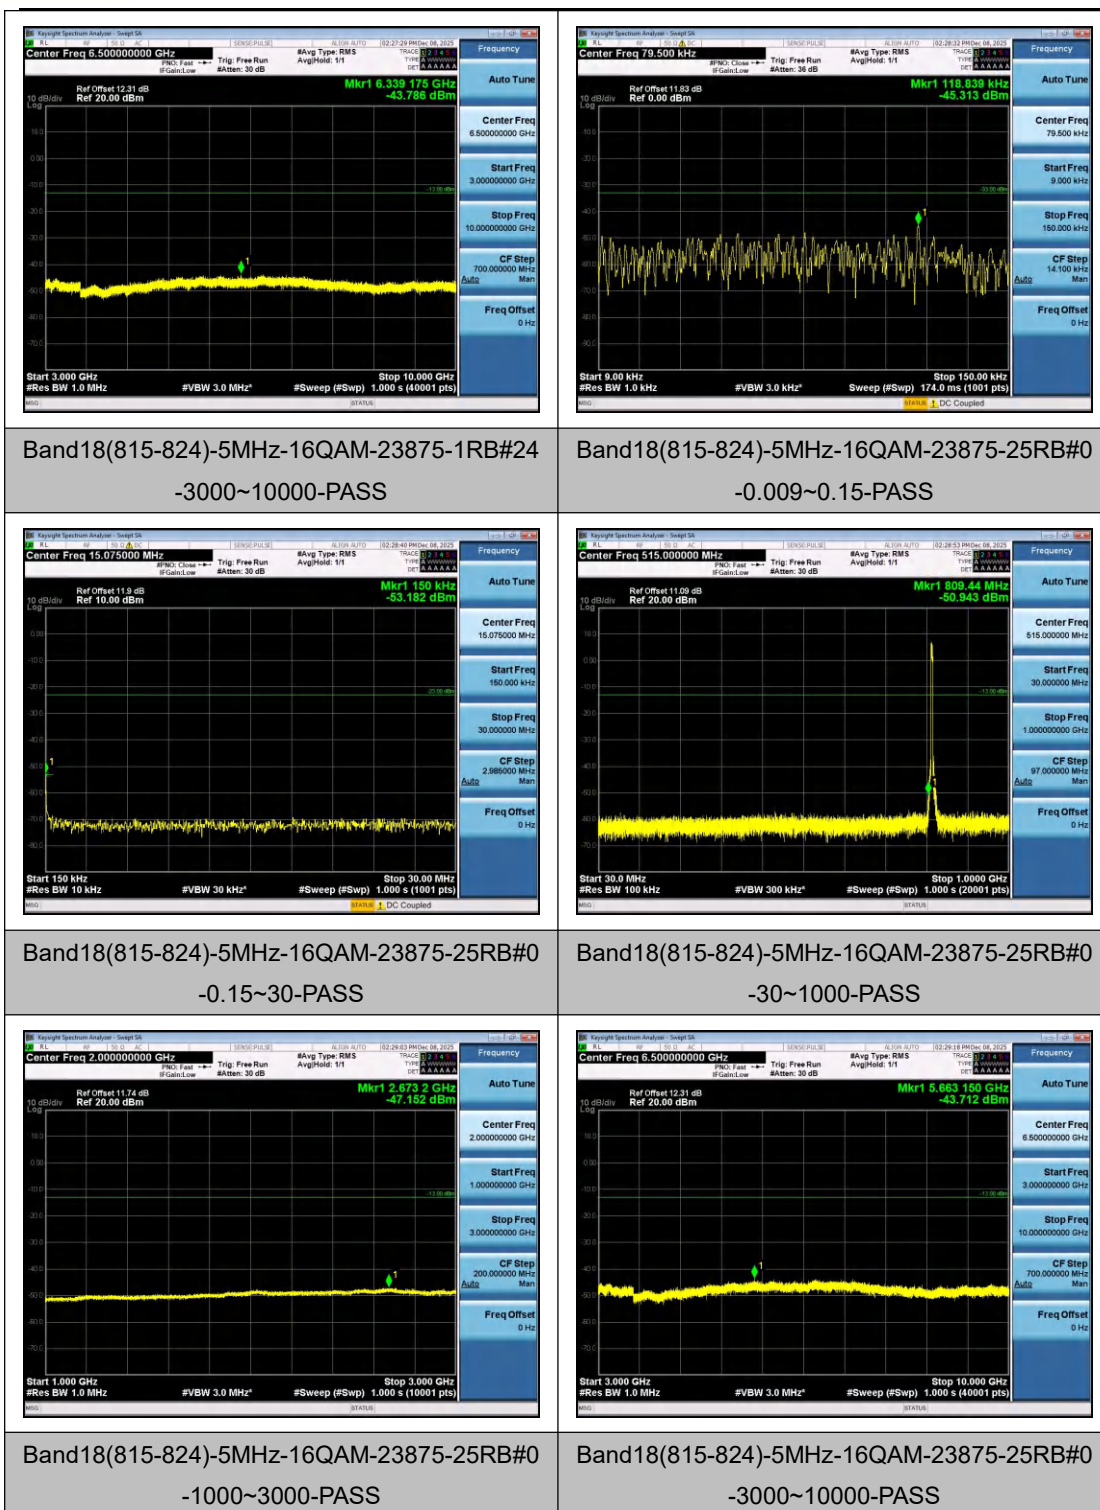


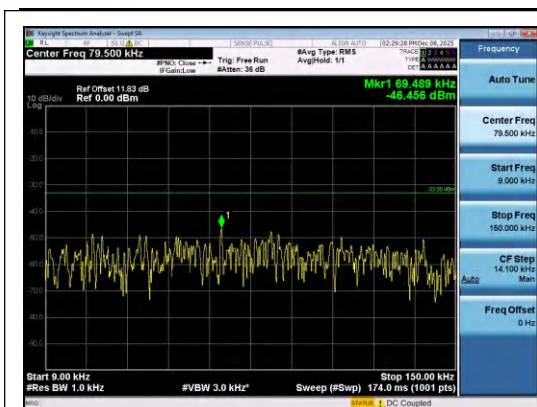


Band18(815-824)-5MHz-QPSK-23895-1RB#0-0.  
009~0.15-PASS

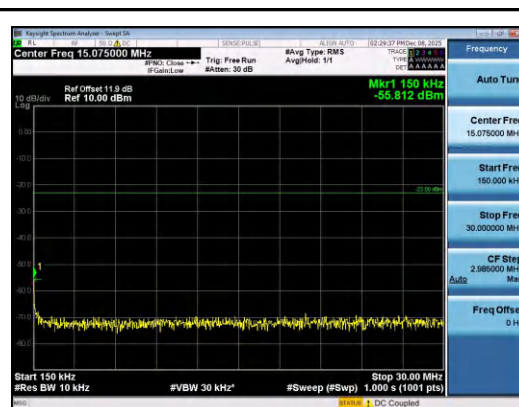


Band18(815-824)-5MHz-QPSK-23895-1RB#0-0.  
15~30-PASS

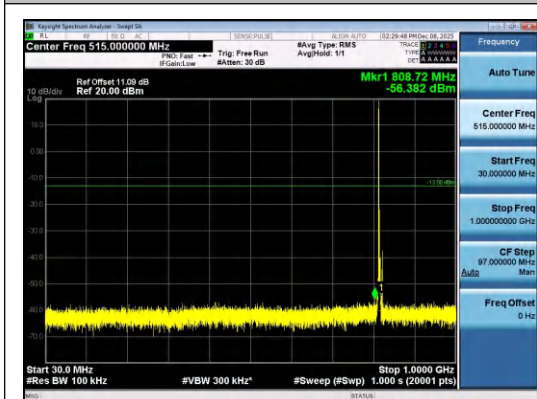


Band18(815-824)-5MHz-QPSK-23895-1RB#0-30  
~1000-PASS

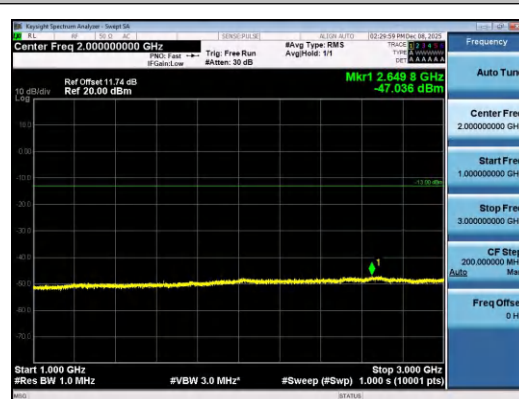


Band18(815-824)-5MHz-QPSK-23895-1RB#0-10  
00~3000-PASS

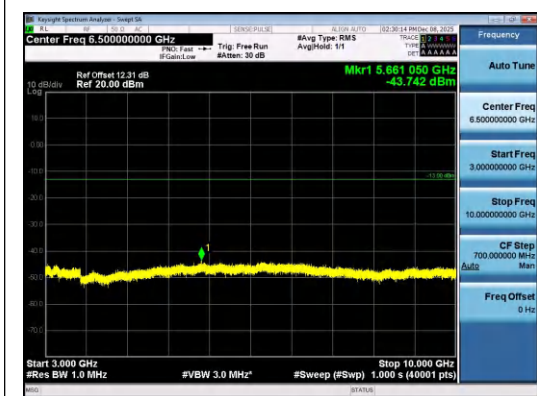



Band18(815-824)-5MHz-QPSK-23895-1RB#0-30  
00~10000-PASS

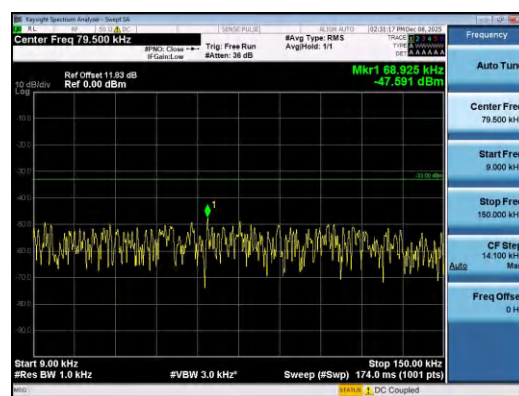



Band18(815-824)-5MHz-QPSK-23895-1RB#24-0  
.009~0.15-PASS

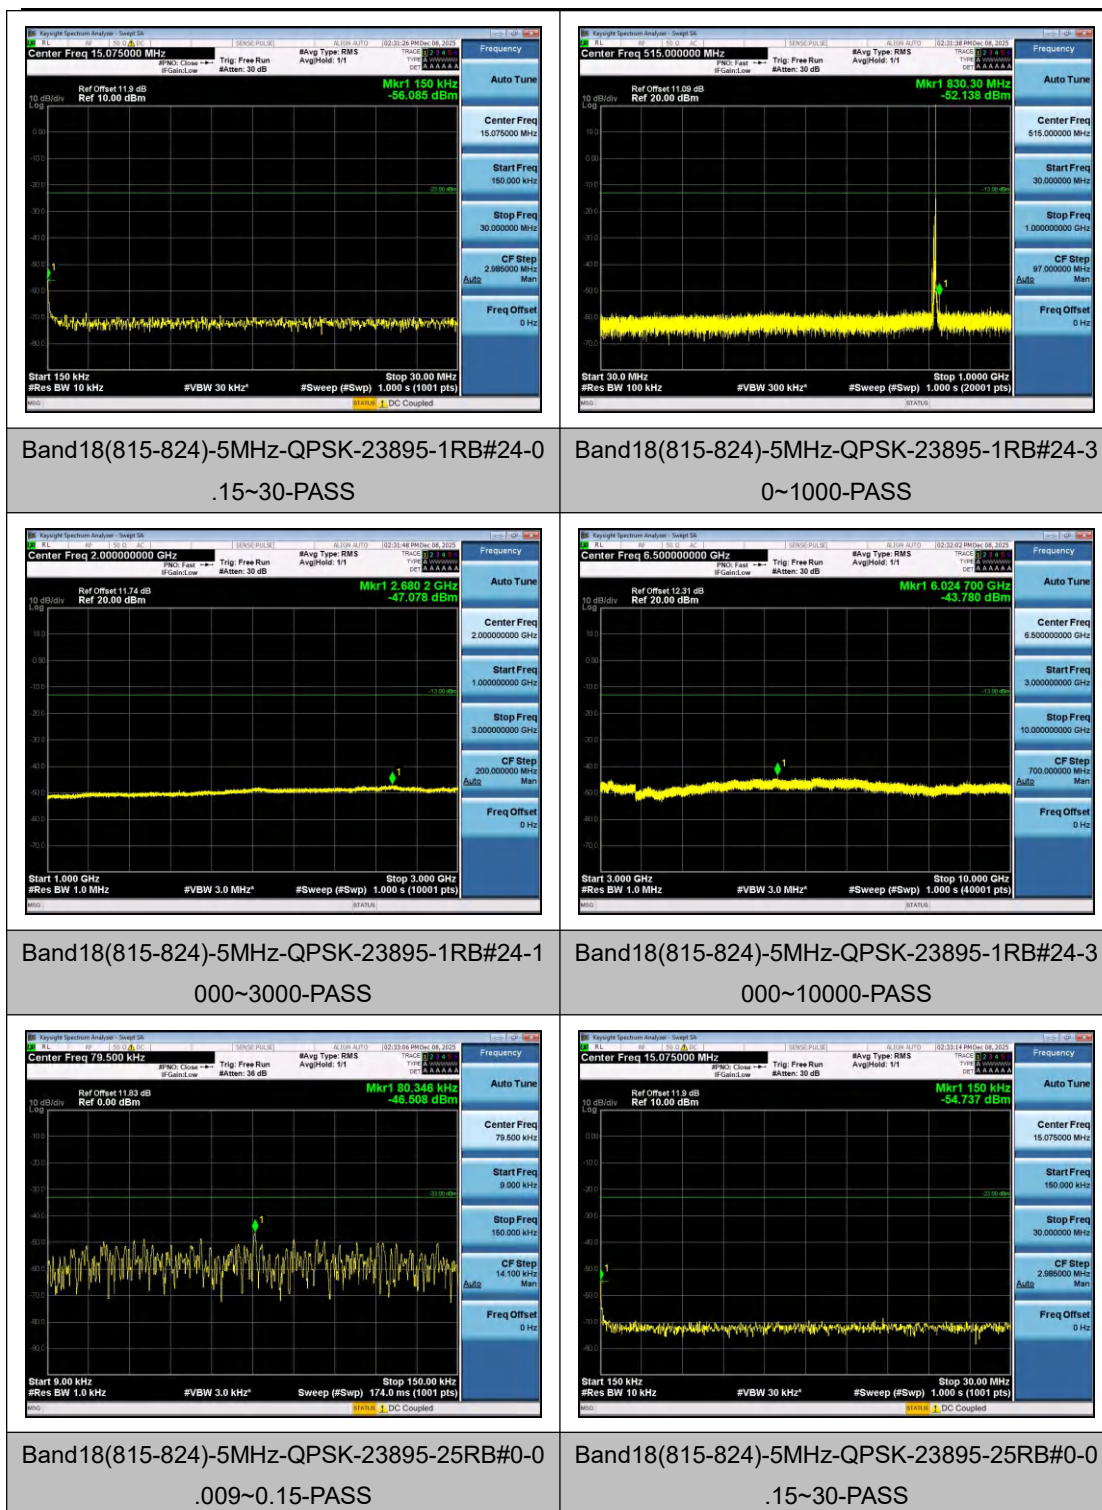


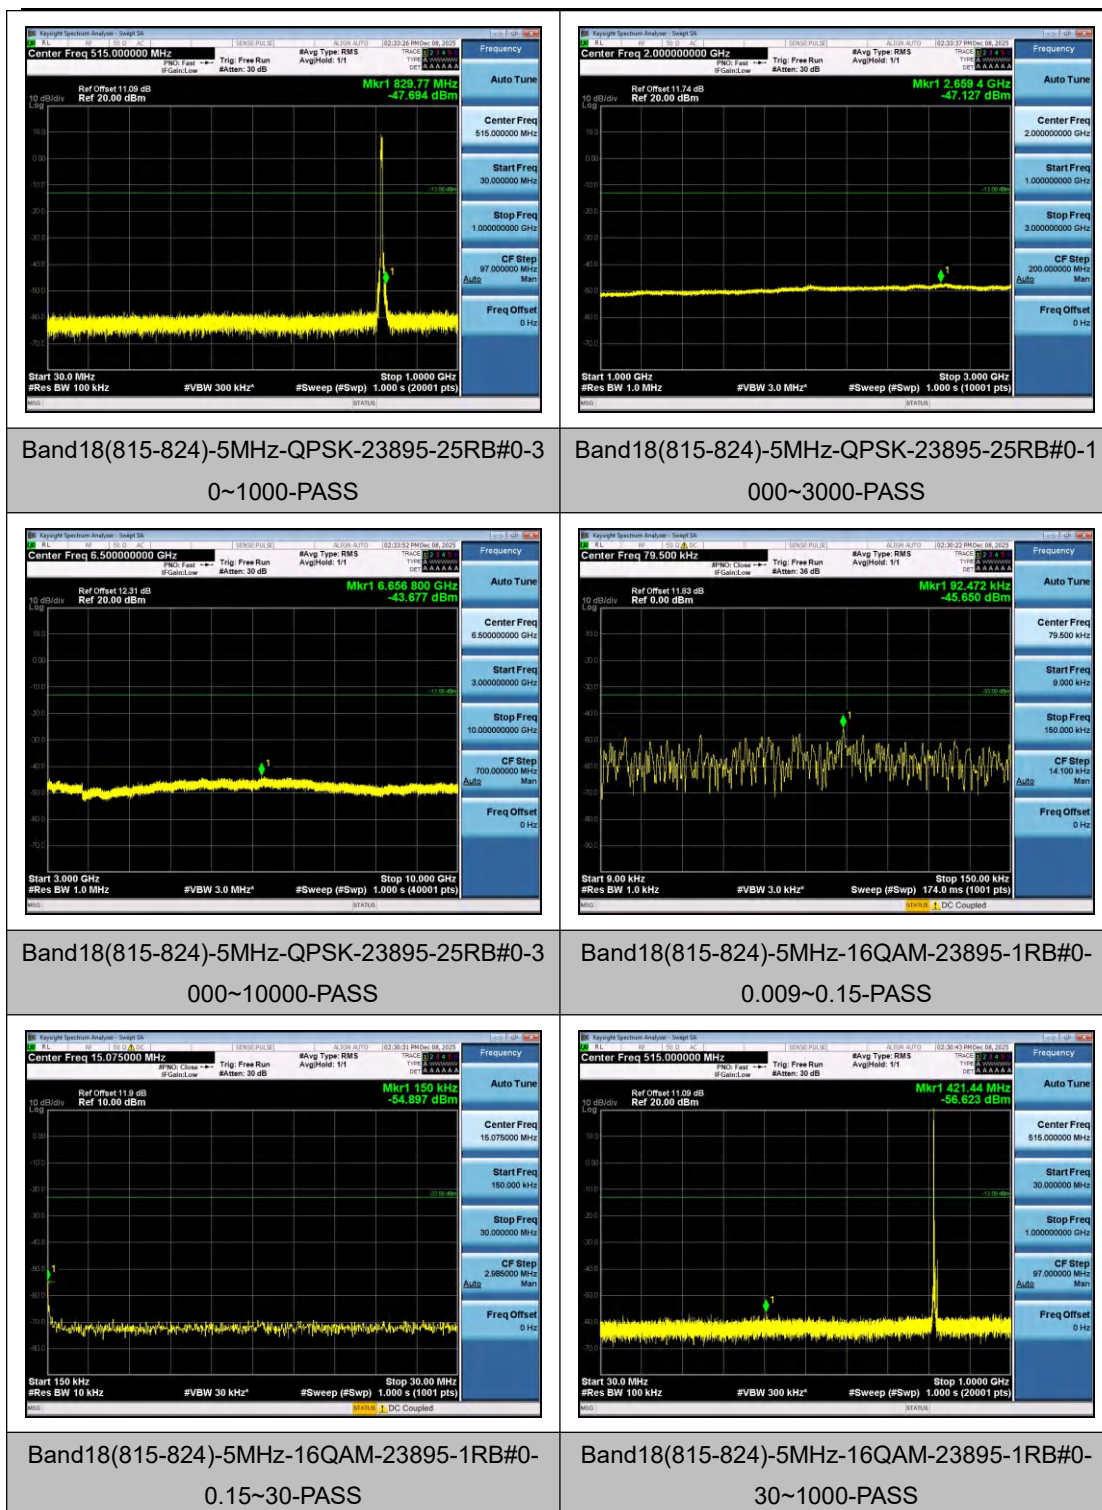


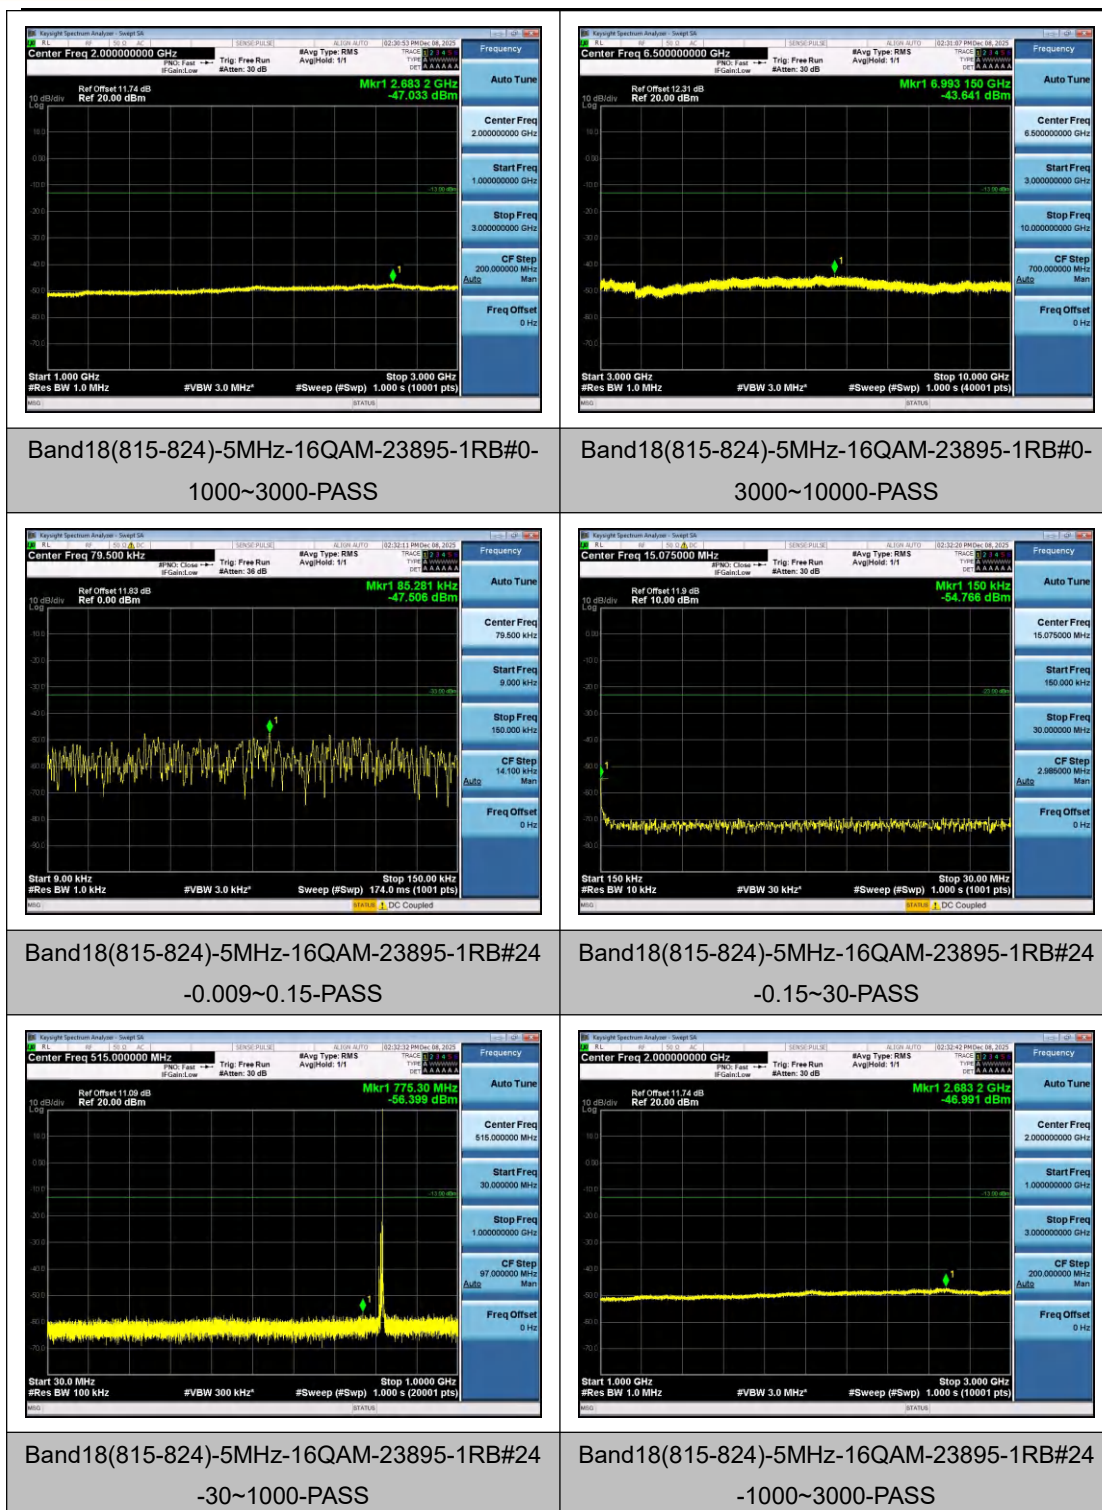


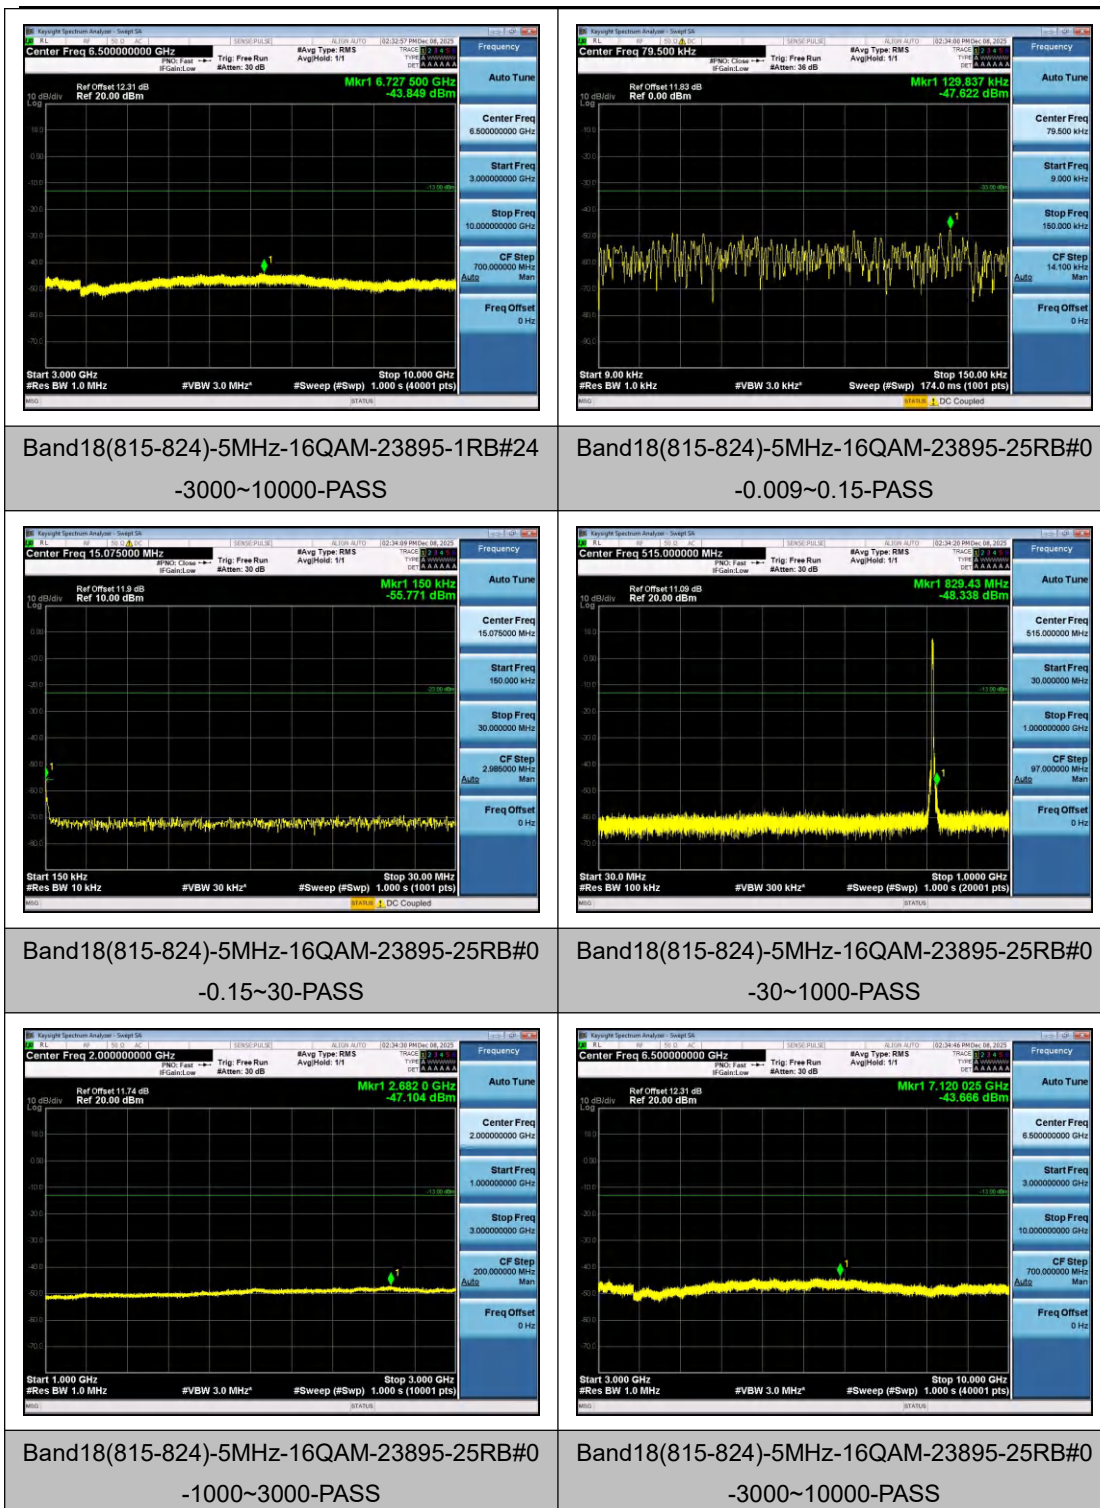


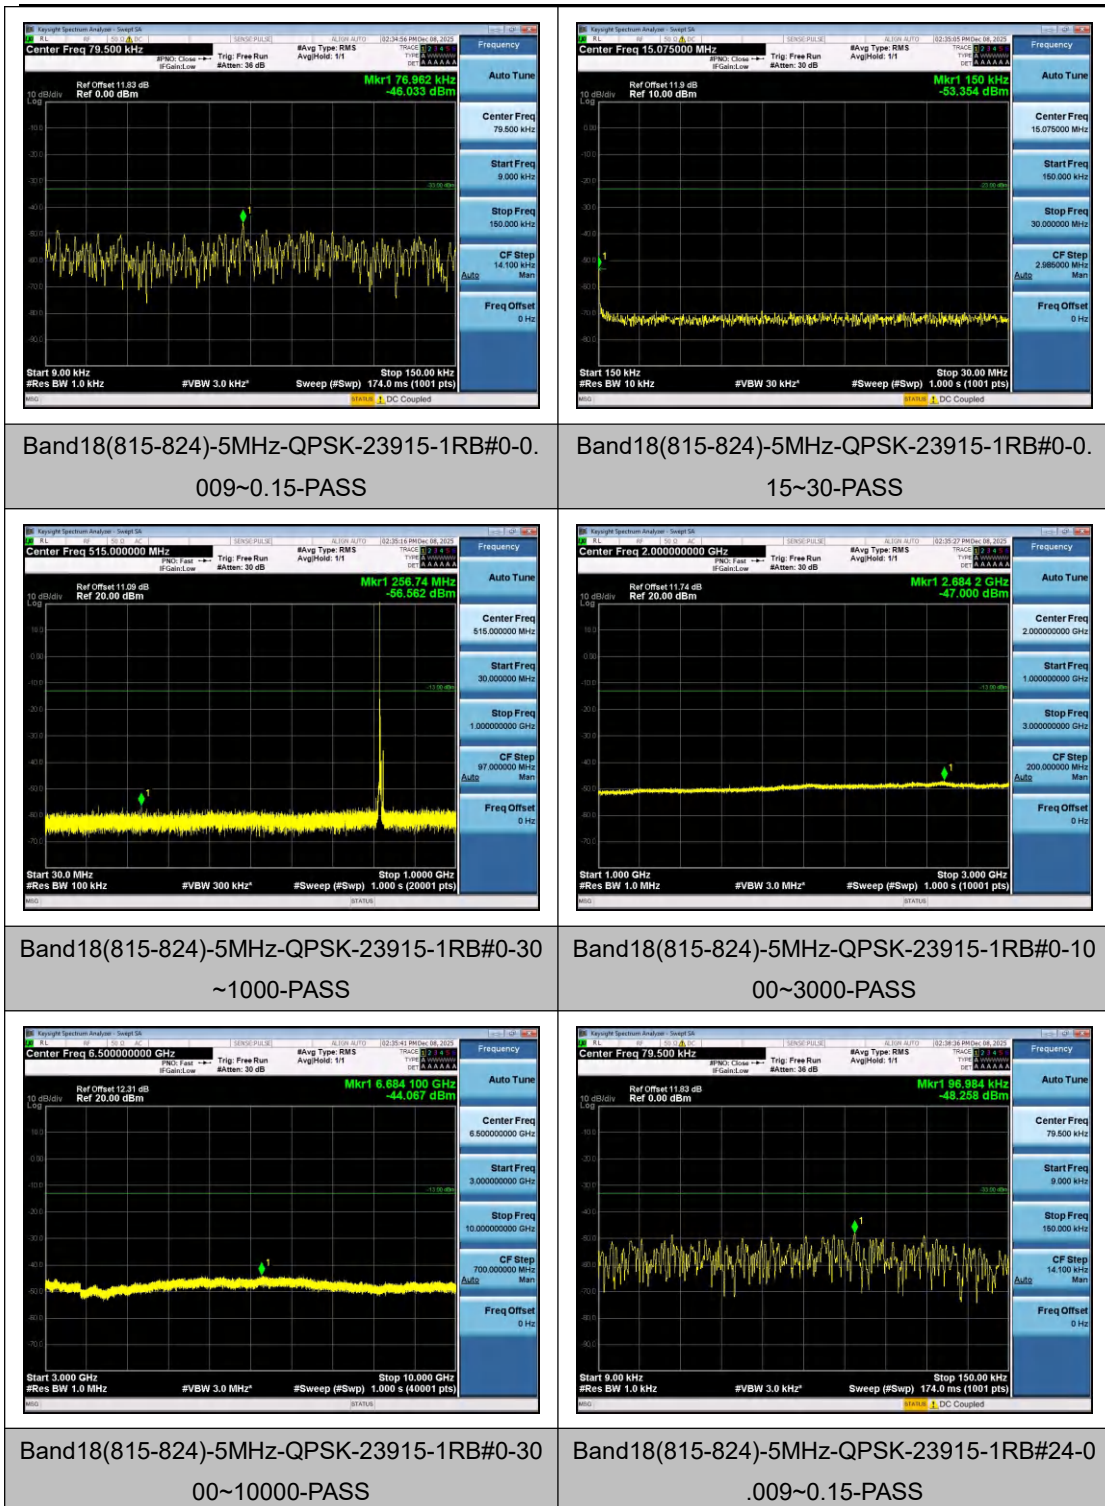


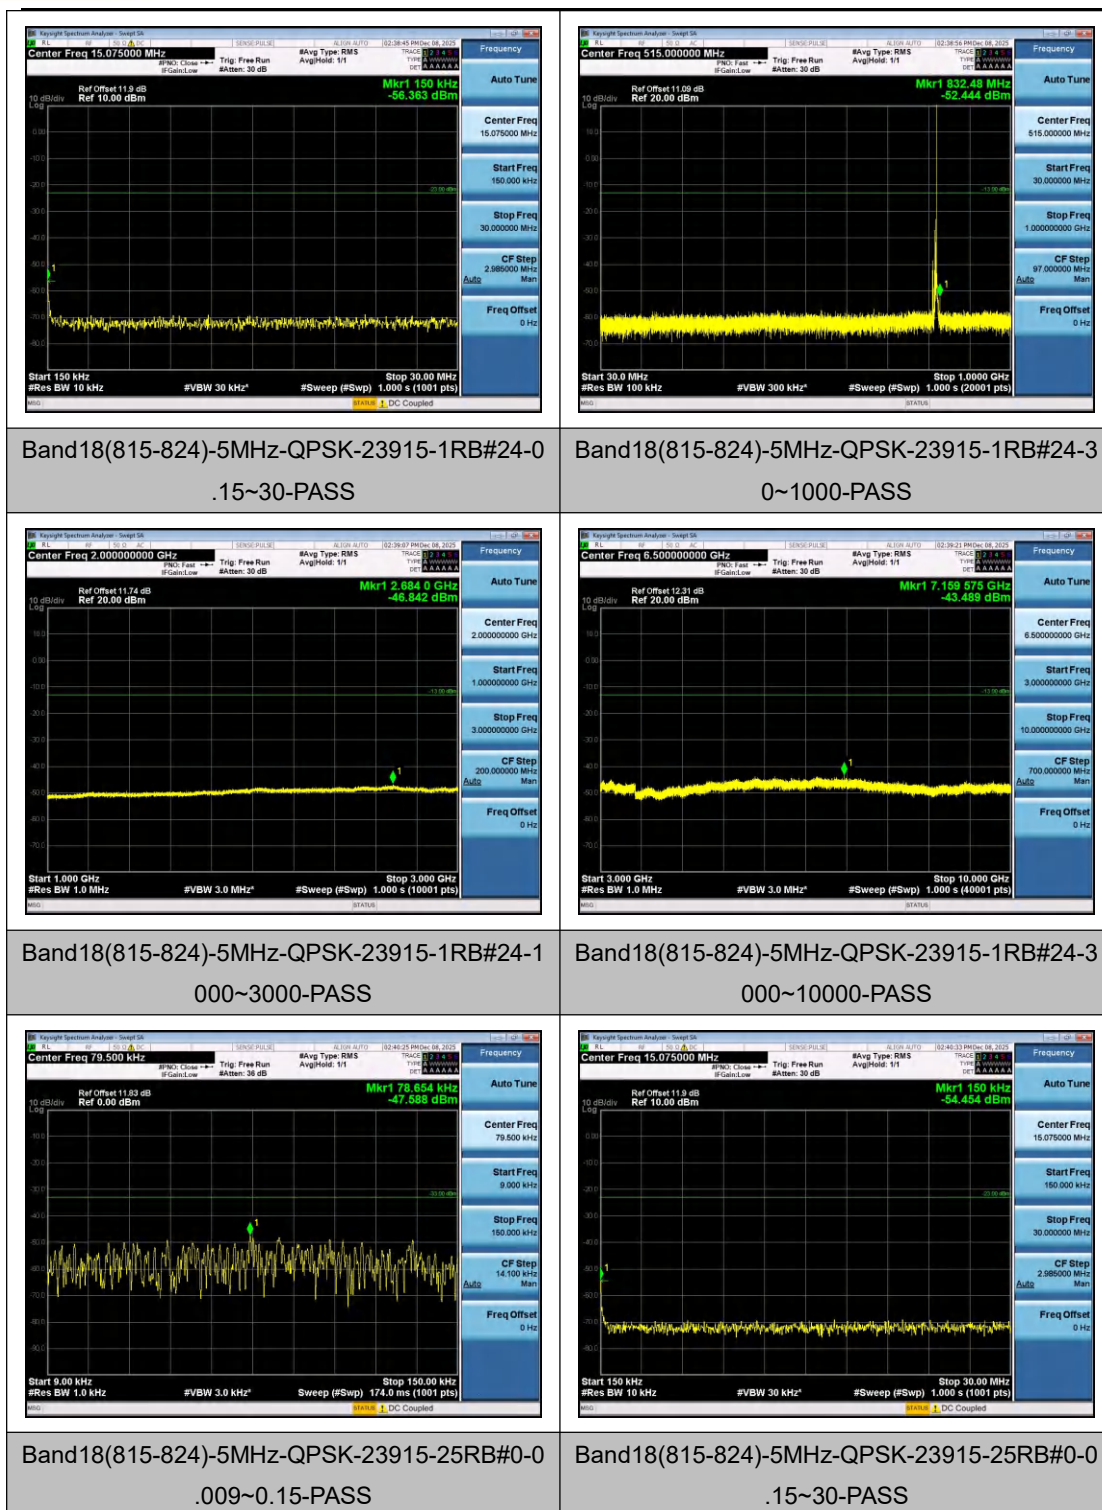


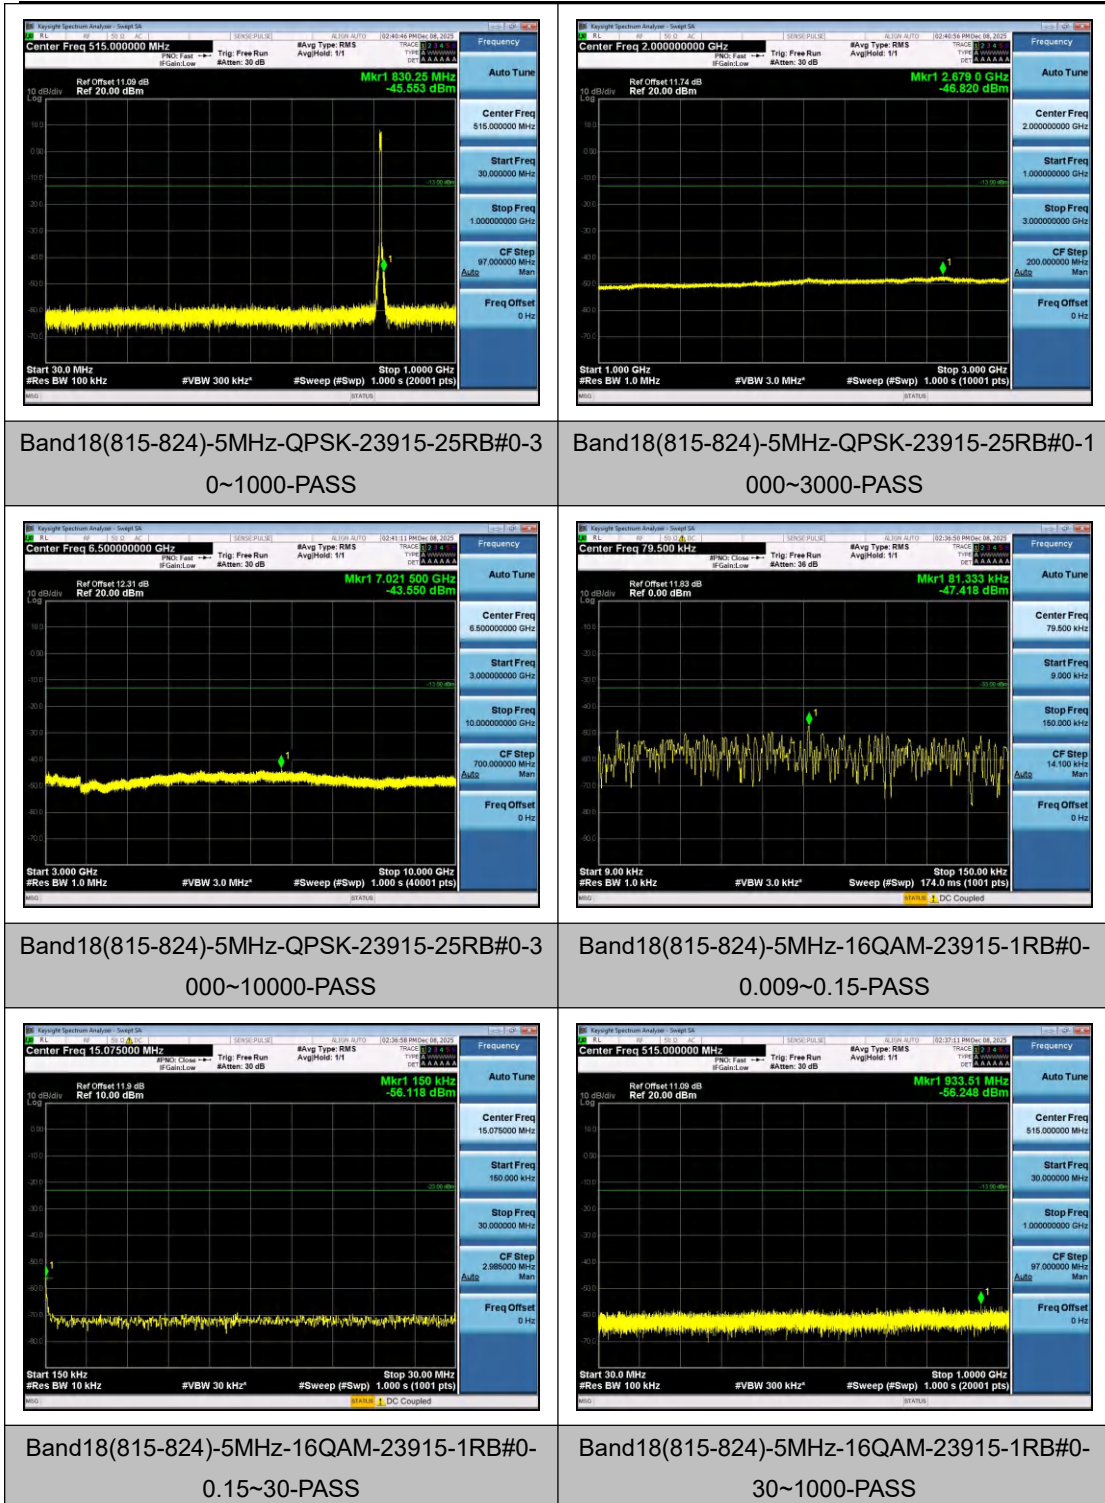


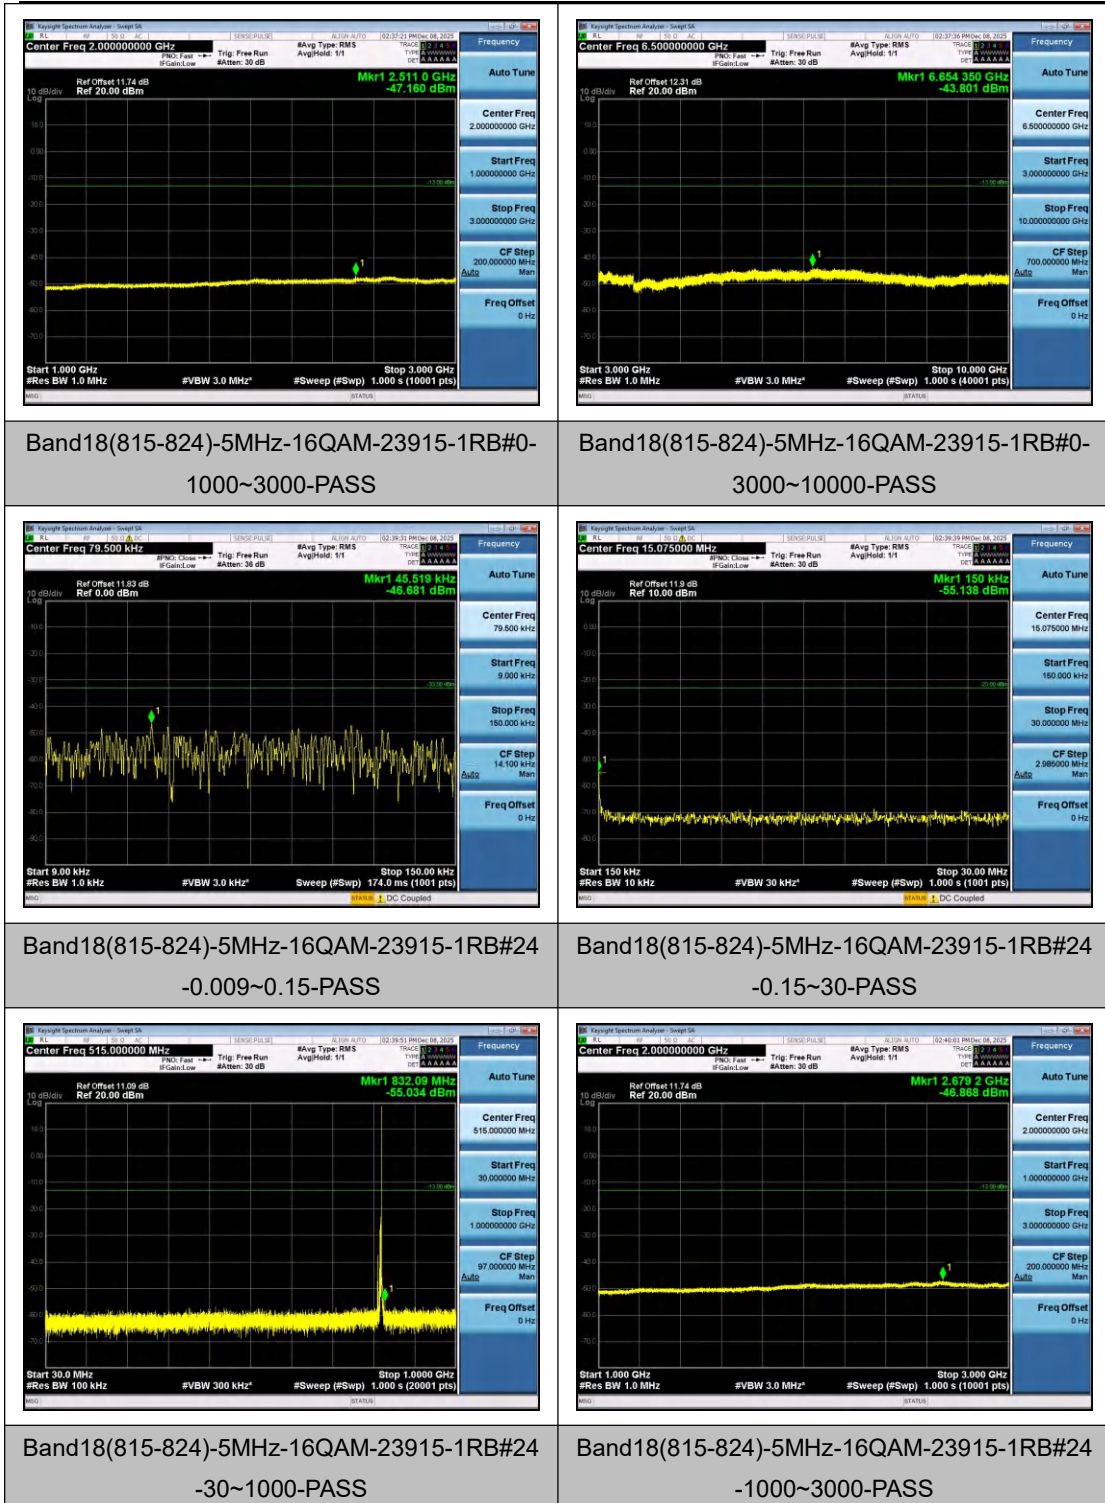


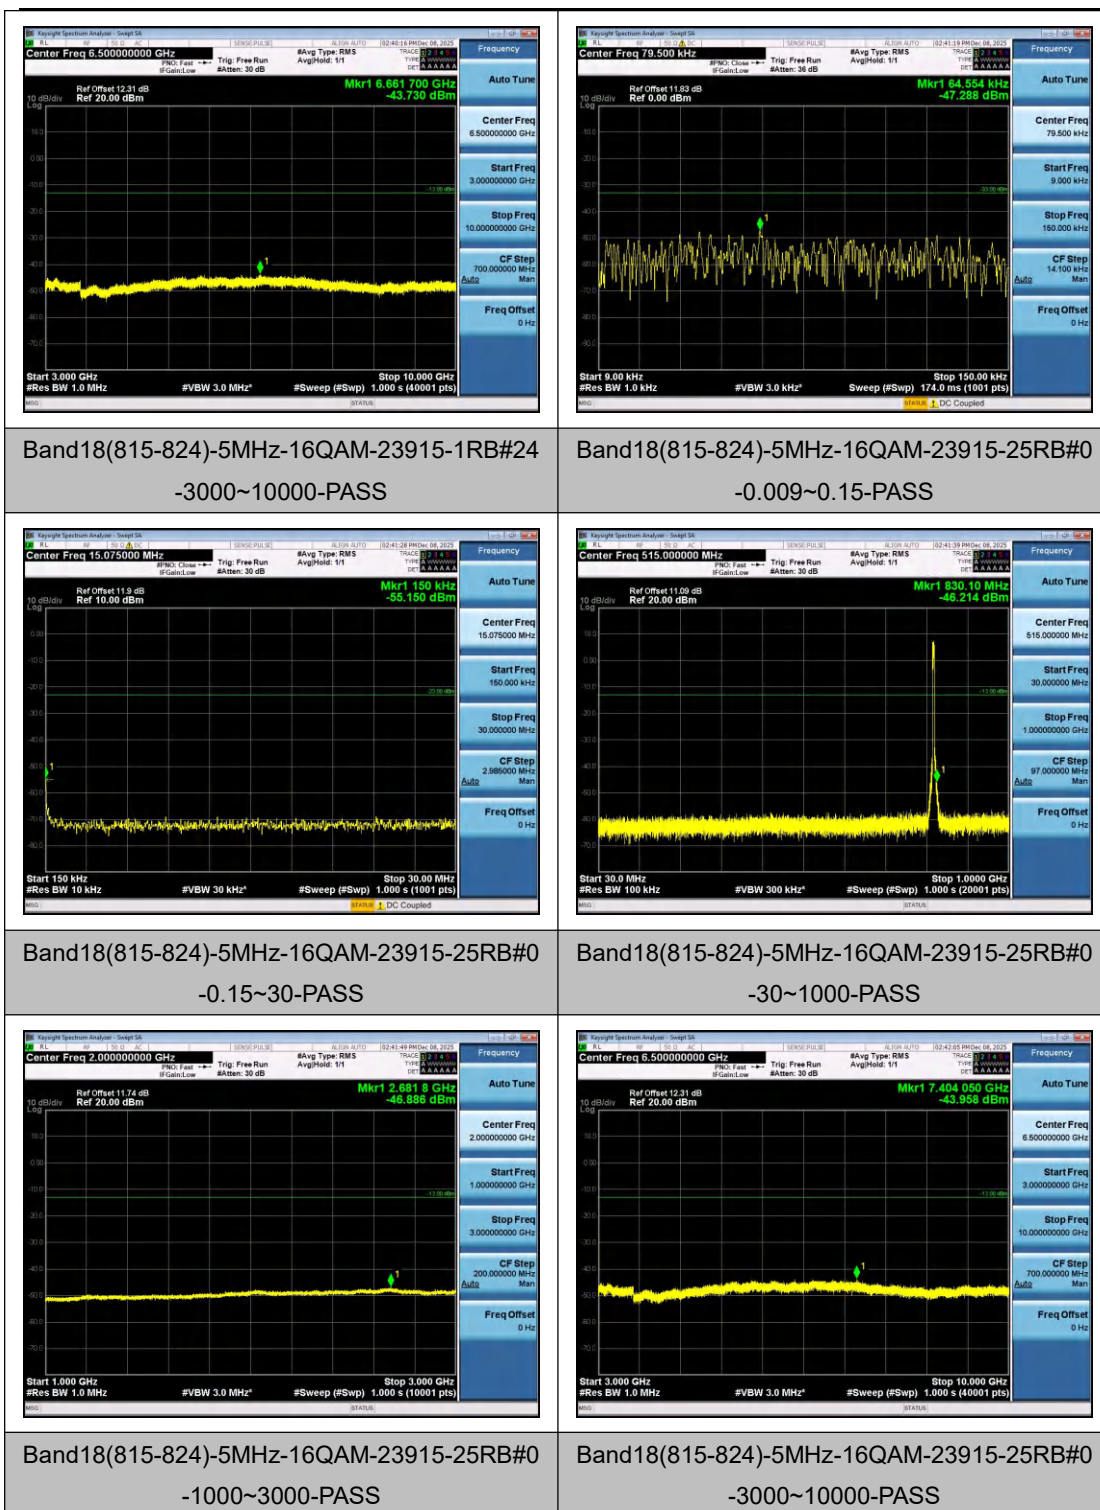


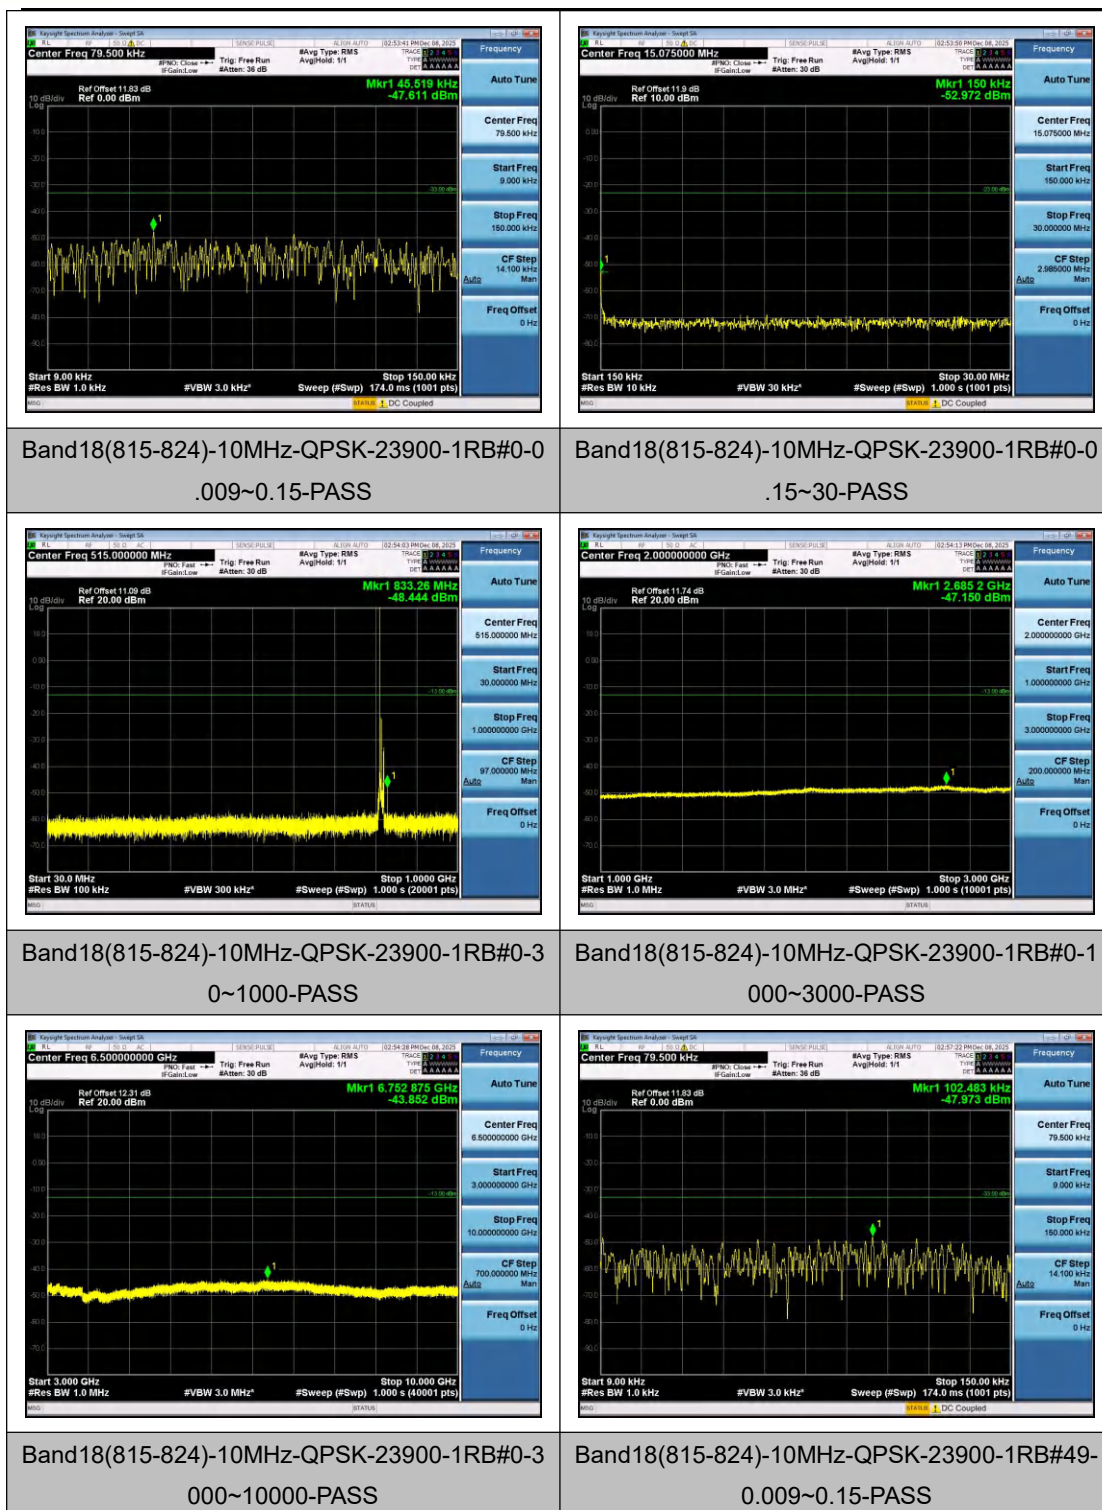

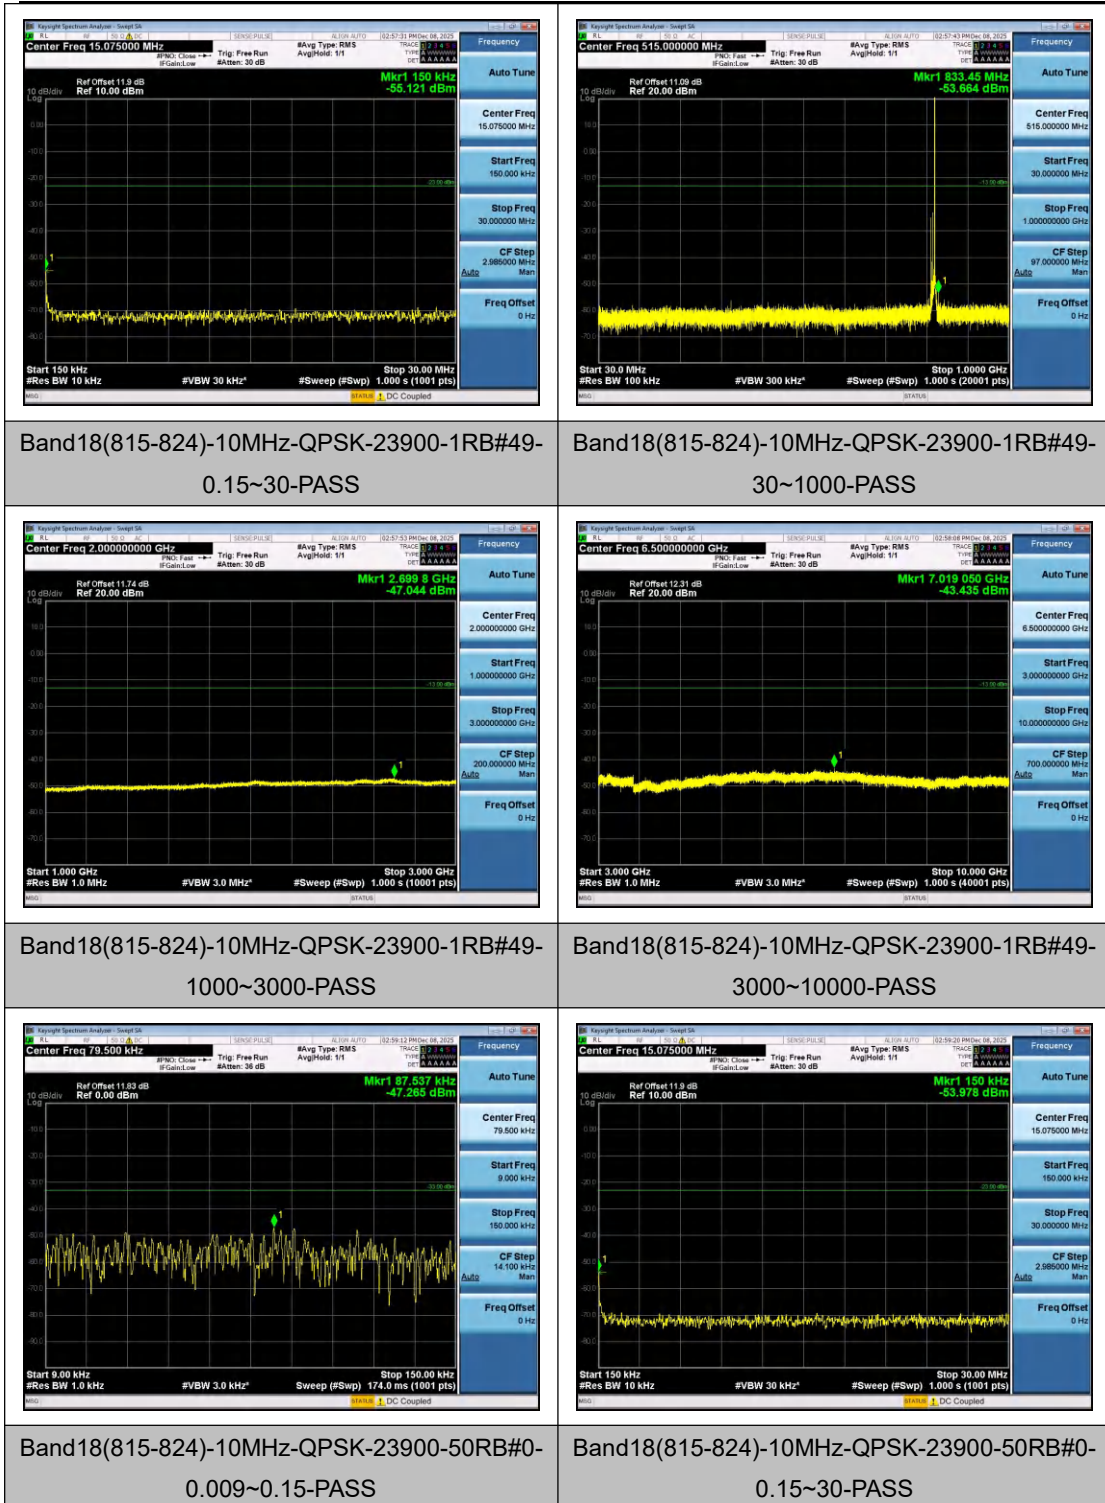

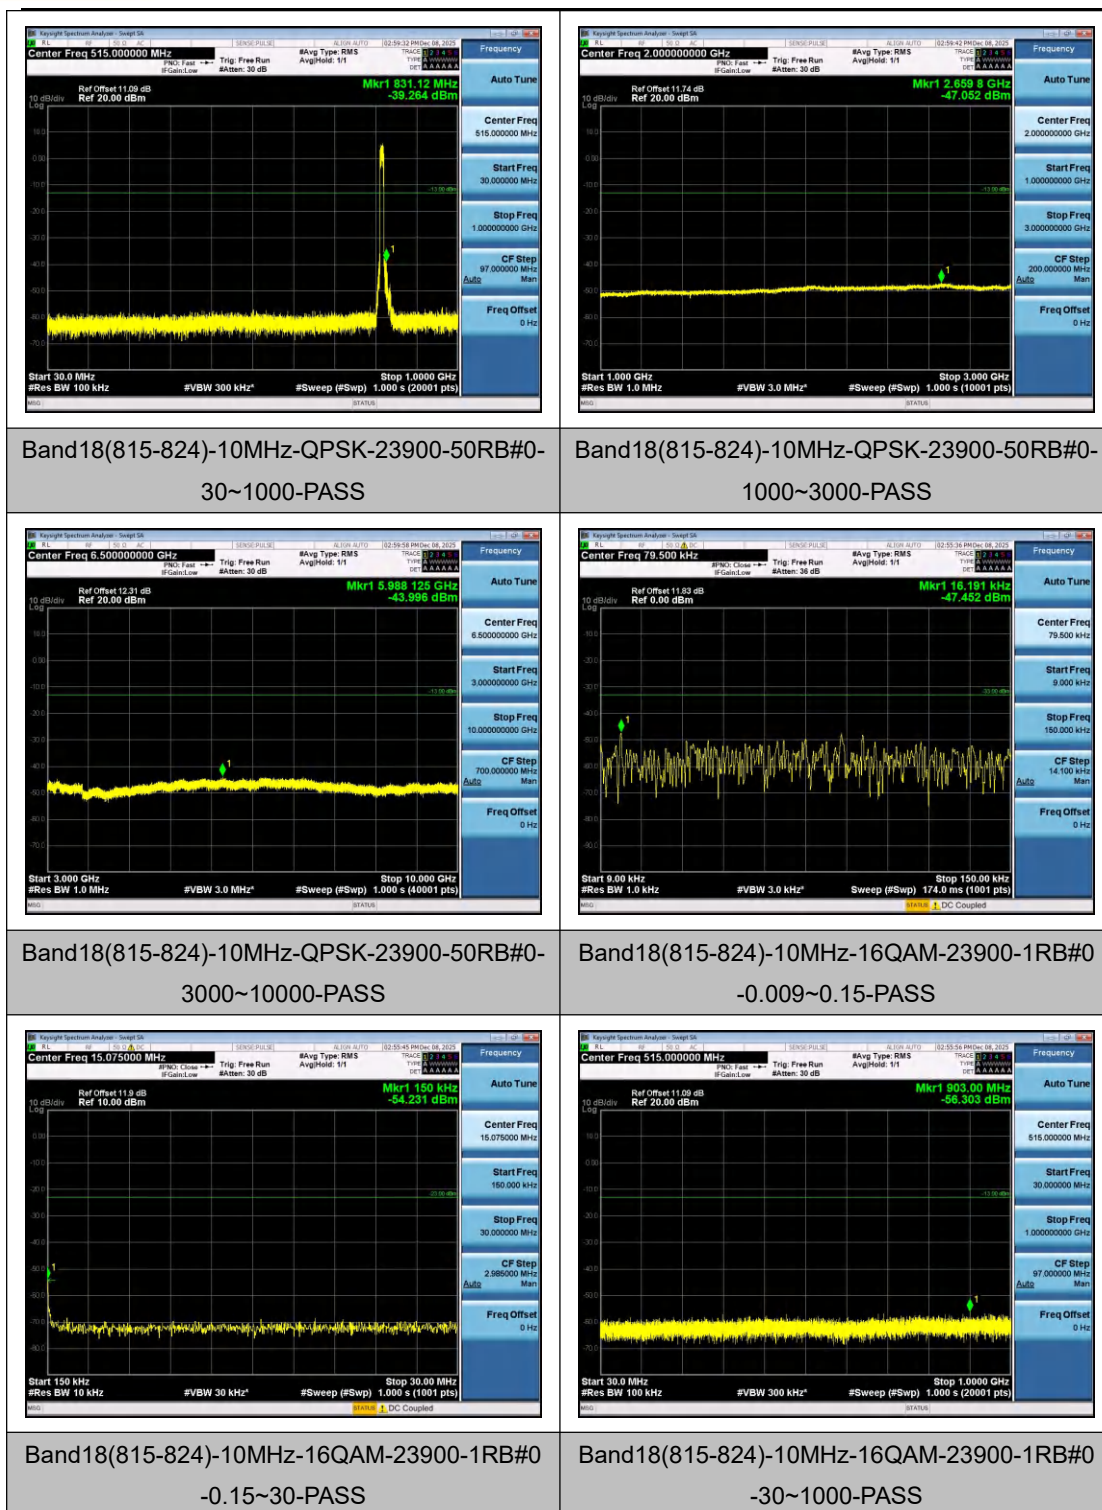

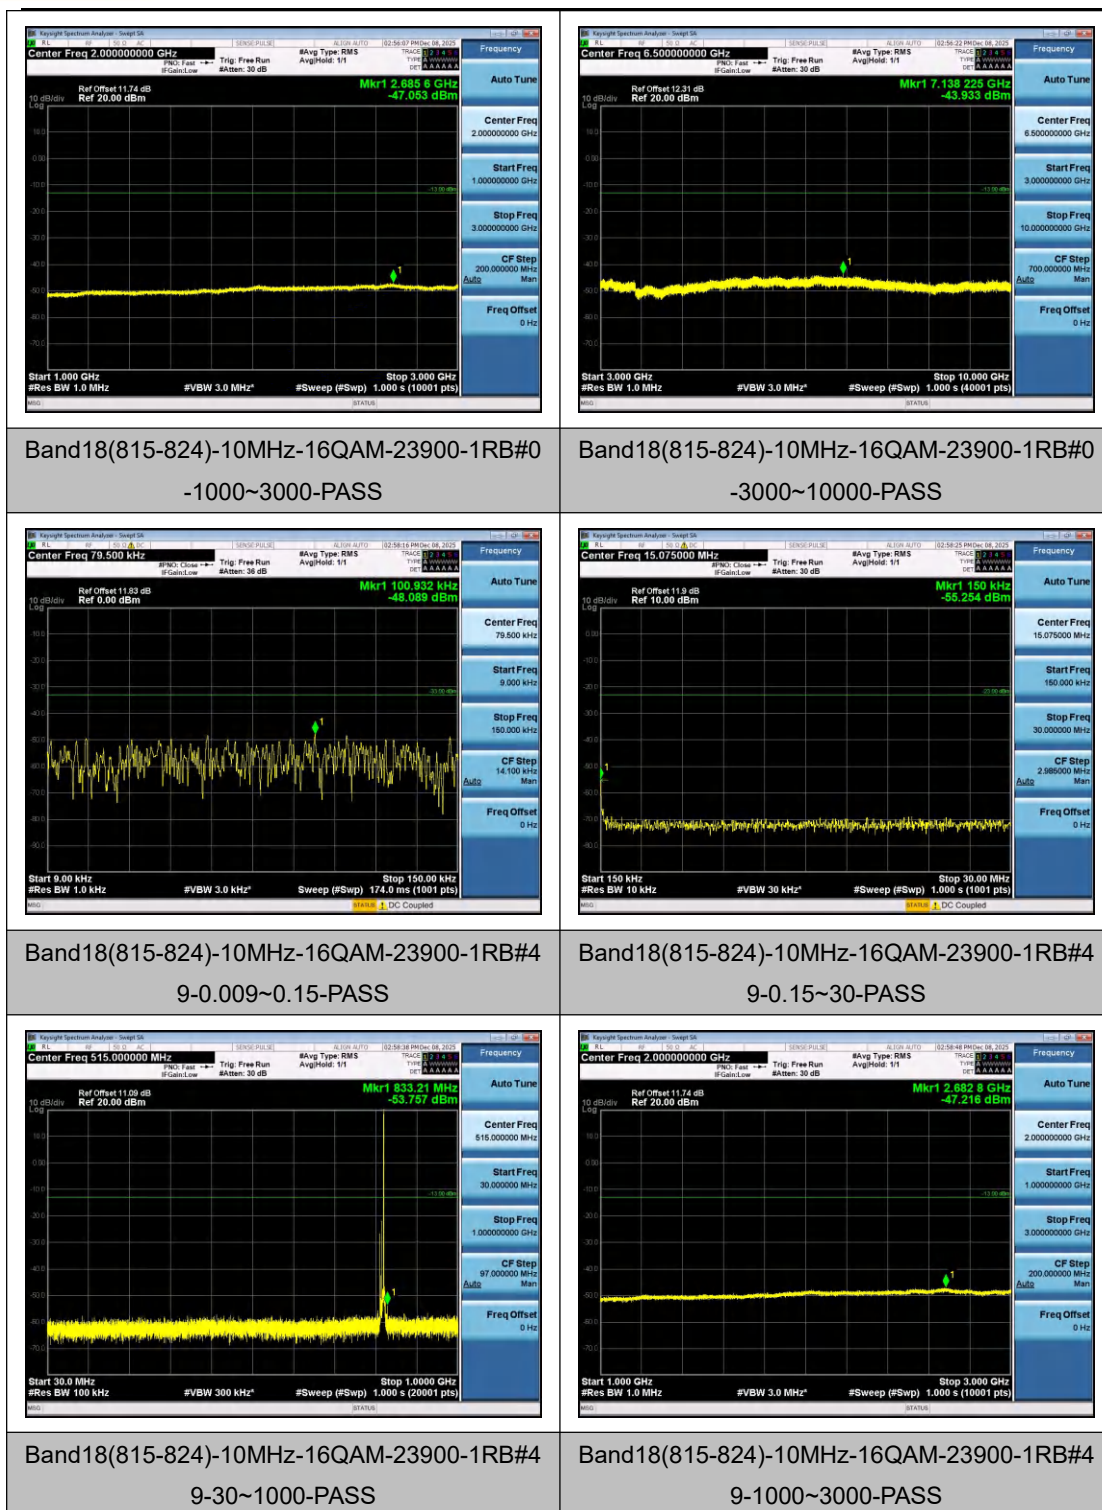

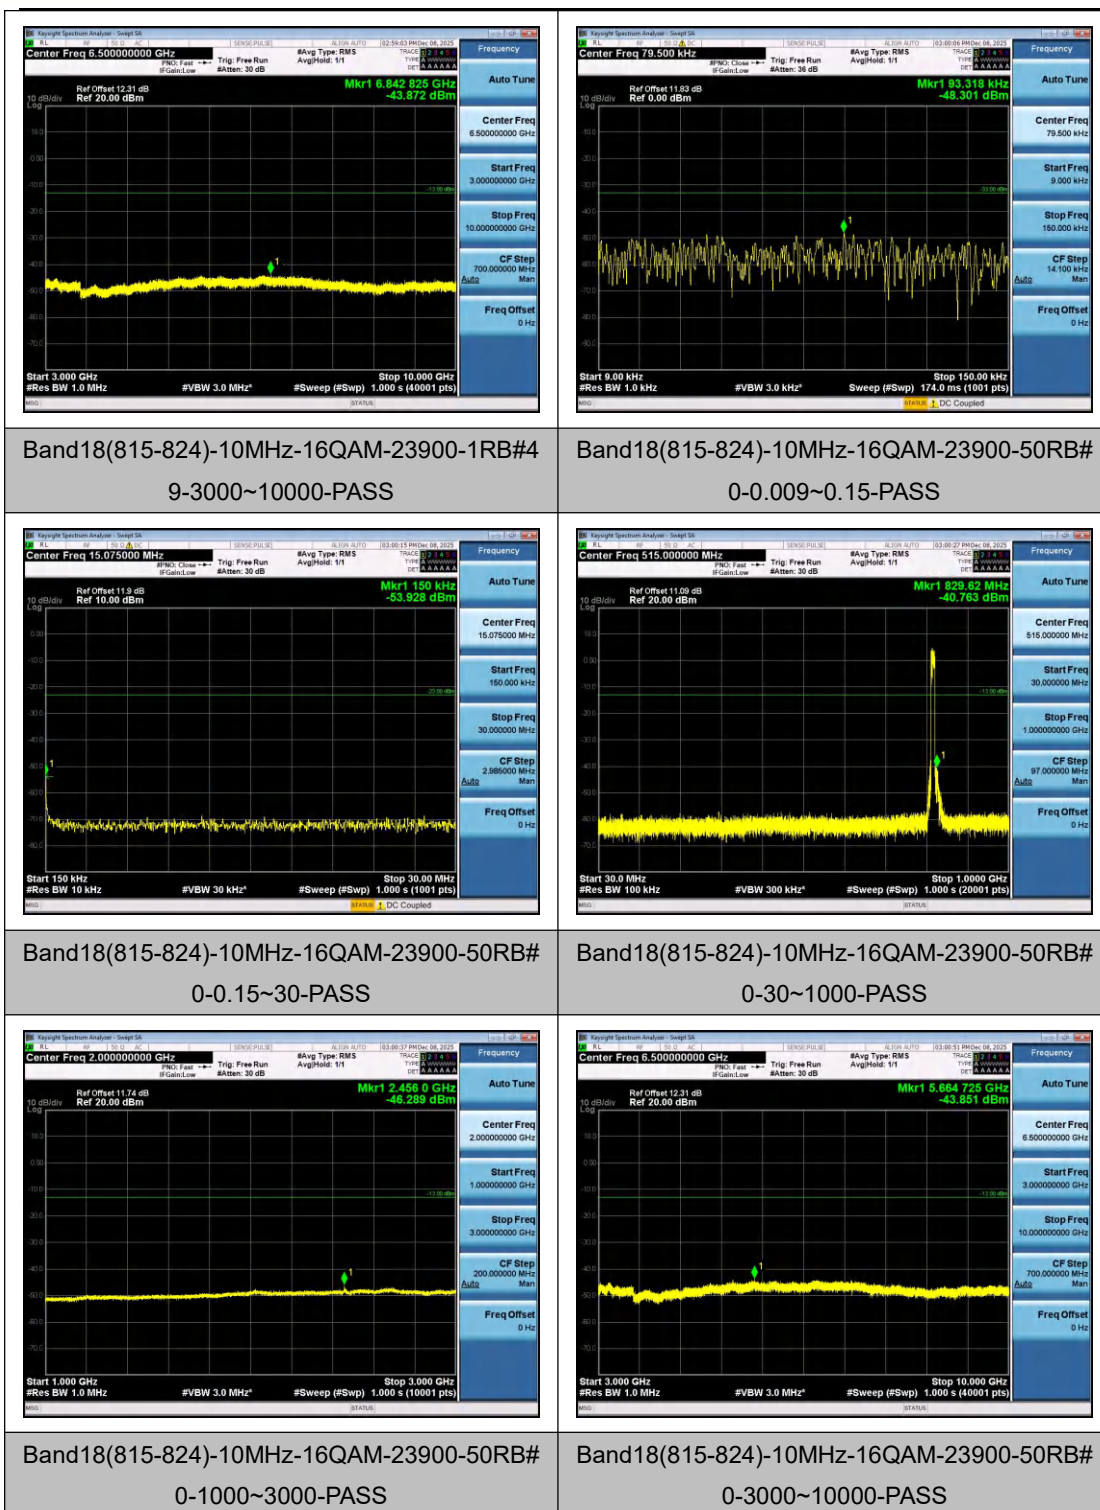

## Appendix F: Frequency Stability

### Test Result

| c                |           |            |         |              |               |                  |                |                 |             |         |
|------------------|-----------|------------|---------|--------------|---------------|------------------|----------------|-----------------|-------------|---------|
| Band             | Bandwidth | Modulation | Channel | RB Configure | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| Band18(8 15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | VN            | NT               | -3.30          | -0.004037       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | VL            | NT               | -3.68          | -0.004502       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | VH            | NT               | -3.28          | -0.004012       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | VN            | NT               | -2.36          | -0.002887       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | VL            | NT               | -3.50          | -0.004281       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | VH            | NT               | -2.52          | -0.003083       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23895   | 25RB#0       | VN            | NT               | -3.16          | -0.003856       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23895   | 25RB#0       | VL            | NT               | -2.95          | -0.003600       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23895   | 25RB#0       | VH            | NT               | -2.19          | -0.002672       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23895   | 25RB#0       | VN            | NT               | -2.05          | -0.002502       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23895   | 25RB#0       | VL            | NT               | -2.45          | -0.002990       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23895   | 25RB#0       | VH            | NT               | 3.46           | 0.004222        | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23915   | 25RB#0       | VN            | NT               | -2.19          | -0.002666       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23915   | 25RB#0       | VL            | NT               | 2.59           | 0.003153        | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | QPSK       | 23915   | 25RB#0       | VH            | NT               | -3.18          | -0.003871       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23915   | 25RB#0       | VN            | NT               | -3.86          | -0.004699       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23915   | 25RB#0       | VL            | NT               | -1.66          | -0.002021       | ±2.5        | PASS    |
| Band18(8 15-824) | 5MHz      | 16QAM      | 23915   | 25RB#0       | VH            | NT               | -4.11          | -0.005003       | ±2.5        | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                     |       |       |       |        |    |    |       |           |      |      |
|---------------------|-------|-------|-------|--------|----|----|-------|-----------|------|------|
| 15-824)             |       |       |       |        |    |    |       |           |      |      |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | VN | NT | -3.92 | -0.004780 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | VL | NT | -3.52 | -0.004293 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | VH | NT | -2.85 | -0.003476 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | VN | NT | -3.79 | -0.004622 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | VL | NT | -1.10 | -0.001341 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | VH | NT | 2.03  | 0.002476  | ±2.5 | PASS |

| Temperature         |           |            |         |              |               |                  |                |                 |             |         |
|---------------------|-----------|------------|---------|--------------|---------------|------------------|----------------|-----------------|-------------|---------|
| Band                | Bandwidth | Modulation | Channel | RB Configure | Voltage [Vdc] | Temperature (°C) | Deviation (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | -30              | -2.98          | -0.003645       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | -20              | -5.38          | -0.006581       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | -10              | -3.83          | -0.004685       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 0                | -4.48          | -0.005480       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 10               | -3.52          | -0.004306       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 20               | -3.46          | -0.004232       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 30               | -4.22          | -0.005162       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 40               | -3.72          | -0.004550       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | QPSK       | 23875   | 25RB#0       | NV            | 50               | -2.56          | -0.003131       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | NV            | -30              | -5.54          | -0.006777       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | NV            | -20              | -2.37          | -0.002899       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | NV            | -10              | -2.78          | -0.003401       | ±2.5        | PASS    |
| Band18(8<br>15-824) | 5MHz      | 16QAM      | 23875   | 25RB#0       | NV            | 0                | 1.72           | 0.002104        | ±2.5        | PASS    |

**Shenzhen Anbotech Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotech.com](http://www.anbotech.com) E-mail: [service@anbotech.com](mailto:service@anbotech.com)

|                     |      |       |       |        |    |     |       |           |      |      |
|---------------------|------|-------|-------|--------|----|-----|-------|-----------|------|------|
| 15-824)             |      |       |       |        |    |     |       |           |      |      |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23875 | 25RB#0 | NV | 10  | -2.99 | -0.003657 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23875 | 25RB#0 | NV | 20  | -3.46 | -0.004232 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23875 | 25RB#0 | NV | 30  | -4.08 | -0.004991 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23875 | 25RB#0 | NV | 40  | -3.93 | -0.004807 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23875 | 25RB#0 | NV | 50  | -2.99 | -0.003657 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | -30 | -2.73 | -0.003331 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | -20 | 2.82  | 0.003441  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | -10 | -2.16 | -0.002636 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 0   | 2.75  | 0.003356  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 10  | -1.72 | -0.002099 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 20  | -4.43 | -0.005406 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 30  | -1.85 | -0.002257 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 40  | -2.62 | -0.003197 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | QPSK  | 23895 | 25RB#0 | NV | 50  | -2.20 | -0.002685 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | -30 | 3.05  | 0.003722  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | -20 | -2.99 | -0.003649 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | -10 | -2.35 | -0.002868 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | 0   | 2.66  | 0.003246  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | 10  | 2.59  | 0.003160  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | 20  | -3.46 | -0.004222 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz | 16QAM | 23895 | 25RB#0 | NV | 30  | -2.56 | -0.003124 | ±2.5 | PASS |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                     |       |       |       |        |    |     |       |           |      |      |
|---------------------|-------|-------|-------|--------|----|-----|-------|-----------|------|------|
| 15-824)             |       |       |       |        |    |     |       |           |      |      |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23895 | 25RB#0 | NV | 40  | 2.89  | 0.003527  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23895 | 25RB#0 | NV | 50  | 1.66  | 0.002026  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | -30 | -1.80 | -0.002191 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | -20 | -3.78 | -0.004601 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | -10 | -2.89 | -0.003518 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 0   | -2.62 | -0.003189 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 10  | -5.45 | -0.006634 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 20  | -1.57 | -0.001911 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 30  | -3.12 | -0.003798 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 40  | -3.75 | -0.004565 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | QPSK  | 23915 | 25RB#0 | NV | 50  | -3.12 | -0.003798 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | -30 | 3.10  | 0.003774  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | -20 | 3.02  | 0.003676  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | -10 | 1.82  | 0.002215  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 0   | -2.43 | -0.002958 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 10  | -2.53 | -0.003080 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 20  | -3.22 | -0.003920 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 30  | -4.42 | -0.005380 | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 40  | 1.96  | 0.002386  | ±2.5 | PASS |
| Band18(8<br>15-824) | 5MHz  | 16QAM | 23915 | 25RB#0 | NV | 50  | -1.69 | -0.002057 | ±2.5 | PASS |
| Band18(8            | 10MHz | QPSK  | 23900 | 50RB#0 | NV | -30 | -1.92 | -0.002341 | ±2.5 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|                     |       |       |       |        |    |     |       |           |      |      |
|---------------------|-------|-------|-------|--------|----|-----|-------|-----------|------|------|
| 15-824)             |       |       |       |        |    |     |       |           |      |      |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | -20 | -3.28 | -0.004000 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | -10 | 1.86  | 0.002268  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 0   | 2.79  | 0.003402  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 10  | -1.54 | -0.001878 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 20  | 1.79  | 0.002183  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 30  | -2.83 | -0.003451 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 40  | -3.62 | -0.004415 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | QPSK  | 23900 | 50RB#0 | NV | 50  | 1.96  | 0.002390  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | -30 | -2.75 | -0.003354 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | -20 | -2.65 | -0.003232 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | -10 | 2.73  | 0.003329  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 0   | 2.96  | 0.003610  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 10  | -2.95 | -0.003598 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 20  | -2.46 | -0.003000 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 30  | 1.80  | 0.002195  | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 40  | -2.73 | -0.003329 | ±2.5 | PASS |
| Band18(8<br>15-824) | 10MHz | 16QAM | 23900 | 50RB#0 | NV | 50  | -2.06 | -0.002512 | ±2.5 | PASS |

---END---