

Appendix Test Data

Report No:	1812C50616812505-08	Test Sample NO:	1-2-2
Start Test Date:	2025-11-21	Finish Test Date:	2025-12-8
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24°C	Relative Humidity:	44%
Pressure:	101 kPa		



Appendix A:Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band18(824-830)	5MHz	QPSK	23965	1RB#0	23.61	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#12	23.71	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	23.93	PASS
Band18(824-830)	5MHz	QPSK	23965	12RB#0	22.72	PASS
Band18(824-830)	5MHz	QPSK	23965	12RB#6	22.78	PASS
Band18(824-830)	5MHz	QPSK	23965	12RB#13	22.81	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	22.68	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	22.89	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#12	22.90	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	23.16	PASS
Band18(824-830)	5MHz	16QAM	23965	12RB#0	21.67	PASS
Band18(824-830)	5MHz	16QAM	23965	12RB#6	21.91	PASS
Band18(824-830)	5MHz	16QAM	23965	12RB#13	21.81	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	21.71	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	23.76	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#12	23.72	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#24	23.95	PASS
Band18(824-830)	5MHz	QPSK	23970	12RB#0	22.73	PASS
Band18(824-830)	5MHz	QPSK	23970	12RB#6	22.74	PASS
Band18(824-830)	5MHz	QPSK	23970	12RB#13	22.93	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	22.81	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	23.11	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#12	22.94	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	22.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band18(824-830)	5MHz	16QAM	23970	12RB#0	21.74	PASS
Band18(824-830)	5MHz	16QAM	23970	12RB#6	21.60	PASS
Band18(824-830)	5MHz	16QAM	23970	12RB#13	21.86	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	21.82	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	23.65	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#12	0.00	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	23.81	PASS
Band18(824-830)	5MHz	QPSK	23975	12RB#0	22.65	PASS
Band18(824-830)	5MHz	QPSK	23975	12RB#6	22.75	PASS
Band18(824-830)	5MHz	QPSK	23975	12RB#13	22.85	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	22.78	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	22.74	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#12	22.80	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	23.08	PASS
Band18(824-830)	5MHz	16QAM	23975	12RB#0	21.70	PASS
Band18(824-830)	5MHz	16QAM	23975	12RB#6	21.76	PASS
Band18(824-830)	5MHz	16QAM	23975	12RB#13	21.76	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	21.76	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	23.83	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#24	23.98	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	23.95	PASS
Band18(824-830)	10MHz	QPSK	23950	25RB#0	22.82	PASS
Band18(824-830)	10MHz	QPSK	23950	25RB#12	22.81	PASS
Band18(824-830)	10MHz	QPSK	23950	25RB#25	22.91	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	22.93	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	22.91	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#24	22.74	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	22.97	PASS
Band18(824-830)	10MHz	16QAM	23950	25RB#0	21.78	PASS
Band18(824-830)	10MHz	16QAM	23950	25RB#12	21.77	PASS
Band18(824-830)	10MHz	16QAM	23950	25RB#25	21.83	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	21.83	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	23.64	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#38	23.77	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	24.09	PASS
Band18(824-830)	15MHz	QPSK	23925	38RB#0	22.77	PASS
Band18(824-830)	15MHz	QPSK	23925	38RB#18	22.90	PASS
Band18(824-830)	15MHz	QPSK	23925	38RB#37	22.86	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	22.85	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	22.56	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#38	22.81	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	23.05	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band18(824-830)	15MHz	16QAM	23925	38RB#0	22.78	PASS
Band18(824-830)	15MHz	16QAM	23925	38RB#18	21.84	PASS
Band18(824-830)	15MHz	16QAM	23925	38RB#37	22.85	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	21.79	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix B: Peak-to-Average Ratio(CCDF)


Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band18(824-830)	5MHz	QPSK	23965	1RB#0	4.79	13	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	5.38	13	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	5.86	13	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	6.19	13	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	4.77	13	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	5.42	13	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	5.80	13	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	6.20	13	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	4.75	13	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	5.38	13	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	5.82	13	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	6.19	13	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	4.77	13	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	5.32	13	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	5.82	13	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	6.16	13	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	4.59	13	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	5.60	13	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	5.62	13	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	6.25	13	PASS

Test Graphs

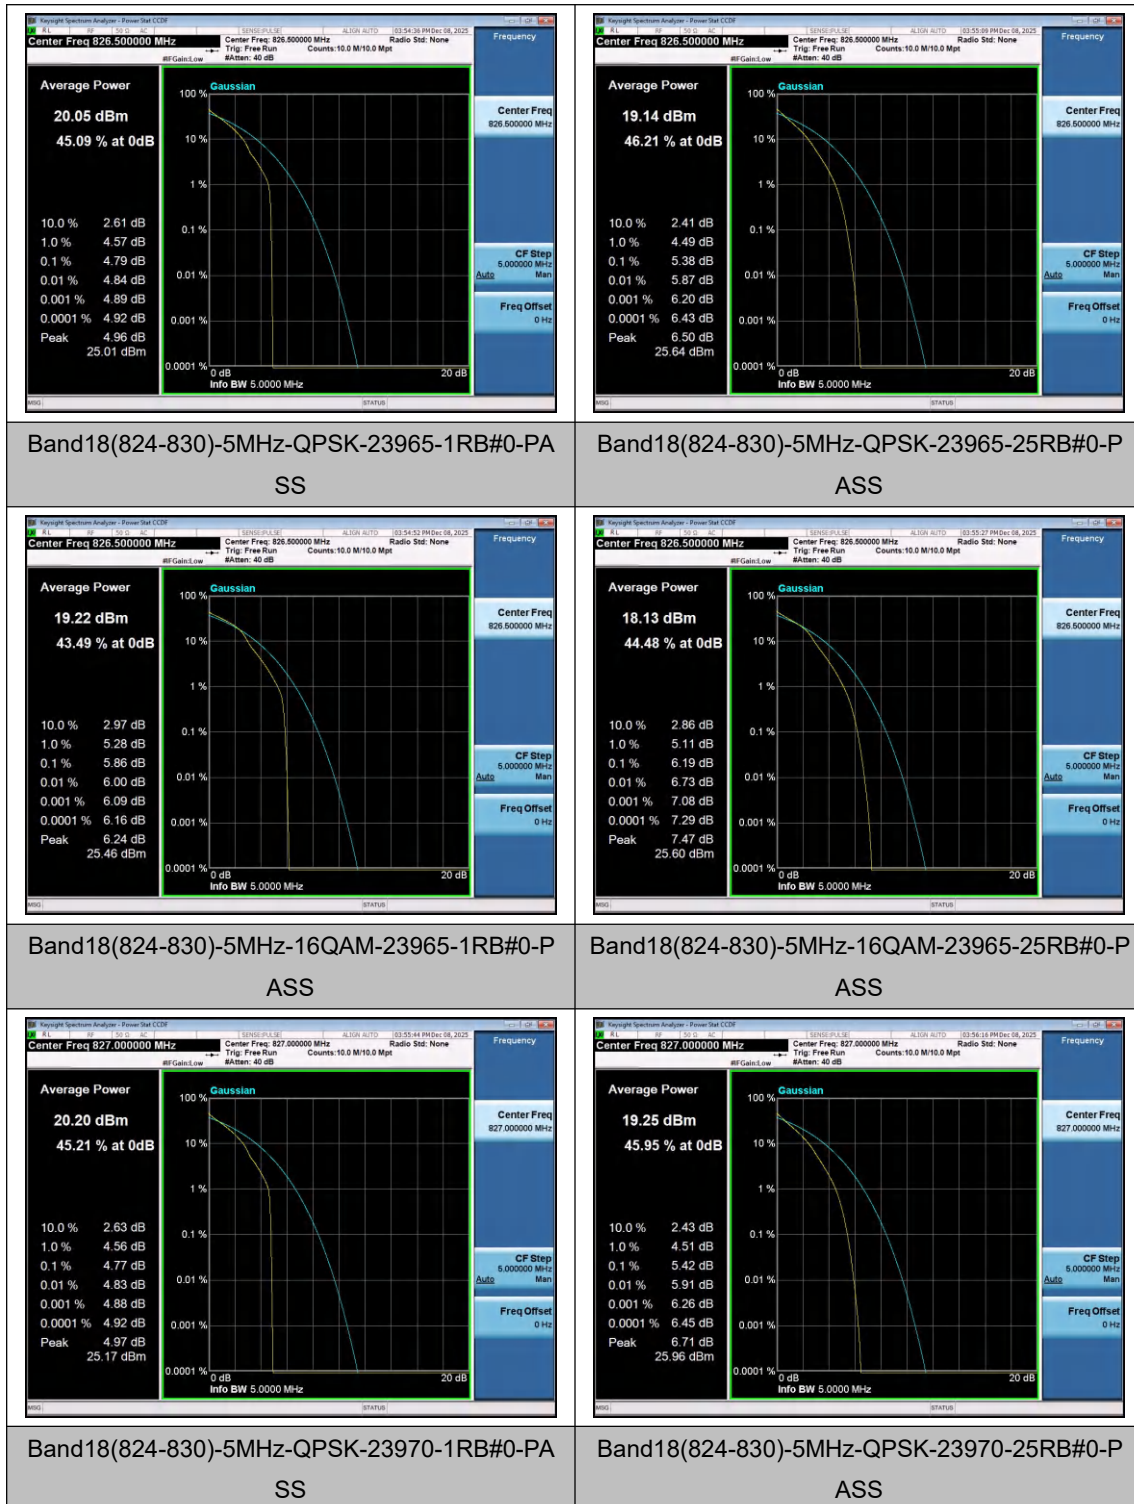

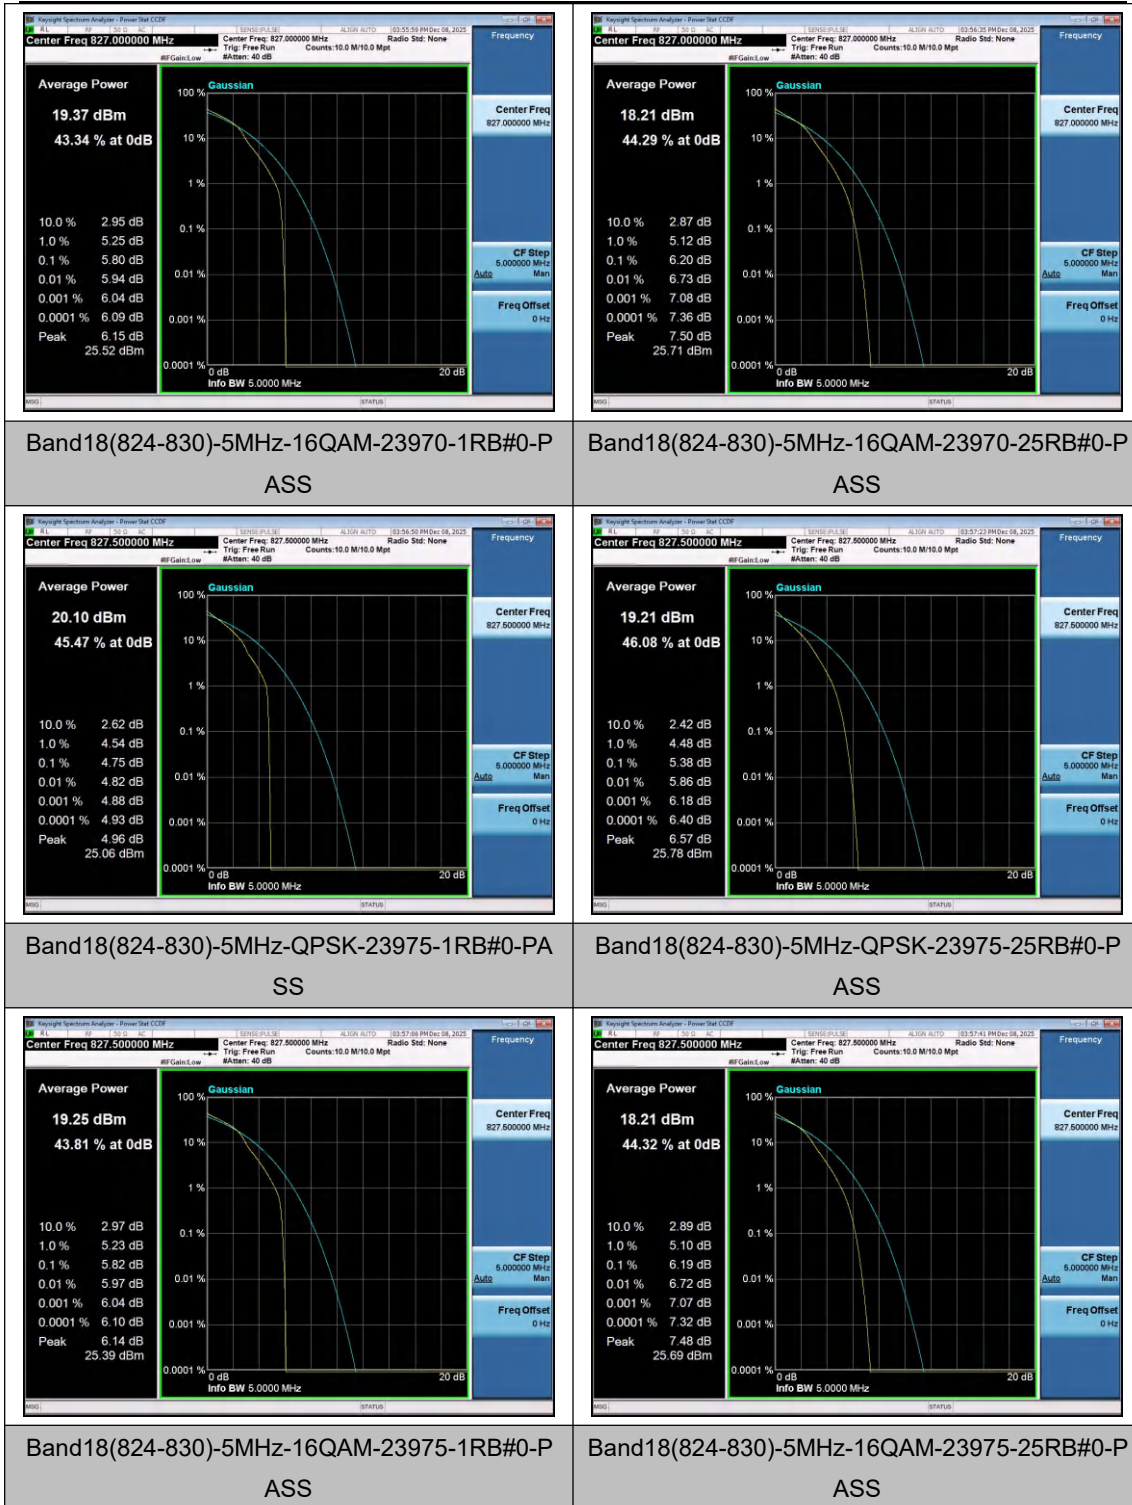

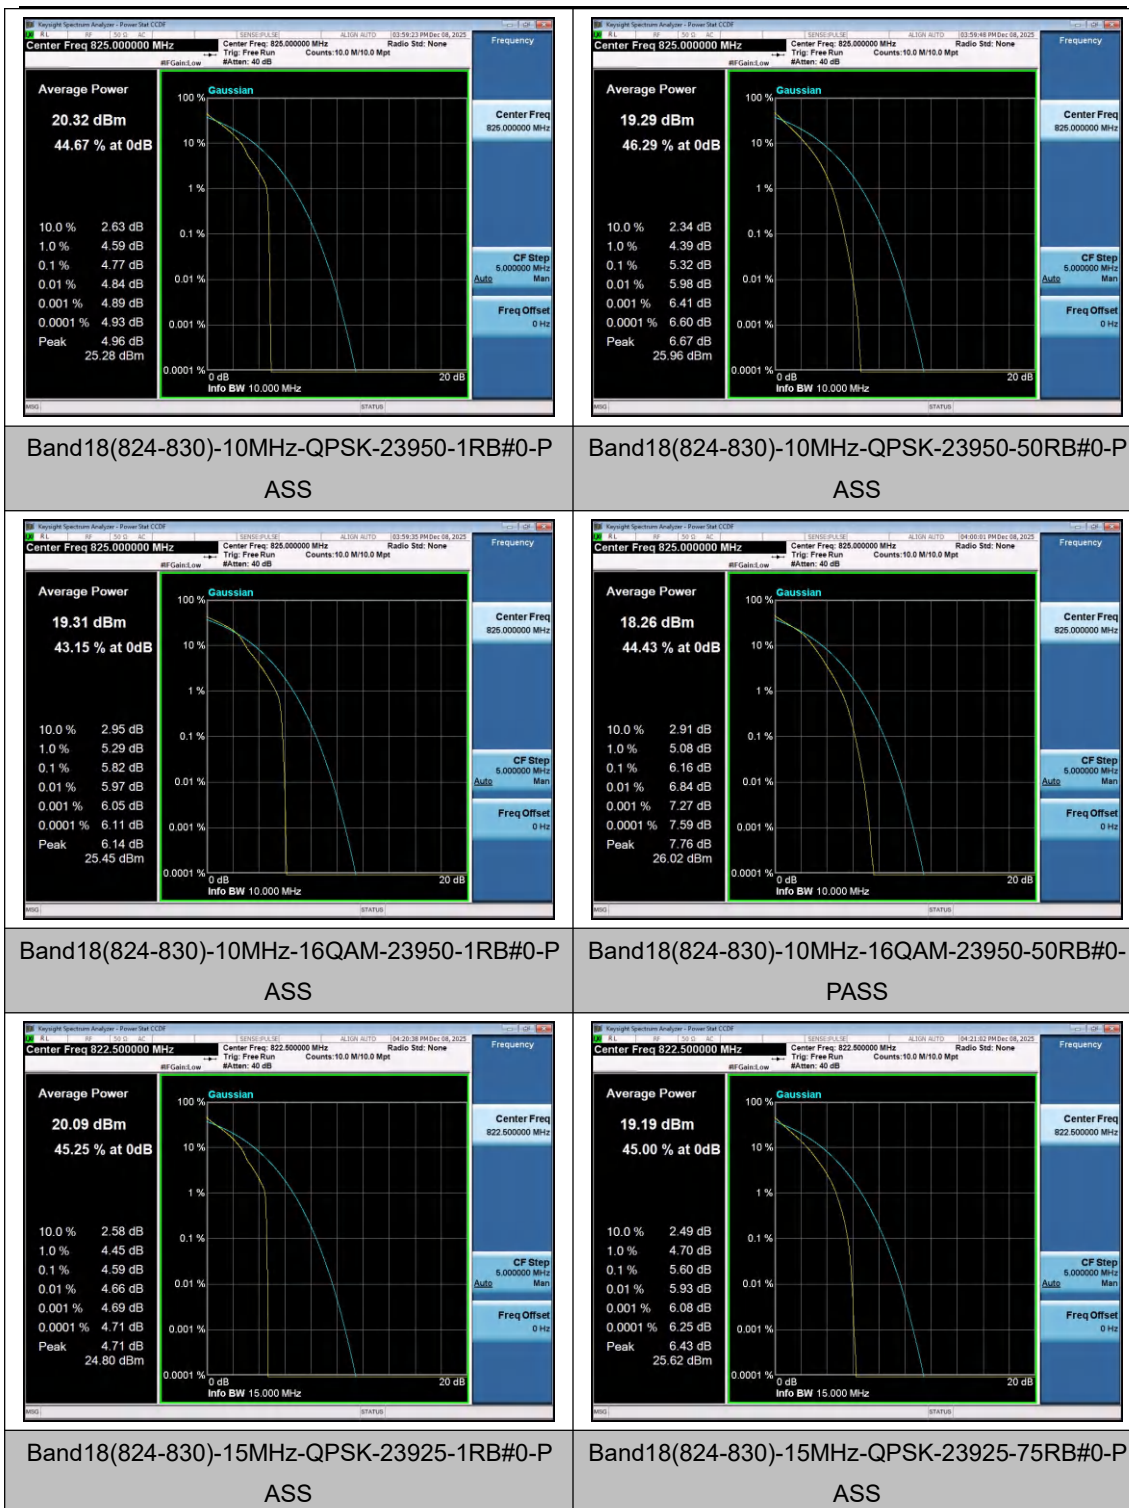

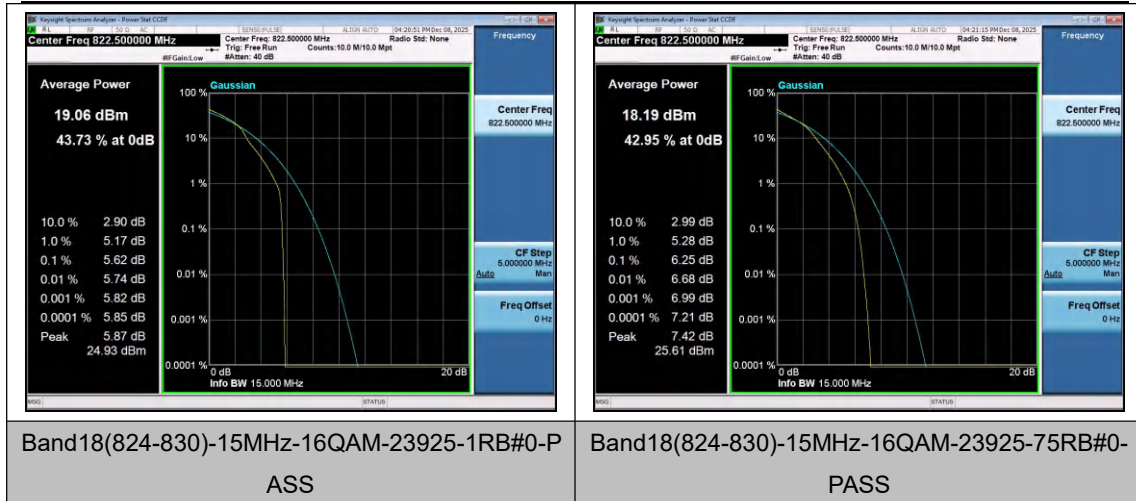

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band18(824-830)	5MHz	QPSK	23965	25RB#0	4.5113	5.036	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	4.5001	4.994	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	4.5076	4.983	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	4.5187	5.011	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	4.5081	5.003	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	4.5118	4.963	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	8.9581	9.848	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	8.9642	9.834	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	13.474	14.65	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	13.471	14.72	PASS

Test Graphs

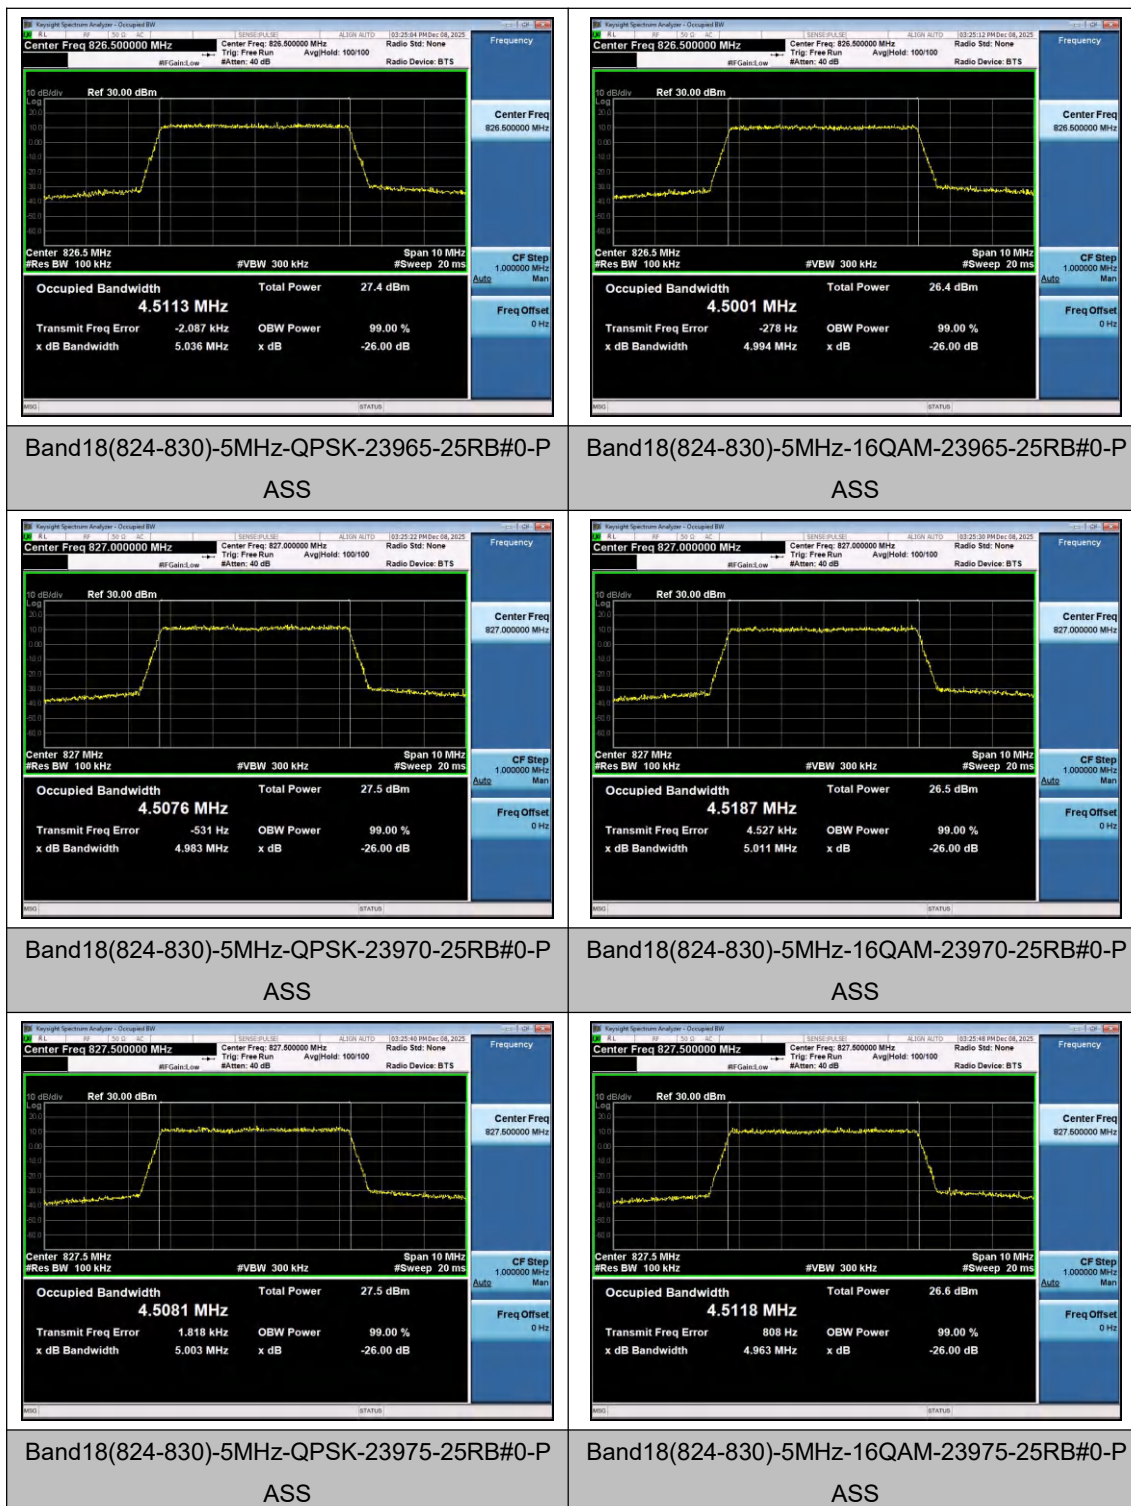


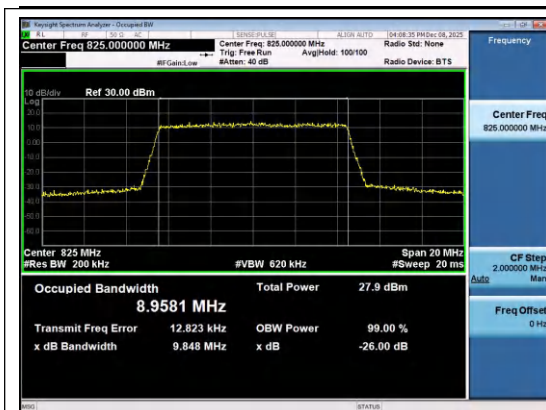


Band18(824-830)-10MHz-QPSK-23950-50RB#0-
PASS

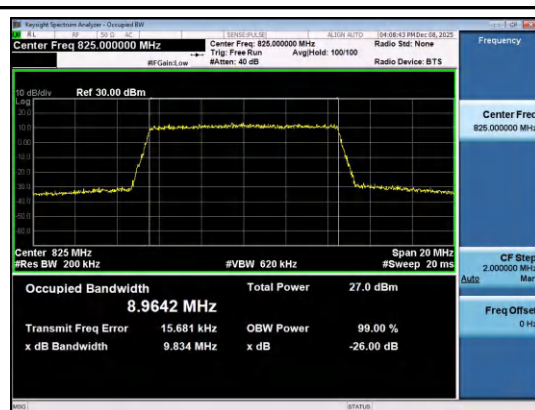

Band18(824-830)-10MHz-16QAM-23950-50RB#0-
PASS

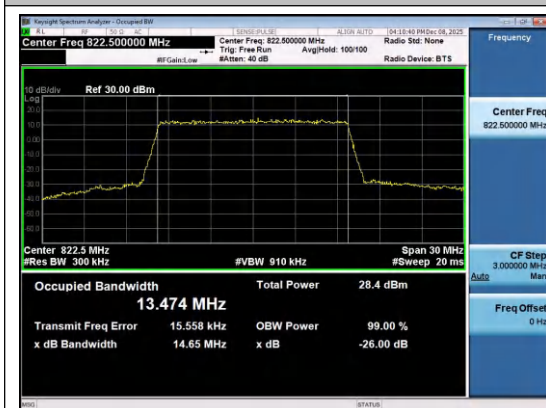

Band18(824-830)-15MHz-QPSK-23925-75RB#0-
PASS

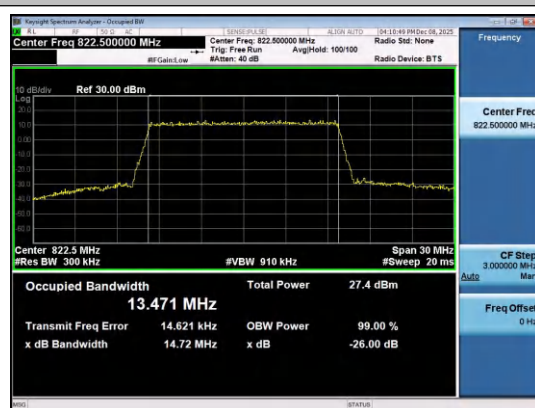


Band18(824-830)-15MHz-16QAM-23925-75RB#0-
PASS

Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result (dBm)	Margin (dB)	Verdict
Band18(824-830)	5MHz	QPSK	23965	1RB#0	-33.61	20.61	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	-57.68	44.68	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	-39.15	26.15	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	-35.33	22.33	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	-57.83	44.83	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	-40.41	27.41	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	-57.81	44.81	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	-33.02	20.02	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	-39.22	26.22	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	-58.34	45.34	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	-34.07	21.07	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	-40.05	27.05	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	-54.88	41.88	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	-44.25	31.25	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	-40.54	27.54	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	-55.31	42.31	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	-45.55	32.55	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	-42.15	29.15	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	-53.47	40.47	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	-44.52	31.52	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	-41.65	28.65	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	-53.84	40.84	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	-45.88	32.88	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	-42.74	29.74	PASS


Test Graphs

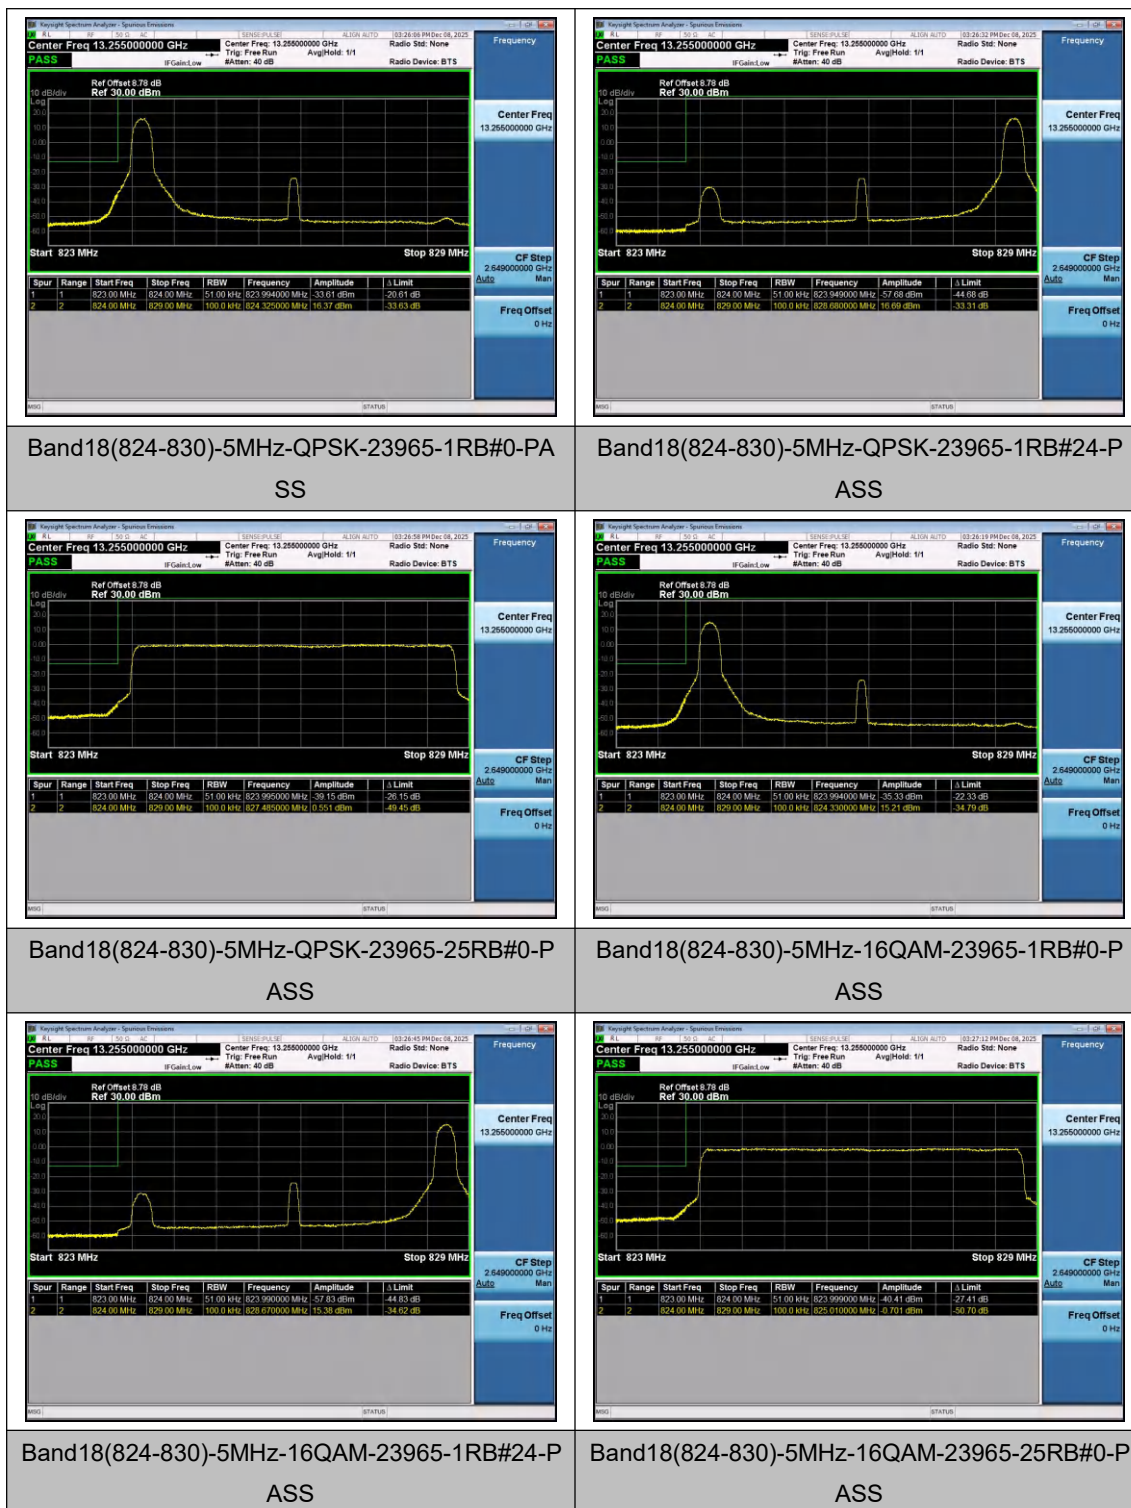



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

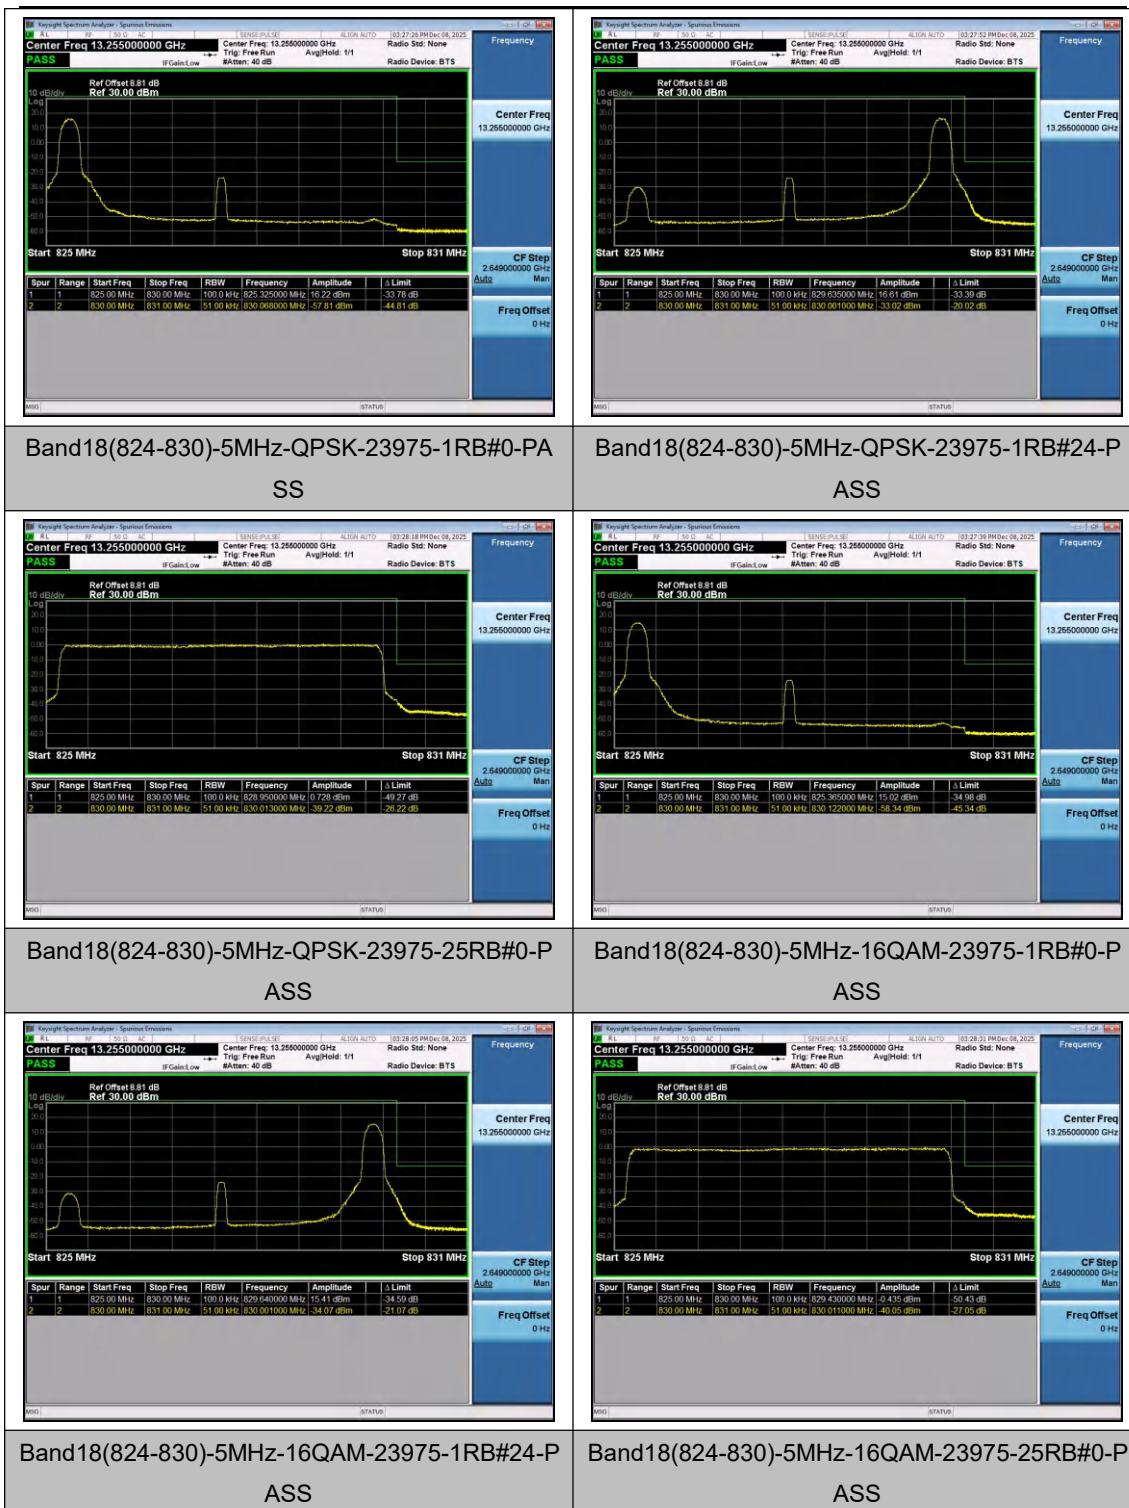

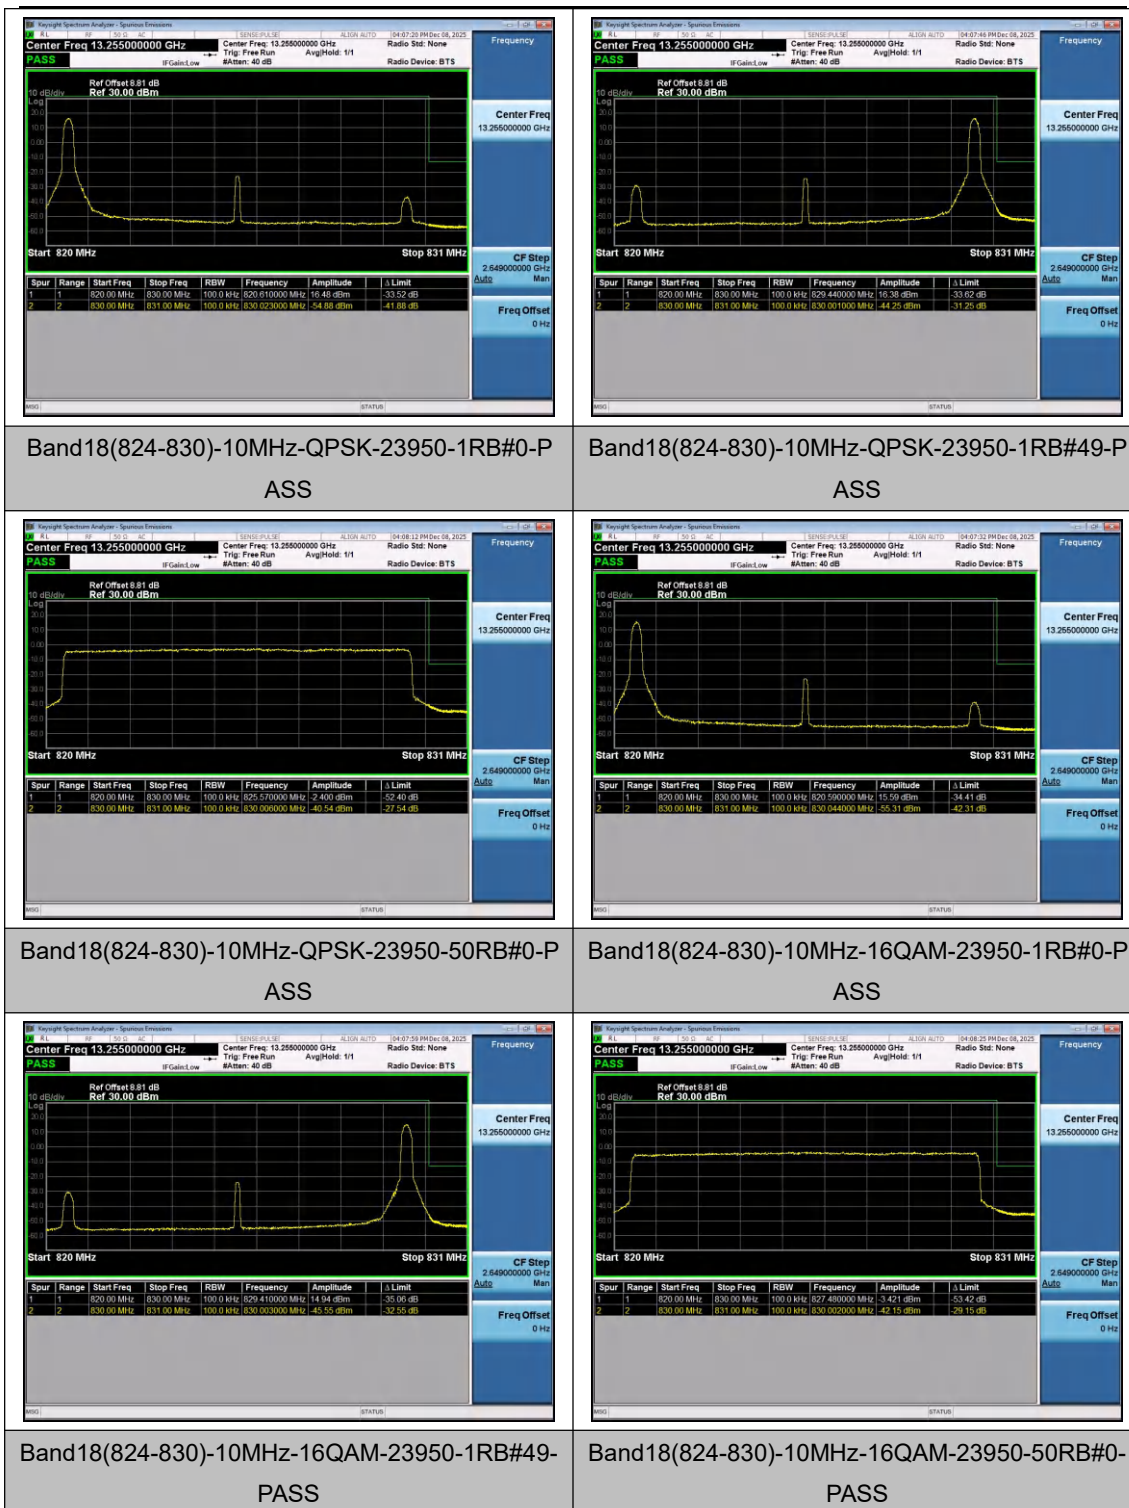

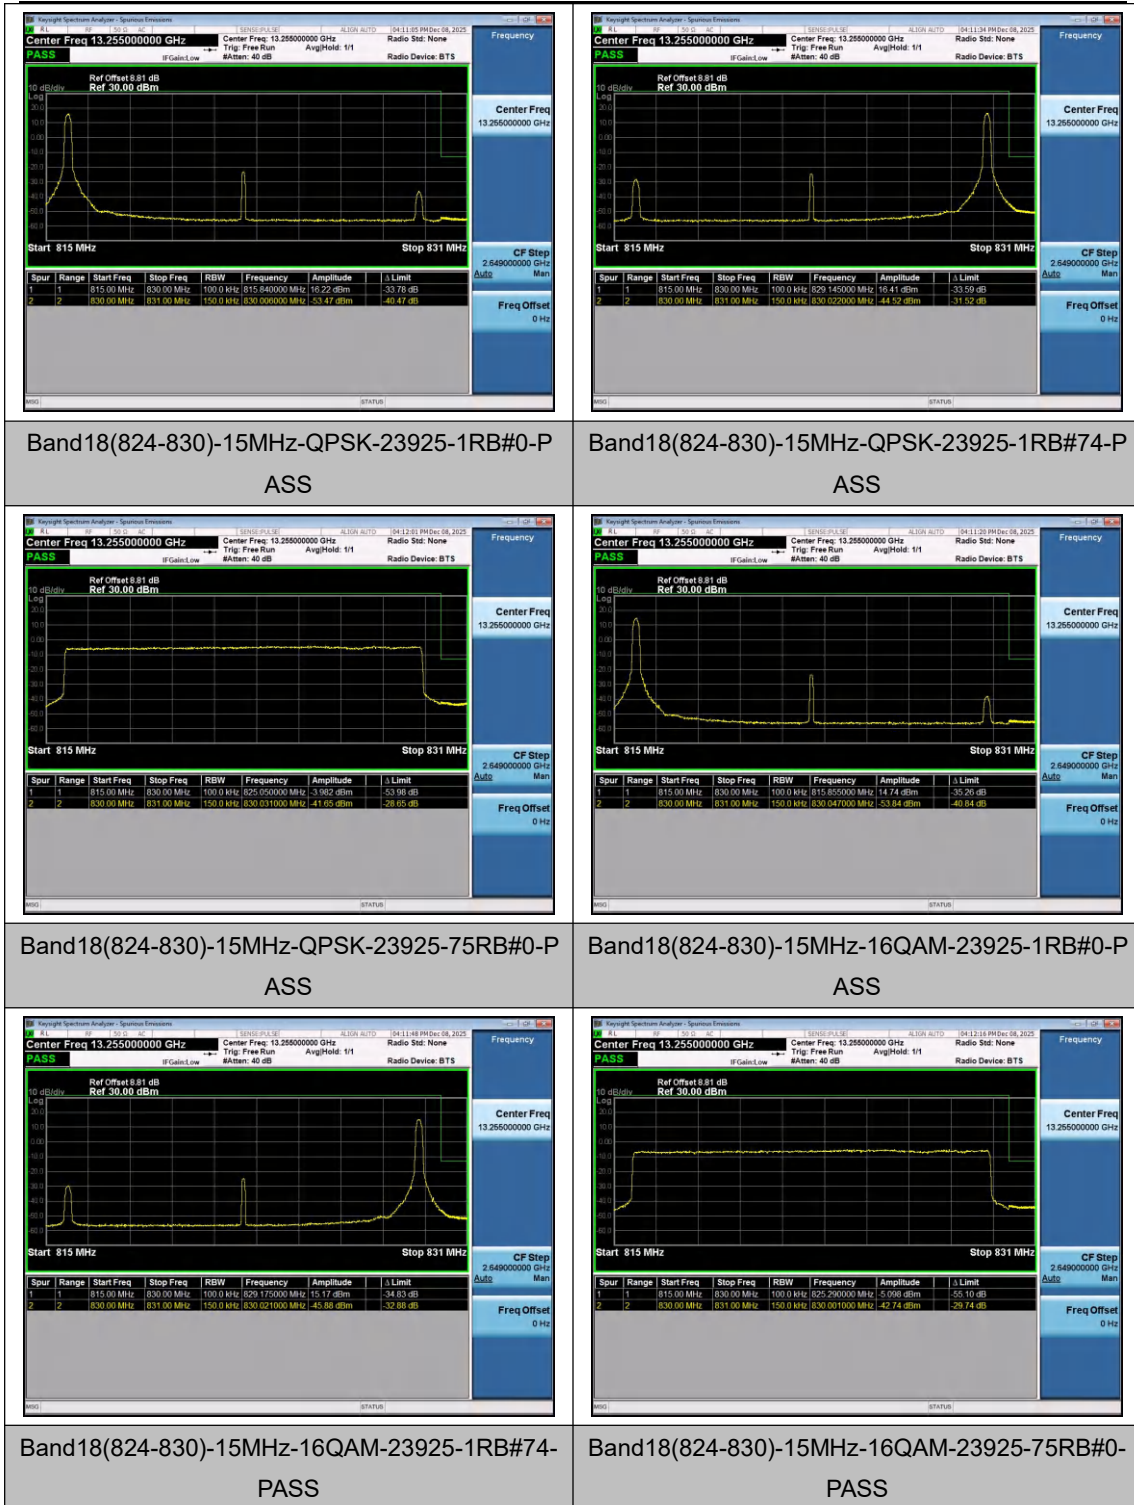

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Limit (dBm)	Verdict
Band18(824-830)	5MHz	QPSK	23965	1RB#0	0.009~0.15	-47.24	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#0	0.15~30	-54.84	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#0	30~1000	-35.56	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#0	1000~3000	-47.08	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#0	3000~10000	-43.67	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	0.009~0.15	-47.34	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	0.15~30	-54.74	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	30~1000	-46.49	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	1000~3000	-46.93	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	1RB#24	3000~10000	-43.86	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	0.009~0.15	-44.65	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	0.15~30	-54.56	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	30~1000	-37.17	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	1000~3000	-46.97	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	3000~10000	-43.76	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	0.009~0.15	-47.89	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	0.15~30	-55.67	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	30~1000	-35.91	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

824-830)								
Band18(824-830)	5MHz	16QAM	23965	1RB#0	1000~3000	-47.05	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#0	3000~10000	-43.91	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	0.009~0.15	-47.70	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	0.15~30	-53.71	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	30~1000	-50.07	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	1000~3000	-42.71	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	1RB#24	3000~10000	-43.98	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	0.009~0.15	-47.81	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	0.15~30	-54.85	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	30~1000	-37.81	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	1000~3000	-47.06	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	3000~10000	-43.76	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	0.009~0.15	-46.20	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	0.15~30	-56.00	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	30~1000	-34.94	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	1000~3000	-46.81	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#0	3000~10000	-44.10	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#24	0.009~0.15	-48.45	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#24	0.15~30	-55.17	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#24	30~1000	-45.57	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	1RB#24	1000~3000	-47.20	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band18(824-830)	5MHz	QPSK	23970	1RB#24	3000~10000	-43.96	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	0.009~0.15	-48.87	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	0.15~30	-53.49	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	30~1000	-37.43	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	1000~3000	-47.15	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	3000~10000	-43.92	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	0.009~0.15	-47.23	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	0.15~30	-53.76	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	30~1000	-34.13	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	1000~3000	-47.17	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#0	3000~10000	-43.69	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	0.009~0.15	-48.52	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	0.15~30	-55.43	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	30~1000	-46.36	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	1000~3000	-47.08	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	1RB#24	3000~10000	-43.86	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	0.009~0.15	-46.37	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	0.15~30	-54.33	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	30~1000	-37.21	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	1000~3000	-47.05	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	3000~10000	-43.91	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	0.009~0.15	-47.59	-33.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

824-830)								
Band18(824-830)	5MHz	QPSK	23975	1RB#0	0.15~30	-55.25	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	30~1000	-35.12	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	1000~3000	-47.10	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#0	3000~10000	-43.91	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	0.009~0.15	-47.87	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	0.15~30	-55.89	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	30~1000	-46.53	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	1000~3000	-47.00	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	1RB#24	3000~10000	-43.92	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	0.009~0.15	-47.68	-33.0	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	0.15~30	-54.64	-23.0	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	30~1000	-36.45	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	1000~3000	-47.03	-13.0	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	3000~10000	-43.77	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	0.009~0.15	-46.53	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	0.15~30	-56.50	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	30~1000	-36.11	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	1000~3000	-47.20	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#0	3000~10000	-44.03	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	0.009~0.15	-47.75	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	0.15~30	-55.82	-23.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band18(824-830)	5MHz	16QAM	23975	1RB#24	30~1000	-46.74	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	1000~3000	-47.02	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	1RB#24	3000~10000	-44.01	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	0.009~0.15	-47.58	-33.0	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	0.15~30	-55.05	-23.0	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	30~1000	-37.99	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	1000~3000	-43.69	-13.0	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	3000~10000	-44.01	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	0.009~0.15	-47.20	-33.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	0.15~30	-55.26	-23.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	30~1000	-42.83	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	1000~3000	-47.19	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#0	3000~10000	-43.74	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	0.009~0.15	-47.12	-33.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	0.15~30	-54.97	-23.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	30~1000	-46.47	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	1000~3000	-46.82	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	1RB#49	3000~10000	-43.86	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	0.009~0.15	-48.79	-33.0	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	0.15~30	-53.61	-23.0	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	30~1000	-37.15	-13.0	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	1000~3000	-45.76	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

824-830)								
Band18(824-830)	10MHz	QPSK	23950	50RB#0	3000~10000	-44.17	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	0.009~0.15	-47.86	-33.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	0.15~30	-53.18	-23.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	30~1000	-49.41	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	1000~3000	-46.87	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#0	3000~10000	-43.71	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	0.009~0.15	-47.96	-33.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	0.15~30	-53.31	-23.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	30~1000	-44.90	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	1000~3000	-45.18	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	1RB#49	3000~10000	-44.13	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	0.009~0.15	-47.70	-33.0	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	0.15~30	-52.48	-23.0	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	30~1000	-38.51	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	1000~3000	-47.01	-13.0	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	3000~10000	-43.47	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	0.009~0.15	-48.30	-33.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	0.15~30	-54.92	-23.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	30~1000	-48.33	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	1000~3000	-47.08	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#0	3000~10000	-43.93	-13.0	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band18(824-830)	15MHz	QPSK	23925	1RB#74	0.009~0.15	-47.17	-33.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	0.15~30	-54.32	-23.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	30~1000	-45.25	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	1000~3000	-46.92	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	1RB#74	3000~10000	-43.90	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	0.009~0.15	-48.17	-33.0	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	0.15~30	-53.34	-23.0	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	30~1000	-36.30	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	1000~3000	-47.14	-13.0	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	3000~10000	-43.13	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	0.009~0.15	-46.97	-33.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	0.15~30	-56.83	-23.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	30~1000	-46.70	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	1000~3000	-47.16	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#0	3000~10000	-44.05	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	0.009~0.15	-45.77	-33.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	0.15~30	-53.43	-23.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	30~1000	-47.85	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	1000~3000	-47.04	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	1RB#74	3000~10000	-43.65	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	0.009~0.15	-46.93	-33.0	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	0.15~30	-55.30	-23.0	PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

824-830)								
Band18(824-830)	15MHz	16QAM	23925	75RB#0	30~1000	-35.24	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	1000~3000	-47.05	-13.0	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	3000~10000	-43.82	-13.0	PASS


Test Graphs

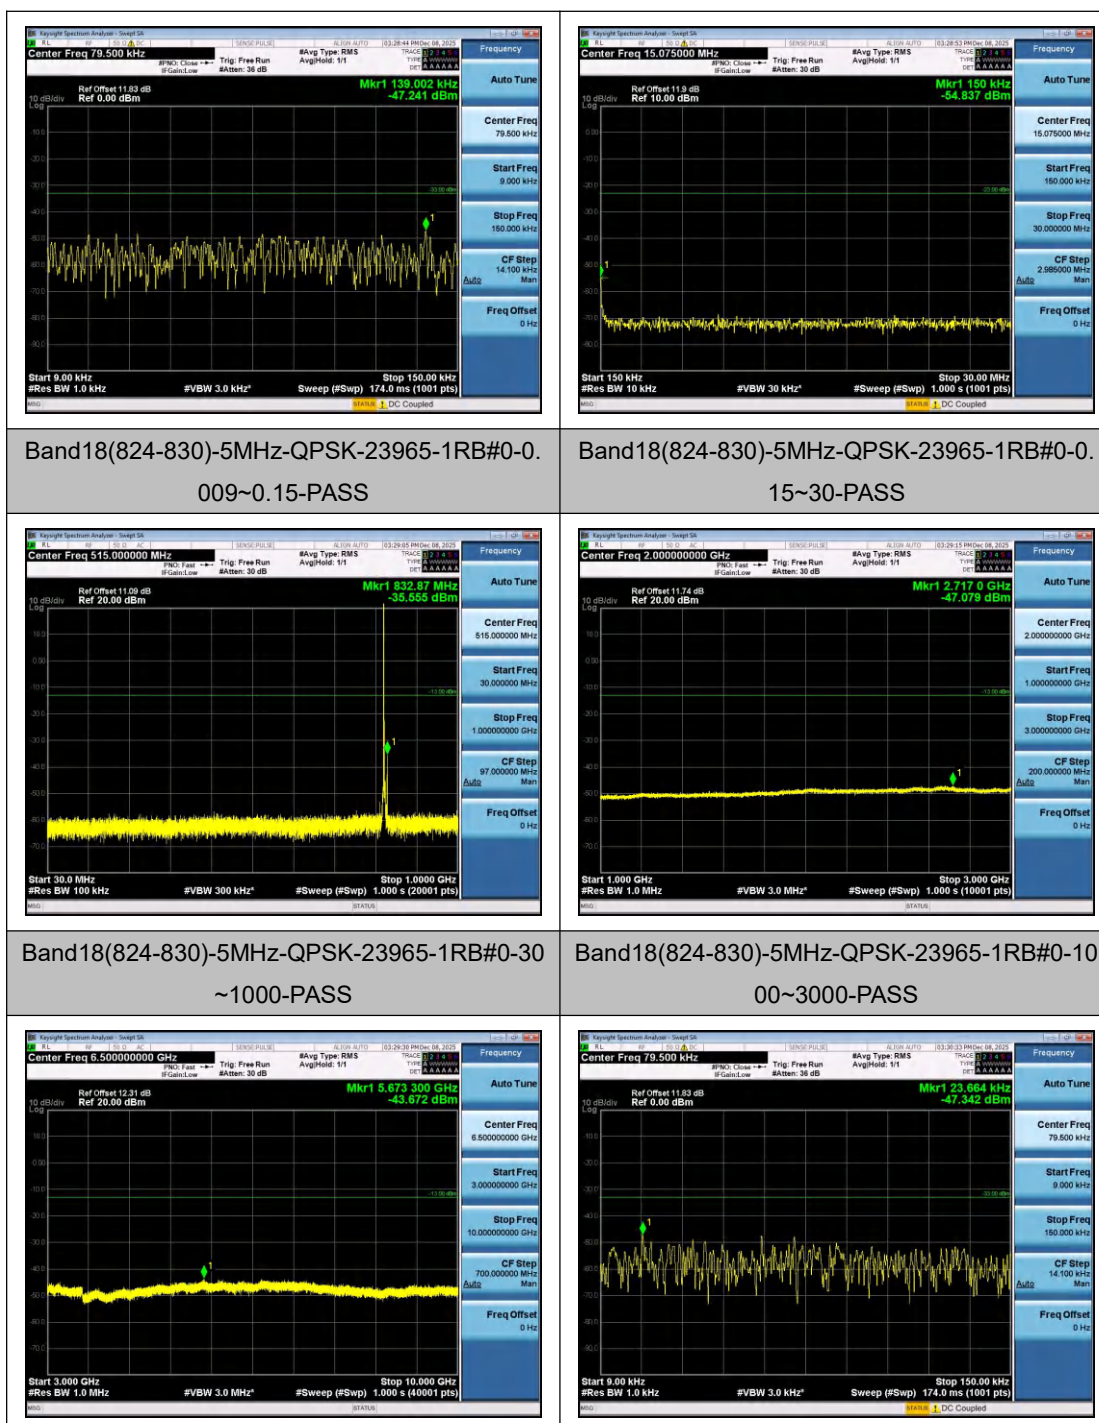



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

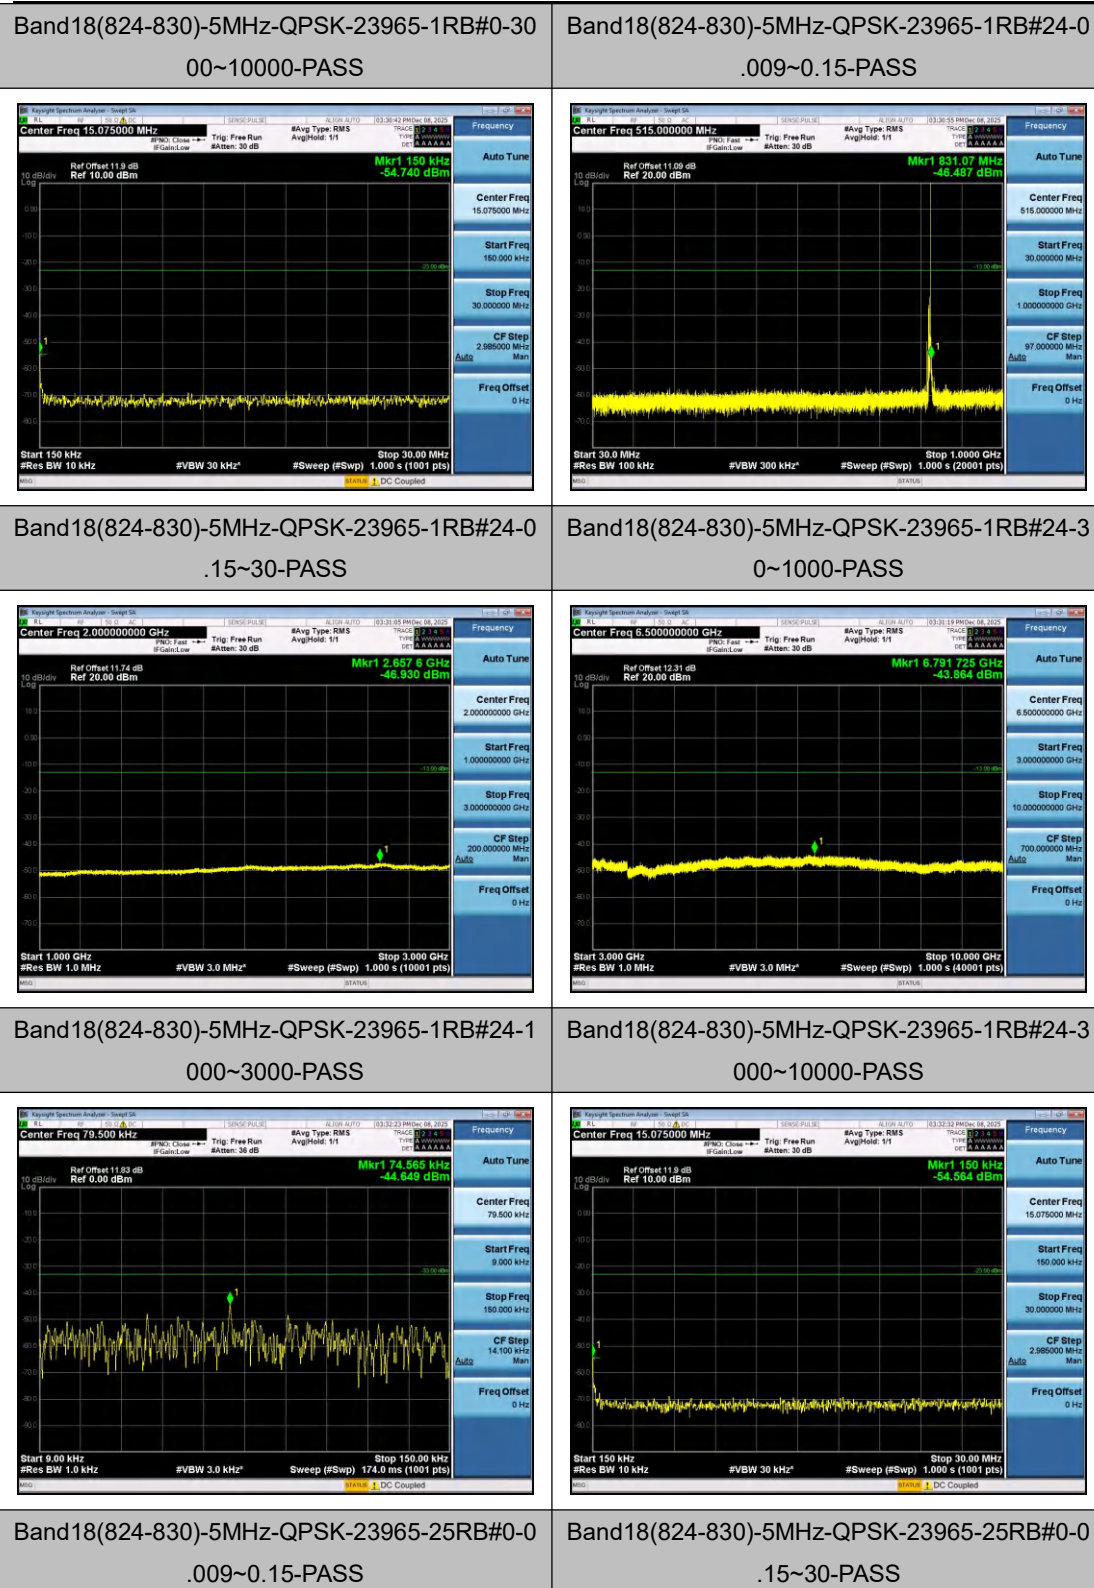


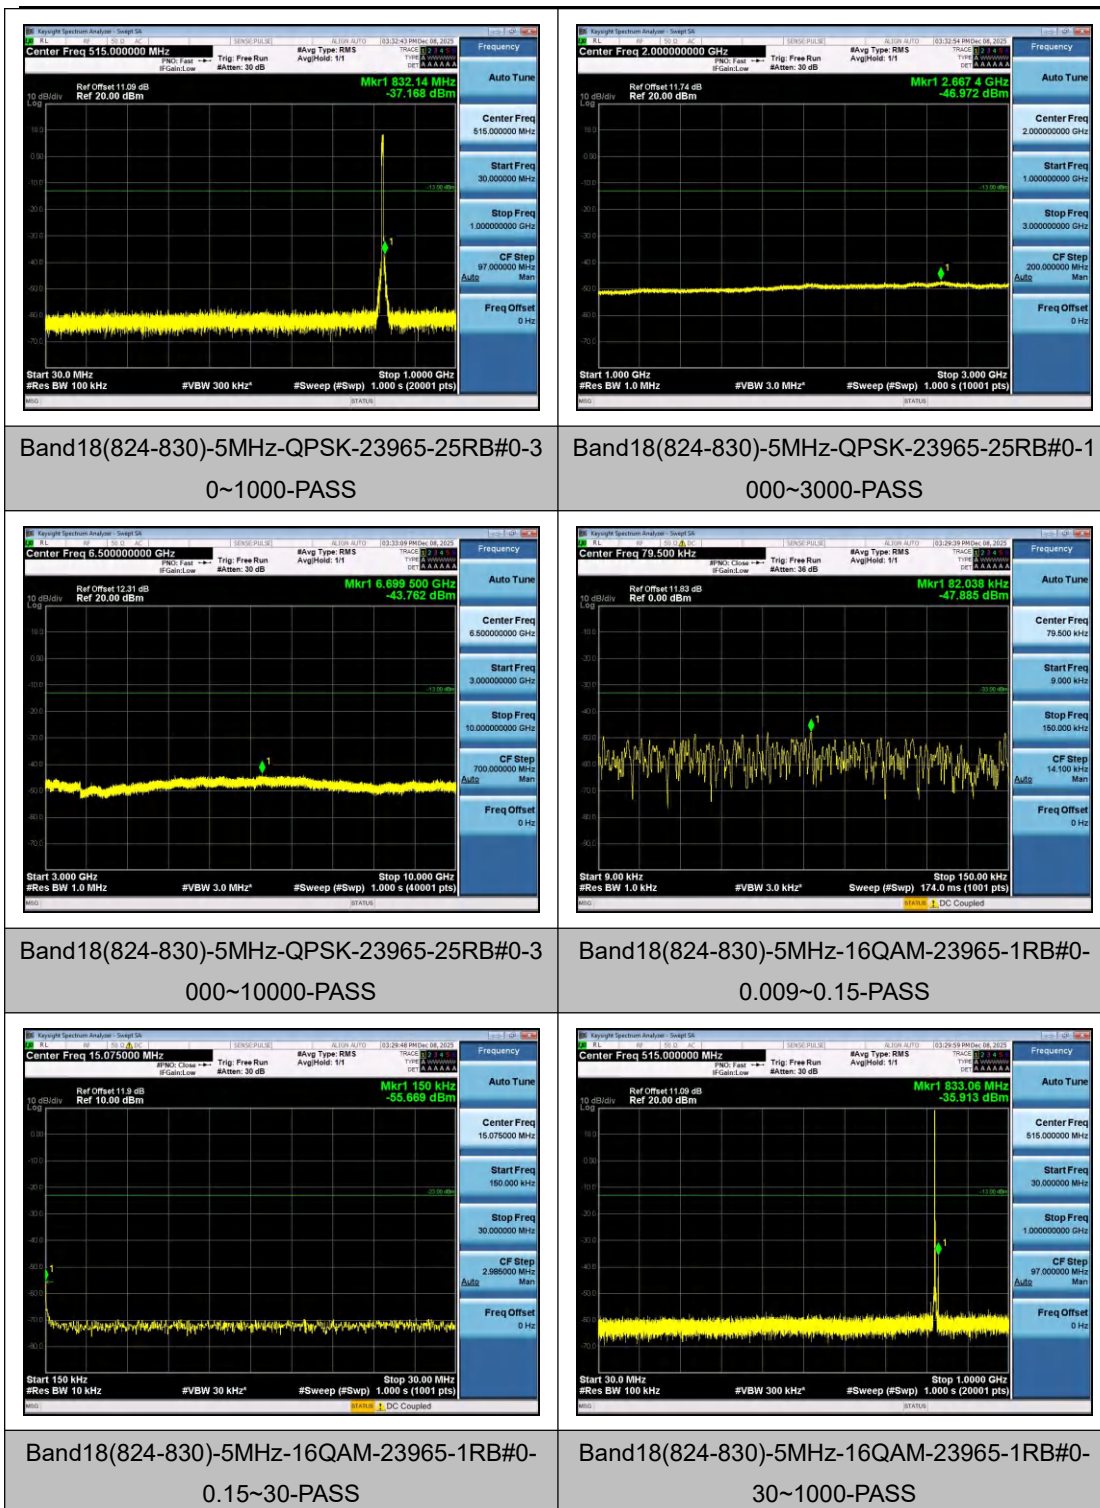


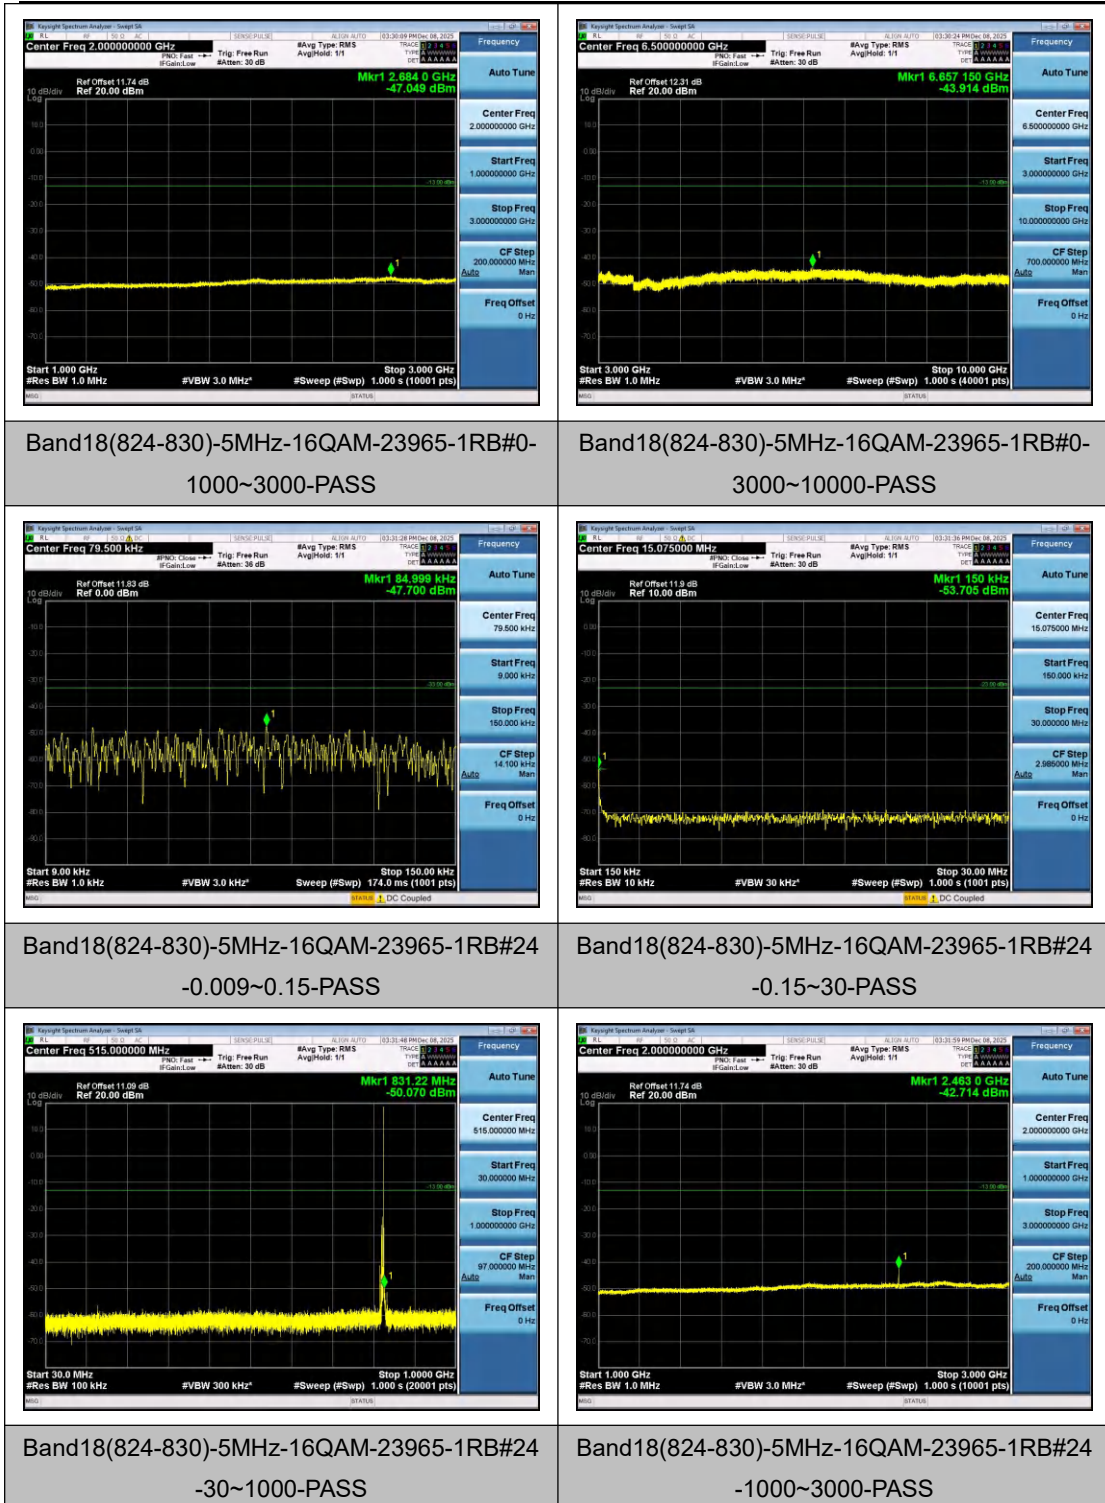


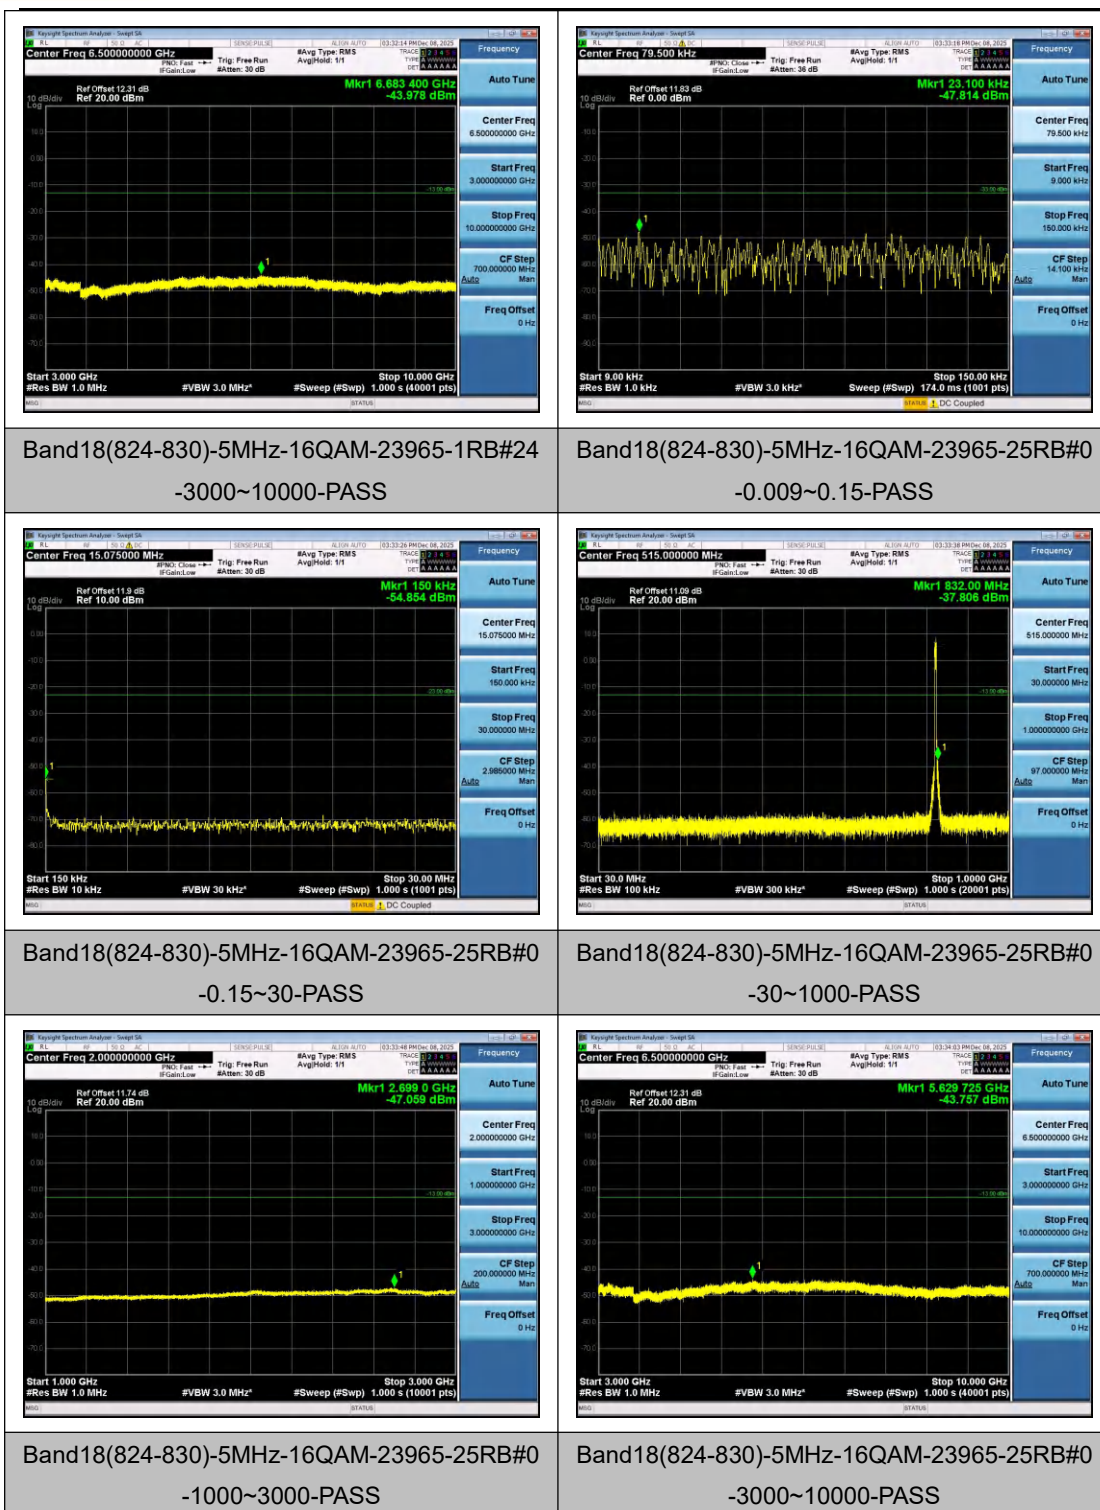


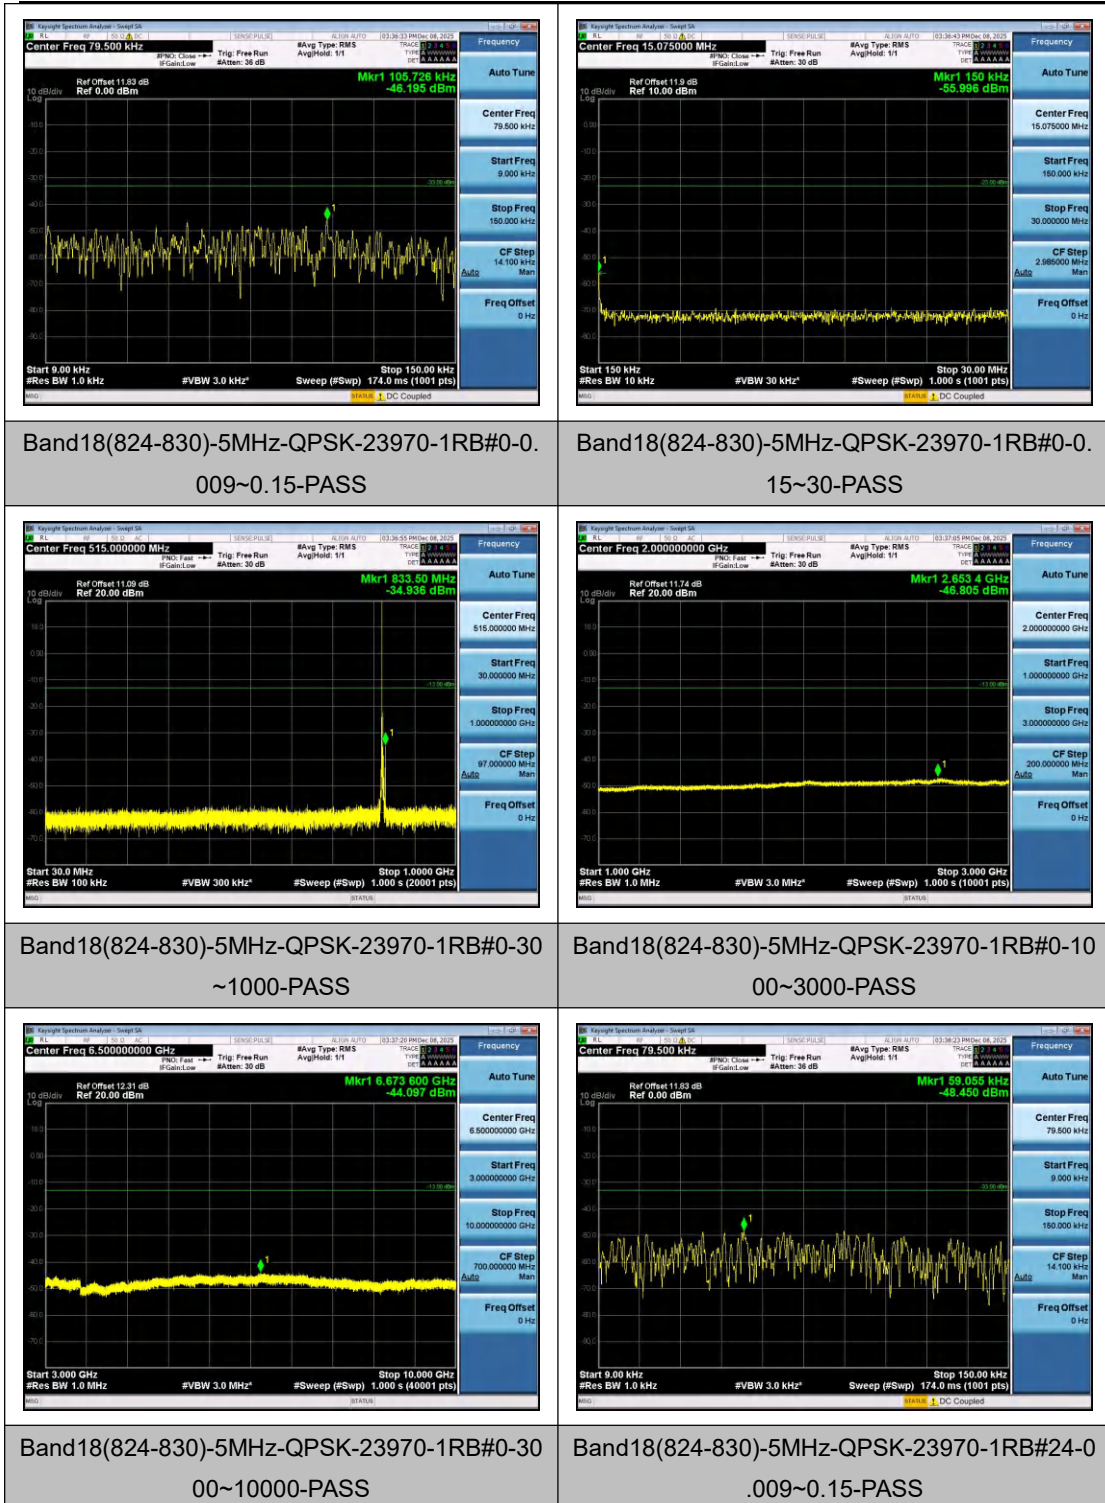


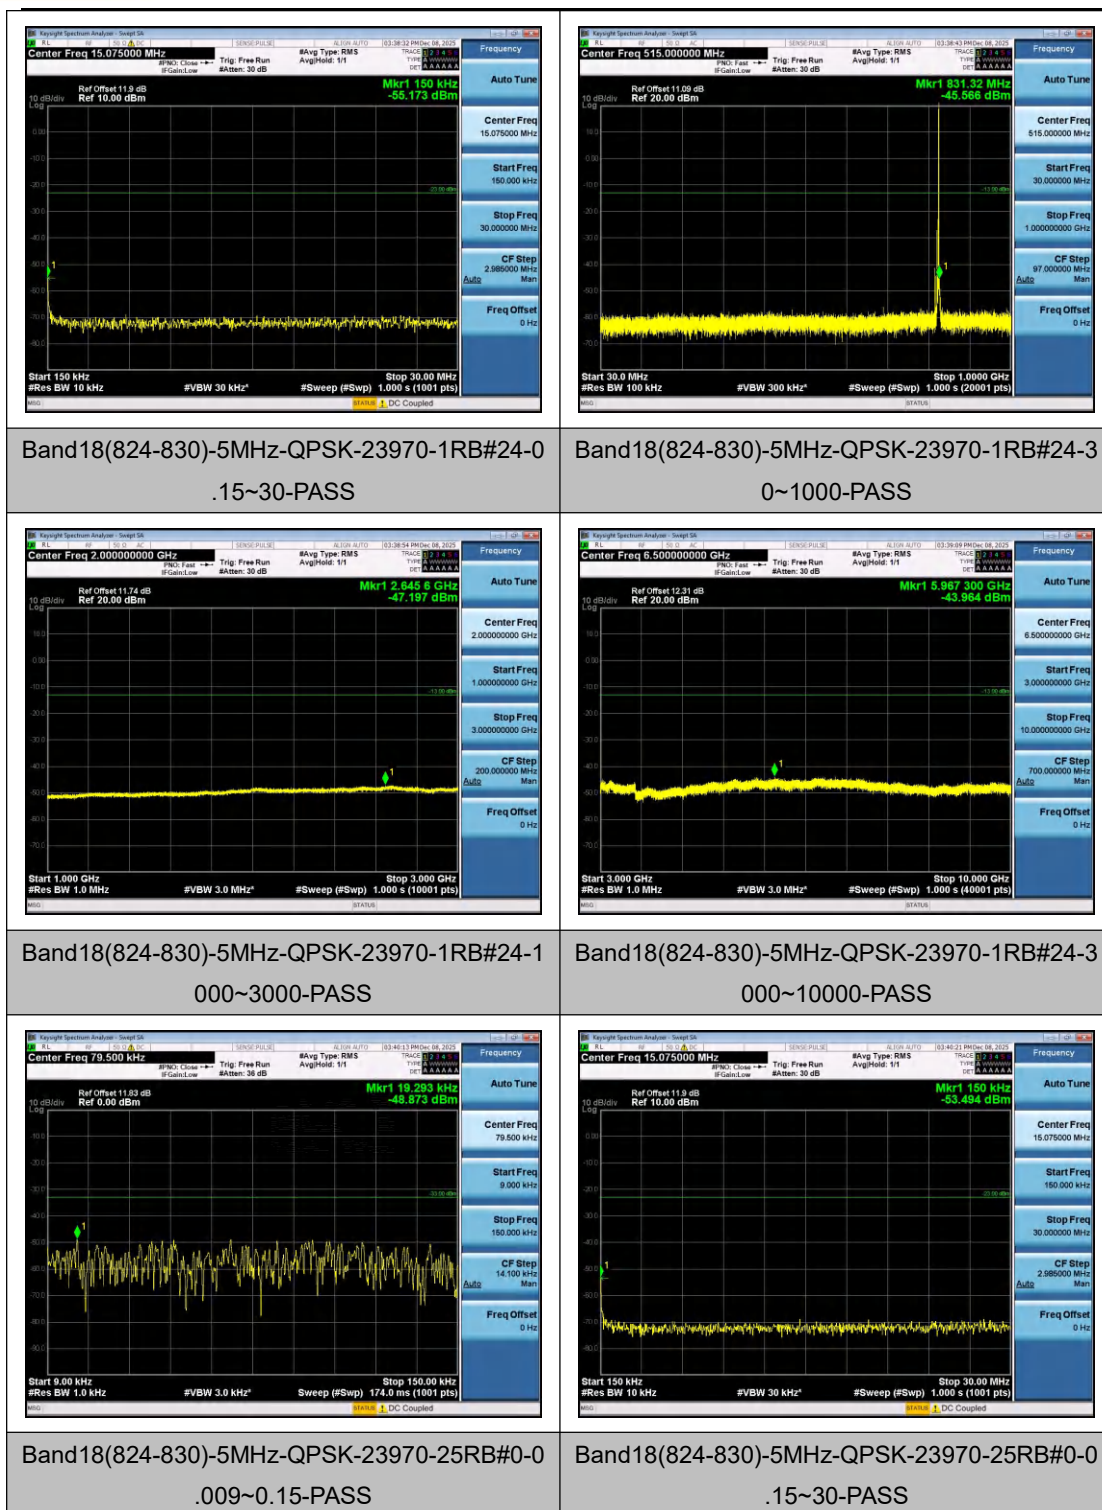


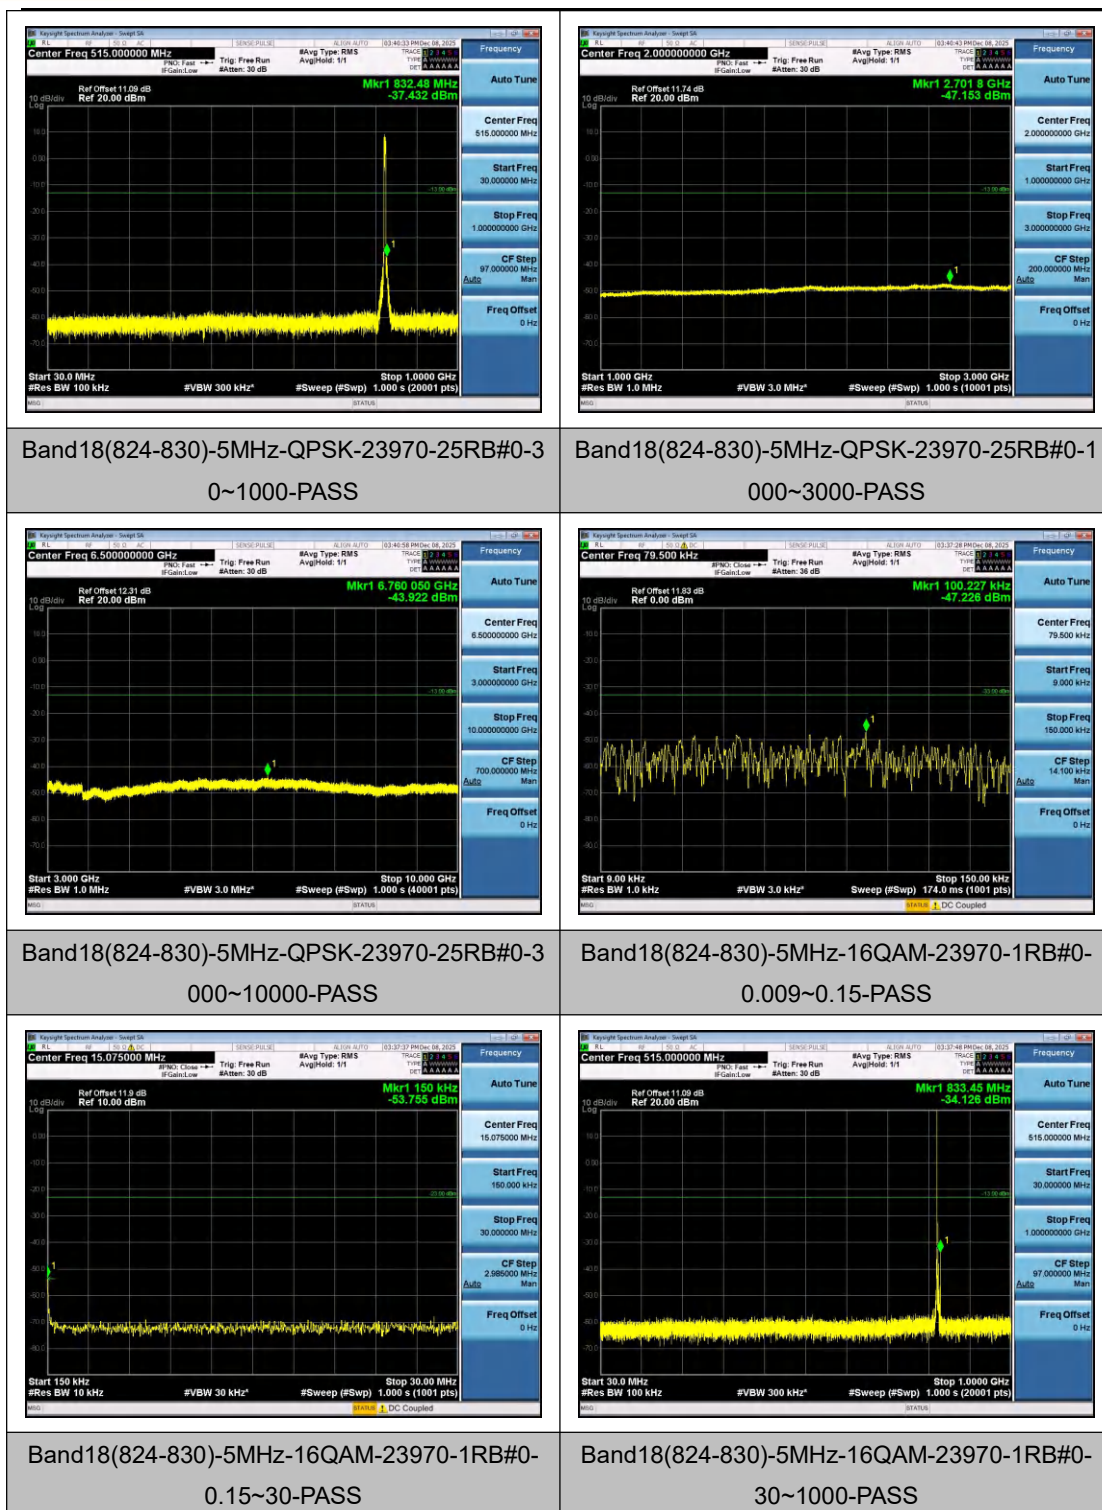


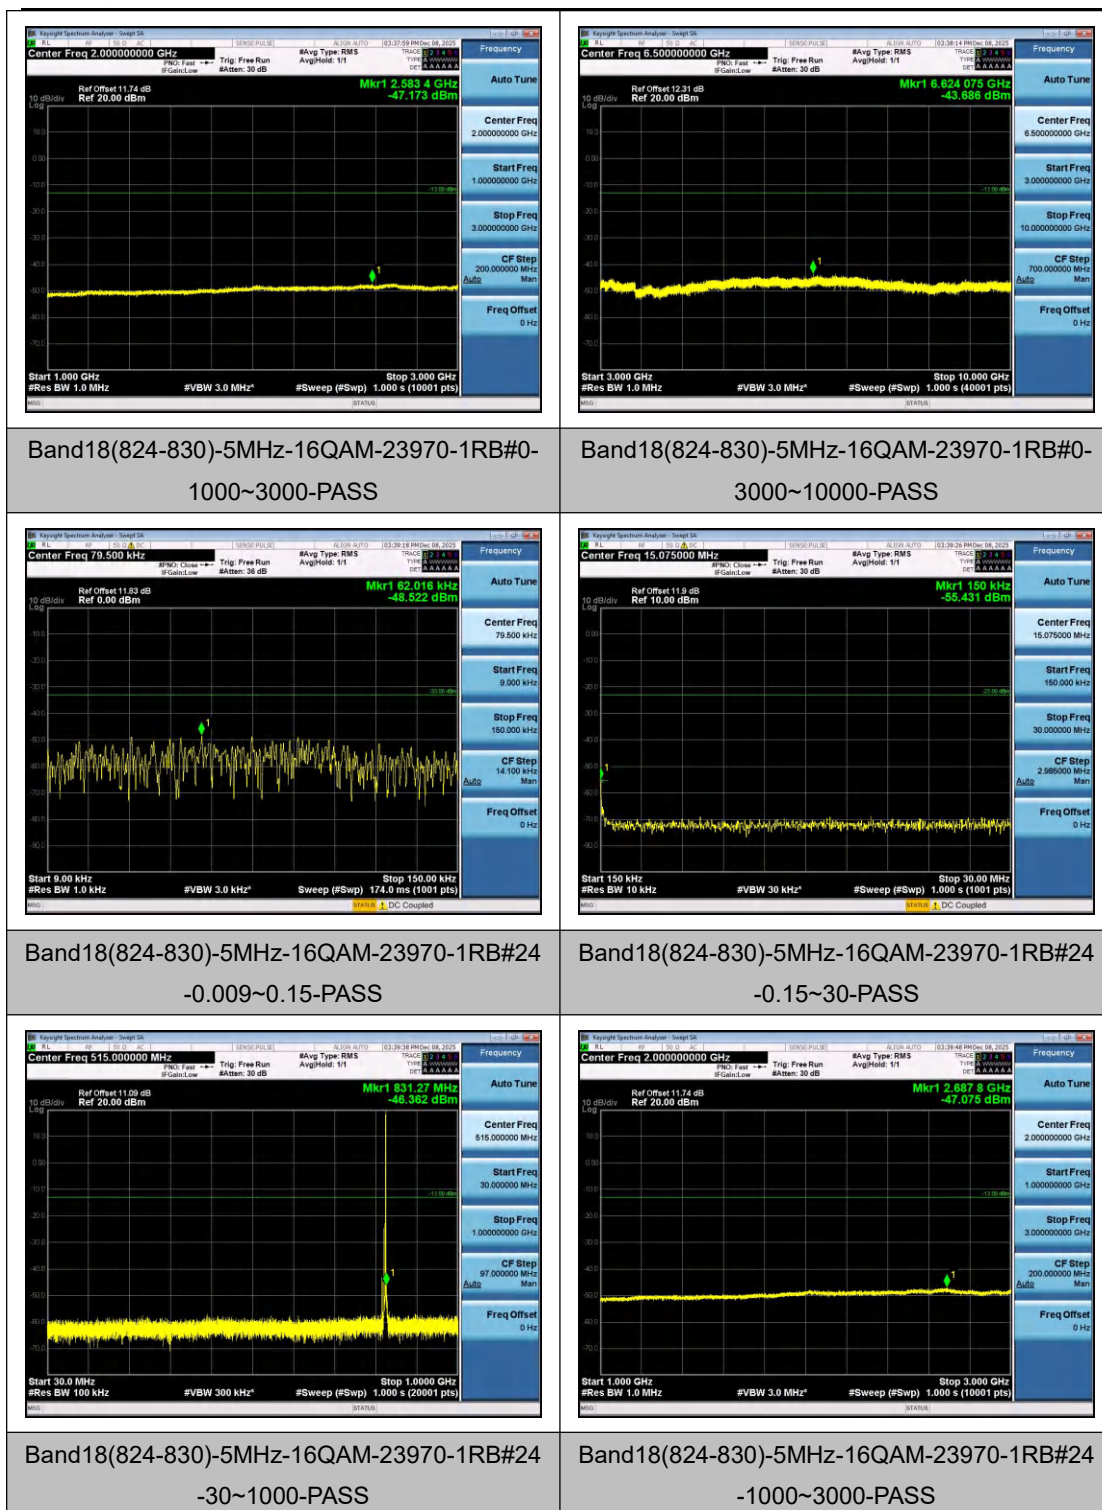


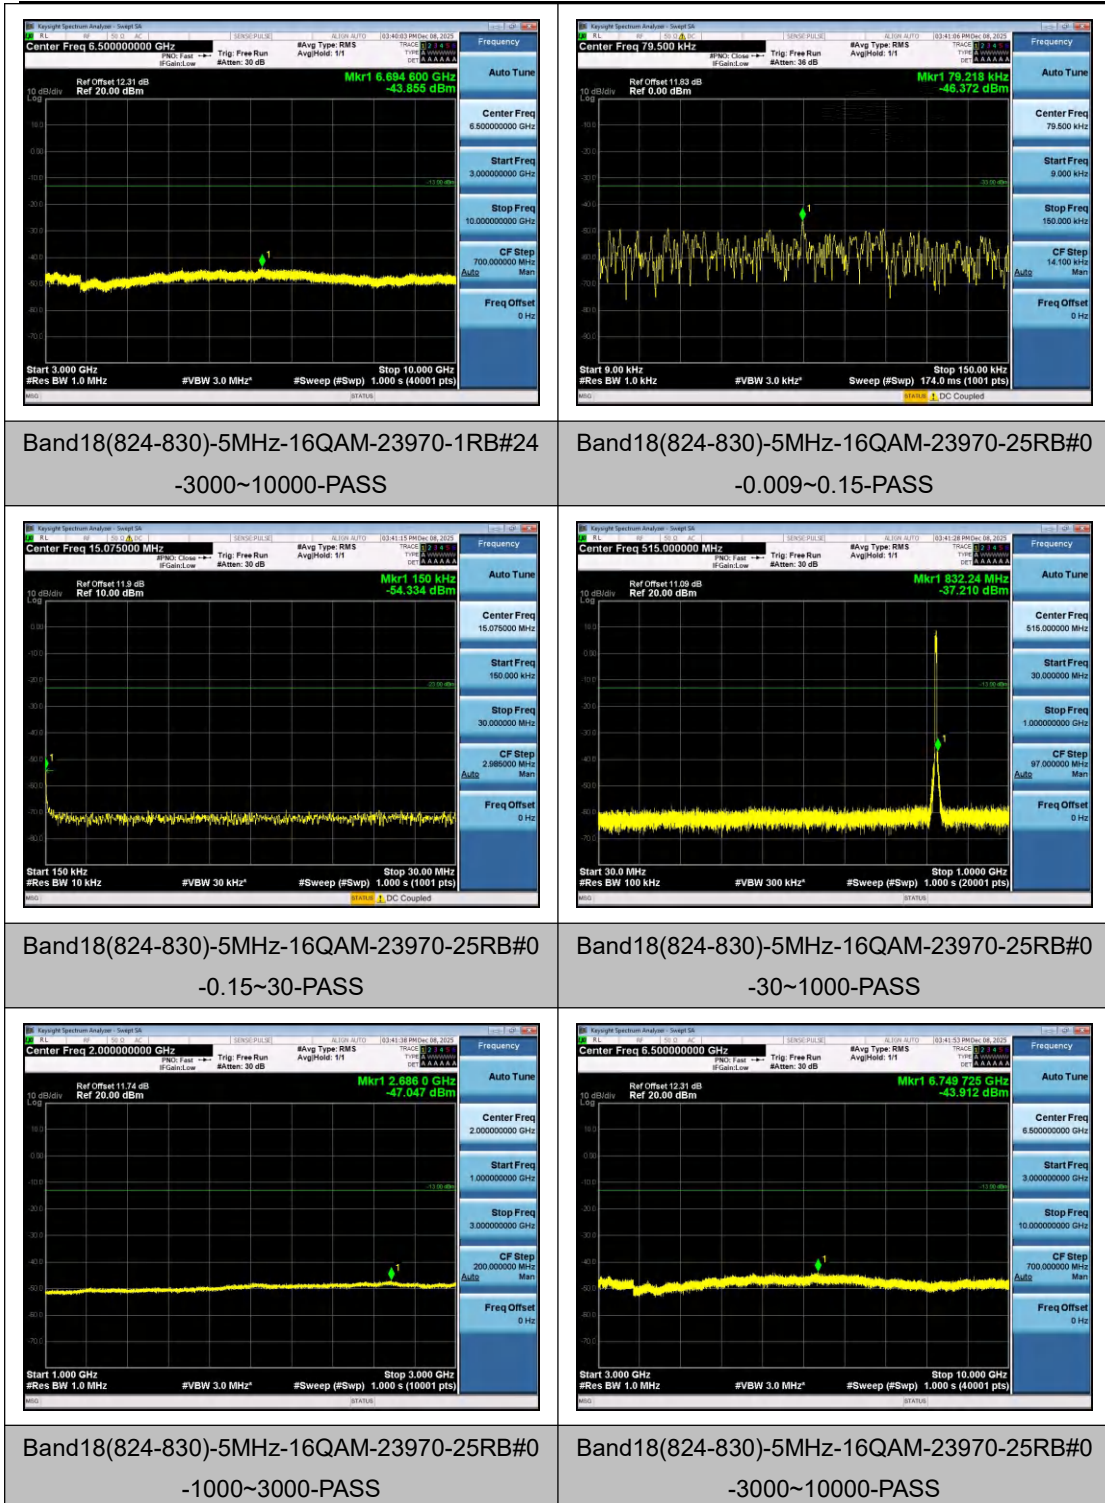


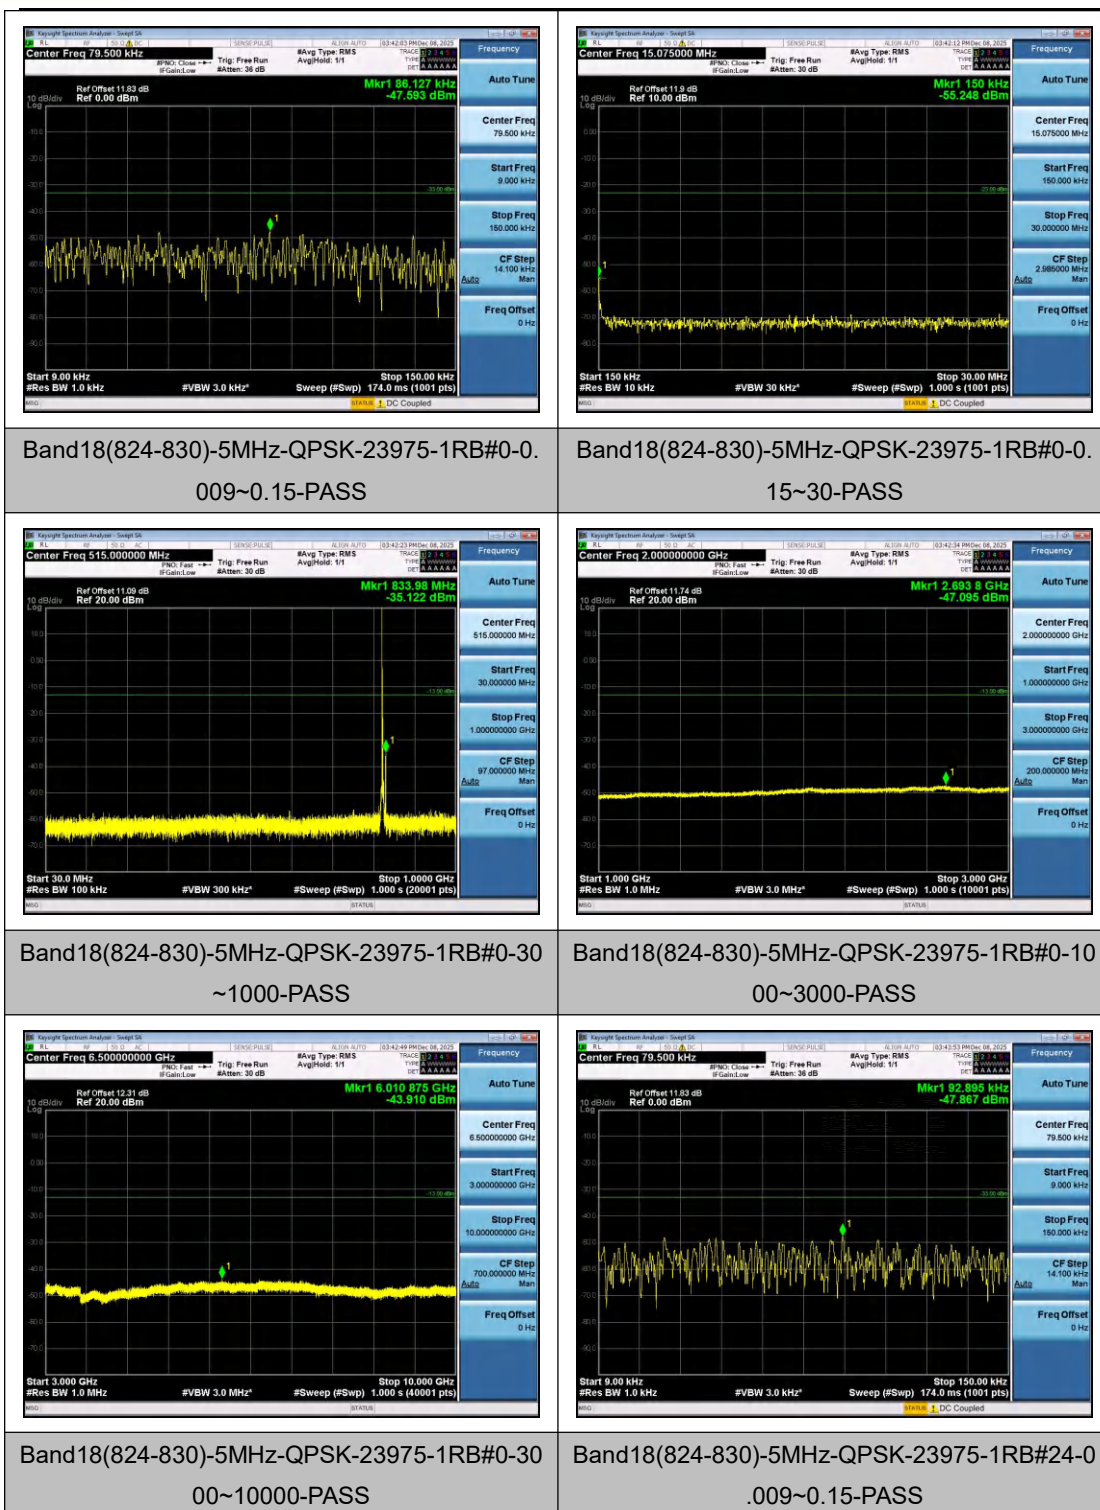


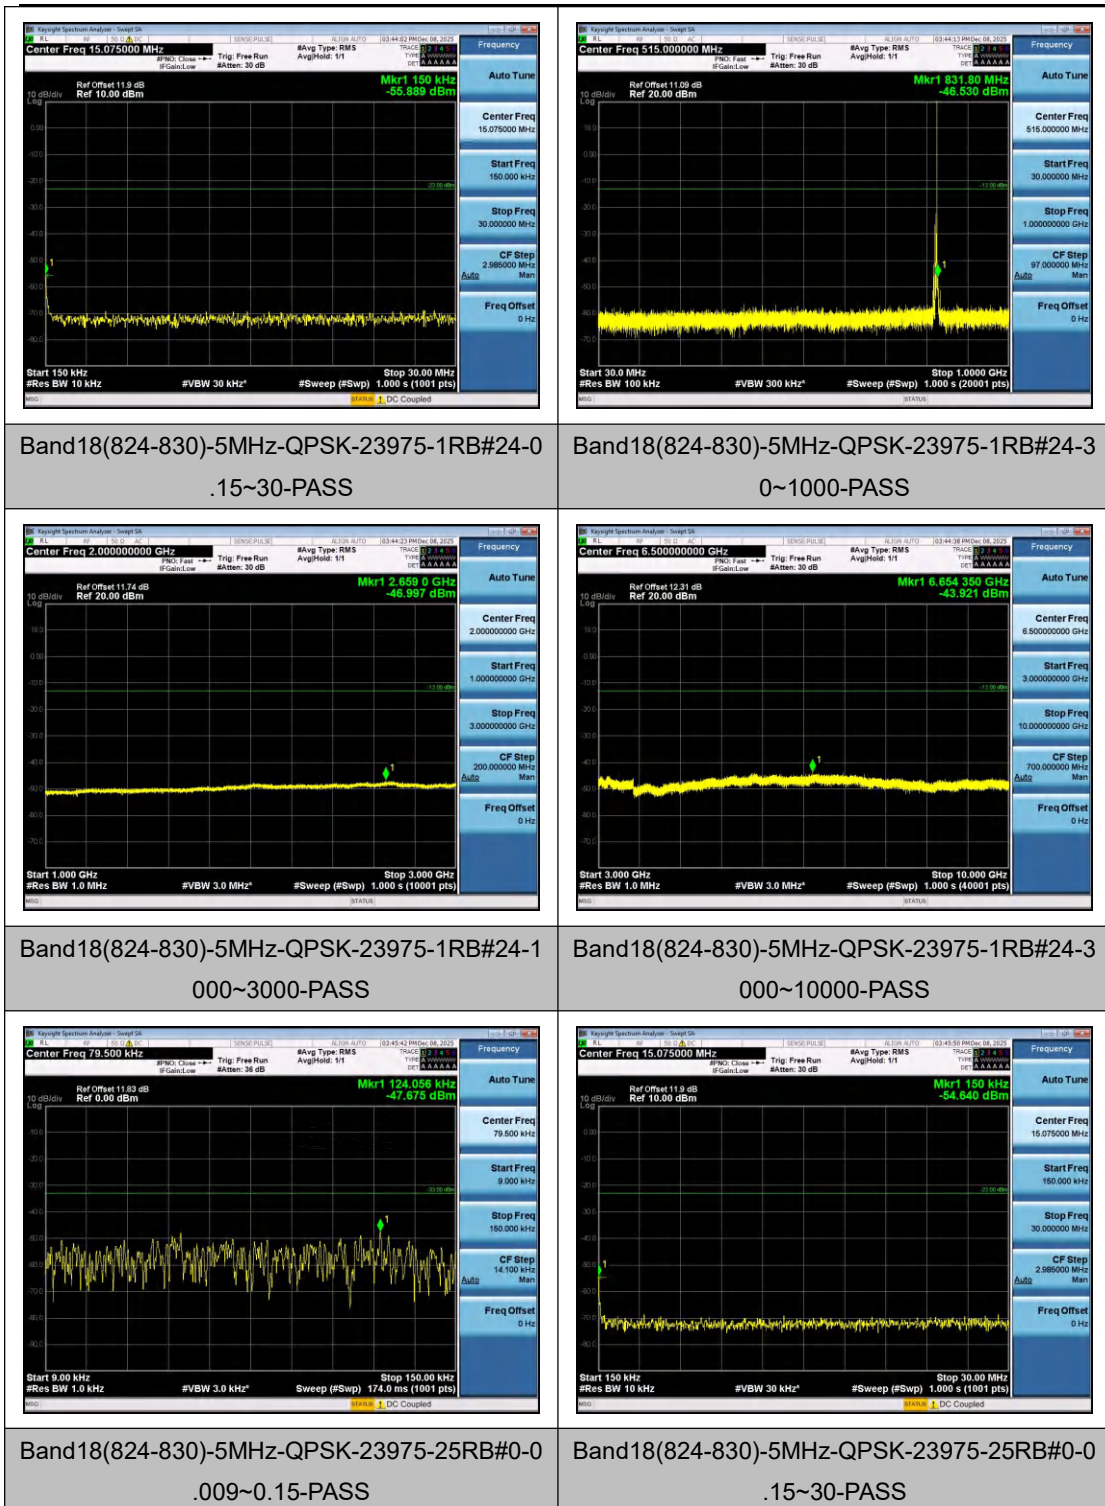


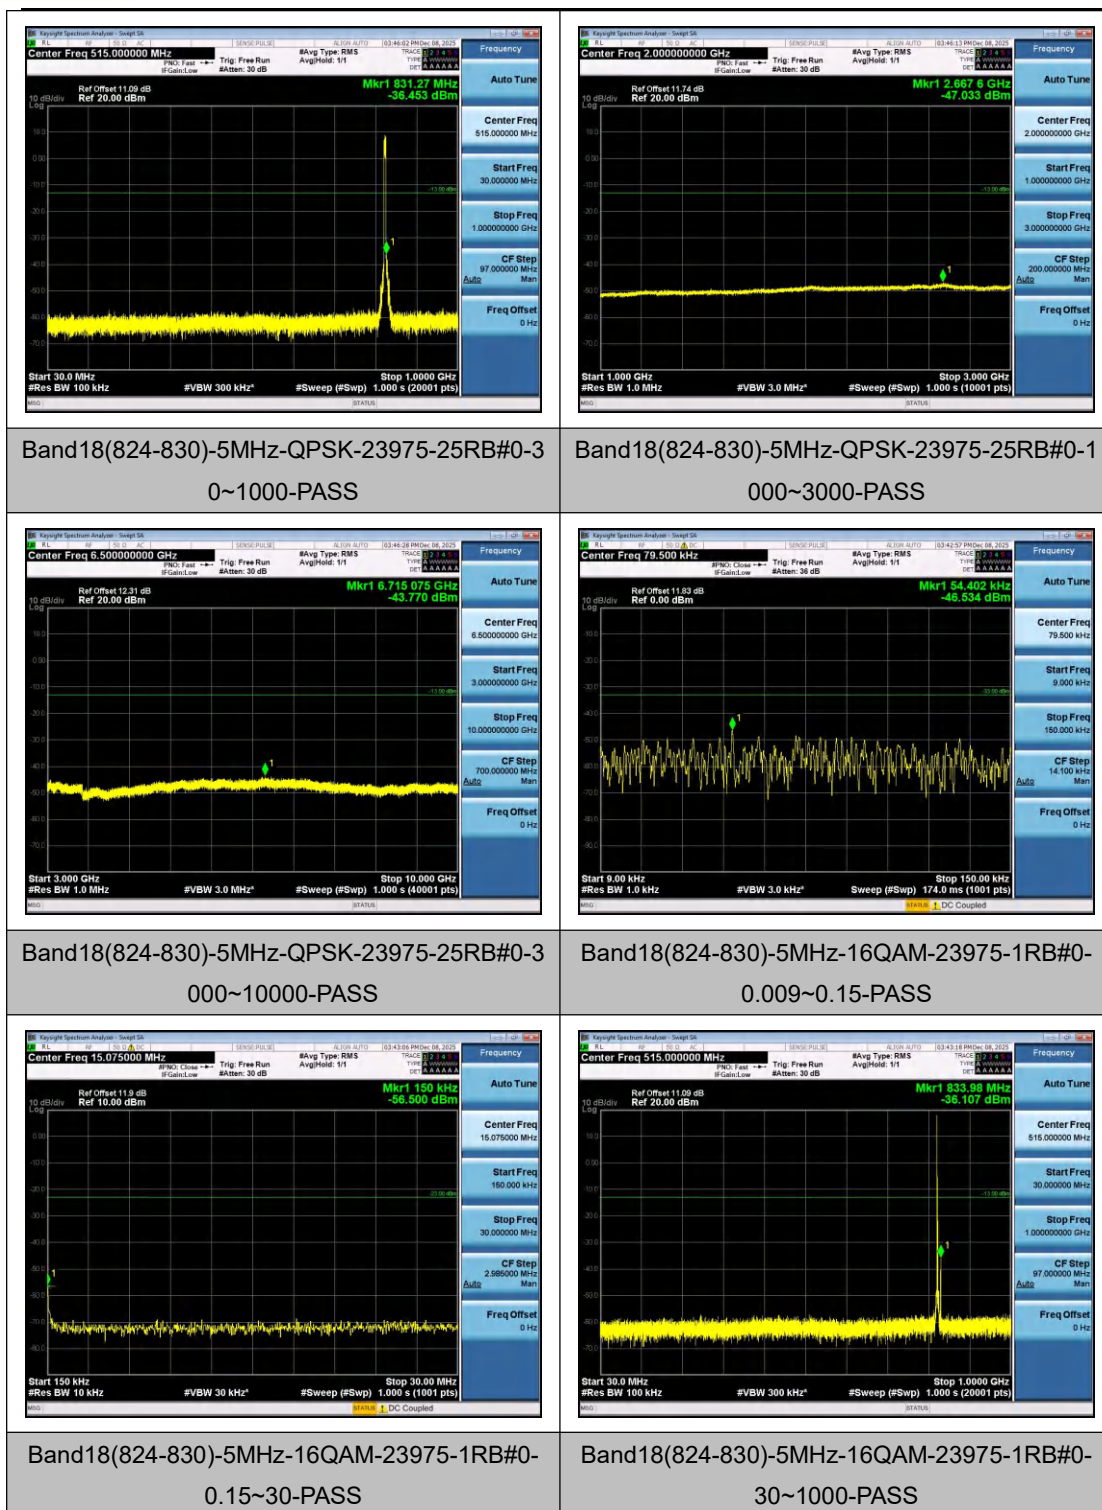


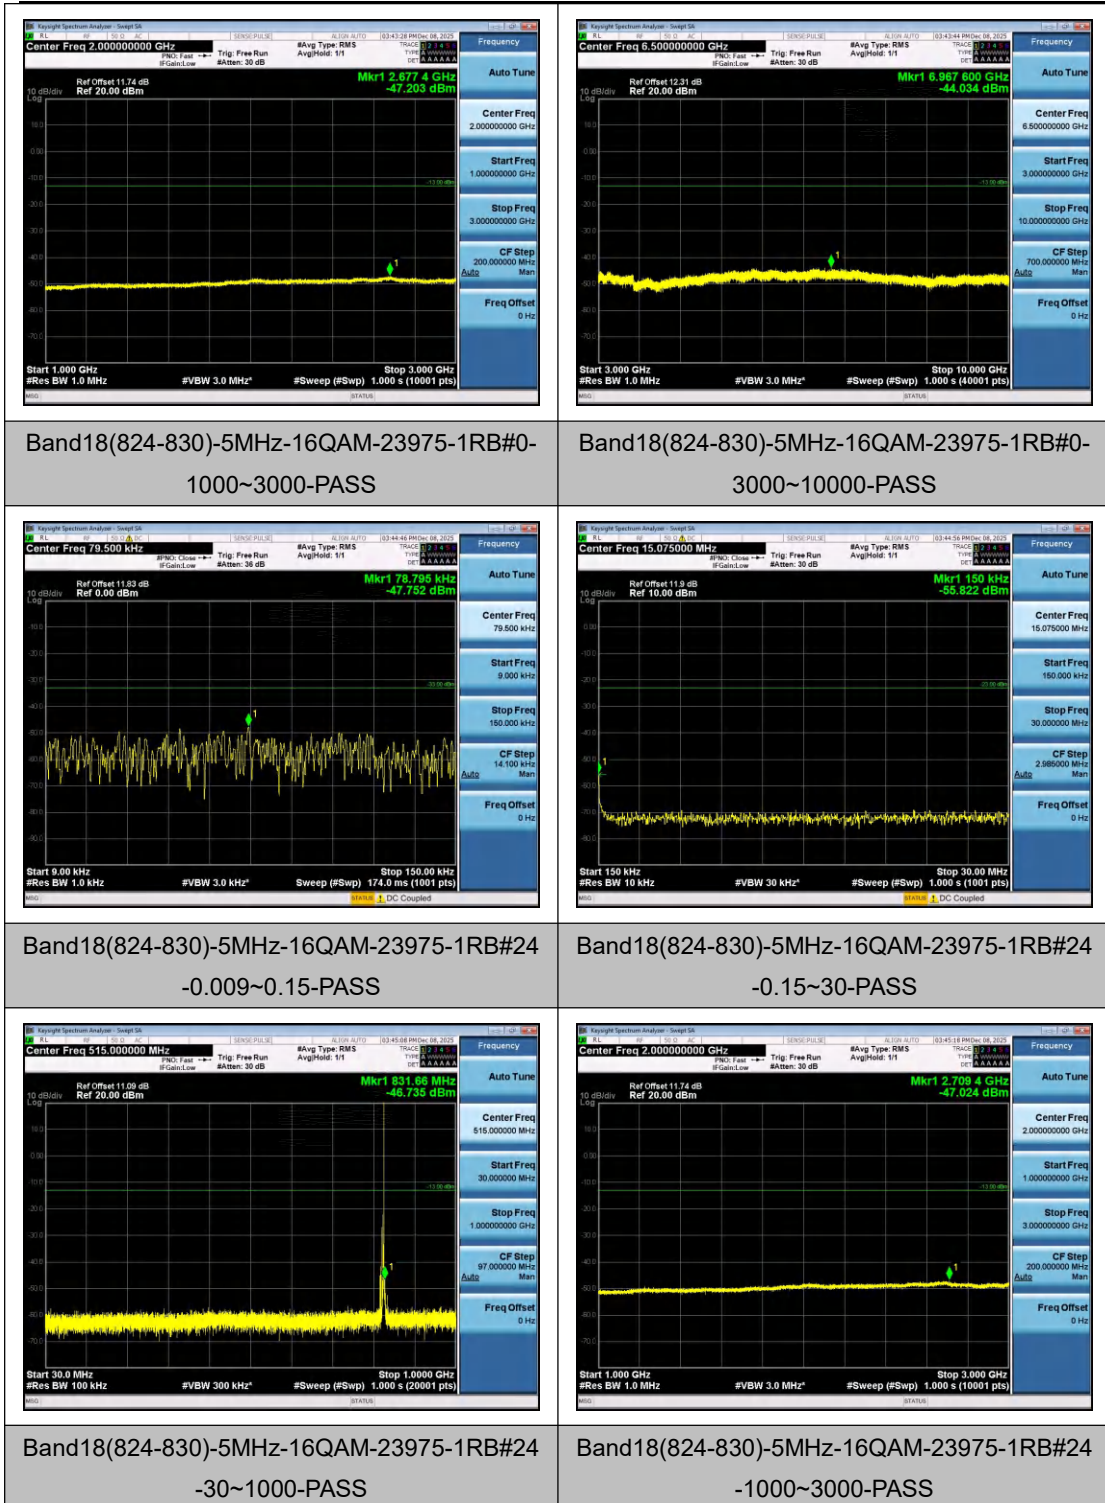


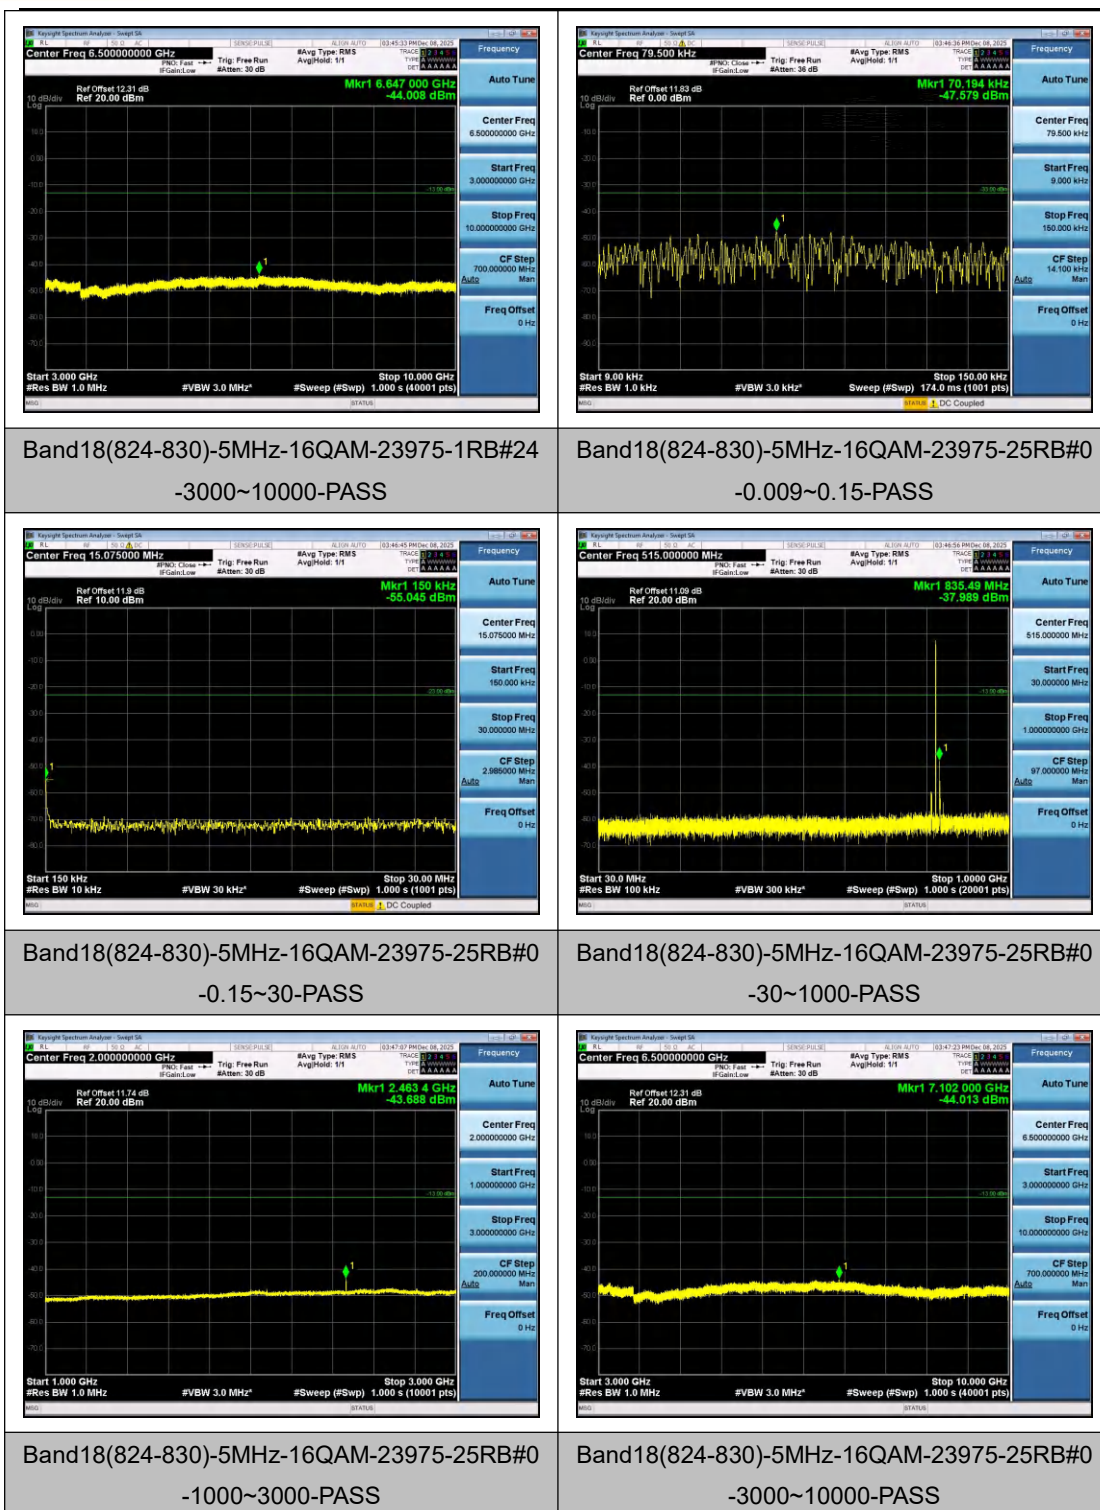


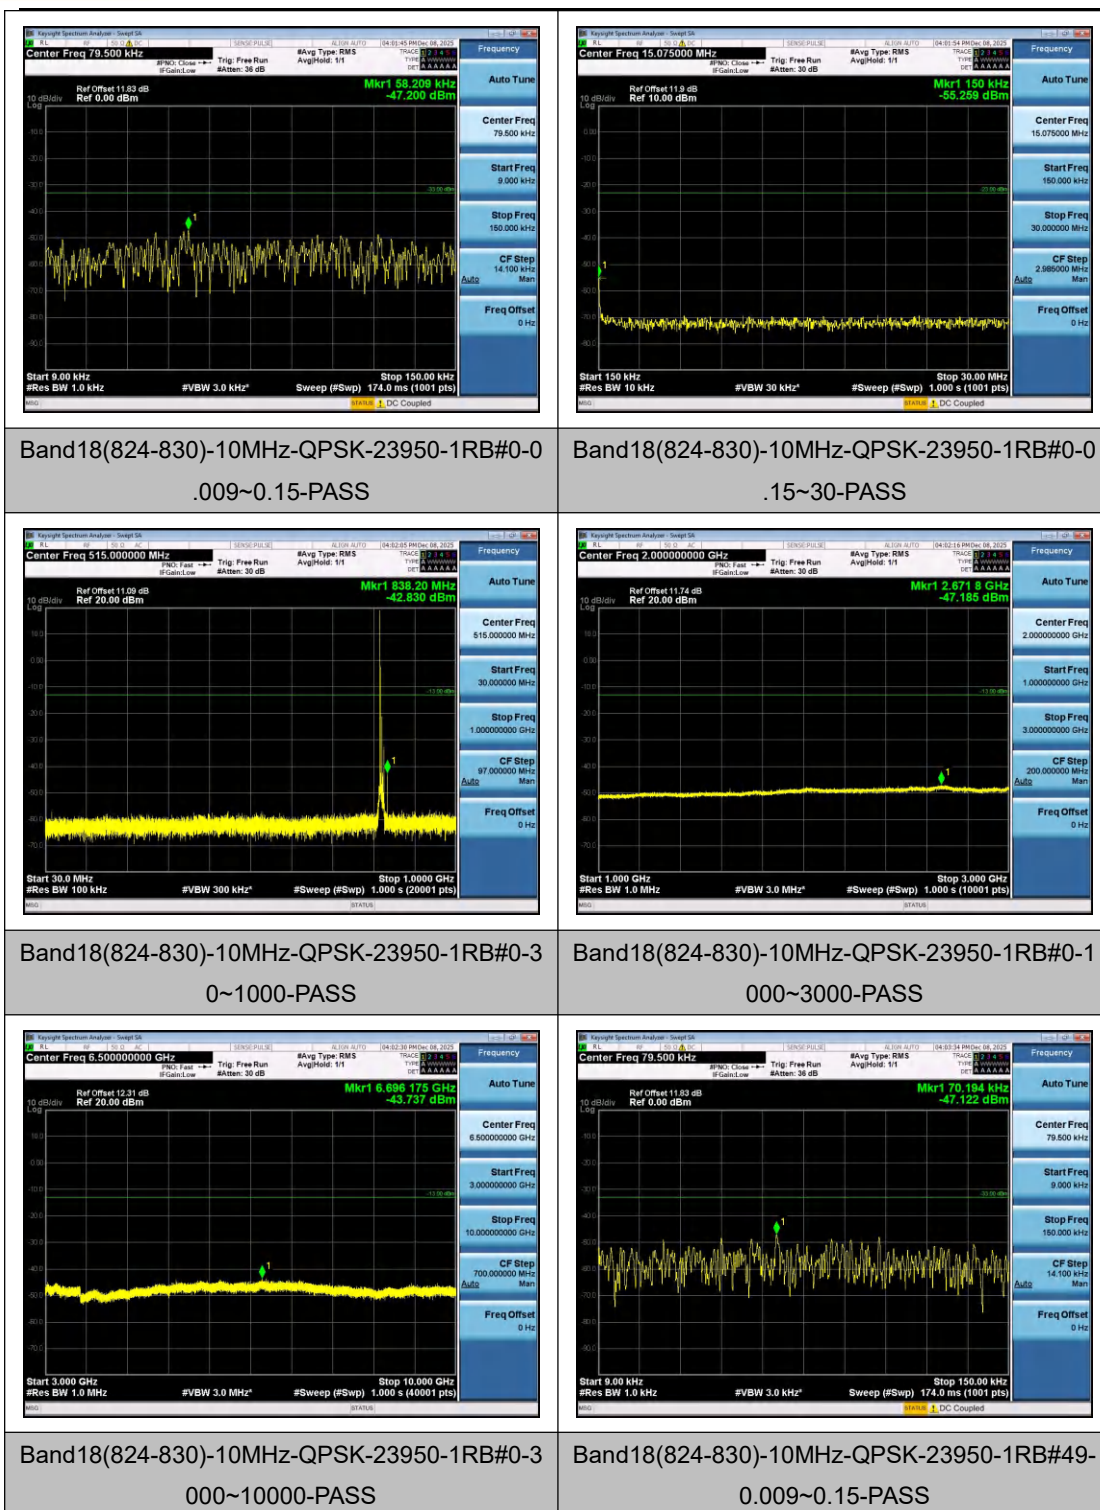


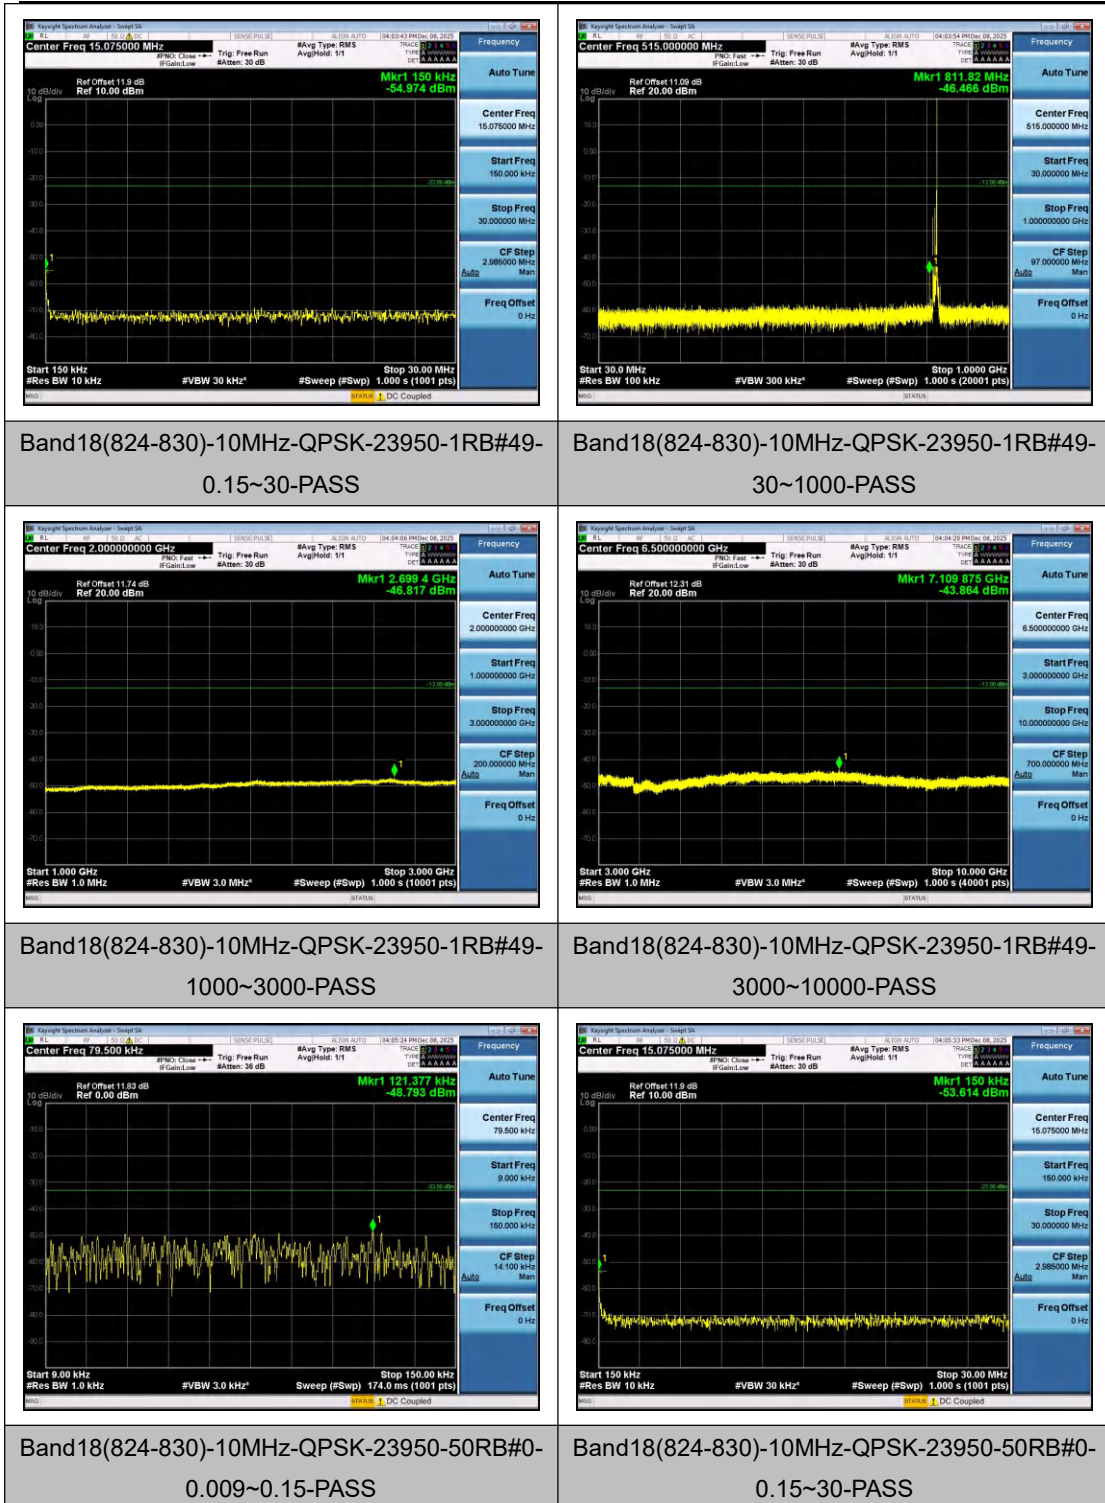


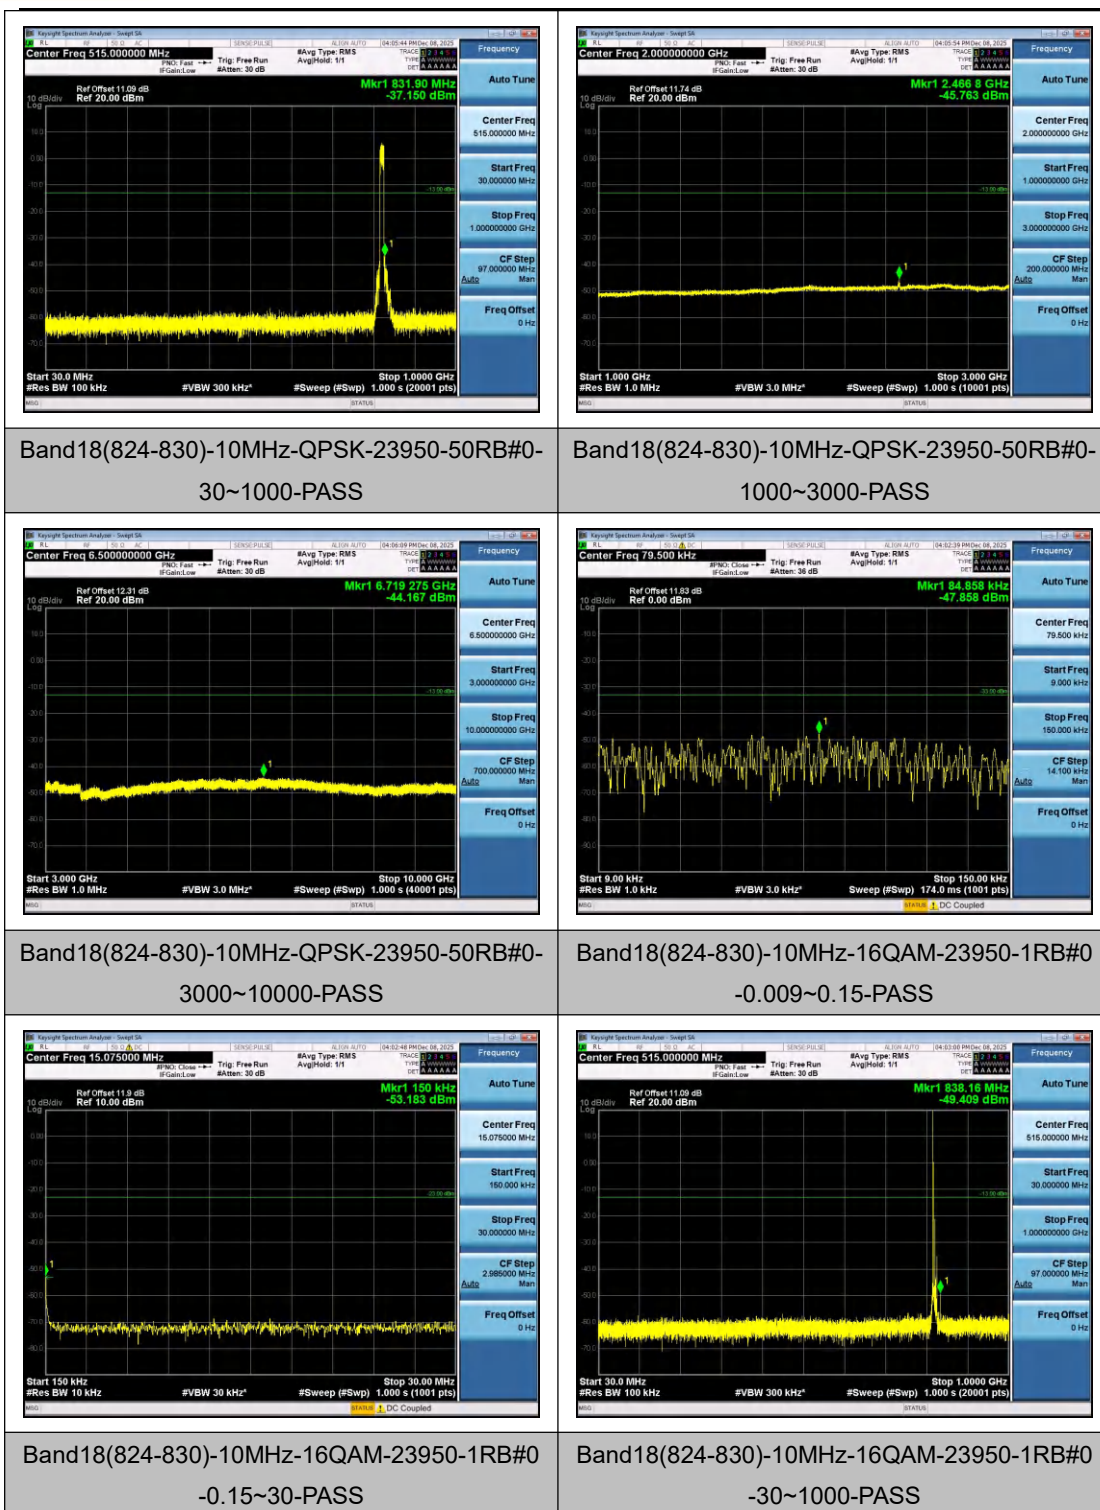


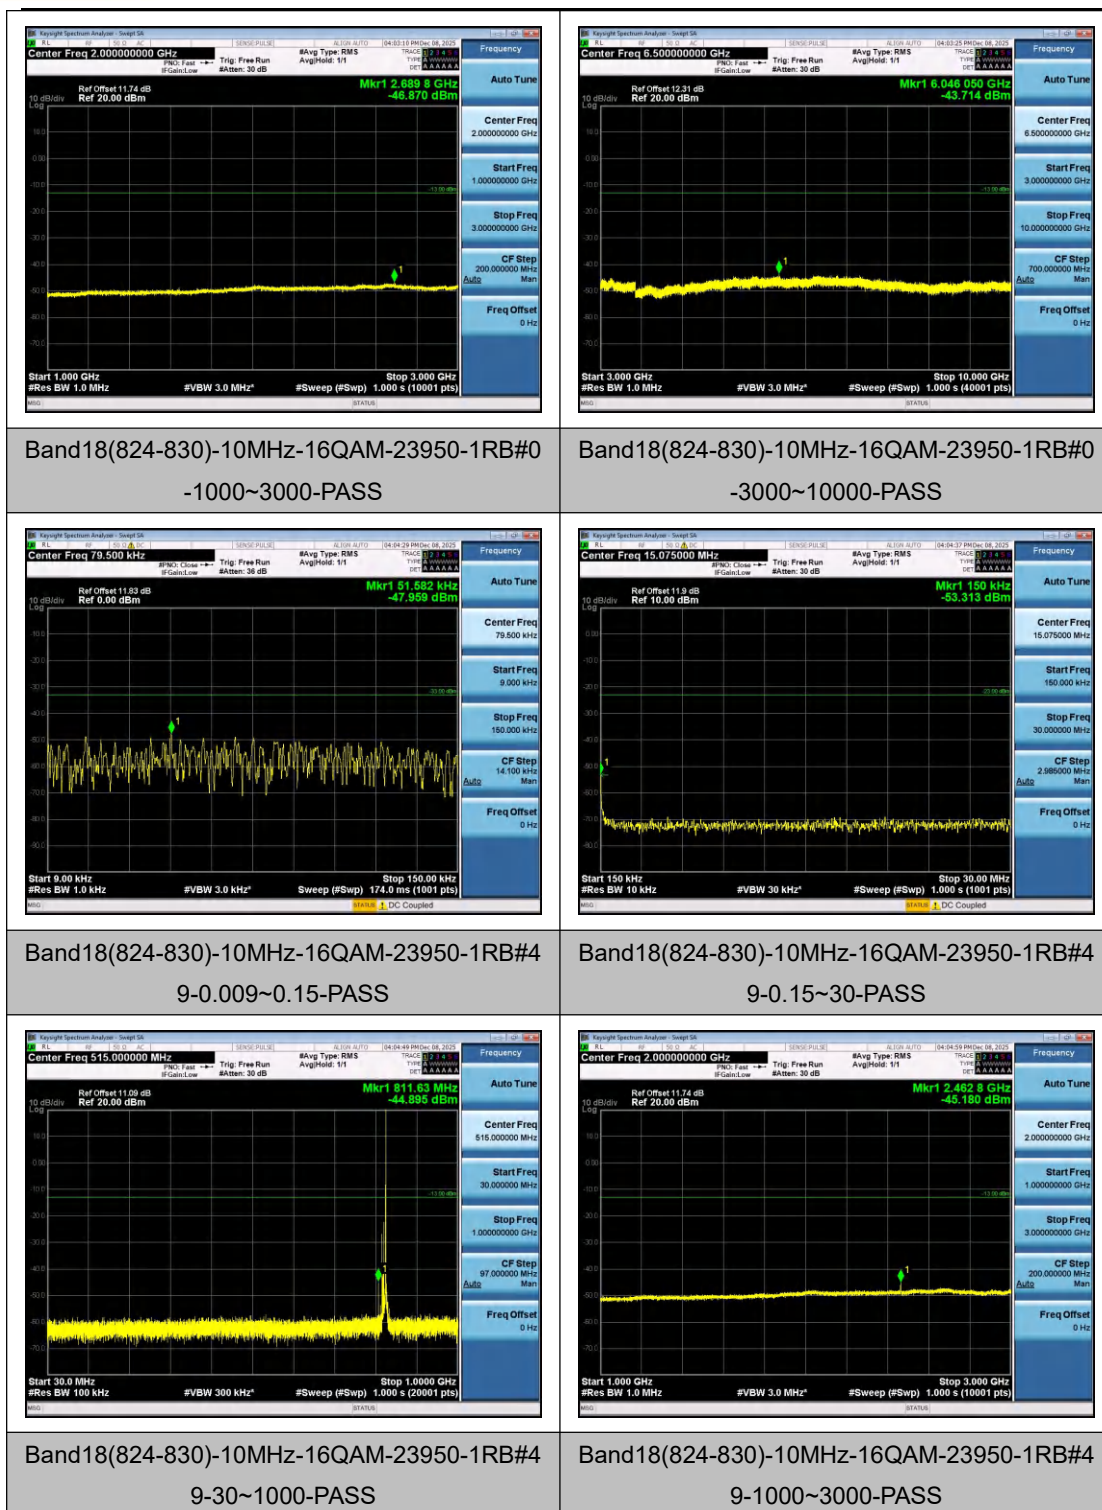


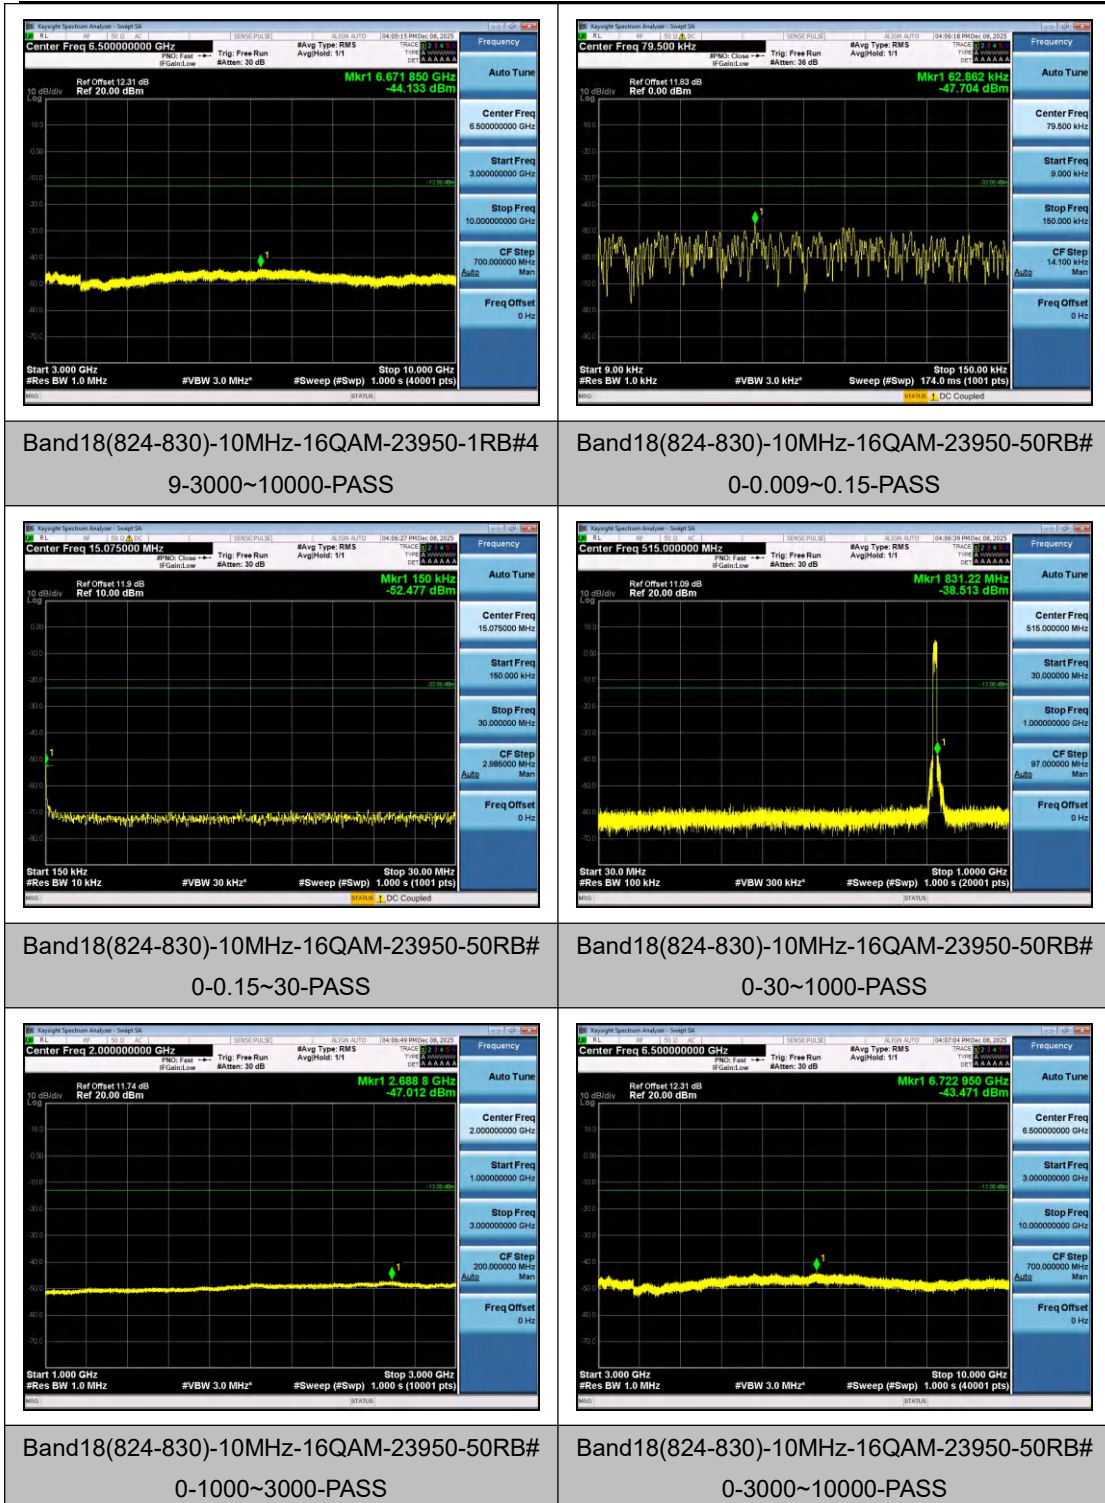


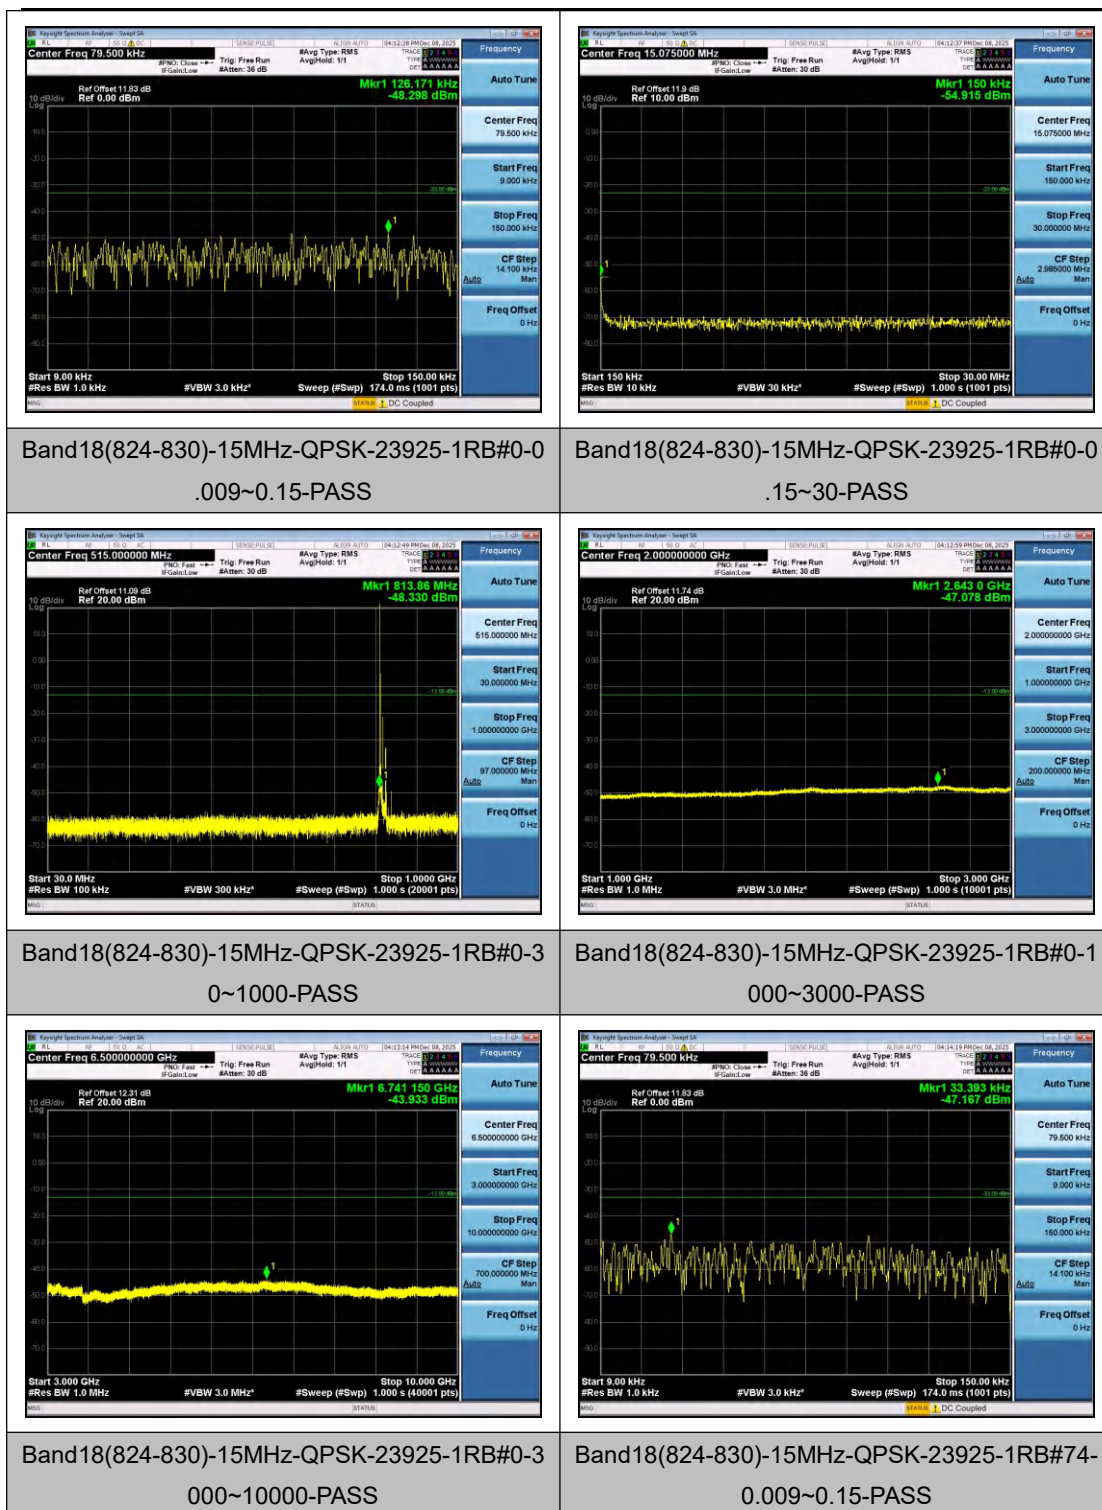

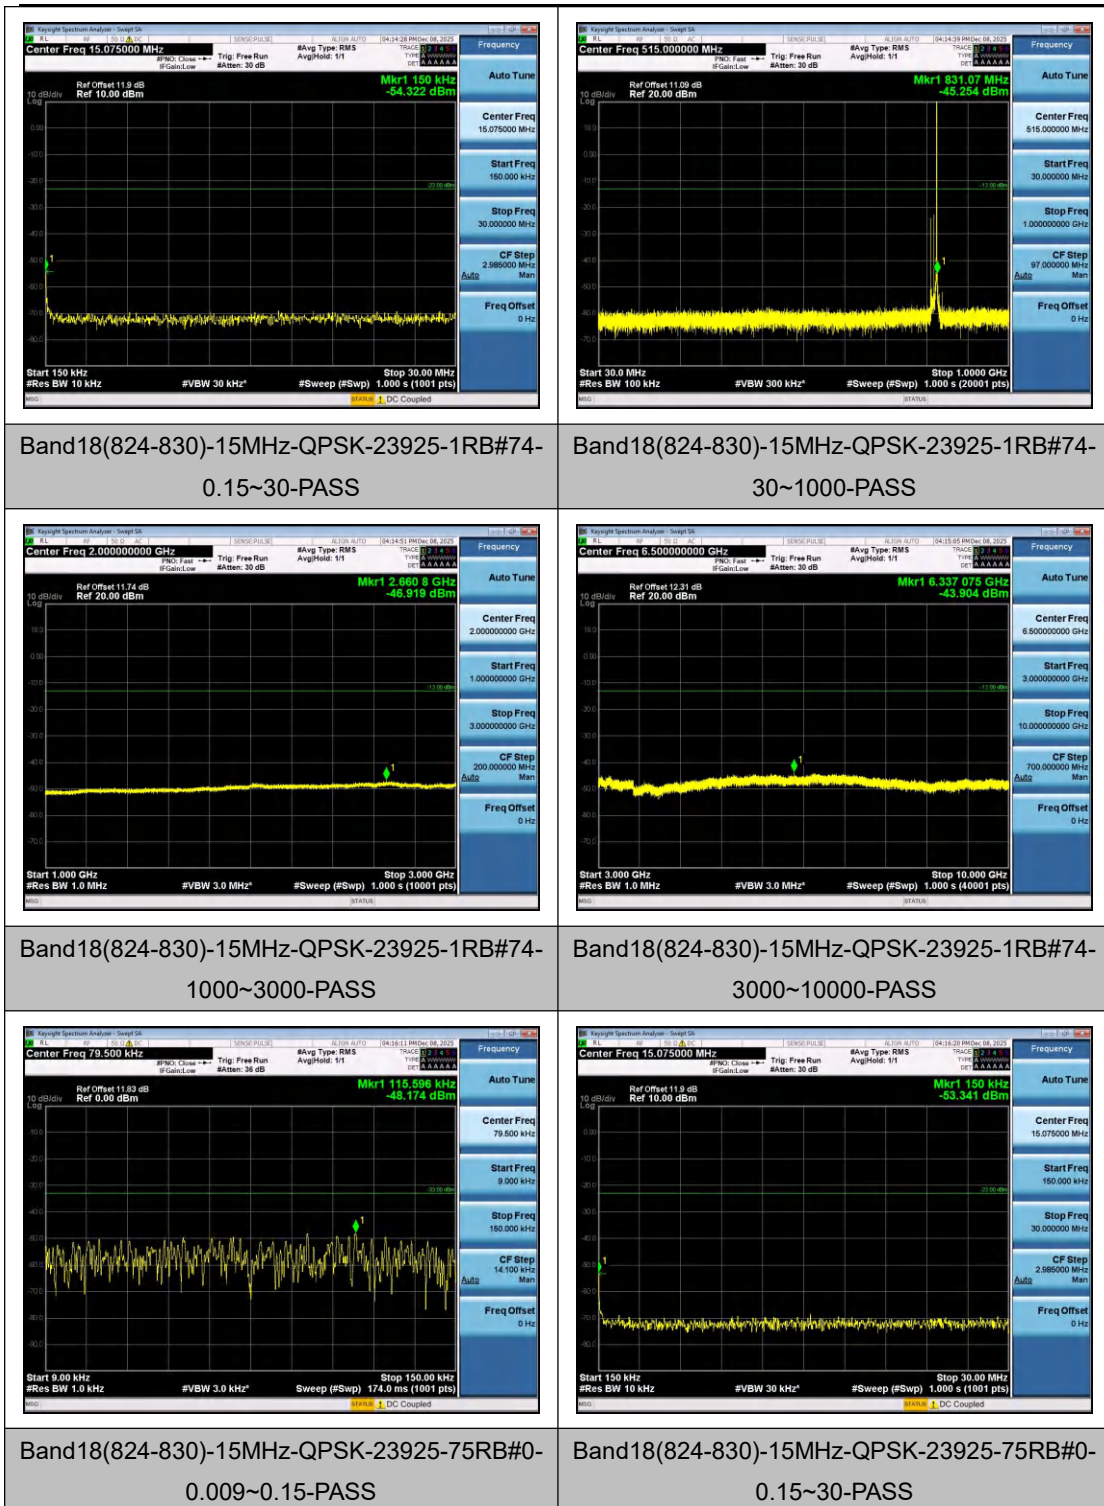

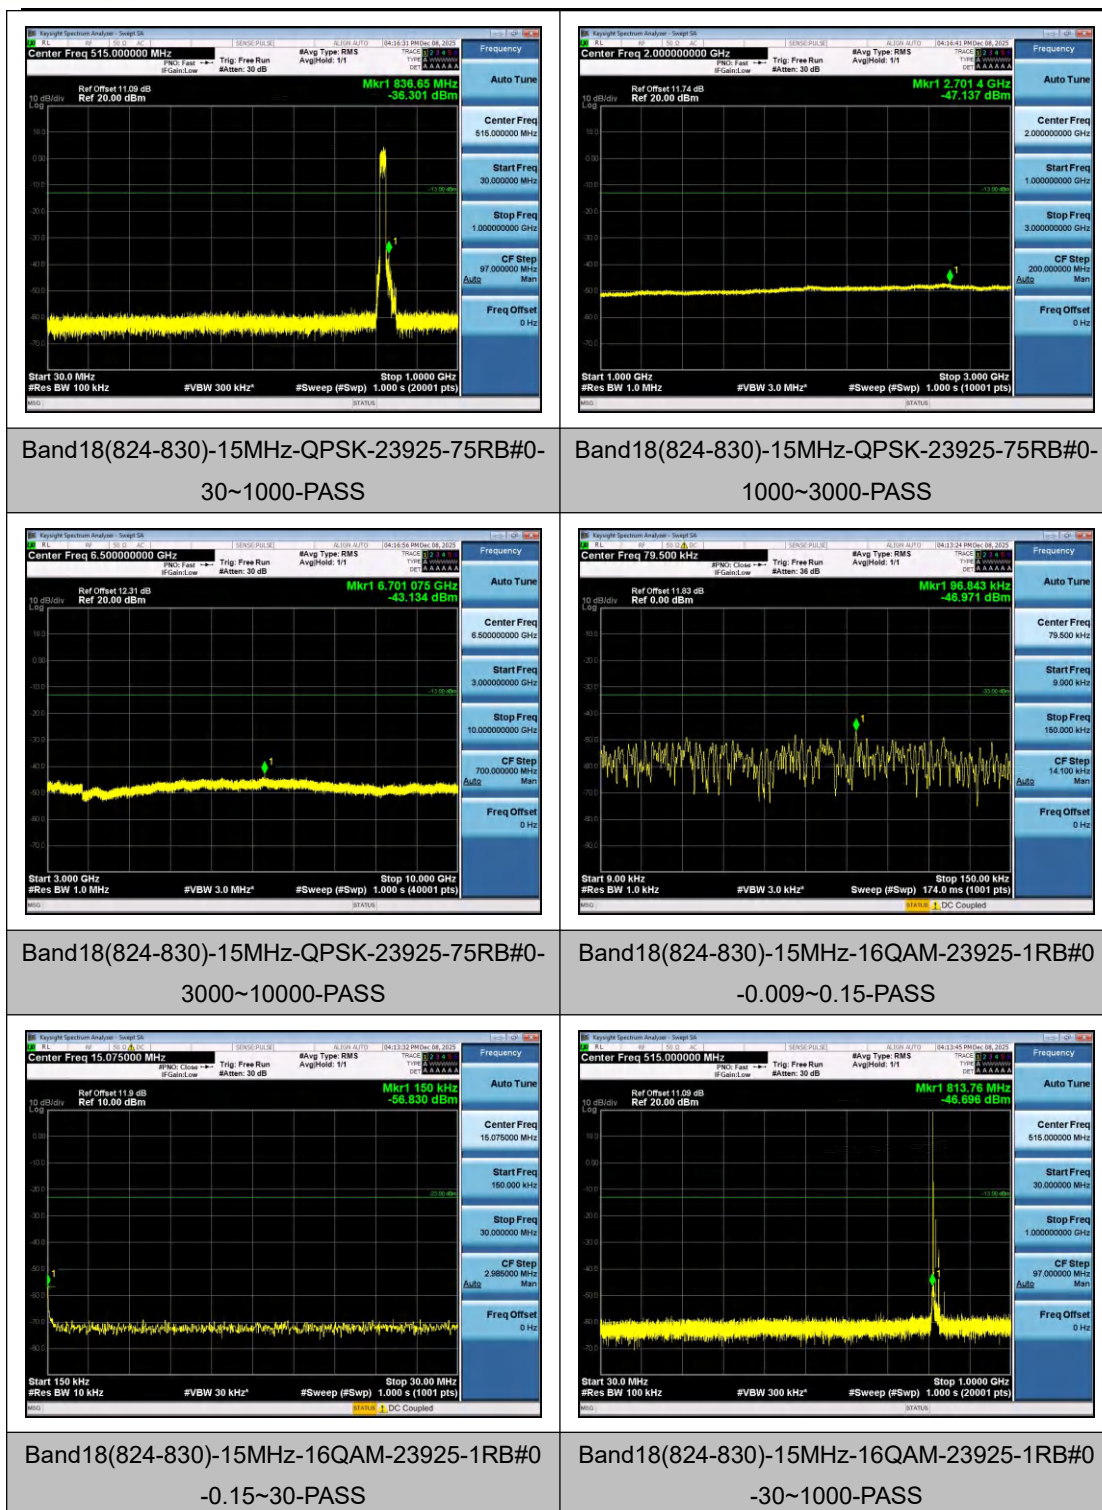

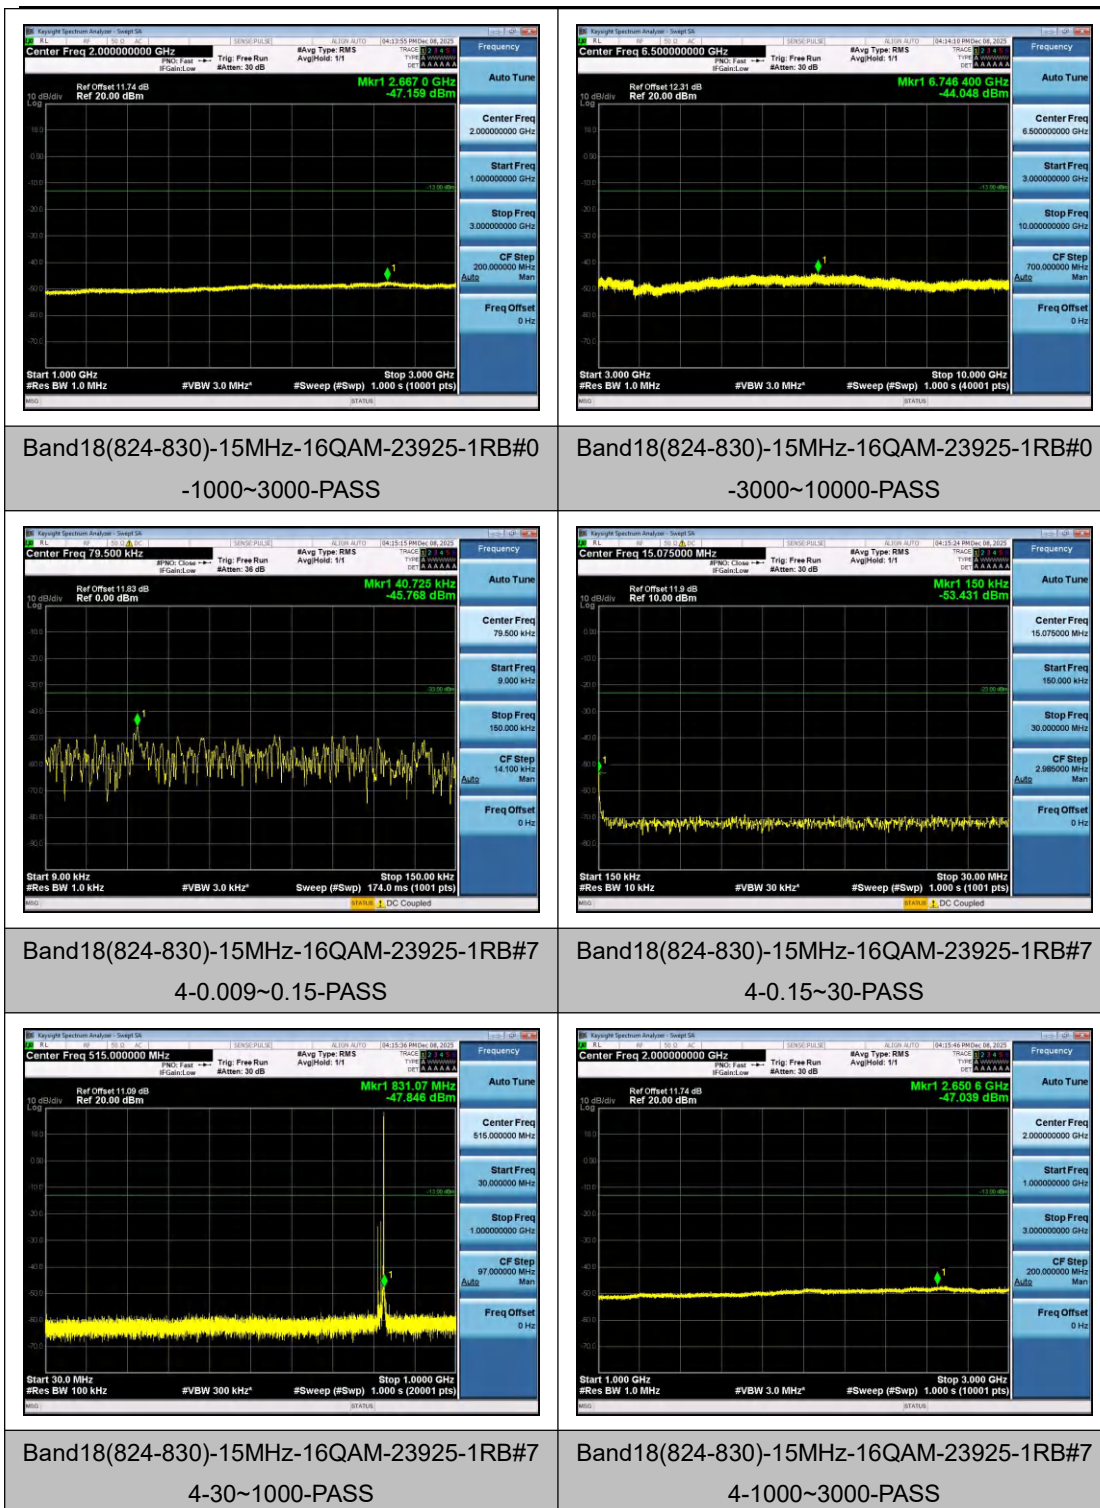

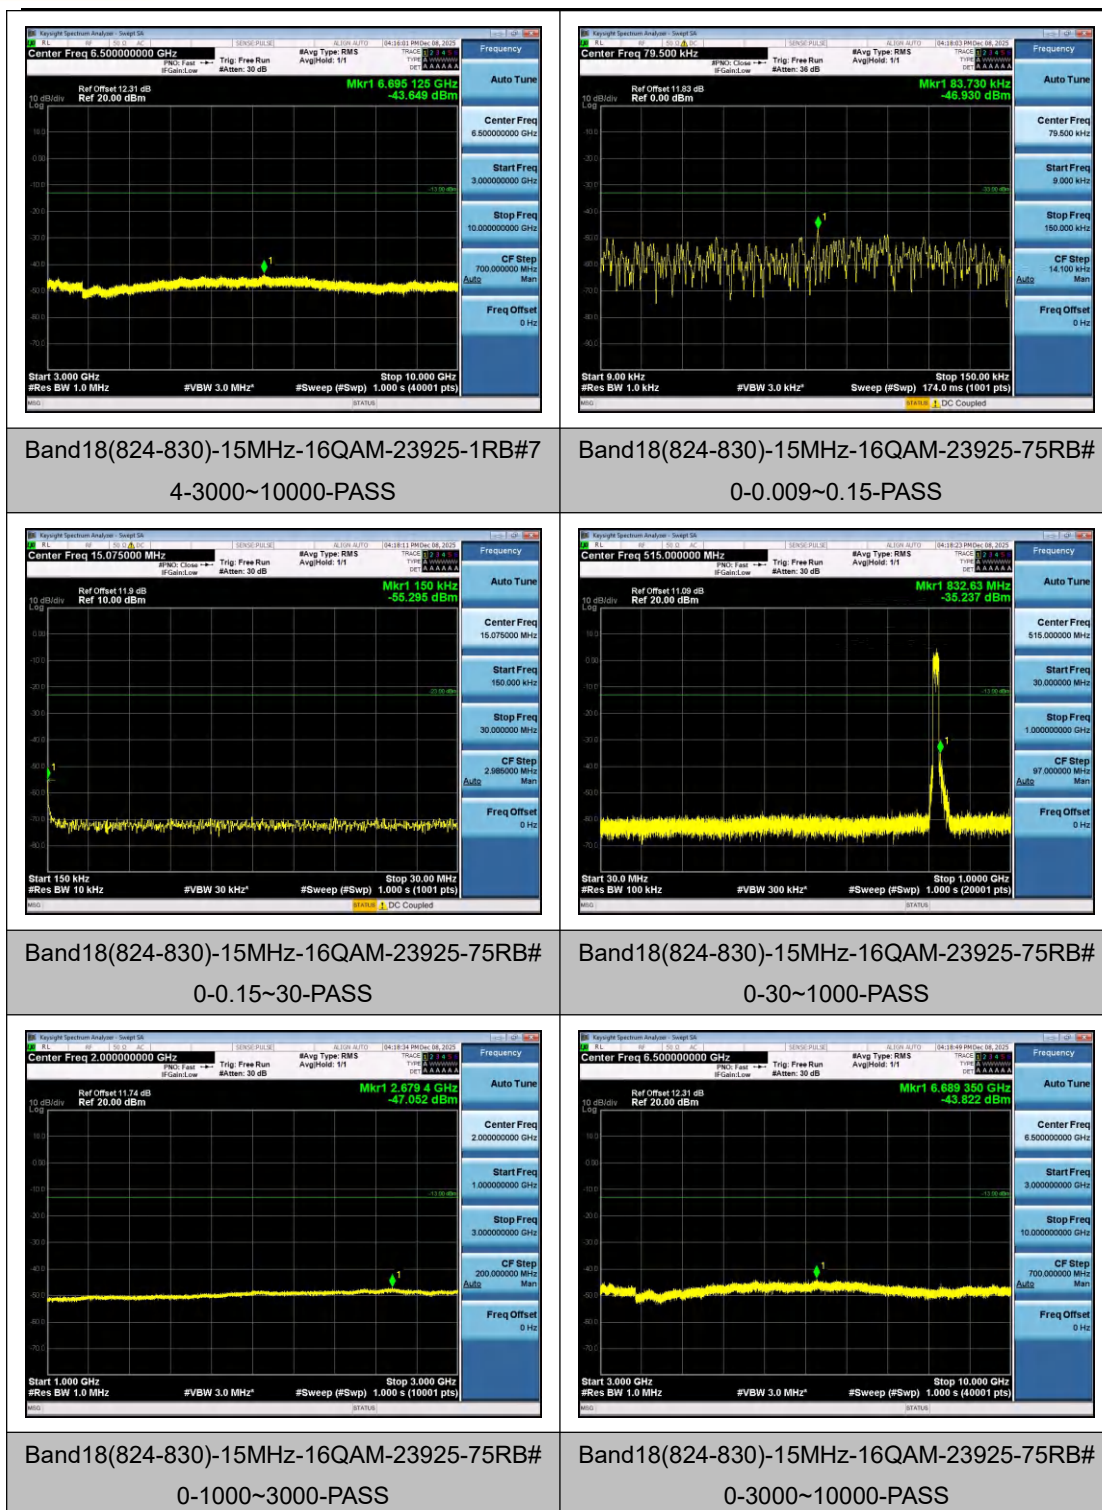

Appendix F: Frequency Stability

Test Result

c										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band18(824-830)	5MHz	QPSK	23965	25RB#0	VN	NT	2.10	0.002541	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	VL	NT	-2.86	-0.003460	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	VH	NT	-2.88	-0.003485	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	VN	NT	-4.38	-0.005299	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	VL	NT	-4.01	-0.004852	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23965	25RB#0	VH	NT	-4.85	-0.005868	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	VN	NT	-4.13	-0.004994	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	VL	NT	-2.90	-0.003507	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23970	25RB#0	VH	NT	-2.90	-0.003507	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	VN	NT	1.56	0.001886	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	VL	NT	3.05	0.003688	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23970	25RB#0	VH	NT	-3.09	-0.003736	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	VN	NT	1.90	0.002296	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	VL	NT	-3.46	-0.004181	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23975	25RB#0	VH	NT	-2.49	-0.003009	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	VN	NT	-3.69	-0.004459	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	VL	NT	-1.87	-0.002260	±2.5	PASS
Band18(824-830)	5MHz	16QAM	23975	25RB#0	VH	NT	-3.08	-0.003722	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

30)										
Band18(824-830)	10MHz	QPSK	23950	50RB#0	VN	NT	-3.98	-0.004824	±2.5	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	VL	NT	-4.48	-0.005430	±2.5	PASS
Band18(824-830)	10MHz	QPSK	23950	50RB#0	VH	NT	-3.59	-0.004352	±2.5	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	VN	NT	2.72	0.003297	±2.5	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	VL	NT	-2.22	-0.002691	±2.5	PASS
Band18(824-830)	10MHz	16QAM	23950	50RB#0	VH	NT	-3.29	-0.003988	±2.5	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	VN	NT	-4.09	-0.004973	±2.5	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	VL	NT	2.59	0.003149	±2.5	PASS
Band18(824-830)	15MHz	QPSK	23925	75RB#0	VH	NT	-2.85	-0.003465	±2.5	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	VN	NT	-2.47	-0.003003	±2.5	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	VL	NT	-2.39	-0.002906	±2.5	PASS
Band18(824-830)	15MHz	16QAM	23925	75RB#0	VH	NT	-1.90	-0.002310	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	-30	-1.99	-0.002408	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	-20	-1.77	-0.002142	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	-10	3.50	0.004235	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	0	2.29	0.002771	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	10	-2.30	-0.002783	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	20	-2.37	-0.002868	±2.5	PASS
Band18(824-830)	5MHz	QPSK	23965	25RB#0	NV	30	-2.33	-0.002819	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

4-830)										
Band18(82 4-830)	5MHz	QPSK	23965	25RB#0	NV	40	-1.97	-0.002384	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23965	25RB#0	NV	50	-2.82	-0.003412	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	-30	-4.96	-0.006001	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	-20	-4.62	-0.005590	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	-10	-4.13	-0.004997	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	0	-3.23	-0.003908	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	10	-4.35	-0.005263	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	20	-3.81	-0.004610	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	30	-4.15	-0.005021	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	40	-3.63	-0.004392	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23965	25RB#0	NV	50	-3.58	-0.004332	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	-30	-2.30	-0.002781	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	-20	-2.68	-0.003241	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	-10	-2.63	-0.003180	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	0	-2.62	-0.003168	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	10	1.67	0.002019	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	20	-1.99	-0.002406	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	30	-3.05	-0.003688	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	40	-2.43	-0.002938	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23970	25RB#0	NV	50	-2.06	-0.002491	±2.5	PASS
Band18(82	5MHz	16QAM	23970	25RB#0	NV	-30	-3.71	-0.004486	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

4-830)										
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	-20	-2.35	-0.002842	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	-10	-4.22	-0.005103	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	0	-3.08	-0.003724	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	10	2.19	0.002648	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	20	-1.66	-0.002007	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	30	1.52	0.001838	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	40	-2.00	-0.002418	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23970	25RB#0	NV	50	-2.23	-0.002696	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	-30	-3.91	-0.004725	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	-20	-2.15	-0.002598	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	-10	-4.41	-0.005329	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	0	-3.79	-0.004580	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	10	-4.11	-0.004967	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	20	-3.26	-0.003940	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	30	-1.30	-0.001571	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	40	-4.19	-0.005063	±2.5	PASS
Band18(82 4-830)	5MHz	QPSK	23975	25RB#0	NV	50	-3.10	-0.003746	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	-30	-1.34	-0.001619	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	-20	1.77	0.002139	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	-10	2.10	0.002538	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	0	2.78	0.003360	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

4-830)										
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	10	-2.90	-0.003505	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	20	-4.26	-0.005148	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	30	-1.69	-0.002042	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	40	-3.82	-0.004616	±2.5	PASS
Band18(82 4-830)	5MHz	16QAM	23975	25RB#0	NV	50	2.60	0.003142	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	-30	-4.02	-0.004873	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	-20	-3.49	-0.004230	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	-10	-3.42	-0.004145	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	0	-4.32	-0.005236	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	10	-3.49	-0.004230	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	20	-2.06	-0.002497	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	30	-2.59	-0.003139	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	40	-3.06	-0.003709	±2.5	PASS
Band18(82 4-830)	10MHz	QPSK	23950	50RB#0	NV	50	-2.75	-0.003333	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	-30	-2.45	-0.002970	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	-20	1.57	0.001903	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	-10	-4.59	-0.005564	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	0	-3.88	-0.004703	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	10	-2.89	-0.003503	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	20	-3.98	-0.004824	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	30	-3.93	-0.004764	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

4-830)										
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	40	-3.96	-0.004800	±2.5	PASS
Band18(82 4-830)	10MHz	16QAM	23950	50RB#0	NV	50	-4.36	-0.005285	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	-30	-2.17	-0.002638	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	-20	-3.89	-0.004729	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	-10	-2.05	-0.002492	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	0	-2.36	-0.002869	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	10	-2.75	-0.003343	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	20	-1.42	-0.001726	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	30	-1.75	-0.002128	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	40	-3.03	-0.003684	±2.5	PASS
Band18(82 4-830)	15MHz	QPSK	23925	75RB#0	NV	50	2.63	0.003198	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	-30	1.70	0.002067	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	-20	-1.89	-0.002298	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	-10	-2.65	-0.003222	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	0	-1.43	-0.001739	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	10	-2.98	-0.003623	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	20	-3.99	-0.004851	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	30	-2.25	-0.002736	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	40	2.36	0.002869	±2.5	PASS
Band18(82 4-830)	15MHz	16QAM	23925	75RB#0	NV	50	3.91	0.004754	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com