






Band2-20MHz-QPSK-18700-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-18700-1RB#0-0.15~30-PA SS
Band2-20MHz-QPSK-18700-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-18700-1RB#0-1000~3000- PASS
Band2-20MHz-QPSK-18700-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-18700-1RB#99-0.009~0.1 5-PASS

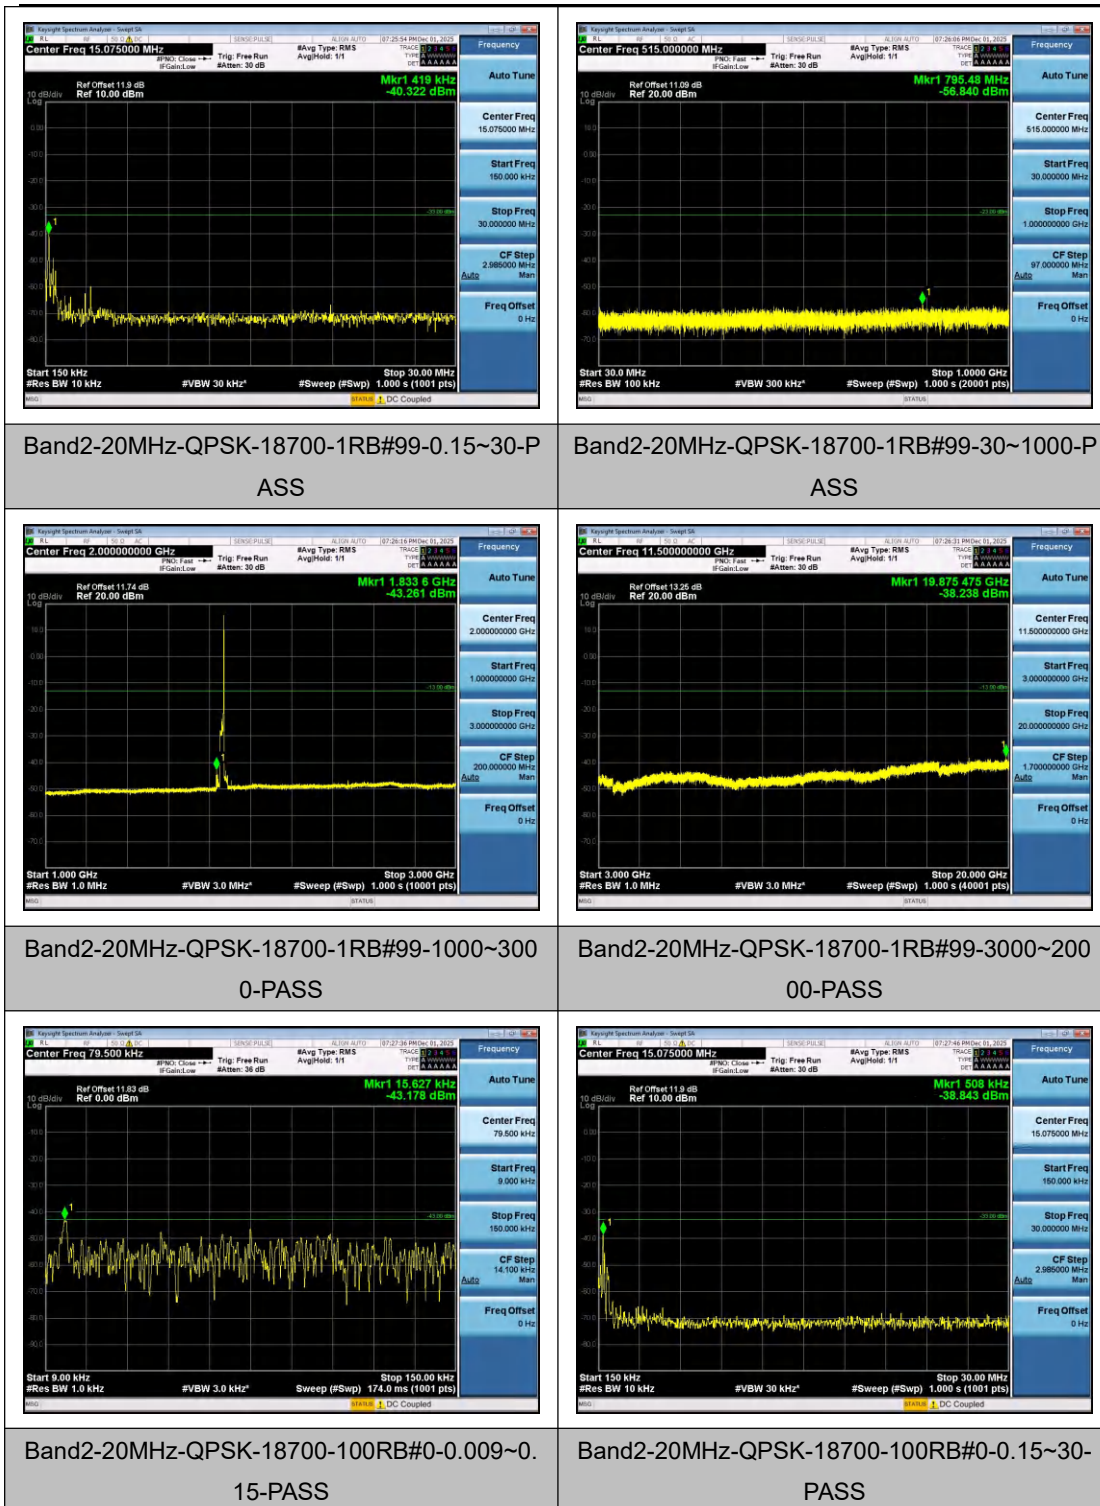


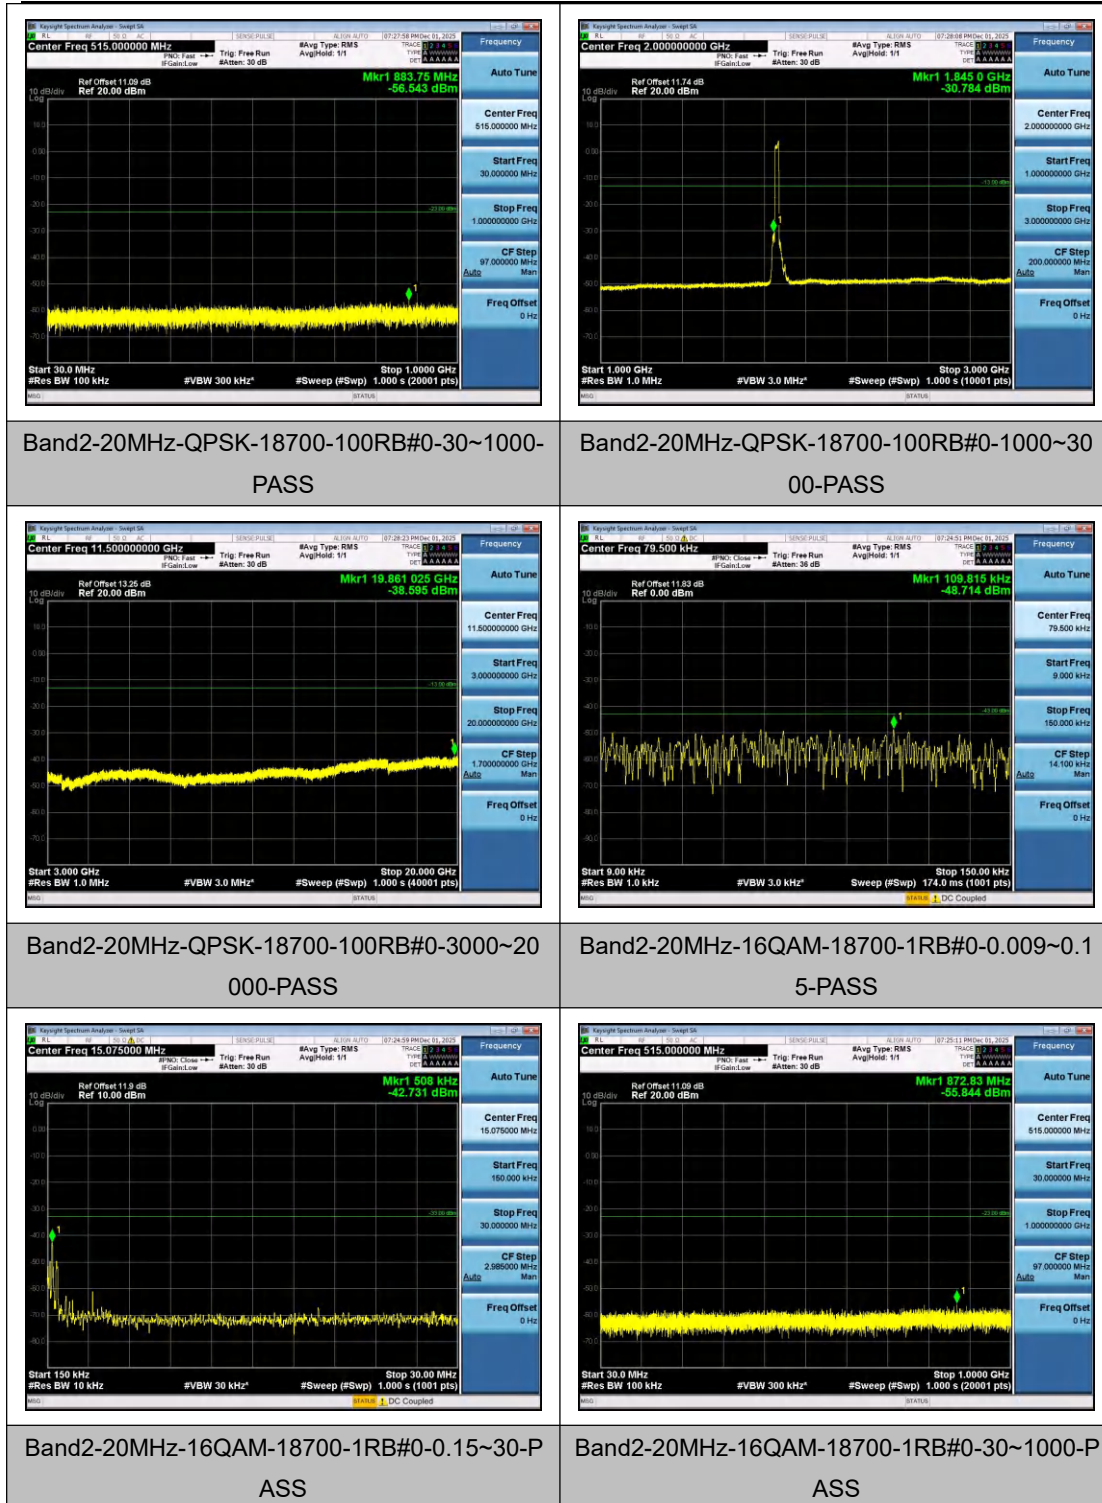


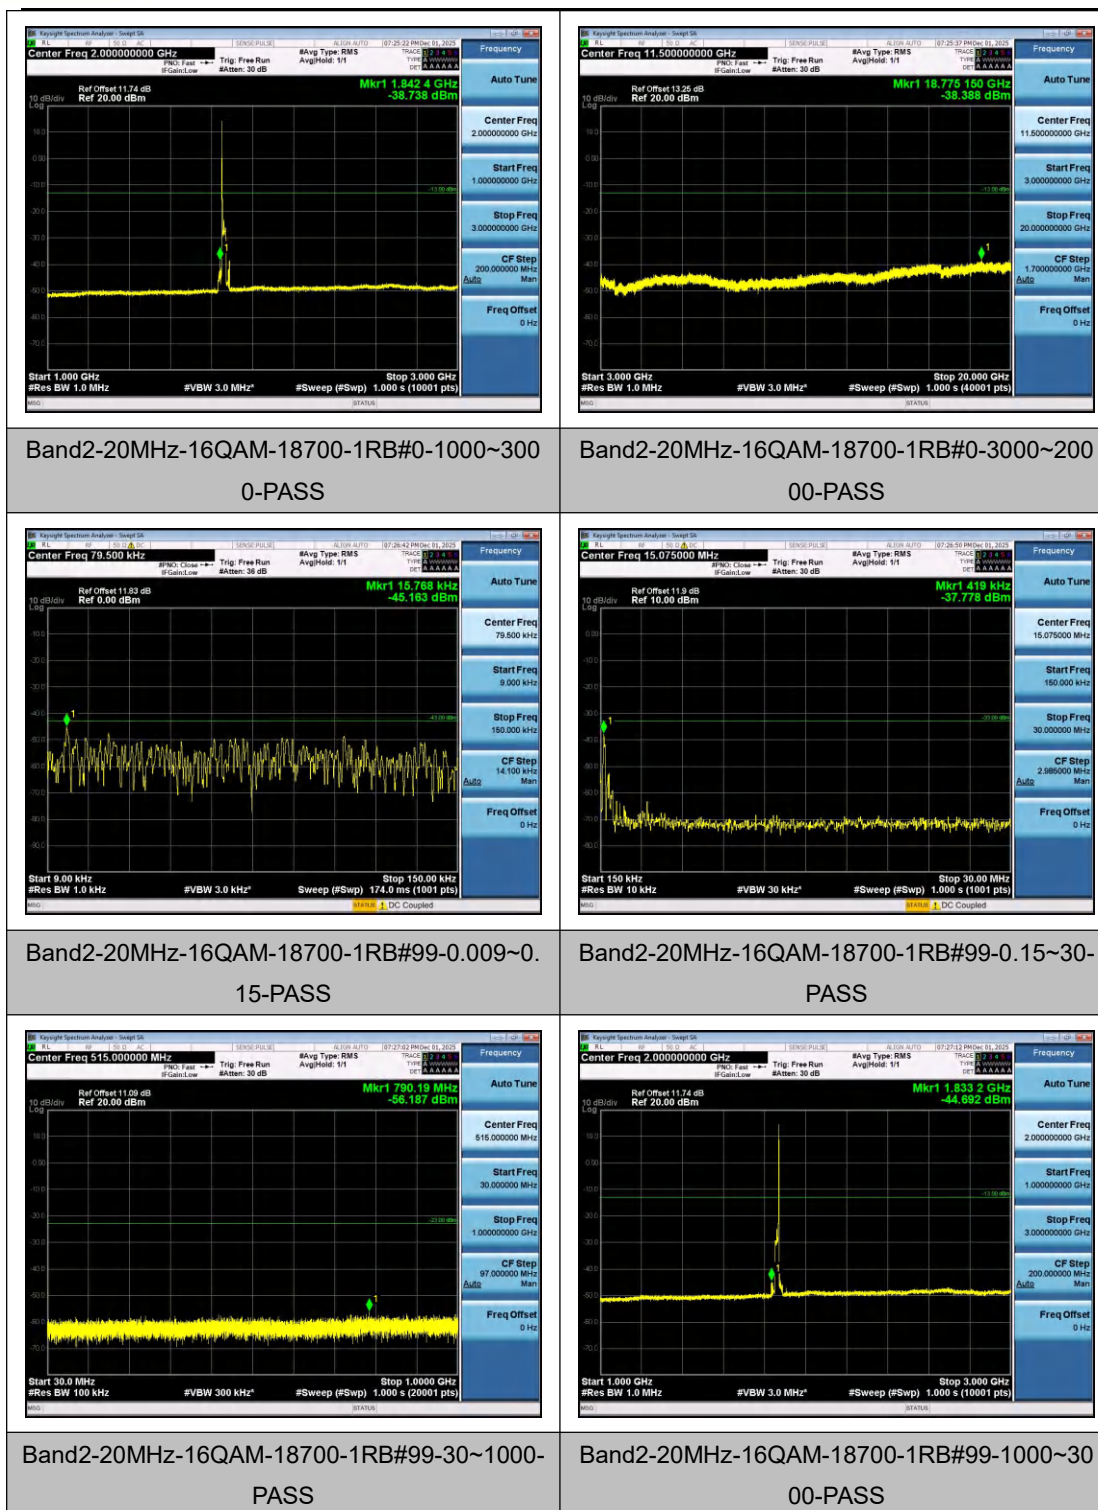


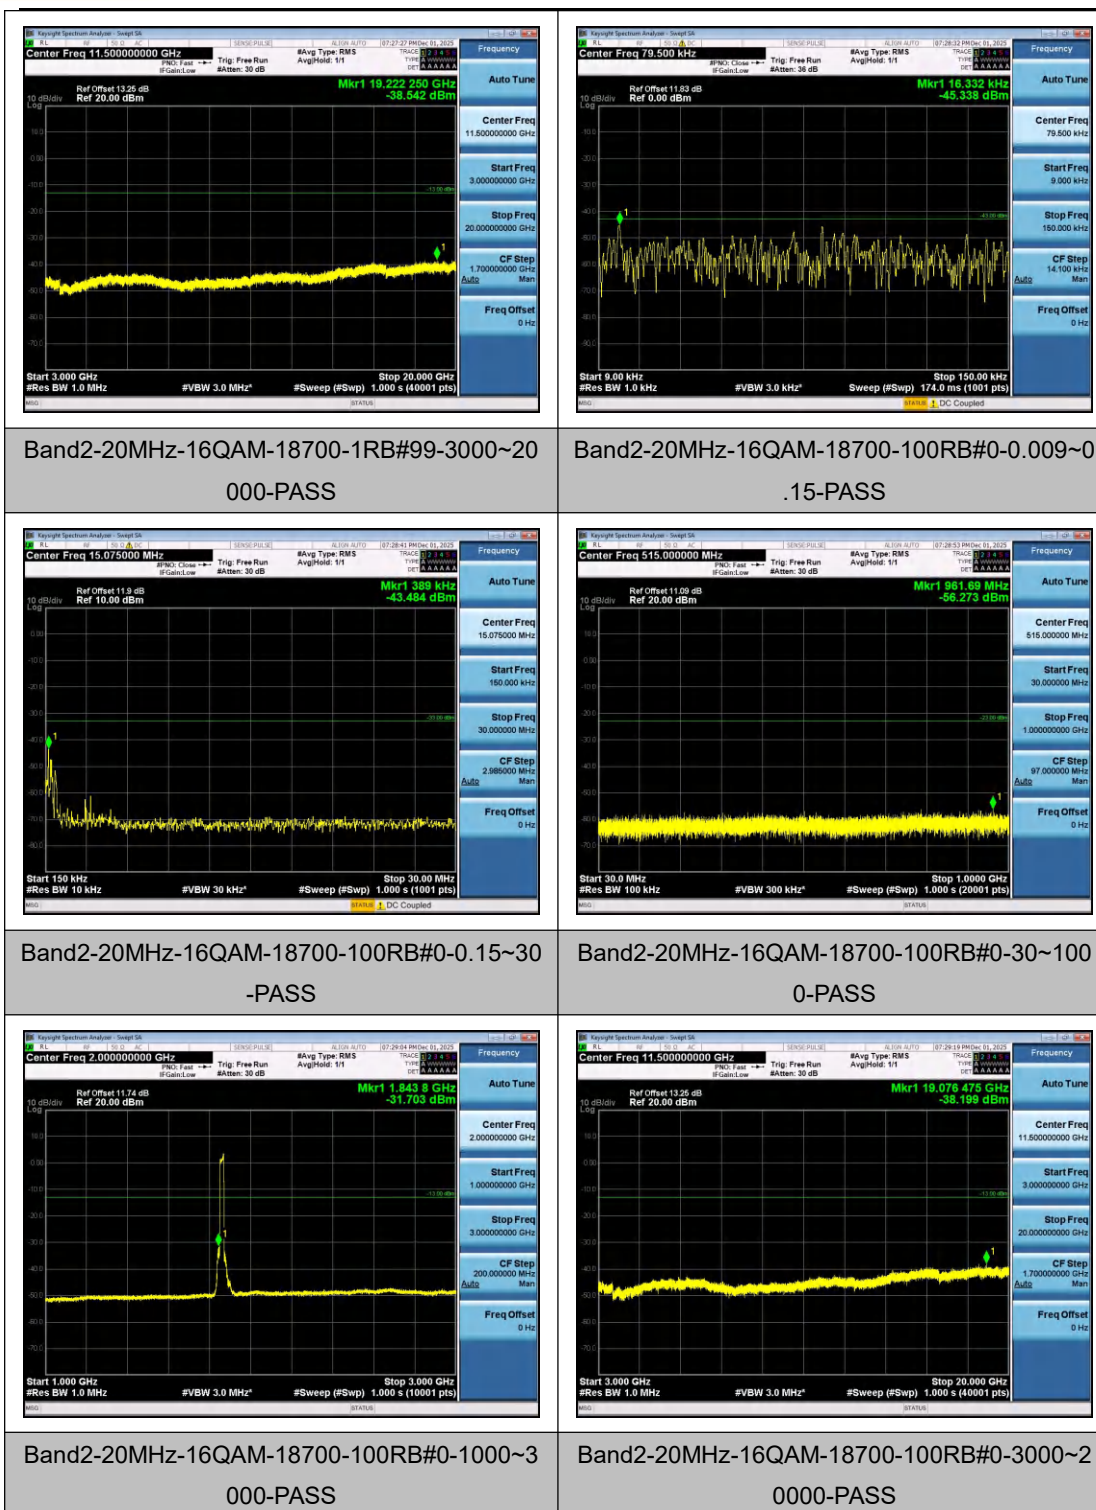







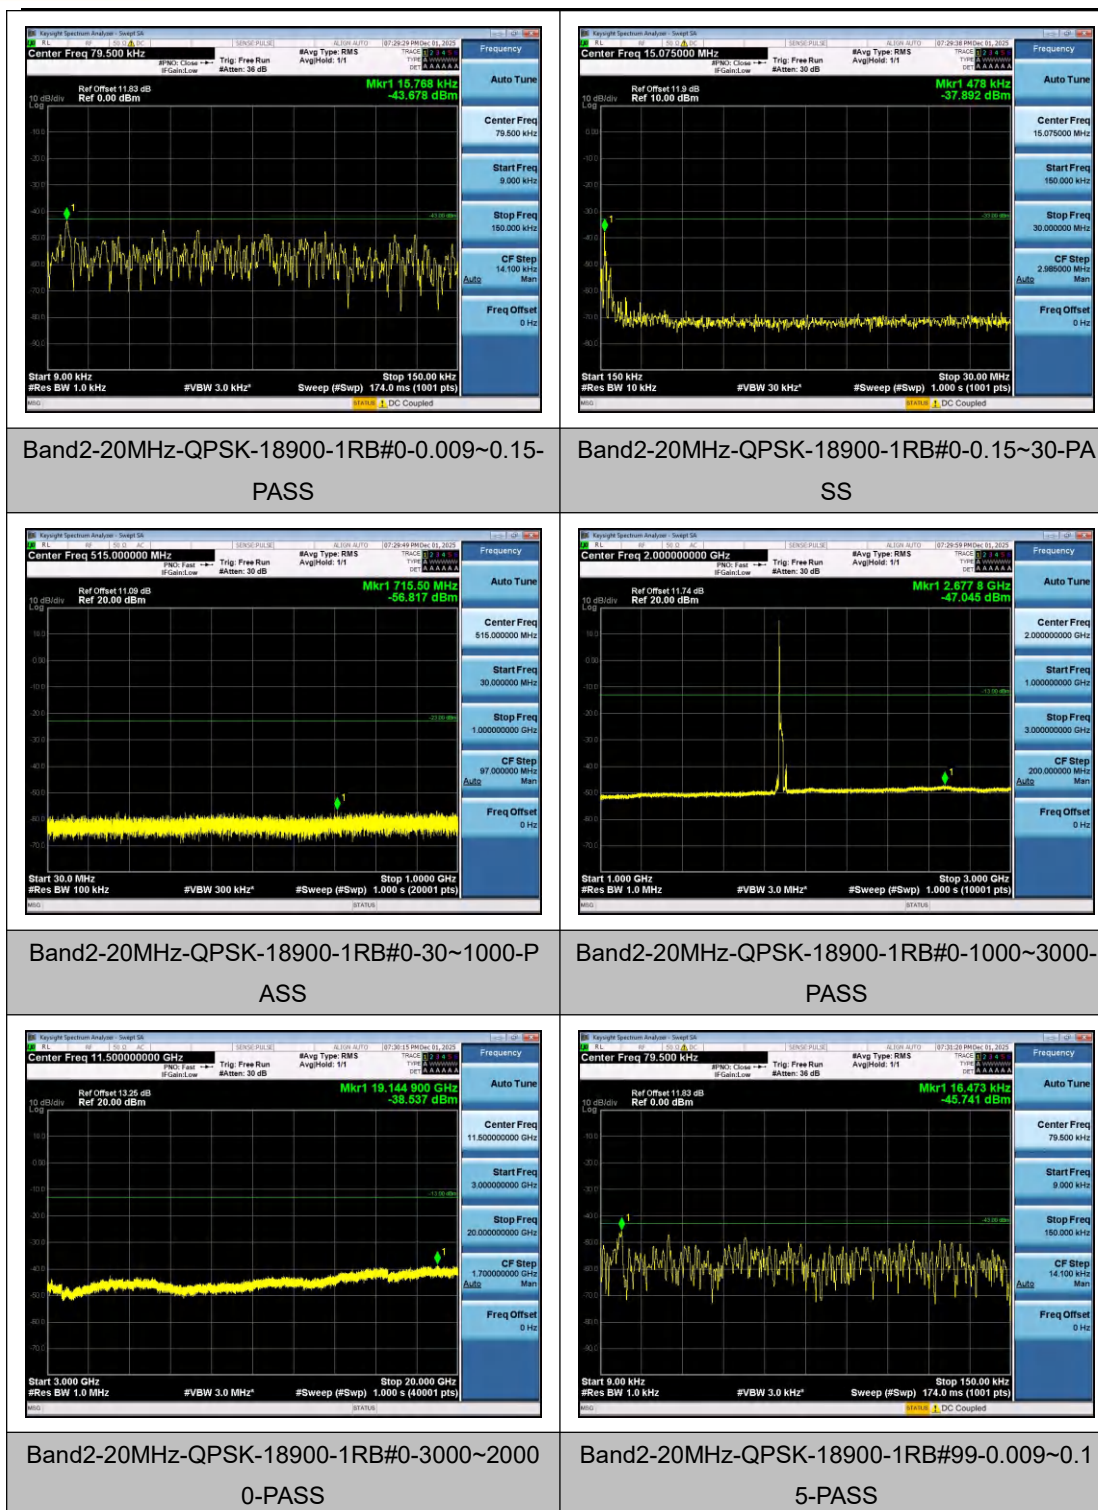


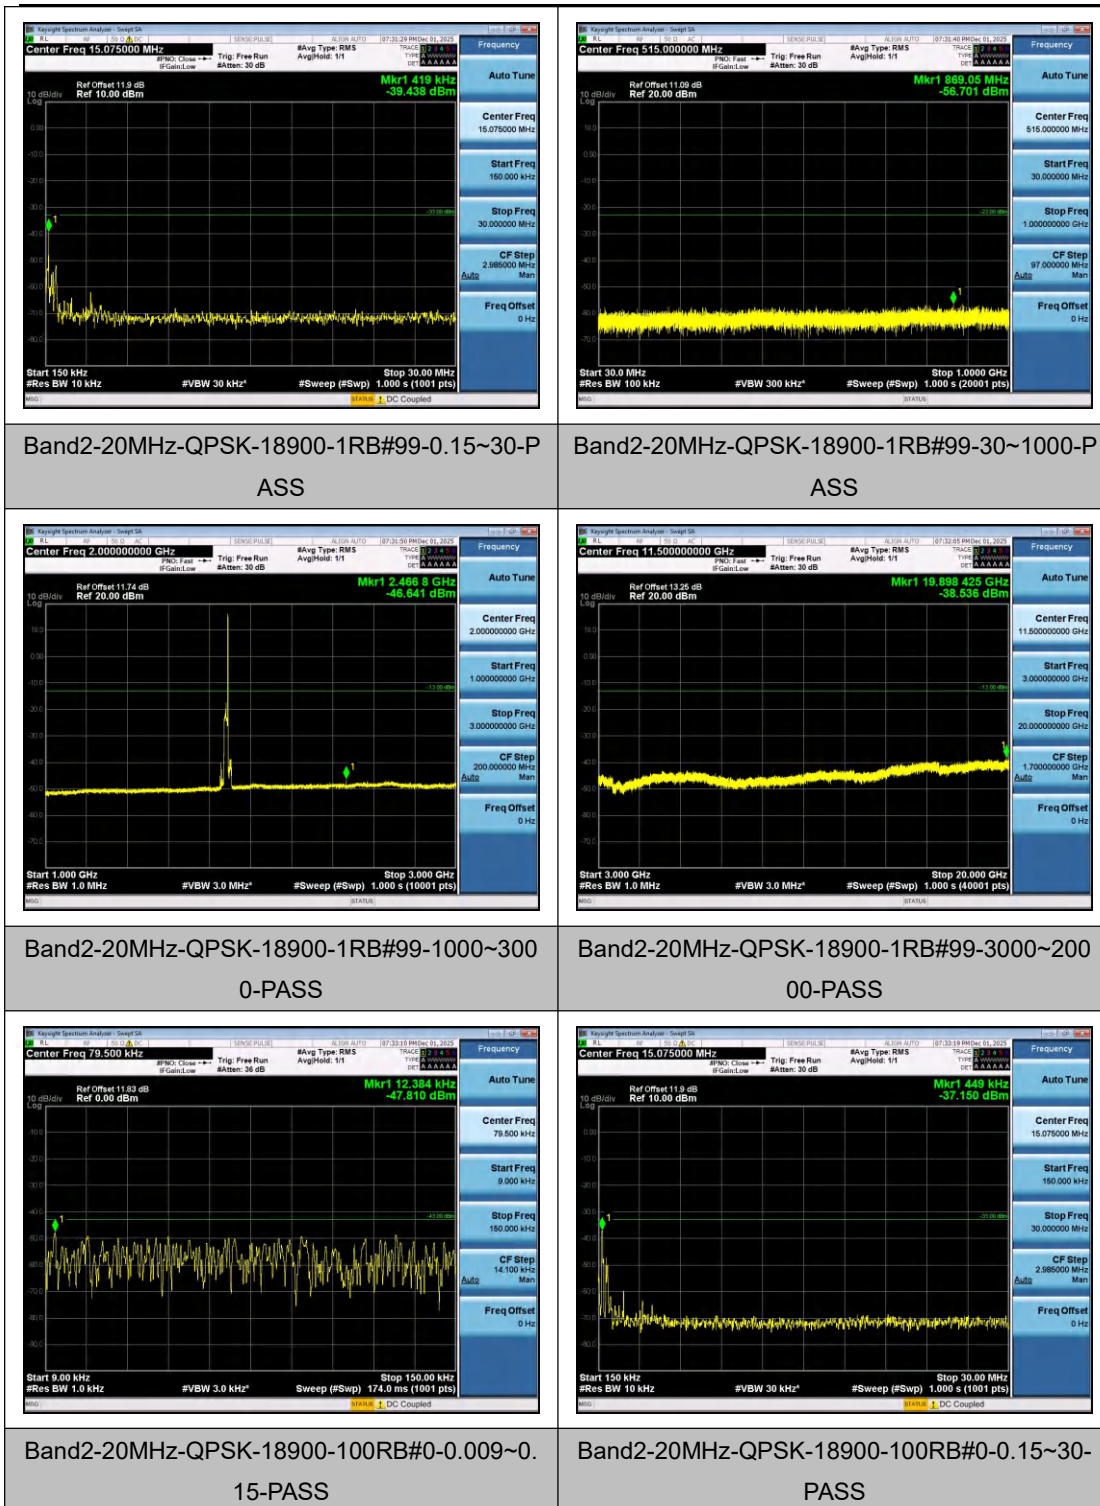


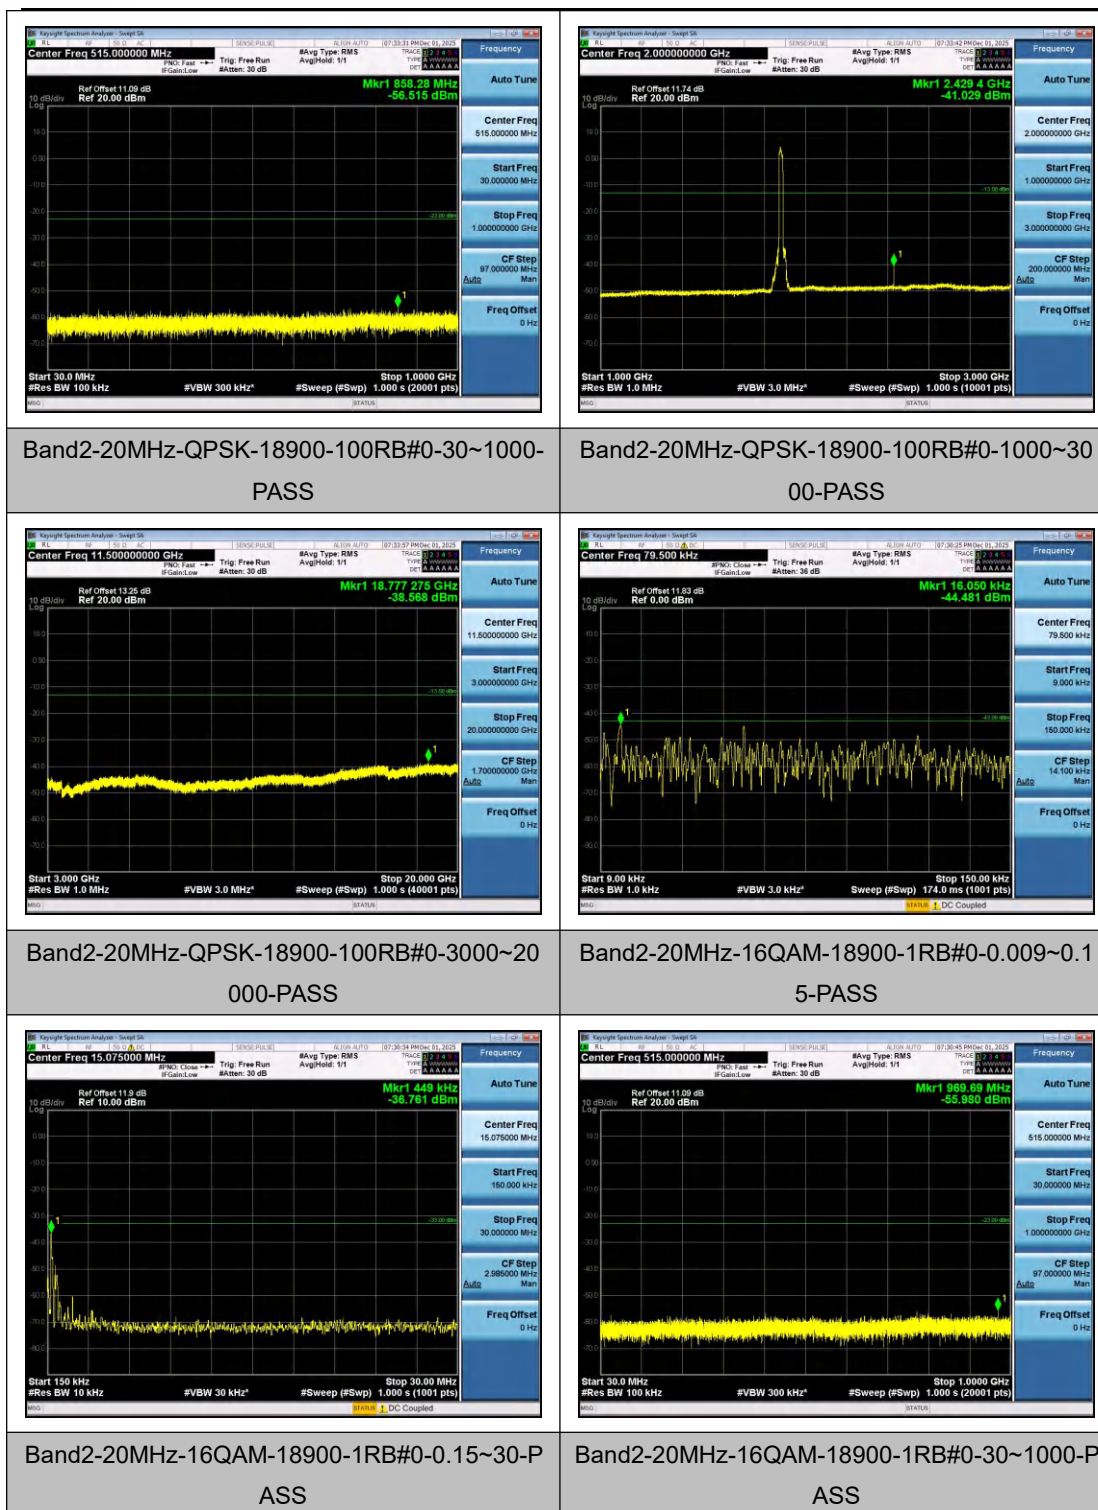


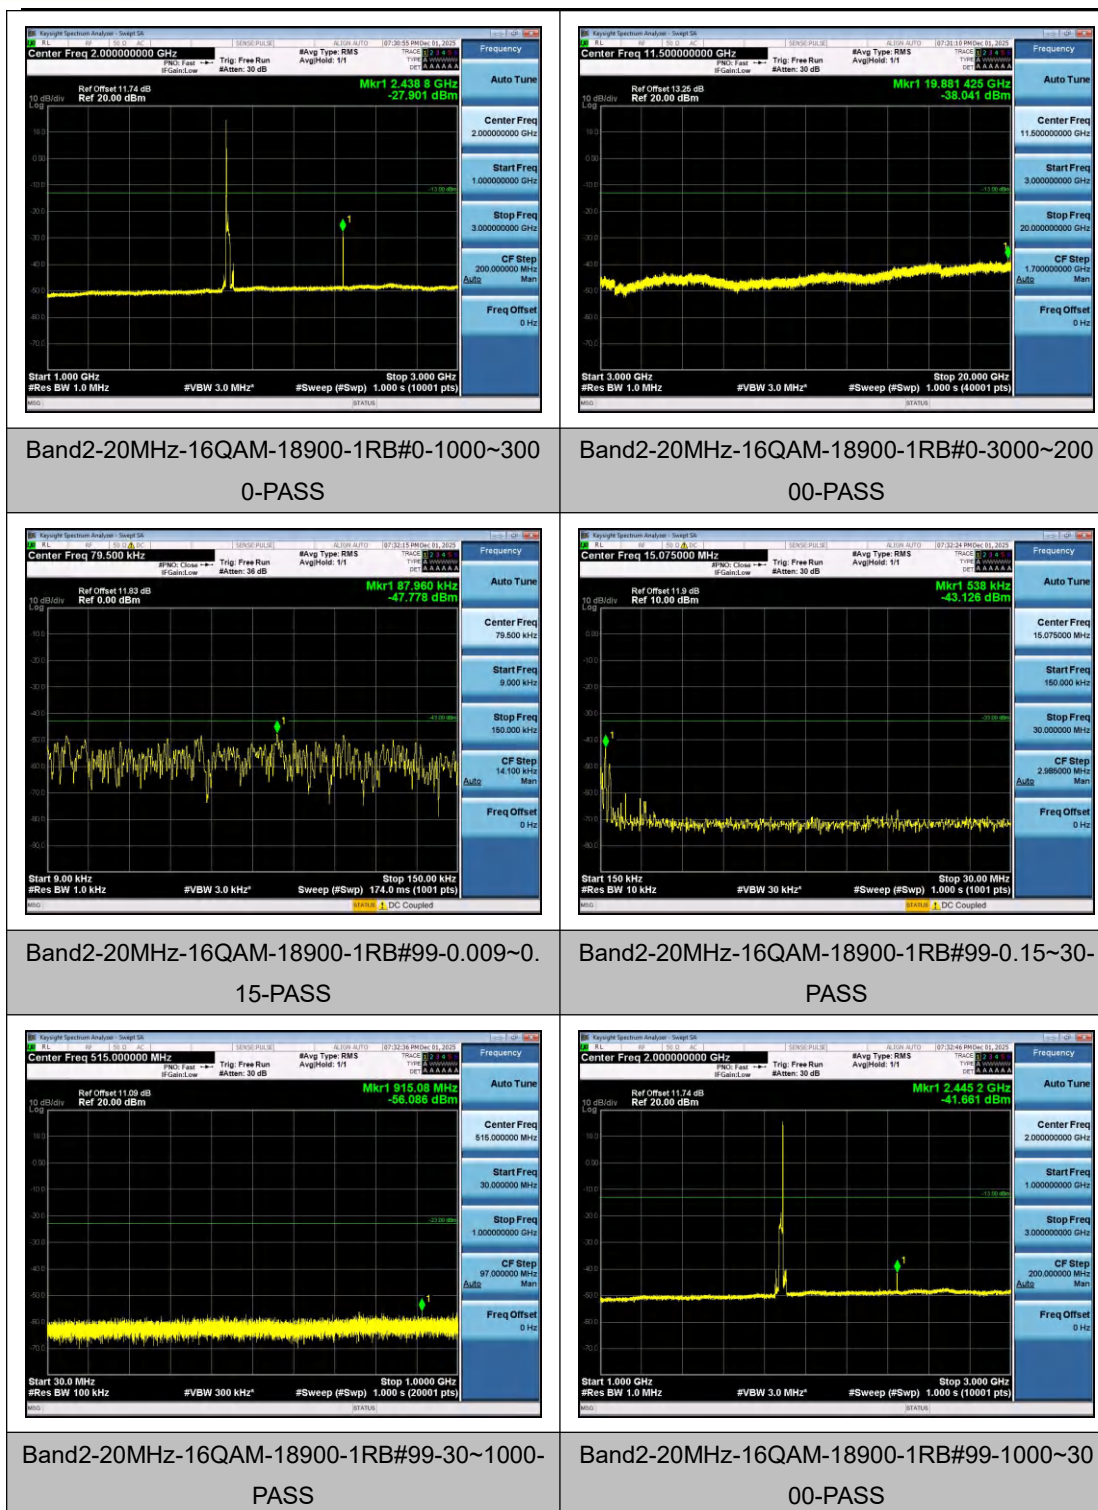


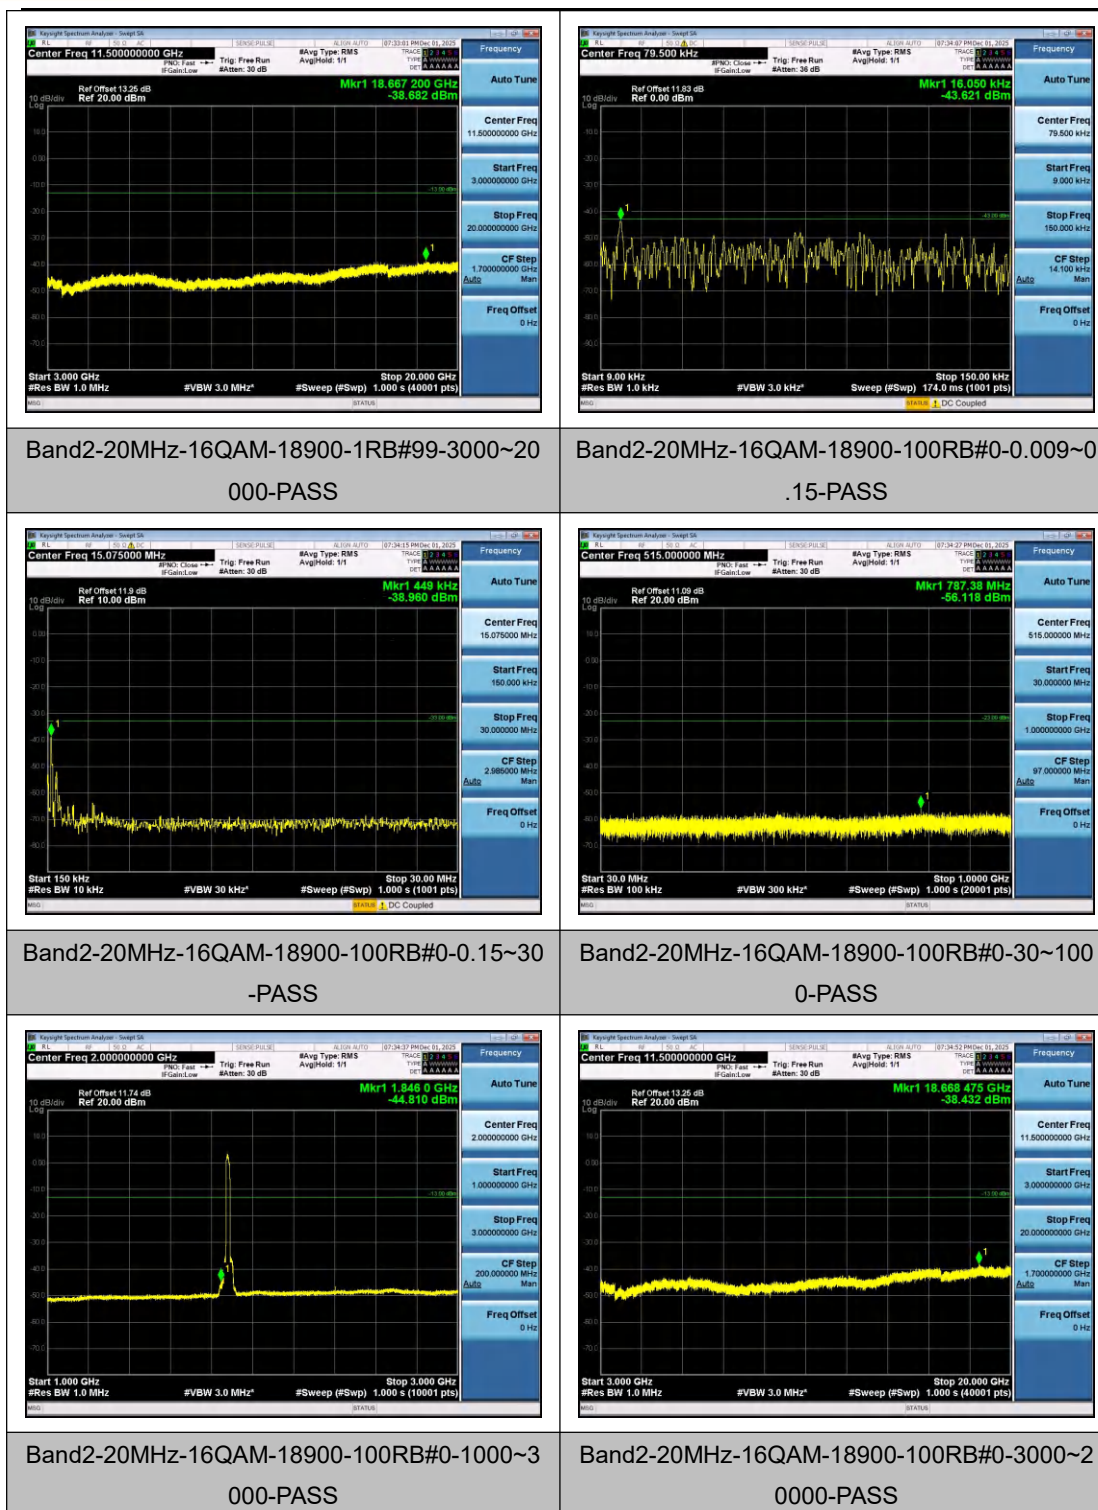


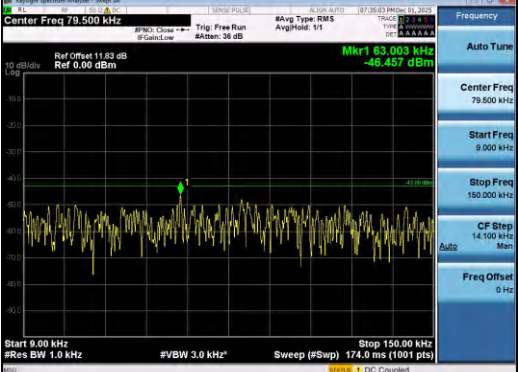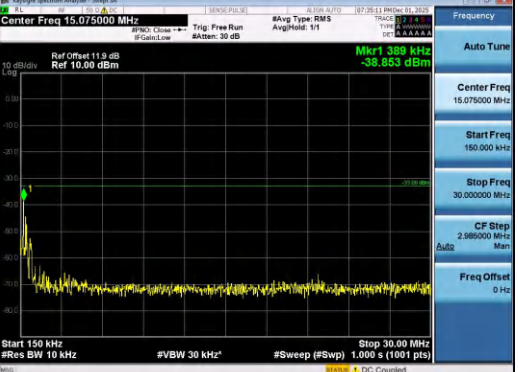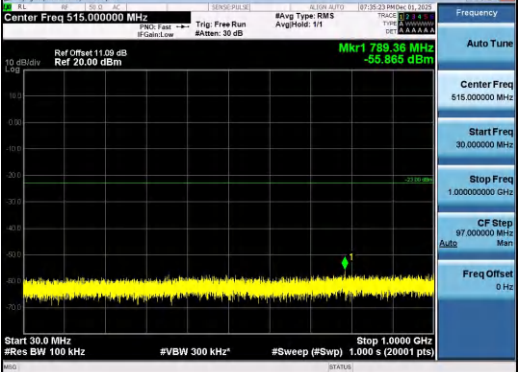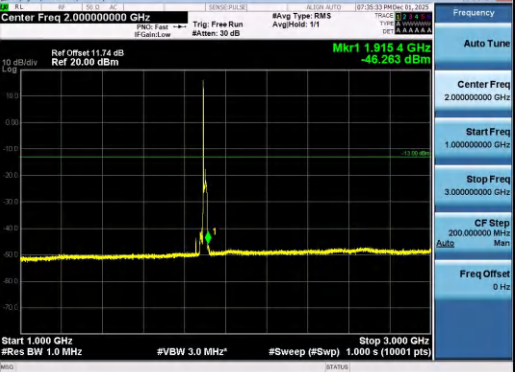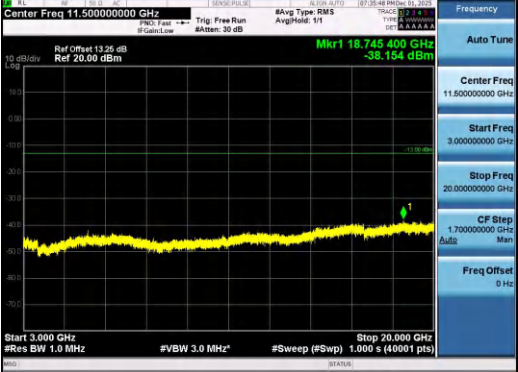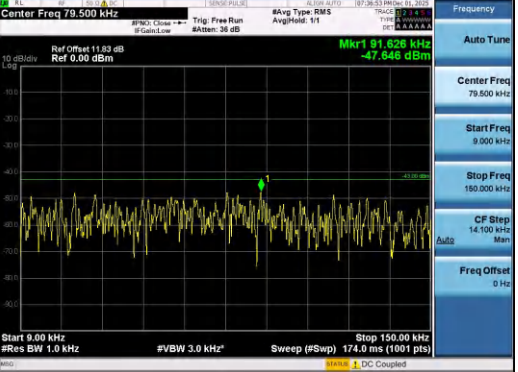	
Band2-20MHz-QPSK-19100-1RB#0-0.009~0.15- PASS	Band2-20MHz-QPSK-19100-1RB#0-0.15~30-PA SS
	
Band2-20MHz-QPSK-19100-1RB#0-30~1000-P ASS	Band2-20MHz-QPSK-19100-1RB#0-1000~3000- PASS
	
Band2-20MHz-QPSK-19100-1RB#0-3000~2000 0-PASS	Band2-20MHz-QPSK-19100-1RB#99-0.009~0.1 5-PASS

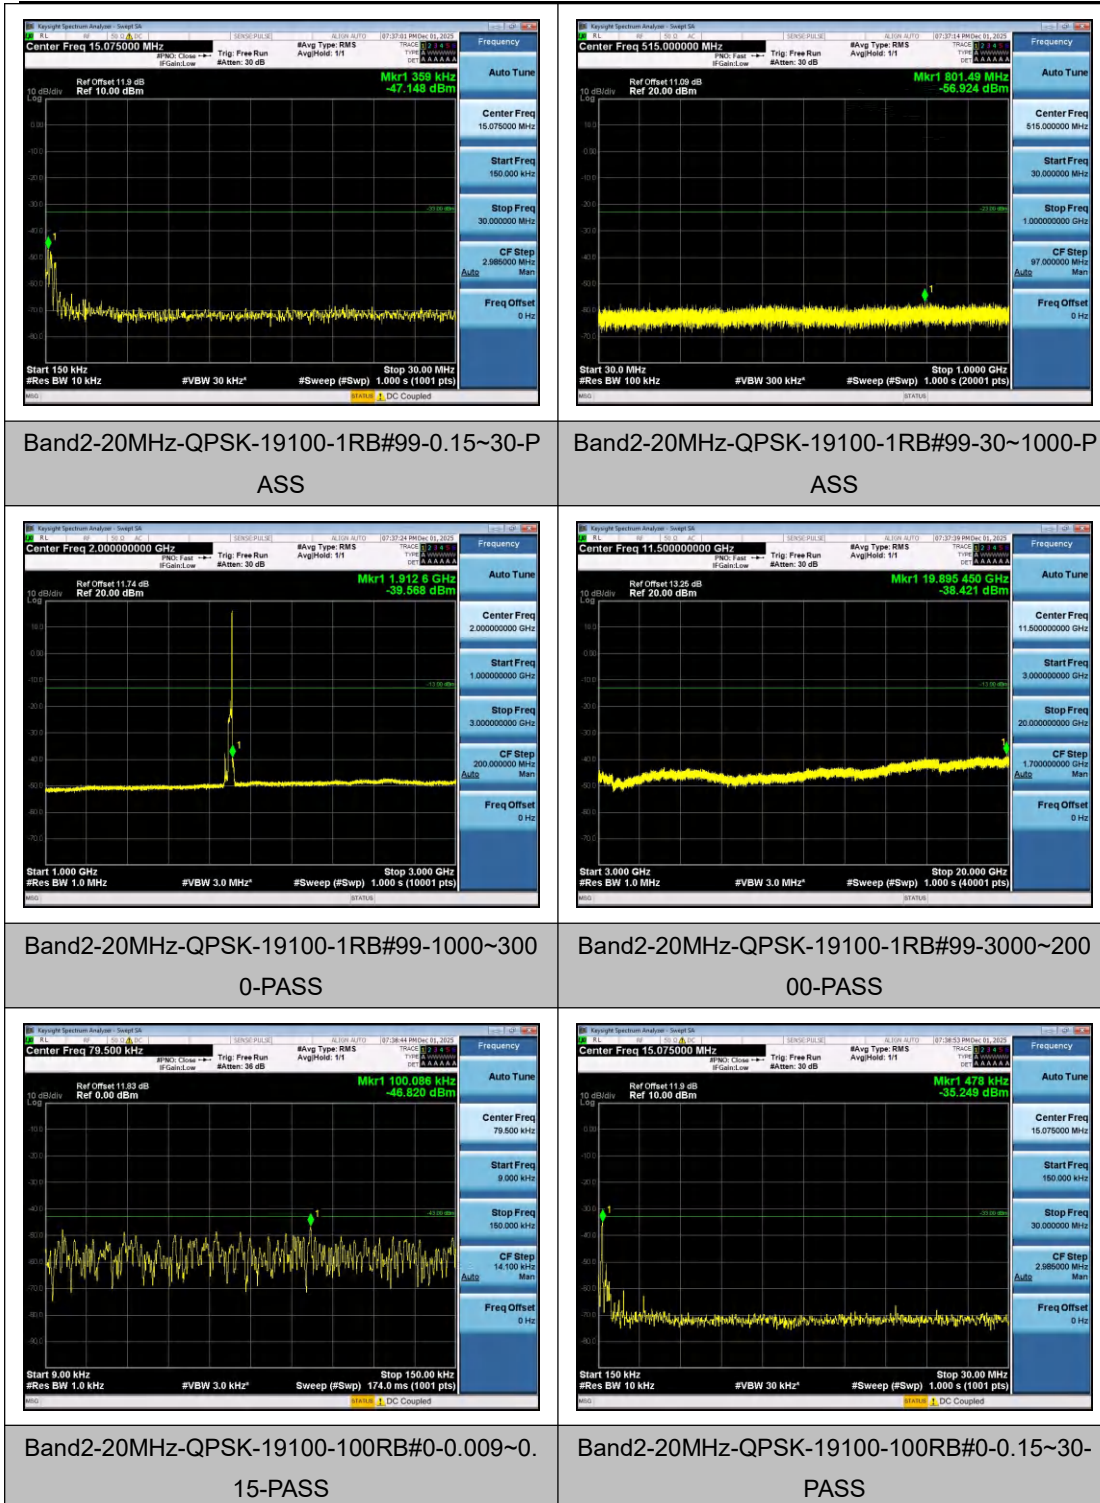

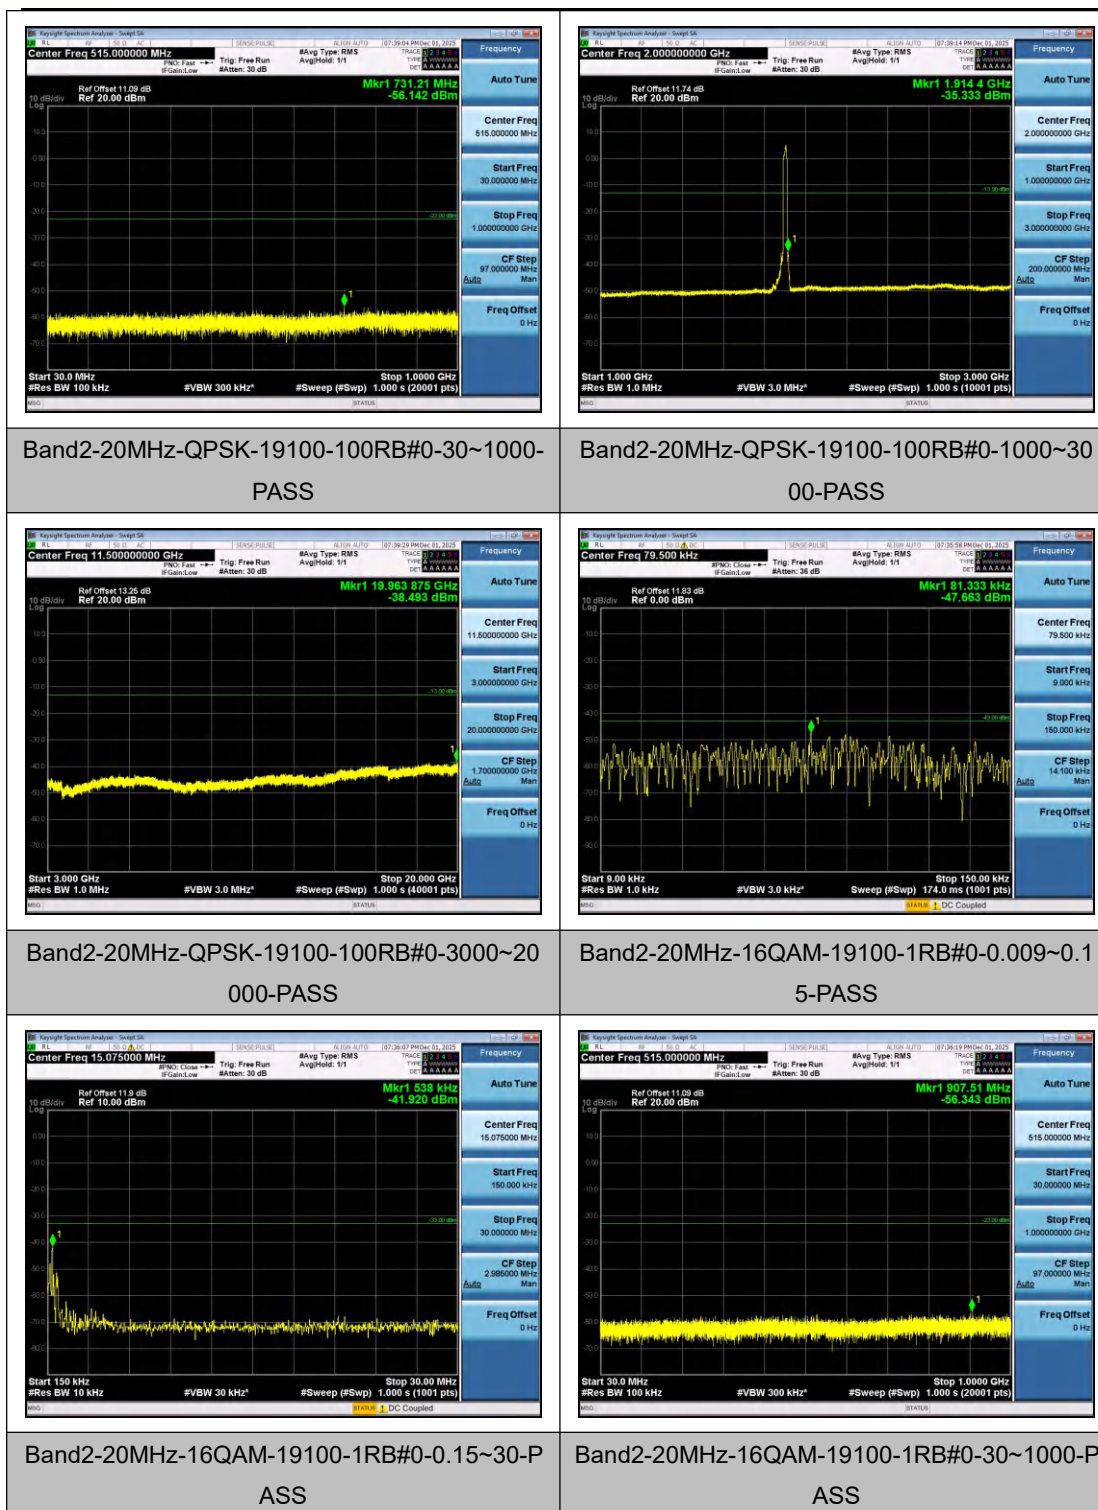

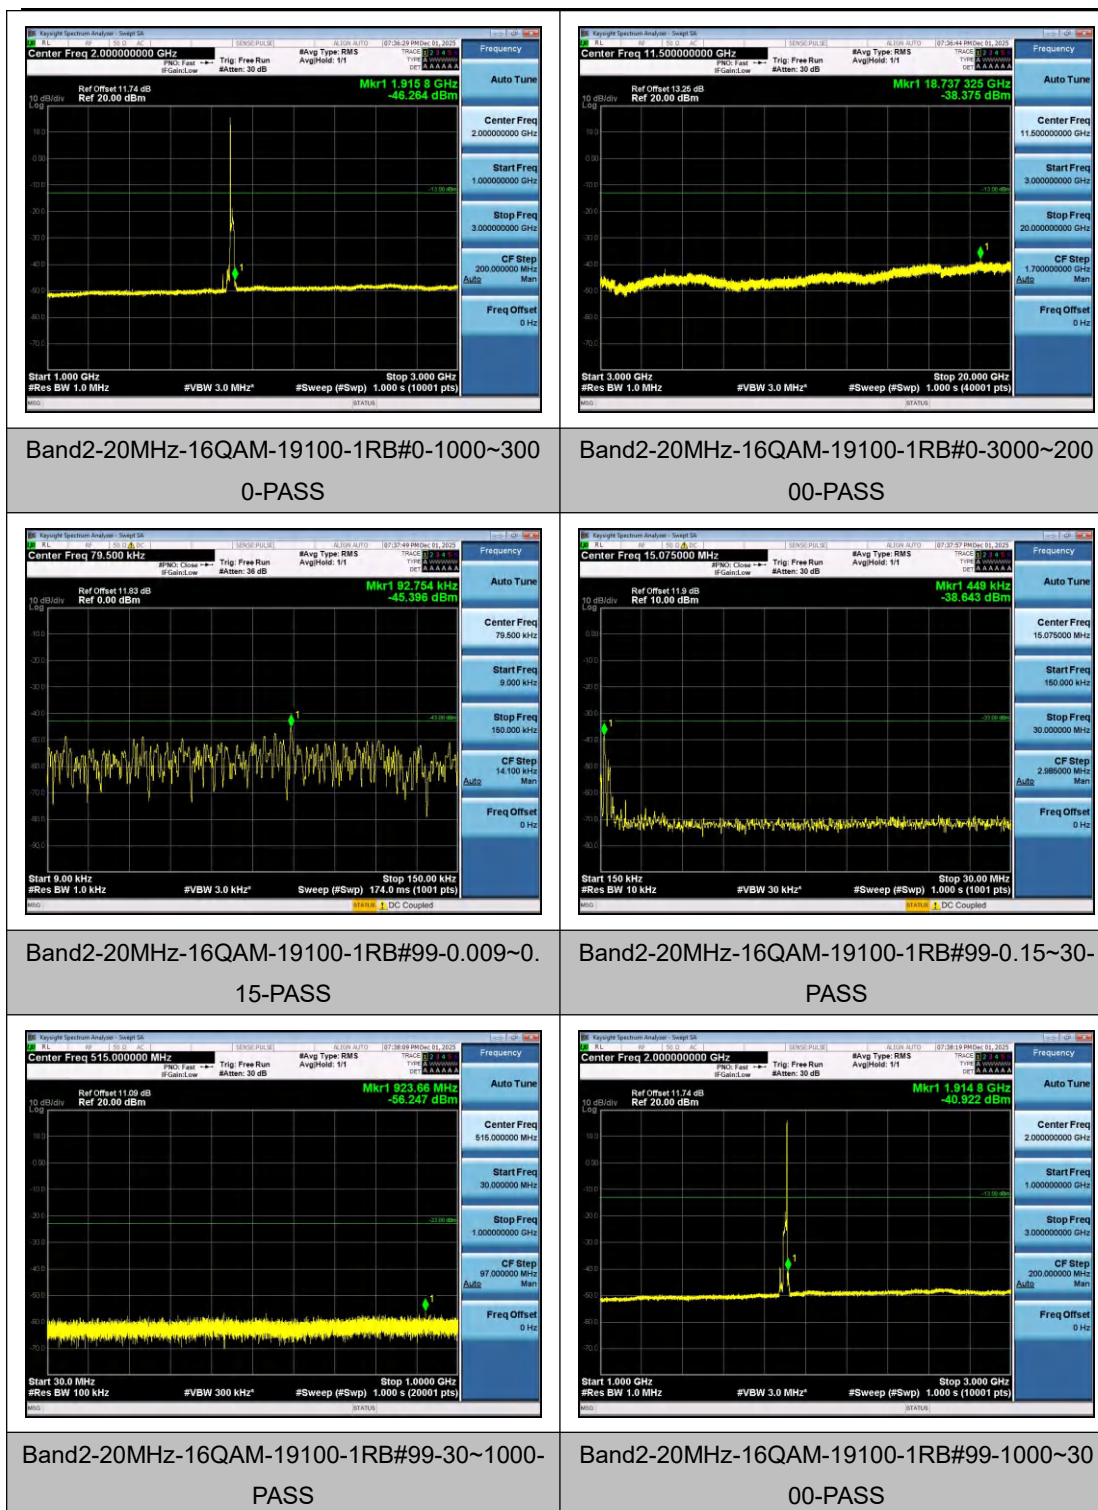

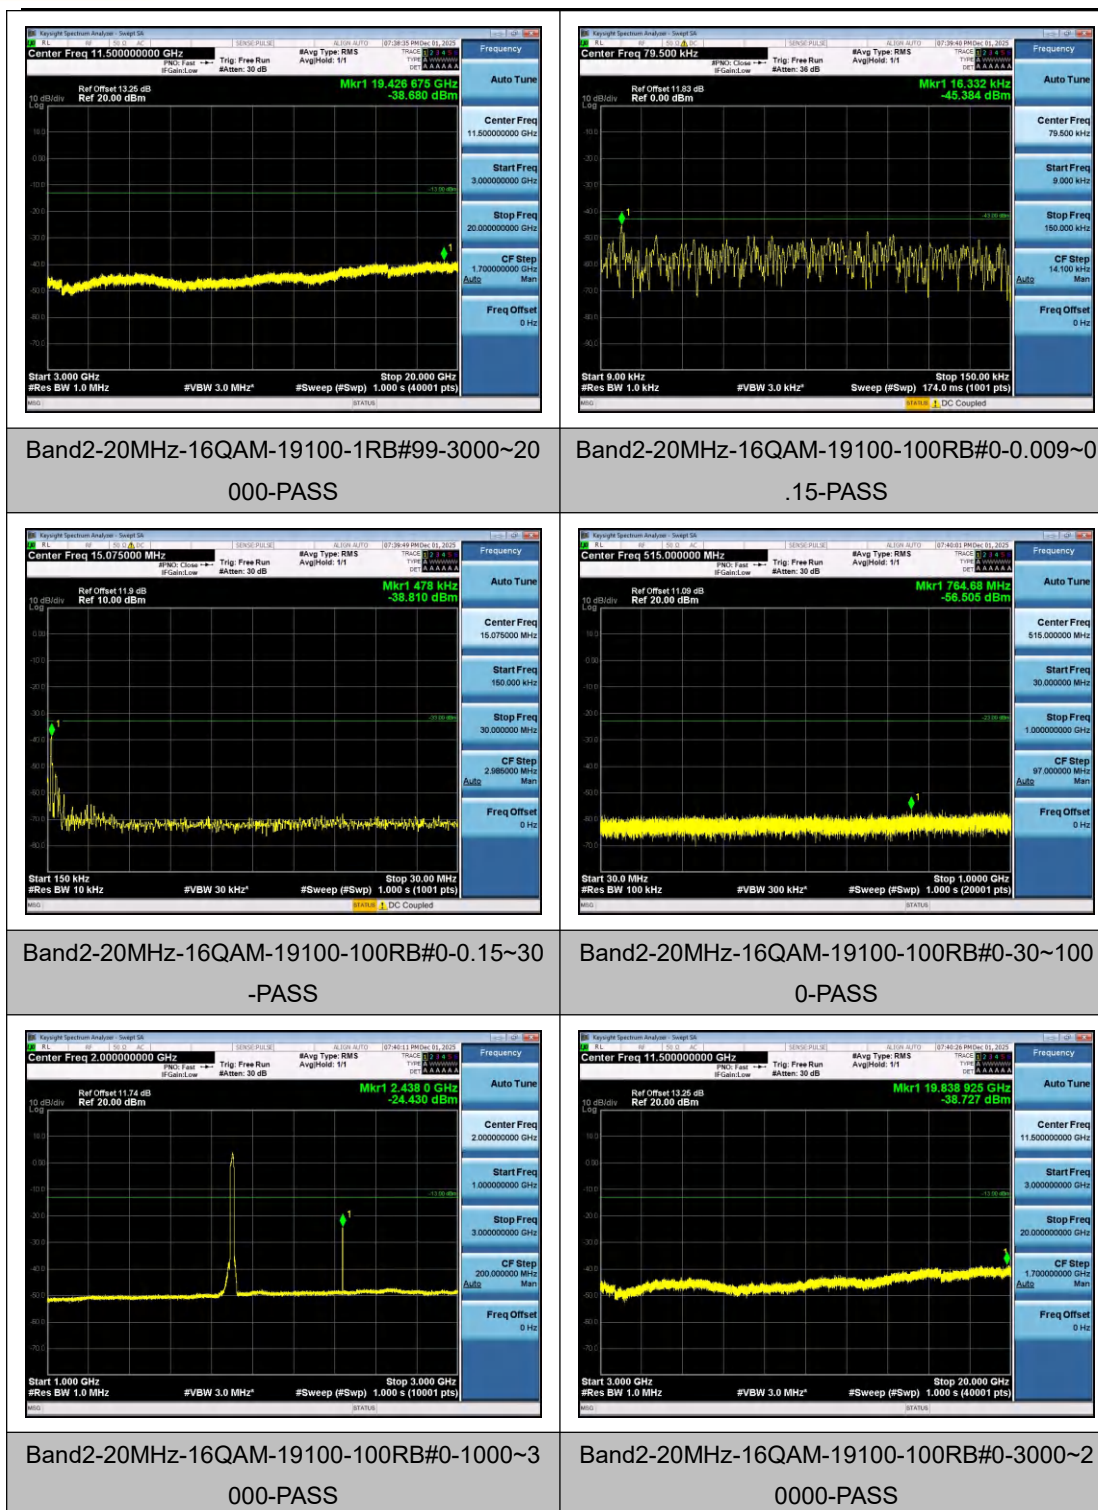

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.1587	1851.2366	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15987	1851.23797	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.1583	1851.2368	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15518	1851.23848	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.15506	1851.23676	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15575	1851.23875	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.4586	1880.5346	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45661	1880.53801	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.45736	1880.53866	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.4604	1880.5376	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.4578	1880.5379	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.4604	1880.5381	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75761	1909.83571	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75704	1909.83804	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.75653	1909.83713	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75878	1909.83568	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75875	1909.83595	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75	1909.83	1850-1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							81	63	10	
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.16 137	1852.83 657	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.16 372	1852.83 712	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 443	1852.83 823	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.16 345	1852.83 215	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.16 528	1852.83 538	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.16 17	1852.83 41	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.66 1	1881.34 06	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.66 424	1881.33 904	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.66 479	1881.33 419	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.66 468	1881.33 368	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.66 309	1881.33 499	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.66 497	1881.33 217	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.16 006	1909.83 586	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.16 101	1909.83 121	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.15 737	1909.83 317	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.15 806	1909.83 296	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15 949	1909.82 819	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.15 976	1909.82 936	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 311	1854.73 191	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.25 435	1854.73 345	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.26	1854.72	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							123	833	10	
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 483	1854.73 923	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26 329	1854.73 039	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.25 953	1854.73 043	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.76 104	1882.23 094	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.76 278	1882.23 448	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.76 074	1882.23 214	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76 202	1882.23 162	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 108	1882.23 258	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 438	1882.22 968	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.26 214	1909.72 734	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26 025	1909.72 705	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.26 188	1909.72 818	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.25 738	1909.72 578	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.26 201	1909.72 741	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.25 896	1909.72 906	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.51 813	1859.45 943	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.52 019	1859.46 059	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.51 742	1859.45 962	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.52 411	1859.46 161	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.52 061	1859.47 481	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.52	1859.46	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							402	702	10	
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.52 206	1884.45 086	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.52 193	1884.44 793	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.51 905	1884.44 725	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.52 182	1884.43 782	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.52 739	1884.45 149	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.52 184	1884.45 684	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.51 869	1909.40 619	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.52 805	1909.40 425	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.51 75	1909.39 8	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.51 09	1909.41 18	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.51 622	1909.40 442	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.53 101	1909.40 431	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.79 697	1864.20 397	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.79 55	1864.20 15	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.79 245	1864.20 445	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.78 729	1864.22 429	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.79 013	1864.22 713	1850-19 10	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.77 863	1864.22 563	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.28 422	1886.66 222	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.28 205	1886.66 705	1850-19 10	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.28	1886.66	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							678	078	10	
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.29 731	1886.65 831	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.30 668	1886.66 568	1850-19 10	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.29 968	1886.65 468	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.83 603	1909.13 203	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.84 6	1909.13 1	1850-19 10	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.85 814	1909.12 814	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.83 532	1909.15 032	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.84 724	1909.16 024	1850-19 10	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.83 037	1909.15 237	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VN	NT	1851.04 95	1868.97 45	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VL	NT	1851.07 776	1868.96 676	1850-19 10	PASS
Band2	20MHz	QPSK	18700	100RB# 0	VH	NT	1851.05 493	1868.99 593	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VN	NT	1851.07 84	1868.98 94	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VL	NT	1851.08 295	1868.97 795	1850-19 10	PASS
Band2	20MHz	16QAM	18700	100RB# 0	VH	NT	1851.08 675	1868.98 175	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VN	NT	1871.10 11	1888.86 91	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VL	NT	1871.08 049	1888.88 549	1850-19 10	PASS
Band2	20MHz	QPSK	18900	100RB# 0	VH	NT	1871.08 447	1888.86 947	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB# 0	VN	NT	1871.07 911	1888.85 611	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB# 0	VL	NT	1871.12 348	1888.92 948	1850-19 10	PASS
Band2	20MHz	16QAM	18900	100RB#	VH	NT	1871.06	1888.85	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

				0			472	372	10	
Band2	20MHz	QPSK	19100	100RB# 0	VN	NT	1891.14 741	1908.88 741	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB# 0	VL	NT	1891.11 058	1908.88 358	1850-19 10	PASS
Band2	20MHz	QPSK	19100	100RB# 0	VH	NT	1891.15 432	1908.88 632	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VN	NT	1891.15 718	1908.91 318	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VL	NT	1891.14 86	1908.88 76	1850-19 10	PASS
Band2	20MHz	16QAM	19100	100RB# 0	VH	NT	1891.14 866	1908.90 066	1850-19 10	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.15 715	1851.23 835	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.15 818	1851.23 748	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.15 92	1851.23 77	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.15 86	1851.23 81	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.15 879	1851.23 669	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.16 067	1851.23 767	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.15 973	1851.23 733	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.15 86	1851.23 82	1850-19 10	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.15 838	1851.23 748	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.15 517	1851.23 777	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.15 494	1851.23 774	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.15 843	1851.23 603	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.15	1851.23	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							613	853	10	
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.15 588	1851.23 768	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.15 498	1851.23 628	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.15 533	1851.23 763	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.15 446	1851.23 666	1850-19 10	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.15 737	1851.23 607	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.45 6	1880.53 78	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.45 773	1880.53 883	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.45 786	1880.53 716	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.45 848	1880.53 898	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.45 751	1880.53 731	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.45 753	1880.53 533	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.45 779	1880.53 719	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.45 742	1880.53 532	1850-19 10	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.45 755	1880.53 625	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.45 748	1880.53 838	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.45 753	1880.53 863	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.45 748	1880.53 738	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.46 011	1880.53 761	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.46 093	1880.53 813	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.45 671	1880.53 801	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.45	1880.53	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							863	753	10	
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.45 72	1880.53 79	1850-19 10	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.45 705	1880.53 815	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.75 674	1909.83 904	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.75 768	1909.83 668	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.75 579	1909.83 979	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.75 68	1909.83 83	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.75 674	1909.83 684	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.75 661	1909.83 931	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.75 555	1909.83 775	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.75 755	1909.83 865	1850-19 10	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.75 726	1909.83 716	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.75 828	1909.83 568	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.75 869	1909.83 709	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.75 838	1909.83 508	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.75 882	1909.83 602	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.76 011	1909.83 621	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.75 818	1909.83 698	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.75 894	1909.83 664	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.75 883	1909.83 553	1850-19 10	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.76 147	1909.83 567	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.16	1852.84	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							412	212	10	
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.16 196	1852.83 856	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.16 152	1852.83 982	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.16 435	1852.83 915	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.16 257	1852.83 747	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.16 394	1852.83 924	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.16 48	1852.83 36	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.16 385	1852.83 845	1850-19 10	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.16 519	1852.83 719	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.16 4	1852.83 29	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.16 492	1852.83 432	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.16 248	1852.83 568	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.16 509	1852.83 349	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.16 384	1852.83 164	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.16 232	1852.83 202	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.16 194	1852.83 244	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.16 249	1852.82 969	1850-19 10	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.16 64	1852.83 17	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.66 315	1881.33 835	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.66 237	1881.33 767	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.66 462	1881.34 032	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.66	1881.33	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							484	964	10	
Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.66 267	1881.34 007	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.66 154	1881.33 864	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.66 286	1881.33 916	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.66 538	1881.33 648	1850-19 10	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.66 426	1881.33 936	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.66 329	1881.33 299	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.66 501	1881.33 111	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.66 429	1881.33 669	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.66 316	1881.33 406	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.66 421	1881.33 441	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.66 396	1881.33 576	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.66 408	1881.33 488	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.66 26	1881.33 52	1850-19 10	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.66 431	1881.33 171	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.15 727	1909.83 167	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.15 901	1909.83 651	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.15 78	1909.83 35	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.15 912	1909.83 692	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.15 777	1909.83 077	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.15 706	1909.83 336	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.15	1909.83	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							917	657	10	
Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.15 81	1909.83 23	1850-19 10	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.15 61	1909.82 99	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.15 913	1909.82 823	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.16 003	1909.82 813	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.15 908	1909.83 068	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.16 026	1909.83 146	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.15 82	1909.83 37	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.15 962	1909.83 022	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.15 903	1909.83 163	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.16 022	1909.82 742	1850-19 10	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.15 958	1909.83 288	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.25 784	1854.73 704	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.25 903	1854.73 723	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.25 05	1854.73 82	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.26 17	1854.73 04	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.25 296	1854.73 486	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.25 488	1854.73 178	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.25 547	1854.73 207	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.26 678	1854.73 738	1850-19 10	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.25 74	1854.73 13	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.26	1854.73	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							29	95	10	
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.26 041	1854.74 171	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.26 43	1854.73 1	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.26 382	1854.74 062	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.26 386	1854.73 376	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.26 31	1854.72 97	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.26 092	1854.74 422	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.26 313	1854.73 313	1850-19 10	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.25 969	1854.72 899	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.75 838	1882.23 418	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.75 762	1882.23 302	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.76 294	1882.23 364	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.75 999	1882.23 329	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.75 889	1882.23 079	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.75 968	1882.23 528	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.76 379	1882.23 539	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.75 846	1882.23 326	1850-19 10	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.75 828	1882.22 998	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.76 127	1882.22 757	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.76 135	1882.23 495	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.76 099	1882.23 339	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.76	1882.23	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							449	209	10	
Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.76 459	1882.23 079	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.76 461	1882.23 161	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.76 34	1882.23 04	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.76 136	1882.22 616	1850-19 10	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.76 108	1882.23 048	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.26 369	1909.72 839	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.26 404	1909.72 084	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.26 353	1909.72 733	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.26 02	1909.72 37	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.26 437	1909.72 327	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.26 294	1909.72 134	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.26 466	1909.72 766	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.26 209	1909.72 379	1850-19 10	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.26 468	1909.72 848	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.25 915	1909.72 735	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.26 225	1909.72 915	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.25 955	1909.72 975	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.25 997	1909.72 747	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.26 277	1909.72 687	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.26 153	1909.72 483	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.25	1909.72	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							95	9	10	
Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.26 062	1909.73 042	1850-19 10	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.25 843	1909.72 723	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.51 736	1859.45 976	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.52 096	1859.46 116	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.51 749	1859.46 049	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.52 27	1859.46 48	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.52 146	1859.46 256	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.51 761	1859.46 851	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.51 812	1859.46 512	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.52 437	1859.46 037	1850-19 10	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.52 256	1859.46 296	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.52 05	1859.45 9	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.52 274	1859.46 684	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.52 581	1859.46 601	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.52 288	1859.46 858	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.52 566	1859.46 776	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.52 059	1859.46 719	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.52 371	1859.46 341	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.52 286	1859.46 846	1850-19 10	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.52 585	1859.46 485	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.51	1884.44	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							817	997	10	
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.51 589	1884.45 179	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.52 272	1884.44 692	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.51 681	1884.45 531	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.52 298	1884.44 588	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.51 665	1884.44 425	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.52 201	1884.44 711	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.52 459	1884.44 499	1850-19 10	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.52 005	1884.44 125	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.52 695	1884.43 805	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.52 386	1884.45 356	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.52 748	1884.44 968	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.51 926	1884.45 026	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.52 806	1884.45 266	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.52 11	1884.44 06	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.52 768	1884.44 518	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.52 885	1884.44 985	1850-19 10	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.52 703	1884.44 583	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.51 689	1909.39 959	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.52 059	1909.39 529	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.51 97	1909.40 06	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.51	1909.39	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							677	667	10	
Band2	10MHz	QPSK	19150	50RB#0	NV	10	1900.52 365	1909.39 765	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	1900.51 888	1909.39 938	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	1900.51 936	1909.40 146	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	1900.51 89	1909.39 78	1850-19 10	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	1900.51 593	1909.39 733	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	1900.51 873	1909.40 123	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	1900.52 29	1909.40 6	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	1900.51 14	1909.39 84	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	1900.52 335	1909.40 405	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	1900.52 498	1909.40 318	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	1900.52 995	1909.40 185	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	1900.50 844	1909.40 504	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	1900.52 376	1909.40 556	1850-19 10	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	1900.52 273	1909.40 423	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	1850.79 48	1864.21 08	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	1850.79 199	1864.20 299	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	1850.79 067	1864.20 367	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	1850.78 542	1864.20 442	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	1850.79 589	1864.19 789	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	1850.79 533	1864.20 333	1850-19 10	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	1850.79	1864.21	1850-19	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com