

Appendix Test Data

Report No:	1812C50616812505-02	Test Sample NO:	1-2-2
Start Test Date:	2025-11-21	Finish Test Date:	2025-12-8
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24°C	Relative Humidity:	44%
Pressure:	101 kPa		



Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Power(dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	13.24	PASS
Band4	1.4MHz	QPSK	19957	1RB#2	13.24	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	13.11	PASS
Band4	1.4MHz	QPSK	19957	3RB#0	13.23	PASS
Band4	1.4MHz	QPSK	19957	3RB#1	13.20	PASS
Band4	1.4MHz	QPSK	19957	3RB#3	13.15	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	12.12	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	11.99	PASS
Band4	1.4MHz	16QAM	19957	1RB#2	12.17	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	11.87	PASS
Band4	1.4MHz	16QAM	19957	3RB#0	12.00	PASS
Band4	1.4MHz	16QAM	19957	3RB#1	12.20	PASS
Band4	1.4MHz	16QAM	19957	3RB#3	11.92	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	11.16	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	13.51	PASS
Band4	1.4MHz	QPSK	20175	1RB#2	13.46	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	13.42	PASS
Band4	1.4MHz	QPSK	20175	3RB#0	13.66	PASS
Band4	1.4MHz	QPSK	20175	3RB#1	13.55	PASS
Band4	1.4MHz	QPSK	20175	3RB#3	13.55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	12.65	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	12.39	PASS
Band4	1.4MHz	16QAM	20175	1RB#2	12.55	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	12.27	PASS
Band4	1.4MHz	16QAM	20175	3RB#0	12.36	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	1.4MHz	16QAM	20175	3RB#1	12.51	PASS
Band4	1.4MHz	16QAM	20175	3RB#3	12.32	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	11.60	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	14.45	PASS
Band4	1.4MHz	QPSK	20393	1RB#2	14.55	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	14.42	PASS
Band4	1.4MHz	QPSK	20393	3RB#0	14.53	PASS
Band4	1.4MHz	QPSK	20393	3RB#1	14.52	PASS
Band4	1.4MHz	QPSK	20393	3RB#3	14.52	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	13.54	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	13.20	PASS
Band4	1.4MHz	16QAM	20393	1RB#2	13.66	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	13.27	PASS
Band4	1.4MHz	16QAM	20393	3RB#0	13.39	PASS
Band4	1.4MHz	16QAM	20393	3RB#1	13.52	PASS
Band4	1.4MHz	16QAM	20393	3RB#3	13.35	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	12.46	PASS
Band4	3MHz	QPSK	19965	1RB#0	24.40	PASS
Band4	3MHz	QPSK	19965	1RB#8	13.01	PASS
Band4	3MHz	QPSK	19965	1RB#14	12.96	PASS
Band4	3MHz	QPSK	19965	8RB#0	12.20	PASS
Band4	3MHz	QPSK	19965	8RB#4	12.33	PASS
Band4	3MHz	QPSK	19965	8RB#7	12.20	PASS
Band4	3MHz	QPSK	19965	15RB#0	12.30	PASS
Band4	3MHz	16QAM	19965	1RB#0	12.07	PASS
Band4	3MHz	16QAM	19965	1RB#8	12.04	PASS
Band4	3MHz	16QAM	19965	1RB#14	12.07	PASS
Band4	3MHz	16QAM	19965	8RB#0	11.27	PASS
Band4	3MHz	16QAM	19965	8RB#4	11.30	PASS
Band4	3MHz	16QAM	19965	8RB#7	11.35	PASS
Band4	3MHz	16QAM	19965	15RB#0	11.36	PASS
Band4	3MHz	QPSK	20175	1RB#0	13.36	PASS
Band4	3MHz	QPSK	20175	1RB#8	13.59	PASS
Band4	3MHz	QPSK	20175	1RB#14	13.56	PASS
Band4	3MHz	QPSK	20175	8RB#0	12.57	PASS
Band4	3MHz	QPSK	20175	8RB#4	12.69	PASS
Band4	3MHz	QPSK	20175	8RB#7	12.69	PASS
Band4	3MHz	QPSK	20175	15RB#0	12.65	PASS
Band4	3MHz	16QAM	20175	1RB#0	12.33	PASS
Band4	3MHz	16QAM	20175	1RB#8	12.56	PASS
Band4	3MHz	16QAM	20175	1RB#14	12.64	PASS
Band4	3MHz	16QAM	20175	8RB#0	11.61	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	3MHz	16QAM	20175	8RB#4	11.69	PASS
Band4	3MHz	16QAM	20175	8RB#7	11.78	PASS
Band4	3MHz	16QAM	20175	15RB#0	11.73	PASS
Band4	3MHz	QPSK	20385	1RB#0	14.31	PASS
Band4	3MHz	QPSK	20385	1RB#8	14.43	PASS
Band4	3MHz	QPSK	20385	1RB#14	14.39	PASS
Band4	3MHz	QPSK	20385	8RB#0	13.40	PASS
Band4	3MHz	QPSK	20385	8RB#4	13.50	PASS
Band4	3MHz	QPSK	20385	8RB#7	13.45	PASS
Band4	3MHz	QPSK	20385	15RB#0	13.54	PASS
Band4	3MHz	16QAM	20385	1RB#0	13.12	PASS
Band4	3MHz	16QAM	20385	1RB#8	13.44	PASS
Band4	3MHz	16QAM	20385	1RB#14	13.17	PASS
Band4	3MHz	16QAM	20385	8RB#0	12.40	PASS
Band4	3MHz	16QAM	20385	8RB#4	12.57	PASS
Band4	3MHz	16QAM	20385	8RB#7	12.47	PASS
Band4	3MHz	16QAM	20385	15RB#0	12.43	PASS
Band4	5MHz	QPSK	19975	1RB#0	13.37	PASS
Band4	5MHz	QPSK	19975	1RB#12	13.36	PASS
Band4	5MHz	QPSK	19975	1RB#24	13.36	PASS
Band4	5MHz	QPSK	19975	12RB#0	12.40	PASS
Band4	5MHz	QPSK	19975	12RB#6	12.37	PASS
Band4	5MHz	QPSK	19975	12RB#13	12.37	PASS
Band4	5MHz	QPSK	19975	25RB#0	12.37	PASS
Band4	5MHz	16QAM	19975	1RB#0	12.25	PASS
Band4	5MHz	16QAM	19975	1RB#12	12.28	PASS
Band4	5MHz	16QAM	19975	1RB#24	12.34	PASS
Band4	5MHz	16QAM	19975	12RB#0	11.38	PASS
Band4	5MHz	16QAM	19975	12RB#6	11.44	PASS
Band4	5MHz	16QAM	19975	12RB#13	11.31	PASS
Band4	5MHz	16QAM	19975	25RB#0	11.45	PASS
Band4	5MHz	QPSK	20175	1RB#0	13.98	PASS
Band4	5MHz	QPSK	20175	1RB#12	13.63	PASS
Band4	5MHz	QPSK	20175	1RB#24	13.79	PASS
Band4	5MHz	QPSK	20175	12RB#0	12.87	PASS
Band4	5MHz	QPSK	20175	12RB#6	12.72	PASS
Band4	5MHz	QPSK	20175	12RB#13	12.56	PASS
Band4	5MHz	QPSK	20175	25RB#0	12.71	PASS
Band4	5MHz	16QAM	20175	1RB#0	12.93	PASS
Band4	5MHz	16QAM	20175	1RB#12	12.54	PASS
Band4	5MHz	16QAM	20175	1RB#24	12.79	PASS
Band4	5MHz	16QAM	20175	12RB#0	11.89	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	5MHz	16QAM	20175	12RB#6	11.71	PASS
Band4	5MHz	16QAM	20175	12RB#13	11.47	PASS
Band4	5MHz	16QAM	20175	25RB#0	11.76	PASS
Band4	5MHz	QPSK	20375	1RB#0	14.56	PASS
Band4	5MHz	QPSK	20375	1RB#12	14.65	PASS
Band4	5MHz	QPSK	20375	1RB#24	14.58	PASS
Band4	5MHz	QPSK	20375	12RB#0	13.56	PASS
Band4	5MHz	QPSK	20375	12RB#6	13.66	PASS
Band4	5MHz	QPSK	20375	12RB#13	13.74	PASS
Band4	5MHz	QPSK	20375	25RB#0	13.67	PASS
Band4	5MHz	16QAM	20375	1RB#0	13.69	PASS
Band4	5MHz	16QAM	20375	1RB#12	13.76	PASS
Band4	5MHz	16QAM	20375	1RB#24	13.72	PASS
Band4	5MHz	16QAM	20375	12RB#0	12.57	PASS
Band4	5MHz	16QAM	20375	12RB#6	12.72	PASS
Band4	5MHz	16QAM	20375	12RB#13	12.76	PASS
Band4	5MHz	16QAM	20375	25RB#0	12.67	PASS
Band4	10MHz	QPSK	20000	1RB#0	13.34	PASS
Band4	10MHz	QPSK	20000	1RB#24	13.44	PASS
Band4	10MHz	QPSK	20000	1RB#49	13.74	PASS
Band4	10MHz	QPSK	20000	25RB#0	12.36	PASS
Band4	10MHz	QPSK	20000	25RB#12	12.42	PASS
Band4	10MHz	QPSK	20000	25RB#25	12.59	PASS
Band4	10MHz	QPSK	20000	50RB#0	12.56	PASS
Band4	10MHz	16QAM	20000	1RB#0	12.40	PASS
Band4	10MHz	16QAM	20000	1RB#24	12.40	PASS
Band4	10MHz	16QAM	20000	1RB#49	12.80	PASS
Band4	10MHz	16QAM	20000	25RB#0	11.40	PASS
Band4	10MHz	16QAM	20000	25RB#12	11.48	PASS
Band4	10MHz	16QAM	20000	25RB#25	11.73	PASS
Band4	10MHz	16QAM	20000	50RB#0	11.56	PASS
Band4	10MHz	QPSK	20175	1RB#0	13.84	PASS
Band4	10MHz	QPSK	20175	1RB#24	13.71	PASS
Band4	10MHz	QPSK	20175	1RB#49	14.06	PASS
Band4	10MHz	QPSK	20175	25RB#0	12.75	PASS
Band4	10MHz	QPSK	20175	25RB#12	12.76	PASS
Band4	10MHz	QPSK	20175	25RB#25	12.66	PASS
Band4	10MHz	QPSK	20175	50RB#0	12.77	PASS
Band4	10MHz	16QAM	20175	1RB#0	12.84	PASS
Band4	10MHz	16QAM	20175	1RB#24	12.59	PASS
Band4	10MHz	16QAM	20175	1RB#49	13.12	PASS
Band4	10MHz	16QAM	20175	25RB#0	11.78	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	10MHz	16QAM	20175	25RB#12	11.78	PASS
Band4	10MHz	16QAM	20175	25RB#25	11.66	PASS
Band4	10MHz	16QAM	20175	50RB#0	11.78	PASS
Band4	10MHz	QPSK	20350	1RB#0	14.42	PASS
Band4	10MHz	QPSK	20350	1RB#24	14.90	PASS
Band4	10MHz	QPSK	20350	1RB#49	14.56	PASS
Band4	10MHz	QPSK	20350	25RB#0	13.46	PASS
Band4	10MHz	QPSK	20350	25RB#12	13.77	PASS
Band4	10MHz	QPSK	20350	25RB#25	13.89	PASS
Band4	10MHz	QPSK	20350	50RB#0	13.71	PASS
Band4	10MHz	16QAM	20350	1RB#0	13.28	PASS
Band4	10MHz	16QAM	20350	1RB#24	13.95	PASS
Band4	10MHz	16QAM	20350	1RB#49	13.36	PASS
Band4	10MHz	16QAM	20350	25RB#0	12.46	PASS
Band4	10MHz	16QAM	20350	25RB#12	12.87	PASS
Band4	10MHz	16QAM	20350	25RB#25	12.99	PASS
Band4	10MHz	16QAM	20350	50RB#0	12.78	PASS
Band4	15MHz	QPSK	20025	1RB#0	13.13	PASS
Band4	15MHz	QPSK	20025	1RB#38	13.53	PASS
Band4	15MHz	QPSK	20025	1RB#74	13.75	PASS
Band4	15MHz	QPSK	20025	38RB#0	12.58	PASS
Band4	15MHz	QPSK	20025	38RB#18	12.45	PASS
Band4	15MHz	QPSK	20025	38RB#37	12.55	PASS
Band4	15MHz	QPSK	20025	75RB#0	12.58	PASS
Band4	15MHz	16QAM	20025	1RB#0	12.18	PASS
Band4	15MHz	16QAM	20025	1RB#38	12.53	PASS
Band4	15MHz	16QAM	20025	1RB#74	12.85	PASS
Band4	15MHz	16QAM	20025	38RB#0	12.53	PASS
Band4	15MHz	16QAM	20025	38RB#18	11.47	PASS
Band4	15MHz	16QAM	20025	38RB#37	12.55	PASS
Band4	15MHz	16QAM	20025	75RB#0	11.51	PASS
Band4	15MHz	QPSK	20175	1RB#0	13.80	PASS
Band4	15MHz	QPSK	20175	1RB#38	13.79	PASS
Band4	15MHz	QPSK	20175	1RB#74	14.07	PASS
Band4	15MHz	QPSK	20175	38RB#0	12.85	PASS
Band4	15MHz	QPSK	20175	38RB#18	12.81	PASS
Band4	15MHz	QPSK	20175	38RB#37	12.81	PASS
Band4	15MHz	QPSK	20175	75RB#0	12.82	PASS
Band4	15MHz	16QAM	20175	1RB#0	12.84	PASS
Band4	15MHz	16QAM	20175	1RB#38	12.68	PASS
Band4	15MHz	16QAM	20175	1RB#74	13.14	PASS
Band4	15MHz	16QAM	20175	38RB#0	12.85	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	15MHz	16QAM	20175	38RB#18	11.80	PASS
Band4	15MHz	16QAM	20175	38RB#37	12.81	PASS
Band4	15MHz	16QAM	20175	75RB#0	11.77	PASS
Band4	15MHz	QPSK	20325	1RB#0	14.03	PASS
Band4	15MHz	QPSK	20325	1RB#38	14.68	PASS
Band4	15MHz	QPSK	20325	1RB#74	14.43	PASS
Band4	15MHz	QPSK	20325	38RB#0	13.60	PASS
Band4	15MHz	QPSK	20325	38RB#18	13.51	PASS
Band4	15MHz	QPSK	20325	38RB#37	13.60	PASS
Band4	15MHz	QPSK	20325	75RB#0	13.62	PASS
Band4	15MHz	16QAM	20325	1RB#0	13.16	PASS
Band4	15MHz	16QAM	20325	1RB#38	13.75	PASS
Band4	15MHz	16QAM	20325	1RB#74	13.57	PASS
Band4	15MHz	16QAM	20325	38RB#0	13.63	PASS
Band4	15MHz	16QAM	20325	38RB#18	12.63	PASS
Band4	15MHz	16QAM	20325	38RB#37	13.63	PASS
Band4	15MHz	16QAM	20325	75RB#0	12.66	PASS
Band4	20MHz	QPSK	20050	1RB#0	13.24	PASS
Band4	20MHz	QPSK	20050	1RB#49	13.75	PASS
Band4	20MHz	QPSK	20050	1RB#99	13.95	PASS
Band4	20MHz	QPSK	20050	50RB#0	12.29	PASS
Band4	20MHz	QPSK	20050	50RB#25	12.60	PASS
Band4	20MHz	QPSK	20050	50RB#50	12.97	PASS
Band4	20MHz	QPSK	20050	100RB#0	12.75	PASS
Band4	20MHz	16QAM	20050	1RB#0	12.18	PASS
Band4	20MHz	16QAM	20050	1RB#49	12.71	PASS
Band4	20MHz	16QAM	20050	1RB#99	12.84	PASS
Band4	20MHz	16QAM	20050	50RB#0	11.29	PASS
Band4	20MHz	16QAM	20050	50RB#25	11.61	PASS
Band4	20MHz	16QAM	20050	50RB#50	12.00	PASS
Band4	20MHz	16QAM	20050	100RB#0	11.79	PASS
Band4	20MHz	QPSK	20175	1RB#0	13.21	PASS
Band4	20MHz	QPSK	20175	1RB#49	13.83	PASS
Band4	20MHz	QPSK	20175	1RB#99	14.00	PASS
Band4	20MHz	QPSK	20175	50RB#0	12.88	PASS
Band4	20MHz	QPSK	20175	50RB#25	12.99	PASS
Band4	20MHz	QPSK	20175	50RB#50	12.64	PASS
Band4	20MHz	QPSK	20175	100RB#0	12.79	PASS
Band4	20MHz	16QAM	20175	1RB#0	12.36	PASS
Band4	20MHz	16QAM	20175	1RB#49	12.85	PASS
Band4	20MHz	16QAM	20175	1RB#99	13.15	PASS
Band4	20MHz	16QAM	20175	50RB#0	11.94	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	20MHz	16QAM	20175	50RB#25	12.05	PASS
Band4	20MHz	16QAM	20175	50RB#50	11.68	PASS
Band4	20MHz	16QAM	20175	100RB#0	11.75	PASS
Band4	20MHz	QPSK	20300	1RB#0	13.76	PASS
Band4	20MHz	QPSK	20300	1RB#49	14.55	PASS
Band4	20MHz	QPSK	20300	1RB#99	14.62	PASS
Band4	20MHz	QPSK	20300	50RB#0	13.25	PASS
Band4	20MHz	QPSK	20300	50RB#25	13.48	PASS
Band4	20MHz	QPSK	20300	50RB#50	13.93	PASS
Band4	20MHz	QPSK	20300	100RB#0	13.62	PASS
Band4	20MHz	16QAM	20300	1RB#0	12.60	PASS
Band4	20MHz	16QAM	20300	1RB#49	13.42	PASS
Band4	20MHz	16QAM	20300	1RB#99	13.44	PASS
Band4	20MHz	16QAM	20300	50RB#0	12.29	PASS
Band4	20MHz	16QAM	20300	50RB#25	12.50	PASS
Band4	20MHz	16QAM	20300	50RB#50	12.96	PASS
Band4	20MHz	16QAM	20300	100RB#0	12.57	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	4.87	13	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	5.58	13	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	5.94	13	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	6.39	13	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	4.95	13	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	5.58	13	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	6.00	13	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	6.39	13	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	5.28	13	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	5.77	13	PASS
Band4	1.4MHz	16QAM	20393	1RB#0	6.06	13	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	6.58	13	PASS
Band4	3MHz	QPSK	19965	1RB#0	5.38	13	PASS
Band4	3MHz	QPSK	19965	15RB#0	5.75	13	PASS
Band4	3MHz	16QAM	19965	1RB#0	6.24	13	PASS
Band4	3MHz	16QAM	19965	15RB#0	6.60	13	PASS
Band4	3MHz	QPSK	20175	1RB#0	4.48	13	PASS
Band4	3MHz	QPSK	20175	15RB#0	5.39	13	PASS
Band4	3MHz	16QAM	20175	1RB#0	5.38	13	PASS
Band4	3MHz	16QAM	20175	15RB#0	6.17	13	PASS
Band4	3MHz	QPSK	20385	1RB#0	5.65	13	PASS
Band4	3MHz	QPSK	20385	15RB#0	5.63	13	PASS
Band4	3MHz	16QAM	20385	1RB#0	6.83	13	PASS
Band4	3MHz	16QAM	20385	15RB#0	6.52	13	PASS
Band4	5MHz	QPSK	19975	1RB#0	5.31	13	PASS
Band4	5MHz	QPSK	19975	25RB#0	5.90	13	PASS
Band4	5MHz	16QAM	19975	1RB#0	5.93	13	PASS
Band4	5MHz	16QAM	19975	25RB#0	6.60	13	PASS
Band4	5MHz	QPSK	20175	1RB#0	4.36	13	PASS
Band4	5MHz	QPSK	20175	25RB#0	5.49	13	PASS
Band4	5MHz	16QAM	20175	1RB#0	5.16	13	PASS
Band4	5MHz	16QAM	20175	25RB#0	6.20	13	PASS
Band4	5MHz	QPSK	20375	1RB#0	5.60	13	PASS
Band4	5MHz	QPSK	20375	25RB#0	5.90	13	PASS
Band4	5MHz	16QAM	20375	1RB#0	6.18	13	PASS
Band4	5MHz	16QAM	20375	25RB#0	6.59	13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	10MHz	QPSK	20000	1RB#0	5.18	13	PASS
Band4	10MHz	QPSK	20000	50RB#0	5.92	13	PASS
Band4	10MHz	16QAM	20000	1RB#0	6.07	13	PASS
Band4	10MHz	16QAM	20000	50RB#0	6.67	13	PASS
Band4	10MHz	QPSK	20175	1RB#0	4.44	13	PASS
Band4	10MHz	QPSK	20175	50RB#0	5.43	13	PASS
Band4	10MHz	16QAM	20175	1RB#0	5.34	13	PASS
Band4	10MHz	16QAM	20175	50RB#0	6.20	13	PASS
Band4	10MHz	QPSK	20350	1RB#0	5.48	13	PASS
Band4	10MHz	QPSK	20350	50RB#0	5.79	13	PASS
Band4	10MHz	16QAM	20350	1RB#0	6.20	13	PASS
Band4	10MHz	16QAM	20350	50RB#0	6.60	13	PASS
Band4	15MHz	QPSK	20025	1RB#0	5.26	13	PASS
Band4	15MHz	QPSK	20025	75RB#0	6.33	13	PASS
Band4	15MHz	16QAM	20025	1RB#0	6.13	13	PASS
Band4	15MHz	16QAM	20025	75RB#0	6.79	13	PASS
Band4	15MHz	QPSK	20175	1RB#0	4.80	13	PASS
Band4	15MHz	QPSK	20175	75RB#0	5.71	13	PASS
Band4	15MHz	16QAM	20175	1RB#0	5.70	13	PASS
Band4	15MHz	16QAM	20175	75RB#0	6.28	13	PASS
Band4	15MHz	QPSK	20325	1RB#0	4.88	13	PASS
Band4	15MHz	QPSK	20325	75RB#0	6.26	13	PASS
Band4	15MHz	16QAM	20325	1RB#0	6.00	13	PASS
Band4	15MHz	16QAM	20325	75RB#0	6.71	13	PASS
Band4	20MHz	QPSK	20050	1RB#0	5.19	13	PASS
Band4	20MHz	QPSK	20050	100RB#0	5.74	13	PASS
Band4	20MHz	16QAM	20050	1RB#0	5.85	13	PASS
Band4	20MHz	16QAM	20050	100RB#0	6.55	13	PASS
Band4	20MHz	QPSK	20175	1RB#0	5.38	13	PASS
Band4	20MHz	QPSK	20175	100RB#0	5.46	13	PASS
Band4	20MHz	16QAM	20175	1RB#0	6.28	13	PASS
Band4	20MHz	16QAM	20175	100RB#0	6.24	13	PASS
Band4	20MHz	QPSK	20300	1RB#0	4.53	13	PASS
Band4	20MHz	QPSK	20300	100RB#0	5.92	13	PASS
Band4	20MHz	16QAM	20300	1RB#0	5.58	13	PASS
Band4	20MHz	16QAM	20300	100RB#0	6.67	13	PASS

Test Graphs

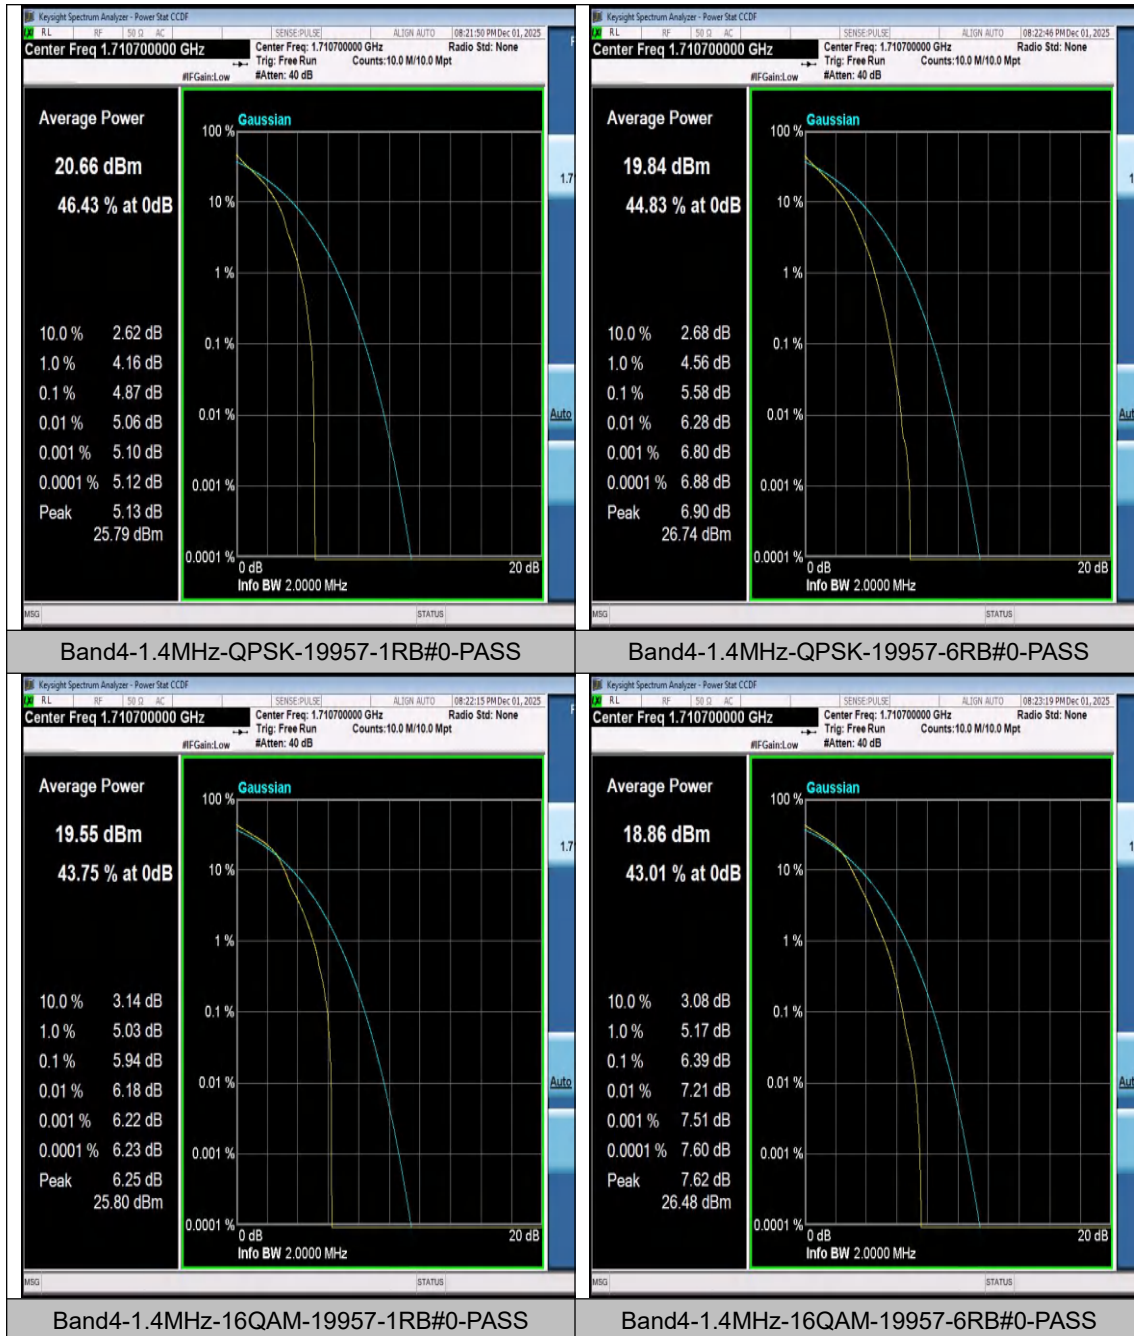


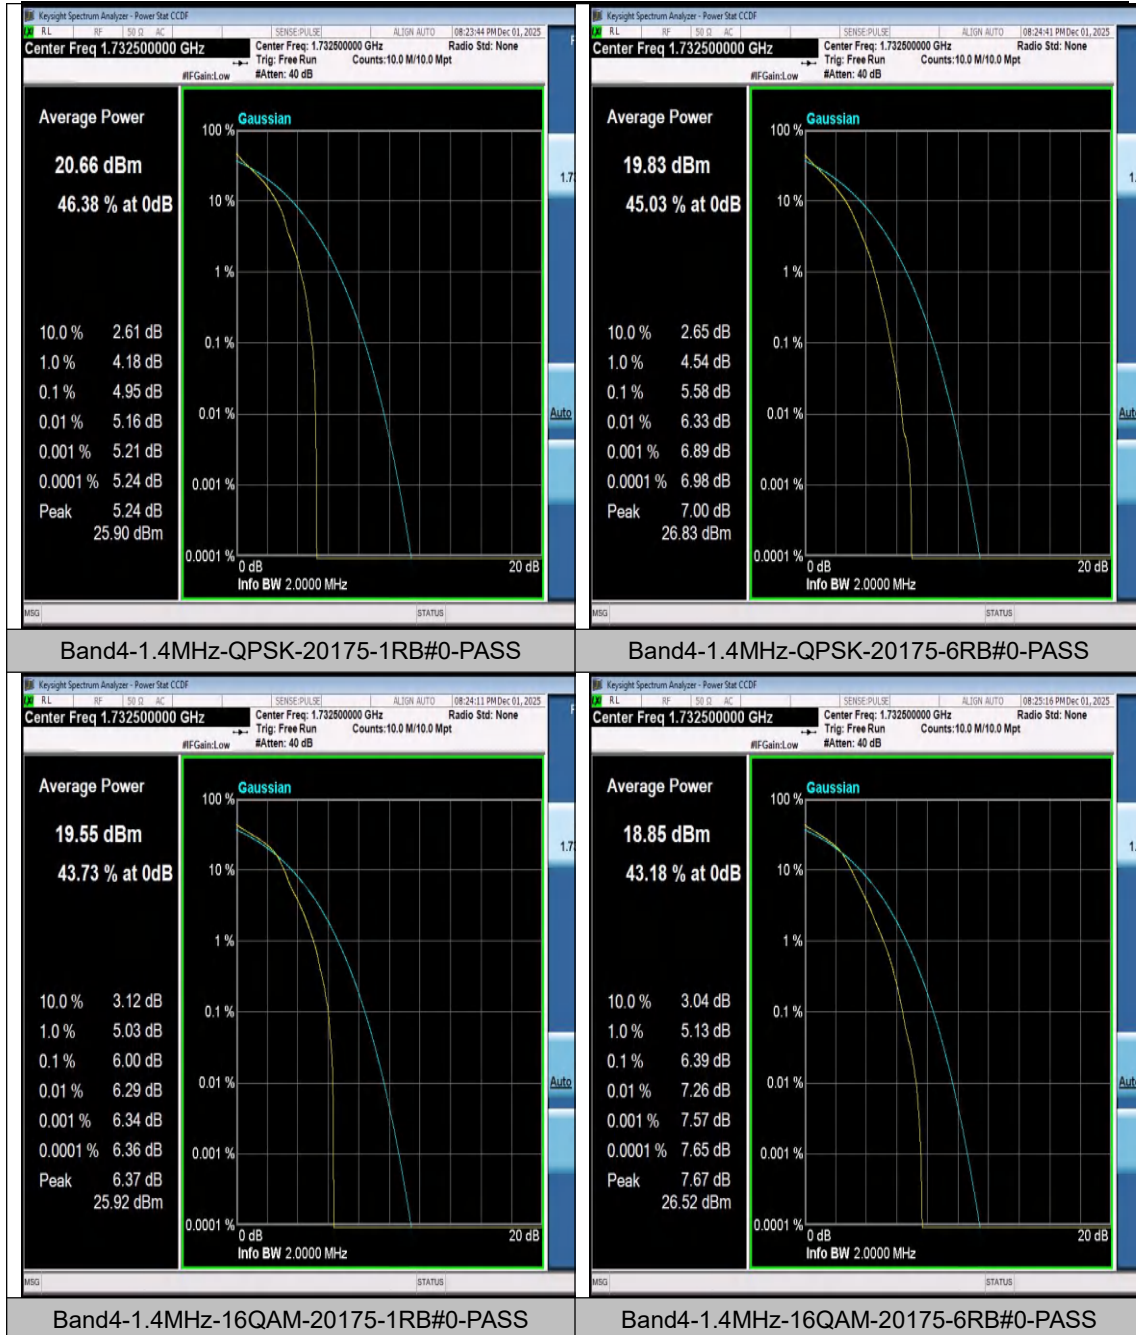

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

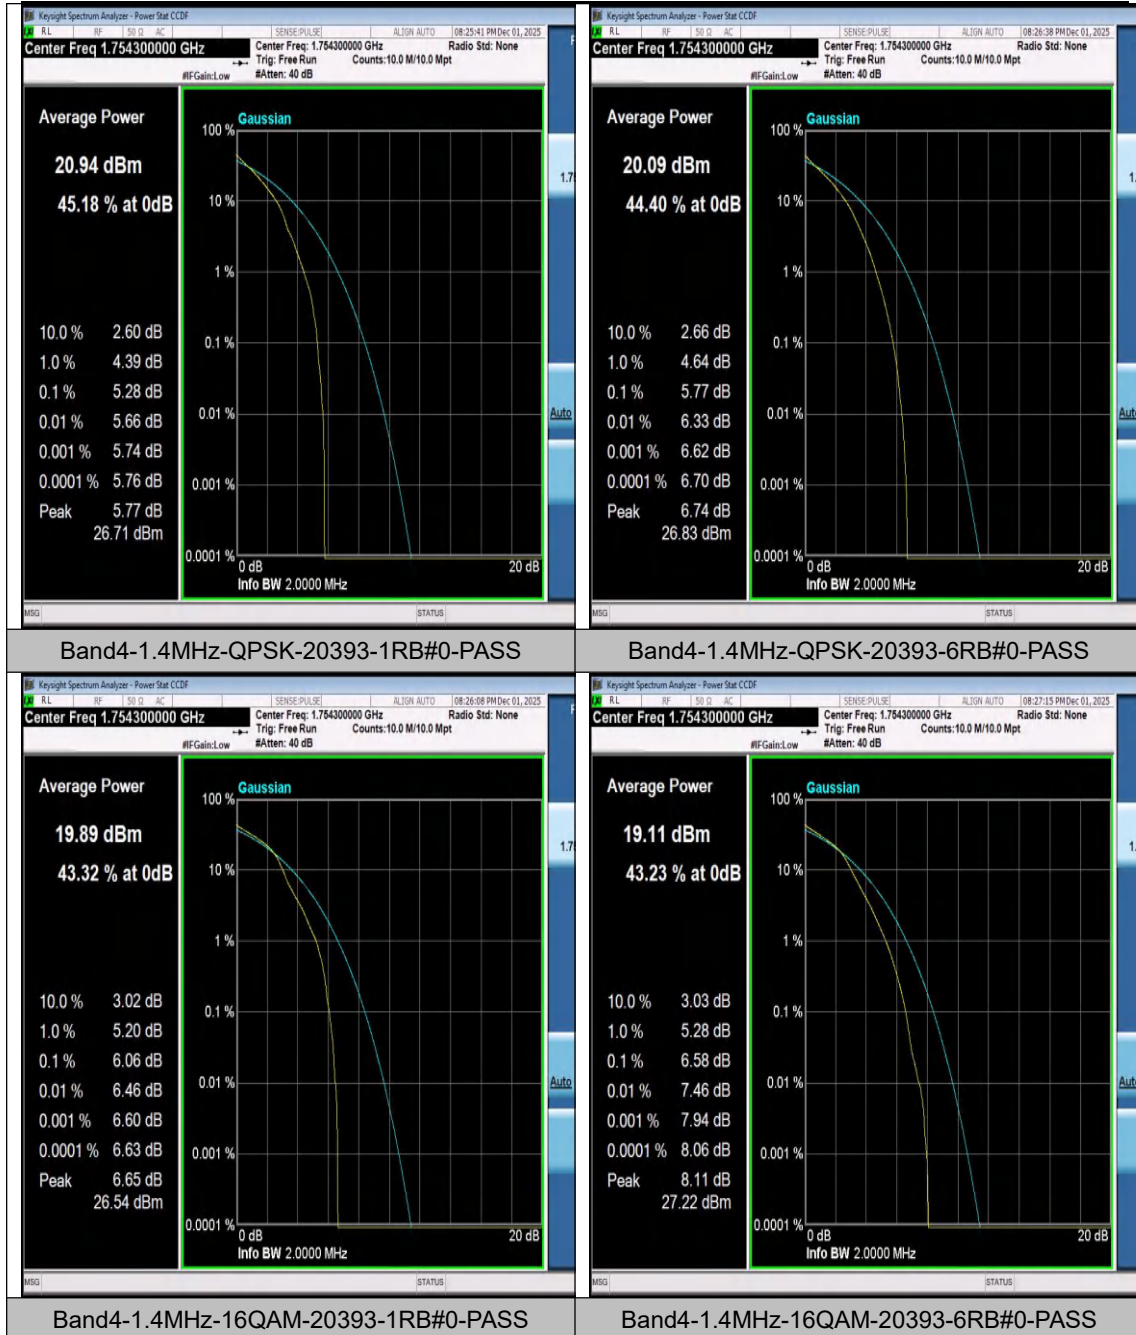

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

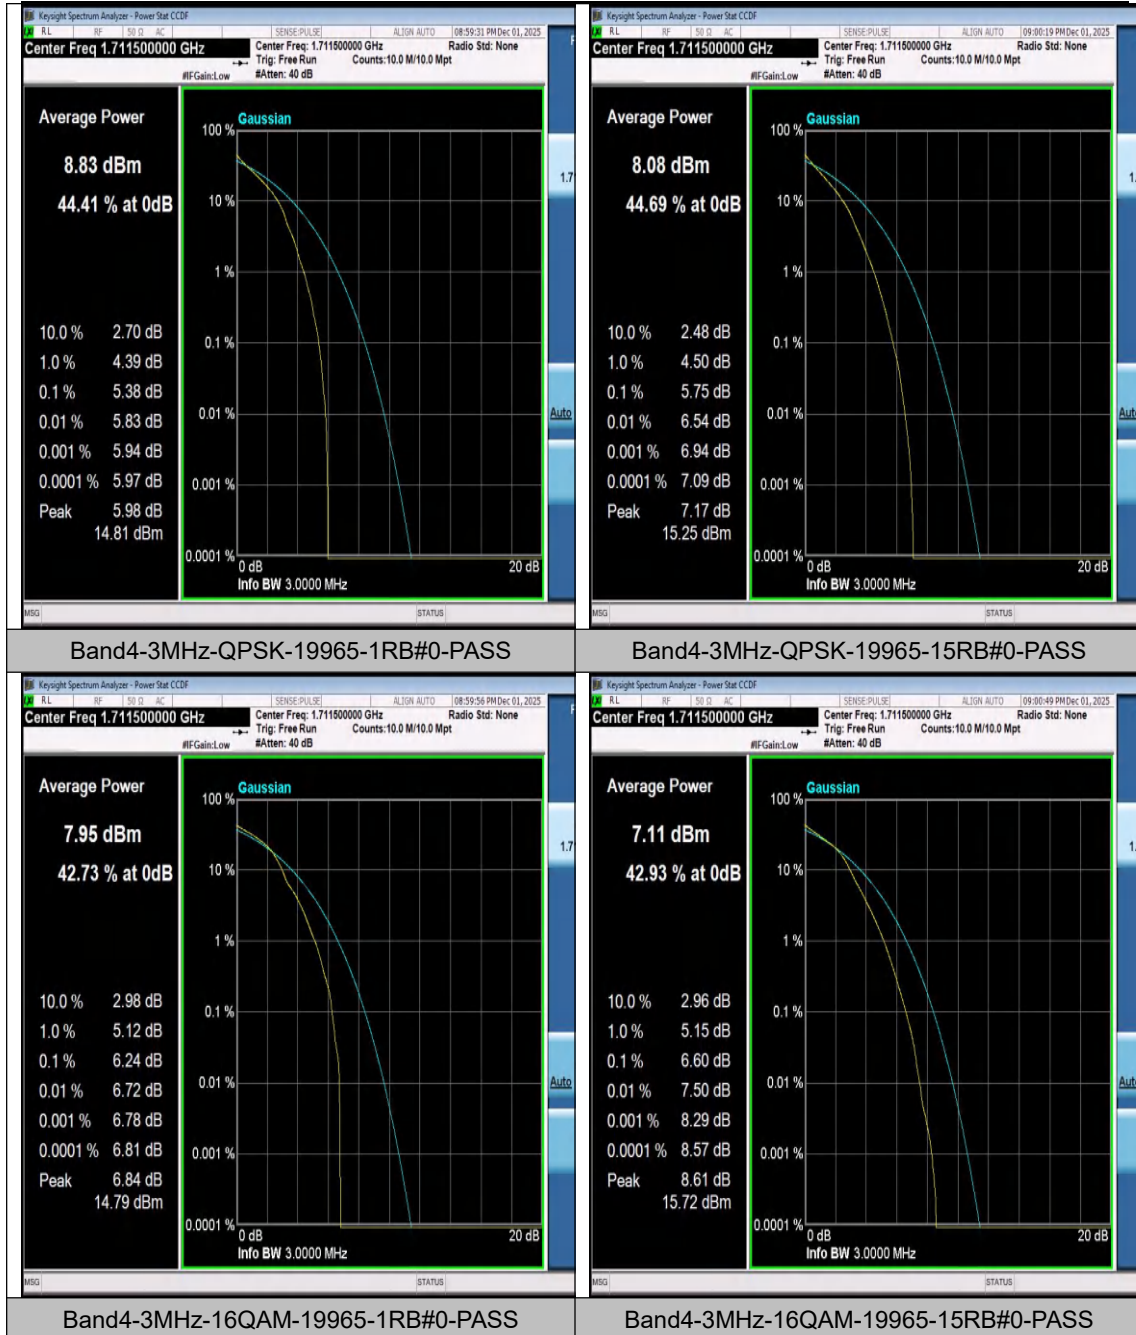

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

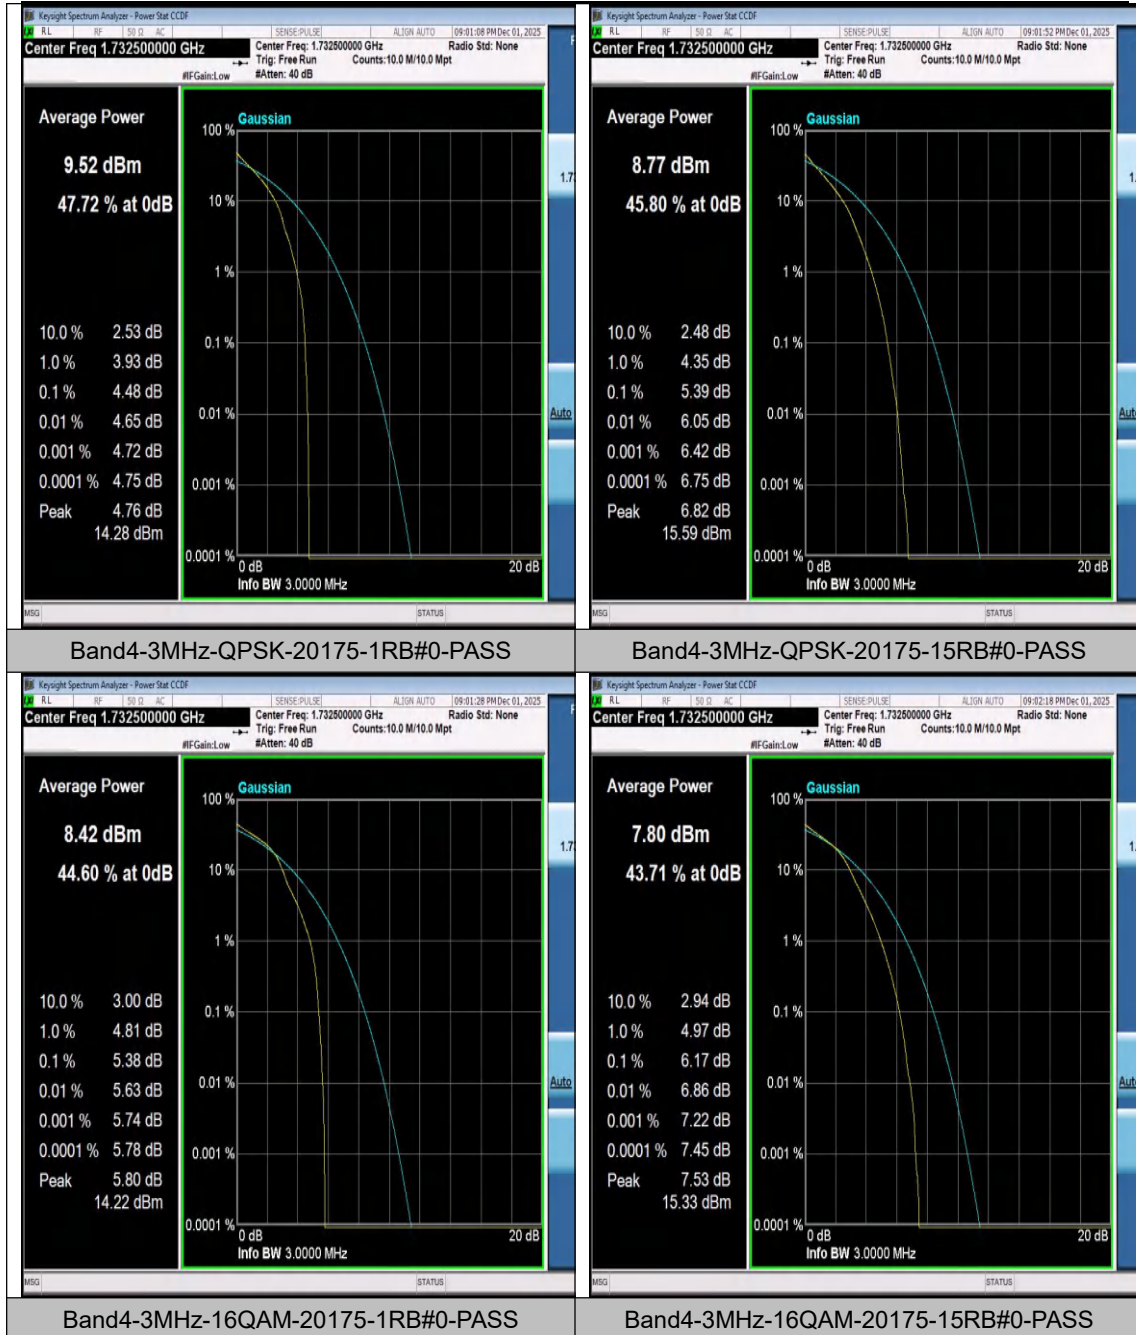

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

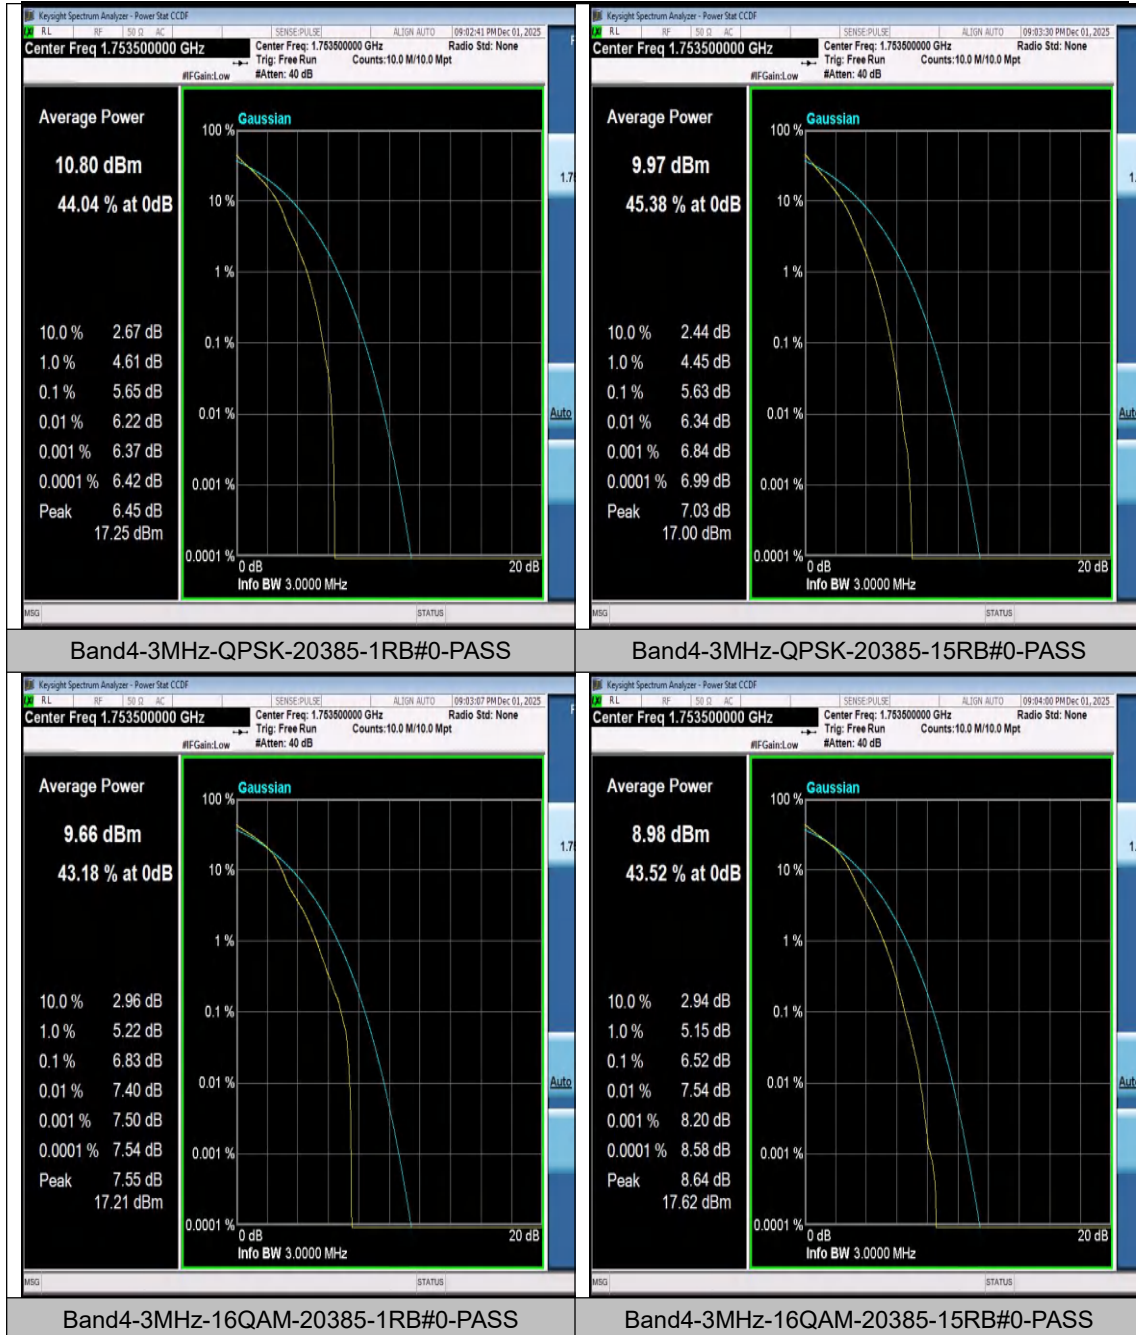

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

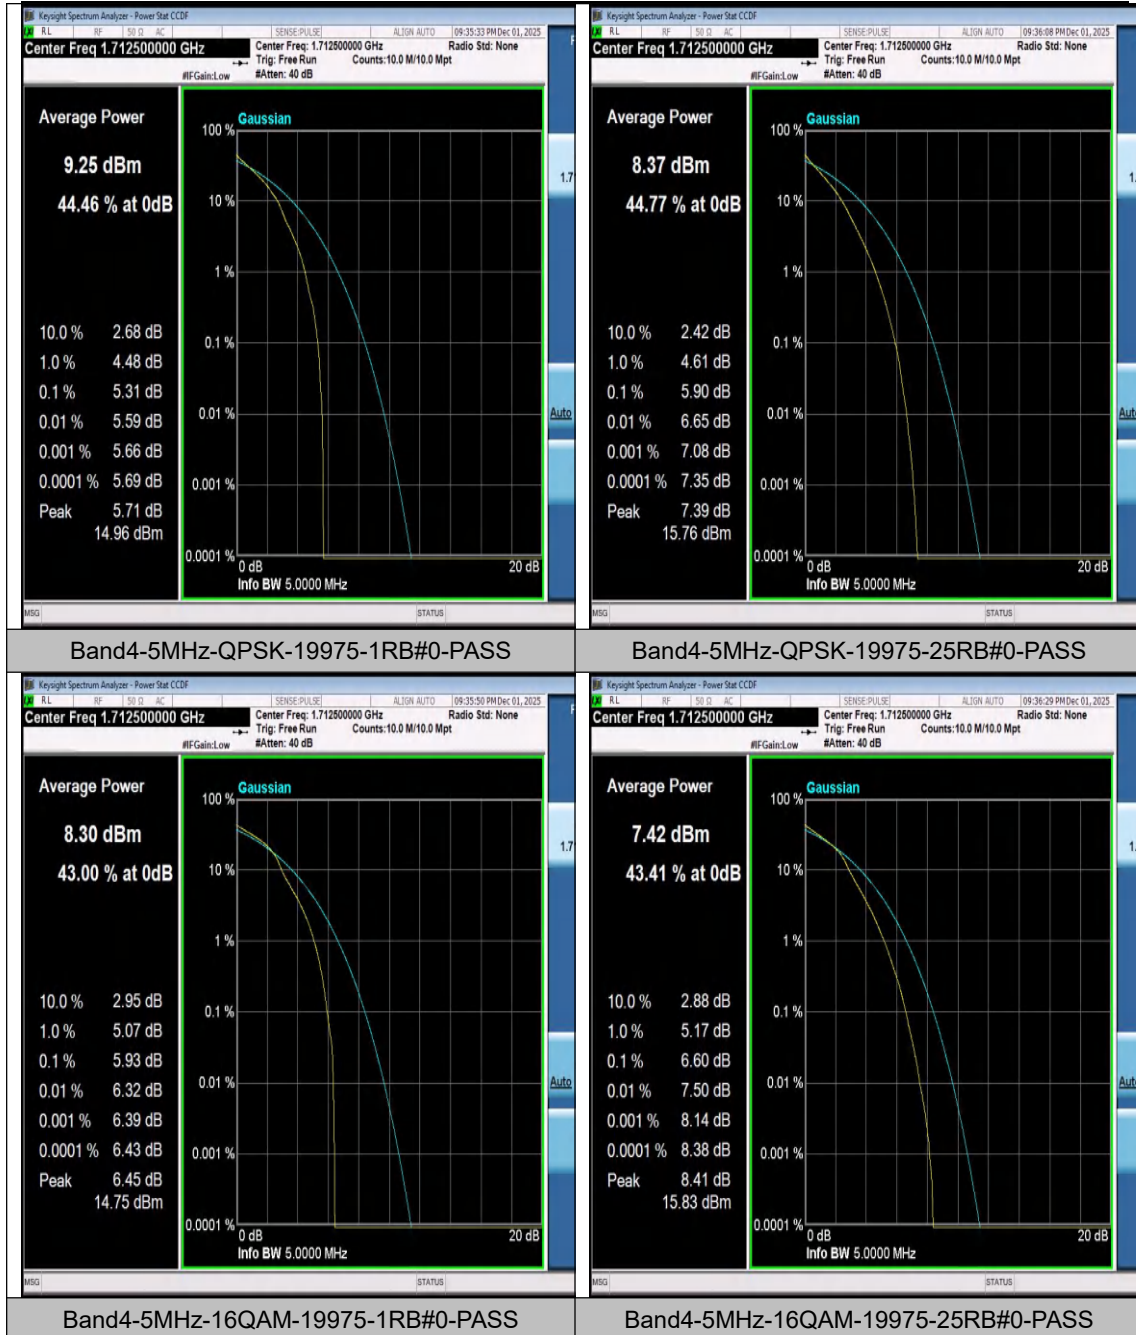

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

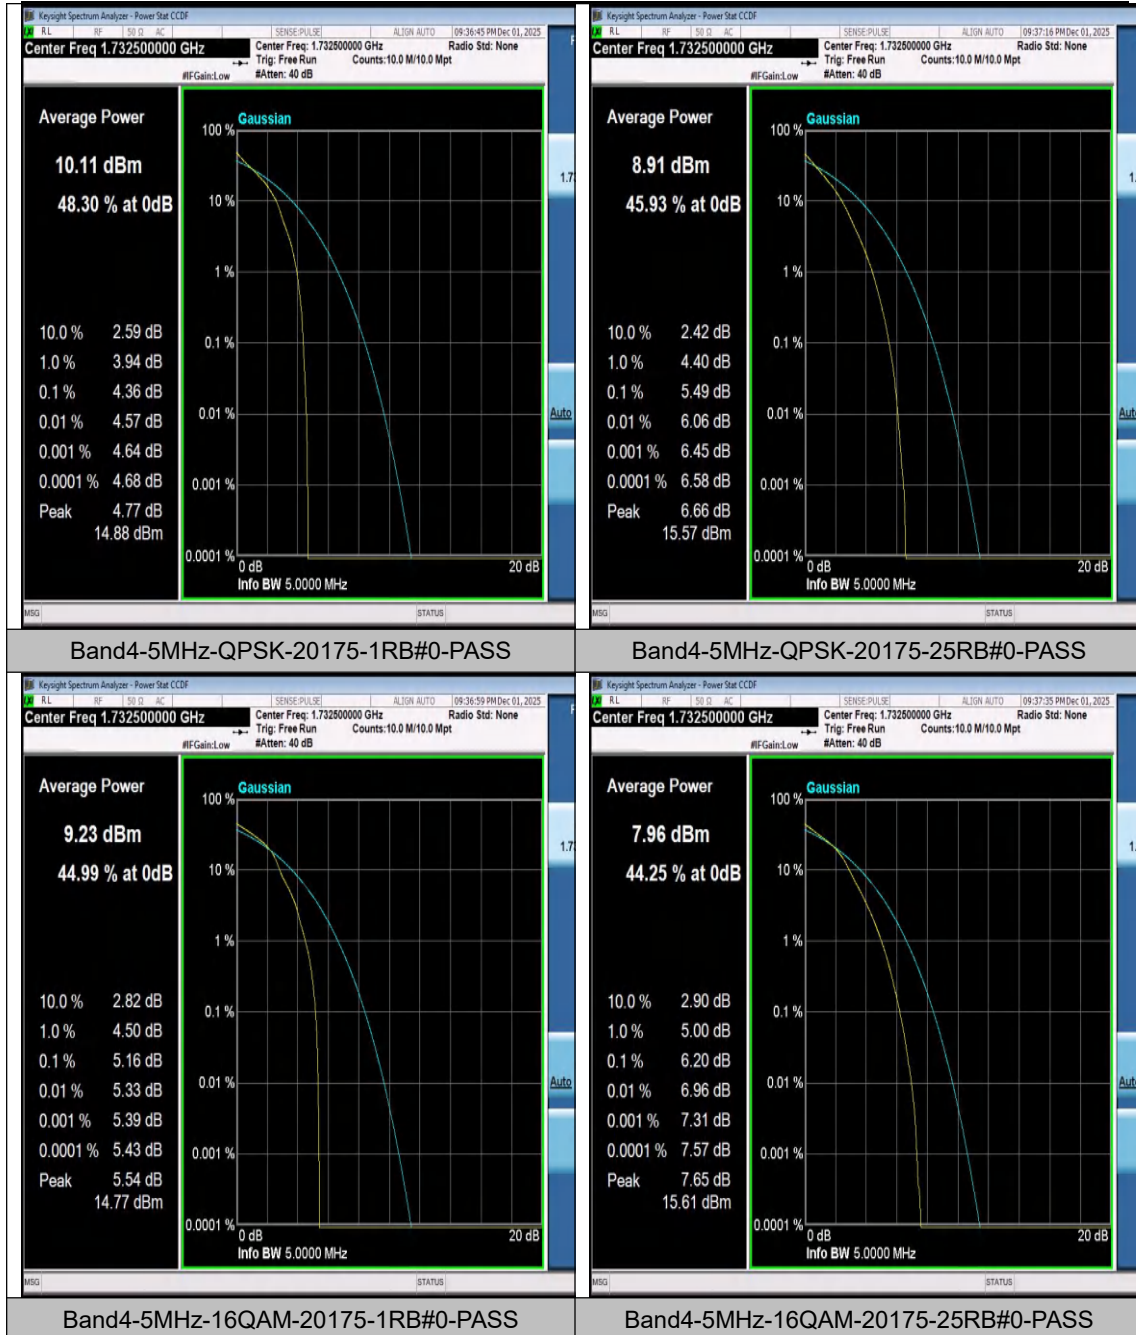

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

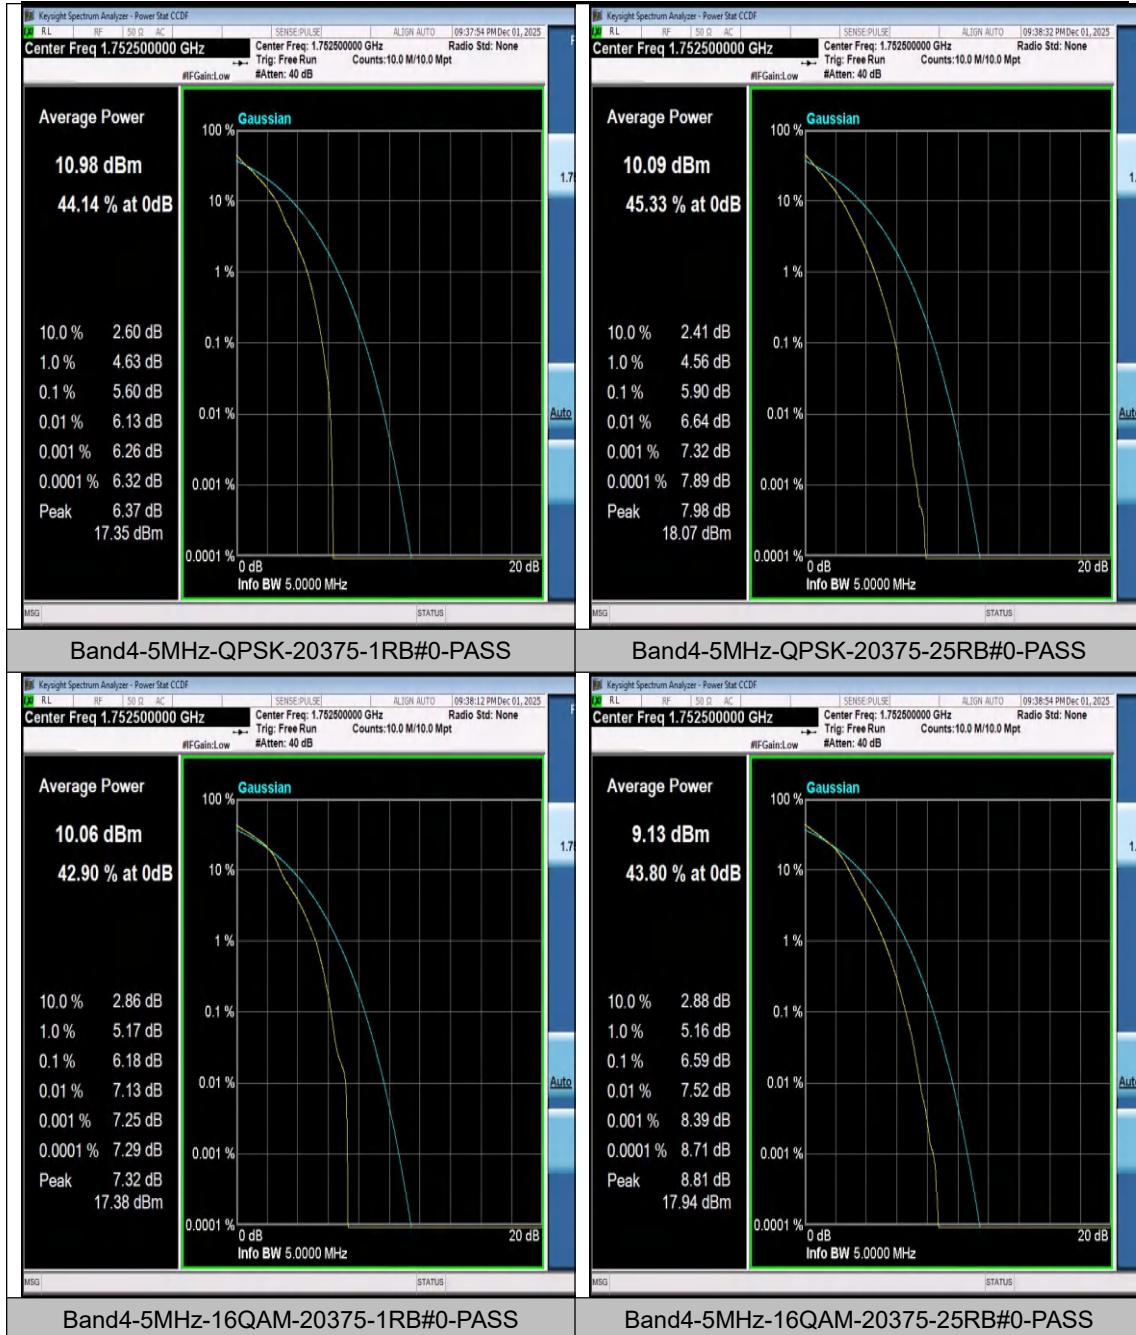

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

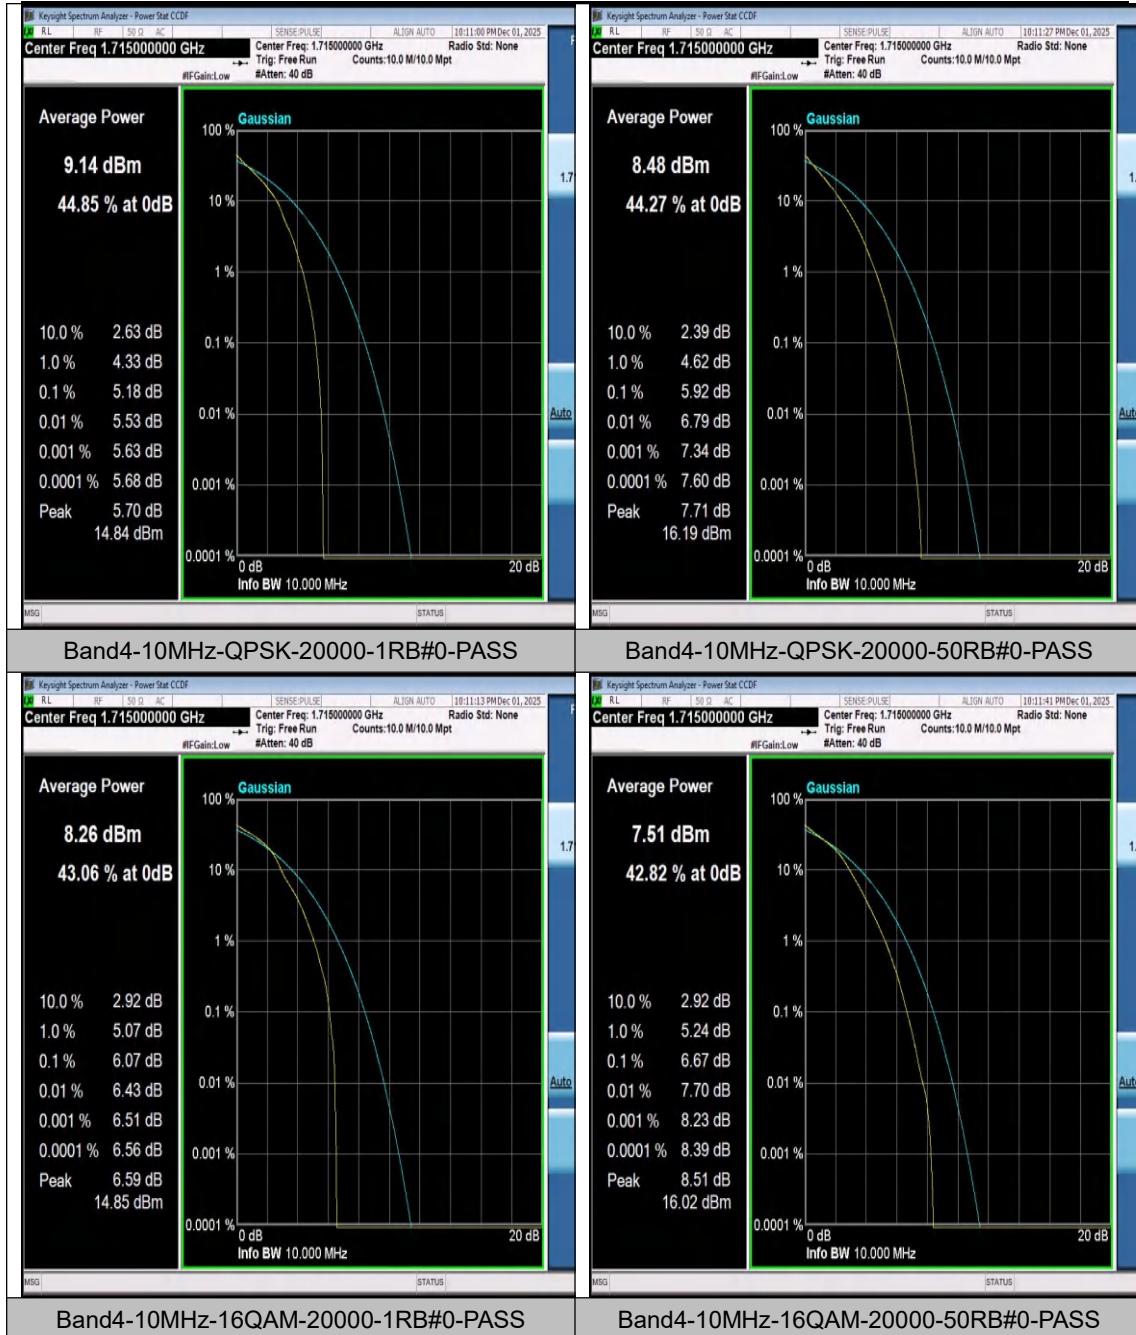

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

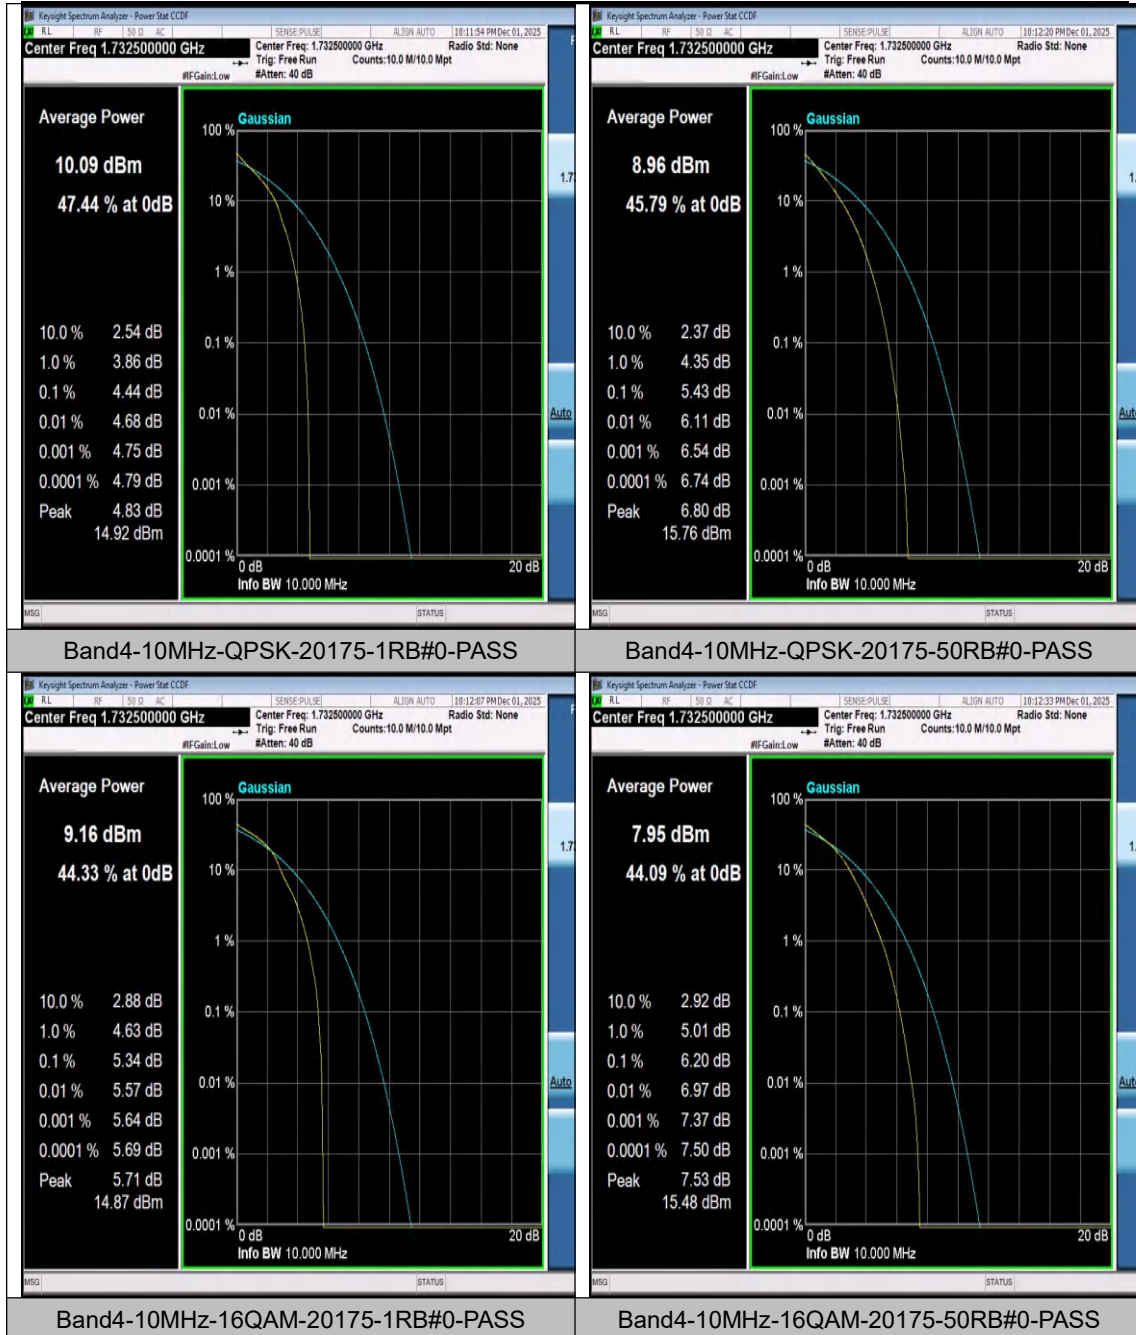

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

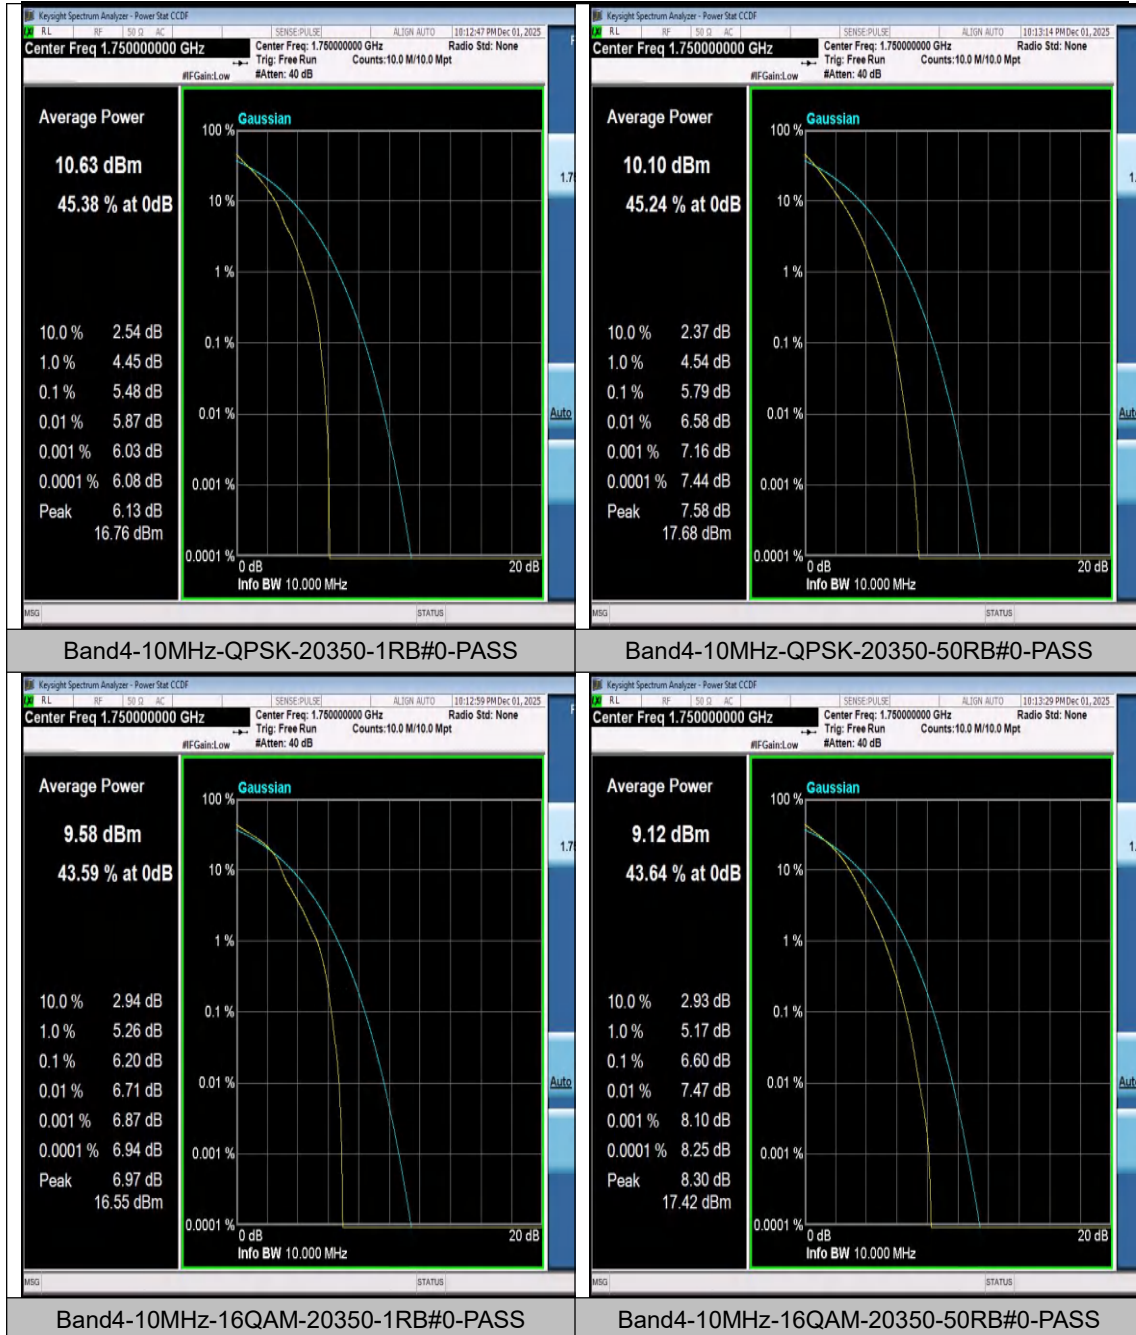

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

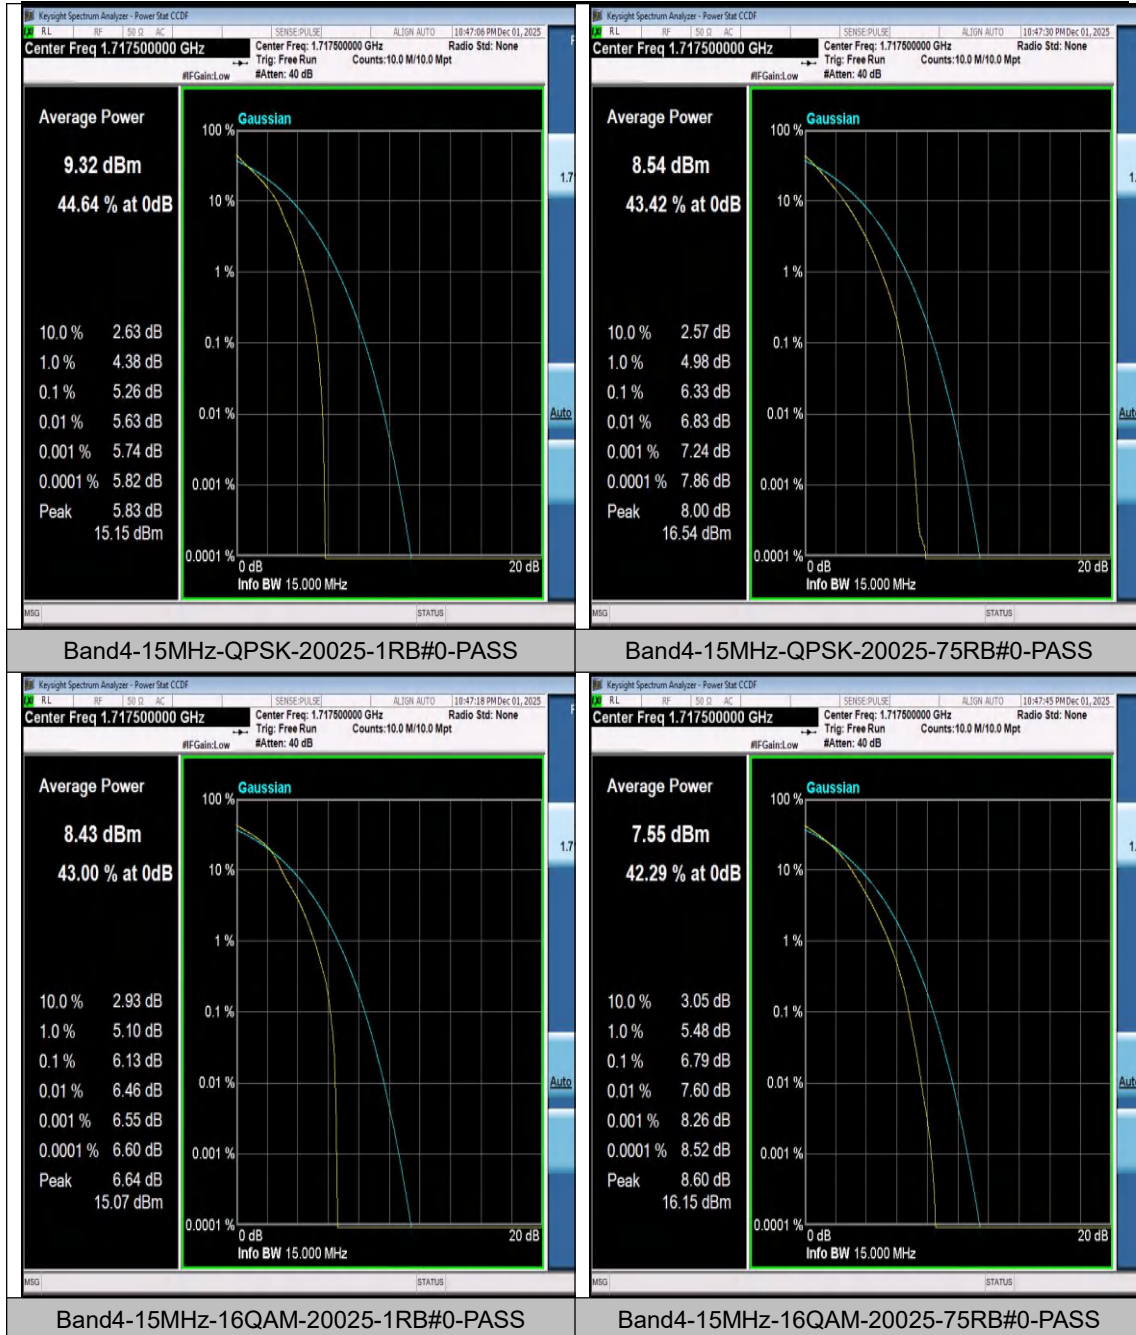

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

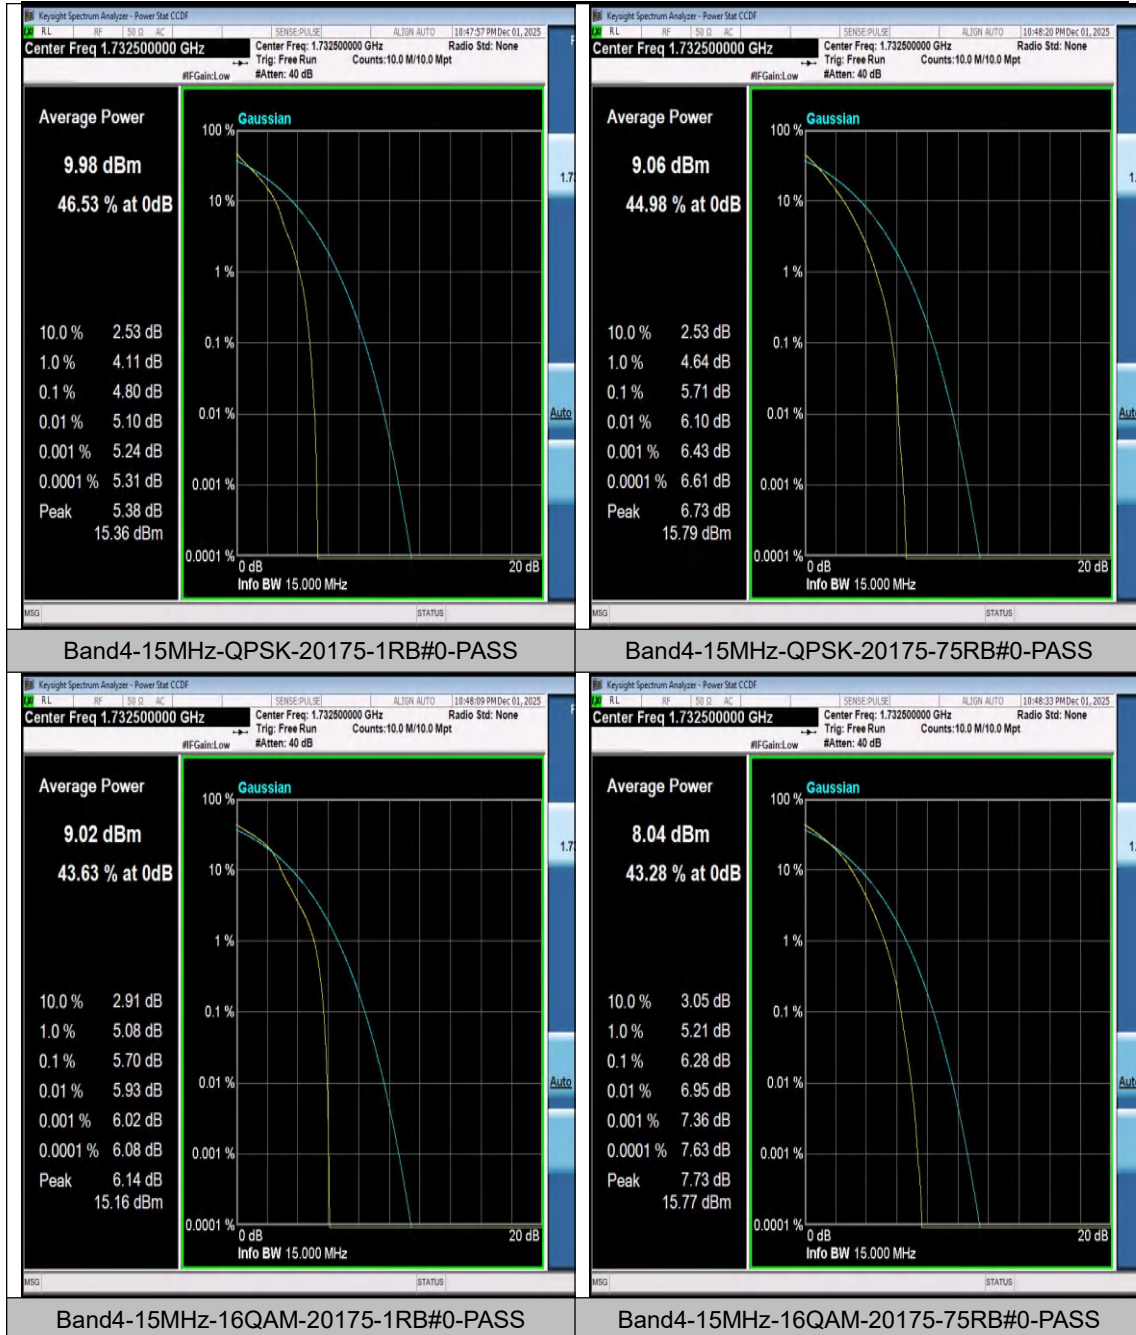

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

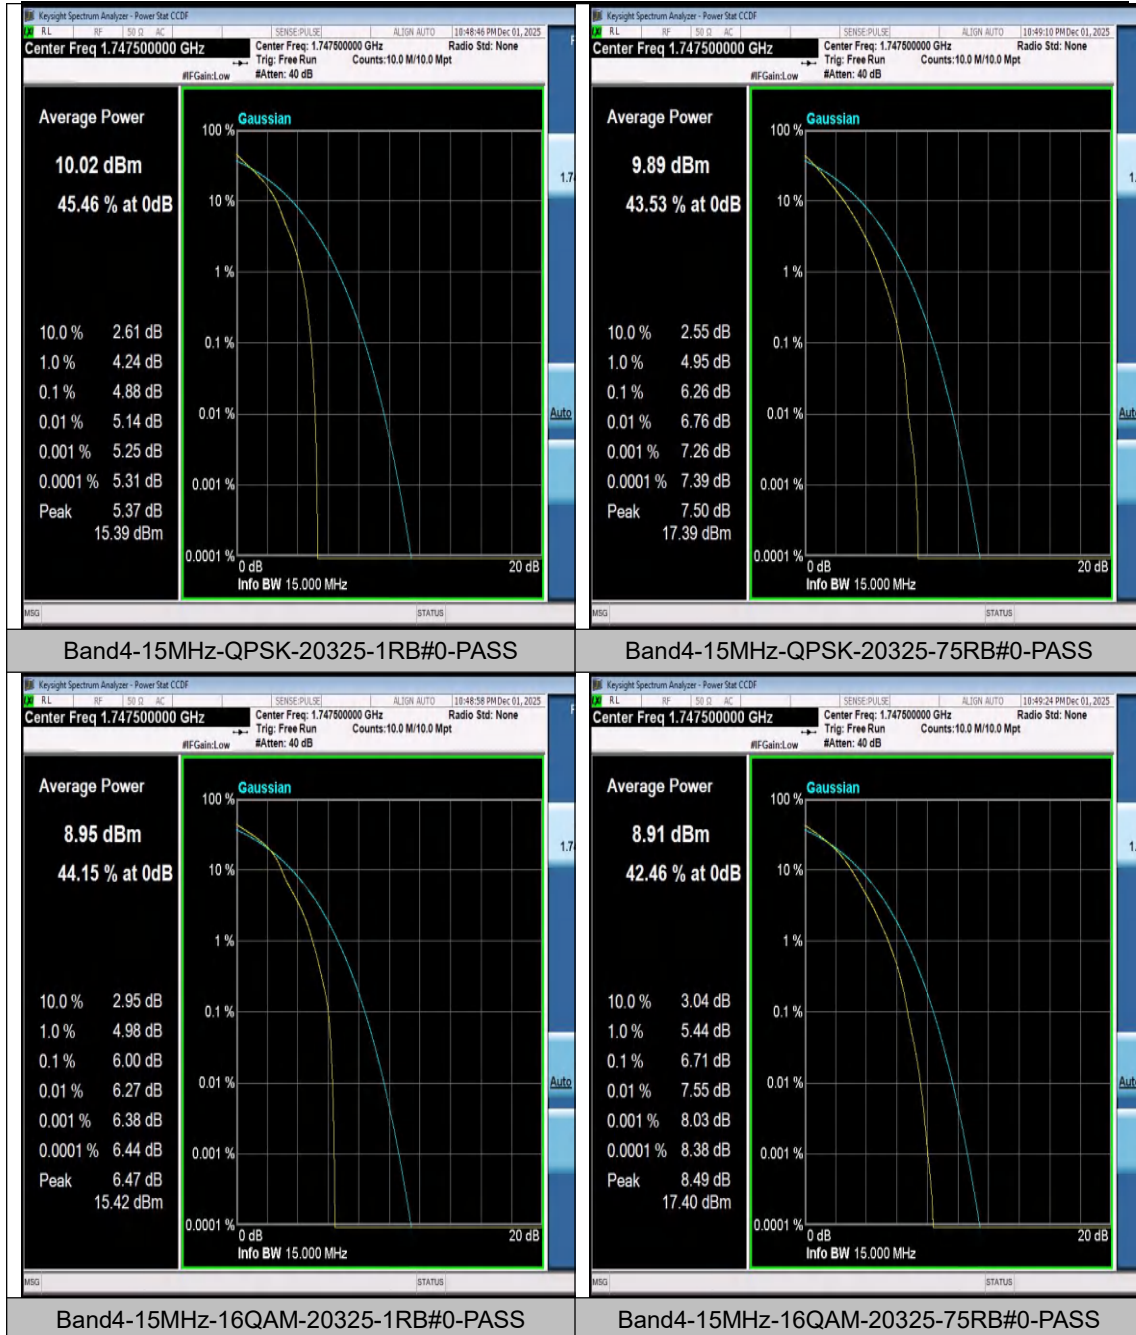

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

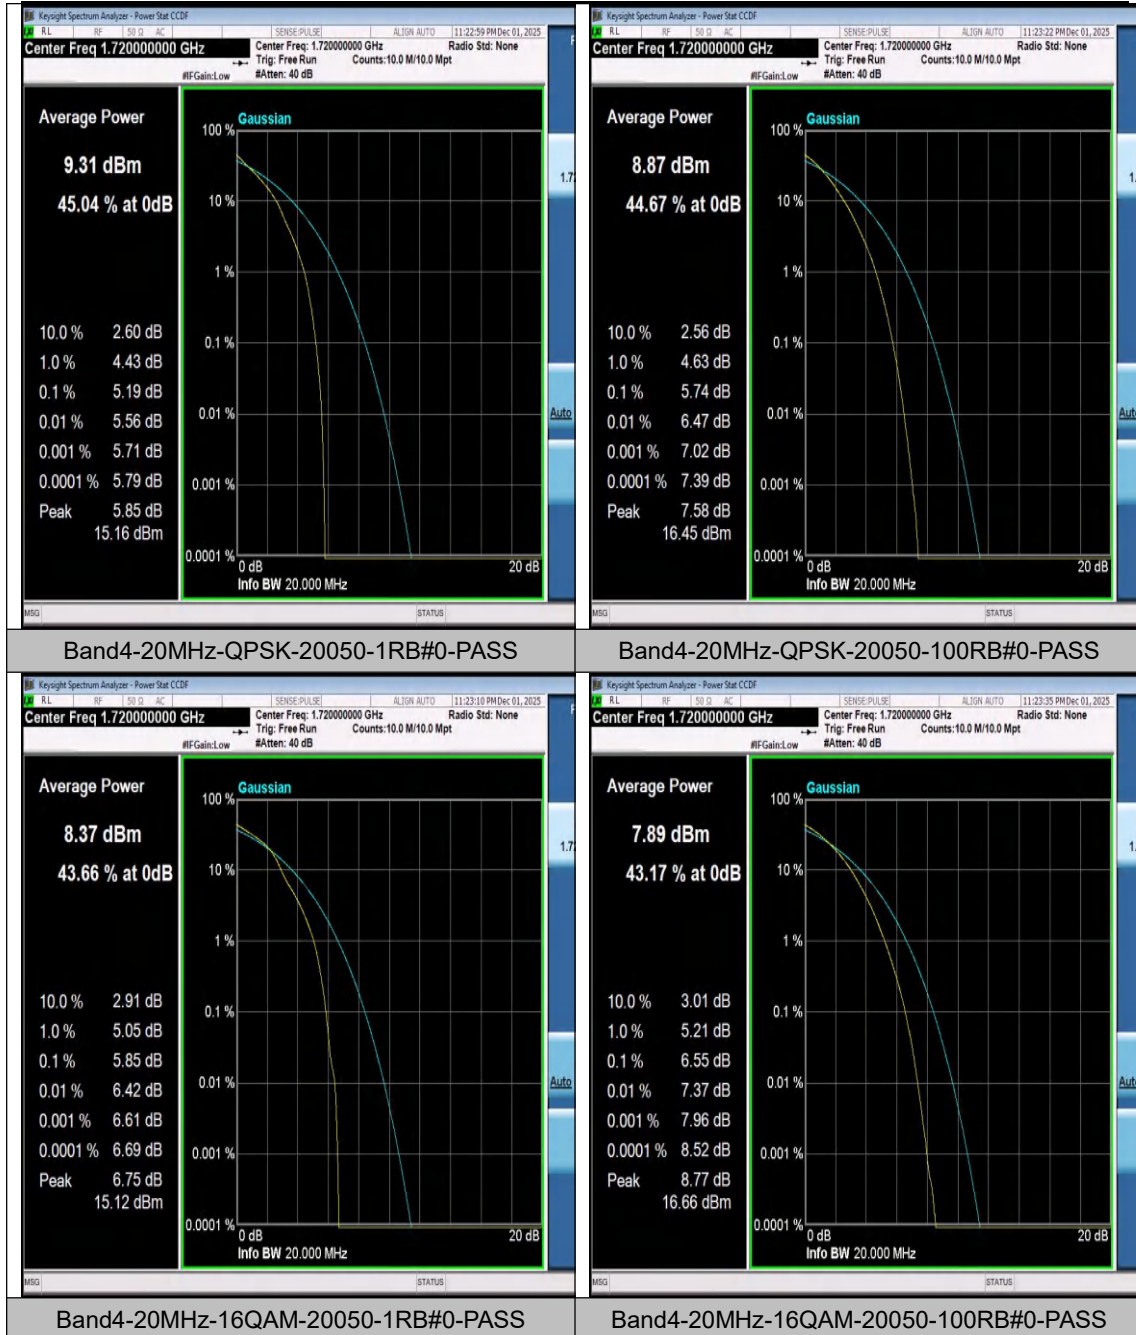

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

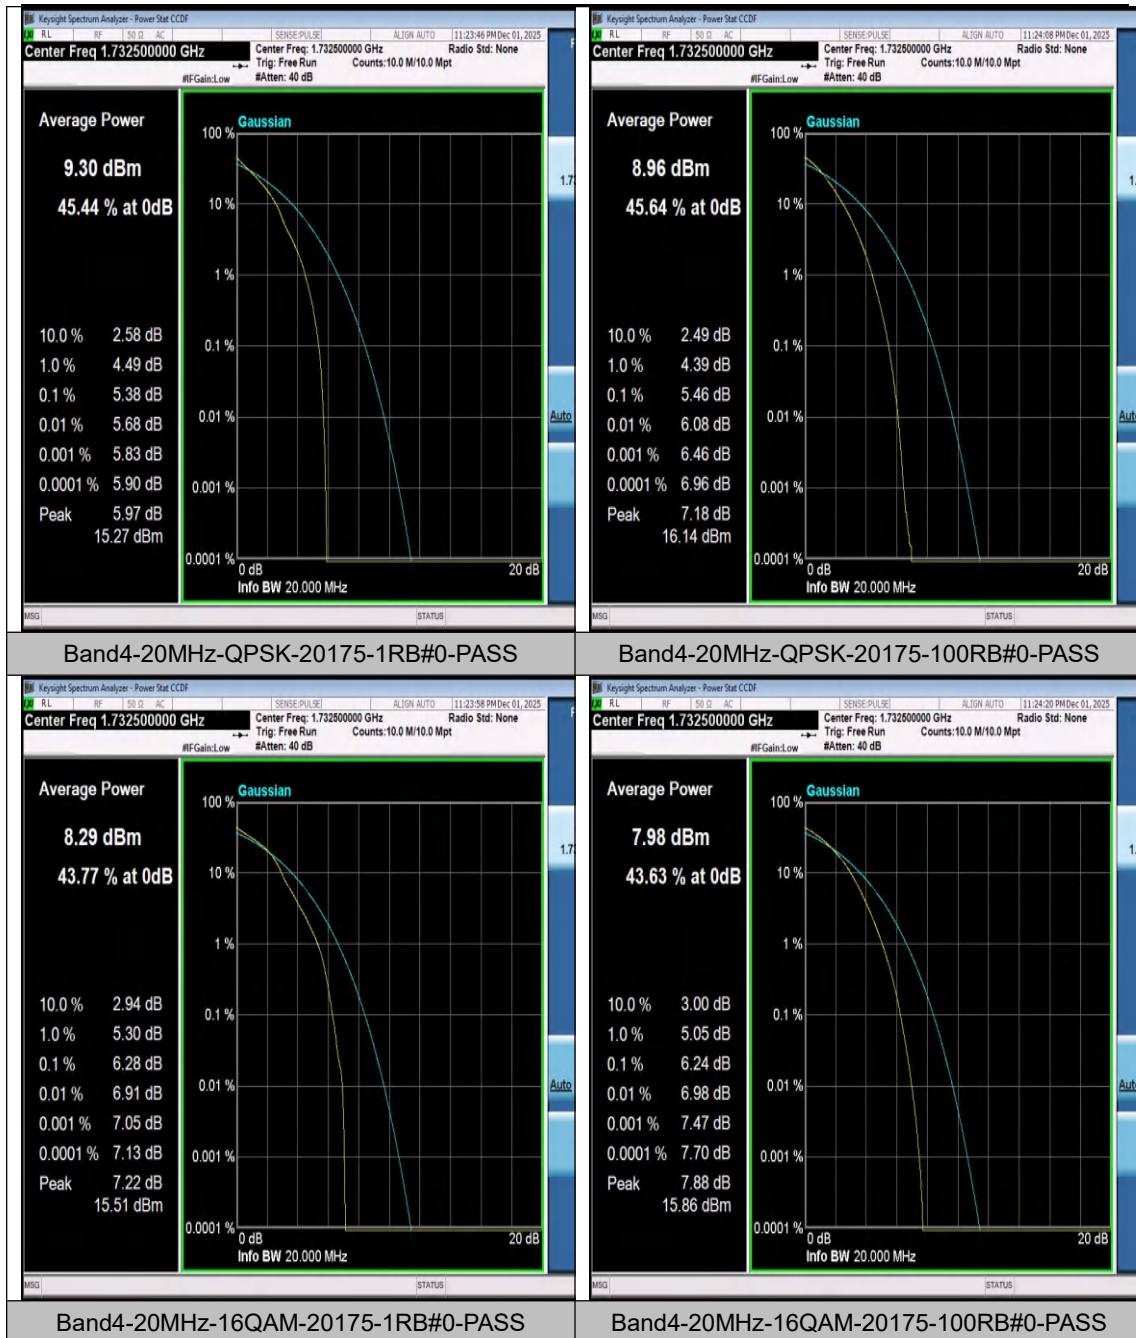

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

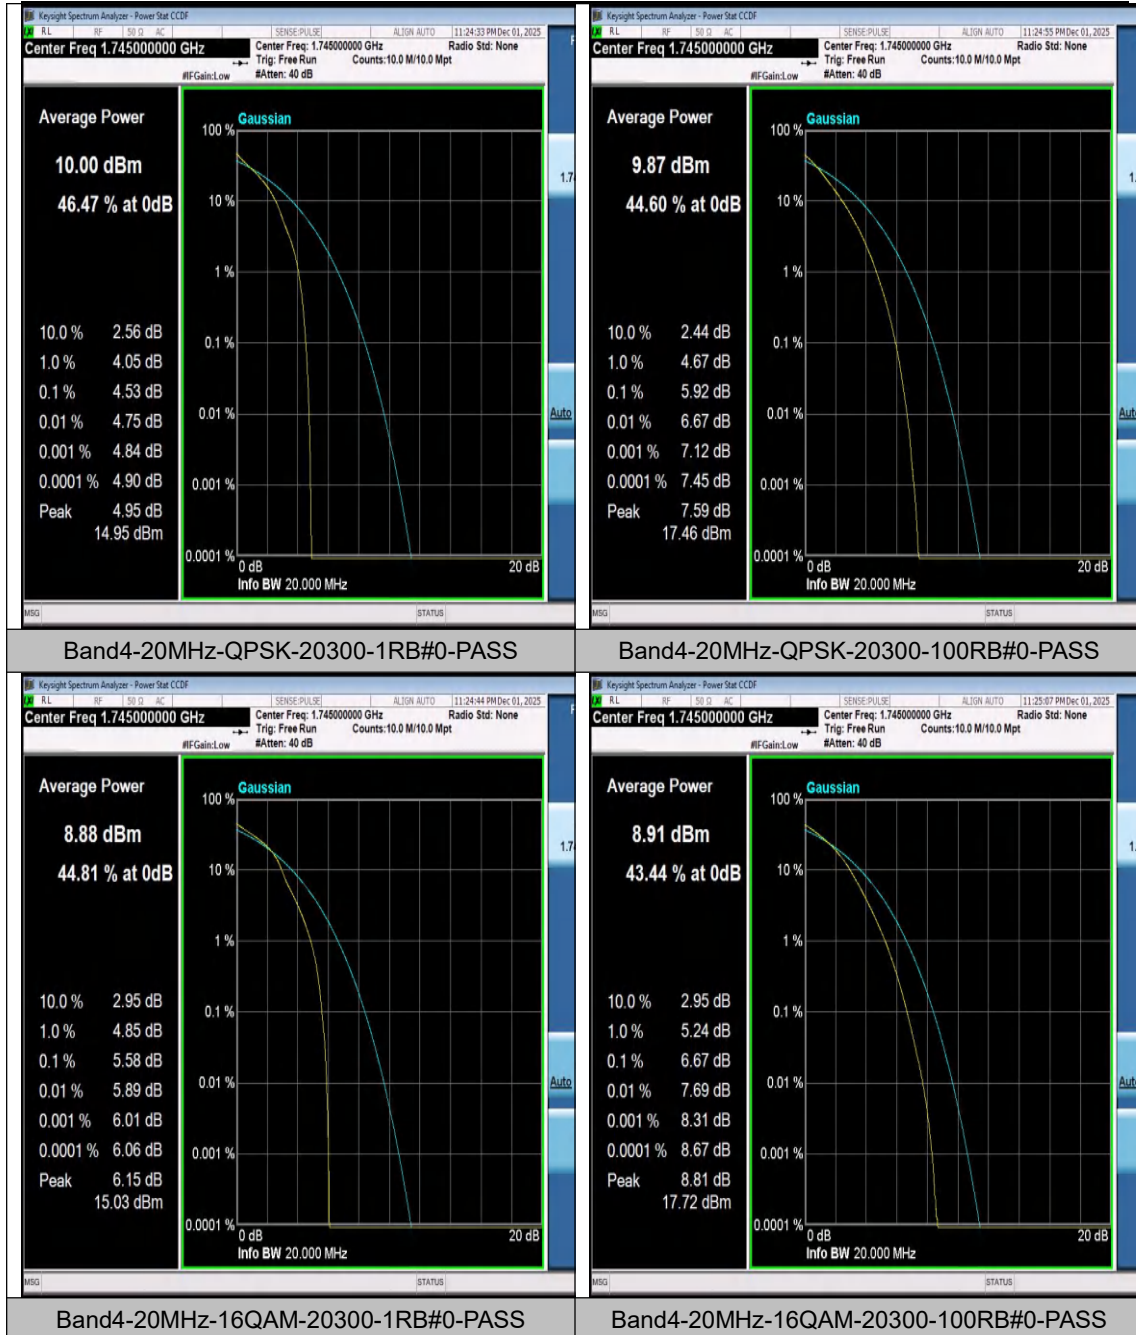

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	1.0940	1.275	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	1.0992	1.275	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	1.0906	1.265	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	1.0998	1.281	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	1.0945	1.273	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	1.0957	1.285	PASS
Band4	3MHz	QPSK	19965	15RB#0	2.6911	2.970	PASS
Band4	3MHz	16QAM	19965	15RB#0	2.6812	2.961	PASS
Band4	3MHz	QPSK	20175	15RB#0	2.6919	2.936	PASS
Band4	3MHz	16QAM	20175	15RB#0	2.6828	2.960	PASS
Band4	3MHz	QPSK	20385	15RB#0	2.6857	2.936	PASS
Band4	3MHz	16QAM	20385	15RB#0	2.6849	2.962	PASS
Band4	5MHz	QPSK	19975	25RB#0	4.5093	4.914	PASS
Band4	5MHz	16QAM	19975	25RB#0	4.4993	4.902	PASS
Band4	5MHz	QPSK	20175	25RB#0	4.4997	4.875	PASS
Band4	5MHz	16QAM	20175	25RB#0	4.5064	4.922	PASS
Band4	5MHz	QPSK	20375	25RB#0	4.4936	4.889	PASS
Band4	5MHz	16QAM	20375	25RB#0	4.5121	4.911	PASS
Band4	10MHz	QPSK	20000	50RB#0	8.9947	9.794	PASS
Band4	10MHz	16QAM	20000	50RB#0	8.9808	9.693	PASS
Band4	10MHz	QPSK	20175	50RB#0	8.9736	9.751	PASS
Band4	10MHz	16QAM	20175	50RB#0	8.9848	9.702	PASS
Band4	10MHz	QPSK	20350	50RB#0	8.9708	9.740	PASS
Band4	10MHz	16QAM	20350	50RB#0	8.9716	9.791	PASS
Band4	15MHz	QPSK	20025	75RB#0	13.509	14.51	PASS
Band4	15MHz	16QAM	20025	75RB#0	13.522	14.57	PASS
Band4	15MHz	QPSK	20175	75RB#0	13.447	14.57	PASS
Band4	15MHz	16QAM	20175	75RB#0	13.474	14.53	PASS
Band4	15MHz	QPSK	20325	75RB#0	13.479	14.61	PASS
Band4	15MHz	16QAM	20325	75RB#0	13.514	14.59	PASS
Band4	20MHz	QPSK	20050	100RB#0	17.929	19.23	PASS
Band4	20MHz	16QAM	20050	100RB#0	17.939	19.30	PASS
Band4	20MHz	QPSK	20175	100RB#0	17.861	19.33	PASS
Band4	20MHz	16QAM	20175	100RB#0	17.891	19.25	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band4	20MHz	QPSK	20300	100RB#0	18.050	19.54	PASS
Band4	20MHz	16QAM	20300	100RB#0	18.023	19.39	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

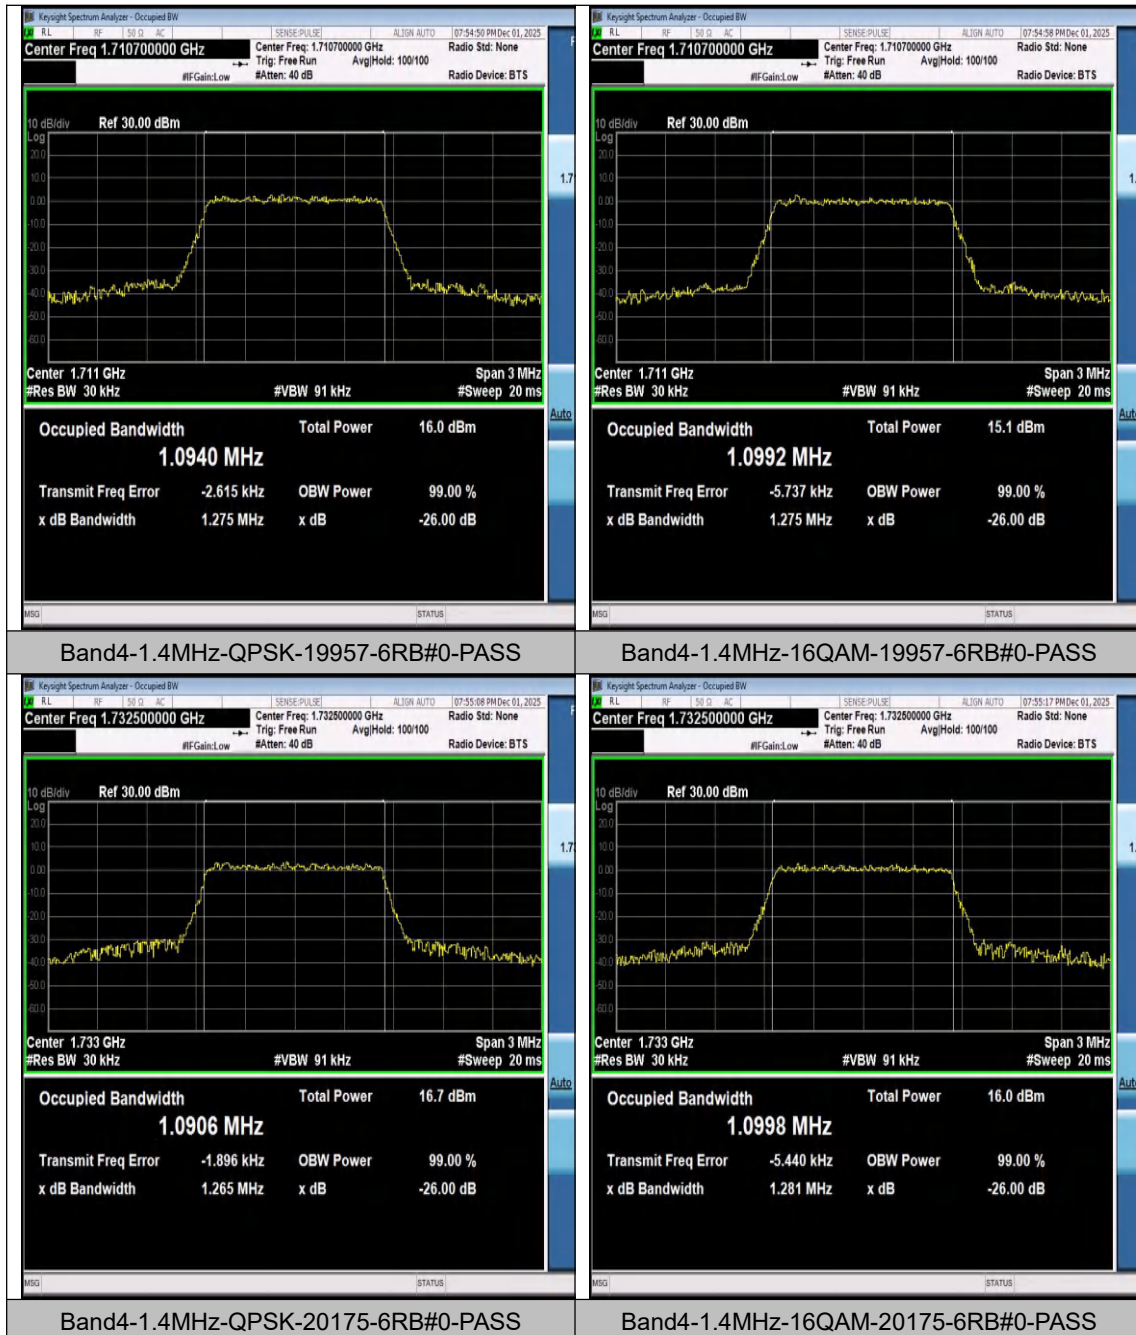

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

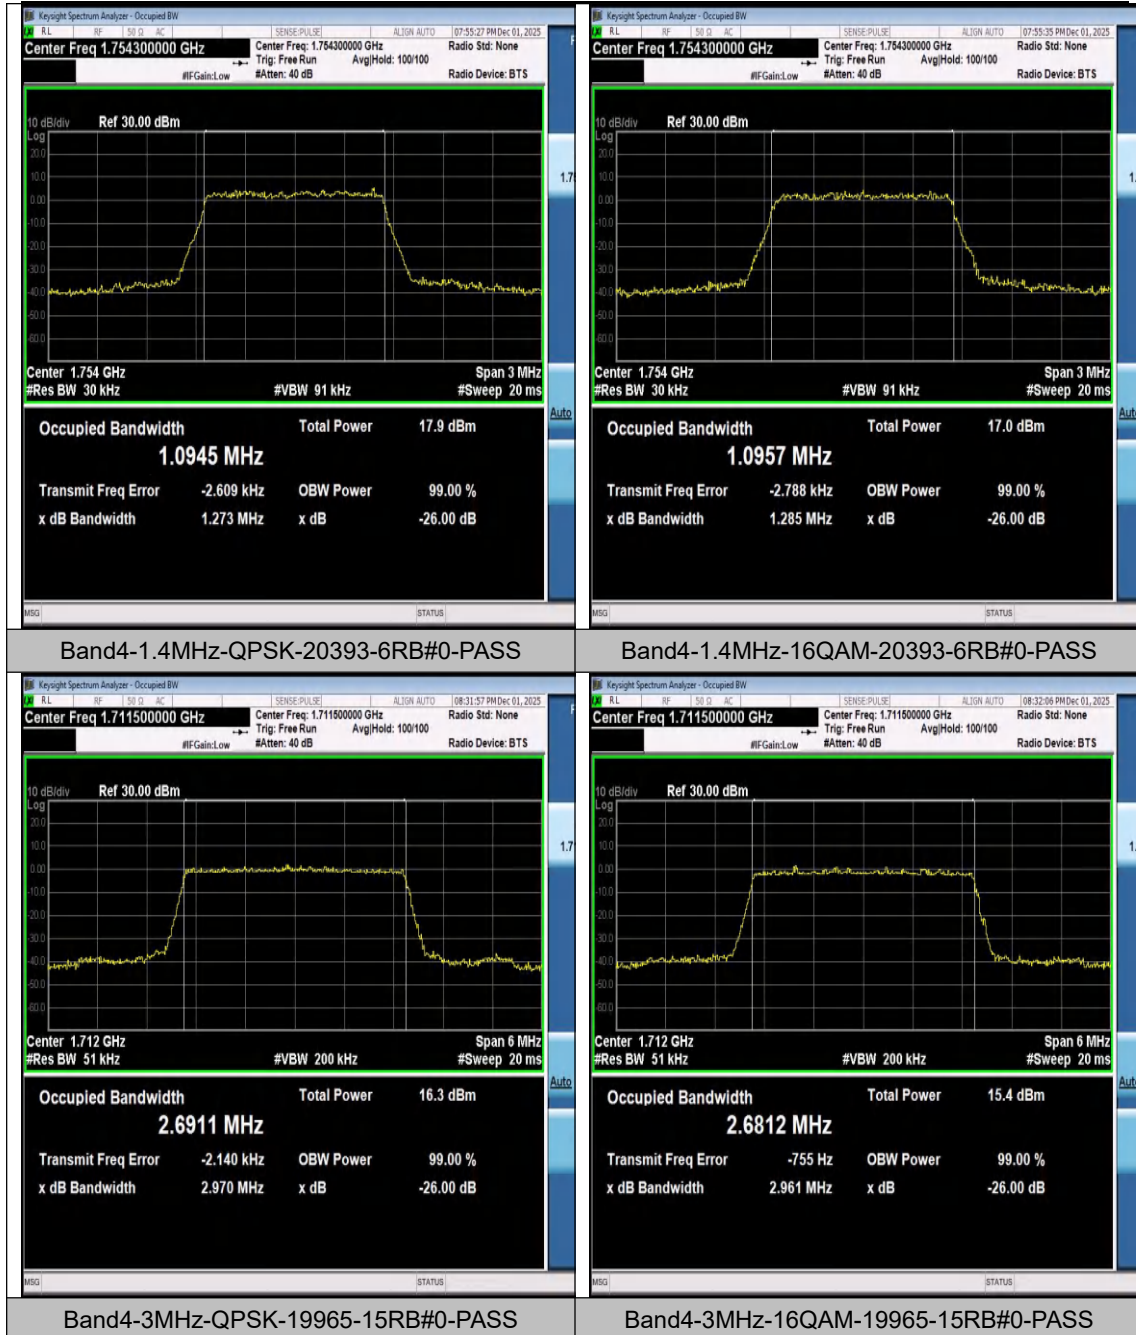

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

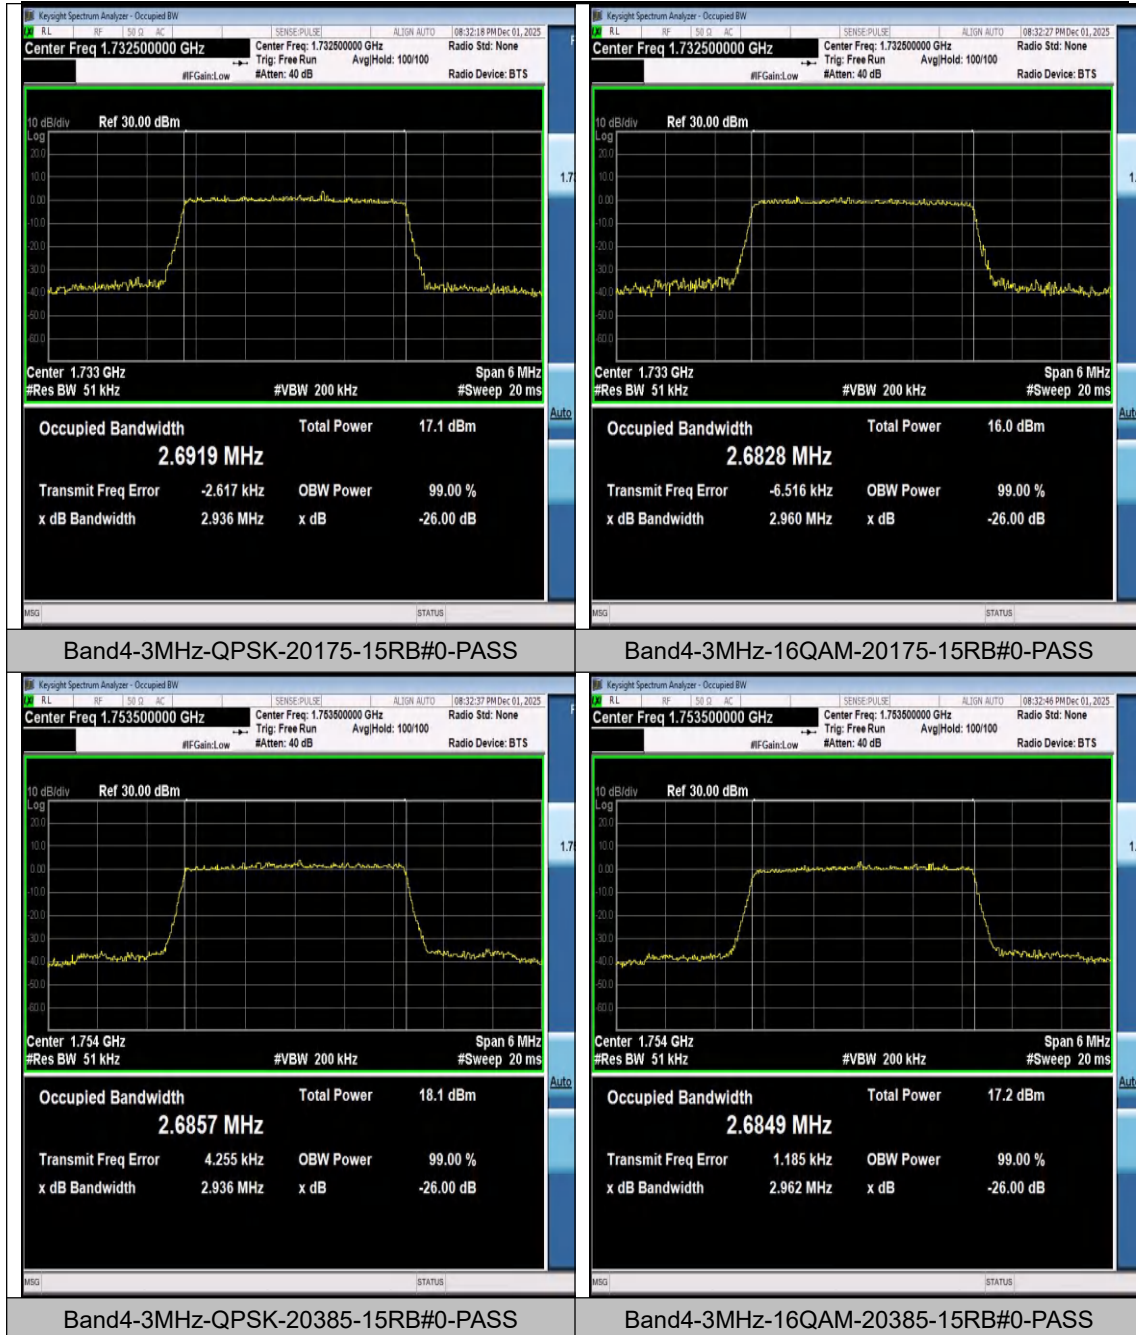

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

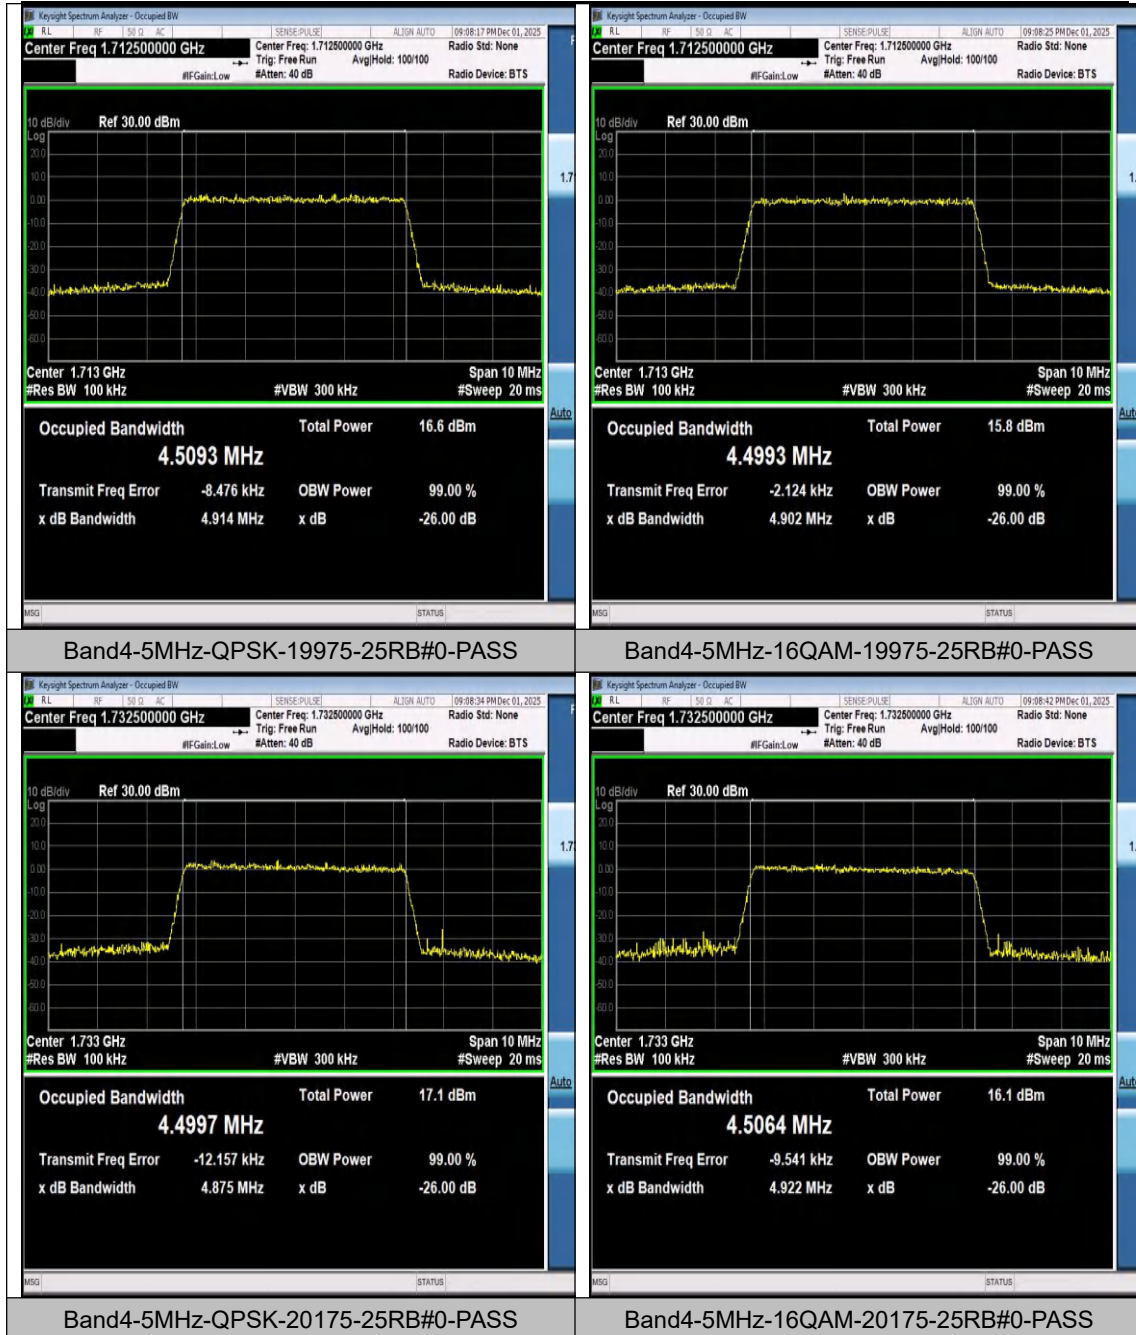

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

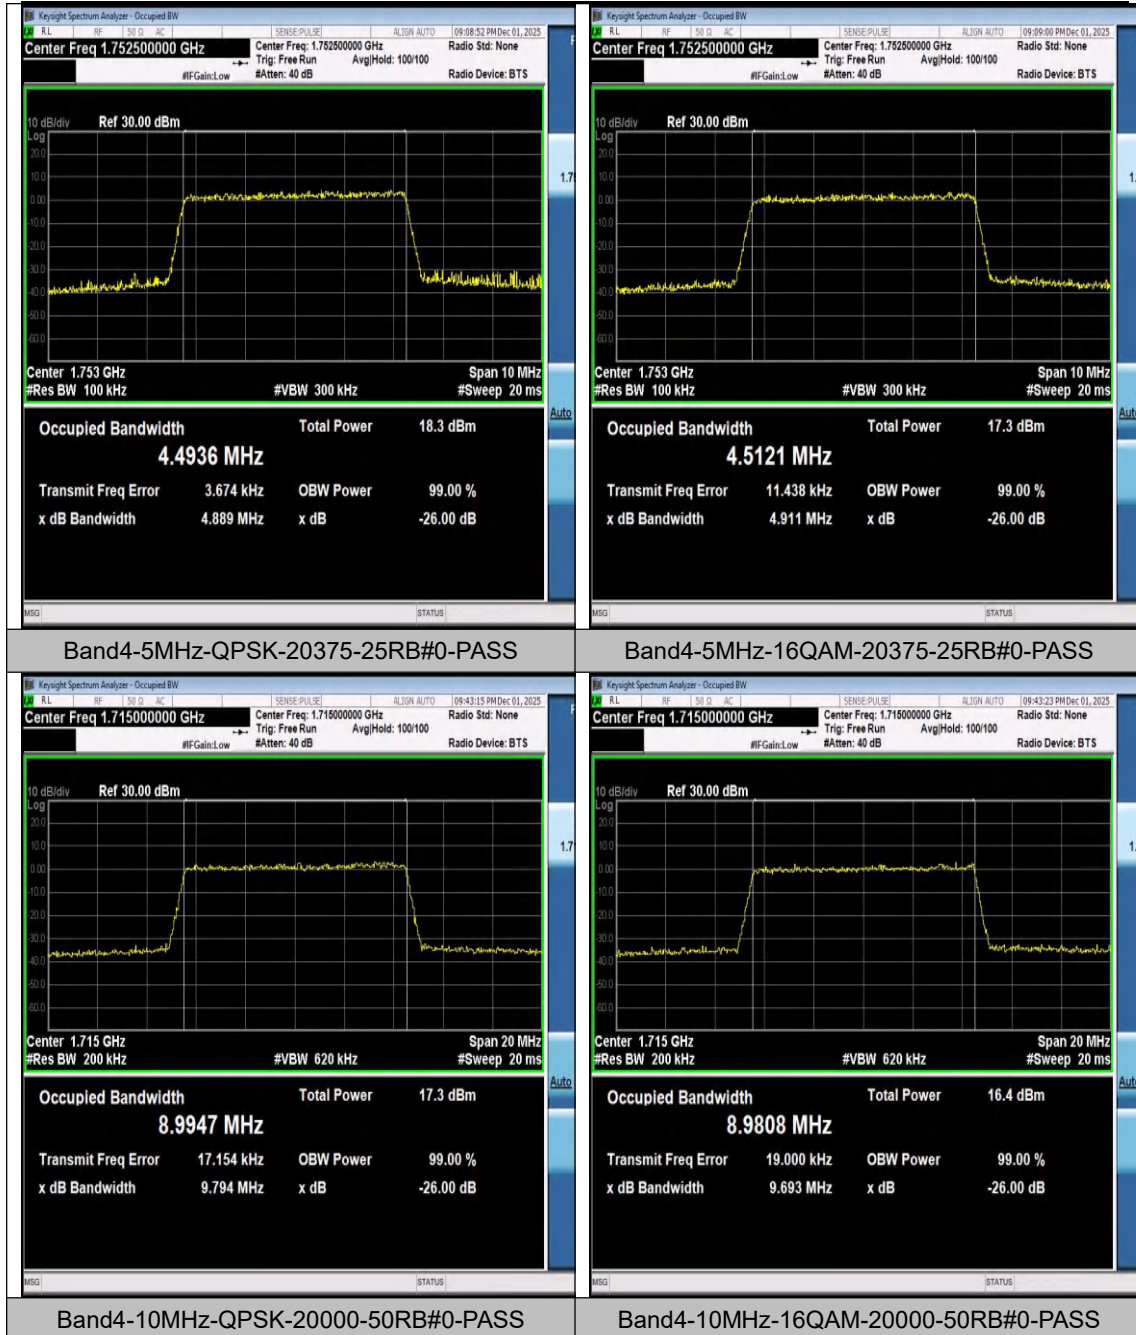

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

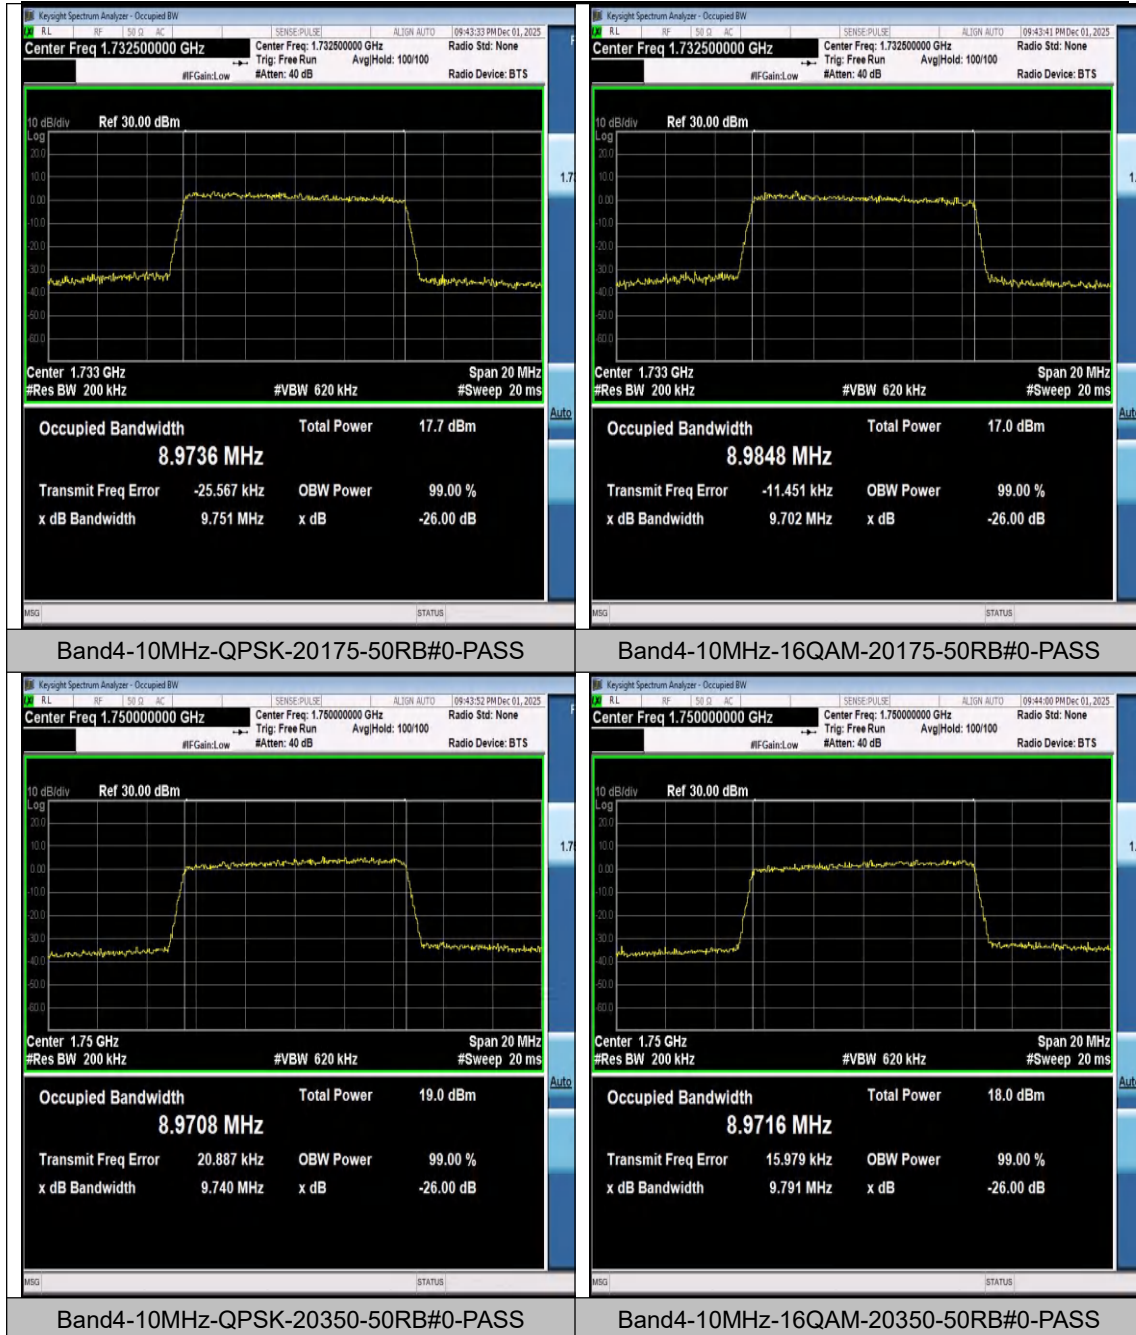

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

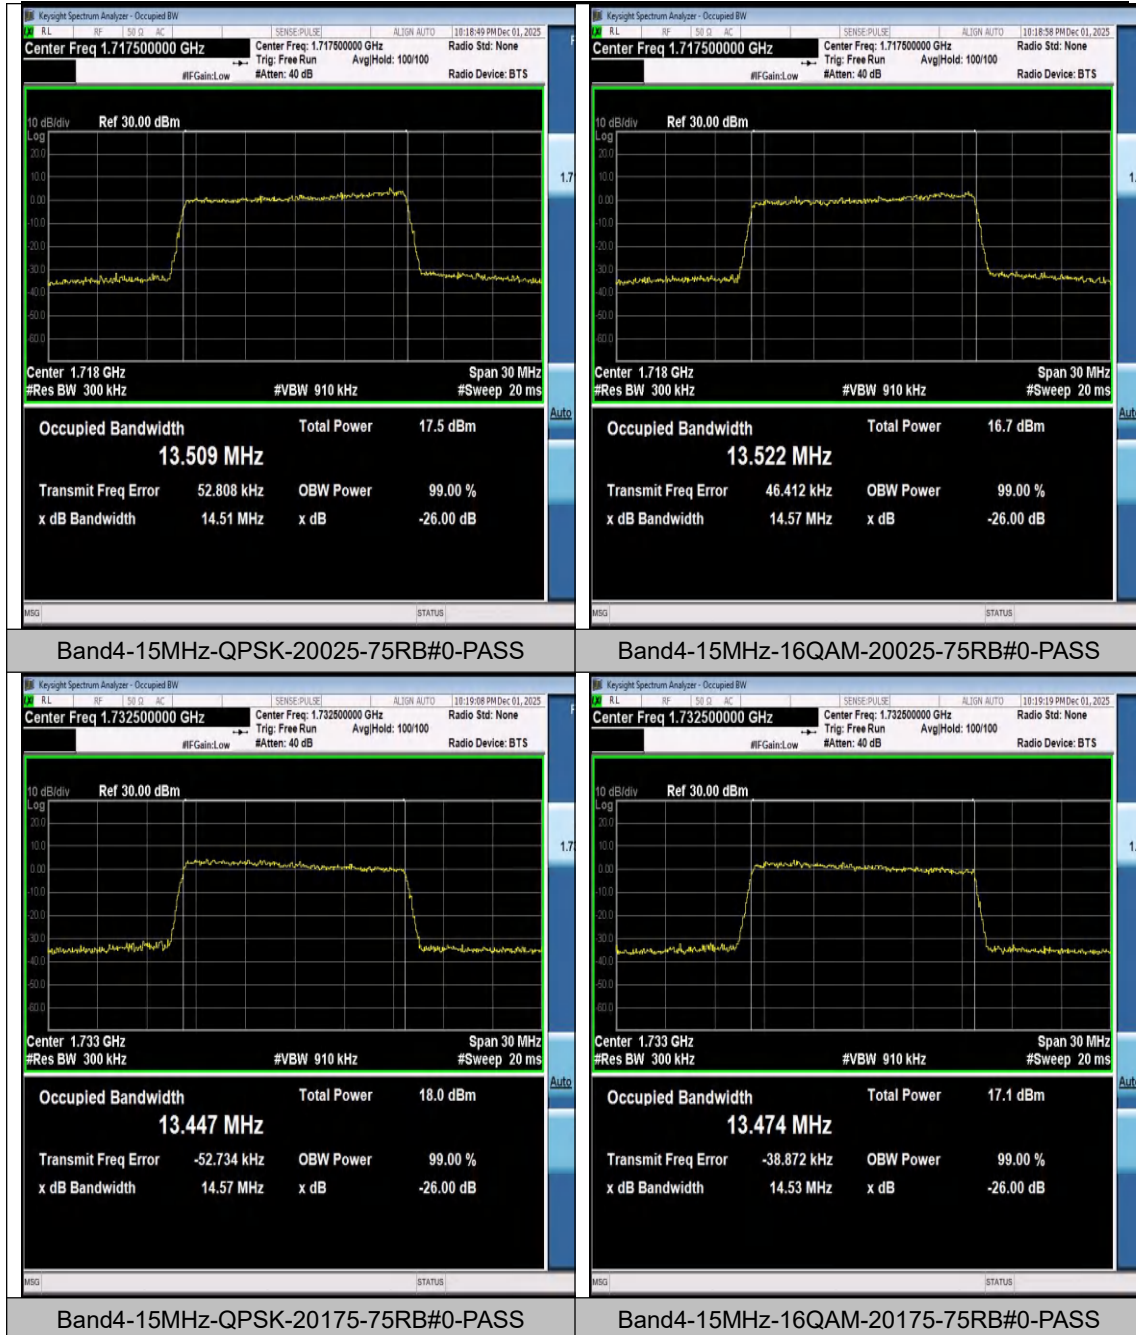

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

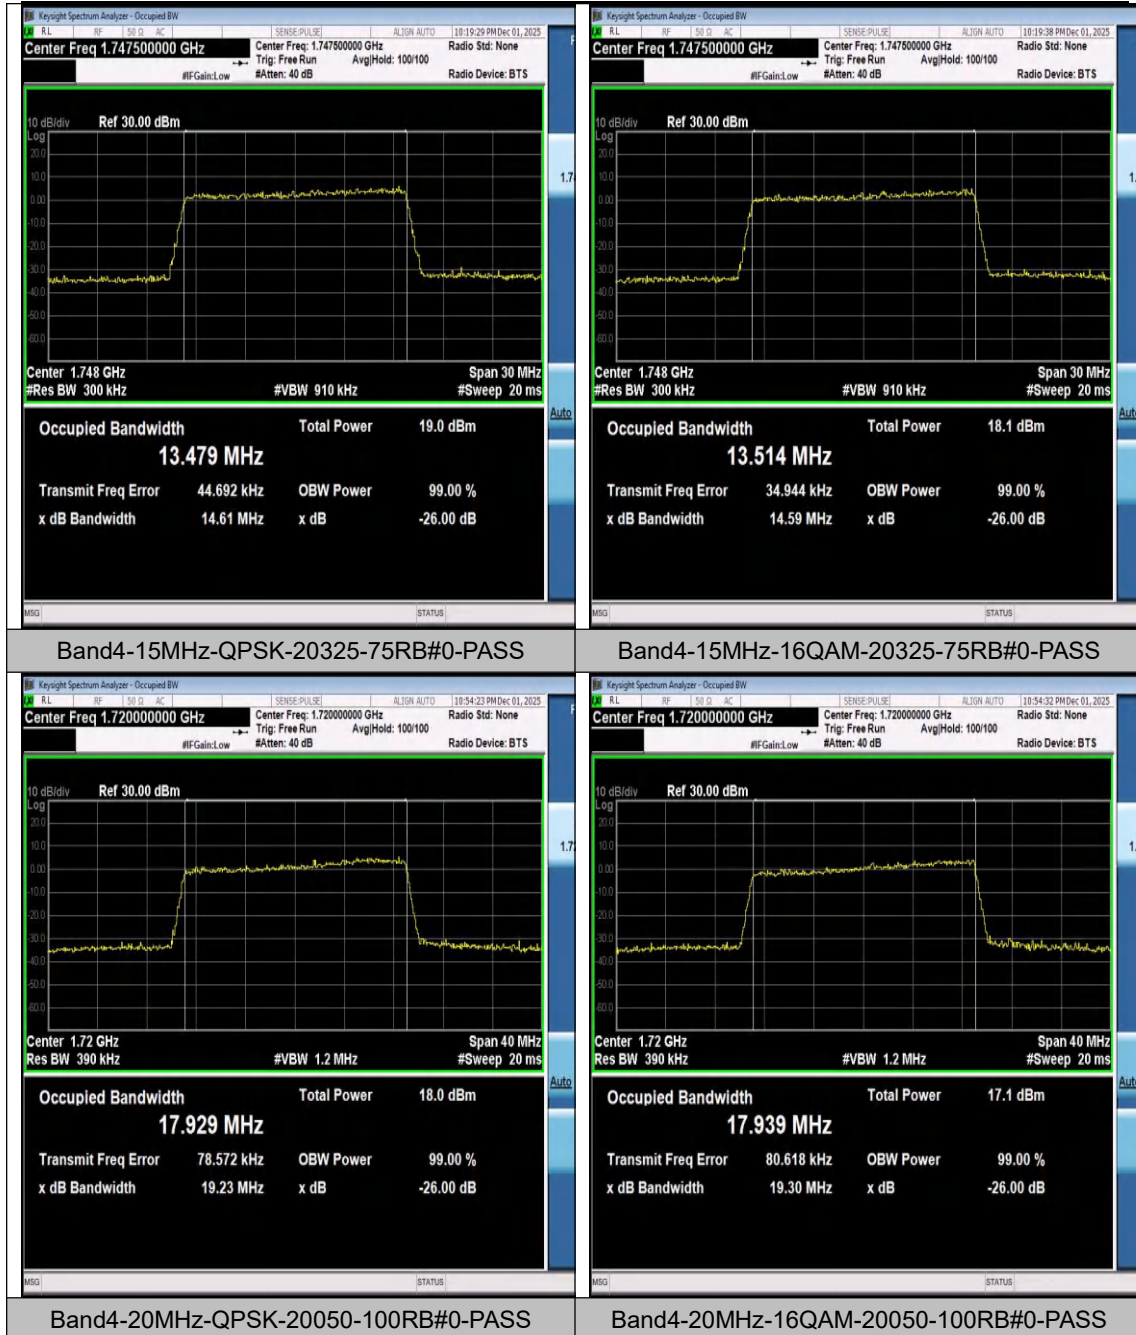

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com