



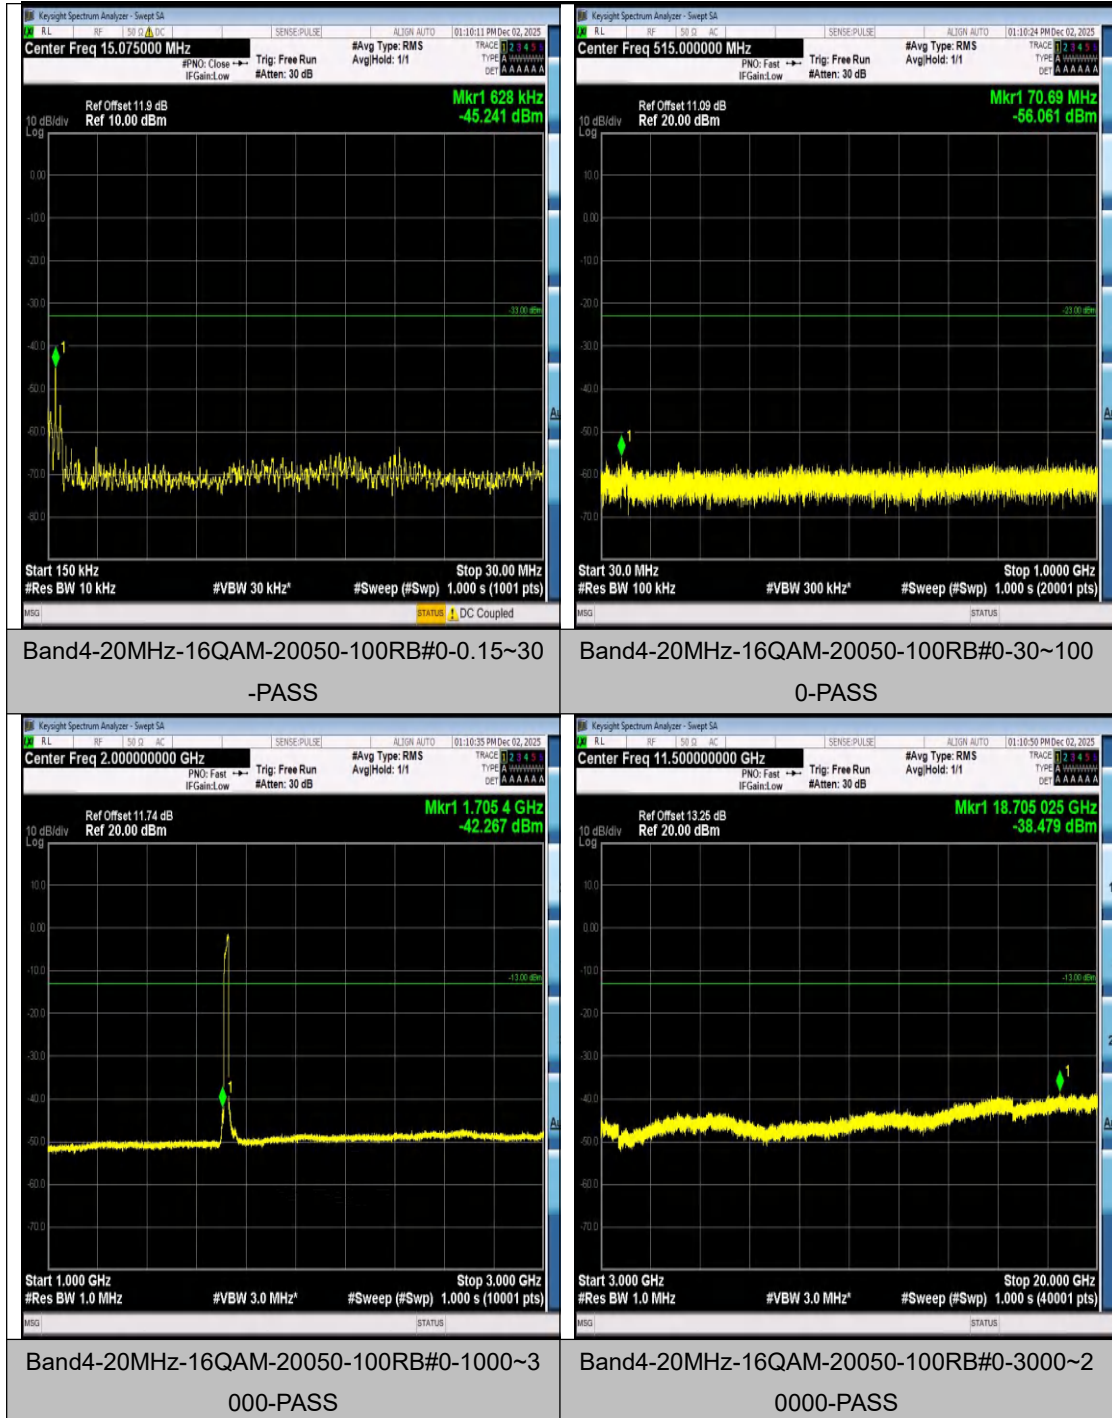

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

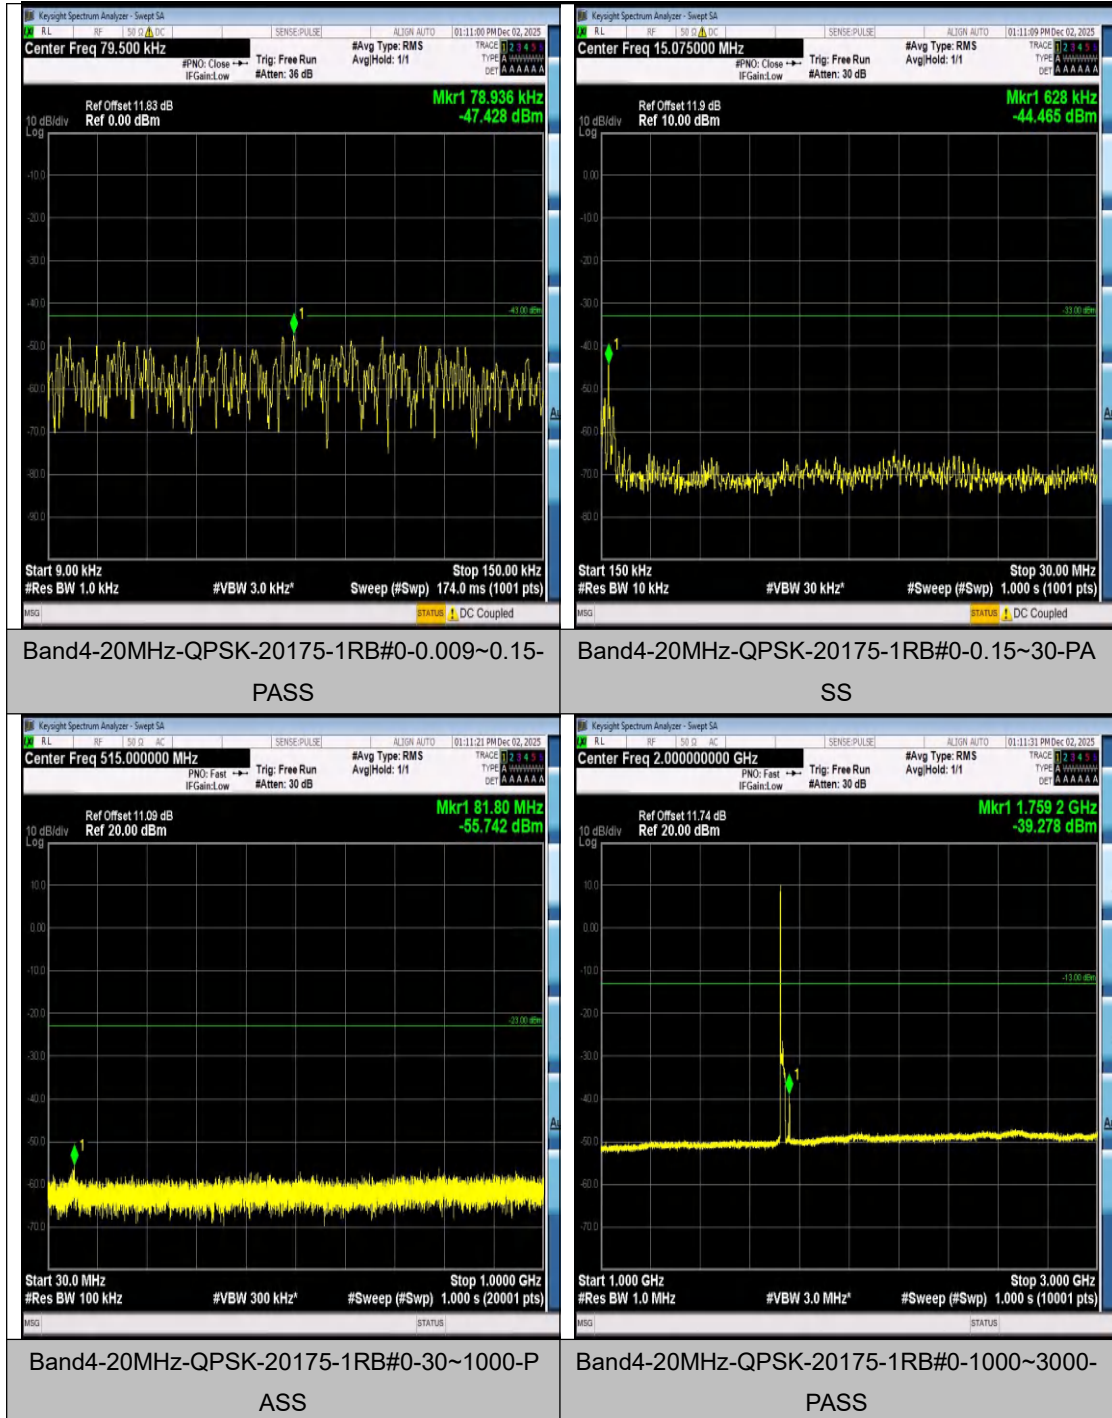

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

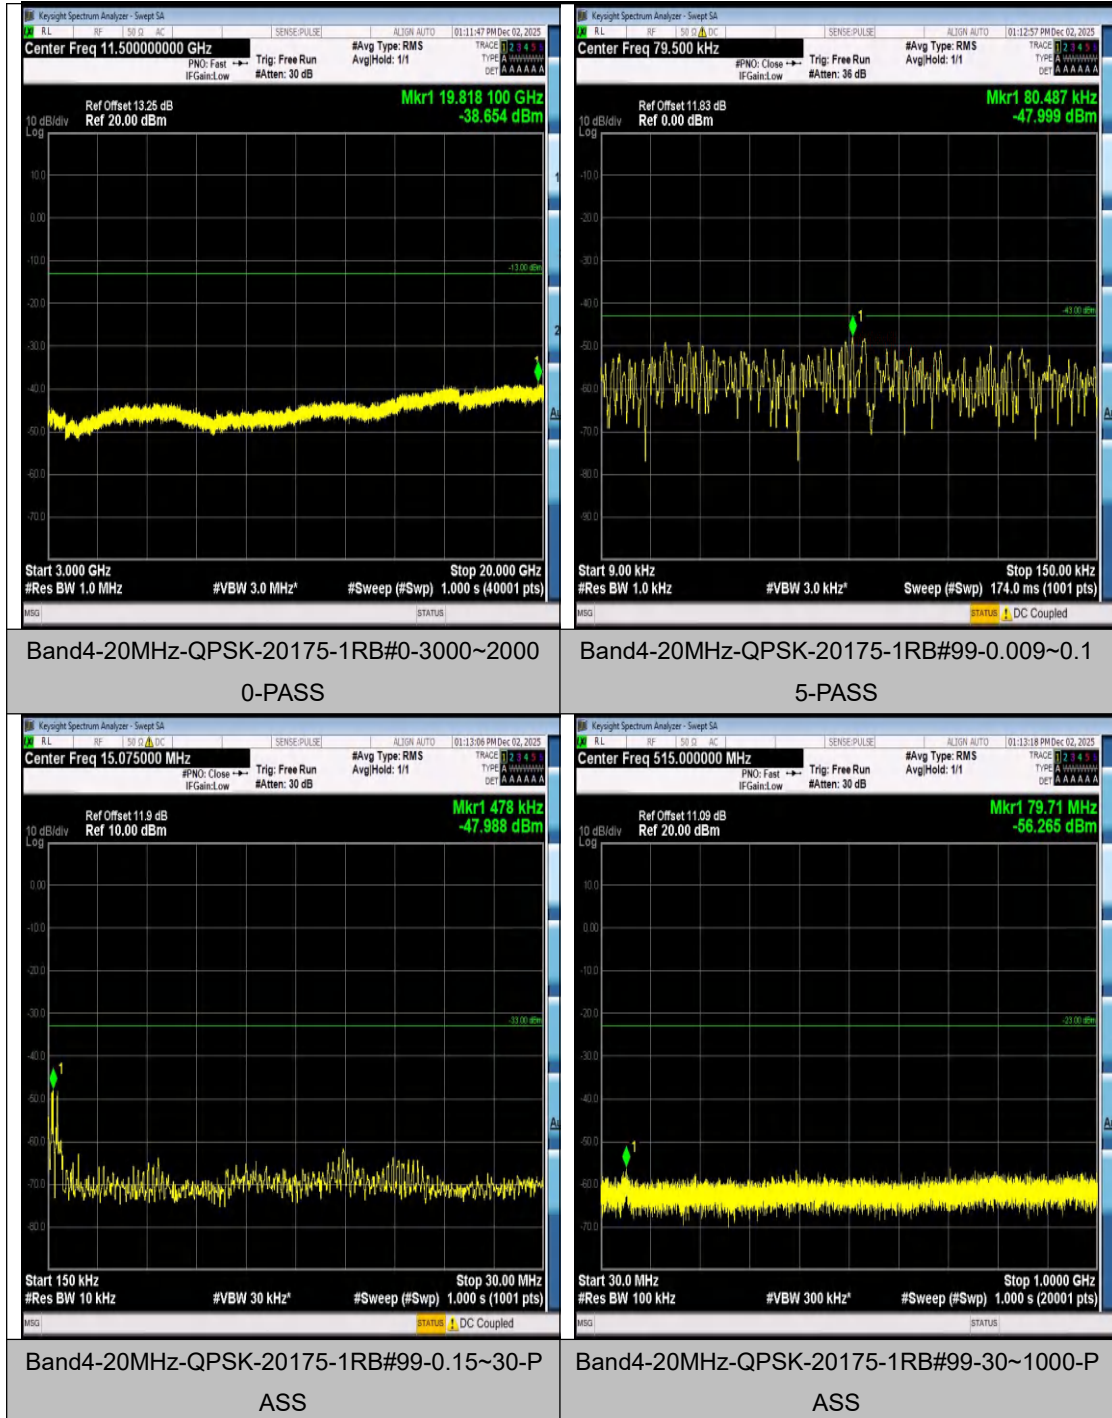

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

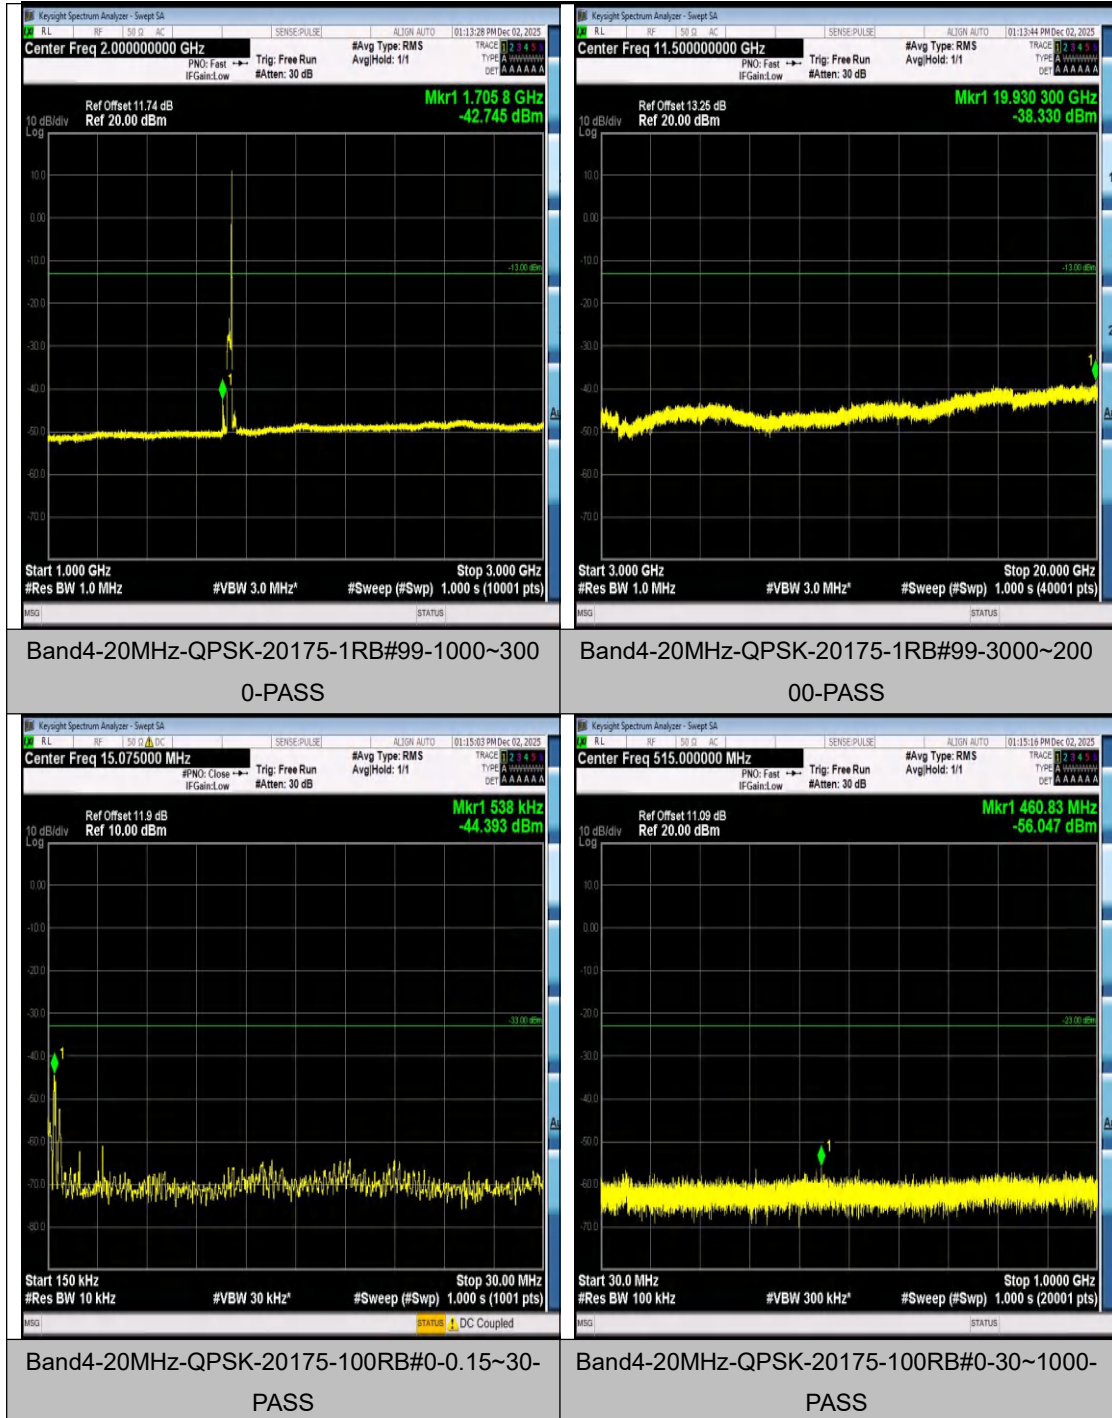

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

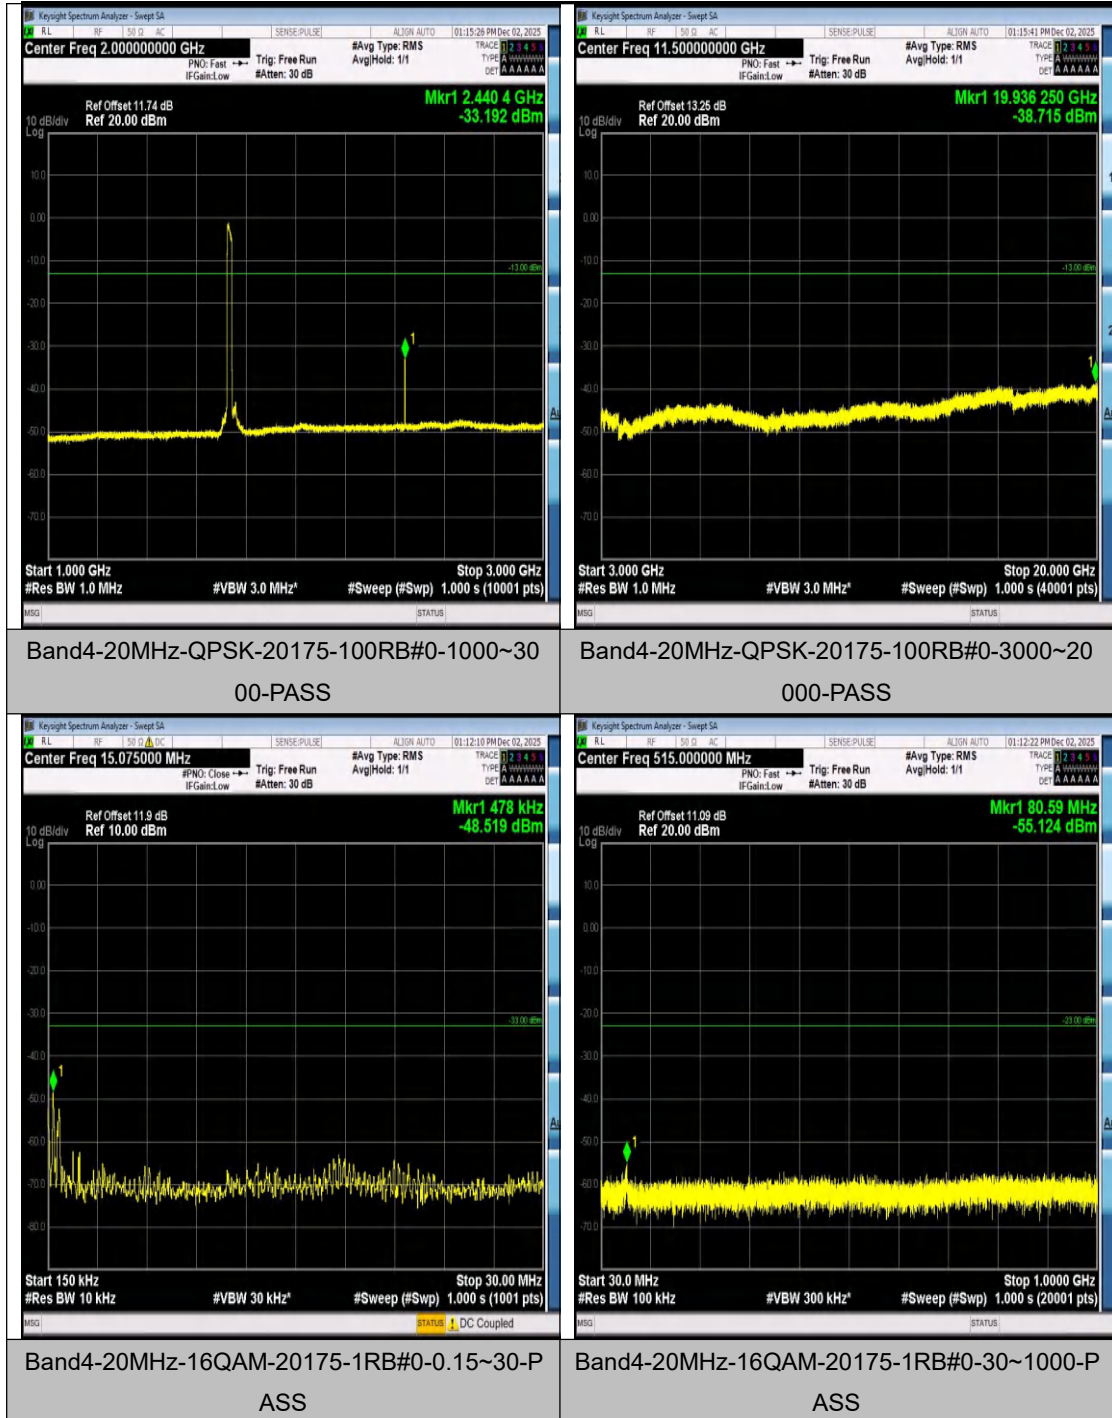

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

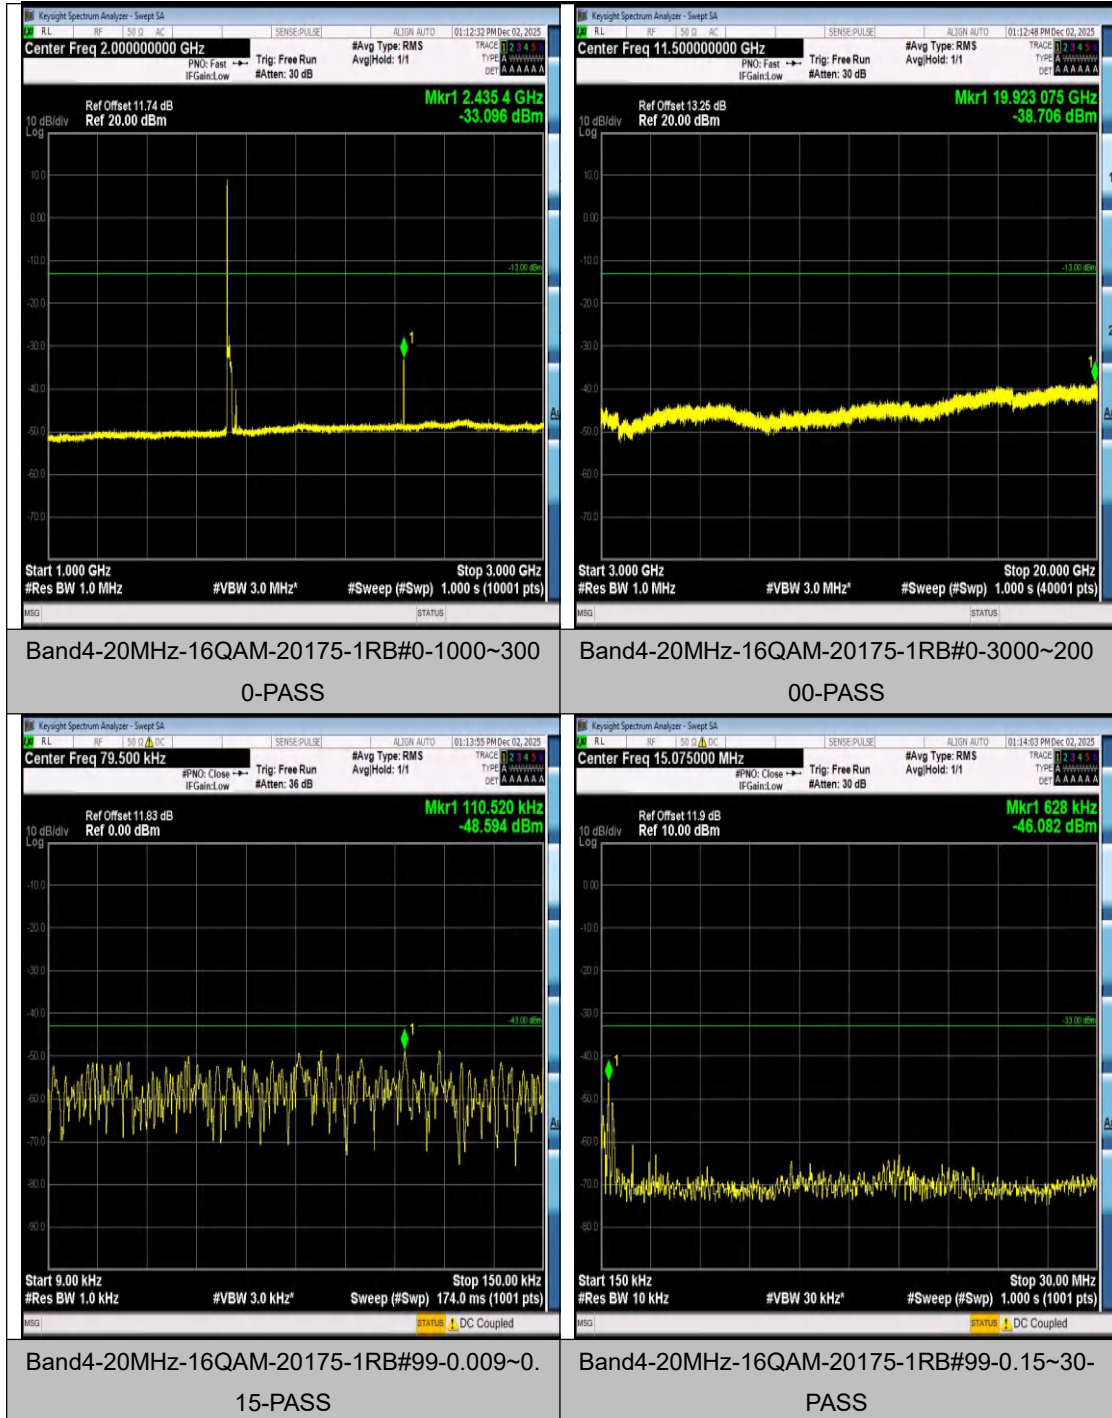

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

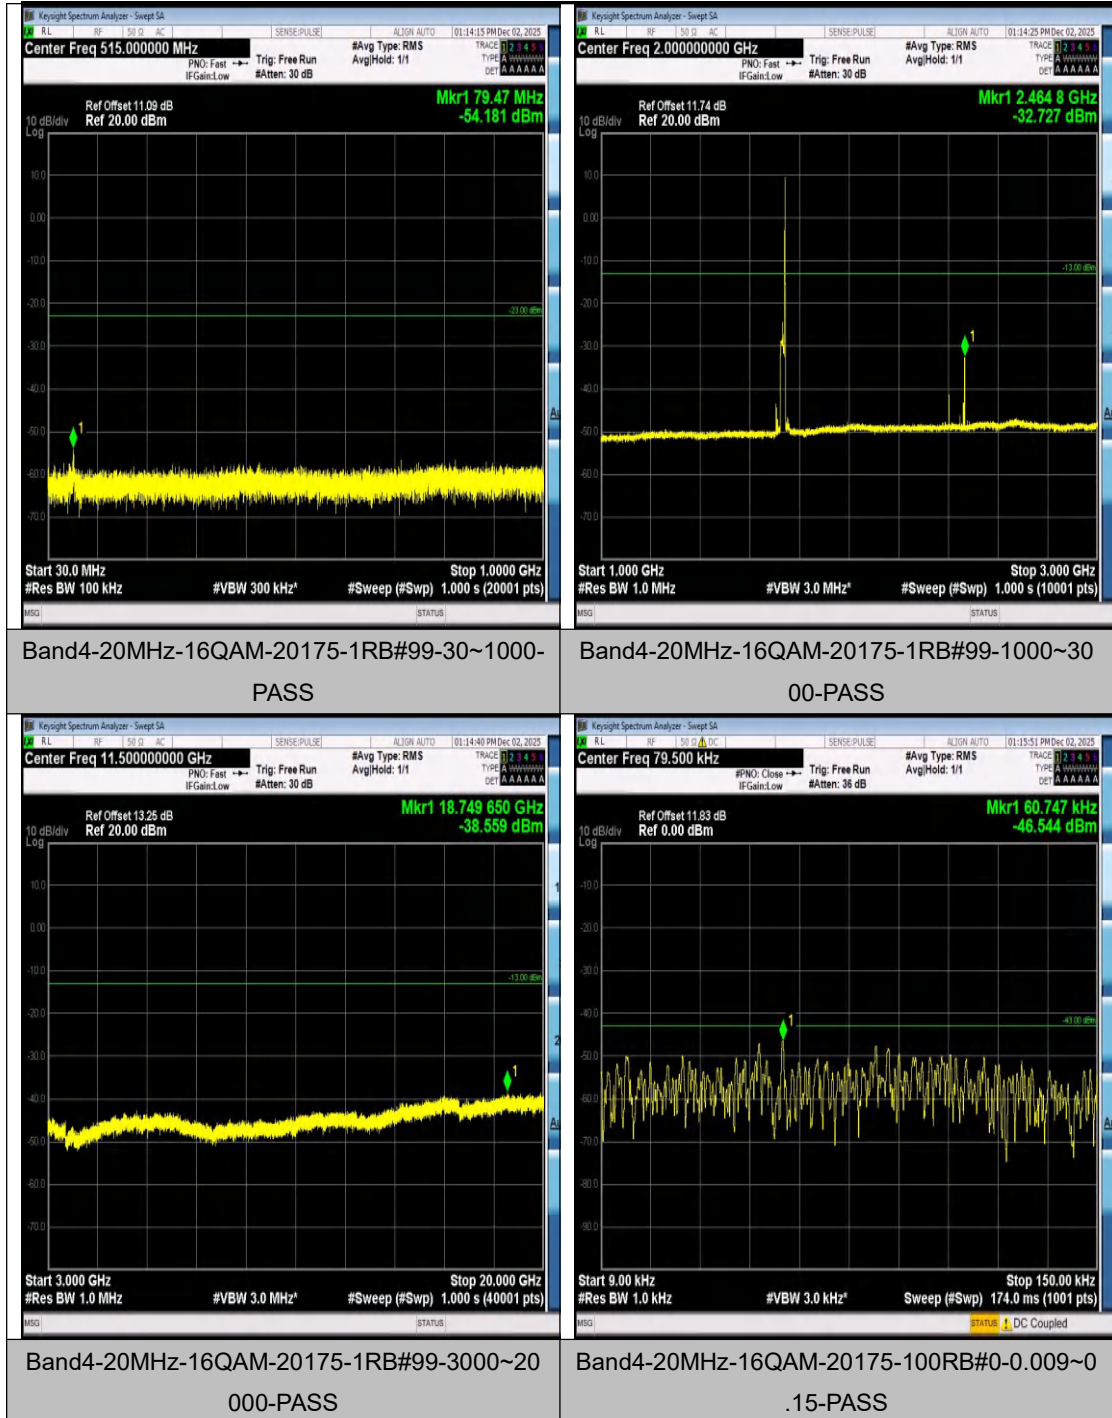

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

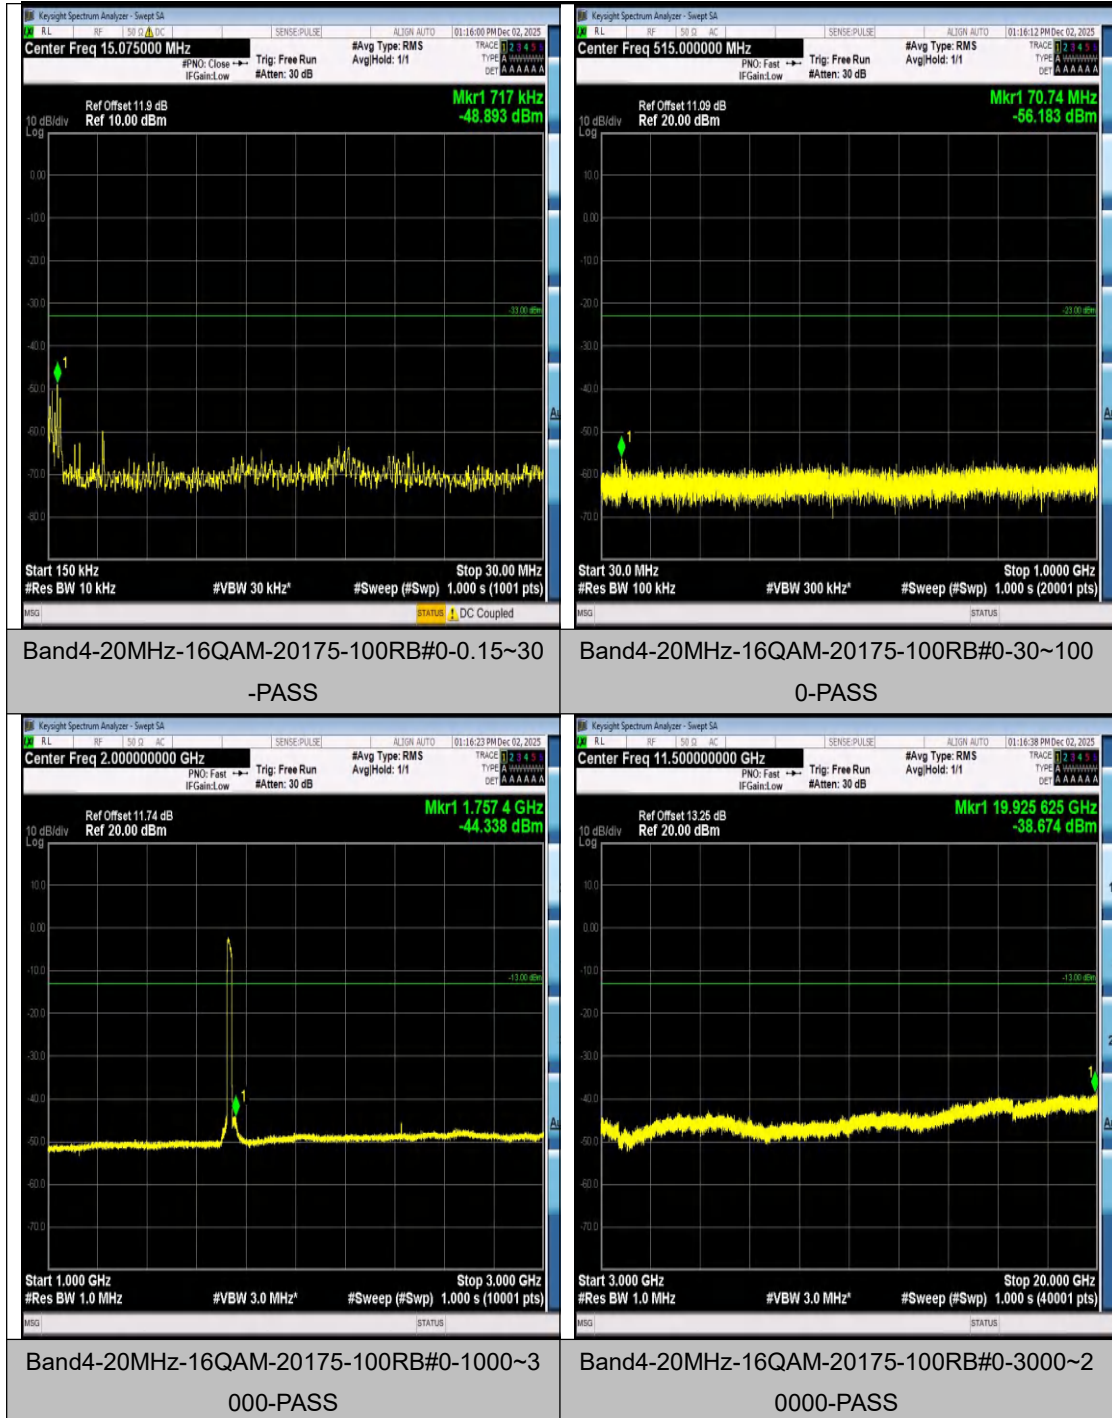

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

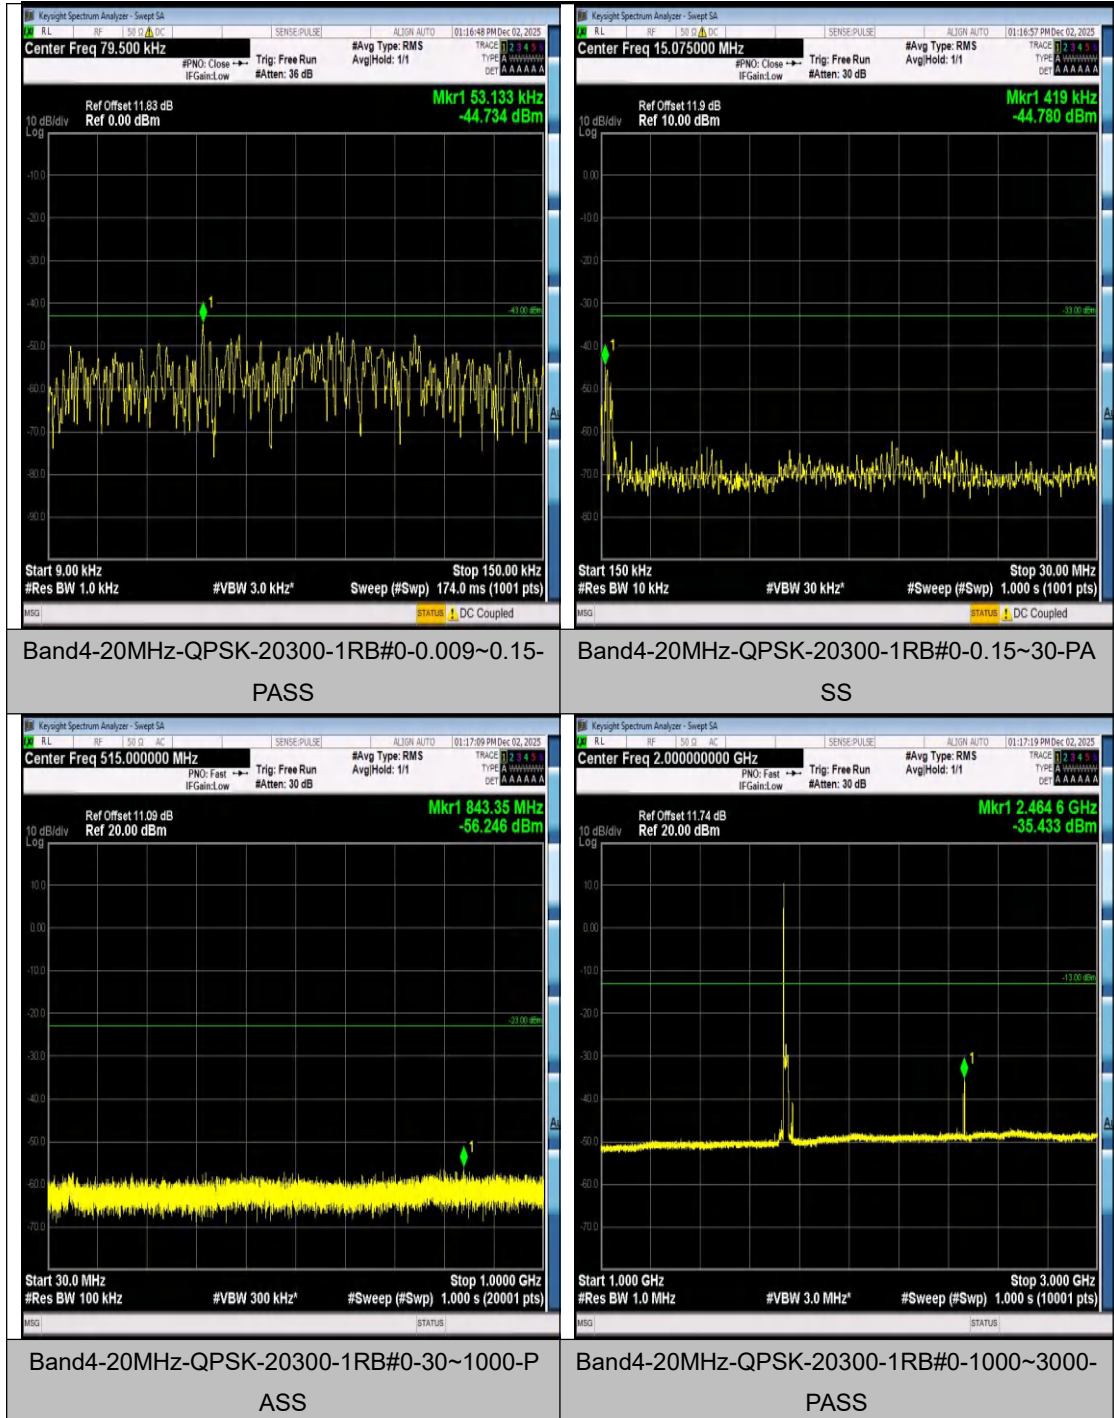

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

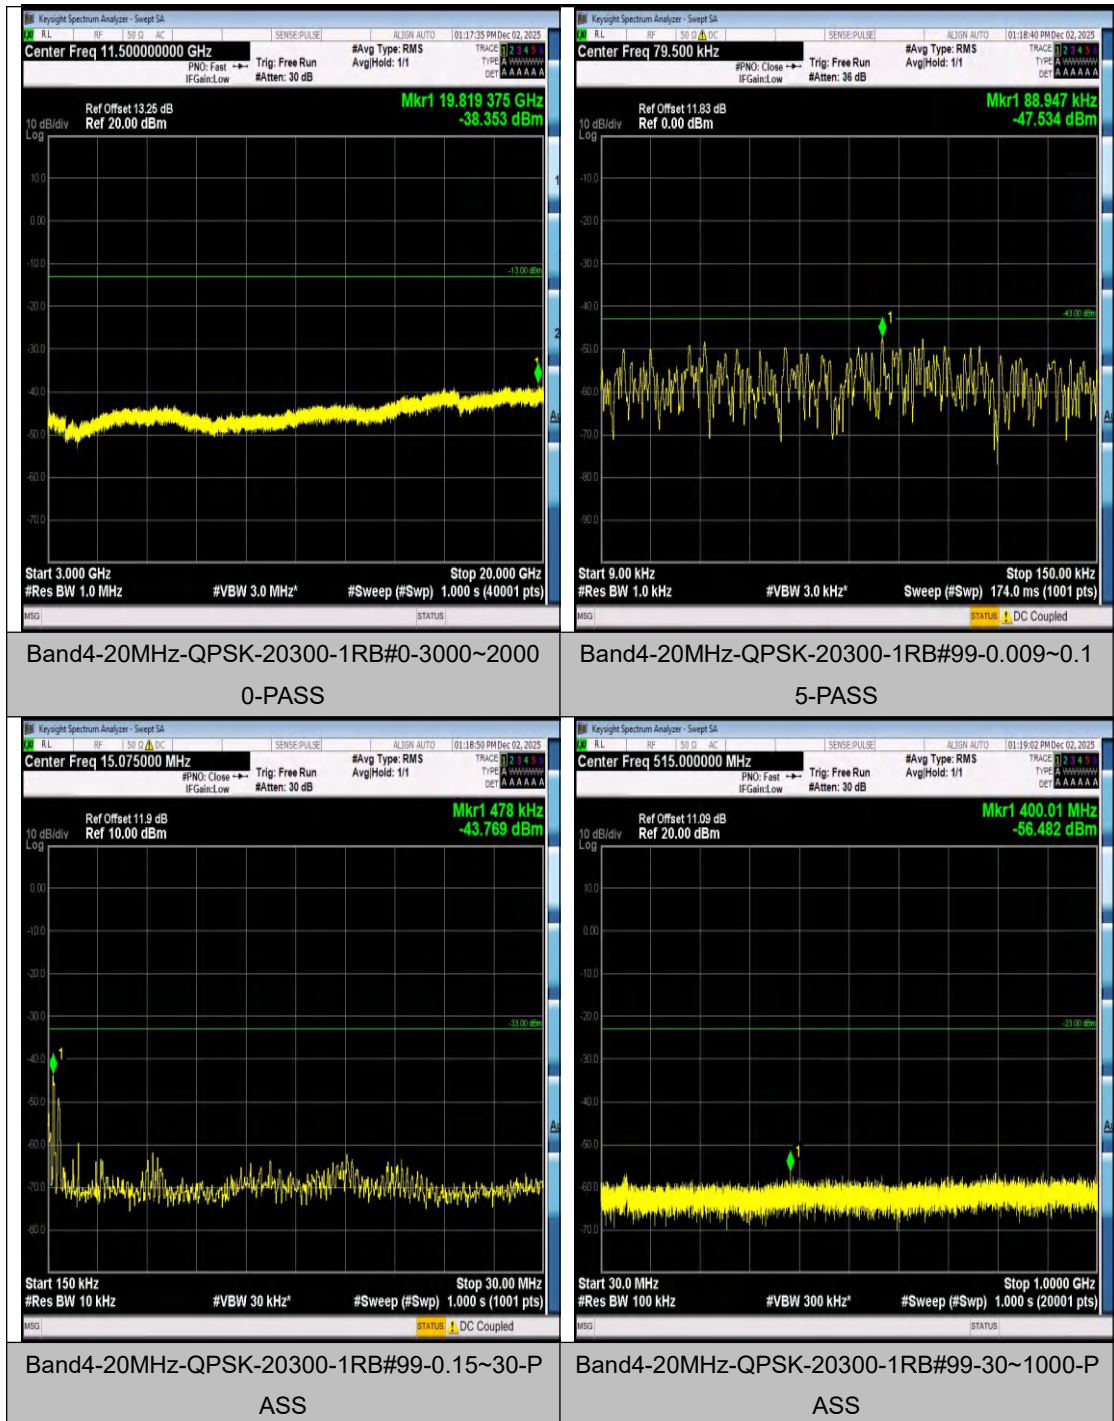

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

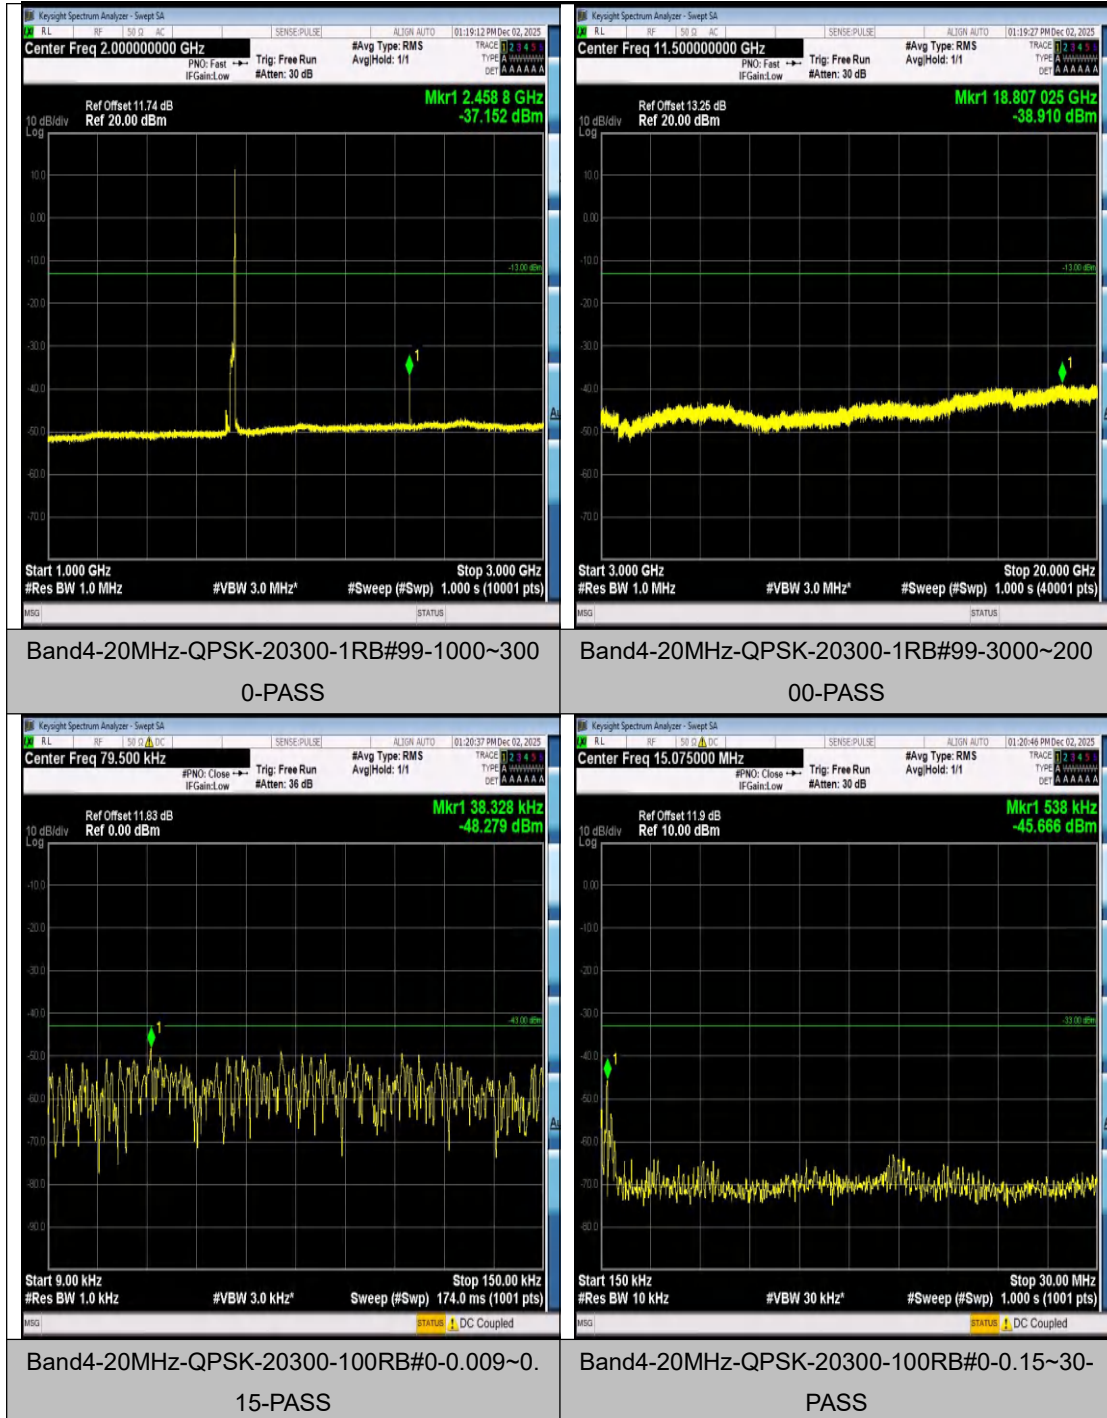

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

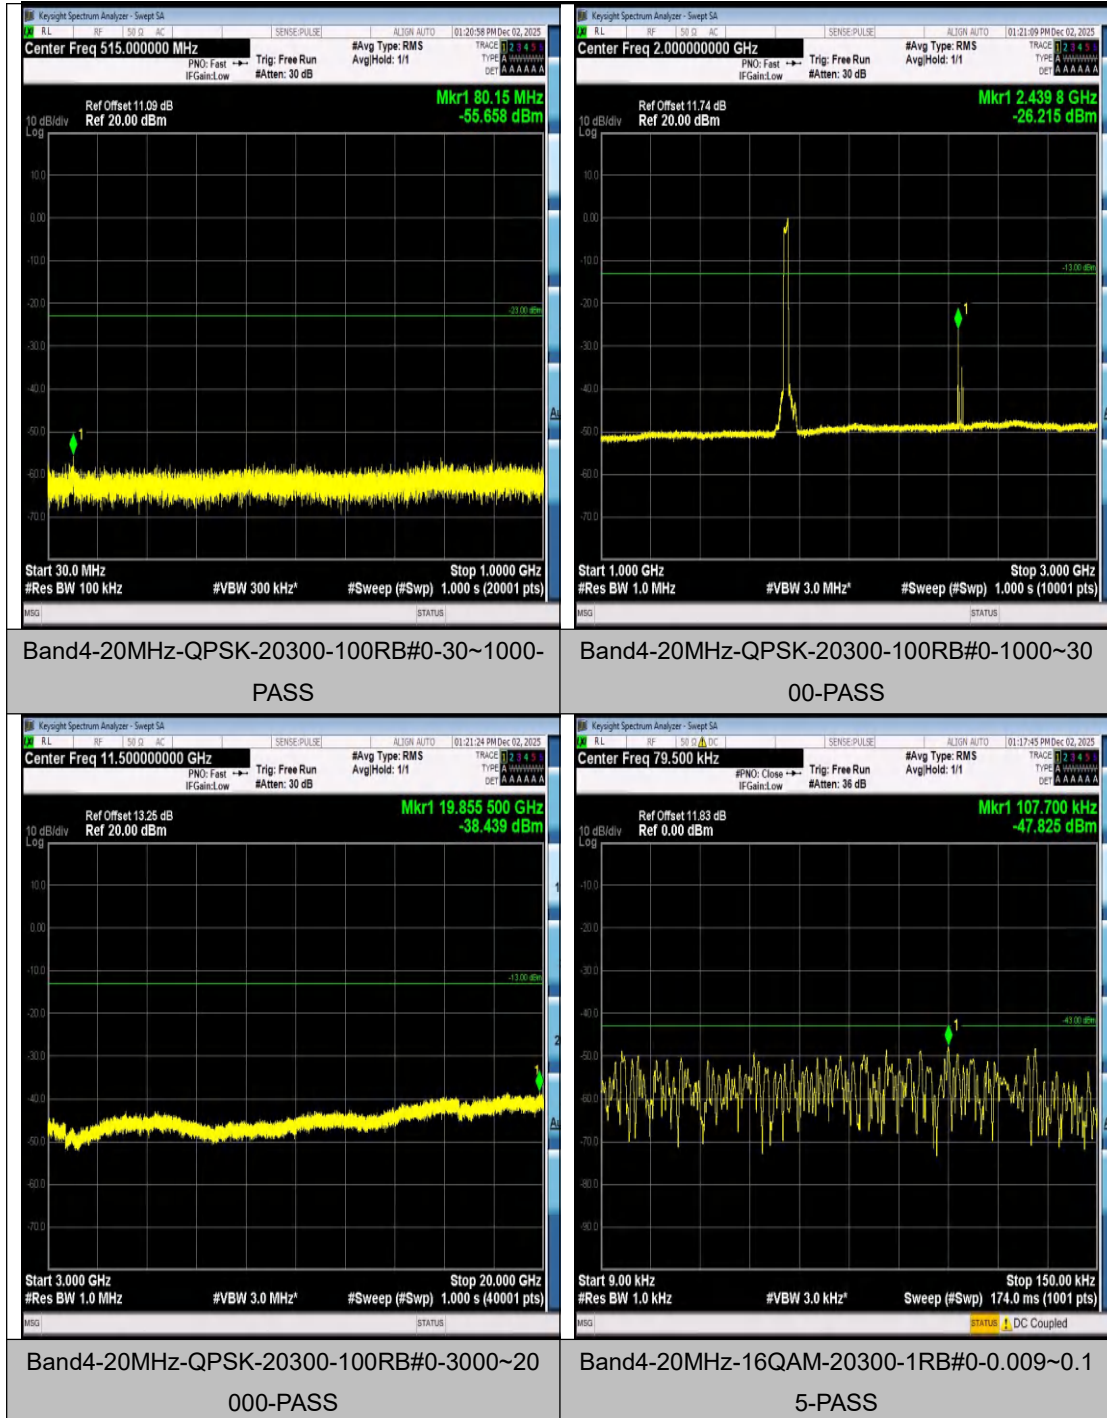

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

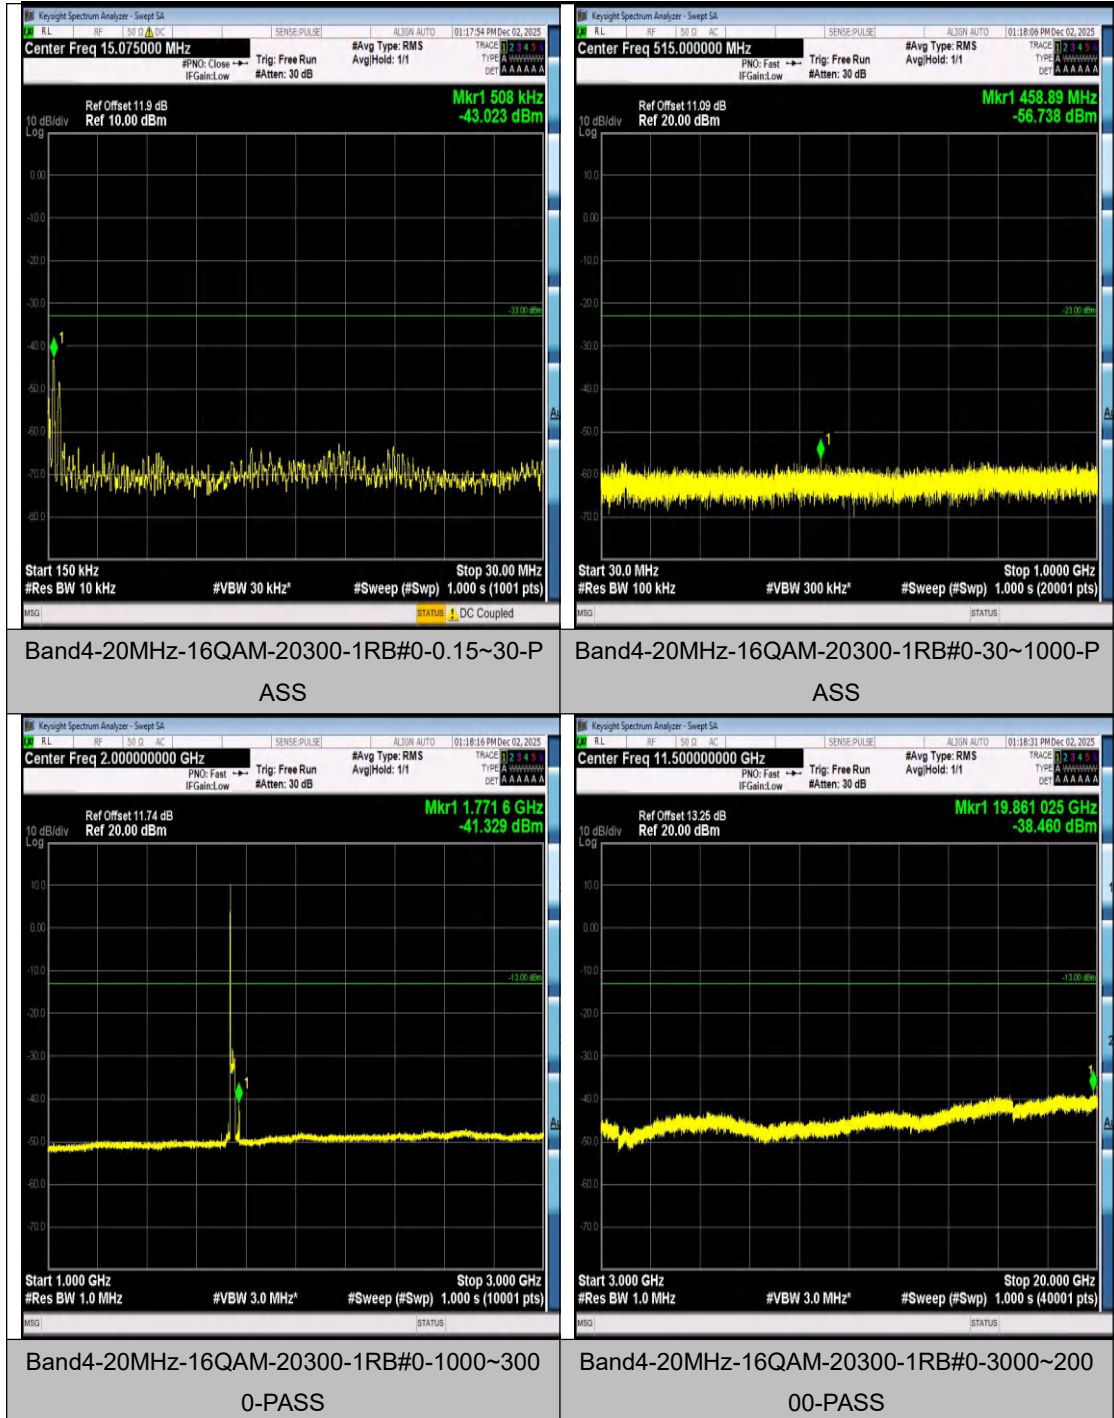

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

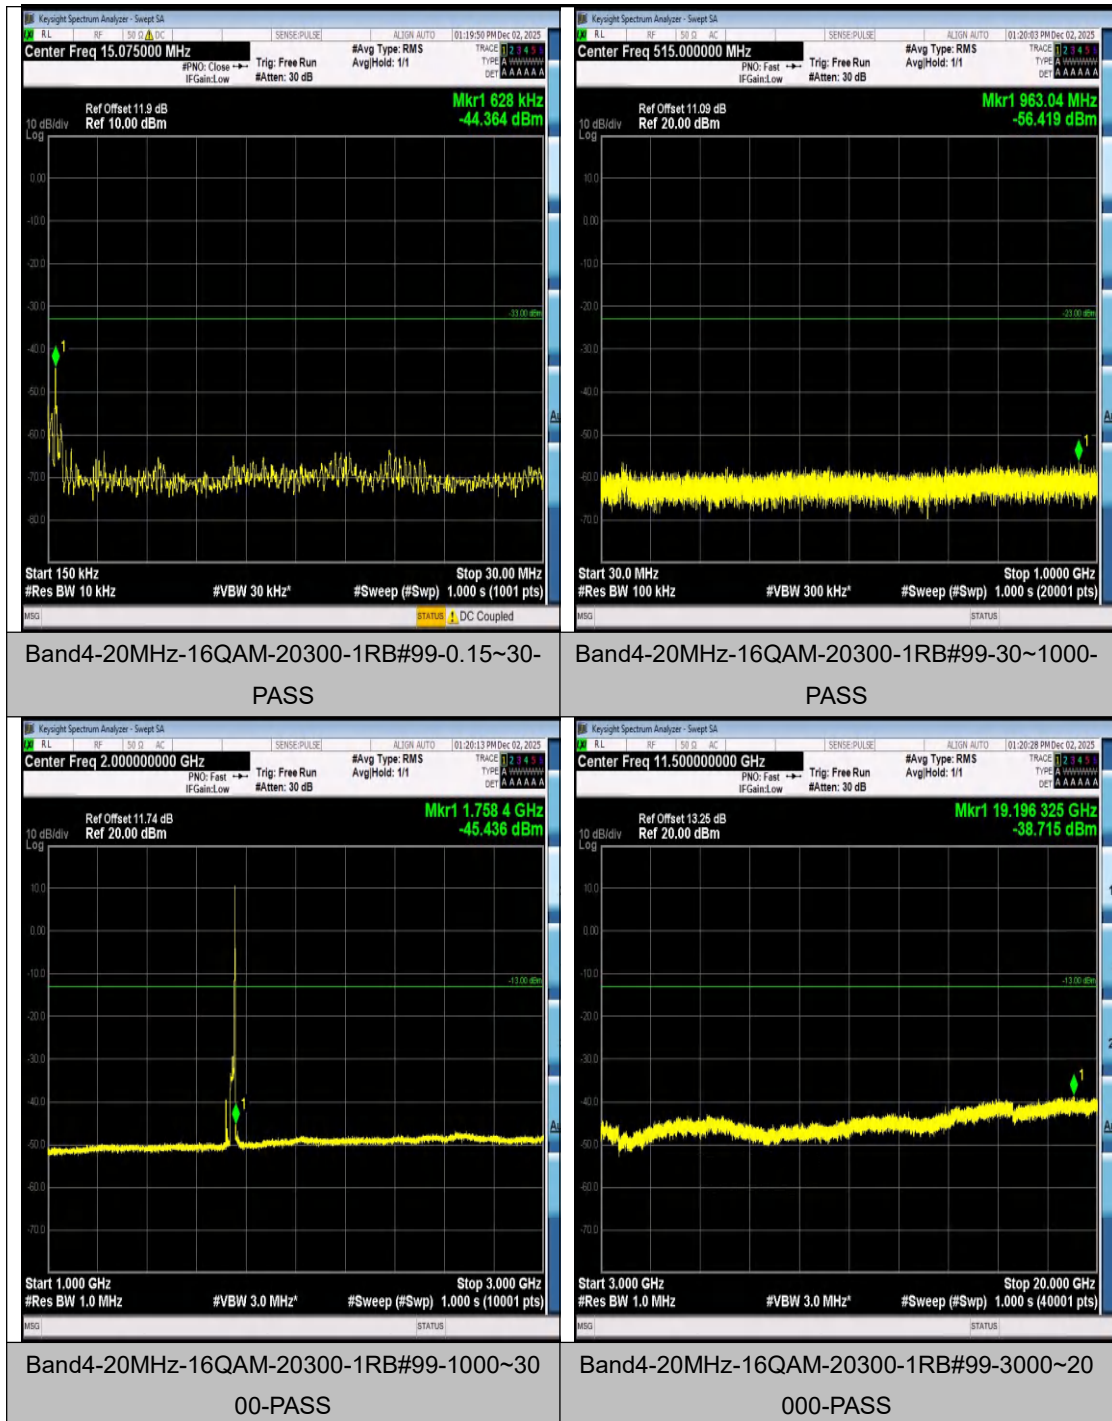

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

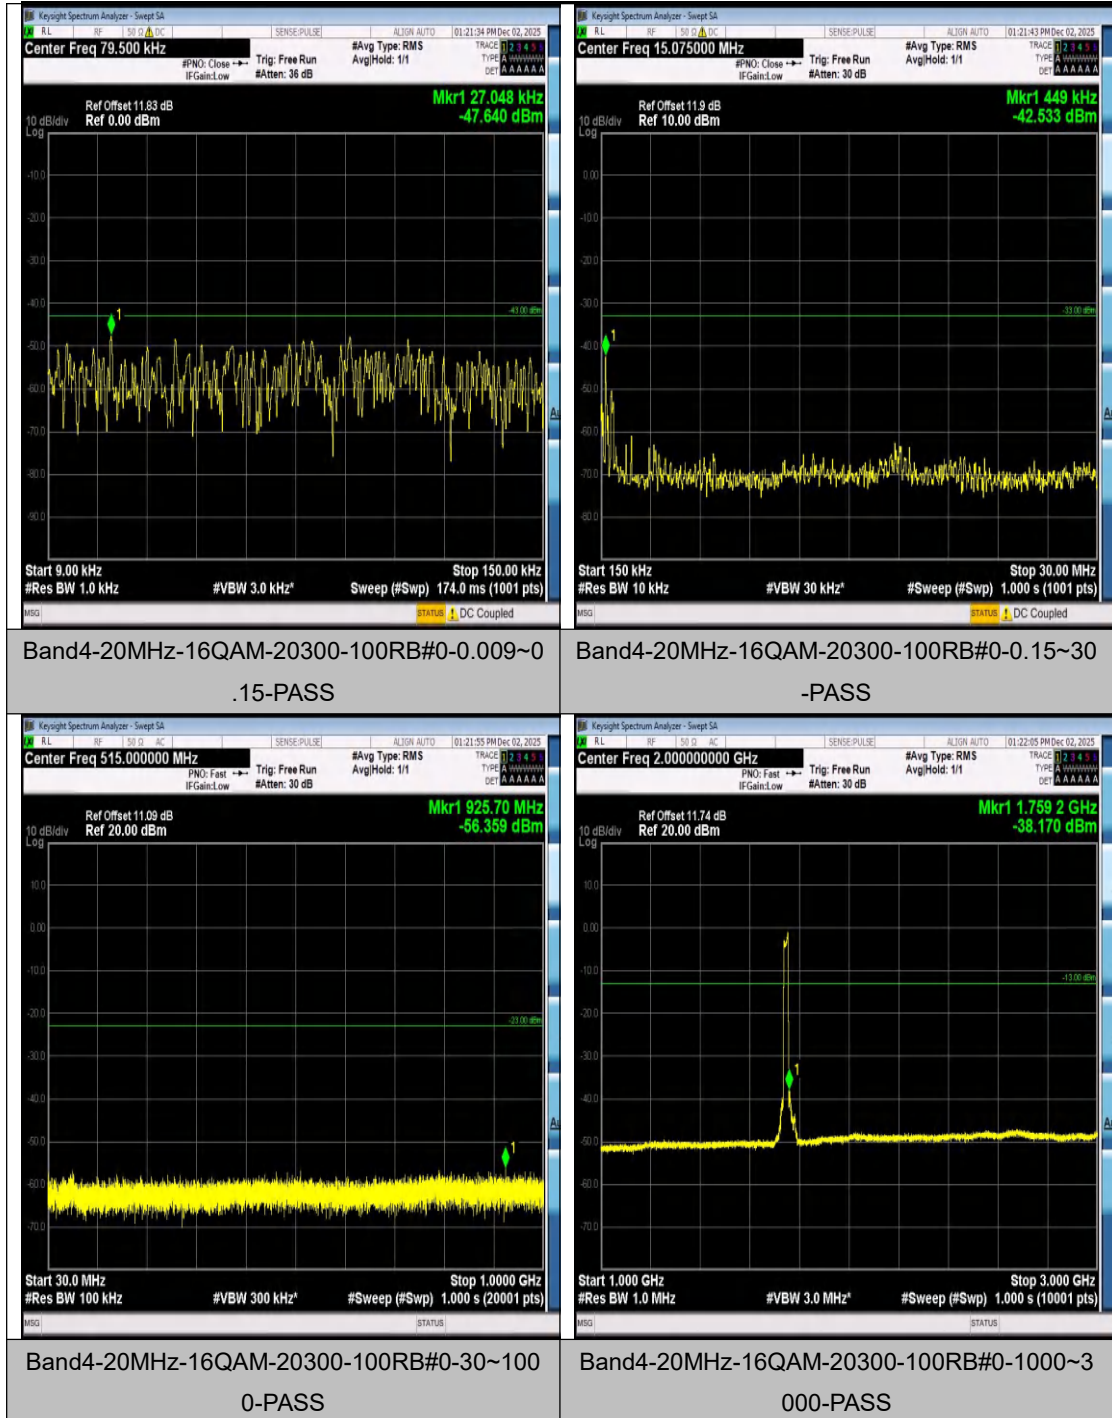

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

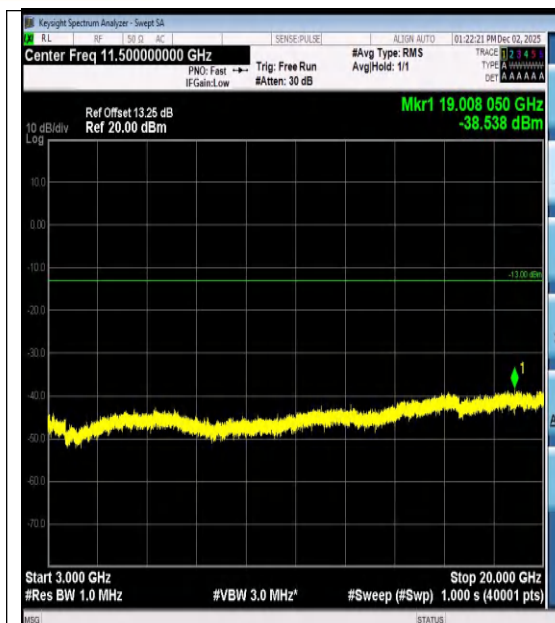

Band4-20MHz-16QAM-20300-100RB#0-3000~2
0000-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band4	1.4MHz	QPSK	19957	6RB#0	VN	NT	1710.15779	1711.23619	1710-1755	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VL	NT	1710.15748	1711.23758	1710-1755	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	VH	NT	1710.15666	1711.23716	1710-1755	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VN	NT	1710.16001	1711.23771	1710-1755	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VL	NT	1710.15598	1711.23818	1710-1755	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	VH	NT	1710.15537	1711.23747	1710-1755	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	1731.95872	1733.03742	1710-1755	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	1731.95847	1733.03627	1710-1755	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	1731.95902	1733.03652	1710-1755	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VN	NT	1731.95862	1733.03892	1710-1755	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VL	NT	1731.95589	1733.03869	1710-1755	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	VH	NT	1731.95614	1733.03904	1710-1755	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VN	NT	1753.75878	1754.83728	1710-1755	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VL	NT	1753.75766	1754.83546	1710-1755	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	VH	NT	1753.75828	1754.83798	1710-1755	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VN	NT	1753.75972	1754.83892	1710-1755	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VL	NT	1753.75774	1754.83854	1710-1755	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	VH	NT	1753.76	1754.83	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							072	922	55	
Band4	3MHz	QPSK	19965	15RB#0	VN	NT	1710.16 105	1712.84 225	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	VL	NT	1710.15 985	1712.83 915	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	VH	NT	1710.16 206	1712.83 626	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	VN	NT	1710.16 232	1712.83 562	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	VL	NT	1710.16 063	1712.83 113	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	VH	NT	1710.16 204	1712.83 234	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	1731.16 268	1733.83 498	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	1731.16 011	1733.83 811	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	1731.16 201	1733.83 961	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	VN	NT	1731.16 094	1733.83 294	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	VL	NT	1731.16 045	1733.83 105	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	VH	NT	1731.16 075	1733.83 235	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	VN	NT	1752.16 162	1754.84 042	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	VL	NT	1752.16 304	1754.84 174	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	VH	NT	1752.16 322	1754.84 172	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	VN	NT	1752.16 372	1754.83 492	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	VL	NT	1752.16 42	1754.83 66	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	VH	NT	1752.16 405	1754.83 845	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	VN	NT	1710.25 66	1714.72 98	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	VL	NT	1710.26 012	1714.73 132	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	VH	NT	1710.25	1714.73	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							888	288	55	
Band4	5MHz	16QAM	19975	25RB#0	VN	NT	1710.25 894	1714.73 204	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	VL	NT	1710.26 137	1714.73 517	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	VH	NT	1710.26 067	1714.73 487	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	1730.25 263	1734.72 753	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	1730.25 343	1734.72 403	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	1730.25 072	1734.72 752	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	VN	NT	1730.25 485	1734.72 825	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	VL	NT	1730.25 629	1734.72 599	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	VH	NT	1730.25 81	1734.72 77	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	VN	NT	1750.27 358	1754.74 078	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	VL	NT	1750.27 544	1754.74 344	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	VH	NT	1750.27 429	1754.74 189	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	VN	NT	1750.27 27	1754.74 42	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	VL	NT	1750.27 404	1754.74 124	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	VH	NT	1750.27 126	1754.74 196	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	VN	NT	1710.53 935	1719.47 695	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	VL	NT	1710.53 626	1719.47 356	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	VH	NT	1710.53 904	1719.47 424	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	VN	NT	1710.54 439	1719.48 369	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	VL	NT	1710.54 147	1719.48 527	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	VH	NT	1710.53	1719.48	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							92	08	55	
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	1728.01 919	1736.95 079	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	1728.01 873	1736.94 923	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	1728.01 099	1736.94 449	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	VN	NT	1728.01 538	1736.94 368	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	VL	NT	1728.01 809	1736.94 049	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	VH	NT	1728.01 844	1736.93 974	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	VN	NT	1745.55 402	1754.47 442	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	VL	NT	1745.55 881	1754.47 751	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	VH	NT	1745.55 813	1754.48 043	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	VN	NT	1745.55 078	1754.47 788	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	VL	NT	1745.53 844	1754.47 894	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	VH	NT	1745.55 512	1754.47 902	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	VN	NT	1710.81 365	1724.24 865	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	VL	NT	1710.81 492	1724.24 192	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	VH	NT	1710.82 258	1724.24 958	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	VN	NT	1710.81 758	1724.24 358	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	VL	NT	1710.81 512	1724.25 212	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	VH	NT	1710.81 043	1724.24 843	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	1725.77 408	1739.16 208	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	1725.77 005	1739.16 005	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	1725.77	1739.15	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							163	563	55	
Band4	15MHz	16QAM	20175	75RB#0	VN	NT	1725.77 79	1739.14 89	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	VL	NT	1725.77 75	1739.15 95	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	VH	NT	1725.78 997	1739.14 897	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	VN	NT	1740.83 089	1754.23 689	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	VL	NT	1740.82 44	1754.25 04	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	VH	NT	1740.82 384	1754.23 884	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	VN	NT	1740.83 906	1754.24 706	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	VL	NT	1740.83 292	1754.23 492	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	VH	NT	1740.83 036	1754.24 336	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	VN	NT	1711.11 644	1728.99 744	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	VL	NT	1711.11 901	1728.97 201	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	VH	NT	1711.12 928	1728.97 328	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	VN	NT	1711.14 227	1729.00 127	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	VL	NT	1711.13 708	1728.98 308	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	VH	NT	1711.14 804	1728.98 704	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	VN	NT	1723.55 776	1741.34 776	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	VL	NT	1723.54 789	1741.35 889	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	VH	NT	1723.57 001	1741.35 801	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	VN	NT	1723.58 952	1741.34 852	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	VL	NT	1723.57 45	1741.33 85	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB#	VH	NT	1723.57	1741.33	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

				0			639	739	55	
Band4	20MHz	QPSK	20300	100RB# 0	VN	NT	1736.06 361	1753.98 261	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	VL	NT	1736.05 429	1753.97 929	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	VH	NT	1736.07 198	1753.98 898	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	VN	NT	1736.09 892	1753.98 792	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	VL	NT	1736.08 517	1754.00 417	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	VH	NT	1736.08 703	1753.99 503	1710-17 55	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-30	1710.15 865	1711.23 775	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-20	1710.15 769	1711.23 629	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	-10	1710.15 682	1711.23 822	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	0	1710.15 71	1711.23 53	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	10	1710.15 733	1711.23 743	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	20	1710.15 645	1711.23 745	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	30	1710.15 82	1711.23 75	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	40	1710.15 773	1711.23 623	1710-17 55	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	NV	50	1710.15 655	1711.23 815	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-30	1710.15 7	1711.23 73	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-20	1710.15 563	1711.23 723	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	-10	1710.15 619	1711.23 819	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	0	1710.15	1711.23	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							749	699	55	
Band4	1.4MHz	16QAM	19957	6RB#0	NV	10	1710.15 598	1711.23 838	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	20	1710.15 868	1711.23 818	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	30	1710.15 605	1711.23 705	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	40	1710.15 775	1711.23 915	1710-17 55	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	NV	50	1710.15 557	1711.23 857	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	1731.95 632	1733.03 762	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	1731.95 628	1733.03 708	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-10	1731.95 804	1733.03 724	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	1731.95 87	1733.03 48	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	1731.95 992	1733.03 842	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	1731.95 924	1733.03 754	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	30	1731.95 672	1733.03 662	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	40	1731.95 902	1733.03 772	1710-17 55	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	50	1731.95 572	1733.03 712	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-30	1731.95 612	1733.03 742	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-20	1731.95 684	1733.03 844	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	-10	1731.95 611	1733.03 671	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	0	1731.95 662	1733.03 852	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	10	1731.95 568	1733.03 708	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	20	1731.95 792	1733.03 702	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	30	1731.95	1733.03	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							628	628	55	
Band4	1.4MHz	16QAM	20175	6RB#0	NV	40	1731.95 603	1733.03 843	1710-17 55	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	NV	50	1731.95 783	1733.03 733	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-30	1753.75 757	1754.83 887	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-20	1753.75 779	1754.83 779	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	-10	1753.75 757	1754.83 657	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	0	1753.75 687	1754.83 887	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	10	1753.75 797	1754.83 637	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	20	1753.75 805	1754.83 895	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	30	1753.75 848	1754.83 608	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	40	1753.75 977	1754.83 927	1710-17 55	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	NV	50	1753.75 726	1754.83 886	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-30	1753.75 583	1754.83 843	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-20	1753.75 888	1754.83 828	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	-10	1753.75 775	1754.83 885	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	0	1753.75 746	1754.83 826	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	10	1753.75 763	1754.83 903	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	20	1753.76 084	1754.83 844	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	30	1753.75 799	1754.83 829	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	40	1753.76 14	1754.83 95	1710-17 55	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	NV	50	1753.76 04	1754.83 87	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-30	1710.16	1712.83	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							032	922	55	
Band4	3MHz	QPSK	19965	15RB#0	NV	-20	1710.16 008	1712.84 018	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	-10	1710.16 181	1712.83 731	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	0	1710.16 131	1712.83 671	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	10	1710.16 208	1712.83 498	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	20	1710.16 354	1712.84 344	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	30	1710.16 25	1712.83 97	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	40	1710.16 472	1712.83 582	1710-17 55	PASS
Band4	3MHz	QPSK	19965	15RB#0	NV	50	1710.16 037	1712.84 197	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-30	1710.16 366	1712.83 236	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-20	1710.16 258	1712.83 598	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	-10	1710.16 135	1712.83 195	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	0	1710.16 154	1712.82 984	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	10	1710.16 132	1712.83 722	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	20	1710.16 095	1712.83 445	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	30	1710.16 216	1712.82 966	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	40	1710.16 38	1712.83 46	1710-17 55	PASS
Band4	3MHz	16QAM	19965	15RB#0	NV	50	1710.16 167	1712.83 437	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	1731.16 108	1733.83 858	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	1731.16 116	1733.83 856	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-10	1731.16 184	1733.83 564	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	1731.16	1733.83	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							218	788	55	
Band4	3MHz	QPSK	20175	15RB#0	NV	10	1731.16 261	1733.83 931	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	1731.16 116	1733.84 206	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	30	1731.16 159	1733.83 729	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	40	1731.16 292	1733.84 152	1710-17 55	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	50	1731.16 208	1733.83 898	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-30	1731.16 166	1733.83 066	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-20	1731.16 435	1733.83 295	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	-10	1731.16 216	1733.83 226	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	0	1731.16 307	1733.83 457	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	10	1731.16 35	1733.83 29	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	20	1731.16 323	1733.83 303	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	30	1731.16 274	1733.83 344	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	40	1731.16 233	1733.83 393	1710-17 55	PASS
Band4	3MHz	16QAM	20175	15RB#0	NV	50	1731.16 213	1733.83 213	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-30	1752.16 201	1754.84 101	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-20	1752.16 176	1754.83 826	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	-10	1752.16 161	1754.83 981	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	0	1752.16 333	1754.83 903	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	10	1752.16 376	1754.83 926	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	20	1752.16 26	1754.84 07	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	30	1752.16	1754.83	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							356	926	55	
Band4	3MHz	QPSK	20385	15RB#0	NV	40	1752.16 058	1754.83 978	1710-17 55	PASS
Band4	3MHz	QPSK	20385	15RB#0	NV	50	1752.16 226	1754.84 166	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-30	1752.16 668	1754.83 618	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-20	1752.16 547	1754.83 467	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	-10	1752.16 383	1754.83 553	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	0	1752.16 356	1754.83 836	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	10	1752.16 48	1754.83 71	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	20	1752.16 295	1754.83 625	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	30	1752.16 274	1754.83 784	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	40	1752.16 378	1754.83 698	1710-17 55	PASS
Band4	3MHz	16QAM	20385	15RB#0	NV	50	1752.16 244	1754.83 844	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-30	1710.25 428	1714.73 058	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-20	1710.25 923	1714.73 023	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	-10	1710.26 293	1714.72 853	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	0	1710.25 693	1714.73 433	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	10	1710.25 937	1714.73 077	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	20	1710.25 914	1714.73 254	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	30	1710.26 039	1714.73 209	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	40	1710.25 271	1714.73 391	1710-17 55	PASS
Band4	5MHz	QPSK	19975	25RB#0	NV	50	1710.25 5	1714.73 16	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-30	1710.26	1714.73	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							039	409	55	
Band4	5MHz	16QAM	19975	25RB#0	NV	-20	1710.26 108	1714.73 408	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	-10	1710.25 935	1714.73 445	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	0	1710.25 961	1714.73 261	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	10	1710.25 975	1714.73 285	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	20	1710.26 138	1714.73 318	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	30	1710.26 008	1714.73 218	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	40	1710.26 023	1714.73 453	1710-17 55	PASS
Band4	5MHz	16QAM	19975	25RB#0	NV	50	1710.25 963	1714.73 243	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	1730.25 281	1734.72 531	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	1730.25 139	1734.72 559	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-10	1730.25 608	1734.72 358	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	1730.25 218	1734.72 618	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	1730.24 803	1734.72 553	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	1730.25 618	1734.72 538	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	30	1730.25 236	1734.72 426	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	40	1730.25 302	1734.72 732	1710-17 55	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	50	1730.25 377	1734.72 437	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-30	1730.25 318	1734.72 528	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-20	1730.25 442	1734.73 032	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	-10	1730.25 554	1734.72 584	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	0	1730.25	1734.72	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							481	321	55	
Band4	5MHz	16QAM	20175	25RB#0	NV	10	1730.25 617	1734.72 817	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	20	1730.25 533	1734.72 553	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	30	1730.25 477	1734.72 407	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	40	1730.25 465	1734.72 505	1710-17 55	PASS
Band4	5MHz	16QAM	20175	25RB#0	NV	50	1730.25 366	1734.72 706	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-30	1750.27 664	1754.74 254	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-20	1750.27 052	1754.74 172	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	-10	1750.27 215	1754.73 775	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	0	1750.26 919	1754.74 079	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	10	1750.27 511	1754.74 151	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	20	1750.27 302	1754.74 092	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	30	1750.26 871	1754.73 991	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	40	1750.27 442	1754.73 692	1710-17 55	PASS
Band4	5MHz	QPSK	20375	25RB#0	NV	50	1750.27 197	1754.73 967	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-30	1750.27 156	1754.74 386	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-20	1750.27 156	1754.74 576	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	-10	1750.27 583	1754.74 313	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	0	1750.27 304	1754.74 034	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	10	1750.27 268	1754.74 648	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	20	1750.27 526	1754.74 276	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	30	1750.27	1754.74	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							217	277	55	
Band4	5MHz	16QAM	20375	25RB#0	NV	40	1750.27 347	1754.74 287	1710-17 55	PASS
Band4	5MHz	16QAM	20375	25RB#0	NV	50	1750.27 551	1754.74 301	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-30	1710.53 714	1719.47 754	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-20	1710.53 898	1719.47 578	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	-10	1710.54 037	1719.47 707	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	0	1710.53 782	1719.47 992	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	10	1710.54 334	1719.47 244	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	20	1710.53 738	1719.47 788	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	30	1710.53 996	1719.47 986	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	40	1710.53 72	1719.47 98	1710-17 55	PASS
Band4	10MHz	QPSK	20000	50RB#0	NV	50	1710.54 147	1719.47 617	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-30	1710.54 518	1719.47 928	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-20	1710.54 31	1719.48 46	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	-10	1710.53 787	1719.48 647	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	0	1710.54 128	1719.48 298	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	10	1710.54 285	1719.47 925	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	20	1710.53 345	1719.48 775	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	30	1710.53 749	1719.48 059	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	40	1710.54 208	1719.48 348	1710-17 55	PASS
Band4	10MHz	16QAM	20000	50RB#0	NV	50	1710.54 206	1719.48 566	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	1728.01	1736.95	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							299	049	55	
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	1728.01 811	1736.95 521	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-10	1728.01 166	1736.94 816	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	1728.01 306	1736.94 716	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	1728.01 671	1736.94 521	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	1728.00 925	1736.95 105	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	30	1728.01 153	1736.94 933	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	40	1728.00 739	1736.94 829	1710-17 55	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	50	1728.01 839	1736.94 719	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-30	1728.02 023	1736.94 543	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-20	1728.02 062	1736.95 302	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	-10	1728.02 178	1736.94 438	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	0	1728.02 347	1736.94 647	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	10	1728.01 142	1736.94 932	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	20	1728.01 881	1736.94 421	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	30	1728.01 871	1736.95 191	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	40	1728.01 836	1736.95 446	1710-17 55	PASS
Band4	10MHz	16QAM	20175	50RB#0	NV	50	1728.01 643	1736.93 723	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-30	1745.54 829	1754.47 619	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-20	1745.55 757	1754.47 807	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	-10	1745.55 029	1754.47 929	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	0	1745.53	1754.47	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							772	882	55	
Band4	10MHz	QPSK	20350	50RB#0	NV	10	1745.54 513	1754.47 883	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	20	1745.55 176	1754.48 386	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	30	1745.54 637	1754.48 337	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	40	1745.54 129	1754.47 819	1710-17 55	PASS
Band4	10MHz	QPSK	20350	50RB#0	NV	50	1745.54 674	1754.48 024	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-30	1745.55 413	1754.48 023	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-20	1745.55 726	1754.47 506	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	-10	1745.55 515	1754.48 405	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	0	1745.55 865	1754.48 335	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	10	1745.54 467	1754.47 877	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	20	1745.55 728	1754.47 558	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	30	1745.55 869	1754.47 709	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	40	1745.55 494	1754.48 244	1710-17 55	PASS
Band4	10MHz	16QAM	20350	50RB#0	NV	50	1745.55 033	1754.48 043	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-30	1710.81 865	1724.24 365	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-20	1710.81 125	1724.25 325	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	-10	1710.80 877	1724.24 077	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	0	1710.81 714	1724.25 314	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	10	1710.81 227	1724.25 227	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	20	1710.81 094	1724.24 994	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	30	1710.81	1724.24	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							813	713	55	
Band4	15MHz	QPSK	20025	75RB#0	NV	40	1710.81 863	1724.25 063	1710-17 55	PASS
Band4	15MHz	QPSK	20025	75RB#0	NV	50	1710.80 676	1724.25 076	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-30	1710.79 843	1724.24 643	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-20	1710.80 281	1724.24 581	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	-10	1710.80 018	1724.24 118	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	0	1710.81 042	1724.24 742	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	10	1710.81 277	1724.24 377	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	20	1710.82 661	1724.24 061	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	30	1710.80 889	1724.24 189	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	40	1710.82 831	1724.25 231	1710-17 55	PASS
Band4	15MHz	16QAM	20025	75RB#0	NV	50	1710.80 422	1724.23 722	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	1725.77 358	1739.15 458	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	1725.77 593	1739.15 093	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-10	1725.78 158	1739.15 658	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	1725.77 142	1739.15 042	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	1725.77 14	1739.15 34	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	1725.76 927	1739.15 527	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	30	1725.77 666	1739.14 066	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	40	1725.77 233	1739.14 633	1710-17 55	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	50	1725.77 618	1739.15 018	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-30	1725.77	1739.14	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							768	268	55	
Band4	15MHz	16QAM	20175	75RB#0	NV	-20	1725.78 545	1739.13 045	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	-10	1725.77 478	1739.16 078	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	0	1725.77 341	1739.13 641	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	10	1725.77 89	1739.14 79	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	20	1725.77 62	1739.14 12	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	30	1725.77 527	1739.15 527	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	40	1725.77 424	1739.14 824	1710-17 55	PASS
Band4	15MHz	16QAM	20175	75RB#0	NV	50	1725.78 294	1739.15 294	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-30	1740.83 334	1754.23 534	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-20	1740.82 787	1754.23 587	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	-10	1740.81 325	1754.23 525	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	0	1740.81 302	1754.23 502	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	10	1740.83 028	1754.24 828	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	20	1740.82 379	1754.23 479	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	30	1740.82 893	1754.23 593	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	40	1740.81 901	1754.24 601	1710-17 55	PASS
Band4	15MHz	QPSK	20325	75RB#0	NV	50	1740.83 071	1754.23 171	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-30	1740.82 572	1754.23 672	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-20	1740.81 675	1754.23 175	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	-10	1740.82 987	1754.24 487	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	0	1740.81	1754.24	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

							403	703	55	
Band4	15MHz	16QAM	20325	75RB#0	NV	10	1740.83 197	1754.24 997	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	20	1740.83 087	1754.23 687	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	30	1740.82 468	1754.24 168	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	40	1740.84 285	1754.23 785	1710-17 55	PASS
Band4	15MHz	16QAM	20325	75RB#0	NV	50	1740.82 601	1754.23 901	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	-30	1711.15 103	1728.97 203	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	-20	1711.14 392	1728.98 692	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	-10	1711.14 573	1728.98 773	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	0	1711.12 122	1728.98 922	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	10	1711.13 243	1728.99 143	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	20	1711.14 352	1728.97 252	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	30	1711.10 92	1728.98 32	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	40	1711.12 744	1728.97 944	1710-17 55	PASS
Band4	20MHz	QPSK	20050	100RB# 0	NV	50	1711.15 526	1728.97 926	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	-30	1711.14 061	1728.98 761	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	-20	1711.14 885	1729.00 285	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	-10	1711.15 474	1728.98 474	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	0	1711.14 017	1729.00 217	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	10	1711.14 552	1728.98 352	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	20	1711.14 583	1728.98 683	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB#	NV	30	1711.14	1728.98	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

				0			429	929	55	
Band4	20MHz	16QAM	20050	100RB# 0	NV	40	1711.14 141	1728.98 041	1710-17 55	PASS
Band4	20MHz	16QAM	20050	100RB# 0	NV	50	1711.13 767	1728.97 967	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	-30	1723.58 606	1741.37 106	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	-20	1723.57 918	1741.35 318	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	-10	1723.55 89	1741.35 49	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	0	1723.56 006	1741.35 106	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	10	1723.56 142	1741.34 742	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	20	1723.57 224	1741.36 024	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	30	1723.58 24	1741.35 94	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	40	1723.55 899	1741.35 499	1710-17 55	PASS
Band4	20MHz	QPSK	20175	100RB# 0	NV	50	1723.59 258	1741.36 158	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	-30	1723.59 244	1741.39 144	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	-20	1723.58 921	1741.35 421	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	-10	1723.57 467	1741.34 967	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	0	1723.57 413	1741.35 013	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	10	1723.57 493	1741.34 893	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	20	1723.58 327	1741.37 127	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	30	1723.57 811	1741.38 811	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	40	1723.57 077	1741.36 877	1710-17 55	PASS
Band4	20MHz	16QAM	20175	100RB# 0	NV	50	1723.57 733	1741.39 333	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB#	NV	-30	1736.05	1753.99	1710-17	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

				0			246	546	55	
Band4	20MHz	QPSK	20300	100RB# 0	NV	-20	1736.03 152	1753.98 452	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	-10	1736.05 668	1753.97 968	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	0	1736.06 768	1753.97 868	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	10	1736.06 955	1753.98 855	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	20	1736.08 519	1753.97 219	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	30	1736.06 527	1753.98 127	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	40	1736.07 073	1753.97 173	1710-17 55	PASS
Band4	20MHz	QPSK	20300	100RB# 0	NV	50	1736.07 135	1753.99 335	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	-30	1736.08 58	1754.00 18	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	-20	1736.07 333	1753.99 133	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	-10	1736.08 118	1753.98 918	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	0	1736.08 401	1754.00 101	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	10	1736.08 363	1753.98 963	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	20	1736.08 893	1753.99 793	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	30	1736.07 848	1754.00 148	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	40	1736.08 403	1753.99 703	1710-17 55	PASS
Band4	20MHz	16QAM	20300	100RB# 0	NV	50	1736.07 601	1753.99 501	1710-17 55	PASS

Test Graphs

Voltage

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com