



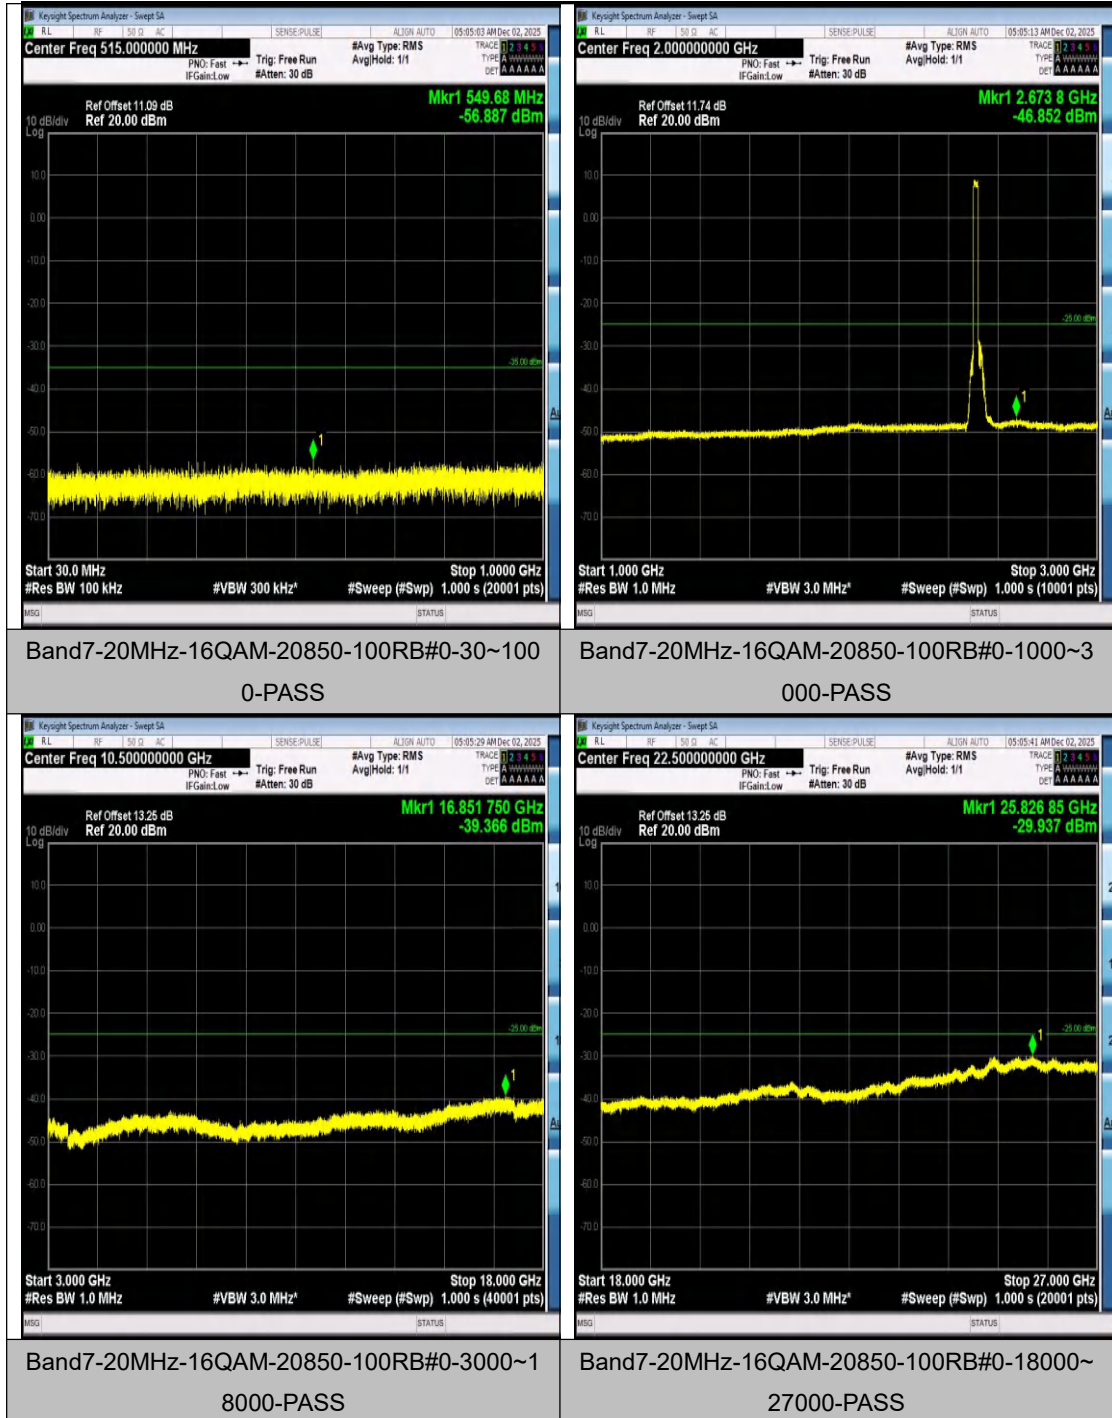

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

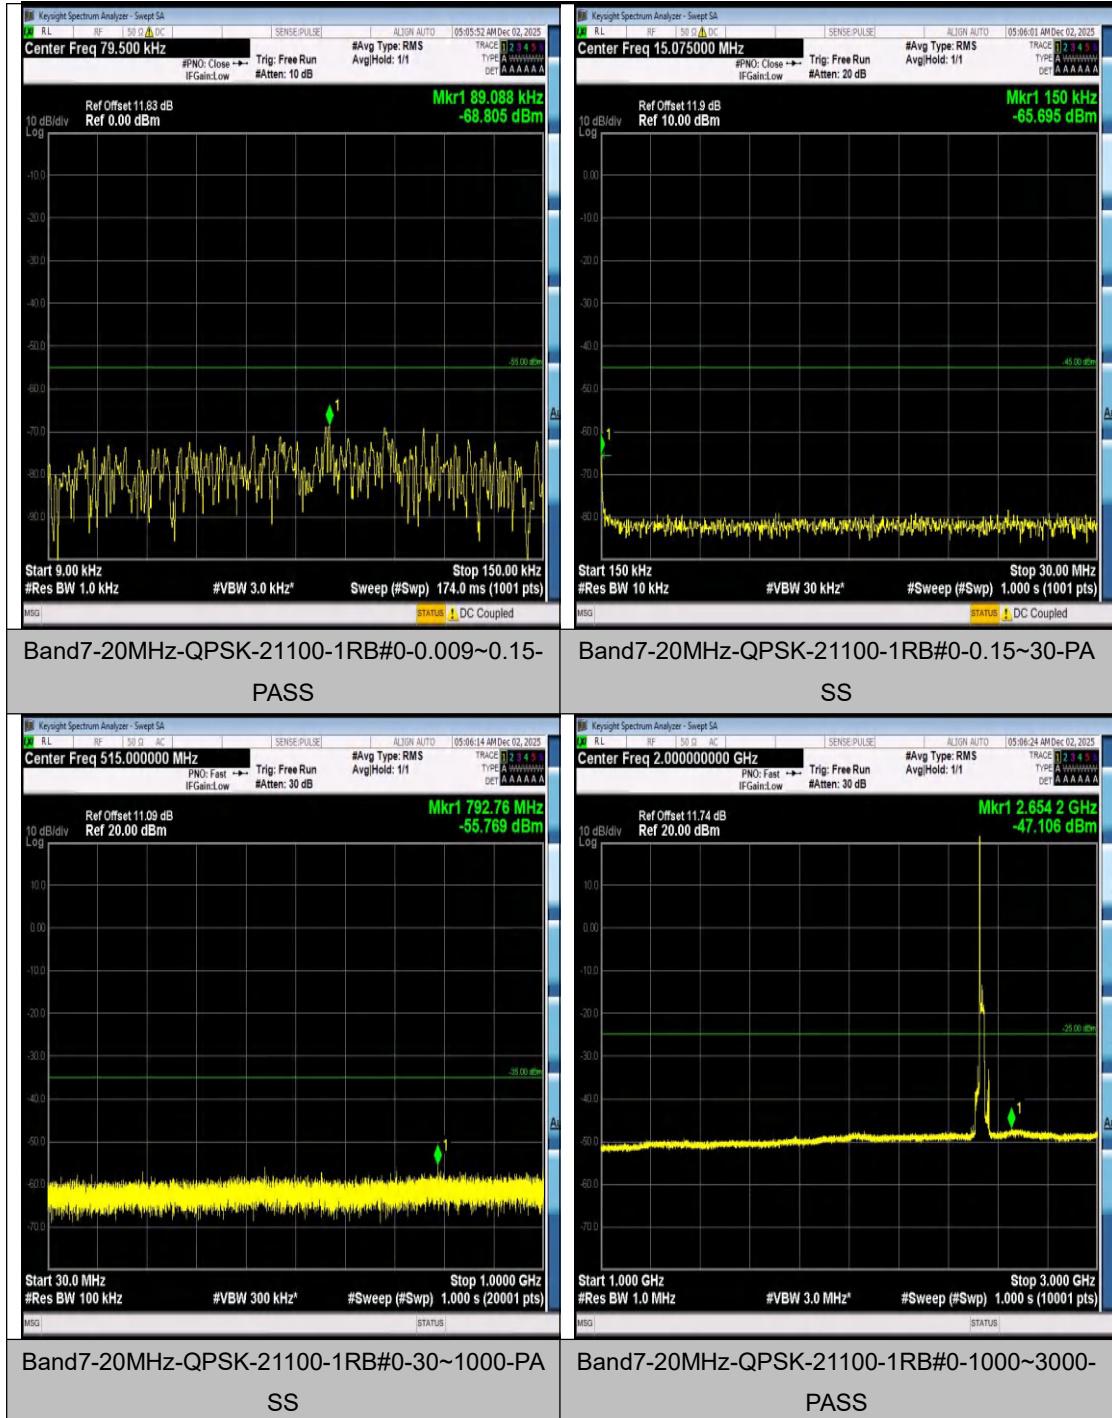

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

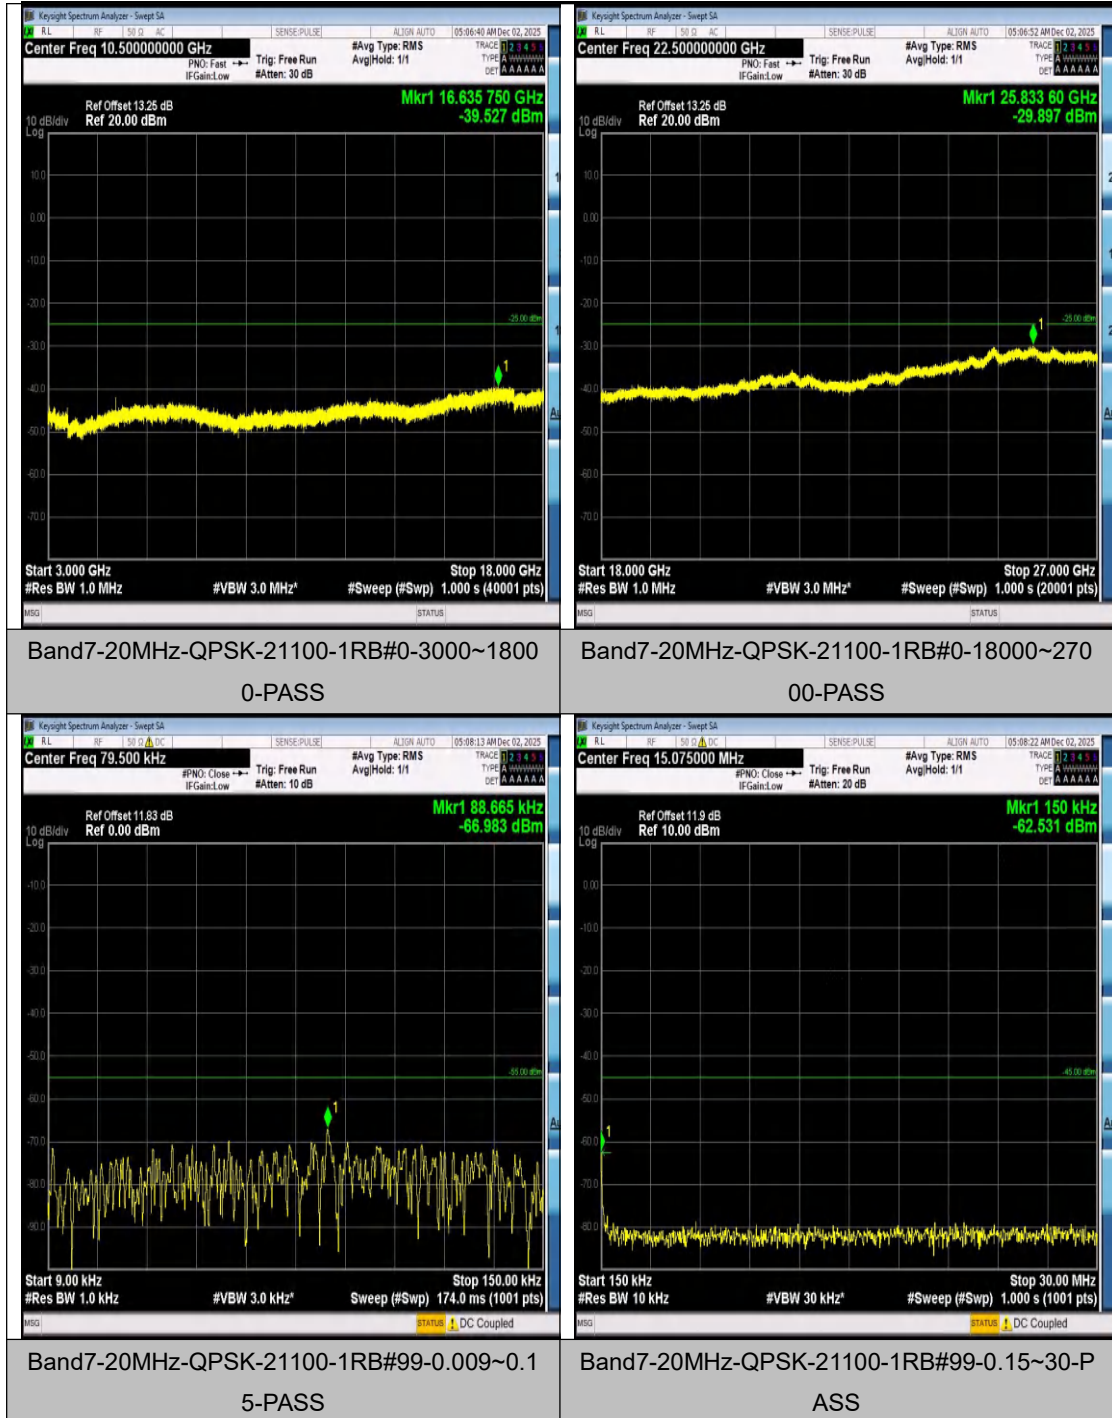

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

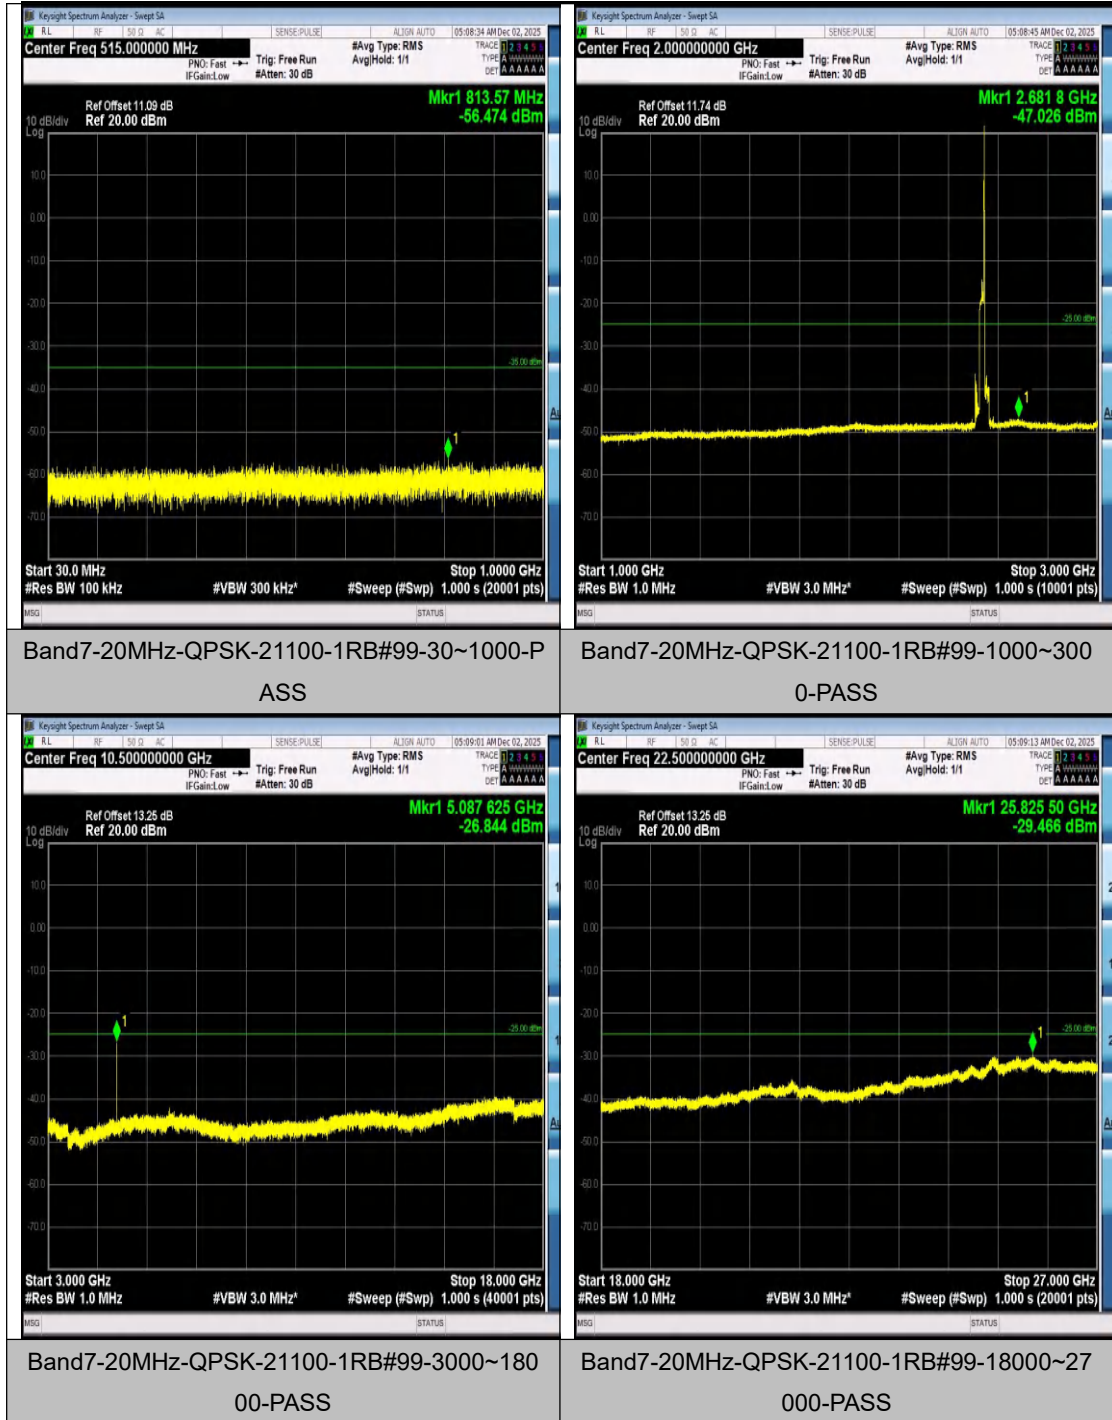

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

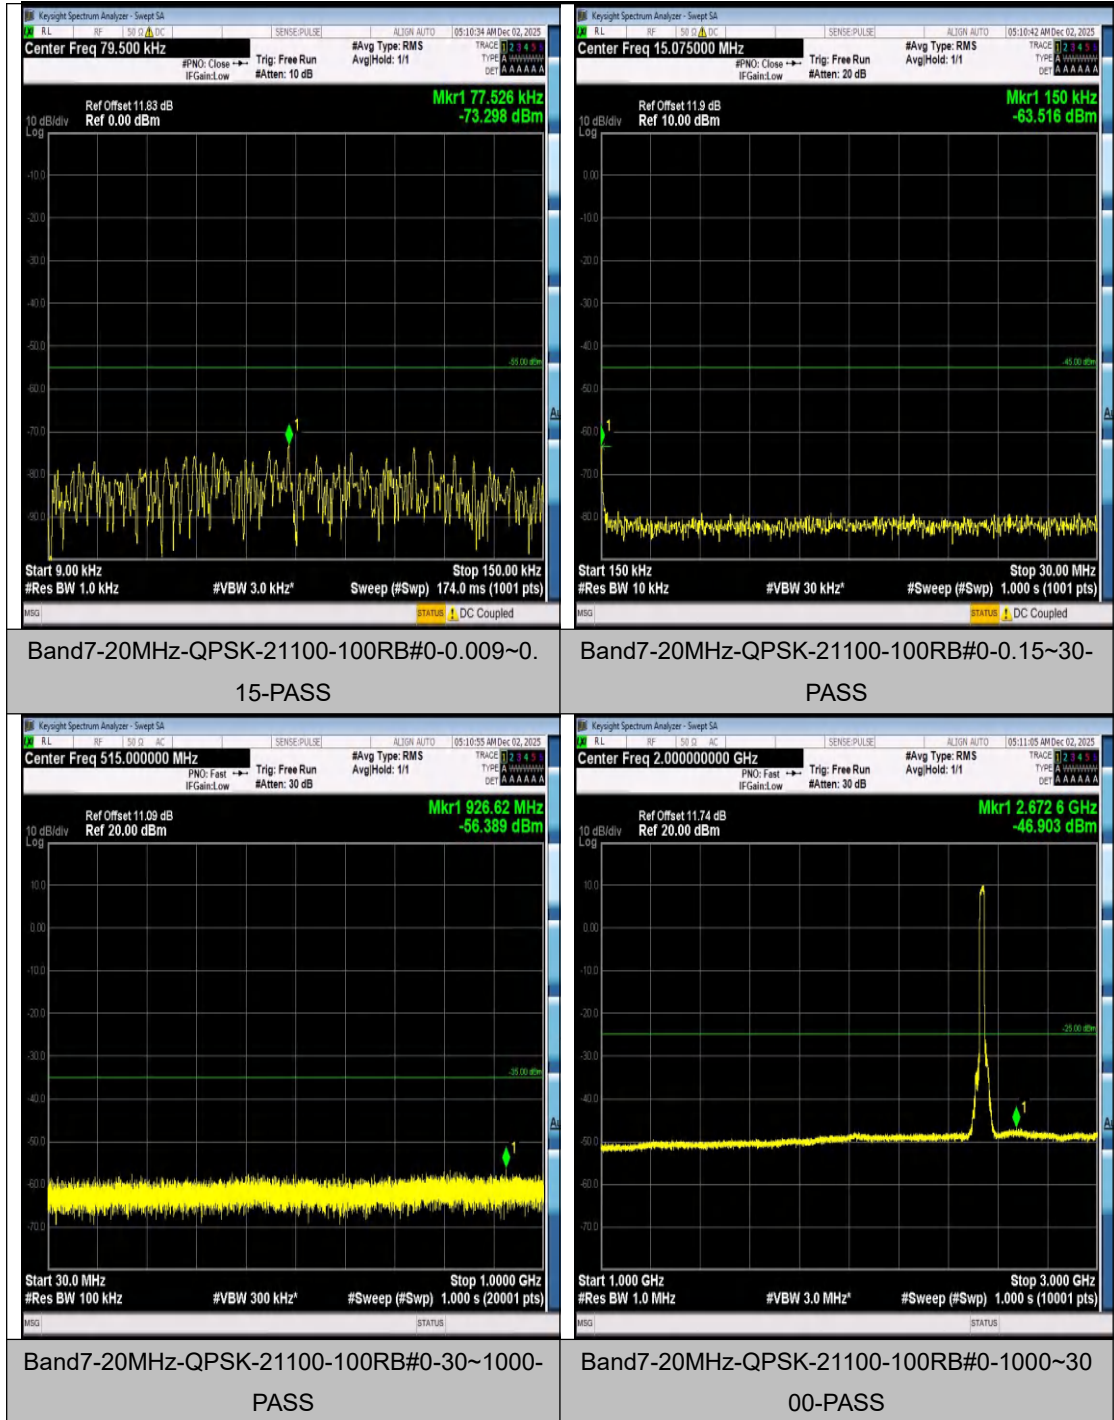

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

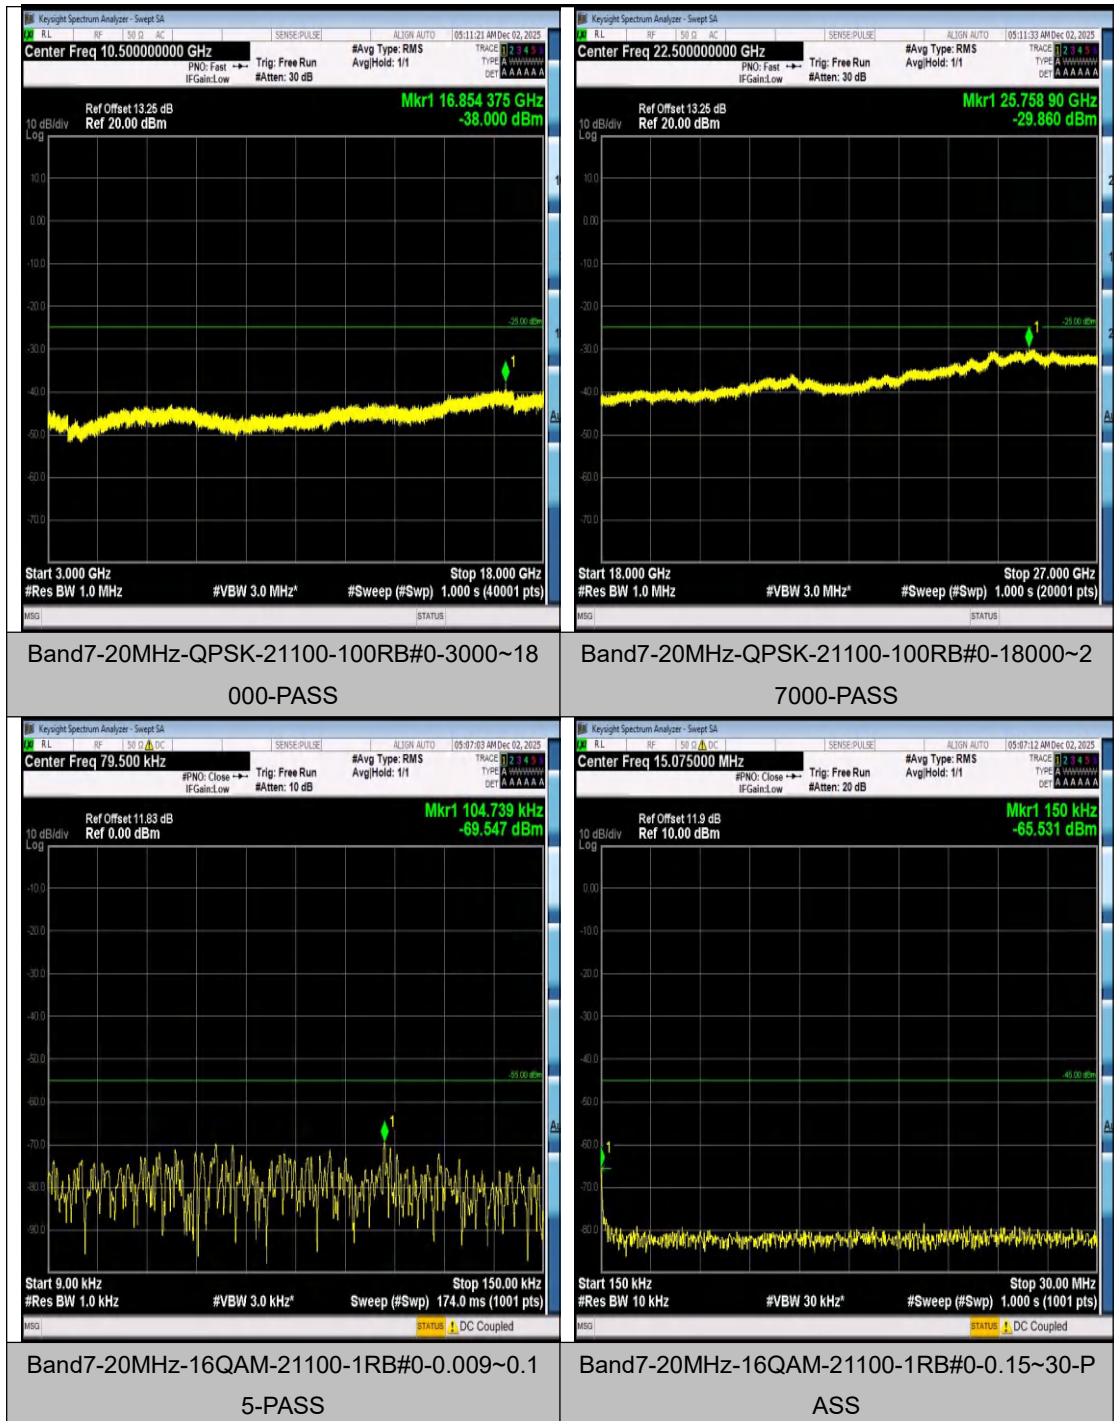

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

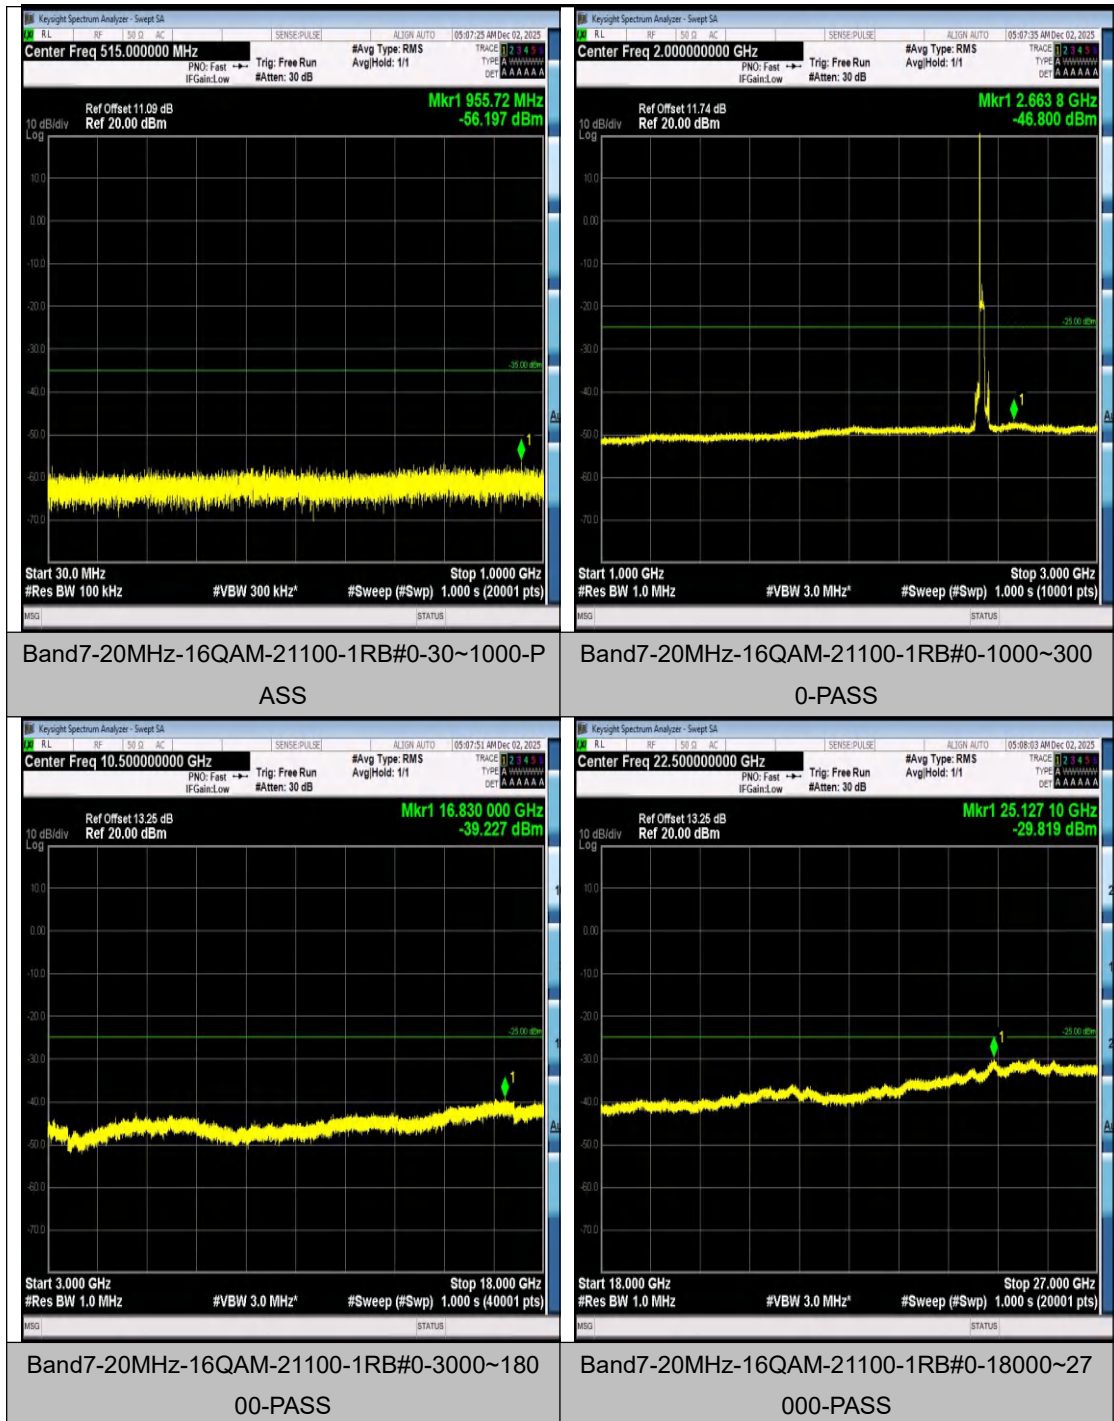

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

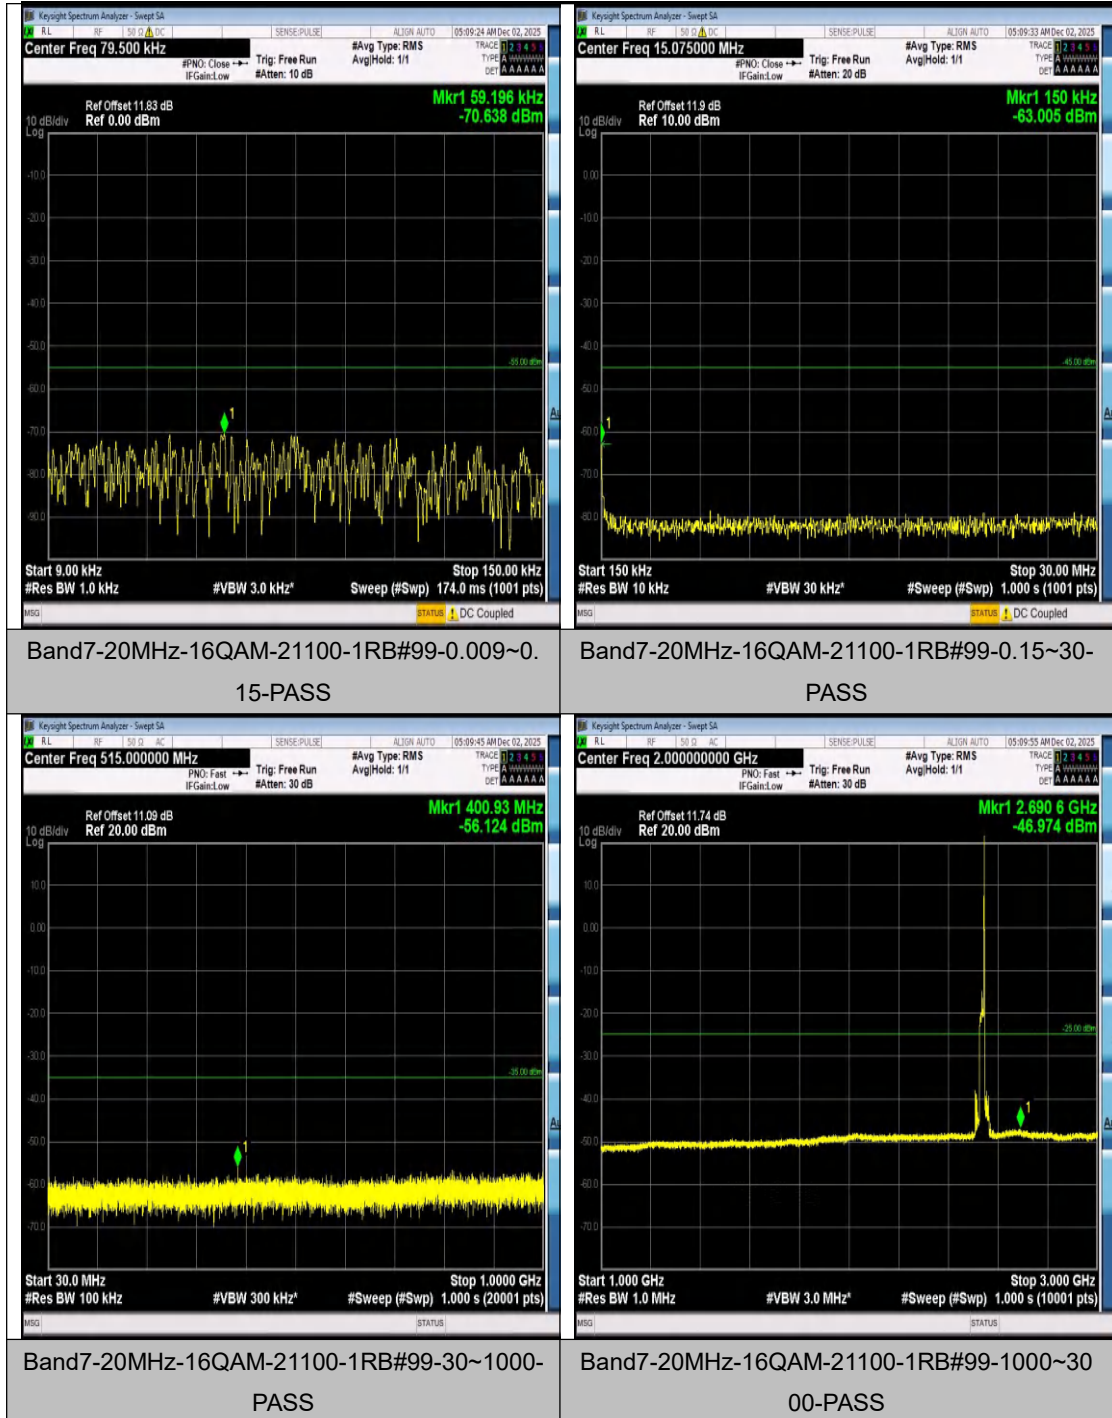

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

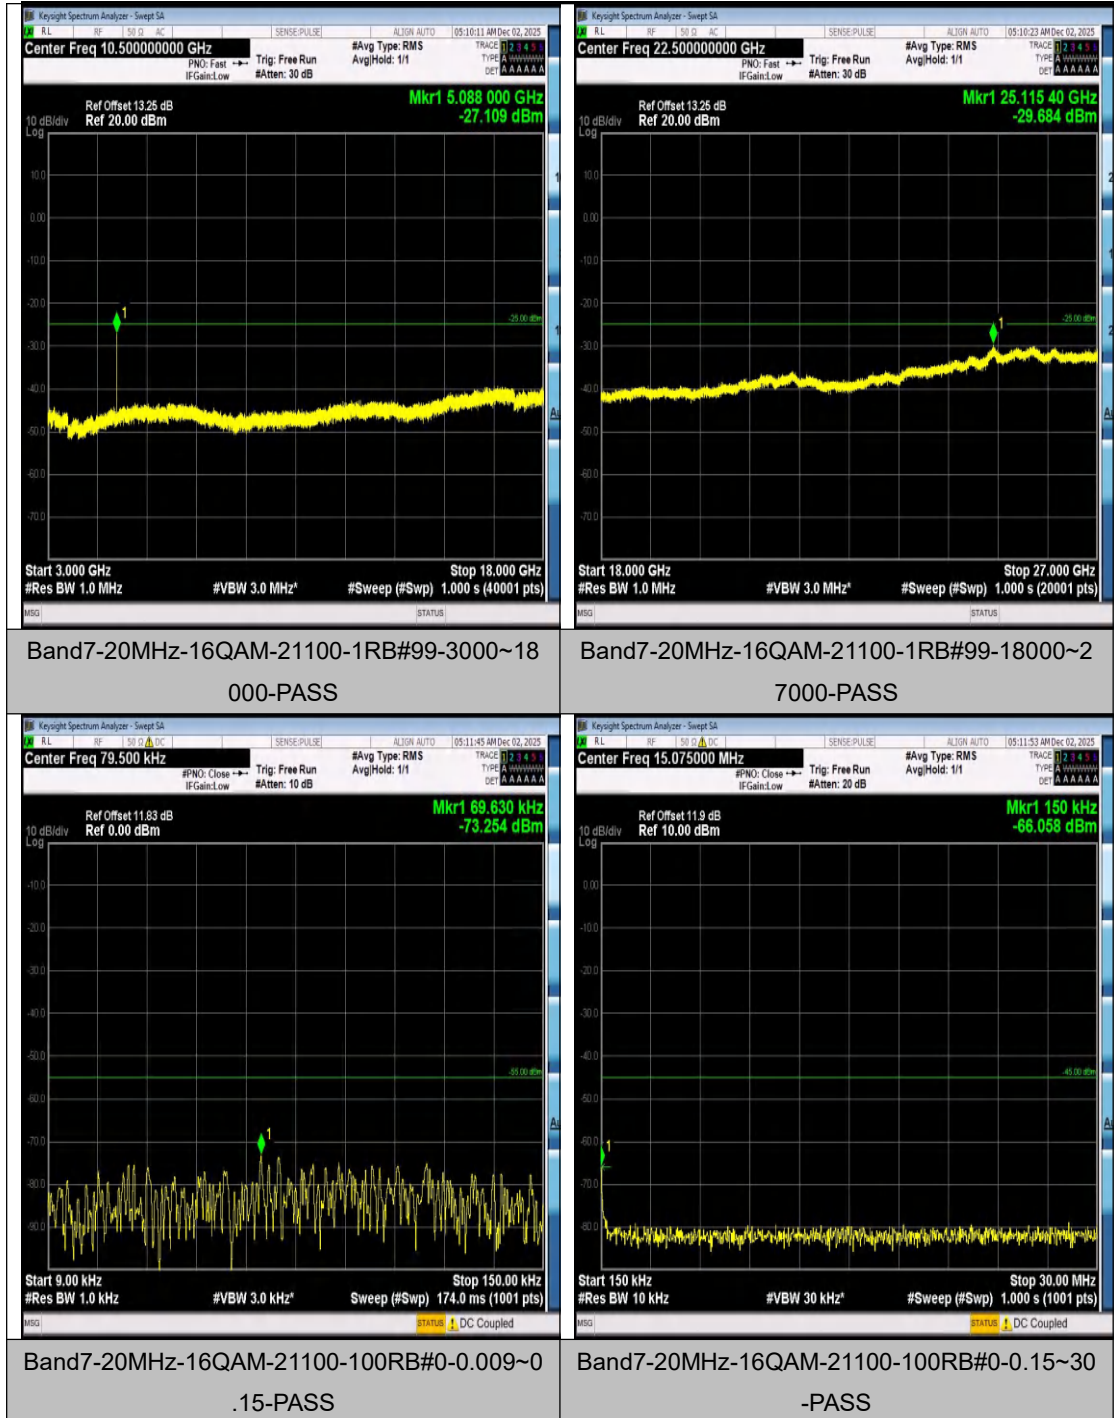

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

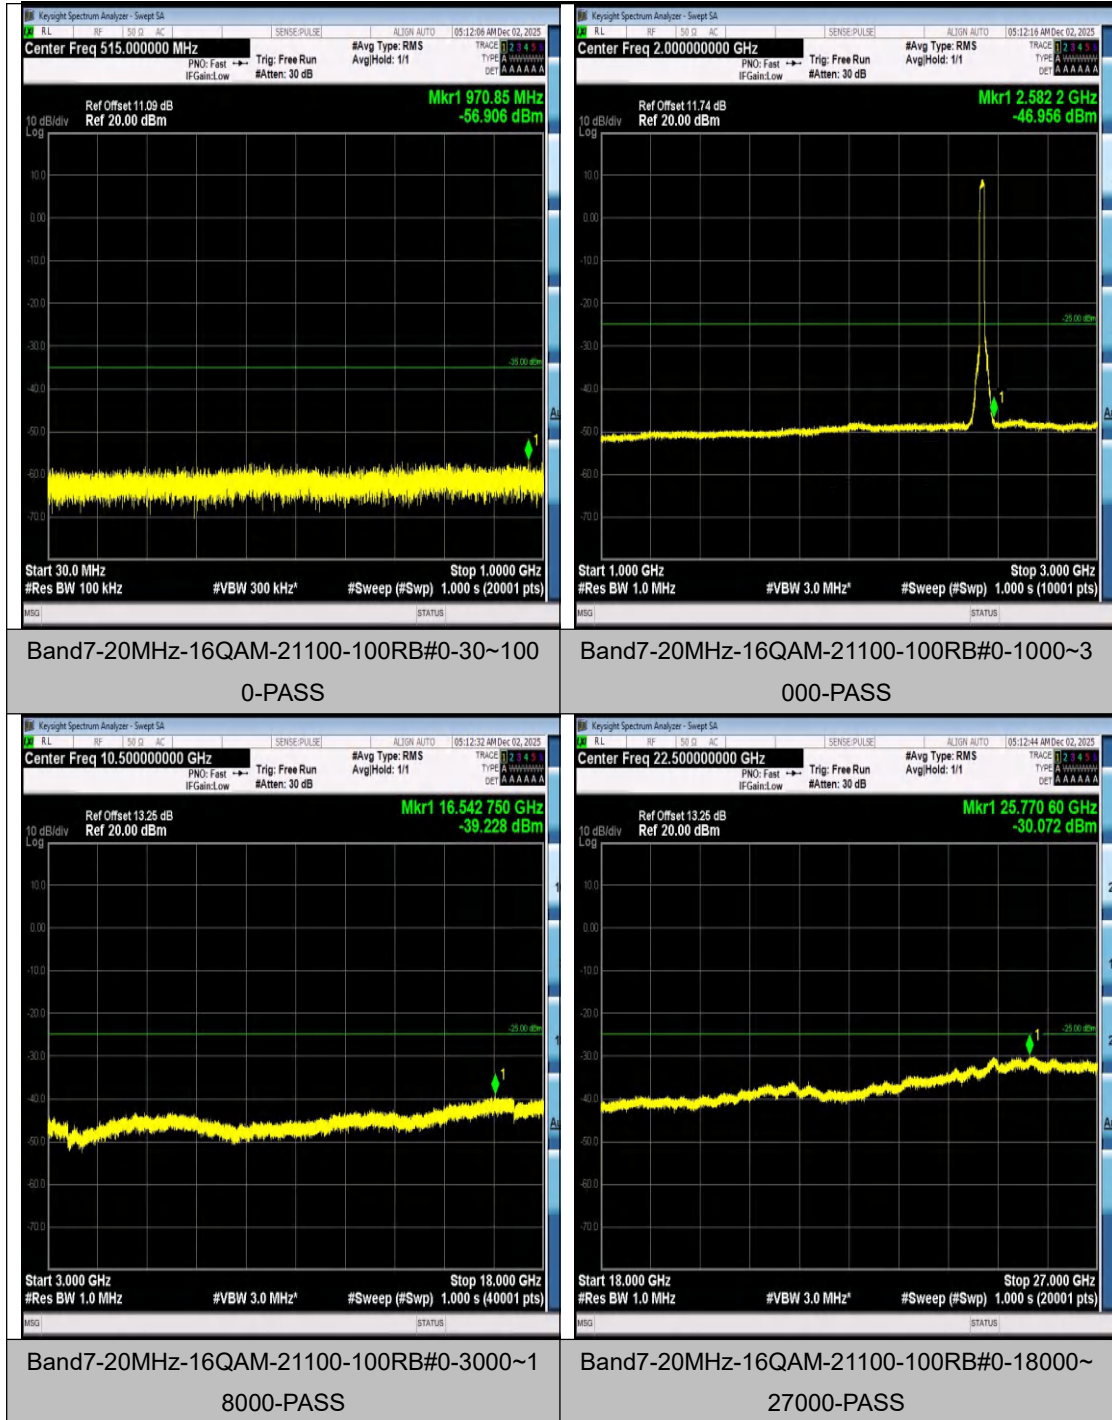

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

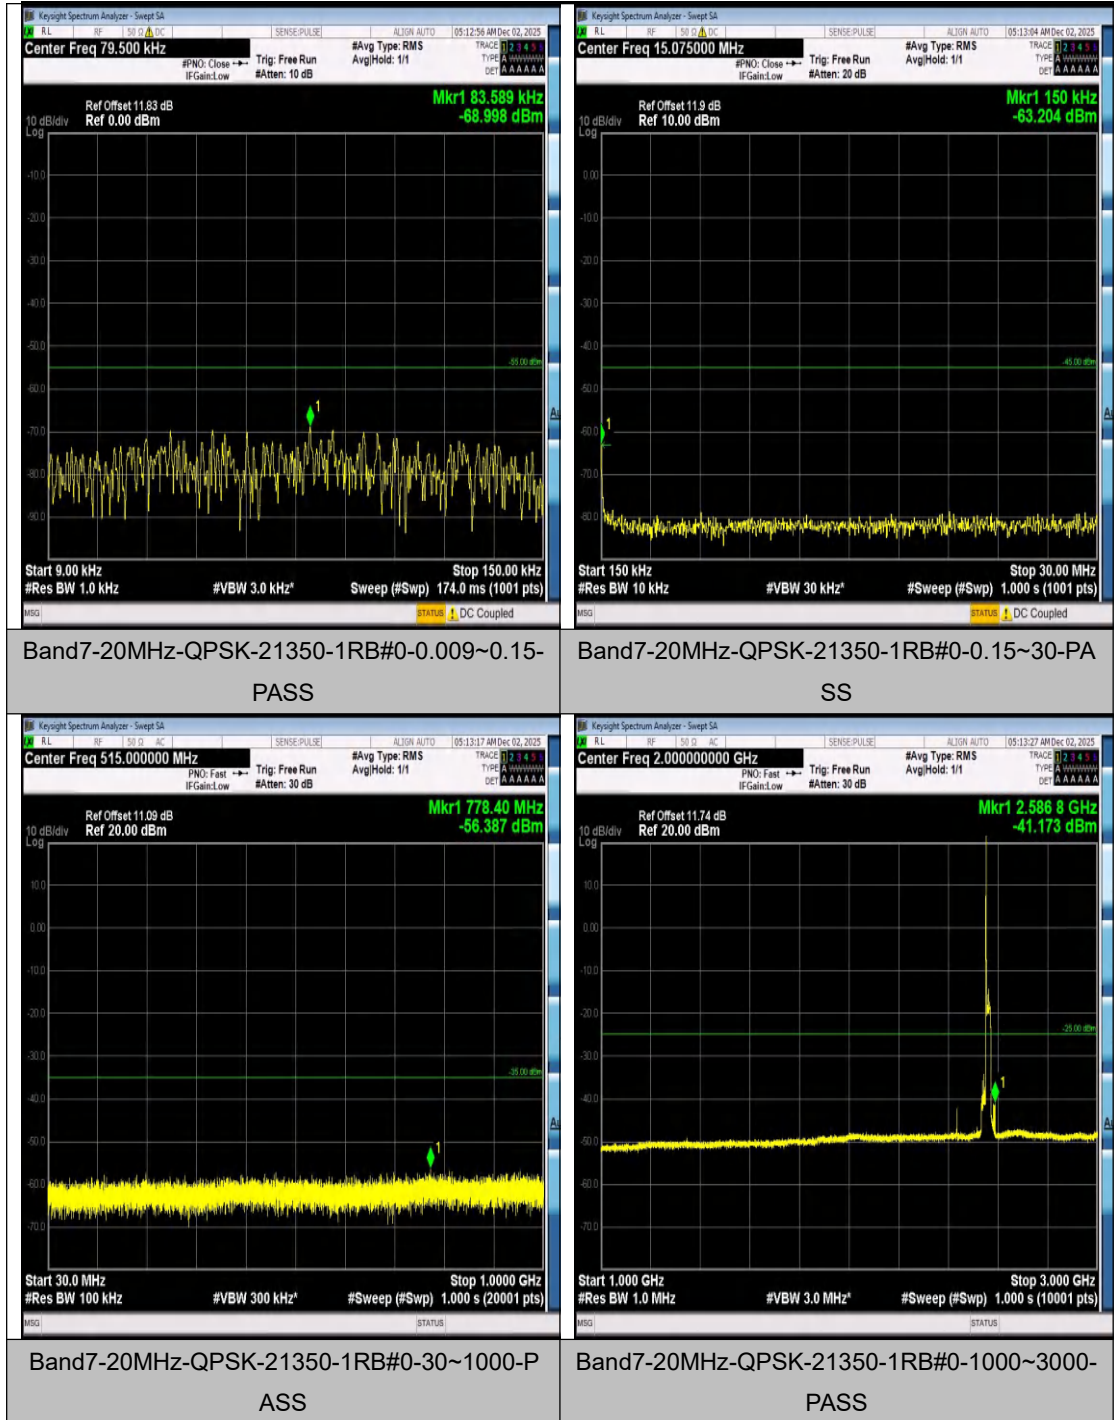

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

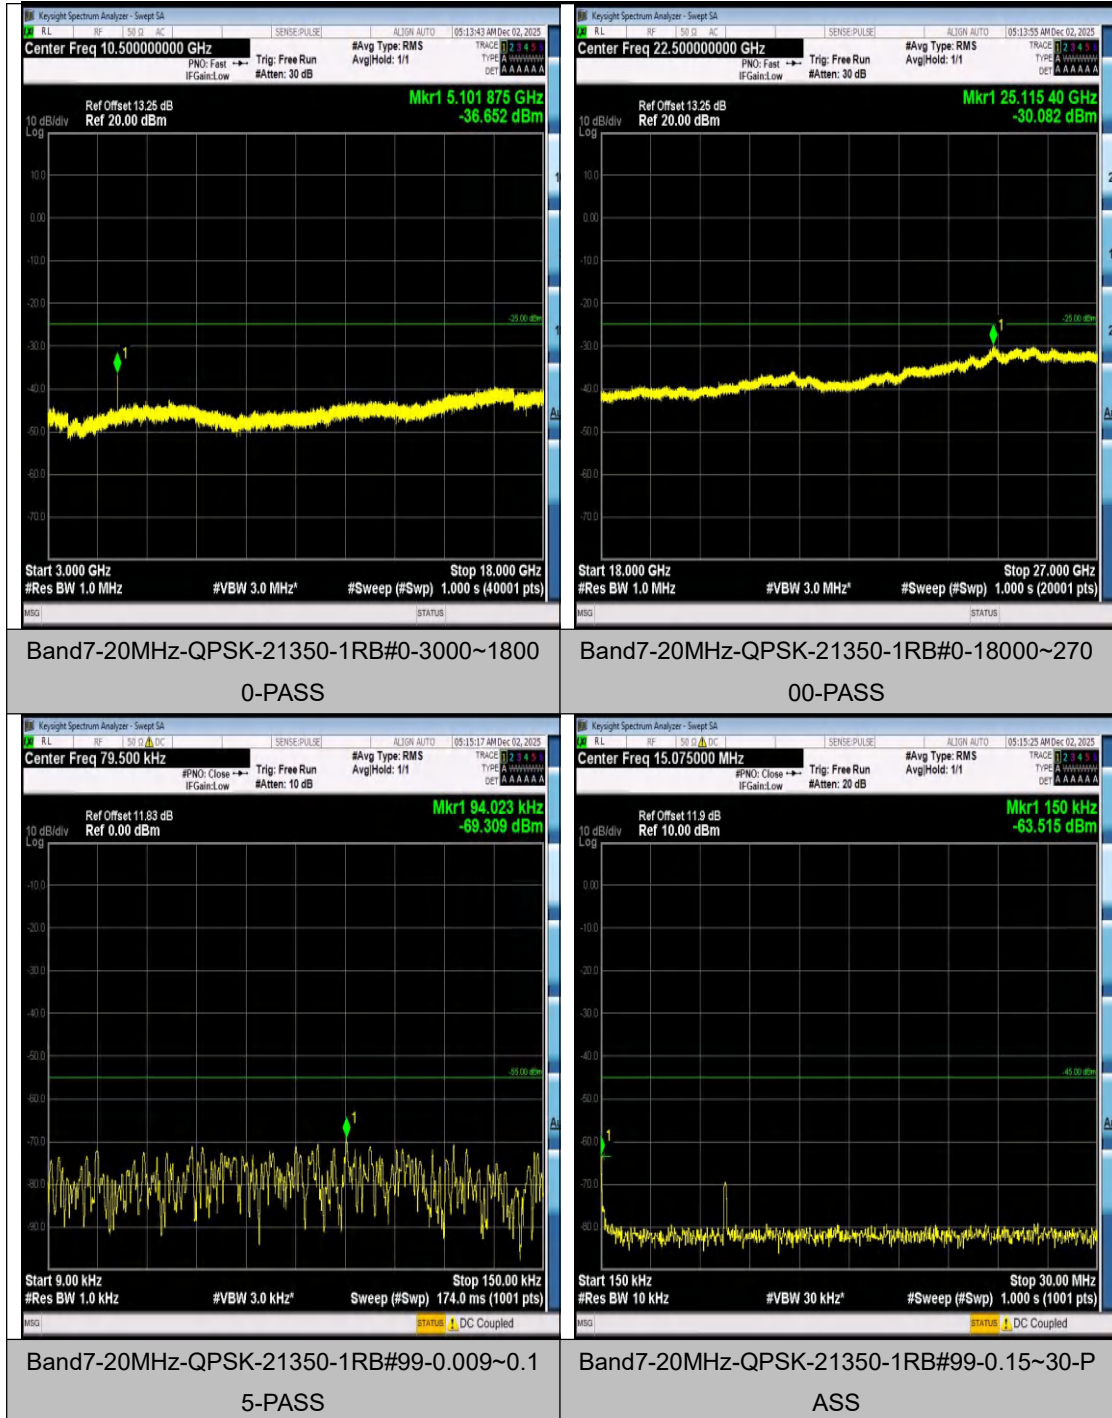

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

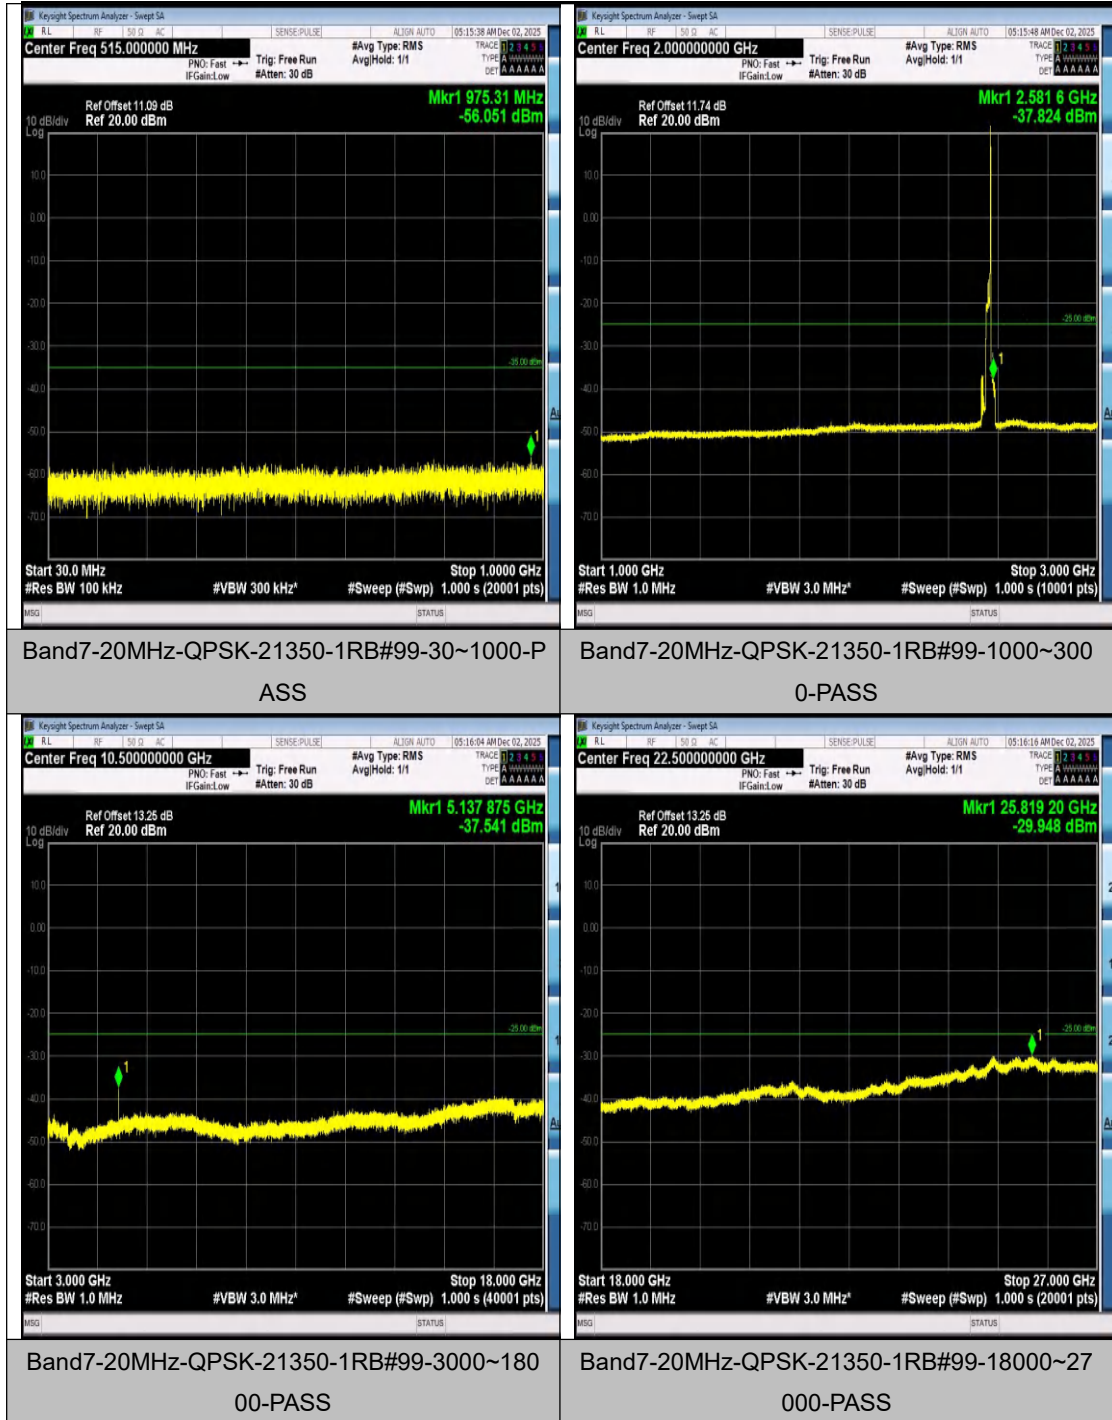

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

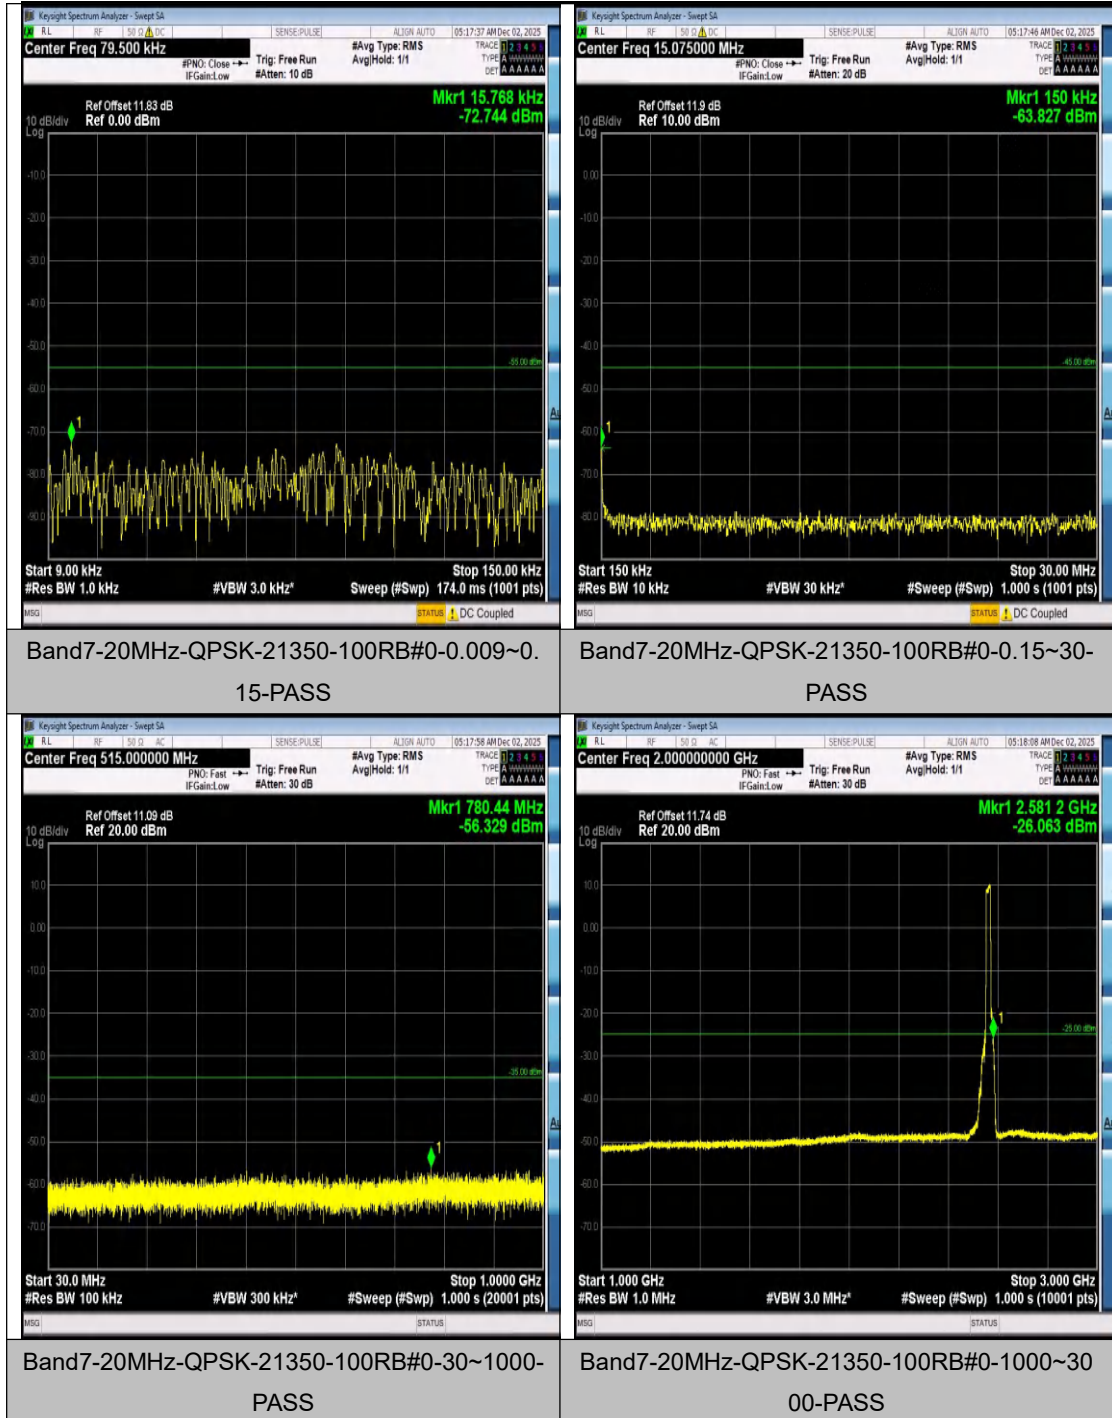

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

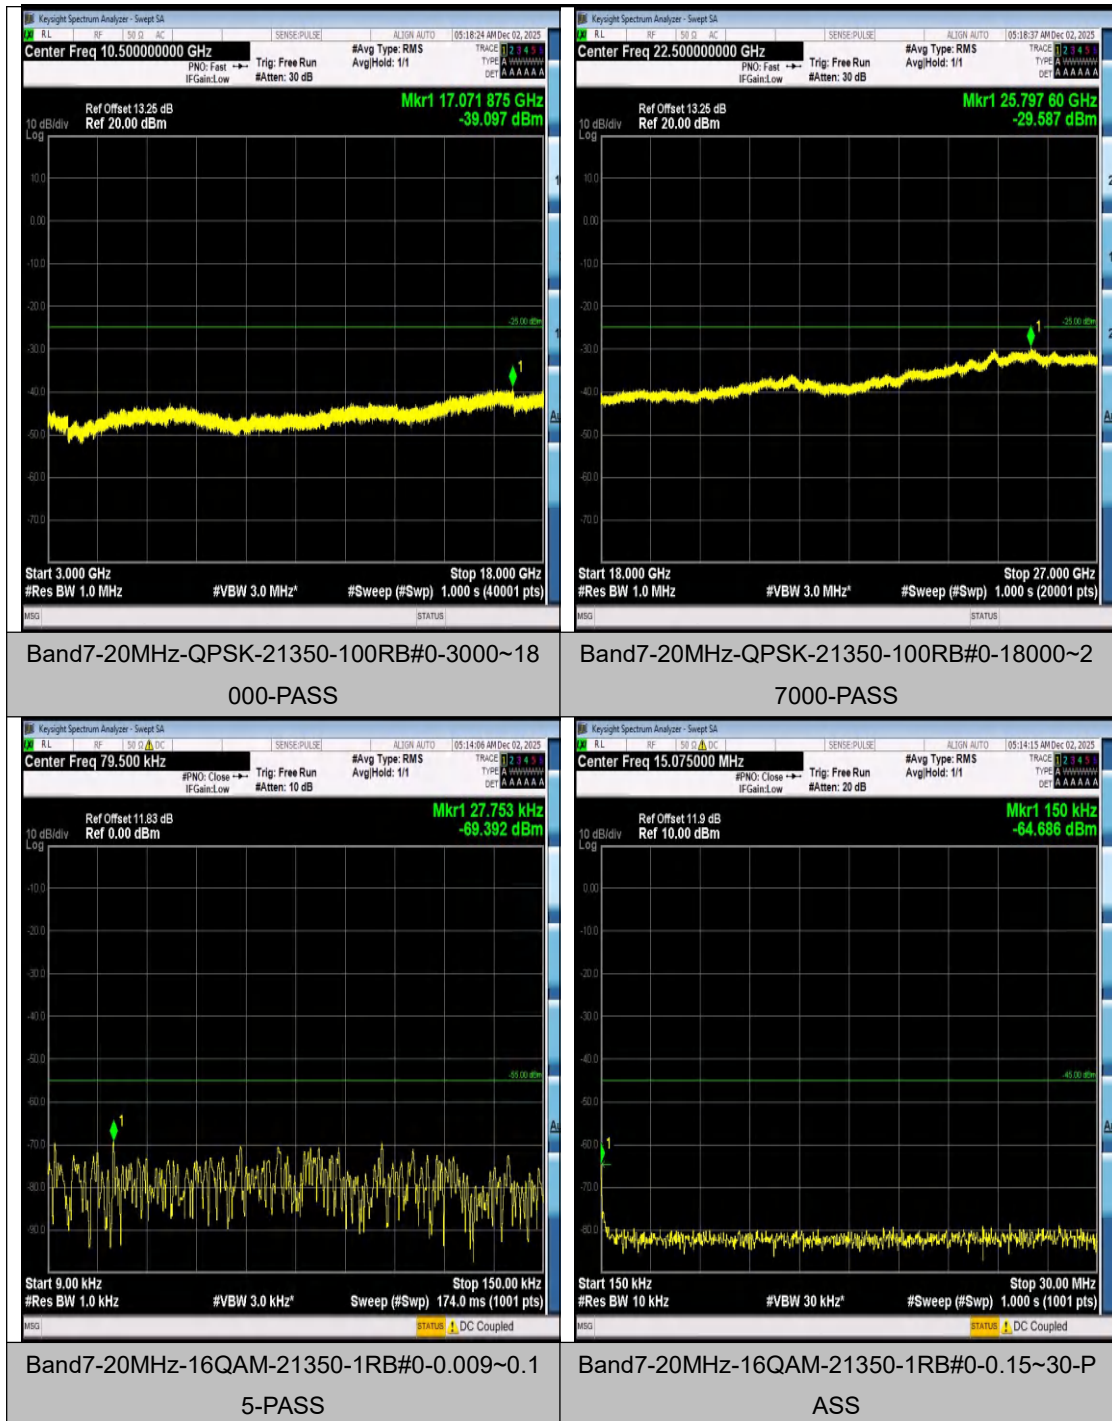

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

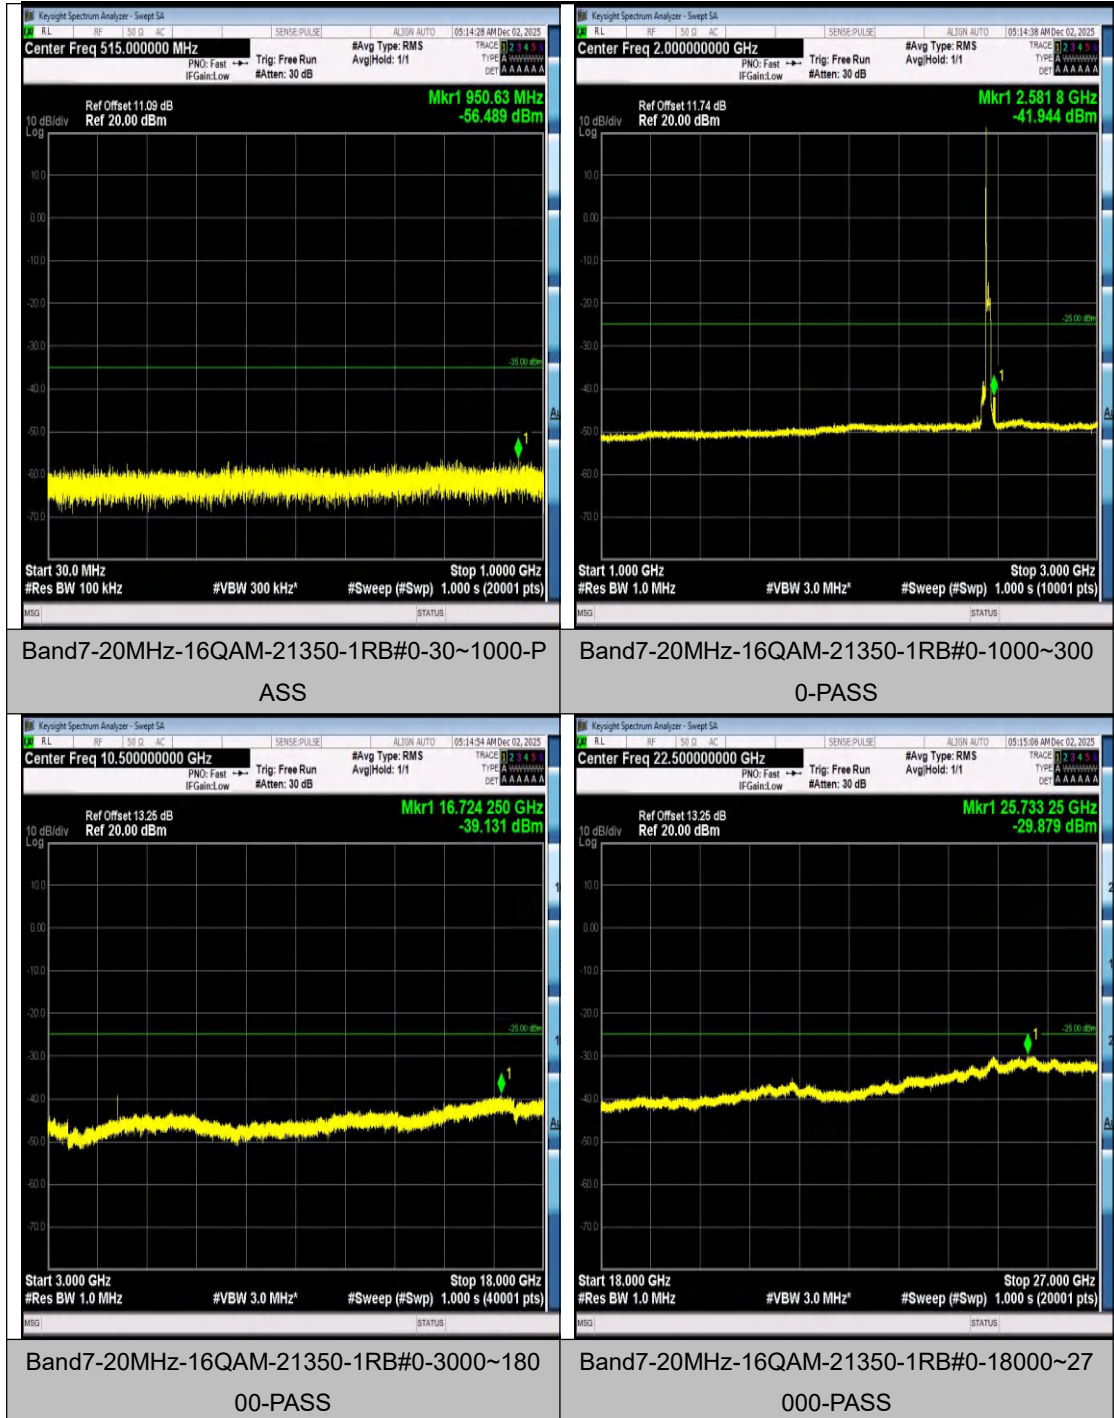

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

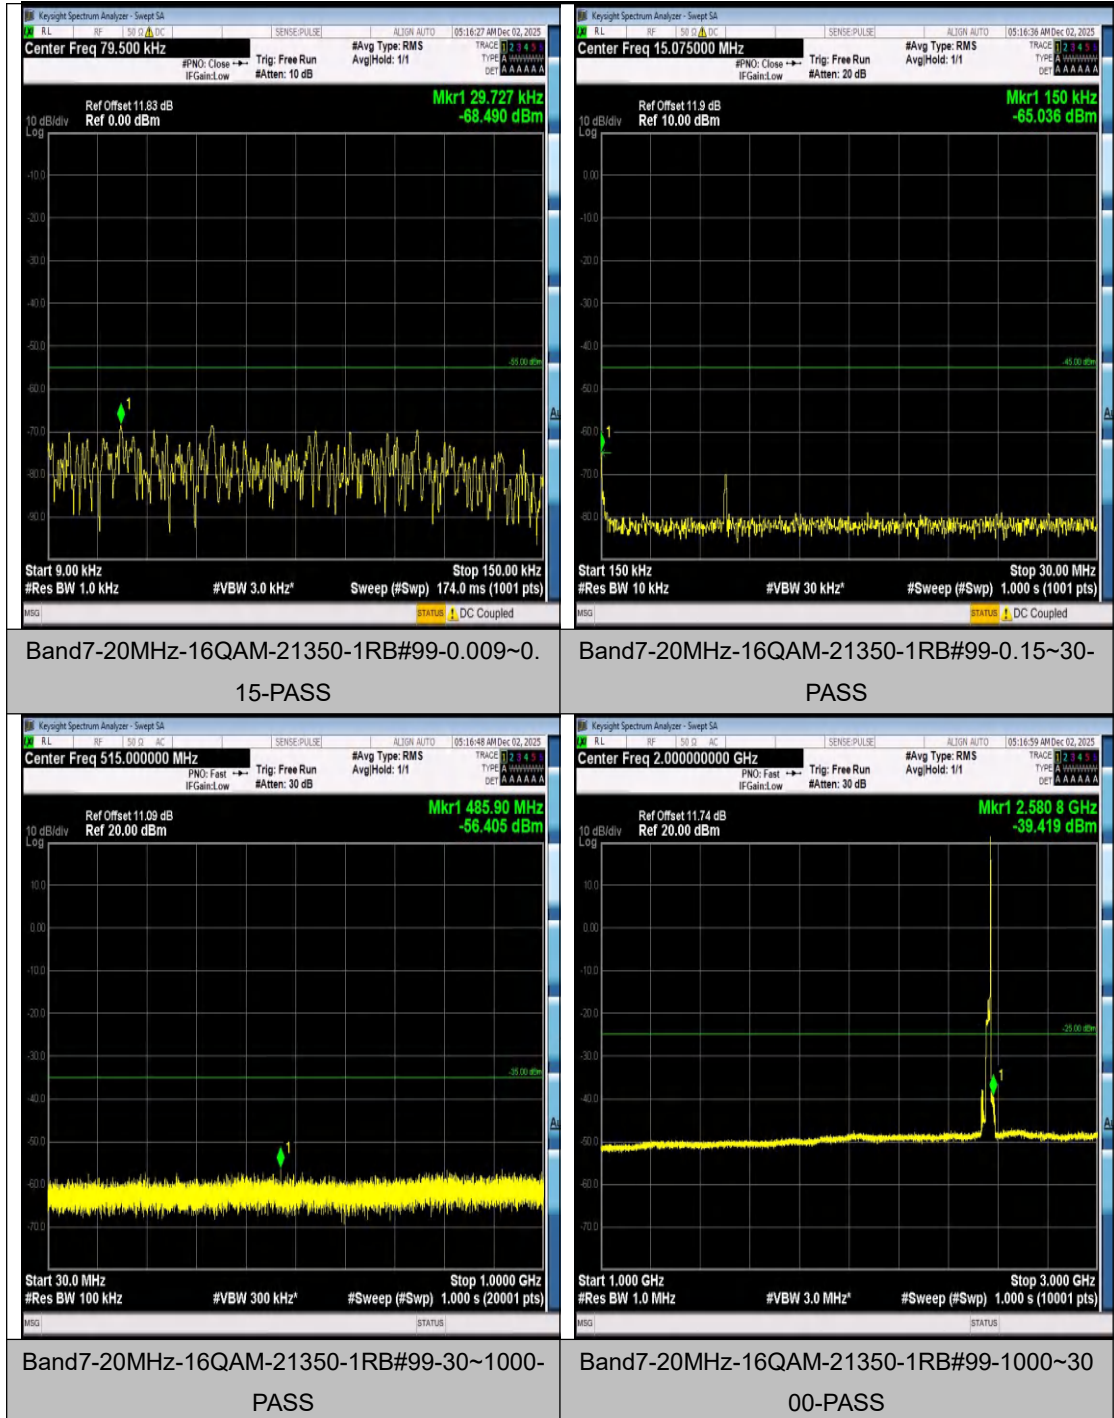

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

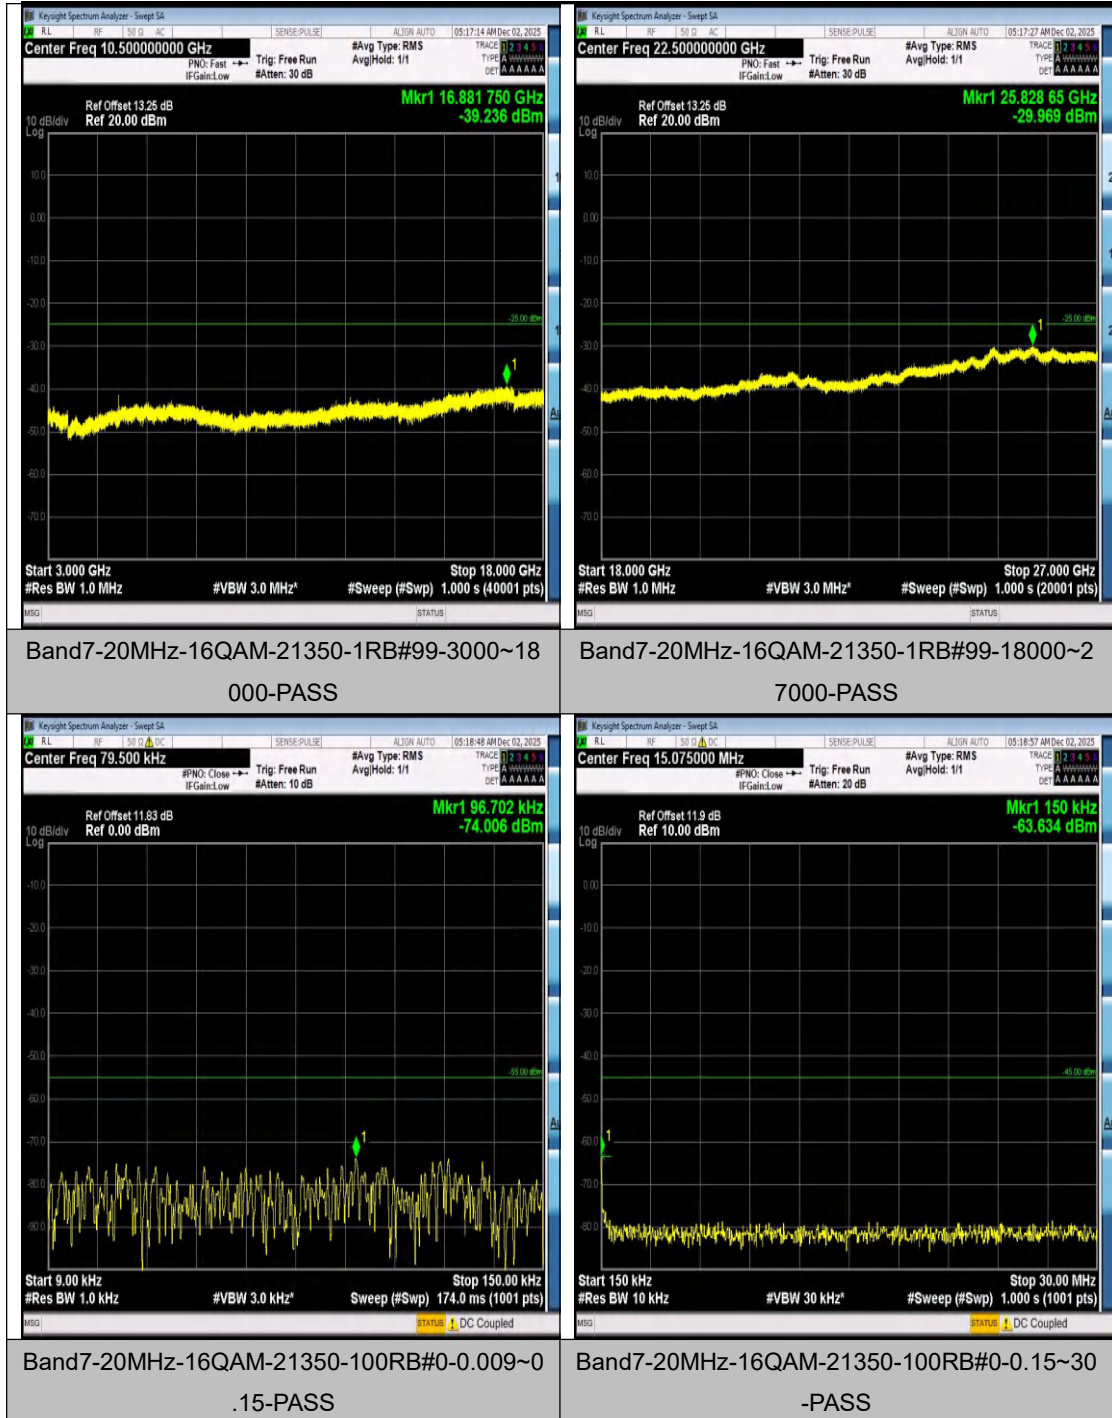

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

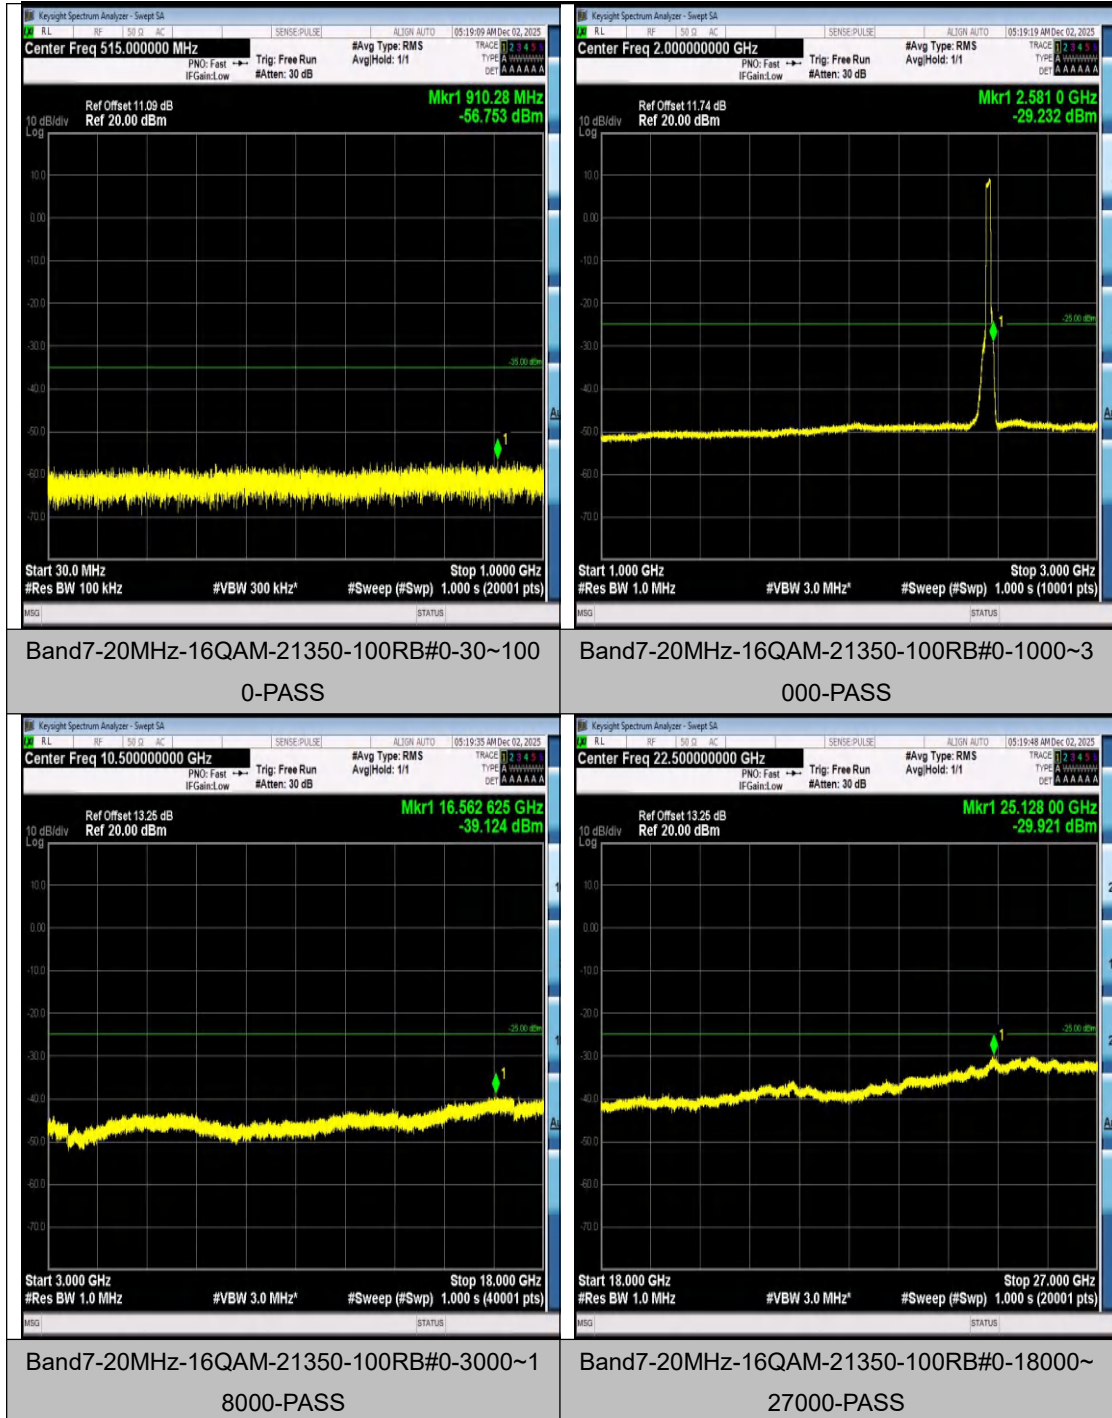

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix F: Frequency Stability

### Test Result

| Voltage |           |            |         |                  |               |                  |            |            |             |         |
|---------|-----------|------------|---------|------------------|---------------|------------------|------------|------------|-------------|---------|
| Band    | Bandwidth | Modulation | Channel | RB Configuration | Voltage [Vdc] | Temperature (°C) | FL (MHz)   | FH (MHz)   | Limit (MHz) | Verdict |
| Band7   | 5MHz      | QPSK       | 20775   | 25RB#0           | VN            | NT               | 2500.25307 | 2504.73037 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 20775   | 25RB#0           | VL            | NT               | 2500.26067 | 2504.72727 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 20775   | 25RB#0           | VH            | NT               | 2500.24873 | 2504.72603 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 20775   | 25RB#0           | VN            | NT               | 2500.26003 | 2504.73503 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 20775   | 25RB#0           | VL            | NT               | 2500.26333 | 2504.73303 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 20775   | 25RB#0           | VH            | NT               | 2500.25966 | 2504.73926 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21100   | 25RB#0           | VN            | NT               | 2532.76109 | 2537.23449 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21100   | 25RB#0           | VL            | NT               | 2532.76032 | 2537.23292 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21100   | 25RB#0           | VH            | NT               | 2532.76138 | 2537.23638 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21100   | 25RB#0           | VN            | NT               | 2532.75971 | 2537.23281 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21100   | 25RB#0           | VL            | NT               | 2532.76048 | 2537.23358 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21100   | 25RB#0           | VH            | NT               | 2532.76174 | 2537.23084 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21425   | 25RB#0           | VN            | NT               | 2565.26553 | 2569.73493 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21425   | 25RB#0           | VL            | NT               | 2565.26519 | 2569.73189 | 2500-2570   | PASS    |
| Band7   | 5MHz      | QPSK       | 21425   | 25RB#0           | VH            | NT               | 2565.26318 | 2569.73718 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21425   | 25RB#0           | VN            | NT               | 2565.26441 | 2569.73951 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21425   | 25RB#0           | VL            | NT               | 2565.26405 | 2569.73555 | 2500-2570   | PASS    |
| Band7   | 5MHz      | 16QAM      | 21425   | 25RB#0           | VH            | NT               | 2565.26    | 2569.74    | 2500-2570   | PASS    |

|       |       |       |       |        |    |    |                |                |               |      |
|-------|-------|-------|-------|--------|----|----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |    | 579            | 129            | 70            |      |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | VN | NT | 2500.52<br>77  | 2509.45<br>31  | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | VL | NT | 2500.52<br>507 | 2509.46<br>587 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | VH | NT | 2500.52<br>622 | 2509.45<br>492 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | VN | NT | 2500.52<br>695 | 2509.45<br>925 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | VL | NT | 2500.53<br>162 | 2509.47<br>022 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | VH | NT | 2500.52<br>356 | 2509.47<br>006 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | VN | NT | 2530.53<br>956 | 2539.47<br>236 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | VL | NT | 2530.53<br>425 | 2539.46<br>935 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | VH | NT | 2530.53<br>796 | 2539.47<br>296 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | VN | NT | 2530.53<br>649 | 2539.47<br>589 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | VL | NT | 2530.54<br>284 | 2539.46<br>544 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | VH | NT | 2530.53<br>246 | 2539.46<br>526 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | VN | NT | 2560.52<br>432 | 2569.47<br>532 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | VL | NT | 2560.52<br>201 | 2569.47<br>541 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | VH | NT | 2560.52<br>641 | 2569.47<br>791 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | VN | NT | 2560.51<br>805 | 2569.47<br>035 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | VL | NT | 2560.53<br>798 | 2569.47<br>988 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | VH | NT | 2560.53<br>485 | 2569.47<br>665 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | VN | NT | 2500.79<br>187 | 2514.17<br>787 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | VL | NT | 2500.79<br>882 | 2514.18<br>082 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | VH | NT | 2500.79        | 2514.17        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |    |                |                |               |      |
|-------|-------|-------|-------|-------------|----|----|----------------|----------------|---------------|------|
|       |       |       |       |             |    |    | 042            | 142            | 70            |      |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0      | VN | NT | 2500.78<br>905 | 2514.18<br>805 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0      | VL | NT | 2500.79<br>698 | 2514.19<br>398 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0      | VH | NT | 2500.79<br>421 | 2514.19<br>021 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0      | VN | NT | 2528.31<br>647 | 2541.70<br>347 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0      | VL | NT | 2528.30<br>916 | 2541.70<br>416 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0      | VH | NT | 2528.31<br>089 | 2541.70<br>889 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0      | VN | NT | 2528.31<br>436 | 2541.69<br>936 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0      | VL | NT | 2528.30<br>797 | 2541.69<br>197 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0      | VH | NT | 2528.31<br>69  | 2541.70<br>19  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0      | VN | NT | 2555.79<br>859 | 2569.21<br>959 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0      | VL | NT | 2555.80<br>624 | 2569.23<br>624 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0      | VH | NT | 2555.79<br>787 | 2569.22<br>087 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | VN | NT | 2555.80<br>436 | 2569.21<br>836 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | VL | NT | 2555.79<br>76  | 2569.22<br>76  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | VH | NT | 2555.81<br>376 | 2569.22<br>776 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | VN | NT | 2501.07<br>677 | 2518.93<br>677 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | VL | NT | 2501.07<br>421 | 2518.93<br>821 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | VH | NT | 2501.08<br>419 | 2518.92<br>619 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | VN | NT | 2501.04<br>415 | 2518.92<br>415 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | VL | NT | 2501.06<br>606 | 2518.92<br>406 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#      | VH | NT | 2501.04        | 2518.93        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |    |                |                |               |      |
|-------|-------|-------|-------|-------------|----|----|----------------|----------------|---------------|------|
|       |       |       |       | 0           |    |    | 768            | 568            | 70            |      |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | VN | NT | 2526.08<br>828 | 2543.92<br>728 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | VL | NT | 2526.10<br>624 | 2543.92<br>424 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | VH | NT | 2526.07<br>505 | 2543.92<br>505 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | VN | NT | 2526.11<br>843 | 2543.94<br>543 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | VL | NT | 2526.11<br>081 | 2543.95<br>381 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | VH | NT | 2526.10<br>028 | 2543.95<br>128 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | VN | NT | 2551.07<br>587 | 2568.96<br>687 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | VL | NT | 2551.05<br>922 | 2568.94<br>722 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | VH | NT | 2551.08<br>563 | 2568.95<br>963 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | VN | NT | 2551.09<br>646 | 2568.95<br>646 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | VL | NT | 2551.09<br>209 | 2568.96<br>709 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | VH | NT | 2551.10<br>802 | 2568.96<br>502 | 2500-25<br>70 | PASS |

| Temperature |           |            |         |                  |               |                  |                |                |               |         |
|-------------|-----------|------------|---------|------------------|---------------|------------------|----------------|----------------|---------------|---------|
| Band        | Bandwidth | Modulation | Channel | RB Configuration | Voltage [Vdc] | Temperature (°C) | FL (MHz)       | FH (MHz)       | Limit (MHz)   | Verdict |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | -30              | 2500.24<br>965 | 2504.72<br>925 | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | -20              | 2500.25<br>45  | 2504.73<br>37  | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | -10              | 2500.24<br>727 | 2504.73<br>347 | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | 0                | 2500.25<br>615 | 2504.73<br>405 | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | 10               | 2500.26<br>548 | 2504.72<br>998 | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | 20               | 2500.25<br>115 | 2504.72<br>835 | 2500-25<br>70 | PASS    |
| Band7       | 5MHz      | QPSK       | 20775   | 25RB#0           | NV            | 30               | 2500.24        | 2504.72        | 2500-25       | PASS    |

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

|       |      |       |       |        |    |     |                |                |               |      |
|-------|------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |      |       |       |        |    |     | 933            | 613            | 70            |      |
| Band7 | 5MHz | QPSK  | 20775 | 25RB#0 | NV | 40  | 2500.25<br>643 | 2504.72<br>933 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 20775 | 25RB#0 | NV | 50  | 2500.26<br>345 | 2504.73<br>035 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | -30 | 2500.25<br>772 | 2504.73<br>682 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | -20 | 2500.25<br>934 | 2504.72<br>664 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | -10 | 2500.26<br>446 | 2504.73<br>026 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 0   | 2500.25<br>838 | 2504.72<br>838 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 10  | 2500.25<br>82  | 2504.73<br>21  | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 20  | 2500.26<br>241 | 2504.73<br>011 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 30  | 2500.26<br>068 | 2504.73<br>568 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 40  | 2500.25<br>845 | 2504.73<br>065 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 20775 | 25RB#0 | NV | 50  | 2500.25<br>806 | 2504.72<br>996 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | -30 | 2532.75<br>666 | 2537.23<br>406 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | -20 | 2532.75<br>875 | 2537.23<br>185 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | -10 | 2532.76<br>166 | 2537.23<br>226 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 0   | 2532.75<br>792 | 2537.23<br>362 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 10  | 2532.76<br>034 | 2537.23<br>204 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 20  | 2532.75<br>905 | 2537.23<br>835 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 30  | 2532.75<br>786 | 2537.23<br>326 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 40  | 2532.75<br>702 | 2537.23<br>352 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21100 | 25RB#0 | NV | 50  | 2532.75<br>881 | 2537.23<br>391 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | -30 | 2532.76        | 2537.23        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |      |       |       |        |    |     |                |                |               |      |
|-------|------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |      |       |       |        |    |     | 623            | 053            | 70            |      |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | -20 | 2532.76<br>276 | 2537.23<br>296 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | -10 | 2532.76<br>235 | 2537.23<br>085 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 0   | 2532.76<br>395 | 2537.23<br>185 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 10  | 2532.76<br>167 | 2537.23<br>237 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 20  | 2532.76<br>39  | 2537.23<br>25  | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 30  | 2532.76<br>244 | 2537.23<br>234 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 40  | 2532.76<br>098 | 2537.23<br>118 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21100 | 25RB#0 | NV | 50  | 2532.76<br>573 | 2537.23<br>283 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | -30 | 2565.26<br>452 | 2569.73<br>802 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | -20 | 2565.26<br>614 | 2569.73<br>634 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | -10 | 2565.26<br>199 | 2569.73<br>629 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 0   | 2565.26<br>101 | 2569.73<br>861 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 10  | 2565.26<br>469 | 2569.73<br>459 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 20  | 2565.26<br>651 | 2569.73<br>711 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 30  | 2565.26<br>73  | 2569.73<br>24  | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 40  | 2565.26<br>494 | 2569.73<br>504 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | QPSK  | 21425 | 25RB#0 | NV | 50  | 2565.26<br>395 | 2569.73<br>765 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21425 | 25RB#0 | NV | -30 | 2565.26<br>52  | 2569.73<br>92  | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21425 | 25RB#0 | NV | -20 | 2565.26<br>305 | 2569.74<br>175 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21425 | 25RB#0 | NV | -10 | 2565.26<br>081 | 2569.74<br>151 | 2500-25<br>70 | PASS |
| Band7 | 5MHz | 16QAM | 21425 | 25RB#0 | NV | 0   | 2565.26        | 2569.73        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |     | 155            | 855            | 70            |      |
| Band7 | 5MHz  | 16QAM | 21425 | 25RB#0 | NV | 10  | 2565.26<br>487 | 2569.73<br>787 | 2500-25<br>70 | PASS |
| Band7 | 5MHz  | 16QAM | 21425 | 25RB#0 | NV | 20  | 2565.26<br>184 | 2569.73<br>184 | 2500-25<br>70 | PASS |
| Band7 | 5MHz  | 16QAM | 21425 | 25RB#0 | NV | 30  | 2565.26<br>499 | 2569.73<br>859 | 2500-25<br>70 | PASS |
| Band7 | 5MHz  | 16QAM | 21425 | 25RB#0 | NV | 40  | 2565.26<br>294 | 2569.73<br>984 | 2500-25<br>70 | PASS |
| Band7 | 5MHz  | 16QAM | 21425 | 25RB#0 | NV | 50  | 2565.26<br>308 | 2569.74<br>018 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | -30 | 2500.52<br>211 | 2509.45<br>641 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | -20 | 2500.52<br>949 | 2509.45<br>619 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | -10 | 2500.52<br>57  | 2509.45<br>42  | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 0   | 2500.52<br>8   | 2509.45<br>76  | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 10  | 2500.52<br>466 | 2509.46<br>456 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 20  | 2500.52<br>505 | 2509.45<br>565 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 30  | 2500.52<br>575 | 2509.45<br>355 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 40  | 2500.52<br>797 | 2509.45<br>677 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 20800 | 50RB#0 | NV | 50  | 2500.52<br>667 | 2509.45<br>407 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | -30 | 2500.53<br>203 | 2509.46<br>613 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | -20 | 2500.52<br>649 | 2509.46<br>259 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | -10 | 2500.52<br>698 | 2509.46<br>838 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 0   | 2500.53<br>255 | 2509.46<br>225 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 10  | 2500.52<br>772 | 2509.46<br>152 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 20  | 2500.53<br>247 | 2509.46<br>137 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 30  | 2500.52        | 2509.45        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |     | 721            | 471            | 70            |      |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 40  | 2500.53<br>025 | 2509.46<br>675 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 20800 | 50RB#0 | NV | 50  | 2500.53<br>157 | 2509.47<br>017 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | -30 | 2530.52<br>814 | 2539.47<br>554 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | -20 | 2530.53<br>778 | 2539.47<br>248 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | -10 | 2530.53<br>127 | 2539.47<br>957 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 0   | 2530.53<br>466 | 2539.47<br>476 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 10  | 2530.53<br>056 | 2539.47<br>676 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 20  | 2530.53<br>551 | 2539.47<br>631 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 30  | 2530.53<br>636 | 2539.46<br>826 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 40  | 2530.53<br>409 | 2539.47<br>279 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21100 | 50RB#0 | NV | 50  | 2530.54<br>09  | 2539.47<br>32  | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | -30 | 2530.54<br>067 | 2539.47<br>347 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | -20 | 2530.54<br>033 | 2539.47<br>363 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | -10 | 2530.53<br>847 | 2539.47<br>057 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 0   | 2530.54<br>292 | 2539.47<br>462 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 10  | 2530.53<br>739 | 2539.46<br>909 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 20  | 2530.54<br>114 | 2539.47<br>684 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 30  | 2530.53<br>681 | 2539.47<br>761 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 40  | 2530.54<br>033 | 2539.47<br>103 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21100 | 50RB#0 | NV | 50  | 2530.52<br>997 | 2539.47<br>147 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | -30 | 2560.53        | 2569.47        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |     | 191            | 461            | 70            |      |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | -20 | 2560.53<br>1   | 2569.46<br>9   | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | -10 | 2560.52<br>549 | 2569.47<br>419 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 0   | 2560.53<br>537 | 2569.47<br>347 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 10  | 2560.52<br>656 | 2569.47<br>646 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 20  | 2560.52<br>448 | 2569.47<br>538 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 30  | 2560.52<br>884 | 2569.47<br>374 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 40  | 2560.52<br>411 | 2569.46<br>771 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | QPSK  | 21400 | 50RB#0 | NV | 50  | 2560.53<br>552 | 2569.47<br>472 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | -30 | 2560.53<br>692 | 2569.46<br>972 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | -20 | 2560.53<br>017 | 2569.46<br>967 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | -10 | 2560.53<br>103 | 2569.47<br>073 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 0   | 2560.52<br>952 | 2569.47<br>402 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 10  | 2560.52<br>321 | 2569.47<br>261 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 20  | 2560.53<br>544 | 2569.47<br>724 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 30  | 2560.52<br>642 | 2569.47<br>582 | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 40  | 2560.53<br>34  | 2569.47<br>38  | 2500-25<br>70 | PASS |
| Band7 | 10MHz | 16QAM | 21400 | 50RB#0 | NV | 50  | 2560.53<br>373 | 2569.47<br>333 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | -30 | 2500.78<br>818 | 2514.18<br>118 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | -20 | 2500.79<br>933 | 2514.18<br>133 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | -10 | 2500.80<br>331 | 2514.18<br>031 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 0   | 2500.78        | 2514.17        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |     | 934            | 634            | 70            |      |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 10  | 2500.79<br>783 | 2514.17<br>983 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 20  | 2500.79<br>975 | 2514.18<br>375 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 30  | 2500.80<br>017 | 2514.18<br>517 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 40  | 2500.78<br>9   | 2514.17<br>9   | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 20825 | 75RB#0 | NV | 50  | 2500.78<br>564 | 2514.17<br>664 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | -30 | 2500.80<br>011 | 2514.18<br>411 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | -20 | 2500.79<br>048 | 2514.20<br>248 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | -10 | 2500.78<br>475 | 2514.19<br>175 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 0   | 2500.78<br>973 | 2514.19<br>873 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 10  | 2500.79<br>037 | 2514.18<br>737 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 20  | 2500.79<br>148 | 2514.18<br>548 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 30  | 2500.79<br>663 | 2514.18<br>963 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 40  | 2500.77<br>857 | 2514.17<br>957 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 20825 | 75RB#0 | NV | 50  | 2500.79<br>02  | 2514.19<br>72  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | -30 | 2528.31<br>255 | 2541.70<br>255 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | -20 | 2528.30<br>859 | 2541.70<br>259 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | -10 | 2528.31<br>398 | 2541.70<br>198 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 0   | 2528.31<br>97  | 2541.71<br>07  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 10  | 2528.30<br>399 | 2541.70<br>599 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 20  | 2528.31<br>219 | 2541.70<br>419 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 30  | 2528.31        | 2541.70        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |        |    |     |                |                |               |      |
|-------|-------|-------|-------|--------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |        |    |     | 689            | 689            | 70            |      |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 40  | 2528.30<br>558 | 2541.70<br>158 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21100 | 75RB#0 | NV | 50  | 2528.31<br>198 | 2541.70<br>798 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | -30 | 2528.30<br>563 | 2541.69<br>763 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | -20 | 2528.30<br>488 | 2541.69<br>988 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | -10 | 2528.31<br>075 | 2541.69<br>475 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 0   | 2528.31<br>743 | 2541.71<br>243 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 10  | 2528.31<br>032 | 2541.70<br>232 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 20  | 2528.30<br>717 | 2541.70<br>017 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 30  | 2528.32<br>607 | 2541.69<br>407 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 40  | 2528.31<br>666 | 2541.70<br>066 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21100 | 75RB#0 | NV | 50  | 2528.31<br>613 | 2541.69<br>913 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | -30 | 2555.79<br>609 | 2569.22<br>109 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | -20 | 2555.80<br>484 | 2569.22<br>684 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | -10 | 2555.80<br>646 | 2569.21<br>846 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 0   | 2555.80<br>607 | 2569.22<br>307 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 10  | 2555.80<br>275 | 2569.22<br>875 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 20  | 2555.79<br>828 | 2569.22<br>928 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 30  | 2555.79<br>676 | 2569.21<br>976 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 40  | 2555.81<br>186 | 2569.22<br>786 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | QPSK  | 21375 | 75RB#0 | NV | 50  | 2555.80<br>041 | 2569.21<br>741 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0 | NV | -30 | 2555.80        | 2569.22        | 2500-25       | PASS |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       |             |    |     | 759            | 459            | 70            |      |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | -20 | 2555.81<br>312 | 2569.22<br>712 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | -10 | 2555.81<br>01  | 2569.22<br>91  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 0   | 2555.81<br>99  | 2569.21<br>59  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 10  | 2555.81<br>444 | 2569.21<br>444 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 20  | 2555.80<br>931 | 2569.22<br>431 | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 30  | 2555.80<br>08  | 2569.22<br>48  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 40  | 2555.81<br>39  | 2569.21<br>99  | 2500-25<br>70 | PASS |
| Band7 | 15MHz | 16QAM | 21375 | 75RB#0      | NV | 50  | 2555.81<br>934 | 2569.22<br>234 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | -30 | 2501.07<br>106 | 2518.92<br>806 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | -20 | 2501.06<br>602 | 2518.94<br>102 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | -10 | 2501.06<br>573 | 2518.92<br>073 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 0   | 2501.07<br>611 | 2518.93<br>211 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 10  | 2501.07<br>009 | 2518.93<br>209 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 20  | 2501.07<br>313 | 2518.92<br>513 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 30  | 2501.08<br>153 | 2518.92<br>653 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 40  | 2501.08<br>442 | 2518.92<br>542 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 20850 | 100RB#<br>0 | NV | 50  | 2501.07<br>432 | 2518.91<br>932 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | -30 | 2501.05<br>362 | 2518.93<br>262 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | -20 | 2501.06<br>476 | 2518.92<br>676 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | -10 | 2501.05<br>307 | 2518.92<br>207 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#      | NV | 0   | 2501.05        | 2518.92        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       | 0           |    |     | 58             | 58             | 70            |      |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | 10  | 2501.05<br>044 | 2518.93<br>344 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | 20  | 2501.06<br>039 | 2518.92<br>139 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | 30  | 2501.05<br>174 | 2518.92<br>274 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | 40  | 2501.06<br>243 | 2518.92<br>143 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 20850 | 100RB#<br>0 | NV | 50  | 2501.06<br>184 | 2518.92<br>984 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | -30 | 2526.10<br>8   | 2543.92<br>8   | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | -20 | 2526.08<br>586 | 2543.92<br>886 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | -10 | 2526.09<br>678 | 2543.91<br>778 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 0   | 2526.09<br>65  | 2543.93<br>65  | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 10  | 2526.11<br>704 | 2543.91<br>604 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 20  | 2526.09<br>422 | 2543.91<br>922 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 30  | 2526.09<br>689 | 2543.92<br>789 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 40  | 2526.08<br>236 | 2543.92<br>836 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21100 | 100RB#<br>0 | NV | 50  | 2526.10<br>176 | 2543.91<br>176 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | -30 | 2526.10<br>064 | 2543.93<br>564 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | -20 | 2526.11<br>998 | 2543.94<br>198 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | -10 | 2526.10<br>699 | 2543.92<br>899 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | 0   | 2526.11<br>445 | 2543.92<br>245 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | 10  | 2526.11<br>295 | 2543.91<br>295 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | 20  | 2526.11<br>689 | 2543.95<br>389 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#      | NV | 30  | 2526.11        | 2543.93        | 2500-25       | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|       |       |       |       |             |    |     |                |                |               |      |
|-------|-------|-------|-------|-------------|----|-----|----------------|----------------|---------------|------|
|       |       |       |       | 0           |    |     | 828            | 728            | 70            |      |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | 40  | 2526.10<br>858 | 2543.94<br>958 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21100 | 100RB#<br>0 | NV | 50  | 2526.09<br>901 | 2543.93<br>401 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | -30 | 2551.08<br>229 | 2568.95<br>329 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | -20 | 2551.07<br>534 | 2568.95<br>734 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | -10 | 2551.07<br>847 | 2568.94<br>447 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 0   | 2551.07<br>033 | 2568.96<br>833 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 10  | 2551.08<br>417 | 2568.95<br>417 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 20  | 2551.07<br>672 | 2568.96<br>172 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 30  | 2551.07<br>836 | 2568.97<br>836 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 40  | 2551.05<br>829 | 2568.93<br>829 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | QPSK  | 21350 | 100RB#<br>0 | NV | 50  | 2551.07<br>754 | 2568.95<br>754 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | -30 | 2551.09<br>354 | 2568.95<br>654 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | -20 | 2551.09<br>48  | 2568.96<br>38  | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | -10 | 2551.10<br>4   | 2568.96<br>1   | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 0   | 2551.10<br>097 | 2568.97<br>297 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 10  | 2551.08<br>866 | 2568.94<br>766 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 20  | 2551.10<br>801 | 2568.94<br>701 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 30  | 2551.09<br>922 | 2568.96<br>922 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 40  | 2551.10<br>083 | 2568.96<br>983 | 2500-25<br>70 | PASS |
| Band7 | 20MHz | 16QAM | 21350 | 100RB#<br>0 | NV | 50  | 2551.08<br>749 | 2568.96<br>249 | 2500-25<br>70 | PASS |

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Test Graphs

