


Test Graphs




Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
Tel: (86) 0755-26066440 Email: service@anbotech.com

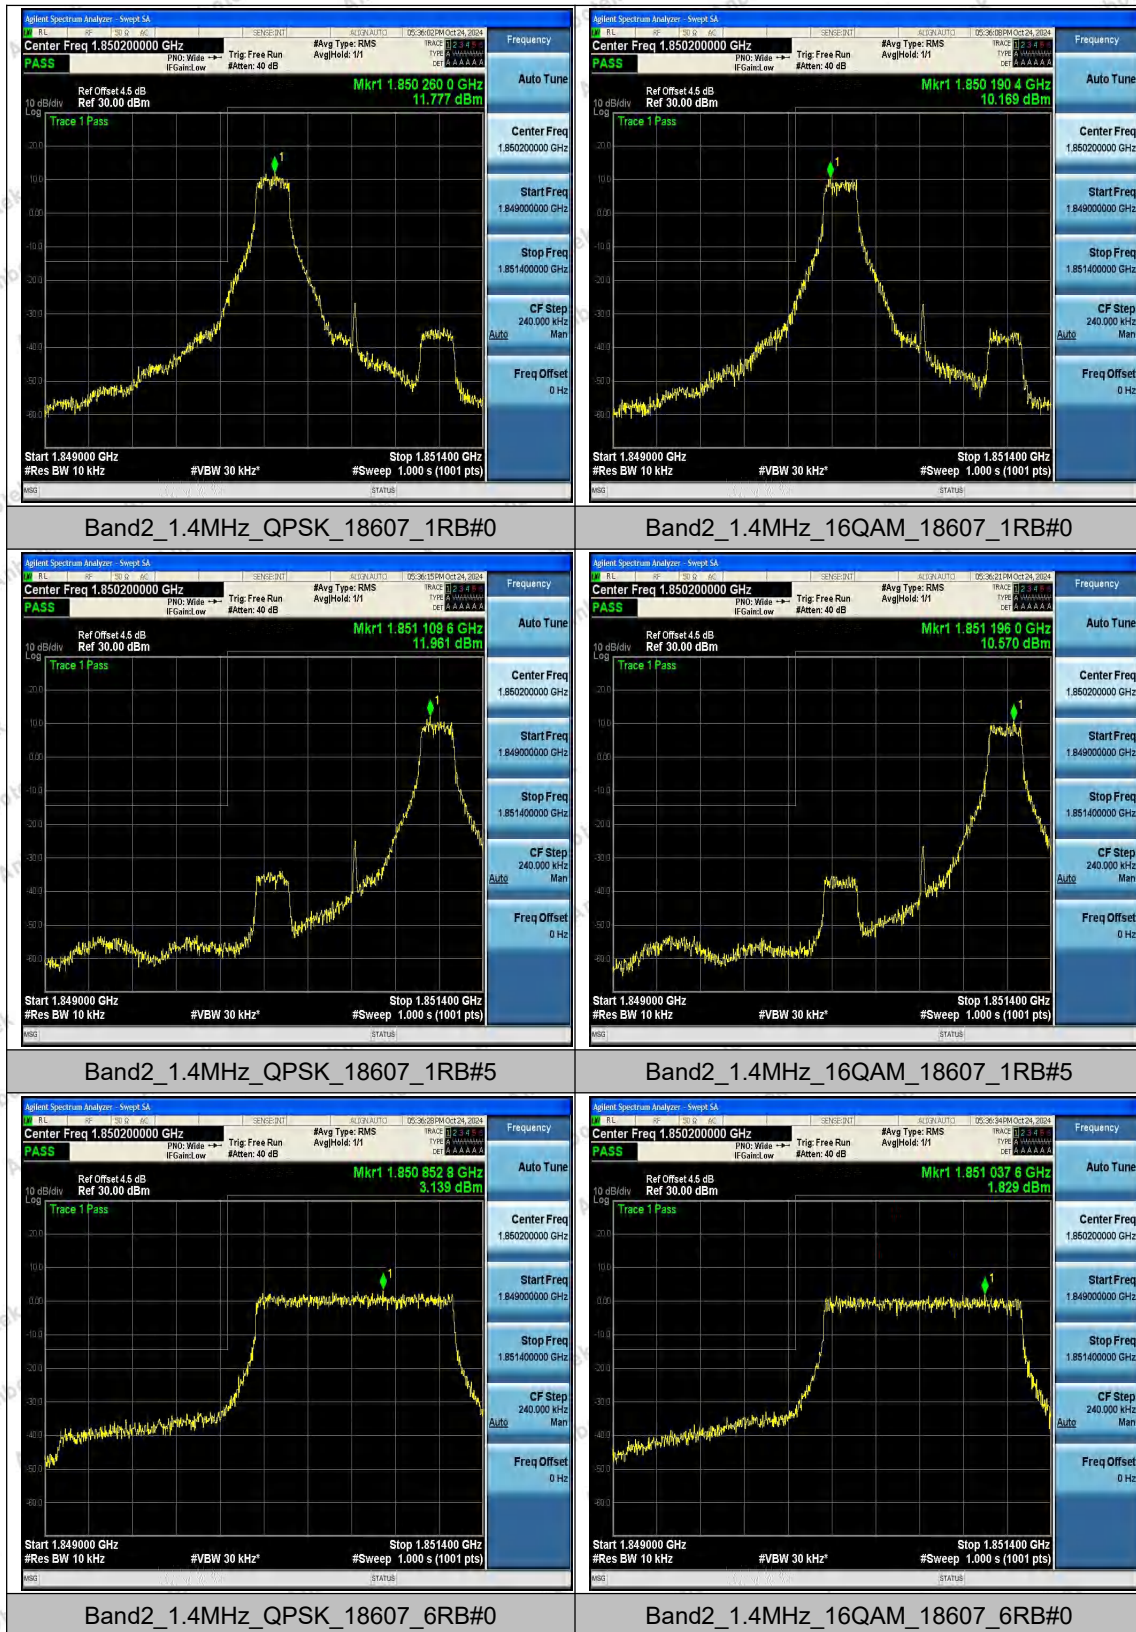



Hotline
400-003-0500
www.anbotech.com




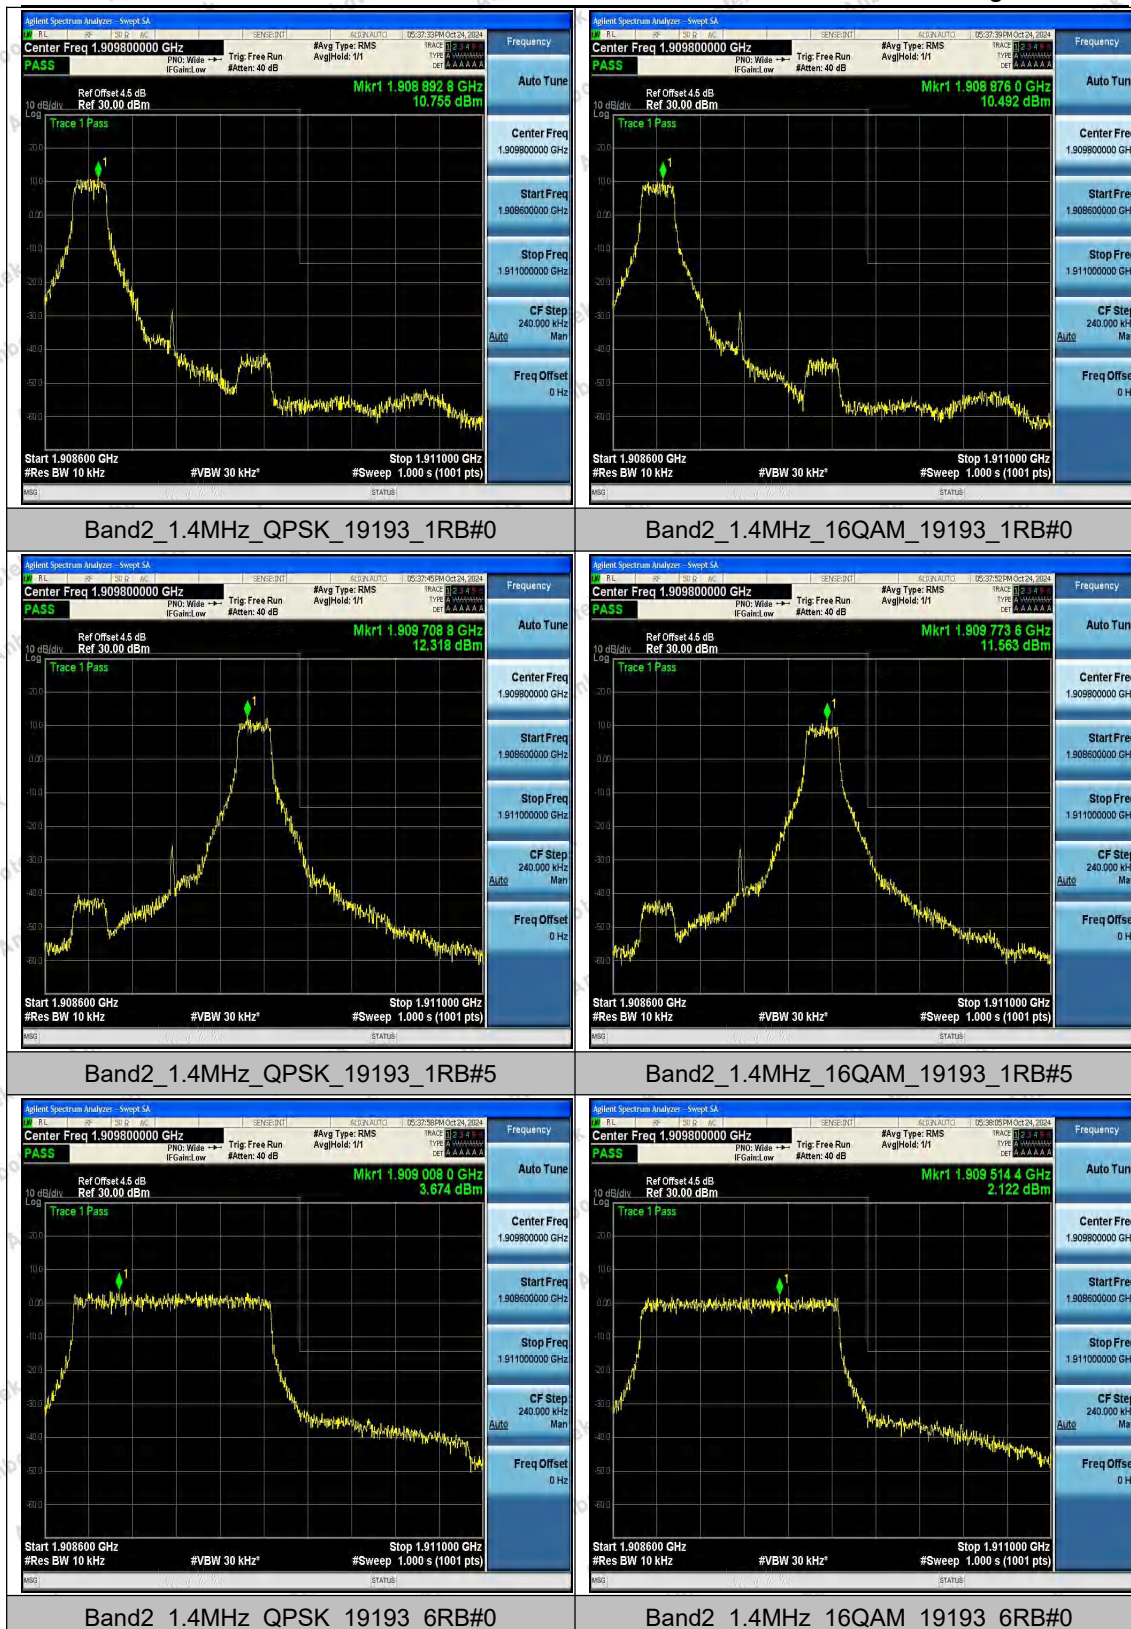


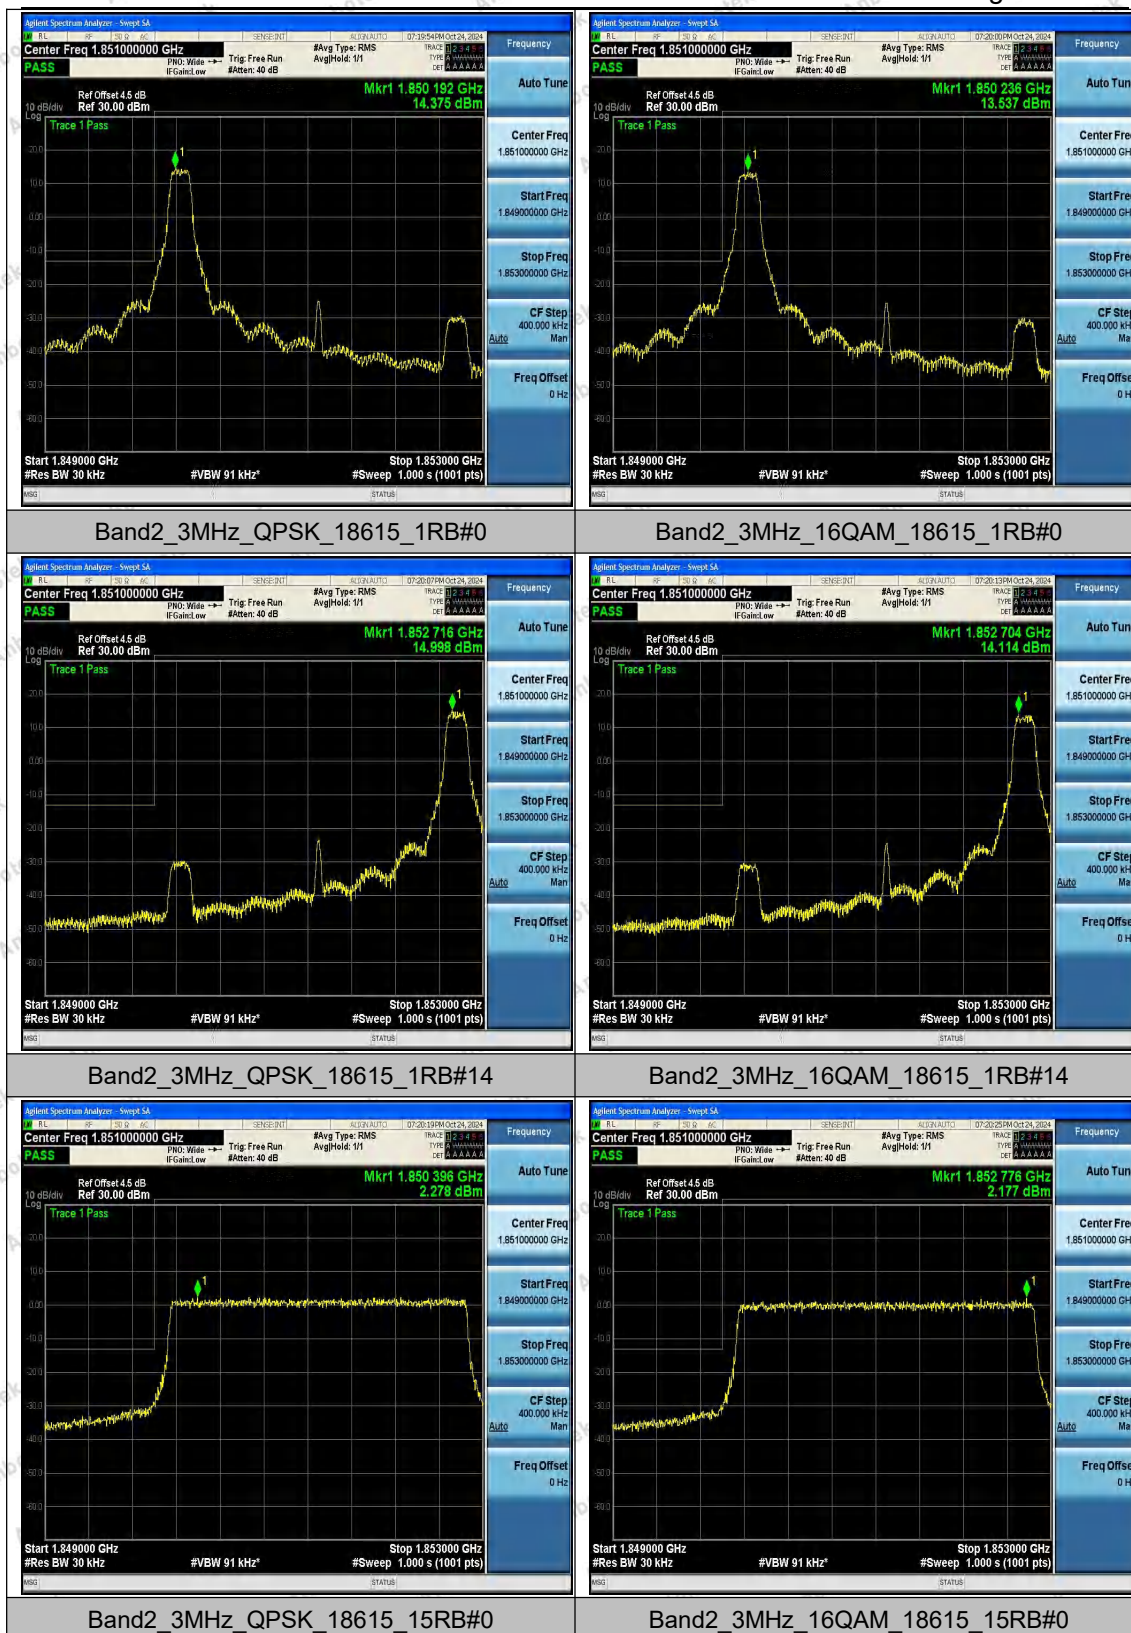


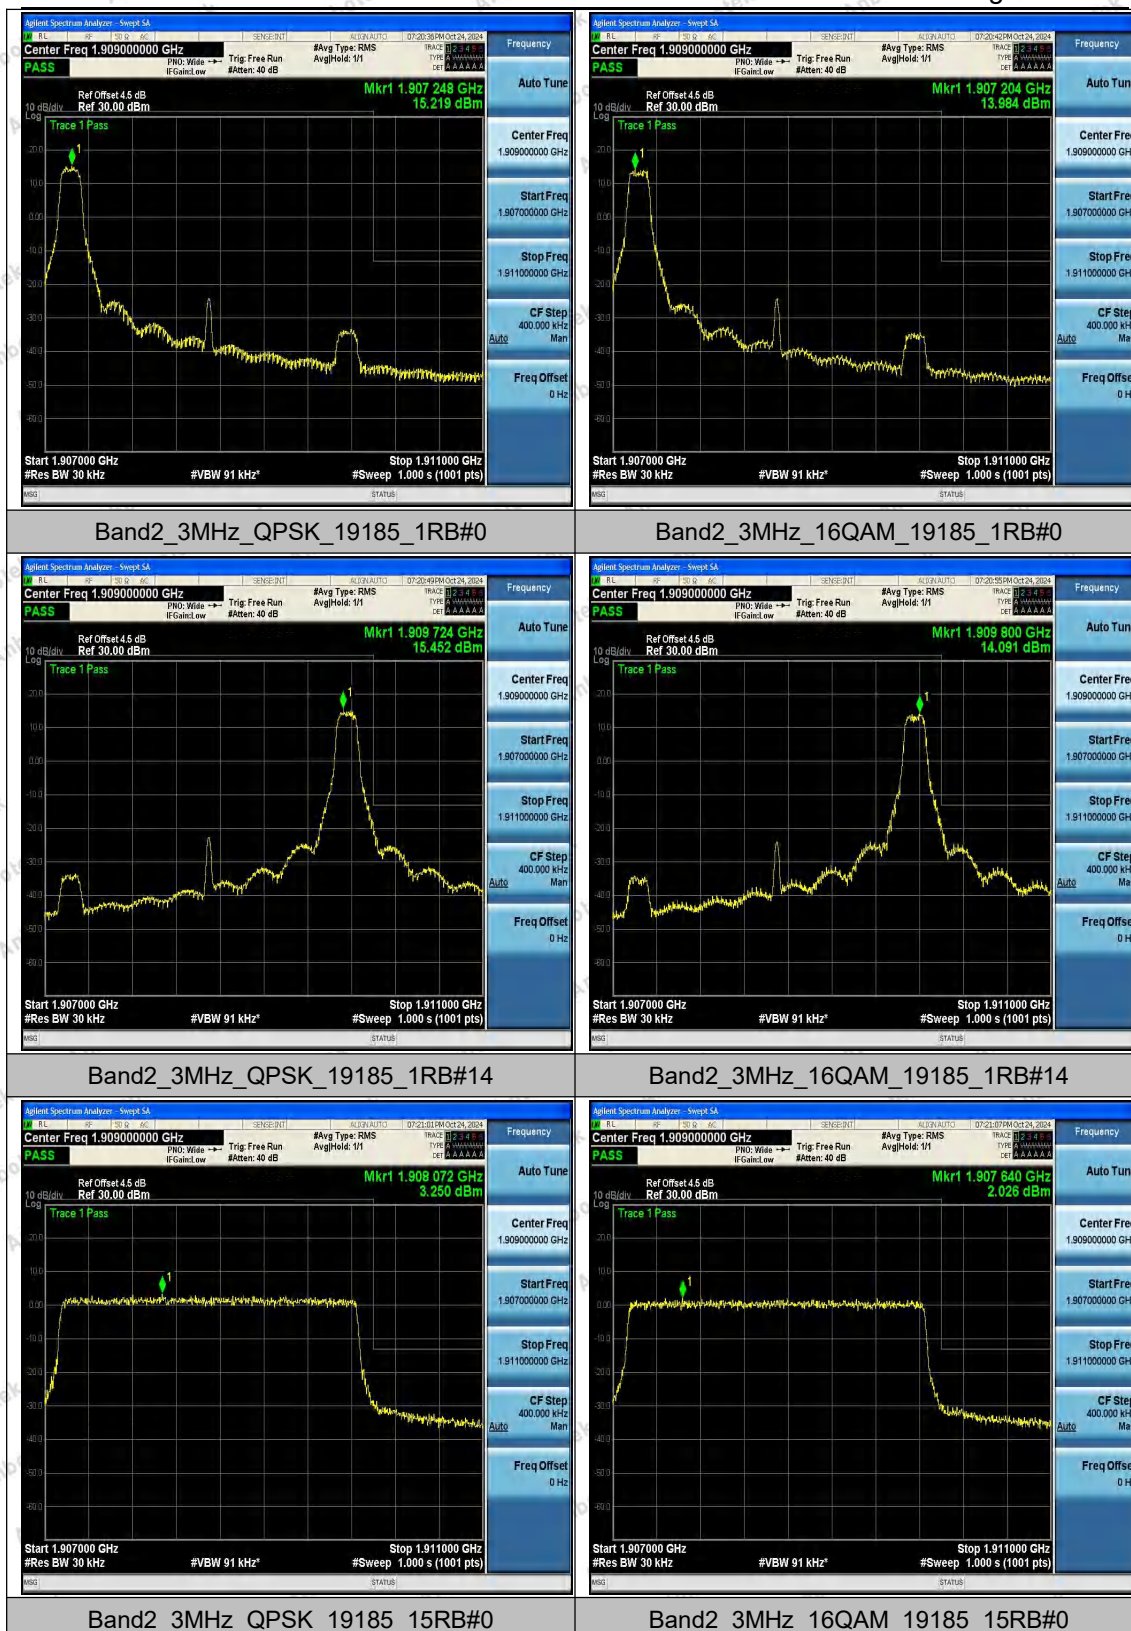


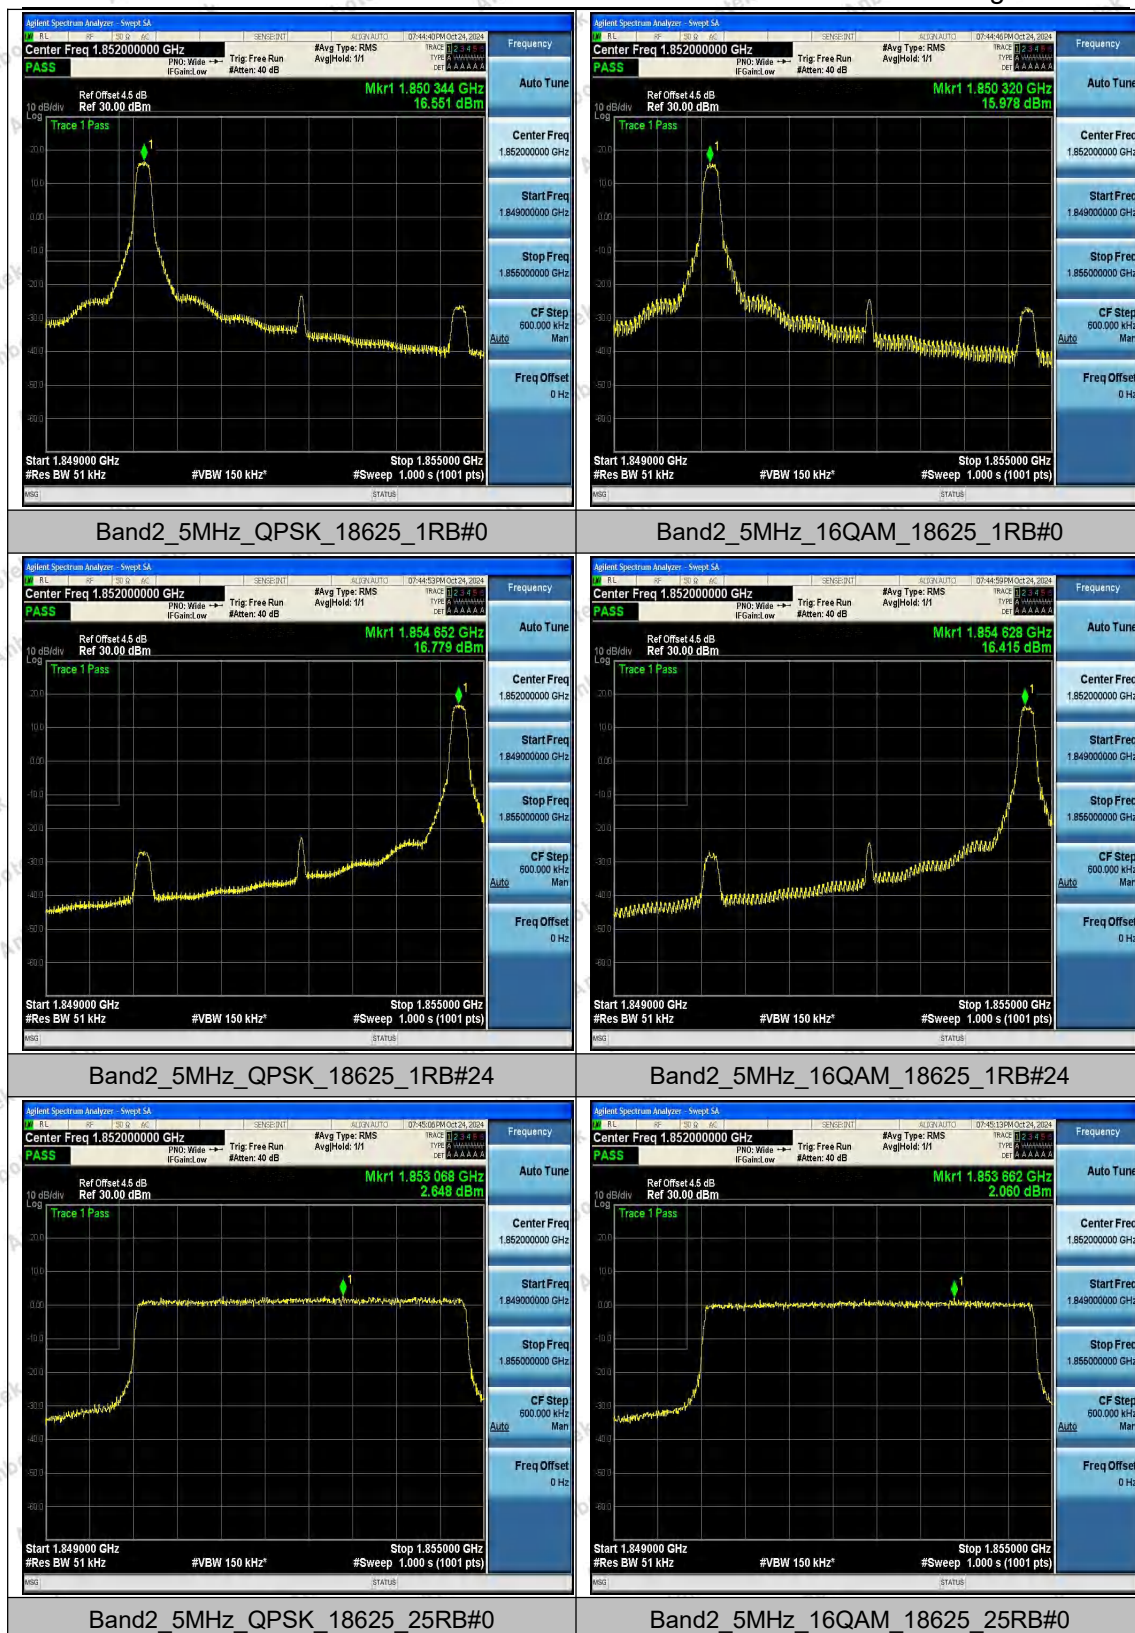


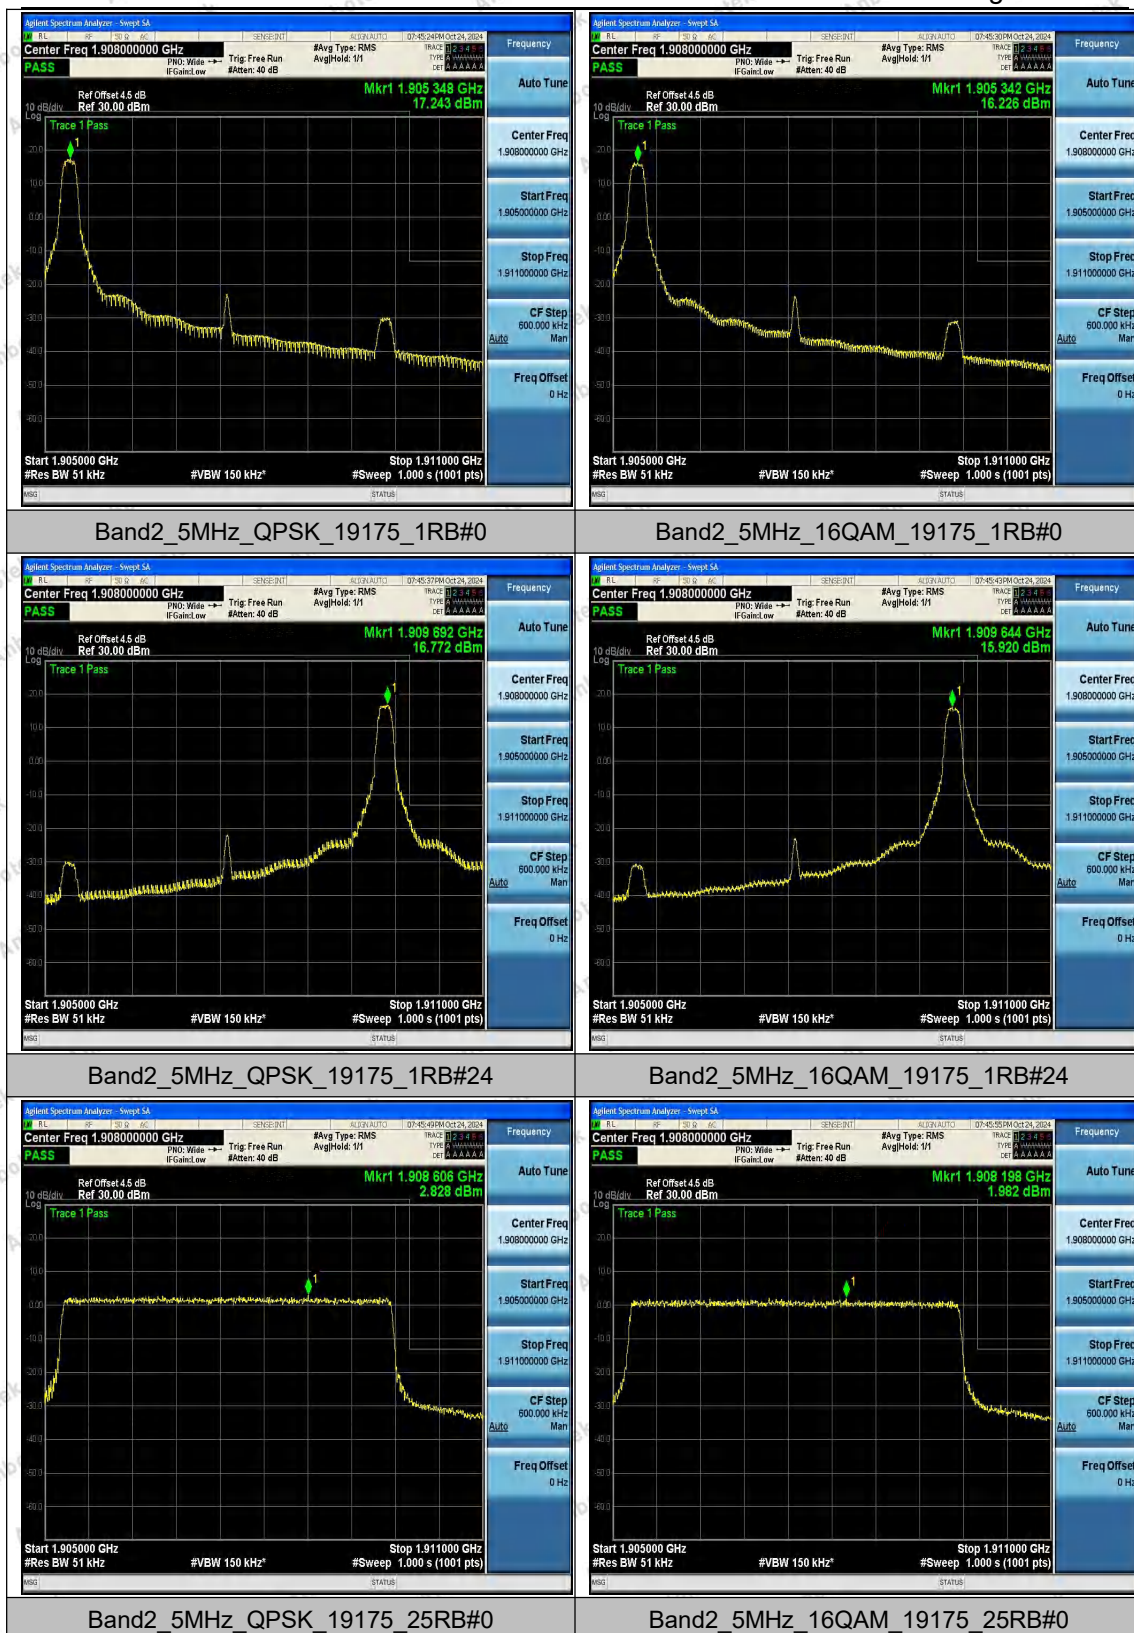


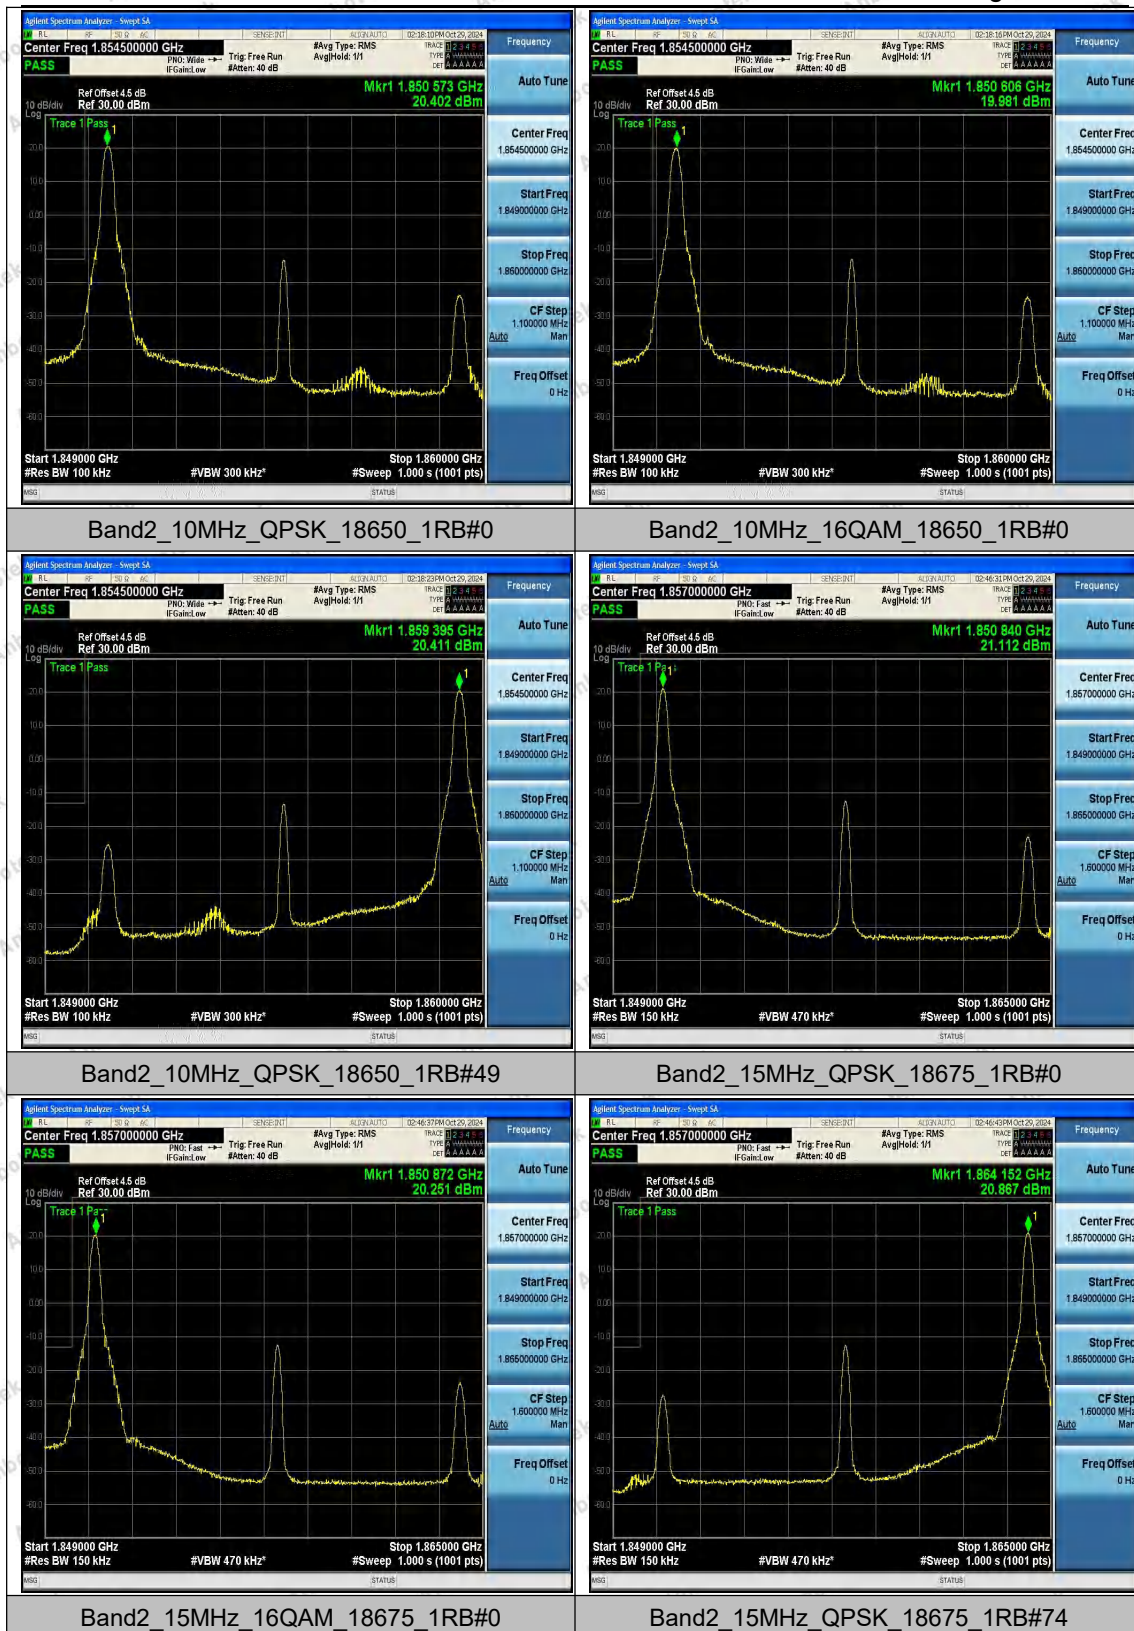

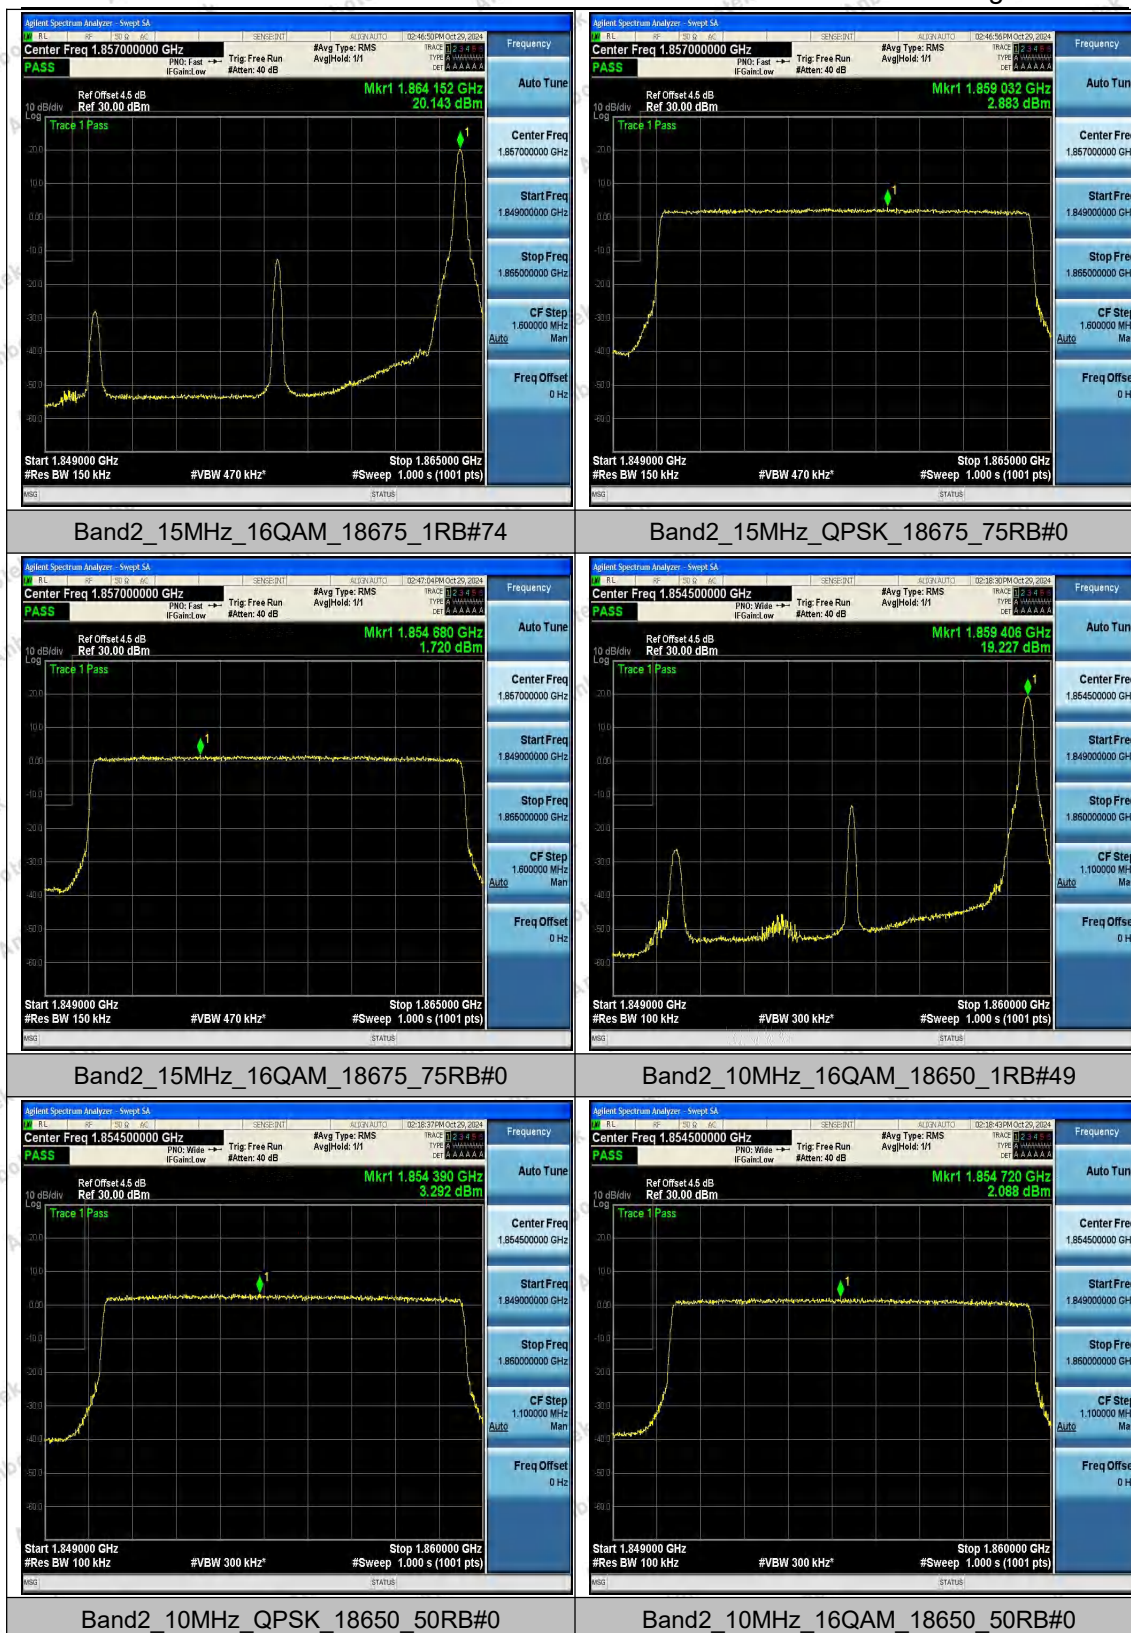

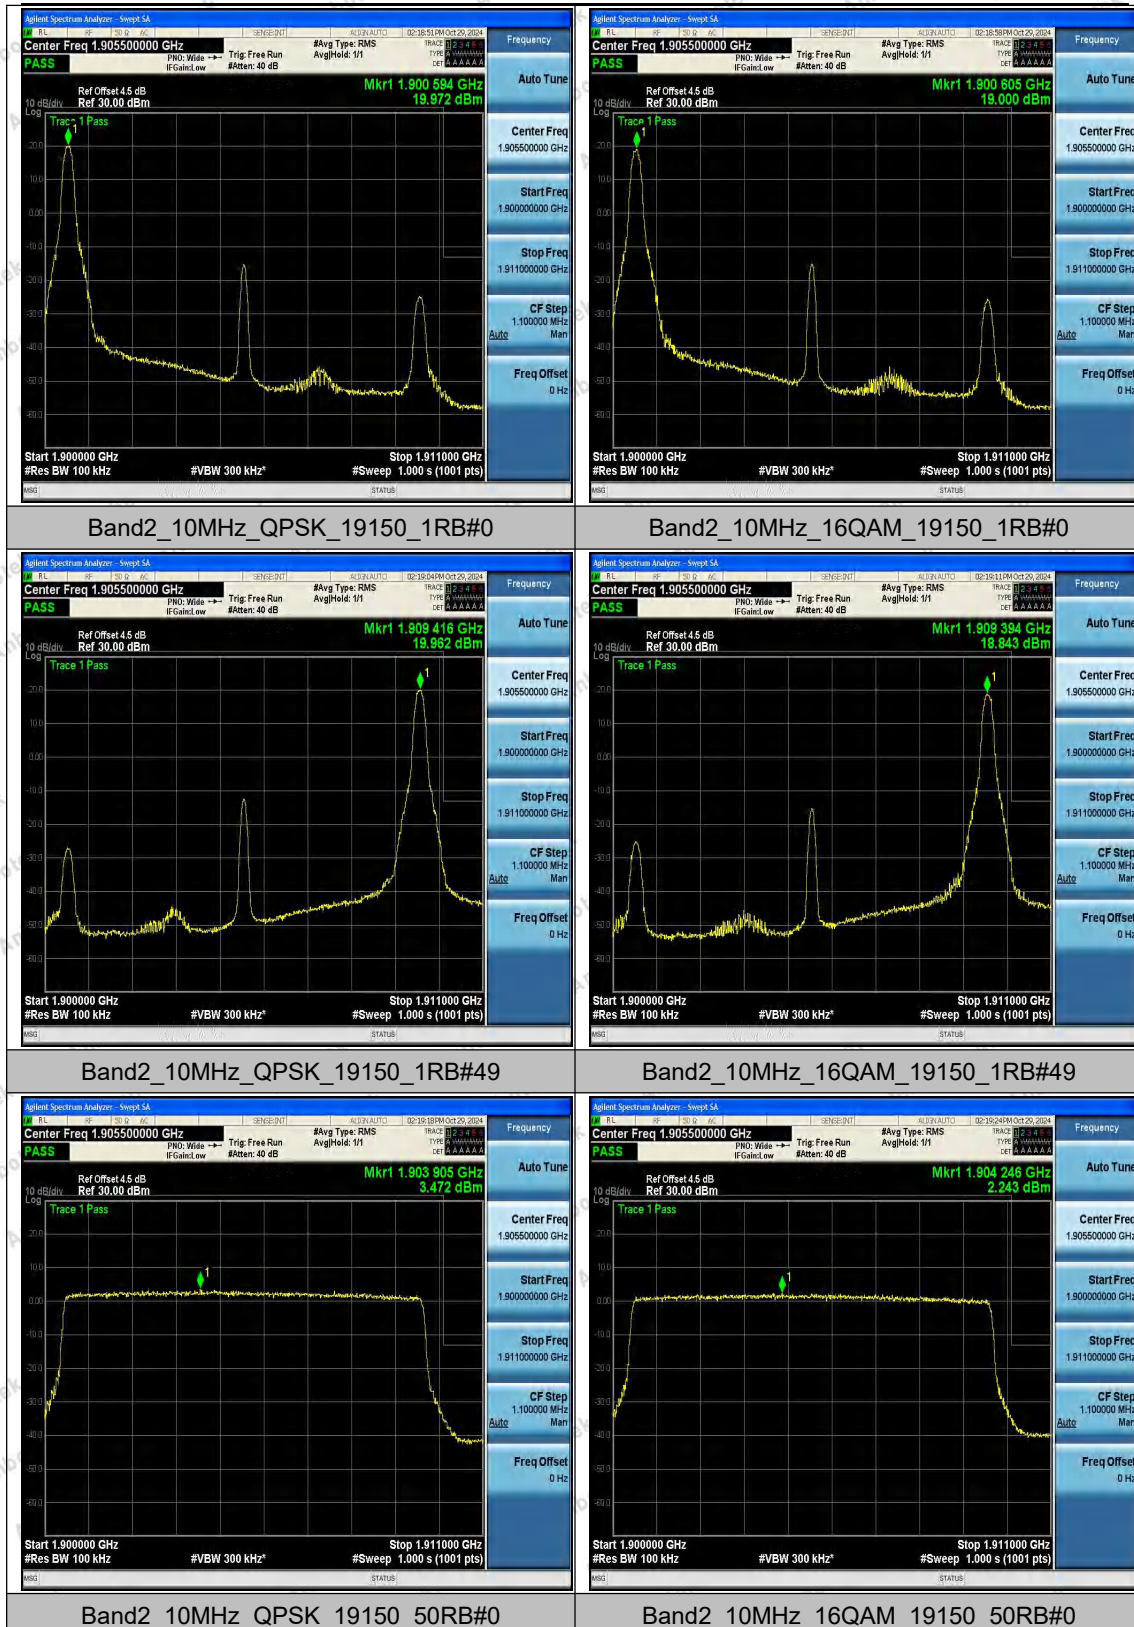

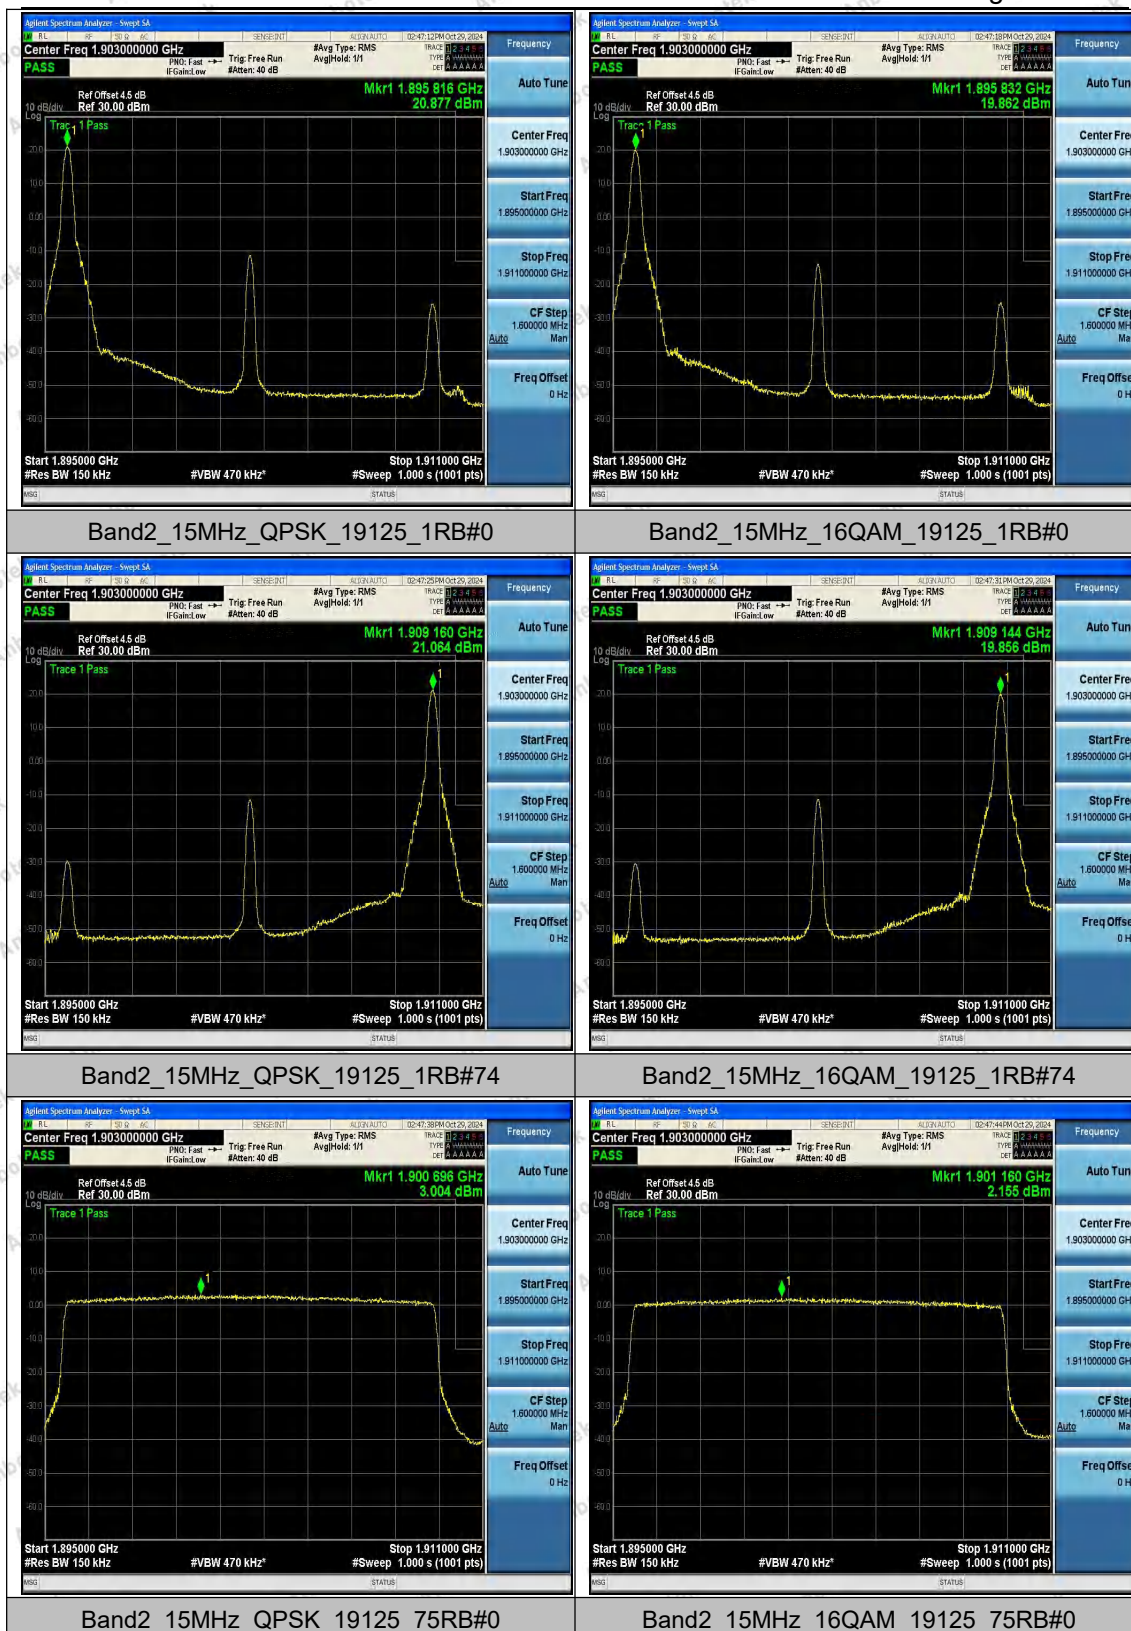

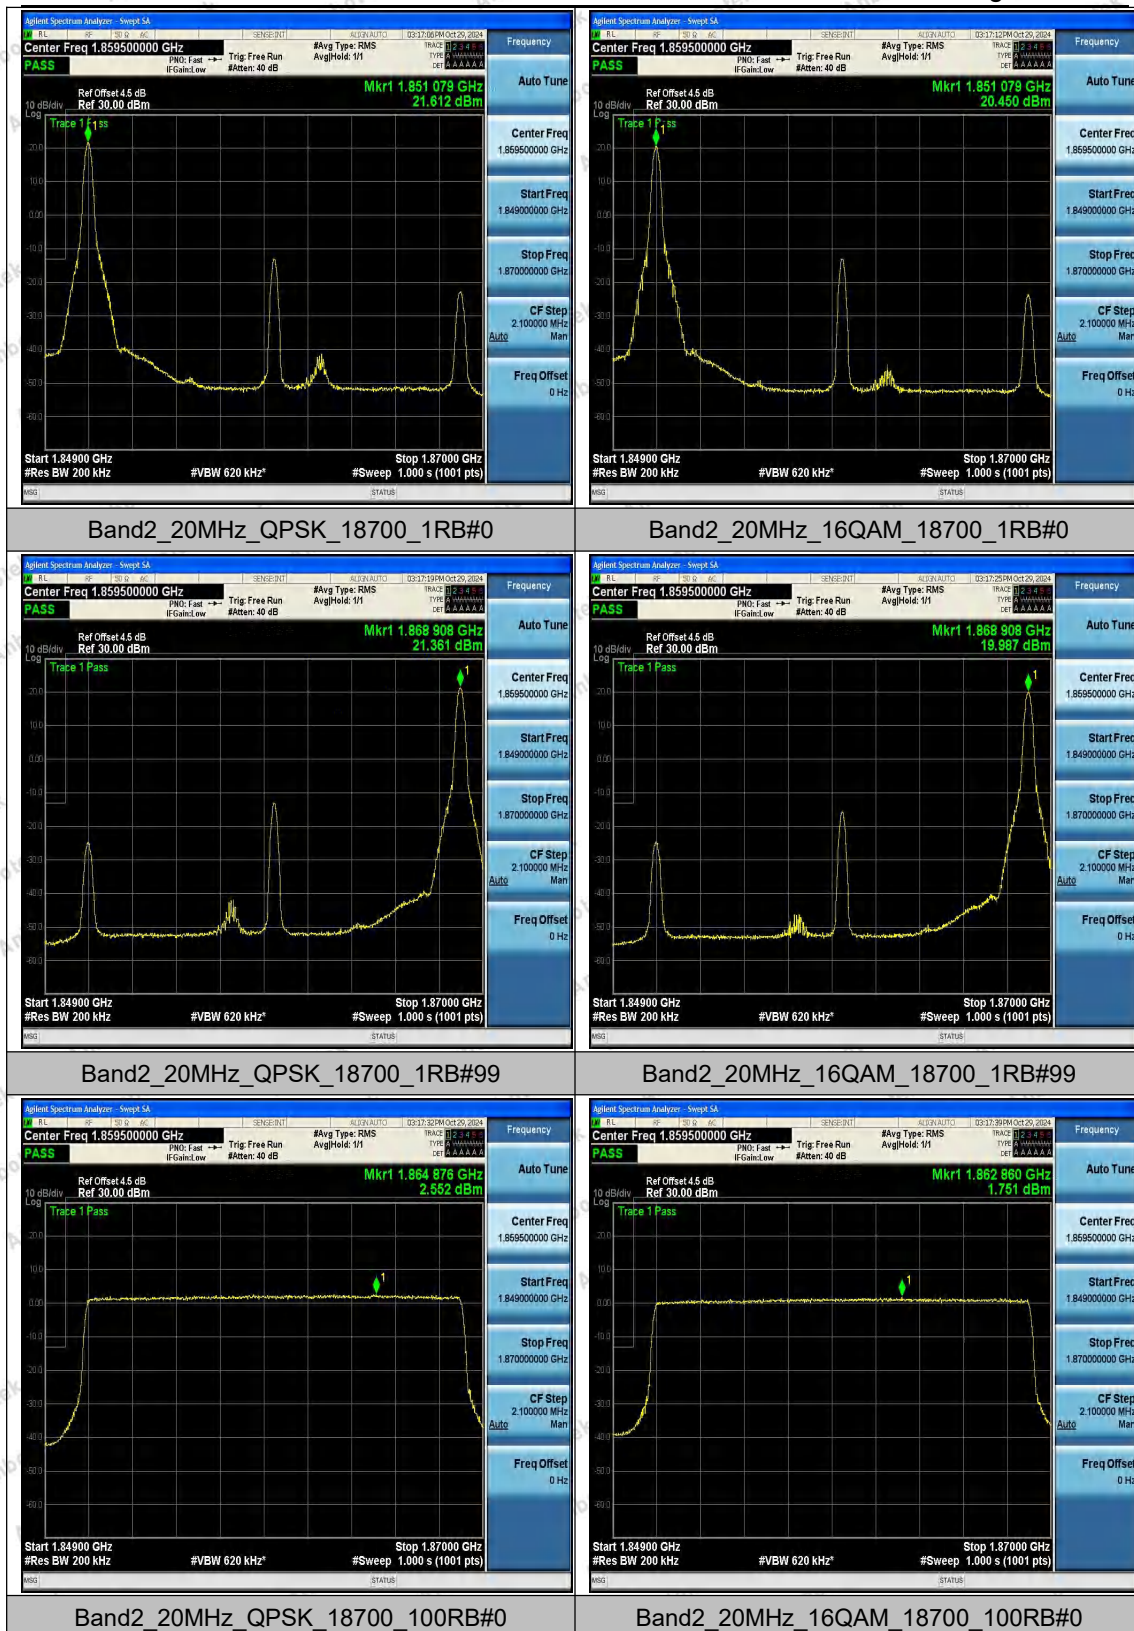


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



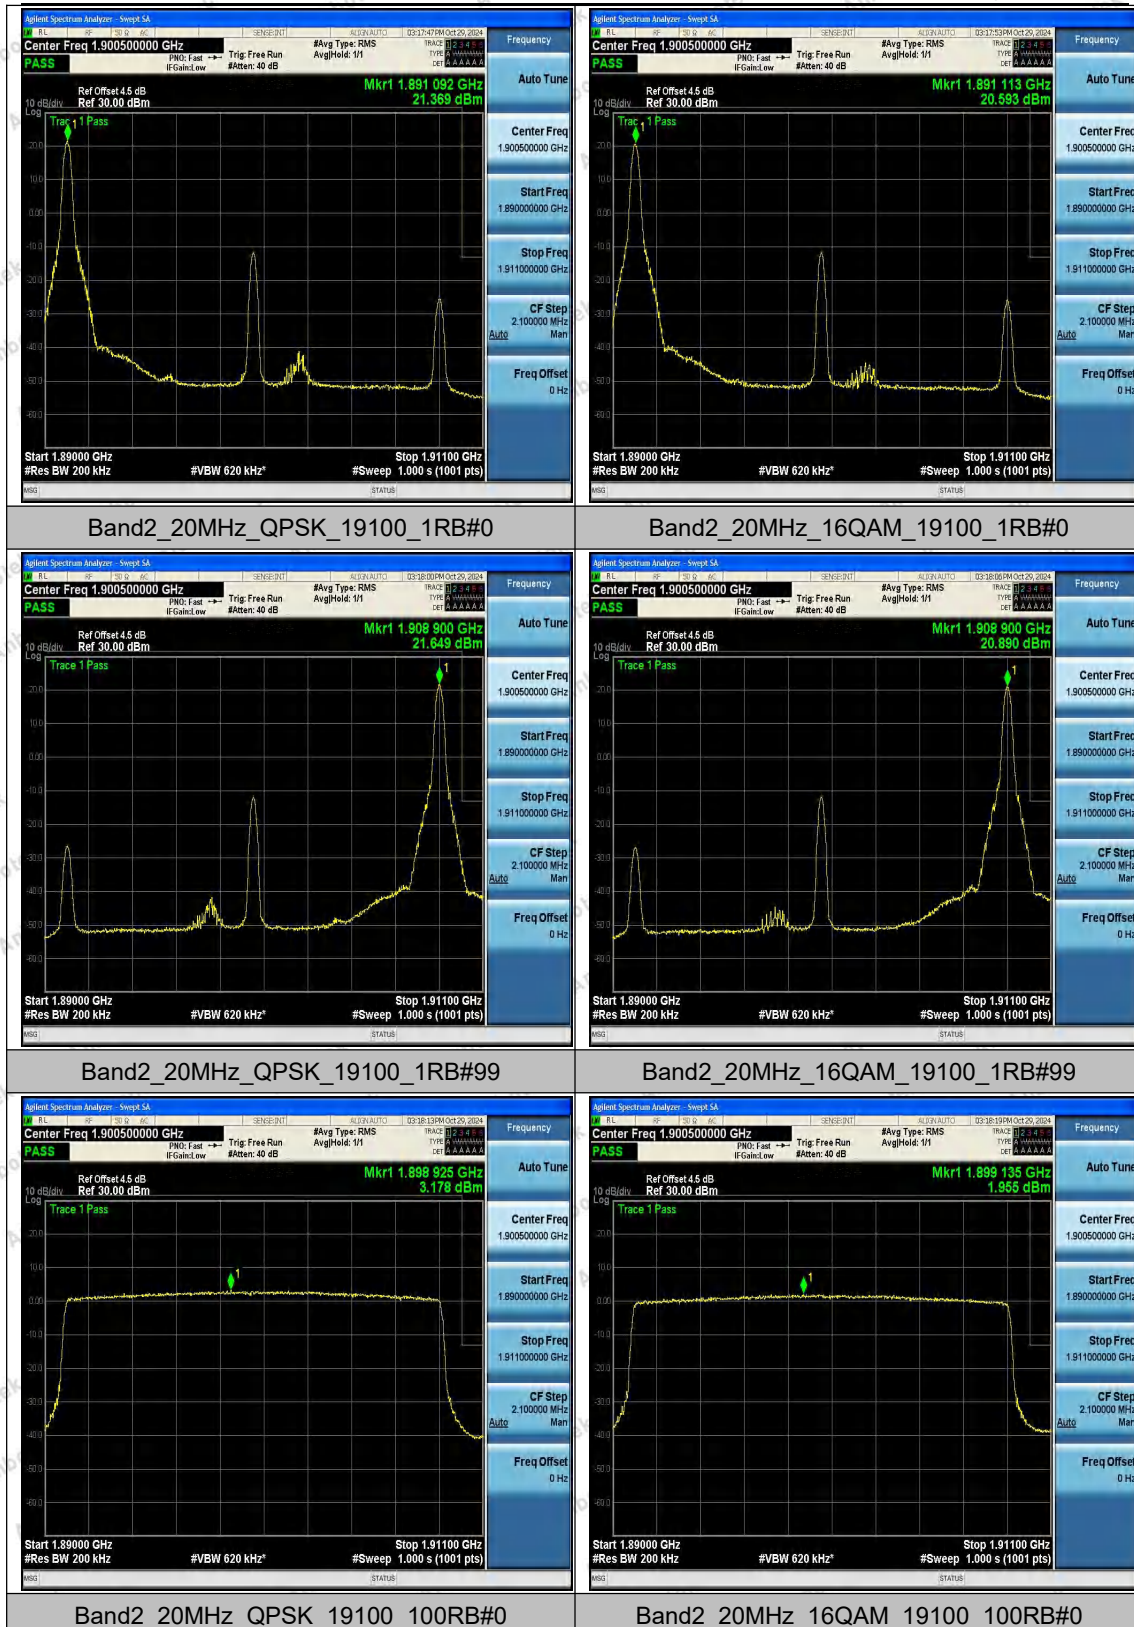

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	0.009~0.15	-58.27	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	0.15~30	-57.50	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	30~1000	-66.11	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	1000~3000	-43.96	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	3000~20000	-47.68	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	0.009~0.15	-59.17	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	0.15~30	-55.47	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	30~1000	-66.33	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	1000~3000	-44.56	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	3000~20000	-47.76	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	0.009~0.15	-59.89	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	0.15~30	-58.51	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	30~1000	-66.19	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	1000~3000	-43.48	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	3000~20000	-47.84	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	0.009~0.15	-60.27	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	0.15~30	-55.03	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	30~1000	-66.26	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	1000~3000	-43.68	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	3000~20000	-47.84	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	0.009~0.15	-57.11	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	0.15~30	-55.85	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	30~1000	-65.78	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	1000~3000	-42.72	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	3000~20000	-47.34	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	0.009~0.15	-57.03	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	0.15~30	-56.00	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	30~1000	-66.00	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	1000~3000	-43.84	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	3000~20000	-47.80	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.009~0.15	-56.32	PASS
Band2	3MHz	QPSK	18615	1RB#0	0.15~30	-54.53	PASS
Band2	3MHz	QPSK	18615	1RB#0	30~1000	-66.24	PASS
Band2	3MHz	QPSK	18615	1RB#0	1000~3000	-49.02	PASS
Band2	3MHz	QPSK	18615	1RB#0	3000~20000	-47.40	PASS
Band2	3MHz	16QAM	18615	1RB#0	0.009~0.15	-62.54	PASS
Band2	3MHz	16QAM	18615	1RB#0	0.15~30	-54.94	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	3MHz	16QAM	18615	1RB#0	30~1000	-65.97	PASS
Band2	3MHz	16QAM	18615	1RB#0	1000~3000	-49.57	PASS
Band2	3MHz	16QAM	18615	1RB#0	3000~20000	-47.86	PASS
Band2	3MHz	QPSK	18900	1RB#0	0.009~0.15	-60.68	PASS
Band2	3MHz	QPSK	18900	1RB#0	0.15~30	-59.62	PASS
Band2	3MHz	QPSK	18900	1RB#0	30~1000	-66.03	PASS
Band2	3MHz	QPSK	18900	1RB#0	1000~3000	-49.66	PASS
Band2	3MHz	QPSK	18900	1RB#0	3000~20000	-47.51	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.009~0.15	-58.63	PASS
Band2	3MHz	16QAM	18900	1RB#0	0.15~30	-55.62	PASS
Band2	3MHz	16QAM	18900	1RB#0	30~1000	-66.40	PASS
Band2	3MHz	16QAM	18900	1RB#0	1000~3000	-50.33	PASS
Band2	3MHz	16QAM	18900	1RB#0	3000~20000	-47.42	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.009~0.15	-54.54	PASS
Band2	3MHz	QPSK	19185	1RB#0	0.15~30	-55.42	PASS
Band2	3MHz	QPSK	19185	1RB#0	30~1000	-66.34	PASS
Band2	3MHz	QPSK	19185	1RB#0	1000~3000	-46.40	PASS
Band2	3MHz	QPSK	19185	1RB#0	3000~20000	-47.51	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.009~0.15	-58.01	PASS
Band2	3MHz	16QAM	19185	1RB#0	0.15~30	-57.16	PASS
Band2	3MHz	16QAM	19185	1RB#0	30~1000	-66.05	PASS
Band2	3MHz	16QAM	19185	1RB#0	1000~3000	-47.46	PASS
Band2	3MHz	16QAM	19185	1RB#0	3000~20000	-47.39	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.009~0.15	-59.13	PASS
Band2	5MHz	QPSK	18625	1RB#0	0.15~30	-56.03	PASS
Band2	5MHz	QPSK	18625	1RB#0	30~1000	-66.21	PASS
Band2	5MHz	QPSK	18625	1RB#0	1000~3000	-52.42	PASS
Band2	5MHz	QPSK	18625	1RB#0	3000~20000	-47.60	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.009~0.15	-58.71	PASS
Band2	5MHz	16QAM	18625	1RB#0	0.15~30	-54.84	PASS
Band2	5MHz	16QAM	18625	1RB#0	30~1000	-66.29	PASS
Band2	5MHz	16QAM	18625	1RB#0	1000~3000	-52.25	PASS
Band2	5MHz	16QAM	18625	1RB#0	3000~20000	-47.66	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.009~0.15	-57.17	PASS
Band2	5MHz	QPSK	18900	1RB#0	0.15~30	-55.25	PASS
Band2	5MHz	QPSK	18900	1RB#0	30~1000	-66.30	PASS
Band2	5MHz	QPSK	18900	1RB#0	1000~3000	-51.70	PASS
Band2	5MHz	QPSK	18900	1RB#0	3000~20000	-47.58	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.009~0.15	-55.79	PASS
Band2	5MHz	16QAM	18900	1RB#0	0.15~30	-56.40	PASS
Band2	5MHz	16QAM	18900	1RB#0	30~1000	-65.73	PASS
Band2	5MHz	16QAM	18900	1RB#0	1000~3000	-51.50	PASS



Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-47.83	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.009~0.15	-62.01	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.15~30	-53.69	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-65.88	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-49.34	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-47.74	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.009~0.15	-60.66	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.15~30	-57.42	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-66.13	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-51.03	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-47.91	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.009~0.15	-59.31	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.15~30	-55.46	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-66.47	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-52.51	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-47.81	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.009~0.15	-55.73	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.15~30	-56.30	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-66.07	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-52.06	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-48.02	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.009~0.15	-61.10	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.15~30	-55.48	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-66.18	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-52.40	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-47.67	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.009~0.15	-57.71	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.15~30	-55.47	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-66.25	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-52.37	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-47.48	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.009~0.15	-58.10	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.15~30	-55.05	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-66.22	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-50.58	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-47.88	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.009~0.15	-56.41	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.15~30	-56.30	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-66.12	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-52.44	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.15~30	-56.05	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-66.34	PASS



Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-52.67	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-47.56	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.009~0.15	-60.41	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.15~30	-56.31	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-66.29	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-52.40	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-47.18	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.009~0.15	-58.99	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.15~30	-56.52	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-66.21	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-52.57	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-47.55	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.009~0.15	-59.21	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.15~30	-57.54	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-66.36	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-52.30	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-47.43	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.009~0.15	-59.55	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.15~30	-56.64	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-66.09	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-52.20	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-47.88	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.009~0.15	-56.46	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.15~30	-56.87	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-66.37	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-52.40	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-47.64	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.009~0.15	-56.44	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.15~30	-56.20	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-65.95	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-52.37	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-47.44	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.009~0.15	-57.89	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-47.31	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.009~0.15	-60.09	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.15~30	-55.06	PASS
Band2	20MHz	16QAM	18700	1RB#0	30~1000	-66.20	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-52.07	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-47.95	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.009~0.15	-57.69	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.15~30	-55.76	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-66.12	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500


www.anbotek.com



Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-52.58	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-47.62	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.009~0.15	-60.14	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.15~30	-57.79	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-66.28	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-52.22	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-47.67	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.009~0.15	-59.54	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.15~30	-56.27	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-66.31	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-51.70	PASS
Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-47.65	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.009~0.15	-56.74	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.15~30	-54.14	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-66.28	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-52.33	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-47.59	PASS



Test Graphs

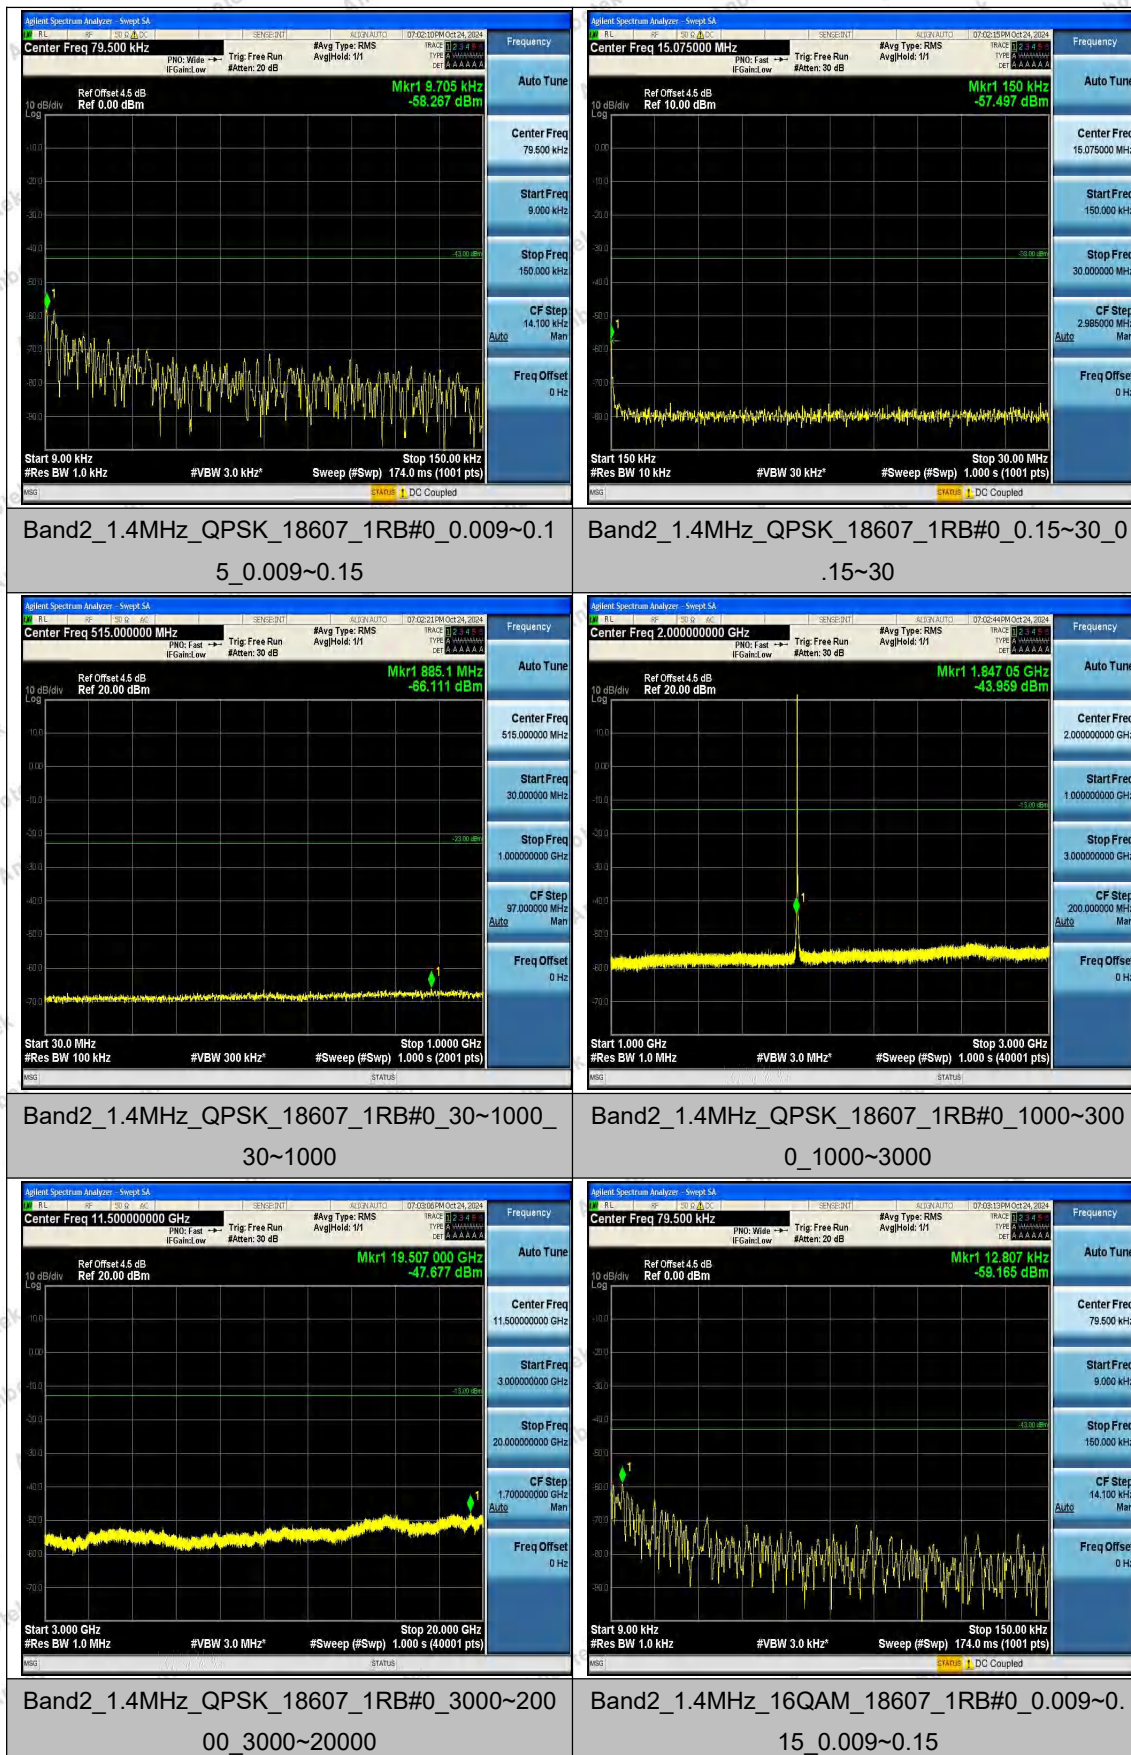


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hantcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com



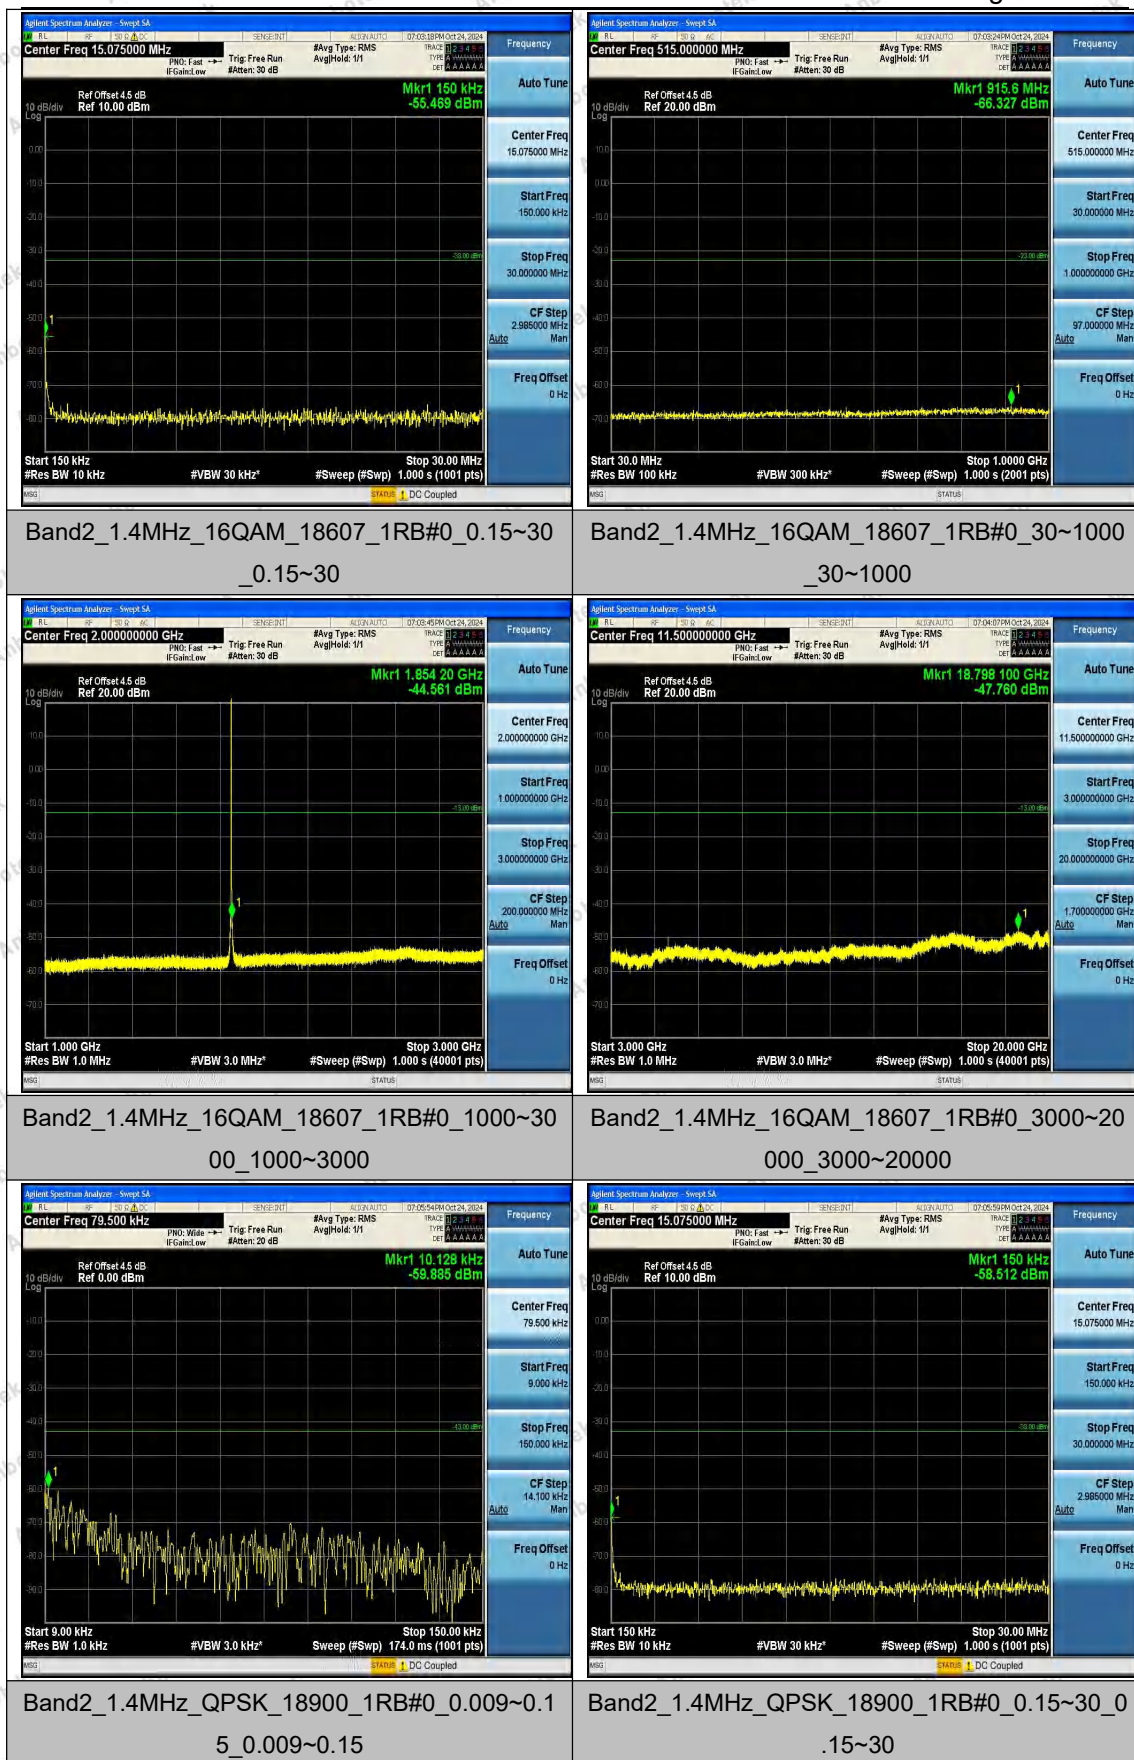


Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com



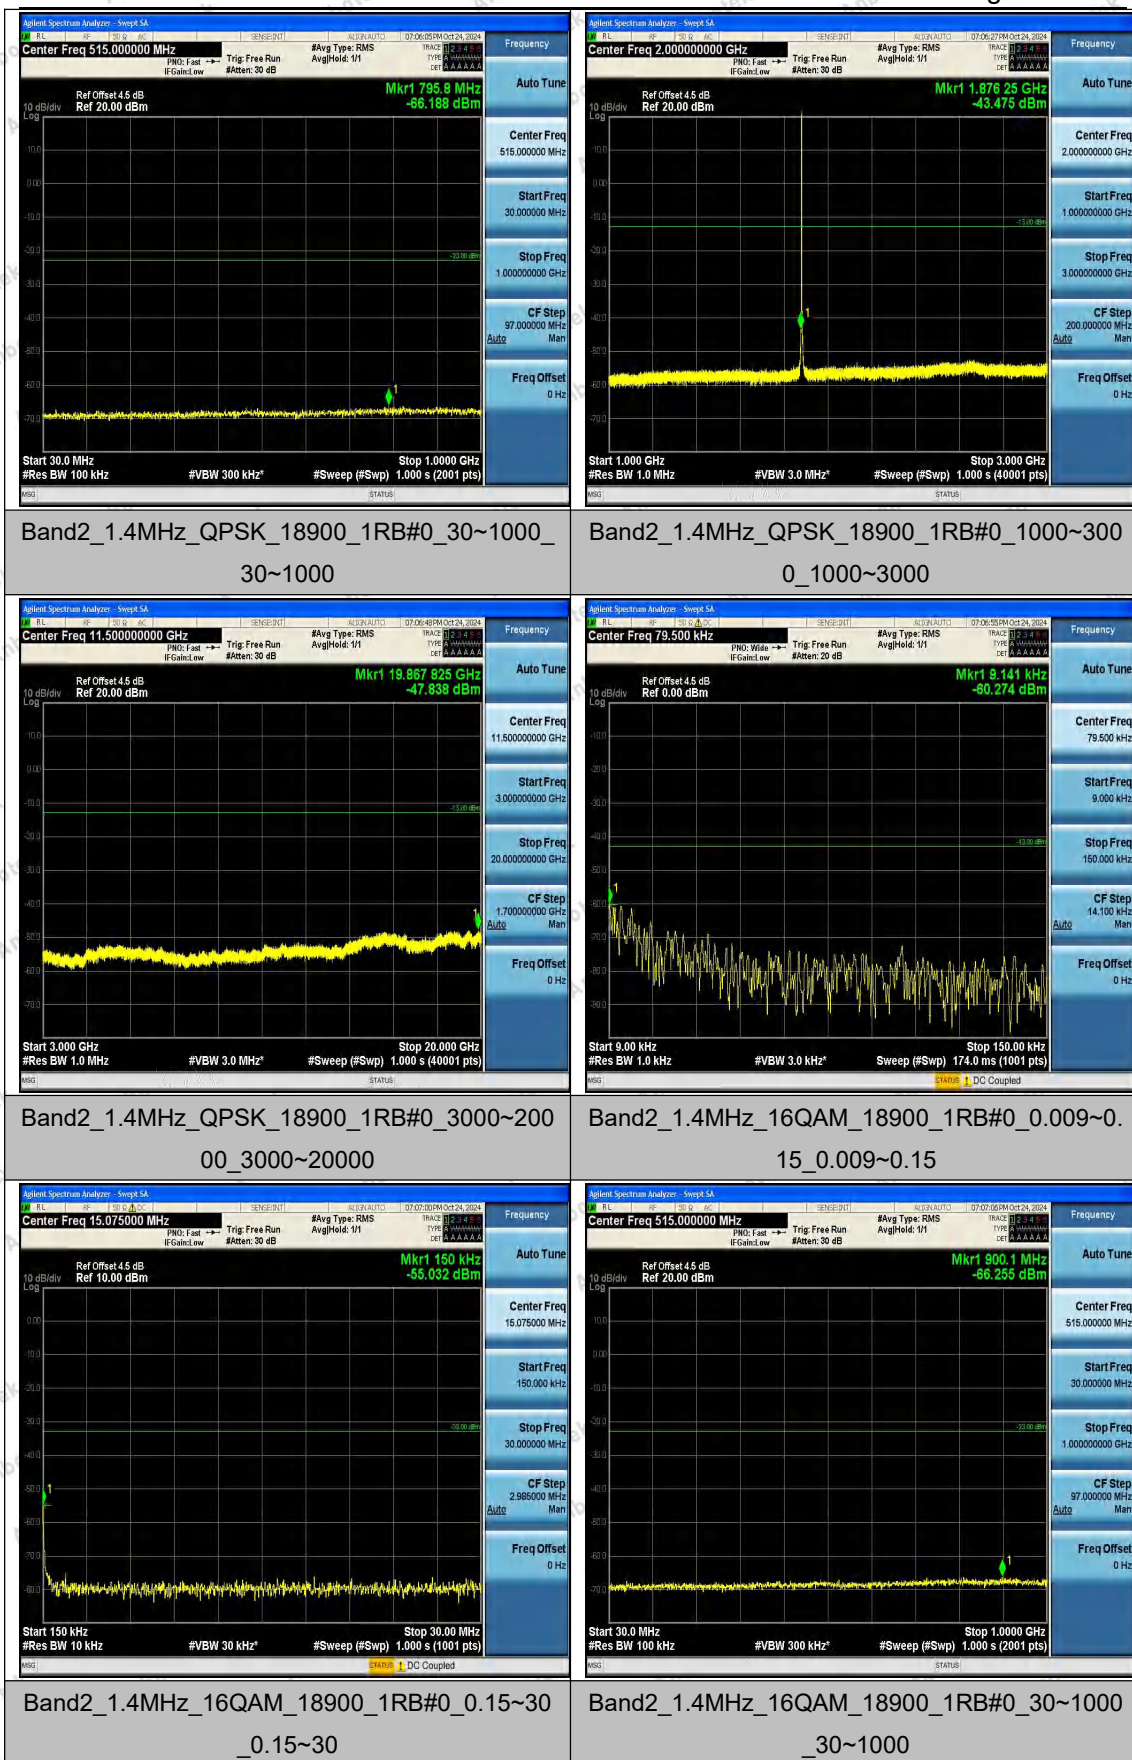

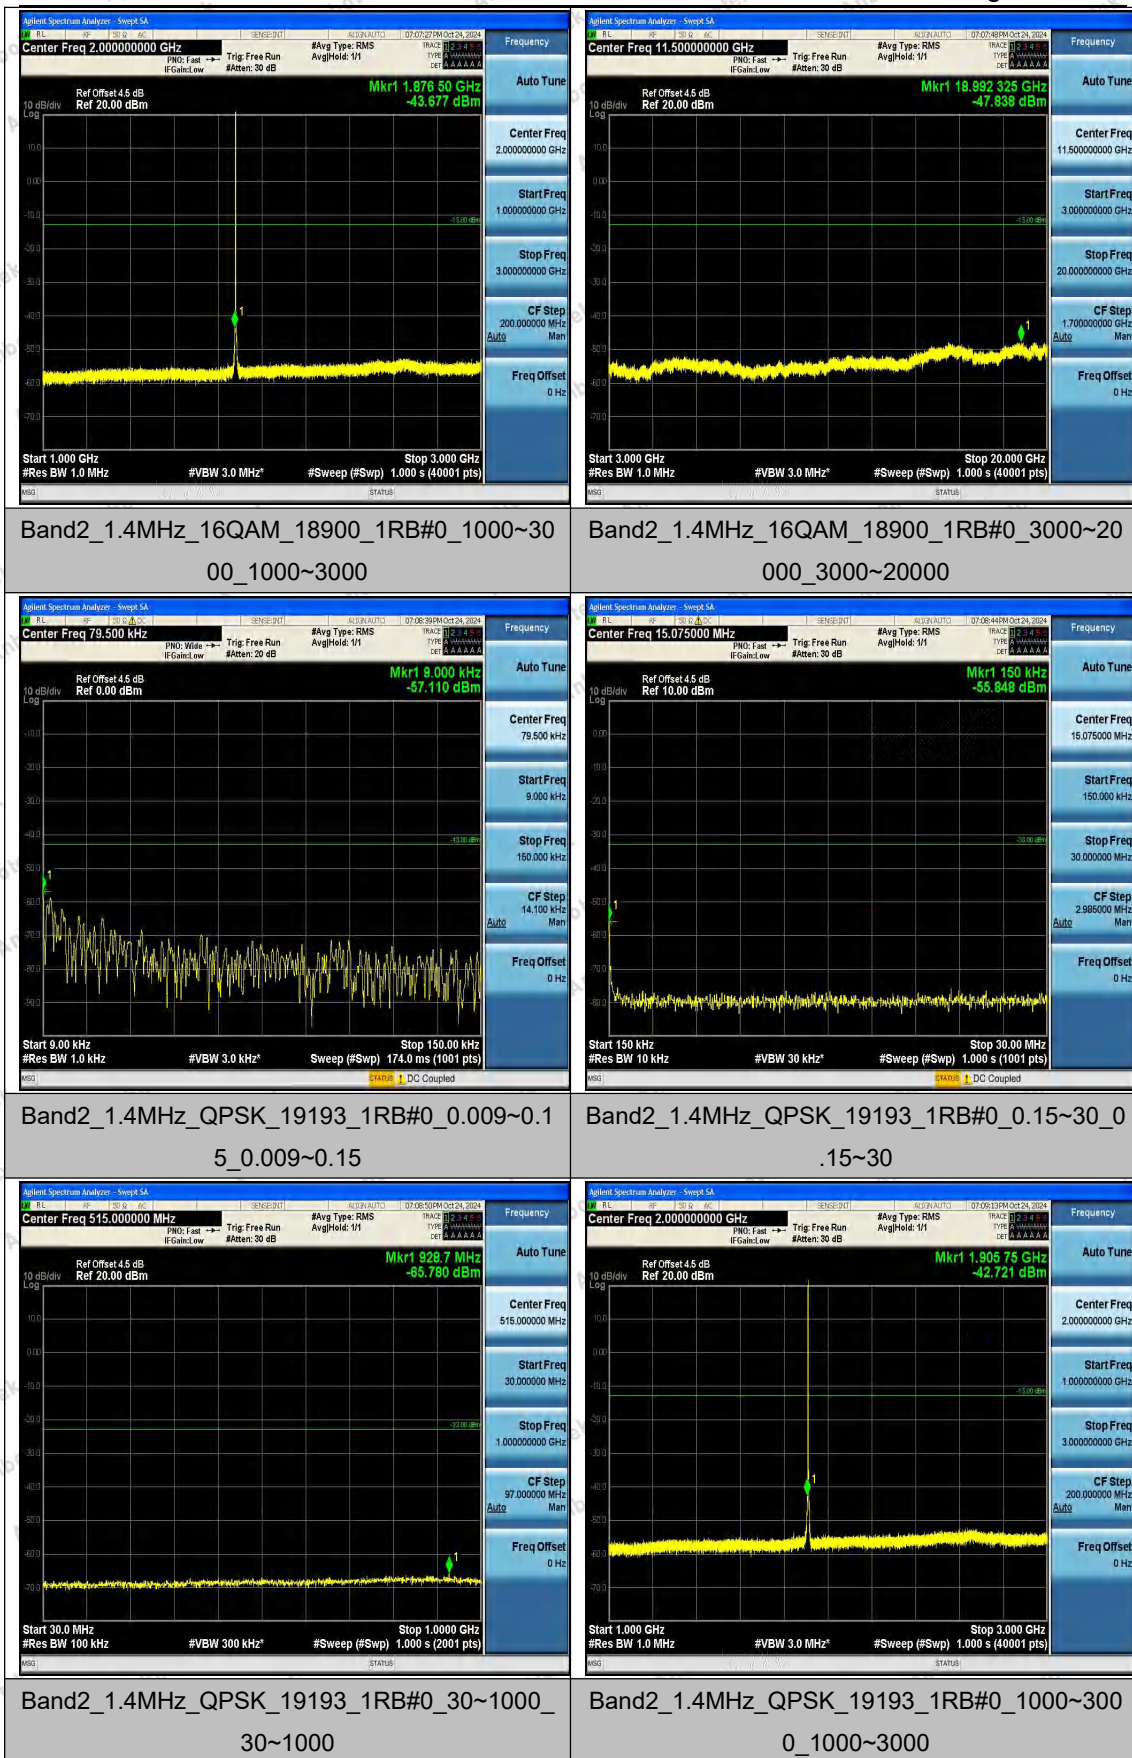

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hanguang Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
 Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
 400-003-0500

www.anbotek.com



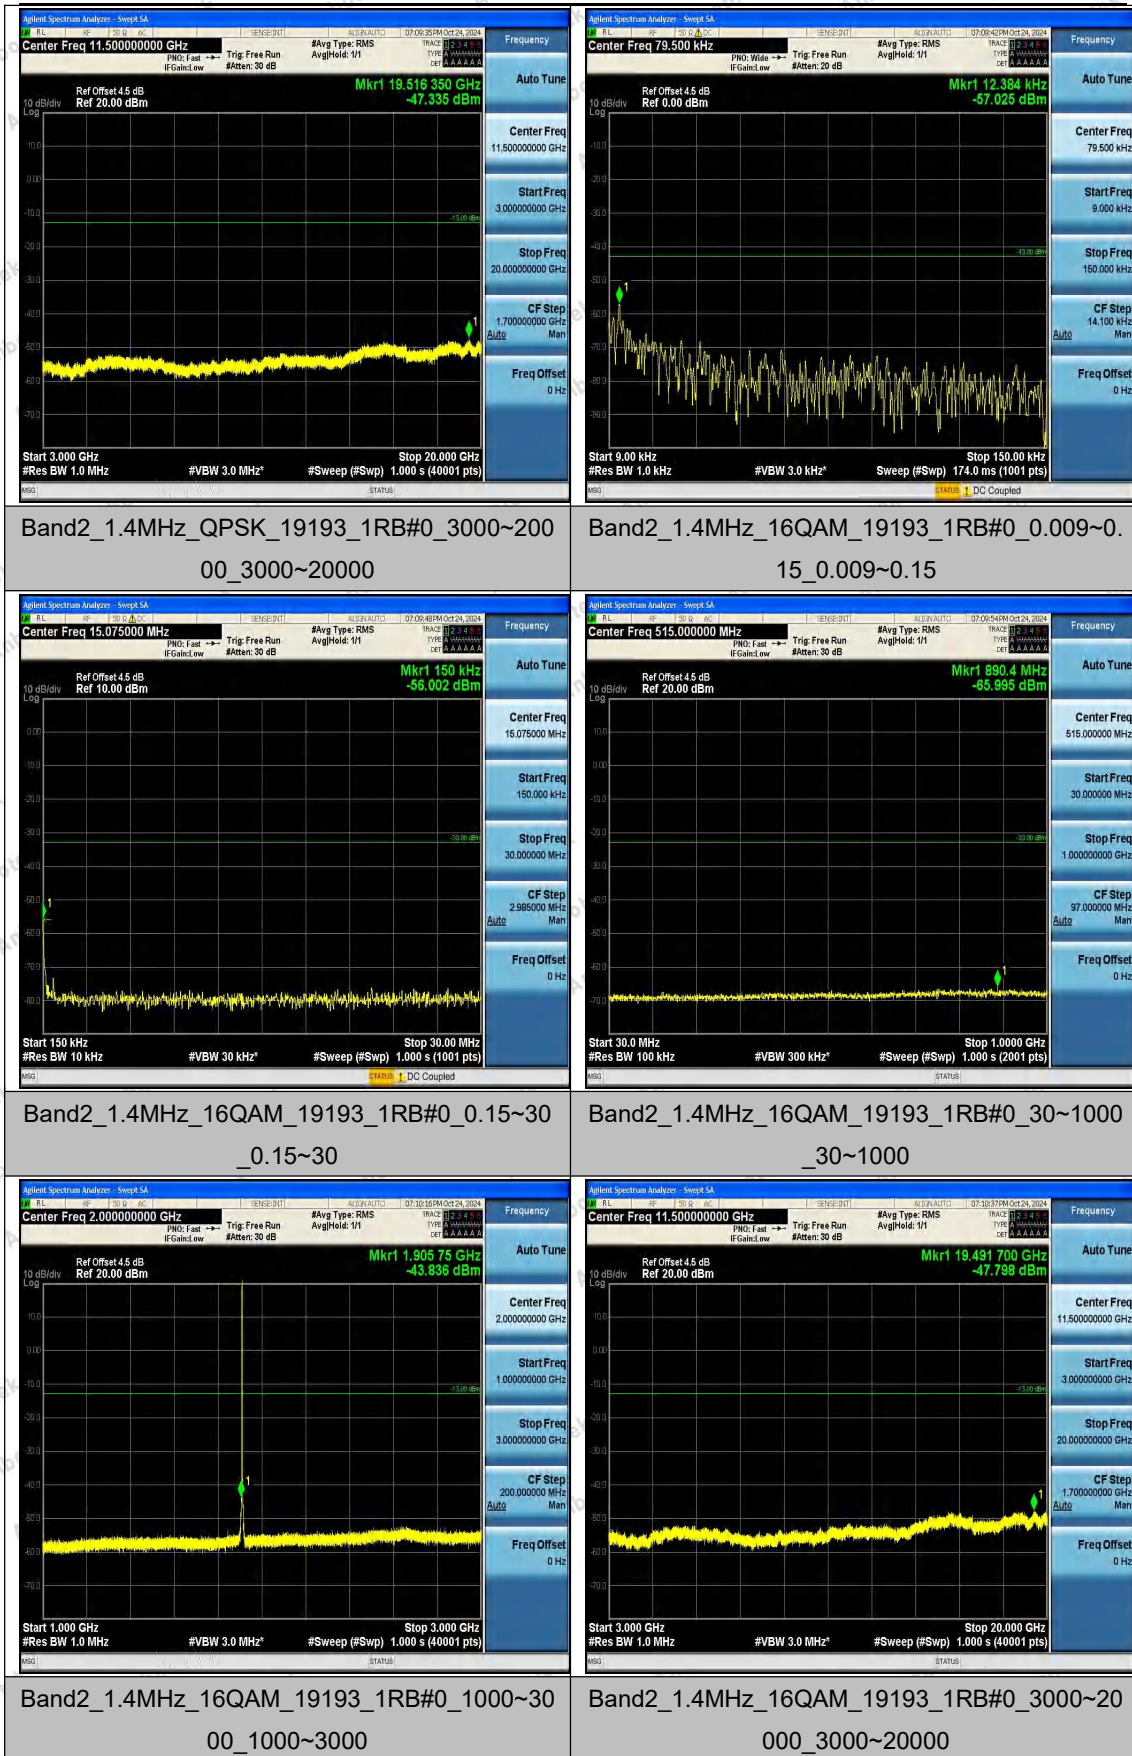

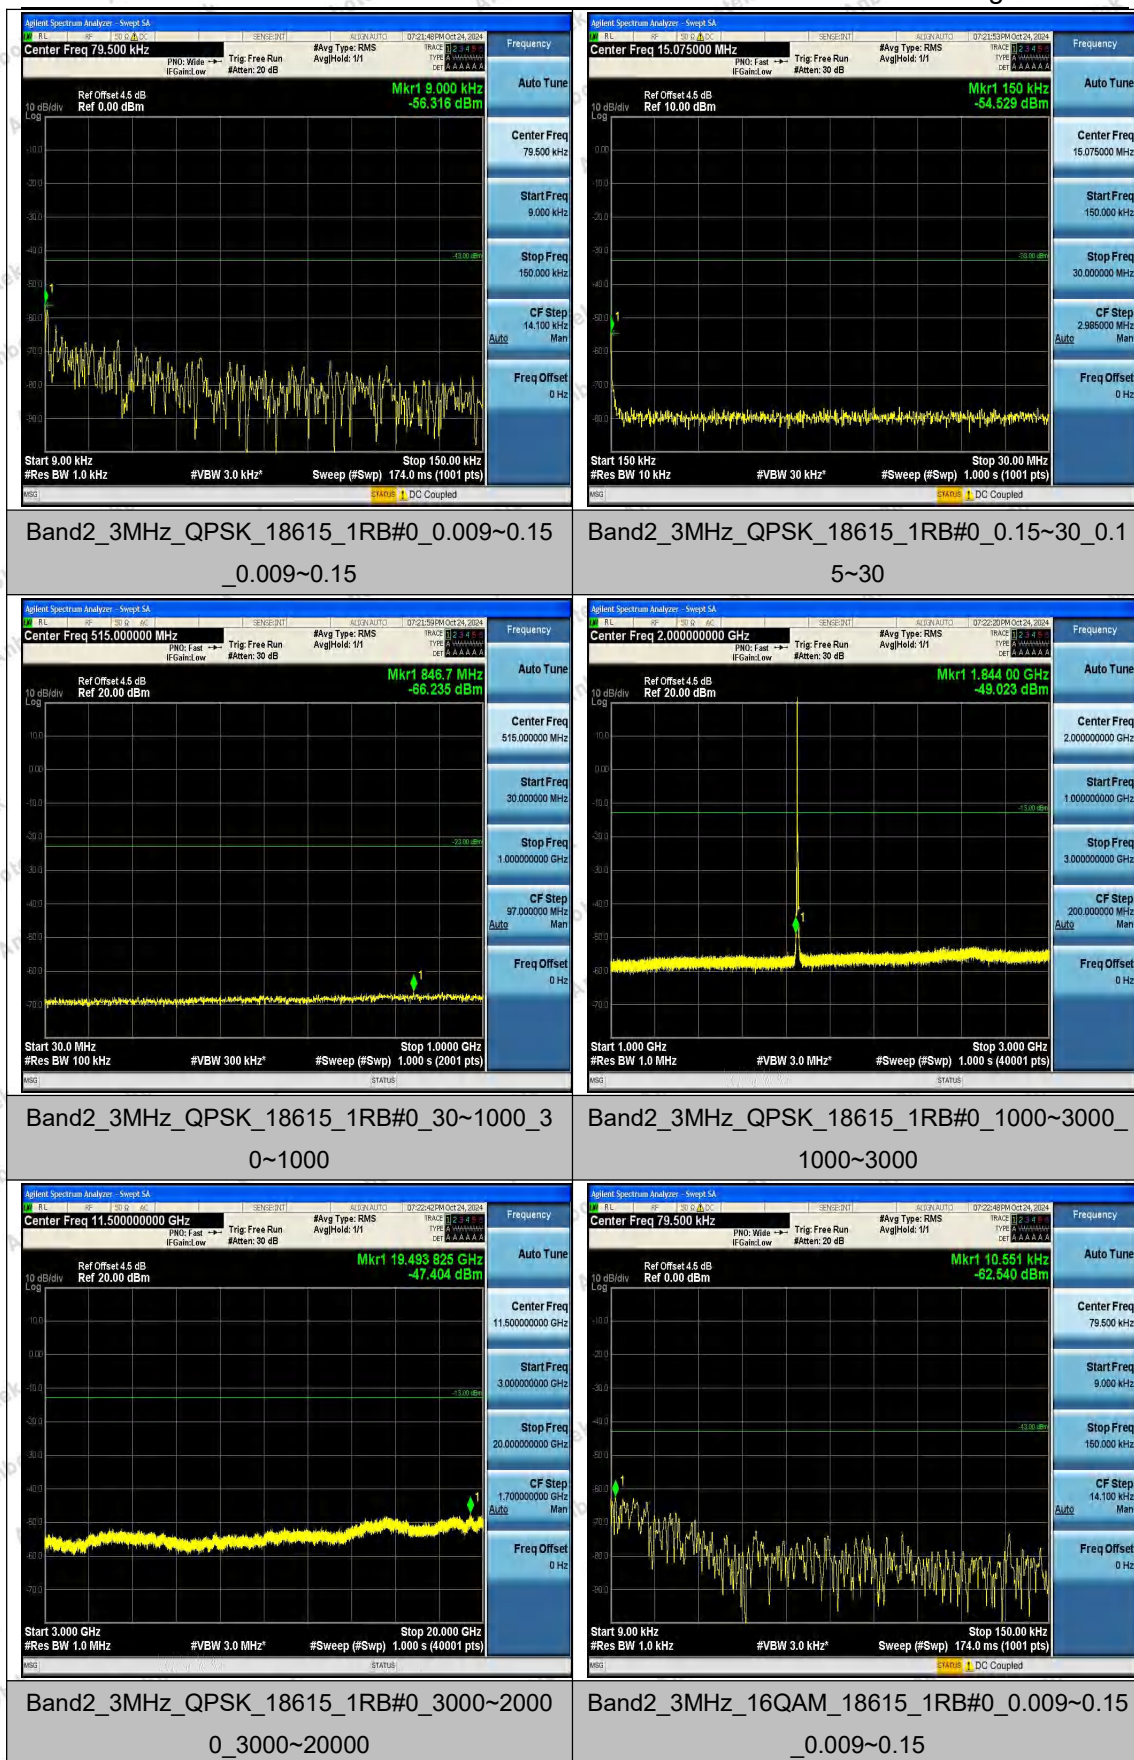

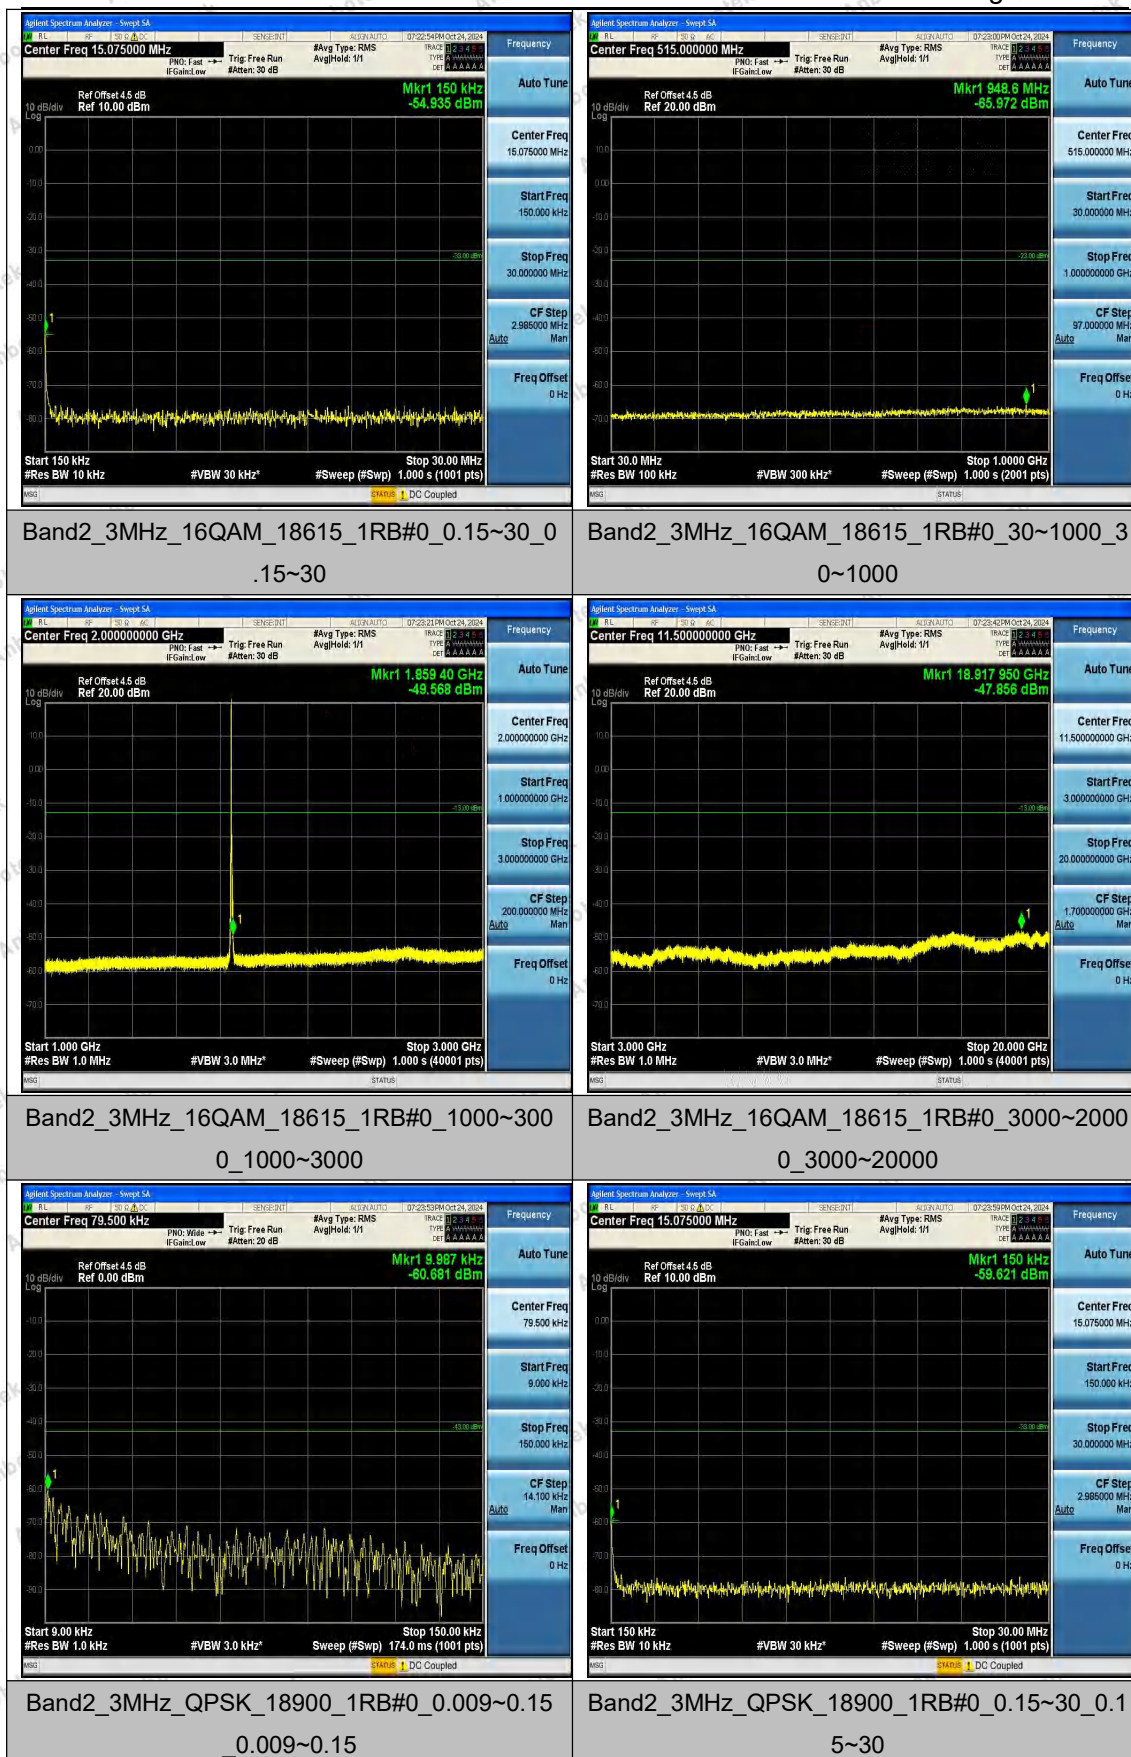

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
 Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
 400-003-0500

www.anbotech.com



