



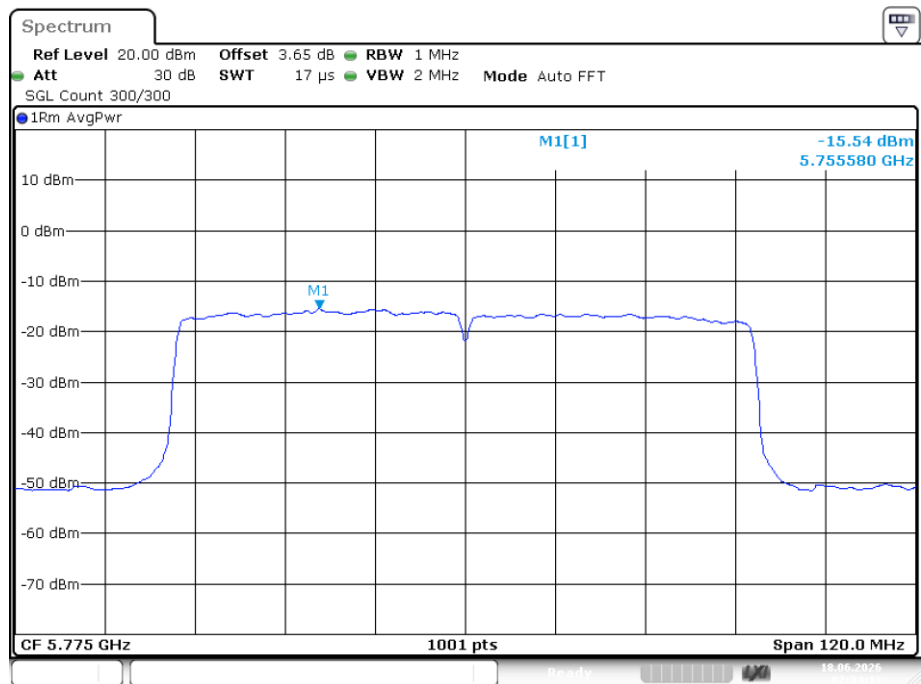


Date: 18.JUN.2026 02:34:13

PSD NVNT ac80 5775MHz Ant1

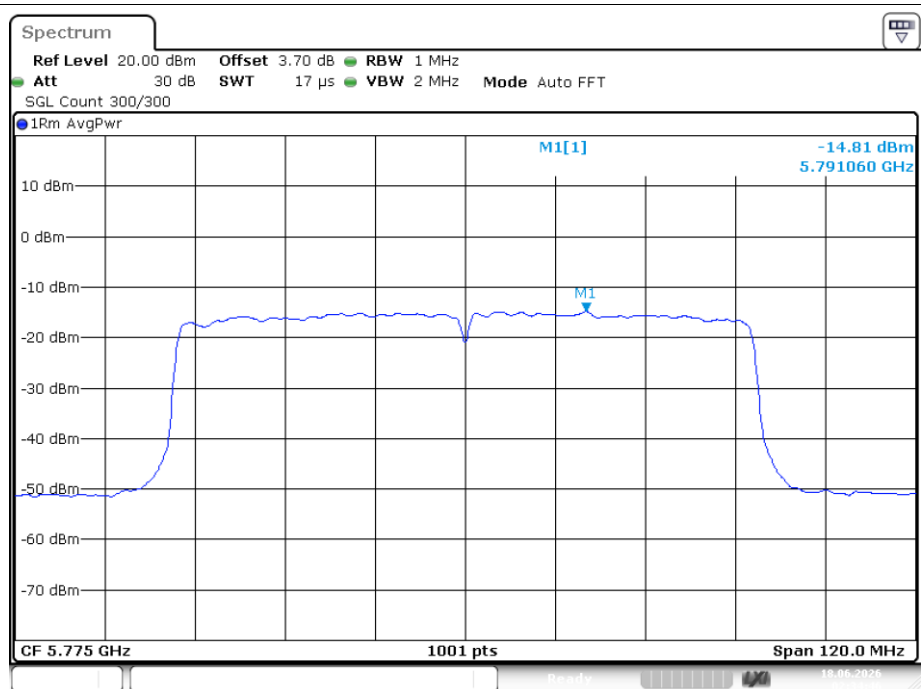


Date: 18.JUN.2026 02:34:46

PSD NVNT ac80 5775MHz Ant2

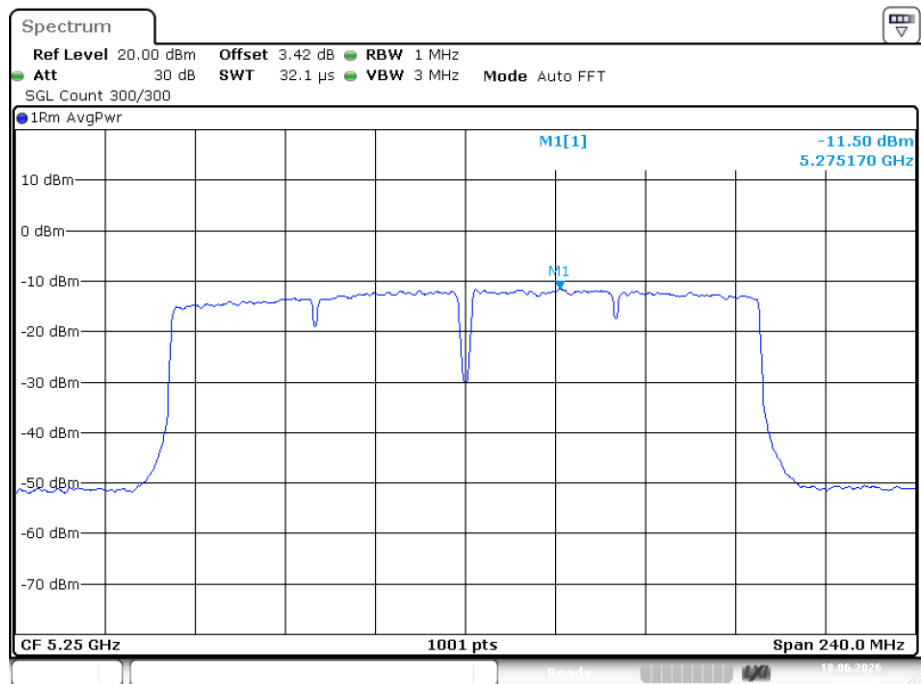


Date: 18.JUN.2026 02:54:38

PSD NVNT ac160 5250MHz Ant1

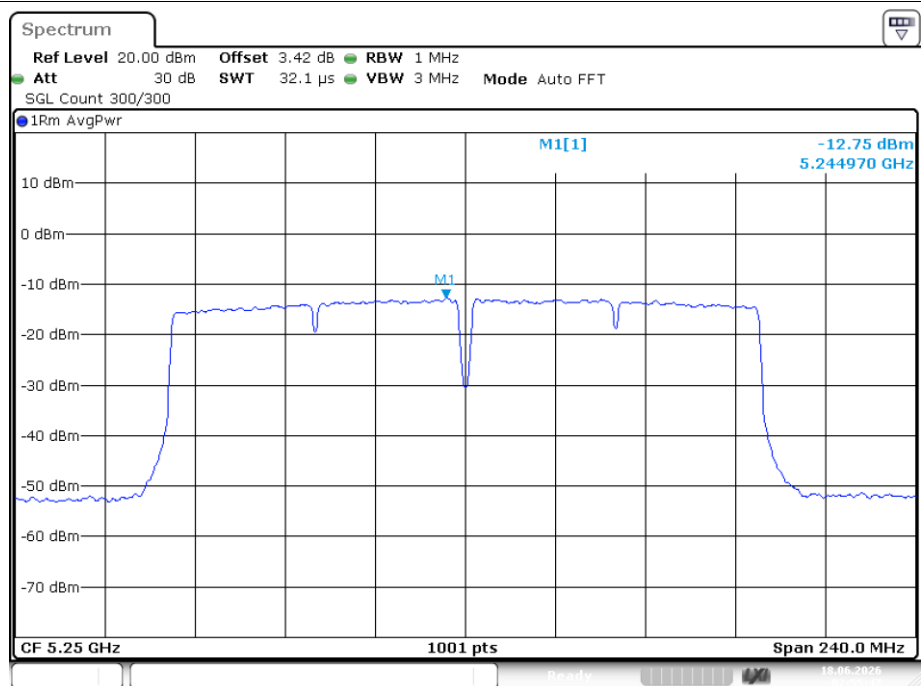


Date: 18.JUN.2026 02:55:48

PSD NVNT ac160 5250MHz Ant2

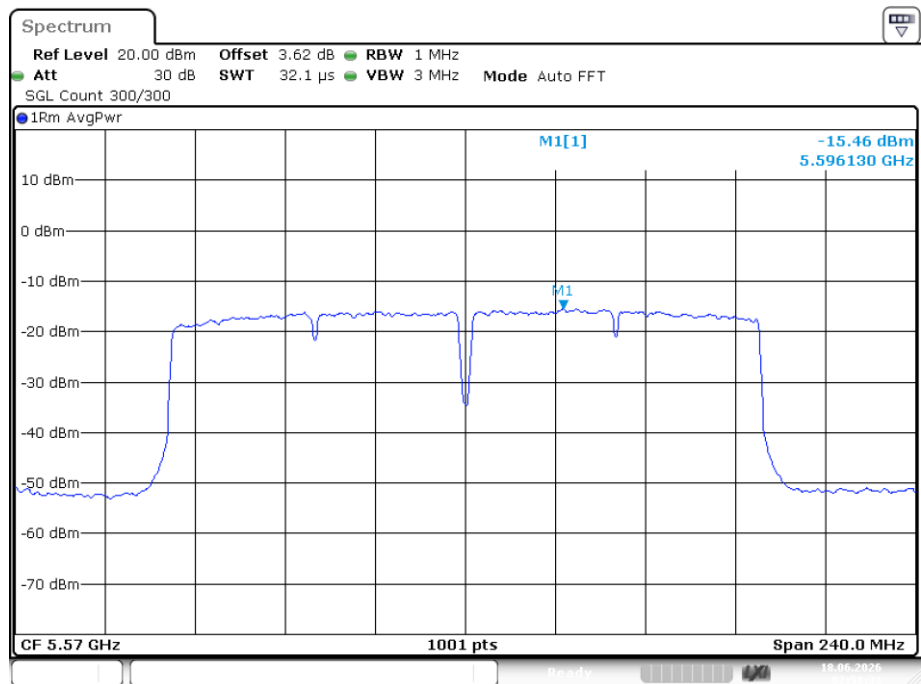


Date: 18.JUN.2026 02:58:33

PSD NVNT ac160 5570MHz Ant1

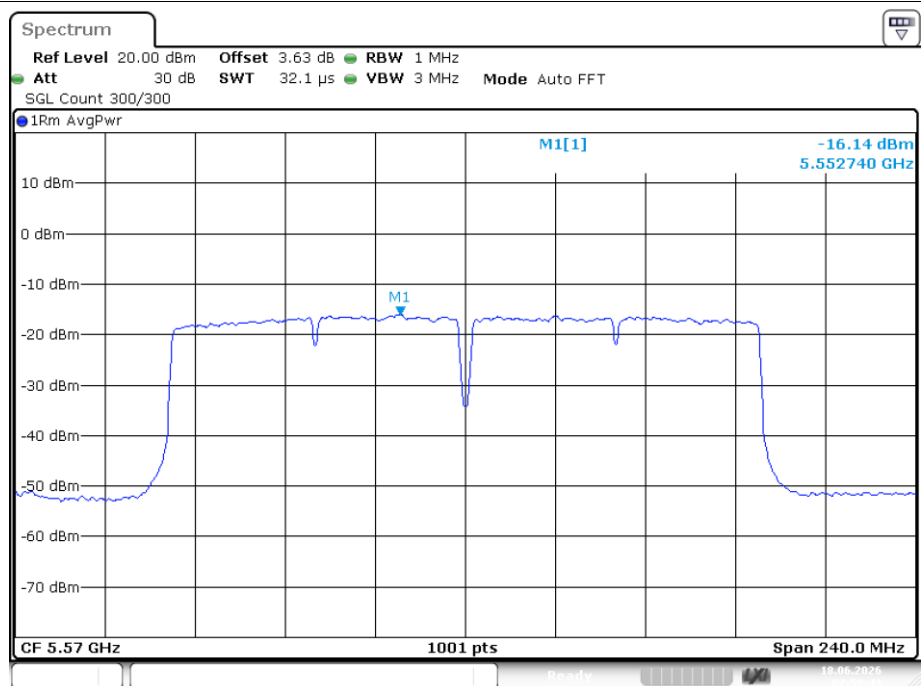


Date: 18.JUN.2026 02:59:42

PSD NVNT ac160 5570MHz Ant2

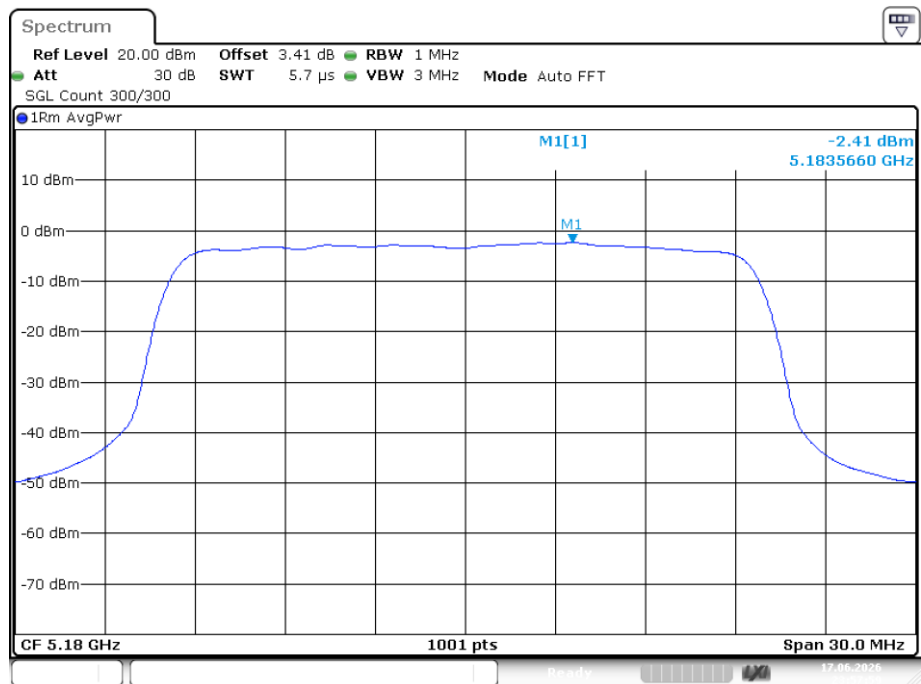


Date: 17.JUN.2026 23:57:58

PSD NVNT ax20 5180MHz Ant1

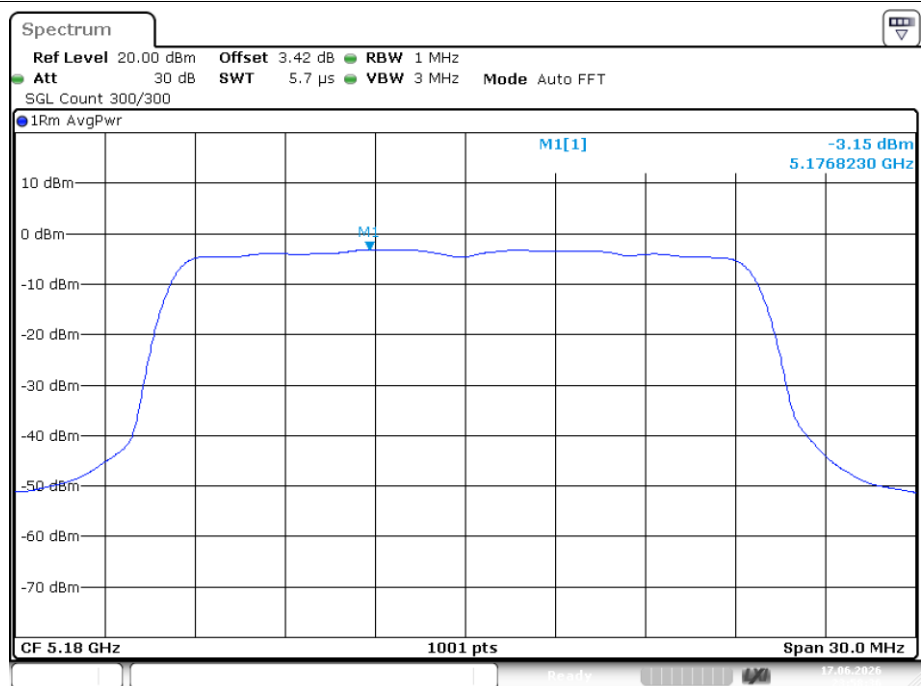


Date: 17.JUN.2026 23:58:36

PSD NVNT ax20 5180MHz Ant2

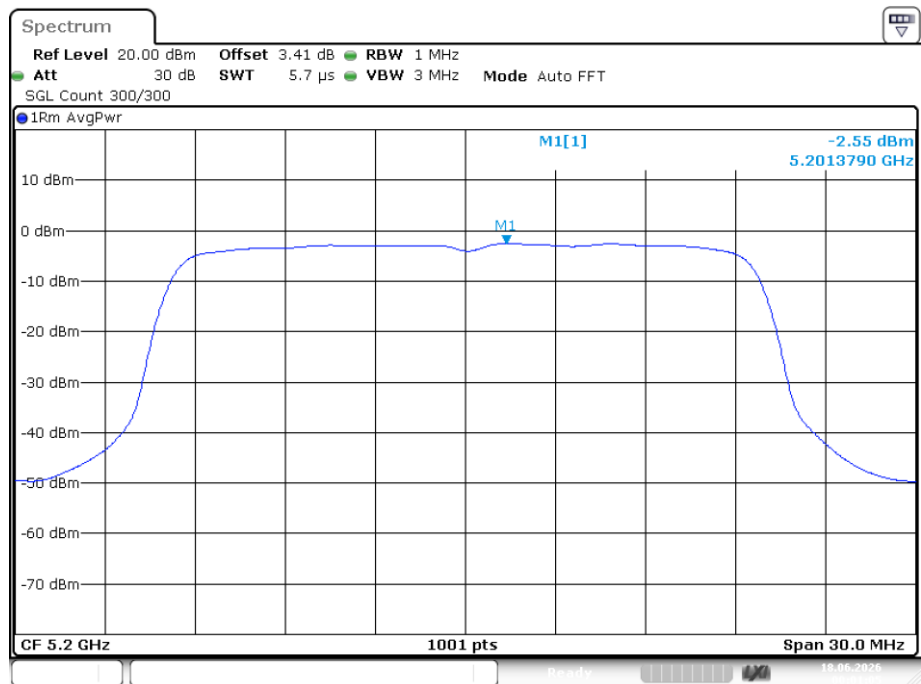


Date: 18.JUN.2026 00:01:05

PSD NVNT ax20 5200MHz Ant1

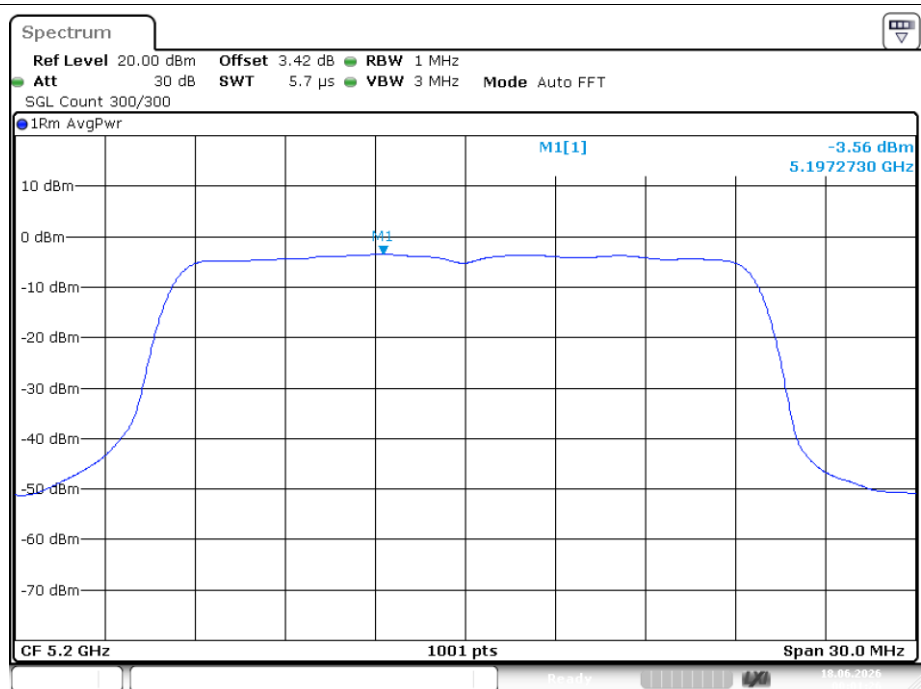


Date: 18.JUN.2026 00:01:27

PSD NVNT ax20 5200MHz Ant2

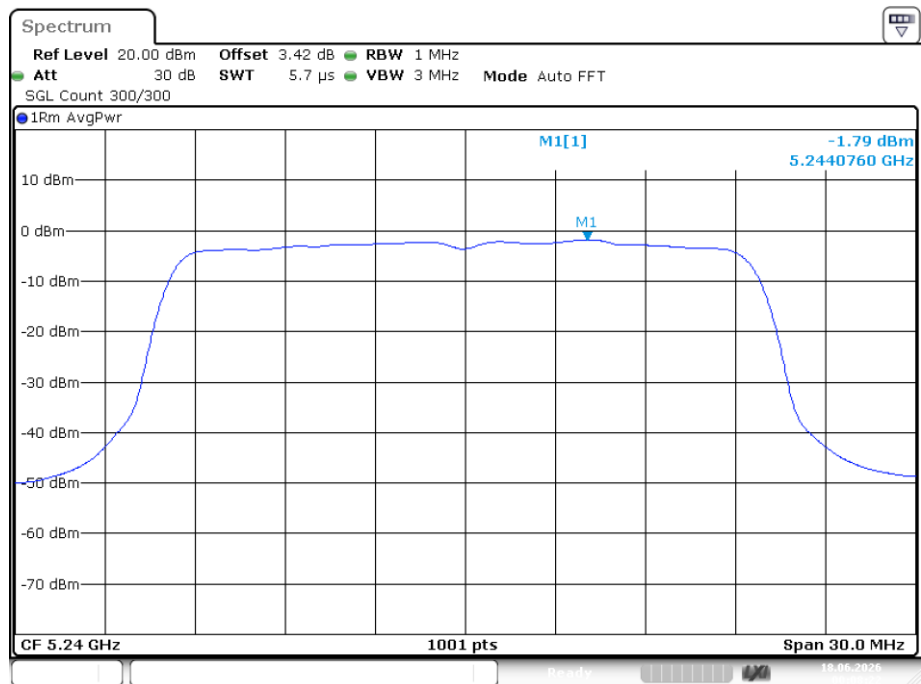


Date: 18.JUN.2026 00:08:22

PSD NVNT ax20 5240MHz Ant1

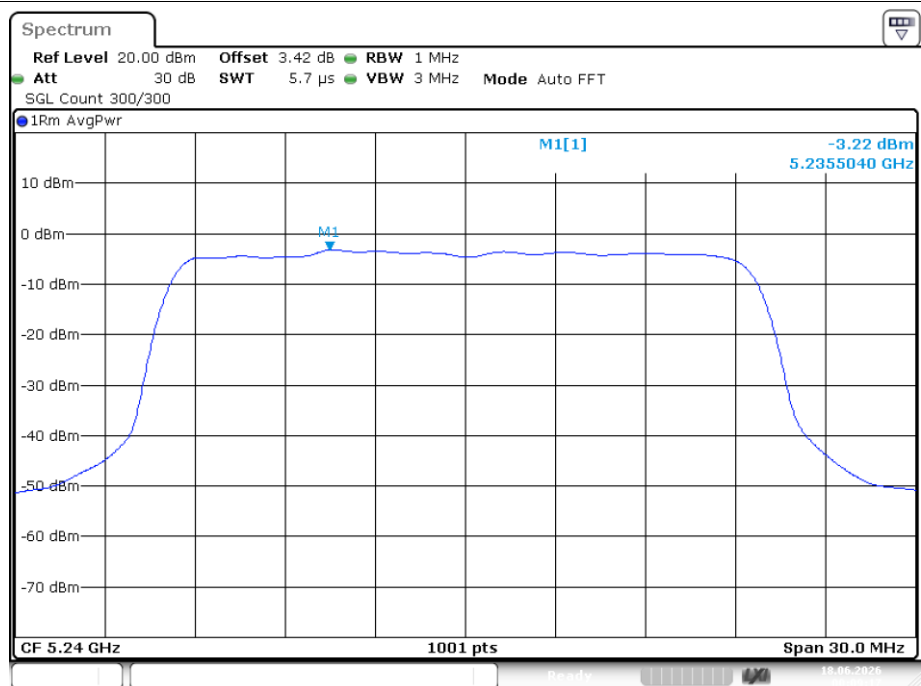


Date: 18.JUN.2026 00:09:18

PSD NVNT ax20 5240MHz Ant2

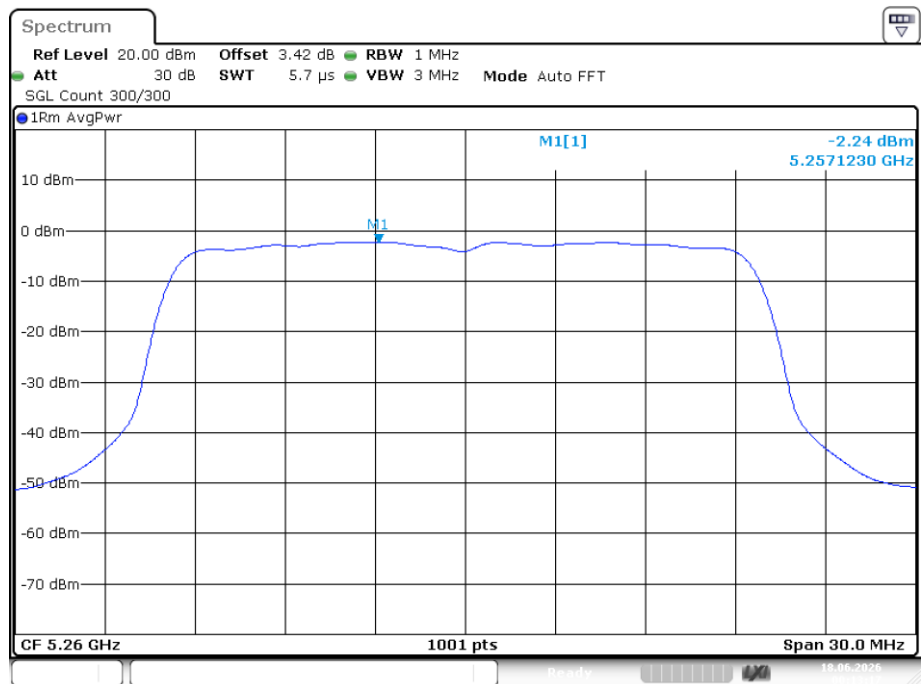


Date: 18.JUN.2026 00:13:16

PSD NVNT ax20 5260MHz Ant1

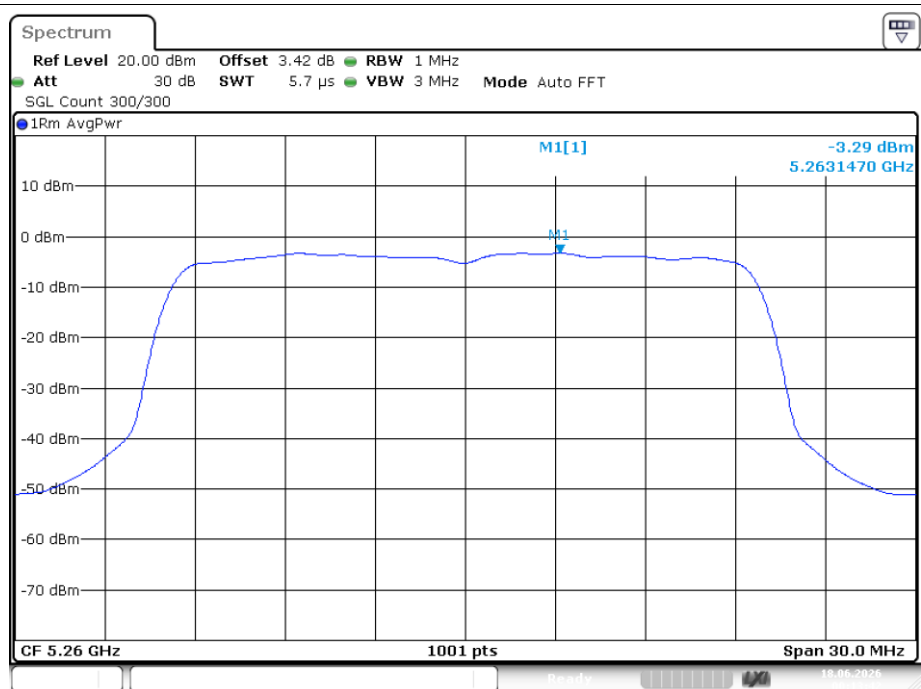


Date: 18.JUN.2026 00:13:41

PSD NVNT ax20 5260MHz Ant2

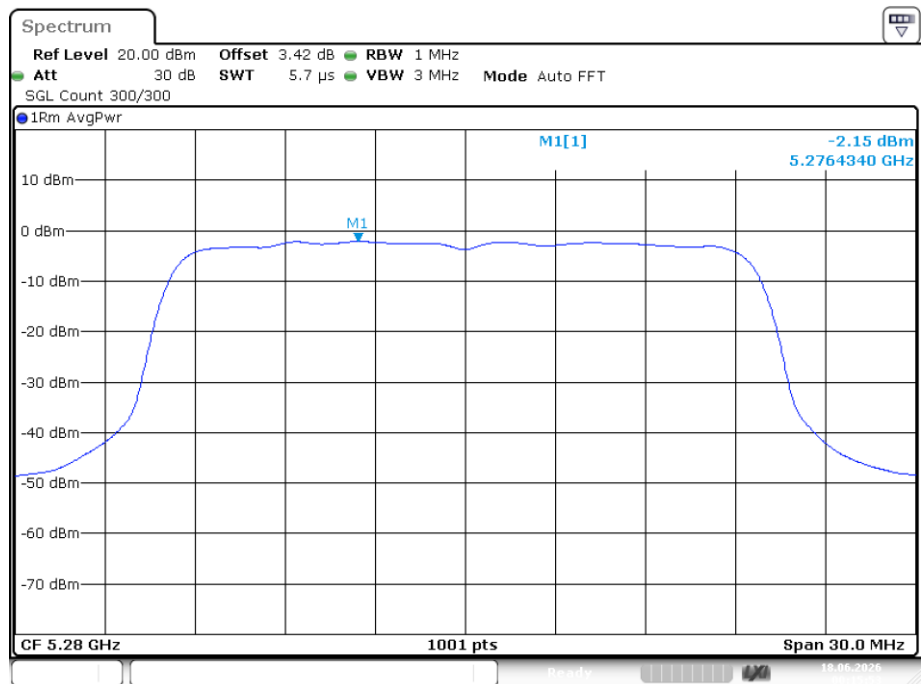


Date: 18.JUN.2026 00:15:53

PSD NVNT ax20 5280MHz Ant1

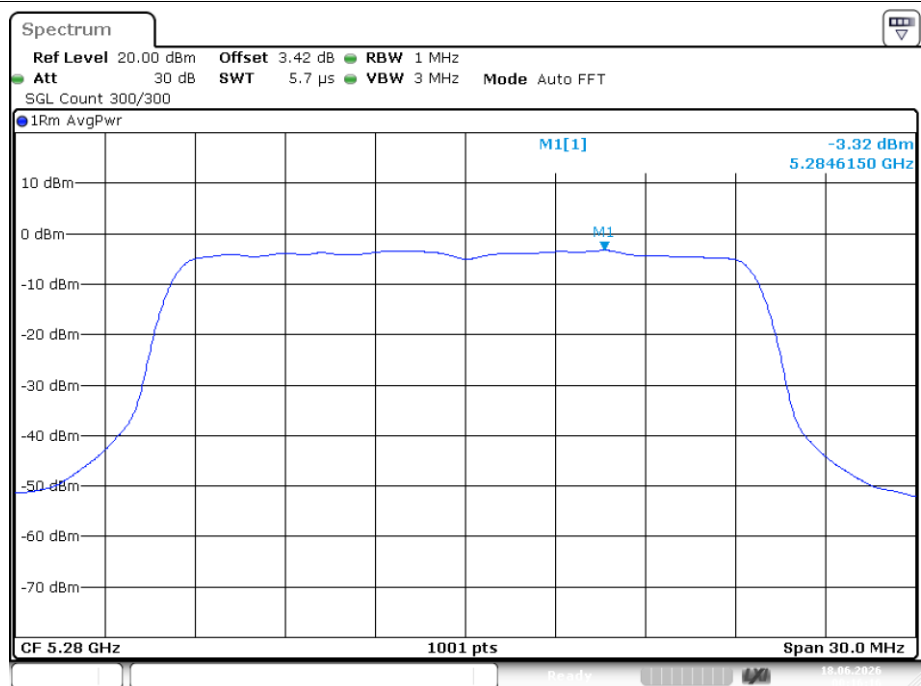


Date: 18.JUN.2026 00:16:16

PSD NVNT ax20 5280MHz Ant2

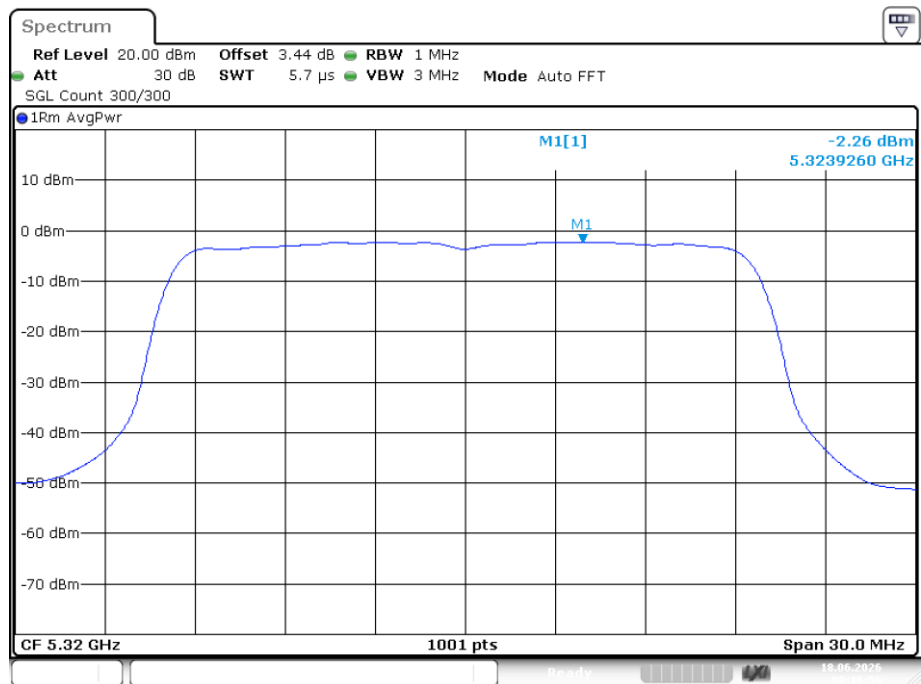


Date: 18.JUN.2026 00:16:56

PSD NVNT ax20 5320MHz Ant1

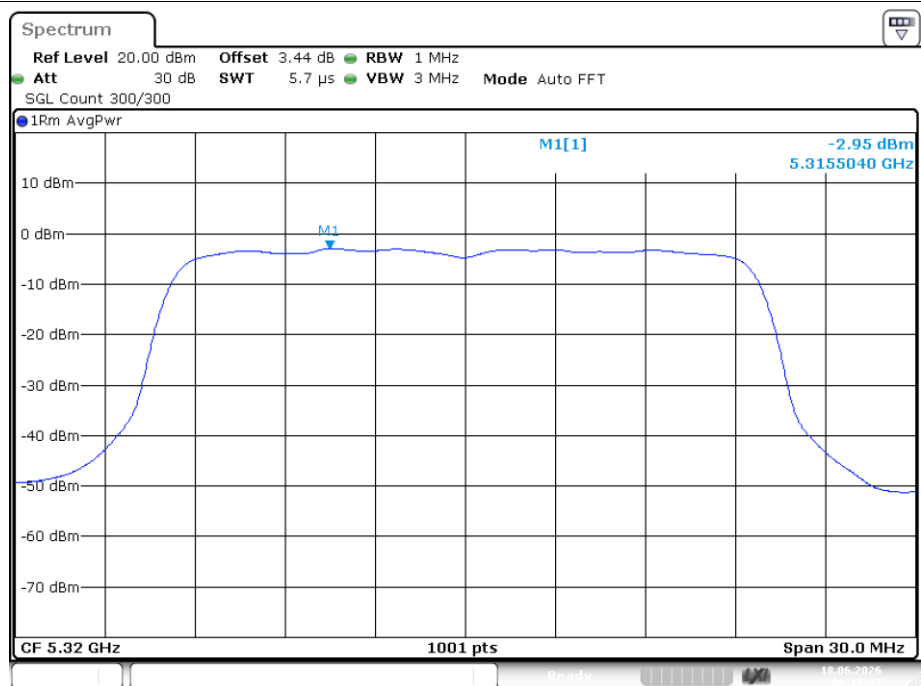


Date: 18.JUN.2026 00:17:31

PSD NVNT ax20 5320MHz Ant2

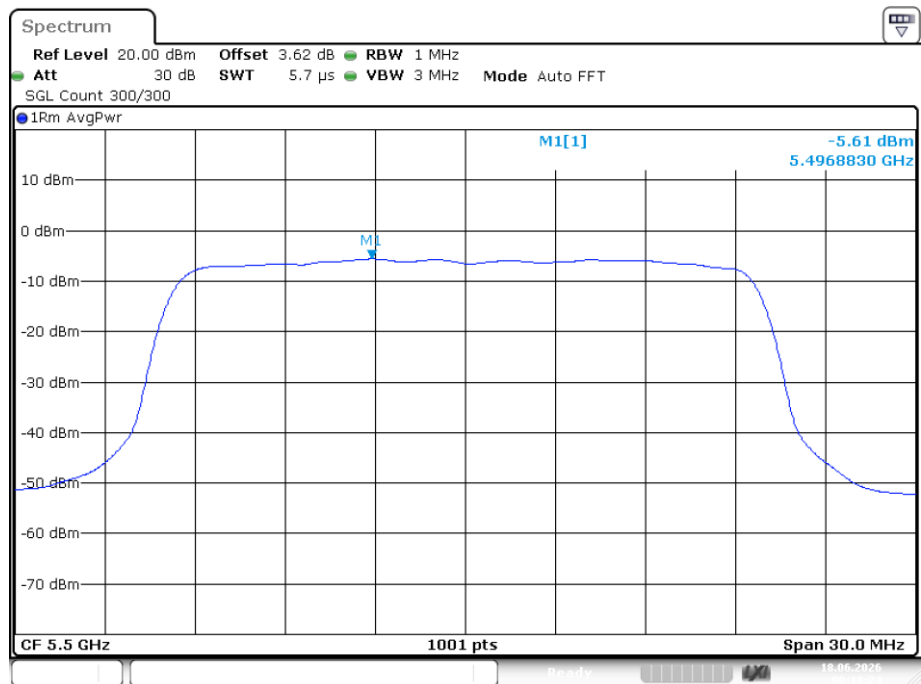


Date: 18.JUN.2026 00:18:24

PSD NVNT ax20 5500MHz Ant1

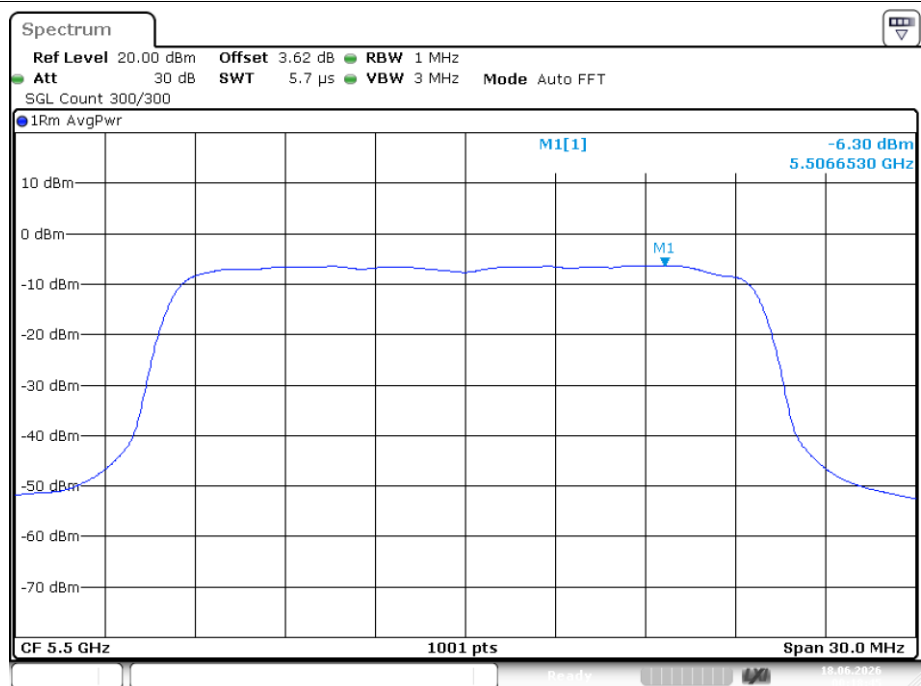


Date: 18.JUN.2026 00:18:46


PSD NVNT ax20 5500MHz Ant2

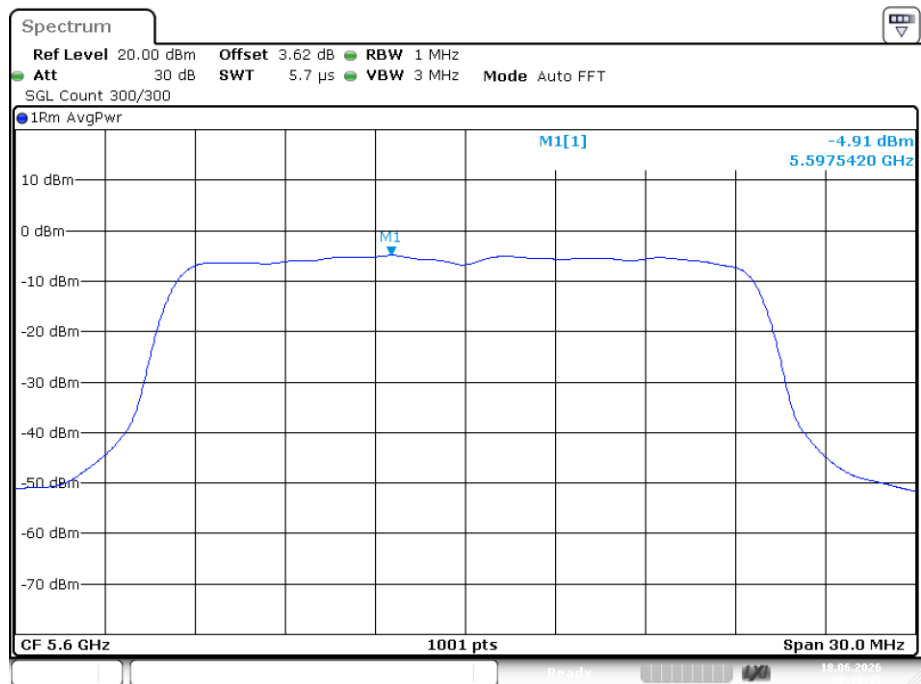

PSD NVNT ax20 5600MHz Ant1

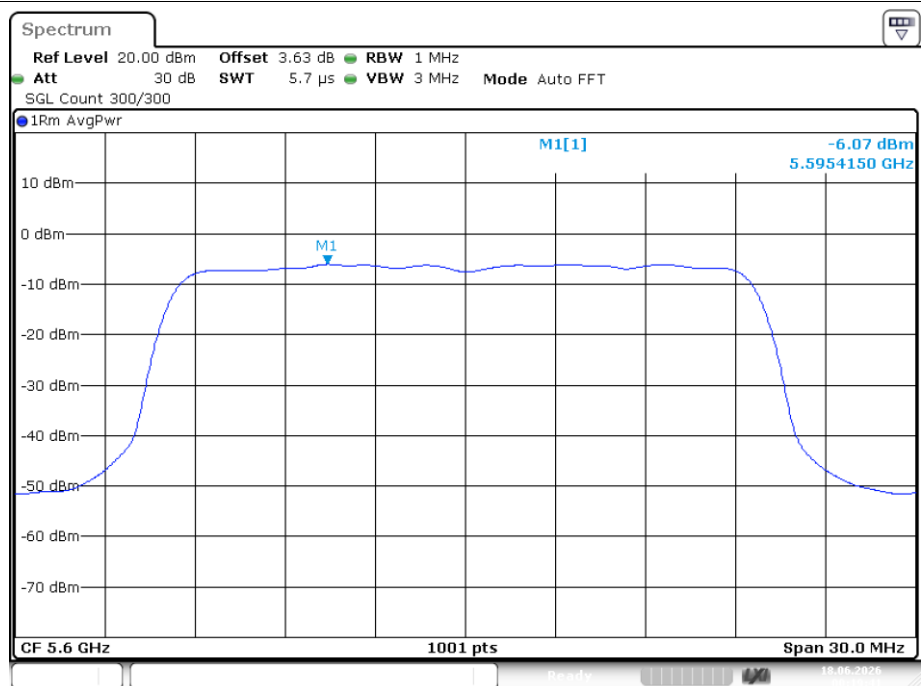


PSD NVNT ax20 5600MHz Ant2

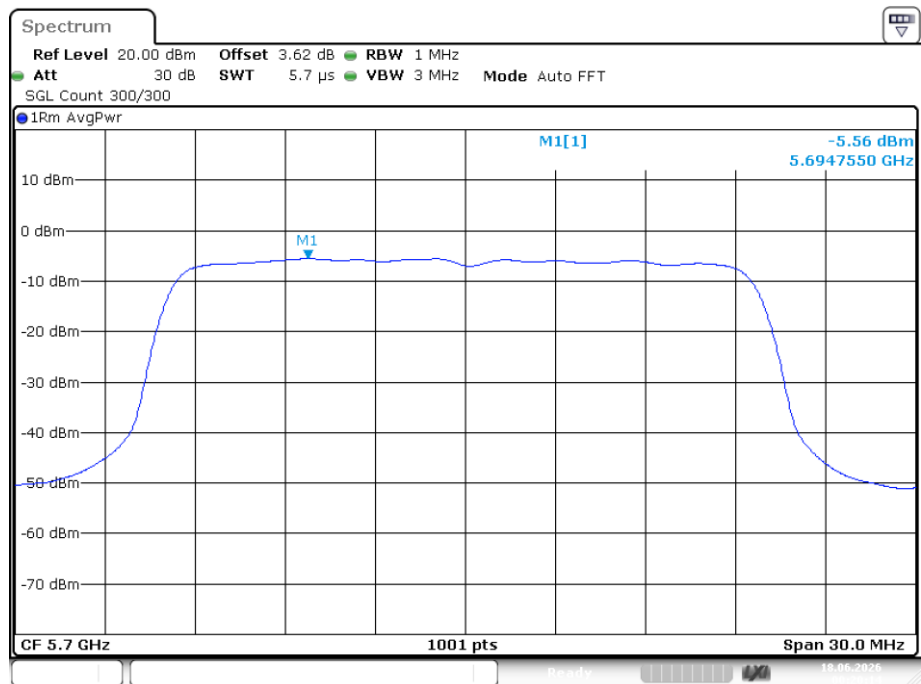


Date: 18.JUN.2026 00:20:14

PSD NVNT ax20 5700MHz Ant1

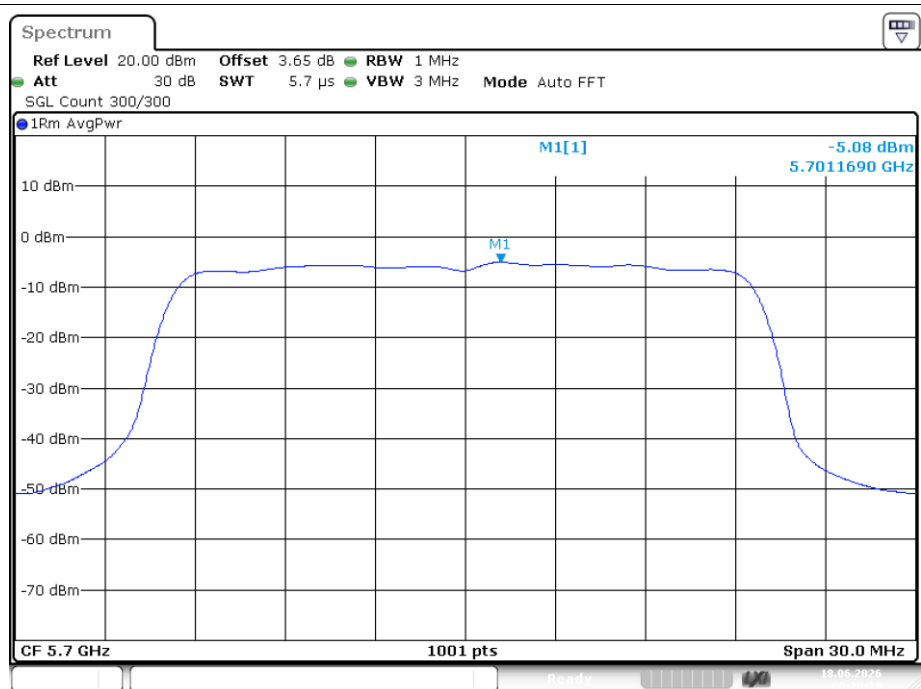


Date: 18.JUN.2026 00:20:38

PSD NVNT ax20 5700MHz Ant2

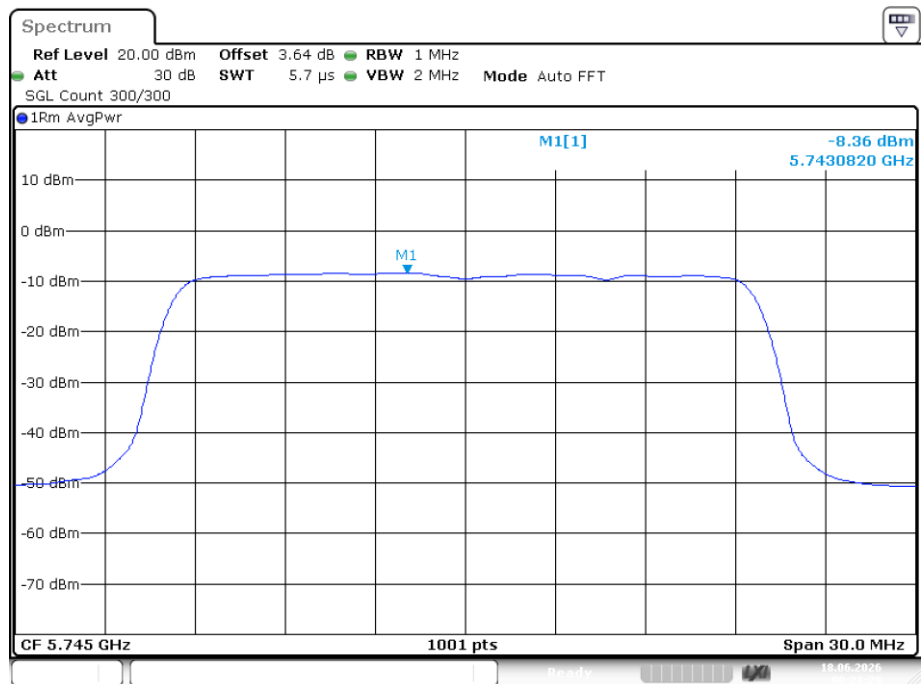


Date: 18.JUN.2026 00:21:29

PSD NVNT ax20 5745MHz Ant1

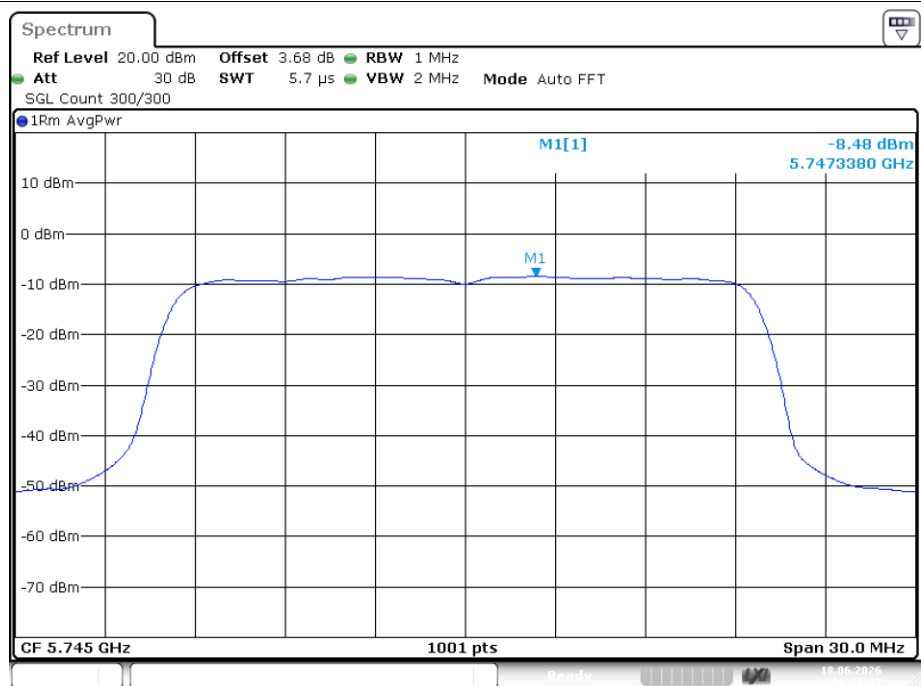


Date: 18.JUN.2026 00:21:55

PSD NVNT ax20 5745MHz Ant2

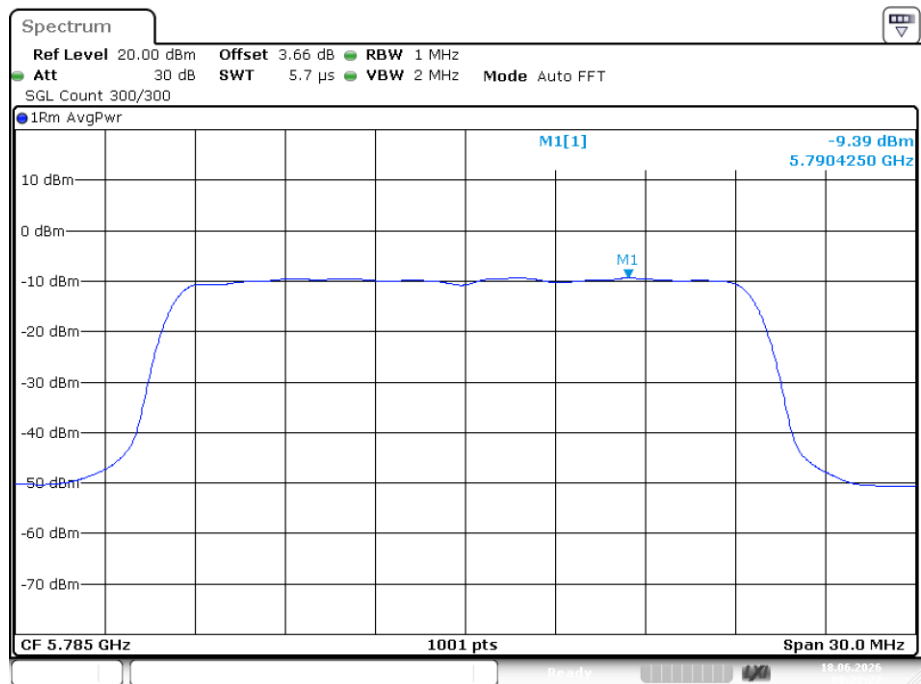


Date: 18.JUN.2026 00:22:27

PSD NVNT ax20 5785MHz Ant1

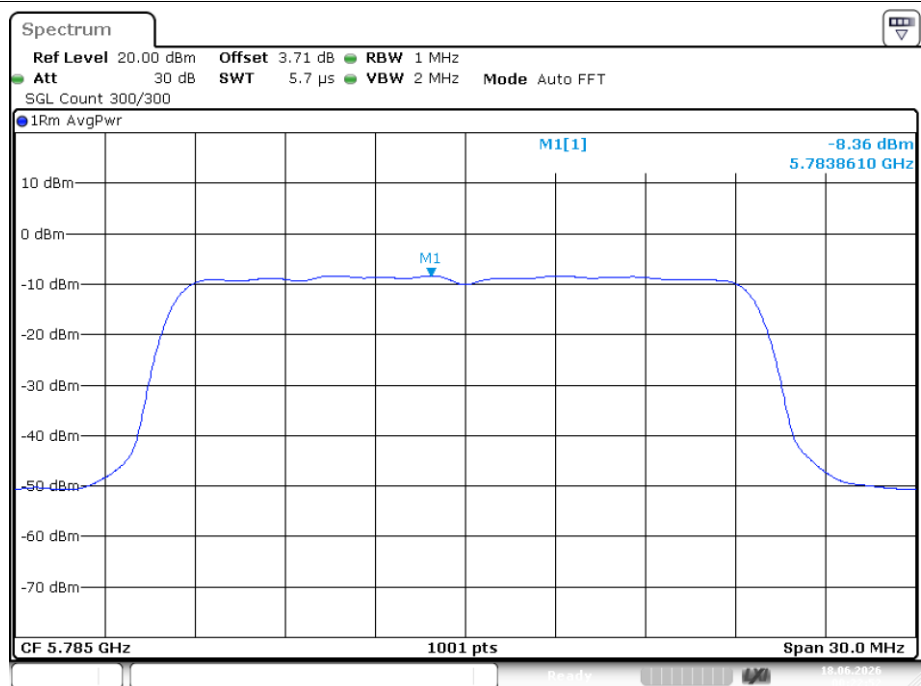


Date: 18.JUN.2026 00:22:52

PSD NVNT ax20 5785MHz Ant2

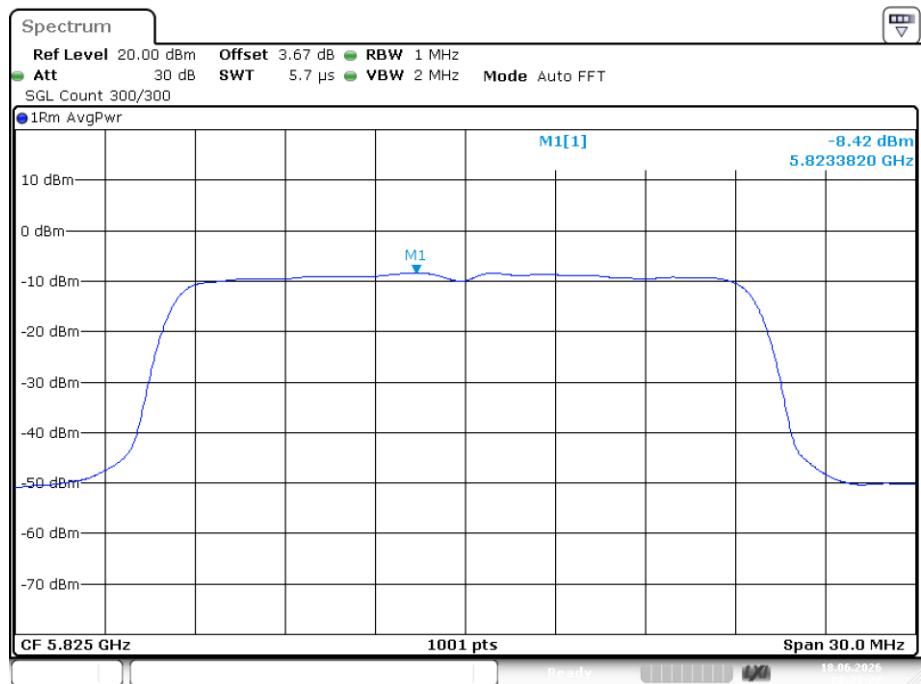


Date: 18.JUN.2026 00:23:27

PSD NVNT ax20 5825MHz Ant1

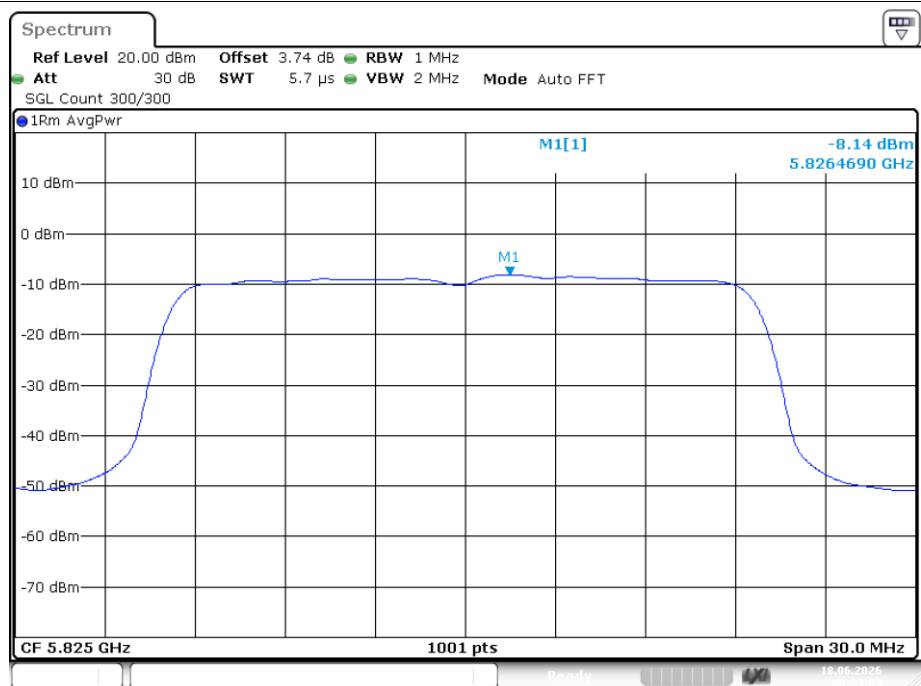


Date: 18.JUN.2026 00:24:05

PSD NVNT ax20 5825MHz Ant2

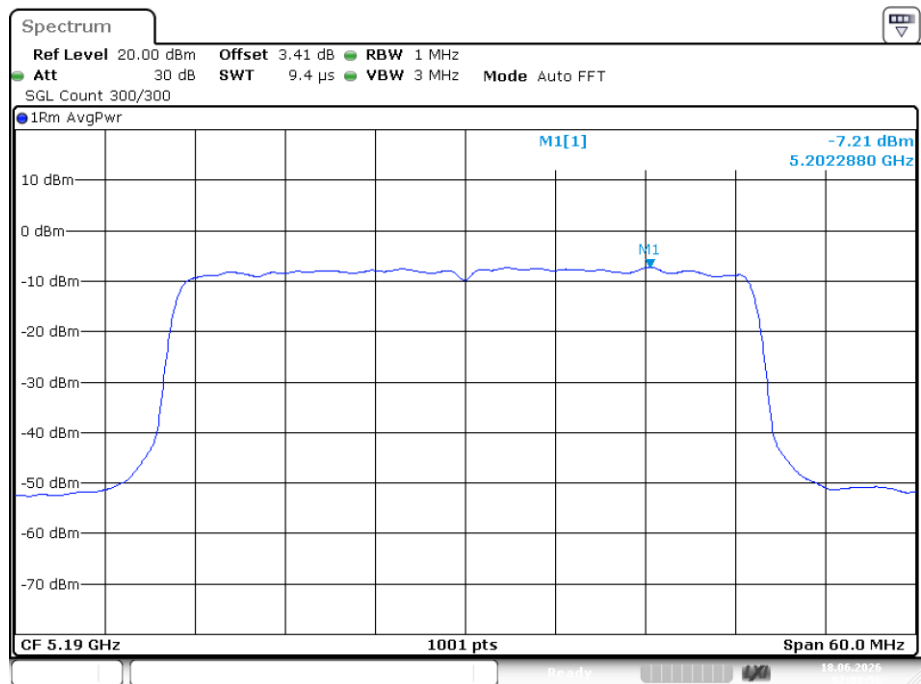


Date: 18.JUN.2026 02:08:56

PSD NVNT ax40 5190MHz Ant1

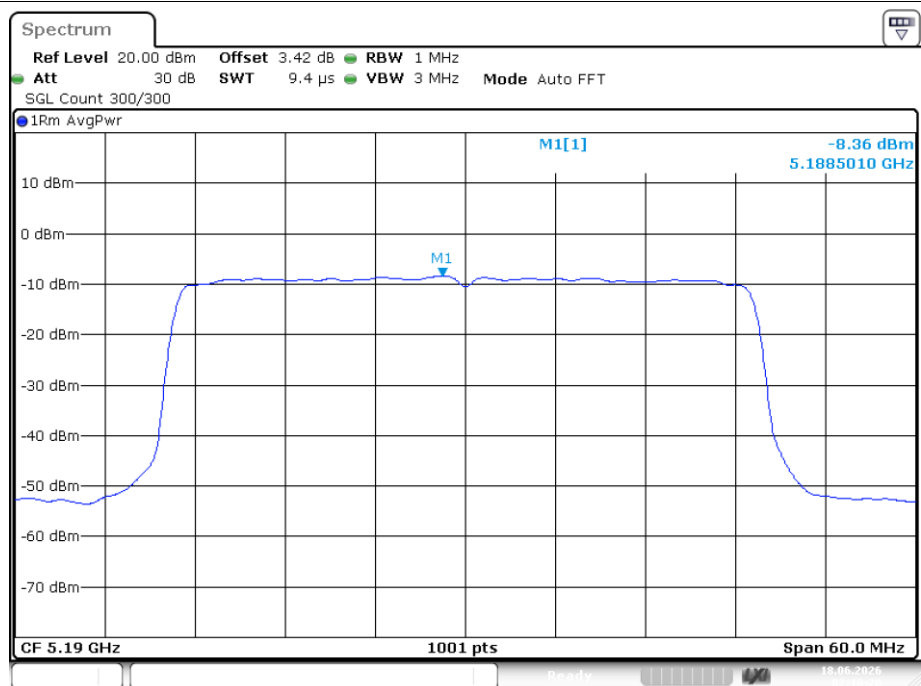


Date: 18.JUN.2026 02:10:20

PSD NVNT ax40 5190MHz Ant2

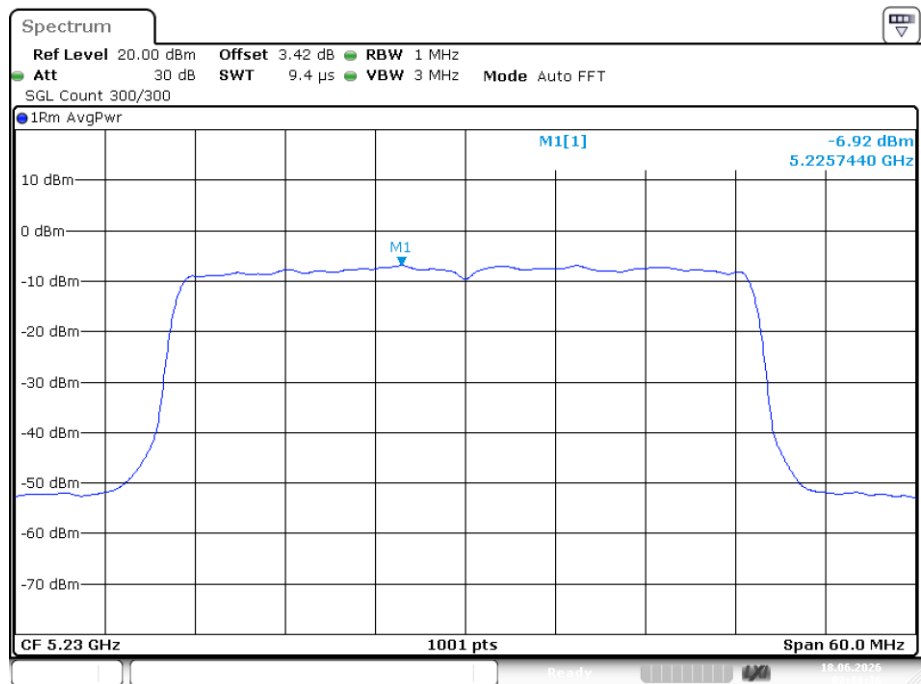


Date: 18.JUN.2026 02:11:36

PSD NVNT ax40 5230MHz Ant1

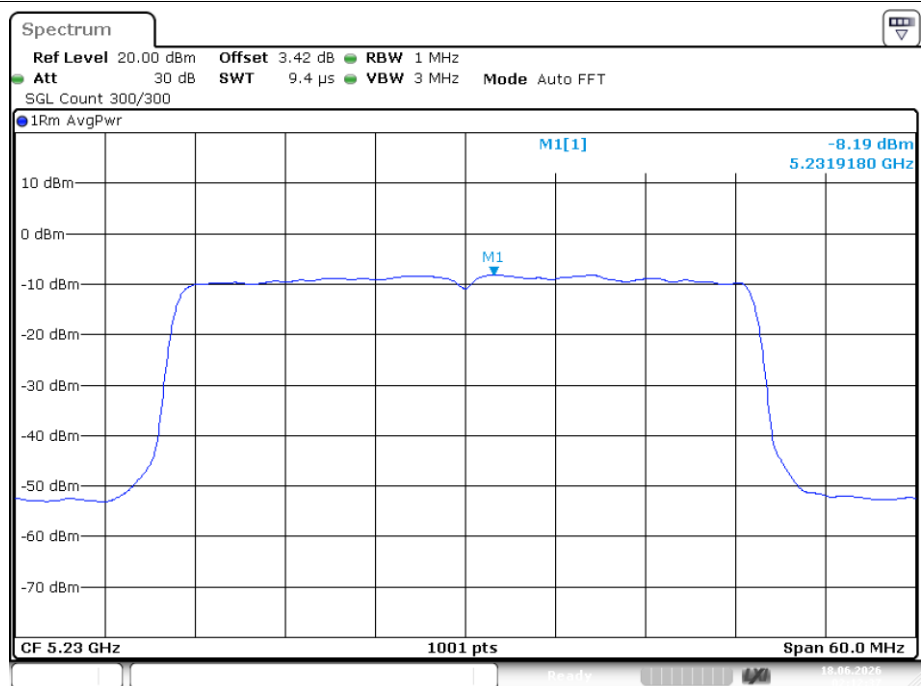


Date: 18.JUN.2026 02:12:36

PSD NVNT ax40 5230MHz Ant2

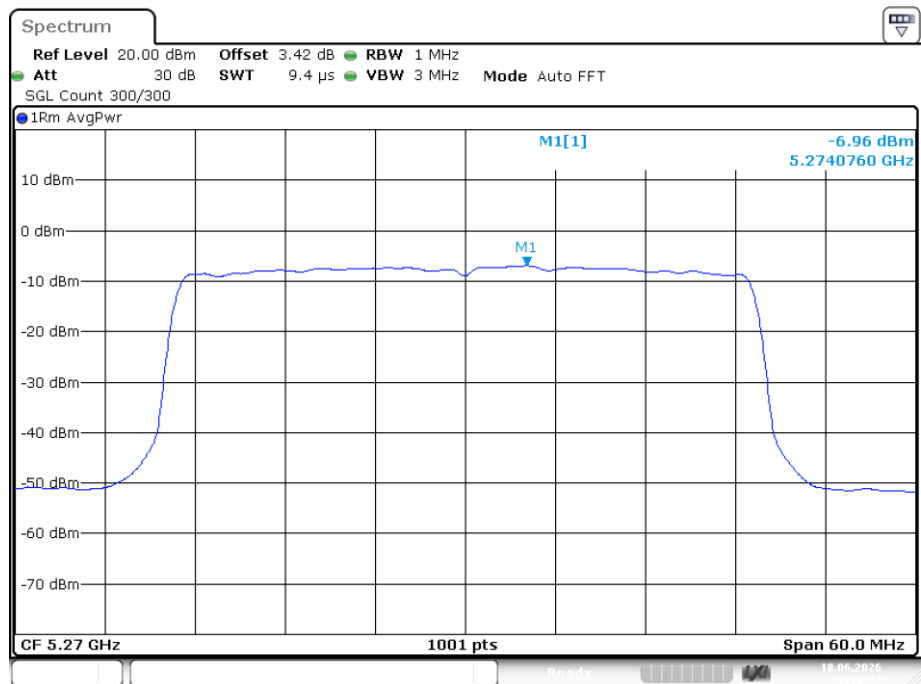


Date: 18.JUN.2026 02:13:31

PSD NVNT ax40 5270MHz Ant1

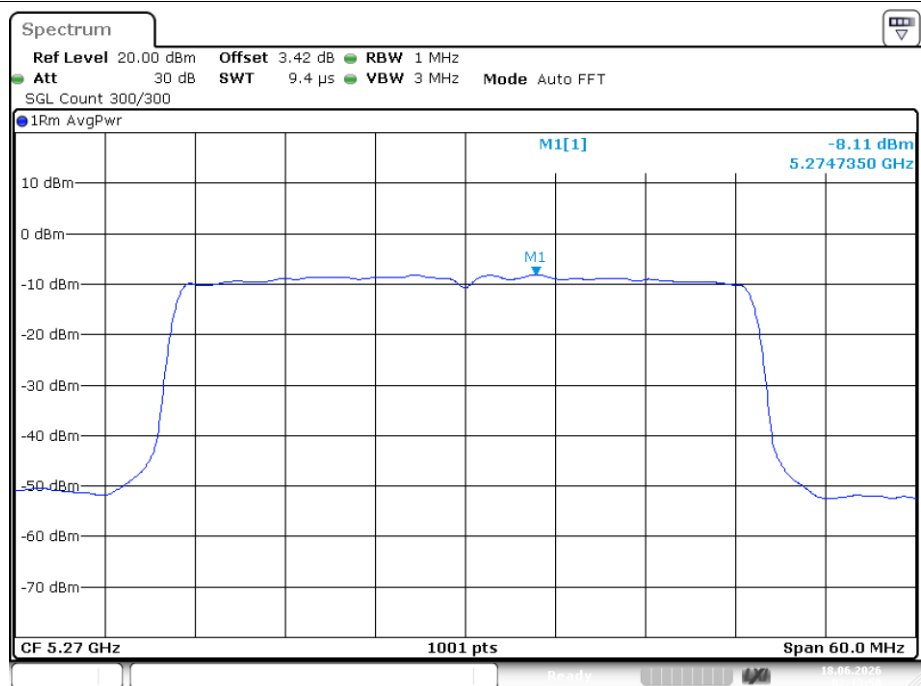


Date: 18.JUN.2026 02:13:58

PSD NVNT ax40 5270MHz Ant2

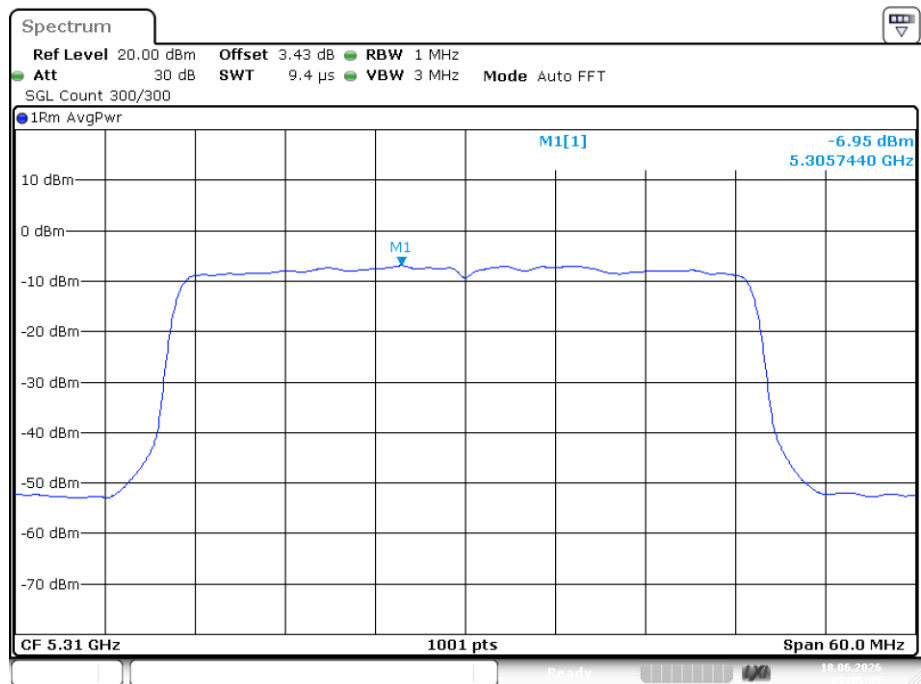


Date: 18.JUN.2026 02:15:45

PSD NVNT ax40 5310MHz Ant1

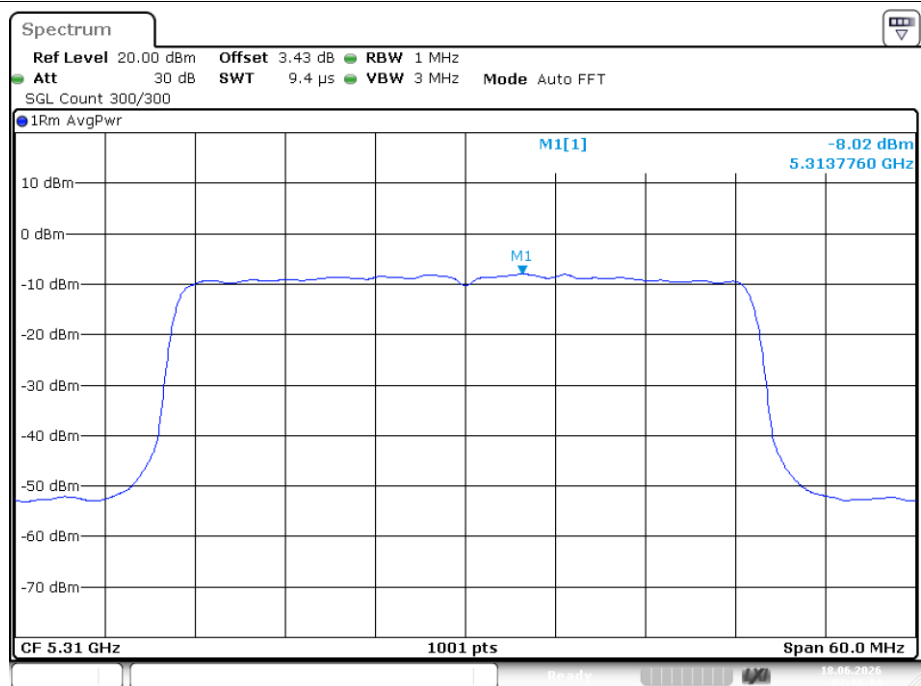


Date: 18.JUN.2026 02:16:14

PSD NVNT ax40 5310MHz Ant2

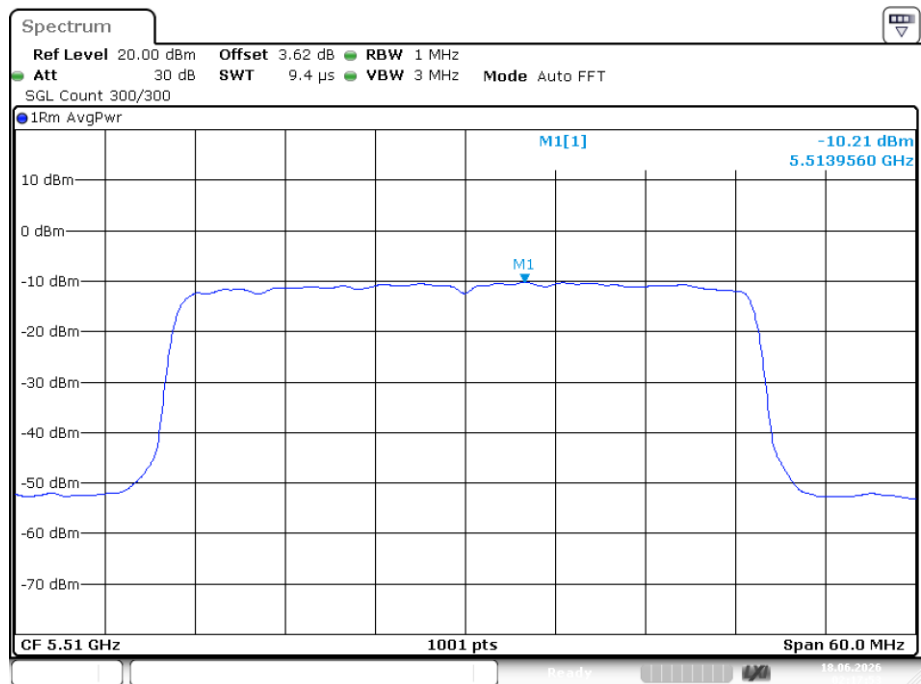


Date: 18.JUN.2026 02:17:52

PSD NVNT ax40 5510MHz Ant1

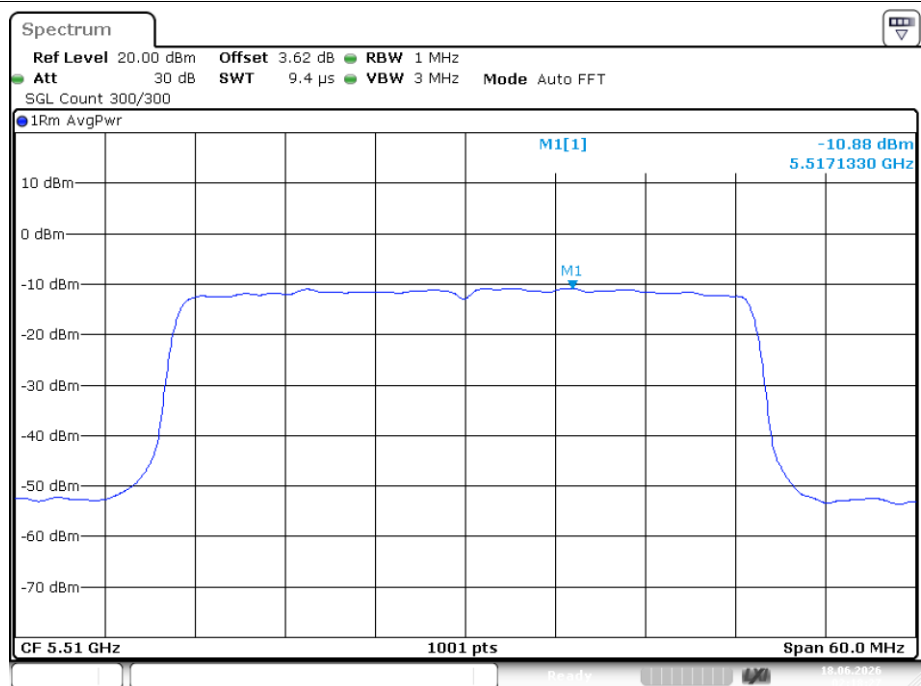


Date: 18.JUN.2026 02:18:27

PSD NVNT ax40 5510MHz Ant2

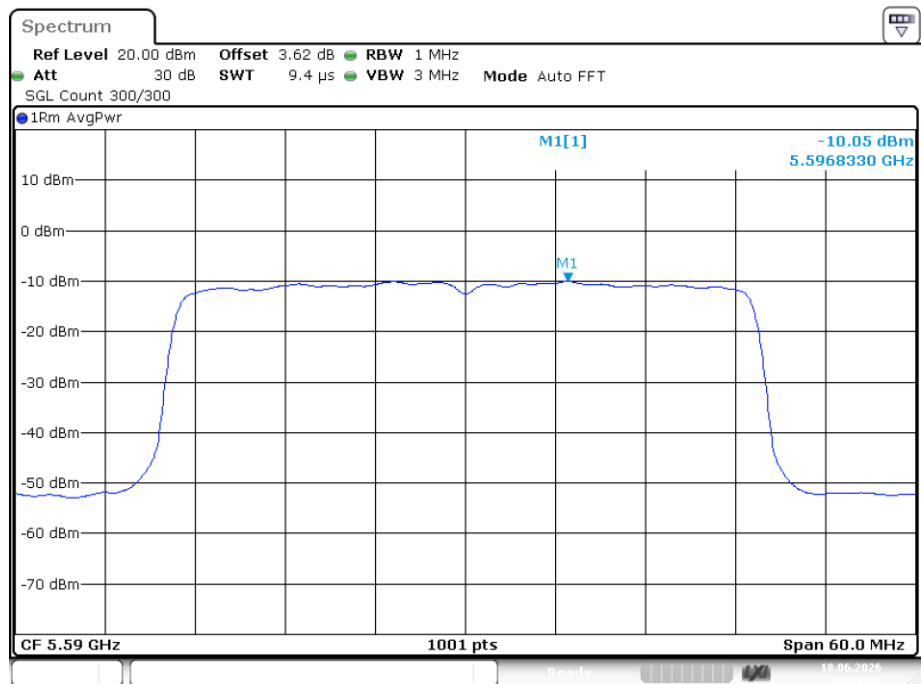


Date: 18.JUN.2026 02:19:06

PSD NVNT ax40 5590MHz Ant1

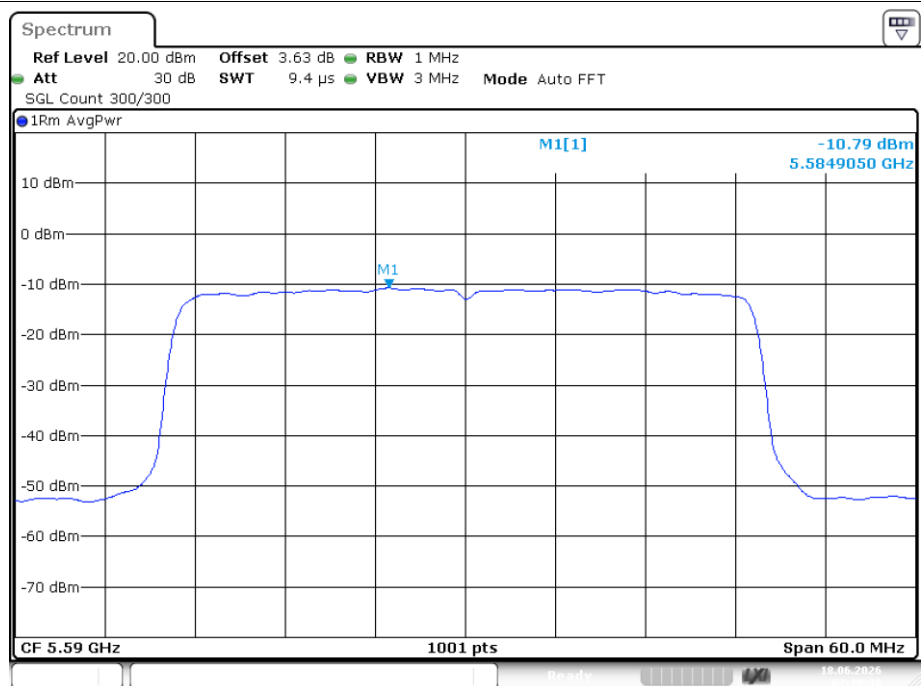


Date: 18.JUN.2026 02:19:38

PSD NVNT ax40 5590MHz Ant2

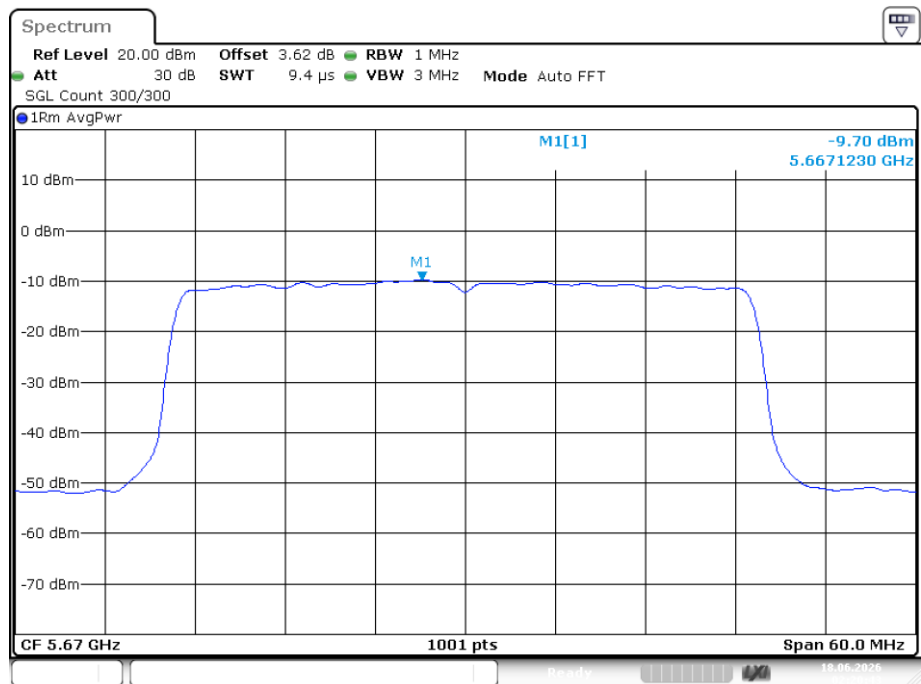


Date: 18.JUN.2026 02:20:43

PSD NVNT ax40 5670MHz Ant1

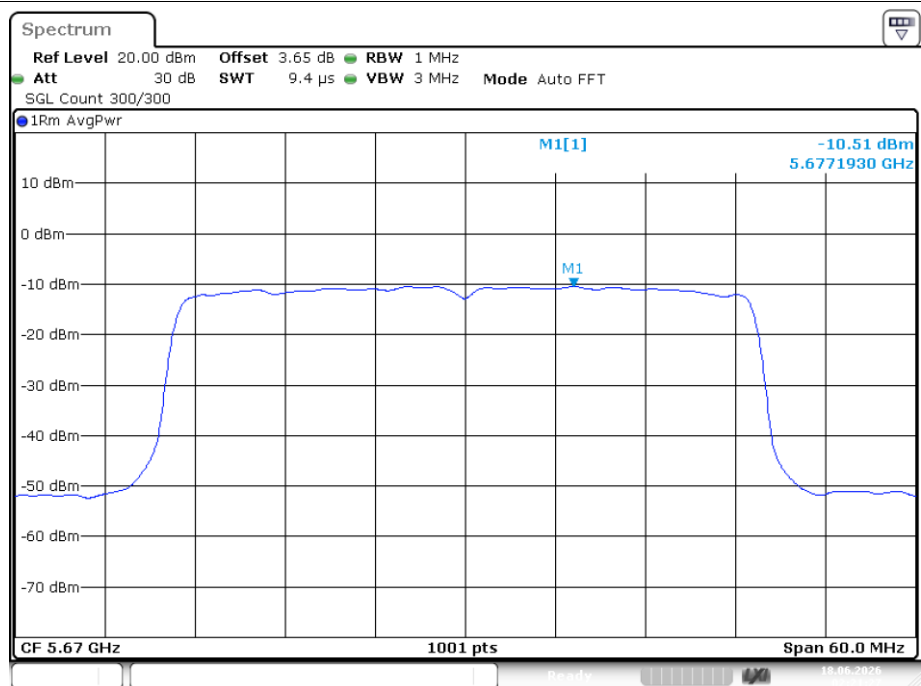


Date: 18.JUN.2026 02:21:27

PSD NVNT ax40 5670MHz Ant2

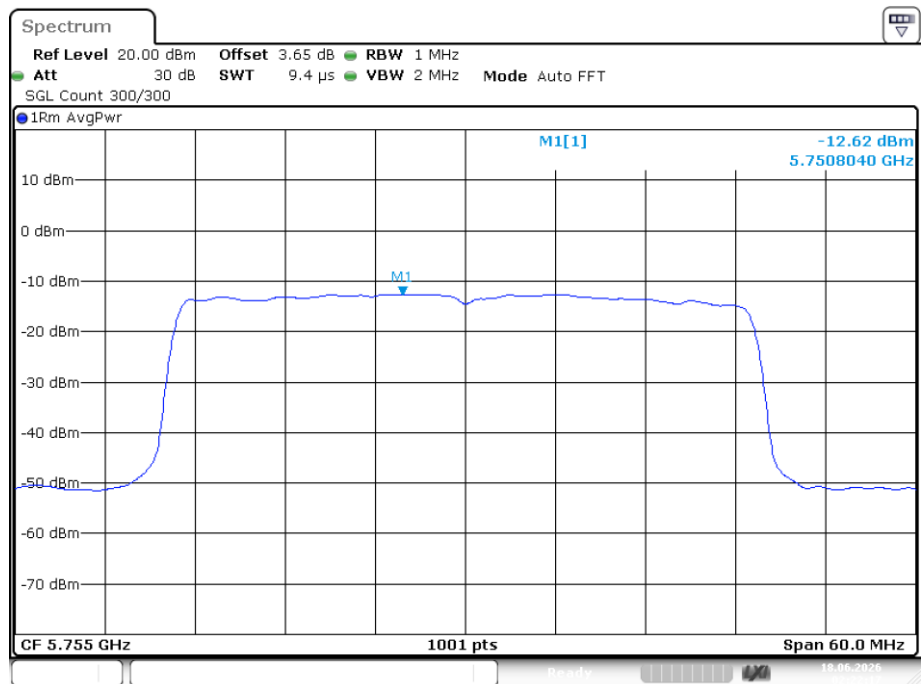


Date: 18.JUN.2026 02:22:17

PSD NVNT ax40 5755MHz Ant1

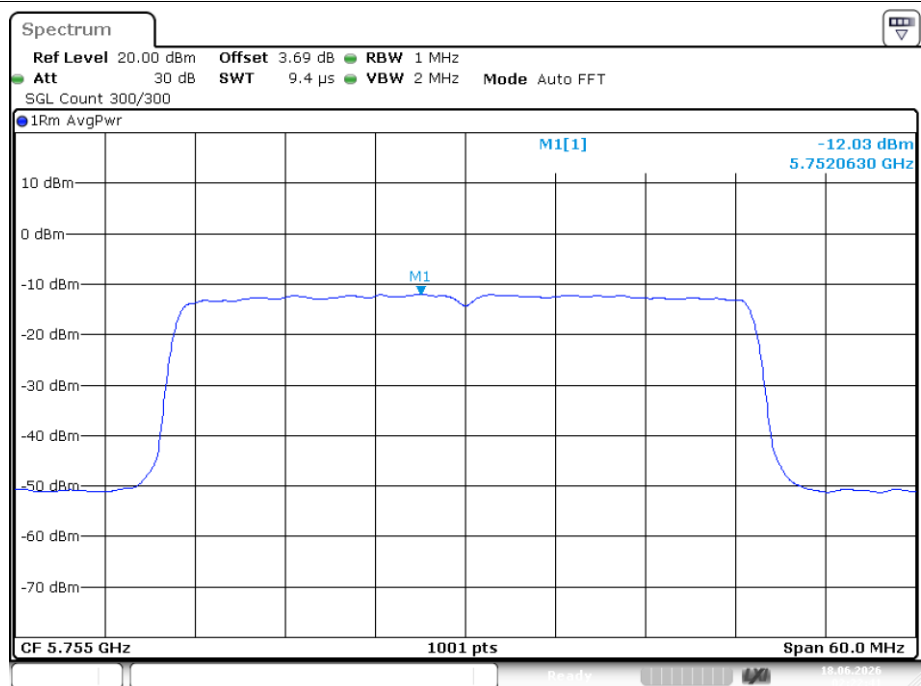


Date: 18.JUN.2026 02:22:41

PSD NVNT ax40 5755MHz Ant2

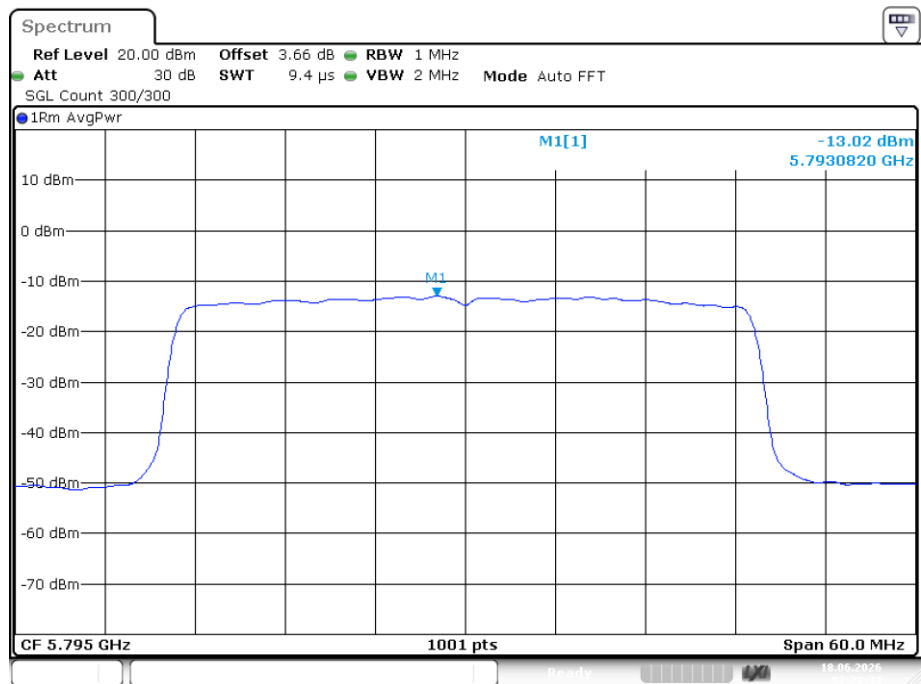


Date: 18.JUN.2026 02:23:34

PSD NVNT ax40 5795MHz Ant1

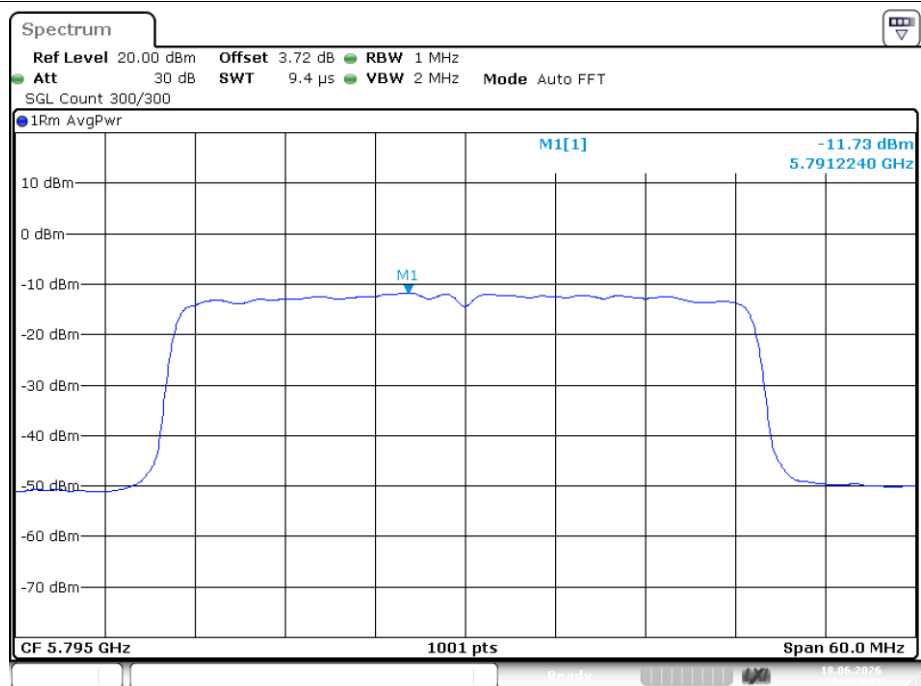


Date: 18.JUN.2026 02:24:02

PSD NVNT ax40 5795MHz Ant2

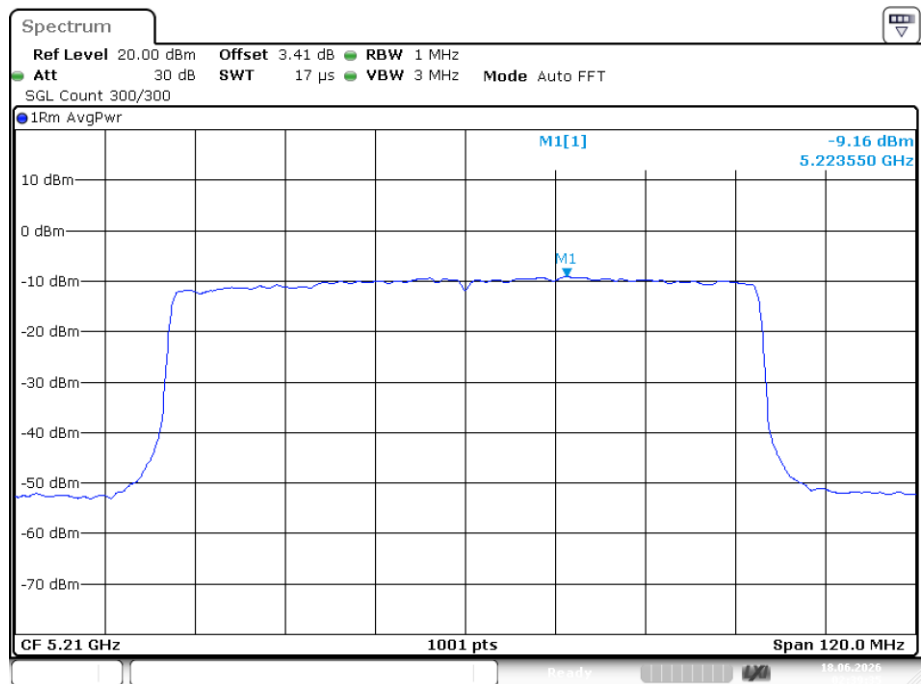


Date: 18.JUN.2026 02:39:34

PSD NVNT ax80 5210MHz Ant1

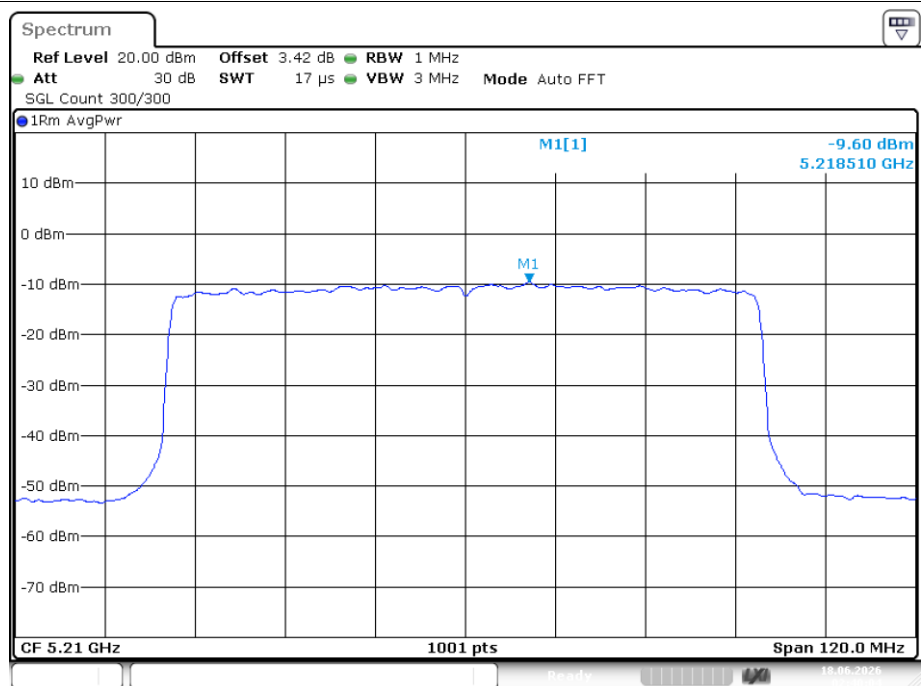


Date: 18.JUN.2026 02:40:04

PSD NVNT ax80 5210MHz Ant2

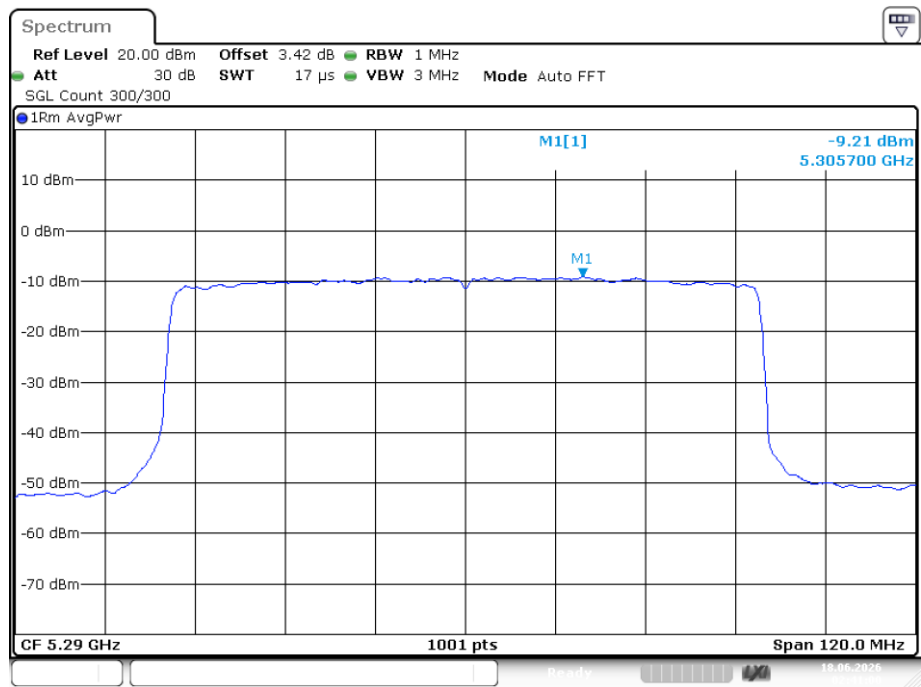


Date: 18.JUN.2026 02:41:00

PSD NVNT ax80 5290MHz Ant1

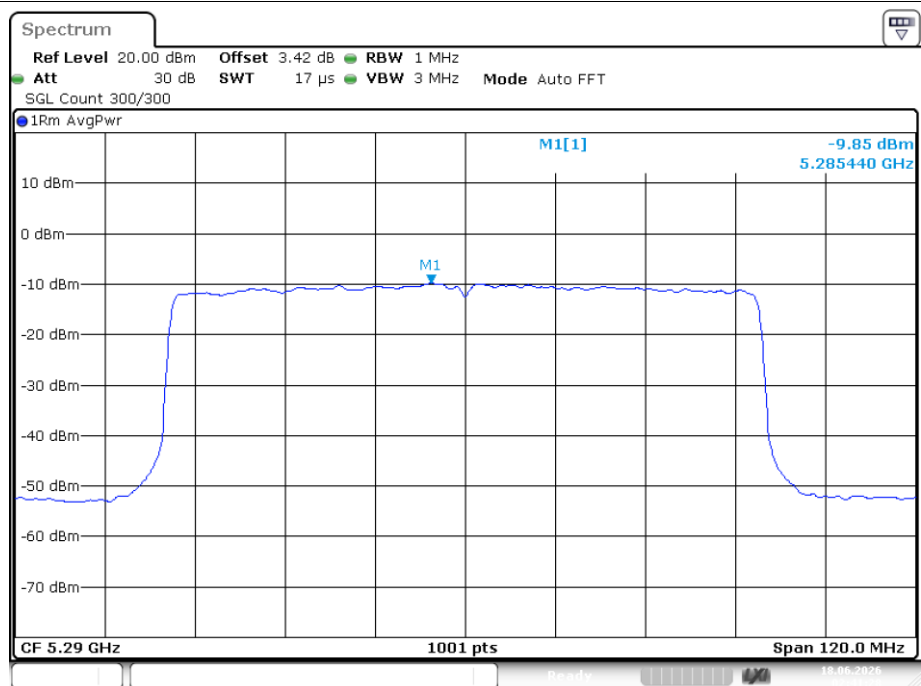


Date: 18.JUN.2026 02:41:29

PSD NVNT ax80 5290MHz Ant2

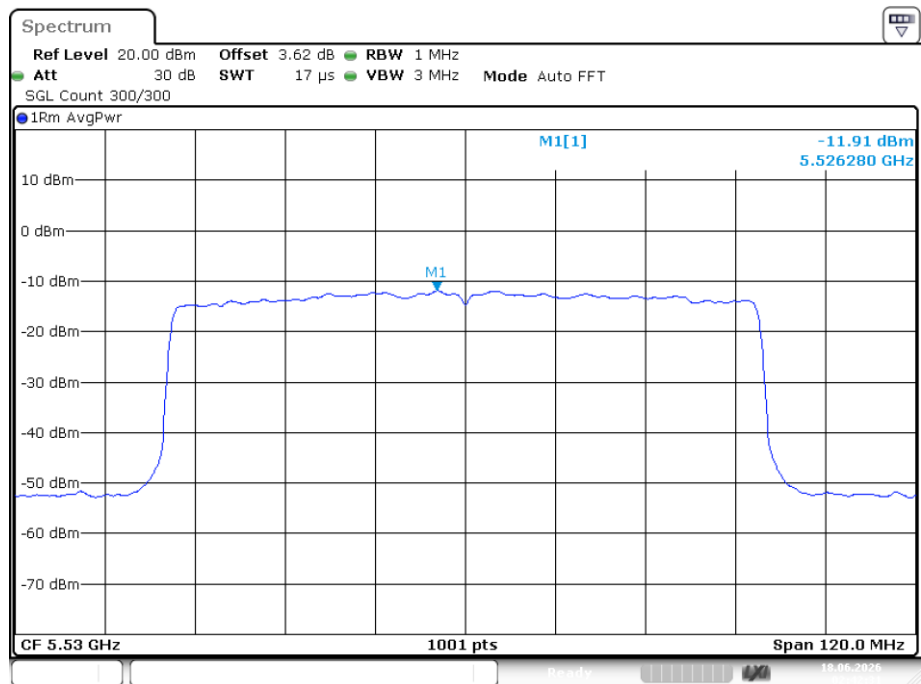


Date: 18.JUN.2026 02:42:31

PSD NVNT ax80 5530MHz Ant1

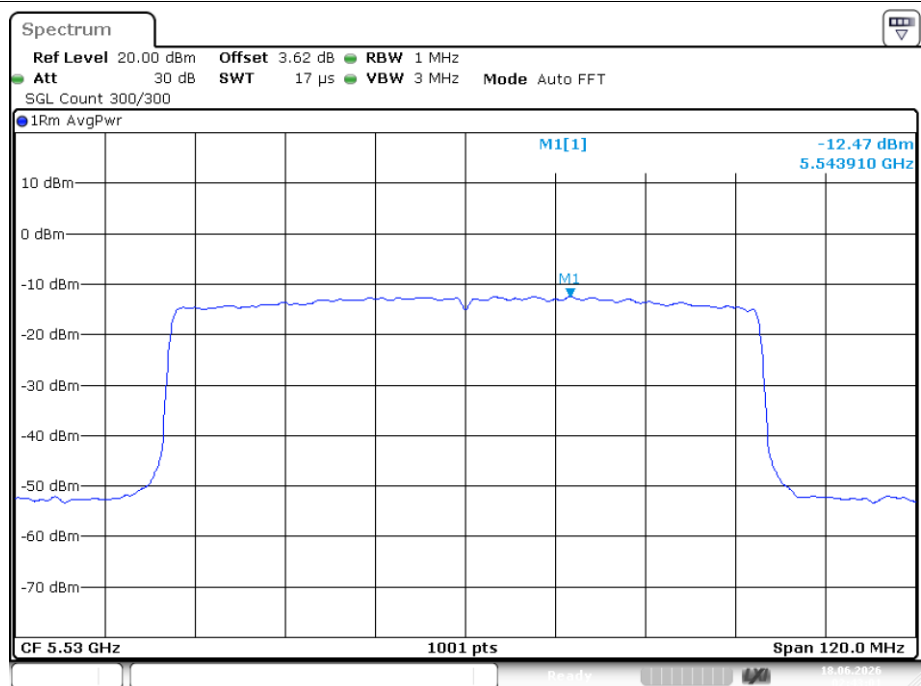


Date: 18.JUN.2026 02:43:01

PSD NVNT ax80 5530MHz Ant2

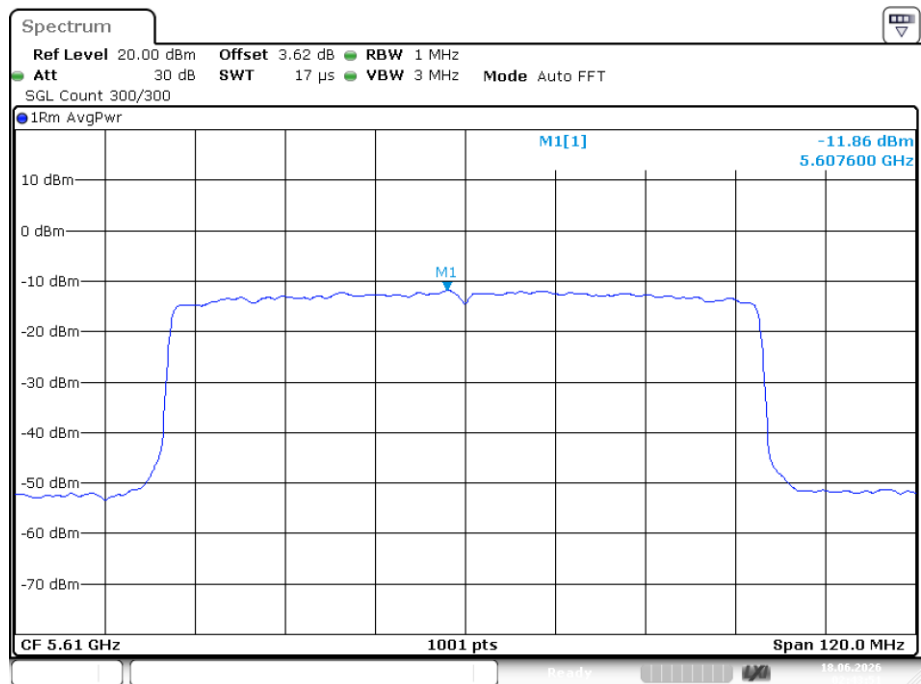


Date: 18.JUN.2026 02:43:51

PSD NVNT ax80 5610MHz Ant1

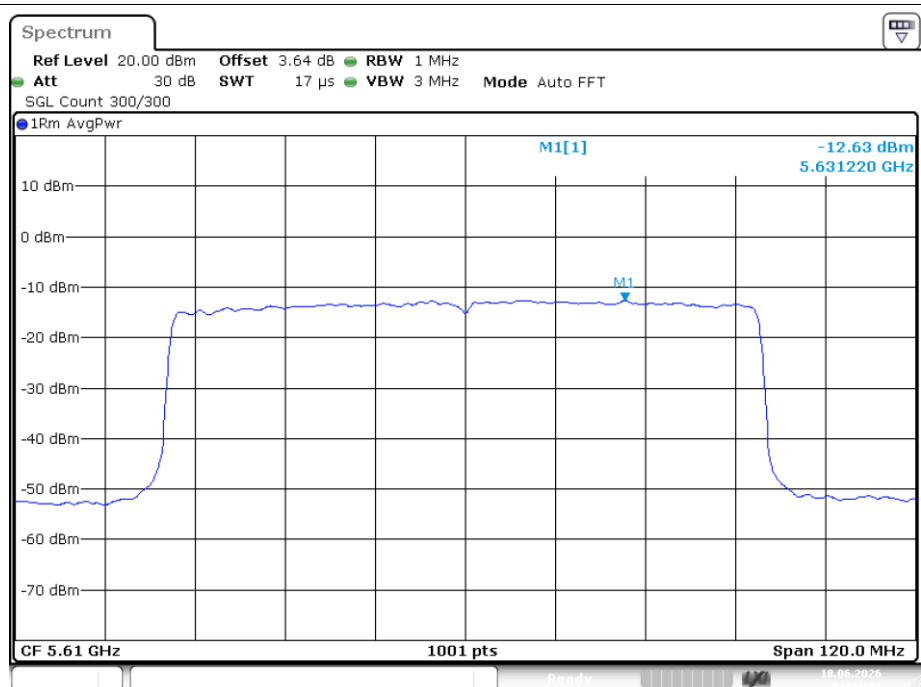


Date: 18.JUN.2026 02:44:20

PSD NVNT ax80 5610MHz Ant2

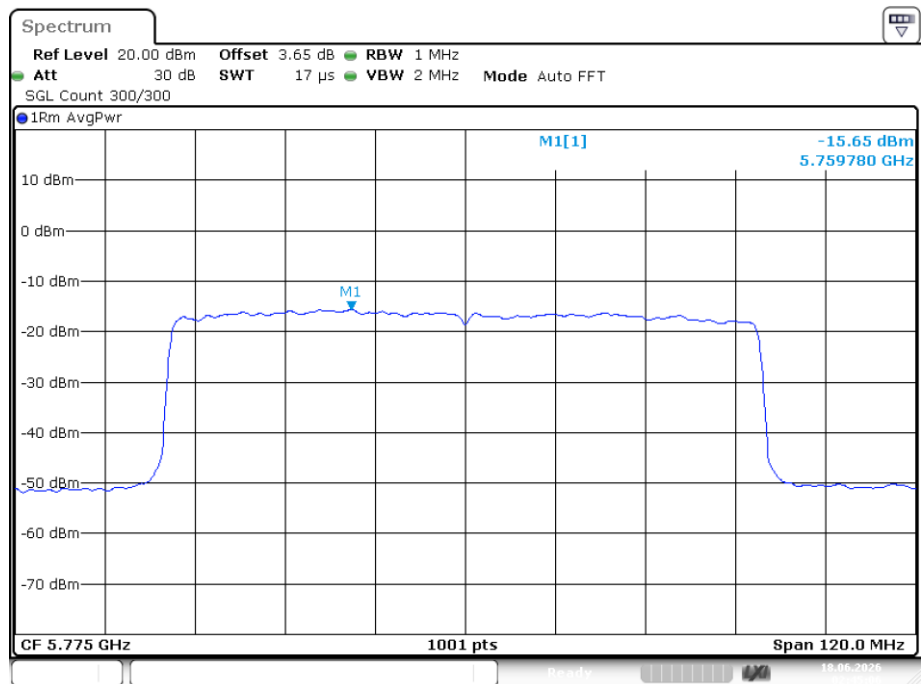


Date: 18.JUN.2026 02:45:06

PSD NVNT ax80 5775MHz Ant1

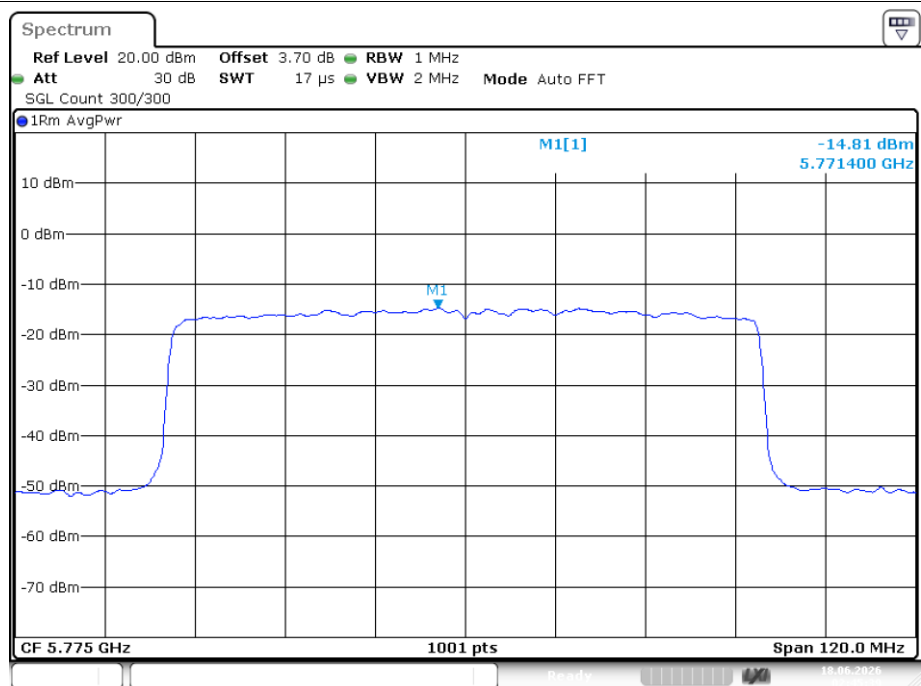


Date: 18.JUN.2026 02:45:39

PSD NVNT ax80 5775MHz Ant2

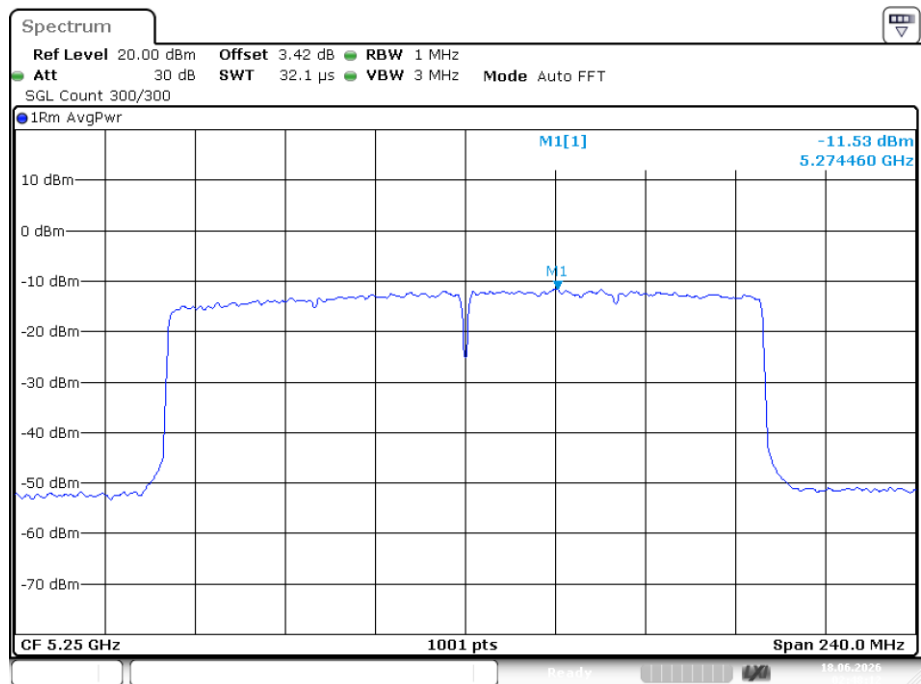


Date: 18.JUN.2026 02:48:12

PSD NVNT ax160 5250MHz Ant1

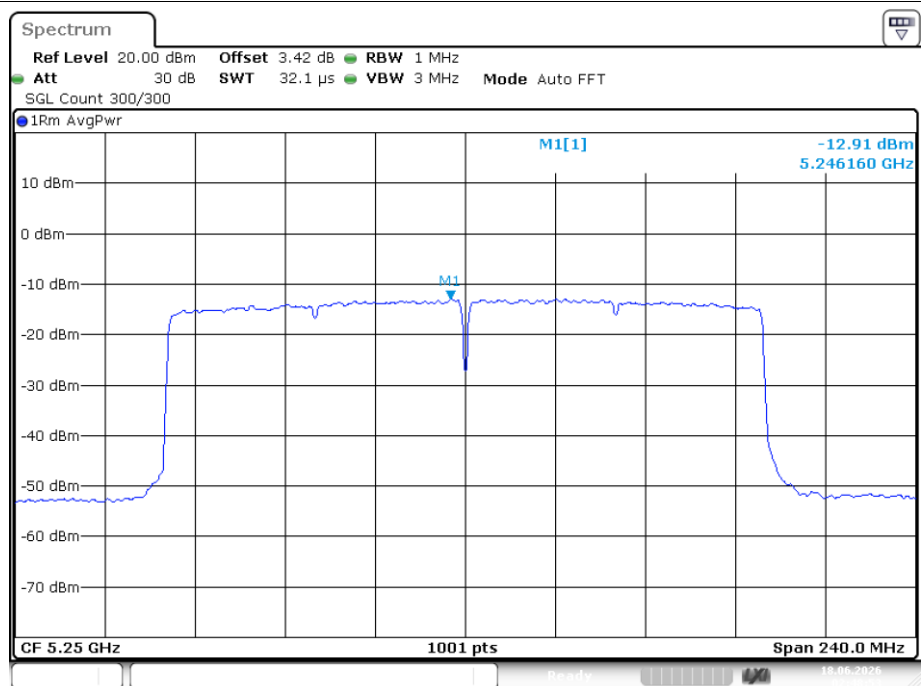


Date: 18.JUN.2026 02:48:54

PSD NVNT ax160 5250MHz Ant2

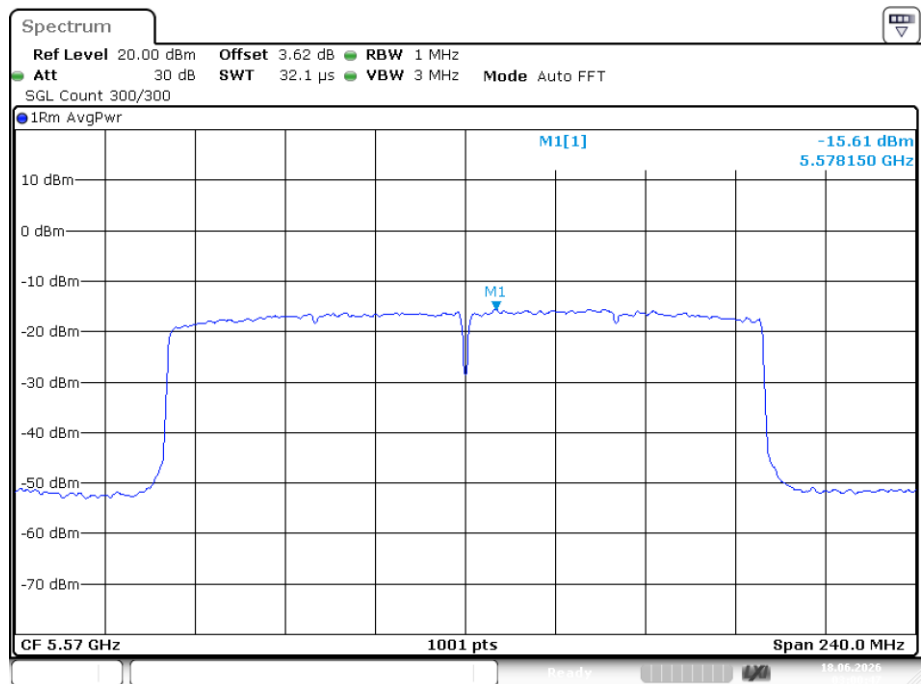

Date: 18.JUN.2026 03:00:46

PSD NVNT ax160 5570MHz Ant1

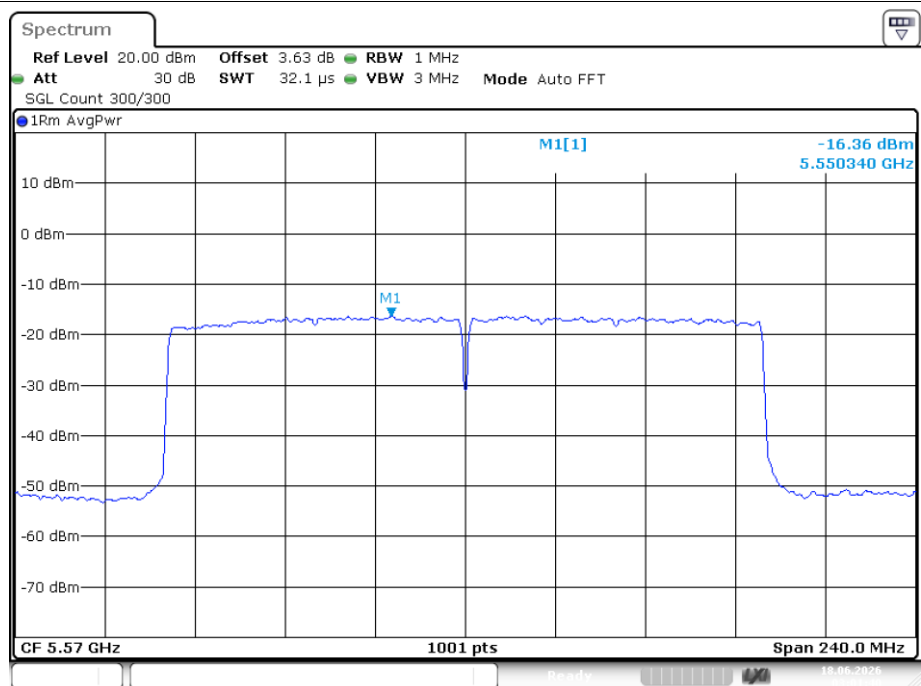

Date: 18.JUN.2026 03:01:40

PSD NVNT ax160 5570MHz Ant2

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (MHz)	Verdict
25C 3.27V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
25C 3.85V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
25C 4.43V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
-25C 3.85V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
-15C 3.85V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
-5C 3.85V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
5C 3.85V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
15C 3.85V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
35C 3.85V	a	5180	Ant1	5179.96	-40000	-7.72	5150-5250	Pass
45C 3.85V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
55C 3.85V	a	5180	Ant1	5180	0	0	5150-5250	Pass
65C 3.85V	a	5180	Ant1	5179.98	-20000	-3.86	5150-5250	Pass
25C 3.27V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
25C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
25C 4.43V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
-25C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
-15C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
-5C 3.85V	a	5200	Ant1	5200	0	0	5150-5250	Pass
5C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
15C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
35C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
45C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
55C 3.85V	a	5200	Ant1	5199.96	-40000	-7.69	5150-5250	Pass
65C 3.85V	a	5200	Ant1	5199.98	-20000	-3.85	5150-5250	Pass
25C 3.27V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
25C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
25C 4.43V	a	5240	Ant1	5240	0	0	5150-5250	Pass
-25C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
-15C 3.85V	a	5240	Ant1	5239.96	-40000	-7.63	5150-5250	Pass
-5C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
5C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
15C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass
35C 3.85V	a	5240	Ant1	5239.98	-20000	-3.82	5150-5250	Pass

45C 3.85V	a	5240	Ant1	5239.96	-40000	-7.63	5150-5250	Pass
55C 3.85V	a	5240	Ant1	5240	0	0	5150-5250	Pass
65C 3.85V	a	5240	Ant1	5239.96	-40000	-7.63	5150-5250	Pass
25C 3.27V	a	5260	Ant1	5259.96	-40000	-7.6	5250-5350	Pass
25C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
25C 4.43V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
-25C 3.85V	a	5260	Ant1	5259.96	-40000	-7.6	5250-5350	Pass
-15C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
-5C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
5C 3.85V	a	5260	Ant1	5260	0	0	5250-5350	Pass
15C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
35C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
45C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
55C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
65C 3.85V	a	5260	Ant1	5259.98	-20000	-3.8	5250-5350	Pass
25C 3.27V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
25C 3.85V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
25C 4.43V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
-25C 3.85V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
-15C 3.85V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
-5C 3.85V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
5C 3.85V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
15C 3.85V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
35C 3.85V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
45C 3.85V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
55C 3.85V	a	5280	Ant1	5279.96	-40000	-7.58	5250-5350	Pass
65C 3.85V	a	5280	Ant1	5279.98	-20000	-3.79	5250-5350	Pass
25C 3.27V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 4.43V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
-25C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
-15C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
-5C 3.85V	a	5320	Ant1	5319.94	-60000	-11.28	5250-5350	Pass
5C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
15C 3.85V	a	5320	Ant1	5319.96	-40000	-7.52	5250-5350	Pass
35C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
45C 3.85V	a	5320	Ant1	5319.96	-40000	-7.52	5250-5350	Pass
55C 3.85V	a	5320	Ant1	5320	0	0	5250-5350	Pass

65C 3.85V	a	5320	Ant1	5319.98	-20000	-3.76	5250-5350	Pass
25C 3.27V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
25C 3.85V	a	5500	Ant1	5499.96	-40000	-7.27	5470-5725	Pass
25C 4.43V	a	5500	Ant1	5499.96	-40000	-7.27	5470-5725	Pass
-25C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
-15C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
-5C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
5C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
15C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
35C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
45C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
55C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
65C 3.85V	a	5500	Ant1	5499.98	-20000	-3.64	5470-5725	Pass
25C 3.27V	a	5600	Ant1	5599.96	-40000	-7.14	5470-5725	Pass
25C 3.85V	a	5600	Ant1	5599.96	-40000	-7.14	5470-5725	Pass
25C 4.43V	a	5600	Ant1	5599.96	-40000	-7.14	5470-5725	Pass
-25C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
-15C 3.85V	a	5600	Ant1	5599.96	-40000	-7.14	5470-5725	Pass
-5C 3.85V	a	5600	Ant1	5599.96	-40000	-7.14	5470-5725	Pass
5C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
15C 3.85V	a	5600	Ant1	5599.94	-60000	-10.71	5470-5725	Pass
35C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
45C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
55C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
65C 3.85V	a	5600	Ant1	5599.98	-20000	-3.57	5470-5725	Pass
25C 3.27V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
25C 3.85V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
25C 4.43V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
-25C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
-15C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
-5C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
5C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
15C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
35C 3.85V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
45C 3.85V	a	5700	Ant1	5699.98	-20000	-3.51	5470-5725	Pass
55C 3.85V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
65C 3.85V	a	5700	Ant1	5699.96	-40000	-7.02	5470-5725	Pass
25C 3.27V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass

25C 3.85V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
25C 4.43V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
-25C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
-15C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
-5C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
5C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
15C 3.85V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
35C 3.85V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
45C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
55C 3.85V	a	5745	Ant1	5744.96	-40000	-6.96	5725-5850	Pass
65C 3.85V	a	5745	Ant1	5744.98	-20000	-3.48	5725-5850	Pass
25C 3.27V	a	5785	Ant1	5784.96	-40000	-6.91	5725-5850	Pass
25C 3.85V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
25C 4.43V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
-25C 3.85V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
-15C 3.85V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
-5C 3.85V	a	5785	Ant1	5784.96	-40000	-6.91	5725-5850	Pass
5C 3.85V	a	5785	Ant1	5784.94	-60000	-10.37	5725-5850	Pass
15C 3.85V	a	5785	Ant1	5785	0	0	5725-5850	Pass
35C 3.85V	a	5785	Ant1	5784.96	-40000	-6.91	5725-5850	Pass
45C 3.85V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
55C 3.85V	a	5785	Ant1	5784.98	-20000	-3.46	5725-5850	Pass
65C 3.85V	a	5785	Ant1	5784.96	-40000	-6.91	5725-5850	Pass
25C 3.27V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
25C 3.85V	a	5825	Ant1	5824.96	-40000	-6.87	5725-5850	Pass
25C 4.43V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
-25C 3.85V	a	5825	Ant1	5824.96	-40000	-6.87	5725-5850	Pass
-15C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
-5C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
5C 3.85V	a	5825	Ant1	5824.96	-40000	-6.87	5725-5850	Pass
15C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
35C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
45C 3.85V	a	5825	Ant1	5824.96	-40000	-6.87	5725-5850	Pass
55C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
65C 3.85V	a	5825	Ant1	5824.98	-20000	-3.43	5725-5850	Pass
25C 3.27V	a	5180	Ant2	5179.96	-40000	-7.72	5150-5250	Pass
25C 3.85V	a	5180	Ant2	5179.96	-40000	-7.72	5150-5250	Pass
25C 4.43V	a	5180	Ant2	5179.96	-40000	-7.72	5150-5250	Pass