

NVNT	n40	5755	Sum	-8.94	-	-8.94	30	Pass
NVNT	n40	5795	Ant1	-12.51	0	-12.51	30	Pass
NVNT	n40	5795	Ant2	-11.65	0	-11.65	30	Pass
NVNT	n40	5795	Sum	-9.05	-	-9.05	30	Pass
NVNT	ac20	5180	Ant1	-3.17	0	-3.17	11	Pass
NVNT	ac20	5180	Ant2	-3.93	0	-3.93	11	Pass
NVNT	ac20	5180	Sum	-0.52	-	-0.52	11	Pass
NVNT	ac20	5200	Ant1	-2.88	0	-2.88	11	Pass
NVNT	ac20	5200	Ant2	-4.36	0	-4.36	11	Pass
NVNT	ac20	5200	Sum	-0.55	-	-0.55	11	Pass
NVNT	ac20	5240	Ant1	-2.93	0	-2.93	11	Pass
NVNT	ac20	5240	Ant2	-4.15	0	-4.15	11	Pass
NVNT	ac20	5240	Sum	-0.49	-	-0.49	11	Pass
NVNT	ac20	5260	Ant1	-2.8	0	-2.8	11	Pass
NVNT	ac20	5260	Ant2	-3.95	0	-3.95	11	Pass
NVNT	ac20	5260	Sum	-0.33	-	-0.33	11	Pass
NVNT	ac20	5280	Ant1	-2.68	0	-2.68	11	Pass
NVNT	ac20	5280	Ant2	-4.13	0	-4.13	11	Pass
NVNT	ac20	5280	Sum	-0.33	-	-0.33	11	Pass
NVNT	ac20	5320	Ant1	-2.85	0	-2.85	11	Pass
NVNT	ac20	5320	Ant2	-3.92	0	-3.92	11	Pass
NVNT	ac20	5320	Sum	-0.34	-	-0.34	11	Pass
NVNT	ac20	5500	Ant1	-6.12	0	-6.12	11	Pass
NVNT	ac20	5500	Ant2	-6.93	0	-6.93	11	Pass
NVNT	ac20	5500	Sum	-3.5	-	-3.5	11	Pass
NVNT	ac20	5600	Ant1	-5.86	0	-5.86	11	Pass
NVNT	ac20	5600	Ant2	-6.53	0	-6.53	11	Pass
NVNT	ac20	5600	Sum	-3.17	-	-3.17	11	Pass
NVNT	ac20	5700	Ant1	-6.14	0	-6.14	11	Pass
NVNT	ac20	5700	Ant2	-6.3	0	-6.3	11	Pass
NVNT	ac20	5700	Sum	-3.21	-	-3.21	11	Pass
NVNT	ac20	5745	Ant1	-9.02	0	-9.02	30	Pass
NVNT	ac20	5745	Ant2	-8.75	0	-8.75	30	Pass
NVNT	ac20	5745	Sum	-5.87	-	-5.87	30	Pass
NVNT	ac20	5785	Ant1	-10.05	0	-10.05	30	Pass
NVNT	ac20	5785	Ant2	-8.95	0	-8.95	30	Pass
NVNT	ac20	5785	Sum	-6.45	-	-6.45	30	Pass
NVNT	ac20	5825	Ant1	-9.46	0	-9.46	30	Pass
NVNT	ac20	5825	Ant2	-9.14	0	-9.14	30	Pass
NVNT	ac20	5825	Sum	-6.29	-	-6.29	30	Pass
NVNT	ac40	5190	Ant1	-7.03	0	-7.03	11	Pass
NVNT	ac40	5190	Ant2	-8.13	0	-8.13	11	Pass
NVNT	ac40	5190	Sum	-4.53	-	-4.53	11	Pass
NVNT	ac40	5230	Ant1	-6.7	0	-6.7	11	Pass

NVNT	ac40	5230	Ant2	-7.97	0	-7.97	11	Pass
NVNT	ac40	5230	Sum	-4.28	-	-4.28	11	Pass
NVNT	ac40	5270	Ant1	-6.61	0	-6.61	11	Pass
NVNT	ac40	5270	Ant2	-7.94	0	-7.94	11	Pass
NVNT	ac40	5270	Sum	-4.21	-	-4.21	11	Pass
NVNT	ac40	5310	Ant1	-6.7	0	-6.7	11	Pass
NVNT	ac40	5310	Ant2	-7.68	0	-7.68	11	Pass
NVNT	ac40	5310	Sum	-4.15	-	-4.15	11	Pass
NVNT	ac40	5510	Ant1	-10.08	0	-10.08	11	Pass
NVNT	ac40	5510	Ant2	-10.65	0	-10.65	11	Pass
NVNT	ac40	5510	Sum	-7.35	-	-7.35	11	Pass
NVNT	ac40	5590	Ant1	-9.86	0	-9.86	11	Pass
NVNT	ac40	5590	Ant2	-10.29	0	-10.29	11	Pass
NVNT	ac40	5590	Sum	-7.06	-	-7.06	11	Pass
NVNT	ac40	5670	Ant1	-9.6	0	-9.6	11	Pass
NVNT	ac40	5670	Ant2	-10.03	0	-10.03	11	Pass
NVNT	ac40	5670	Sum	-6.8	-	-6.8	11	Pass
NVNT	ac40	5755	Ant1	-12.3	0	-12.3	30	Pass
NVNT	ac40	5755	Ant2	-11.51	0	-11.51	30	Pass
NVNT	ac40	5755	Sum	-8.88	-	-8.88	30	Pass
NVNT	ac40	5795	Ant1	-12.4	0	-12.4	30	Pass
NVNT	ac40	5795	Ant2	-11.52	0	-11.52	30	Pass
NVNT	ac40	5795	Sum	-8.93	-	-8.93	30	Pass
NVNT	ac80	5210	Ant1	-9.22	0	-9.22	11	Pass
NVNT	ac80	5210	Ant2	-9.87	0	-9.87	11	Pass
NVNT	ac80	5210	Sum	-6.52	-	-6.52	11	Pass
NVNT	ac80	5290	Ant1	-8.99	0	-8.99	11	Pass
NVNT	ac80	5290	Ant2	-10.13	0	-10.13	11	Pass
NVNT	ac80	5290	Sum	-6.51	-	-6.51	11	Pass
NVNT	ac80	5530	Ant1	-11.96	0	-11.96	11	Pass
NVNT	ac80	5530	Ant2	-12.67	0	-12.67	11	Pass
NVNT	ac80	5530	Sum	-9.29	-	-9.29	11	Pass
NVNT	ac80	5610	Ant1	-11.93	0	-11.93	11	Pass
NVNT	ac80	5610	Ant2	-12.42	0	-12.42	11	Pass
NVNT	ac80	5610	Sum	-9.16	-	-9.16	11	Pass
NVNT	ac80	5775	Ant1	-15.54	0	-15.54	30	Pass
NVNT	ac80	5775	Ant2	-14.81	0	-14.81	30	Pass
NVNT	ac80	5775	Sum	-12.15	-	-12.15	30	Pass
NVNT	ac160	5250	Ant1	-11.5	0	-11.5	11	Pass
NVNT	ac160	5250	Ant2	-12.75	0	-12.75	11	Pass
NVNT	ac160	5250	Sum	-9.07	-	-9.07	11	Pass
NVNT	ac160	5570	Ant1	-15.46	0	-15.46	11	Pass
NVNT	ac160	5570	Ant2	-16.14	0	-16.14	11	Pass
NVNT	ac160	5570	Sum	-12.78	-	-12.78	11	Pass

NVNT	ax20	5180	Ant1	-2.41	0	-2.41	11	Pass
NVNT	ax20	5180	Ant2	-3.15	0	-3.15	11	Pass
NVNT	ax20	5180	Sum	0.25	-	0.25	11	Pass
NVNT	ax20	5200	Ant1	-2.55	0	-2.55	11	Pass
NVNT	ax20	5200	Ant2	-3.56	0	-3.56	11	Pass
NVNT	ax20	5200	Sum	-0.02	-	-0.02	11	Pass
NVNT	ax20	5240	Ant1	-1.79	0	-1.79	11	Pass
NVNT	ax20	5240	Ant2	-3.22	0	-3.22	11	Pass
NVNT	ax20	5240	Sum	0.56	-	0.56	11	Pass
NVNT	ax20	5260	Ant1	-2.24	0	-2.24	11	Pass
NVNT	ax20	5260	Ant2	-3.29	0	-3.29	11	Pass
NVNT	ax20	5260	Sum	0.28	-	0.28	11	Pass
NVNT	ax20	5280	Ant1	-2.15	0	-2.15	11	Pass
NVNT	ax20	5280	Ant2	-3.32	0	-3.32	11	Pass
NVNT	ax20	5280	Sum	0.31	-	0.31	11	Pass
NVNT	ax20	5320	Ant1	-2.26	0	-2.26	11	Pass
NVNT	ax20	5320	Ant2	-2.95	0	-2.95	11	Pass
NVNT	ax20	5320	Sum	0.42	-	0.42	11	Pass
NVNT	ax20	5500	Ant1	-5.61	0	-5.61	11	Pass
NVNT	ax20	5500	Ant2	-6.3	0	-6.3	11	Pass
NVNT	ax20	5500	Sum	-2.93	-	-2.93	11	Pass
NVNT	ax20	5600	Ant1	-4.91	0	-4.91	11	Pass
NVNT	ax20	5600	Ant2	-6.07	0	-6.07	11	Pass
NVNT	ax20	5600	Sum	-2.44	-	-2.44	11	Pass
NVNT	ax20	5700	Ant1	-5.56	0	-5.56	11	Pass
NVNT	ax20	5700	Ant2	-5.08	0	-5.08	11	Pass
NVNT	ax20	5700	Sum	-2.3	-	-2.3	11	Pass
NVNT	ax20	5745	Ant1	-8.36	0	-8.36	30	Pass
NVNT	ax20	5745	Ant2	-8.48	0	-8.48	30	Pass
NVNT	ax20	5745	Sum	-5.41	-	-5.41	30	Pass
NVNT	ax20	5785	Ant1	-9.39	0	-9.39	30	Pass
NVNT	ax20	5785	Ant2	-8.36	0	-8.36	30	Pass
NVNT	ax20	5785	Sum	-5.83	-	-5.83	30	Pass
NVNT	ax20	5825	Ant1	-8.42	0	-8.42	30	Pass
NVNT	ax20	5825	Ant2	-8.14	0	-8.14	30	Pass
NVNT	ax20	5825	Sum	-5.27	-	-5.27	30	Pass
NVNT	ax40	5190	Ant1	-7.21	0	-7.21	11	Pass
NVNT	ax40	5190	Ant2	-8.36	0	-8.36	11	Pass
NVNT	ax40	5190	Sum	-4.74	-	-4.74	11	Pass
NVNT	ax40	5230	Ant1	-6.92	0	-6.92	11	Pass
NVNT	ax40	5230	Ant2	-8.19	0	-8.19	11	Pass
NVNT	ax40	5230	Sum	-4.5	-	-4.5	11	Pass
NVNT	ax40	5270	Ant1	-6.96	0	-6.96	11	Pass
NVNT	ax40	5270	Ant2	-8.11	0	-8.11	11	Pass

NVNT	ax40	5270	Sum	-4.49	-	-4.49	11	Pass
NVNT	ax40	5310	Ant1	-6.95	0	-6.95	11	Pass
NVNT	ax40	5310	Ant2	-8.02	0	-8.02	11	Pass
NVNT	ax40	5310	Sum	-4.44	-	-4.44	11	Pass
NVNT	ax40	5510	Ant1	-10.21	0	-10.21	11	Pass
NVNT	ax40	5510	Ant2	-10.88	0	-10.88	11	Pass
NVNT	ax40	5510	Sum	-7.52	-	-7.52	11	Pass
NVNT	ax40	5590	Ant1	-10.05	0	-10.05	11	Pass
NVNT	ax40	5590	Ant2	-10.79	0	-10.79	11	Pass
NVNT	ax40	5590	Sum	-7.39	-	-7.39	11	Pass
NVNT	ax40	5670	Ant1	-9.7	0	-9.7	11	Pass
NVNT	ax40	5670	Ant2	-10.51	0	-10.51	11	Pass
NVNT	ax40	5670	Sum	-7.08	-	-7.08	11	Pass
NVNT	ax40	5755	Ant1	-12.62	0	-12.62	30	Pass
NVNT	ax40	5755	Ant2	-12.03	0	-12.03	30	Pass
NVNT	ax40	5755	Sum	-9.3	-	-9.3	30	Pass
NVNT	ax40	5795	Ant1	-13.02	0	-13.02	30	Pass
NVNT	ax40	5795	Ant2	-11.73	0	-11.73	30	Pass
NVNT	ax40	5795	Sum	-9.32	-	-9.32	30	Pass
NVNT	ax80	5210	Ant1	-9.16	0	-9.16	11	Pass
NVNT	ax80	5210	Ant2	-9.6	0	-9.6	11	Pass
NVNT	ax80	5210	Sum	-6.36	-	-6.36	11	Pass
NVNT	ax80	5290	Ant1	-9.21	0	-9.21	11	Pass
NVNT	ax80	5290	Ant2	-9.85	0	-9.85	11	Pass
NVNT	ax80	5290	Sum	-6.51	-	-6.51	11	Pass
NVNT	ax80	5530	Ant1	-11.91	0	-11.91	11	Pass
NVNT	ax80	5530	Ant2	-12.47	0	-12.47	11	Pass
NVNT	ax80	5530	Sum	-9.17	-	-9.17	11	Pass
NVNT	ax80	5610	Ant1	-11.86	0	-11.86	11	Pass
NVNT	ax80	5610	Ant2	-12.63	0	-12.63	11	Pass
NVNT	ax80	5610	Sum	-9.22	-	-9.22	11	Pass
NVNT	ax80	5775	Ant1	-15.65	0	-15.65	30	Pass
NVNT	ax80	5775	Ant2	-14.81	0	-14.81	30	Pass
NVNT	ax80	5775	Sum	-12.2	-	-12.2	30	Pass
NVNT	ax160	5250	Ant1	-11.53	0	-11.53	11	Pass
NVNT	ax160	5250	Ant2	-12.91	0	-12.91	11	Pass
NVNT	ax160	5250	Sum	-9.16	-	-9.16	11	Pass
NVNT	ax160	5570	Ant1	-15.61	0	-15.61	11	Pass
NVNT	ax160	5570	Ant2	-16.36	0	-16.36	11	Pass
NVNT	ax160	5570	Sum	-12.96	-	-12.96	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total Conducted PSD (dBm)	ISED Limit Conducted(dBm)	Verdict
-----------	------	-----------------	---------	---------------------	------------------	---------------------------	---------------------------	---------

NVNT	a	5180	Ant1	3.6	0.04	3.64	-	-
NVNT	a	5180	Ant2	3.05	0.04	3.09	-	-
NVNT	a	5200	Ant1	3.6	0.04	3.64	-	-
NVNT	a	5200	Ant2	2.86	0.04	2.9	-	-
NVNT	a	5240	Ant1	3.64	0.04	3.68	-	-
NVNT	a	5240	Ant2	2.98	0.04	3.02	-	-
NVNT	a	5260	Ant1	2.99	0.04	3.03	11	Pass
NVNT	a	5260	Ant2	2.2	0.04	2.24	11	Pass
NVNT	a	5280	Ant1	3.2	0.04	3.24	11	Pass
NVNT	a	5280	Ant2	2.34	0.04	2.38	11	Pass
NVNT	a	5320	Ant1	3.02	0.04	3.06	11	Pass
NVNT	a	5320	Ant2	2.39	0.04	2.43	11	Pass
NVNT	a	5500	Ant1	-0.08	0.04	-0.04	11	Pass
NVNT	a	5500	Ant2	1.45	0.04	1.49	11	Pass
NVNT	a	5600	Ant1	0.68	0.04	0.72	11	Pass
NVNT	a	5600	Ant2	1.59	0.04	1.63	11	Pass
NVNT	a	5700	Ant1	0.21	0.04	0.25	11	Pass
NVNT	a	5700	Ant2	1.79	0.04	1.83	11	Pass
NVNT	a	5745	Ant1	-2.42	0.04	-2.38	30	Pass
NVNT	a	5745	Ant2	-1.65	0.04	-1.61	30	Pass
NVNT	a	5785	Ant1	-3.64	0.04	-3.6	30	Pass
NVNT	a	5785	Ant2	-1.68	0.04	-1.64	30	Pass
NVNT	a	5825	Ant1	-3.27	0.04	-3.23	30	Pass
NVNT	a	5825	Ant2	-1.97	0.04	-1.93	30	Pass
NVNT	n20	5180	Ant1	-2.96	0	-2.96	-	-
NVNT	n20	5180	Ant2	-3.8	0	-3.8	-	-
NVNT	n20	5180	Sum	-0.35	-	-0.35	-	-
NVNT	n20	5200	Ant1	-3.15	0	-3.15	-	-
NVNT	n20	5200	Ant2	-4.22	0	-4.22	-	-
NVNT	n20	5200	Sum	-0.64	-	-0.64	-	-
NVNT	n20	5240	Ant1	-3.05	0	-3.05	-	-
NVNT	n20	5240	Ant2	-4.09	0	-4.09	-	-
NVNT	n20	5240	Sum	-0.53	-	-0.53	-	-
NVNT	n20	5260	Ant1	-2.96	0	-2.96	11	Pass
NVNT	n20	5260	Ant2	-3.96	0	-3.96	11	Pass
NVNT	n20	5260	Sum	-0.42	-	-0.42	11	Pass
NVNT	n20	5280	Ant1	-2.81	0	-2.81	11	Pass
NVNT	n20	5280	Ant2	-3.94	0	-3.94	11	Pass
NVNT	n20	5280	Sum	-0.33	-	-0.33	11	Pass
NVNT	n20	5320	Ant1	-2.82	0	-2.82	11	Pass
NVNT	n20	5320	Ant2	-3.66	0	-3.66	11	Pass
NVNT	n20	5320	Sum	-0.21	-	-0.21	11	Pass
NVNT	n20	5500	Ant1	-6.2	0	-6.2	11	Pass
NVNT	n20	5500	Ant2	-7.03	0	-7.03	11	Pass

NVNT	n20	5500	Sum	-3.58	-	-3.58	11	Pass
NVNT	n20	5600	Ant1	-5.8	0	-5.8	11	Pass
NVNT	n20	5600	Ant2	-6.61	0	-6.61	11	Pass
NVNT	n20	5600	Sum	-3.18	-	-3.18	11	Pass
NVNT	n20	5700	Ant1	-6.03	0	-6.03	11	Pass
NVNT	n20	5700	Ant2	-6.25	0	-6.25	11	Pass
NVNT	n20	5700	Sum	-3.13	-	-3.13	11	Pass
NVNT	n20	5745	Ant1	-9.07	0	-9.07	30	Pass
NVNT	n20	5745	Ant2	-8.73	0	-8.73	30	Pass
NVNT	n20	5745	Sum	-5.89	-	-5.89	30	Pass
NVNT	n20	5785	Ant1	-9.76	0	-9.76	30	Pass
NVNT	n20	5785	Ant2	-8.87	0	-8.87	30	Pass
NVNT	n20	5785	Sum	-6.28	-	-6.28	30	Pass
NVNT	n20	5825	Ant1	-9.23	0	-9.23	30	Pass
NVNT	n20	5825	Ant2	-9.25	0	-9.25	30	Pass
NVNT	n20	5825	Sum	-6.23	-	-6.23	30	Pass
NVNT	n40	5190	Ant1	-6.93	0	-6.93	-	-
NVNT	n40	5190	Ant2	-8.07	0	-8.07	-	-
NVNT	n40	5190	Sum	-4.45	-	-4.45	-	-
NVNT	n40	5230	Ant1	-6.62	0	-6.62	-	-
NVNT	n40	5230	Ant2	-8.05	0	-8.05	-	-
NVNT	n40	5230	Sum	-4.27	-	-4.27	-	-
NVNT	n40	5270	Ant1	-6.55	0	-6.55	11	Pass
NVNT	n40	5270	Ant2	-8.07	0	-8.07	11	Pass
NVNT	n40	5270	Sum	-4.23	-	-4.23	11	Pass
NVNT	n40	5310	Ant1	-6.59	0	-6.59	11	Pass
NVNT	n40	5310	Ant2	-7.73	0	-7.73	11	Pass
NVNT	n40	5310	Sum	-4.11	-	-4.11	11	Pass
NVNT	n40	5510	Ant1	-10.21	0	-10.21	11	Pass
NVNT	n40	5510	Ant2	-10.51	0	-10.51	11	Pass
NVNT	n40	5510	Sum	-7.35	-	-7.35	11	Pass
NVNT	n40	5590	Ant1	-9.65	0	-9.65	11	Pass
NVNT	n40	5590	Ant2	-10.3	0	-10.3	11	Pass
NVNT	n40	5590	Sum	-6.95	-	-6.95	11	Pass
NVNT	n40	5670	Ant1	-9.45	0	-9.45	11	Pass
NVNT	n40	5670	Ant2	-10.23	0	-10.23	11	Pass
NVNT	n40	5670	Sum	-6.81	-	-6.81	11	Pass
NVNT	n40	5755	Ant1	-12.22	0	-12.22	30	Pass
NVNT	n40	5755	Ant2	-11.69	0	-11.69	30	Pass
NVNT	n40	5755	Sum	-8.94	-	-8.94	30	Pass
NVNT	n40	5795	Ant1	-12.51	0	-12.51	30	Pass
NVNT	n40	5795	Ant2	-11.65	0	-11.65	30	Pass
NVNT	n40	5795	Sum	-9.05	-	-9.05	30	Pass
NVNT	ac20	5180	Ant1	-3.17	0	-3.17	-	-

NVNT	ac20	5180	Ant2	-3.93	0	-3.93	-	-
NVNT	ac20	5180	Sum	-0.52	-	-0.52	-	-
NVNT	ac20	5200	Ant1	-2.88	0	-2.88	-	-
NVNT	ac20	5200	Ant2	-4.36	0	-4.36	-	-
NVNT	ac20	5200	Sum	-0.55	-	-0.55	-	-
NVNT	ac20	5240	Ant1	-2.93	0	-2.93	-	-
NVNT	ac20	5240	Ant2	-4.15	0	-4.15	-	-
NVNT	ac20	5240	Sum	-0.49	-	-0.49	-	-
NVNT	ac20	5260	Ant1	-2.8	0	-2.8	11	Pass
NVNT	ac20	5260	Ant2	-3.95	0	-3.95	11	Pass
NVNT	ac20	5260	Sum	-0.33	-	-0.33	11	Pass
NVNT	ac20	5280	Ant1	-2.68	0	-2.68	11	Pass
NVNT	ac20	5280	Ant2	-4.13	0	-4.13	11	Pass
NVNT	ac20	5280	Sum	-0.33	-	-0.33	11	Pass
NVNT	ac20	5320	Ant1	-2.85	0	-2.85	11	Pass
NVNT	ac20	5320	Ant2	-3.92	0	-3.92	11	Pass
NVNT	ac20	5320	Sum	-0.34	-	-0.34	11	Pass
NVNT	ac20	5500	Ant1	-6.12	0	-6.12	11	Pass
NVNT	ac20	5500	Ant2	-6.93	0	-6.93	11	Pass
NVNT	ac20	5500	Sum	-3.5	-	-3.5	11	Pass
NVNT	ac20	5600	Ant1	-5.86	0	-5.86	11	Pass
NVNT	ac20	5600	Ant2	-6.53	0	-6.53	11	Pass
NVNT	ac20	5600	Sum	-3.17	-	-3.17	11	Pass
NVNT	ac20	5700	Ant1	-6.14	0	-6.14	11	Pass
NVNT	ac20	5700	Ant2	-6.3	0	-6.3	11	Pass
NVNT	ac20	5700	Sum	-3.21	-	-3.21	11	Pass
NVNT	ac20	5745	Ant1	-9.02	0	-9.02	30	Pass
NVNT	ac20	5745	Ant2	-8.75	0	-8.75	30	Pass
NVNT	ac20	5745	Sum	-5.87	-	-5.87	30	Pass
NVNT	ac20	5785	Ant1	-10.05	0	-10.05	30	Pass
NVNT	ac20	5785	Ant2	-8.95	0	-8.95	30	Pass
NVNT	ac20	5785	Sum	-6.45	-	-6.45	30	Pass
NVNT	ac20	5825	Ant1	-9.46	0	-9.46	30	Pass
NVNT	ac20	5825	Ant2	-9.14	0	-9.14	30	Pass
NVNT	ac20	5825	Sum	-6.29	-	-6.29	30	Pass
NVNT	ac40	5190	Ant1	-7.03	0	-7.03	-	-
NVNT	ac40	5190	Ant2	-8.13	0	-8.13	-	-
NVNT	ac40	5190	Sum	-4.53	-	-4.53	-	-
NVNT	ac40	5230	Ant1	-6.7	0	-6.7	-	-
NVNT	ac40	5230	Ant2	-7.97	0	-7.97	-	-
NVNT	ac40	5230	Sum	-4.28	-	-4.28	-	-
NVNT	ac40	5270	Ant1	-6.61	0	-6.61	11	Pass
NVNT	ac40	5270	Ant2	-7.94	0	-7.94	11	Pass
NVNT	ac40	5270	Sum	-4.21	-	-4.21	11	Pass

NVNT	ac40	5310	Ant1	-6.7	0	-6.7	11	Pass
NVNT	ac40	5310	Ant2	-7.68	0	-7.68	11	Pass
NVNT	ac40	5310	Sum	-4.15	-	-4.15	11	Pass
NVNT	ac40	5510	Ant1	-10.08	0	-10.08	11	Pass
NVNT	ac40	5510	Ant2	-10.65	0	-10.65	11	Pass
NVNT	ac40	5510	Sum	-7.35	-	-7.35	11	Pass
NVNT	ac40	5590	Ant1	-9.86	0	-9.86	11	Pass
NVNT	ac40	5590	Ant2	-10.29	0	-10.29	11	Pass
NVNT	ac40	5590	Sum	-7.06	-	-7.06	11	Pass
NVNT	ac40	5670	Ant1	-9.6	0	-9.6	11	Pass
NVNT	ac40	5670	Ant2	-10.03	0	-10.03	11	Pass
NVNT	ac40	5670	Sum	-6.8	-	-6.8	11	Pass
NVNT	ac40	5755	Ant1	-12.3	0	-12.3	30	Pass
NVNT	ac40	5755	Ant2	-11.51	0	-11.51	30	Pass
NVNT	ac40	5755	Sum	-8.88	-	-8.88	30	Pass
NVNT	ac40	5795	Ant1	-12.4	0	-12.4	30	Pass
NVNT	ac40	5795	Ant2	-11.52	0	-11.52	30	Pass
NVNT	ac40	5795	Sum	-8.93	-	-8.93	30	Pass
NVNT	ac80	5210	Ant1	-9.22	0	-9.22	-	-
NVNT	ac80	5210	Ant2	-9.87	0	-9.87	-	-
NVNT	ac80	5210	Sum	-6.52	-	-6.52	-	-
NVNT	ac80	5290	Ant1	-8.99	0	-8.99	11	Pass
NVNT	ac80	5290	Ant2	-10.13	0	-10.13	11	Pass
NVNT	ac80	5290	Sum	-6.51	-	-6.51	11	Pass
NVNT	ac80	5530	Ant1	-11.96	0	-11.96	11	Pass
NVNT	ac80	5530	Ant2	-12.67	0	-12.67	11	Pass
NVNT	ac80	5530	Sum	-9.29	-	-9.29	11	Pass
NVNT	ac80	5610	Ant1	-11.93	0	-11.93	11	Pass
NVNT	ac80	5610	Ant2	-12.42	0	-12.42	11	Pass
NVNT	ac80	5610	Sum	-9.16	-	-9.16	11	Pass
NVNT	ac80	5775	Ant1	-15.54	0	-15.54	30	Pass
NVNT	ac80	5775	Ant2	-14.81	0	-14.81	30	Pass
NVNT	ac80	5775	Sum	-12.15	-	-12.15	30	Pass
NVNT	ac160	5250	Ant1	-11.5	0	-11.5	11	Pass
NVNT	ac160	5250	Ant2	-12.75	0	-12.75	11	Pass
NVNT	ac160	5250	Sum	-9.07	-	-9.07	11	Pass
NVNT	ac160	5570	Ant1	-15.46	0	-15.46	11	Pass
NVNT	ac160	5570	Ant2	-16.14	0	-16.14	11	Pass
NVNT	ac160	5570	Sum	-12.78	-	-12.78	11	Pass
NVNT	ax20	5180	Ant1	-2.41	0	-2.41	-	-
NVNT	ax20	5180	Ant2	-3.15	0	-3.15	-	-
NVNT	ax20	5180	Sum	0.25	-	0.25	-	-
NVNT	ax20	5200	Ant1	-2.55	0	-2.55	-	-
NVNT	ax20	5200	Ant2	-3.56	0	-3.56	-	-


NVNT	ax20	5200	Sum	-0.02	-	-0.02	-	-
NVNT	ax20	5240	Ant1	-1.79	0	-1.79	-	-
NVNT	ax20	5240	Ant2	-3.22	0	-3.22	-	-
NVNT	ax20	5240	Sum	0.56	-	0.56	-	-
NVNT	ax20	5260	Ant1	-2.24	0	-2.24	11	Pass
NVNT	ax20	5260	Ant2	-3.29	0	-3.29	11	Pass
NVNT	ax20	5260	Sum	0.28	-	0.28	11	Pass
NVNT	ax20	5280	Ant1	-2.15	0	-2.15	11	Pass
NVNT	ax20	5280	Ant2	-3.32	0	-3.32	11	Pass
NVNT	ax20	5280	Sum	0.31	-	0.31	11	Pass
NVNT	ax20	5320	Ant1	-2.26	0	-2.26	11	Pass
NVNT	ax20	5320	Ant2	-2.95	0	-2.95	11	Pass
NVNT	ax20	5320	Sum	0.42	-	0.42	11	Pass
NVNT	ax20	5500	Ant1	-5.61	0	-5.61	11	Pass
NVNT	ax20	5500	Ant2	-6.3	0	-6.3	11	Pass
NVNT	ax20	5500	Sum	-2.93	-	-2.93	11	Pass
NVNT	ax20	5600	Ant1	-4.91	0	-4.91	11	Pass
NVNT	ax20	5600	Ant2	-6.07	0	-6.07	11	Pass
NVNT	ax20	5600	Sum	-2.44	-	-2.44	11	Pass
NVNT	ax20	5700	Ant1	-5.56	0	-5.56	11	Pass
NVNT	ax20	5700	Ant2	-5.08	0	-5.08	11	Pass
NVNT	ax20	5700	Sum	-2.3	-	-2.3	11	Pass
NVNT	ax20	5745	Ant1	-8.36	0	-8.36	30	Pass
NVNT	ax20	5745	Ant2	-8.48	0	-8.48	30	Pass
NVNT	ax20	5745	Sum	-5.41	-	-5.41	30	Pass
NVNT	ax20	5785	Ant1	-9.39	0	-9.39	30	Pass
NVNT	ax20	5785	Ant2	-8.36	0	-8.36	30	Pass
NVNT	ax20	5785	Sum	-5.83	-	-5.83	30	Pass
NVNT	ax20	5825	Ant1	-8.42	0	-8.42	30	Pass
NVNT	ax20	5825	Ant2	-8.14	0	-8.14	30	Pass
NVNT	ax20	5825	Sum	-5.27	-	-5.27	30	Pass
NVNT	ax40	5190	Ant1	-7.21	0	-7.21	-	-
NVNT	ax40	5190	Ant2	-8.36	0	-8.36	-	-
NVNT	ax40	5190	Sum	-4.74	-	-4.74	-	-
NVNT	ax40	5230	Ant1	-6.92	0	-6.92	-	-
NVNT	ax40	5230	Ant2	-8.19	0	-8.19	-	-
NVNT	ax40	5230	Sum	-4.5	-	-4.5	-	-
NVNT	ax40	5270	Ant1	-6.96	0	-6.96	11	Pass
NVNT	ax40	5270	Ant2	-8.11	0	-8.11	11	Pass
NVNT	ax40	5270	Sum	-4.49	-	-4.49	11	Pass
NVNT	ax40	5310	Ant1	-6.95	0	-6.95	11	Pass
NVNT	ax40	5310	Ant2	-8.02	0	-8.02	11	Pass
NVNT	ax40	5310	Sum	-4.44	-	-4.44	11	Pass
NVNT	ax40	5510	Ant1	-10.21	0	-10.21	11	Pass

NVNT	ax40	5510	Ant2	-10.88	0	-10.88	11	Pass
NVNT	ax40	5510	Sum	-7.52	-	-7.52	11	Pass
NVNT	ax40	5590	Ant1	-10.05	0	-10.05	11	Pass
NVNT	ax40	5590	Ant2	-10.79	0	-10.79	11	Pass
NVNT	ax40	5590	Sum	-7.39	-	-7.39	11	Pass
NVNT	ax40	5670	Ant1	-9.7	0	-9.7	11	Pass
NVNT	ax40	5670	Ant2	-10.51	0	-10.51	11	Pass
NVNT	ax40	5670	Sum	-7.08	-	-7.08	11	Pass
NVNT	ax40	5755	Ant1	-12.62	0	-12.62	30	Pass
NVNT	ax40	5755	Ant2	-12.03	0	-12.03	30	Pass
NVNT	ax40	5755	Sum	-9.3	-	-9.3	30	Pass
NVNT	ax40	5795	Ant1	-13.02	0	-13.02	30	Pass
NVNT	ax40	5795	Ant2	-11.73	0	-11.73	30	Pass
NVNT	ax40	5795	Sum	-9.32	-	-9.32	30	Pass
NVNT	ax80	5210	Ant1	-9.16	0	-9.16	-	-
NVNT	ax80	5210	Ant2	-9.6	0	-9.6	-	-
NVNT	ax80	5210	Sum	-6.36	-	-6.36	-	-
NVNT	ax80	5290	Ant1	-9.21	0	-9.21	11	Pass
NVNT	ax80	5290	Ant2	-9.85	0	-9.85	11	Pass
NVNT	ax80	5290	Sum	-6.51	-	-6.51	11	Pass
NVNT	ax80	5530	Ant1	-11.91	0	-11.91	11	Pass
NVNT	ax80	5530	Ant2	-12.47	0	-12.47	11	Pass
NVNT	ax80	5530	Sum	-9.17	-	-9.17	11	Pass
NVNT	ax80	5610	Ant1	-11.86	0	-11.86	11	Pass
NVNT	ax80	5610	Ant2	-12.63	0	-12.63	11	Pass
NVNT	ax80	5610	Sum	-9.22	-	-9.22	11	Pass
NVNT	ax80	5775	Ant1	-15.65	0	-15.65	30	Pass
NVNT	ax80	5775	Ant2	-14.81	0	-14.81	30	Pass
NVNT	ax80	5775	Sum	-12.2	-	-12.2	30	Pass
NVNT	ax160	5250	Ant1	-11.53	0	-11.53	11	Pass
NVNT	ax160	5250	Ant2	-12.91	0	-12.91	11	Pass
NVNT	ax160	5250	Sum	-9.16	-	-9.16	11	Pass
NVNT	ax160	5570	Ant1	-15.61	0	-15.61	11	Pass
NVNT	ax160	5570	Ant2	-16.36	0	-16.36	11	Pass
NVNT	ax160	5570	Sum	-12.96	-	-12.96	11	Pass

Condition	Mode	Frequency (MHz)	Antenna	Total Conducted PSD (dBm)	Antenna Gain (dBi)	E.i.r.p PSD (dBm)	ISED Limit (dBm)	Verdict
NVNT	a	5180	Ant1	3.64	2.92	6.56	10	Pass
NVNT	a	5180	Ant2	3.09	2.92	6.01	10	Pass
NVNT	a	5200	Ant1	3.64	2.92	6.56	10	Pass
NVNT	a	5200	Ant2	2.9	2.92	5.82	10	Pass
NVNT	a	5240	Ant1	3.68	2.92	6.6	10	Pass
NVNT	a	5240	Ant2	3.02	2.92	5.94	10	Pass


NVNT	n20	5180	Ant1	-2.96	2.92	-0.04	10	Pass
NVNT	n20	5180	Ant2	-3.8	2.92	-0.88	10	Pass
NVNT	n20	5180	Sum	-0.35	2.92	2.57	10	Pass
NVNT	n20	5200	Ant1	-3.15	2.92	-0.23	10	Pass
NVNT	n20	5200	Ant2	-4.22	2.92	-1.3	10	Pass
NVNT	n20	5200	Sum	-0.64	2.92	2.28	10	Pass
NVNT	n20	5240	Ant1	-3.05	2.92	-0.13	10	Pass
NVNT	n20	5240	Ant2	-4.09	2.92	-1.17	10	Pass
NVNT	n20	5240	Sum	-0.53	2.92	2.39	10	Pass
NVNT	n40	5190	Ant1	-6.93	2.92	-4.01	10	Pass
NVNT	n40	5190	Ant2	-8.07	2.92	-5.15	10	Pass
NVNT	n40	5190	Sum	-4.45	2.92	-1.53	10	Pass
NVNT	n40	5230	Ant1	-6.62	2.92	-3.7	10	Pass
NVNT	n40	5230	Ant2	-8.05	2.92	-5.13	10	Pass
NVNT	n40	5230	Sum	-4.27	2.92	-1.35	10	Pass
NVNT	ac20	5180	Ant1	-3.17	2.92	-0.25	10	Pass
NVNT	ac20	5180	Ant2	-3.93	2.92	-1.01	10	Pass
NVNT	ac20	5180	Sum	-0.52	2.92	2.4	10	Pass
NVNT	ac20	5200	Ant1	-2.88	2.92	0.04	10	Pass
NVNT	ac20	5200	Ant2	-4.36	2.92	-1.44	10	Pass
NVNT	ac20	5200	Sum	-0.55	2.92	2.37	10	Pass
NVNT	ac20	5240	Ant1	-2.93	2.92	-0.01	10	Pass
NVNT	ac20	5240	Ant2	-4.15	2.92	-1.23	10	Pass
NVNT	ac20	5240	Sum	-0.49	2.92	2.43	10	Pass
NVNT	ac40	5190	Ant1	-7.03	2.92	-4.11	10	Pass
NVNT	ac40	5190	Ant2	-8.13	2.92	-5.21	10	Pass
NVNT	ac40	5190	Sum	-4.53	2.92	-1.61	10	Pass
NVNT	ac40	5230	Ant1	-6.7	2.92	-3.78	10	Pass
NVNT	ac40	5230	Ant2	-7.97	2.92	-5.05	10	Pass
NVNT	ac40	5230	Sum	-4.28	2.92	-1.36	10	Pass
NVNT	ac80	5210	Ant1	-9.22	2.92	-6.3	10	Pass
NVNT	ac80	5210	Ant2	-9.87	2.92	-6.95	10	Pass
NVNT	ac80	5210	Sum	-6.52	2.92	-3.6	10	Pass
NVNT	ac160	5250	Ant1	-11.5	2.92	-8.58	10	Pass
NVNT	ac160	5250	Ant2	-12.75	2.92	-9.83	10	Pass
NVNT	ac160	5250	Sum	-9.07	2.92	-6.15	10	Pass
NVNT	ax20	5180	Ant1	-2.41	2.92	0.51	10	Pass
NVNT	ax20	5180	Ant2	-3.15	2.92	-0.23	10	Pass
NVNT	ax20	5180	Sum	0.25	2.92	3.17	10	Pass
NVNT	ax20	5200	Ant1	-2.55	2.92	0.37	10	Pass
NVNT	ax20	5200	Ant2	-3.56	2.92	-0.64	10	Pass
NVNT	ax20	5200	Sum	-0.02	2.92	2.9	10	Pass
NVNT	ax20	5240	Ant1	-1.79	2.92	1.13	10	Pass
NVNT	ax20	5240	Ant2	-3.22	2.92	-0.3	10	Pass

NVNT	ax20	5240	Sum	0.56	2.92	3.48	10	Pass
NVNT	ax40	5190	Ant1	-7.21	2.92	-4.29	10	Pass
NVNT	ax40	5190	Ant2	-8.36	2.92	-5.44	10	Pass
NVNT	ax40	5190	Sum	-4.74	2.92	-1.82	10	Pass
NVNT	ax40	5230	Ant1	-6.92	2.92	-4	10	Pass
NVNT	ax40	5230	Ant2	-8.19	2.92	-5.27	10	Pass
NVNT	ax40	5230	Sum	-4.5	2.92	-1.58	10	Pass
NVNT	ax80	5210	Ant1	-9.16	2.92	-6.24	10	Pass
NVNT	ax80	5210	Ant2	-9.6	2.92	-6.68	10	Pass
NVNT	ax80	5210	Sum	-6.36	2.92	-3.44	10	Pass
NVNT	ax160	5250	Ant1	-11.53	2.92	-8.61	10	Pass
NVNT	ax160	5250	Ant2	-12.91	2.92	-9.99	10	Pass
NVNT	ax160	5250	Sum	-9.16	2.92	-6.24	10	Pass

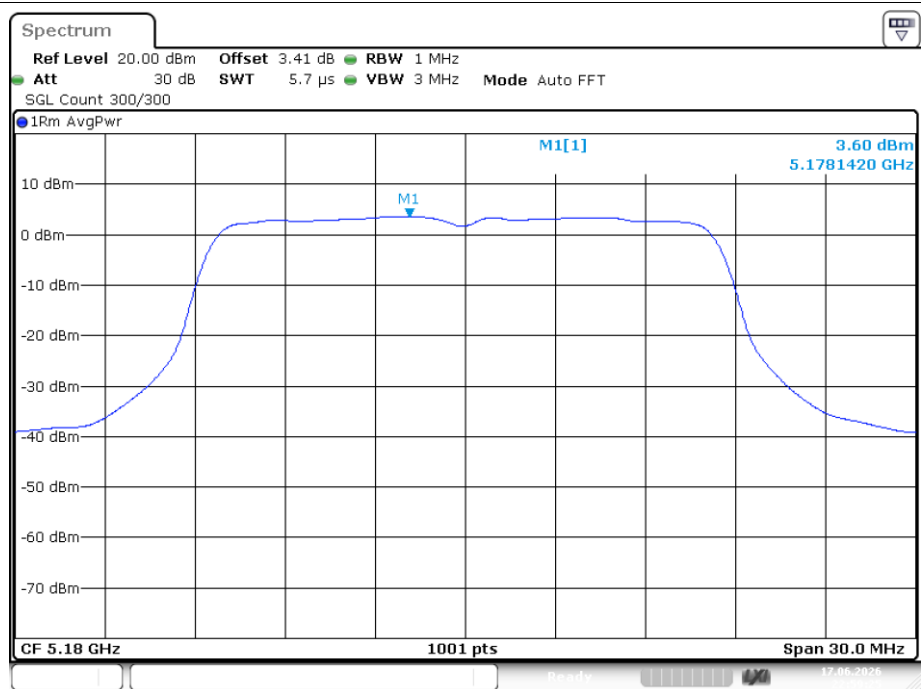


Date: 17.JUN.2026 22:59:25

PSD NVNT a 5180MHz Ant1

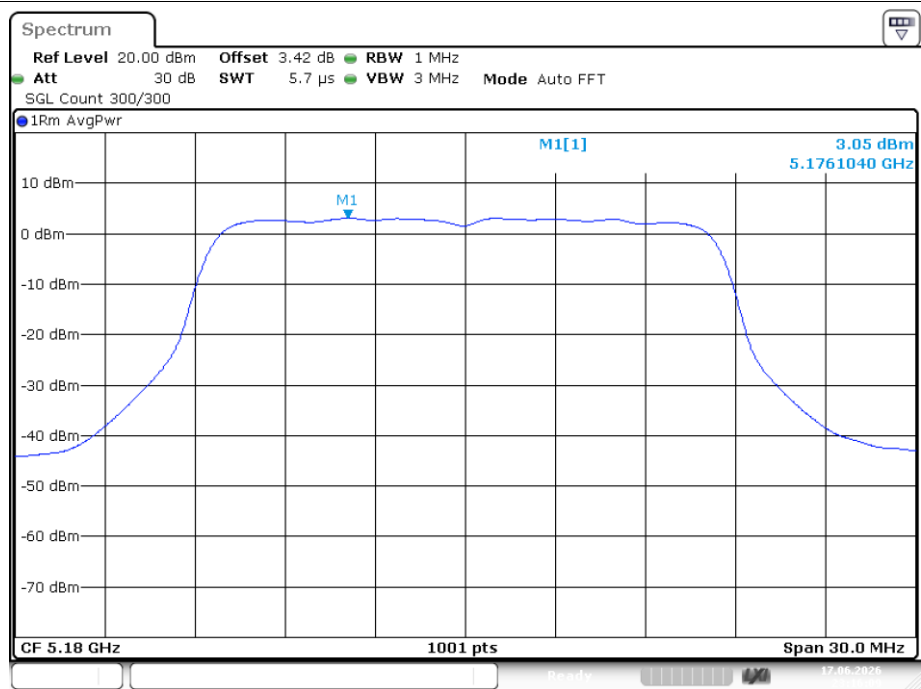


Date: 17.JUN.2026 23:16:09

PSD NVNT a 5180MHz Ant2

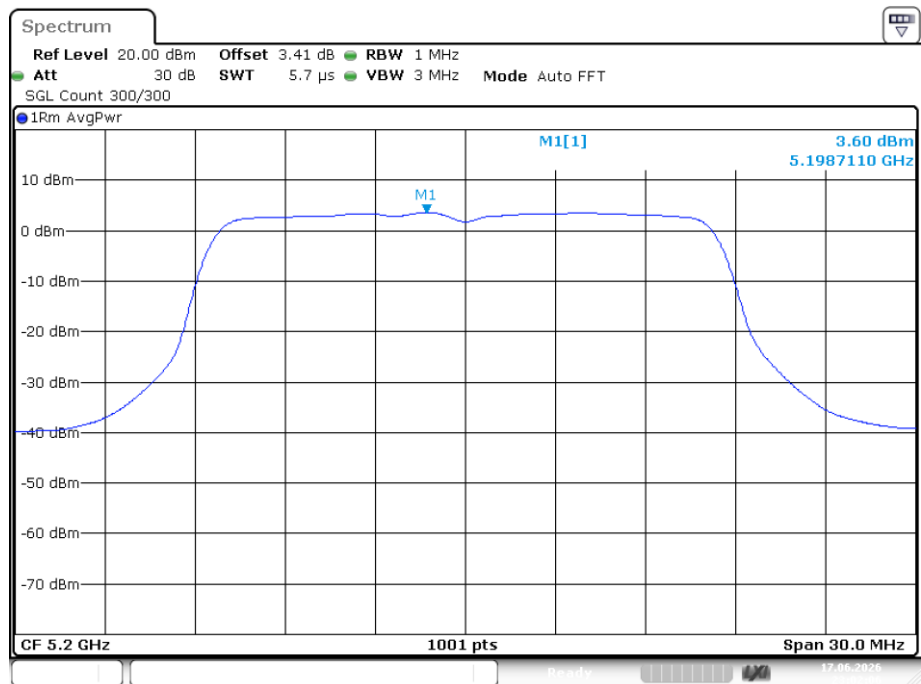


Date: 17.JUN.2026 23:02:06

PSD NVNT a 5200MHz Ant1

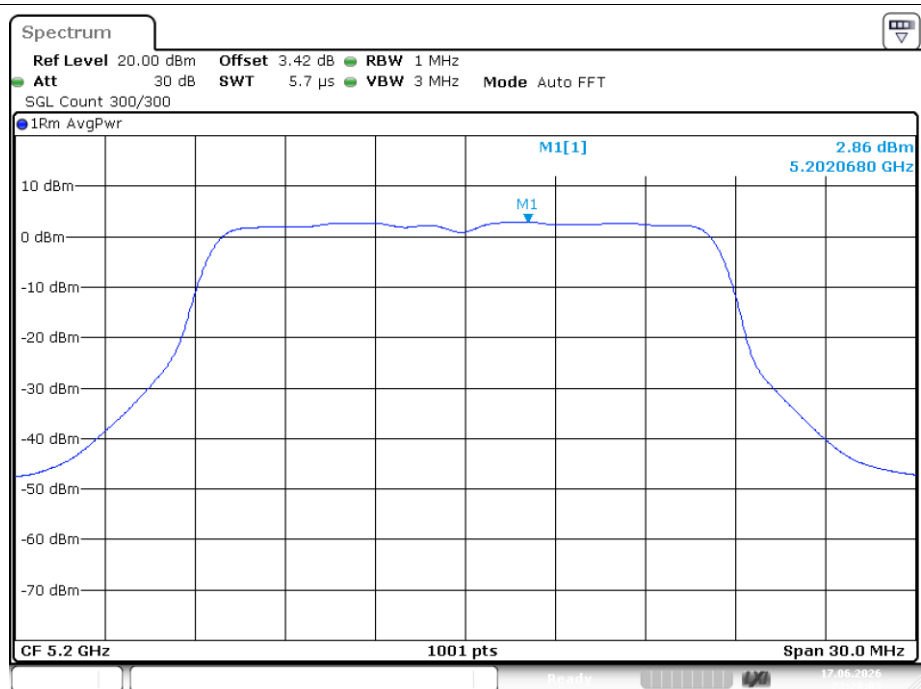


Date: 17.JUN.2026 23:28:04

PSD NVNT a 5200MHz Ant2

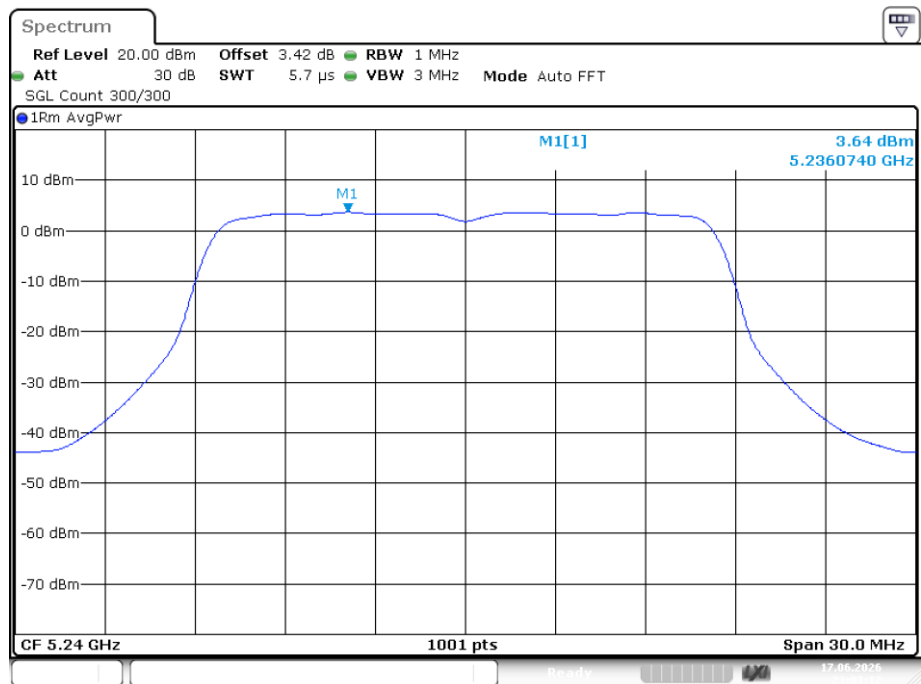


Date: 17.JUN.2026 23:03:11

PSD NVNT a 5240MHz Ant1

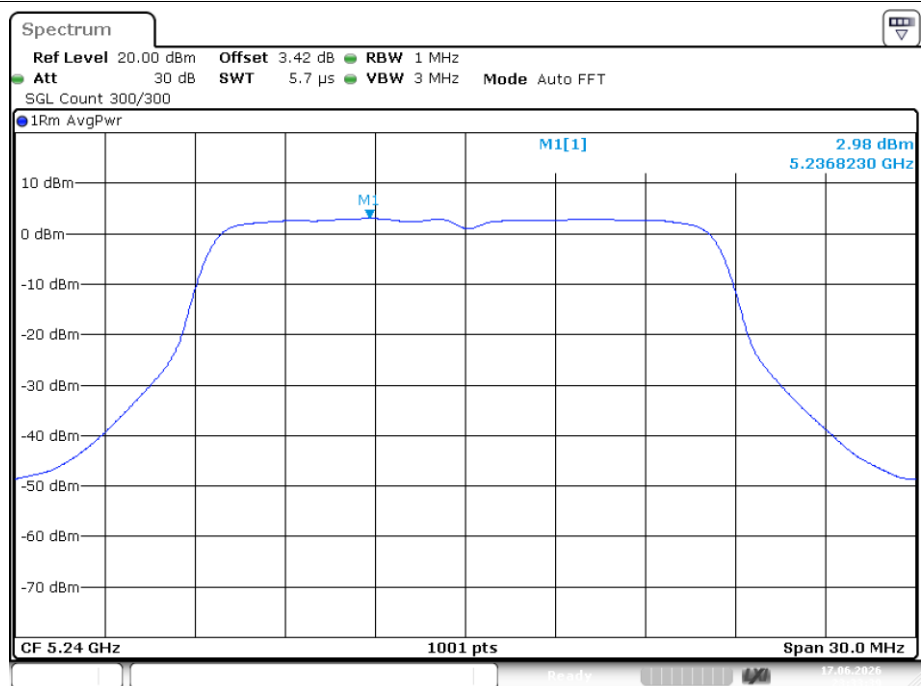


Date: 17.JUN.2026 23:33:39

PSD NVNT a 5240MHz Ant2

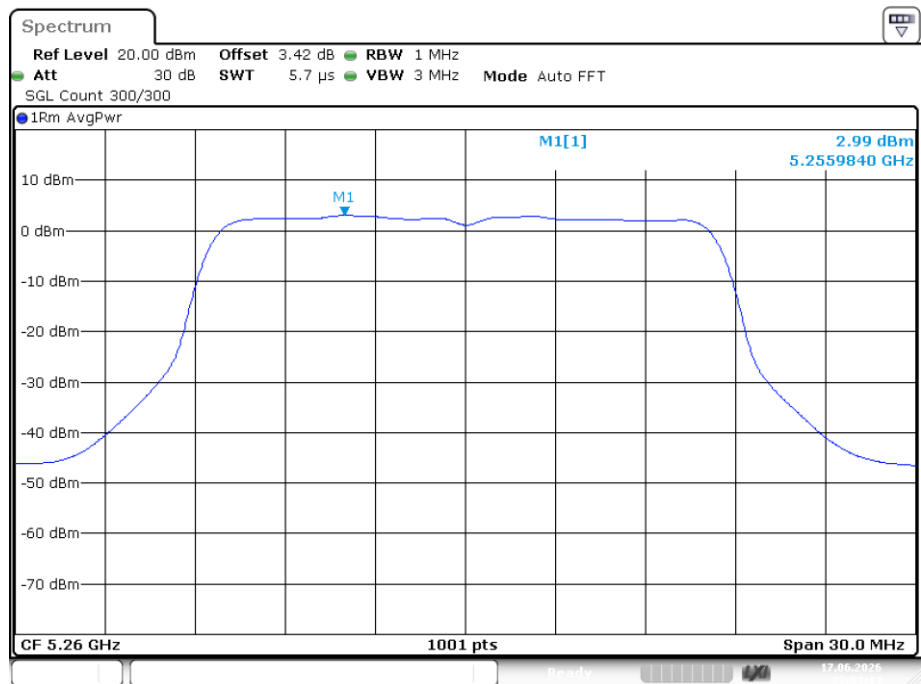


Date: 17.JUN.2026 23:04:14

PSD NVNT a 5260MHz Ant1

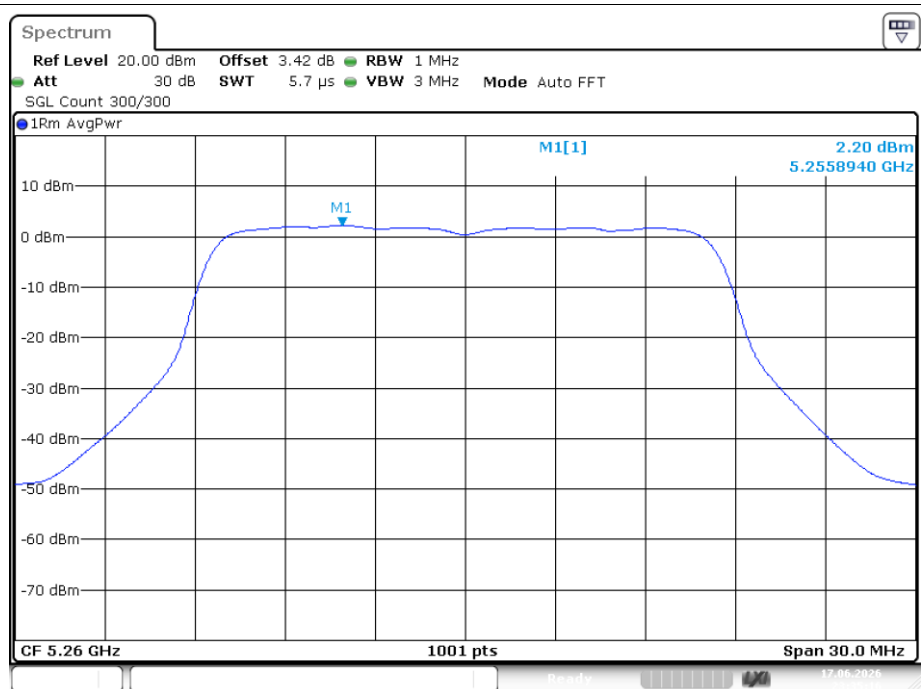


Date: 17.JUN.2026 23:35:17

PSD NVNT a 5260MHz Ant2

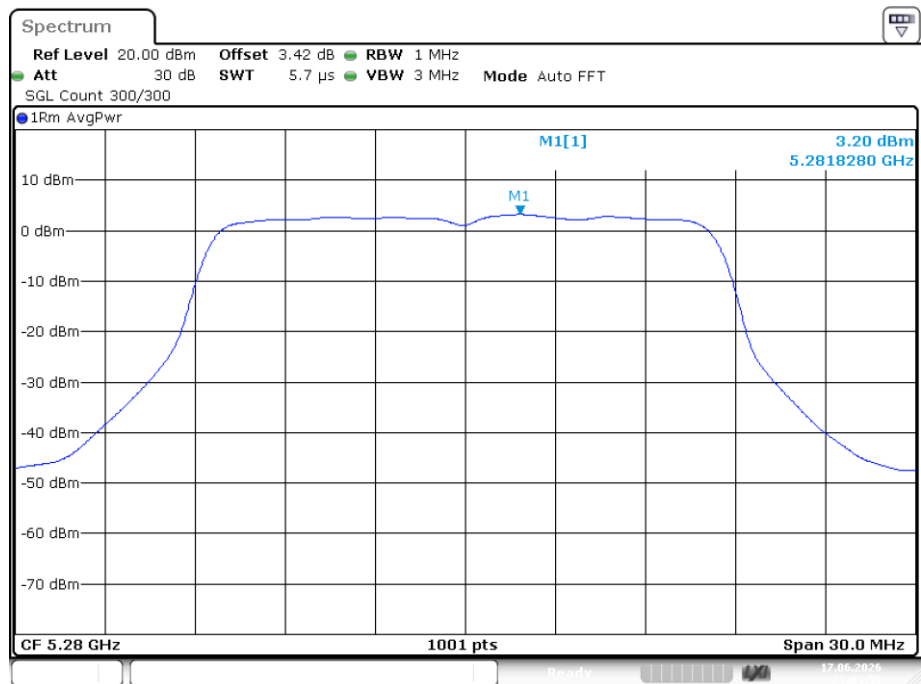


Date: 17.JUN.2026 23:04:58

PSD NVNT a 5280MHz Ant1

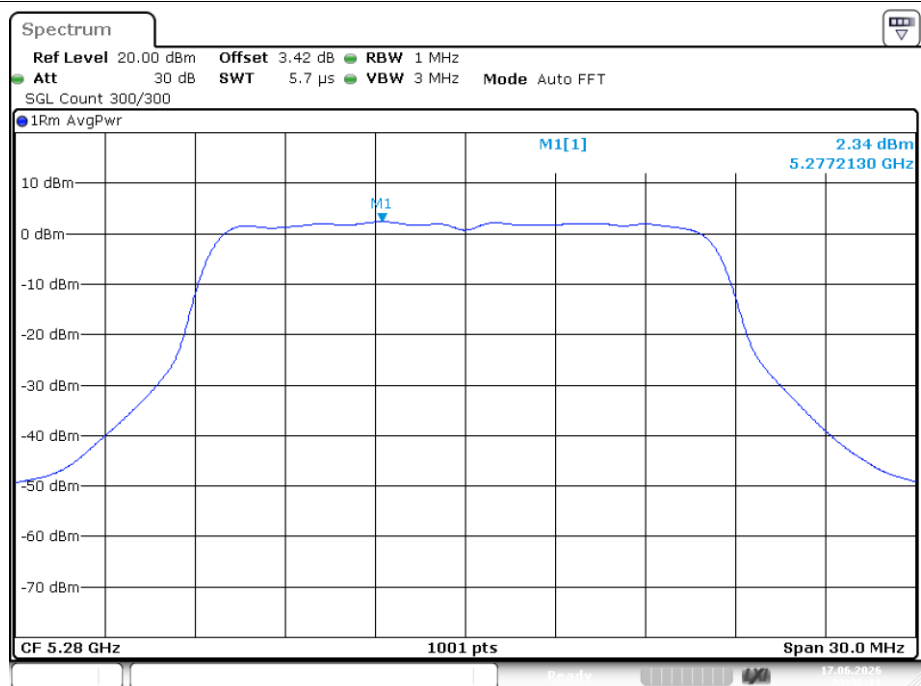


Date: 17.JUN.2026 23:36:10

PSD NVNT a 5280MHz Ant2

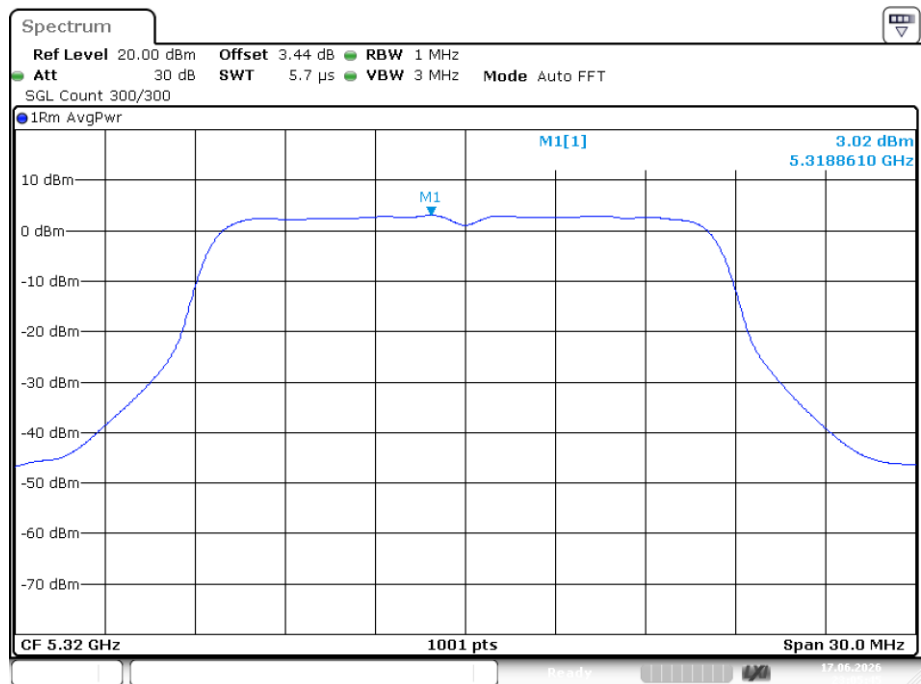


Date: 17.JUN.2026 23:05:46

PSD NVNT a 5320MHz Ant1

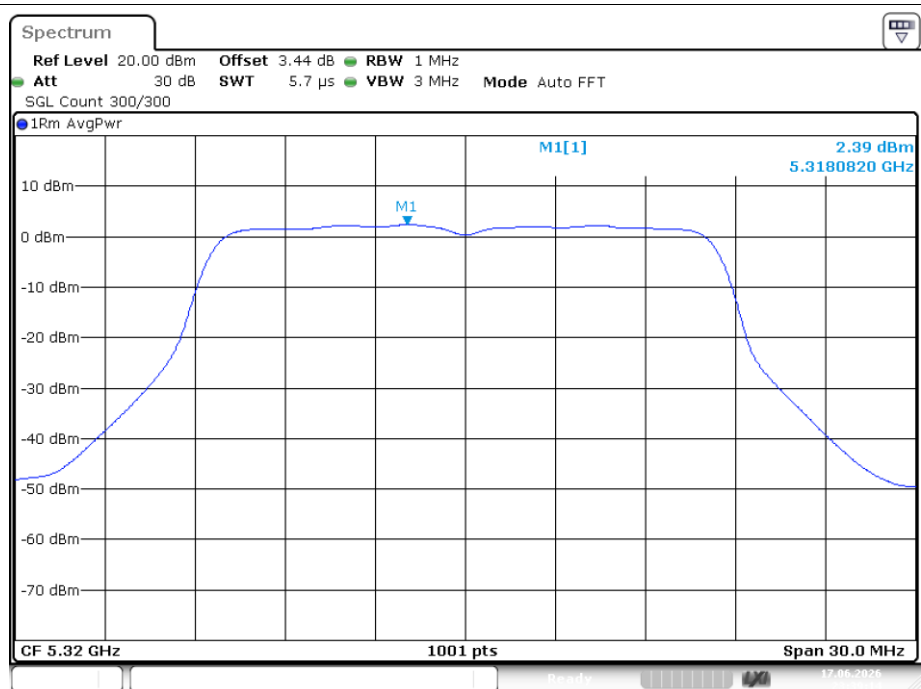


Date: 17.JUN.2026 23:39:14

PSD NVNT a 5320MHz Ant2

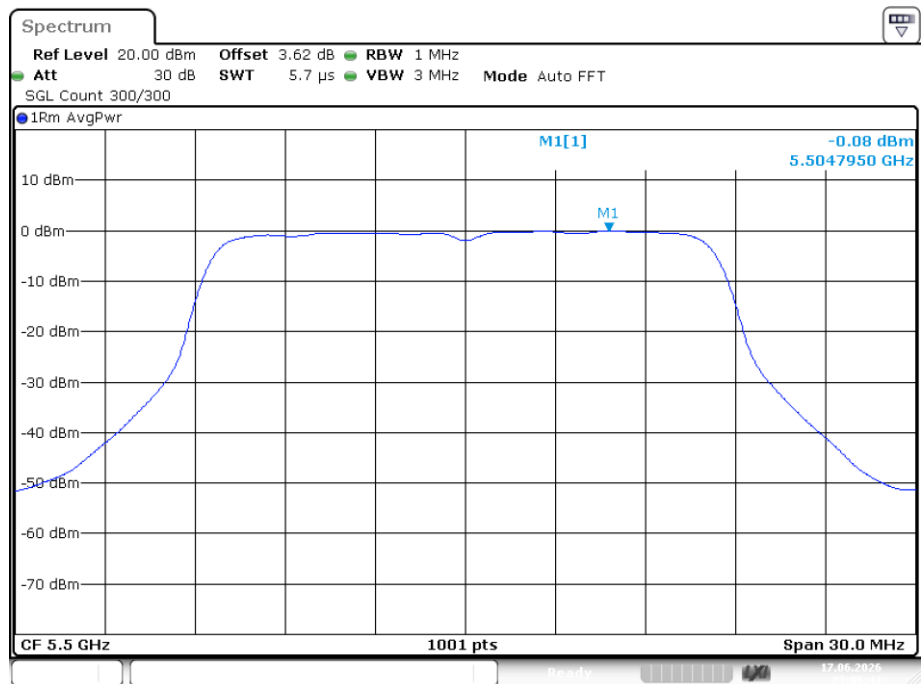


Date: 17.JUN.2026 23:06:43

PSD NVNT a 5500MHz Ant1

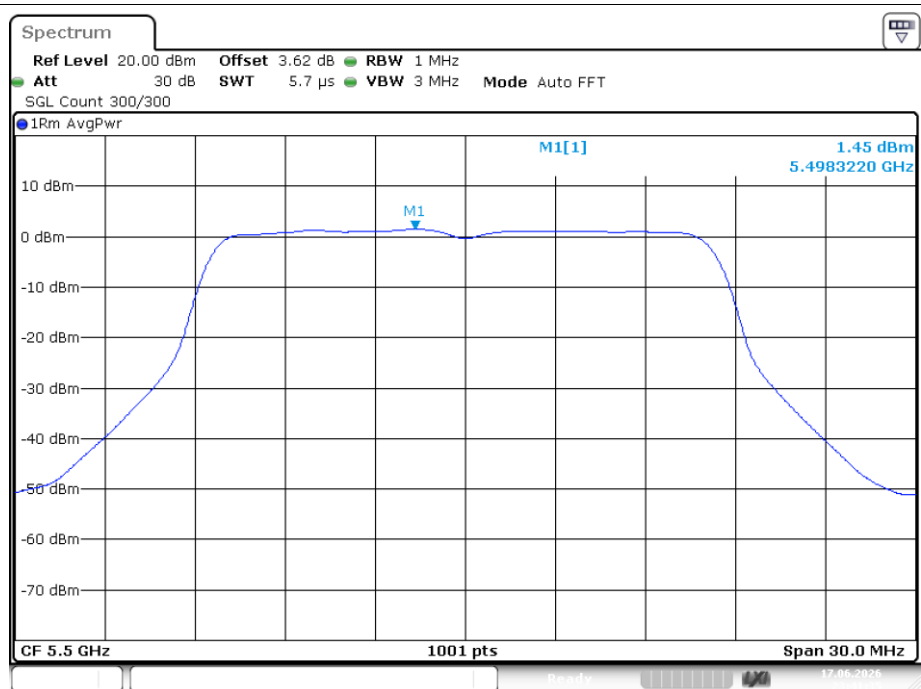


Date: 17.JUN.2026 23:41:35

PSD NVNT a 5500MHz Ant2

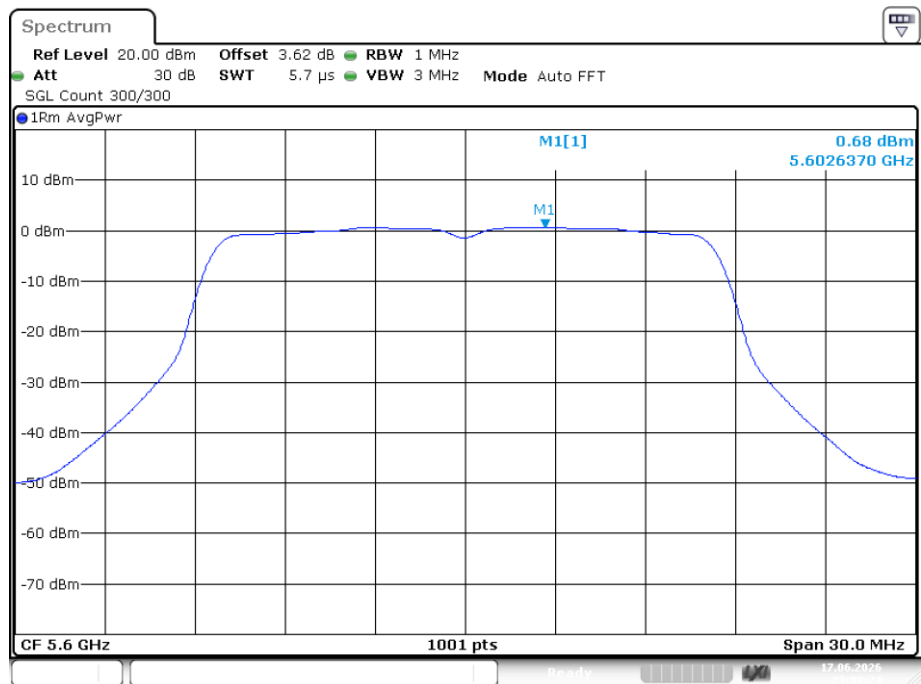


Date: 17.JUN.2026 23:09:24

PSD NVNT a 5600MHz Ant1

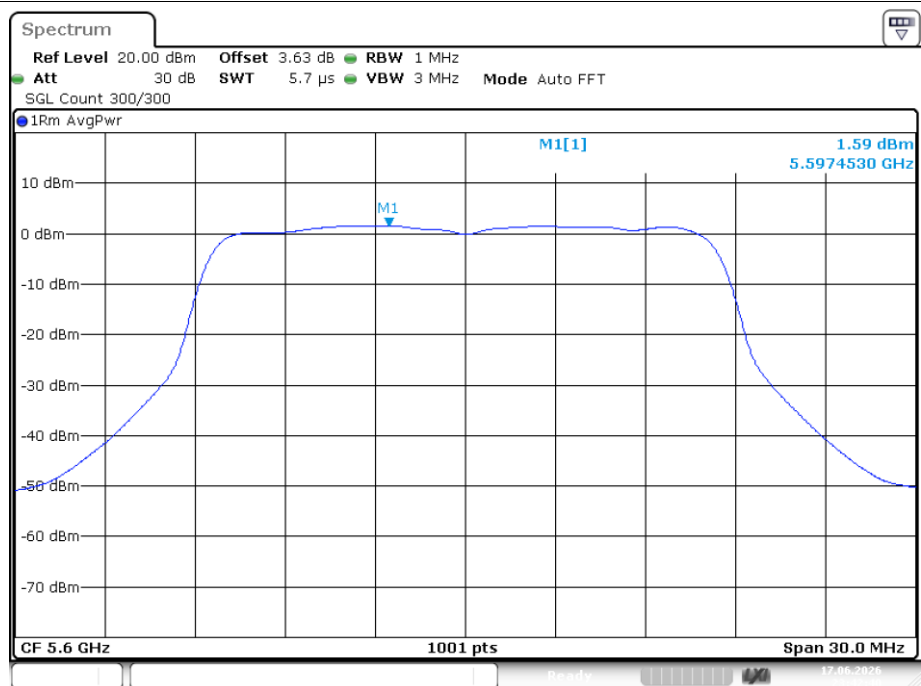


Date: 17.JUN.2026 23:42:40

PSD NVNT a 5600MHz Ant2

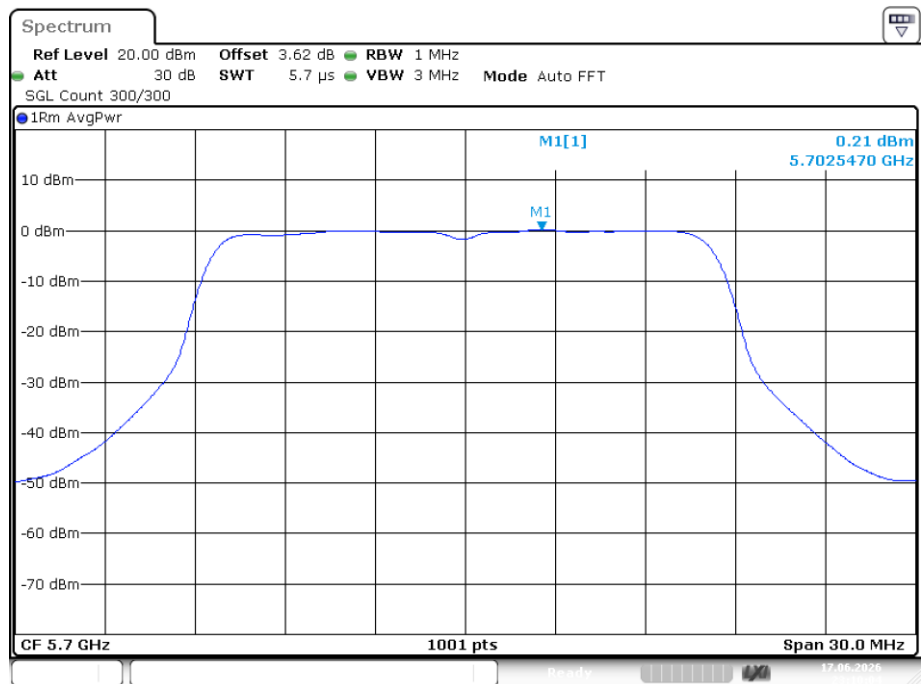


Date: 17.JUN.2026 23:10:04

PSD NVNT a 5700MHz Ant1

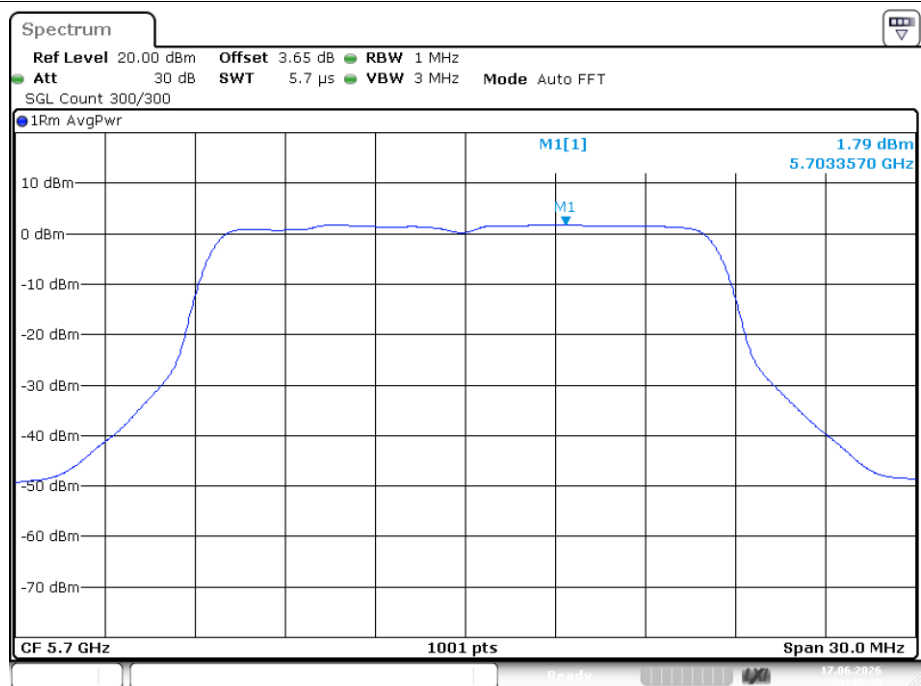


Date: 17.JUN.2026 23:43:29

PSD NVNT a 5700MHz Ant2

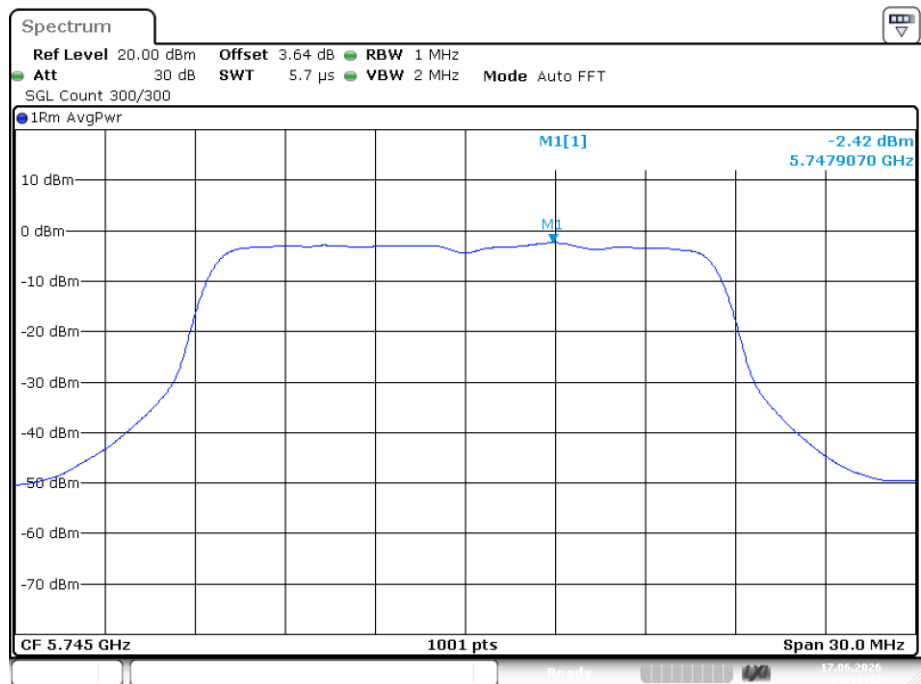


Date: 17.JUN.2026 23:11:17

PSD NVNT a 5745MHz Ant1

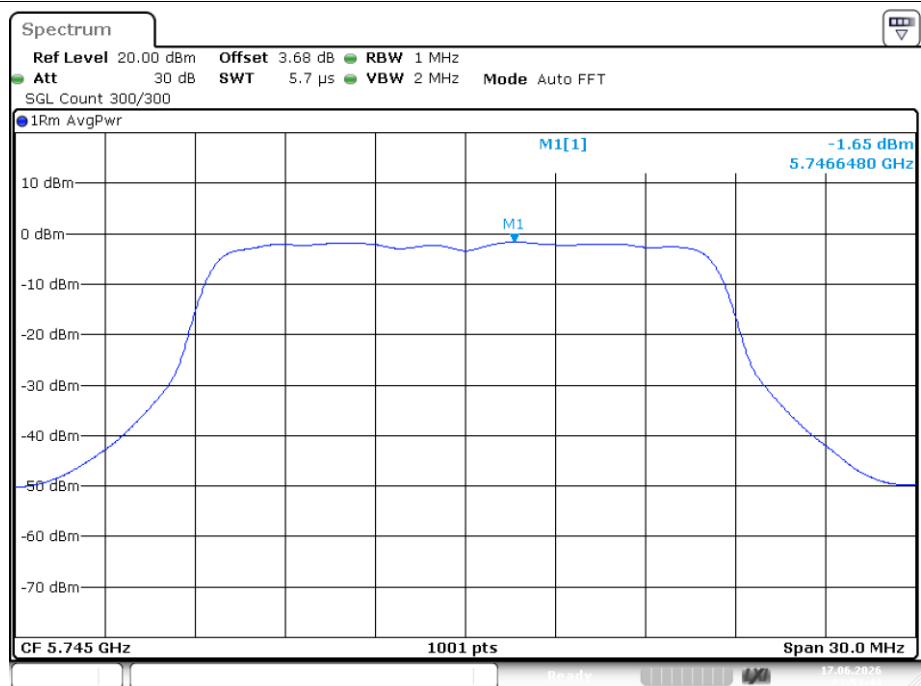


Date: 17.JUN.2026 23:53:44

PSD NVNT a 5745MHz Ant2

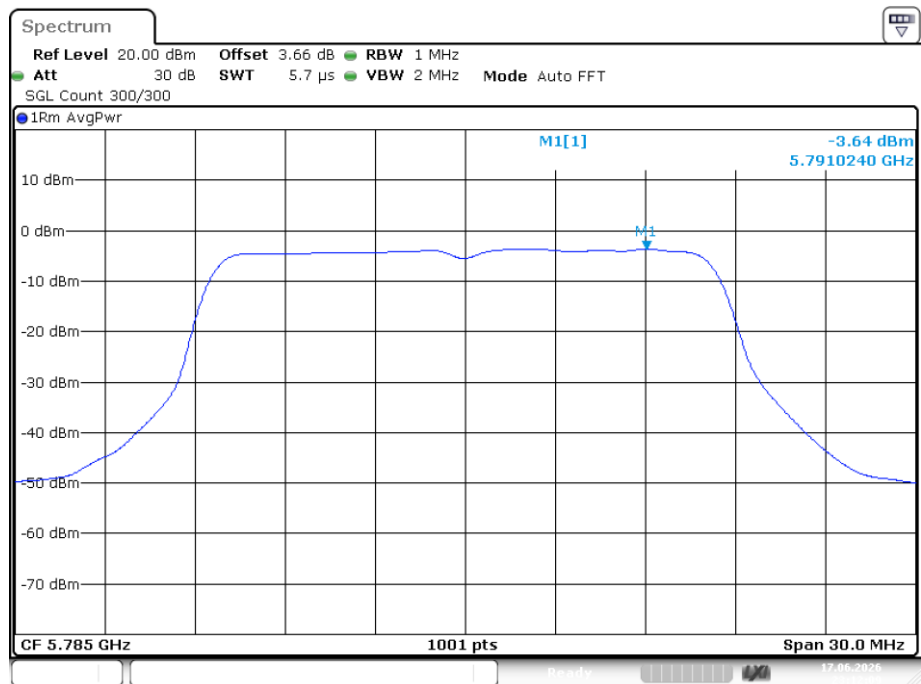


Date: 17.JUN.2026 23:12:09

PSD NVNT a 5785MHz Ant1

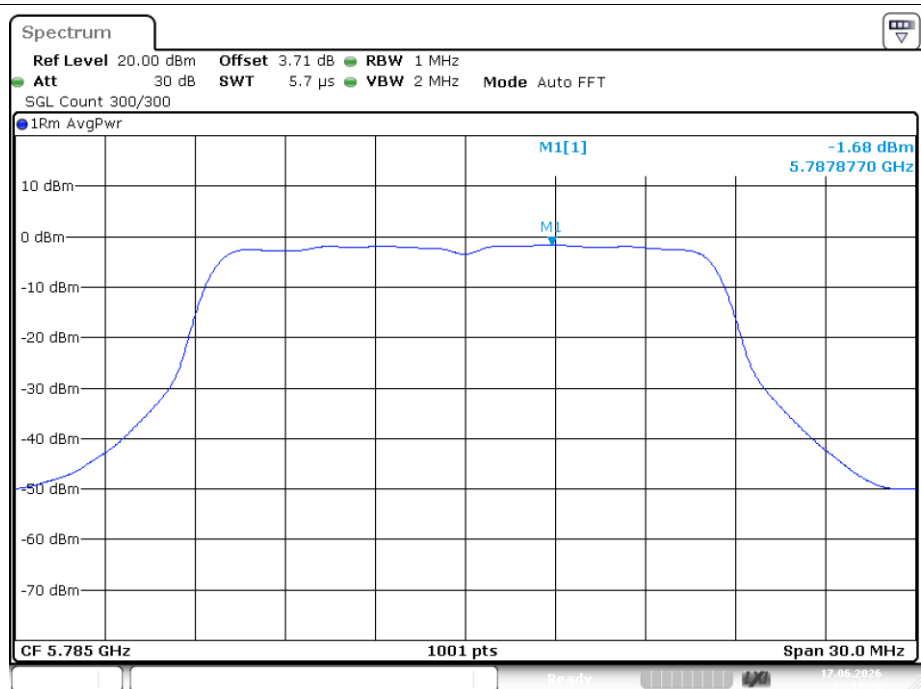


Date: 17.JUN.2026 23:54:27

PSD NVNT a 5785MHz Ant2

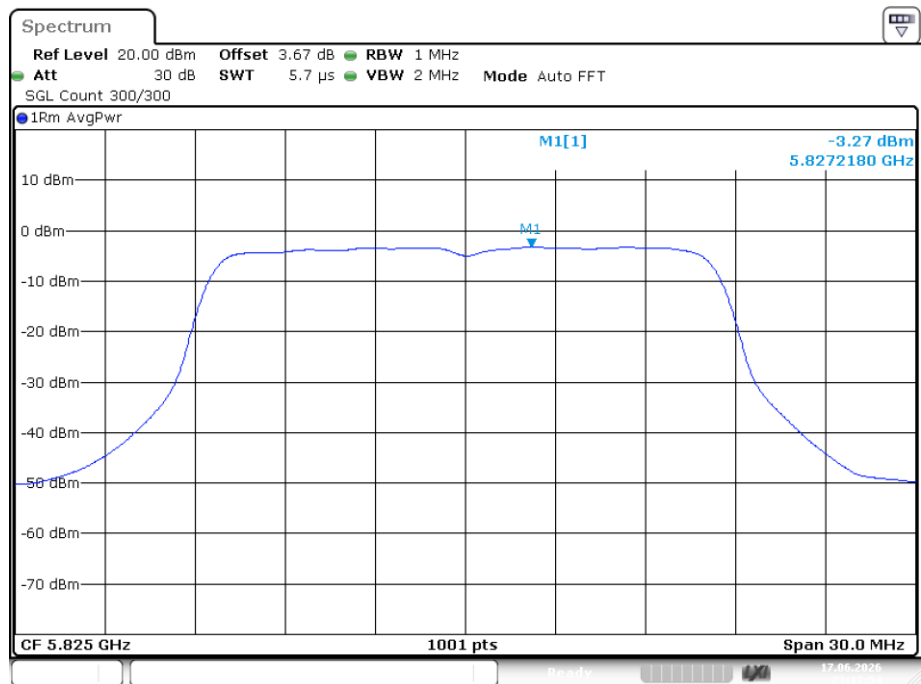


Date: 17.JUN.2026 23:12:54

PSD NVNT a 5825MHz Ant1

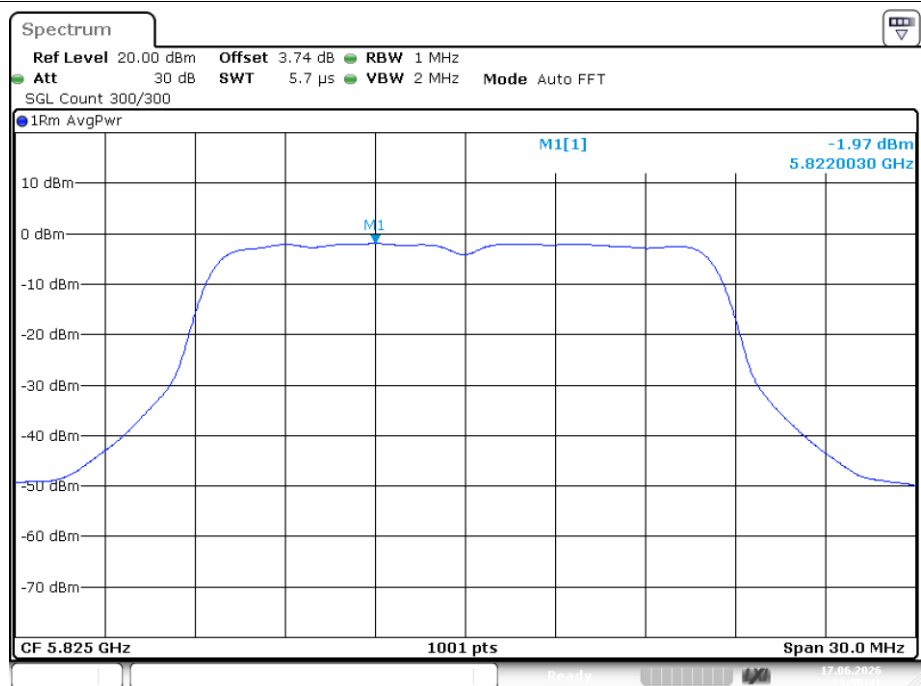


Date: 17.JUN.2026 23:55:41

PSD NVNT a 5825MHz Ant2

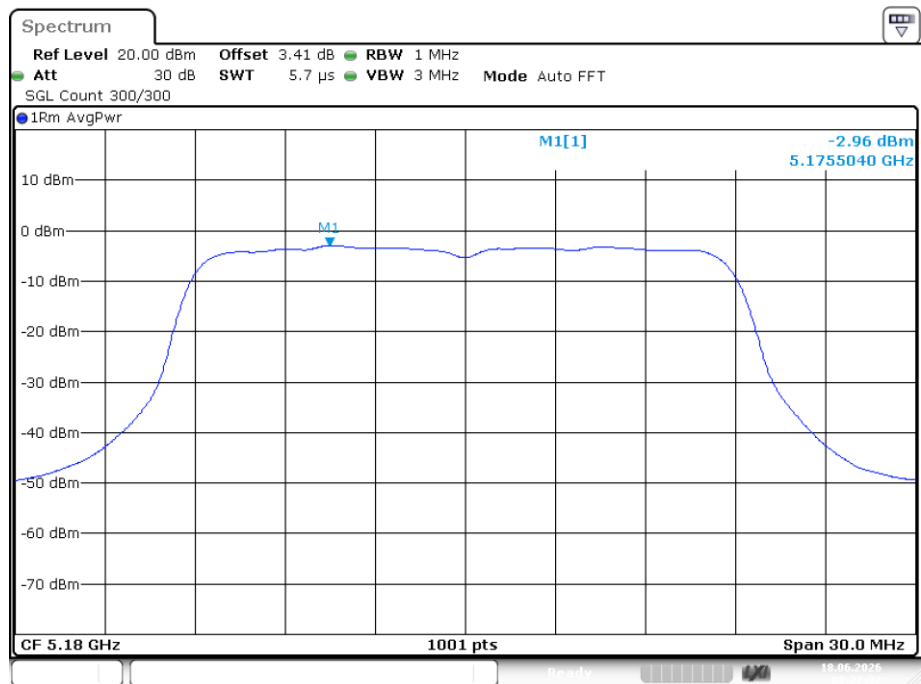


Date: 18.JUN.2026 00:27:32

PSD NVNT n20 5180MHz Ant1

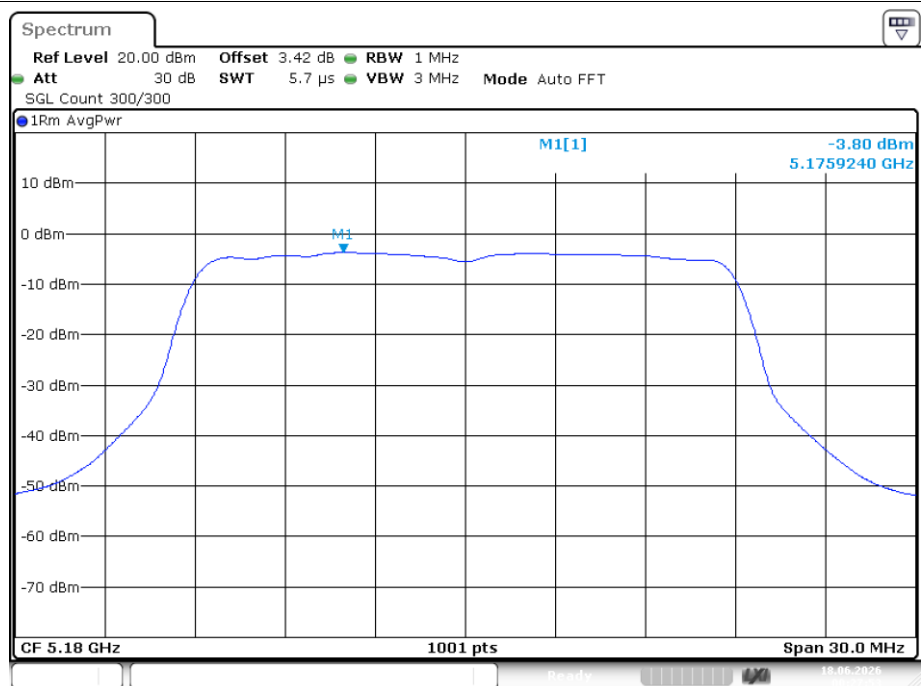


Date: 18.JUN.2026 00:27:53

PSD NVNT n20 5180MHz Ant2

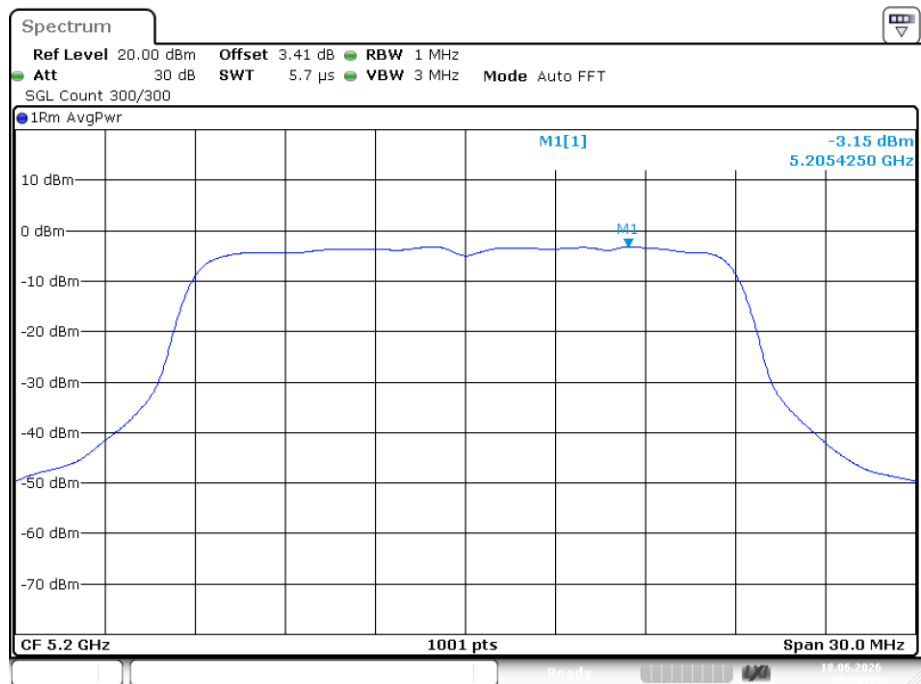


Date: 18.JUN.2026 00:30:19

PSD NVNT n20 5200MHz Ant1

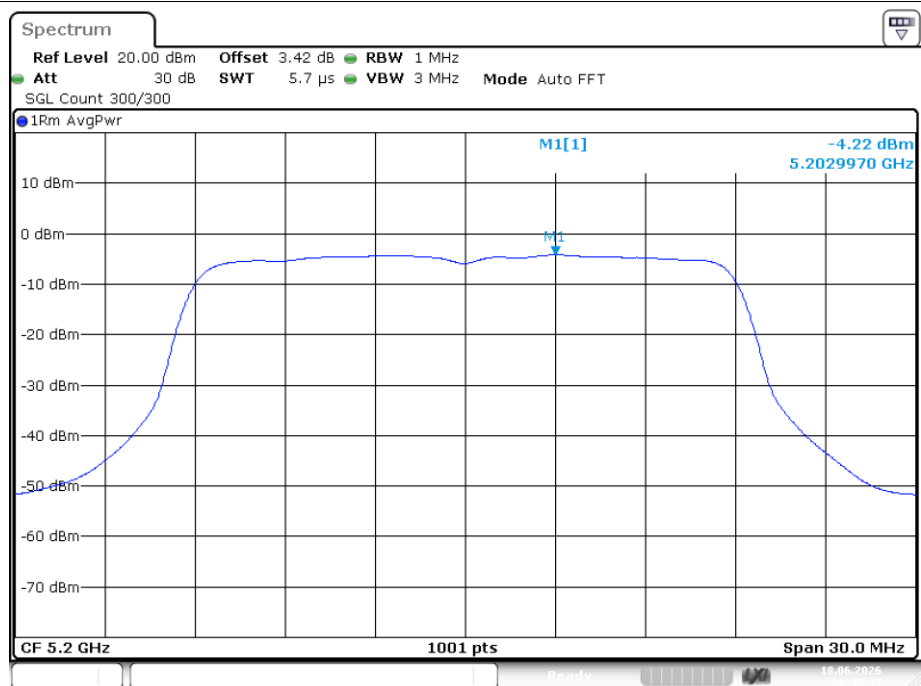


Date: 18.JUN.2026 00:30:48

PSD NVNT n20 5200MHz Ant2

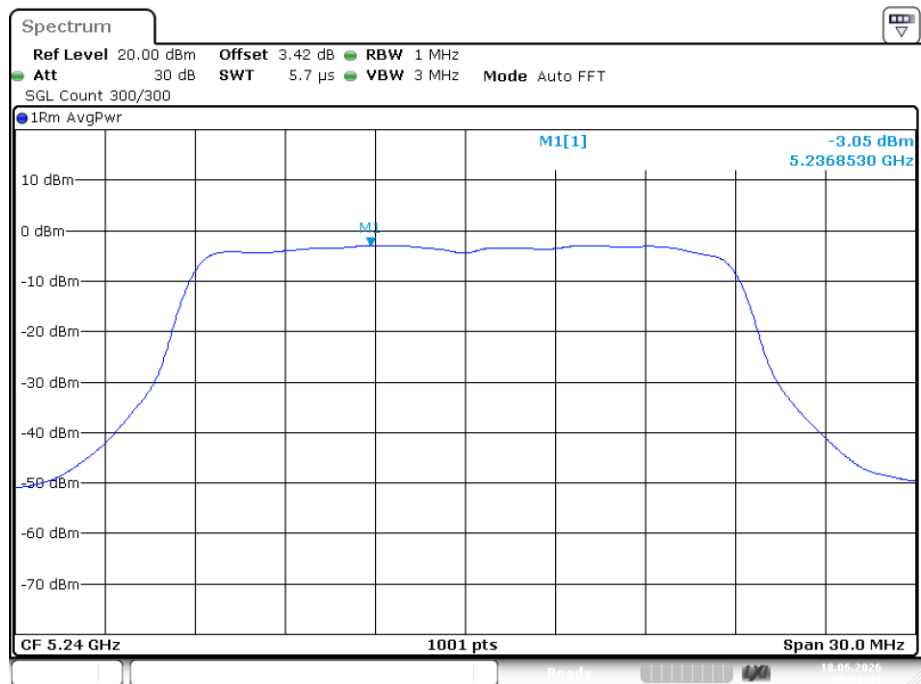


Date: 18.JUN.2026 00:31:33

PSD NVNT n20 5240MHz Ant1

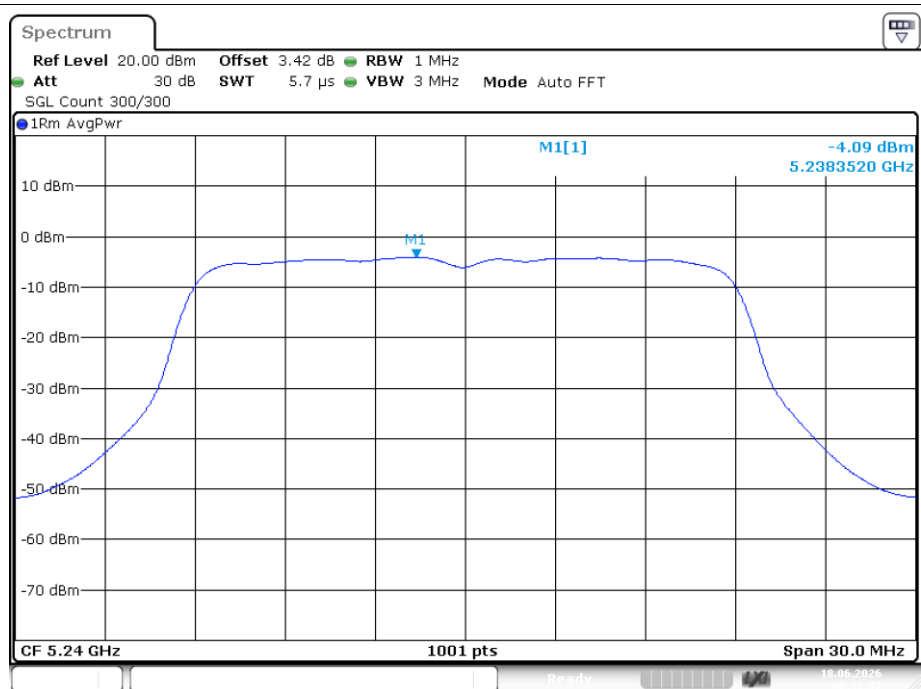


Date: 18.JUN.2026 00:31:52

PSD NVNT n20 5240MHz Ant2

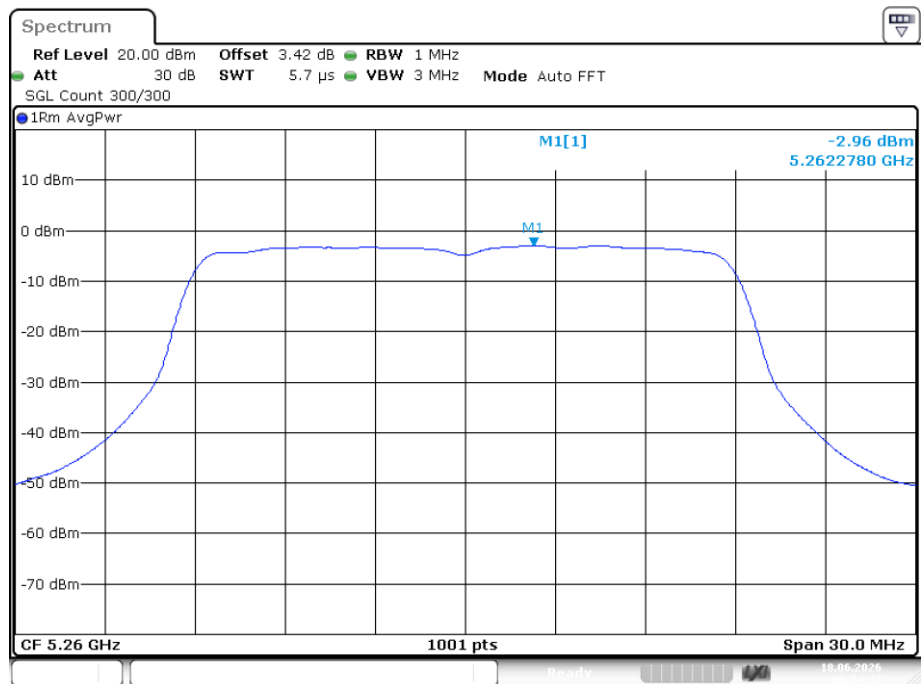


Date: 18.JUN.2026 00:34:18

PSD NVNT n20 5260MHz Ant1

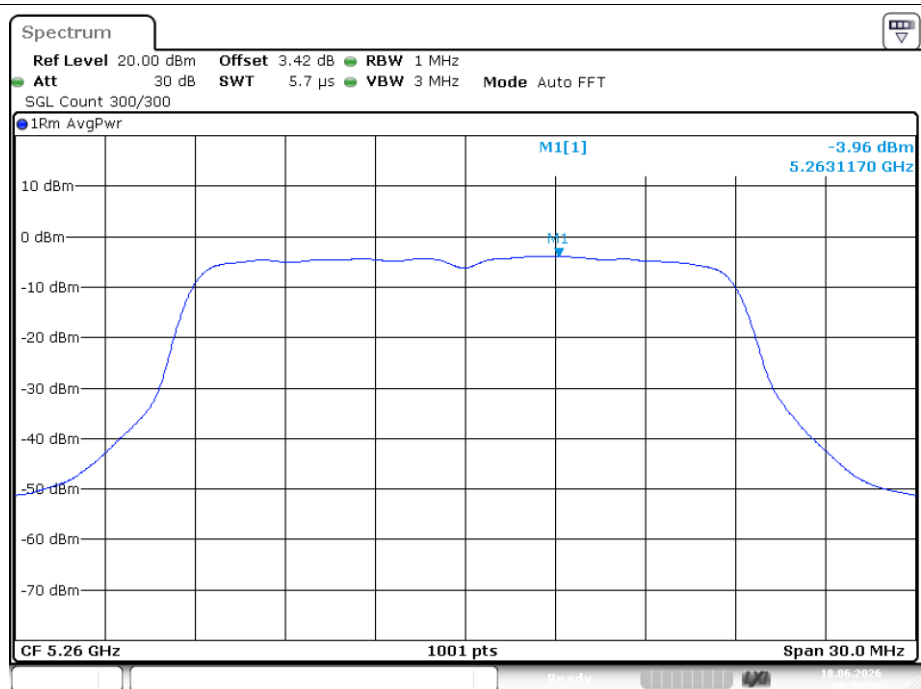


Date: 18.JUN.2026 00:34:39

PSD NVNT n20 5260MHz Ant2

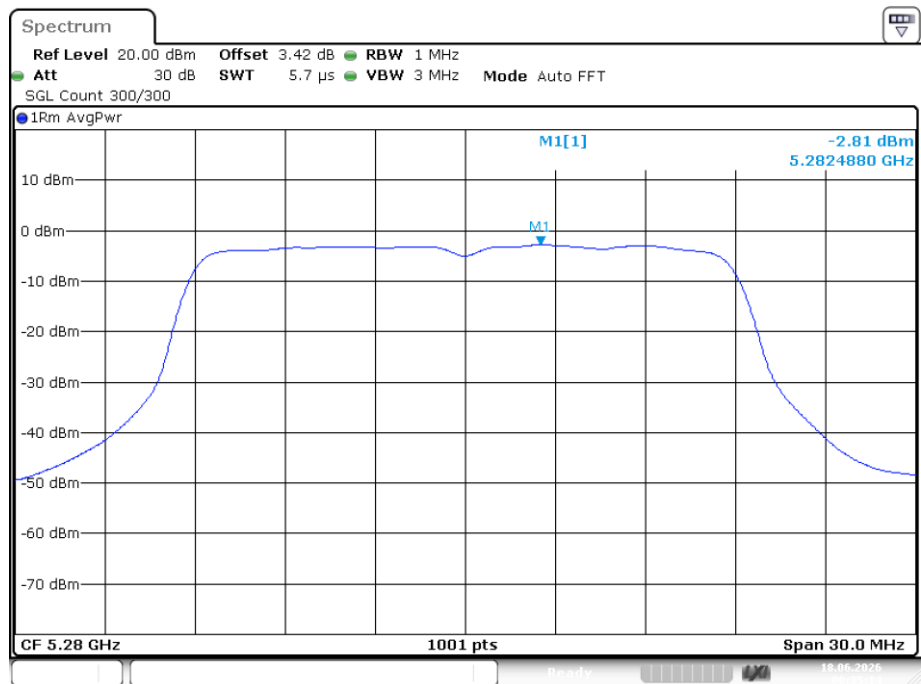


Date: 18.JUN.2026 00:35:13

PSD NVNT n20 5280MHz Ant1

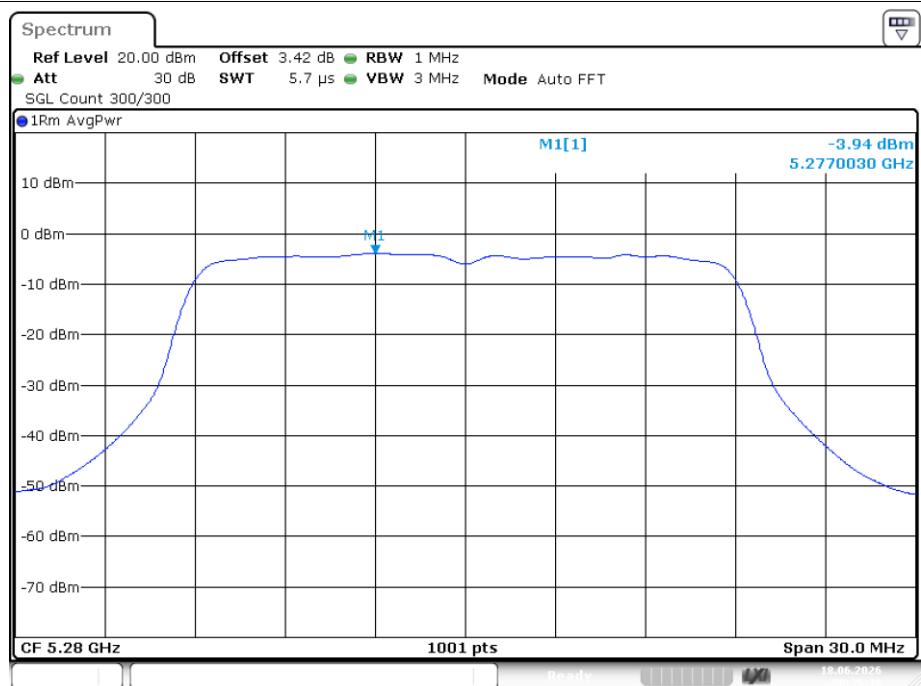


Date: 18.JUN.2026 00:35:38

PSD NVNT n20 5280MHz Ant2

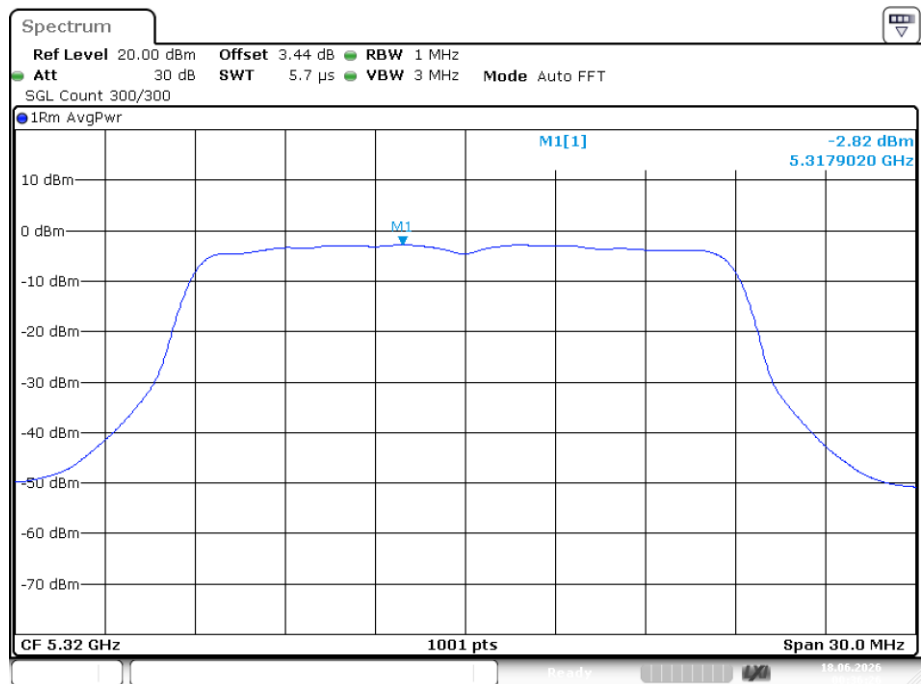


Date: 18.JUN.2026 00:36:25

PSD NVNT n20 5320MHz Ant1

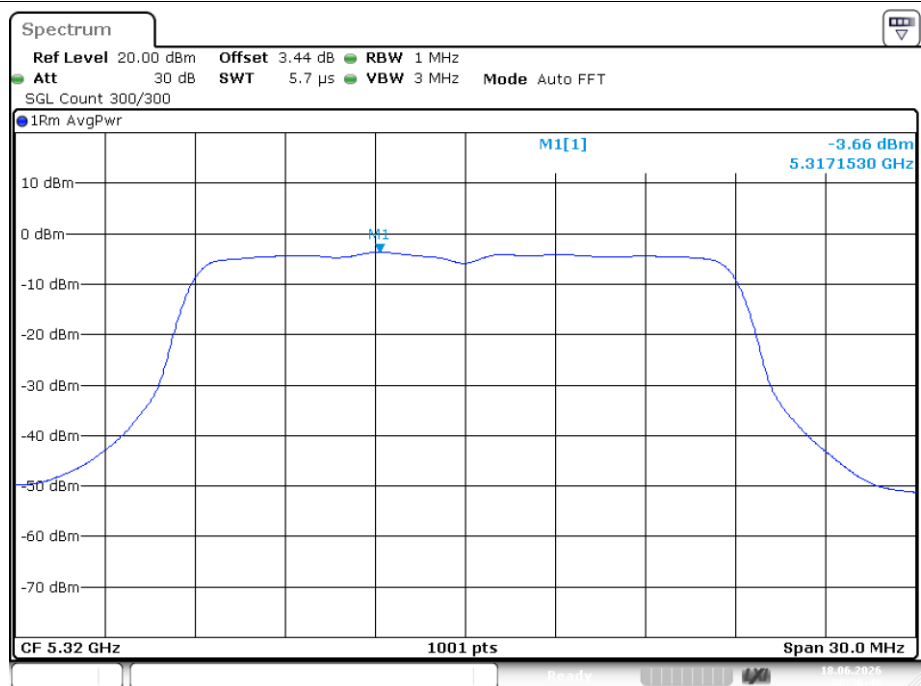


Date: 18.JUN.2026 00:36:45

PSD NVNT n20 5320MHz Ant2

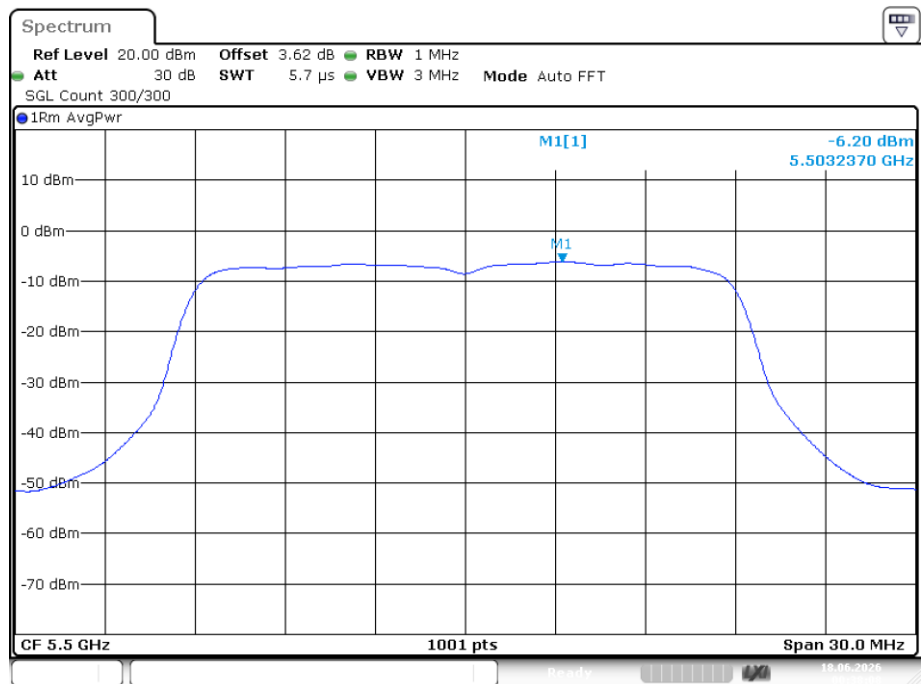


Date: 18.JUN.2026 00:38:08

PSD NVNT n20 5500MHz Ant1

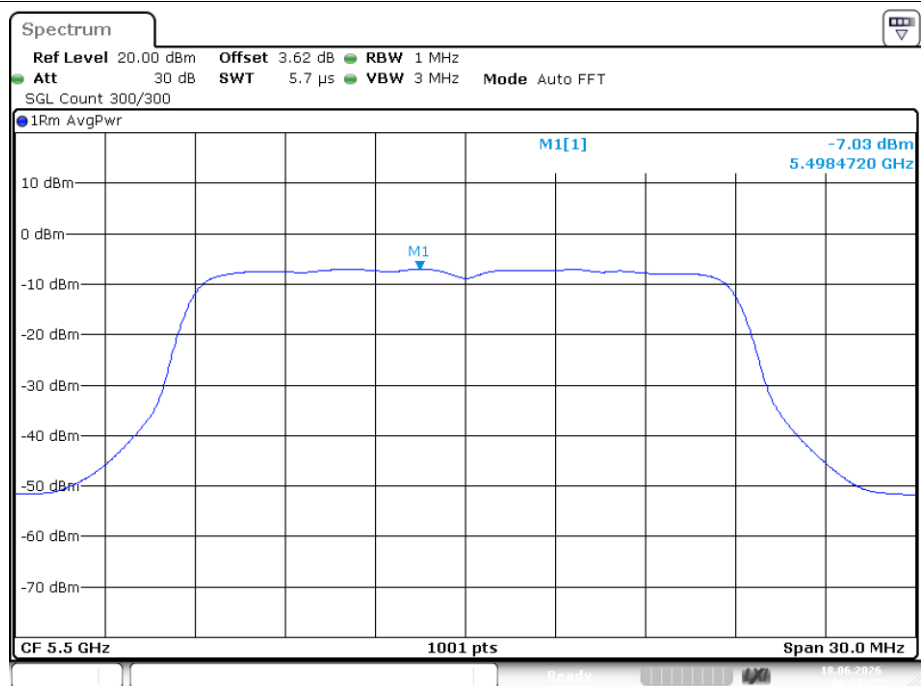


Date: 18.JUN.2026 00:38:27

PSD NVNT n20 5500MHz Ant2

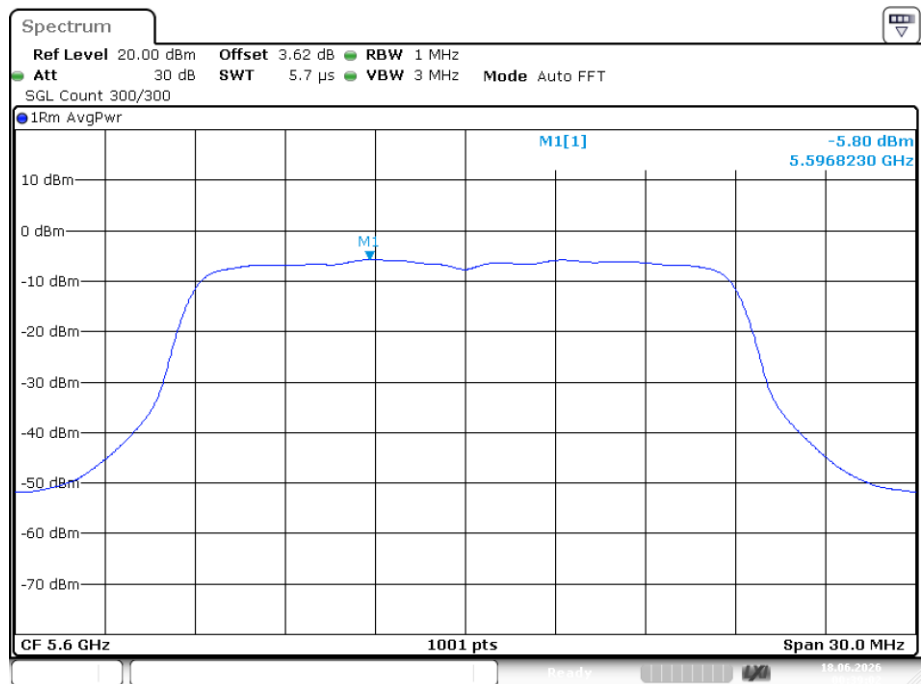


Date: 18.JUN.2026 00:39:02

PSD NVNT n20 5600MHz Ant1

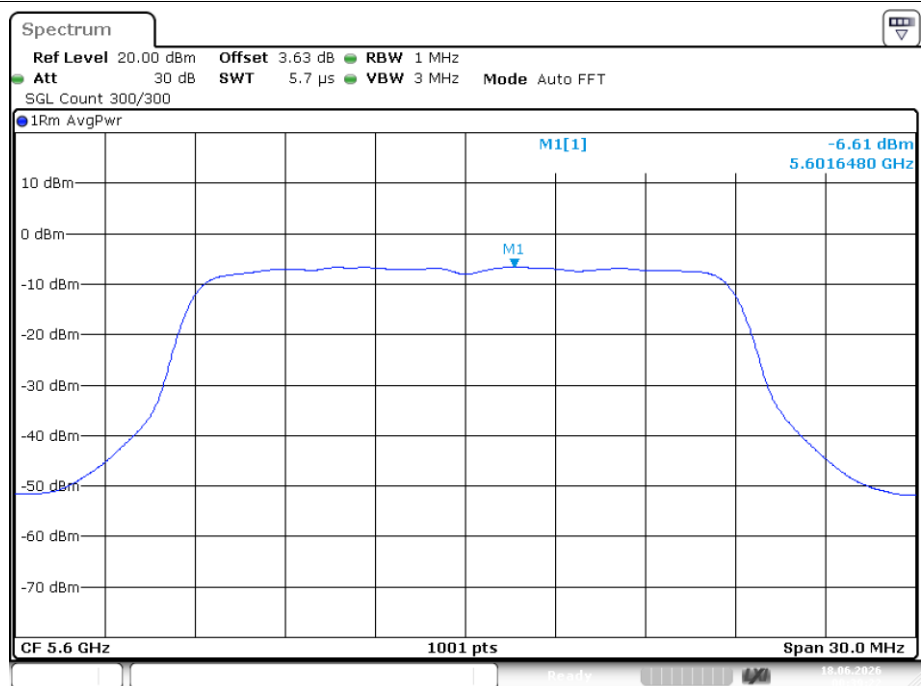


Date: 18.JUN.2026 00:39:23

PSD NVNT n20 5600MHz Ant2

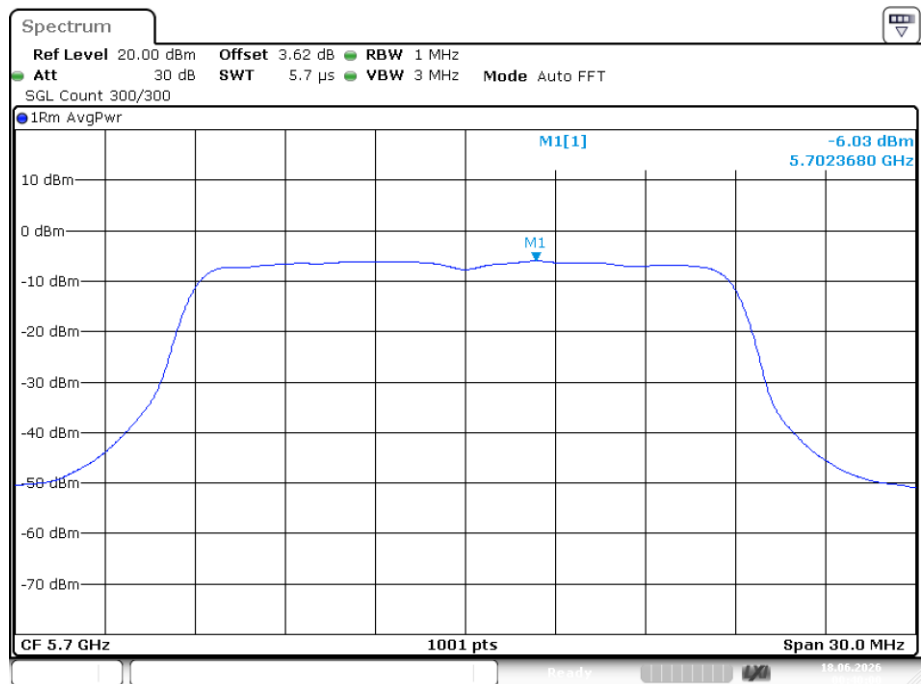


Date: 18.JUN.2026 00:40:00

PSD NVNT n20 5700MHz Ant1

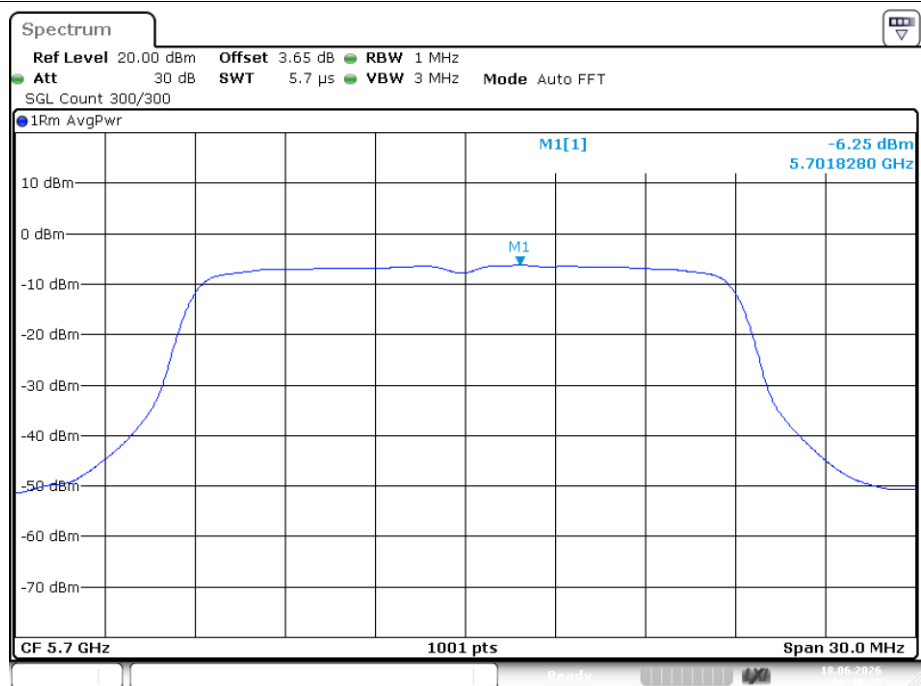


Date: 18.JUN.2026 00:40:20

PSD NVNT n20 5700MHz Ant2

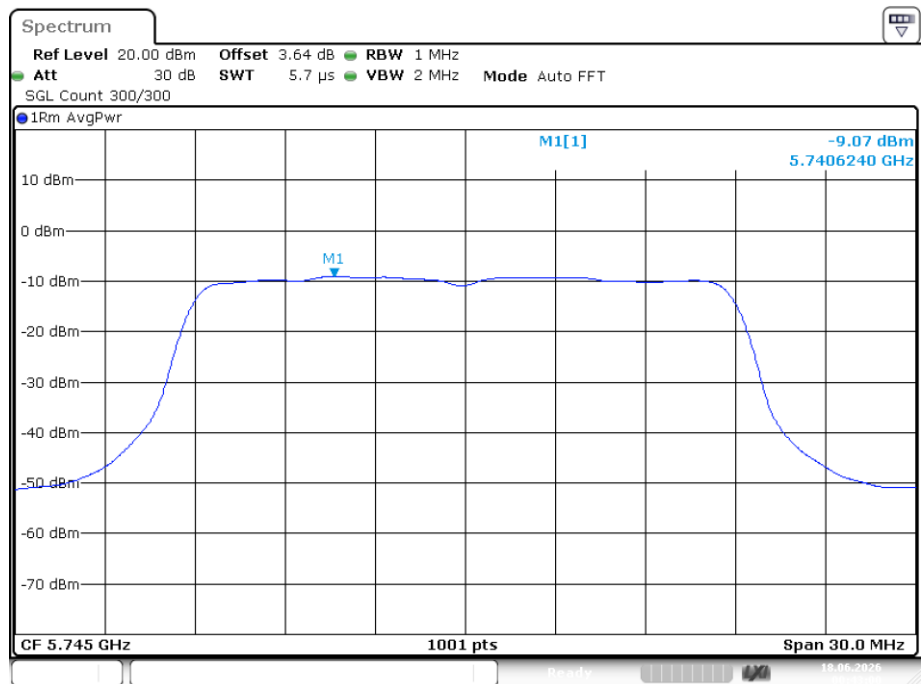


Date: 18.JUN.2026 00:43:00

PSD NVNT n20 5745MHz Ant1

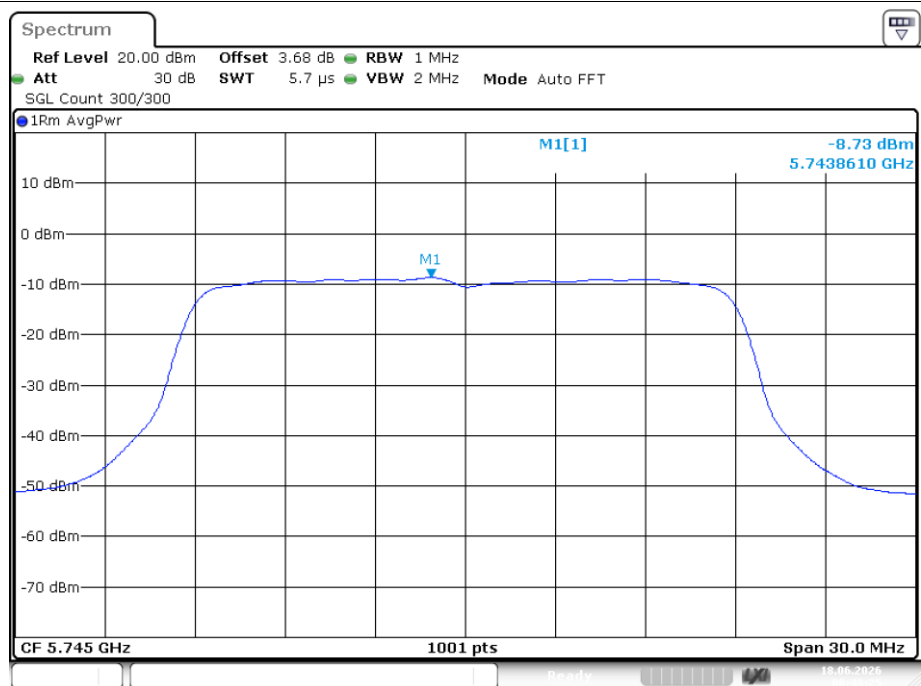


Date: 18.JUN.2026 00:43:25

PSD NVNT n20 5745MHz Ant2

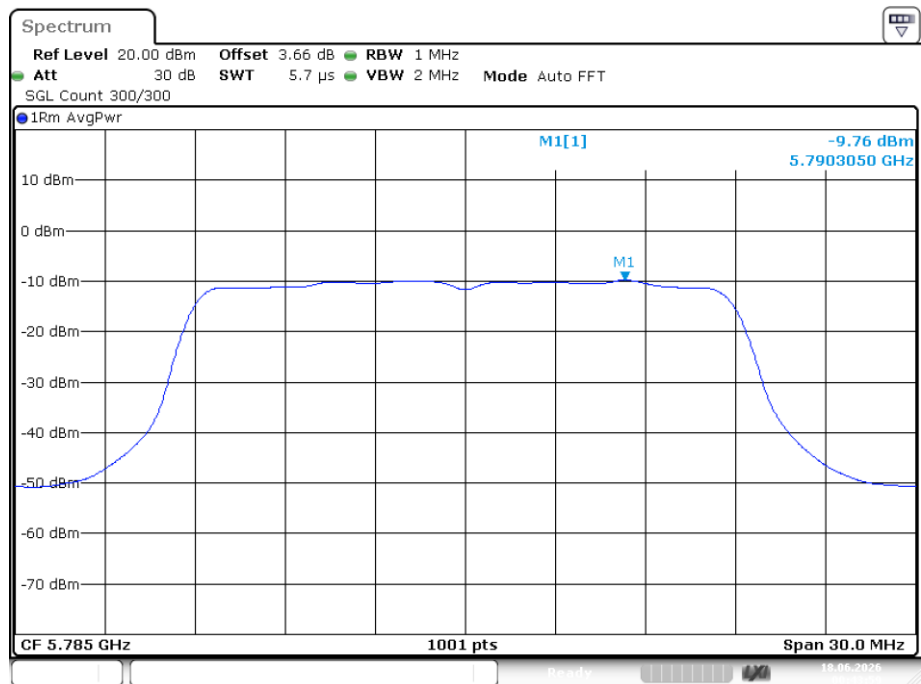

Date: 18.JUN.2026 00:43:59

PSD NVNT n20 5785MHz Ant1

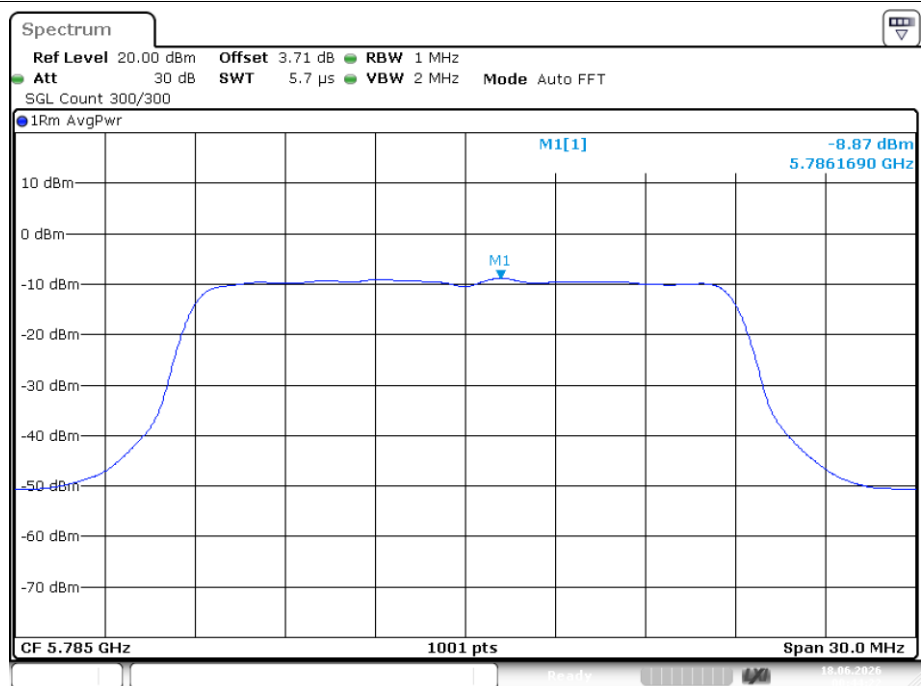

Date: 18.JUN.2026 00:44:22

PSD NVNT n20 5785MHz Ant2