



Appendix R: Test Data for E-UTRA Band 41

Product Name: Smartphone

Test Model: S24 Pro

Environmental Conditions

Temperature:	23.8°C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Paddi Chen
Supervised by:	Nick Peng





R.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.89	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.26	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.83	PASS
Band41	5MHz	16QAM	39675	1RB#12	21.71	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.76	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.31	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.83	PASS
Band41	5MHz	16QAM	39675	12RB#0	20.08	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.82	PASS
Band41	5MHz	16QAM	39675	12RB#6	20.06	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.78	PASS
Band41	5MHz	16QAM	39675	12RB#13	20.00	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.78	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.15	PASS
Band41	5MHz	QPSK	40620	1RB#0	21.26	PASS
Band41	5MHz	16QAM	40620	1RB#0	20.65	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.30	PASS
Band41	5MHz	16QAM	40620	1RB#12	20.95	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.22	PASS
Band41	5MHz	16QAM	40620	1RB#24	20.83	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.30	PASS
Band41	5MHz	16QAM	40620	12RB#0	19.54	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.29	PASS
Band41	5MHz	16QAM	40620	12RB#6	19.53	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.44	PASS
Band41	5MHz	16QAM	40620	12RB#13	19.58	PASS
Band41	5MHz	QPSK	40620	25RB#0	20.47	PASS
Band41	5MHz	16QAM	40620	25RB#0	19.75	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.22	PASS
Band41	5MHz	16QAM	41565	1RB#0	20.93	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.16	PASS
Band41	5MHz	16QAM	41565	1RB#12	20.76	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.19	PASS
Band41	5MHz	16QAM	41565	1RB#24	20.85	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.15	PASS
Band41	5MHz	16QAM	41565	12RB#0	19.30	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	QPSK	41565	12RB#6	20.14	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.28	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.19	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.45	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.14	PASS
Band41	5MHz	16QAM	41565	25RB#0	19.39	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.27	PASS
Band41	10MHz	16QAM	39700	1RB#0	21.96	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.15	PASS
Band41	10MHz	16QAM	39700	1RB#24	21.78	PASS
Band41	10MHz	QPSK	39700	1RB#49	21.47	PASS
Band41	10MHz	16QAM	39700	1RB#49	20.85	PASS
Band41	10MHz	QPSK	39700	25RB#0	20.87	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.17	PASS
Band41	10MHz	QPSK	39700	25RB#12	20.88	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.17	PASS
Band41	10MHz	QPSK	39700	25RB#25	20.66	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.04	PASS
Band41	10MHz	QPSK	39700	50RB#0	20.71	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.06	PASS
Band41	10MHz	QPSK	40620	1RB#0	21.75	PASS
Band41	10MHz	16QAM	40620	1RB#0	21.50	PASS
Band41	10MHz	QPSK	40620	1RB#24	21.66	PASS
Band41	10MHz	16QAM	40620	1RB#24	21.29	PASS
Band41	10MHz	QPSK	40620	1RB#49	21.61	PASS
Band41	10MHz	16QAM	40620	1RB#49	21.32	PASS
Band41	10MHz	QPSK	40620	25RB#0	20.62	PASS
Band41	10MHz	16QAM	40620	25RB#0	19.83	PASS
Band41	10MHz	QPSK	40620	25RB#12	20.63	PASS
Band41	10MHz	16QAM	40620	25RB#12	19.83	PASS
Band41	10MHz	QPSK	40620	25RB#25	20.57	PASS
Band41	10MHz	16QAM	40620	25RB#25	19.80	PASS
Band41	10MHz	QPSK	40620	50RB#0	20.69	PASS
Band41	10MHz	16QAM	40620	50RB#0	19.81	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.51	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.13	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.48	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.16	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.48	PASS
Band41	10MHz	16QAM	41540	1RB#49	21.13	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.44	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.65	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	41540	25RB#12	20.38	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.65	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.47	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.65	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.48	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.69	PASS
Band41	15MHz	QPSK	39725	1RB#0	22.16	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.98	PASS
Band41	15MHz	QPSK	39725	1RB#38	22.05	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.87	PASS
Band41	15MHz	QPSK	39725	1RB#74	21.97	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.69	PASS
Band41	15MHz	QPSK	39725	38RB#0	21.02	PASS
Band41	15MHz	16QAM	39725	38RB#0	20.68	PASS
Band41	15MHz	QPSK	39725	38RB#18	20.68	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.67	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.67	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.67	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.67	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.03	PASS
Band41	15MHz	QPSK	40620	1RB#0	21.79	PASS
Band41	15MHz	16QAM	40620	1RB#0	21.54	PASS
Band41	15MHz	QPSK	40620	1RB#38	21.62	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.24	PASS
Band41	15MHz	QPSK	40620	1RB#74	21.59	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.18	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.67	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.67	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.69	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.69	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.69	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.68	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.68	PASS
Band41	15MHz	16QAM	40620	75RB#0	19.85	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.50	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.13	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.40	PASS
Band41	15MHz	16QAM	41515	1RB#38	21.08	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.47	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.12	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.45	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.45	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	38RB#18	20.45	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.45	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.45	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.45	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.45	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.68	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.89	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.28	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.62	PASS
Band41	20MHz	16QAM	39750	1RB#49	20.92	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.49	PASS
Band41	20MHz	16QAM	39750	1RB#99	20.95	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.09	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.47	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.09	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.47	PASS
Band41	20MHz	QPSK	39750	50RB#50	20.91	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.32	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.03	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.33	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.60	PASS
Band41	20MHz	16QAM	40620	1RB#0	21.31	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.26	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.00	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.29	PASS
Band41	20MHz	16QAM	40620	1RB#99	20.97	PASS
Band41	20MHz	QPSK	40620	50RB#0	20.82	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.20	PASS
Band41	20MHz	QPSK	40620	50RB#25	20.68	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.21	PASS
Band41	20MHz	QPSK	40620	50RB#50	20.58	PASS
Band41	20MHz	16QAM	40620	50RB#50	19.93	PASS
Band41	20MHz	QPSK	40620	100RB#0	20.73	PASS
Band41	20MHz	16QAM	40620	100RB#0	19.86	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.24	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.18	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.26	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.10	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.17	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.16	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.44	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.76	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	41490	50RB#25	20.45	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.76	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.42	PASS
Band41	20MHz	16QAM	41490	50RB#50	19.90	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.30	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.51	PASS





R.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.50	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.72	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	9.00	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.66	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.76	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.21	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.07	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	10.02	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.44	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.69	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.01	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.74	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.96	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.62	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.89	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.64	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.61	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.11	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.21	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.54	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.21	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.87	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.12	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.64	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	7.83	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.33	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.61	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.74	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.37	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.38	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.39	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.97	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.11	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	9.02	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.29	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.83	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	1RB#0	7.98	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.67	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	8.78	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.55	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.53	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.53	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	8.85	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.73	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.24	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.31	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.13	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.44	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

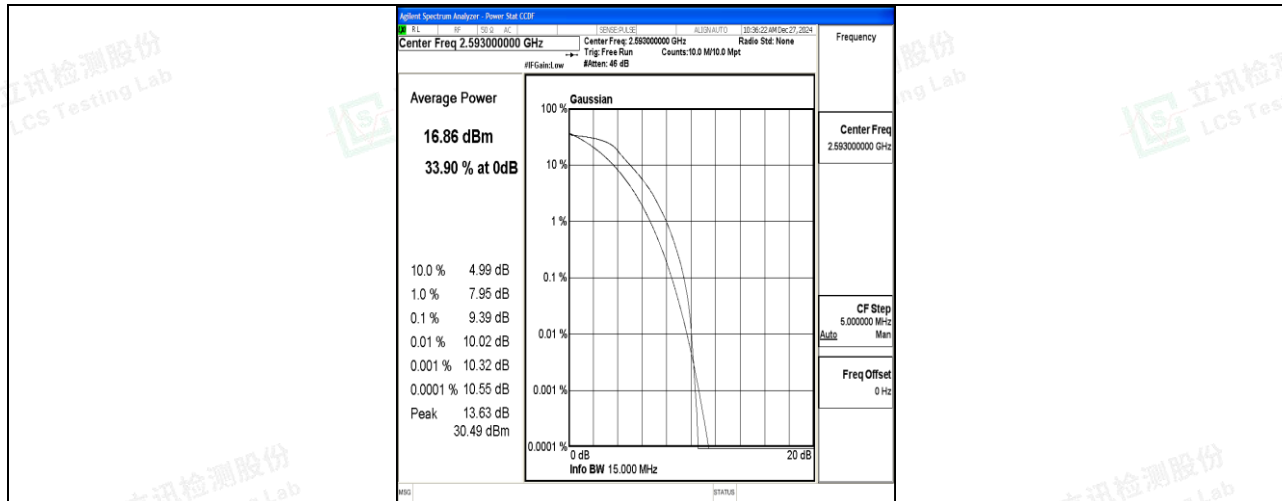

Band41-15MHz-QPSK-40620-75RB#0-PASS

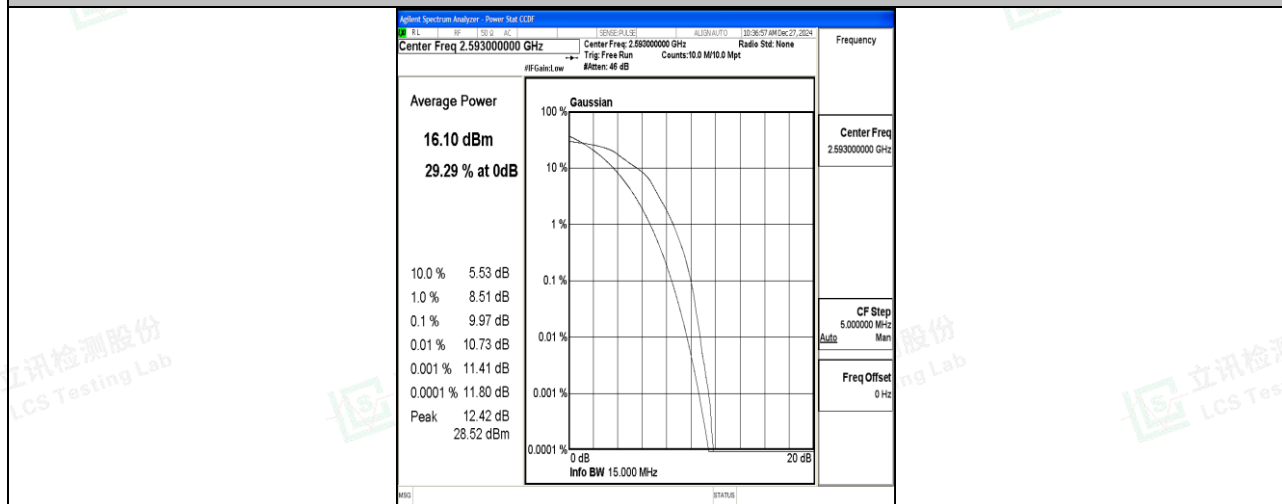

Band41-15MHz-16QAM-40620-75RB#0-PASS

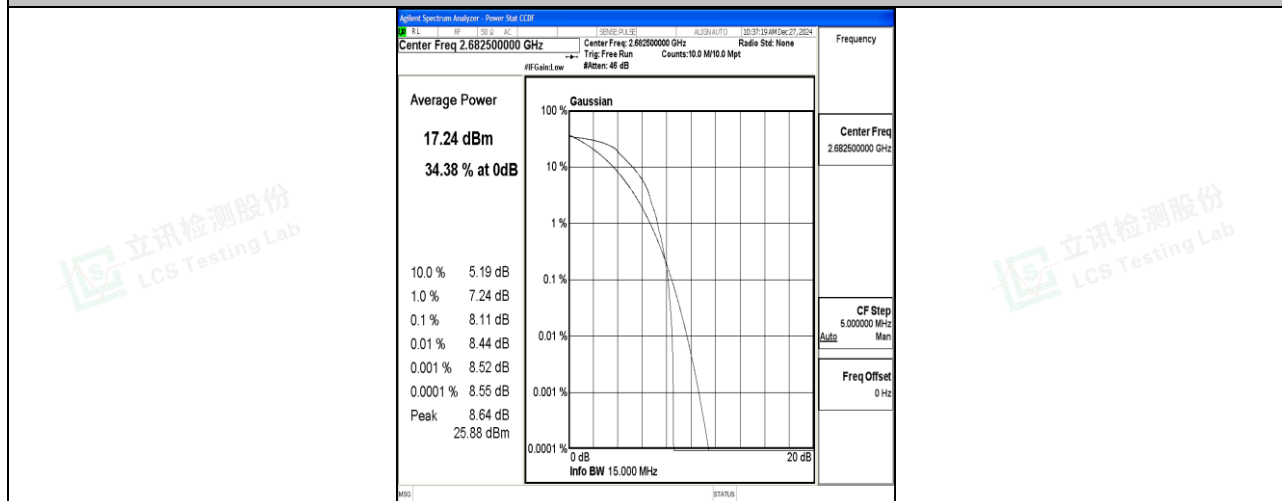

Band41-15MHz-QPSK-41515-1RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

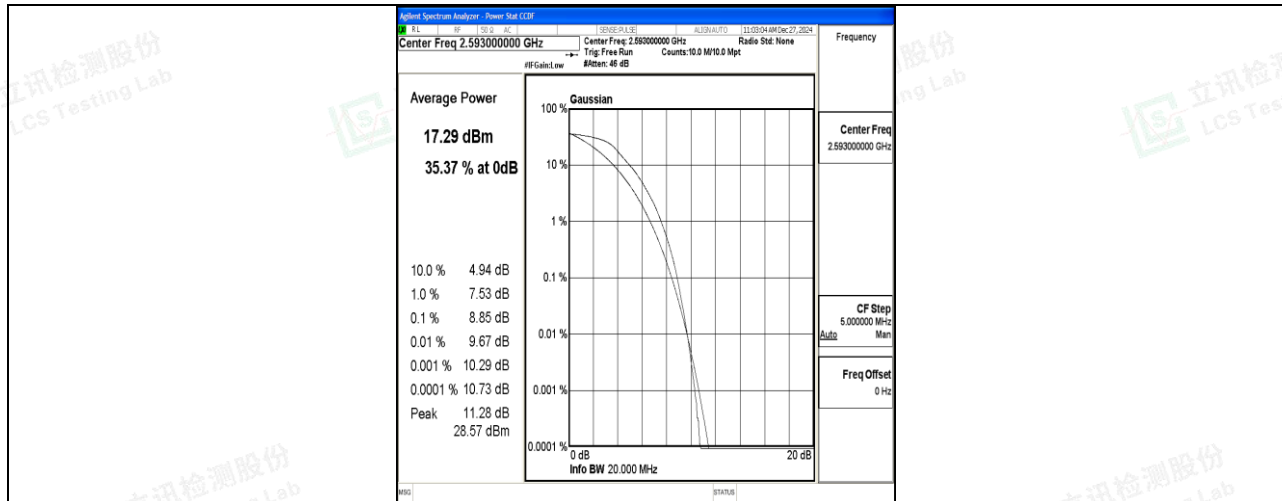

Band41-20MHz-QPSK-40620-100RB#0-PASS

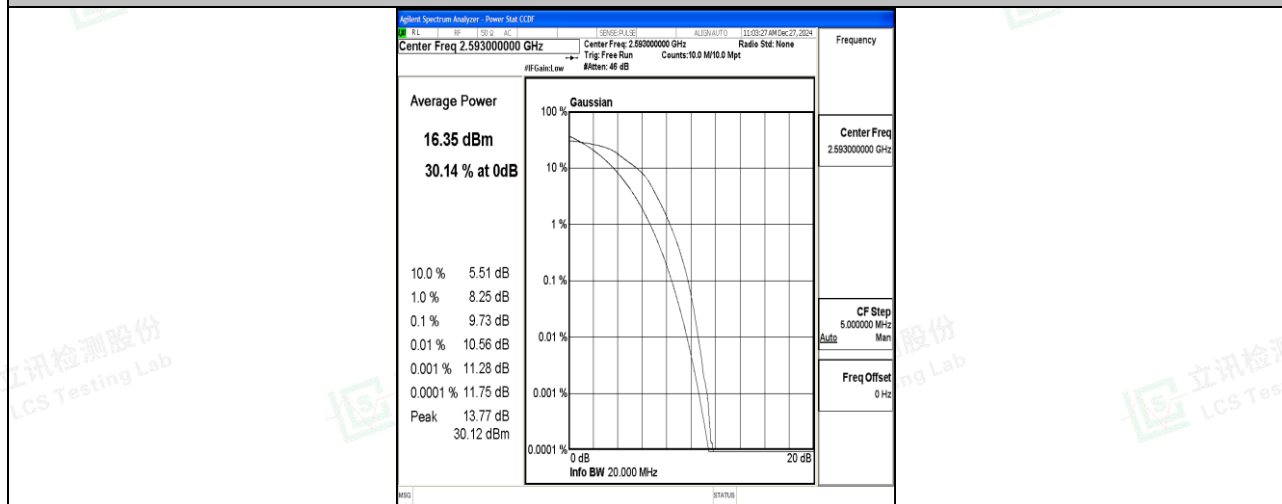

Band41-20MHz-16QAM-40620-100RB#0-PASS

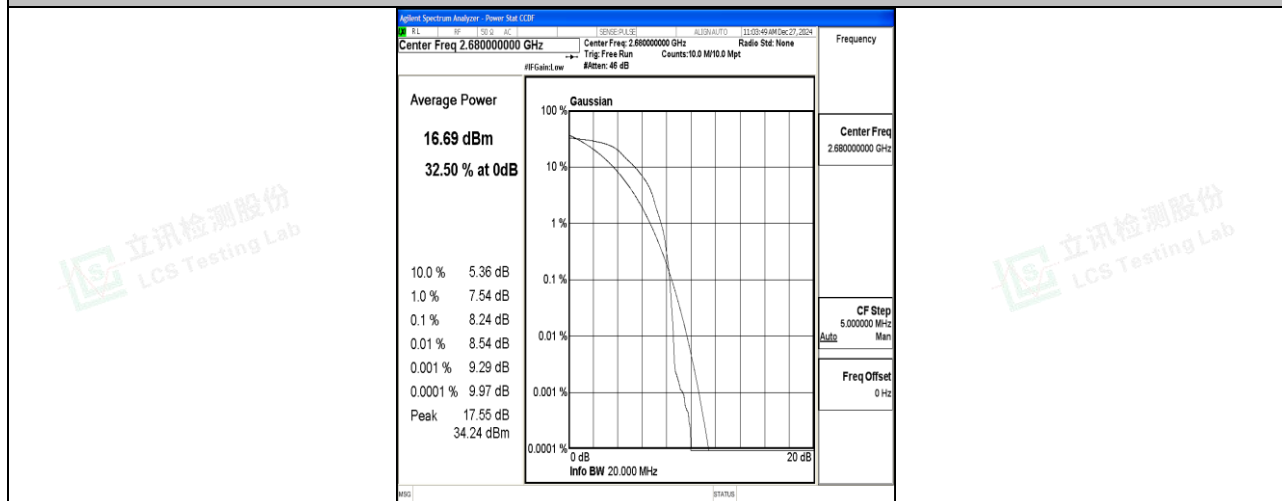

Band41-20MHz-QPSK-41490-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

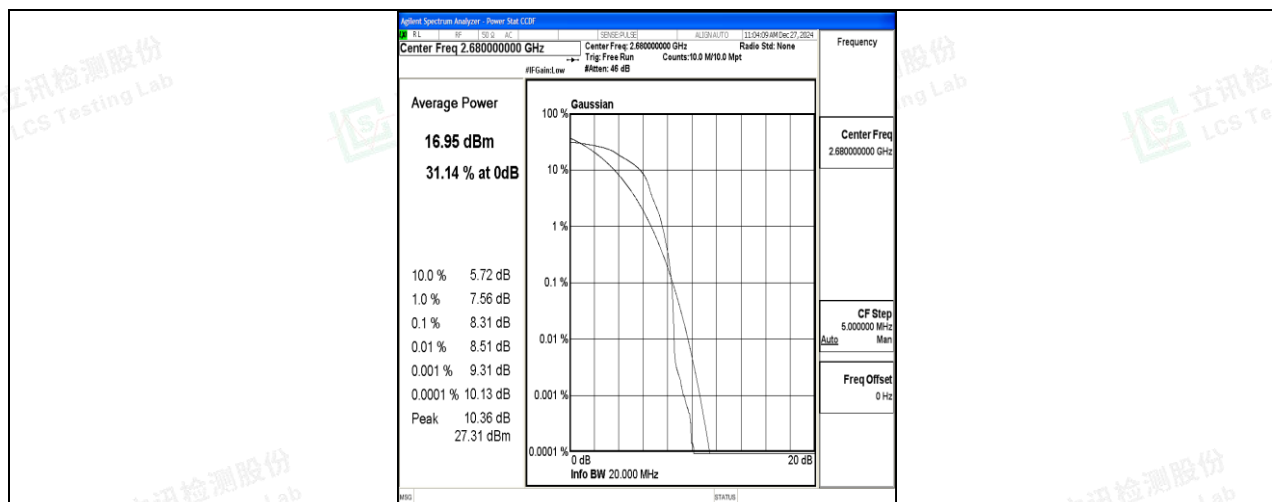

Band41-20MHz-16QAM-41490-1RB#0-PASS

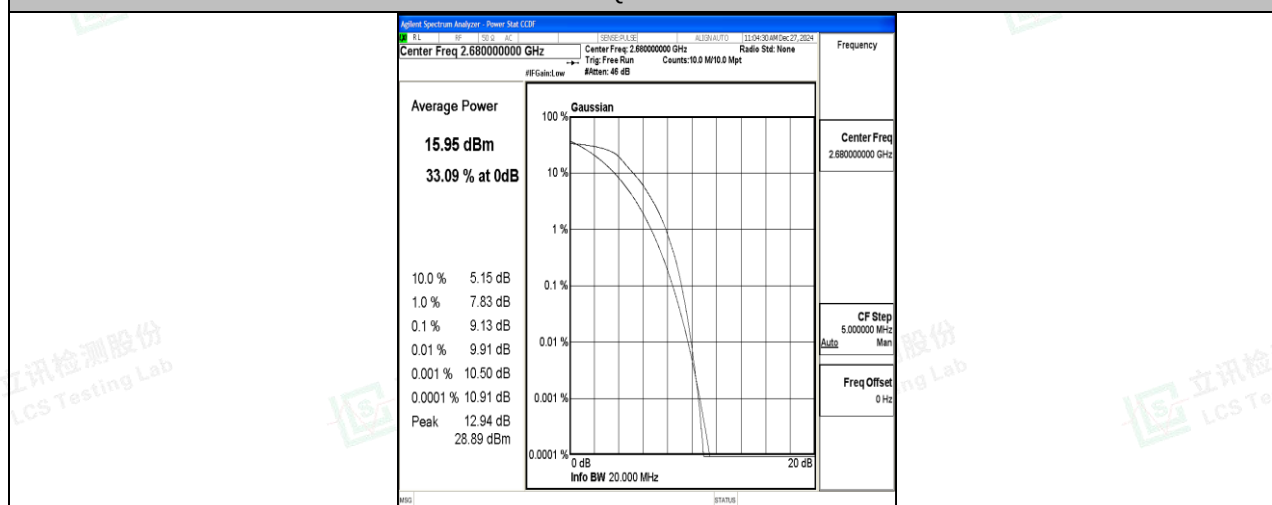

Band41-20MHz-QPSK-41490-100RB#0-PASS

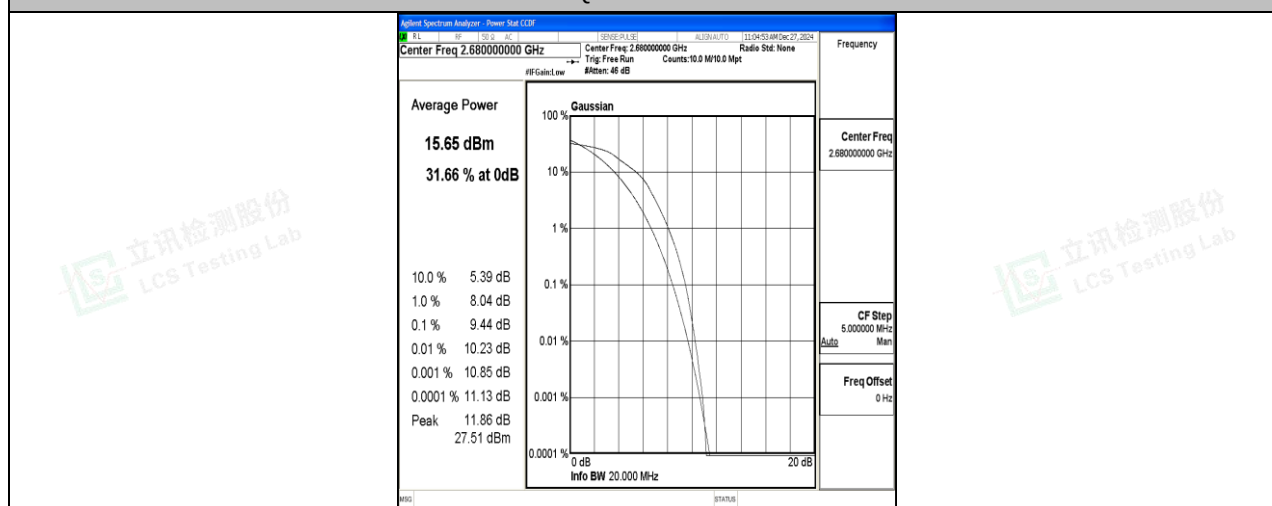

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



R.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5201	5.219	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5303	5.324	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5235	5.196	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5063	5.390	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4947	5.116	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5017	5.322	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9853	9.974	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9953	10.09	PASS
Band41	10MHz	QPSK	40620	50RB#0	8.9872	10.12	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9719	10.10	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0021	10.23	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0152	10.86	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.924	20.97	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.950	19.65	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.958	19.65	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.931	19.74	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.497	15.88	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.514	15.38	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.453	16.11	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.457	15.15	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.500	16.16	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.480	15.13	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.923	19.74	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.943	20.69	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

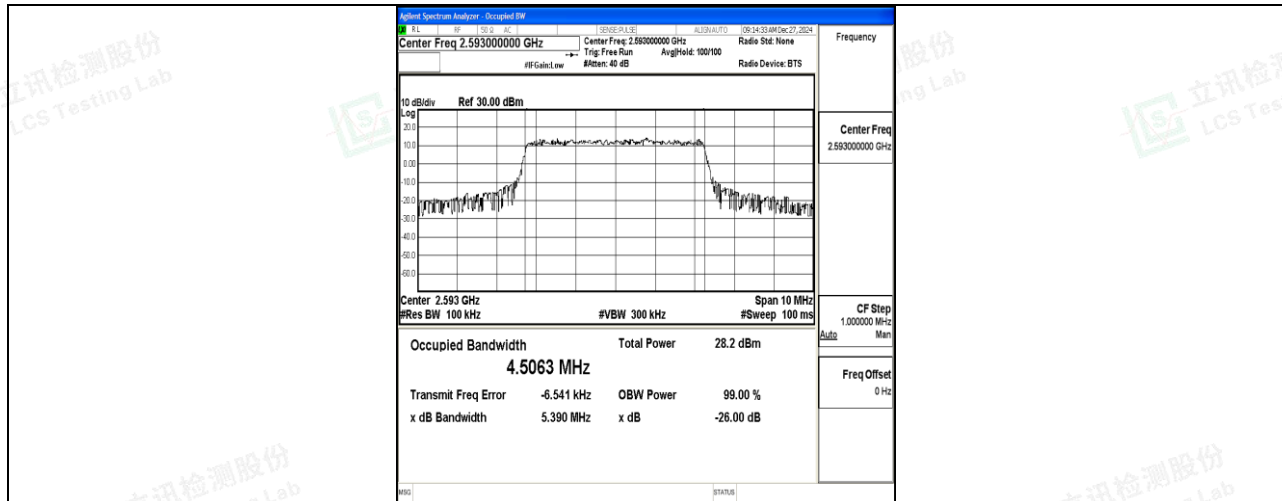

Band41-5MHz-16QAM-40620-25RB#0-PASS

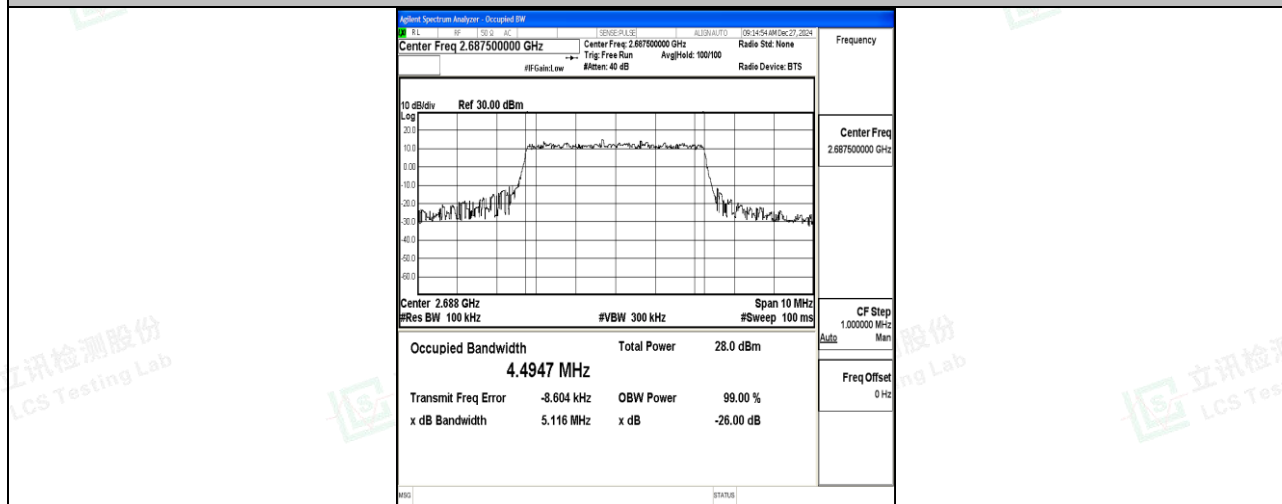

Band41-5MHz-QPSK-41565-25RB#0-PASS

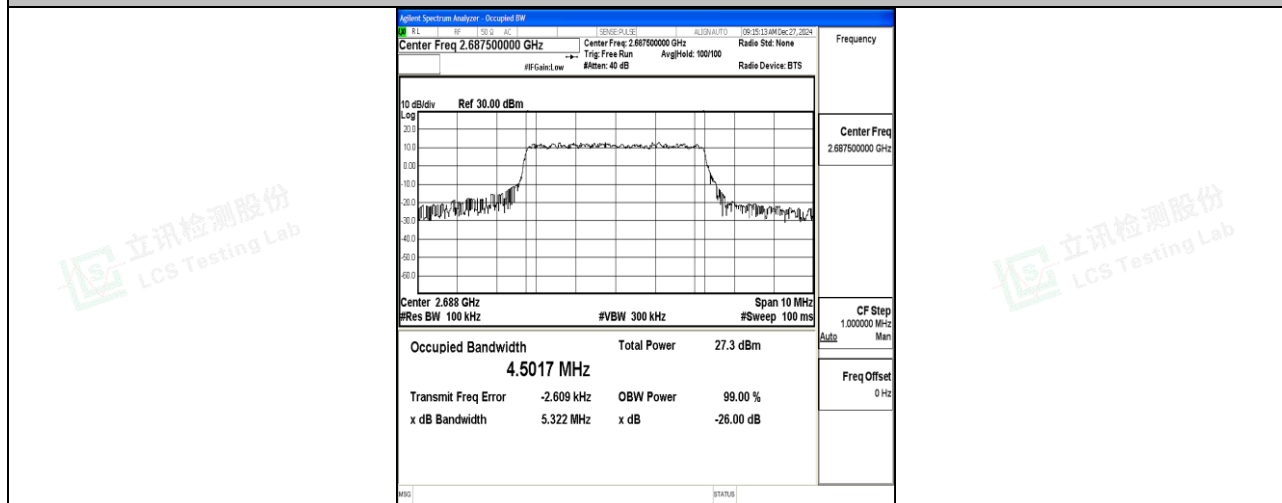

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

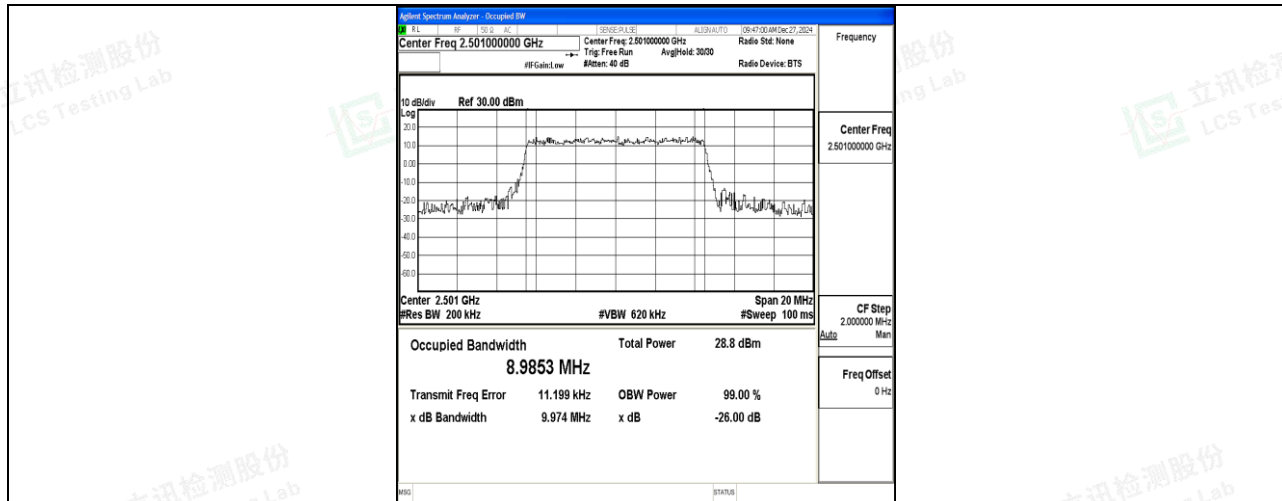

Band41-10MHz-QPSK-39700-50RB#0-PASS

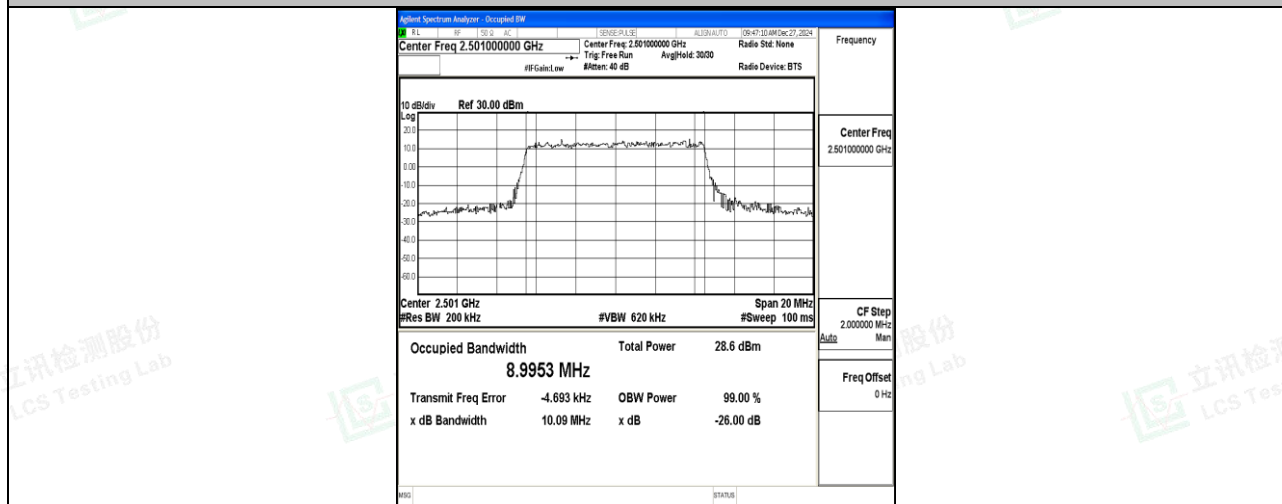

Band41-10MHz-16QAM-39700-50RB#0-PASS

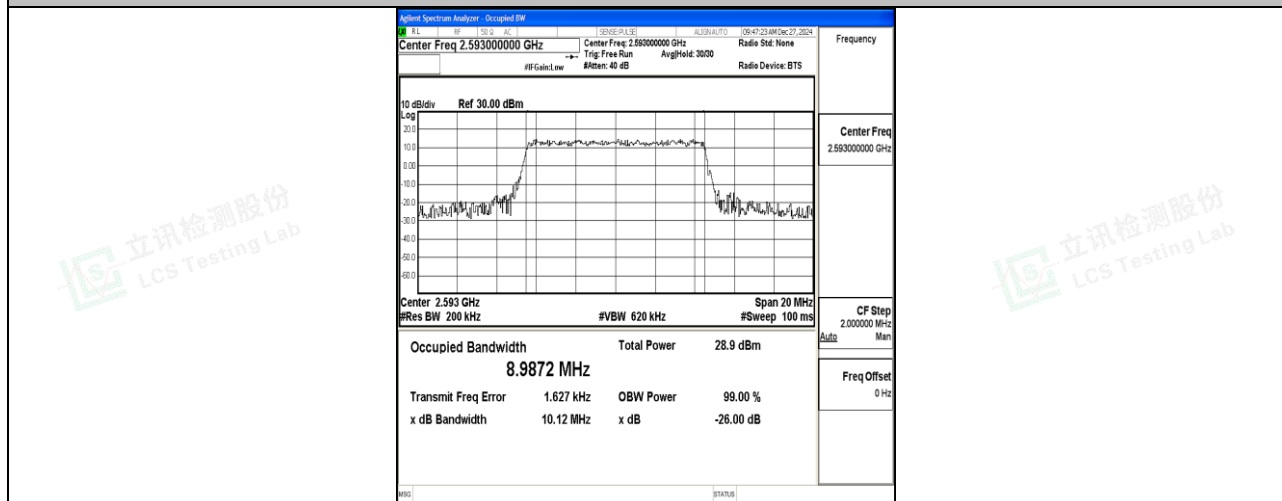

Band41-10MHz-QPSK-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

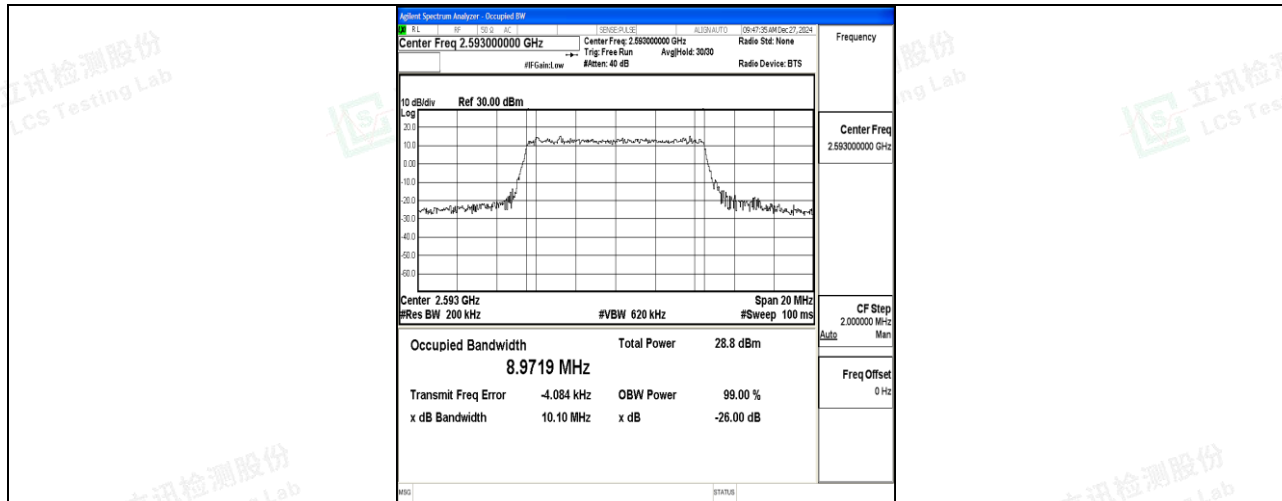

Band41-10MHz-16QAM-40620-50RB#0-PASS

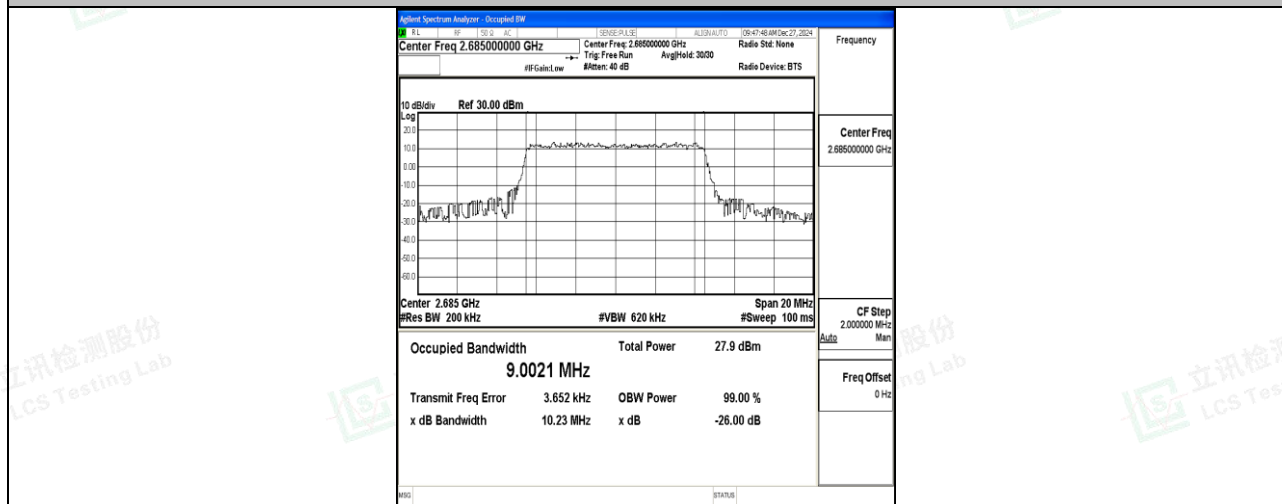

Band41-10MHz-QPSK-41540-50RB#0-PASS

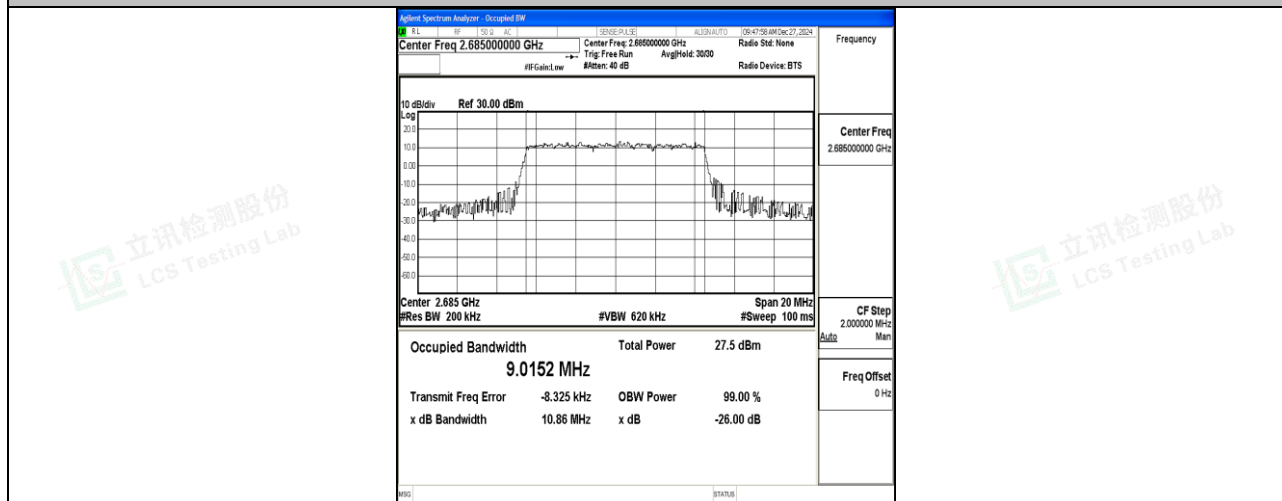

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

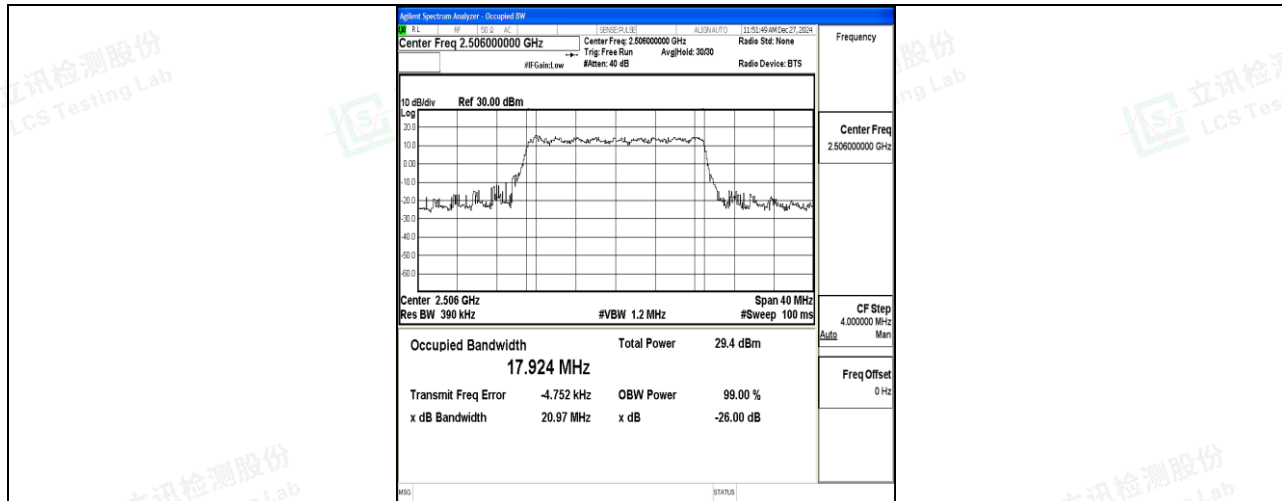

Band41-20MHz-QPSK-39750-100RB#0-PASS

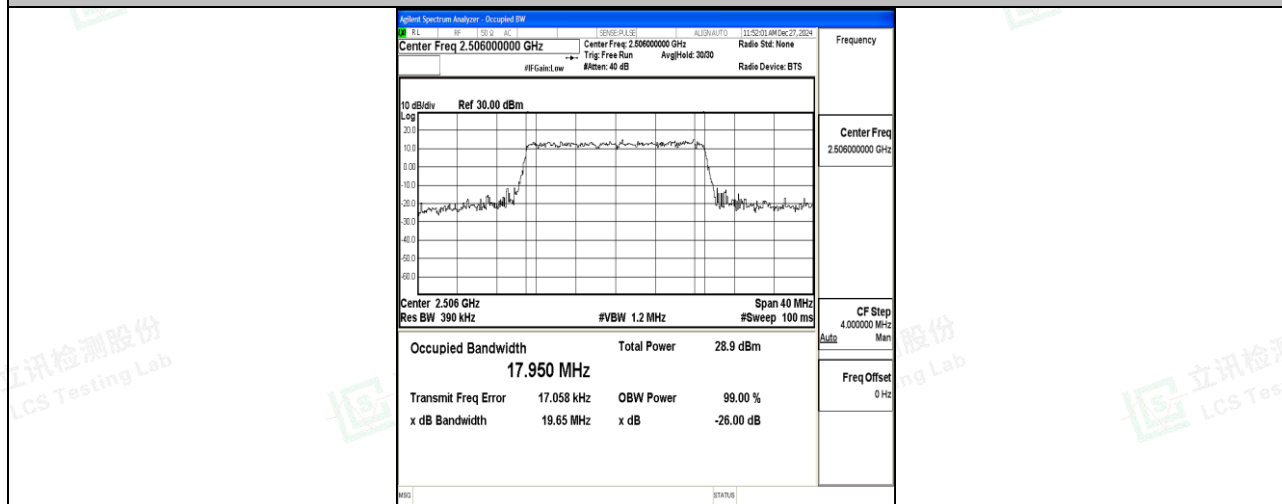

Band41-20MHz-16QAM-39750-100RB#0-PASS

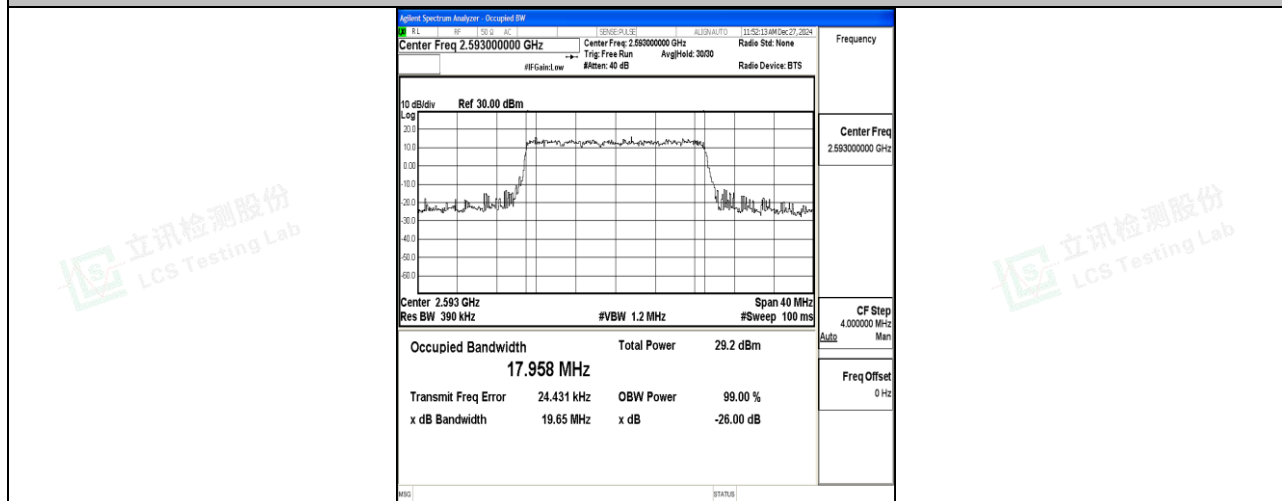

Band41-20MHz-QPSK-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

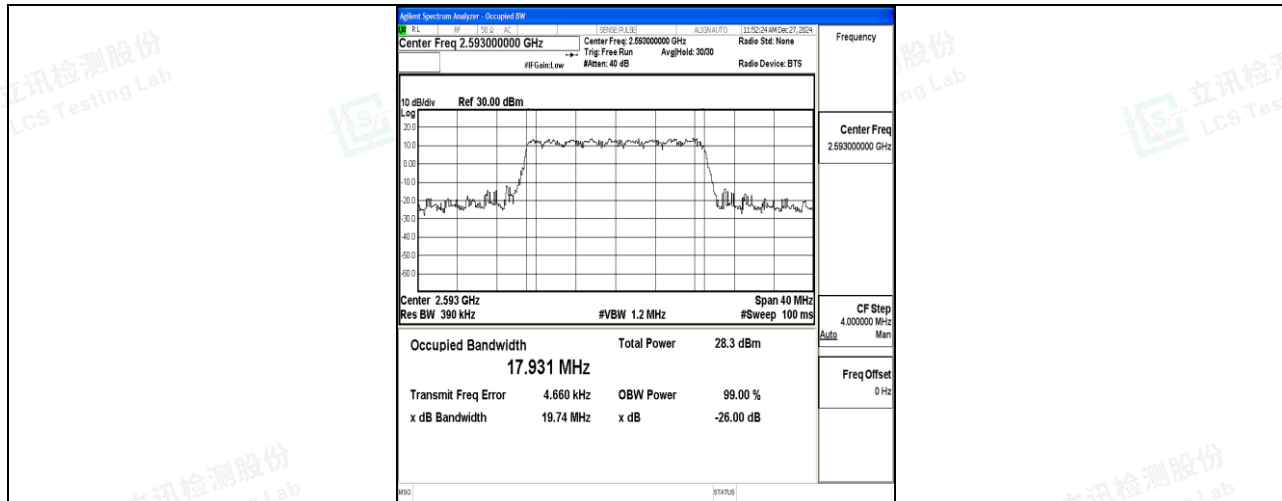

Band41-20MHz-16QAM-40620-100RB#0-PASS

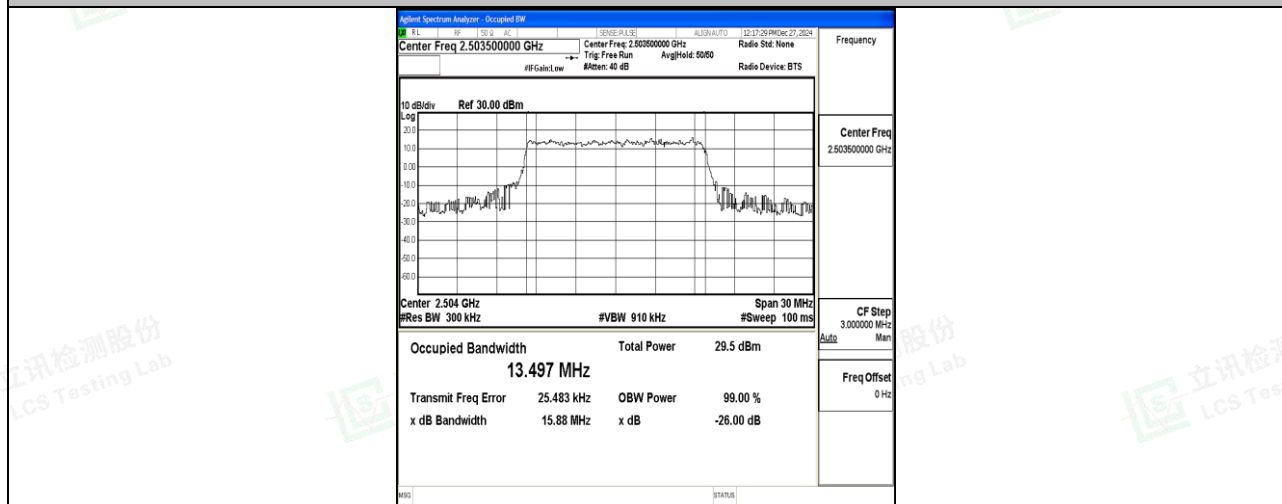

Band41-15MHz-QPSK-39725-75RB#0-PASS

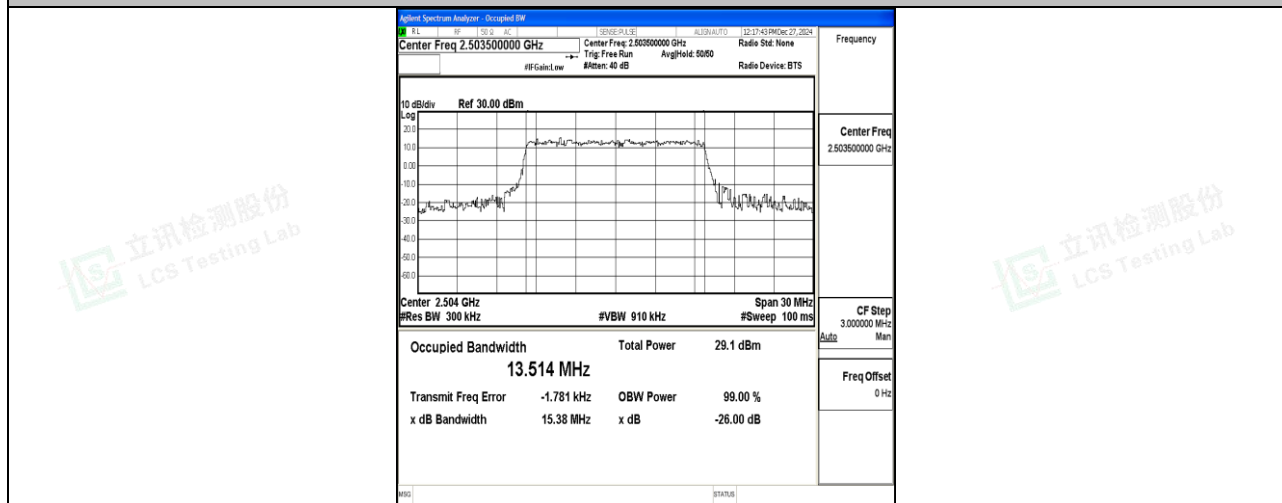

Band41-15MHz-16QAM-39725-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

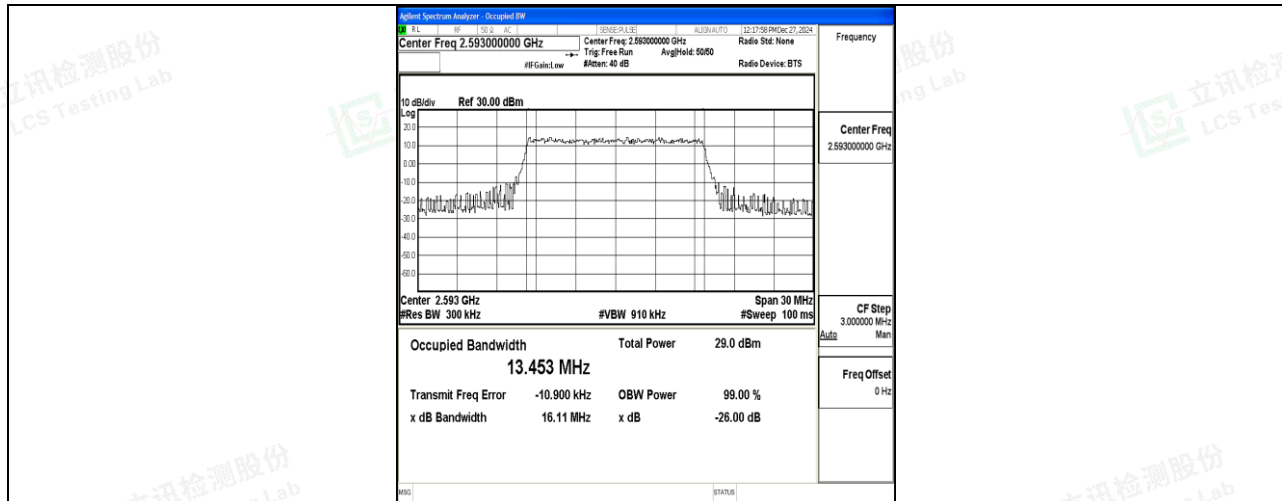

Band41-15MHz-QPSK-40620-75RB#0-PASS

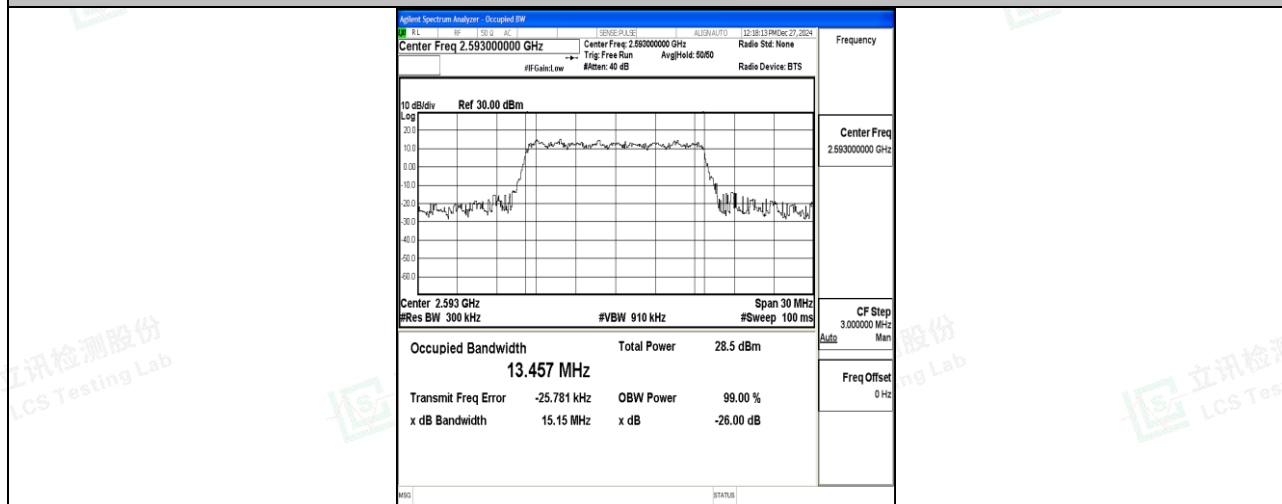

Band41-15MHz-16QAM-40620-75RB#0-PASS

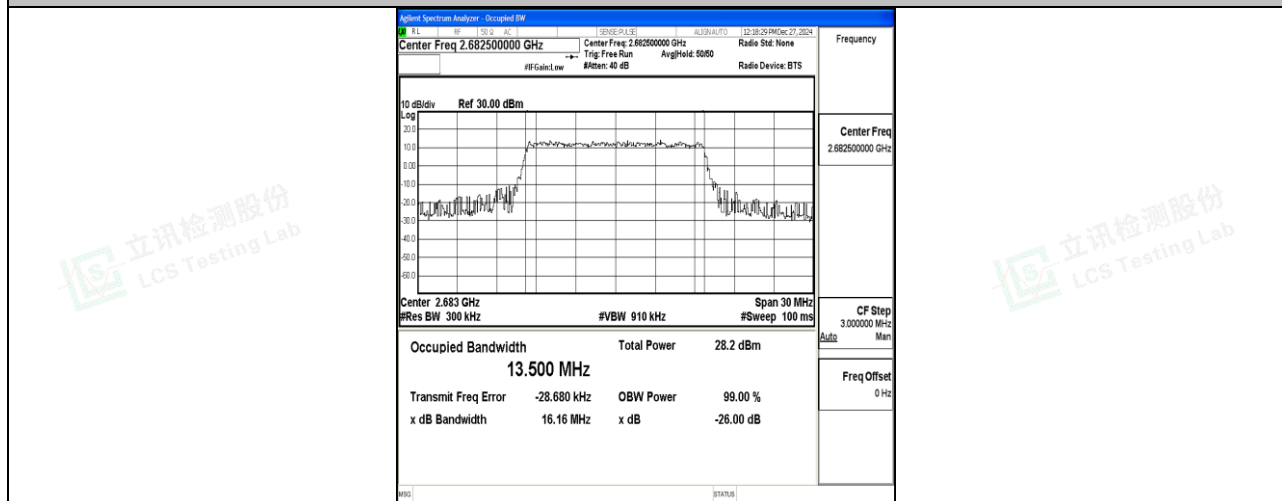

Band41-15MHz-QPSK-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

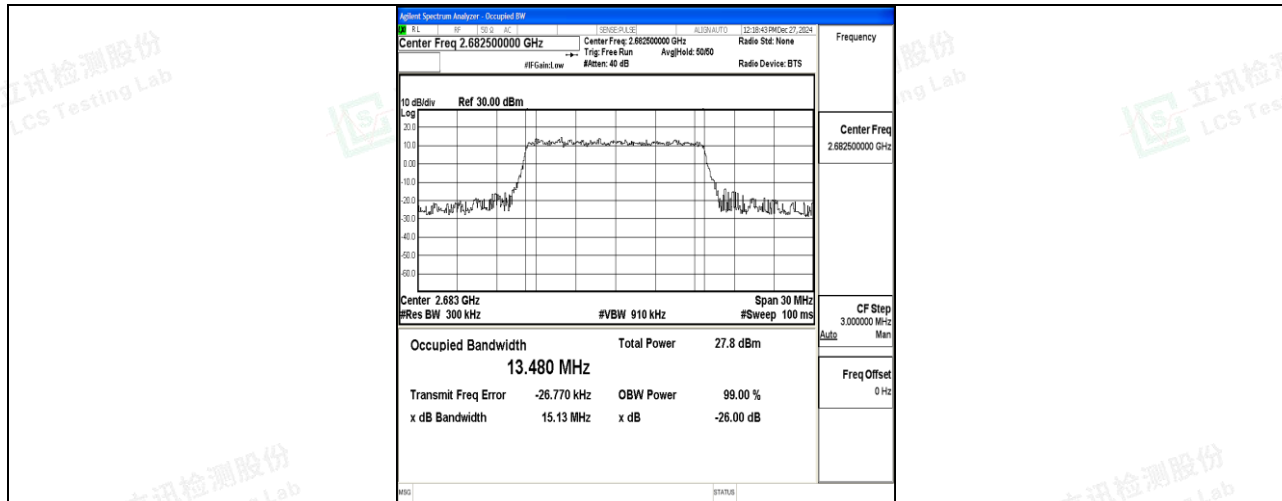

Band41-15MHz-16QAM-41515-75RB#0-PASS

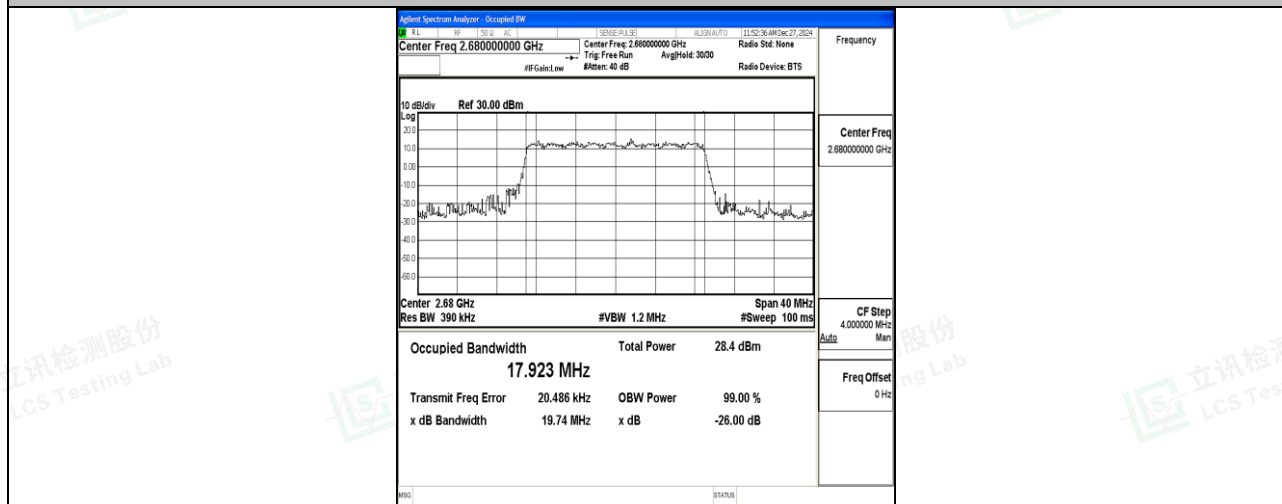

Band41-20MHz-QPSK-41490-100RB#0-PASS

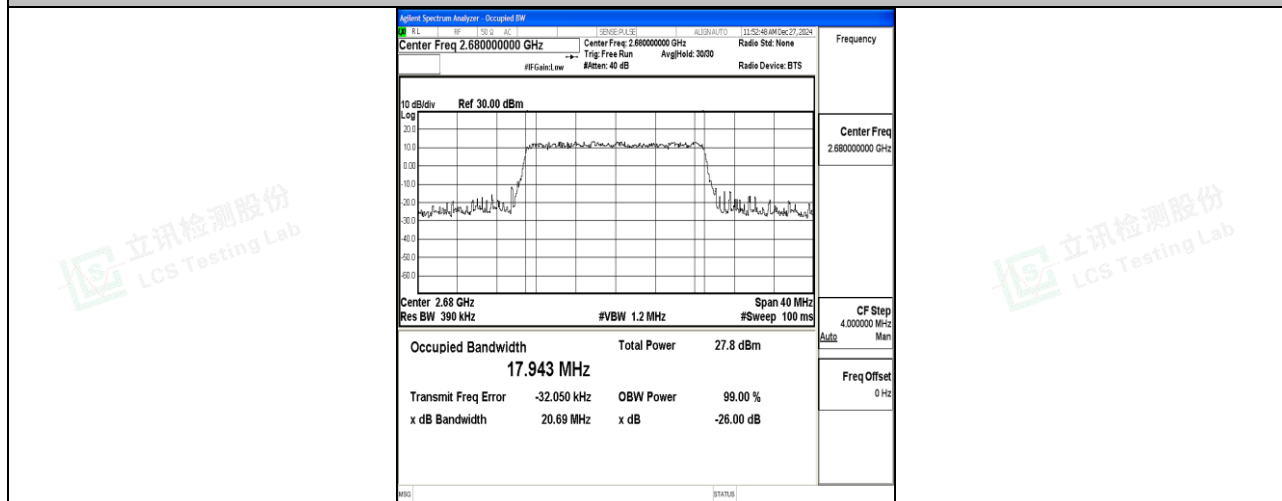

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




R.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.42	-45.06	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.41	-43.79	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.13	-44.80	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.01	-46.15	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-36.67	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.48	-37.34	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.48	-41.23	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.03	-42.19	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.52	-34.30	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.47	-34.05	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.12	-40.03	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.15	-39.96	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.23	-33.36	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.37	-33.71	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.32	-40.15	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.01	-40.78	PASS

Test Graphs

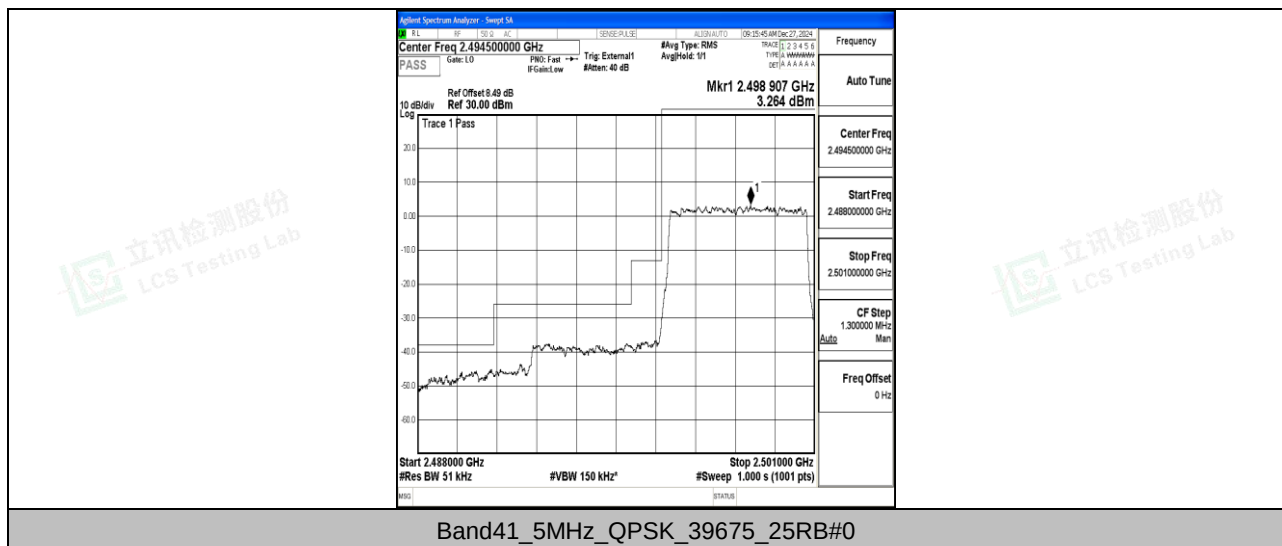

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity









Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



R.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-68.82	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-59.36	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-62.35	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.52	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-35.56	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.75	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-62.63	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-61.98	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.60	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.28	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-65.63	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-61.18	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-62.59	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-33.66	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-34.98	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-68.46	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-60.19	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-62.40	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.66	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.87	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-66.16	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-62.83	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.27	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-33.76	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.79	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-67.54	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-61.75	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-62.11	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.18	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.58	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-68.12	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-60.59	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-61.75	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.63	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.42	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-66.48	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-61.52	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-62.42	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.54	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.32	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-66.65	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-60.23	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.17	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-62.38	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.46	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.64	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-66.44	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-60.88	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.38	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.43	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.34	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-69.34	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-60.62	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.23	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.20	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.14	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-67.69	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-61.30	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.08	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.44	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.44	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-68.57	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-60.62	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-62.28	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.45	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.83	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-70.16	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-59.52	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-61.95	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.20	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.61	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-66.59	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-61.78	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.30	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.55	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.49	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-67.73	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-58.44	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.30	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.30	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.35	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-65.94	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-58.25	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.13	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.65	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.75	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-68.49	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-59.09	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-61.94	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.84	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.51	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-67.91	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-61.36	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.19	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.03	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.69	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-67.37	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-60.09	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.25	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-33.50	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.57	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.83	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-62.28	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.32	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.39	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.72	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-61.02	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-61.99	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.32	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.59	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.45	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.74	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-68.62	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-60.44	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-62.33	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-33.52	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.07	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.64	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-67.16	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-59.25	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

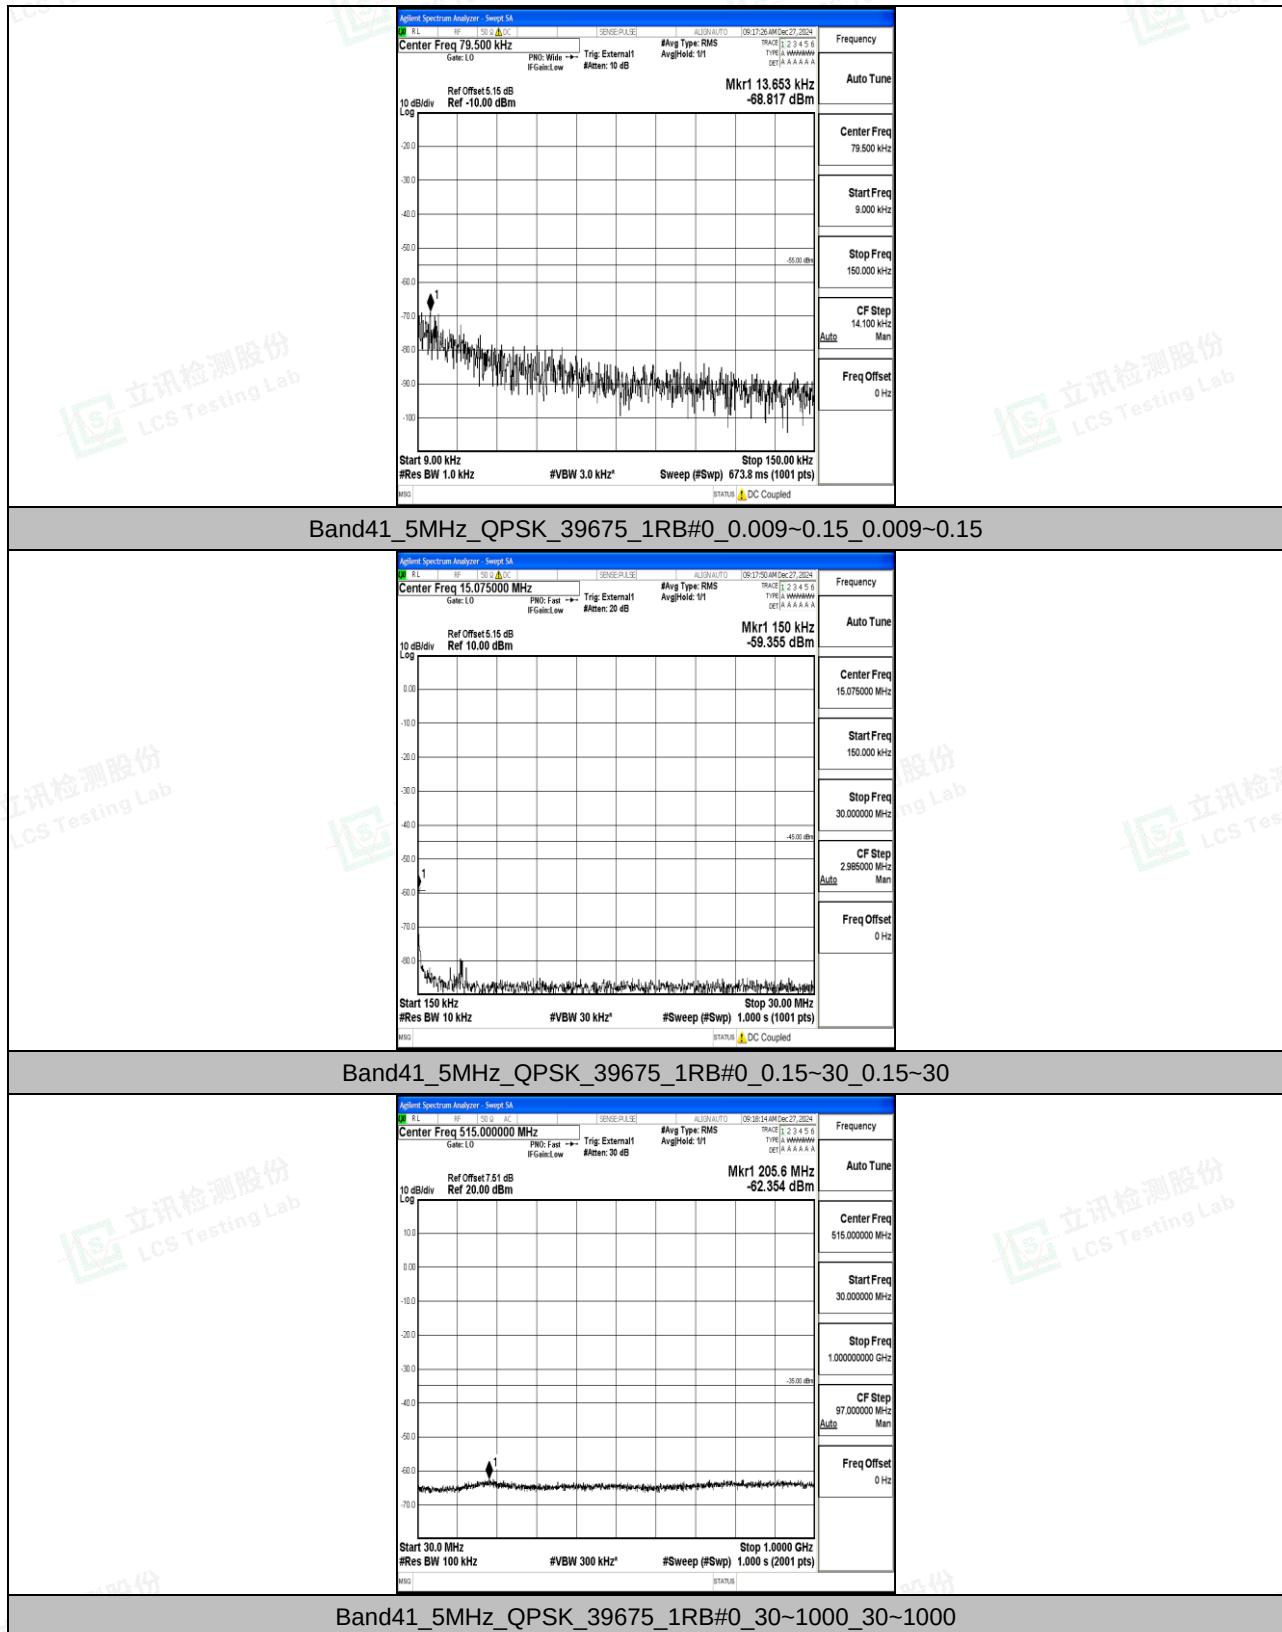


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

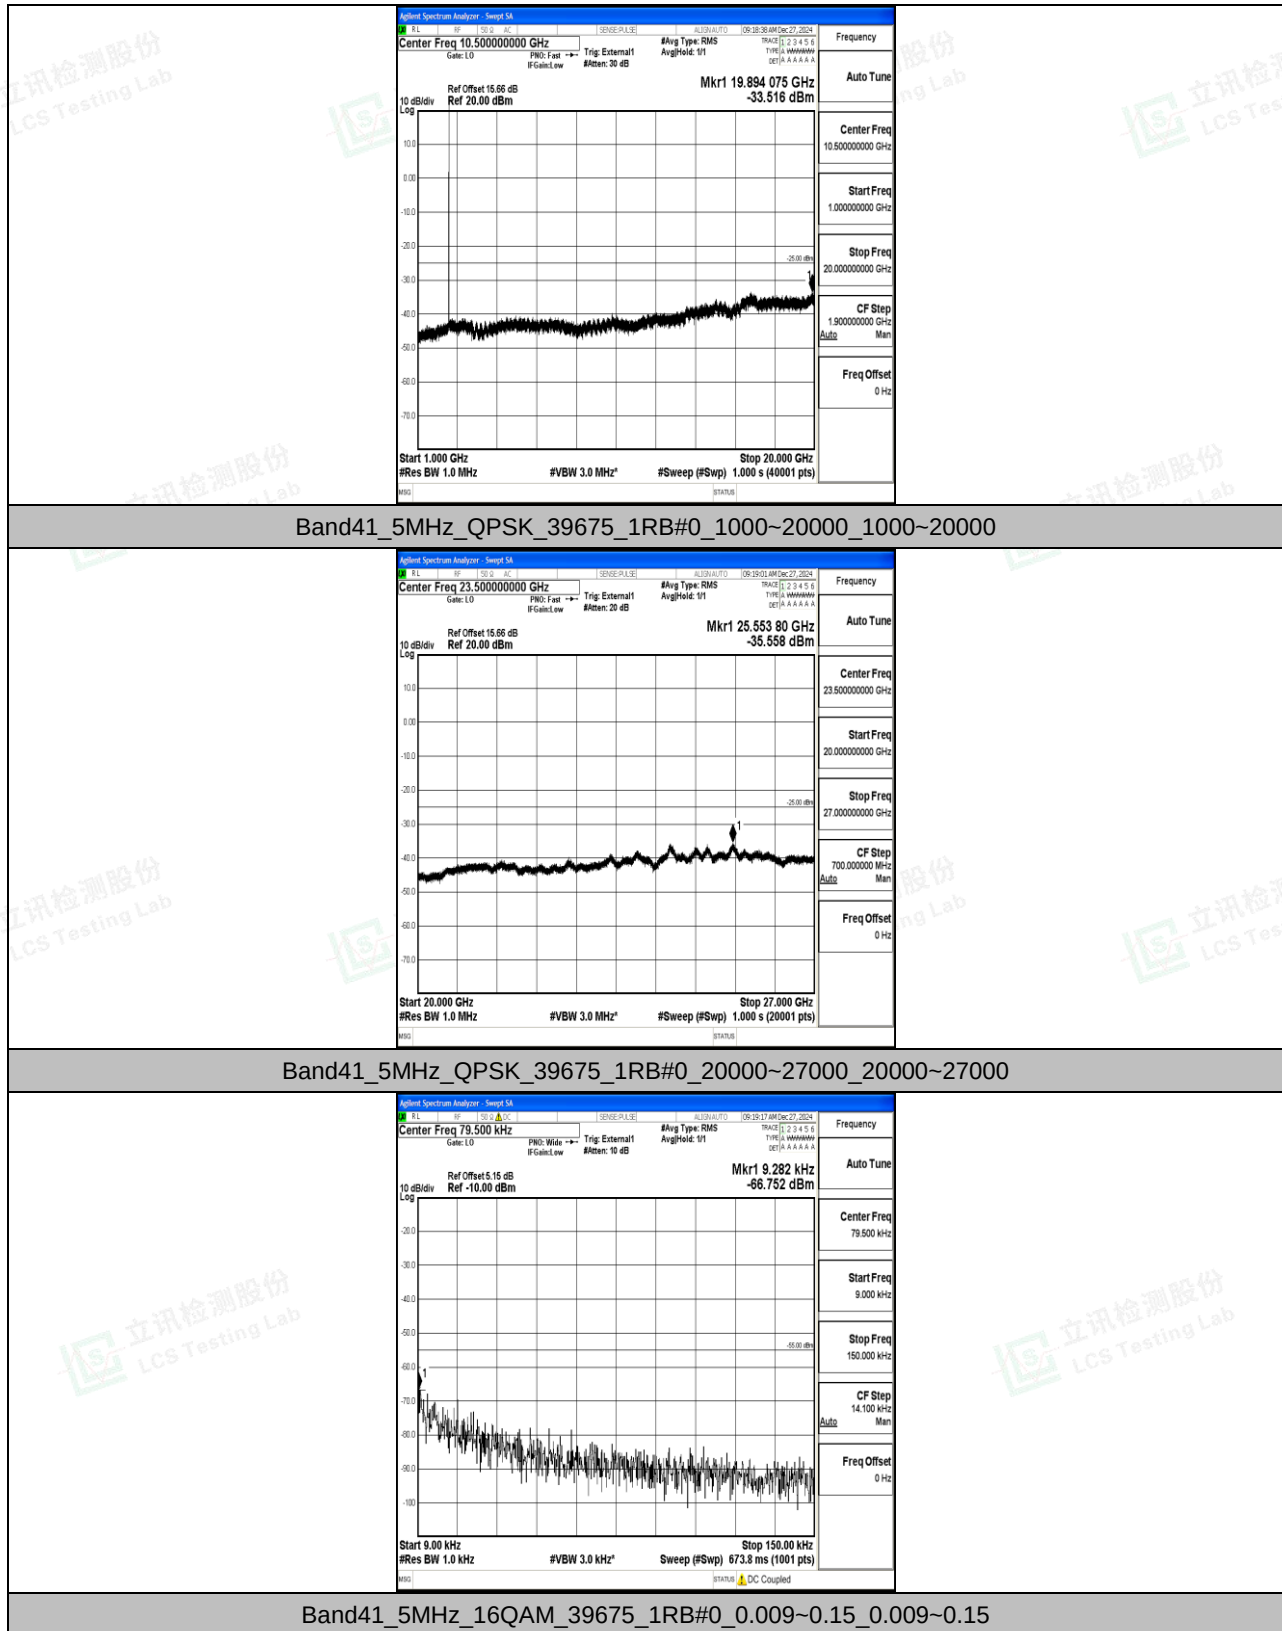


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

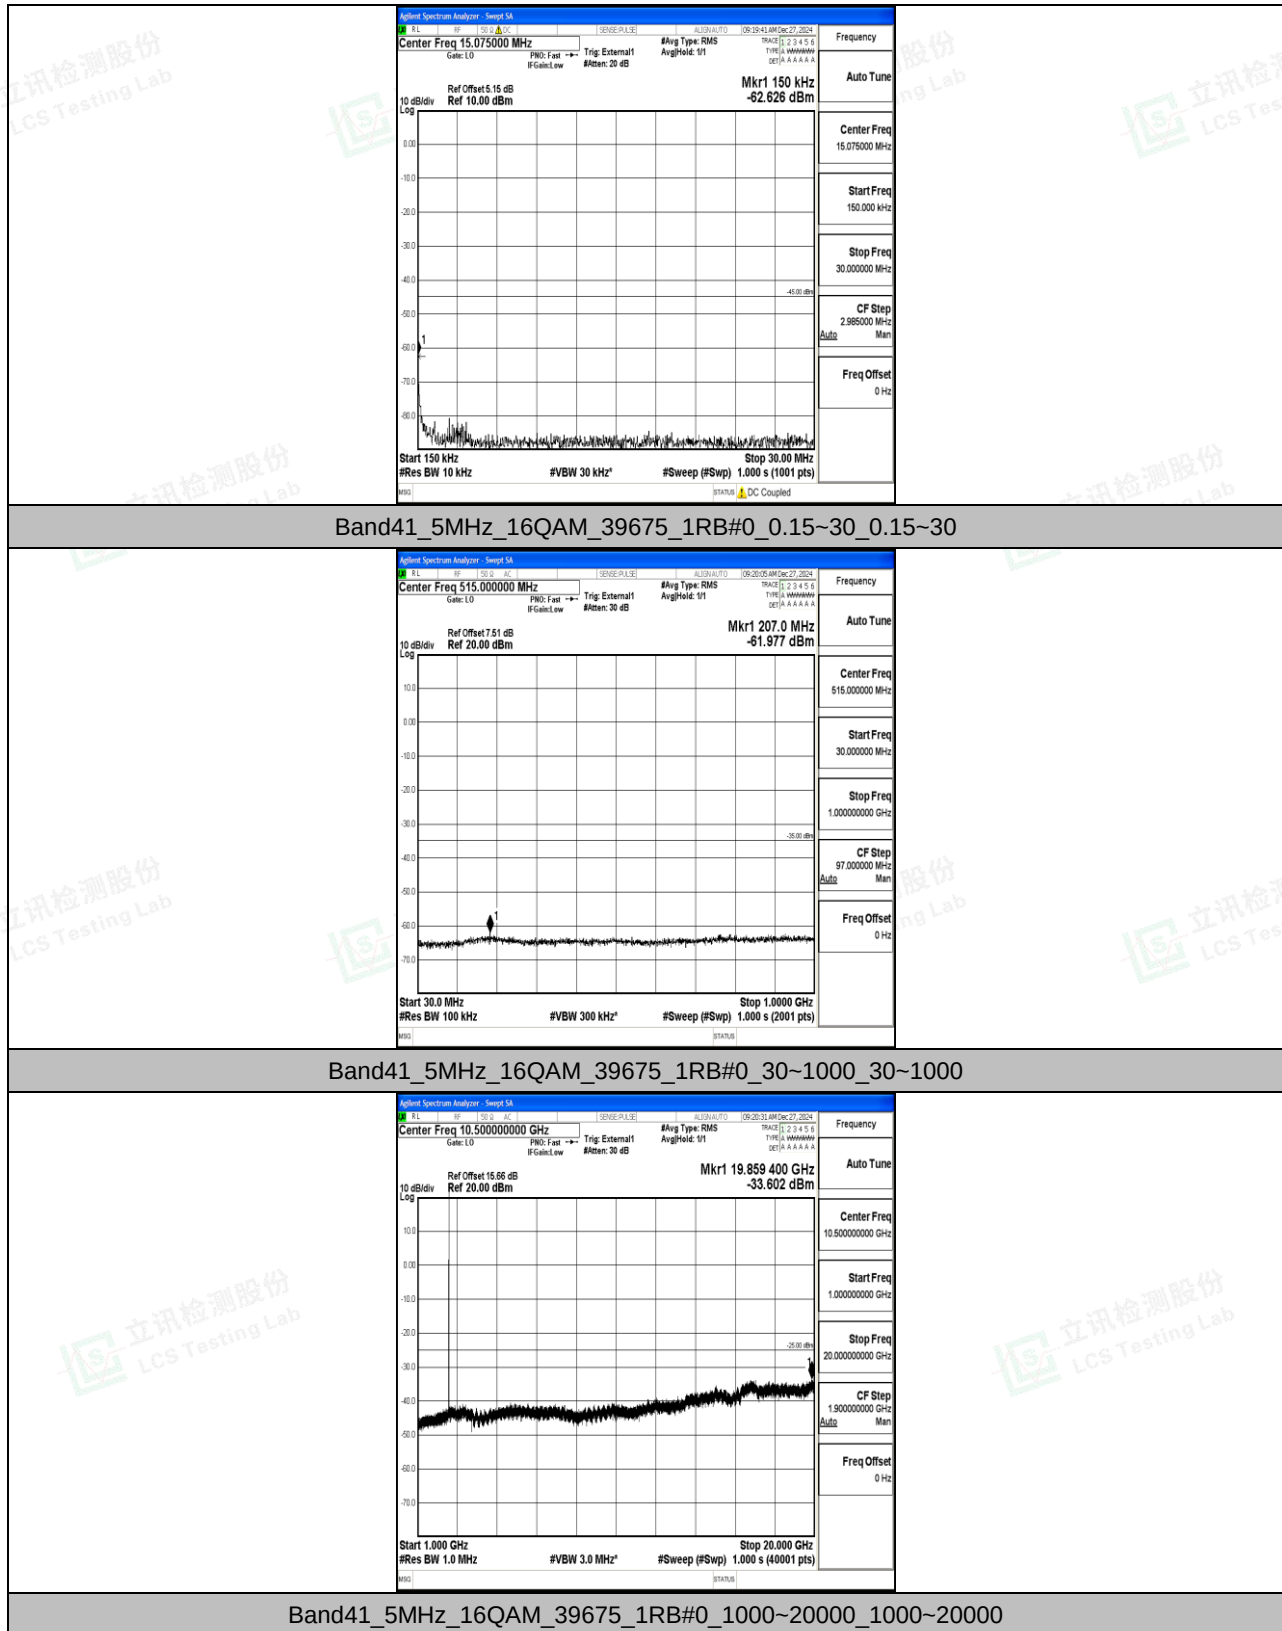


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

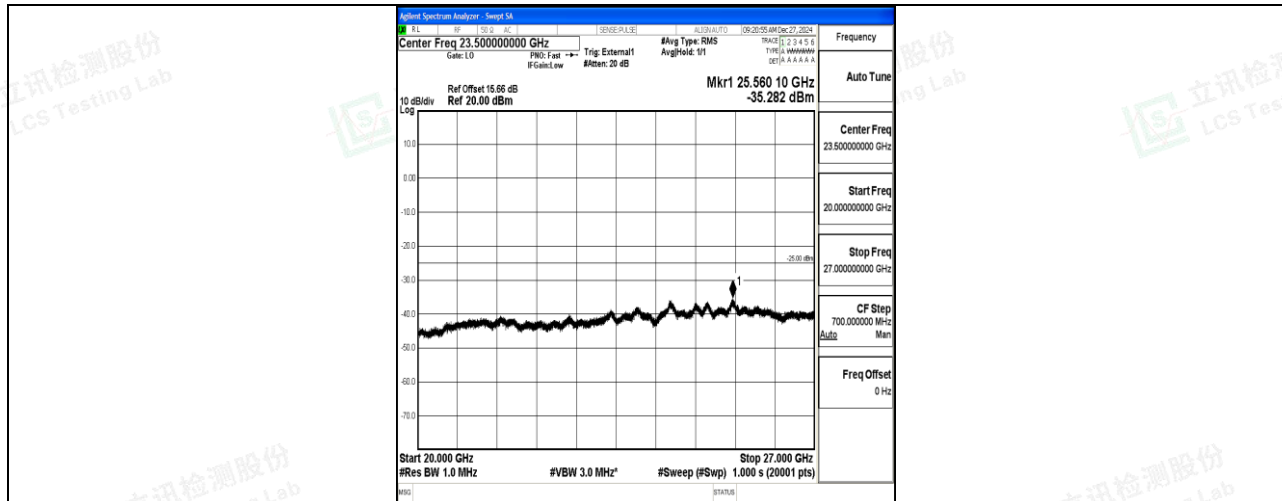

Band41_5MHz_16QAM_39675_1RB#0_20000~27000_20000~27000

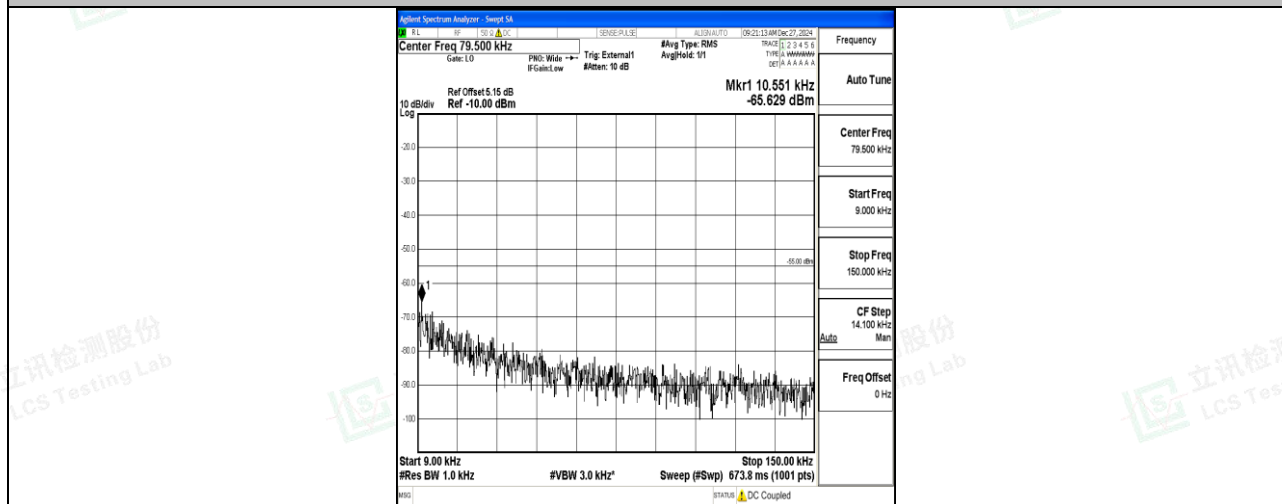

Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

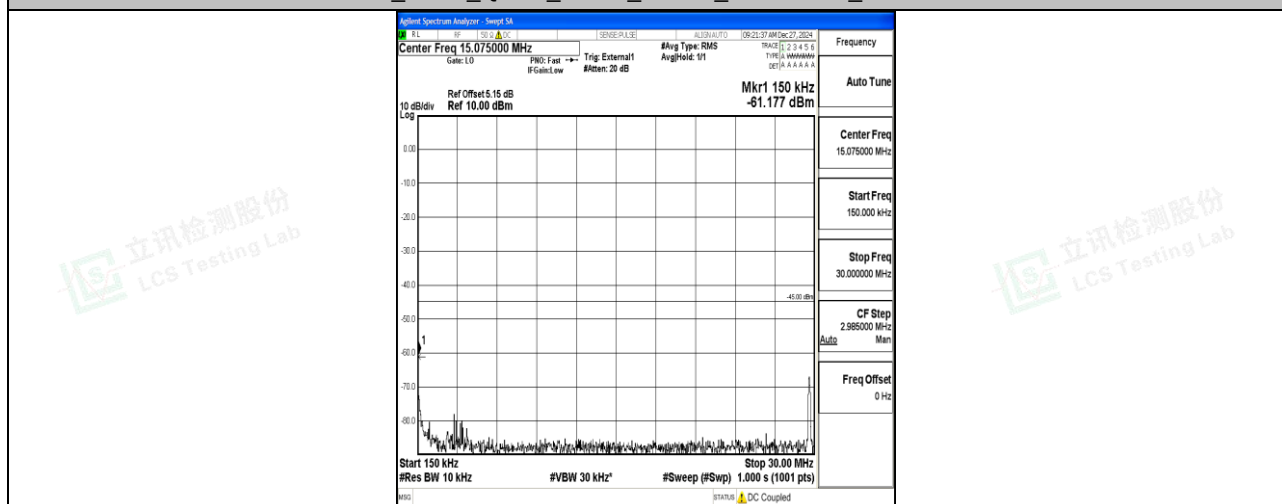

Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

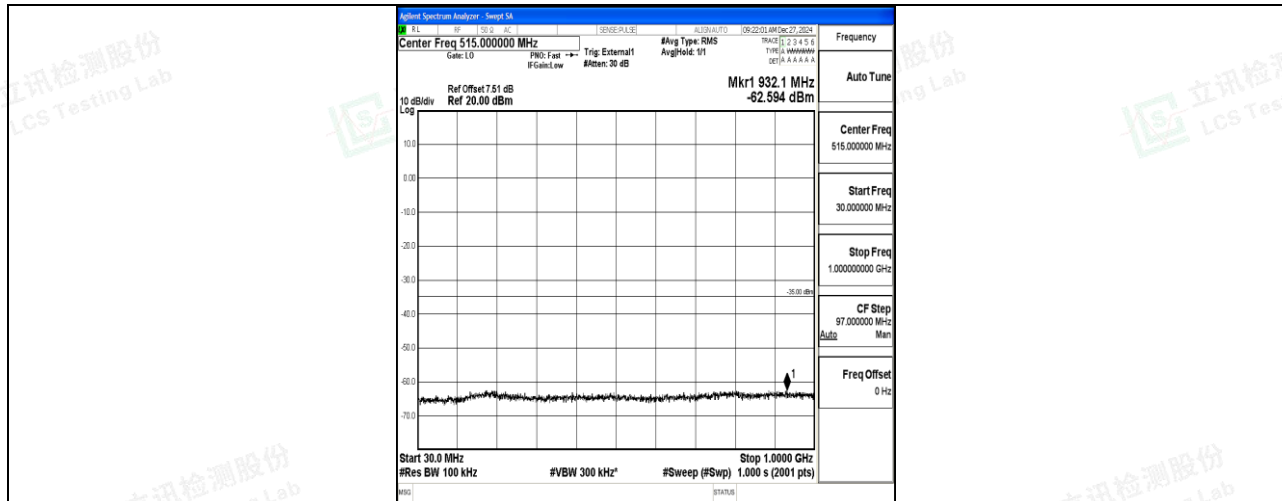

Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

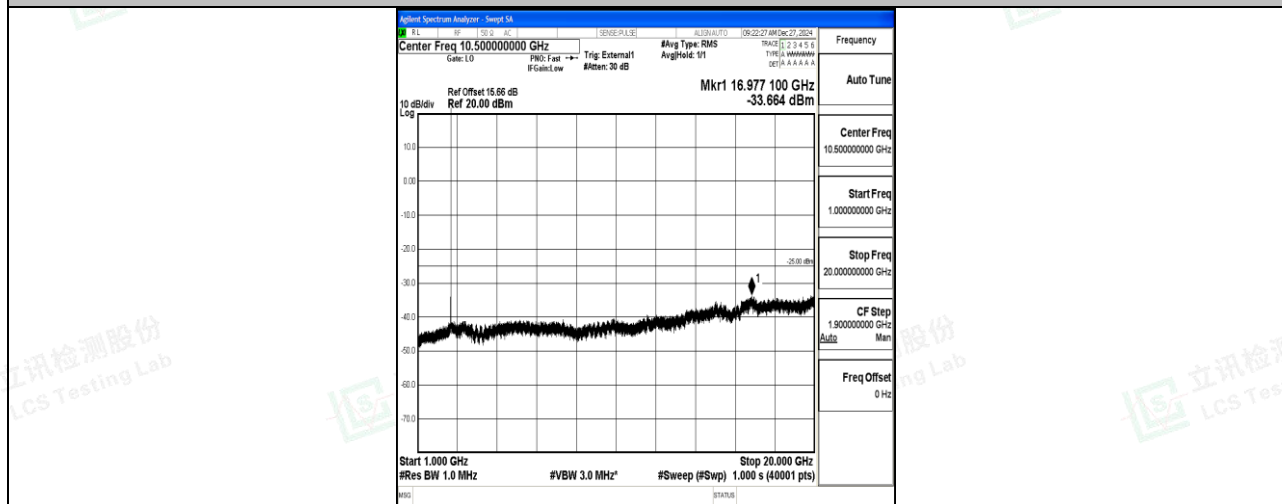

Band41_5MHz_QPSK_40620_1RB#0_1000~20000_1000~20000

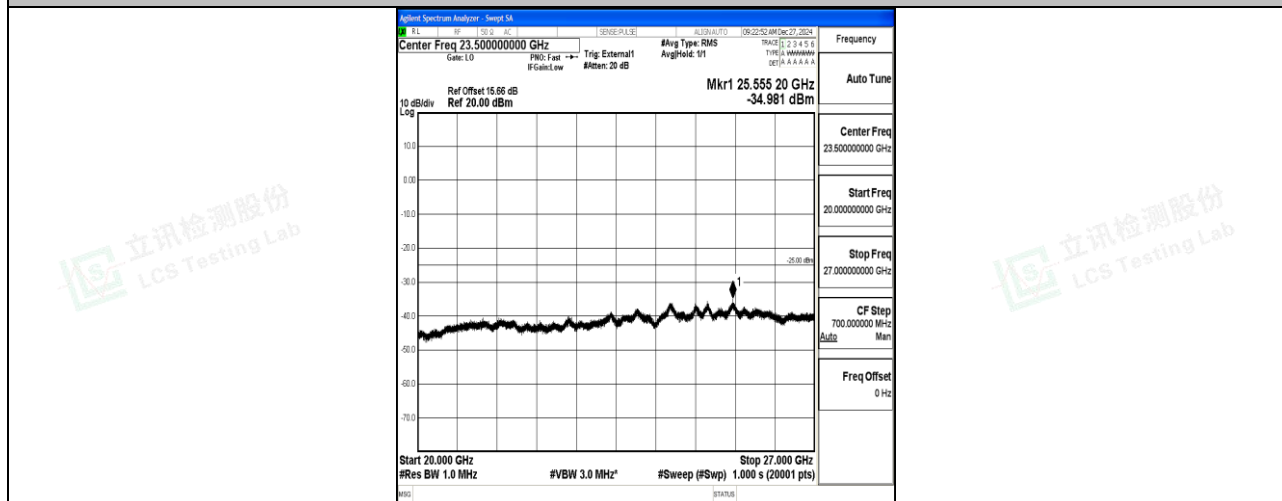

Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity