





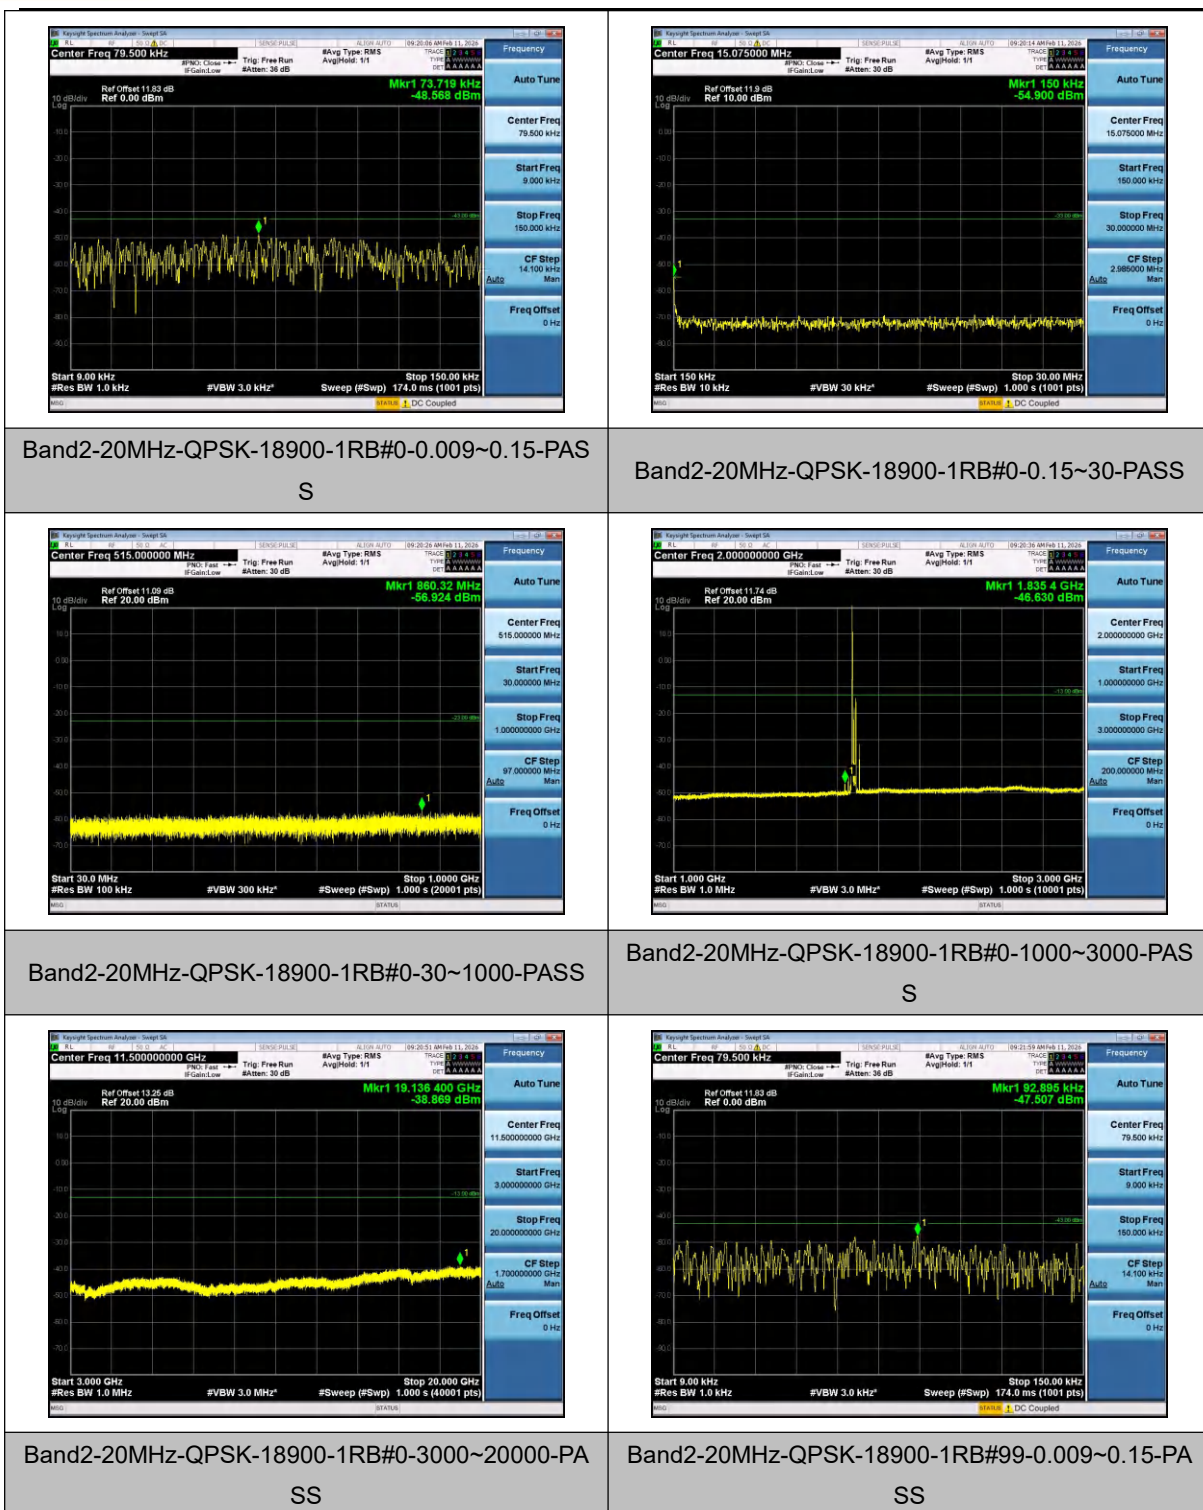


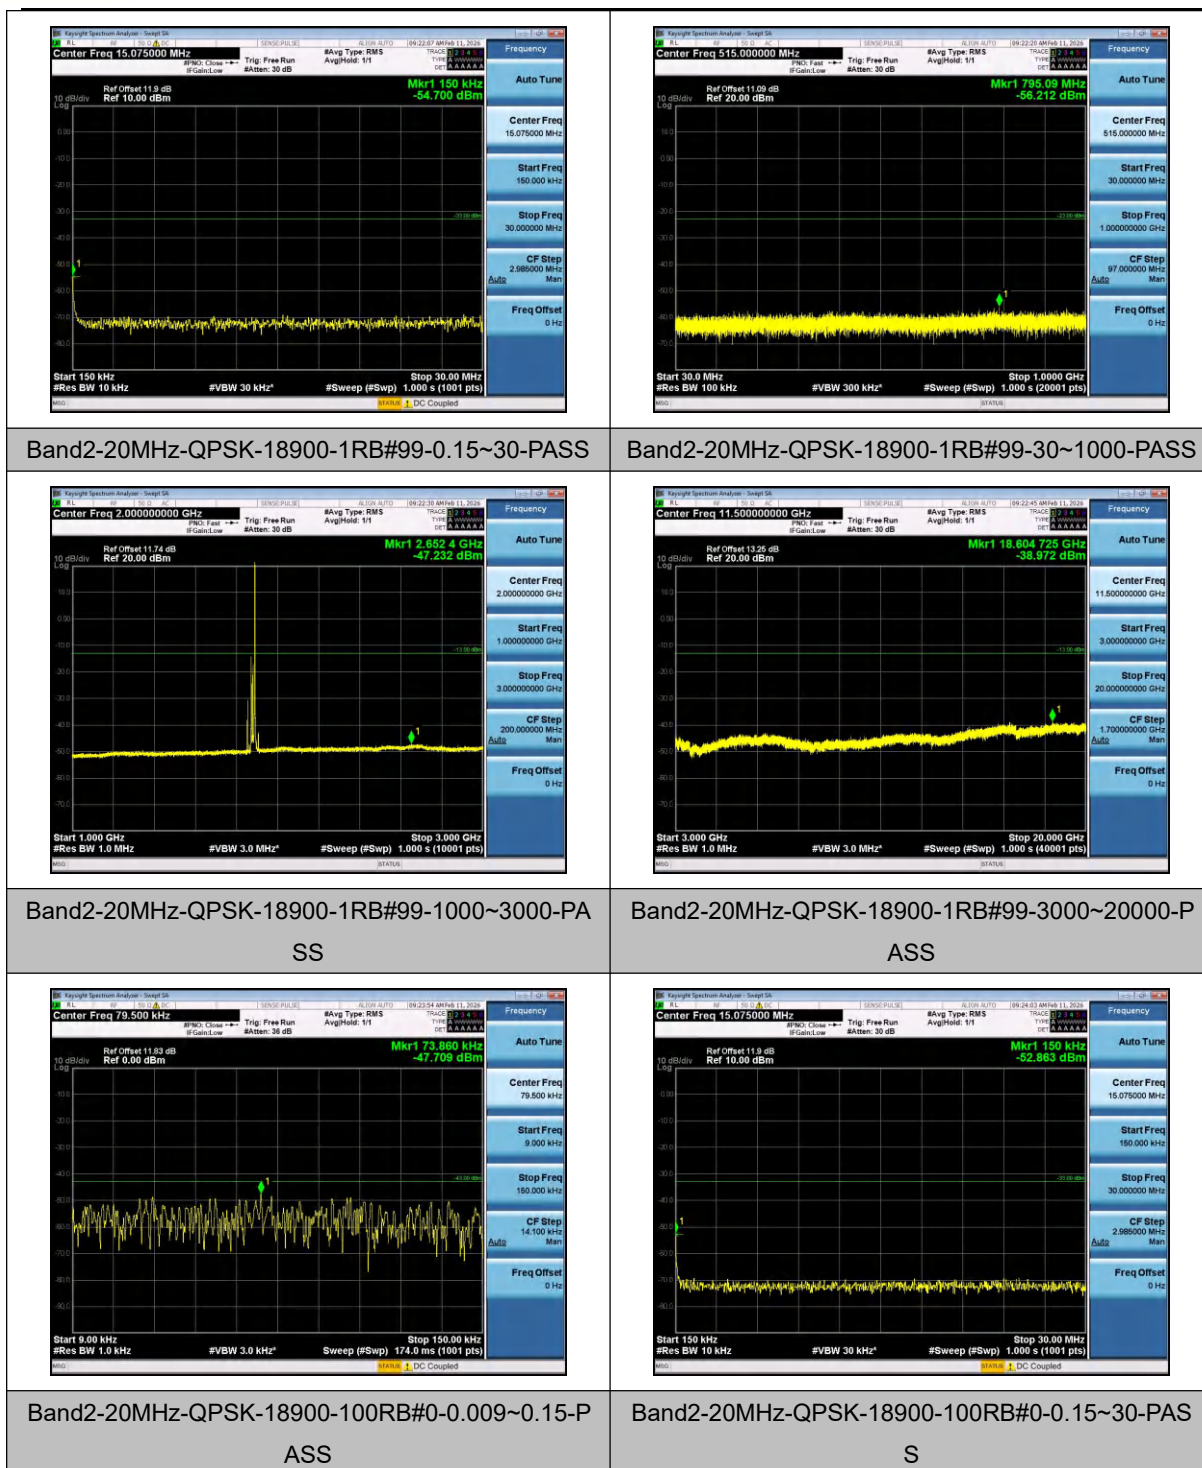


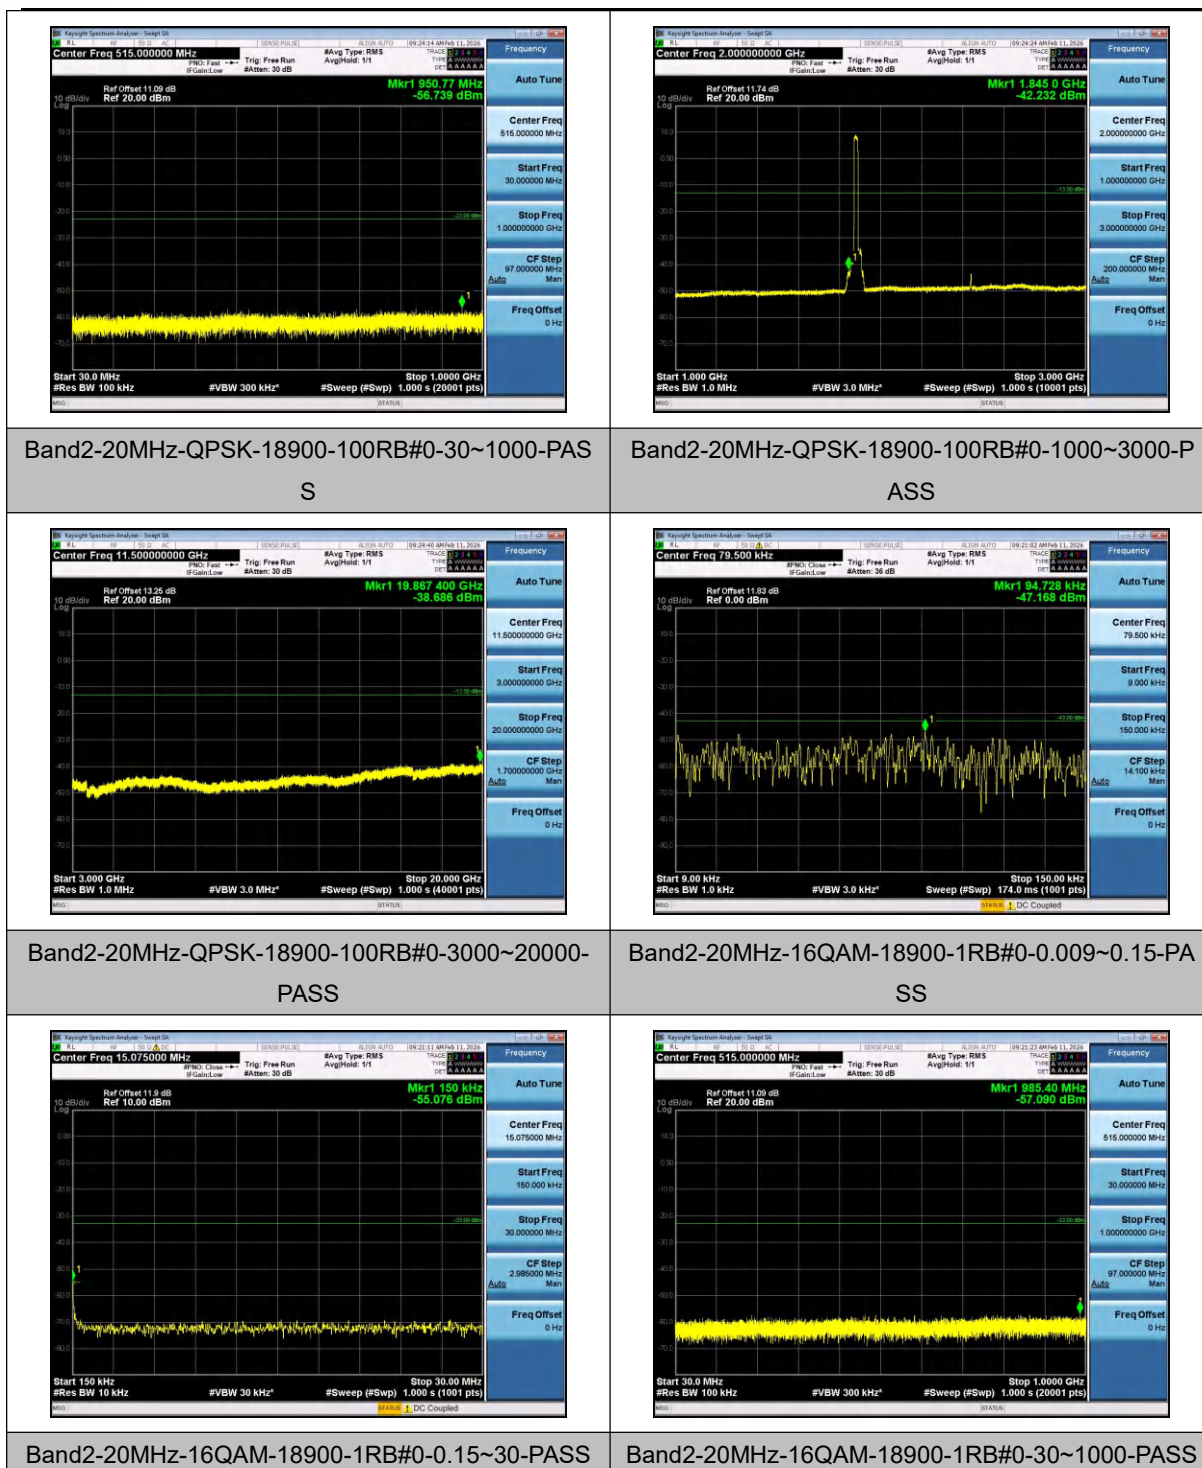


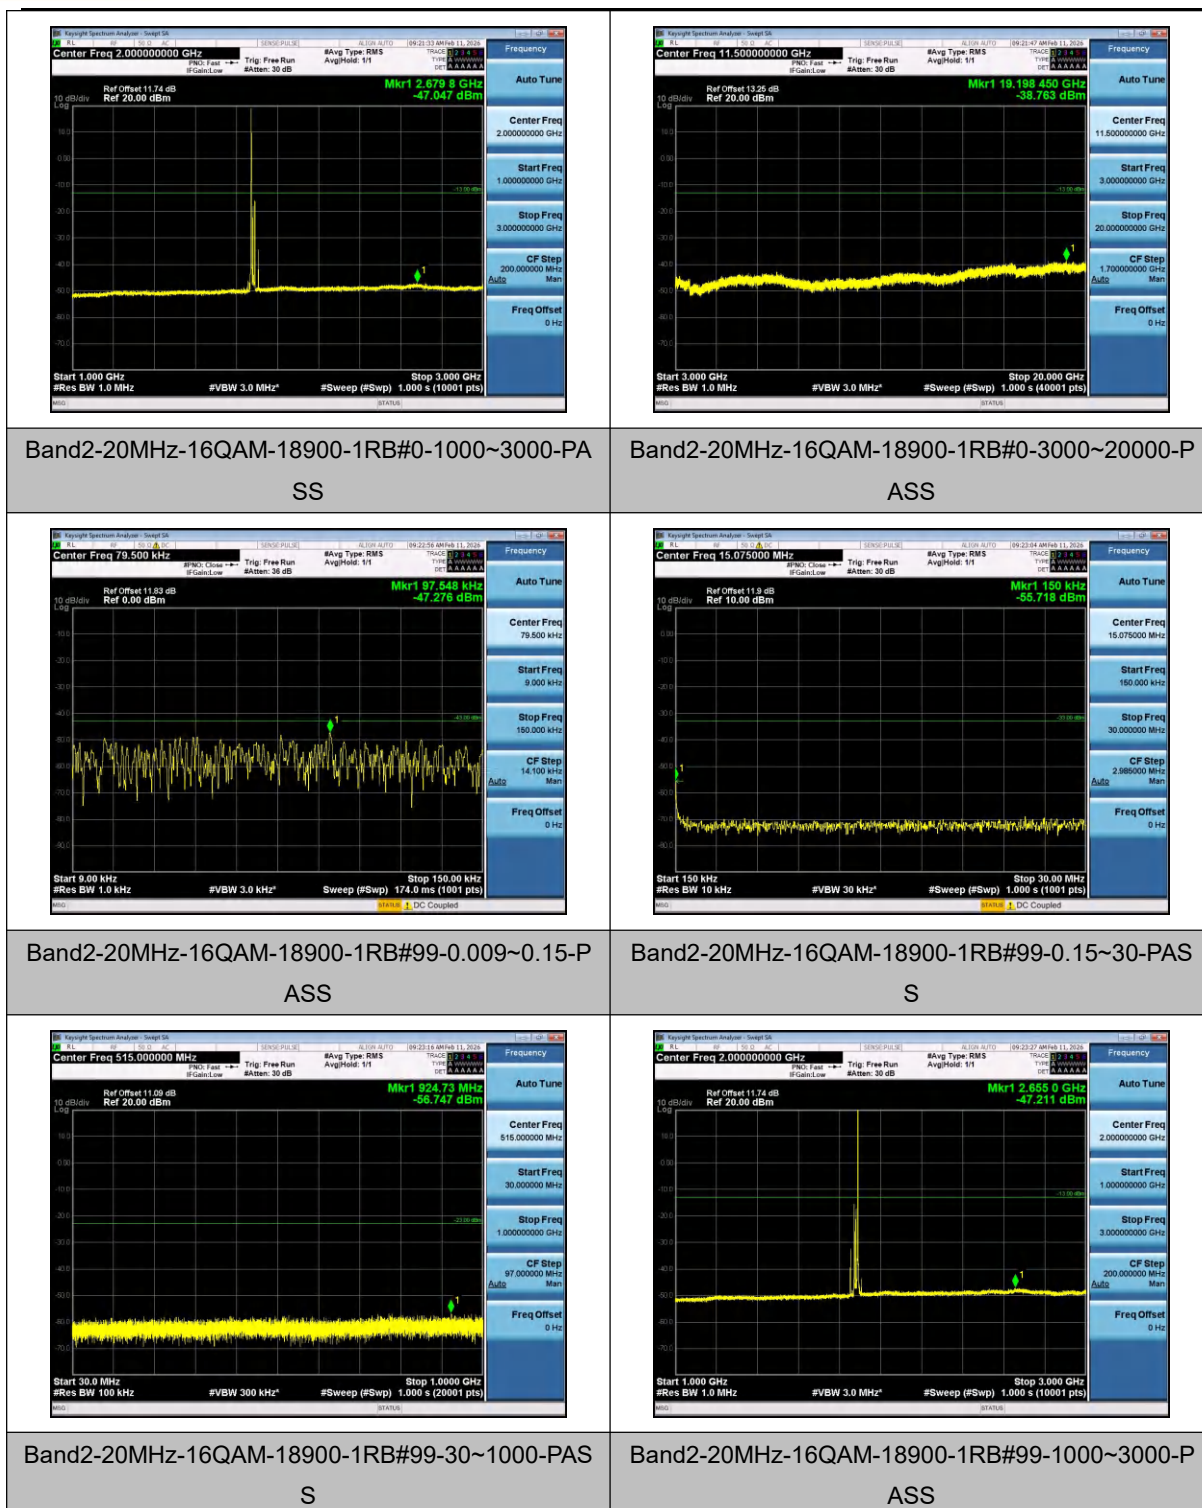


Band2-20MHz-16QAM-18900-1RB#99-3000~20000- PASS	Band2-20MHz-16QAM-18900-100RB#0-0.009~0.15- PASS
Band2-20MHz-16QAM-18900-100RB#0-0.15~30-PA- SS	Band2-20MHz-16QAM-18900-100RB#0-30~1000-PA- SS
Band2-20MHz-16QAM-18900-100RB#0-1000~3000- PASS	Band2-20MHz-16QAM-18900-100RB#0-3000~20000- -PASS

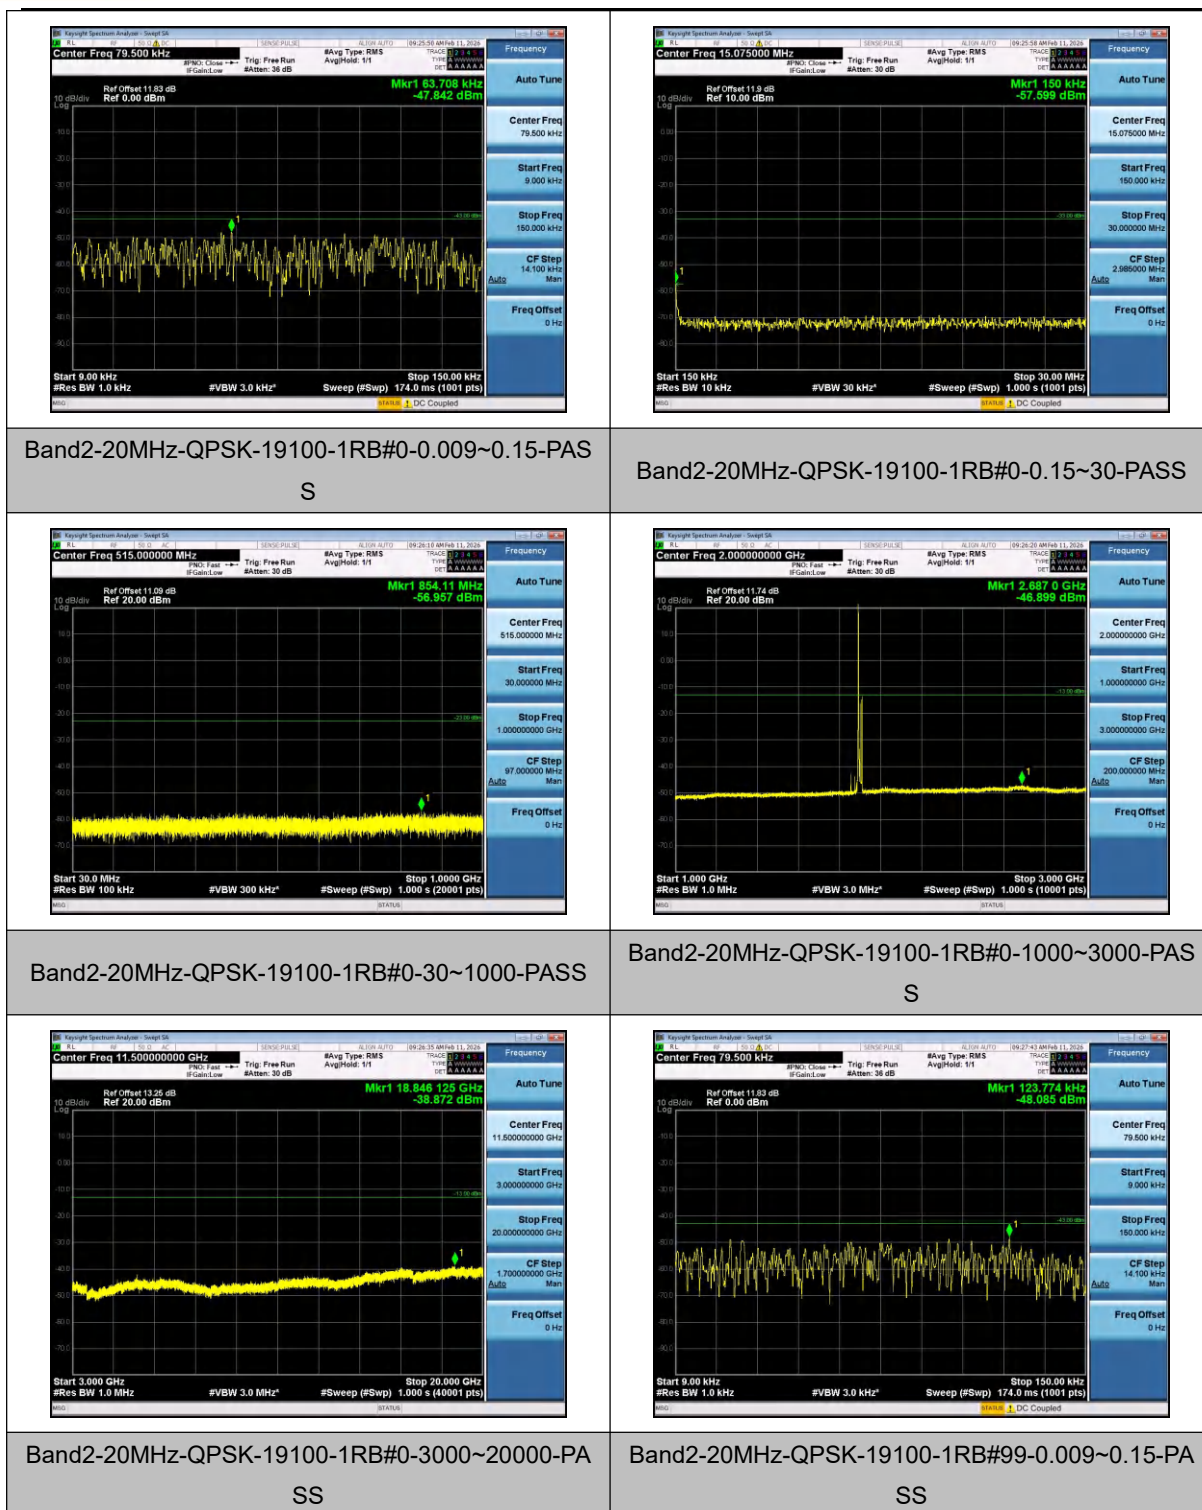


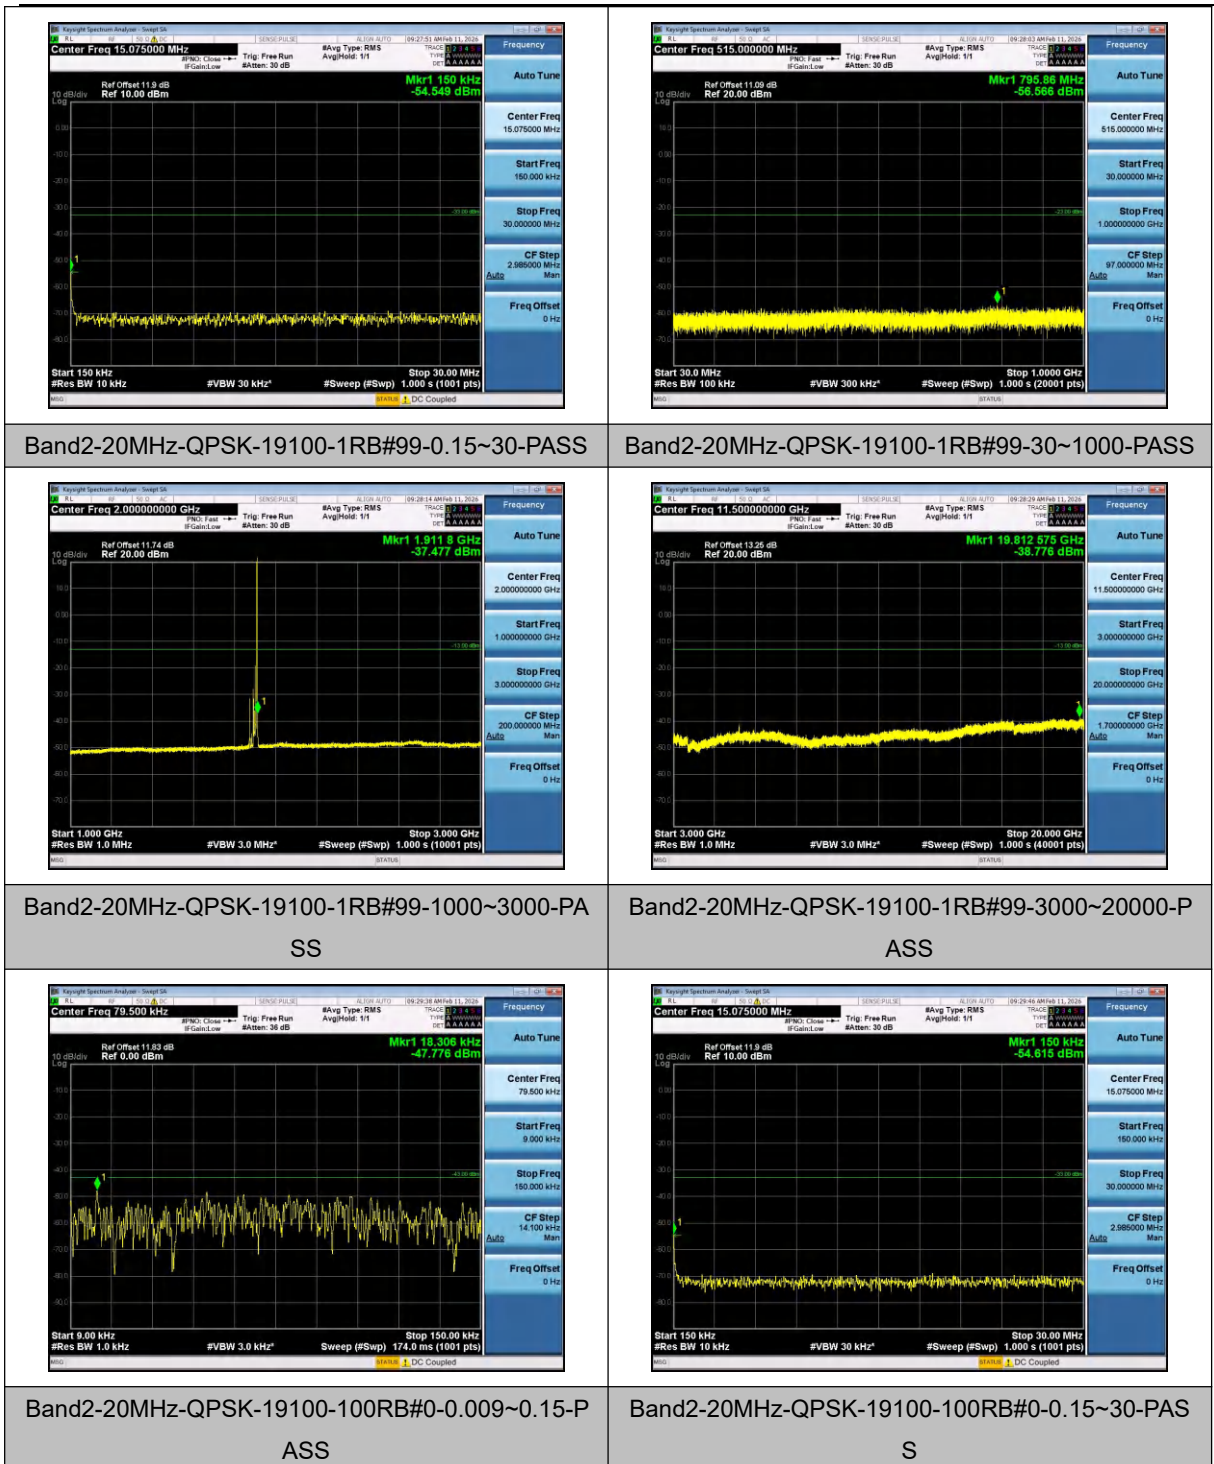

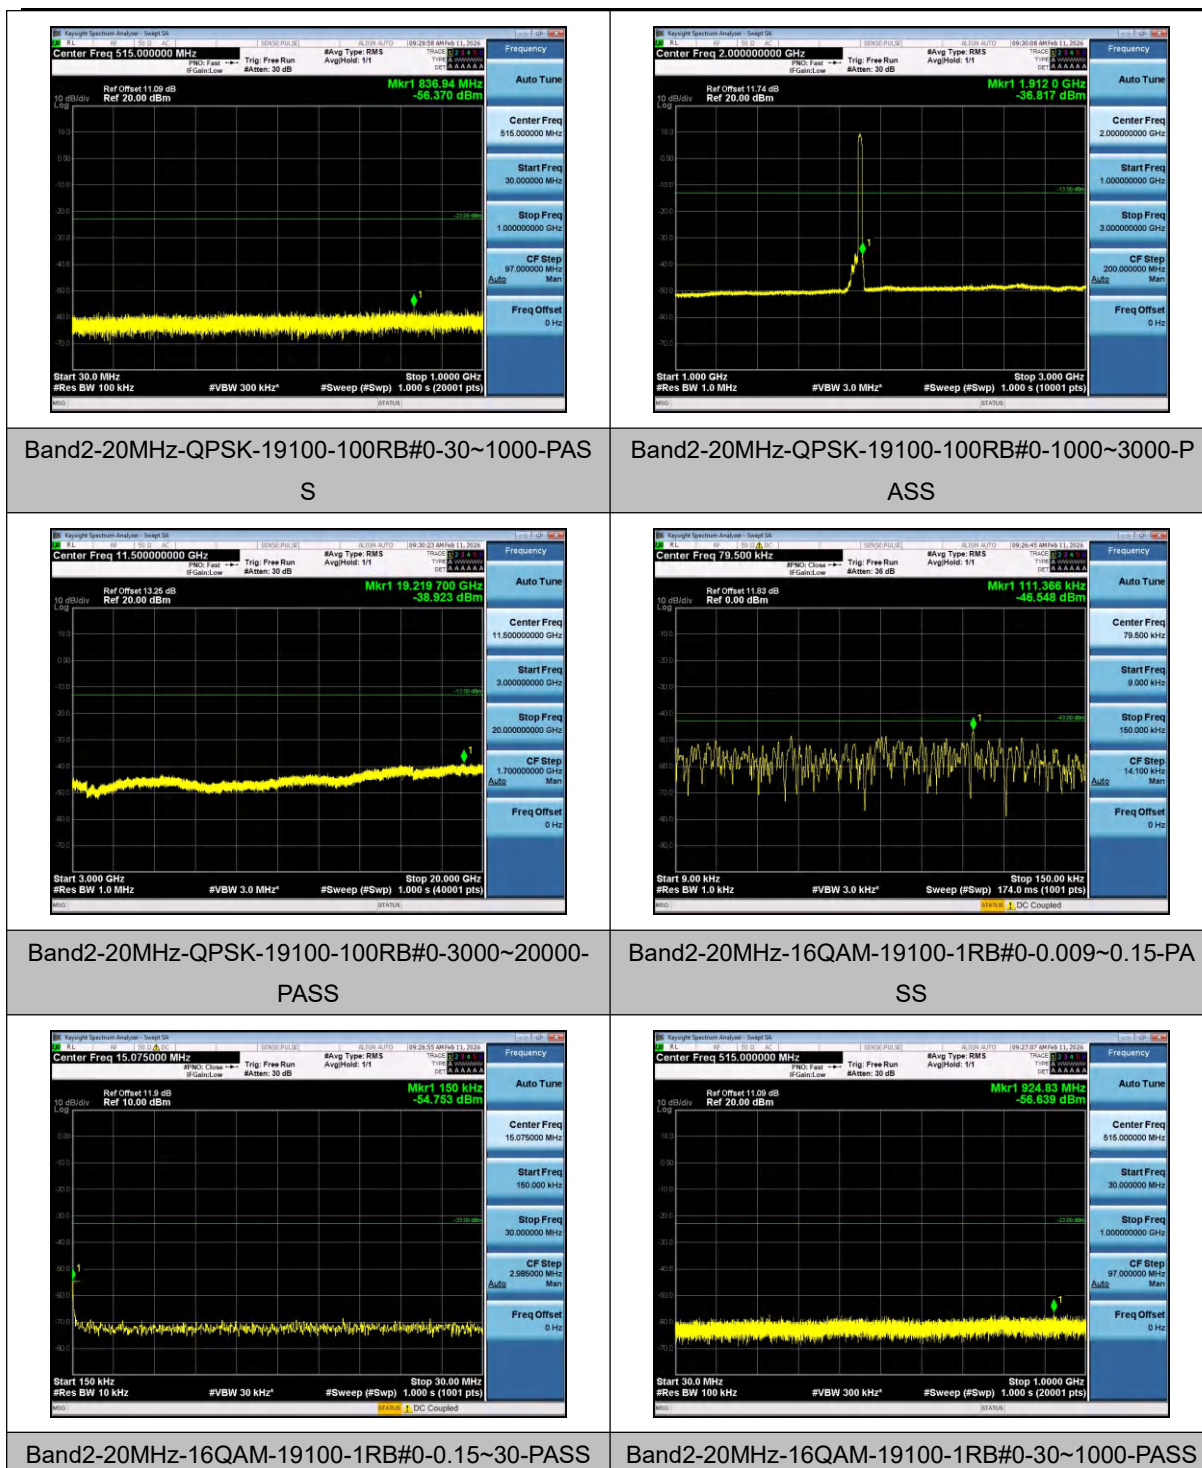


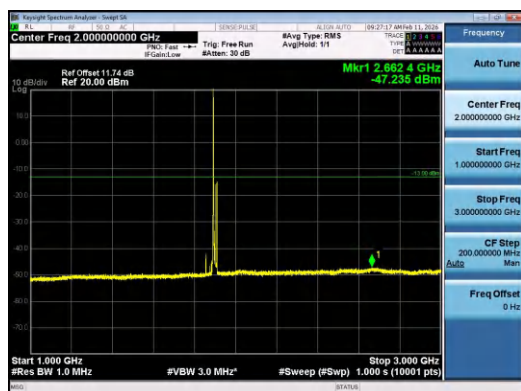


Band2-20MHz-16QAM-19100-1RB#0-1000~3000-PA
SS

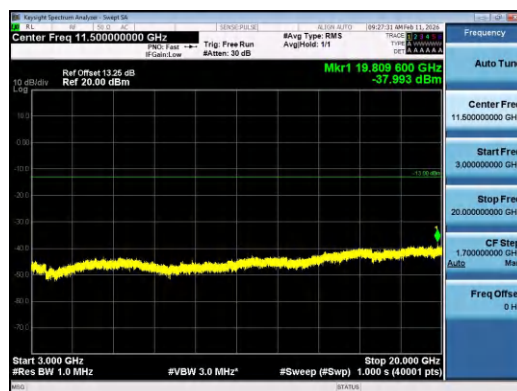


Band2-20MHz-16QAM-19100-1RB#0-3000~20000-P
ASS

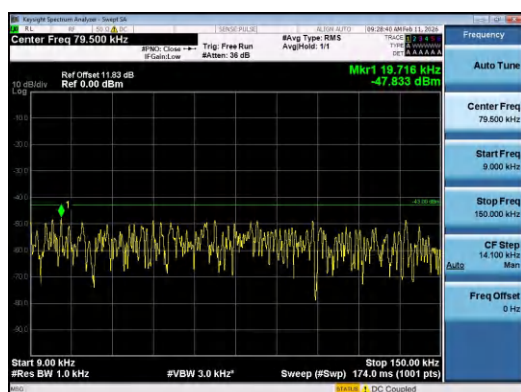


Band2-20MHz-16QAM-19100-1RB#99-0.009~0.15-P
ASS

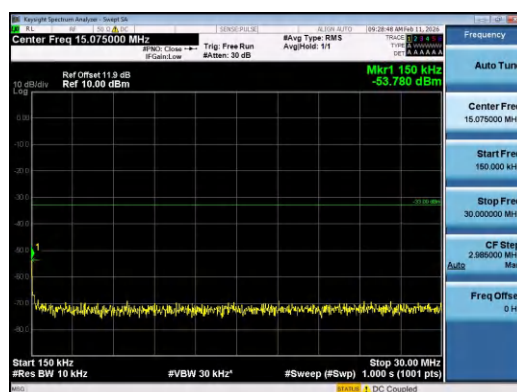

Band2-20MHz-16QAM-19100-1RB#99-0.15~30-PAS
S

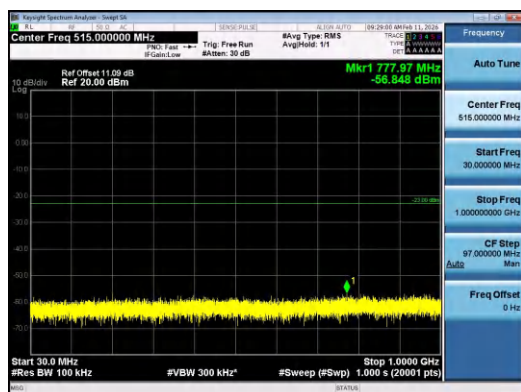

Band2-20MHz-16QAM-19100-1RB#99-30~1000-PAS
S

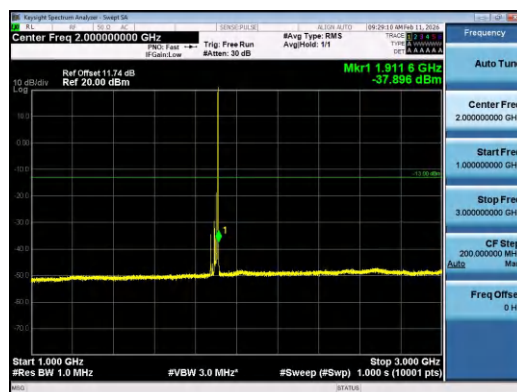

Band2-20MHz-16QAM-19100-1RB#99-1000~3000-P
ASS

Band2-20MHz-16QAM-19100-1RB#99-3000~20000- PASS	Band2-20MHz-16QAM-19100-100RB#0-0.009~0.15- PASS
Band2-20MHz-16QAM-19100-100RB#0-0.15~30-PA- SS	Band2-20MHz-16QAM-19100-100RB#0-30~1000-PA- SS
Band2-20MHz-16QAM-19100-100RB#0-1000~3000- PASS	Band2-20MHz-16QAM-19100-100RB#0-3000~20000- -PASS

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	1850.15913	1851.23543	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	1850.15823	1851.23733	1850-1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	1850.15771	1851.23711	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	1850.15573	1851.23863	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	1850.1552	1851.2365	1850-1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	1850.15659	1851.23759	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	1879.45612	1880.53652	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	1879.45676	1880.53636	1850-1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	1879.4586	1880.5382	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	1879.45667	1880.53757	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	1879.45503	1880.53863	1850-1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	1879.45646	1880.53686	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	1908.75812	1909.83992	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	1908.75713	1909.83883	1850-1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	1908.7583	1909.8401	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	1908.75814	1909.83714	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	1908.75863	1909.83703	1850-1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	1908.75913	1909.83583	1850-1910	PASS

Band2	3MHz	QPSK	18615	15RB#0	VN	NT	1850.15 824	1852.84 044	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	1850.15 746	1852.84 206	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	1850.16 094	1852.84 654	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	1850.16 224	1852.83 914	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	1850.15 824	1852.83 644	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	1850.15 841	1852.83 961	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	1878.65 936	1881.33 836	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	1878.65 704	1881.33 964	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	1878.65 779	1881.34 249	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	1878.65 888	1881.33 858	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	1878.65 722	1881.34 172	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	1878.65 971	1881.33 861	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	1907.15 478	1909.84 048	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	1907.15 646	1909.83 846	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	1907.15 462	1909.84 232	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	1907.15 394	1909.83 754	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	1907.15 638	1909.83 868	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1907.15 414	1909.83 564	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	1850.26 043	1854.73 283	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	1850.26 393	1854.73 813	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	1850.26 216	1854.73 716	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	VN	NT	1850.26 128	1854.74 798	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	1850.26 218	1854.74 708	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	1850.25 978	1854.73 428	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	1877.75 589	1882.23 809	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	1877.75 741	1882.23 501	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1877.75 784	1882.23 734	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	1877.76 218	1882.23 088	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	1877.76 135	1882.23 695	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	1877.76 049	1882.22 949	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	1905.25 948	1909.72 848	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	1905.26 394	1909.73 064	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	1905.26 485	1909.72 845	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	1905.26 213	1909.73 453	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	1905.25 856	1909.73 196	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	1905.25 66	1909.73 1	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	1850.54 202	1859.47 602	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	1850.54 725	1859.46 955	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	1850.54 503	1859.46 123	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	1850.55 293	1859.47 553	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	1850.54 884	1859.46 794	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	1850.55 147	1859.46 987	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	VN	NT	1875.52 937	1884.45 657	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1875.52 527	1884.46 137	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	1875.52 985	1884.46 355	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	1875.53 964	1884.45 104	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	1875.53 309	1884.46 339	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	1875.52 989	1884.45 909	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	1900.51 318	1909.43 668	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	1900.52 191	1909.43 301	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	1900.51 698	1909.43 188	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	1900.52 591	1909.43 331	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	1900.51 07	1909.43 08	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	1900.52 456	1909.43 916	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	1850.83 364	1864.20 864	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	1850.83 496	1864.21 196	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	1850.82 747	1864.22 847	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	1850.81 687	1864.19 287	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	1850.82 037	1864.19 037	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	1850.82 326	1864.20 326	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	1873.29 077	1886.69 077	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	1873.29 963	1886.68 463	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	1873.30 172	1886.69 272	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	18900	75RB#0	VN	NT	1873.29 253	1886.68 453	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	1873.30 98	1886.69 08	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	1873.30 737	1886.69 037	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	1895.81 541	1909.13 241	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	1895.80 599	1909.14 099	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	1895.82 116	1909.13 516	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	1895.80 255	1909.15 355	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	1895.81 308	1909.14 508	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	1895.81 744	1909.13 944	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	1851.11 529	1868.92 529	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	1851.10 392	1868.91 392	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	1851.12 471	1868.92 571	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	1851.12 285	1868.93 385	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	1851.14 809	1868.93 209	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	1851.14 099	1868.93 099	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	1871.09 412	1888.91 412	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	1871.08 946	1888.91 146	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	1871.09 163	1888.91 163	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	1871.07 22	1888.92 12	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	1871.05 779	1888.91 779	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	1871.06 975	1888.92 275	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB#0	VN	NT	1891.07 727	1908.85 627	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	1891.11 365	1908.87 165	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	1891.06 976	1908.86 476	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	1891.09 245	1908.87 545	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	1891.09 411	1908.85 011	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	1891.10 822	1908.91 122	1850- 1910	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	1850.1 5721	1851.23 711	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	1850.1 5737	1851.23 747	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	1850.1 596	1851.23 77	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	1850.1 5622	1851.23 812	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	1850.1 5851	1851.23 701	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	1850.1 5747	1851.23 797	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	1850.1 5588	1851.23 798	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	1850.1 5648	1851.23 748	1850- 1910	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	1850.1 5836	1851.23 766	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	1850.1 5893	1851.23 783	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	1850.1 5433	1851.23 713	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	1850.1 5753	1851.23 933	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	1850.1 5689	1851.23 889	1850- 1910	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	1850.1 5795	1851.23 835	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	1850.1 5814	1851.23 934	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	1850.1 5538	1851.23 678	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	1850.1 5618	1851.23 808	1850- 1910	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	1850.1 5601	1851.23 771	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	1879.4 5666	1880.53 796	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	1879.4 5558	1880.53 778	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	1879.4 5805	1880.53 785	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	1879.4 5719	1880.53 799	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	1879.4 5582	1880.53 782	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	1879.4 5687	1880.53 817	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	1879.4 5702	1880.53 642	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	1879.4 5573	1880.53 813	1850- 1910	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	1879.4 5705	1880.53 755	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	1879.4 5445	1880.53 675	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	1879.4 5753	1880.53 523	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	1879.4 5556	1880.53 796	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	1879.4 5474	1880.53 814	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	1879.4 5591	1880.53 871	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	1879.4 5504	1880.53 884	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	1879.4 5549	1880.53 779	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	1879.4 5835	1880.53 715	1850- 1910	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	1879.4 5611	1880.53 551	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	1908.7 5862	1909.83 942	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	1908.7 584	1909.84 06	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	1908.7 5708	1909.83 958	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	1908.7 5782	1909.83 792	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	1908.7 5831	1909.83 961	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	1908.7 5799	1909.83 949	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	1908.7 5904	1909.83 894	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	1908.7 5735	1909.83 925	1850- 1910	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	1908.7 6019	1909.83 979	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	1908.7 5926	1909.83 666	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	1908.7 5836	1909.83 796	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	1908.7 5931	1909.83 731	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	1908.7 5831	1909.83 551	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	1908.7 5846	1909.83 596	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	1908.7 5873	1909.83 673	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	1908.7 5826	1909.83 726	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	1908.7 5822	1909.83 582	1850- 1910	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	1908.7 5842	1909.83 612	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	1850.1 5988	1852.84 428	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18615	15RB#0	NV	-20	1850.1 588	1852.84 1	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	1850.1 5842	1852.84 012	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	1850.1 5961	1852.84 391	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	1850.1 5922	1852.83 662	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	1850.1 5861	1852.84 281	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	1850.1 5662	1852.84 562	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	1850.1 5794	1852.84 684	1850- 1910	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	1850.1 598	1852.84 33	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	1850.1 5984	1852.83 804	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	1850.1 6023	1852.84 083	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	1850.1 5958	1852.84 048	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	1850.1 5923	1852.83 953	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	1850.1 6103	1852.84 063	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	1850.1 6088	1852.83 408	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	1850.1 601	1852.83 84	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	1850.1 5758	1852.84 088	1850- 1910	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	1850.1 5854	1852.83 904	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	1878.6 5801	1881.34 201	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	1878.6 5805	1881.34 465	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	1878.6 5706	1881.34 086	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	1878.6 5839	1881.34 149	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	10	1878.6 5611	1881.33 751	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	1878.6 5796	1881.33 896	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	1878.6 5659	1881.33 719	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	1878.6 5809	1881.34 519	1850- 1910	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	1878.6 6048	1881.34 548	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	1878.6 6217	1881.33 357	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	1878.6 5969	1881.33 639	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	1878.6 6005	1881.33 895	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	1878.6 5829	1881.33 809	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	1878.6 5931	1881.33 901	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	1878.6 5791	1881.33 681	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	1878.6 596	1881.33 43	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	1878.6 5905	1881.33 905	1850- 1910	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	1878.6 5659	1881.33 589	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	1907.1 538	1909.84 05	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	1907.1 5498	1909.84 148	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	1907.1 5392	1909.84 122	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	1907.1 5552	1909.84 212	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	1907.1 551	1909.84	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	1907.1 5518	1909.83 868	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	1907.1 5616	1909.84 006	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	3MHz	QPSK	19185	15RB#0	NV	40	1907.1 5461	1909.83 991	1850- 1910	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	1907.1 5582	1909.84 142	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	1907.1 5778	1909.83 698	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	1907.1 545	1909.83 68	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	1907.1 5484	1909.83 694	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	1907.1 5448	1909.83 768	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	1907.1 541	1909.83 37	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	1907.1 5622	1909.83 952	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	1907.1 5532	1909.83 532	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	1907.1 5581	1909.83 751	1850- 1910	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	1907.1 546	1909.83 75	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	1850.2 5658	1854.73 468	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	1850.2 6396	1854.73 246	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	1850.2 5831	1854.73 781	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	1850.2 6371	1854.73 711	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	1850.2 5661	1854.74 091	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	1850.2 5899	1854.73 779	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	1850.2 5786	1854.73 936	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	1850.2 5417	1854.73 317	1850- 1910	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	1850.2 5203	1854.73 513	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	1850.2 6339	1854.73 999	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	1850.2 5809	1854.74 749	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	1850.2 6243	1854.73 653	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	1850.2 5855	1854.73 915	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	1850.2 6359	1854.73 569	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	1850.2 6192	1854.74 762	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	1850.2 647	1854.74 12	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	1850.2 6137	1854.74 297	1850- 1910	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	1850.2 5957	1854.73 067	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	1877.7 5744	1882.23 124	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	1877.7 5797	1882.23 287	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	1877.7 5831	1882.23 621	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	1877.7 5483	1882.23 373	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	1877.7 5747	1882.23 207	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	1877.7 5912	1882.22 972	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	1877.7 5516	1882.23 226	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	1877.7 5542	1882.23 272	1850- 1910	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	1877.7 54	1882.23 01	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	1877.7 6015	1882.23 345	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	1877.7 6175	1882.23 375	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	1877.7 612	1882.23 37	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	1877.7 5886	1882.22 816	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	18900	25RB#0	NV	10	1877.7 6119	1882.23 469	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	1877.7 6411	1882.23 181	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	1877.7 6321	1882.23 181	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	1877.7 6554	1882.23 464	1850- 1910	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	1877.7 6076	1882.23 076	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	1905.2 6279	1909.72 619	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	1905.2 5902	1909.72 742	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	1905.2 5986	1909.72 446	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	1905.2 6	1909.73 08	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	1905.2 6113	1909.73 193	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	1905.2 5835	1909.72 615	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	1905.2 6064	1909.73 134	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	1905.2 6021	1909.72 891	1850- 1910	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	1905.2 5779	1909.72 719	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	1905.2 5691	1909.73 471	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	1905.2 5547	1909.72 807	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	1905.2 563	1909.73 54	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	1905.2 5872	1909.73 462	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	1905.2 5768	1909.72 838	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	1905.2 5594	1909.73 634	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	1905.2 5811	1909.73 131	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	5MHz	16QAM	19175	25RB#0	NV	40	1905.2 578	1909.73 33	1850- 1910	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	1905.2 5721	1909.73 231	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	1850.5 4484	1859.46 394	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	1850.5 4754	1859.46 484	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	1850.5 4433	1859.46 883	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	1850.5 462	1859.46 7	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	1850.5 4517	1859.46 627	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	1850.5 409	1859.46 52	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	1850.5 441	1859.47 46	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	1850.5 4287	1859.47 487	1850- 1910	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	1850.5 4344	1859.46 484	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	1850.5 4884	1859.47 924	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	1850.5 5118	1859.47 028	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	1850.5 5502	1859.47 102	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	1850.5 5044	1859.47 644	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	1850.5 4473	1859.46 653	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	1850.5 492	1859.47 01	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	1850.5 4972	1859.47 472	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	1850.5 4598	1859.46 258	1850- 1910	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	1850.5 4609	1859.46 889	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	1875.5 2726	1884.46 676	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	18900	50RB#0	NV	-20	1875.5 2655	1884.46 415	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1875.5 3448	1884.46 088	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	1875.5 3612	1884.46 442	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	1875.5 2688	1884.45 368	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	1875.5 285	1884.46 37	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	1875.5 2975	1884.46 205	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	1875.5 3913	1884.46 793	1850- 1910	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	1875.5 2712	1884.45 502	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	1875.5 407	1884.46 71	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	1875.5 3184	1884.46 174	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	1875.5 3321	1884.46 811	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	1875.5 3493	1884.46 003	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	1875.5 3469	1884.46 139	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	1875.5 3804	1884.46 194	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	1875.5 4214	1884.45 784	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	40	1875.5 3517	1884.45 847	1850- 1910	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	1875.5 3962	1884.46 912	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	1900.5 2389	1909.43 719	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	1900.5 1217	1909.43 487	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	1900.5 2916	1909.43 236	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	1900.5 2252	1909.42 762	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	10MHz	QPSK	19150	50RB#0	NV	10	1900.5 214	1909.43 48	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	1900.5 1305	1909.43 305	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	1900.5 1843	1909.43 503	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	1900.5 1394	1909.43 064	1850- 1910	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	1900.5 1647	1909.43 817	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	1900.5 1281	1909.42 961	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	1900.5 2227	1909.43 167	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	1900.5 3062	1909.42 952	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	1900.5 1402	1909.43 172	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	1900.5 1202	1909.43 702	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	1900.5 2229	1909.42 869	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	1900.5 2214	1909.43 084	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	1900.5 2497	1909.43 537	1850- 1910	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	1900.5 2711	1909.43 801	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	1850.8 236	1864.19 76	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	1850.8 1409	1864.21 809	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	1850.8 261	1864.20 11	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	1850.8 2626	1864.20 926	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	1850.8 3062	1864.21 762	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	1850.8 2442	1864.21 942	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	1850.8 1258	1864.20 658	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	QPSK	18675	75RB#0	NV	40	1850.8 3123	1864.20 923	1850- 1910	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	1850.8 2679	1864.19 379	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	1850.8 3034	1864.20 134	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	1850.8 1676	1864.19 376	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	1850.8 2442	1864.19 742	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	1850.8 2419	1864.20 119	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	1850.8 2238	1864.19 538	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	1850.8 1916	1864.20 016	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	1850.8 2756	1864.19 956	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	1850.8 1795	1864.19 295	1850- 1910	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	1850.8 177	1864.19 57	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	1873.2 8851	1886.68 051	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	1873.2 9707	1886.68 507	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	1873.3 0319	1886.69 019	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	1873.2 9439	1886.68 739	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	1873.2 9781	1886.69 681	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	1873.2 9738	1886.67 638	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	1873.2 9994	1886.68 694	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	1873.2 9548	1886.67 148	1850- 1910	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	1873.2 9537	1886.67 537	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	1873.3 0516	1886.67 816	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	18900	75RB#0	NV	-20	1873.3 019	1886.69 29	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	1873.2 9877	1886.69 377	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	1873.2 9408	1886.68 008	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	1873.2 9551	1886.68 351	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	1873.2 9228	1886.68 128	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	1873.3 0025	1886.68 925	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	1873.2 9266	1886.69 366	1850- 1910	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	1873.2 9984	1886.68 484	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	1895.8 0469	1909.13 969	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	1895.8 0546	1909.13 946	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	1895.8 032	1909.14 62	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	1895.8 0575	1909.14 575	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	1895.8 1576	1909.14 176	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	1895.8 1751	1909.14 151	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	1895.8 1574	1909.14 274	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	1895.8 1911	1909.13 311	1850- 1910	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	1895.8 0223	1909.13 723	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	1895.8 1676	1909.14 376	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	1895.8 0579	1909.14 579	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	1895.8 0086	1909.14 786	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	1895.8 07	1909.16 5	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	15MHz	16QAM	19125	75RB#0	NV	10	1895.8 1446	1909.14 846	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	1895.7 9744	1909.16 544	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	1895.8 0596	1909.13 596	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	1895.8 1688	1909.15 588	1850- 1910	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	1895.8 0543	1909.15 843	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	1851.0 9696	1868.91 196	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	1851.11 461	1868.91 261	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	1851.11 315	1868.94 615	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	1851.1 0366	1868.91 766	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	1851.0 9006	1868.92 906	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	1851.0 9775	1868.91 675	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	1851.1 0127	1868.92 627	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	1851.11 301	1868.92 101	1850- 1910	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	1851.11 329	1868.90 729	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	1851.1 4765	1868.92 565	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	1851.1 2241	1868.92 041	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	1851.1 3788	1868.93 388	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	1851.1 4351	1868.93 751	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	1851.1 3342	1868.94 442	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	1851.1 3436	1868.93 036	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	1851.1 287	1868.93 17	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	16QAM	18700	100RB#0	NV	40	1851.1 3808	1868.92 808	1850- 1910	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	1851.1 2906	1868.93 306	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	1871.0 9583	1888.89 983	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	1871.0 8899	1888.90 599	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	1871.0 8131	1888.91 131	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	1871.0 9406	1888.90 906	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	1871.0 8941	1888.89 641	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	1871.0 9334	1888.92 734	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	1871.1 0763	1888.91 063	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	1871.0 878	1888.90 78	1850- 1910	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	1871.0 8817	1888.90 617	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	1871.0 674	1888.91 24	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	1871.0 6595	1888.91 895	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	1871.0 6447	1888.91 447	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	1871.0 5364	1888.91 164	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	1871.0 691	1888.90 61	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	1871.0 6716	1888.90 416	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	1871.0 6823	1888.91 623	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	1871.0 7668	1888.90 368	1850- 1910	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	1871.0 885	1888.90 85	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	1891.0 8282	1908.85 082	1850- 1910	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band2	20MHz	QPSK	19100	100RB#0	NV	-20	1891.1 2481	1908.86 581	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	1891.0 9307	1908.87 507	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	1891.1 0211	1908.86 111	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	1891.0 9158	1908.88 058	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	1891.0 9318	1908.87 518	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	1891.0 7318	1908.86 618	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	1891.0 9038	1908.86 538	1850- 1910	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	1891.1 0241	1908.86 941	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	1891.0 8913	1908.89 113	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	1891.1 0416	1908.87 216	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	1891.1 0212	1908.83 612	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	1891.0 8602	1908.87 302	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	1891.0 8909	1908.87 609	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	1891.0 9455	1908.89 955	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	1891.0 854	1908.84 94	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	1891.0 7532	1908.85 132	1850- 1910	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	1891.0 7601	1908.89 201	1850- 1910	PASS

---END---