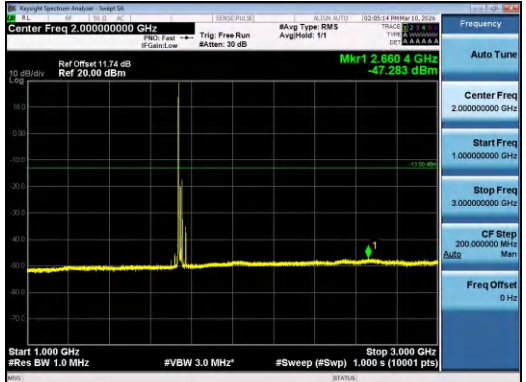
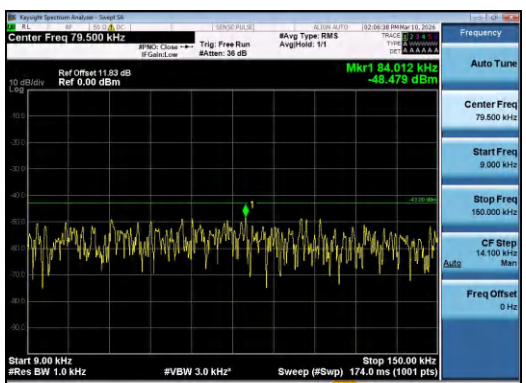
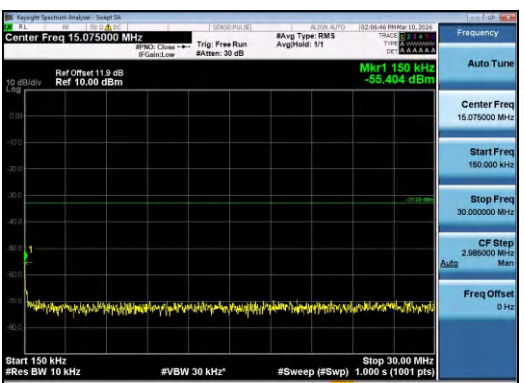
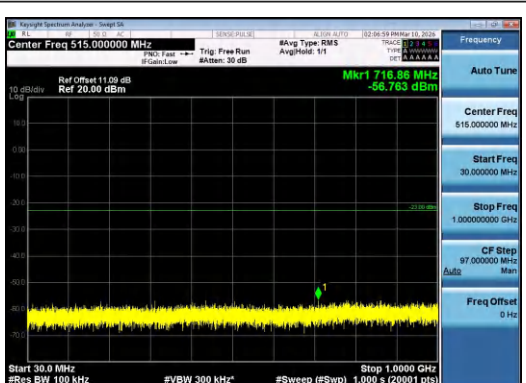
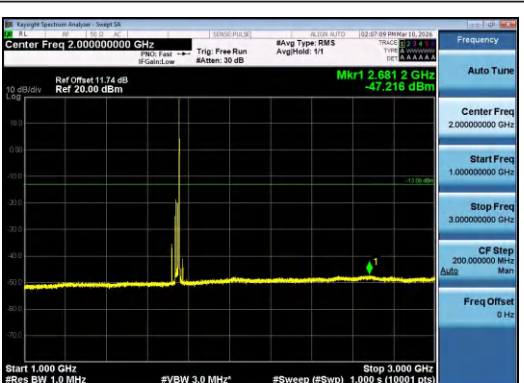
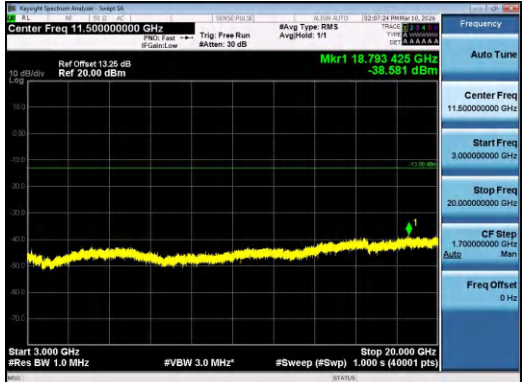
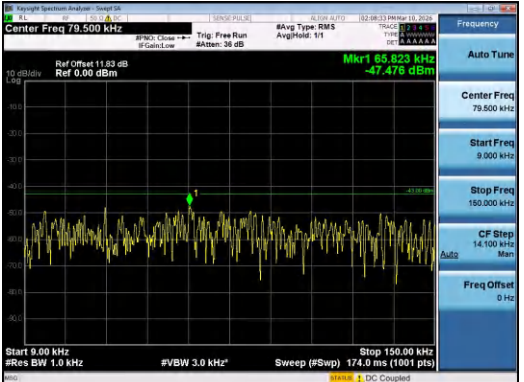
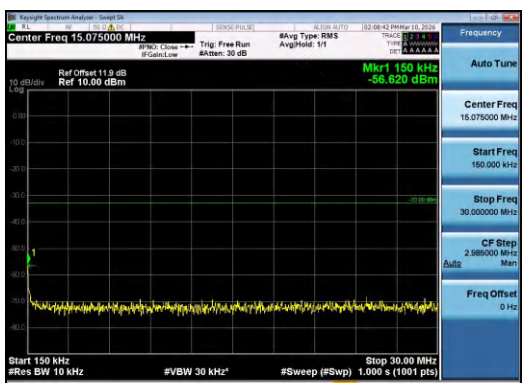
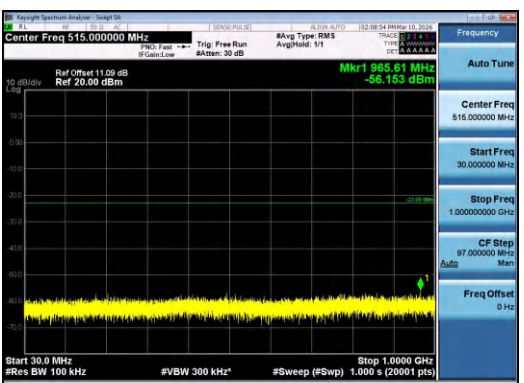
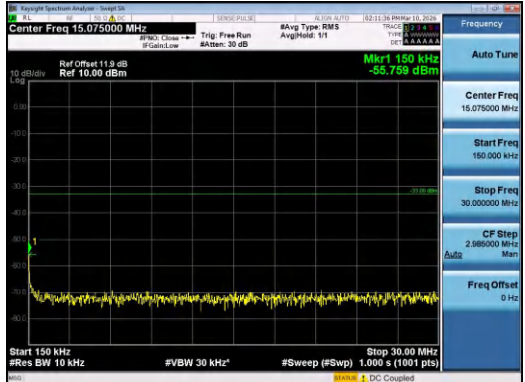
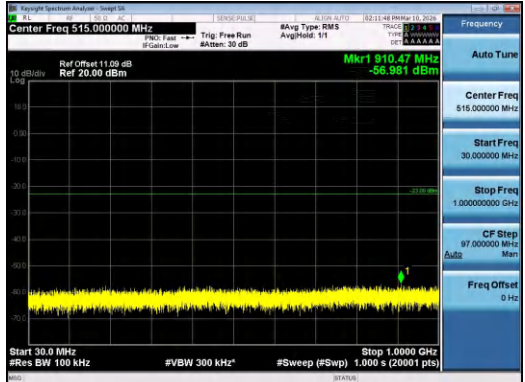
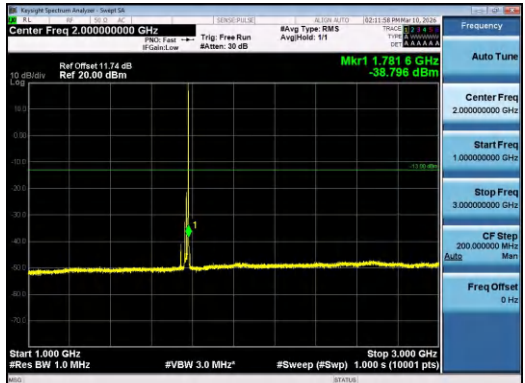
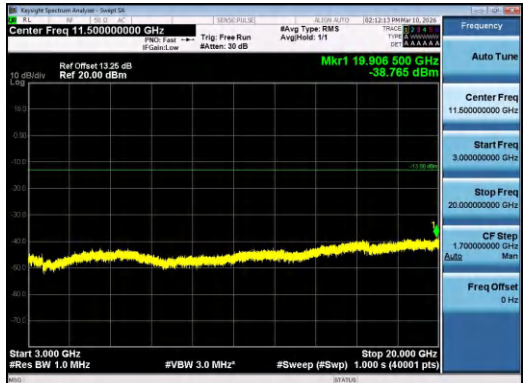
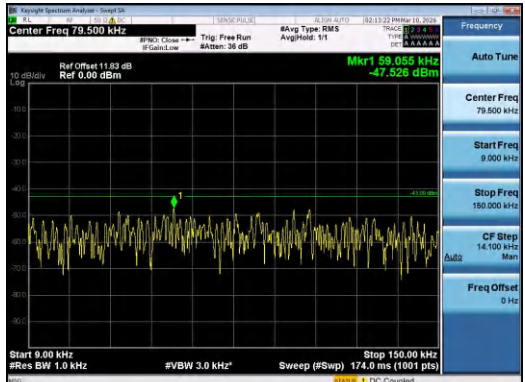
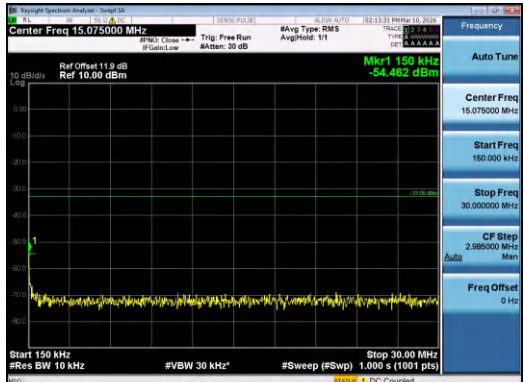








Band66-20MHz-QPSK-132322-100RB#0-30~1000-PA SS	Band66-20MHz-QPSK-132322-100RB#0-1000~3000-PASS
Band66-20MHz-QPSK-132322-100RB#0-3000~20000 -PASS	Band66-20MHz-16QAM-132322-1RB#0-0.009~0.15-P ASS
Band66-20MHz-16QAM-132322-1RB#0-0.15~30-PAS S	Band66-20MHz-16QAM-132322-1RB#0-30~1000-PA SS







	
Band66-20MHz-16QAM-132322-1RB#0-1000~3000-P ASS	Band66-20MHz-16QAM-132322-1RB#0-3000~20000- PASS
	
Band66-20MHz-16QAM-132322-1RB#99-0.009~0.15- PASS	Band66-20MHz-16QAM-132322-1RB#99-0.15~30-PA SS
	
Band66-20MHz-16QAM-132322-1RB#99-30~1000-PA SS	Band66-20MHz-16QAM-132322-1RB#99-1000~3000- PASS

	
Band66-20MHz-16QAM-132322-1RB#99-3000~2000 0-PASS	Band66-20MHz-16QAM-132322-100RB#0-0.009~0.1 5-PASS
	
Band66-20MHz-16QAM-132322-100RB#0-0.15~30-P ASS	Band66-20MHz-16QAM-132322-100RB#0-30~1000-P ASS
	
Band66-20MHz-16QAM-132322-100RB#0-1000~300 0-PASS	Band66-20MHz-16QAM-132322-100RB#0-3000~200 00-PASS

Band66-20MHz-QPSK-132572-1RB#0-0.009~0.15-PASS	Band66-20MHz-QPSK-132572-1RB#0-0.15~30-PASS
Band66-20MHz-QPSK-132572-1RB#0-30~1000-PASS	Band66-20MHz-QPSK-132572-1RB#0-1000~3000-PASS
Band66-20MHz-QPSK-132572-1RB#0-3000~20000-PASS	Band66-20MHz-QPSK-132572-1RB#99-0.009~0.15-PASS

	
Band66-20MHz-QPSK-132572-1RB#99-0.15~30-PAS S	Band66-20MHz-QPSK-132572-1RB#99-30~1000-PA SS
	
Band66-20MHz-QPSK-132572-1RB#99-1000~3000-P ASS	Band66-20MHz-QPSK-132572-1RB#99-3000~20000- PASS
	
Band66-20MHz-QPSK-132572-100RB#0-0.009~0.15- PASS	Band66-20MHz-QPSK-132572-100RB#0-0.15~30-PA SS

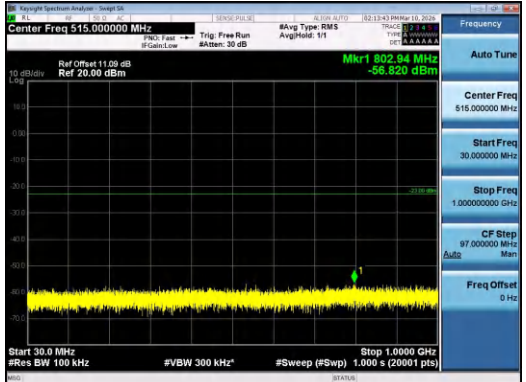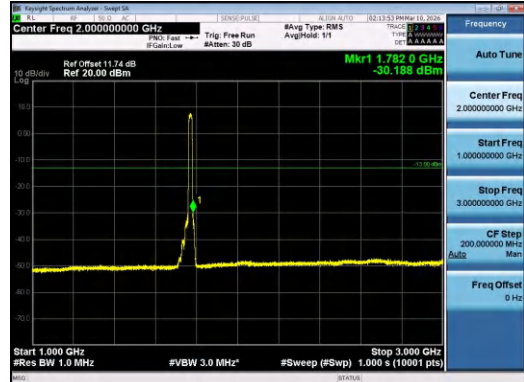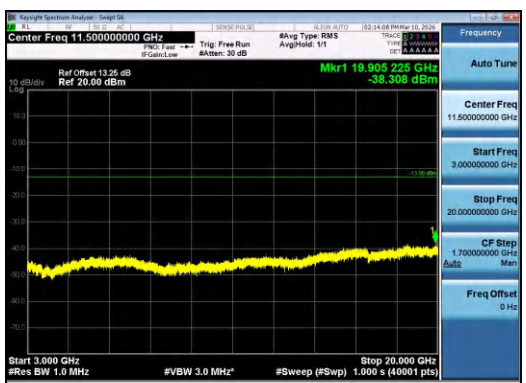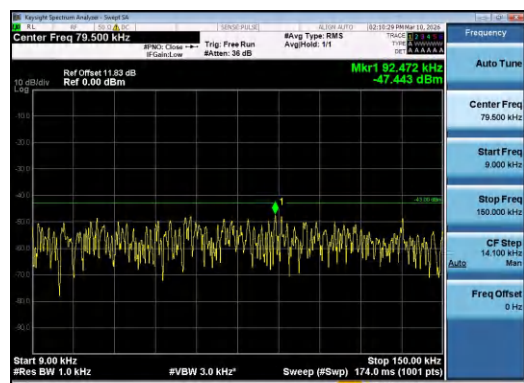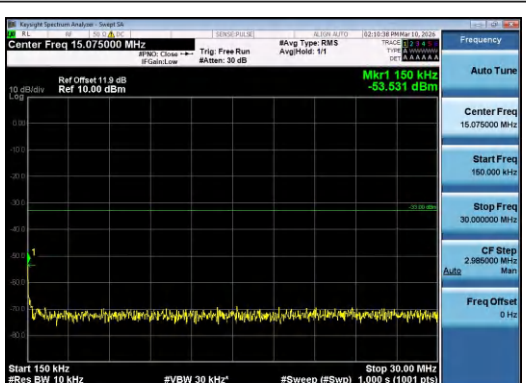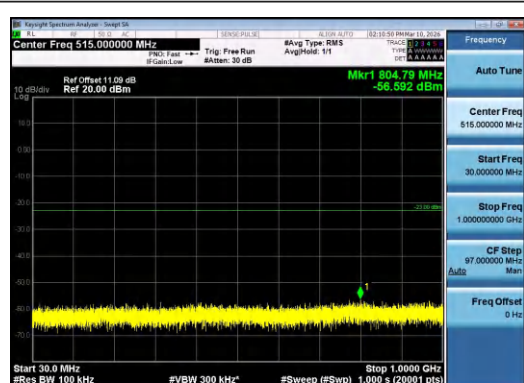	
Band66-20MHz-QPSK-132572-100RB#0-30~1000-PA SS	Band66-20MHz-QPSK-132572-100RB#0-1000~3000-PASS
	
Band66-20MHz-QPSK-132572-100RB#0-3000~20000 -PASS	Band66-20MHz-16QAM-132572-1RB#0-0.009~0.15-P ASS
	
Band66-20MHz-16QAM-132572-1RB#0-0.15~30-PAS S	Band66-20MHz-16QAM-132572-1RB#0-30~1000-PA SS

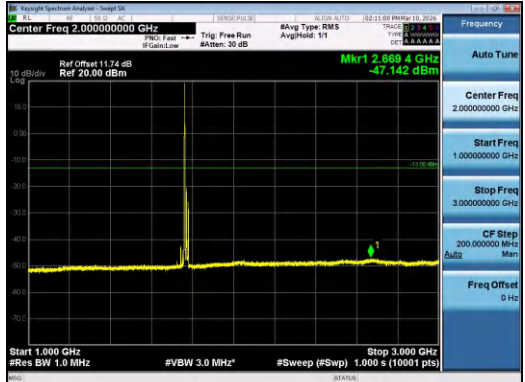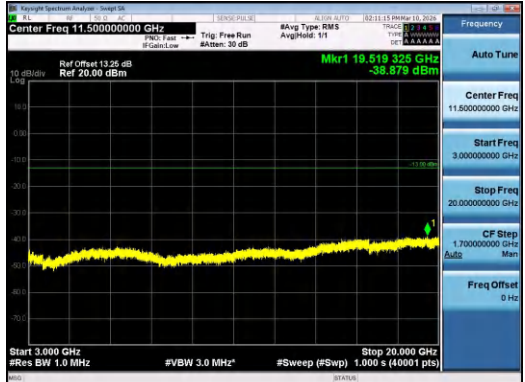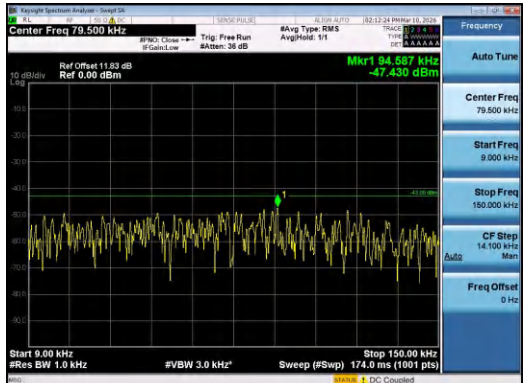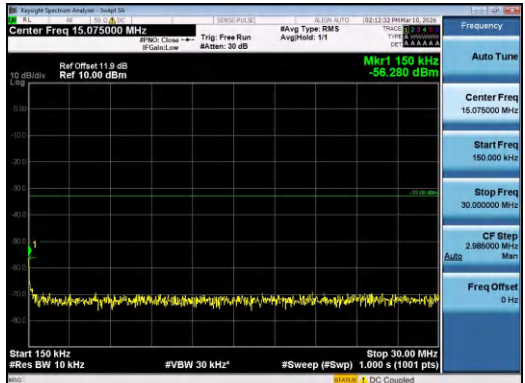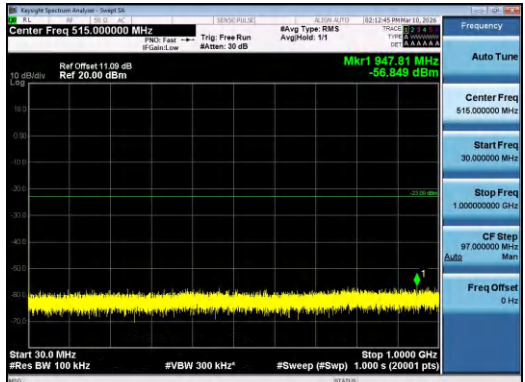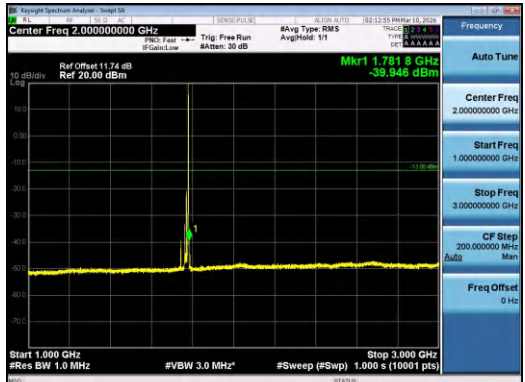	
Band66-20MHz-16QAM-132572-1RB#0-1000~3000-P ASS	Band66-20MHz-16QAM-132572-1RB#0-3000~20000- PASS
	
Band66-20MHz-16QAM-132572-1RB#99-0.009~0.15- PASS	Band66-20MHz-16QAM-132572-1RB#99-0.15~30-PA SS
	
Band66-20MHz-16QAM-132572-1RB#99-30~1000-PA SS	Band66-20MHz-16QAM-132572-1RB#99-1000~3000- PASS

Band66-20MHz-16QAM-132572-1RB#99-3000~2000 0-PASS	Band66-20MHz-16QAM-132572-100RB#0-0.009~0.1 5-PASS
Band66-20MHz-16QAM-132572-100RB#0-0.15~30-P ASS	Band66-20MHz-16QAM-132572-100RB#0-30~1000-P ASS
Band66-20MHz-16QAM-132572-100RB#0-1000~300 0-PASS	Band66-20MHz-16QAM-132572-100RB#0-3000~200 00-PASS

Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
					Voltag	Tempe				
Band66	1.4MHz	QPSK	131979	6RB#0	VN	NT	1710.15743	1711.23763	1710-1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VL	NT	1710.15607	1711.23807	1710-1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	VH	NT	1710.15716	1711.23826	1710-1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VN	NT	1710.15652	1711.23812	1710-1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VL	NT	1710.15606	1711.23806	1710-1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	VH	NT	1710.15701	1711.23781	1710-1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VN	NT	1744.45904	1745.53894	1710-1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VL	NT	1744.45737	1745.53737	1710-1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VH	NT	1744.45768	1745.53708	1710-1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VN	NT	1744.45681	1745.53771	1710-1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VL	NT	1744.45655	1745.53825	1710-1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	VH	NT	1744.45607	1745.53587	1710-1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VN	NT	1778.75636	1779.83766	1710-1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VL	NT	1778.75647	1779.83887	1710-1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	VH	NT	1778.75782	1779.84002	1710-1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VN	NT	1778.75772	1779.83712	1710-1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VL	NT	1778.7587	1779.8369	1710-1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	VH	NT	1778.75768	1779.83708	1710-1780	PASS

Band66	3MHz	QPSK	131987	15RB#0	VN	NT	1710.15 532	1712.8 4422	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	VL	NT	1710.15 872	1712.8 4462	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	VH	NT	1710.16 093	1712.8 3823	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	VN	NT	1710.15 941	1712.8 3581	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	VL	NT	1710.15 687	1712.8 3877	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	VH	NT	1710.15 704	1712.8 3424	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	VN	NT	1743.65 672	1746.3 4192	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	VL	NT	1743.65 698	1746.3 3878	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	VH	NT	1743.65 732	1746.3 3932	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	VN	NT	1743.65 82	1746.3 404	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	VL	NT	1743.65 766	1746.3 3956	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	VH	NT	1743.65 648	1746.3 4018	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	VN	NT	1777.15 515	1779.8 3685	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	VL	NT	1777.15 465	1779.8 4435	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	VH	NT	1777.15 054	1779.8 3814	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	VN	NT	1777.15 119	1779.8 3609	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	VL	NT	1777.15 249	1779.8 3829	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	VH	NT	1777.15 33	1779.8 372	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	VN	NT	1710.25 872	1714.7 3312	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	VL	NT	1710.25 646	1714.7 3256	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	VH	NT	1710.25 395	1714.7 3585	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	131997	25RB#0	VN	NT	1710.26 162	1714.7 3242	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	VL	NT	1710.26 096	1714.7 3166	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	VH	NT	1710.26 037	1714.7 2877	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	VN	NT	1742.75 78	1747.2 315	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	VL	NT	1742.75 483	1747.2 3443	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	VH	NT	1742.75 874	1747.2 3114	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	VN	NT	1742.75 896	1747.2 3166	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	VL	NT	1742.76 29	1747.2 317	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	VH	NT	1742.75 997	1747.2 3047	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	VN	NT	1775.25 845	1779.7 2705	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	VL	NT	1775.25 961	1779.7 3061	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	VH	NT	1775.26 535	1779.7 3195	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	VN	NT	1775.25 754	1779.7 3264	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	VL	NT	1775.25 745	1779.7 3355	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	VH	NT	1775.25 857	1779.7 3547	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	VN	NT	1710.52 818	1719.4 5658	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	VL	NT	1710.52 82	1719.4 521	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	VH	NT	1710.53 236	1719.4 5576	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	VN	NT	1710.53 877	1719.4 5307	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	VL	NT	1710.53 302	1719.4 4902	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	VH	NT	1710.53 678	1719.4 5178	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	QPSK	132322	50RB#0	VN	NT	1740.53 855	1749.4 5425	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	VL	NT	1740.52 767	1749.4 5627	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	VH	NT	1740.52 792	1749.4 5482	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	VN	NT	1740.53 044	1749.4 5324	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	VL	NT	1740.54 015	1749.4 6435	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	VH	NT	1740.53 179	1749.4 6279	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	VN	NT	1770.51 964	1779.4 4004	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	VL	NT	1770.52 338	1779.4 3978	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	VH	NT	1770.52 596	1779.4 3766	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	VN	NT	1770.52 539	1779.4 4489	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	VL	NT	1770.52 842	1779.4 4552	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	VH	NT	1770.51 801	1779.4 4291	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	VN	NT	1710.78 23	1724.1 763	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	VL	NT	1710.79 182	1724.1 9282	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	VH	NT	1710.78 476	1724.1 8076	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	VN	NT	1710.79 04	1724.1 904	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	VL	NT	1710.78 707	1724.1 7607	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	VH	NT	1710.78 916	1724.1 7216	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	VN	NT	1738.30 851	1751.6 9151	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	VL	NT	1738.29 624	1751.6 8424	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	VH	NT	1738.29 568	1751.6 8168	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132322	75RB#0	VN	NT	1738.30 921	1751.6 7421	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	VL	NT	1738.30 603	1751.6 8403	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	VH	NT	1738.31 156	1751.6 7456	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	VN	NT	1765.80 897	1779.1 6097	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	VL	NT	1765.81 015	1779.1 6715	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	VH	NT	1765.81 733	1779.1 6333	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	VN	NT	1765.82 157	1779.1 8057	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	VL	NT	1765.79 906	1779.1 7506	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	VH	NT	1765.80 924	1779.1 6924	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	VN	NT	1711.08 509	1728.9 1909	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	VL	NT	1711.08 165	1728.9 1765	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	VH	NT	1711.08 842	1728.8 9842	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	VN	NT	1711.06 482	1728.9 1482	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	VL	NT	1711.06 046	1728.9 1546	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	VH	NT	1711.07 026	1728.9 0426	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	VN	NT	1736.06 803	1753.8 7703	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	VL	NT	1736.08 723	1753.8 9223	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	VH	NT	1736.06 527	1753.8 8327	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	VN	NT	1736.08 597	1753.9 3497	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	VL	NT	1736.07 952	1753.9 0652	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	VH	NT	1736.07 996	1753.8 9296	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	20MHz	QPSK	132572	100RB#0	VN	NT	1761.07 428	1778.8 7928	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	VL	NT	1761.07 459	1778.8 9459	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	VH	NT	1761.11 217	1778.8 9317	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	VN	NT	1761.13 094	1778.8 9594	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	VL	NT	1761.13 607	1778.8 9007	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	VH	NT	1761.11 49	1778.9 159	1710- 1780	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-30	1710.15 891	1711.23 761	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-20	1710.15 79	1711.23 85	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	-10	1710.15 855	1711.23 835	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	0	1710.15 741	1711.23 711	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	10	1710.15 69	1711.23 83	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	20	1710.15 73	1711.23 76	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	30	1710.15 729	1711.23 919	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	40	1710.15 789	1711.23 639	1710- 1780	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	NV	50	1710.15 757	1711.23 817	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-30	1710.15 675	1711.23 895	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-20	1710.15 656	1711.23 786	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	-10	1710.15 546	1711.23 866	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	0	1710.15 595	1711.23 745	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	16QAM	131979	6RB#0	NV	10	1710.15 668	1711.23 978	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	20	1710.15 545	1711.23 715	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	30	1710.15 554	1711.23 674	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	40	1710.15 708	1711.23 748	1710- 1780	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	NV	50	1710.15 854	1711.23 844	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-30	1744.45 764	1745.53 774	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-20	1744.45 65	1745.53 8	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-10	1744.45 612	1745.53 602	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	0	1744.45 952	1745.53 792	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	10	1744.45 892	1745.53 872	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	20	1744.45 917	1745.53 837	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	30	1744.45 69	1745.53 71	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	40	1744.45 63	1745.53 7	1710- 1780	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	50	1744.45 758	1745.53 678	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-30	1744.45 63	1745.53 83	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-20	1744.45 552	1745.53 472	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	-10	1744.45 675	1745.53 765	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	0	1744.45 691	1745.53 621	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	10	1744.45 592	1745.53 752	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	20	1744.45 613	1745.53 803	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	30	1744.45 421	1745.53 791	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	1.4MHz	16QAM	132322	6RB#0	NV	40	1744.45 659	1745.53 899	1710- 1780	PASS
Band66	1.4MHz	16QAM	132322	6RB#0	NV	50	1744.45 81	1745.53 83	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-30	1778.75 878	1779.83 848	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-20	1778.75 65	1779.84 03	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	-10	1778.75 685	1779.84 075	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	0	1778.75 607	1779.83 917	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	10	1778.75 711	1779.83 951	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	20	1778.75 78	1779.83 82	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	30	1778.75 803	1779.84 043	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	40	1778.75 824	1779.83 654	1710- 1780	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	NV	50	1778.75 808	1779.84 038	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-30	1778.75 762	1779.83 672	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-20	1778.75 835	1779.83 585	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	-10	1778.75 736	1779.83 696	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	0	1778.75 76	1779.83 73	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	10	1778.75 82	1779.83 59	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	20	1778.75 89	1779.83 71	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	30	1778.75 858	1779.83 668	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	40	1778.75 784	1779.83 694	1710- 1780	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	NV	50	1778.75 856	1779.83 716	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-30	1710.15 651	1712.83 871	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	QPSK	131987	15RB#0	NV	-20	1710.15 661	1712.84 141	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	-10	1710.15 881	1712.84 671	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	0	1710.15 681	1712.84 261	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	10	1710.15 744	1712.84 214	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	20	1710.15 706	1712.84 296	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	30	1710.15 769	1712.84 039	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	40	1710.15 78	1712.84 17	1710- 1780	PASS
Band66	3MHz	QPSK	131987	15RB#0	NV	50	1710.15 66	1712.83 98	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-30	1710.15 887	1712.84 057	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-20	1710.15 952	1712.83 802	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	-10	1710.15 807	1712.83 957	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	0	1710.15 787	1712.83 937	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	10	1710.15 692	1712.83 842	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	20	1710.15 753	1712.83 983	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	30	1710.15 996	1712.83 926	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	40	1710.15 755	1712.83 605	1710- 1780	PASS
Band66	3MHz	16QAM	131987	15RB#0	NV	50	1710.15 753	1712.83 643	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-30	1743.65 821	1746.34 301	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-20	1743.65 513	1746.34 303	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-10	1743.65 658	1746.34 248	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	0	1743.65 65	1746.34 27	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	QPSK	132322	15RB#0	NV	10	1743.65 592	1746.33 972	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	20	1743.65 789	1746.34 239	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	30	1743.65 638	1746.34 218	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	40	1743.65 679	1746.34 319	1710- 1780	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	50	1743.65 651	1746.34 091	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-30	1743.65 811	1746.33 951	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-20	1743.65 775	1746.33 895	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	-10	1743.65 587	1746.33 857	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	0	1743.65 646	1746.34 016	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	10	1743.65 65	1746.34 02	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	20	1743.65 923	1746.33 983	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	30	1743.65 89	1746.33 62	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	40	1743.65 439	1746.33 809	1710- 1780	PASS
Band66	3MHz	16QAM	132322	15RB#0	NV	50	1743.65 658	1746.33 948	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-30	1777.15 251	1779.84 001	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-20	1777.15 295	1779.83 575	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	-10	1777.15 151	1779.83 811	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	0	1777.15 488	1779.84 038	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	10	1777.15 15	1779.84 07	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	20	1777.15 314	1779.84 394	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	30	1777.15 768	1779.84 728	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	QPSK	132657	15RB#0	NV	40	1777.15 316	1779.84 136	1710- 1780	PASS
Band66	3MHz	QPSK	132657	15RB#0	NV	50	1777.15 298	1779.83 788	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-30	1777.15 208	1779.83 818	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-20	1777.15 537	1779.84 147	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	-10	1777.15 23	1779.84 04	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	0	1777.15 365	1779.83 585	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	10	1777.15 314	1779.83 964	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	20	1777.15 118	1779.84 178	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	30	1777.15 517	1779.83 657	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	40	1777.15 295	1779.83 555	1710- 1780	PASS
Band66	3MHz	16QAM	132657	15RB#0	NV	50	1777.15 34	1779.83 62	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-30	1710.25 836	1714.73 256	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-20	1710.25 682	1714.72 972	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	-10	1710.25 565	1714.73 435	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	0	1710.25 7	1714.73 06	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	10	1710.25 726	1714.73 056	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	20	1710.25 947	1714.72 957	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	30	1710.25 665	1714.73 295	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	40	1710.25 695	1714.72 395	1710- 1780	PASS
Band66	5MHz	QPSK	131997	25RB#0	NV	50	1710.25 725	1714.73 255	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	-30	1710.25 993	1714.72 853	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	131997	25RB#0	NV	-20	1710.26 107	1714.73 047	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	-10	1710.26 245	1714.73 095	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	0	1710.26 262	1714.73 102	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	10	1710.25 995	1714.73 395	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	20	1710.26 057	1714.73 117	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	30	1710.25 736	1714.73 196	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	40	1710.25 925	1714.73 055	1710- 1780	PASS
Band66	5MHz	16QAM	131997	25RB#0	NV	50	1710.26 512	1714.73 242	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-30	1742.75 347	1747.23 377	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-20	1742.75 812	1747.23 392	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-10	1742.75 369	1747.22 869	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	0	1742.75 656	1747.23 026	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	10	1742.75 853	1747.23 503	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	20	1742.75 541	1747.23 151	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	30	1742.75 926	1747.23 076	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	40	1742.75 748	1747.23 228	1710- 1780	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	50	1742.75 689	1747.23 219	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-30	1742.75 946	1747.23 416	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-20	1742.76 292	1747.23 412	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	-10	1742.76 276	1747.23 256	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	0	1742.75 626	1747.22 976	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	132322	25RB#0	NV	10	1742.76 144	1747.23 564	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	20	1742.76 013	1747.23 273	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	30	1742.76 116	1747.22 966	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	40	1742.76 107	1747.23 137	1710- 1780	PASS
Band66	5MHz	16QAM	132322	25RB#0	NV	50	1742.76 071	1747.23 071	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-30	1775.25 93	1779.73 16	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-20	1775.26 088	1779.73 028	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	-10	1775.25 81	1779.72 85	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	0	1775.26 152	1779.73 042	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	10	1775.26 027	1779.72 677	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	20	1775.26 149	1779.72 949	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	30	1775.26 1	1779.72 63	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	40	1775.25 981	1779.73 461	1710- 1780	PASS
Band66	5MHz	QPSK	132647	25RB#0	NV	50	1775.26 149	1779.73 049	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-30	1775.25 647	1779.73 647	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-20	1775.25 873	1779.73 373	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	-10	1775.26 064	1779.73 284	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	0	1775.25 579	1779.73 209	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	10	1775.26 131	1779.73 021	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	20	1775.25 677	1779.73 037	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	30	1775.25 723	1779.73 073	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	5MHz	16QAM	132647	25RB#0	NV	40	1775.26 006	1779.73 216	1710- 1780	PASS
Band66	5MHz	16QAM	132647	25RB#0	NV	50	1775.25 862	1779.73 282	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-30	1710.52 498	1719.45 668	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-20	1710.51 955	1719.45 685	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	-10	1710.53 054	1719.45 544	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	0	1710.52 667	1719.46 187	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	10	1710.52 08	1719.45 72	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	20	1710.53 189	1719.46 339	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	30	1710.52 239	1719.45 749	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	40	1710.52 602	1719.45 892	1710- 1780	PASS
Band66	10MHz	QPSK	132022	50RB#0	NV	50	1710.52 782	1719.46 192	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	-30	1710.52 831	1719.45 421	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	-20	1710.52 988	1719.45 918	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	-10	1710.53 679	1719.46 359	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	0	1710.52 879	1719.46 159	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	10	1710.53 182	1719.45 612	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	20	1710.53 504	1719.45 844	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	30	1710.53 148	1719.46 238	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	40	1710.52 858	1719.46 428	1710- 1780	PASS
Band66	10MHz	16QAM	132022	50RB#0	NV	50	1710.52 885	1719.45 495	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-30	1740.52 858	1749.45 638	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	QPSK	132322	50RB#0	NV	-20	1740.53 194	1749.45 804	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-10	1740.52 915	1749.45 345	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	0	1740.53 549	1749.45 519	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	10	1740.53 199	1749.45 929	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	20	1740.52 947	1749.45 977	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	30	1740.53 219	1749.45 889	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	40	1740.51 746	1749.45 996	1710- 1780	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	50	1740.52 759	1749.45 049	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	-30	1740.53 617	1749.45 607	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	-20	1740.53 394	1749.46 424	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	-10	1740.53 555	1749.45 115	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	0	1740.53 752	1749.45 502	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	10	1740.52 729	1749.45 089	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	20	1740.53 97	1749.46 45	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	30	1740.52 877	1749.45 717	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	40	1740.53 064	1749.45 244	1710- 1780	PASS
Band66	10MHz	16QAM	132322	50RB#0	NV	50	1740.53 709	1749.45 009	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-30	1770.52 762	1779.44 452	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-20	1770.52 682	1779.44 532	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	-10	1770.51 832	1779.44 722	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	0	1770.52 752	1779.44 072	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	QPSK	132622	50RB#0	NV	10	1770.52 806	1779.44 086	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	20	1770.52 939	1779.43 969	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	30	1770.52 263	1779.44 313	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	40	1770.51 666	1779.44 086	1710- 1780	PASS
Band66	10MHz	QPSK	132622	50RB#0	NV	50	1770.52 33	1779.44 54	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	-30	1770.52 739	1779.44 209	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	-20	1770.51 657	1779.44 827	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	-10	1770.53 078	1779.44 468	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	0	1770.51 467	1779.44 467	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	10	1770.53 214	1779.44 314	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	20	1770.53 04	1779.44 3	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	30	1770.51 745	1779.43 765	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	40	1770.52 017	1779.44 237	1710- 1780	PASS
Band66	10MHz	16QAM	132622	50RB#0	NV	50	1770.51 853	1779.44 263	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-30	1710.79 843	1724.19 543	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-20	1710.79 171	1724.19 171	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	-10	1710.79 35	1724.18 25	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	0	1710.79 739	1724.18 939	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	10	1710.80 026	1724.18 426	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	20	1710.79 537	1724.19 837	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	30	1710.79 029	1724.19 529	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	QPSK	132047	75RB#0	NV	40	1710.77 951	1724.19 351	1710- 1780	PASS
Band66	15MHz	QPSK	132047	75RB#0	NV	50	1710.79	1724.18 8	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	-30	1710.80 354	1724.17 454	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	-20	1710.79 658	1724.17 458	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	-10	1710.79 156	1724.17 856	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	0	1710.79 766	1724.18 266	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	10	1710.78 776	1724.17 276	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	20	1710.79 422	1724.17 722	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	30	1710.79 206	1724.18 806	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	40	1710.80 013	1724.17 313	1710- 1780	PASS
Band66	15MHz	16QAM	132047	75RB#0	NV	50	1710.79 802	1724.18 102	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-30	1738.29 122	1751.67 022	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-20	1738.31 553	1751.68 053	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-10	1738.30 24	1751.68 44	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	0	1738.30 403	1751.67 803	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	10	1738.30 8	1751.67 7	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	20	1738.29 289	1751.67 189	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	30	1738.29 75	1751.67 55	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	40	1738.29 631	1751.67 031	1710- 1780	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	50	1738.29 867	1751.67 867	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	-30	1738.30 044	1751.66 844	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132322	75RB#0	NV	-20	1738.29 253	1751.67 853	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	-10	1738.29 609	1751.67 109	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	0	1738.29 524	1751.66 724	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	10	1738.30 462	1751.67 162	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	20	1738.30 281	1751.67 681	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	30	1738.31 024	1751.66 524	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	40	1738.29 966	1751.66 666	1710- 1780	PASS
Band66	15MHz	16QAM	132322	75RB#0	NV	50	1738.29 784	1751.67 084	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-30	1765.80 662	1779.16 562	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-20	1765.81 614	1779.16 414	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	-10	1765.79 702	1779.16 102	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	0	1765.80 304	1779.16 404	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	10	1765.81 583	1779.15 383	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	20	1765.80 875	1779.16 875	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	30	1765.80 818	1779.16 418	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	40	1765.81 487	1779.15 687	1710- 1780	PASS
Band66	15MHz	QPSK	132597	75RB#0	NV	50	1765.80 611	1779.17 711	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	-30	1765.80 509	1779.17 109	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	-20	1765.80 747	1779.15 647	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	-10	1765.80 681	1779.17 181	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	0	1765.80 892	1779.16 492	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	15MHz	16QAM	132597	75RB#0	NV	10	1765.81 212	1779.18 112	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	20	1765.79 417	1779.17 717	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	30	1765.81 701	1779.17 101	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	40	1765.81 343	1779.16 643	1710- 1780	PASS
Band66	15MHz	16QAM	132597	75RB#0	NV	50	1765.80 52	1779.16 92	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-30	1711.08 79	1728.91 09	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-20	1711.09 823	1728.91 023	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	-10	1711.08 544	1728.90 044	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	0	1711.09 008	1728.89 408	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	10	1711.08 619	1728.90 719	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	20	1711.08 163	1728.90 263	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	30	1711.07 953	1728.90 653	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	40	1711.07 686	1728.90 286	1710- 1780	PASS
Band66	20MHz	QPSK	132072	100RB#0	NV	50	1711.07 995	1728.91 395	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	-30	1711.07 072	1728.91 772	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	-20	1711.04 627	1728.90 527	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	-10	1711.04 752	1728.92 152	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	0	1711.07 277	1728.90 877	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	10	1711.06 724	1728.92 124	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	20	1711.07 335	1728.90 735	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	30	1711.05 719	1728.91 119	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	20MHz	16QAM	132072	100RB#0	NV	40	1711.07 145	1728.92 045	1710- 1780	PASS
Band66	20MHz	16QAM	132072	100RB#0	NV	50	1711.06 792	1728.91 992	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-30	1736.06 898	1753.88 998	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-20	1736.07 168	1753.86 868	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-10	1736.10 223	1753.89 923	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	0	1736.09 877	1753.89 477	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	10	1736.06 919	1753.88 019	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	20	1736.08 189	1753.90 989	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	30	1736.07 455	1753.90 755	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	40	1736.07 763	1753.87 663	1710- 1780	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	50	1736.08 398	1753.90 598	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	-30	1736.08 642	1753.87 142	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	-20	1736.08 945	1753.90 345	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	-10	1736.07 977	1753.91 277	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	0	1736.09 2	1753.91 7	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	10	1736.08 438	1753.93 738	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	20	1736.08 861	1753.89 461	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	30	1736.08 045	1753.91 345	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	40	1736.08 302	1753.89 602	1710- 1780	PASS
Band66	20MHz	16QAM	132322	100RB#0	NV	50	1736.10 706	1753.86 906	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-30	1761.09 328	1778.88 928	1710- 1780	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	20MHz	QPSK	132572	100RB#0	NV	-20	1761.09 311	1778.88 511	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	-10	1761.09 776	1778.87 876	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	0	1761.10 457	1778.89 457	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	10	1761.10 374	1778.89 374	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	20	1761.09 629	1778.88 129	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	30	1761.10 199	1778.89 999	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	40	1761.10 833	1778.88 833	1710- 1780	PASS
Band66	20MHz	QPSK	132572	100RB#0	NV	50	1761.07 976	1778.88 676	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	-30	1761.11 992	1778.90 092	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	-20	1761.11 464	1778.90 064	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	-10	1761.11 855	1778.87 955	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	0	1761.12 692	1778.88 692	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	10	1761.13 073	1778.89 273	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	20	1761.10 768	1778.89 668	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	30	1761.11 911	1778.89 011	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	40	1761.11 879	1778.88 679	1710- 1780	PASS
Band66	20MHz	16QAM	132572	100RB#0	NV	50	1761.12 452	1778.89 652	1710- 1780	PASS

---END---