




Duty Cycle NVNT ax20 5500MHz Ant1

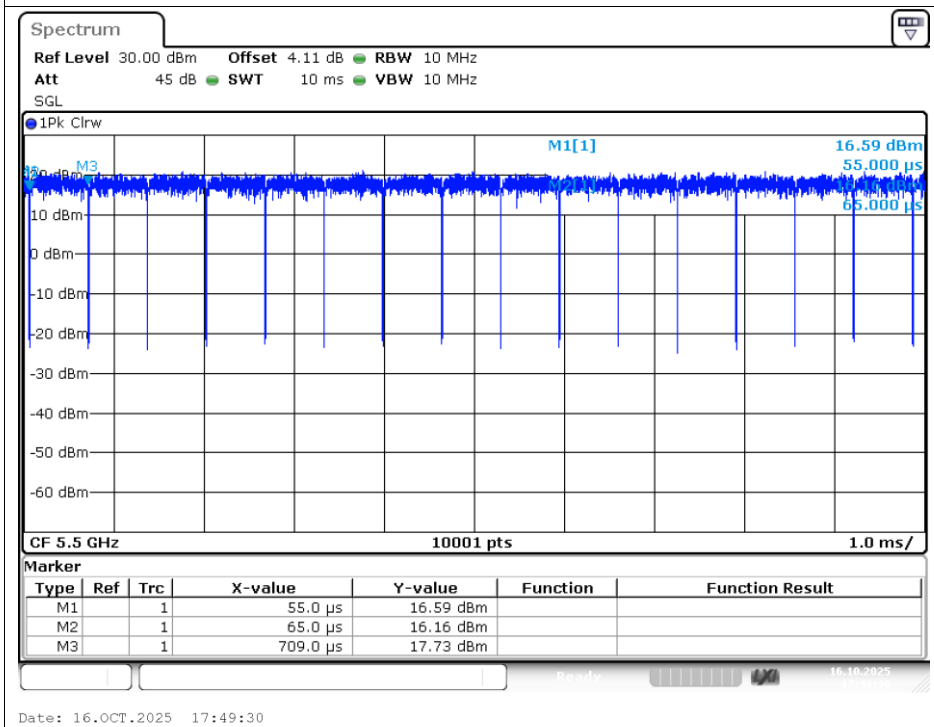


Duty Cycle NVNT ax20 5500MHz Ant2

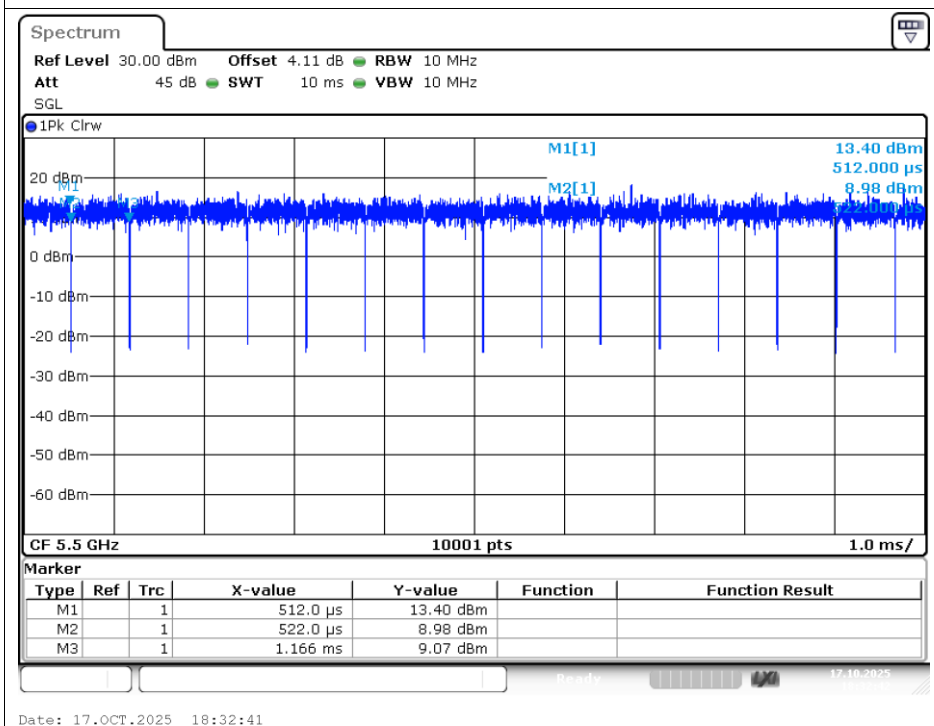


Duty Cycle NVNT ax20 5600MHz Ant1

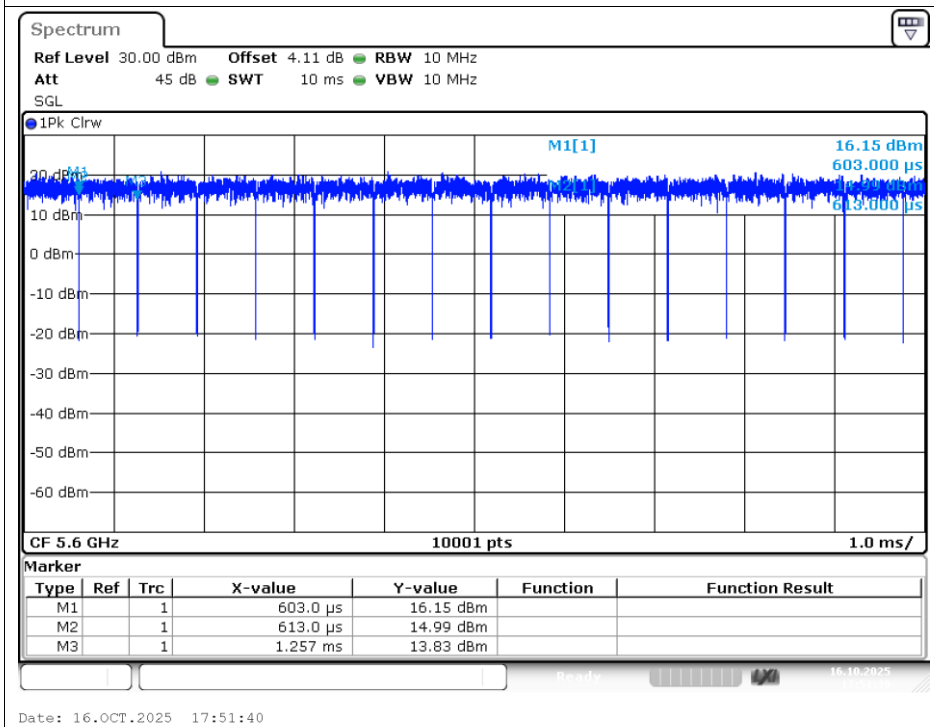


Duty Cycle NVNT ax20 5600MHz Ant2

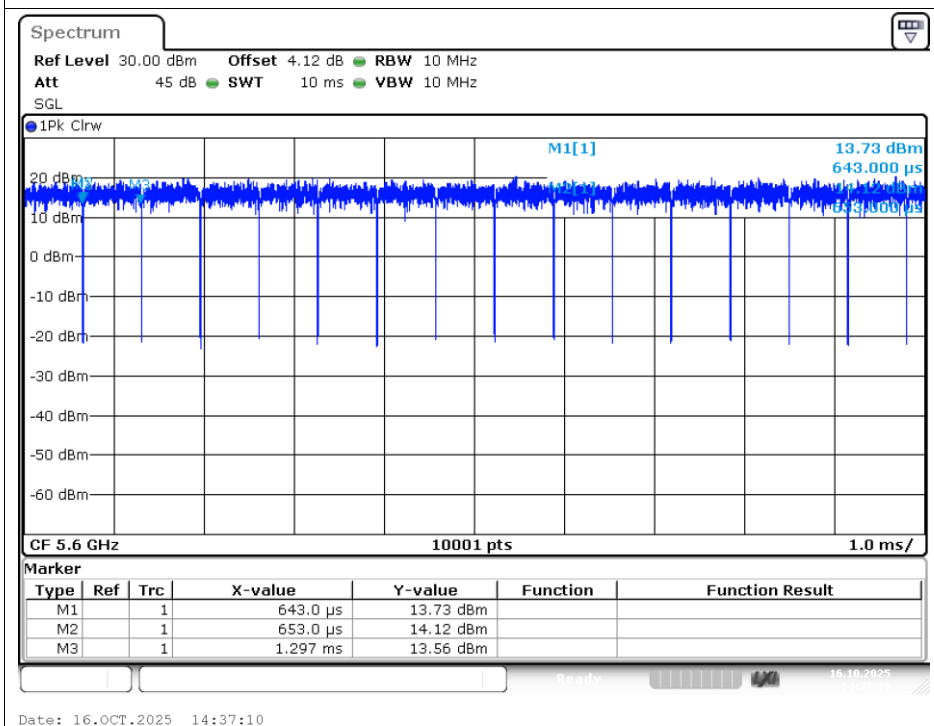


Duty Cycle NVNT ax20 5700MHz Ant1

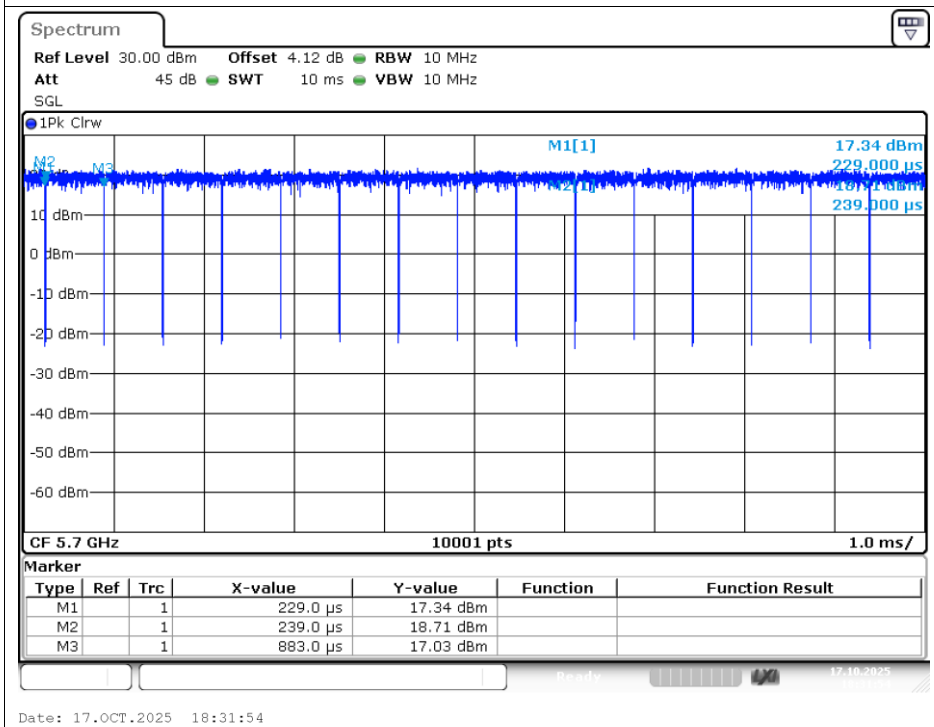


Duty Cycle NVNT ax20 5700MHz Ant2

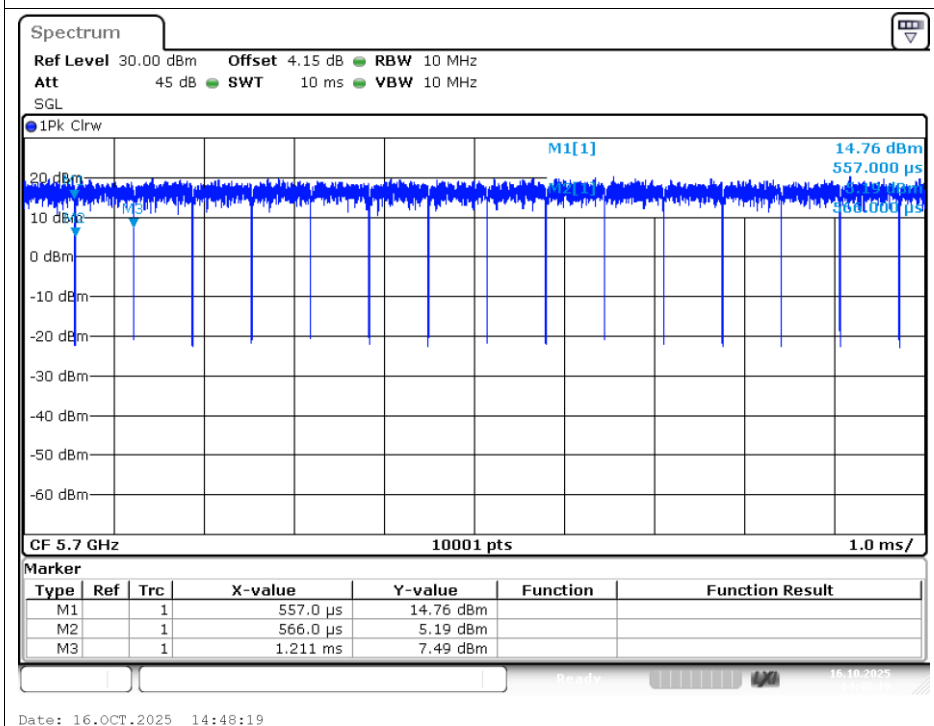


Duty Cycle NVNT ax20 5745MHz Ant1

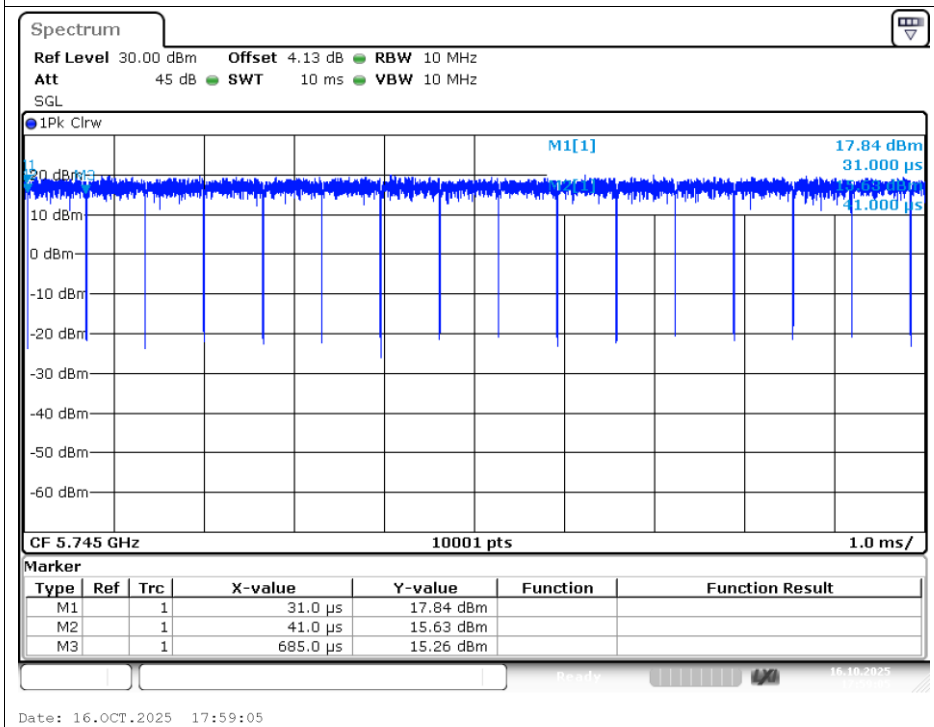


Duty Cycle NVNT ax20 5745MHz Ant2

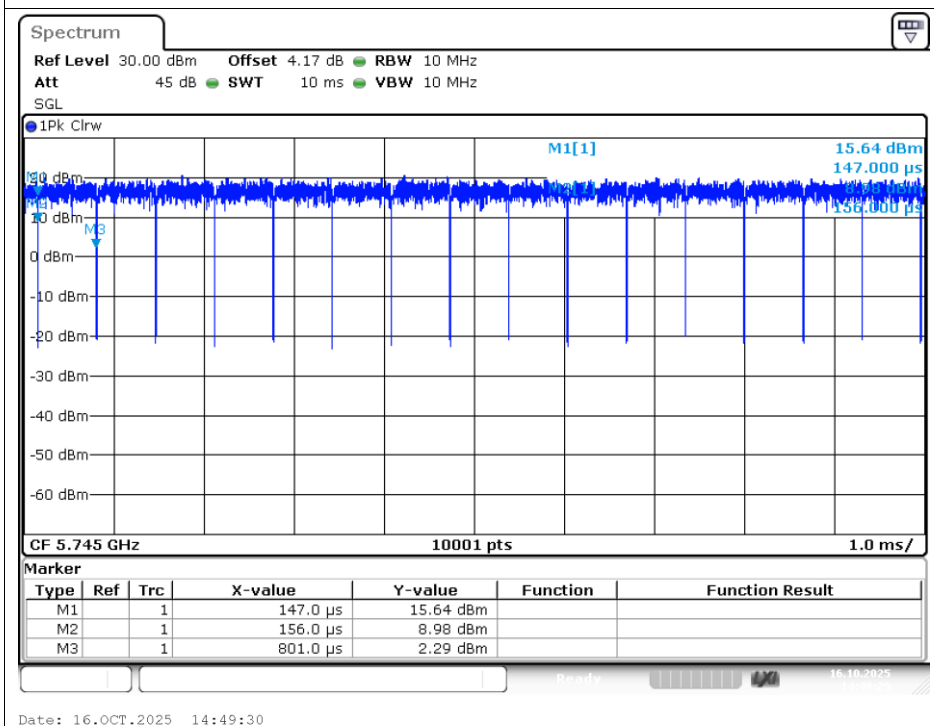


Duty Cycle NVNT ax20 5785MHz Ant1

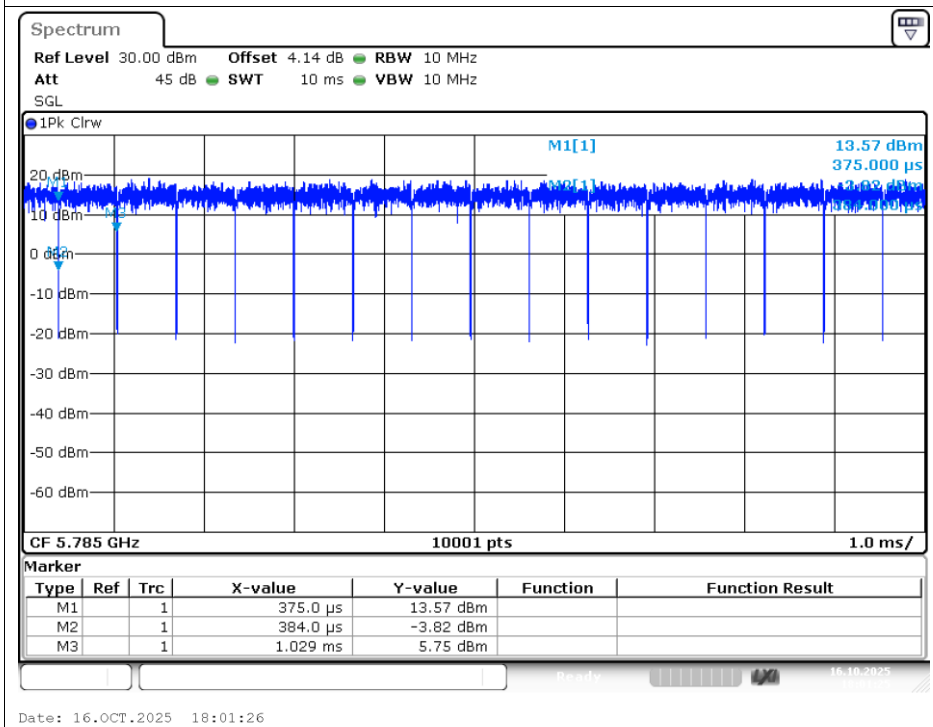


Duty Cycle NVNT ax20 5785MHz Ant2

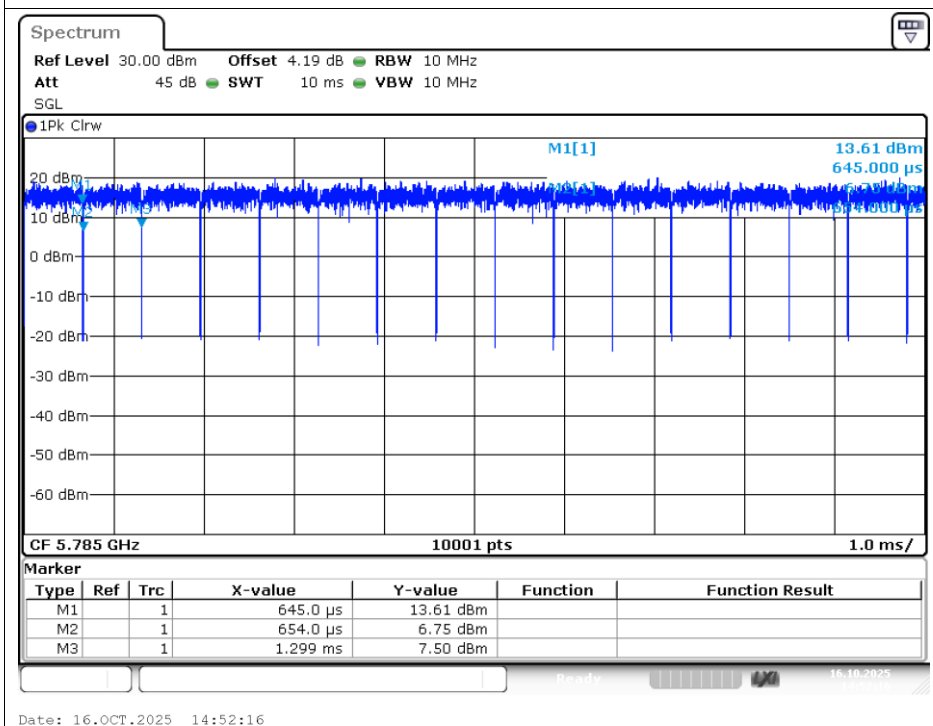


Duty Cycle NVNT ax20 5825MHz Ant1

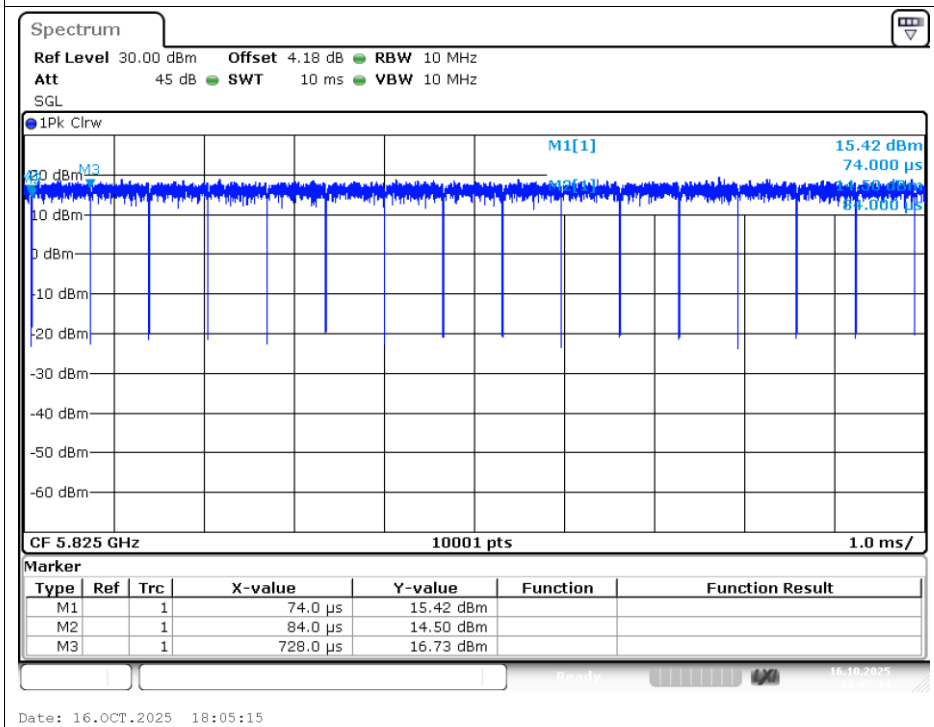


Duty Cycle NVNT ax20 5825MHz Ant2

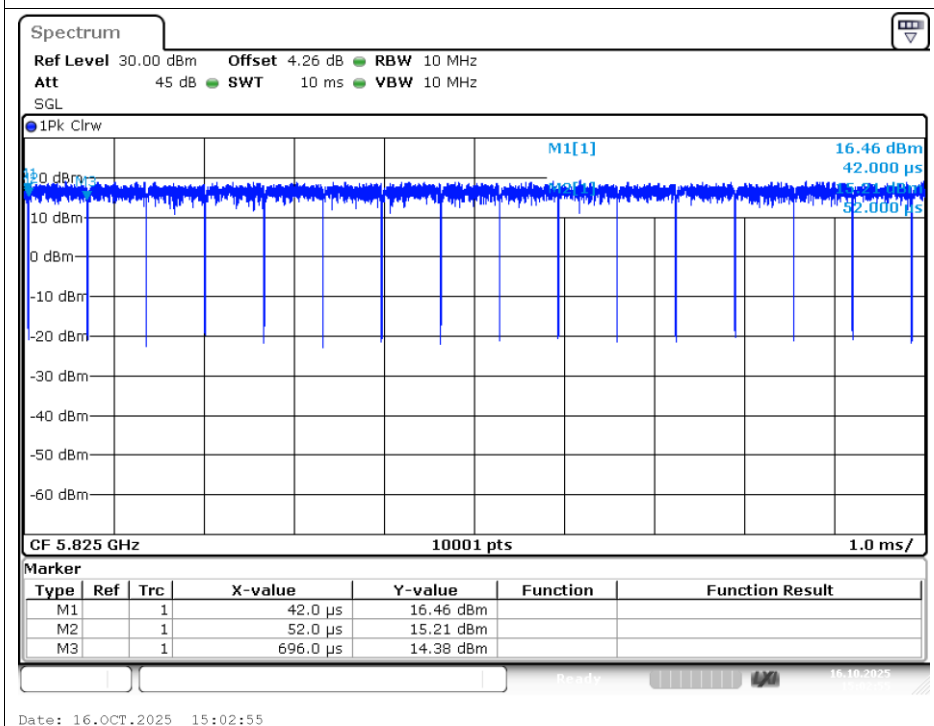


Duty Cycle NVNT ax40 5190MHz Ant1

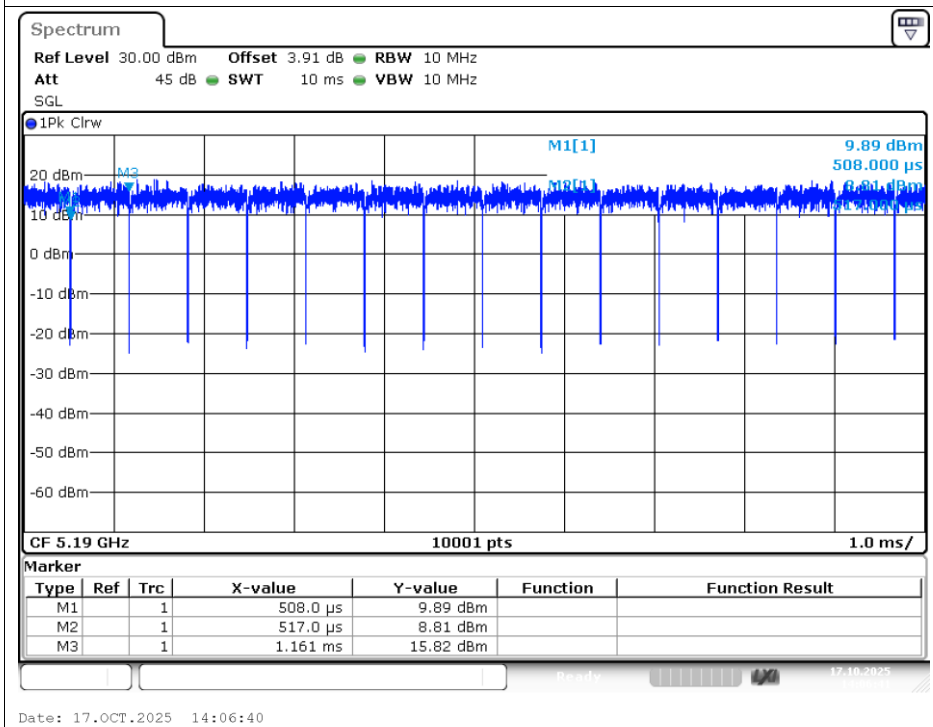


Duty Cycle NVNT ax40 5190MHz Ant2

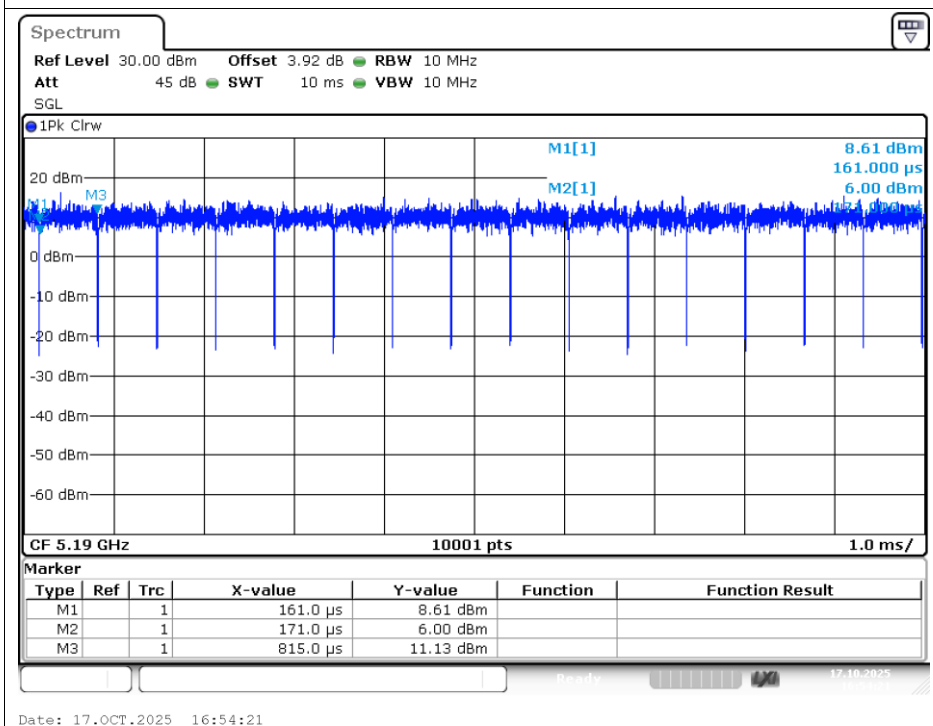


Duty Cycle NVNT ax40 5230MHz Ant1

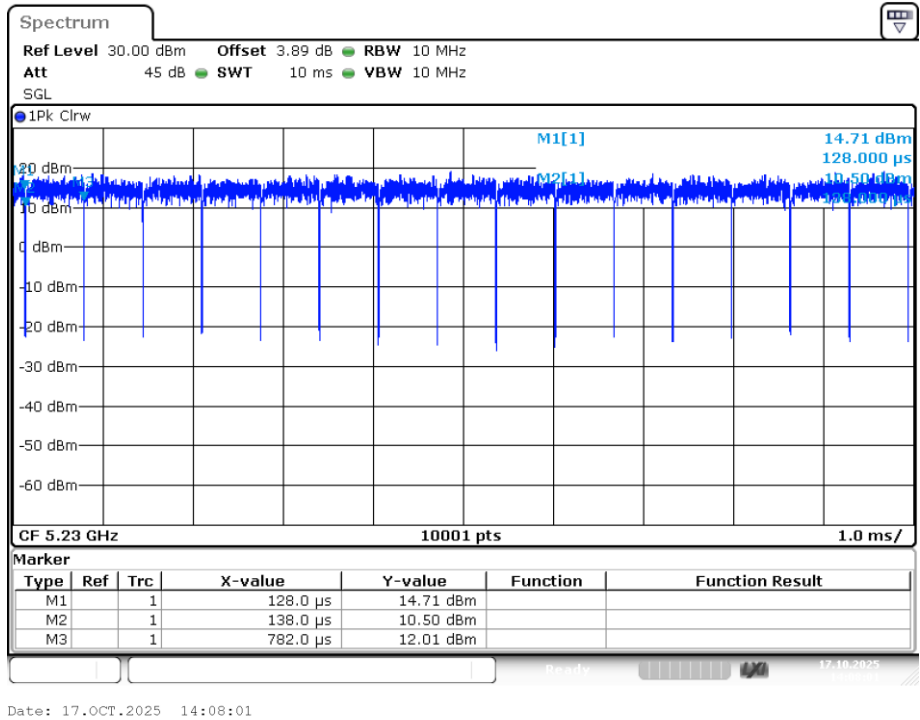


Duty Cycle NVNT ax40 5230MHz Ant2

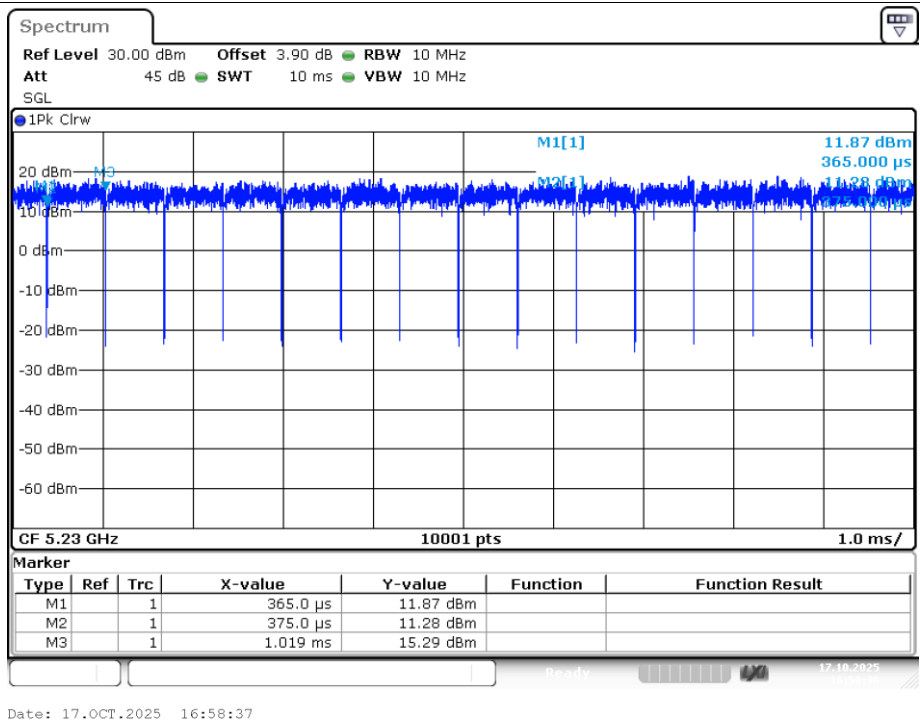


Duty Cycle NVNT ax40 5270MHz Ant1

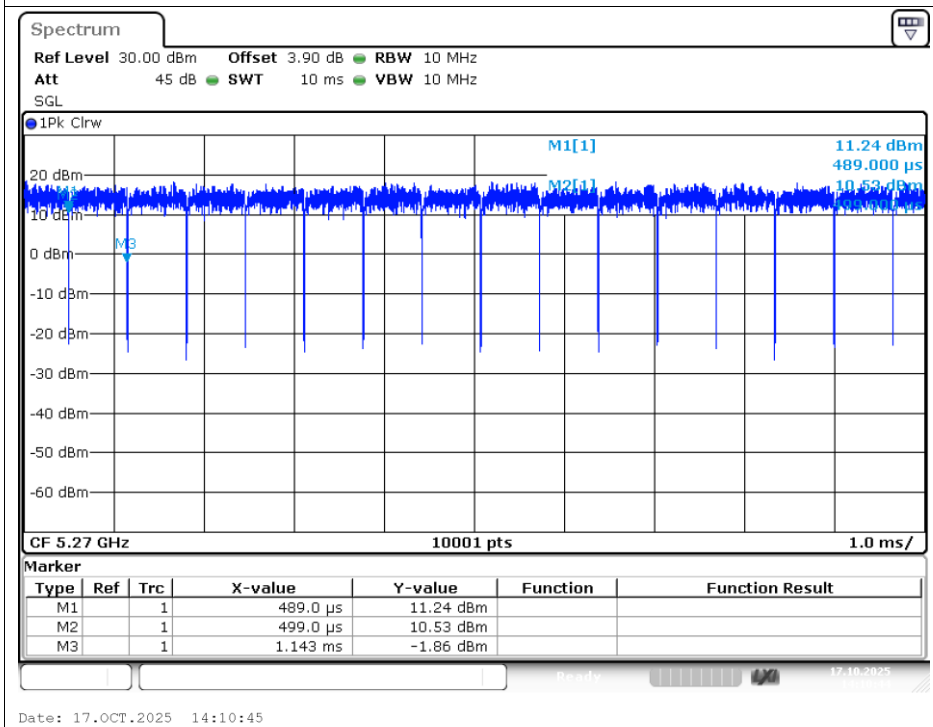


Duty Cycle NVNT ax40 5270MHz Ant2

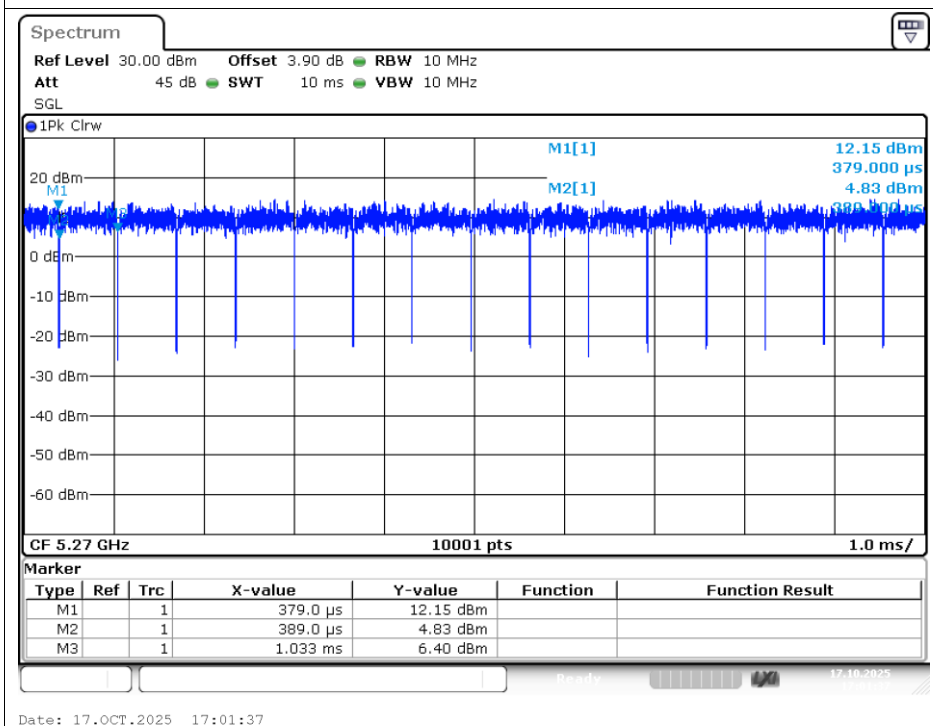


# Duty Cycle NVNT ax40 5310MHz Ant1

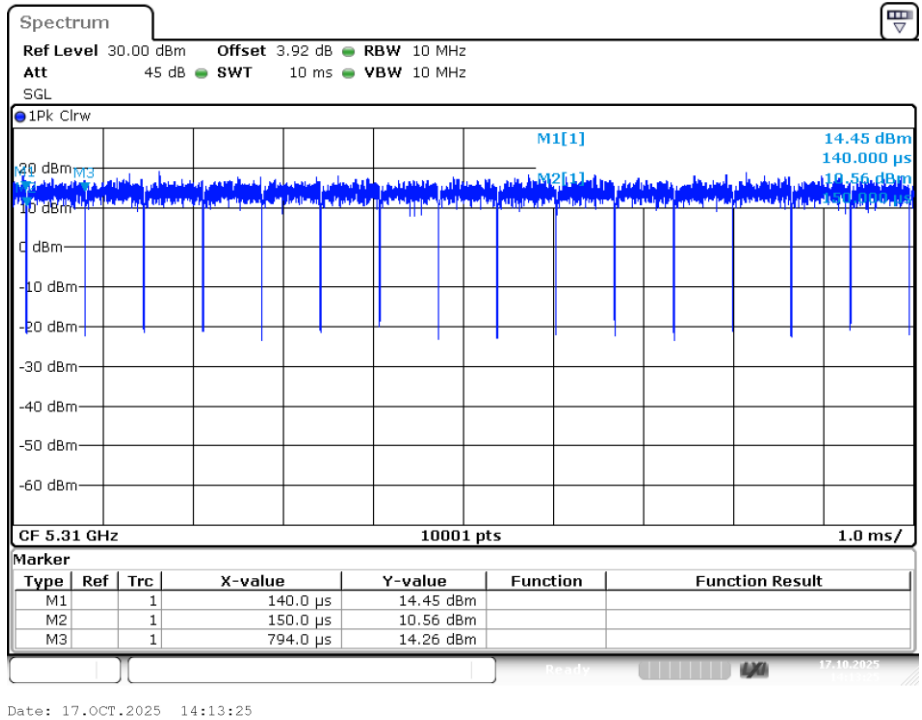


# Duty Cycle NVNT ax40 5310MHz Ant2

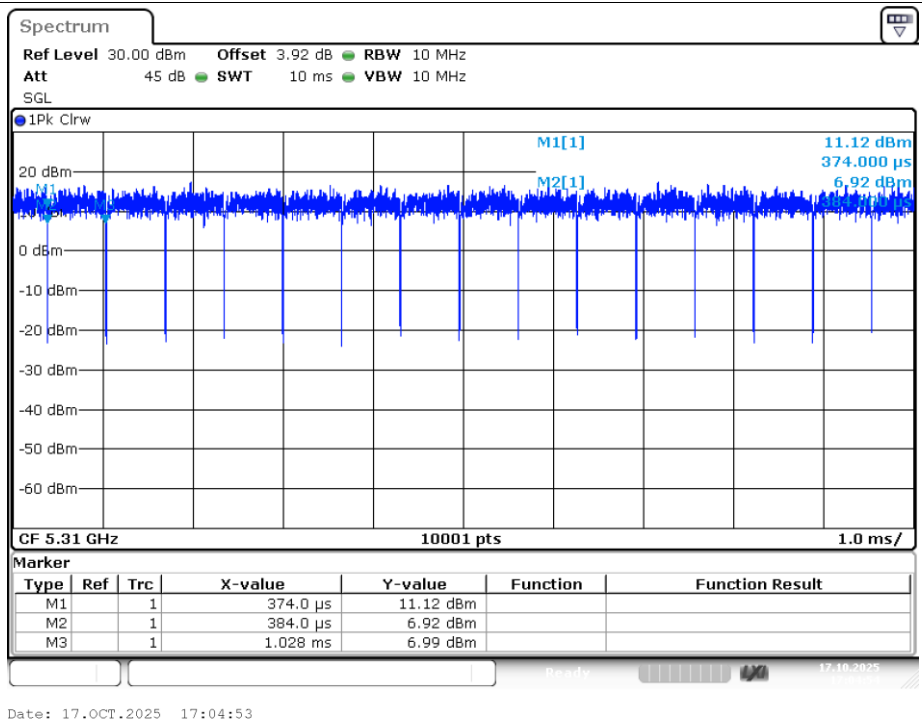


Duty Cycle NVNT ax40 5510MHz Ant1

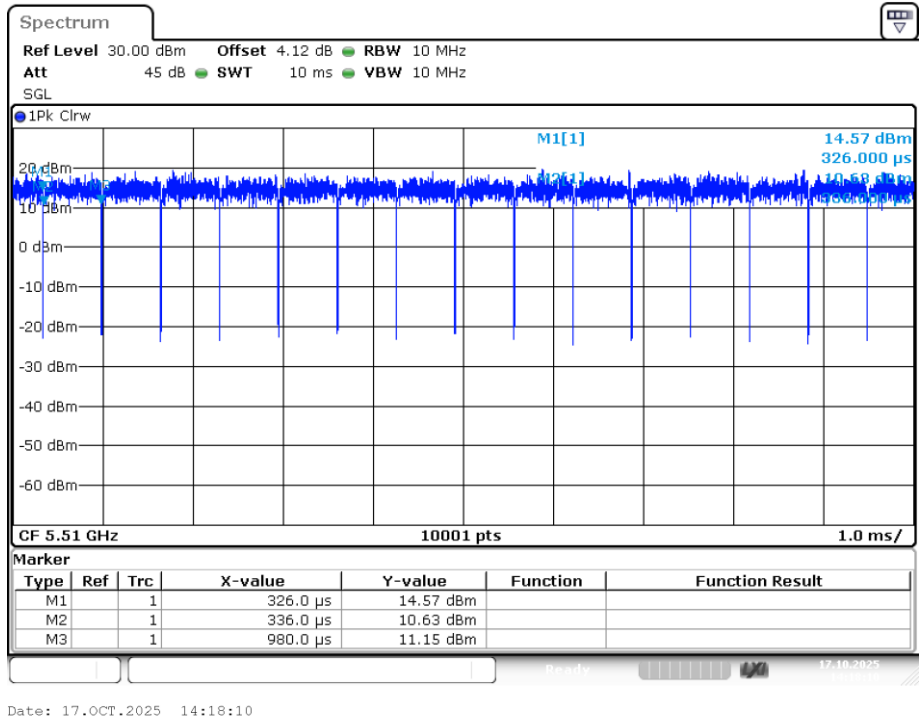


Duty Cycle NVNT ax40 5510MHz Ant2

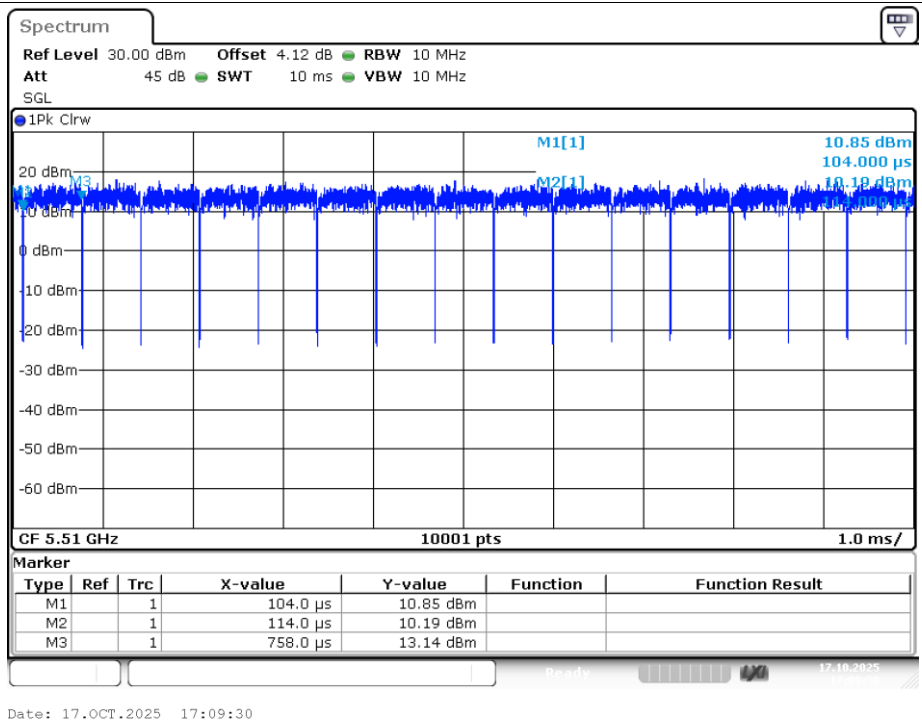


Duty Cycle NVNT ax40 5590MHz Ant1

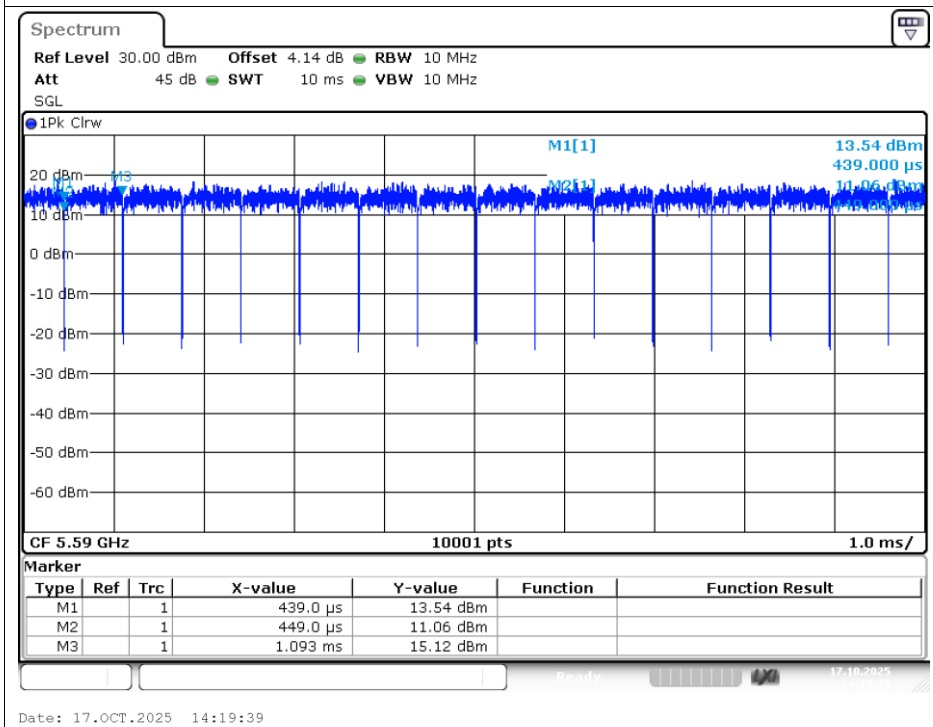


Duty Cycle NVNT ax40 5590MHz Ant2

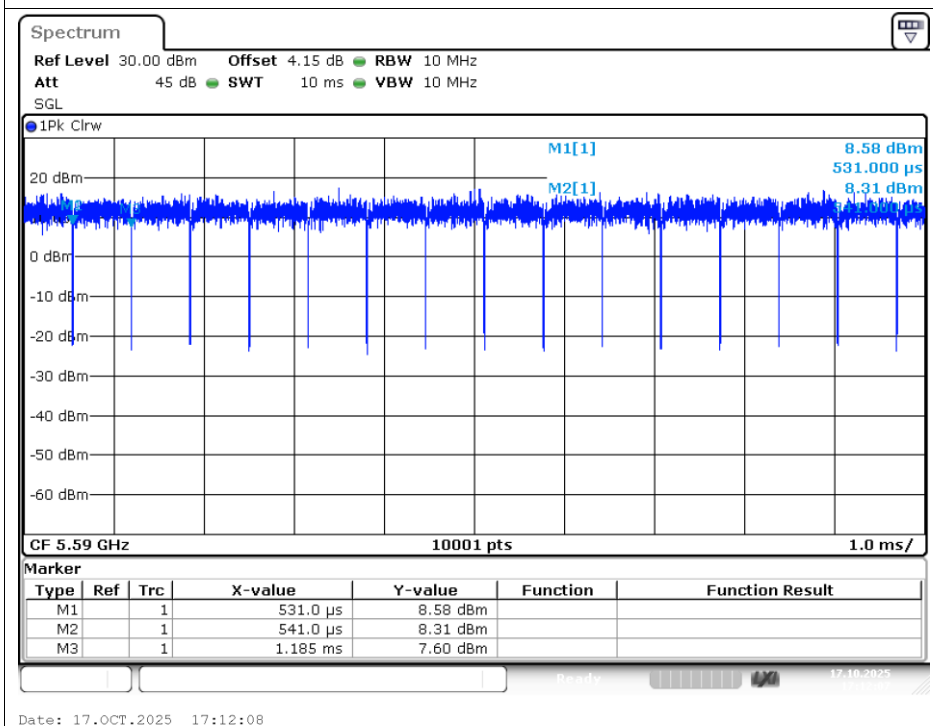


Duty Cycle NVNT ax40 5670MHz Ant1

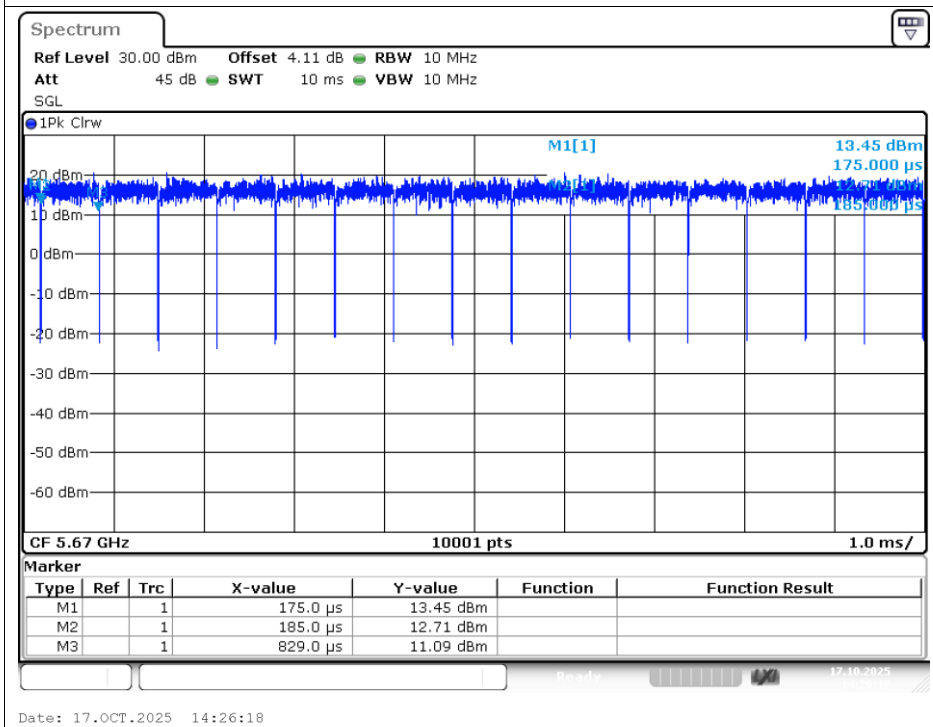


Duty Cycle NVNT ax40 5670MHz Ant2

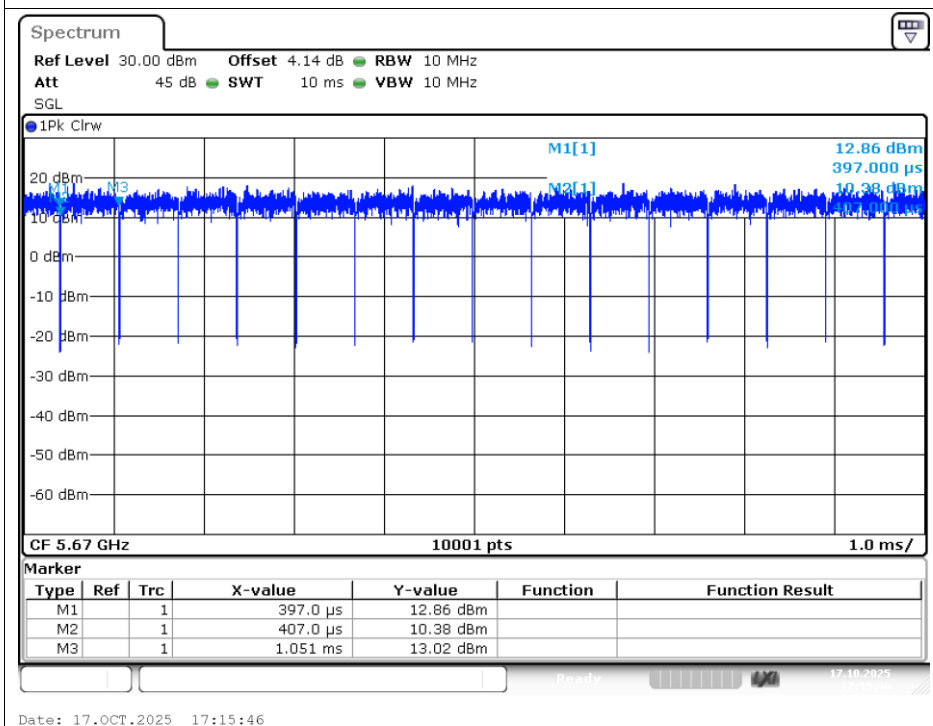


# Duty Cycle NVNT ax40 5755MHz Ant1

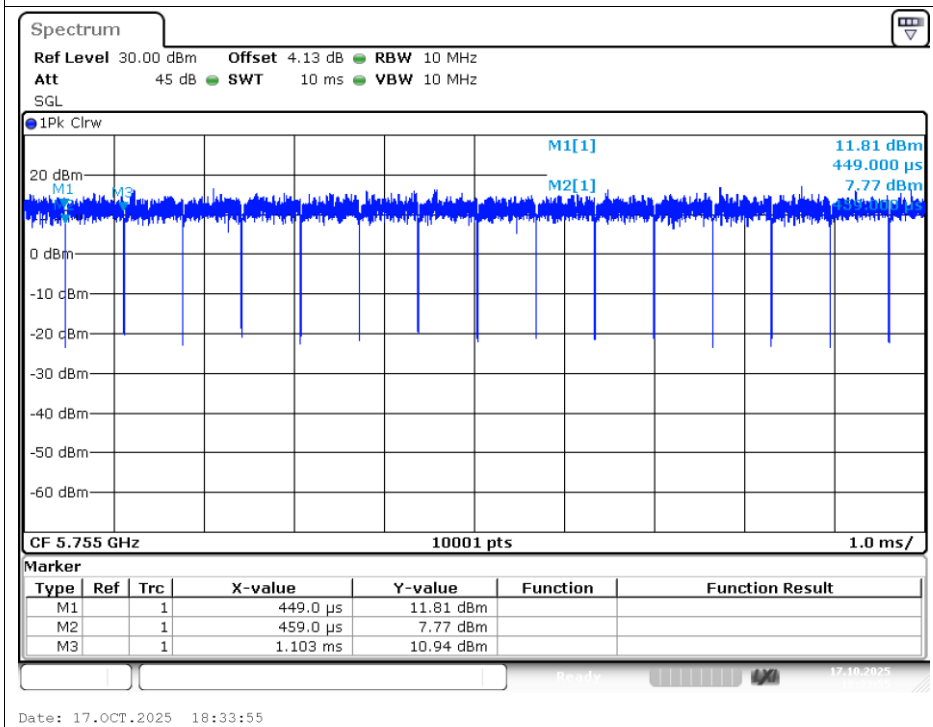


# Duty Cycle NVNT ax40 5755MHz Ant2

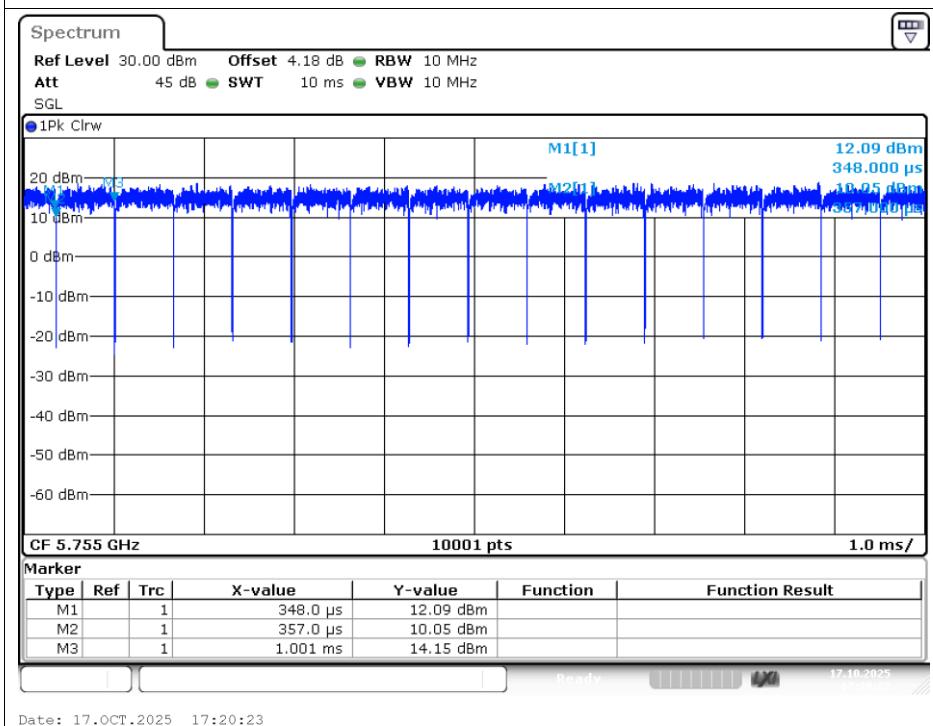


Duty Cycle NVNT ax40 5795MHz Ant1

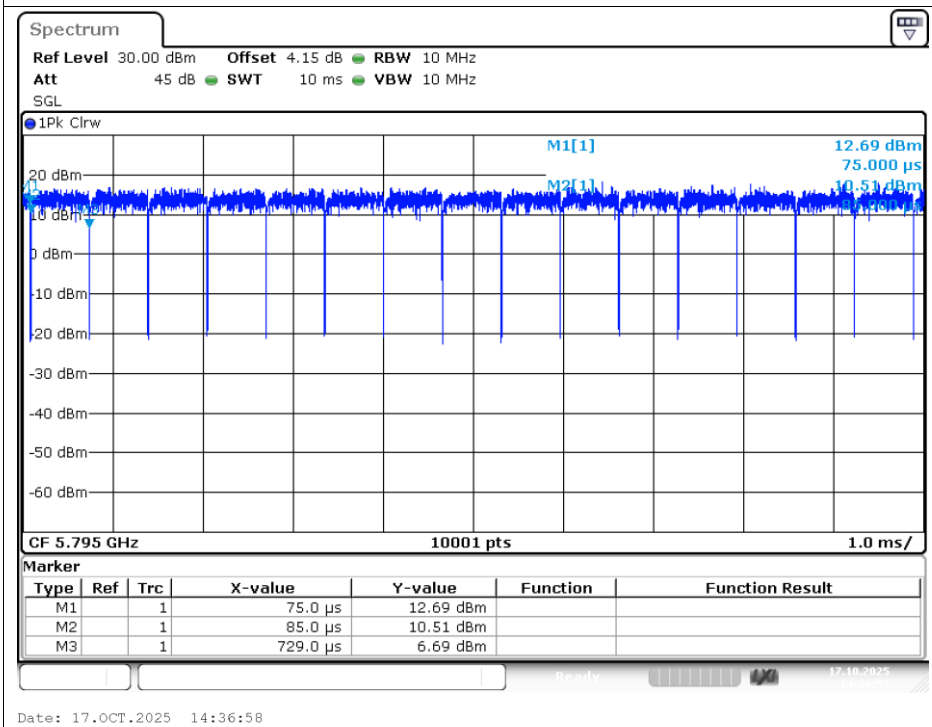


Duty Cycle NVNT ax40 5795MHz Ant2

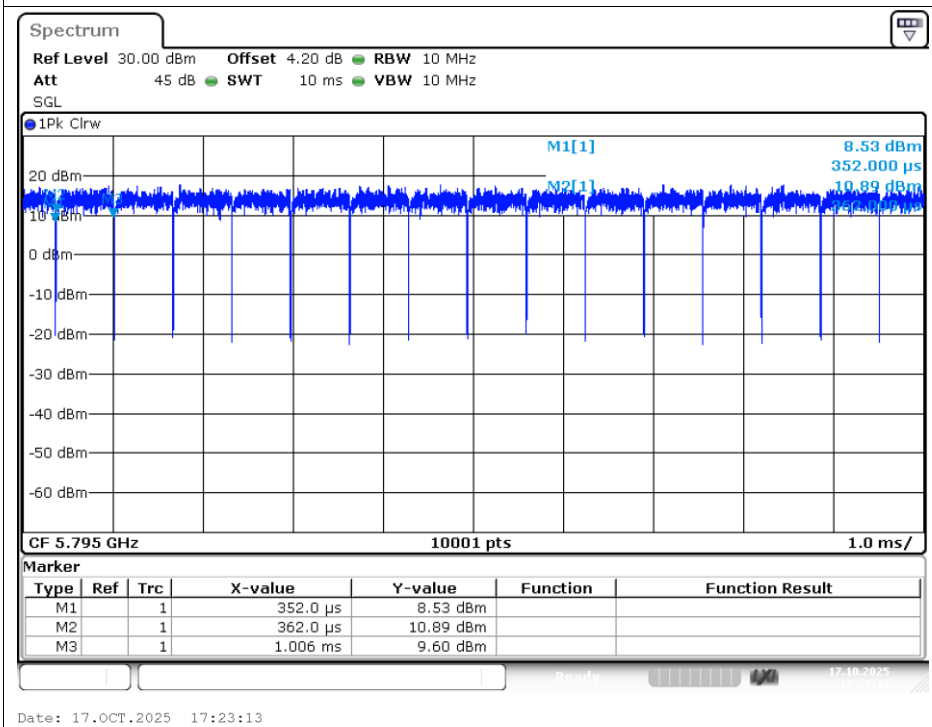


Duty Cycle NVNT ax80 5210MHz Ant1

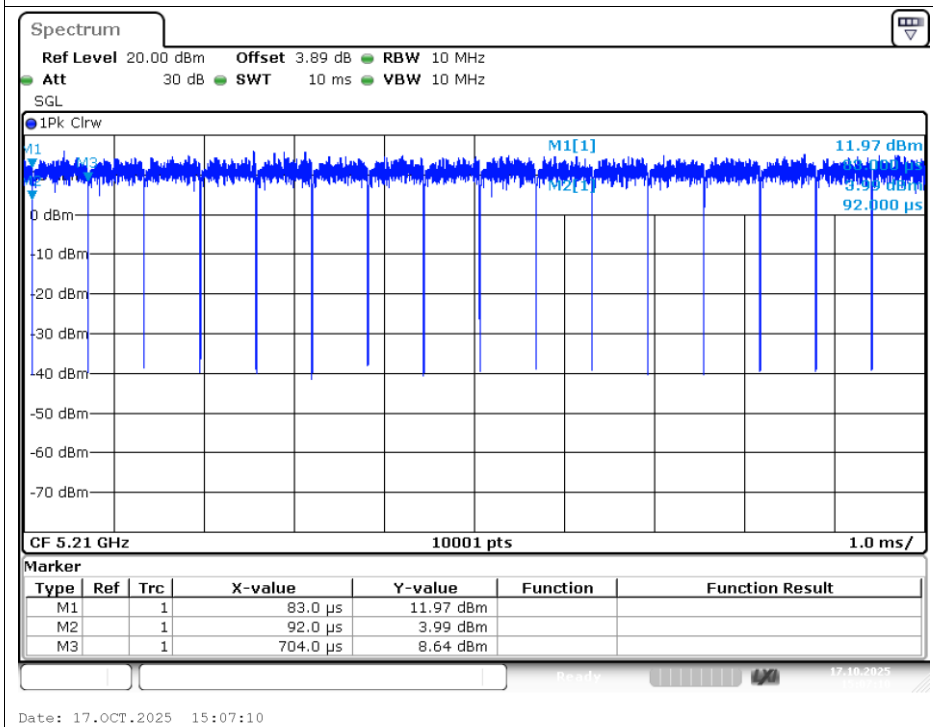


Duty Cycle NVNT ax80 5210MHz Ant2

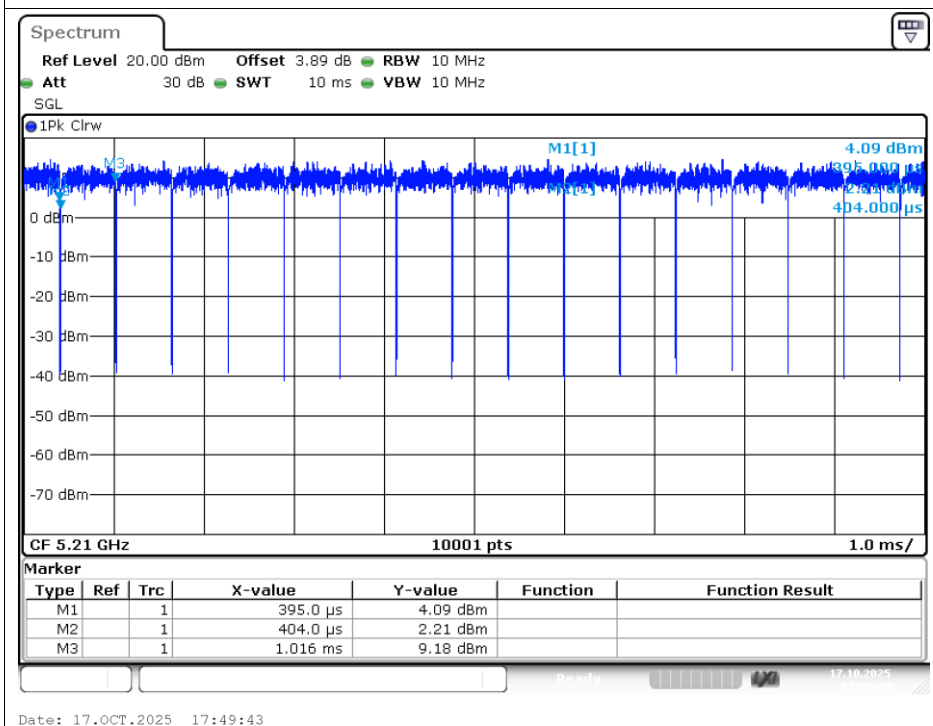


Duty Cycle NVNT ax80 5290MHz Ant1

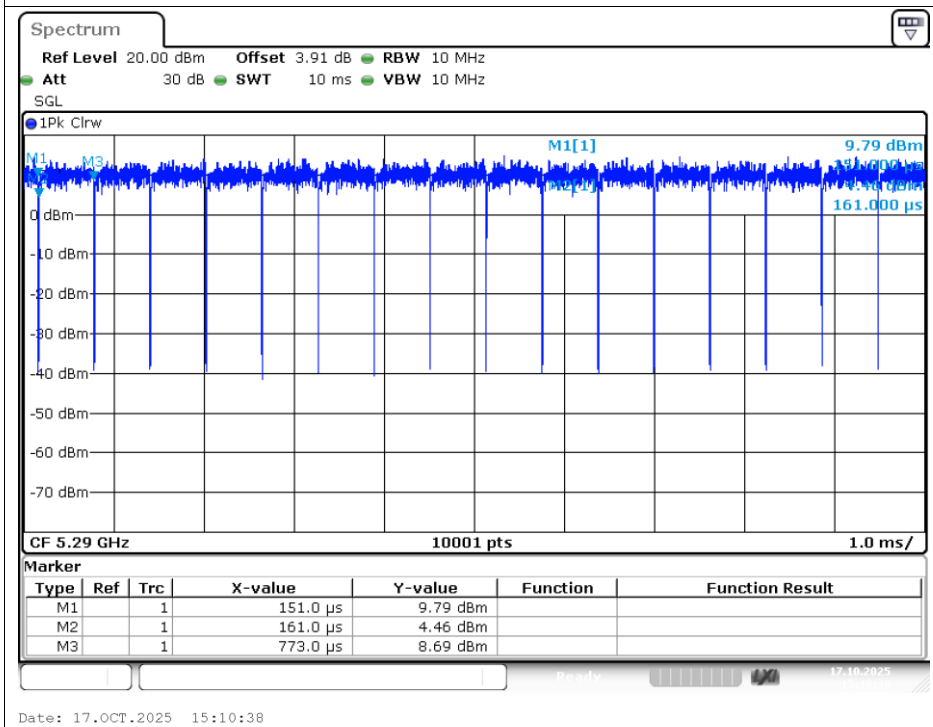


Duty Cycle NVNT ax80 5290MHz Ant2

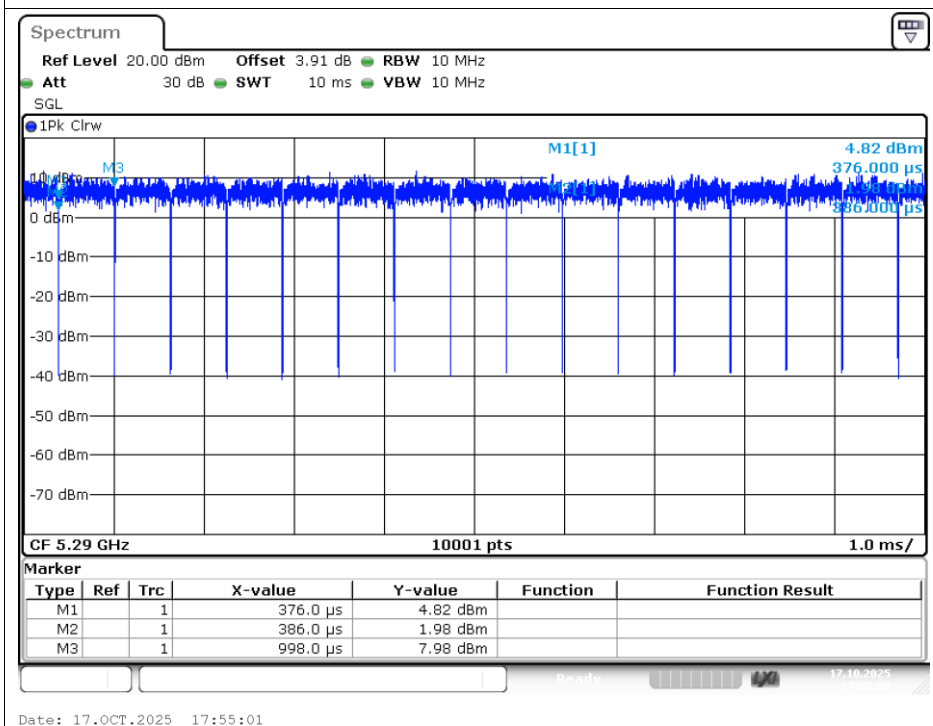


Duty Cycle NVNT ax80 5530MHz Ant1

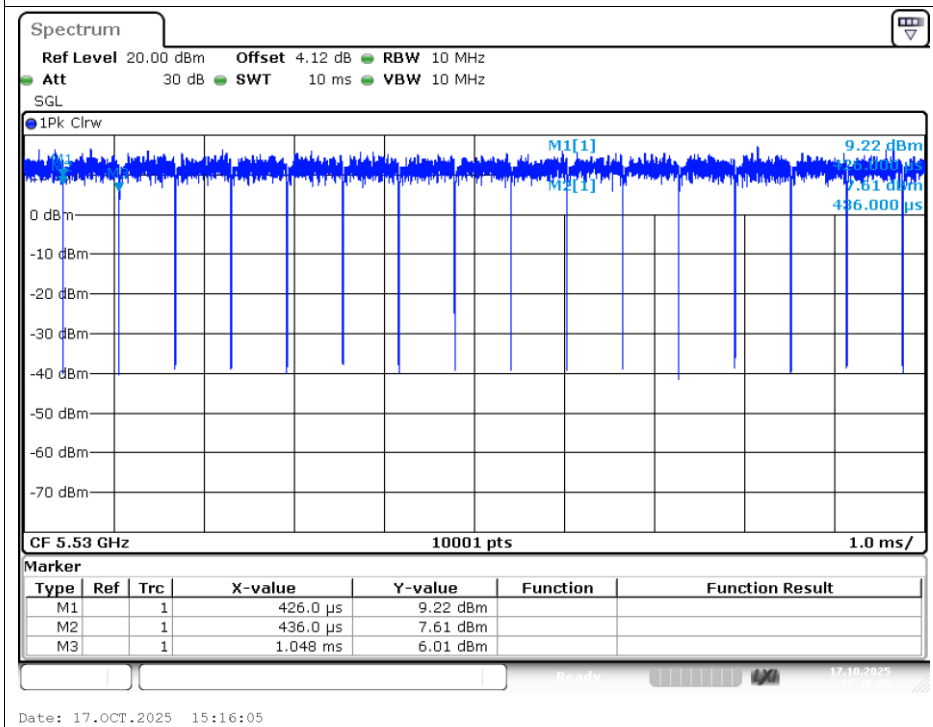


Duty Cycle NVNT ax80 5530MHz Ant2

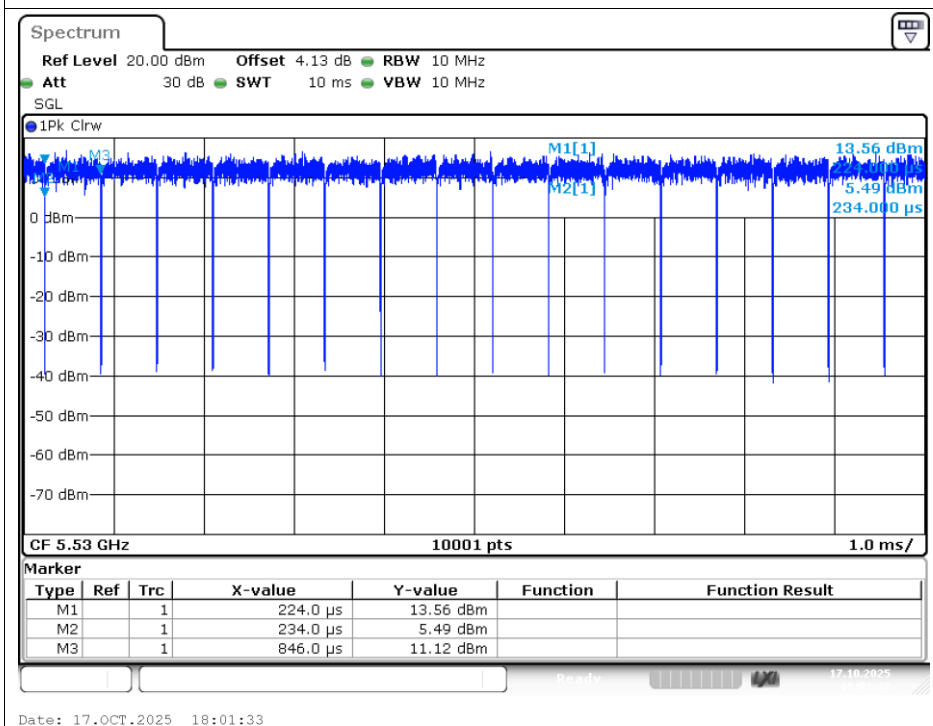


Duty Cycle NVNT ax80 5610MHz Ant1

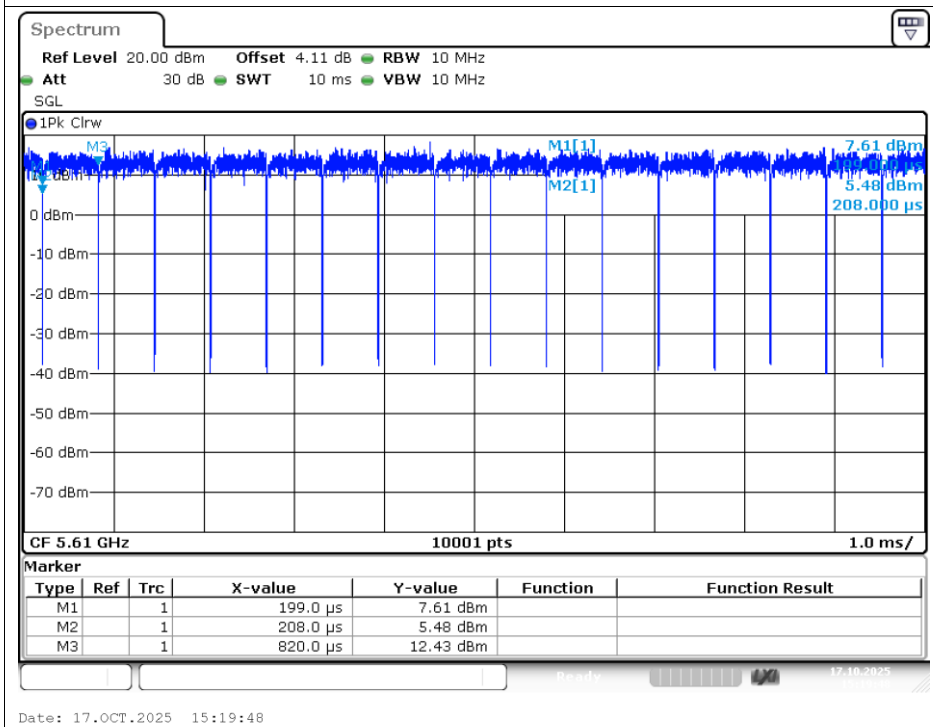


Duty Cycle NVNT ax80 5610MHz Ant2

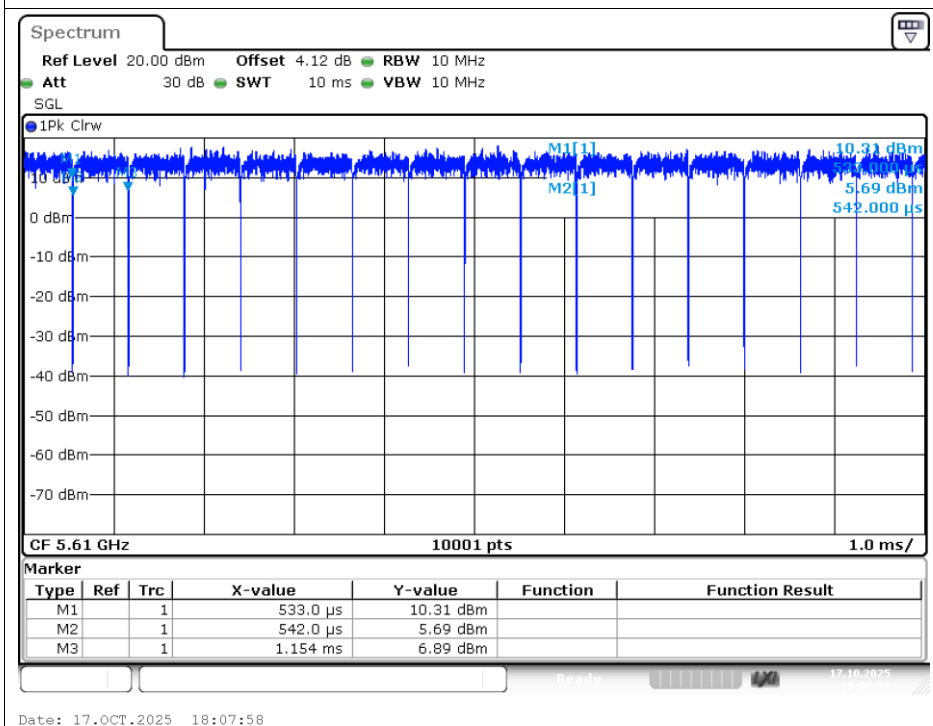

Duty Cycle NVNT ax80 5775MHz Ant1

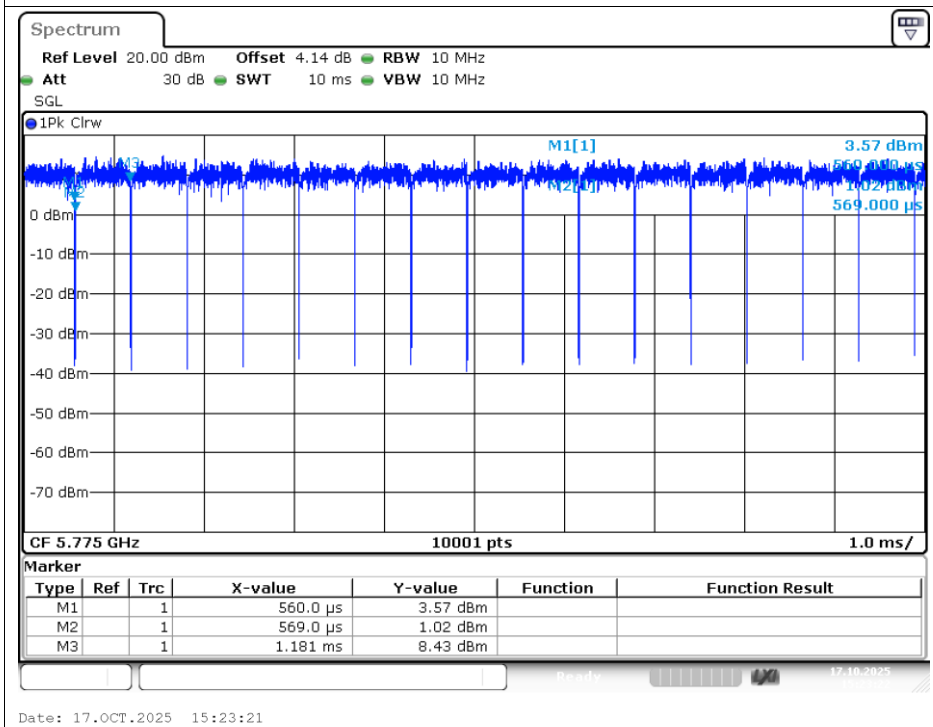

Duty Cycle NVNT ax80 5775MHz Ant2

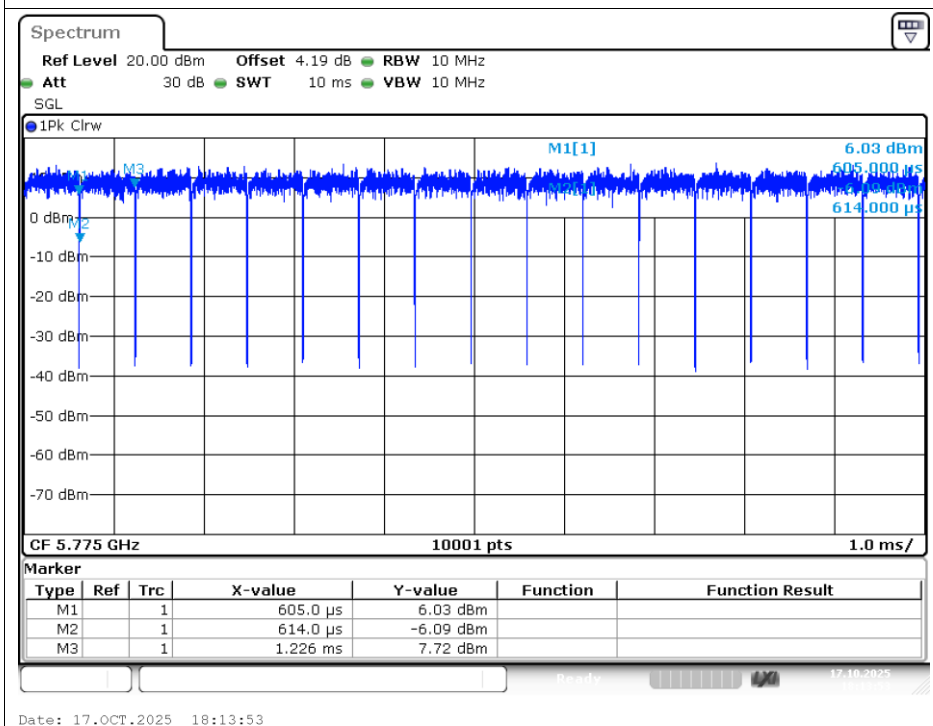

## Maximum Conducted Output Power

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Power (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-------------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | 13.83                 | 0                | 13.83             | 24          | Pass    |
| NVNT      | a    | 5180            | Ant2    | 13.23                 | 0                | 13.23             | 24          | Pass    |
| NVNT      | a    | 5200            | Ant1    | 13.15                 | 0                | 13.15             | 24          | Pass    |
| NVNT      | a    | 5200            | Ant2    | 13.88                 | 0                | 13.88             | 24          | Pass    |
| NVNT      | a    | 5240            | Ant1    | 13.46                 | 0                | 13.46             | 24          | Pass    |
| NVNT      | a    | 5240            | Ant2    | 13.62                 | 0                | 13.62             | 24          | Pass    |
| NVNT      | a    | 5260            | Ant1    | 14                    | 0                | 14                | 24          | Pass    |
| NVNT      | a    | 5260            | Ant2    | 15.01                 | 0                | 15.01             | 24          | Pass    |
| NVNT      | a    | 5280            | Ant1    | 13.49                 | 0                | 13.49             | 24          | Pass    |
| NVNT      | a    | 5280            | Ant2    | 13.01                 | 0                | 13.01             | 24          | Pass    |
| NVNT      | a    | 5320            | Ant1    | 14.27                 | 0                | 14.27             | 24          | Pass    |
| NVNT      | a    | 5320            | Ant2    | 13.98                 | 0                | 13.98             | 24          | Pass    |
| NVNT      | a    | 5500            | Ant1    | 14.31                 | 0                | 14.31             | 24          | Pass    |
| NVNT      | a    | 5500            | Ant2    | 14.25                 | 0                | 14.25             | 24          | Pass    |
| NVNT      | a    | 5600            | Ant1    | 13.75                 | 0                | 13.75             | 24          | Pass    |
| NVNT      | a    | 5600            | Ant2    | 14.21                 | 0                | 14.21             | 24          | Pass    |
| NVNT      | a    | 5700            | Ant1    | 13.97                 | 0                | 13.97             | 24          | Pass    |
| NVNT      | a    | 5700            | Ant2    | 14.38                 | 0                | 14.38             | 24          | Pass    |
| NVNT      | a    | 5745            | Ant1    | 13.24                 | 0                | 13.24             | 30          | Pass    |
| NVNT      | a    | 5745            | Ant2    | 14.29                 | 0                | 14.29             | 30          | Pass    |
| NVNT      | a    | 5785            | Ant1    | 13.38                 | 0                | 13.38             | 30          | Pass    |
| NVNT      | a    | 5785            | Ant2    | 13.62                 | 0                | 13.62             | 30          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 14.44                 | 0                | 14.44             | 30          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 14.52                 | 0                | 14.52             | 30          | Pass    |
| NVNT      | n20  | 5180            | Ant1    | 11.25                 | 0.13             | 11.38             | 24          | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 11.92                 | 0.13             | 12.05             | 24          | Pass    |
| NVNT      | n20  | 5180            | Sum     | 14.61                 | -                | 14.74             | 22.67       | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 12.27                 | 0.13             | 12.4              | 24          | Pass    |
| NVNT      | n20  | 5200            | Ant2    | 10.54                 | 0.13             | 10.67             | 24          | Pass    |
| NVNT      | n20  | 5200            | Sum     | 14.5                  | -                | 14.63             | 22.67       | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 12                    | 0.13             | 12.13             | 24          | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 12.61                 | 0.13             | 12.74             | 24          | Pass    |
| NVNT      | n20  | 5240            | Sum     | 15.33                 | -                | 15.46             | 22.67       | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 12.42                 | 0.13             | 12.55             | 24          | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 12.68                 | 0.13             | 12.81             | 24          | Pass    |
| NVNT      | n20  | 5260            | Sum     | 14.83                 | -                | 15.69             | 22.67       | Pass    |
| NVNT      | n20  | 5280            | Ant1    | 11.48                 | 0.13             | 11.61             | 24          | Pass    |
| NVNT      | n20  | 5280            | Ant2    | 11.36                 | 0.13             | 11.49             | 24          | Pass    |
| NVNT      | n20  | 5280            | Sum     | 14.43                 | -                | 14.56             | 22.67       | Pass    |

|      |     |      |      |       |      |       |       |      |
|------|-----|------|------|-------|------|-------|-------|------|
| NVNT | n20 | 5320 | Ant1 | 10.93 | 0.13 | 11.06 | 24    | Pass |
| NVNT | n20 | 5320 | Ant2 | 11.35 | 0.13 | 11.48 | 24    | Pass |
| NVNT | n20 | 5320 | Sum  | 14.16 | -    | 14.29 | 22.67 | Pass |
| NVNT | n20 | 5500 | Ant1 | 12.75 | 0.13 | 12.88 | 24    | Pass |
| NVNT | n20 | 5500 | Ant2 | 12.14 | 0.13 | 12.27 | 24    | Pass |
| NVNT | n20 | 5500 | Sum  | 15.71 | -    | 15.6  | 22.67 | Pass |
| NVNT | n20 | 5600 | Ant1 | 12.47 | 0.13 | 12.6  | 24    | Pass |
| NVNT | n20 | 5600 | Ant2 | 12.26 | 0.13 | 12.39 | 24    | Pass |
| NVNT | n20 | 5600 | Sum  | 15.38 | -    | 15.51 | 22.67 | Pass |
| NVNT | n20 | 5700 | Ant1 | 12.44 | 0.13 | 12.57 | 24    | Pass |
| NVNT | n20 | 5700 | Ant2 | 12.55 | 0.13 | 12.68 | 24    | Pass |
| NVNT | n20 | 5700 | Sum  | 15.51 | -    | 15.64 | 22.67 | Pass |
| NVNT | n20 | 5745 | Ant1 | 12.7  | 0.13 | 12.83 | 30    | Pass |
| NVNT | n20 | 5745 | Ant2 | 12.27 | 0.13 | 12.4  | 30    | Pass |
| NVNT | n20 | 5745 | Sum  | 16    | -    | 15.63 | 28.67 | Pass |
| NVNT | n20 | 5785 | Ant1 | 12.59 | 0.13 | 12.72 | 30    | Pass |
| NVNT | n20 | 5785 | Ant2 | 12.46 | 0.13 | 12.59 | 30    | Pass |
| NVNT | n20 | 5785 | Sum  | 15.54 | -    | 15.67 | 28.67 | Pass |
| NVNT | n20 | 5825 | Ant1 | 12.57 | 0.13 | 12.7  | 30    | Pass |
| NVNT | n20 | 5825 | Ant2 | 12.35 | 0.13 | 12.48 | 30    | Pass |
| NVNT | n20 | 5825 | Sum  | 15.47 | -    | 15.6  | 28.67 | Pass |
| NVNT | n40 | 5190 | Ant1 | 10.14 | 0.14 | 10.28 | 24    | Pass |
| NVNT | n40 | 5190 | Ant2 | 9.82  | 0.14 | 9.96  | 24    | Pass |
| NVNT | n40 | 5190 | Sum  | 12.99 | -    | 13.13 | 22.67 | Pass |
| NVNT | n40 | 5230 | Ant1 | 11.15 | 0.14 | 11.29 | 24    | Pass |
| NVNT | n40 | 5230 | Ant2 | 11.69 | 0.14 | 11.83 | 24    | Pass |
| NVNT | n40 | 5230 | Sum  | 14.44 | -    | 14.58 | 22.67 | Pass |
| NVNT | n40 | 5270 | Ant1 | 11.27 | 0.14 | 11.41 | 24    | Pass |
| NVNT | n40 | 5270 | Ant2 | 11.14 | 0.14 | 11.28 | 24    | Pass |
| NVNT | n40 | 5270 | Sum  | 14.22 | -    | 14.36 | 22.67 | Pass |
| NVNT | n40 | 5310 | Ant1 | 11.3  | 0.14 | 11.44 | 24    | Pass |
| NVNT | n40 | 5310 | Ant2 | 11.19 | 0.14 | 11.33 | 24    | Pass |
| NVNT | n40 | 5310 | Sum  | 14.26 | -    | 14.4  | 22.67 | Pass |
| NVNT | n40 | 5510 | Ant1 | 11.72 | 0.14 | 11.86 | 24    | Pass |
| NVNT | n40 | 5510 | Ant2 | 10.81 | 0.14 | 10.95 | 24    | Pass |
| NVNT | n40 | 5510 | Sum  | 14.3  | -    | 14.44 | 22.67 | Pass |
| NVNT | n40 | 5590 | Ant1 | 10.37 | 0.14 | 10.51 | 24    | Pass |
| NVNT | n40 | 5590 | Ant2 | 9.74  | 0.14 | 9.88  | 24    | Pass |
| NVNT | n40 | 5590 | Sum  | 13.08 | -    | 13.22 | 22.67 | Pass |
| NVNT | n40 | 5670 | Ant1 | 11.39 | 0.14 | 11.53 | 24    | Pass |
| NVNT | n40 | 5670 | Ant2 | 11.25 | 0.14 | 11.39 | 24    | Pass |
| NVNT | n40 | 5670 | Sum  | 14.33 | -    | 14.47 | 22.67 | Pass |

|      |      |      |      |       |      |       |       |      |
|------|------|------|------|-------|------|-------|-------|------|
| NVNT | n40  | 5755 | Ant1 | 11.59 | 0.14 | 11.73 | 30    | Pass |
| NVNT | n40  | 5755 | Ant2 | 12.03 | 0.14 | 12.17 | 30    | Pass |
| NVNT | n40  | 5755 | Sum  | 14.83 | -    | 14.97 | 28.67 | Pass |
| NVNT | n40  | 5795 | Ant1 | 11.6  | 0.14 | 11.74 | 30    | Pass |
| NVNT | n40  | 5795 | Ant2 | 11.39 | 0.14 | 11.53 | 30    | Pass |
| NVNT | n40  | 5795 | Sum  | 14.51 | -    | 14.65 | 28.67 | Pass |
| NVNT | ac20 | 5180 | Ant1 | 11.24 | 0.12 | 11.36 | 24    | Pass |
| NVNT | ac20 | 5180 | Ant2 | 11.01 | 0.12 | 11.13 | 24    | Pass |
| NVNT | ac20 | 5180 | Sum  | 14.14 | -    | 14.26 | 22.67 | Pass |
| NVNT | ac20 | 5200 | Ant1 | 10.97 | 0.12 | 11.09 | 24    | Pass |
| NVNT | ac20 | 5200 | Ant2 | 12.03 | 0.12 | 12.15 | 24    | Pass |
| NVNT | ac20 | 5200 | Sum  | 14.54 | -    | 14.66 | 22.67 | Pass |
| NVNT | ac20 | 5240 | Ant1 | 12.21 | 0.12 | 12.33 | 24    | Pass |
| NVNT | ac20 | 5240 | Ant2 | 10.79 | 0.12 | 10.91 | 24    | Pass |
| NVNT | ac20 | 5240 | Sum  | 14.57 | -    | 14.69 | 22.67 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 10.37 | 0.12 | 10.49 | 24    | Pass |
| NVNT | ac20 | 5260 | Ant2 | 10.44 | 0.12 | 10.56 | 24    | Pass |
| NVNT | ac20 | 5260 | Sum  | 13.42 | -    | 13.54 | 22.67 | Pass |
| NVNT | ac20 | 5280 | Ant1 | 10.24 | 0.12 | 10.36 | 24    | Pass |
| NVNT | ac20 | 5280 | Ant2 | 10.56 | 0.12 | 10.68 | 24    | Pass |
| NVNT | ac20 | 5280 | Sum  | 13.41 | -    | 13.53 | 22.67 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 10.34 | 0.12 | 10.46 | 24    | Pass |
| NVNT | ac20 | 5320 | Ant2 | 10.38 | 0.12 | 10.5  | 24    | Pass |
| NVNT | ac20 | 5320 | Sum  | 13.37 | -    | 13.49 | 22.67 | Pass |
| NVNT | ac20 | 5500 | Ant1 | 11.94 | 0.12 | 12.06 | 24    | Pass |
| NVNT | ac20 | 5500 | Ant2 | 12.67 | 0.12 | 12.79 | 24    | Pass |
| NVNT | ac20 | 5500 | Sum  | 15.33 | -    | 15.45 | 22.67 | Pass |
| NVNT | ac20 | 5600 | Ant1 | 9.24  | 0.12 | 9.36  | 24    | Pass |
| NVNT | ac20 | 5600 | Ant2 | 11.65 | 0.12 | 11.77 | 24    | Pass |
| NVNT | ac20 | 5600 | Sum  | 13.62 | -    | 13.74 | 22.67 | Pass |
| NVNT | ac20 | 5700 | Ant1 | 11.21 | 0.12 | 11.33 | 24    | Pass |
| NVNT | ac20 | 5700 | Ant2 | 12.92 | 0.12 | 13.04 | 24    | Pass |
| NVNT | ac20 | 5700 | Sum  | 15.16 | -    | 15.28 | 22.67 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 11.84 | 0.12 | 11.96 | 30    | Pass |
| NVNT | ac20 | 5745 | Ant2 | 12.39 | 0.12 | 12.51 | 30    | Pass |
| NVNT | ac20 | 5745 | Sum  | 15.13 | -    | 15.25 | 28.67 | Pass |
| NVNT | ac20 | 5785 | Ant1 | 9.74  | 0.12 | 9.86  | 30    | Pass |
| NVNT | ac20 | 5785 | Ant2 | 11.67 | 0.12 | 11.79 | 30    | Pass |
| NVNT | ac20 | 5785 | Sum  | 13.82 | -    | 13.94 | 28.67 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 11.9  | 0.12 | 12.02 | 30    | Pass |
| NVNT | ac20 | 5825 | Ant2 | 11.05 | 0.12 | 11.17 | 30    | Pass |
| NVNT | ac20 | 5825 | Sum  | 14.51 | -    | 14.63 | 28.67 | Pass |

|      |      |      |      |       |      |       |       |      |
|------|------|------|------|-------|------|-------|-------|------|
| NVNT | ac40 | 5190 | Ant1 | 10.18 | 0.12 | 10.3  | 24    | Pass |
| NVNT | ac40 | 5190 | Ant2 | 10.59 | 0.12 | 10.71 | 24    | Pass |
| NVNT | ac40 | 5190 | Sum  | 13.4  | -    | 13.52 | 22.67 | Pass |
| NVNT | ac40 | 5230 | Ant1 | 10.01 | 0.12 | 10.13 | 24    | Pass |
| NVNT | ac40 | 5230 | Ant2 | 10    | 0.12 | 10.12 | 24    | Pass |
| NVNT | ac40 | 5230 | Sum  | 13.02 | -    | 13.14 | 22.67 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 10.26 | 0.12 | 10.38 | 24    | Pass |
| NVNT | ac40 | 5270 | Ant2 | 9.6   | 0.12 | 9.72  | 24    | Pass |
| NVNT | ac40 | 5270 | Sum  | 12.95 | -    | 13.07 | 22.67 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 10.13 | 0.12 | 10.25 | 24    | Pass |
| NVNT | ac40 | 5310 | Ant2 | 8.78  | 0.12 | 8.9   | 24    | Pass |
| NVNT | ac40 | 5310 | Sum  | 12.52 | -    | 12.64 | 22.67 | Pass |
| NVNT | ac40 | 5510 | Ant1 | 9.18  | 0.12 | 9.3   | 24    | Pass |
| NVNT | ac40 | 5510 | Ant2 | 10.8  | 0.12 | 10.92 | 24    | Pass |
| NVNT | ac40 | 5510 | Sum  | 13.08 | -    | 13.2  | 22.67 | Pass |
| NVNT | ac40 | 5590 | Ant1 | 9.26  | 0.12 | 9.38  | 24    | Pass |
| NVNT | ac40 | 5590 | Ant2 | 11.01 | 0.12 | 11.13 | 24    | Pass |
| NVNT | ac40 | 5590 | Sum  | 13.23 | -    | 13.35 | 22.67 | Pass |
| NVNT | ac40 | 5670 | Ant1 | 12.68 | 0.12 | 12.8  | 24    | Pass |
| NVNT | ac40 | 5670 | Ant2 | 11.21 | 0.12 | 11.33 | 24    | Pass |
| NVNT | ac40 | 5670 | Sum  | 15.02 | -    | 15.14 | 22.67 | Pass |
| NVNT | ac40 | 5755 | Ant1 | 11.92 | 0.12 | 12.04 | 30    | Pass |
| NVNT | ac40 | 5755 | Ant2 | 12.15 | 0.12 | 12.27 | 30    | Pass |
| NVNT | ac40 | 5755 | Sum  | 15.05 | -    | 15.17 | 28.67 | Pass |
| NVNT | ac40 | 5795 | Ant1 | 11.83 | 0.12 | 11.95 | 30    | Pass |
| NVNT | ac40 | 5795 | Ant2 | 11.49 | 0.12 | 11.61 | 30    | Pass |
| NVNT | ac40 | 5795 | Sum  | 14.67 | -    | 14.79 | 28.67 | Pass |
| NVNT | ac80 | 5210 | Ant1 | 11.6  | 0.22 | 11.82 | 24    | Pass |
| NVNT | ac80 | 5210 | Ant2 | 10.08 | 0.22 | 10.3  | 24    | Pass |
| NVNT | ac80 | 5210 | Sum  | 13.92 | -    | 14.14 | 22.67 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 10.64 | 0.22 | 10.86 | 24    | Pass |
| NVNT | ac80 | 5290 | Ant2 | 11.15 | 0.22 | 11.37 | 24    | Pass |
| NVNT | ac80 | 5290 | Sum  | 13.91 | -    | 14.13 | 22.67 | Pass |
| NVNT | ac80 | 5530 | Ant1 | 11.22 | 0.22 | 11.44 | 24    | Pass |
| NVNT | ac80 | 5530 | Ant2 | 10.4  | 0.22 | 10.62 | 24    | Pass |
| NVNT | ac80 | 5530 | Sum  | 13.84 | -    | 14.06 | 22.67 | Pass |
| NVNT | ac80 | 5610 | Ant1 | 9.82  | 0.22 | 10.04 | 24    | Pass |
| NVNT | ac80 | 5610 | Ant2 | 9.87  | 0.22 | 10.09 | 24    | Pass |
| NVNT | ac80 | 5610 | Sum  | 12.86 | -    | 13.08 | 22.67 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 10.08 | 0.22 | 10.3  | 30    | Pass |
| NVNT | ac80 | 5775 | Ant2 | 9.6   | 0.22 | 9.82  | 30    | Pass |
| NVNT | ac80 | 5775 | Sum  | 12.86 | -    | 13.08 | 28.67 | Pass |

|      |      |      |      |       |   |       |       |      |
|------|------|------|------|-------|---|-------|-------|------|
| NVNT | ax20 | 5180 | Ant1 | 12.27 | 0 | 12.27 | 24    | Pass |
| NVNT | ax20 | 5180 | Ant2 | 11.79 | 0 | 11.79 | 24    | Pass |
| NVNT | ax20 | 5180 | Sum  | 15.05 | - | 15.05 | 22.67 | Pass |
| NVNT | ax20 | 5200 | Ant1 | 9.36  | 0 | 9.36  | 24    | Pass |
| NVNT | ax20 | 5200 | Ant2 | 9.95  | 0 | 9.95  | 24    | Pass |
| NVNT | ax20 | 5200 | Sum  | 12.68 | - | 12.68 | 22.67 | Pass |
| NVNT | ax20 | 5240 | Ant1 | 11.98 | 0 | 11.98 | 24    | Pass |
| NVNT | ax20 | 5240 | Ant2 | 12.06 | 0 | 12.06 | 24    | Pass |
| NVNT | ax20 | 5240 | Sum  | 15.03 | - | 15.03 | 22.67 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 10.03 | 0 | 10.03 | 24    | Pass |
| NVNT | ax20 | 5260 | Ant2 | 12.08 | 0 | 12.08 | 24    | Pass |
| NVNT | ax20 | 5260 | Sum  | 14.19 | - | 14.19 | 22.67 | Pass |
| NVNT | ax20 | 5280 | Ant1 | 11.79 | 0 | 11.79 | 24    | Pass |
| NVNT | ax20 | 5280 | Ant2 | 10.49 | 0 | 10.49 | 24    | Pass |
| NVNT | ax20 | 5280 | Sum  | 14.2  | - | 14.2  | 22.67 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 9.85  | 0 | 9.85  | 24    | Pass |
| NVNT | ax20 | 5320 | Ant2 | 9.21  | 0 | 9.21  | 24    | Pass |
| NVNT | ax20 | 5320 | Sum  | 12.55 | - | 12.55 | 22.67 | Pass |
| NVNT | ax20 | 5500 | Ant1 | 11.21 | 0 | 11.21 | 24    | Pass |
| NVNT | ax20 | 5500 | Ant2 | 10.32 | 0 | 10.32 | 24    | Pass |
| NVNT | ax20 | 5500 | Sum  | 13.8  | - | 13.8  | 22.67 | Pass |
| NVNT | ax20 | 5600 | Ant1 | 11.7  | 0 | 11.7  | 24    | Pass |
| NVNT | ax20 | 5600 | Ant2 | 10.61 | 0 | 10.61 | 24    | Pass |
| NVNT | ax20 | 5600 | Sum  | 14.2  | - | 14.2  | 22.67 | Pass |
| NVNT | ax20 | 5700 | Ant1 | 10.66 | 0 | 10.66 | 24    | Pass |
| NVNT | ax20 | 5700 | Ant2 | 10.91 | 0 | 10.91 | 24    | Pass |
| NVNT | ax20 | 5700 | Sum  | 13.8  | - | 13.8  | 22.67 | Pass |
| NVNT | ax20 | 5745 | Ant1 | 12.52 | 0 | 12.52 | 30    | Pass |
| NVNT | ax20 | 5745 | Ant2 | 10.94 | 0 | 10.94 | 30    | Pass |
| NVNT | ax20 | 5745 | Sum  | 14.81 | - | 14.81 | 28.67 | Pass |
| NVNT | ax20 | 5785 | Ant1 | 12.58 | 0 | 12.58 | 30    | Pass |
| NVNT | ax20 | 5785 | Ant2 | 10.38 | 0 | 10.38 | 30    | Pass |
| NVNT | ax20 | 5785 | Sum  | 14.63 | - | 14.63 | 28.67 | Pass |
| NVNT | ax20 | 5825 | Ant1 | 9.14  | 0 | 9.14  | 30    | Pass |
| NVNT | ax20 | 5825 | Ant2 | 12.85 | 0 | 12.85 | 30    | Pass |
| NVNT | ax20 | 5825 | Sum  | 14.39 | - | 14.39 | 28.67 | Pass |
| NVNT | ax40 | 5190 | Ant1 | 10.21 | 0 | 10.21 | 24    | Pass |
| NVNT | ax40 | 5190 | Ant2 | 11.43 | 0 | 11.43 | 24    | Pass |
| NVNT | ax40 | 5190 | Sum  | 13.87 | - | 13.87 | 22.67 | Pass |
| NVNT | ax40 | 5230 | Ant1 | 11.04 | 0 | 11.04 | 24    | Pass |
| NVNT | ax40 | 5230 | Ant2 | 10.47 | 0 | 10.47 | 24    | Pass |
| NVNT | ax40 | 5230 | Sum  | 13.77 | - | 13.77 | 22.67 | Pass |

|      |      |      |      |       |   |       |       |      |
|------|------|------|------|-------|---|-------|-------|------|
| NVNT | ax40 | 5270 | Ant1 | 10.25 | 0 | 10.25 | 24    | Pass |
| NVNT | ax40 | 5270 | Ant2 | 9.62  | 0 | 9.62  | 24    | Pass |
| NVNT | ax40 | 5270 | Sum  | 12.96 | - | 12.96 | 22.67 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 10.79 | 0 | 10.79 | 24    | Pass |
| NVNT | ax40 | 5310 | Ant2 | 11.38 | 0 | 11.38 | 24    | Pass |
| NVNT | ax40 | 5310 | Sum  | 14.11 | - | 14.11 | 22.67 | Pass |
| NVNT | ax40 | 5510 | Ant1 | 10.36 | 0 | 10.36 | 24    | Pass |
| NVNT | ax40 | 5510 | Ant2 | 11.57 | 0 | 11.57 | 24    | Pass |
| NVNT | ax40 | 5510 | Sum  | 14.02 | - | 14.02 | 22.67 | Pass |
| NVNT | ax40 | 5590 | Ant1 | 10.67 | 0 | 10.67 | 24    | Pass |
| NVNT | ax40 | 5590 | Ant2 | 10.17 | 0 | 10.17 | 24    | Pass |
| NVNT | ax40 | 5590 | Sum  | 13.44 | - | 13.44 | 22.67 | Pass |
| NVNT | ax40 | 5670 | Ant1 | 11.24 | 0 | 11.24 | 24    | Pass |
| NVNT | ax40 | 5670 | Ant2 | 11.97 | 0 | 11.97 | 24    | Pass |
| NVNT | ax40 | 5670 | Sum  | 14.63 | - | 14.63 | 22.67 | Pass |
| NVNT | ax40 | 5755 | Ant1 | 11.22 | 0 | 11.22 | 30    | Pass |
| NVNT | ax40 | 5755 | Ant2 | 10.23 | 0 | 10.23 | 30    | Pass |
| NVNT | ax40 | 5755 | Sum  | 13.76 | - | 13.76 | 28.67 | Pass |
| NVNT | ax40 | 5795 | Ant1 | 10.34 | 0 | 10.34 | 30    | Pass |
| NVNT | ax40 | 5795 | Ant2 | 9.89  | 0 | 9.89  | 30    | Pass |
| NVNT | ax40 | 5795 | Sum  | 13.13 | - | 13.13 | 28.67 | Pass |
| NVNT | ax80 | 5210 | Ant1 | 9.83  | 0 | 9.83  | 24    | Pass |
| NVNT | ax80 | 5210 | Ant2 | 9.96  | 0 | 9.96  | 24    | Pass |
| NVNT | ax80 | 5210 | Sum  | 12.91 | - | 12.91 | 22.67 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 8.34  | 0 | 8.34  | 24    | Pass |
| NVNT | ax80 | 5290 | Ant2 | 10.95 | 0 | 10.95 | 24    | Pass |
| NVNT | ax80 | 5290 | Sum  | 12.85 | - | 12.85 | 22.67 | Pass |
| NVNT | ax80 | 5530 | Ant1 | 10.49 | 0 | 10.49 | 24    | Pass |
| NVNT | ax80 | 5530 | Ant2 | 11.63 | 0 | 11.63 | 24    | Pass |
| NVNT | ax80 | 5530 | Sum  | 14.11 | - | 14.11 | 22.67 | Pass |
| NVNT | ax80 | 5610 | Ant1 | 11.23 | 0 | 11.23 | 24    | Pass |
| NVNT | ax80 | 5610 | Ant2 | 9.79  | 0 | 9.79  | 24    | Pass |
| NVNT | ax80 | 5610 | Sum  | 13.58 | - | 13.58 | 22.67 | Pass |
| NVNT | ax80 | 5775 | Ant1 | 11.14 | 0 | 11.14 | 30    | Pass |
| NVNT | ax80 | 5775 | Ant2 | 9.81  | 0 | 9.81  | 30    | Pass |
| NVNT | ax80 | 5775 | Sum  | 13.54 | - | 13.54 | 28.67 | Pass |

Note: The Duty Cycle Factor is compensated in the graph.

## Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm) | Duty Factor (dB) | Total PSD (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|---------------------|------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | 3.46                | 0                | 3.46            | 11          | Pass    |
| NVNT      | a    | 5180            | Ant2    | 2.21                | 0                | 2.21            | 11          | Pass    |
| NVNT      | a    | 5200            | Ant1    | 2.65                | 0                | 2.65            | 11          | Pass    |
| NVNT      | a    | 5200            | Ant2    | 2.67                | 0                | 2.67            | 11          | Pass    |
| NVNT      | a    | 5240            | Ant1    | 2.51                | 0                | 2.51            | 11          | Pass    |
| NVNT      | a    | 5240            | Ant2    | 2.28                | 0                | 2.28            | 11          | Pass    |
| NVNT      | a    | 5260            | Ant1    | 3.18                | 0                | 3.18            | 11          | Pass    |
| NVNT      | a    | 5260            | Ant2    | 3.91                | 0                | 3.91            | 11          | Pass    |
| NVNT      | a    | 5280            | Ant1    | 3                   | 0                | 3               | 11          | Pass    |
| NVNT      | a    | 5280            | Ant2    | 1.79                | 0                | 1.79            | 11          | Pass    |
| NVNT      | a    | 5320            | Ant1    | 3.88                | 0                | 3.88            | 11          | Pass    |
| NVNT      | a    | 5320            | Ant2    | 2.99                | 0                | 2.99            | 11          | Pass    |
| NVNT      | a    | 5500            | Ant1    | 3.94                | 0                | 3.94            | 11          | Pass    |
| NVNT      | a    | 5500            | Ant2    | 2.97                | 0                | 2.97            | 11          | Pass    |
| NVNT      | a    | 5600            | Ant1    | 3.01                | 0                | 3.01            | 11          | Pass    |
| NVNT      | a    | 5600            | Ant2    | 3.35                | 0                | 3.35            | 11          | Pass    |
| NVNT      | a    | 5700            | Ant1    | 3.37                | 0                | 3.37            | 11          | Pass    |
| NVNT      | a    | 5700            | Ant2    | 2.85                | 0                | 2.85            | 11          | Pass    |
| NVNT      | a    | 5745            | Ant1    | 0.13                | 0                | 0.13            | 30          | Pass    |
| NVNT      | a    | 5745            | Ant2    | 0.36                | 0                | 0.36            | 30          | Pass    |
| NVNT      | a    | 5785            | Ant1    | -0.53               | 0                | -0.53           | 30          | Pass    |
| NVNT      | a    | 5785            | Ant2    | -0.94               | 0                | -0.94           | 30          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 0.74                | 0                | 0.74            | 30          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 0.77                | 0                | 0.77            | 30          | Pass    |
| NVNT      | n20  | 5180            | Ant1    | -0.22               | 0.13             | -0.09           | 11          | Pass    |
| NVNT      | n20  | 5180            | Ant2    | 0.7                 | 0.13             | 0.83            | 11          | Pass    |
| NVNT      | n20  | 5180            | Sum     | 3.27                | -                | 3.4             | 9.67        | Pass    |
| NVNT      | n20  | 5200            | Ant1    | 1.35                | 0.13             | 1.48            | 11          | Pass    |
| NVNT      | n20  | 5200            | Ant2    | -0.13               | 0.13             | 0               | 11          | Pass    |
| NVNT      | n20  | 5200            | Sum     | 3.68                | -                | 3.81            | 9.67        | Pass    |
| NVNT      | n20  | 5240            | Ant1    | 0.85                | 0.13             | 0.98            | 11          | Pass    |
| NVNT      | n20  | 5240            | Ant2    | 1.56                | 0.13             | 1.69            | 11          | Pass    |
| NVNT      | n20  | 5240            | Sum     | 4.23                | -                | 4.36            | 9.67        | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 0.31                | 0.13             | 0.44            | 11          | Pass    |
| NVNT      | n20  | 5260            | Ant2    | 1.13                | 0.13             | 1.26            | 11          | Pass    |
| NVNT      | n20  | 5260            | Sum     | 3.75                | -                | 3.88            | 9.67        | Pass    |
| NVNT      | n20  | 5280            | Ant1    | 0.9                 | 0.13             | 1.03            | 11          | Pass    |
| NVNT      | n20  | 5280            | Ant2    | -0.19               | 0.13             | -0.06           | 11          | Pass    |
| NVNT      | n20  | 5280            | Sum     | 3.4                 | -                | 3.53            | 9.67        | Pass    |

|      |     |      |      |       |      |       |       |      |
|------|-----|------|------|-------|------|-------|-------|------|
| NVNT | n20 | 5320 | Ant1 | 0.13  | 0.13 | 0.26  | 11    | Pass |
| NVNT | n20 | 5320 | Ant2 | 0.07  | 0.13 | 0.2   | 11    | Pass |
| NVNT | n20 | 5320 | Sum  | 3.11  | -    | 3.24  | 9.67  | Pass |
| NVNT | n20 | 5500 | Ant1 | 1.87  | 0.13 | 2     | 11    | Pass |
| NVNT | n20 | 5500 | Ant2 | 1.13  | 0.13 | 1.26  | 11    | Pass |
| NVNT | n20 | 5500 | Sum  | 4.53  | -    | 4.66  | 9.67  | Pass |
| NVNT | n20 | 5600 | Ant1 | 1.55  | 0.13 | 1.68  | 11    | Pass |
| NVNT | n20 | 5600 | Ant2 | 0.94  | 0.13 | 1.07  | 11    | Pass |
| NVNT | n20 | 5600 | Sum  | 4.27  | -    | 4.4   | 9.67  | Pass |
| NVNT | n20 | 5700 | Ant1 | 1.63  | 0.13 | 1.76  | 11    | Pass |
| NVNT | n20 | 5700 | Ant2 | 1.71  | 0.13 | 1.84  | 11    | Pass |
| NVNT | n20 | 5700 | Sum  | 4.68  | -    | 4.81  | 9.67  | Pass |
| NVNT | n20 | 5745 | Ant1 | -0.87 | 0.13 | -0.74 | 30    | Pass |
| NVNT | n20 | 5745 | Ant2 | -0.92 | 0.13 | -0.79 | 30    | Pass |
| NVNT | n20 | 5745 | Sum  | 2.12  | -    | 2.25  | 28.67 | Pass |
| NVNT | n20 | 5785 | Ant1 | -1.21 | 0.13 | -1.08 | 30    | Pass |
| NVNT | n20 | 5785 | Ant2 | -2.39 | 0.13 | -2.26 | 30    | Pass |
| NVNT | n20 | 5785 | Sum  | 1.25  | -    | 1.38  | 28.67 | Pass |
| NVNT | n20 | 5825 | Ant1 | -1.13 | 0.13 | -1    | 30    | Pass |
| NVNT | n20 | 5825 | Ant2 | -1.66 | 0.13 | -1.53 | 30    | Pass |
| NVNT | n20 | 5825 | Sum  | 1.62  | -    | 1.75  | 28.67 | Pass |
| NVNT | n40 | 5190 | Ant1 | -3.85 | 0.14 | -3.71 | 11    | Pass |
| NVNT | n40 | 5190 | Ant2 | -4.25 | 0.14 | -4.11 | 11    | Pass |
| NVNT | n40 | 5190 | Sum  | -1.04 | -    | -0.9  | 9.67  | Pass |
| NVNT | n40 | 5230 | Ant1 | -2.84 | 0.14 | -2.7  | 11    | Pass |
| NVNT | n40 | 5230 | Ant2 | -2.23 | 0.14 | -2.09 | 11    | Pass |
| NVNT | n40 | 5230 | Sum  | 0.49  | -    | 0.63  | 9.67  | Pass |
| NVNT | n40 | 5270 | Ant1 | -2.47 | 0.14 | -2.33 | 11    | Pass |
| NVNT | n40 | 5270 | Ant2 | -3.57 | 0.14 | -3.43 | 11    | Pass |
| NVNT | n40 | 5270 | Sum  | 0.03  | -    | 0.17  | 9.67  | Pass |
| NVNT | n40 | 5310 | Ant1 | -2.71 | 0.14 | -2.57 | 11    | Pass |
| NVNT | n40 | 5310 | Ant2 | -2.95 | 0.14 | -2.81 | 11    | Pass |
| NVNT | n40 | 5310 | Sum  | 0.18  | -    | 0.32  | 9.67  | Pass |
| NVNT | n40 | 5510 | Ant1 | -1.84 | 0.14 | -1.7  | 11    | Pass |
| NVNT | n40 | 5510 | Ant2 | -3.81 | 0.14 | -3.67 | 11    | Pass |
| NVNT | n40 | 5510 | Sum  | 0.3   | -    | 0.44  | 9.67  | Pass |
| NVNT | n40 | 5590 | Ant1 | -3.35 | 0.14 | -3.21 | 11    | Pass |
| NVNT | n40 | 5590 | Ant2 | -4.36 | 0.14 | -4.22 | 11    | Pass |
| NVNT | n40 | 5590 | Sum  | -0.82 | -    | -0.68 | 9.67  | Pass |
| NVNT | n40 | 5670 | Ant1 | -2.36 | 0.14 | -2.22 | 11    | Pass |
| NVNT | n40 | 5670 | Ant2 | -2.75 | 0.14 | -2.61 | 11    | Pass |
| NVNT | n40 | 5670 | Sum  | 0.46  | -    | 0.6   | 9.67  | Pass |

|      |      |      |      |       |      |       |       |      |
|------|------|------|------|-------|------|-------|-------|------|
| NVNT | n40  | 5755 | Ant1 | -5.34 | 0.14 | -5.2  | 30    | Pass |
| NVNT | n40  | 5755 | Ant2 | -5.24 | 0.14 | -5.1  | 30    | Pass |
| NVNT | n40  | 5755 | Sum  | -2.28 | -    | -2.14 | 28.67 | Pass |
| NVNT | n40  | 5795 | Ant1 | -5    | 0.14 | -4.86 | 30    | Pass |
| NVNT | n40  | 5795 | Ant2 | -5.5  | 0.14 | -5.36 | 30    | Pass |
| NVNT | n40  | 5795 | Sum  | -2.23 | -    | -2.09 | 28.67 | Pass |
| NVNT | ac20 | 5180 | Ant1 | 0.34  | 0.12 | 0.46  | 11    | Pass |
| NVNT | ac20 | 5180 | Ant2 | 0     | 0.12 | 0.12  | 11    | Pass |
| NVNT | ac20 | 5180 | Sum  | 3.18  | -    | 3.3   | 9.67  | Pass |
| NVNT | ac20 | 5200 | Ant1 | -0.21 | 0.12 | -0.09 | 11    | Pass |
| NVNT | ac20 | 5200 | Ant2 | 0.61  | 0.12 | 0.73  | 11    | Pass |
| NVNT | ac20 | 5200 | Sum  | 3.23  | -    | 3.35  | 9.67  | Pass |
| NVNT | ac20 | 5240 | Ant1 | 1.44  | 0.12 | 1.56  | 11    | Pass |
| NVNT | ac20 | 5240 | Ant2 | -0.38 | 0.12 | -0.26 | 11    | Pass |
| NVNT | ac20 | 5240 | Sum  | 3.63  | -    | 3.75  | 9.67  | Pass |
| NVNT | ac20 | 5260 | Ant1 | -0.74 | 0.12 | -0.62 | 11    | Pass |
| NVNT | ac20 | 5260 | Ant2 | -1    | 0.12 | -0.88 | 11    | Pass |
| NVNT | ac20 | 5260 | Sum  | 2.14  | -    | 2.26  | 9.67  | Pass |
| NVNT | ac20 | 5280 | Ant1 | -0.51 | 0.12 | -0.39 | 11    | Pass |
| NVNT | ac20 | 5280 | Ant2 | -0.87 | 0.12 | -0.75 | 11    | Pass |
| NVNT | ac20 | 5280 | Sum  | 2.32  | -    | 2.44  | 9.67  | Pass |
| NVNT | ac20 | 5320 | Ant1 | -0.7  | 0.12 | -0.58 | 11    | Pass |
| NVNT | ac20 | 5320 | Ant2 | -0.91 | 0.12 | -0.79 | 11    | Pass |
| NVNT | ac20 | 5320 | Sum  | 2.21  | -    | 2.33  | 9.67  | Pass |
| NVNT | ac20 | 5500 | Ant1 | 1.07  | 0.12 | 1.19  | 11    | Pass |
| NVNT | ac20 | 5500 | Ant2 | 1.3   | 0.12 | 1.42  | 11    | Pass |
| NVNT | ac20 | 5500 | Sum  | 4.2   | -    | 4.32  | 9.67  | Pass |
| NVNT | ac20 | 5600 | Ant1 | -1.77 | 0.12 | -1.65 | 11    | Pass |
| NVNT | ac20 | 5600 | Ant2 | 0.48  | 0.12 | 0.6   | 11    | Pass |
| NVNT | ac20 | 5600 | Sum  | 2.51  | -    | 2.63  | 9.67  | Pass |
| NVNT | ac20 | 5700 | Ant1 | 0.4   | 0.12 | 0.52  | 11    | Pass |
| NVNT | ac20 | 5700 | Ant2 | 1.29  | 0.12 | 1.41  | 11    | Pass |
| NVNT | ac20 | 5700 | Sum  | 3.88  | -    | 4     | 9.67  | Pass |
| NVNT | ac20 | 5745 | Ant1 | -1.44 | 0.12 | -1.32 | 30    | Pass |
| NVNT | ac20 | 5745 | Ant2 | -2.09 | 0.12 | -1.97 | 30    | Pass |
| NVNT | ac20 | 5745 | Sum  | 1.26  | -    | 1.38  | 28.67 | Pass |
| NVNT | ac20 | 5785 | Ant1 | -4.27 | 0.12 | -4.15 | 30    | Pass |
| NVNT | ac20 | 5785 | Ant2 | -3.1  | 0.12 | -2.98 | 30    | Pass |
| NVNT | ac20 | 5785 | Sum  | -0.64 | -    | -0.52 | 28.67 | Pass |
| NVNT | ac20 | 5825 | Ant1 | -1.82 | 0.12 | -1.7  | 30    | Pass |
| NVNT | ac20 | 5825 | Ant2 | -3.03 | 0.12 | -2.91 | 30    | Pass |
| NVNT | ac20 | 5825 | Sum  | 0.63  | -    | 0.75  | 28.67 | Pass |

|      |      |      |      |        |      |        |       |      |
|------|------|------|------|--------|------|--------|-------|------|
| NVNT | ac40 | 5190 | Ant1 | -3.97  | 0.12 | -3.85  | 11    | Pass |
| NVNT | ac40 | 5190 | Ant2 | -3.65  | 0.12 | -3.53  | 11    | Pass |
| NVNT | ac40 | 5190 | Sum  | -0.8   | -    | -0.68  | 9.67  | Pass |
| NVNT | ac40 | 5230 | Ant1 | -4.02  | 0.12 | -3.9   | 11    | Pass |
| NVNT | ac40 | 5230 | Ant2 | -4.02  | 0.12 | -3.9   | 11    | Pass |
| NVNT | ac40 | 5230 | Sum  | -1.01  | -    | -0.89  | 9.67  | Pass |
| NVNT | ac40 | 5270 | Ant1 | -3.35  | 0.12 | -3.23  | 11    | Pass |
| NVNT | ac40 | 5270 | Ant2 | -4.97  | 0.12 | -4.85  | 11    | Pass |
| NVNT | ac40 | 5270 | Sum  | -1.07  | -    | -0.95  | 9.67  | Pass |
| NVNT | ac40 | 5310 | Ant1 | -3.73  | 0.12 | -3.61  | 11    | Pass |
| NVNT | ac40 | 5310 | Ant2 | -5.68  | 0.12 | -5.56  | 11    | Pass |
| NVNT | ac40 | 5310 | Sum  | -1.59  | -    | -1.47  | 9.67  | Pass |
| NVNT | ac40 | 5510 | Ant1 | -4.63  | 0.12 | -4.51  | 11    | Pass |
| NVNT | ac40 | 5510 | Ant2 | -3.79  | 0.12 | -3.67  | 11    | Pass |
| NVNT | ac40 | 5510 | Sum  | -1.18  | -    | -1.06  | 9.67  | Pass |
| NVNT | ac40 | 5590 | Ant1 | -4.85  | 0.12 | -4.73  | 11    | Pass |
| NVNT | ac40 | 5590 | Ant2 | -3.06  | 0.12 | -2.94  | 11    | Pass |
| NVNT | ac40 | 5590 | Sum  | -0.85  | -    | -0.73  | 9.67  | Pass |
| NVNT | ac40 | 5670 | Ant1 | -0.91  | 0.12 | -0.79  | 11    | Pass |
| NVNT | ac40 | 5670 | Ant2 | -2.65  | 0.12 | -2.53  | 11    | Pass |
| NVNT | ac40 | 5670 | Sum  | 1.32   | -    | 1.44   | 9.67  | Pass |
| NVNT | ac40 | 5755 | Ant1 | -4.89  | 0.12 | -4.77  | 30    | Pass |
| NVNT | ac40 | 5755 | Ant2 | -4.98  | 0.12 | -4.86  | 30    | Pass |
| NVNT | ac40 | 5755 | Sum  | -1.92  | -    | -1.8   | 28.67 | Pass |
| NVNT | ac40 | 5795 | Ant1 | -4.78  | 0.12 | -4.66  | 30    | Pass |
| NVNT | ac40 | 5795 | Ant2 | -5.84  | 0.12 | -5.72  | 30    | Pass |
| NVNT | ac40 | 5795 | Sum  | -2.27  | -    | -2.15  | 28.67 | Pass |
| NVNT | ac80 | 5210 | Ant1 | -5.65  | 0.22 | -5.43  | 11    | Pass |
| NVNT | ac80 | 5210 | Ant2 | -7.49  | 0.22 | -7.27  | 11    | Pass |
| NVNT | ac80 | 5210 | Sum  | -3.46  | -    | -3.24  | 9.67  | Pass |
| NVNT | ac80 | 5290 | Ant1 | -5.6   | 0.22 | -5.38  | 11    | Pass |
| NVNT | ac80 | 5290 | Ant2 | -6.18  | 0.22 | -5.96  | 11    | Pass |
| NVNT | ac80 | 5290 | Sum  | -2.87  | -    | -2.65  | 9.67  | Pass |
| NVNT | ac80 | 5530 | Ant1 | -5.09  | 0.22 | -4.87  | 11    | Pass |
| NVNT | ac80 | 5530 | Ant2 | -7.51  | 0.22 | -7.29  | 11    | Pass |
| NVNT | ac80 | 5530 | Sum  | -3.12  | -    | -2.9   | 9.67  | Pass |
| NVNT | ac80 | 5610 | Ant1 | -6.69  | 0.22 | -6.47  | 11    | Pass |
| NVNT | ac80 | 5610 | Ant2 | -7.43  | 0.22 | -7.21  | 11    | Pass |
| NVNT | ac80 | 5610 | Sum  | -4.03  | -    | -3.81  | 9.67  | Pass |
| NVNT | ac80 | 5775 | Ant1 | -9.88  | 0.22 | -9.66  | 30    | Pass |
| NVNT | ac80 | 5775 | Ant2 | -11.46 | 0.22 | -11.24 | 30    | Pass |
| NVNT | ac80 | 5775 | Sum  | -7.59  | -    | -7.37  | 28.67 | Pass |

|      |      |      |      |       |   |       |       |      |
|------|------|------|------|-------|---|-------|-------|------|
| NVNT | ax20 | 5180 | Ant1 | 0.95  | 0 | 0.95  | 11    | Pass |
| NVNT | ax20 | 5180 | Ant2 | 0.52  | 0 | 0.52  | 11    | Pass |
| NVNT | ax20 | 5180 | Sum  | 3.75  | - | 3.75  | 9.67  | Pass |
| NVNT | ax20 | 5200 | Ant1 | -2.11 | 0 | -2.11 | 11    | Pass |
| NVNT | ax20 | 5200 | Ant2 | -1.72 | 0 | -1.72 | 11    | Pass |
| NVNT | ax20 | 5200 | Sum  | 1.1   | - | 1.1   | 9.67  | Pass |
| NVNT | ax20 | 5240 | Ant1 | 0.73  | 0 | 0.73  | 11    | Pass |
| NVNT | ax20 | 5240 | Ant2 | 0.51  | 0 | 0.51  | 11    | Pass |
| NVNT | ax20 | 5240 | Sum  | 3.63  | - | 3.63  | 9.67  | Pass |
| NVNT | ax20 | 5260 | Ant1 | -1.07 | 0 | -1.07 | 11    | Pass |
| NVNT | ax20 | 5260 | Ant2 | 0.5   | 0 | 0.5   | 11    | Pass |
| NVNT | ax20 | 5260 | Sum  | 2.8   | - | 2.8   | 9.67  | Pass |
| NVNT | ax20 | 5280 | Ant1 | 1.1   | 0 | 1.1   | 11    | Pass |
| NVNT | ax20 | 5280 | Ant2 | -1.23 | 0 | -1.23 | 11    | Pass |
| NVNT | ax20 | 5280 | Sum  | 3.1   | - | 3.1   | 9.67  | Pass |
| NVNT | ax20 | 5320 | Ant1 | -1.32 | 0 | -1.32 | 11    | Pass |
| NVNT | ax20 | 5320 | Ant2 | -2.38 | 0 | -2.38 | 11    | Pass |
| NVNT | ax20 | 5320 | Sum  | 1.19  | - | 1.19  | 9.67  | Pass |
| NVNT | ax20 | 5500 | Ant1 | 0.52  | 0 | 0.52  | 11    | Pass |
| NVNT | ax20 | 5500 | Ant2 | -1.02 | 0 | -1.02 | 11    | Pass |
| NVNT | ax20 | 5500 | Sum  | 2.83  | - | 2.83  | 9.67  | Pass |
| NVNT | ax20 | 5600 | Ant1 | 0.36  | 0 | 0.36  | 11    | Pass |
| NVNT | ax20 | 5600 | Ant2 | -1.06 | 0 | -1.06 | 11    | Pass |
| NVNT | ax20 | 5600 | Sum  | 2.72  | - | 2.72  | 9.67  | Pass |
| NVNT | ax20 | 5700 | Ant1 | -0.61 | 0 | -0.61 | 11    | Pass |
| NVNT | ax20 | 5700 | Ant2 | -1.11 | 0 | -1.11 | 11    | Pass |
| NVNT | ax20 | 5700 | Sum  | 2.16  | - | 2.16  | 9.67  | Pass |
| NVNT | ax20 | 5745 | Ant1 | -1.52 | 0 | -1.52 | 30    | Pass |
| NVNT | ax20 | 5745 | Ant2 | -3.8  | 0 | -3.8  | 30    | Pass |
| NVNT | ax20 | 5745 | Sum  | 0.5   | - | 0.5   | 28.67 | Pass |
| NVNT | ax20 | 5785 | Ant1 | -1.53 | 0 | -1.53 | 30    | Pass |
| NVNT | ax20 | 5785 | Ant2 | -4.7  | 0 | -4.7  | 30    | Pass |
| NVNT | ax20 | 5785 | Sum  | 0.18  | - | 0.18  | 28.67 | Pass |
| NVNT | ax20 | 5825 | Ant1 | -4.92 | 0 | -4.92 | 30    | Pass |
| NVNT | ax20 | 5825 | Ant2 | -1.55 | 0 | -1.55 | 30    | Pass |
| NVNT | ax20 | 5825 | Sum  | 0.09  | - | 0.09  | 28.67 | Pass |
| NVNT | ax40 | 5190 | Ant1 | -4.09 | 0 | -4.09 | 11    | Pass |
| NVNT | ax40 | 5190 | Ant2 | -2.58 | 0 | -2.58 | 11    | Pass |
| NVNT | ax40 | 5190 | Sum  | -0.26 | - | -0.26 | 9.67  | Pass |
| NVNT | ax40 | 5230 | Ant1 | -3.52 | 0 | -3.52 | 11    | Pass |
| NVNT | ax40 | 5230 | Ant2 | -3.87 | 0 | -3.87 | 11    | Pass |
| NVNT | ax40 | 5230 | Sum  | -0.68 | - | -0.68 | 9.67  | Pass |

|      |      |      |      |        |   |        |       |      |
|------|------|------|------|--------|---|--------|-------|------|
| NVNT | ax40 | 5270 | Ant1 | -4.01  | 0 | -4.01  | 11    | Pass |
| NVNT | ax40 | 5270 | Ant2 | -4.84  | 0 | -4.84  | 11    | Pass |
| NVNT | ax40 | 5270 | Sum  | -1.39  | - | -1.39  | 9.67  | Pass |
| NVNT | ax40 | 5310 | Ant1 | -3.12  | 0 | -3.12  | 11    | Pass |
| NVNT | ax40 | 5310 | Ant2 | -3.39  | 0 | -3.39  | 11    | Pass |
| NVNT | ax40 | 5310 | Sum  | -0.24  | - | -0.24  | 9.67  | Pass |
| NVNT | ax40 | 5510 | Ant1 | -4.01  | 0 | -4.01  | 11    | Pass |
| NVNT | ax40 | 5510 | Ant2 | -3.36  | 0 | -3.36  | 11    | Pass |
| NVNT | ax40 | 5510 | Sum  | -0.66  | - | -0.66  | 9.67  | Pass |
| NVNT | ax40 | 5590 | Ant1 | -3.6   | 0 | -3.6   | 11    | Pass |
| NVNT | ax40 | 5590 | Ant2 | -4.17  | 0 | -4.17  | 11    | Pass |
| NVNT | ax40 | 5590 | Sum  | -0.87  | - | -0.87  | 9.67  | Pass |
| NVNT | ax40 | 5670 | Ant1 | -2.78  | 0 | -2.78  | 11    | Pass |
| NVNT | ax40 | 5670 | Ant2 | -2.32  | 0 | -2.32  | 11    | Pass |
| NVNT | ax40 | 5670 | Sum  | 0.47   | - | 0.47   | 9.67  | Pass |
| NVNT | ax40 | 5755 | Ant1 | -6.24  | 0 | -6.24  | 30    | Pass |
| NVNT | ax40 | 5755 | Ant2 | -7.16  | 0 | -7.16  | 30    | Pass |
| NVNT | ax40 | 5755 | Sum  | -3.67  | - | -3.67  | 28.67 | Pass |
| NVNT | ax40 | 5795 | Ant1 | -6.6   | 0 | -6.6   | 30    | Pass |
| NVNT | ax40 | 5795 | Ant2 | -8.13  | 0 | -8.13  | 30    | Pass |
| NVNT | ax40 | 5795 | Sum  | -4.29  | - | -4.29  | 28.67 | Pass |
| NVNT | ax80 | 5210 | Ant1 | -7.29  | 0 | -7.29  | 11    | Pass |
| NVNT | ax80 | 5210 | Ant2 | -7.46  | 0 | -7.46  | 11    | Pass |
| NVNT | ax80 | 5210 | Sum  | -4.36  | - | -4.36  | 9.67  | Pass |
| NVNT | ax80 | 5290 | Ant1 | -8.37  | 0 | -8.37  | 11    | Pass |
| NVNT | ax80 | 5290 | Ant2 | -6.45  | 0 | -6.45  | 11    | Pass |
| NVNT | ax80 | 5290 | Sum  | -4.29  | - | -4.29  | 9.67  | Pass |
| NVNT | ax80 | 5530 | Ant1 | -6.26  | 0 | -6.26  | 11    | Pass |
| NVNT | ax80 | 5530 | Ant2 | -5.75  | 0 | -5.75  | 11    | Pass |
| NVNT | ax80 | 5530 | Sum  | -2.99  | - | -2.99  | 9.67  | Pass |
| NVNT | ax80 | 5610 | Ant1 | -5.57  | 0 | -5.57  | 11    | Pass |
| NVNT | ax80 | 5610 | Ant2 | -7.3   | 0 | -7.3   | 11    | Pass |
| NVNT | ax80 | 5610 | Sum  | -3.34  | - | -3.34  | 9.67  | Pass |
| NVNT | ax80 | 5775 | Ant1 | -9.5   | 0 | -9.5   | 30    | Pass |
| NVNT | ax80 | 5775 | Ant2 | -11.11 | 0 | -11.11 | 30    | Pass |
| NVNT | ax80 | 5775 | Sum  | -7.22  | - | -7.22  | 28.67 | Pass |

Note: The Duty Cycle Factor is compensated in the graph.

