


Appendix Test Data

Report No.:	1819C50094712501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-8-19	Finish Test Date:	2025-8-29
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	23.9°C	Relative Humidity:	62%
Pressure:	101kPa		

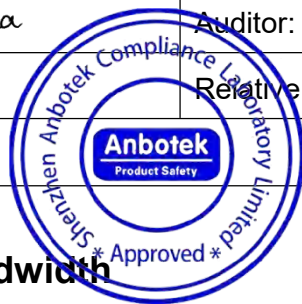



Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.99	2401.46	2402.45	---	---
DH5	Ant1	2441	0.95	2440.49	2441.44	---	---
DH5	Ant1	2480	0.96	2479.48	2480.44	---	---
2DH5	Ant1	2402	1.36	2401.28	2402.64	---	---
2DH5	Ant1	2441	1.34	2440.30	2441.63	---	---
2DH5	Ant1	2480	1.32	2479.29	2480.61	---	---
3DH5	Ant1	2402	1.29	2401.32	2402.61	---	---
3DH5	Ant1	2441	1.32	2440.29	2441.61	---	---
3DH5	Ant1	2480	1.31	2479.29	2480.60	---	---

Test Graphs

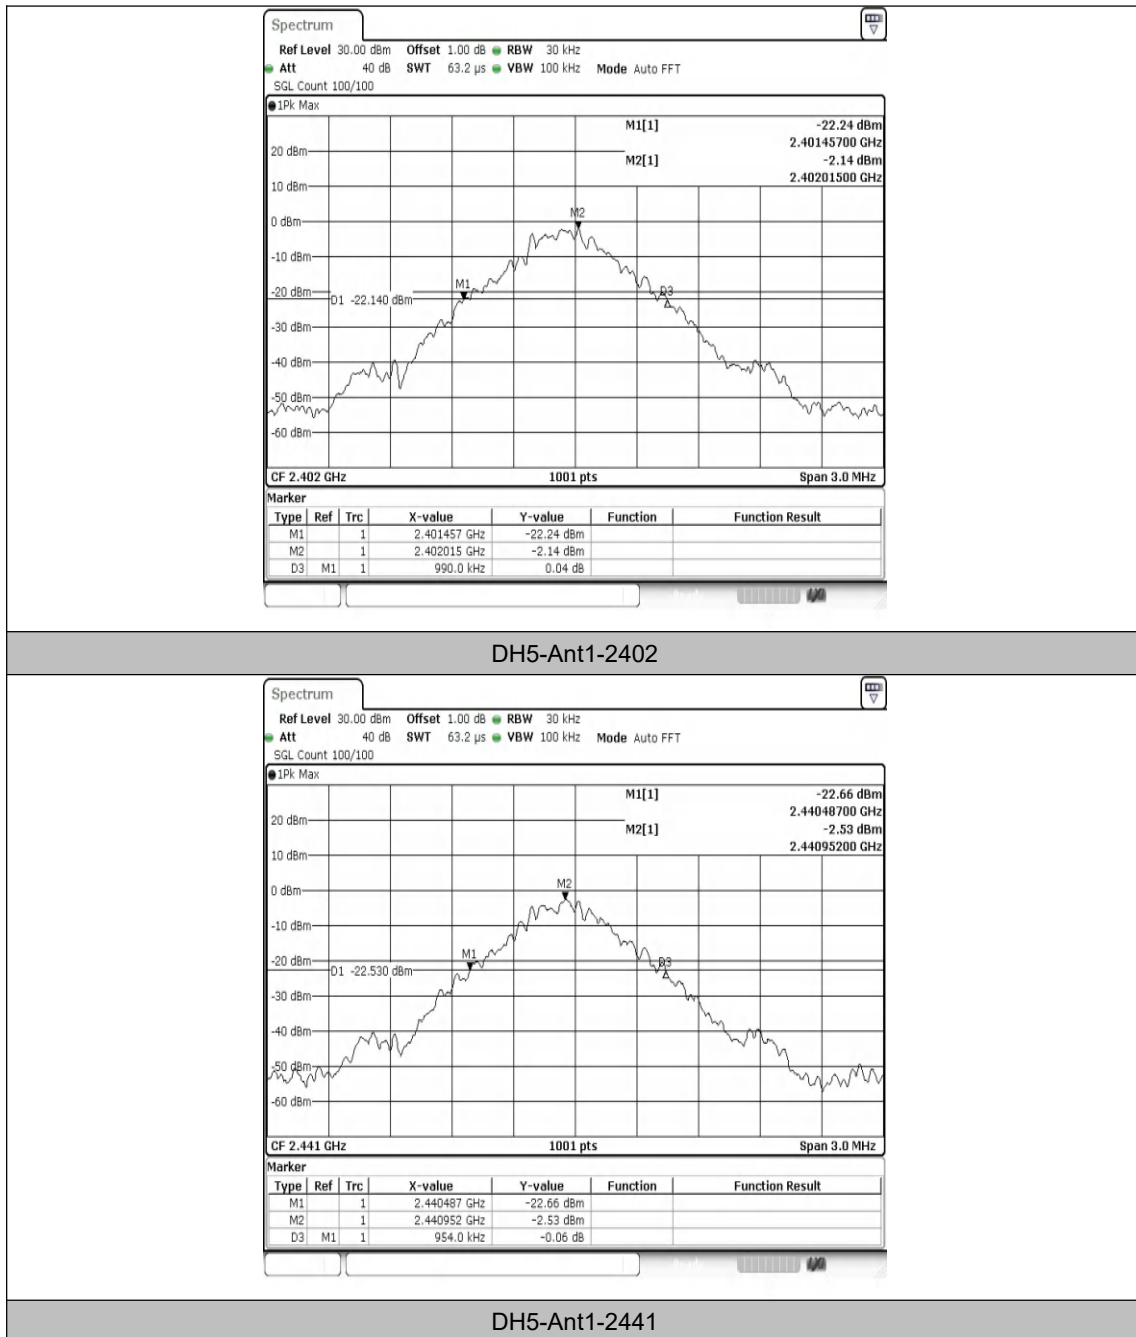


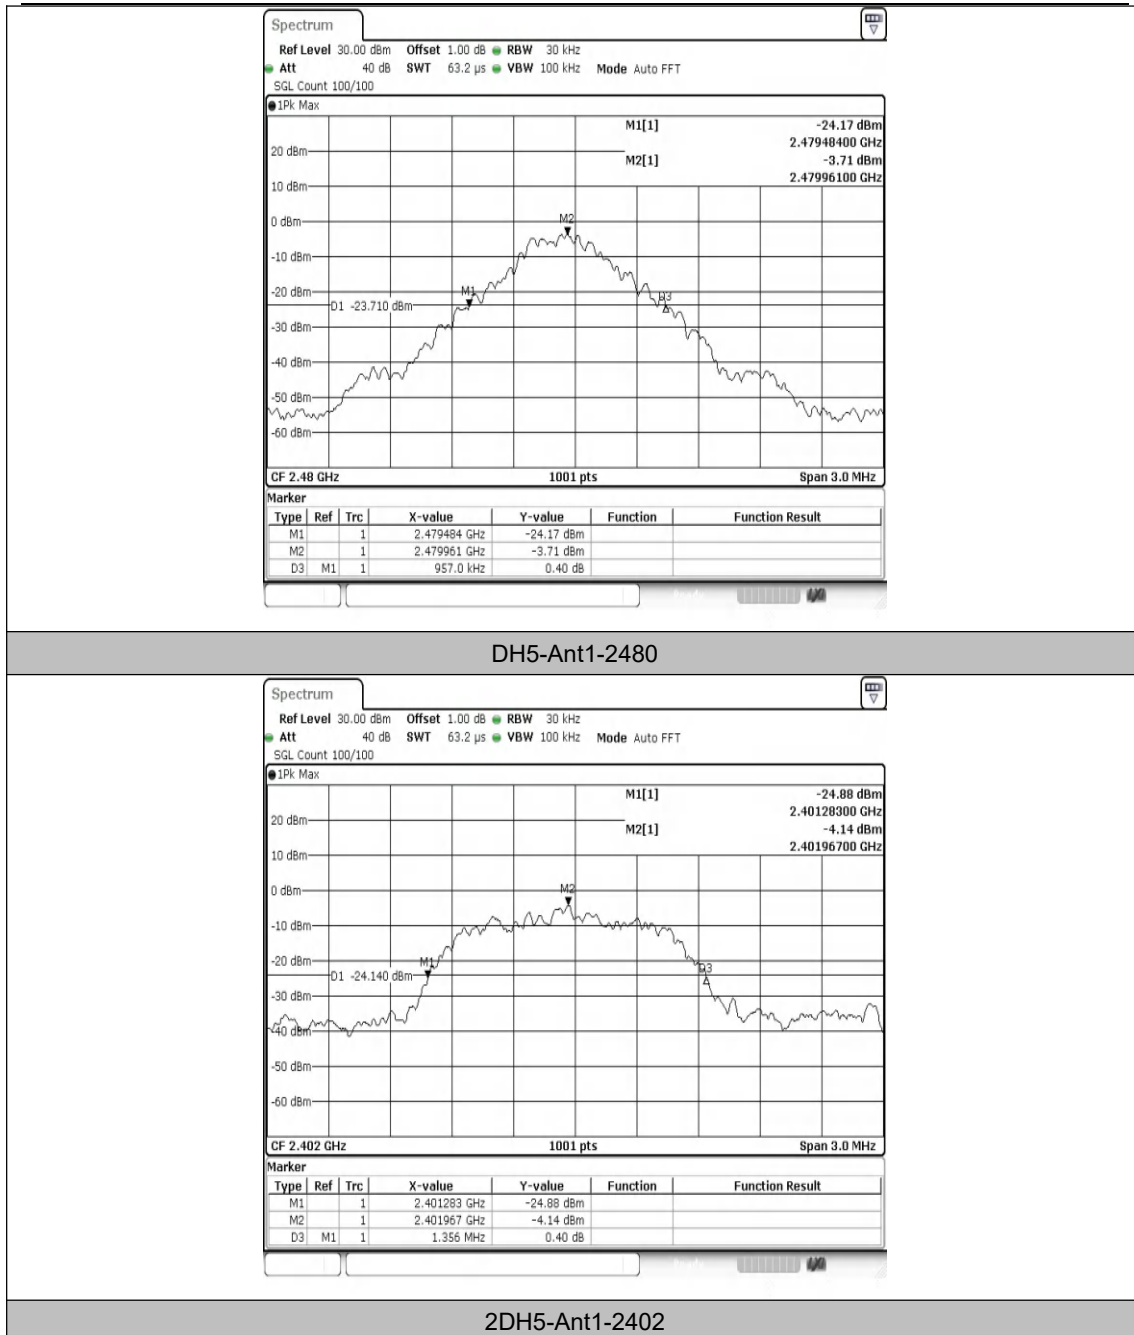

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

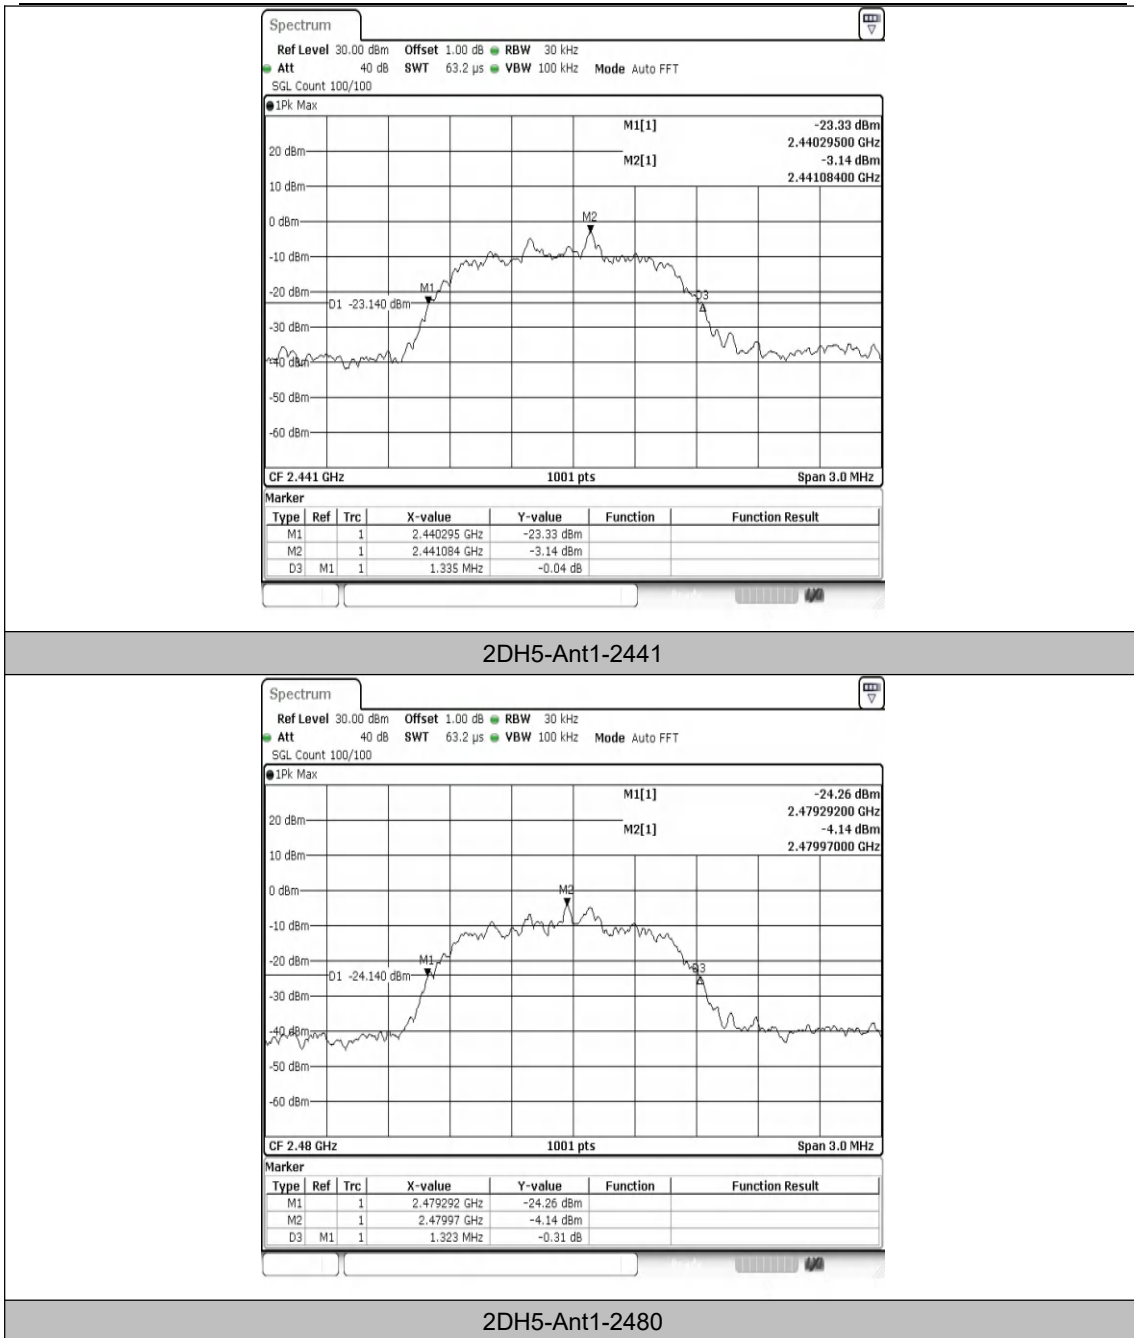


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

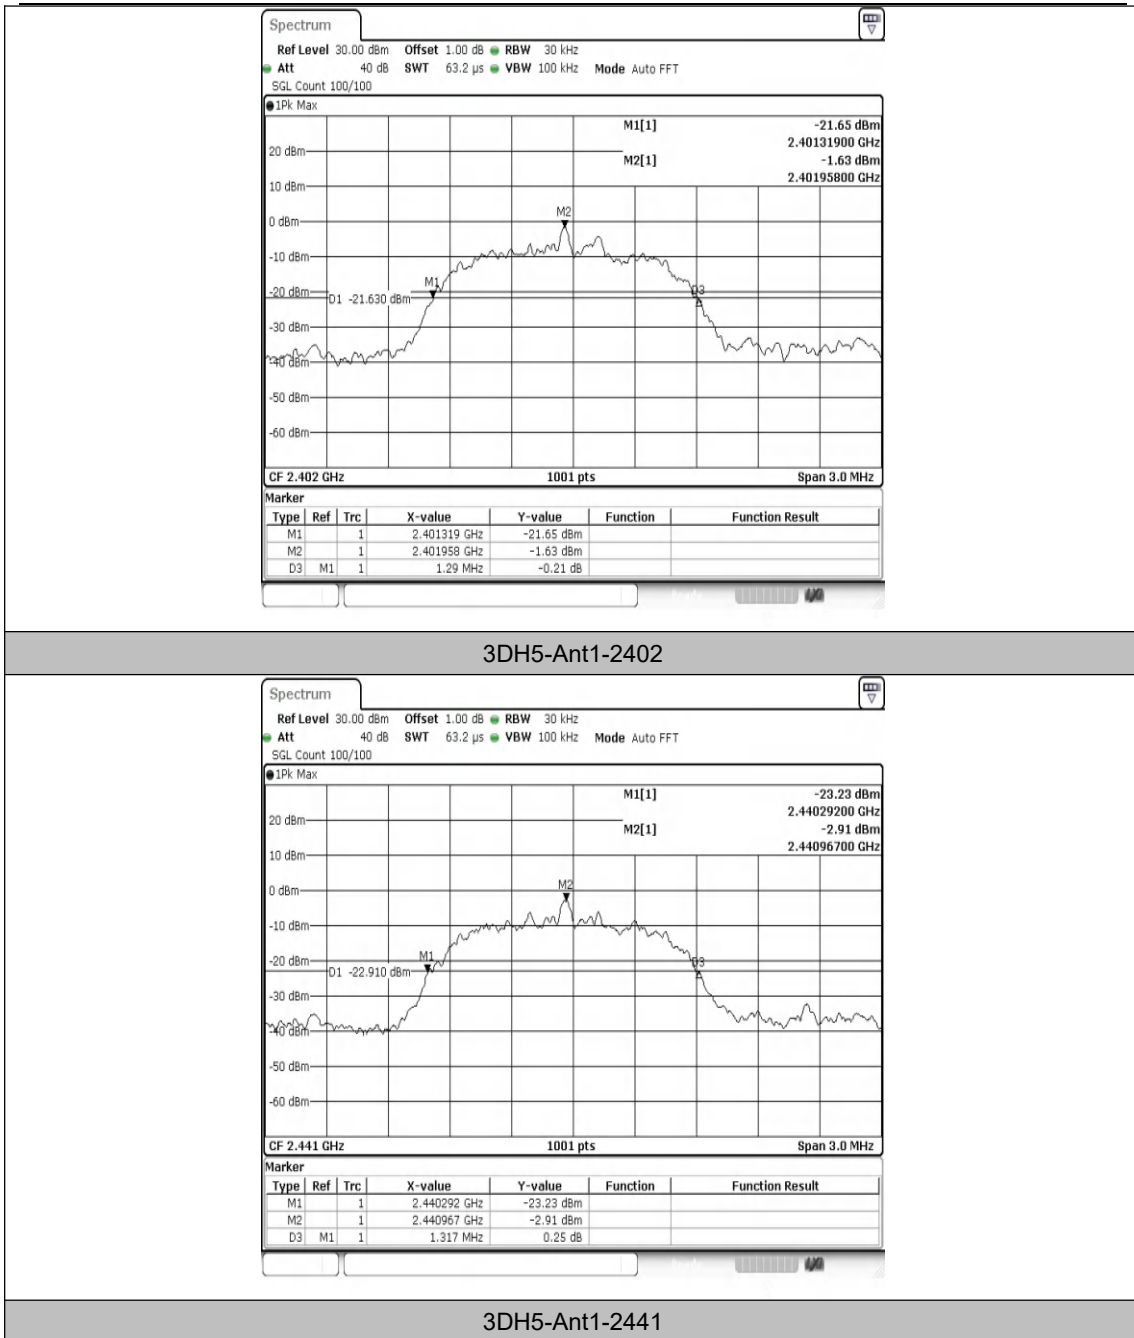

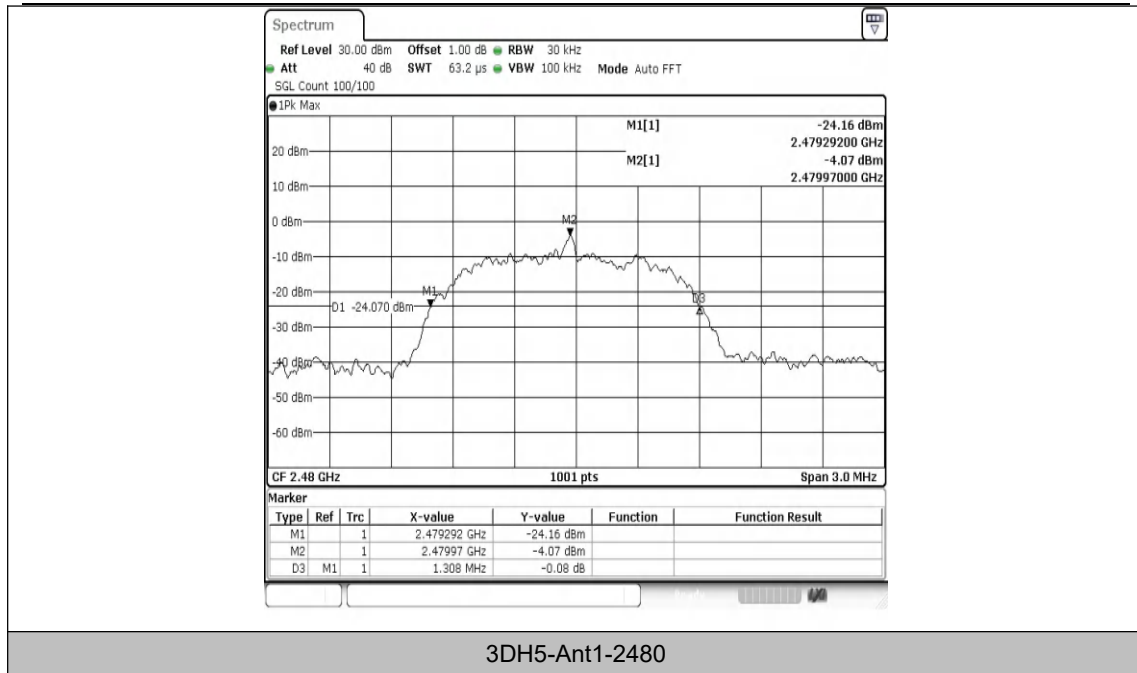

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix B: 99% Occupied Bandwidth


Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.88711	2401.5115	2402.3986	---	---
DH5	Ant1	2441	0.88412	2440.5115	2441.3956	---	---
DH5	Ant1	2480	0.90210	2479.5025	2480.4046	---	---
2DH5	Ant1	2402	1.2108	2401.3586	2402.5694	---	---
2DH5	Ant1	2441	1.2258	2440.3497	2441.5754	---	---
2DH5	Ant1	2480	1.2018	2479.3586	2480.5604	---	---
3DH5	Ant1	2402	1.2288	2401.3437	2402.5724	---	---
3DH5	Ant1	2441	1.2318	2440.3437	2441.5754	---	---
3DH5	Ant1	2480	1.2228	2479.3407	2480.5634	---	---

Test Graphs

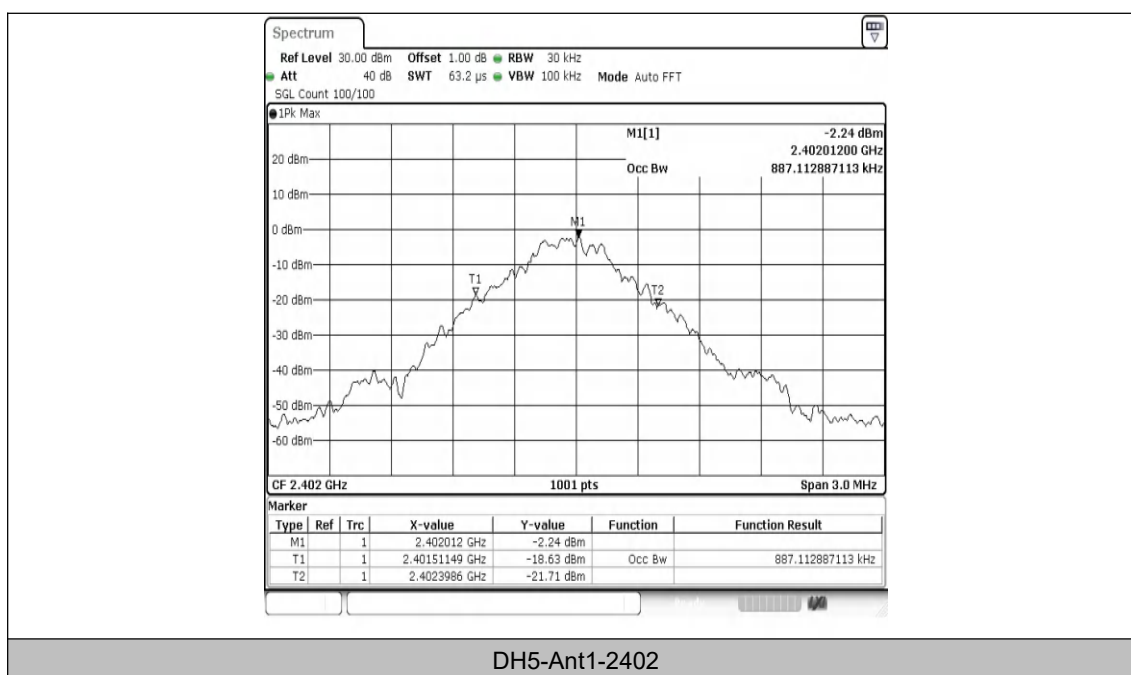

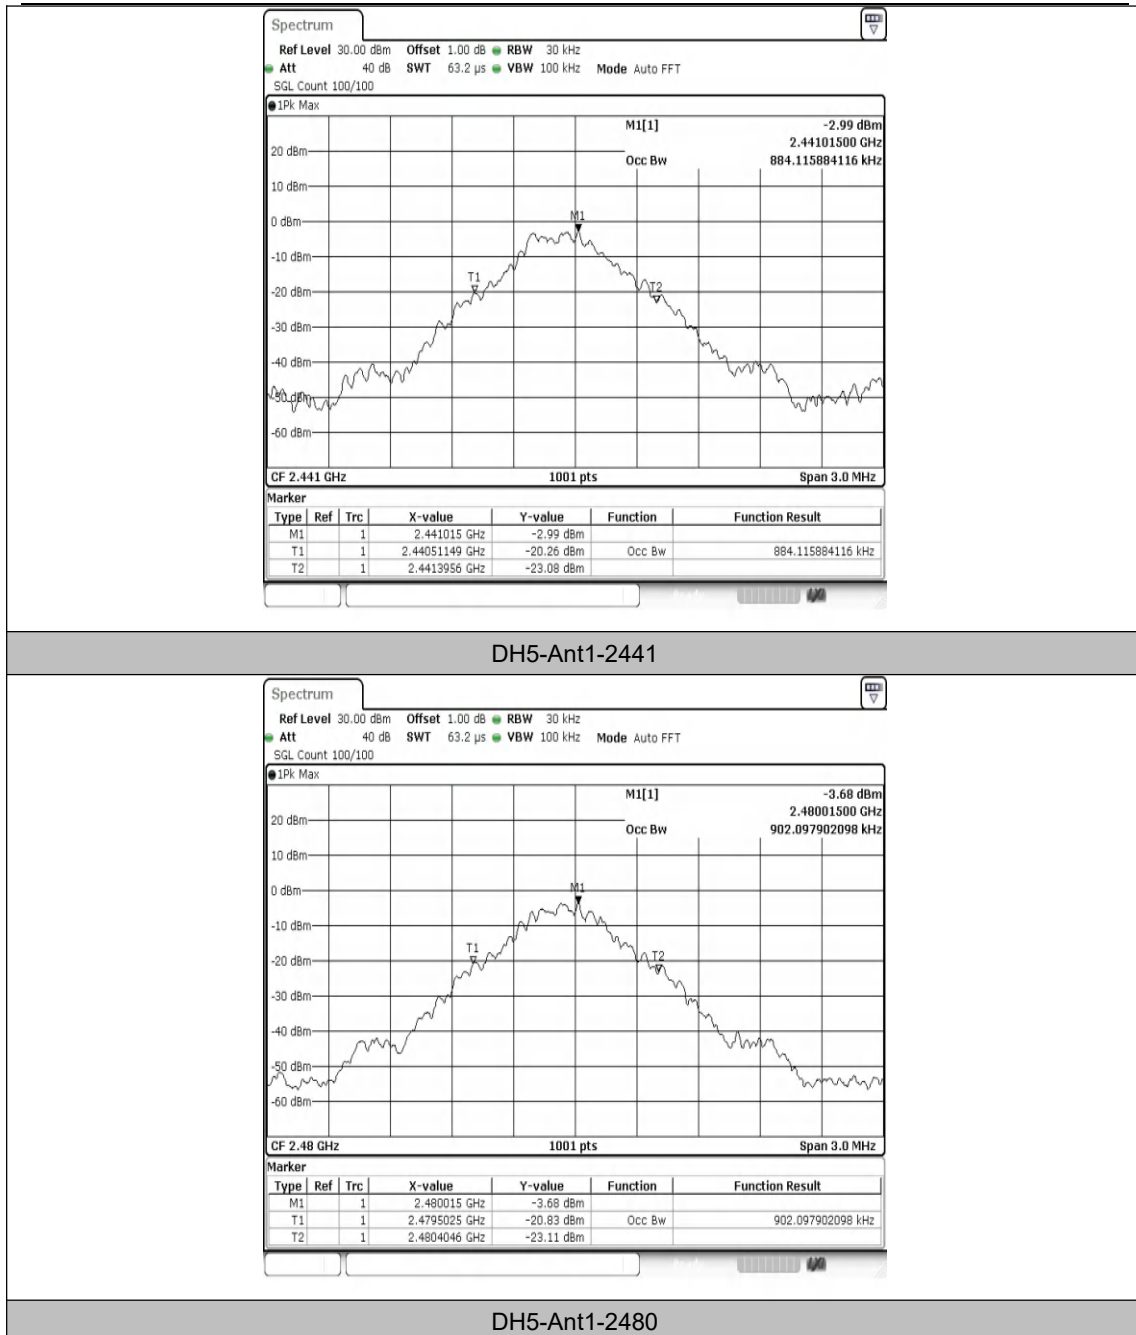


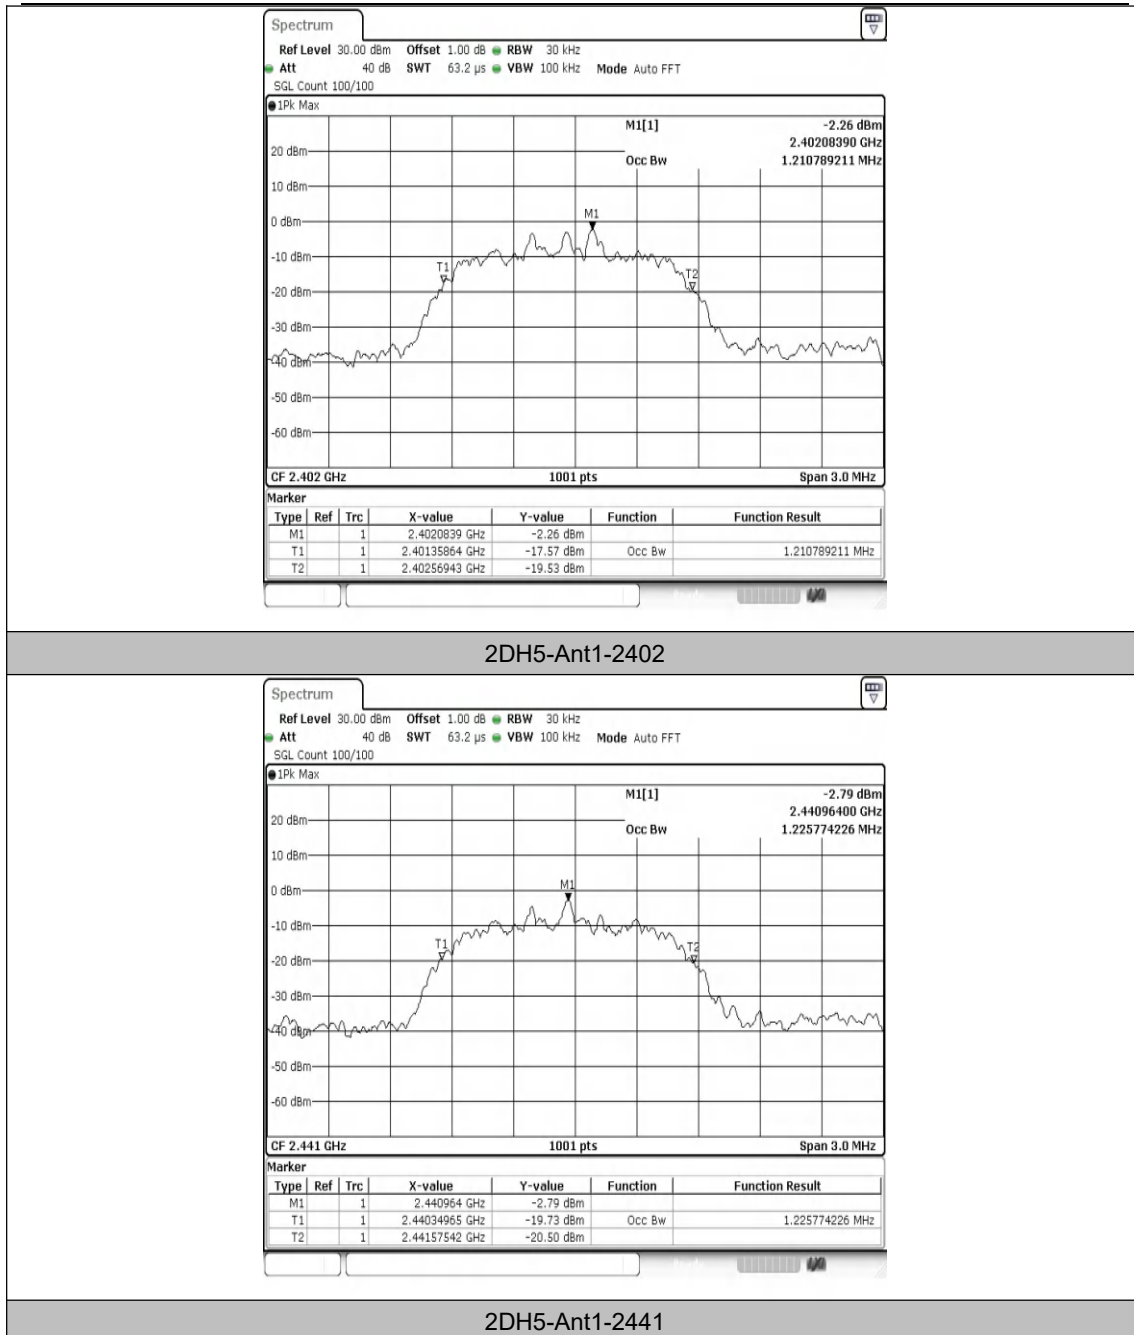

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

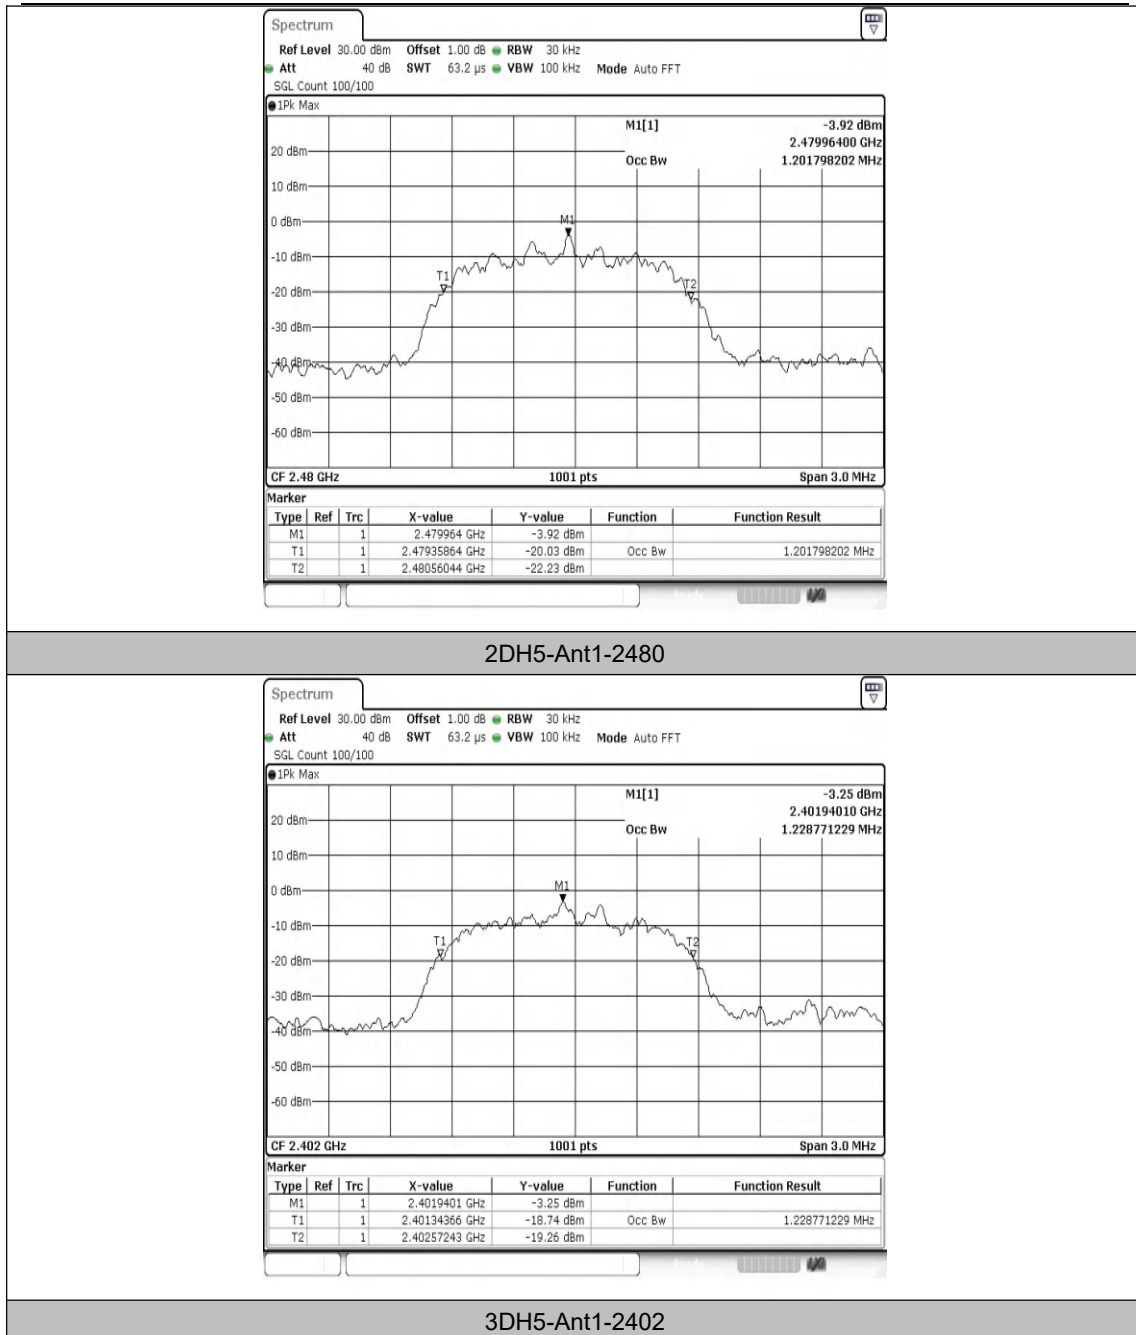

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

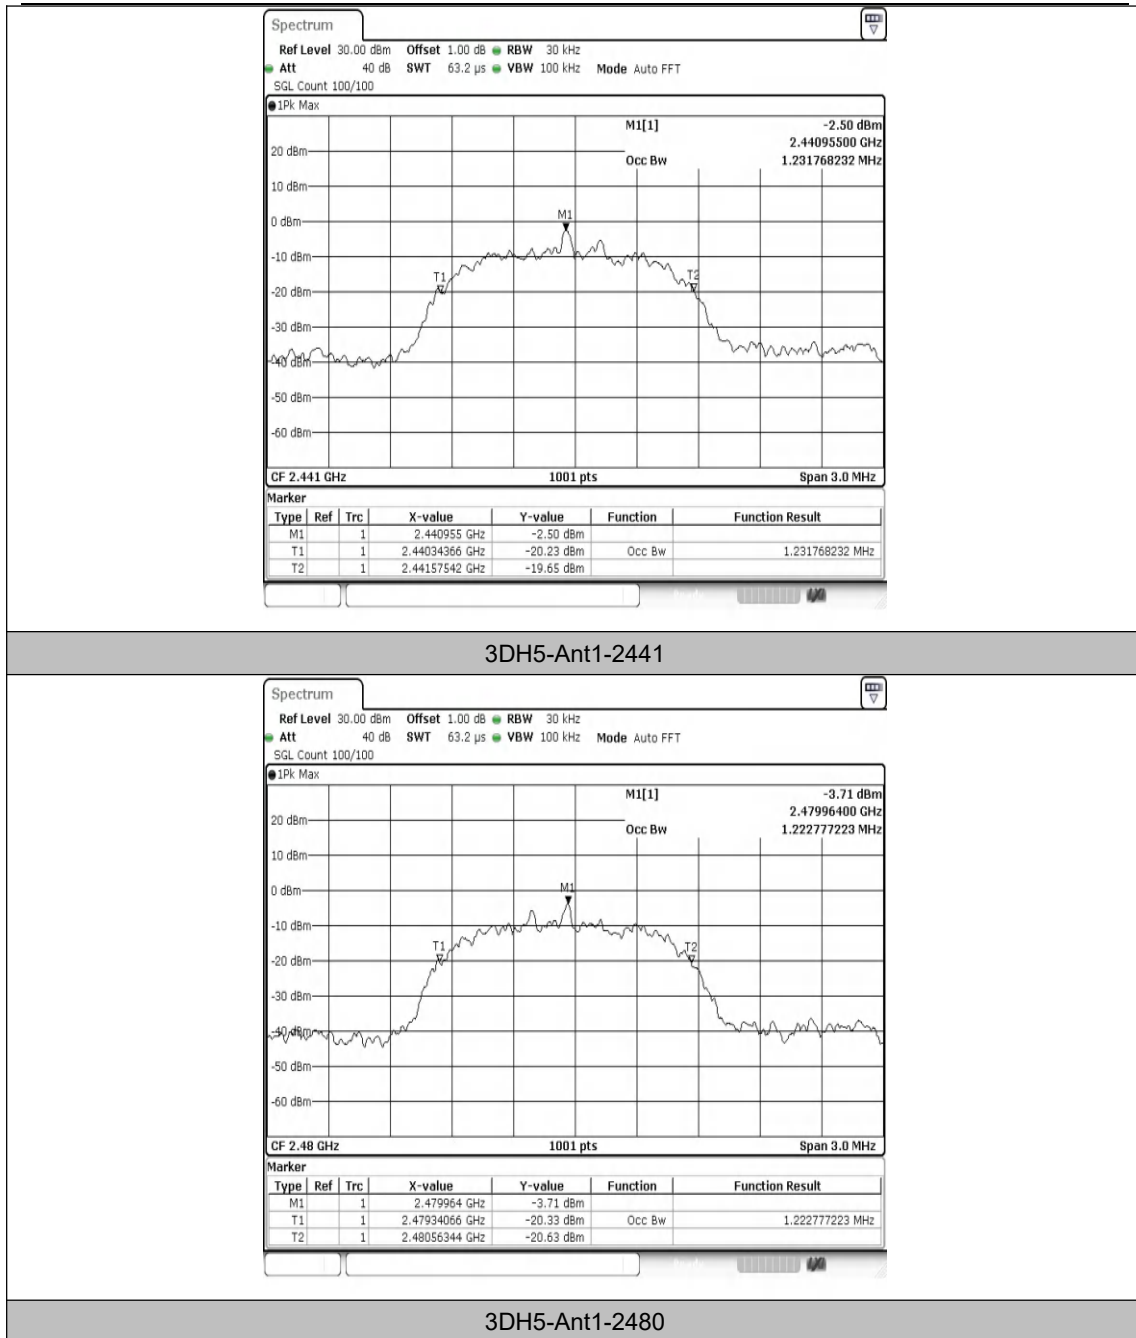

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	1.00	≤20.97	PASS
DH5	Ant1	2441	0.12	≤20.97	PASS
DH5	Ant1	2480	-0.56	≤20.97	PASS
2DH5	Ant1	2402	1.21	≤20.97	PASS
2DH5	Ant1	2441	0.17	≤20.97	PASS
2DH5	Ant1	2480	-0.36	≤20.97	PASS
3DH5	Ant1	2402	1.24	≤20.97	PASS
3DH5	Ant1	2441	0.34	≤20.97	PASS
3DH5	Ant1	2480	-0.51	≤20.97	PASS

Test Graphs

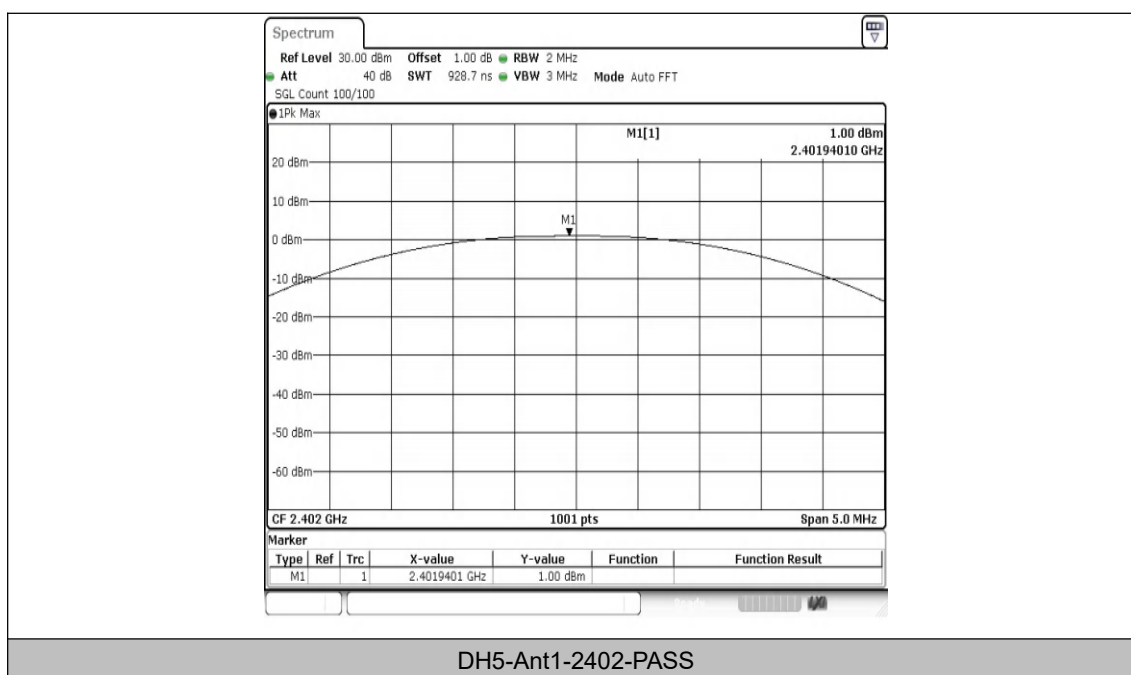


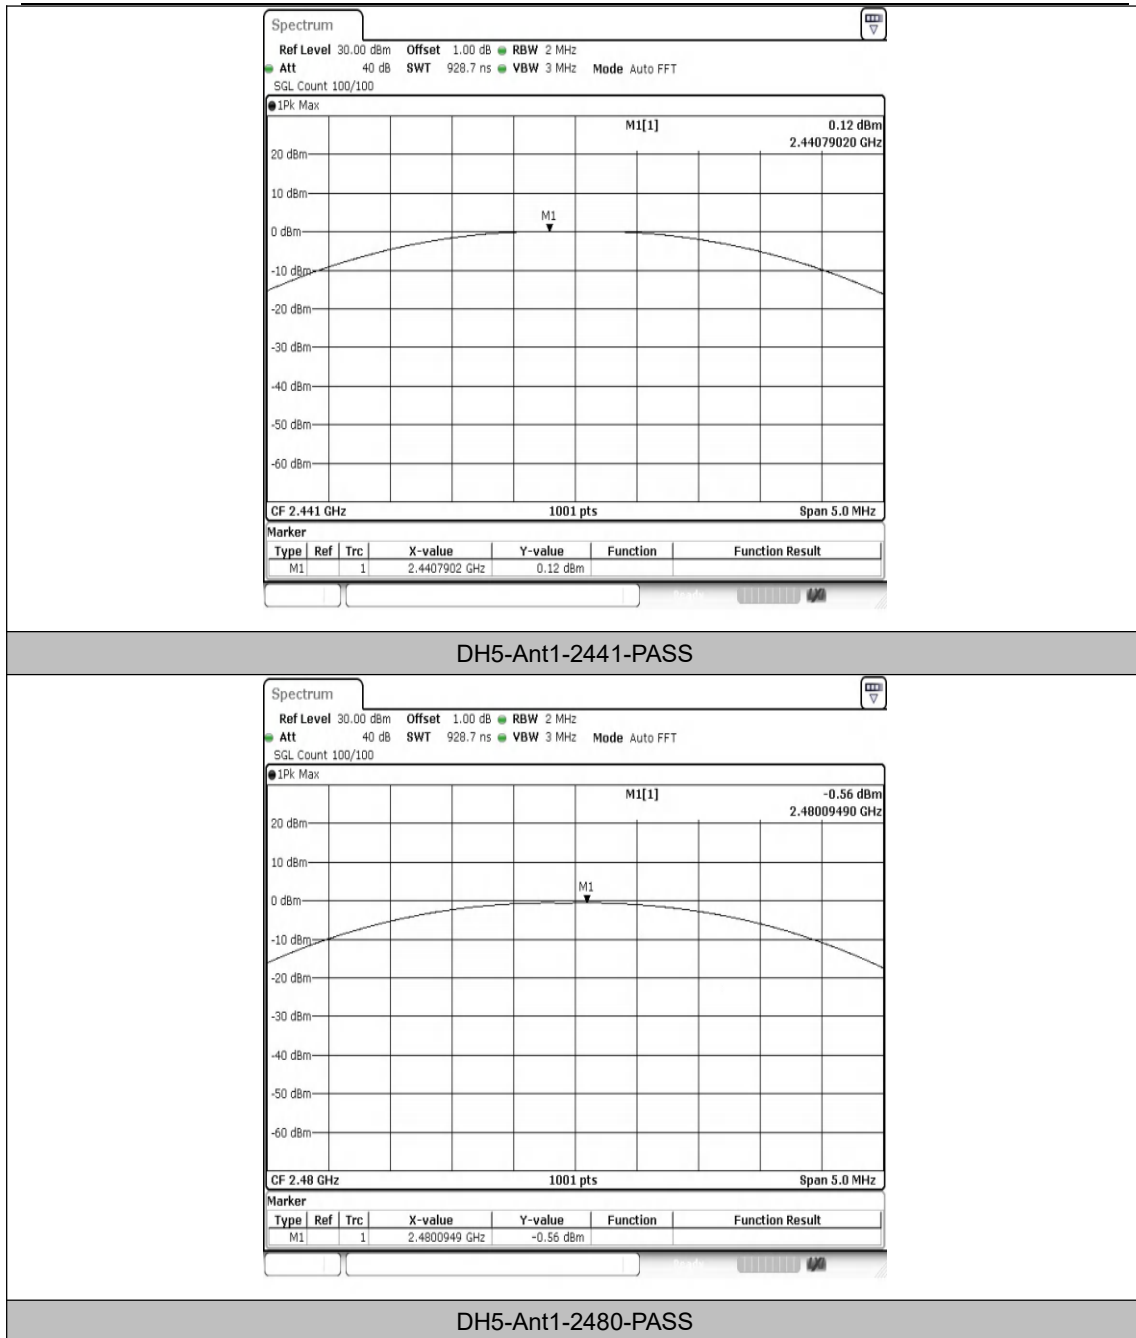

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

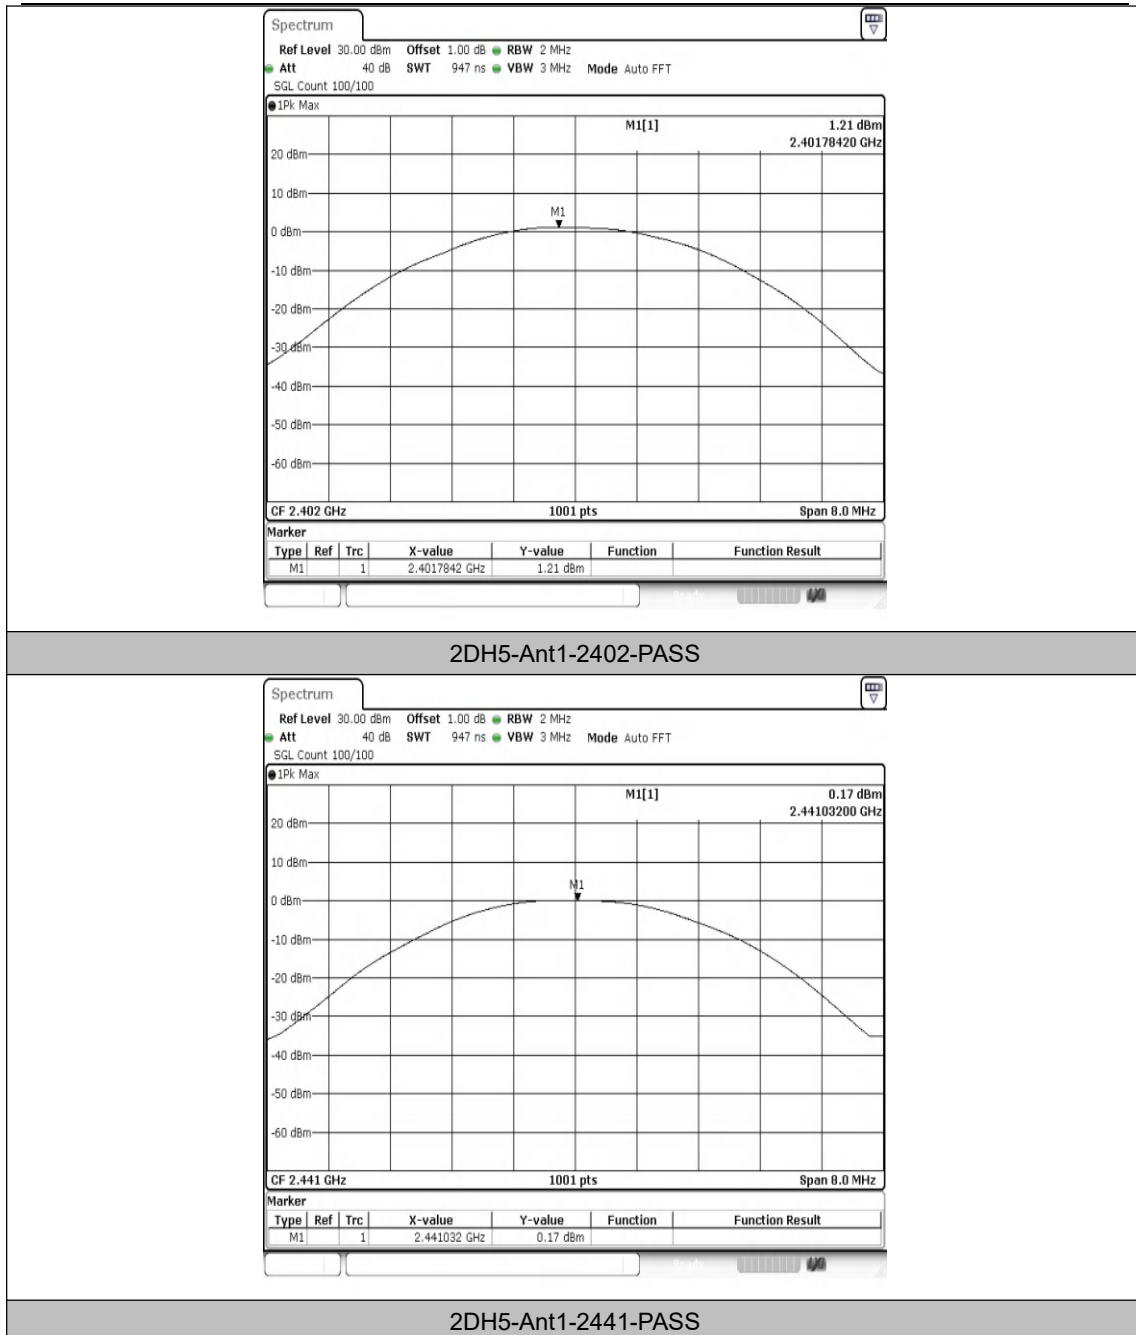


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

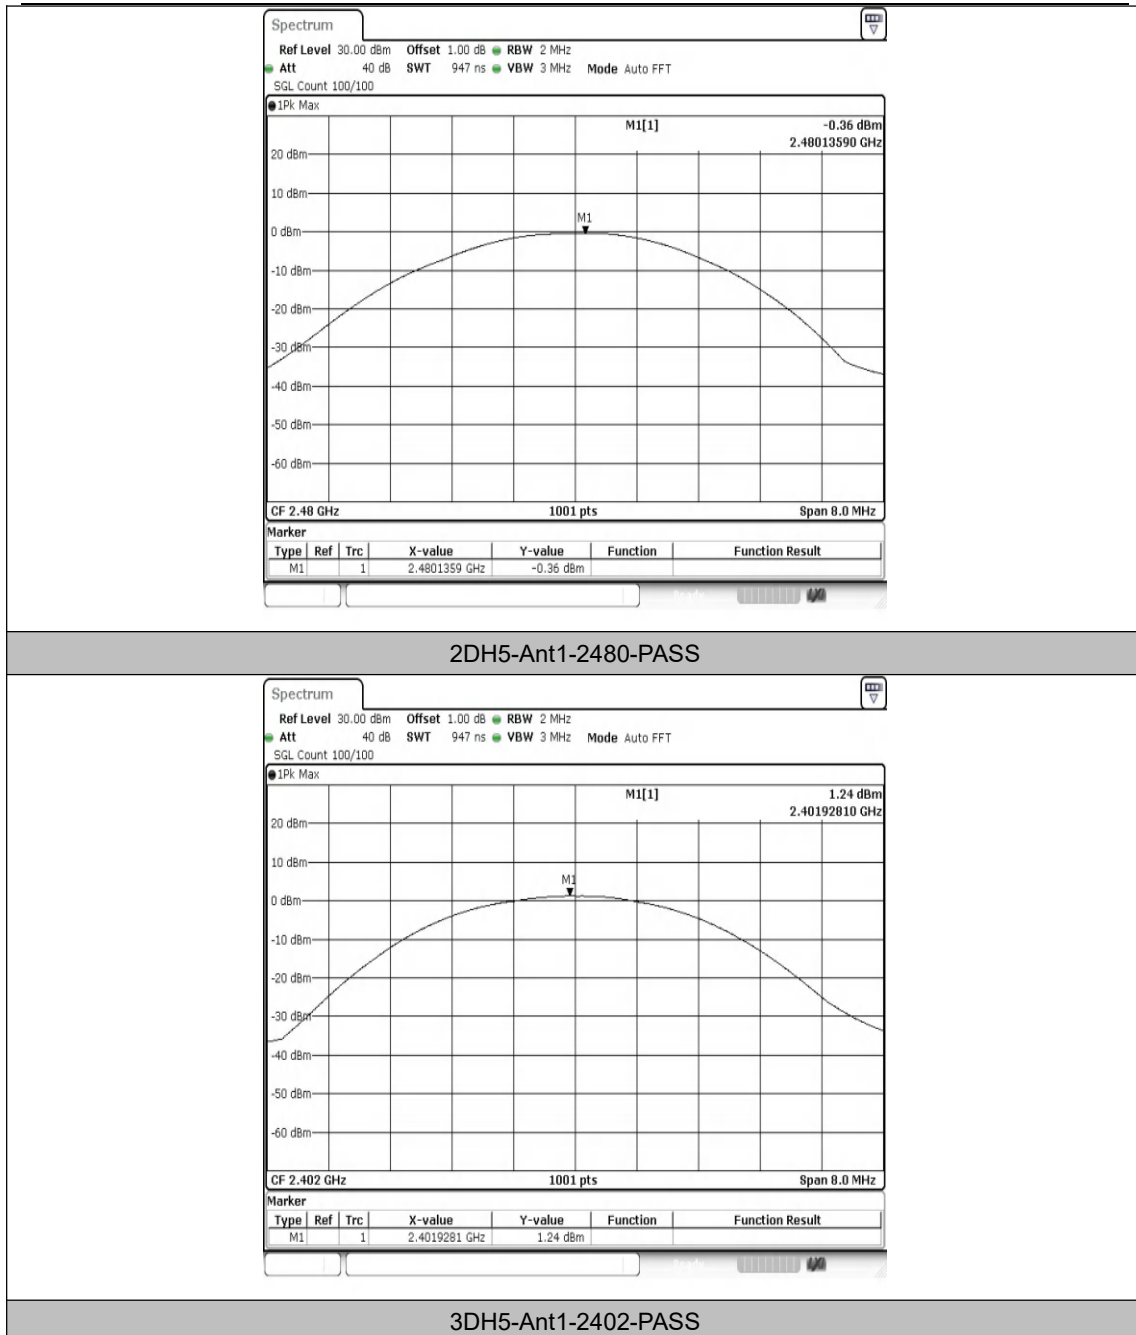

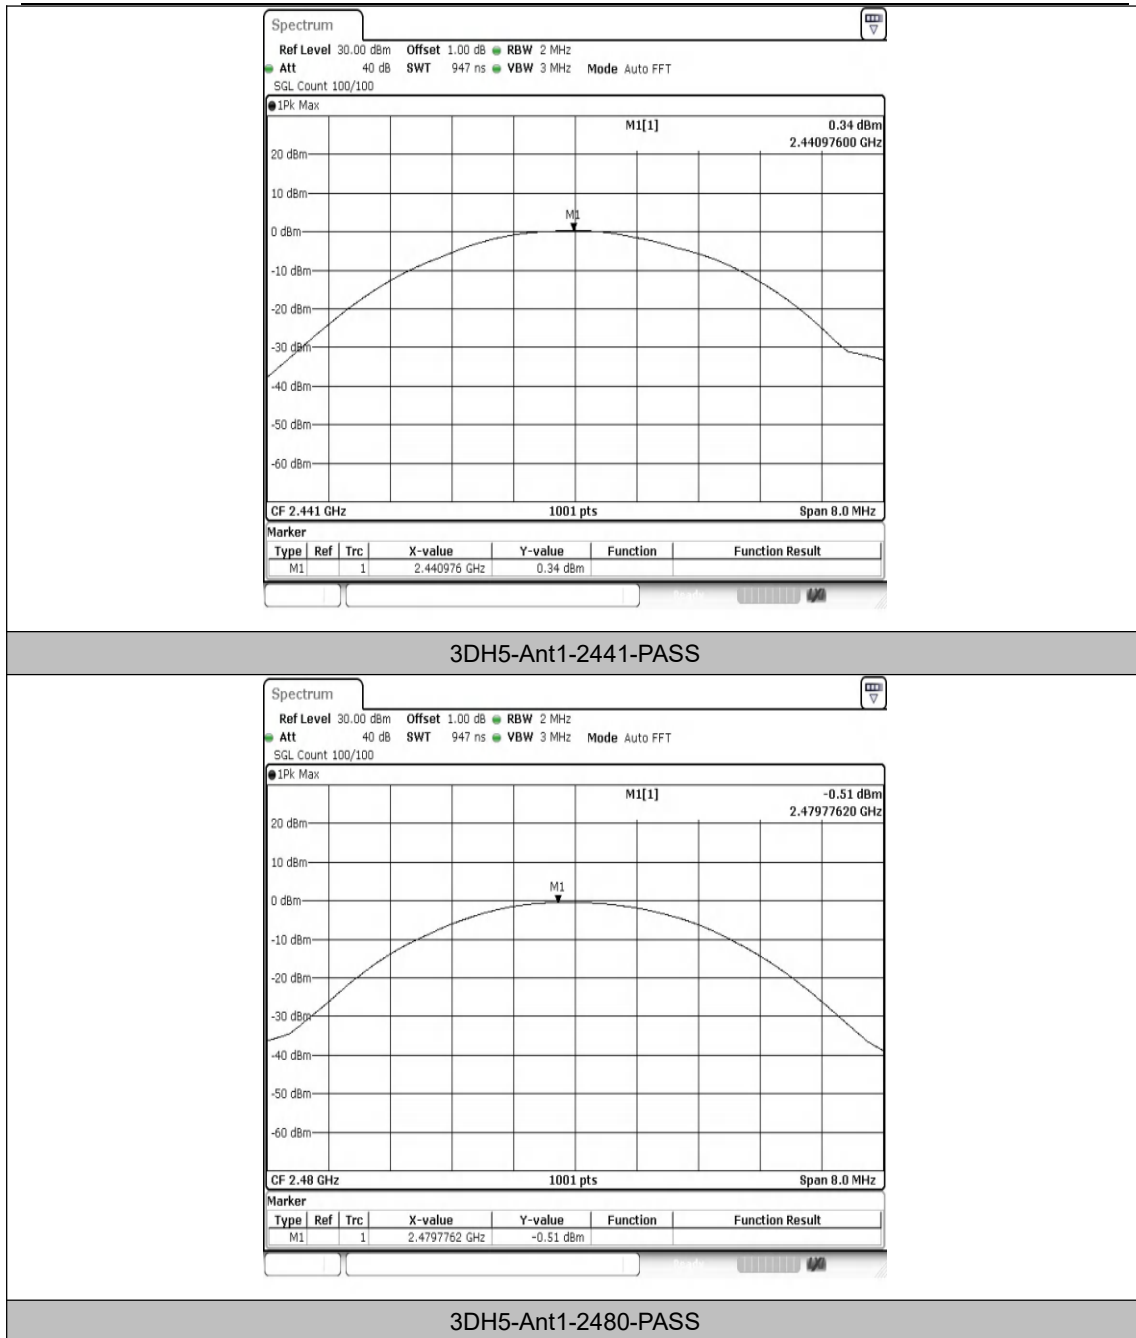



Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	1.000	≥0.660	PASS
2DH5	Ant1	Hop	0.994	≥0.907	PASS
3DH5	Ant1	Hop	0.994	≥0.880	PASS

Test Graphs

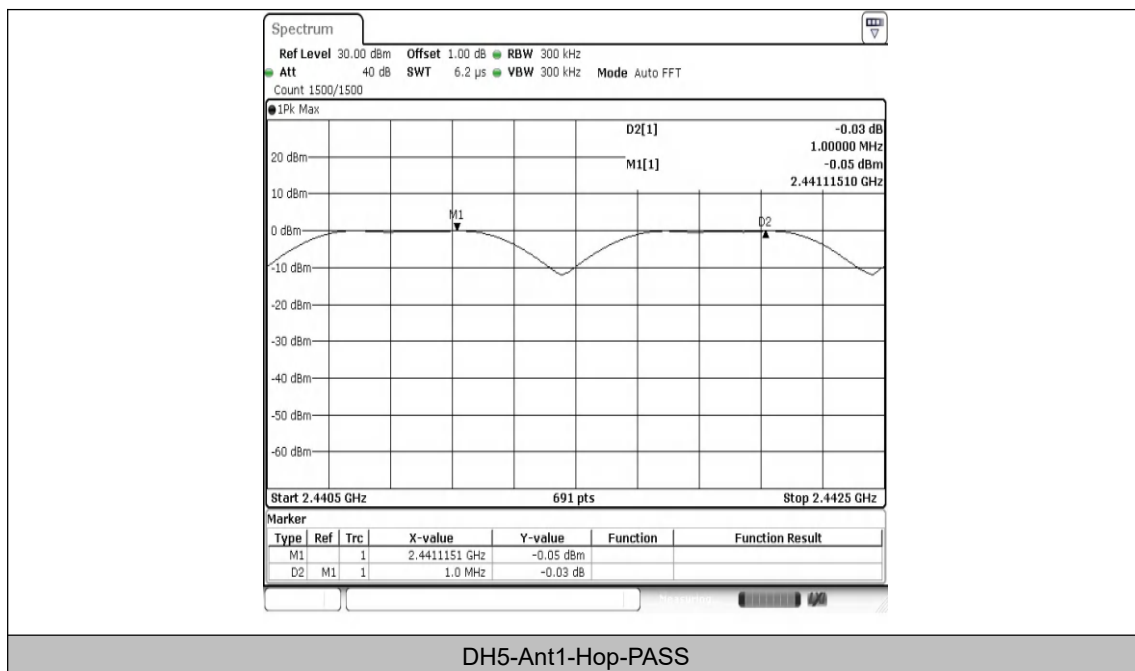

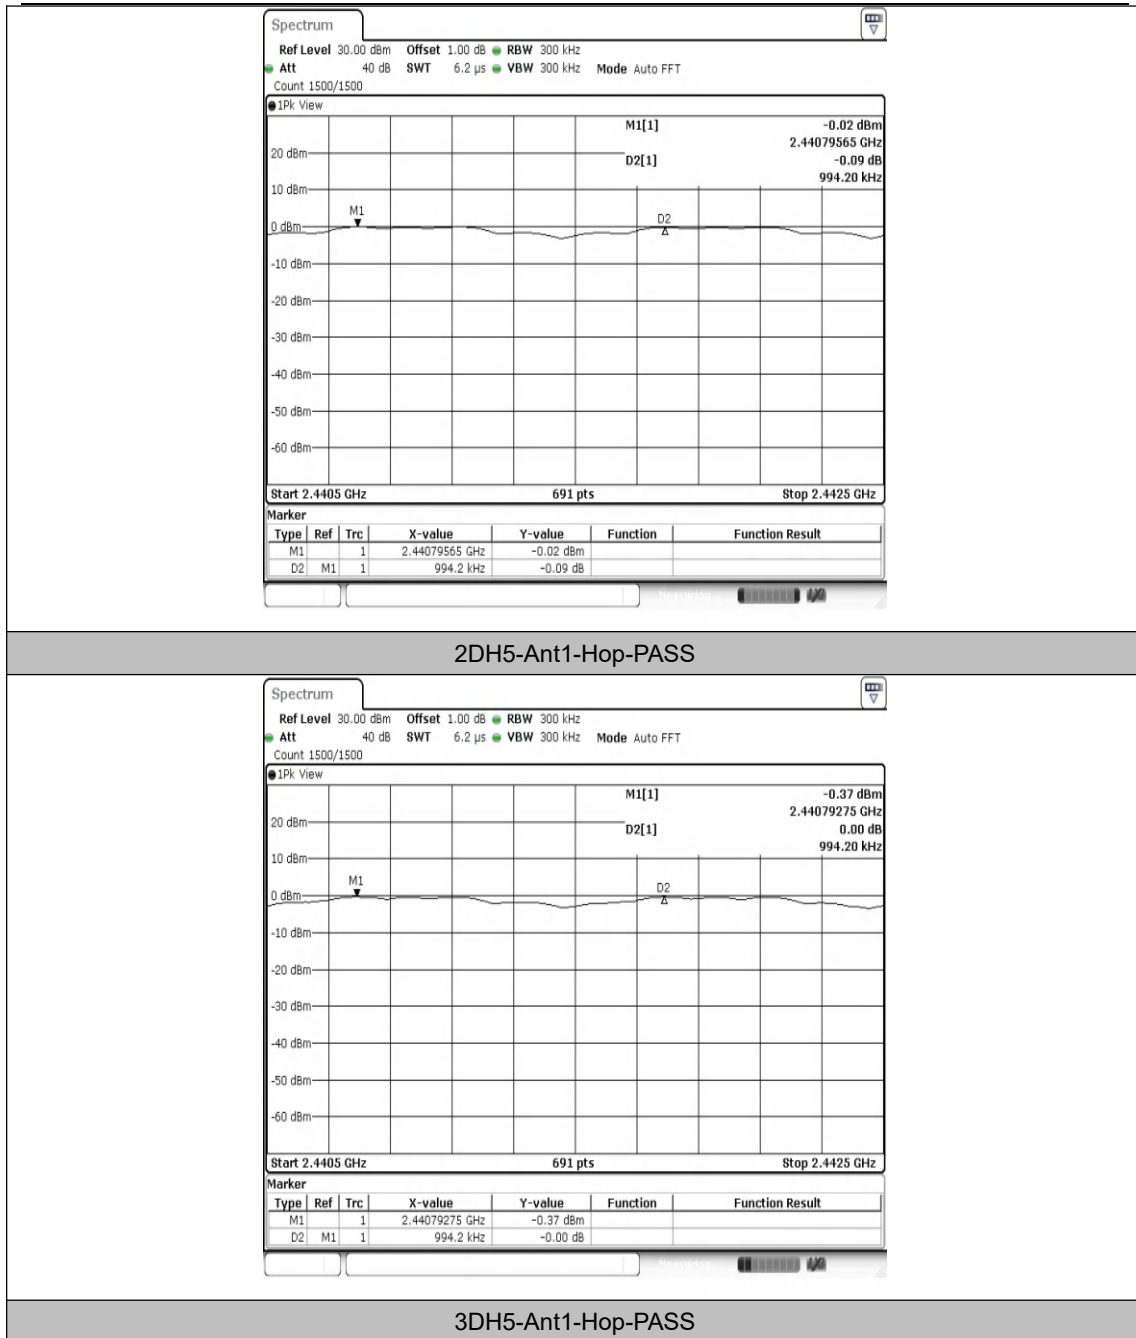


Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.909	107	0.311	≤0.4	PASS
2DH5	Ant1	Hop	2.915	113	0.329	≤0.4	PASS
3DH5	Ant1	Hop	2.918	103	0.301	≤0.4	PASS


Test Graphs

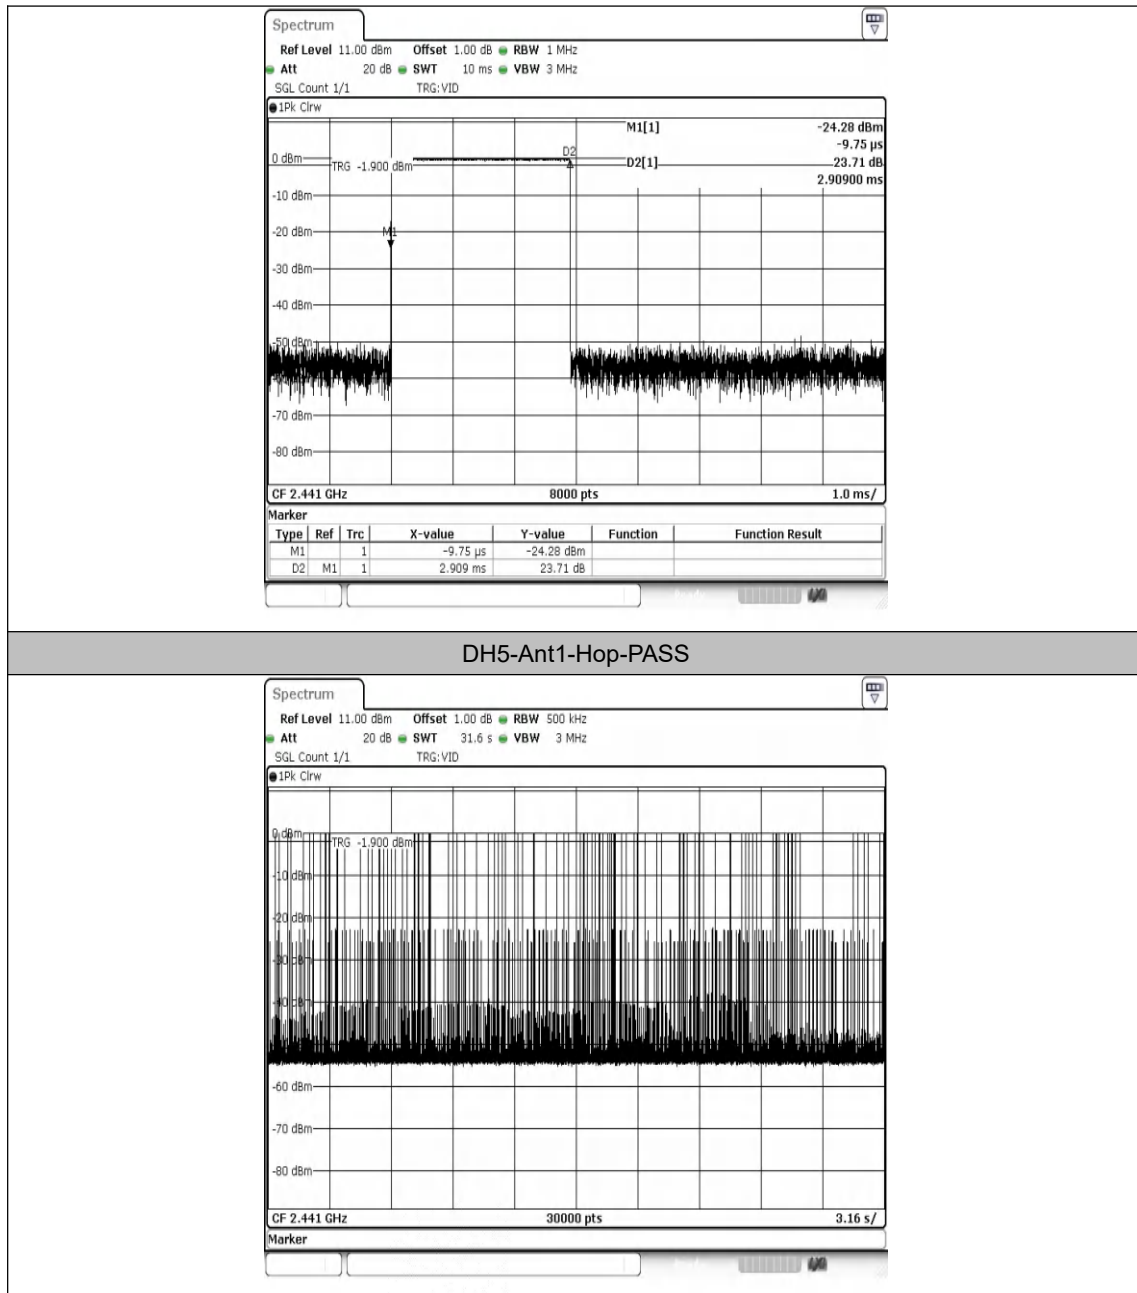

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

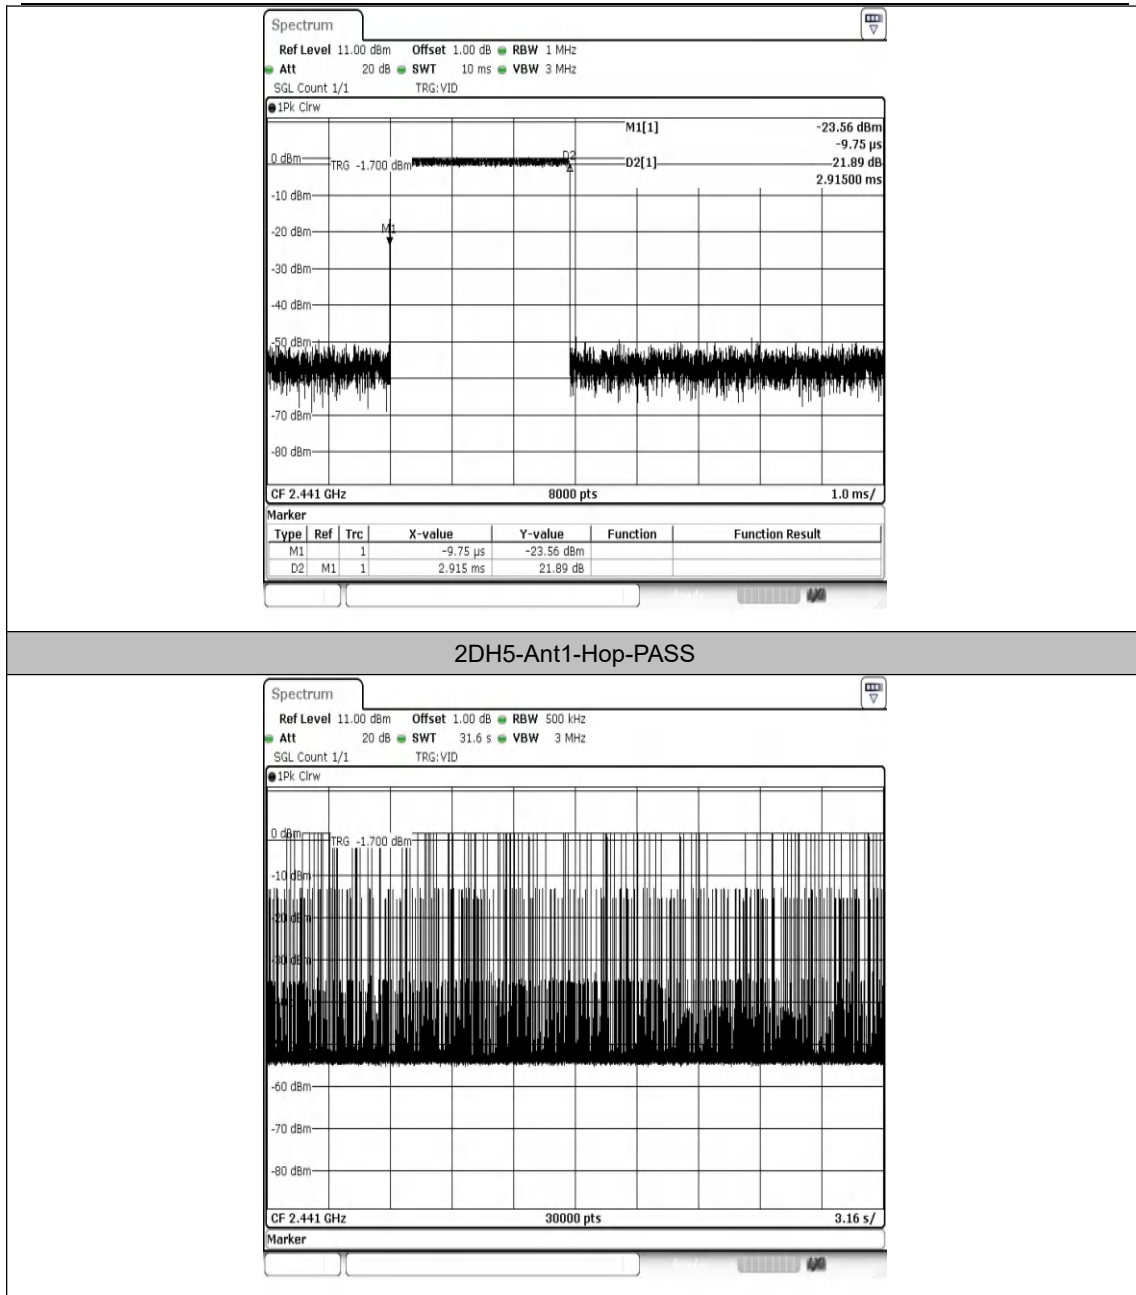

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

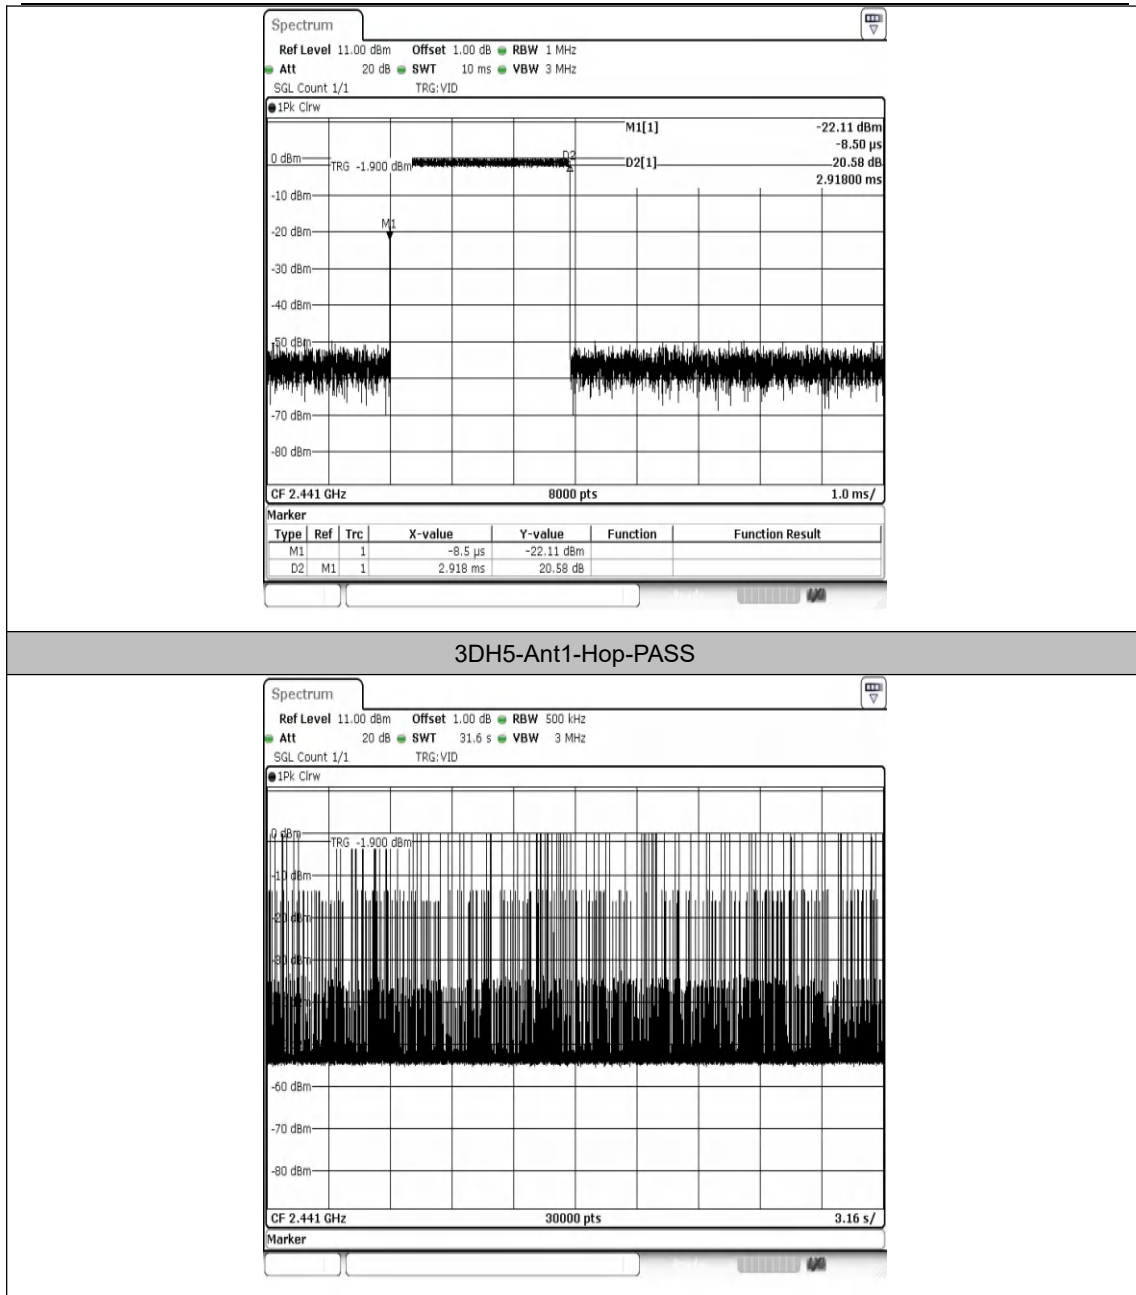

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS
2DH5	Ant1	Hop	79	≥15	PASS
3DH5	Ant1	Hop	79	≥15	PASS

Test Graphs

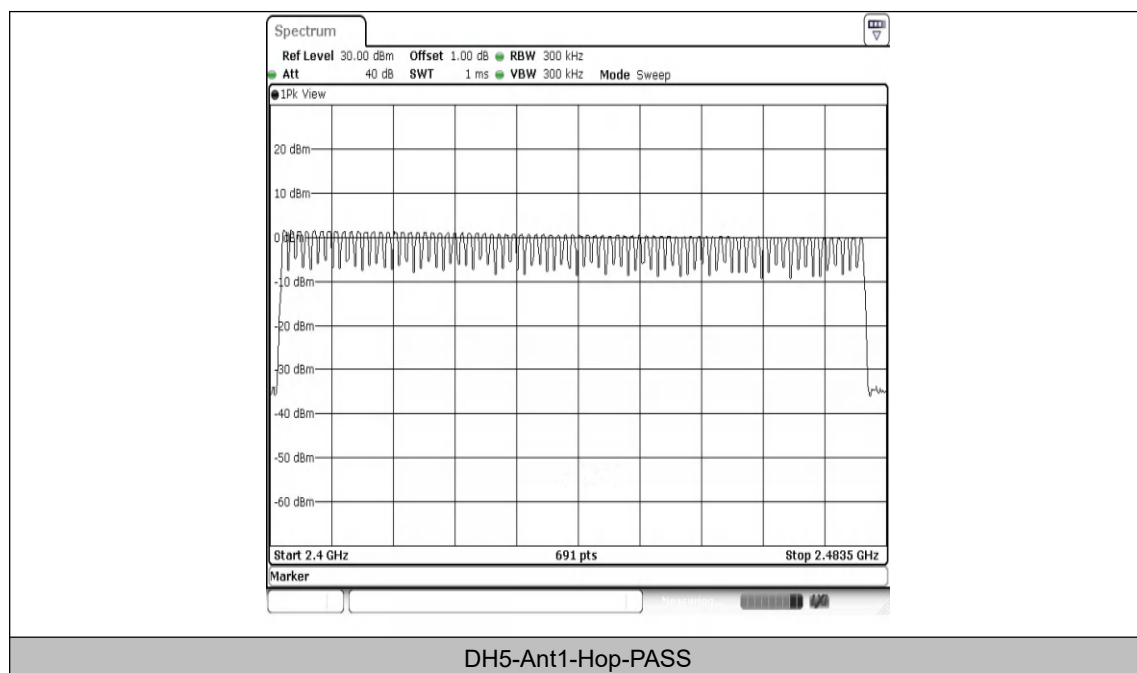

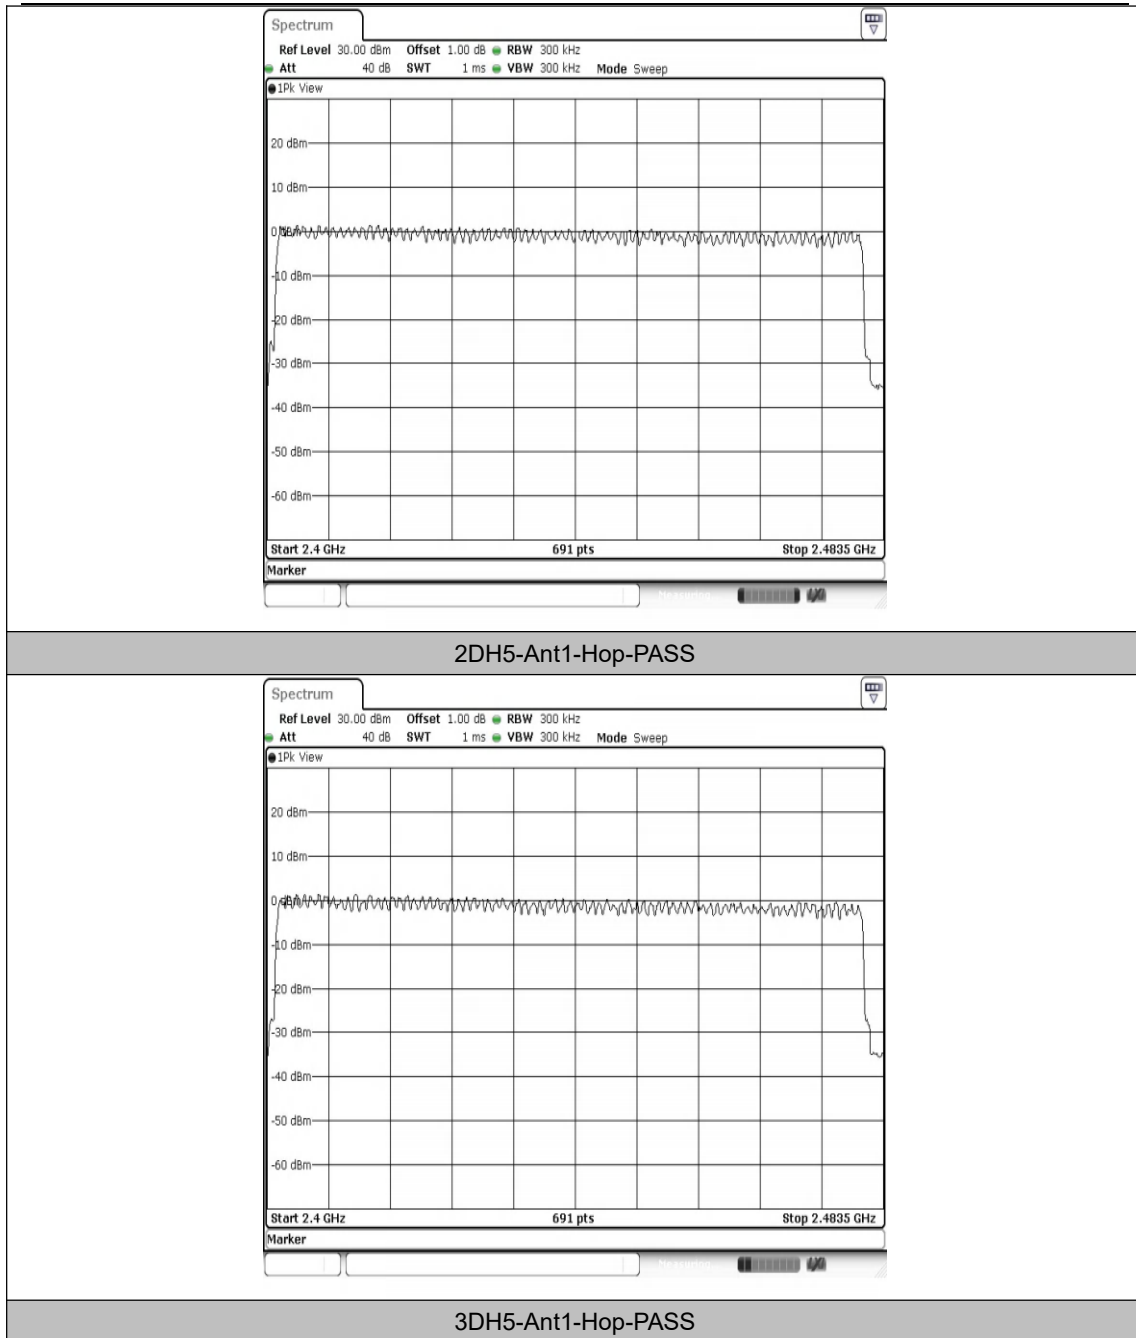

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Conducted Band edge


Test Result


Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	0.93	-54.14	≤-19.07	PASS
DH5	Ant1	High	2480	-0.75	-54.53	≤-20.75	PASS
DH5	Ant1	Low	Hop_2402	0.23	-54.74	≤-19.77	PASS
DH5	Ant1	High	Hop_2480	-1.00	-56.21	≤-21	PASS
2DH5	Ant1	Low	2402	0.94	-48.53	≤-19.06	PASS
2DH5	Ant1	High	2480	-1.04	-43.19	≤-21.04	PASS
2DH5	Ant1	Low	Hop_2402	0.63	-51.26	≤-19.37	PASS
2DH5	Ant1	High	Hop_2480	-0.90	-54.83	≤-20.9	PASS
3DH5	Ant1	Low	2402	0.01	-47.91	≤-19.99	PASS
3DH5	Ant1	High	2480	-1.11	-55.14	≤-21.11	PASS
3DH5	Ant1	Low	Hop_2402	-2.62	-49.08	≤-22.62	PASS
3DH5	Ant1	High	Hop_2480	-1.75	-55.64	≤-21.75	PASS


Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Test Graphs

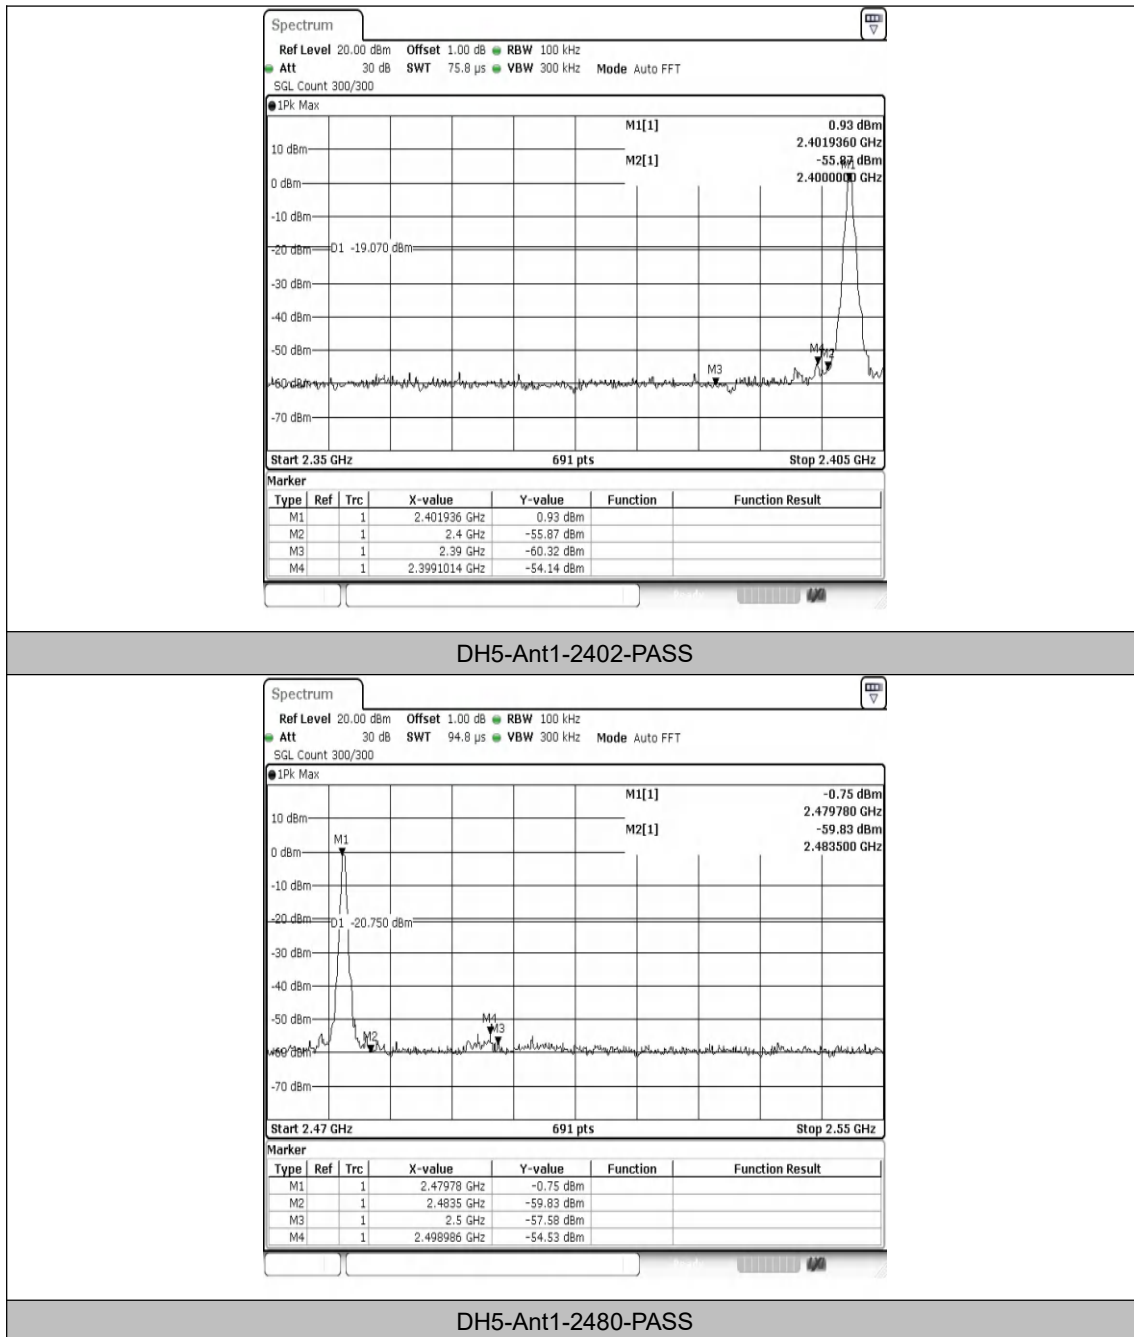

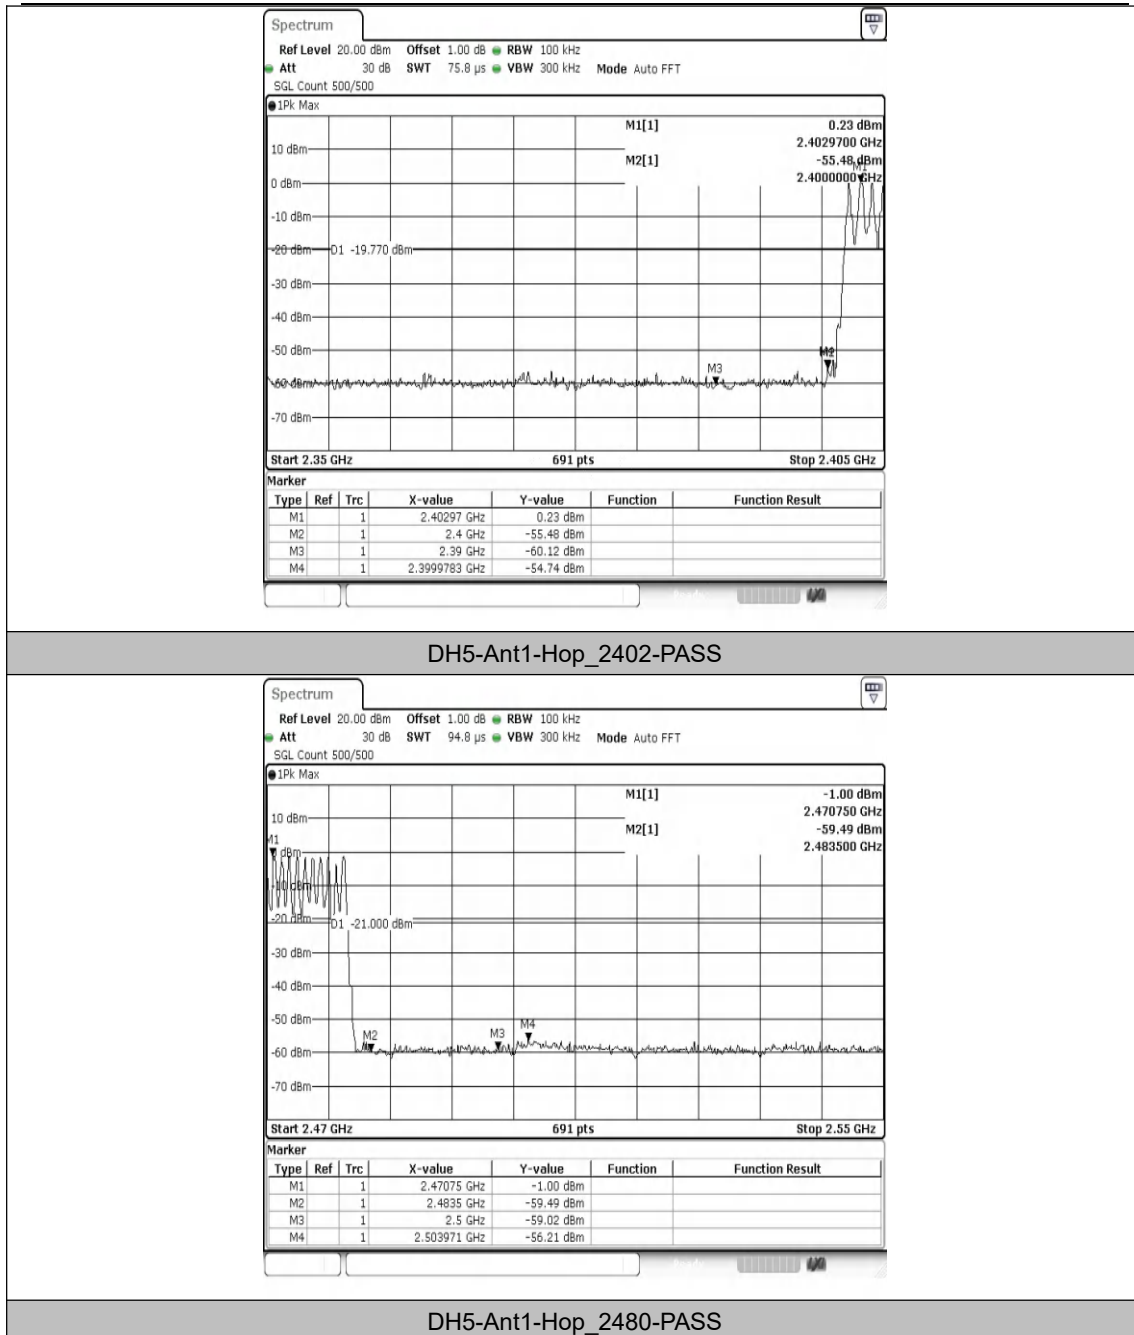

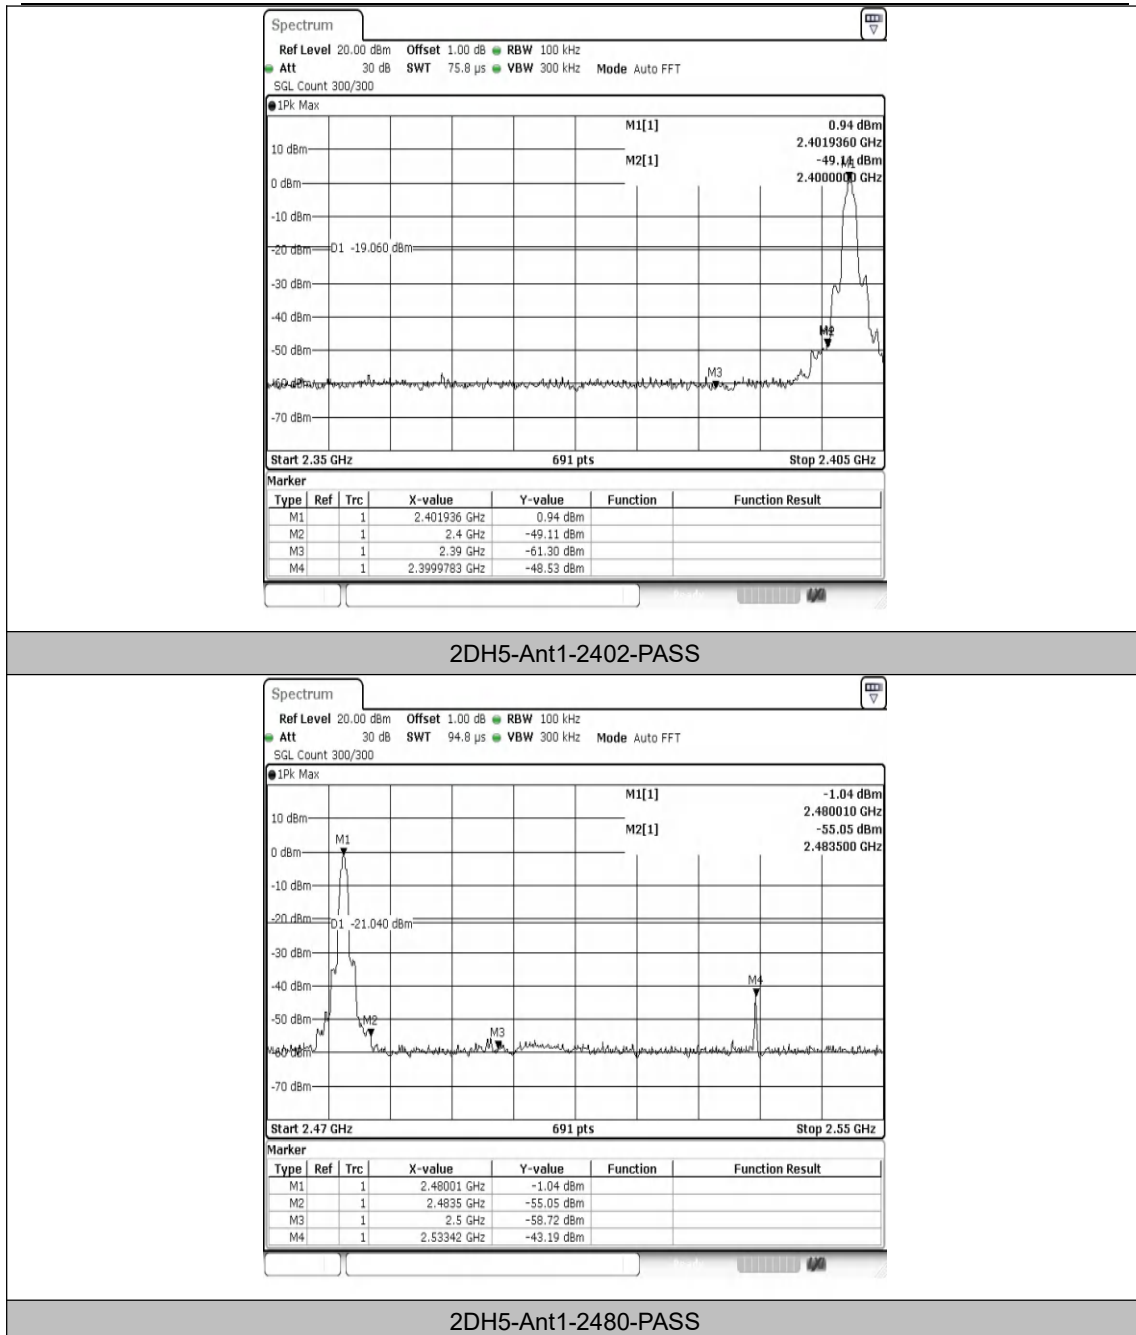


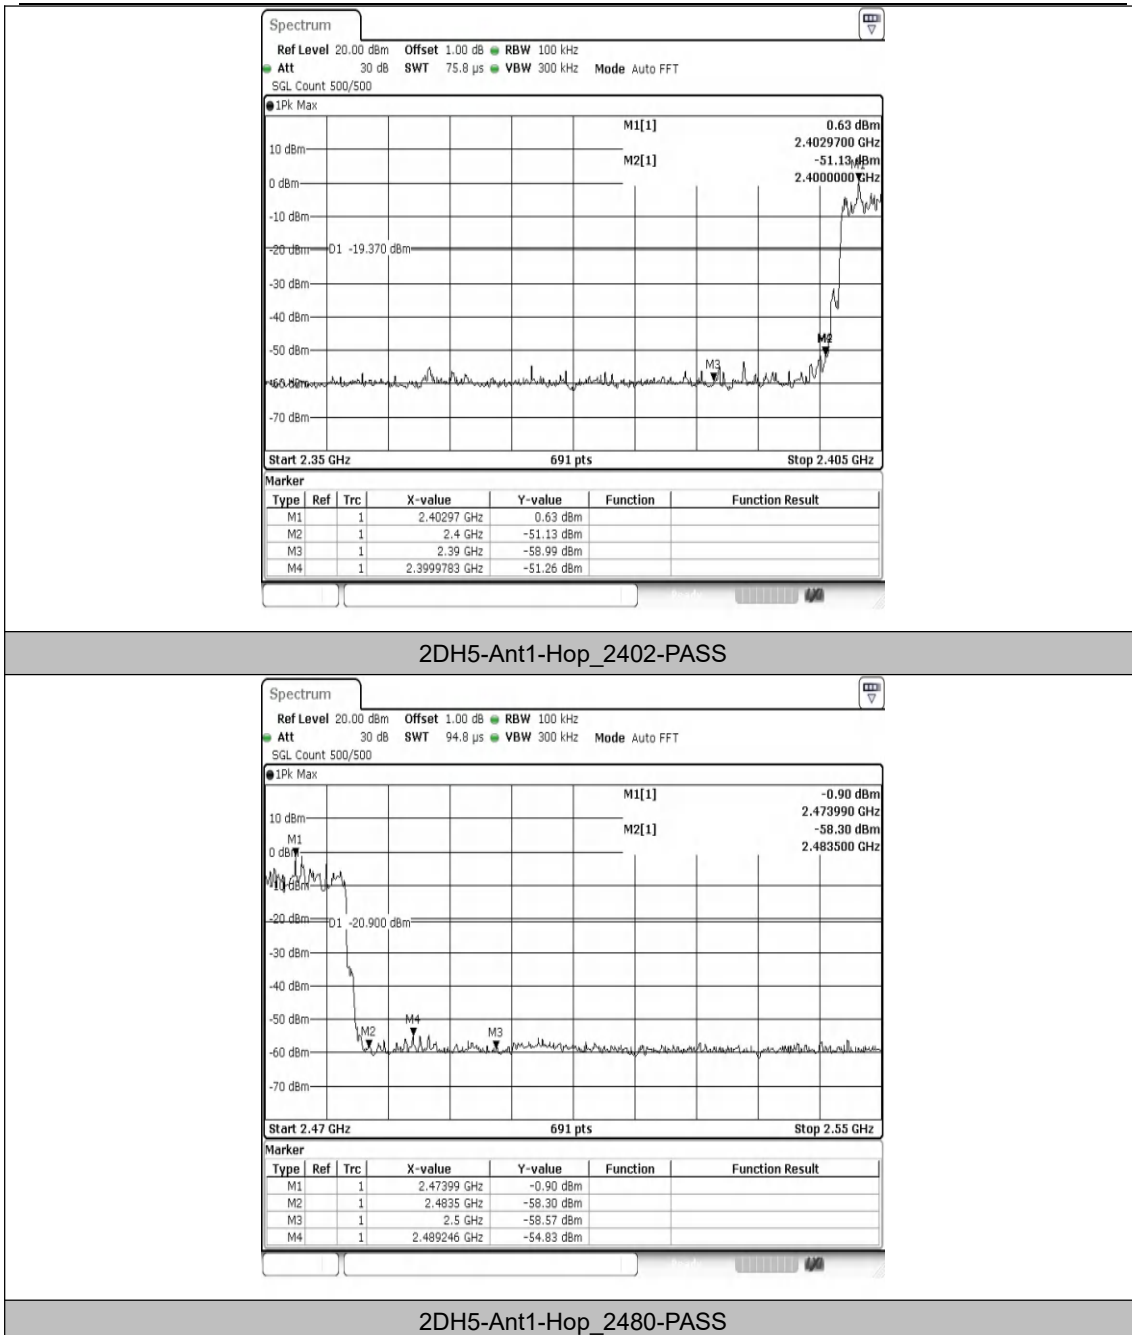


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

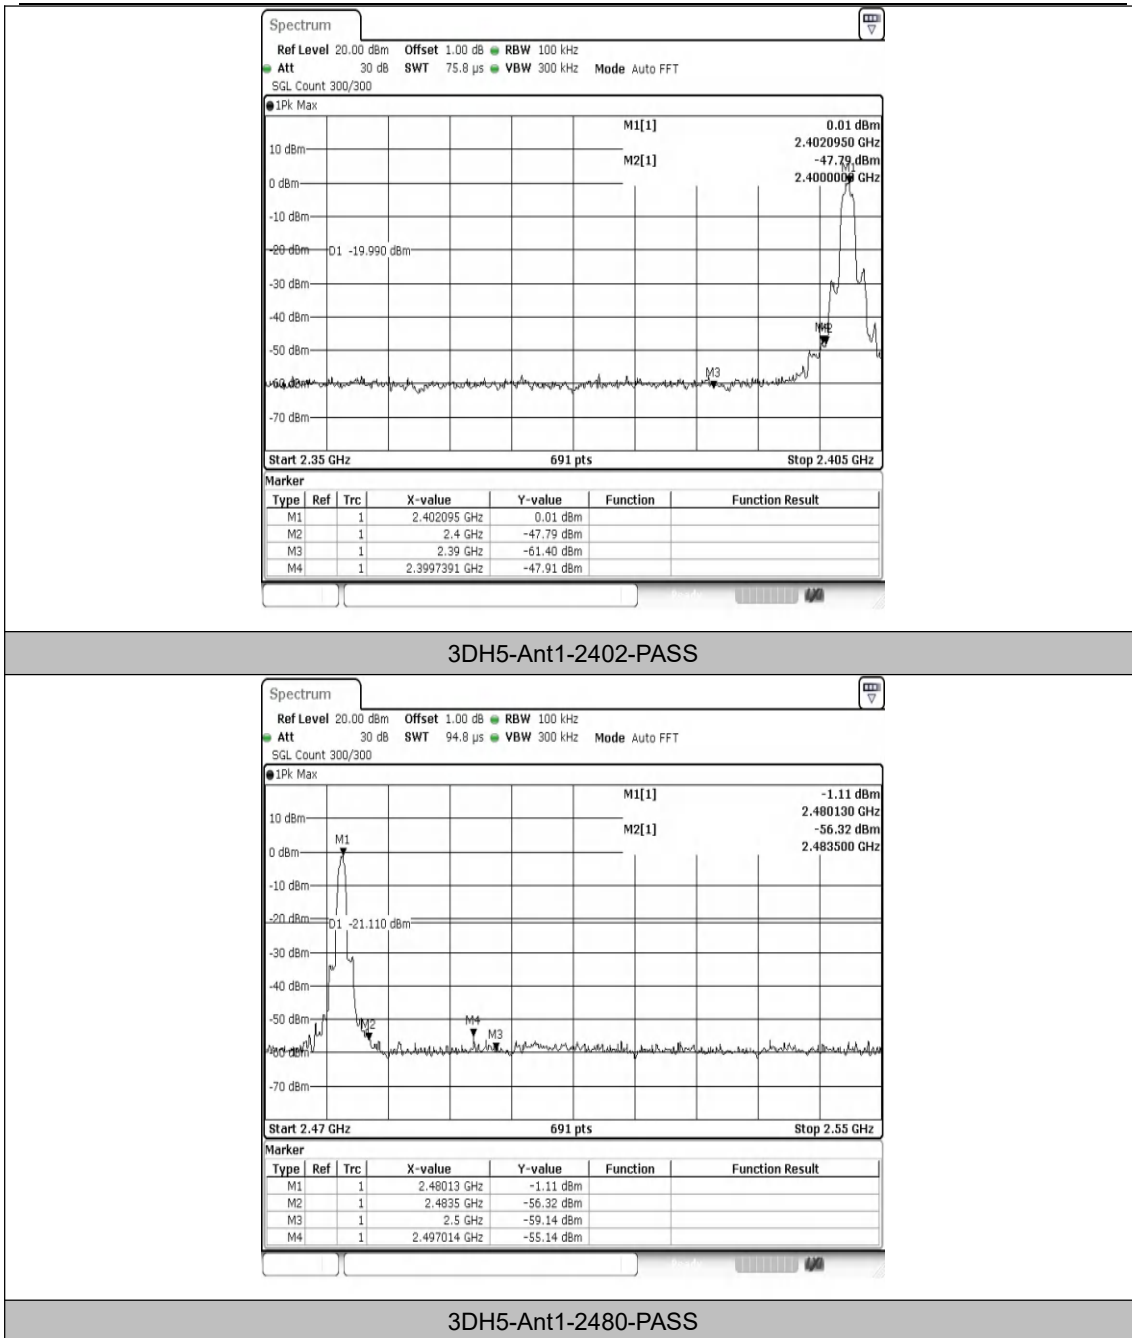

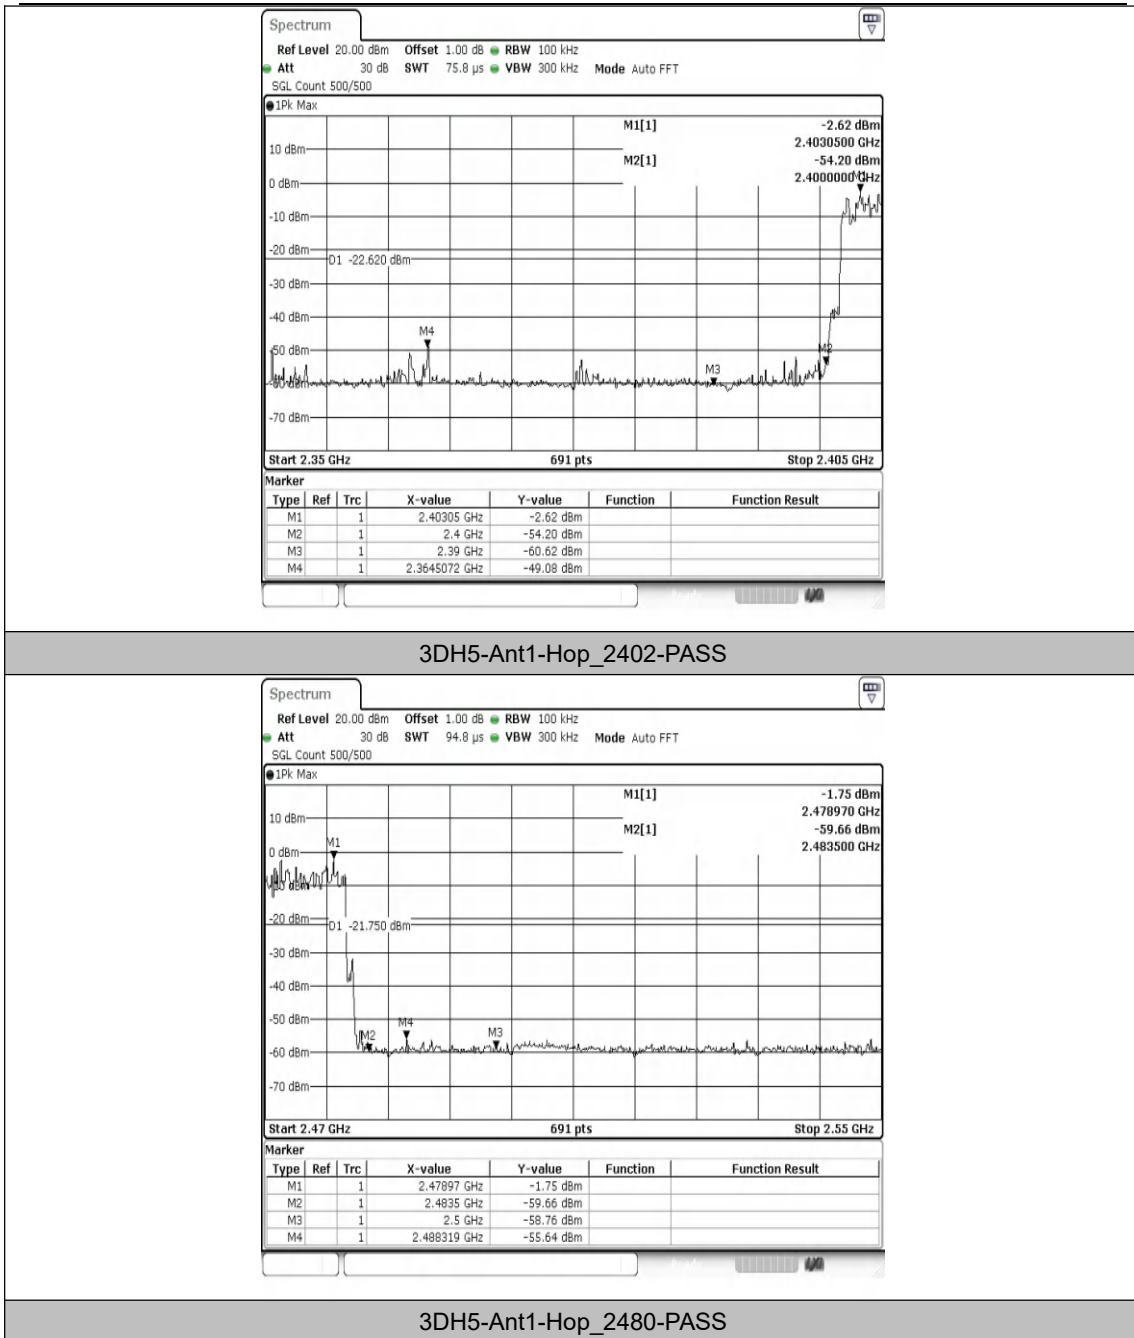

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	0.73	0.73	---	PASS
DH5	Ant1	2402	30~1000	0.73	-57.76	≤-19.27	PASS
DH5	Ant1	2402	1000~26500	0.73	-38.3	≤-19.27	PASS
DH5	Ant1	2441	0~Reference	-0.72	-0.72	---	PASS
DH5	Ant1	2441	30~1000	-0.72	-58.2	≤-20.72	PASS
DH5	Ant1	2441	1000~26500	-0.72	-39.47	≤-20.72	PASS
DH5	Ant1	2480	0~Reference	-1.38	-1.38	---	PASS
DH5	Ant1	2480	30~1000	-1.38	-58.48	≤-21.38	PASS
DH5	Ant1	2480	1000~26500	-1.38	-41.82	≤-21.38	PASS
2DH5	Ant1	2402	0~Reference	-0.89	-0.89	---	PASS
2DH5	Ant1	2402	30~1000	-0.89	-58.05	≤-20.89	PASS
2DH5	Ant1	2402	1000~26500	-0.89	-43.84	≤-20.89	PASS
2DH5	Ant1	2441	0~Reference	-2.31	-2.31	---	PASS
2DH5	Ant1	2441	30~1000	-2.31	-58.4	≤-22.31	PASS
2DH5	Ant1	2441	1000~26500	-2.31	-42.34	≤-22.31	PASS
2DH5	Ant1	2480	0~Reference	-1.31	-1.31	---	PASS
2DH5	Ant1	2480	30~1000	-1.31	-57.55	≤-21.31	PASS
2DH5	Ant1	2480	1000~26500	-1.31	-43.67	≤-21.31	PASS
3DH5	Ant1	2402	0~Reference	0.11	0.11	---	PASS
3DH5	Ant1	2402	30~1000	0.11	-57.84	≤-19.89	PASS
3DH5	Ant1	2402	1000~26500	0.11	-43.66	≤-19.89	PASS
3DH5	Ant1	2441	0~Reference	-0.62	-0.62	---	PASS
3DH5	Ant1	2441	30~1000	-0.62	-57.91	≤-20.62	PASS
3DH5	Ant1	2441	1000~26500	-0.62	-39.86	≤-20.62	PASS
3DH5	Ant1	2480	0~Reference	-1.41	-1.41	---	PASS
3DH5	Ant1	2480	30~1000	-1.41	-57.02	≤-21.41	PASS
3DH5	Ant1	2480	1000~26500	-1.41	-43.37	≤-21.41	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'TDF' of the Spectrum Analyzer during the test.


Test Graphs

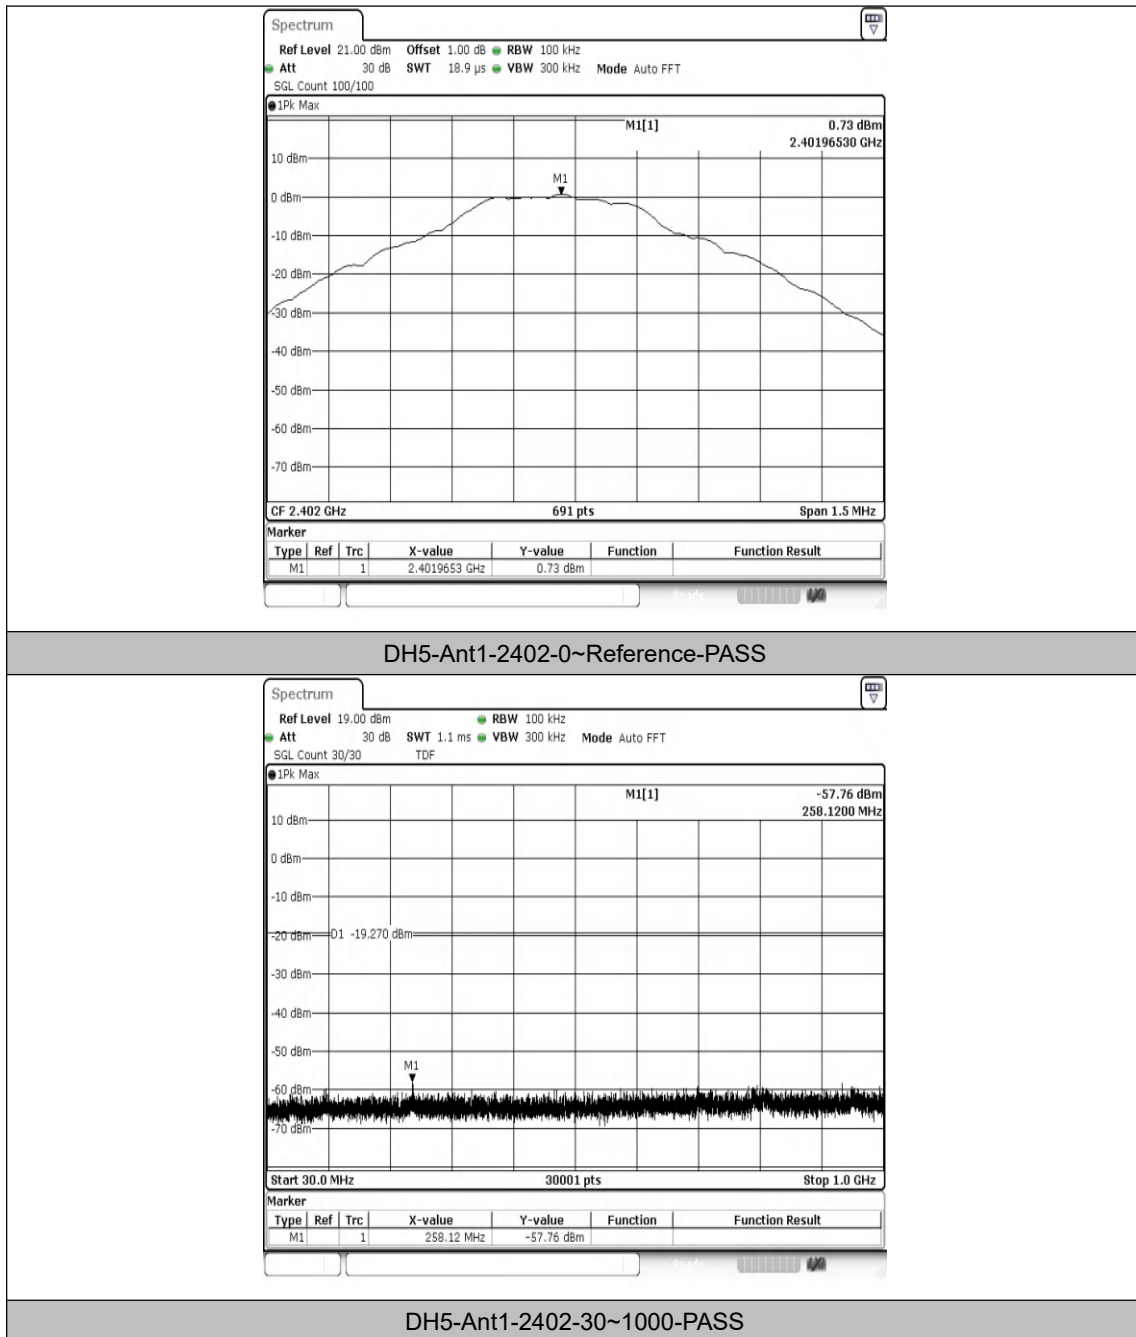

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

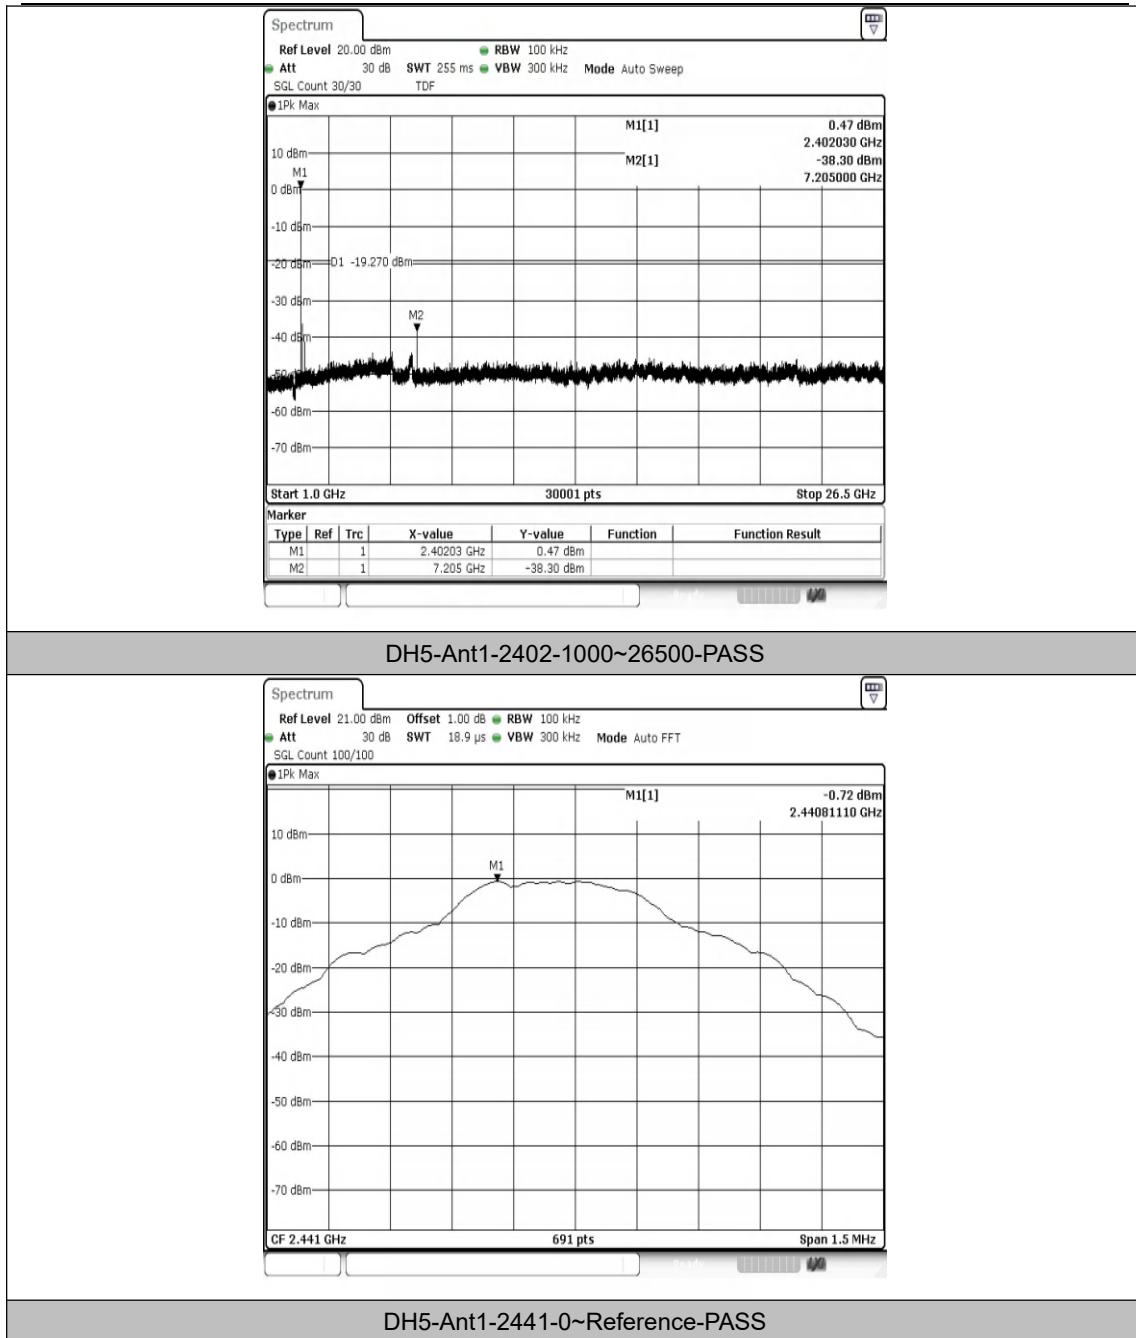

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

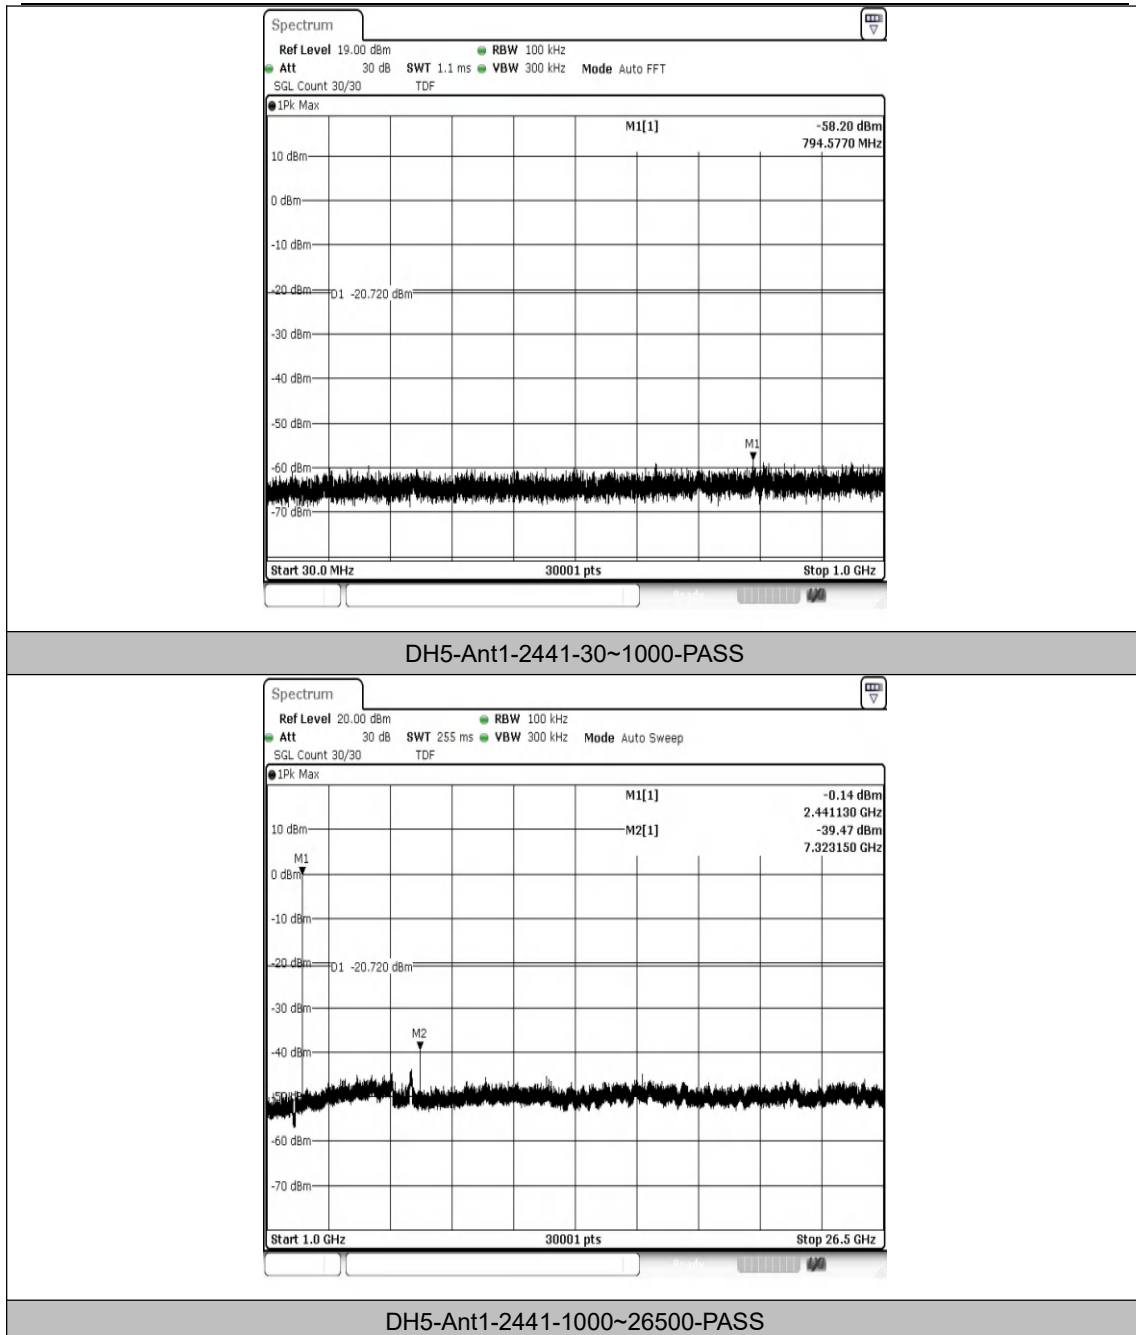

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

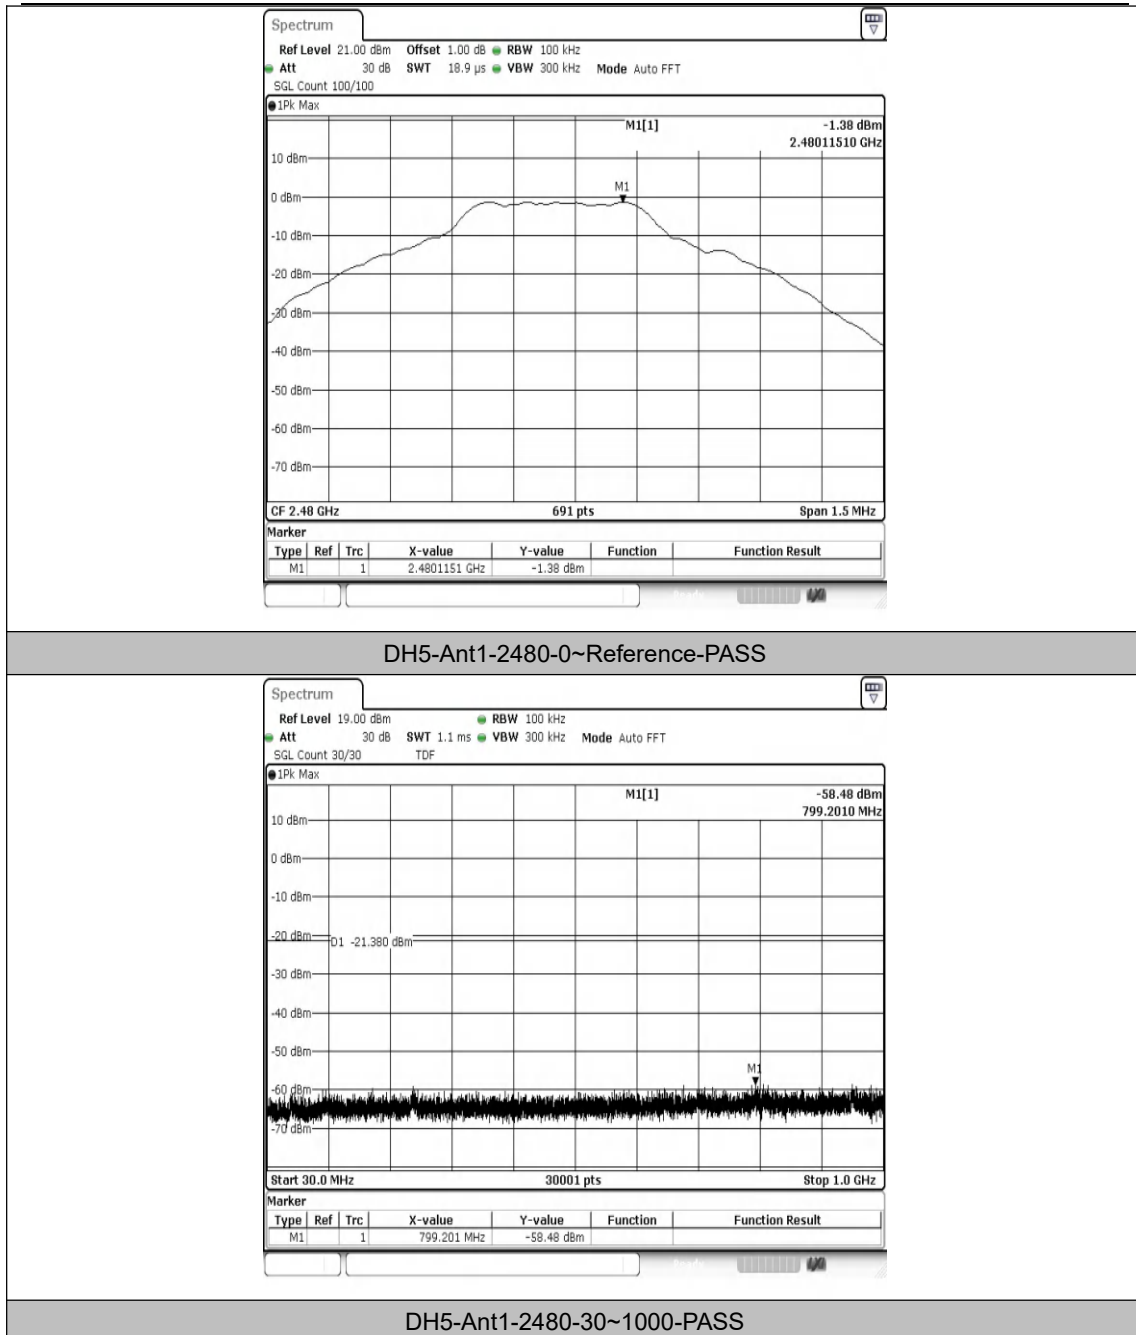

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

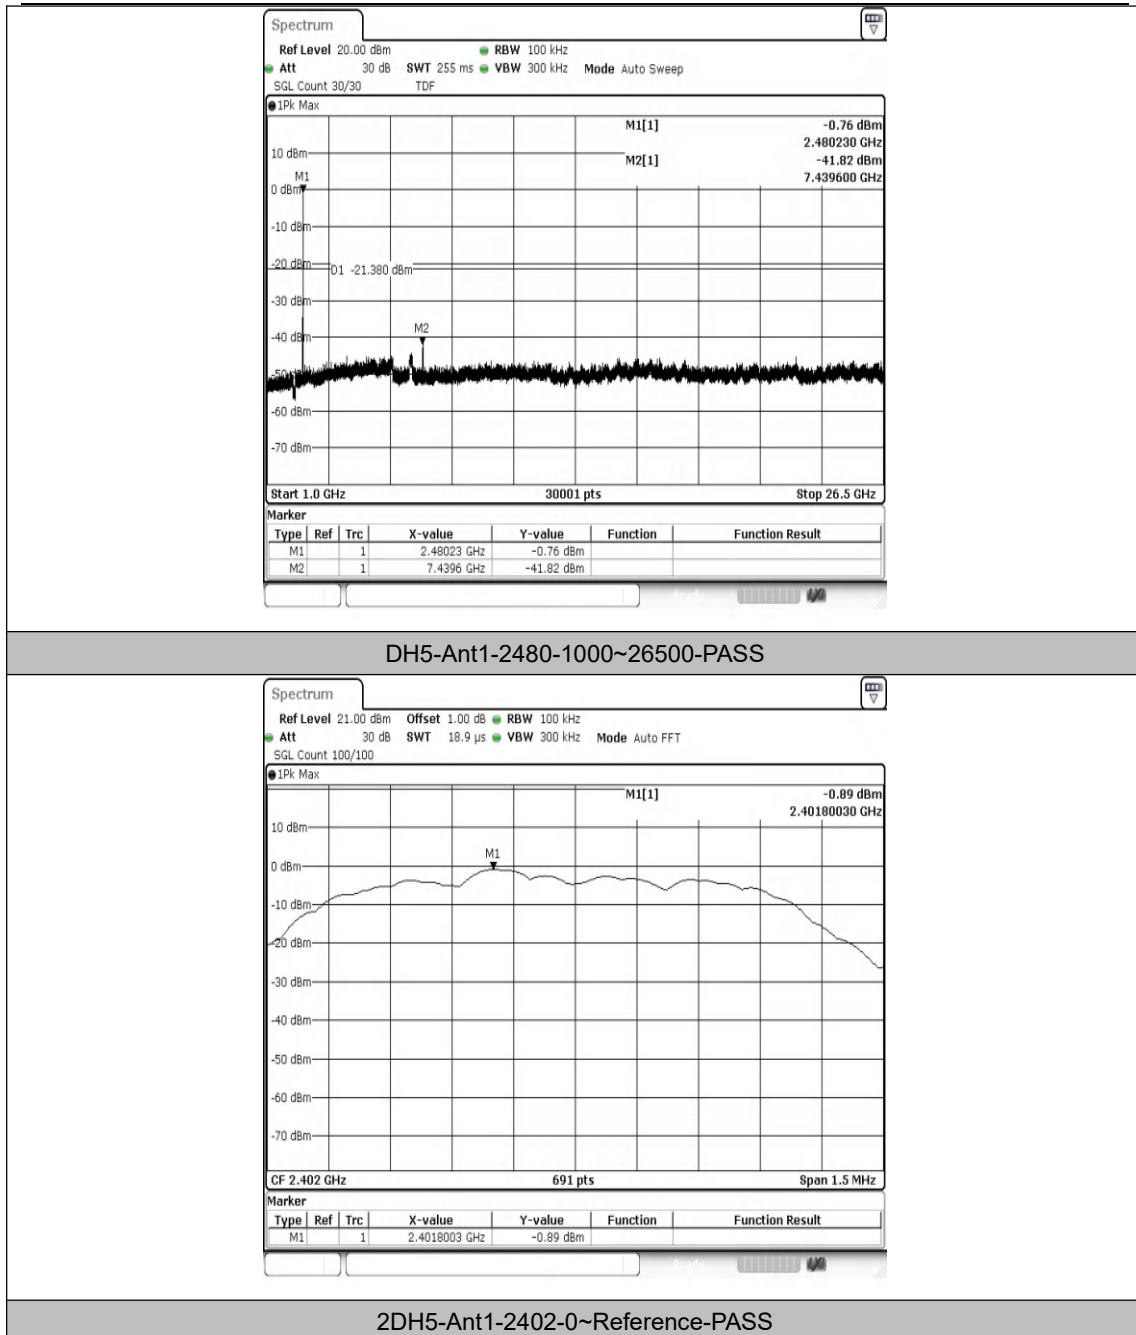

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

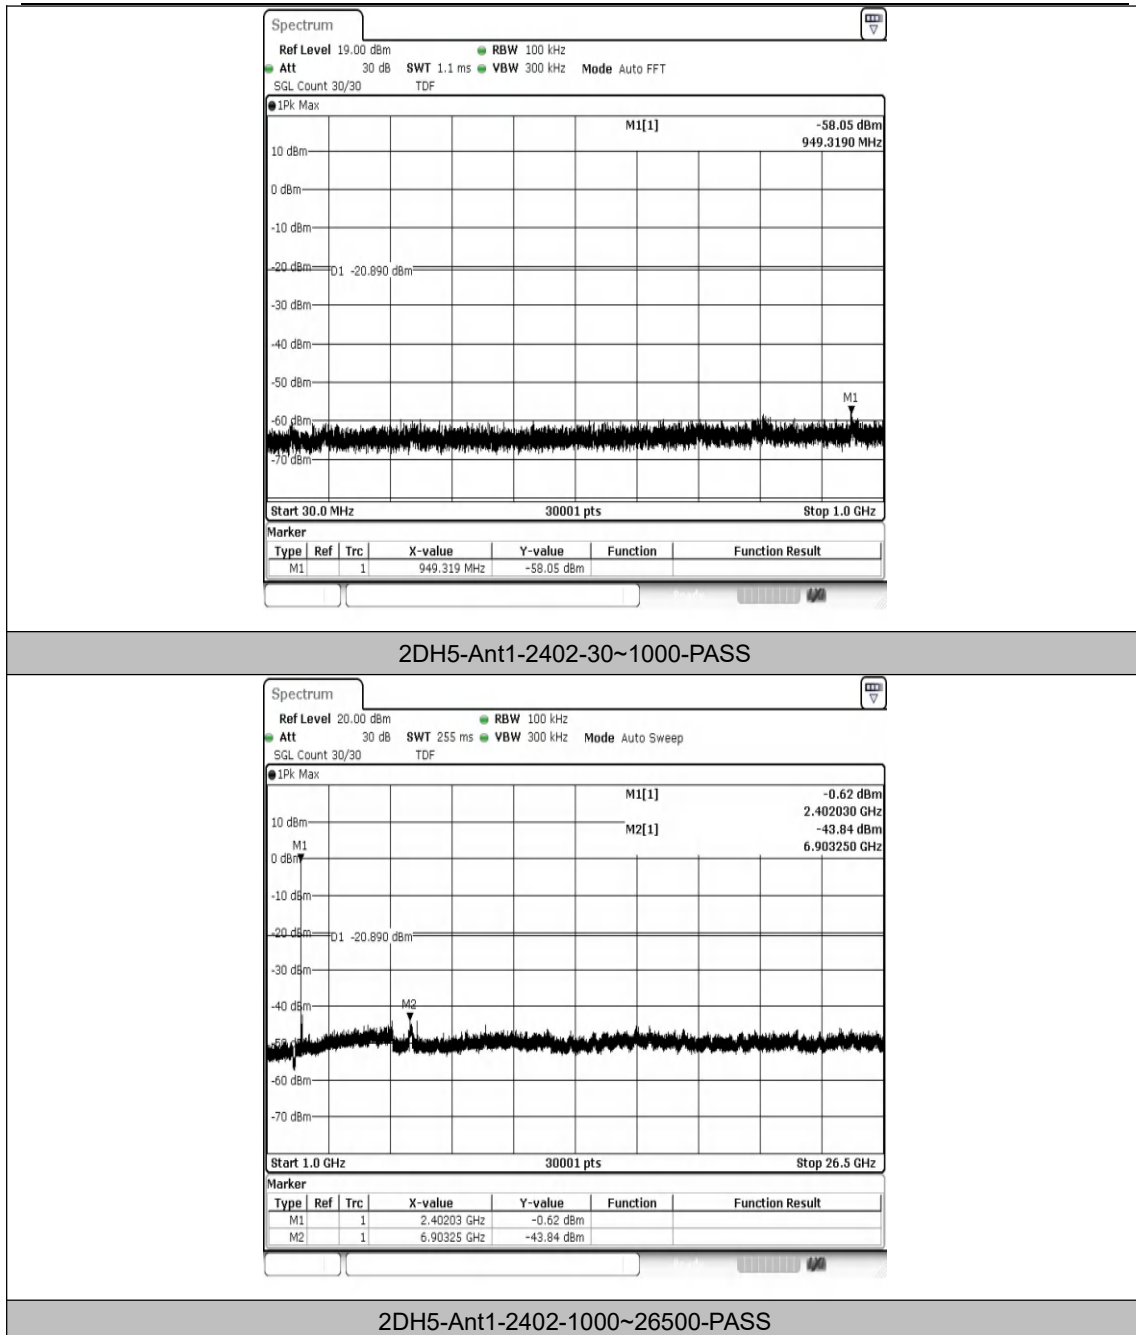


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

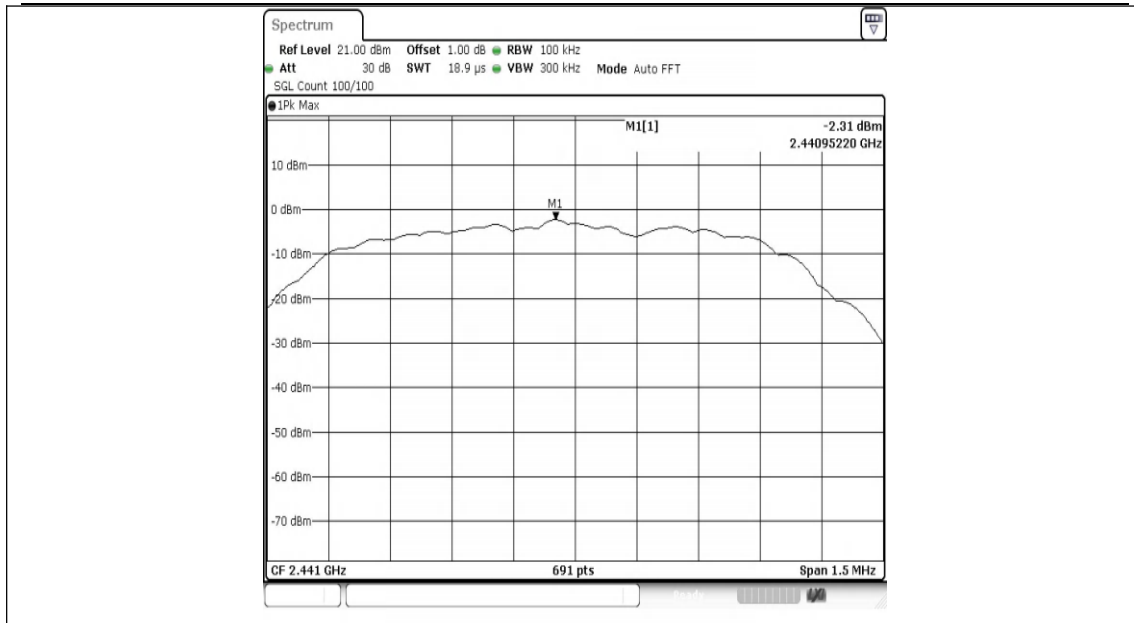

2DH5-Ant1-2441-0~Reference-PASS

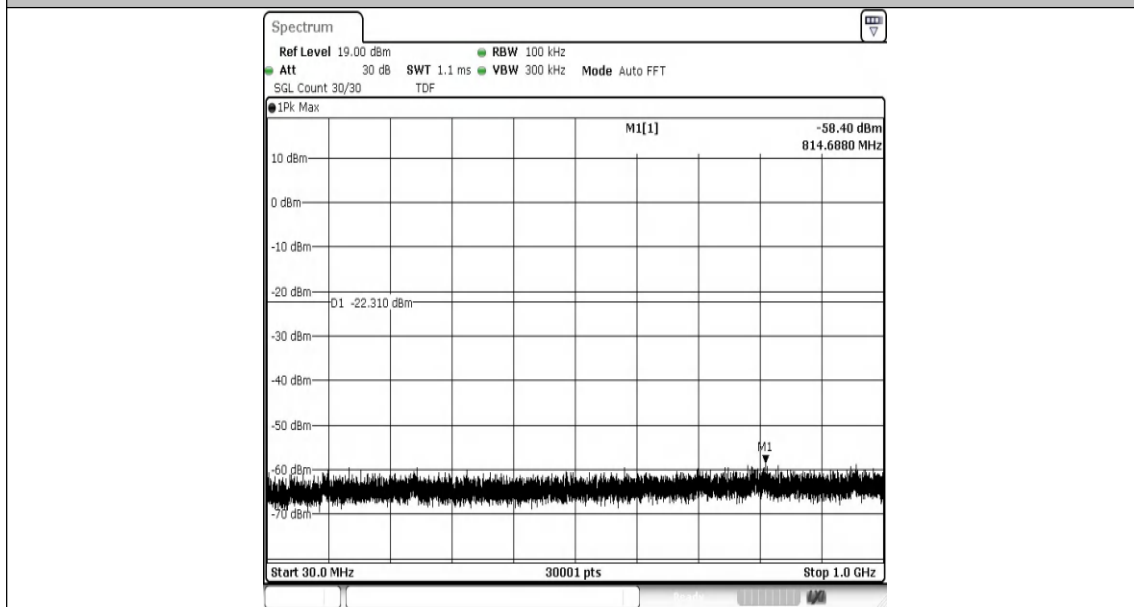


2DH5-Ant1-2441-30~1000-PASS

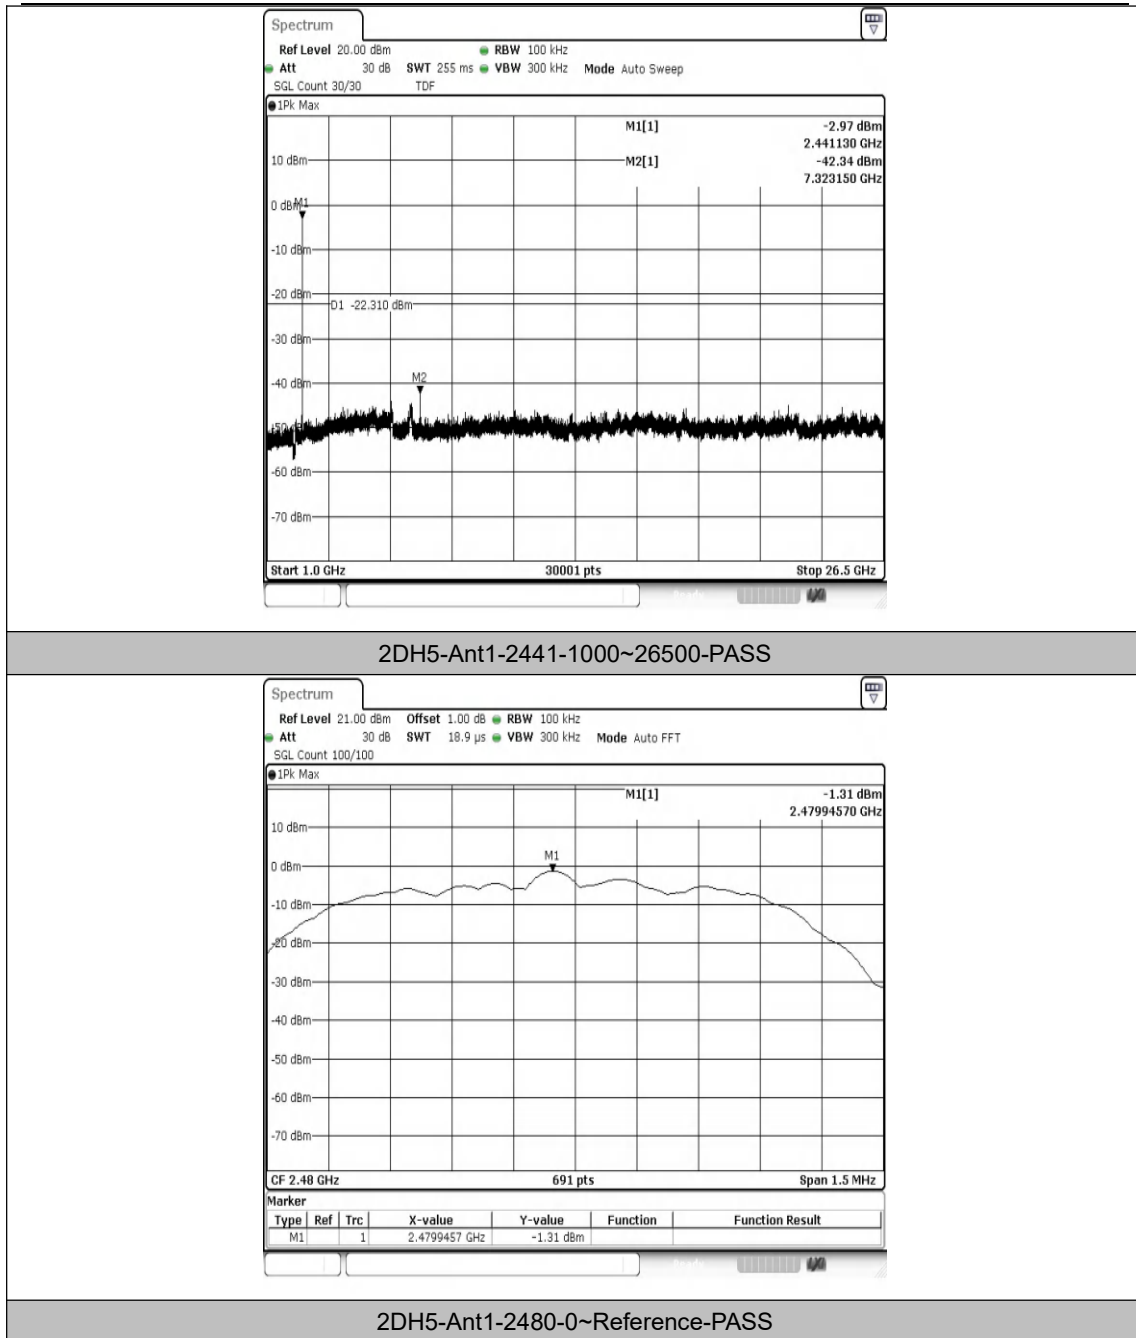

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

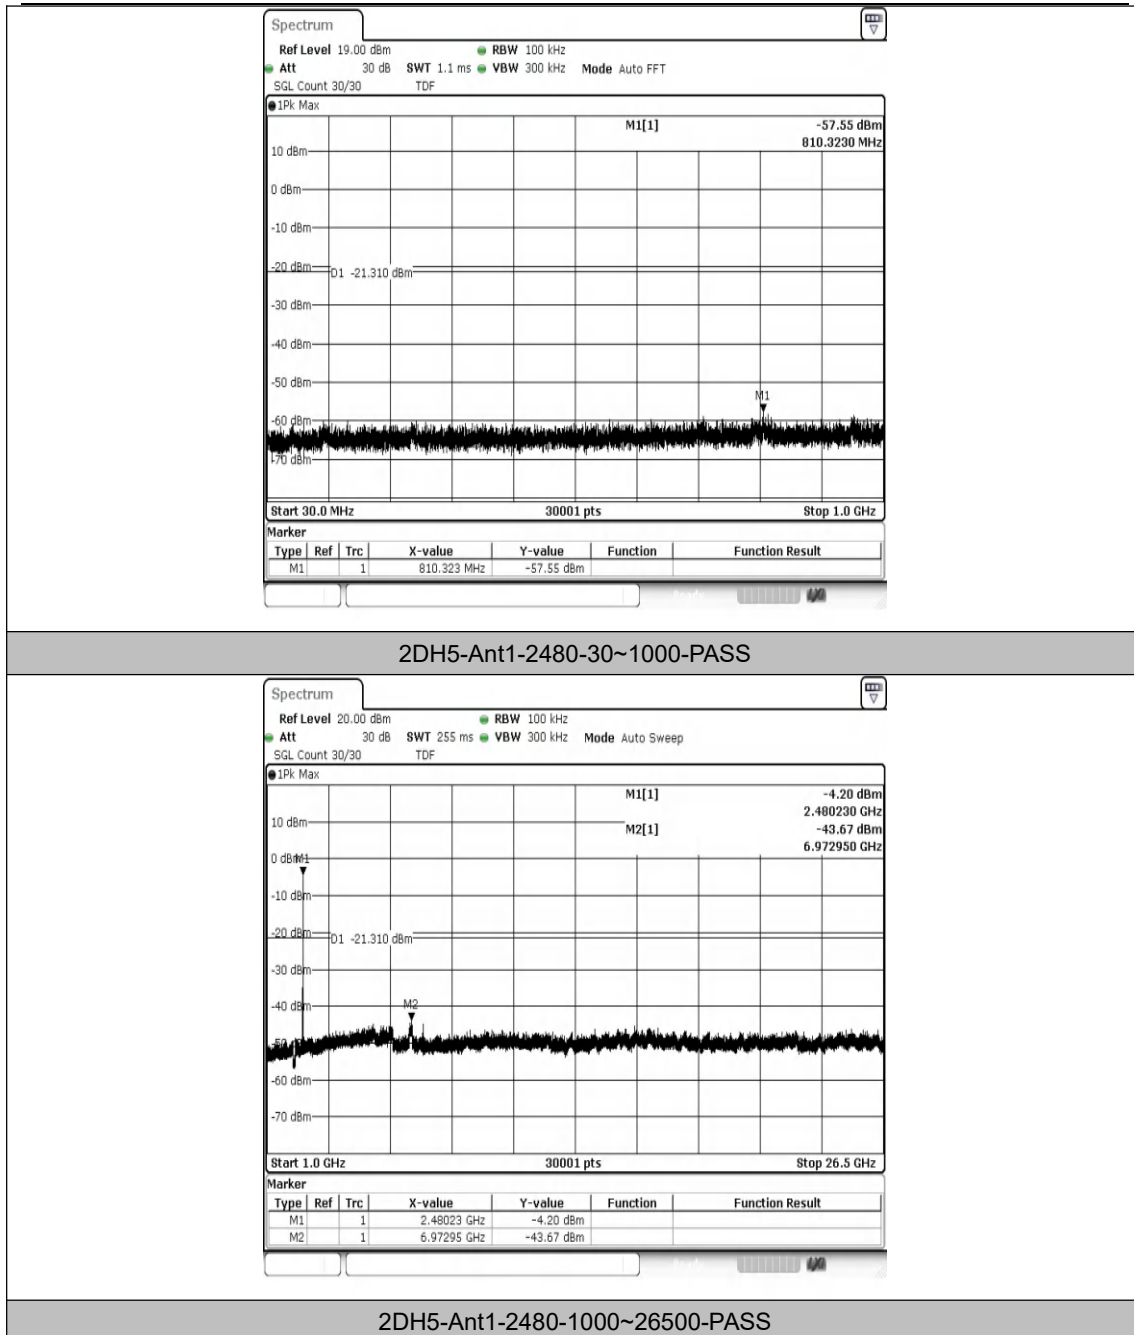


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

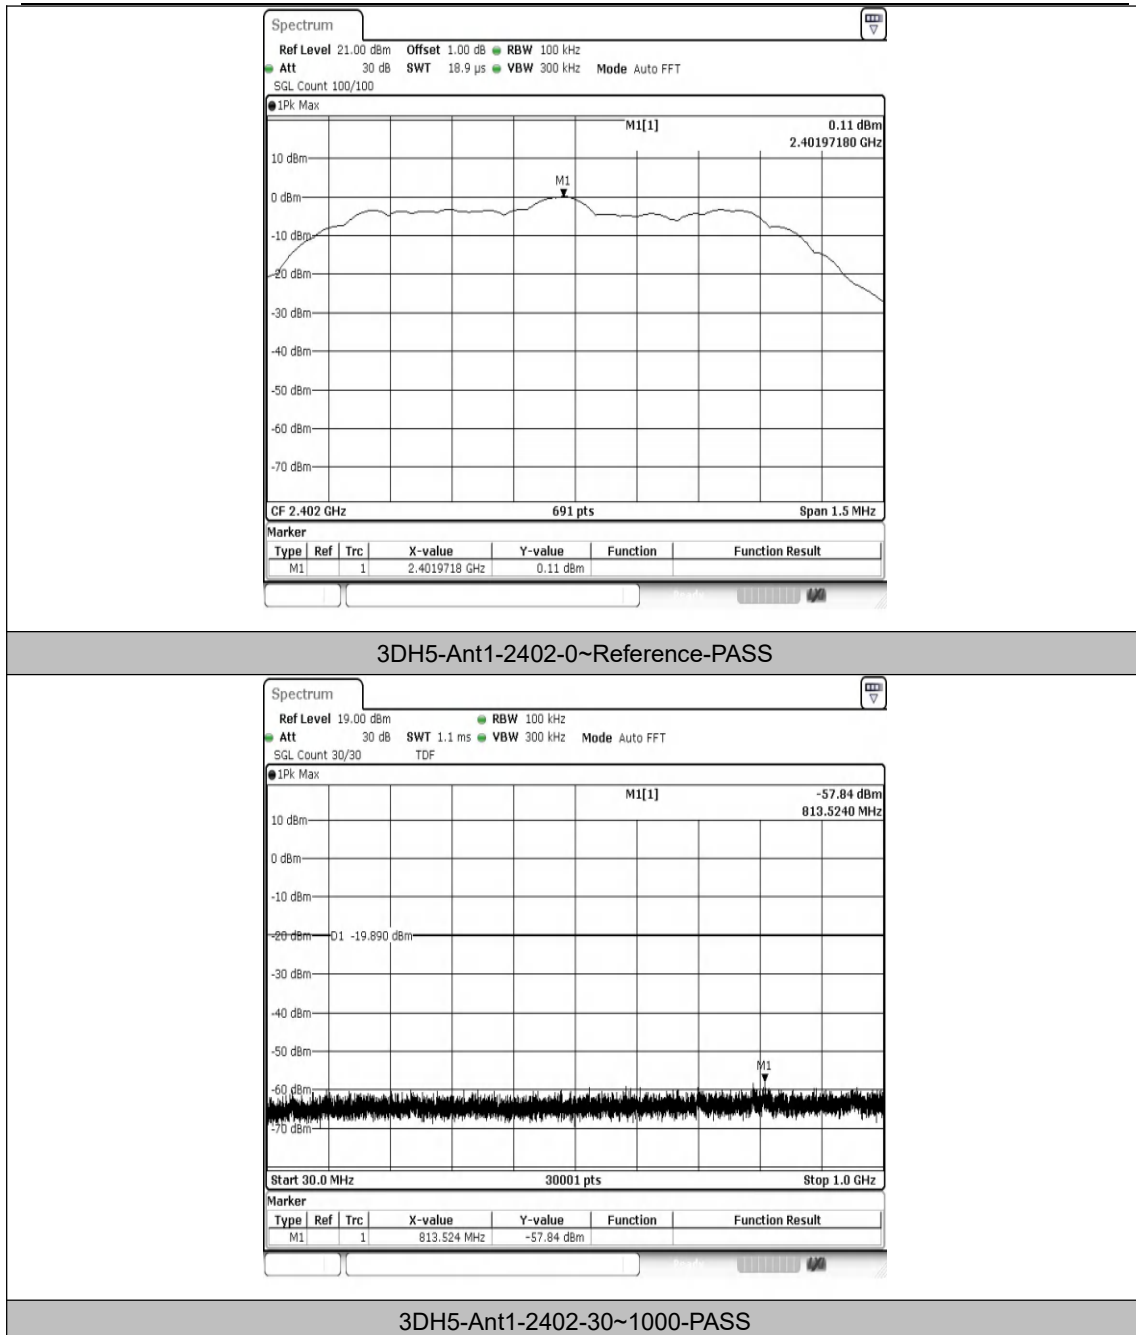


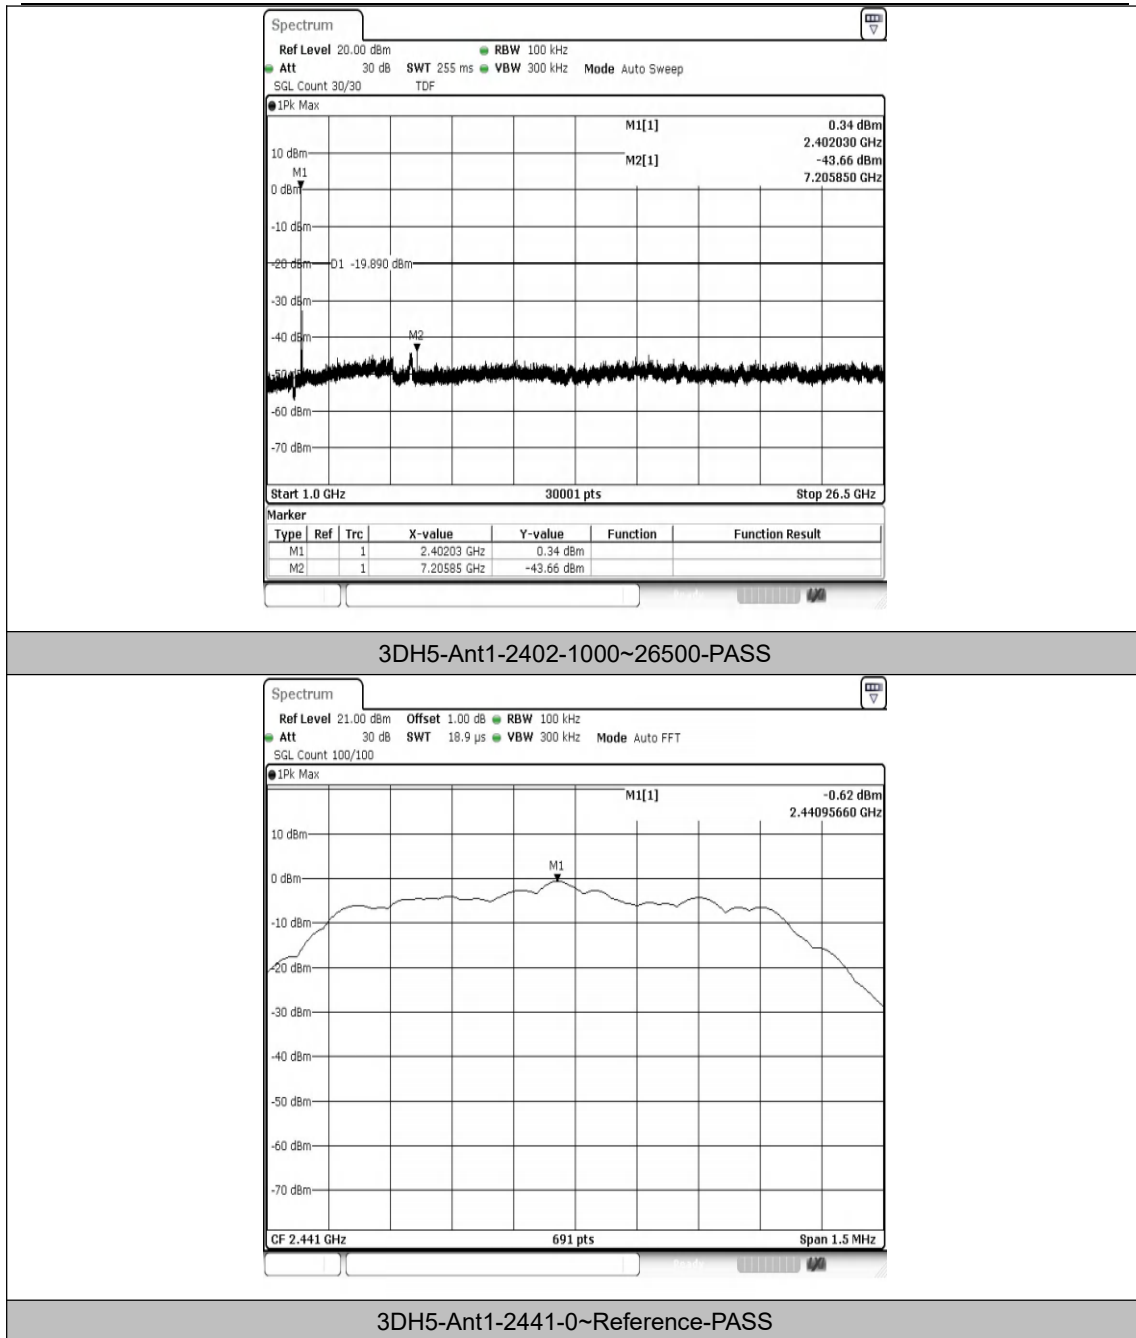

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

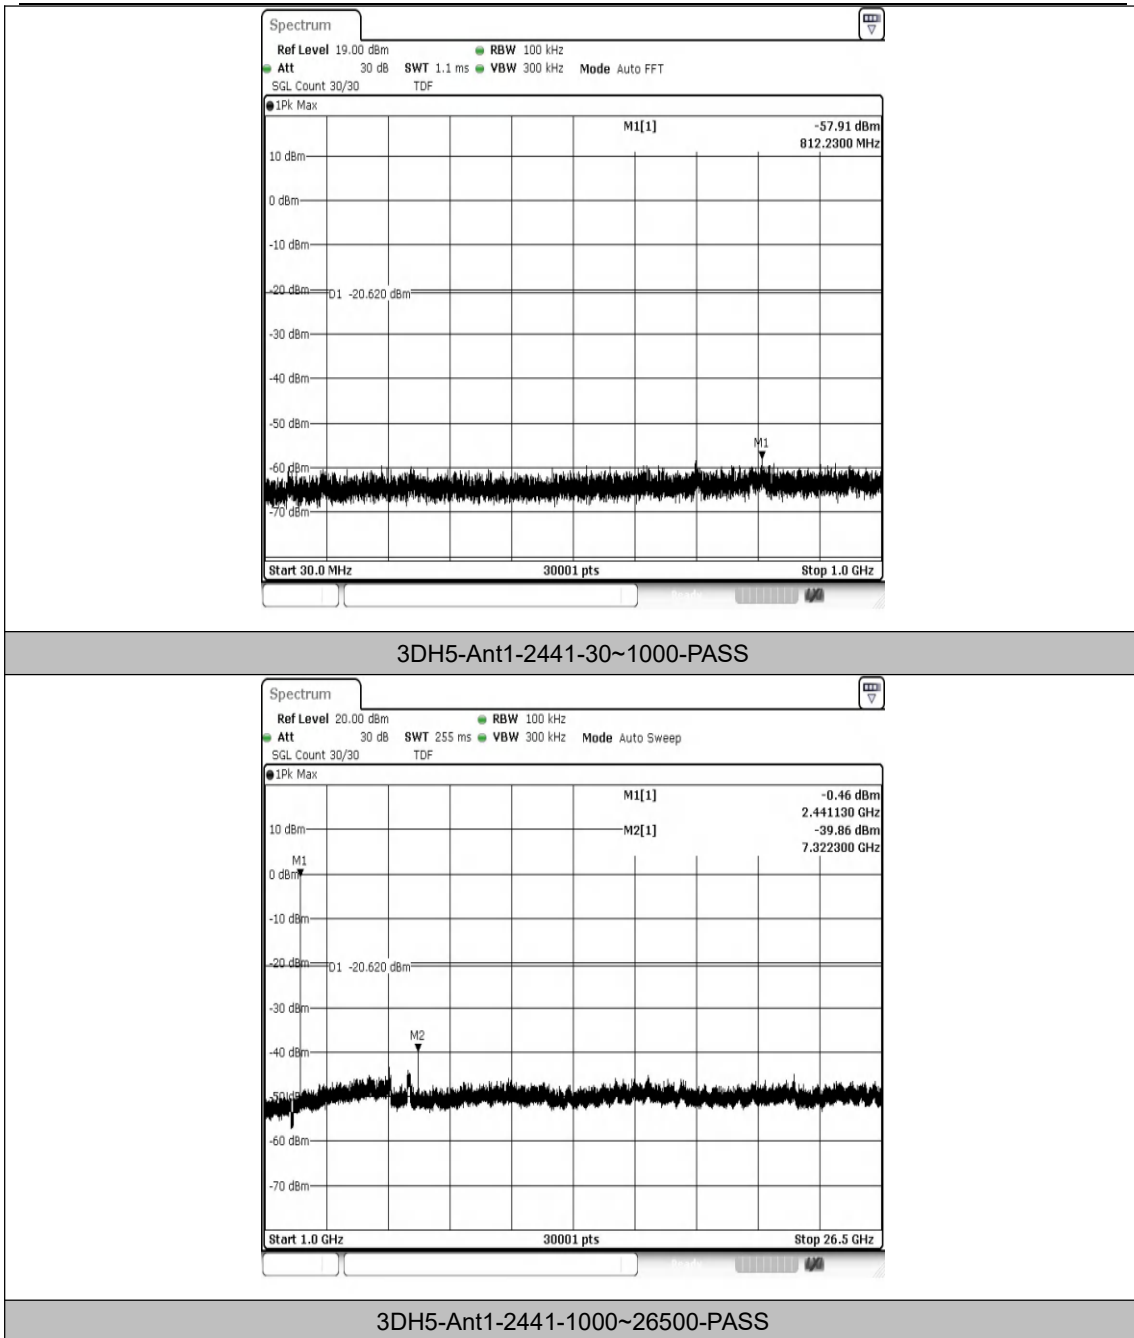

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

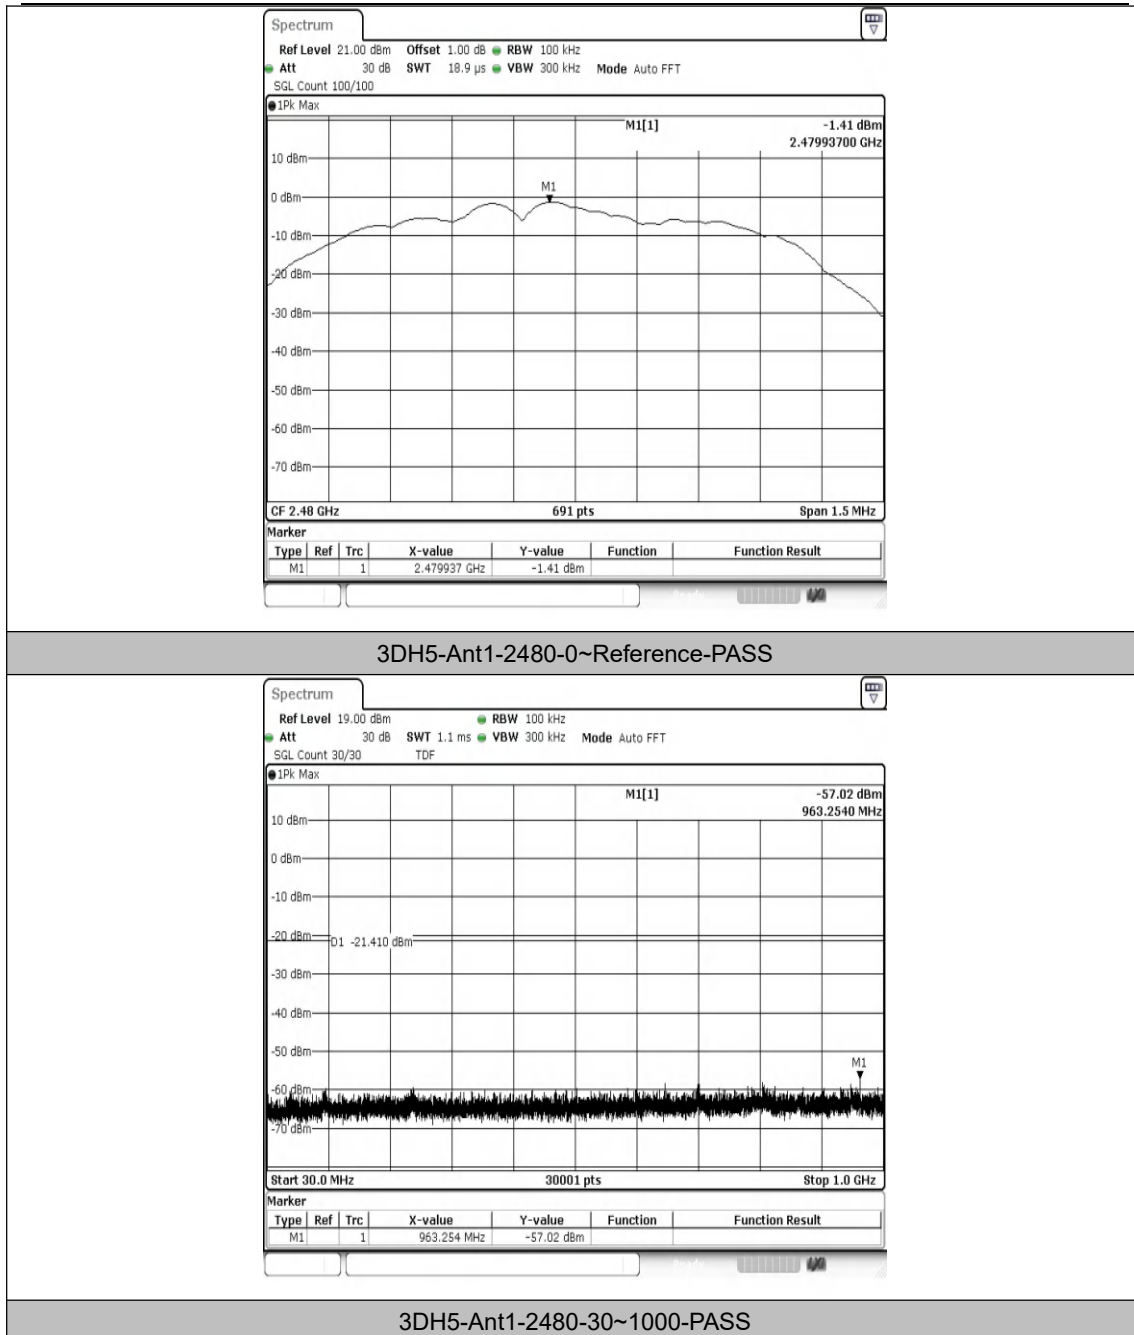

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

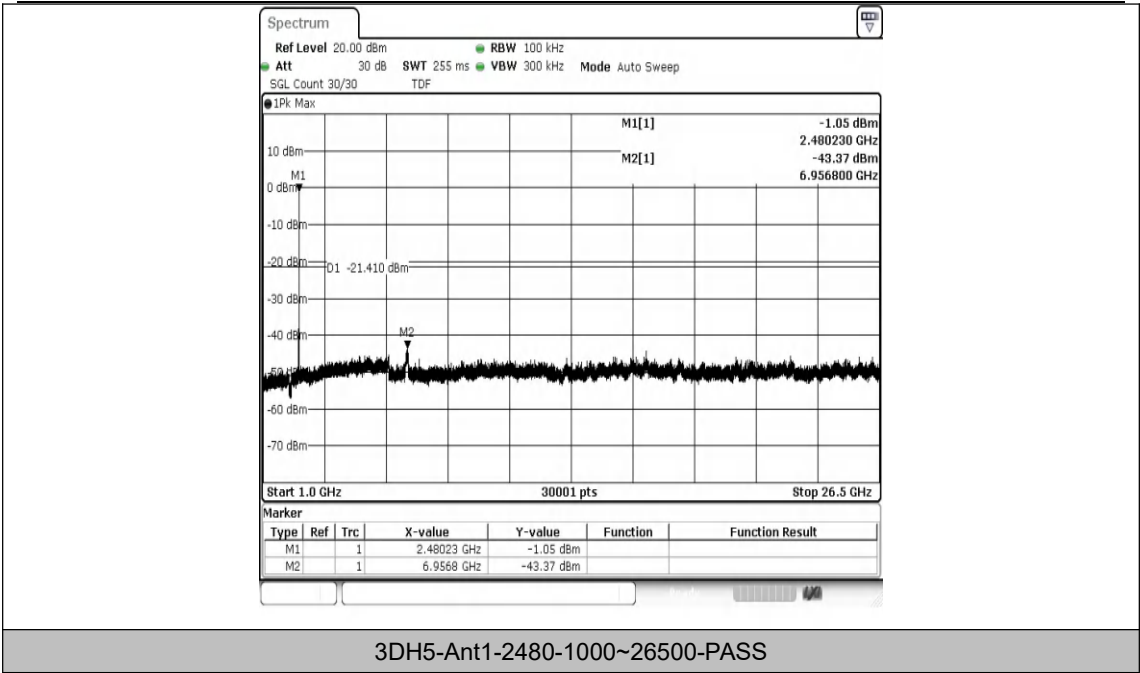

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle


Test Result


Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.91	3.75	77.60	1.10
DH5	Ant1	2441	2.91	3.75	77.60	1.10
DH5	Ant1	2480	2.91	3.75	77.60	1.10
2DH5	Ant1	2402	2.91	3.75	77.60	1.10
2DH5	Ant1	2441	2.91	3.75	77.60	1.10
2DH5	Ant1	2480	2.91	3.75	77.60	1.10
3DH5	Ant1	2402	2.91	3.75	77.60	1.10
3DH5	Ant1	2441	2.91	3.75	77.60	1.10
3DH5	Ant1	2480	2.93	3.77	77.72	1.09


Test Graphs

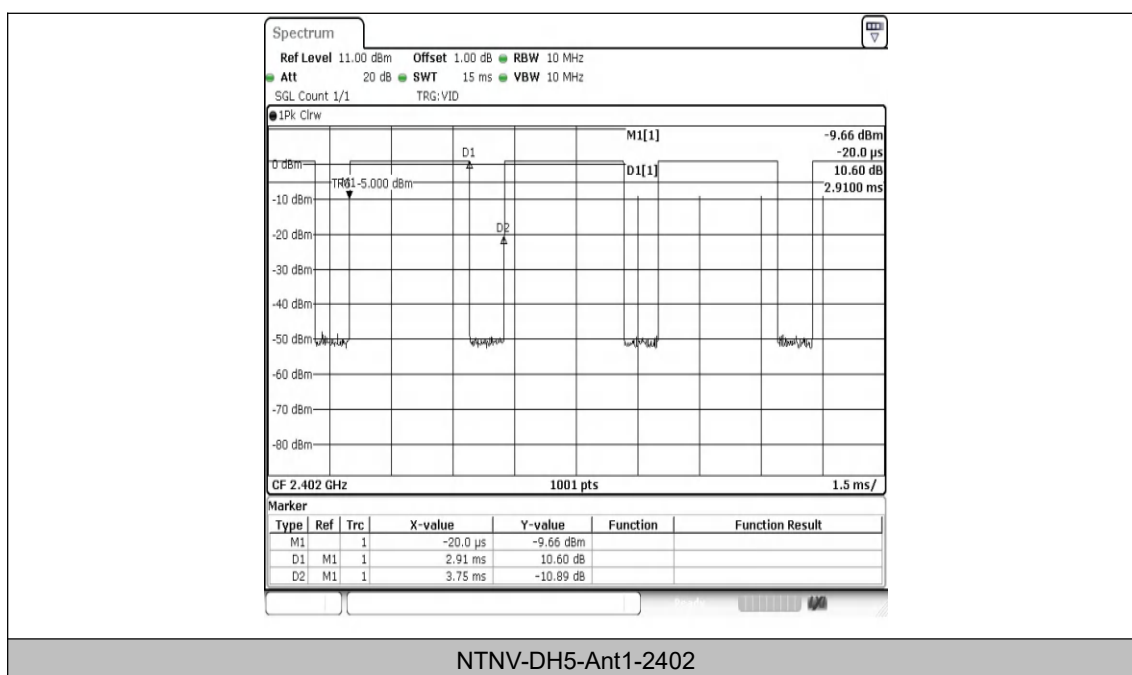

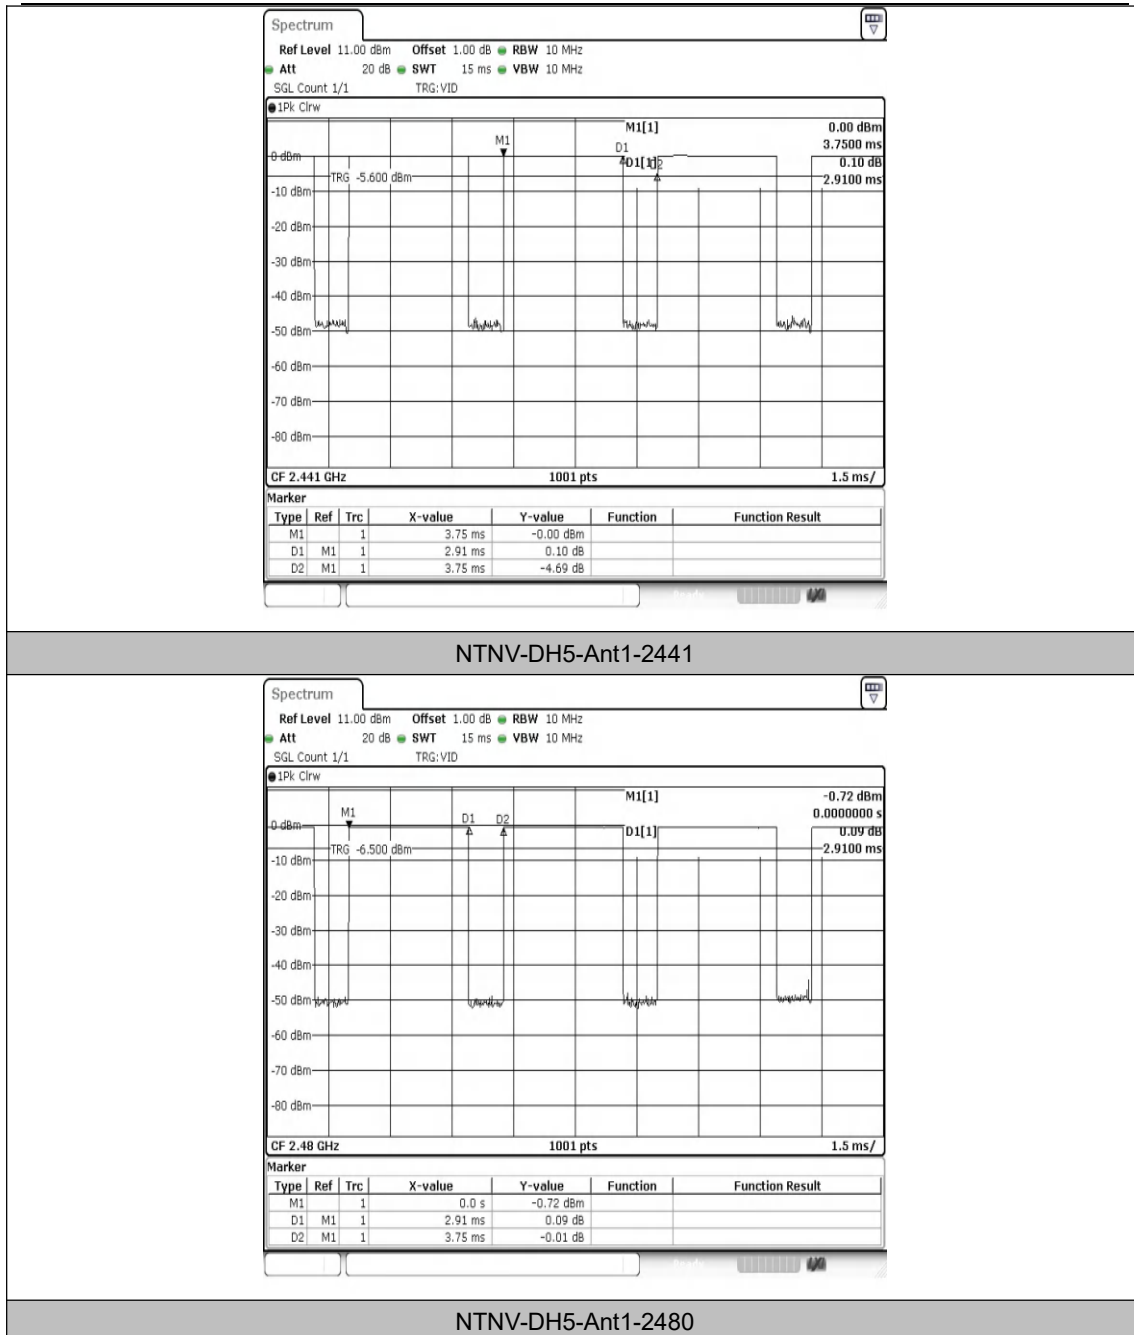

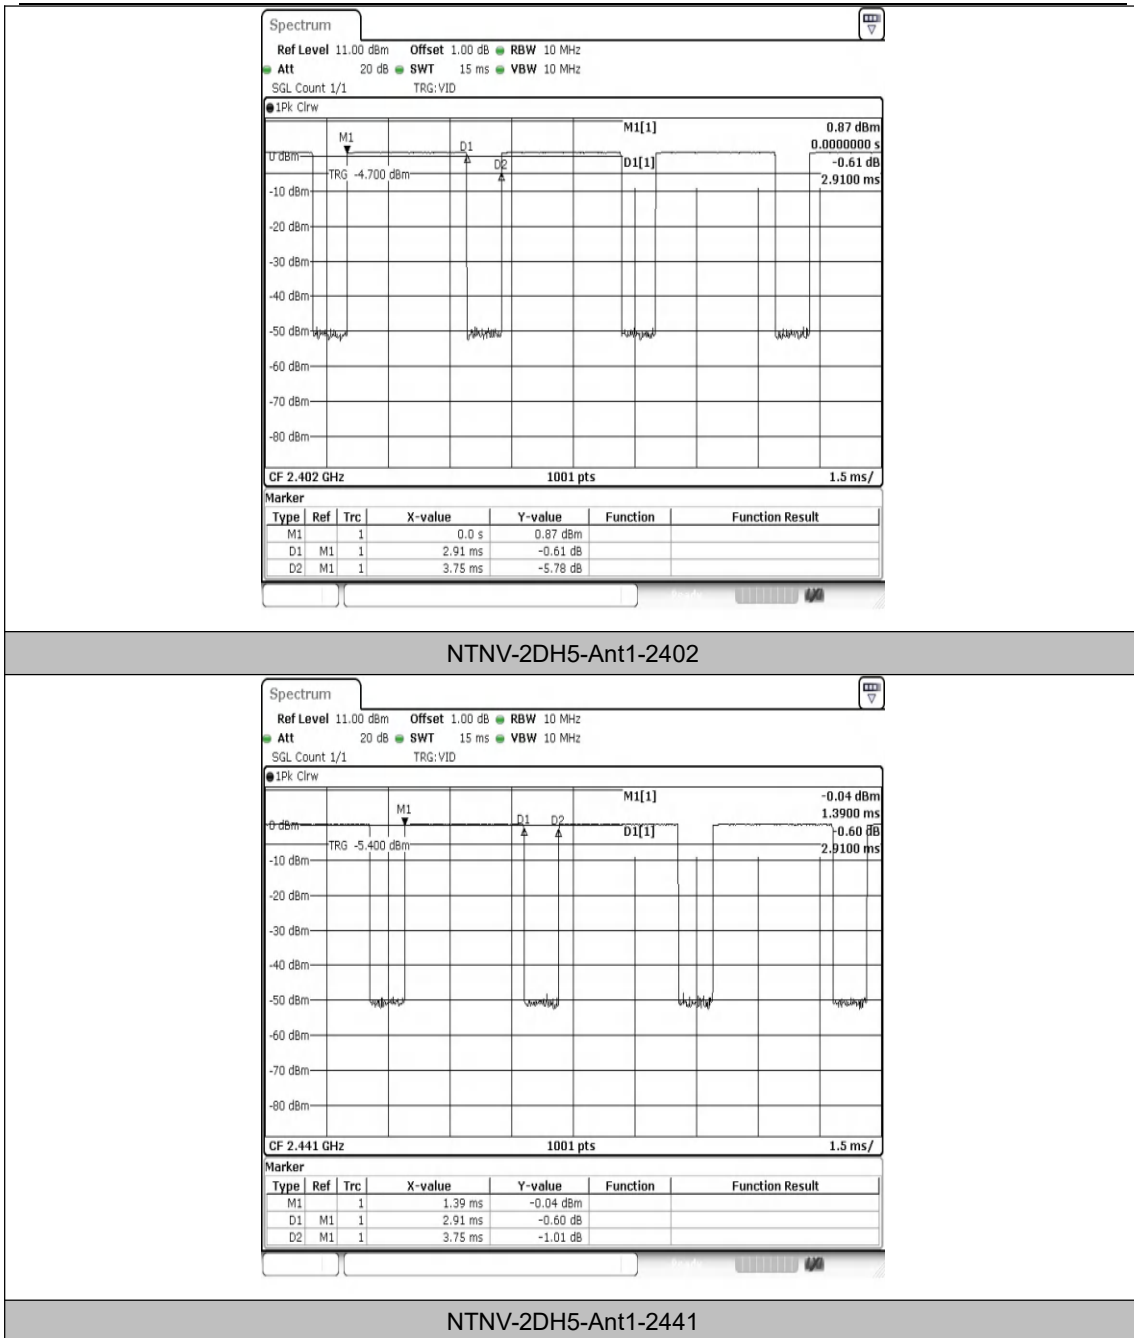

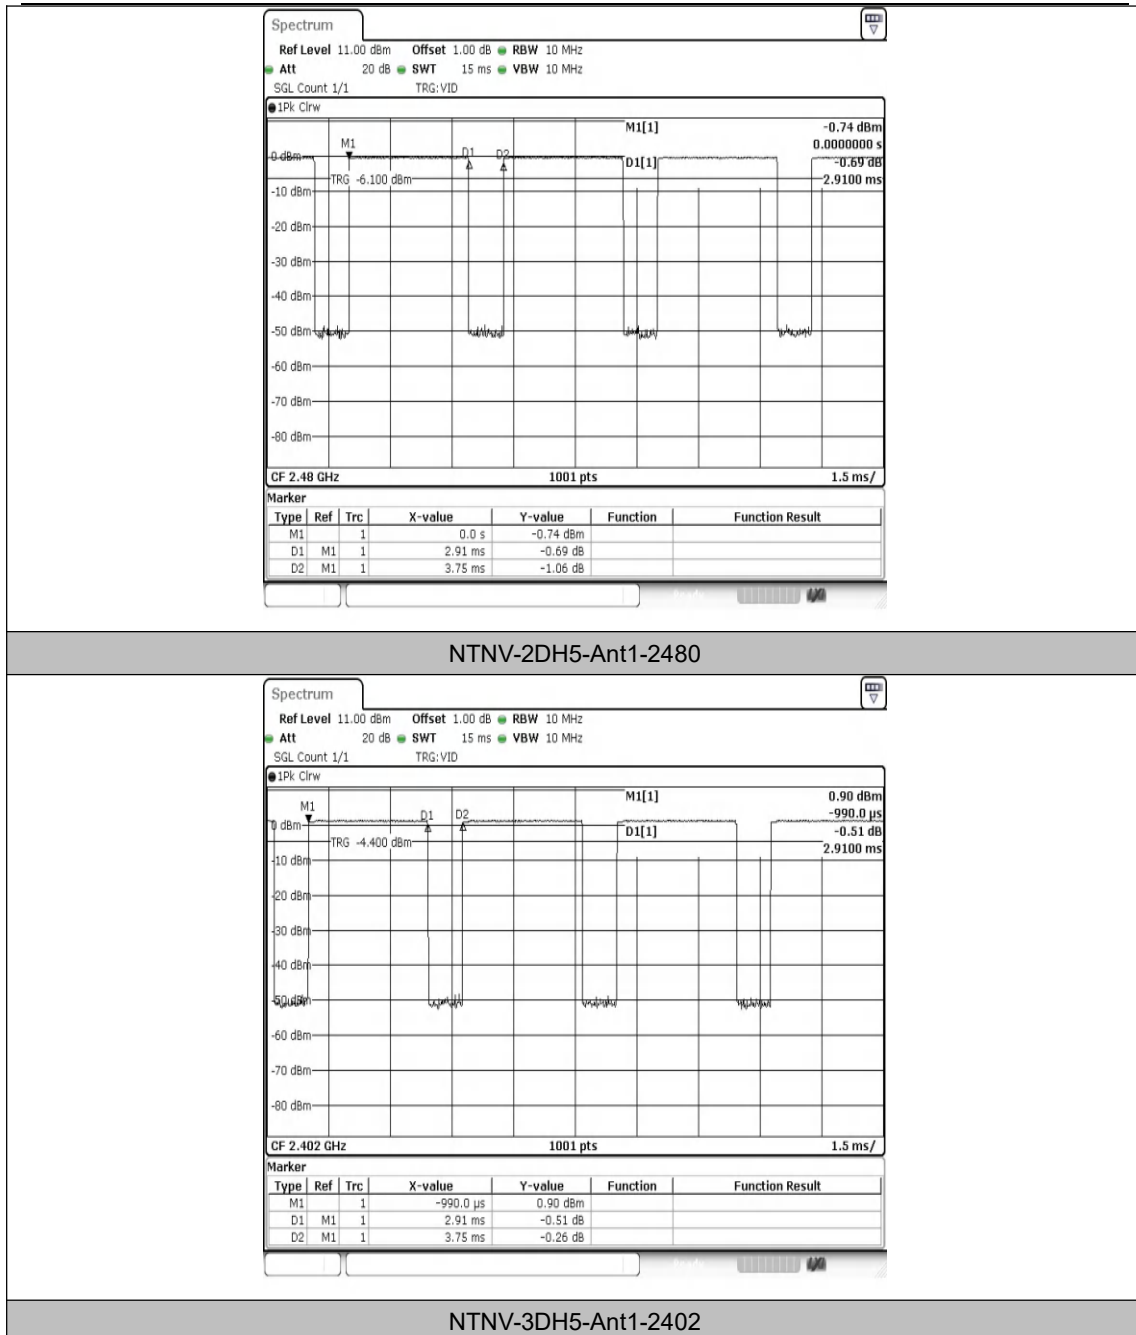

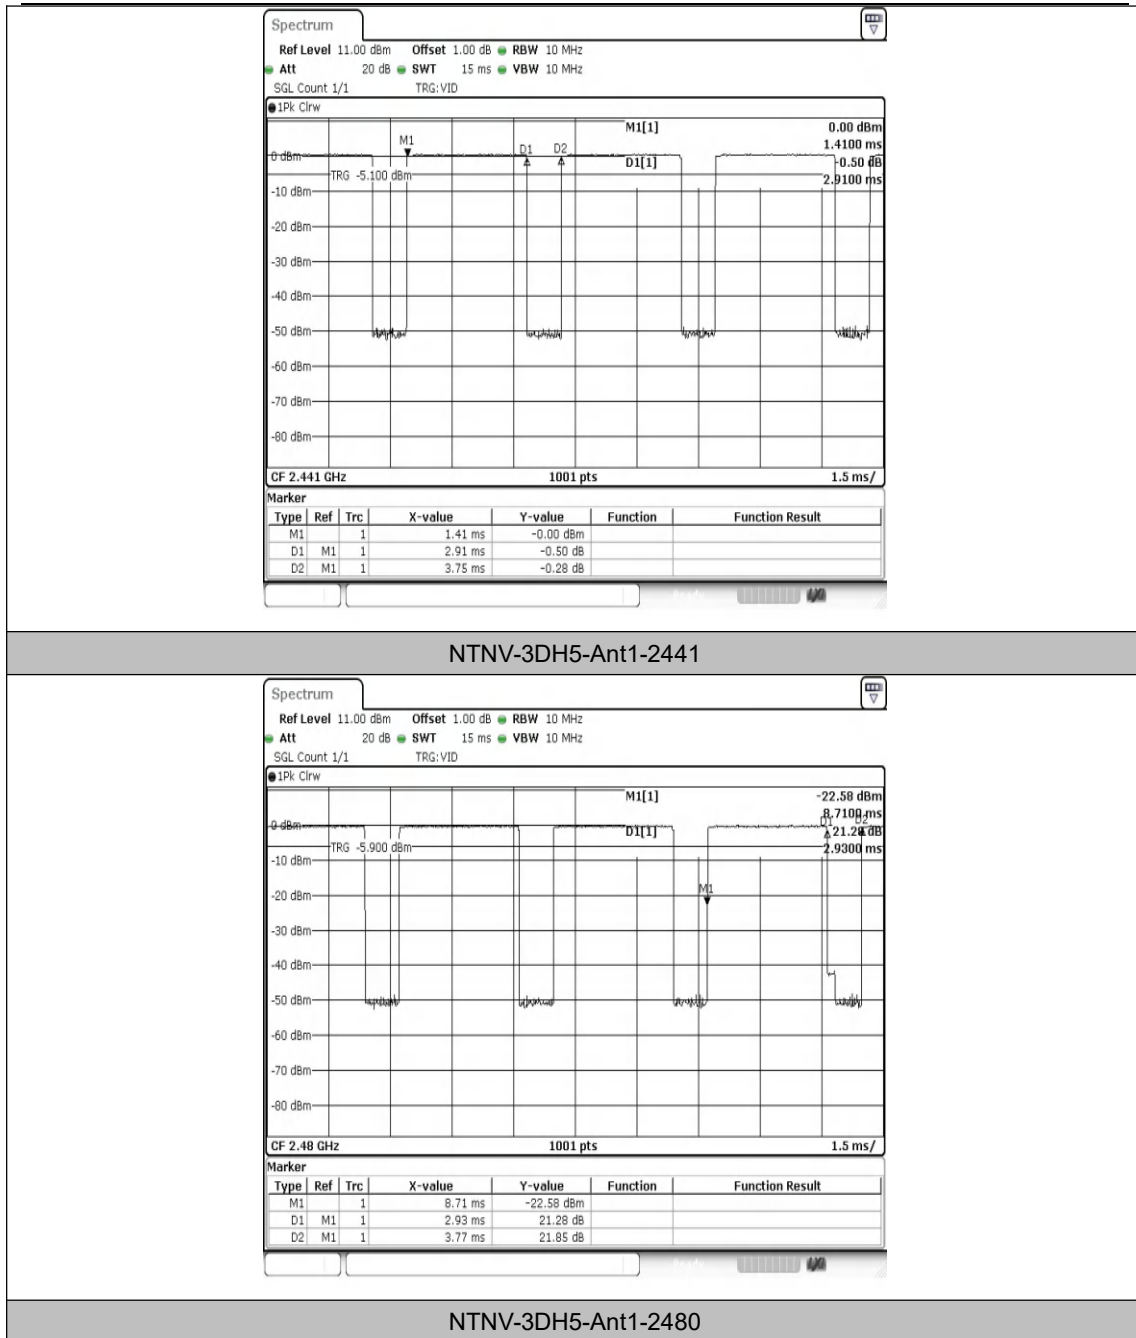

---End---