






DH5_Ant1_High_Hop_2480

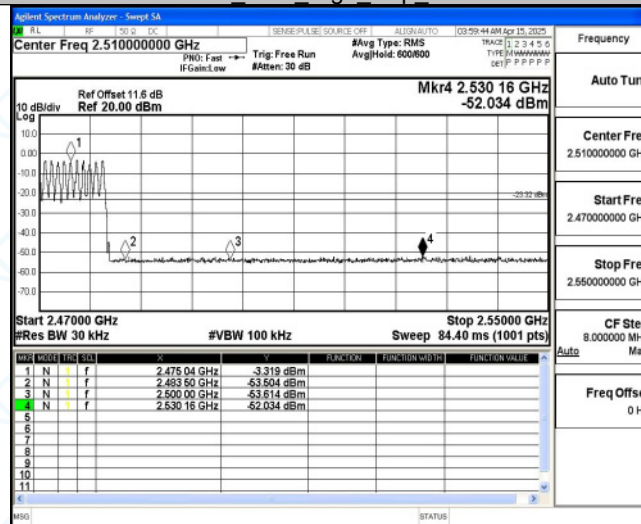

2DH5_Ant1_Low_2402

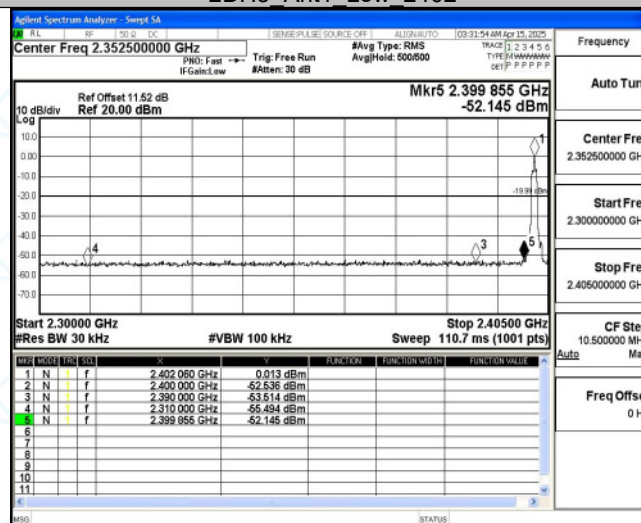


2DH5_Ant1_High_2480

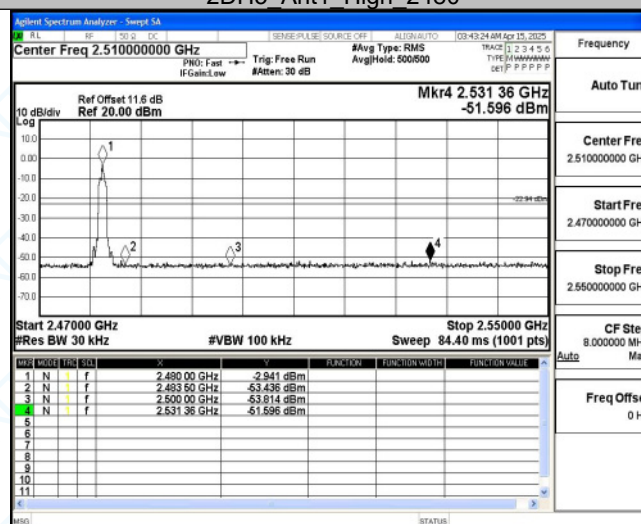





2DH5 Ant1 Low Hop 2402

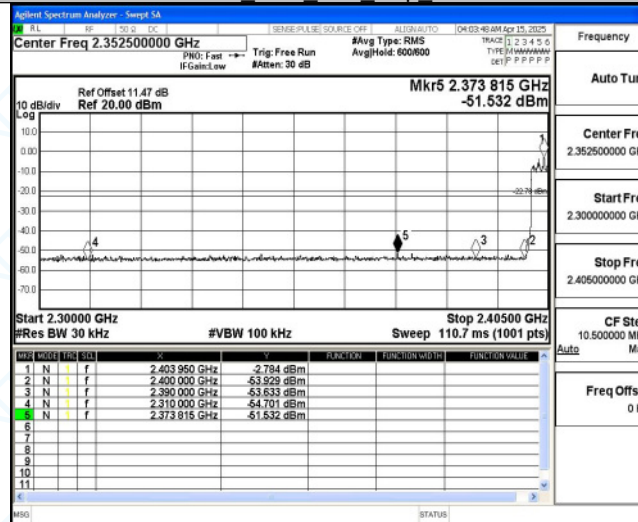

2DH5 Ant1 High Hop 2480

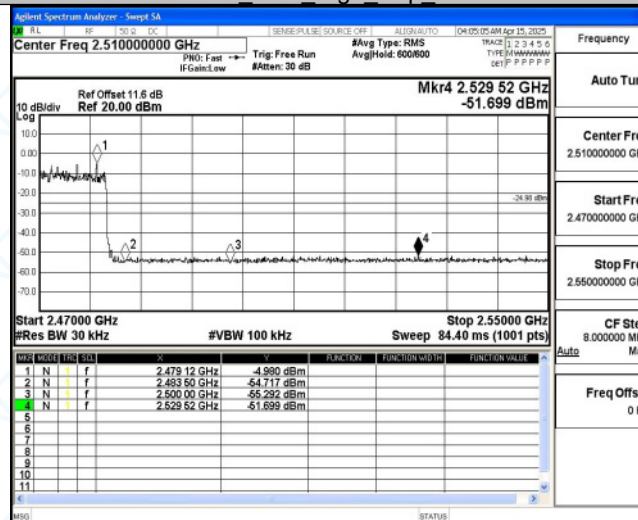


3DH5 Ant1 Low 2402

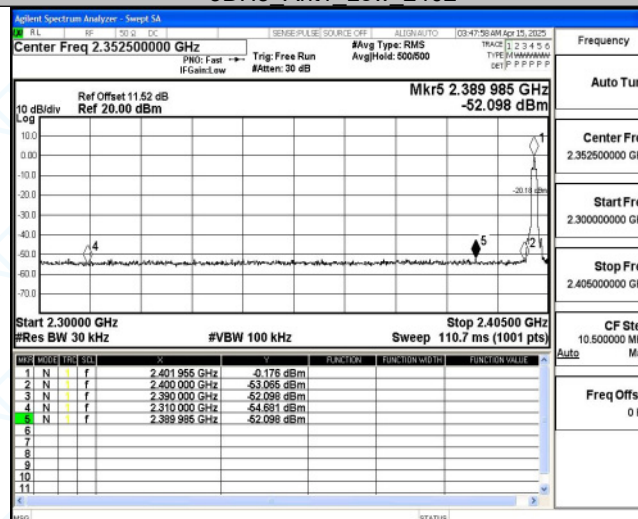





3DH5 Ant1 High 2480

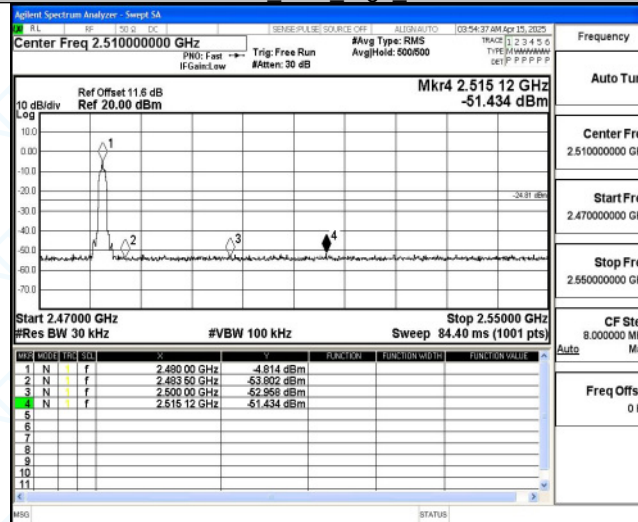

3DH5 Ant1 Low Hop 2402

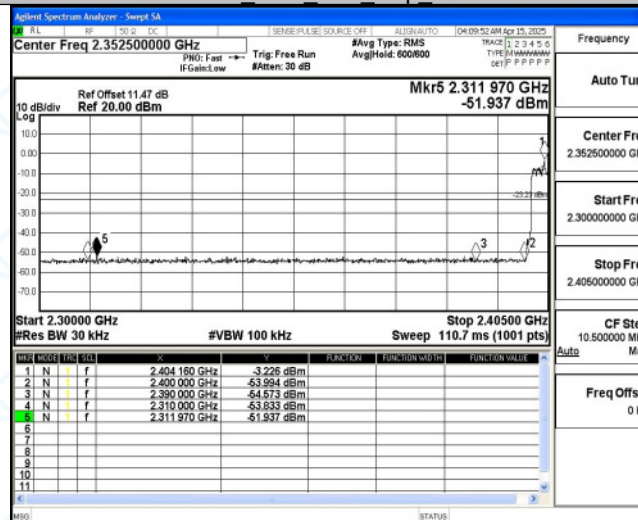

3DH5 Ant1 High Hop 2480

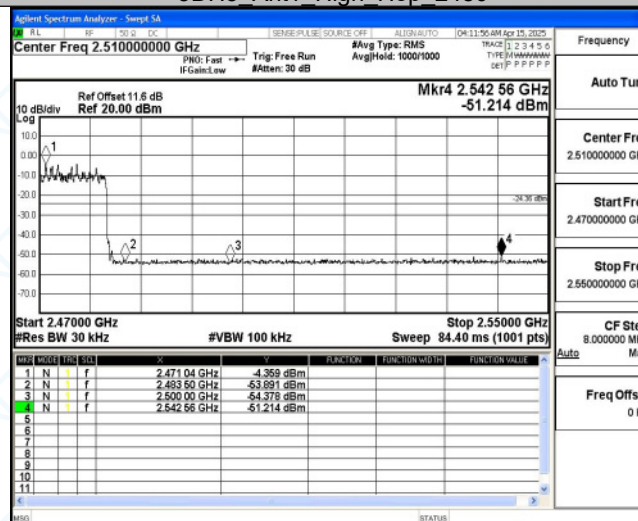



Appendix D: Dwell Time

Test Result


TestMode	Antenna	Freq(MHz)	BurstWidth [ms]	TotalHops [Num]	Result[s]	Limit[s]	Verdict
DH1	Ant1	Hop	0.405	320	0.13	≤0.4	PASS
DH3	Ant1	Hop	1.661	160	0.266	≤0.4	PASS
DH5	Ant1	Hop	2.908	106.67	0.31	≤0.4	PASS
2DH1	Ant1	Hop	0.414	320	0.132	≤0.4	PASS
2DH3	Ant1	Hop	1.667	160	0.267	≤0.4	PASS
2DH5	Ant1	Hop	2.915	106.67	0.311	≤0.4	PASS
3DH1	Ant1	Hop	0.417	320	0.133	≤0.4	PASS
3DH3	Ant1	Hop	1.667	160	0.267	≤0.4	PASS
3DH5	Ant1	Hop	2.918	106.67	0.311	≤0.4	PASS

Note:The right earphone is the worst, only the worse case was reported.




Test Graphs


DH1_Ant1_Hop

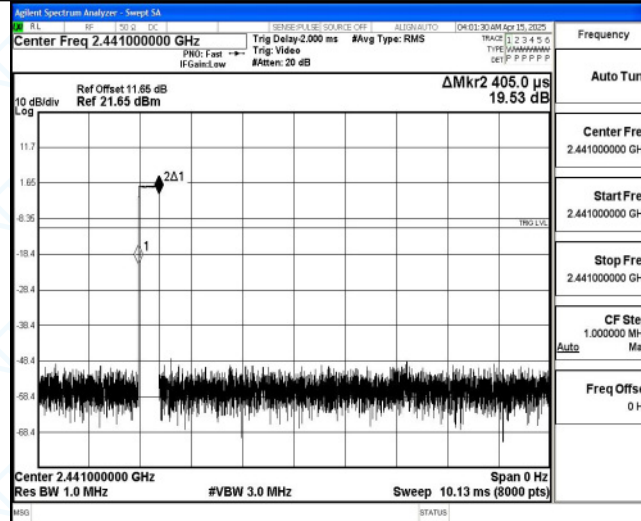

DH3_Ant1_Hop

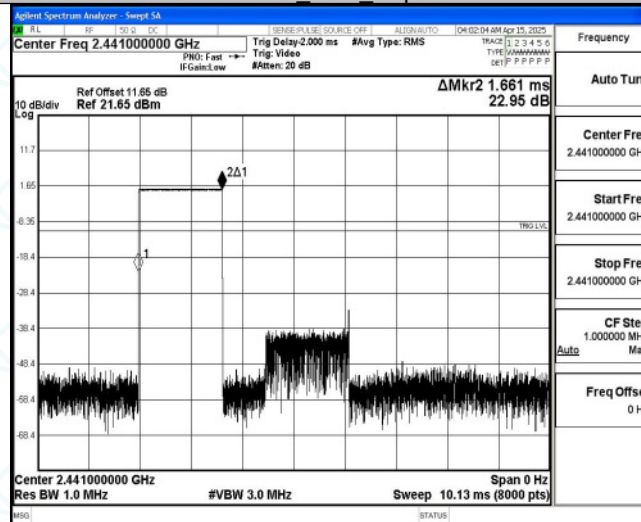


DH5_Ant1_Hop

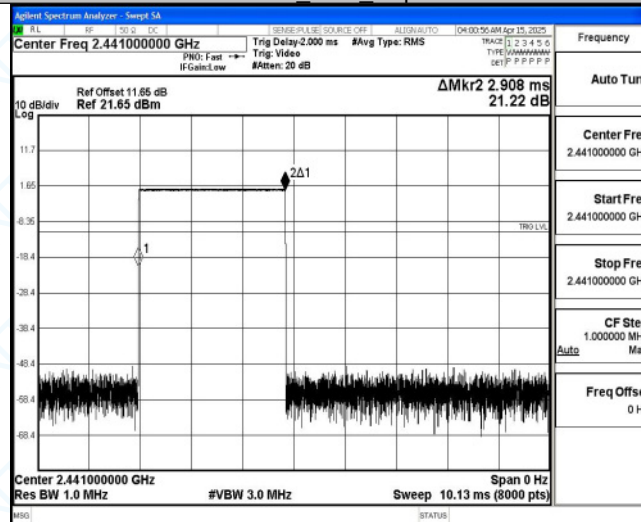





2DH1 Ant1 Hop

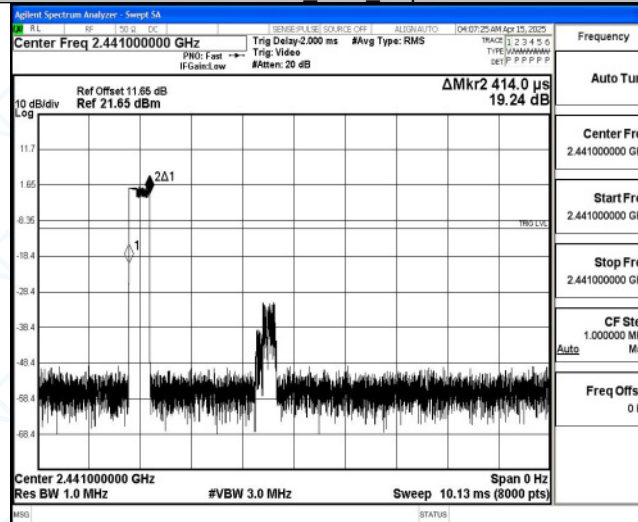

2DH3 Ant1 Hop

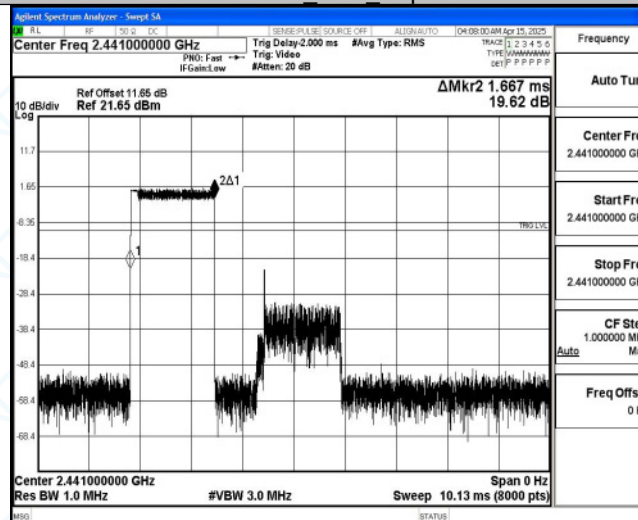


2DH5 Ant1 Hop

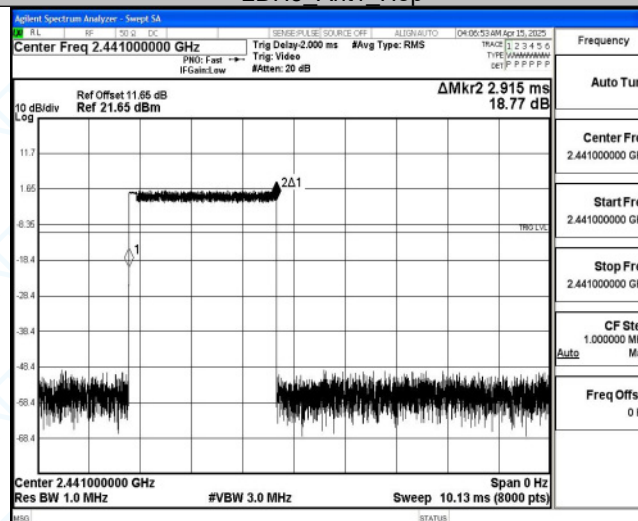





3DH1_Ant1_Hop

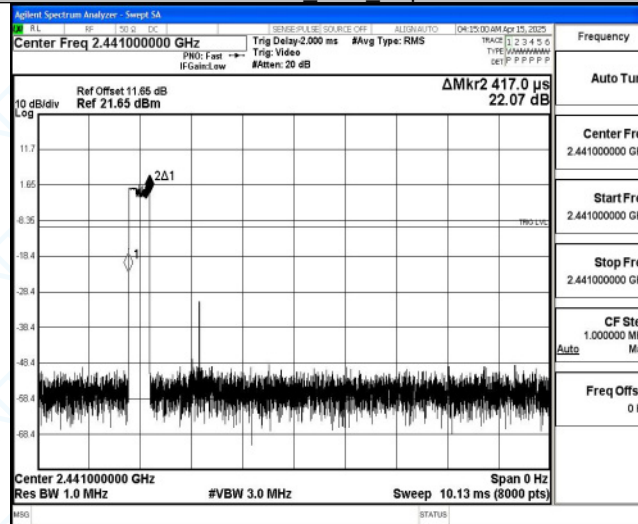

3DH3_Ant1_Hop

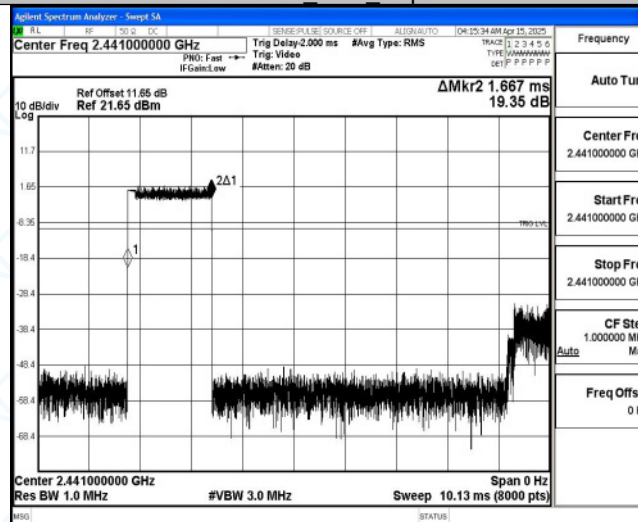

3DH5_Ant1_Hop

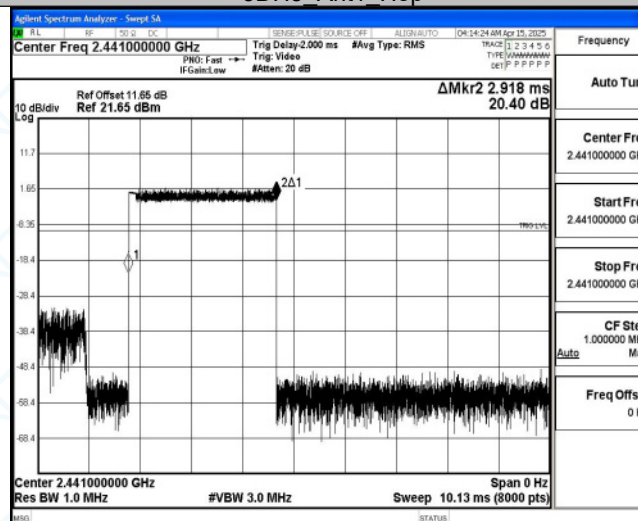



Appendix G: Conducted Spurious Emission

Test Result


TestMode	Antenna	Freq(MHz)	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	Reference	1.83	1.83	---	PASS
			30~1000	1.83	-58.28	≤ -18.17	PASS
			1000~26500	1.83	-25.25	≤ -18.17	PASS
		2441	Reference	0.71	0.71	---	PASS
			30~1000	0.71	-59.1	≤ -19.29	PASS
			1000~26500	0.71	-29.59	≤ -19.29	PASS
		2480	Reference	-1.64	-1.64	---	PASS
			30~1000	-1.64	-58.32	≤ -21.64	PASS
			1000~26500	-1.64	-31.63	≤ -21.64	PASS
2DH5	Ant1	2402	Reference	1.74	1.74	---	PASS
			30~1000	1.74	-59.09	≤ -18.26	PASS
			1000~26500	1.74	-26.88	≤ -18.26	PASS
		2441	Reference	0.53	0.53	---	PASS
			30~1000	0.53	-57.57	≤ -19.47	PASS
			1000~26500	0.53	-26.58	≤ -19.47	PASS
		2480	Reference	-1.22	-1.22	---	PASS
			30~1000	-1.22	-58.65	≤ -21.22	PASS
			1000~26500	-1.22	-30.52	≤ -21.22	PASS
3DH5	Ant1	2402	Reference	1.61	1.61	---	PASS
			30~1000	1.61	-59.02	≤ -18.39	PASS
			1000~26500	1.61	-27.97	≤ -18.39	PASS
		2441	Reference	0.62	0.62	---	PASS
			30~1000	0.62	-58.96	≤ -19.38	PASS
			1000~26500	0.62	-25.84	≤ -19.38	PASS
		2480	Reference	-1.24	-1.24	---	PASS
			30~1000	-1.24	-59.23	≤ -21.24	PASS
			1000~26500	-1.24	-29.25	≤ -21.24	PASS

Note: The right earphone is the worst, only the worse case was reported.




Test Graphs


DH5_Ant1_2402_0~Reference

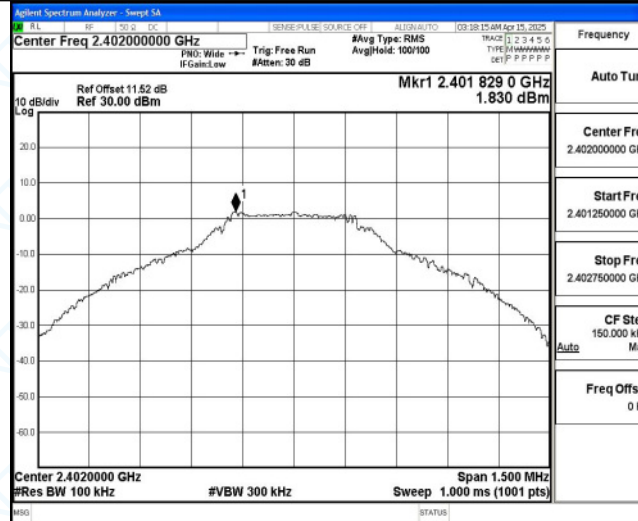

DH5_Ant1_2402_30~1000

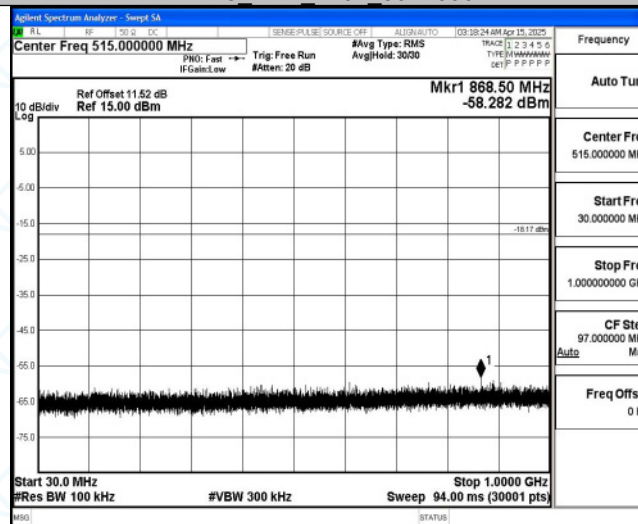


DH5_Ant1_2402_1000~26500

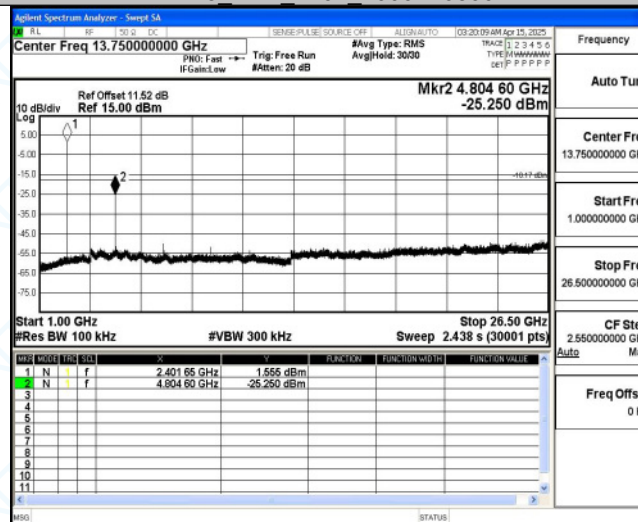





DH5_Ant1_2441_0~Reference

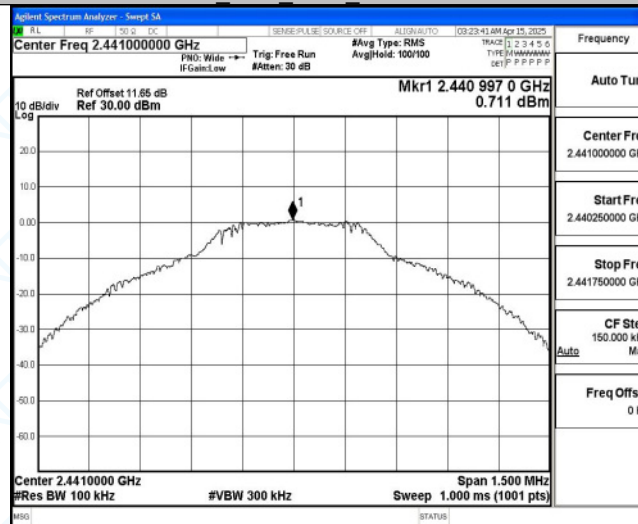

DH5_Ant1_2441_30~1000

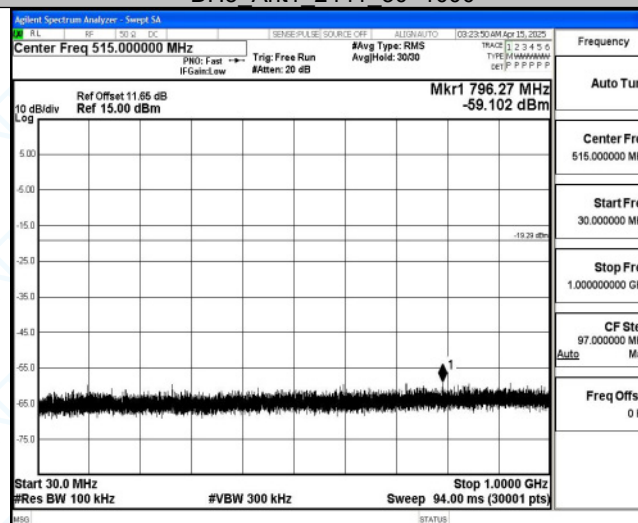


DH5_Ant1_2441_1000~26500

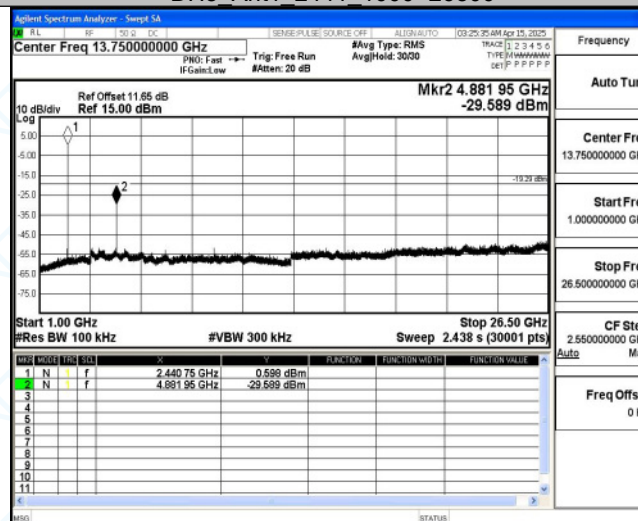





DH5_Ant1_2480_0~Reference

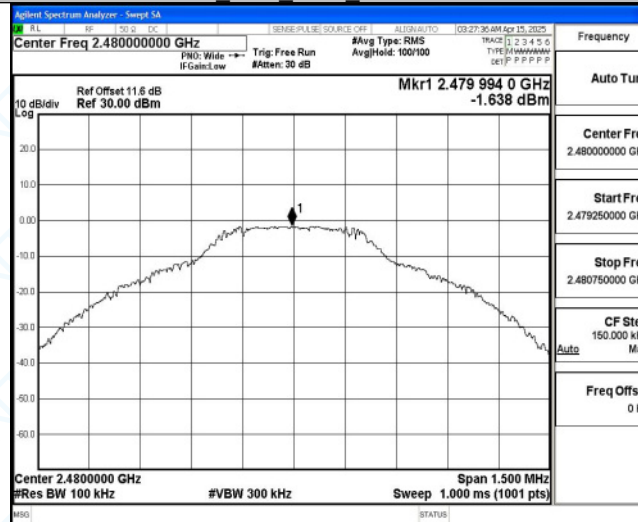

DH5_Ant1_2480_30~1000

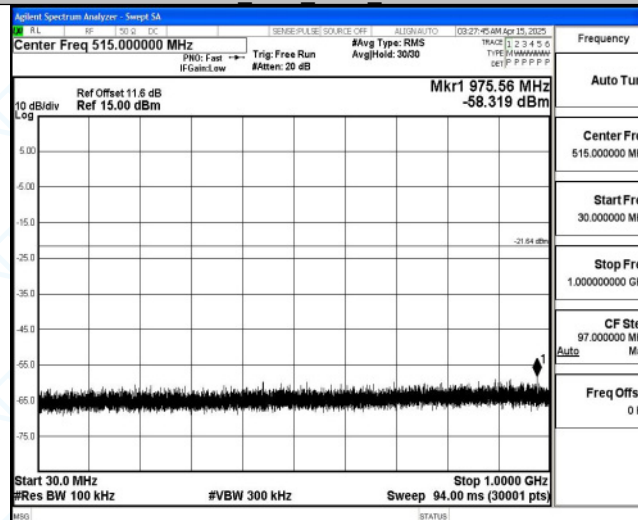


DH5_Ant1_2480_1000~26500

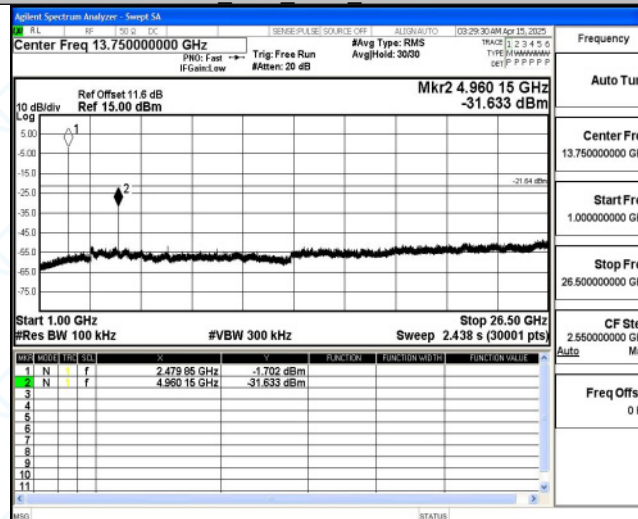





2DH5_Ant1_2402_0~Reference

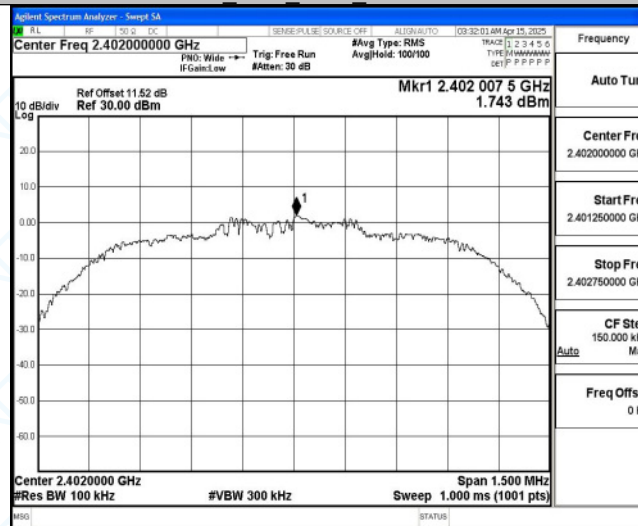

2DH5_Ant1_2402_30~1000

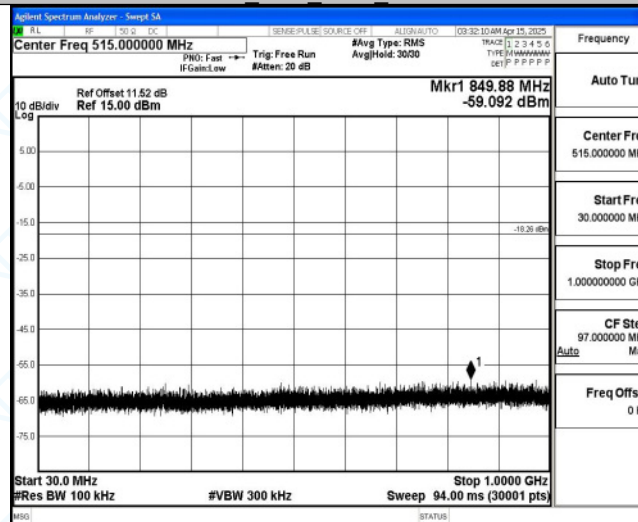


2DH5_Ant1_2402_1000~26500

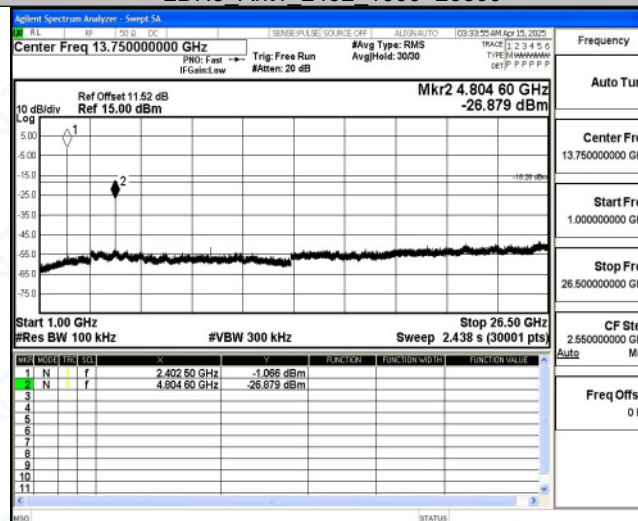





2DH5_Ant1_2441_0~Reference

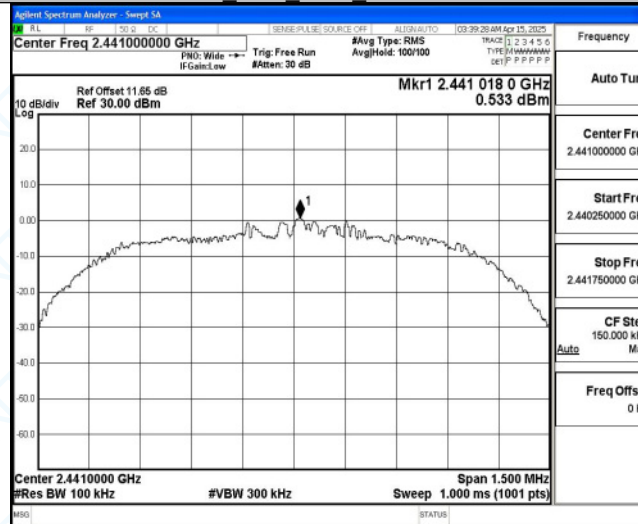

2DH5_Ant1_2441_30~1000

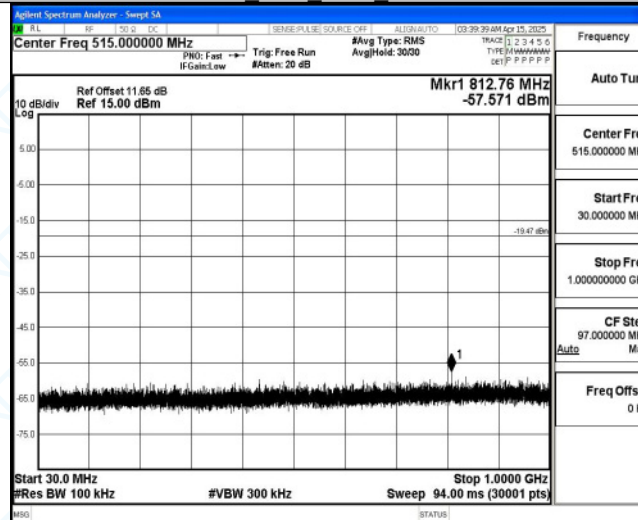


2DH5_Ant1_2441_1000~26500

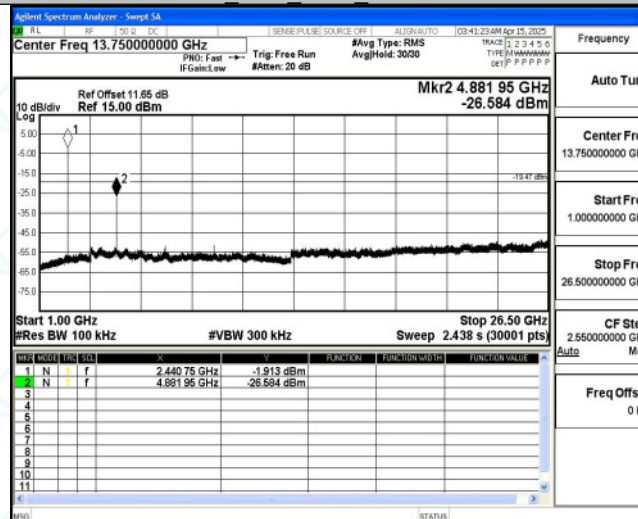





2DH5_Ant1_2480_0~Reference

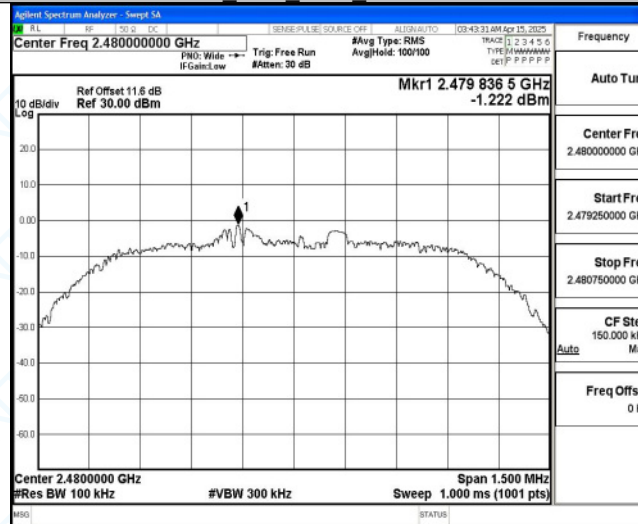

2DH5_Ant1_2480_30~1000

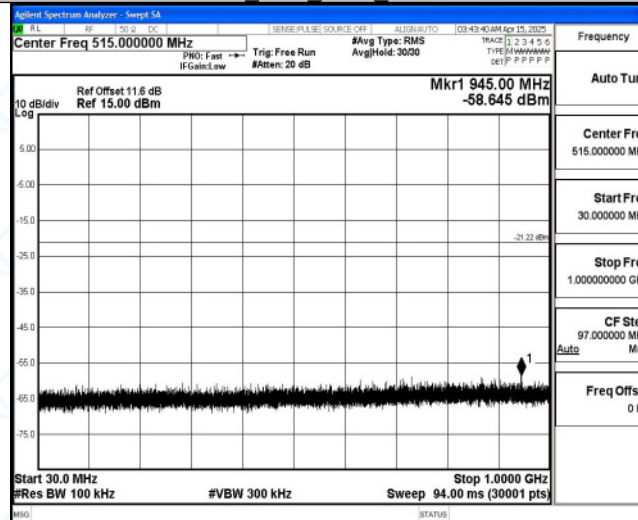


2DH5_Ant1_2480_1000~26500

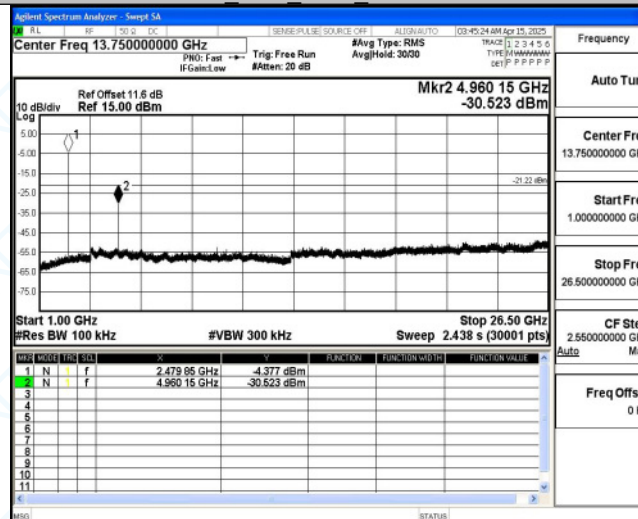





3DH5_Ant1_2402_0~Reference

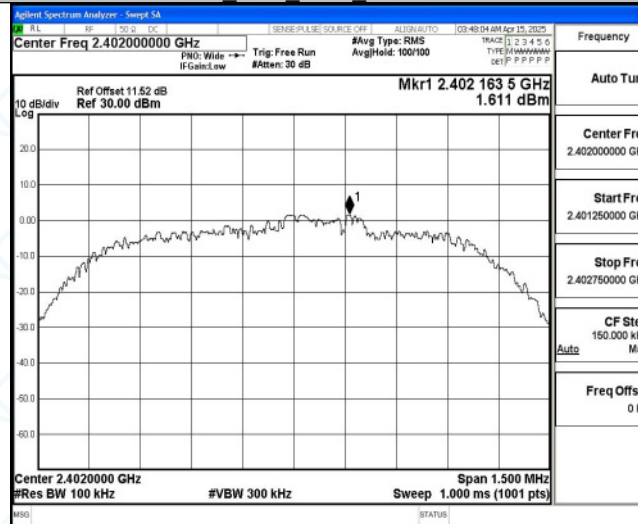

3DH5_Ant1_2402_30~1000

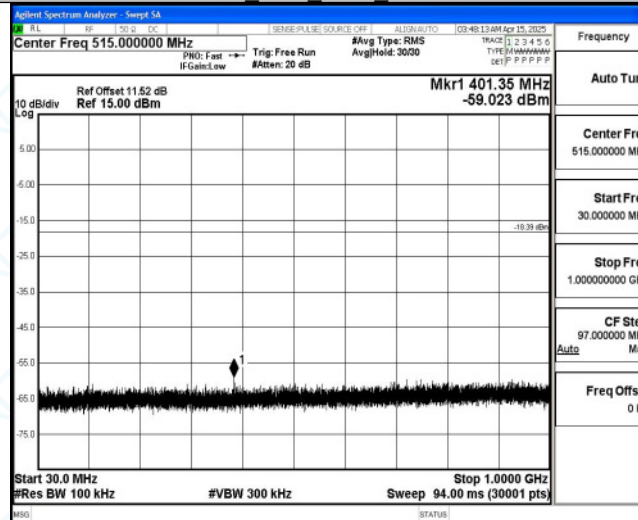


3DH5_Ant1_2402_1000~26500

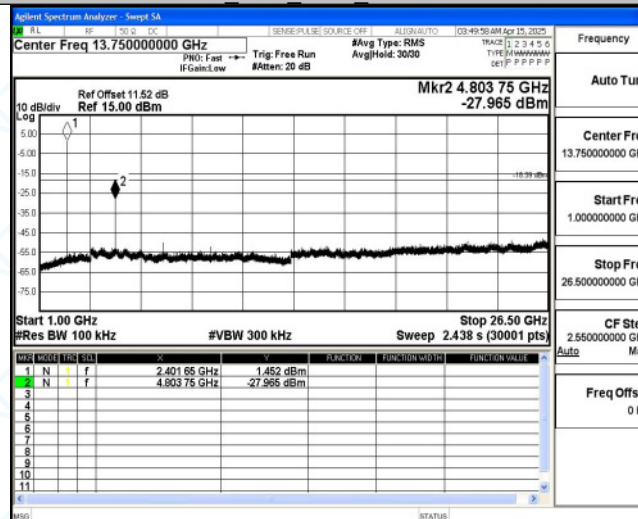





3DH5_Ant1_2441_0~Reference

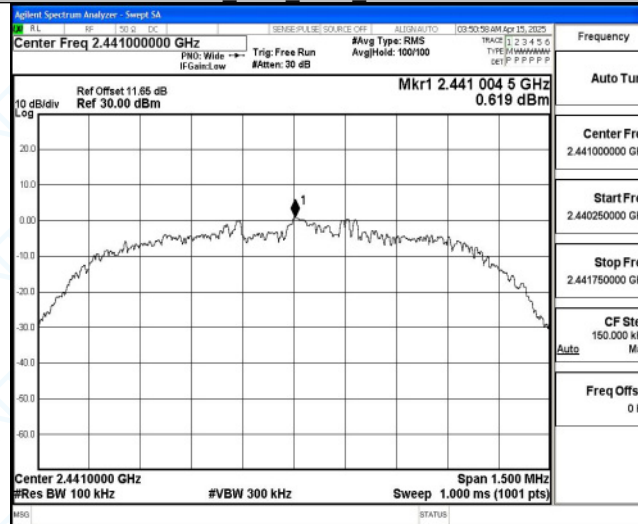

3DH5_Ant1_2441_30~1000

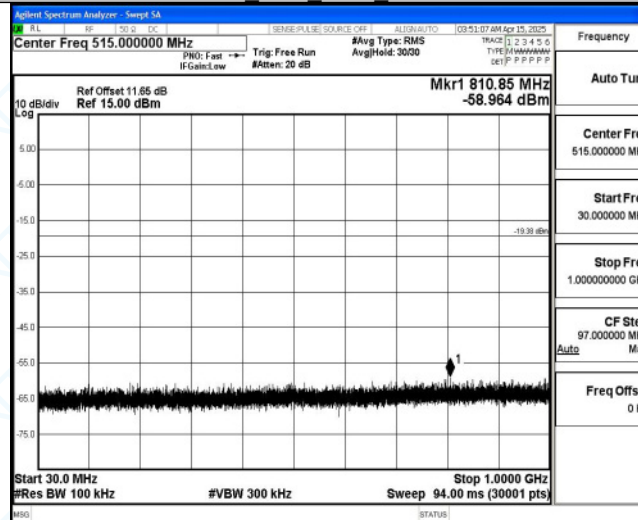


3DH5_Ant1_2441_1000~26500

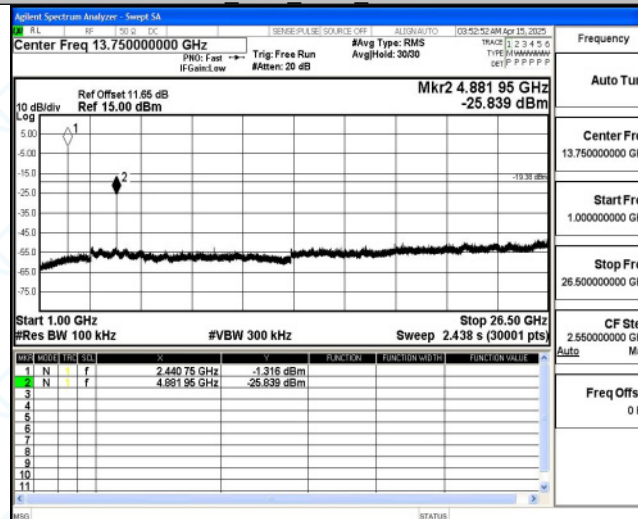





3DH5_Ant1_2480_0~Reference

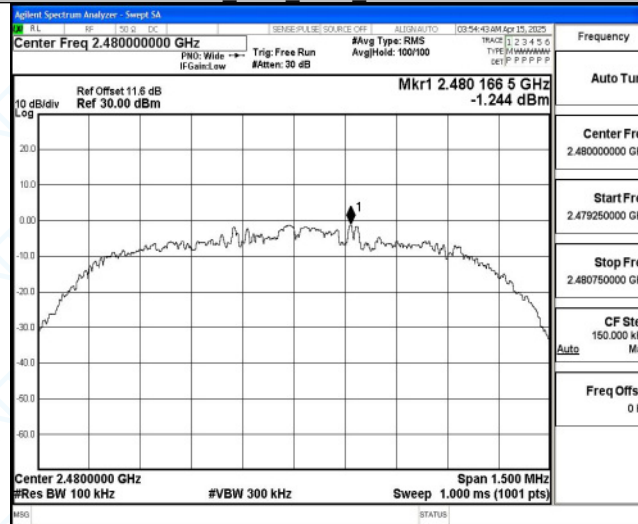

3DH5_Ant1_2480_30~1000

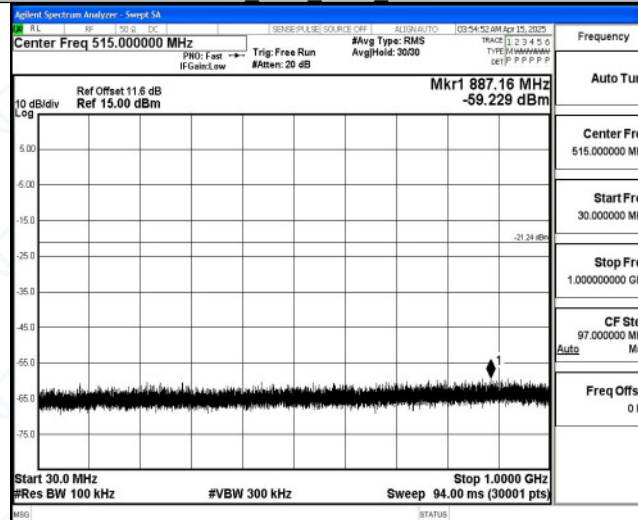

3DH5_Ant1_2480_1000~26500

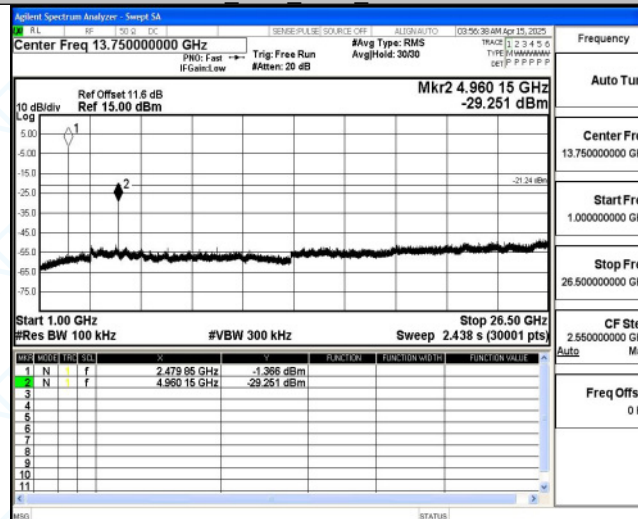

The End Report

Dongguan DN Testing Co., Ltd.

Add: No. 1, West Fourth Street, Xingfa South Road, Wusha Community, Chang 'an Town, Dongguan City, Guangdong P.R.China

Web: www.dn-testing.com

Tel:+86-769-88087383

E-mail: service@dn-testing.com