




8DPSK_3DH1_HOPP_Ant1_NTNV

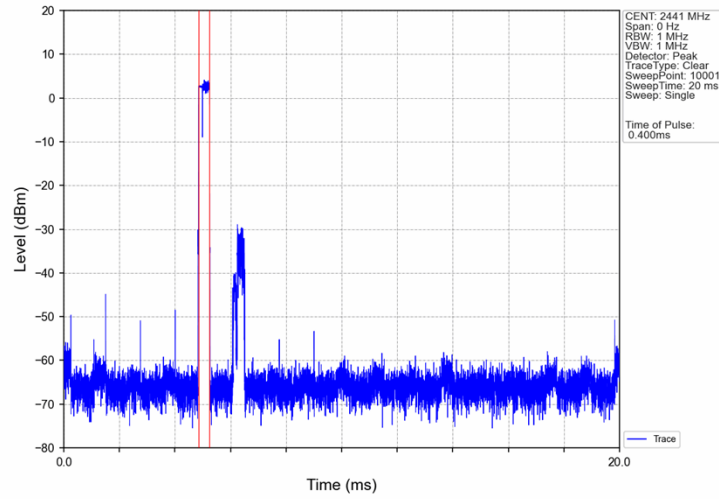


8DPSK_3DH1_HOPP_Ant1_NTNV

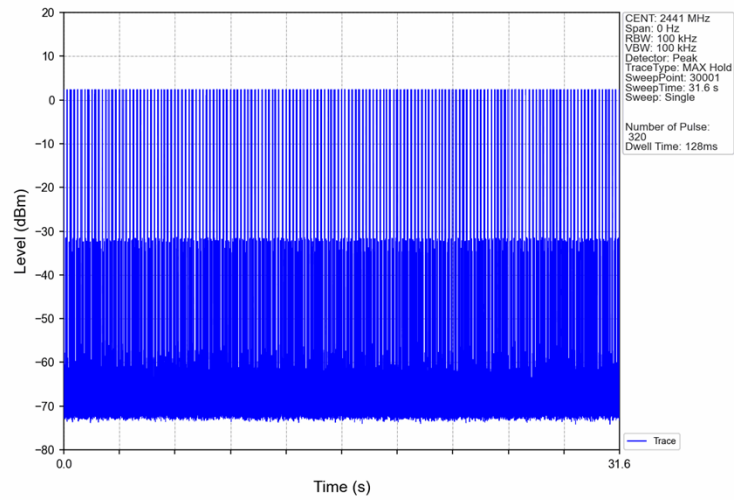


8DPSK_3DH3_HOPP_Ant1_NTNV

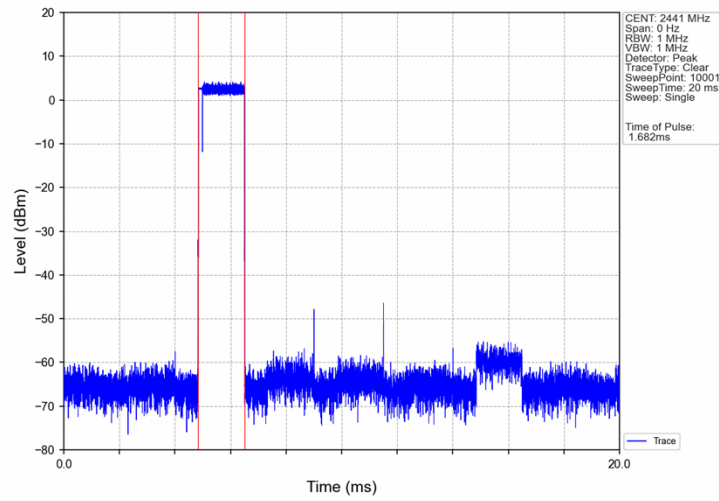


8DPSK_3DH3_HOPP_Ant1_NTNV

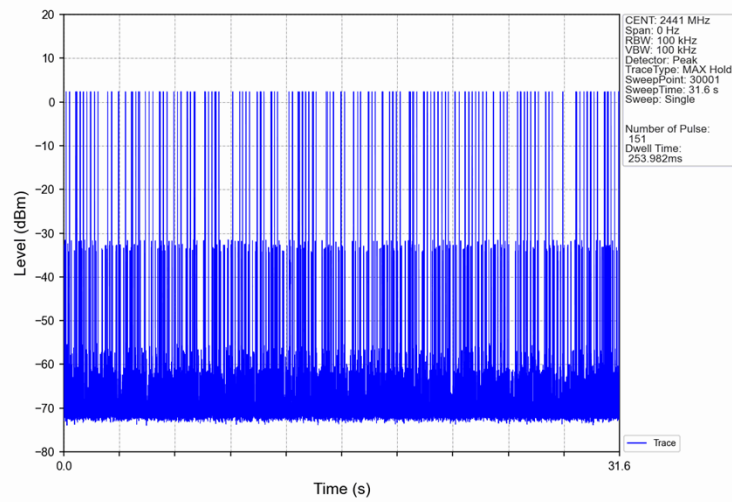

8DPSK_3DH5_HOPP_Ant1_NTNV

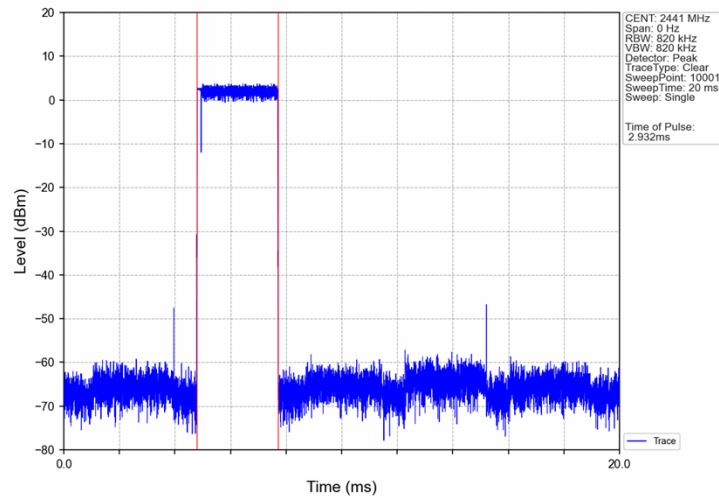

8DPSK_3DH5_HOPP_Ant1_NTNV

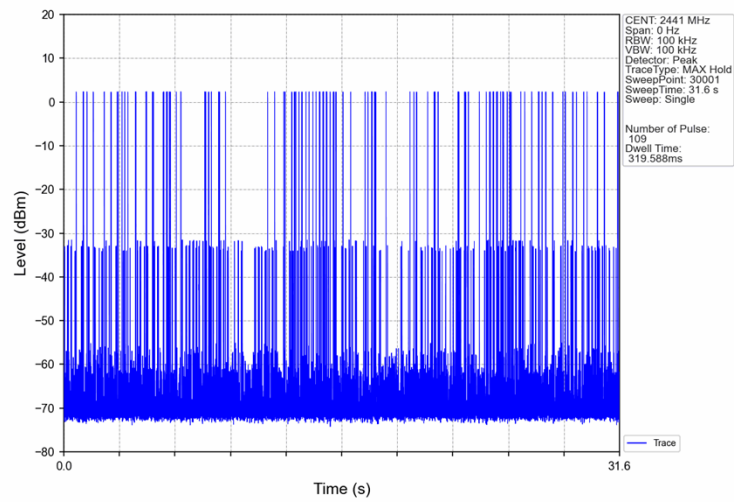

6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Test Result

6.1.1 Ref

Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	4.17
		2441	DH5	1	3.10
		2480	DH5	1	2.54
		HOPP	DH5	1	4.43
					4.43
Pi/4DQPSK	SISO	2402	2DH5	1	2.95
		2441	2DH5	1	2.45
		2480	2DH5	1	1.34
		HOPP	2DH5	1	3.28
					3.28
8DPSK	SISO	2402	3DH5	1	2.96
		2441	3DH5	1	2.45
		2480	3DH5	1	1.43
		HOPP	3DH5	1	3.29
					3.29

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

6.1.2 CSE


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	4.17	-15.83	Pass
		2441	DH5	1	3.10	-16.90	Pass
		2480	DH5	1	2.54	-17.46	Pass
		HOPP	DH5	1	4.43	-15.57	Pass
					4.43	-15.57	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	2.95	-17.05	Pass
		2441	2DH5	1	2.45	-17.55	Pass
		2480	2DH5	1	1.34	-18.66	Pass
		HOPP	2DH5	1	3.28	-16.72	Pass
					3.28	-16.72	Pass
8DPSK	SISO	2402	3DH5	1	2.96	-17.04	Pass
		2441	3DH5	1	2.45	-17.55	Pass
		2480	3DH5	1	1.43	-18.57	Pass
		HOPP	3DH5	1	3.29	-16.71	Pass
					3.29	-16.71	Pass

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.


6.2 Test Graph

6.2.1 Ref


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

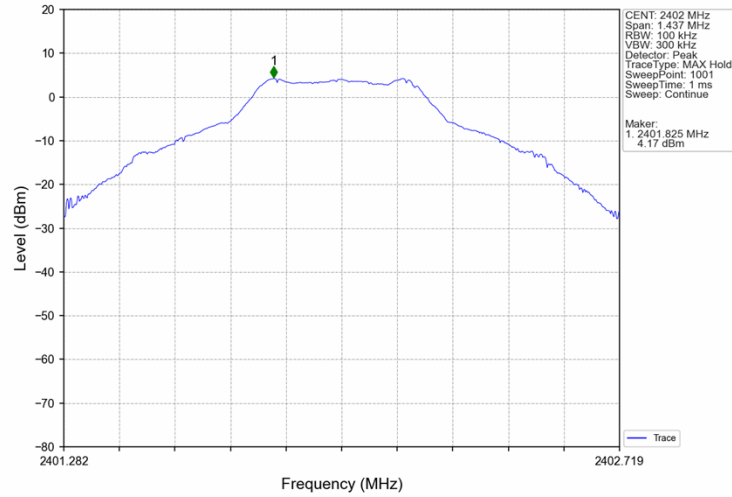


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

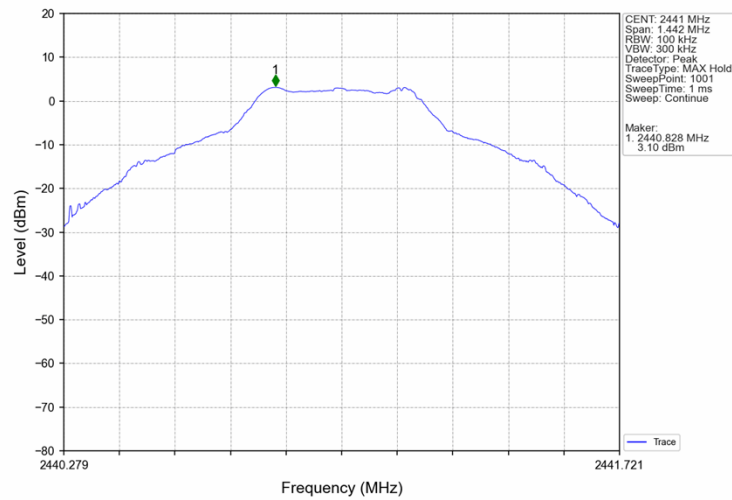


GFSK DH5 HCH 2480MHz_Ant1_NTNV

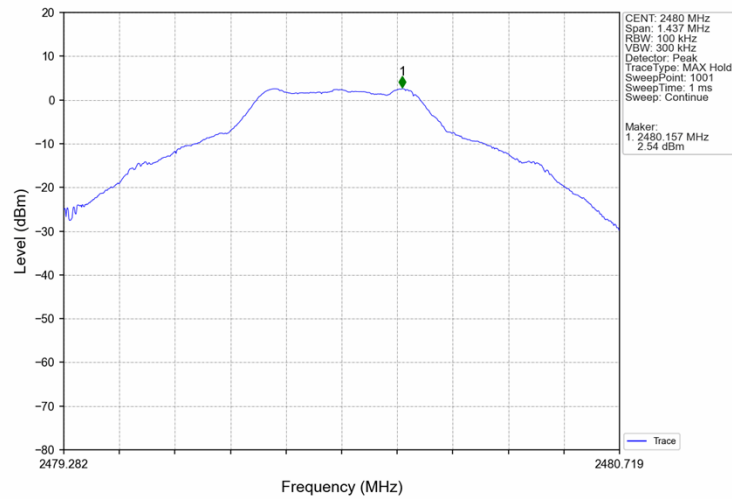


GFSK DH5 HOPP_Ant1_NTNV

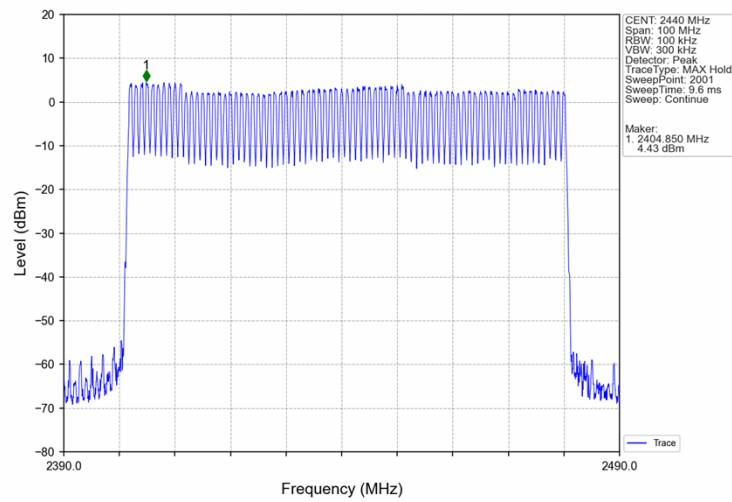


GFSK_DH5_HOPP_Ant1_NTNV

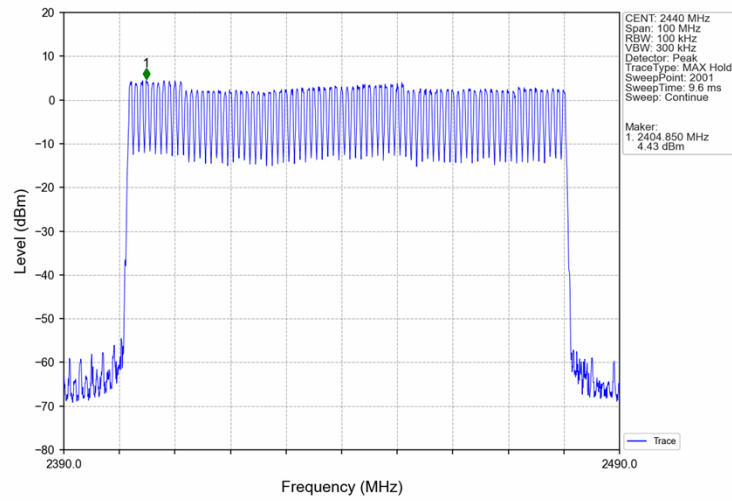


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

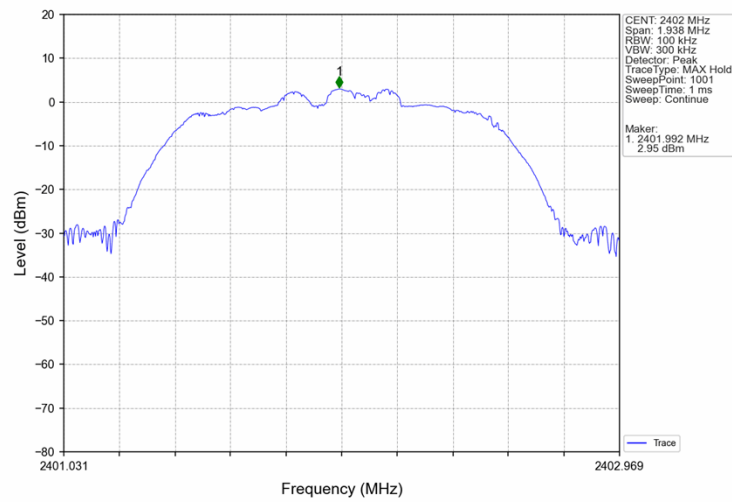


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

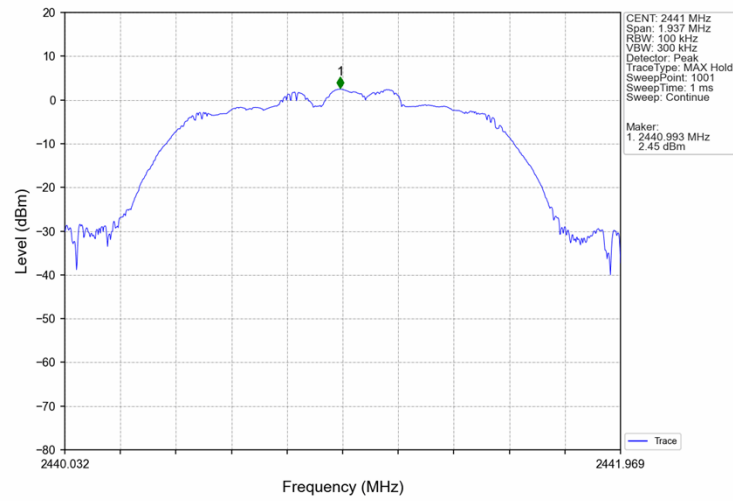


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

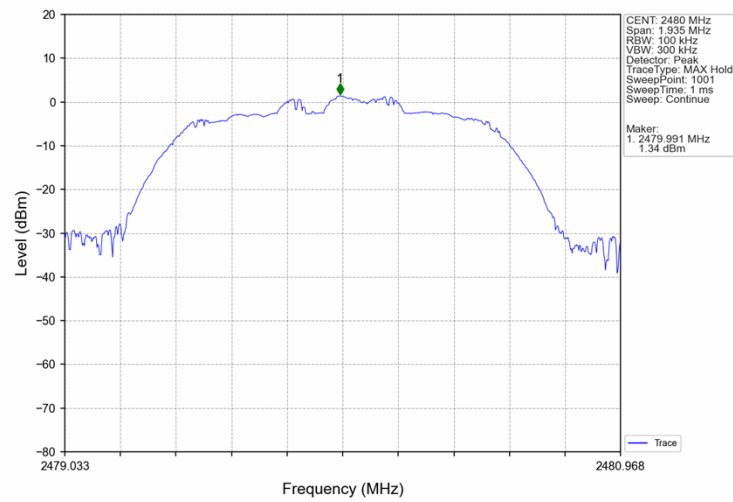


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

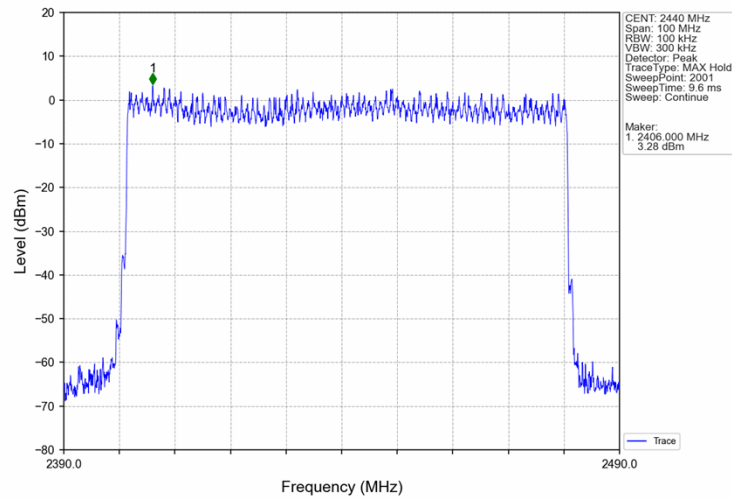


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

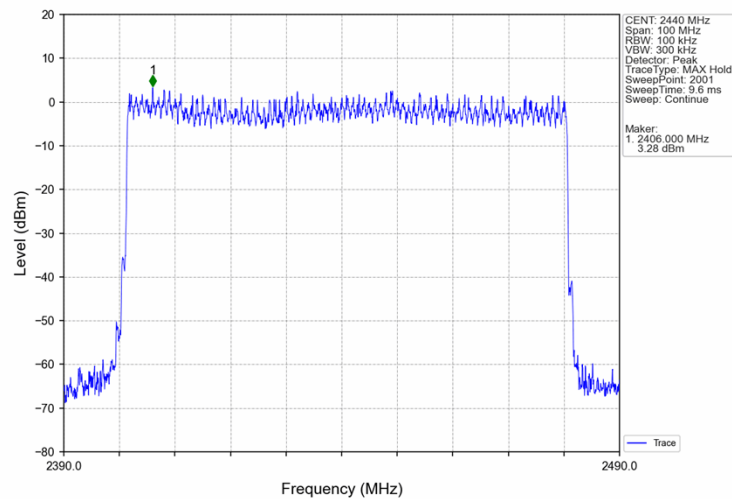


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

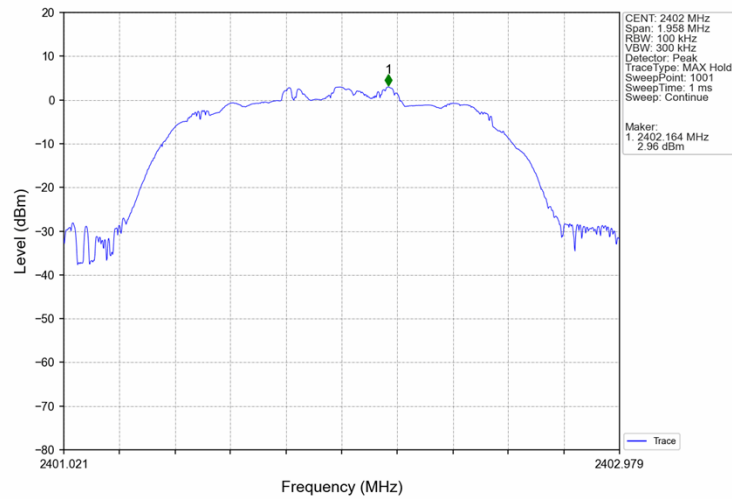


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

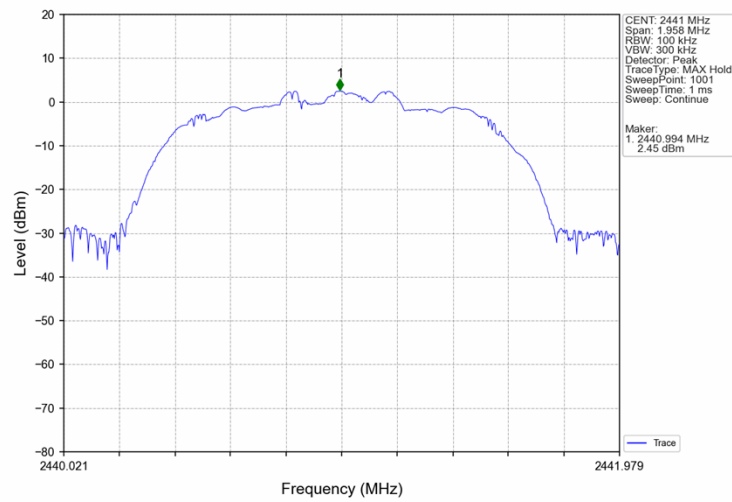


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

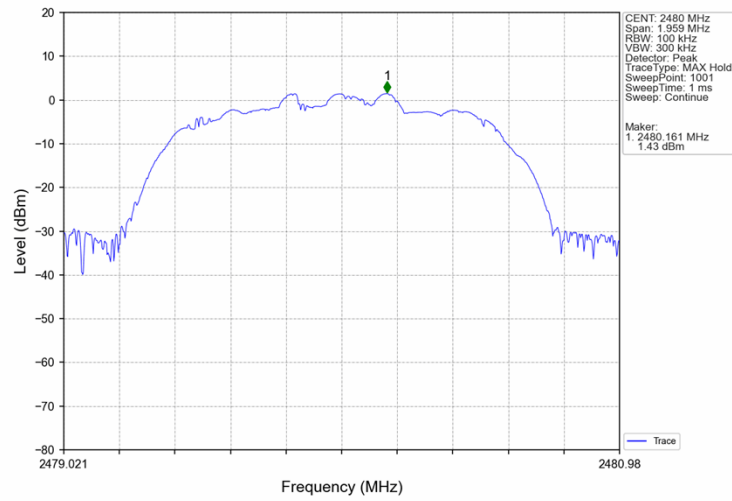

8DPSK_3DH5_HOPP_Ant1_NTNV

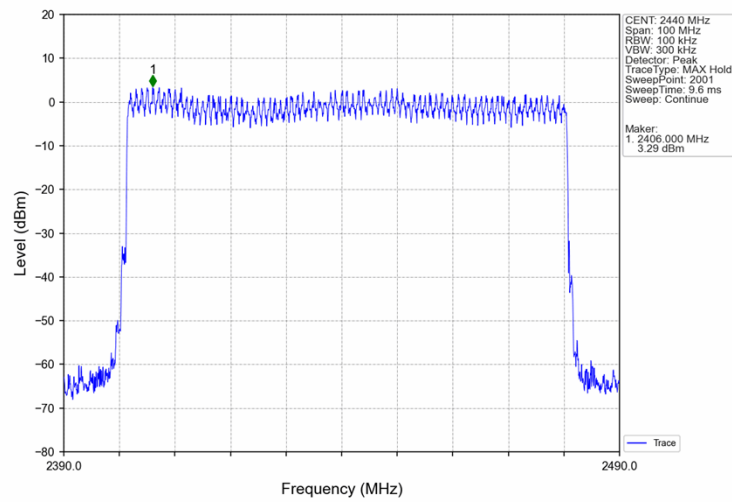


8DPSK_3DH5_HOPP_Ant1_NTNV

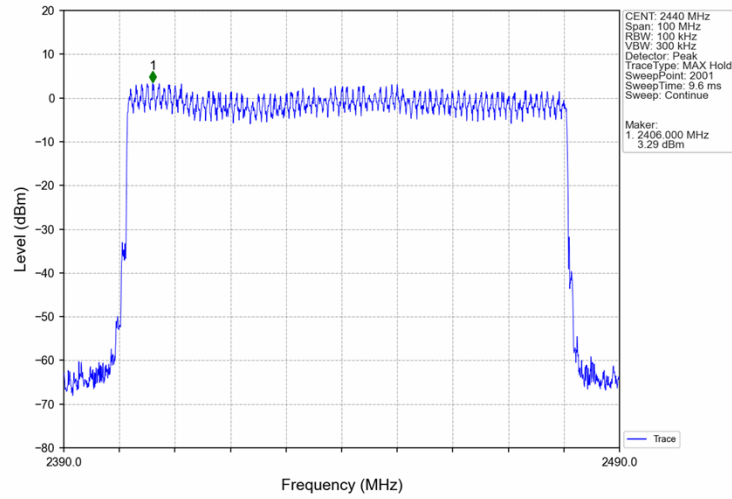


6.2.2 CSE


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

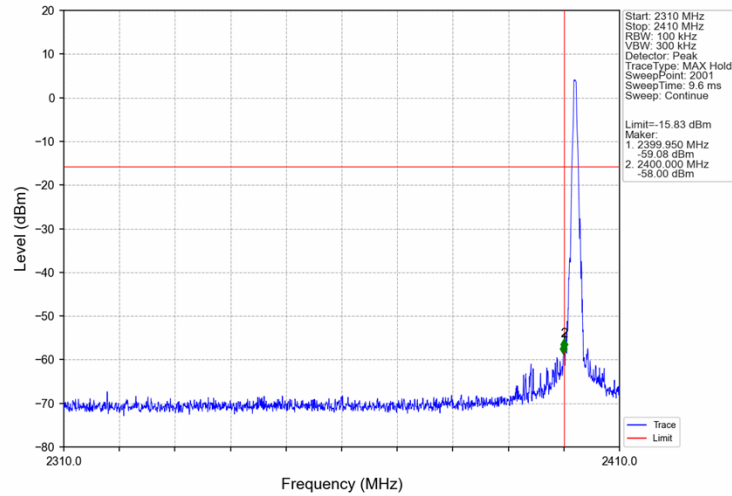


GFSK_DH5_LCH_2402MHz_Ant1_NTNV

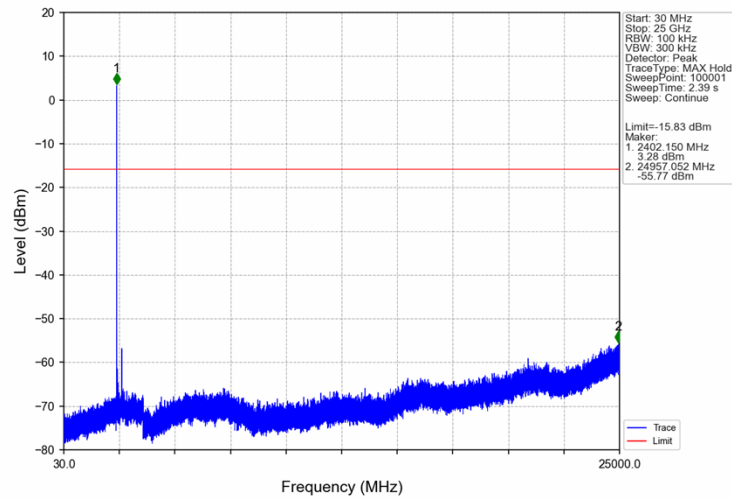


GFSK_DH5_MCH_2441MHz_Ant1_NTNV

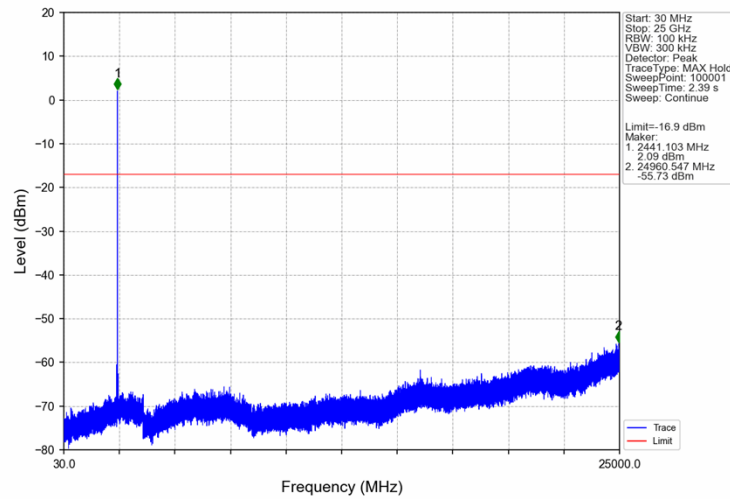


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

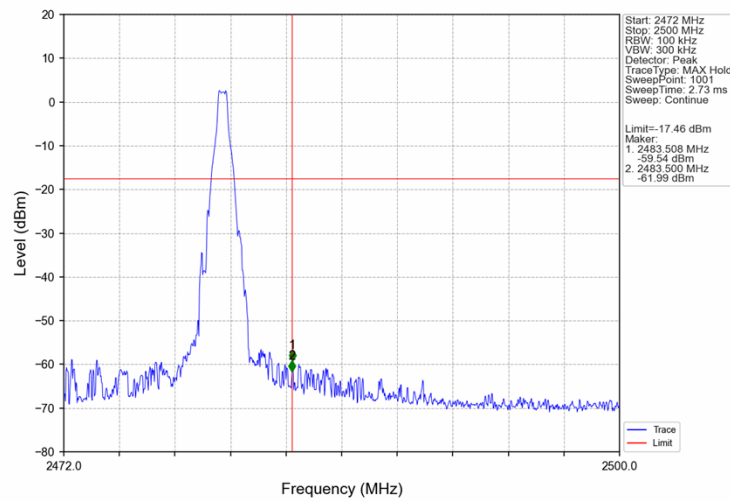


GFSK_DH5_HCH_2480MHz_Ant1_NTNV

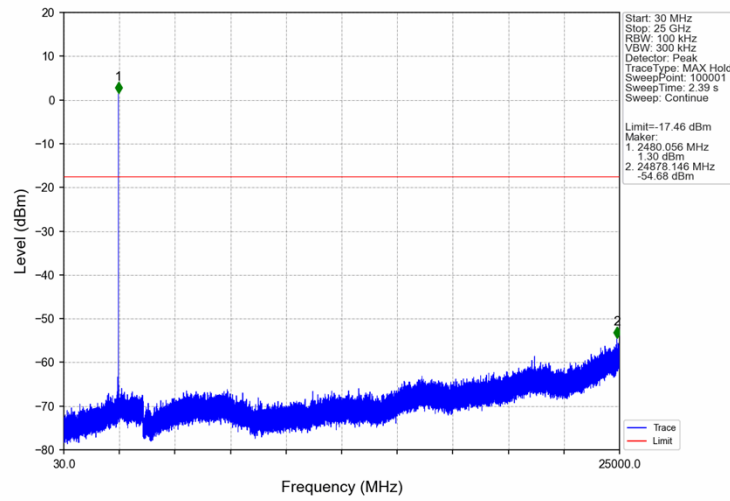


GFSK_DH5_HOPP_Ant1_NTNV

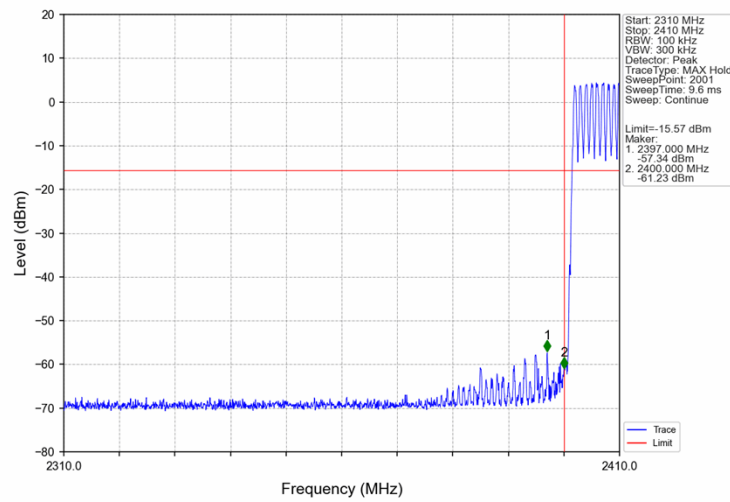


GFSK_DH5_HOPP_Ant1_NTNV

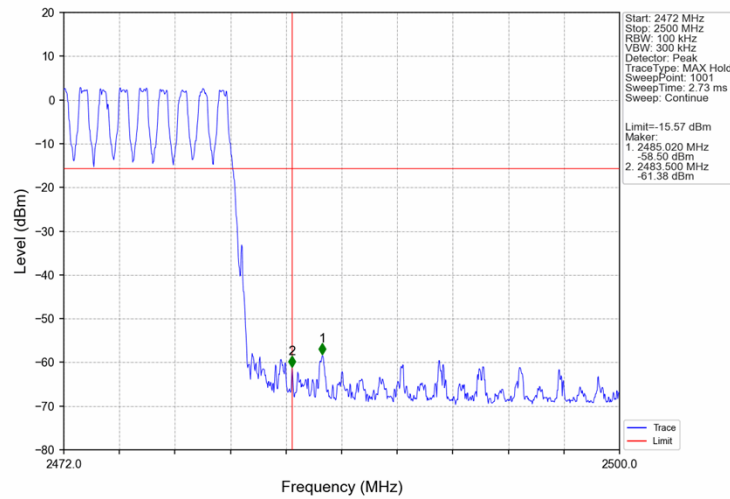


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

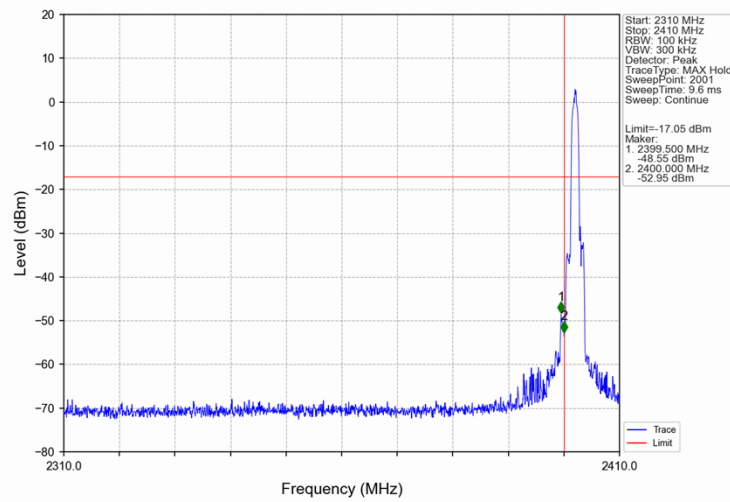


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

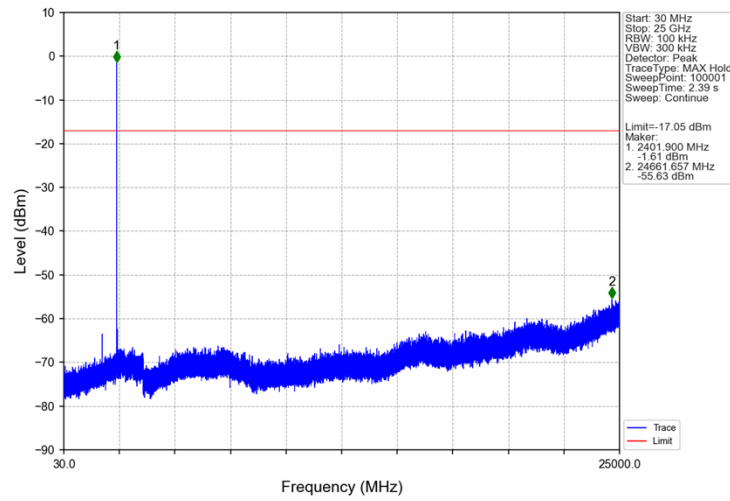


Pi/4DQPSK_2DH5_MCH_2441MHz_Ant1_NTNV

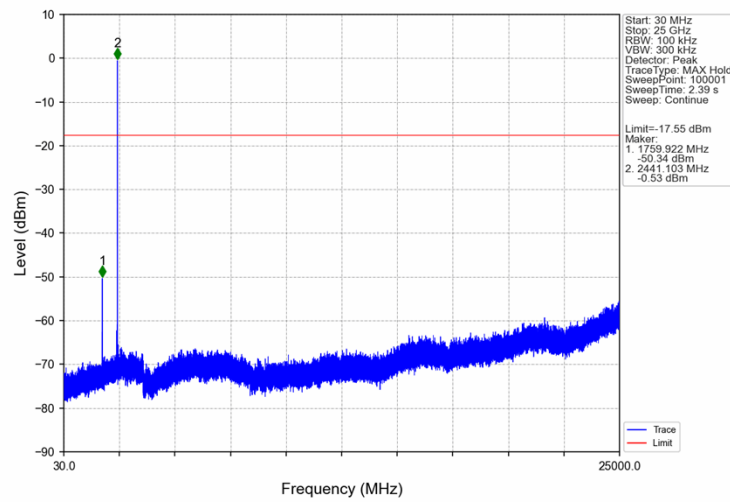


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

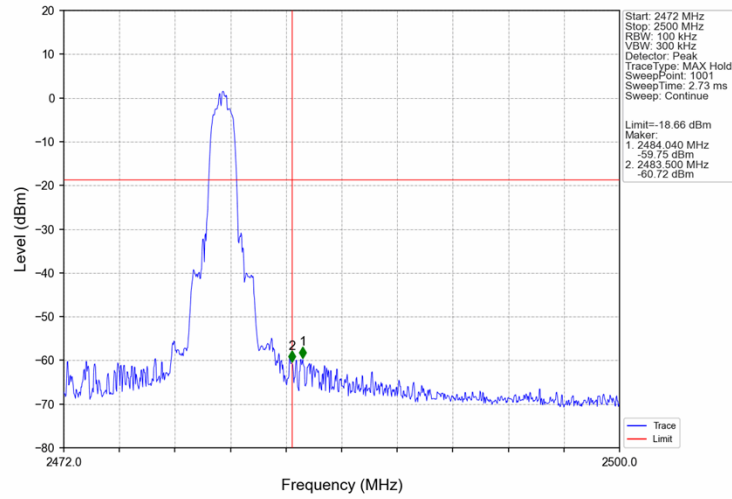


Pi/4DQPSK_2DH5_HCH_2480MHz_Ant1_NTNV

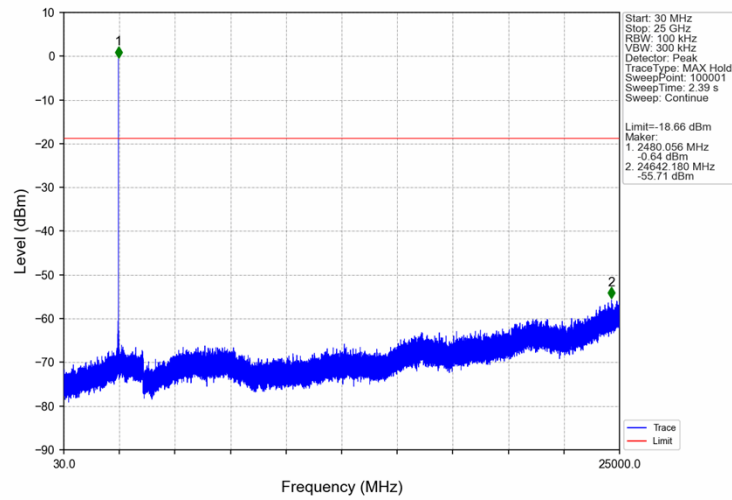


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

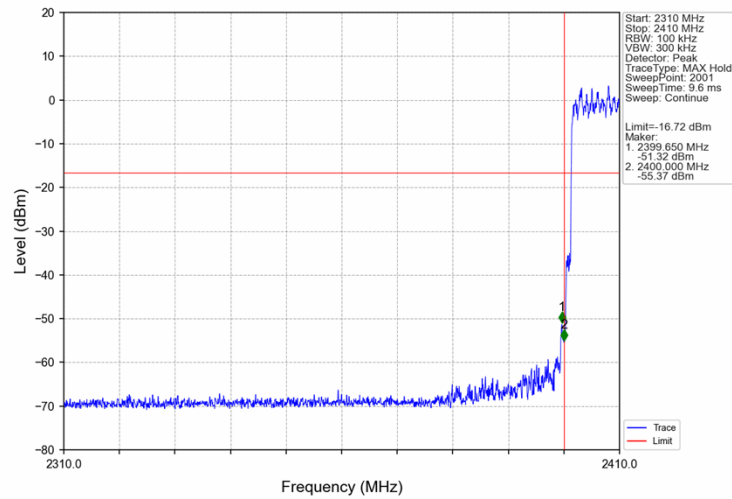


Pi/4DQPSK_2DH5_HOPP_Ant1_NTNV

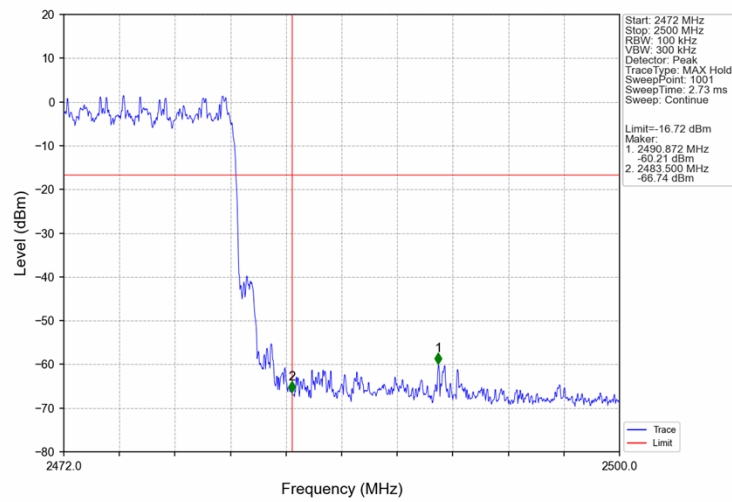


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

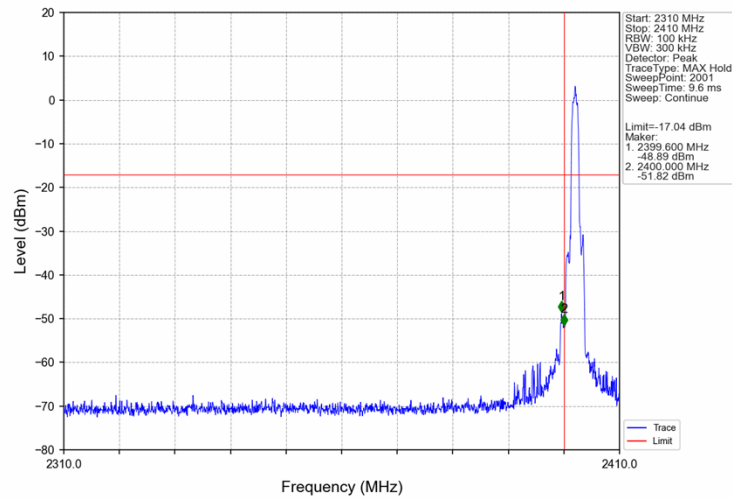


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

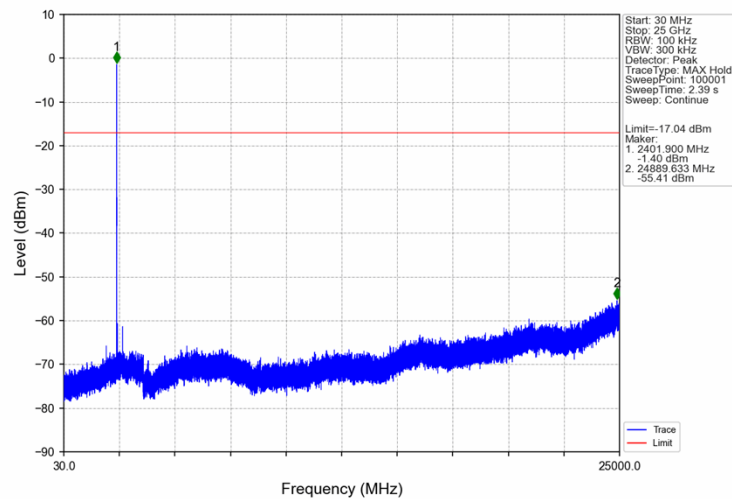


8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

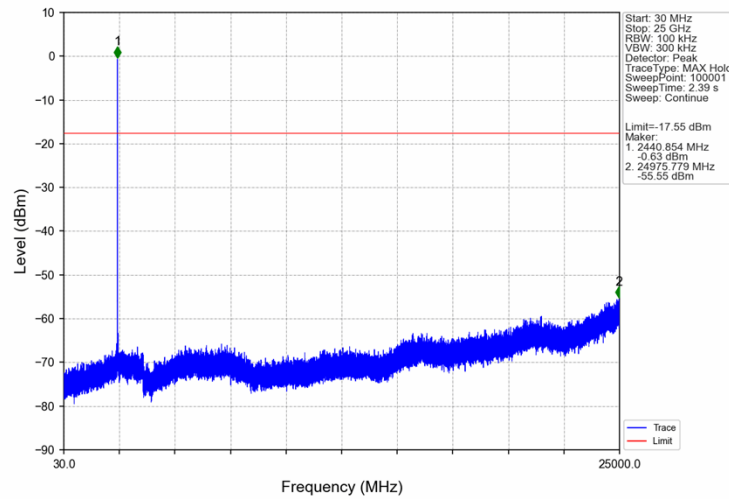


8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

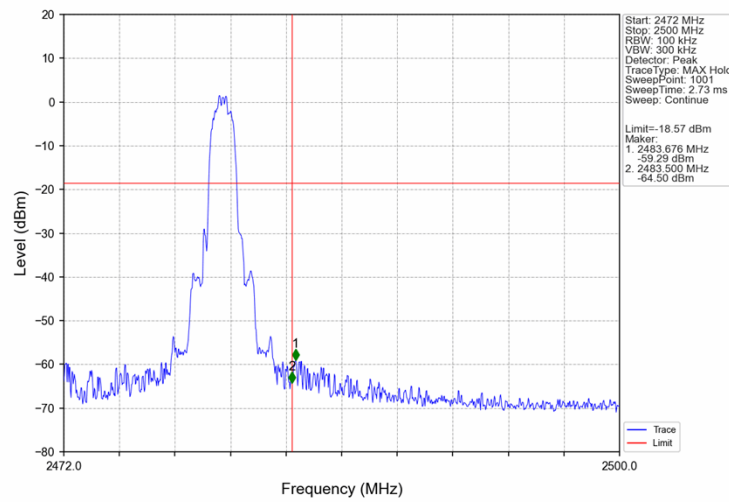

8DPSK_3DH5_HCH_2480MHz_Ant1_NTNV

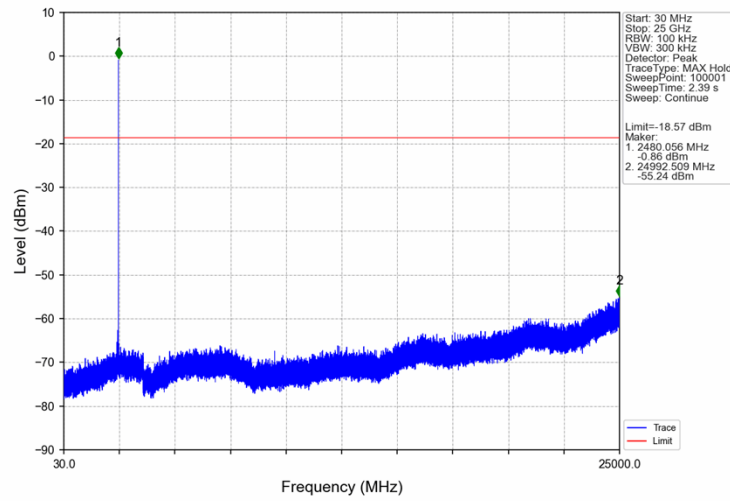


8DPSK_3DH5_HOPP_Ant1_NTNV

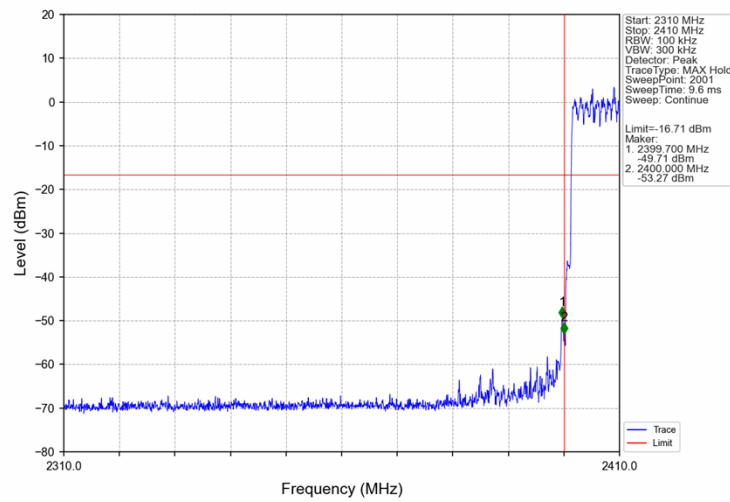



8DPSK_3DH5_HOPP_Ant1_NTNV

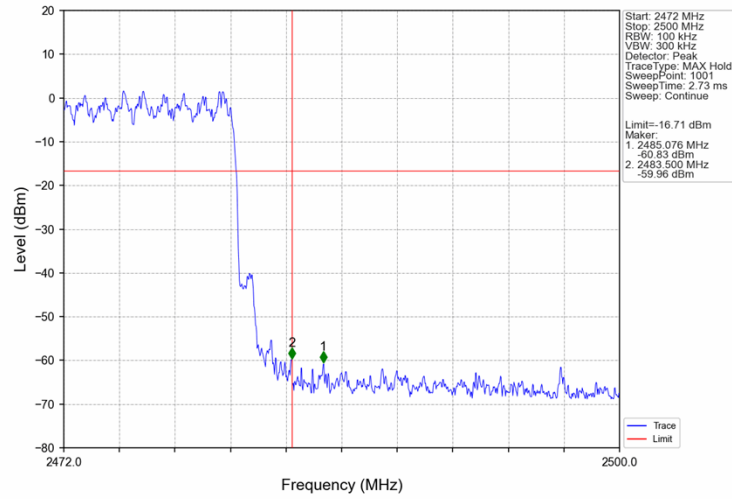

***** End of Report *****