




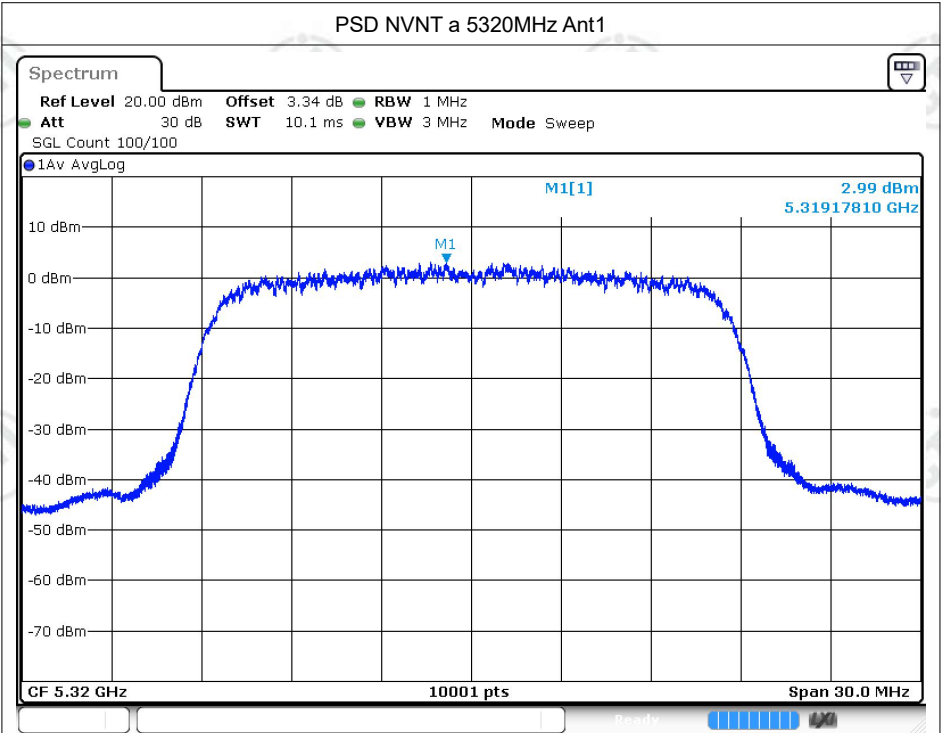


Date: 7.AUG.2025 09:05:52

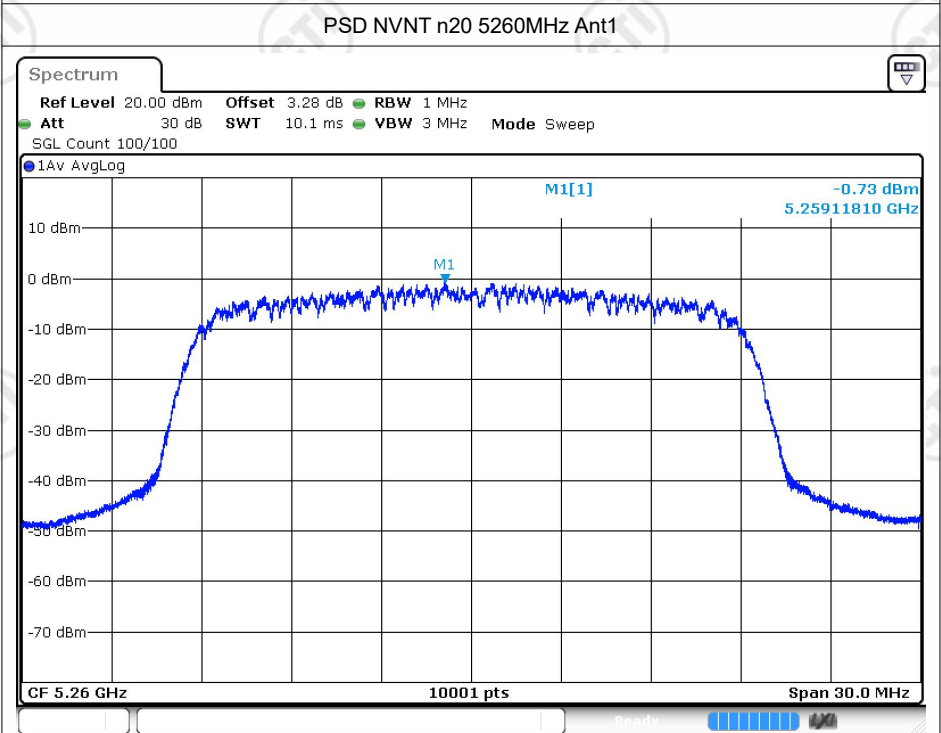



Date: 7.AUG.2025 09:07:11

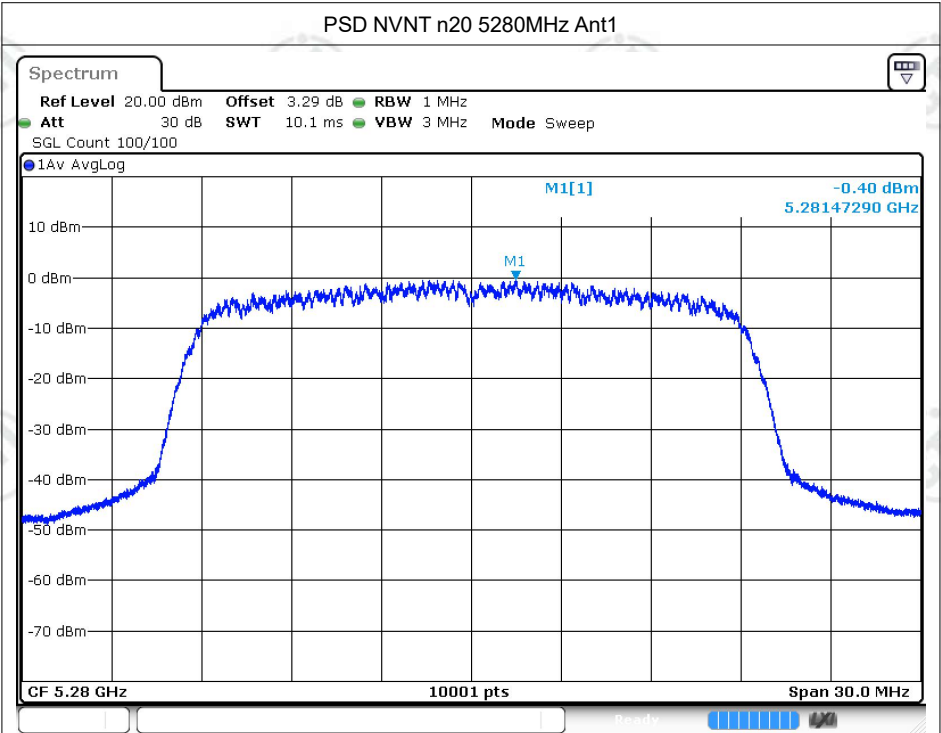


Date: 7.AUG.2025 09:08:09

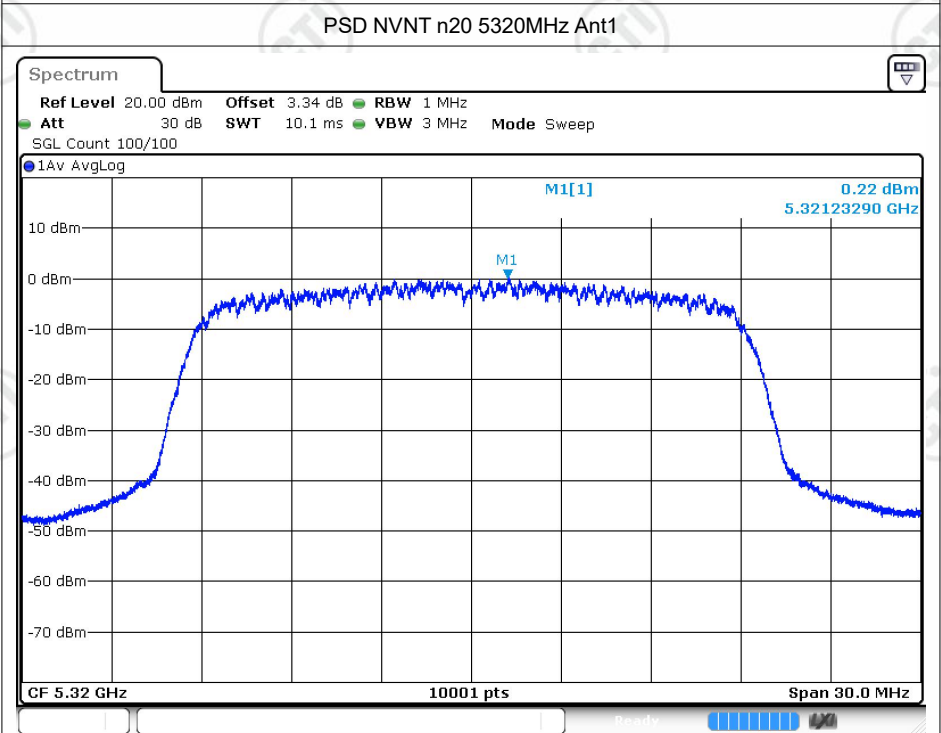


Date: 7.AUG.2025 09:08:53

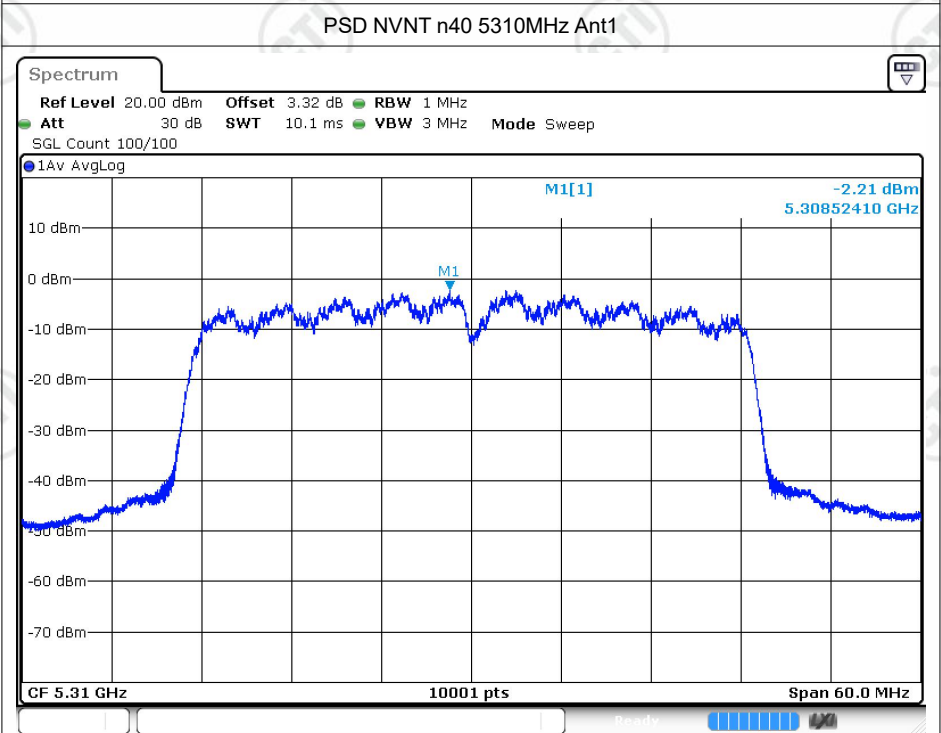
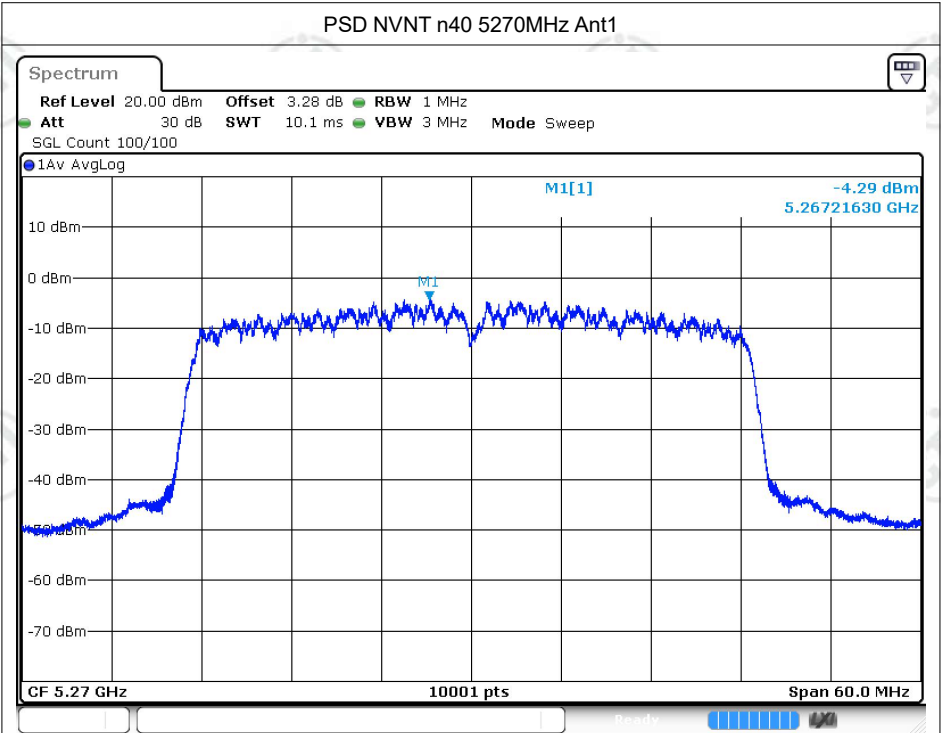


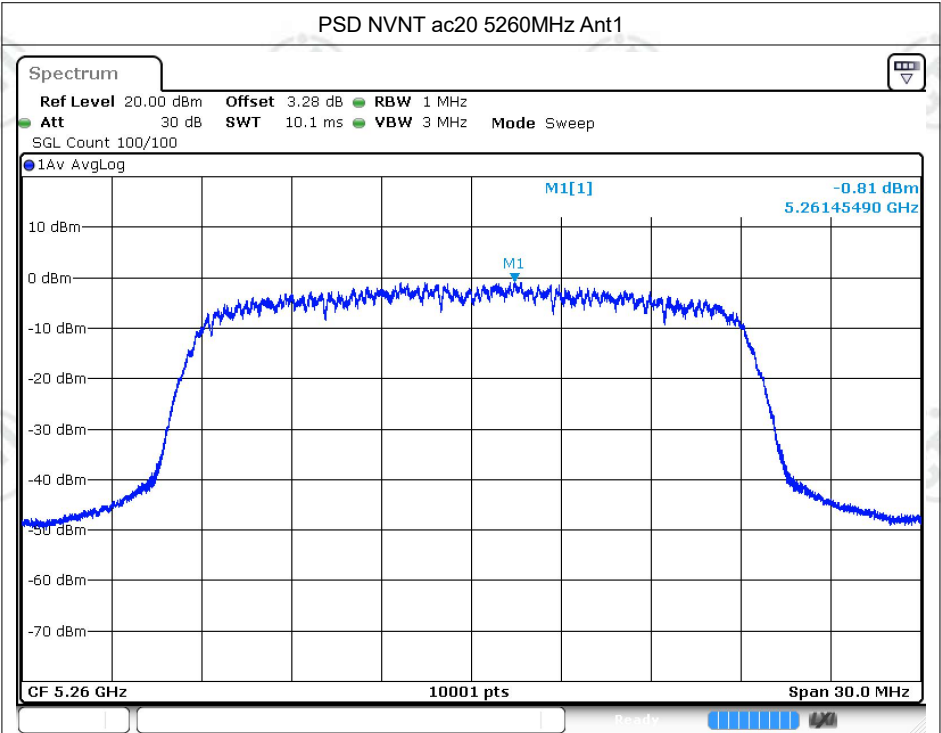


Date: 7.AUG.2025 09:10:39

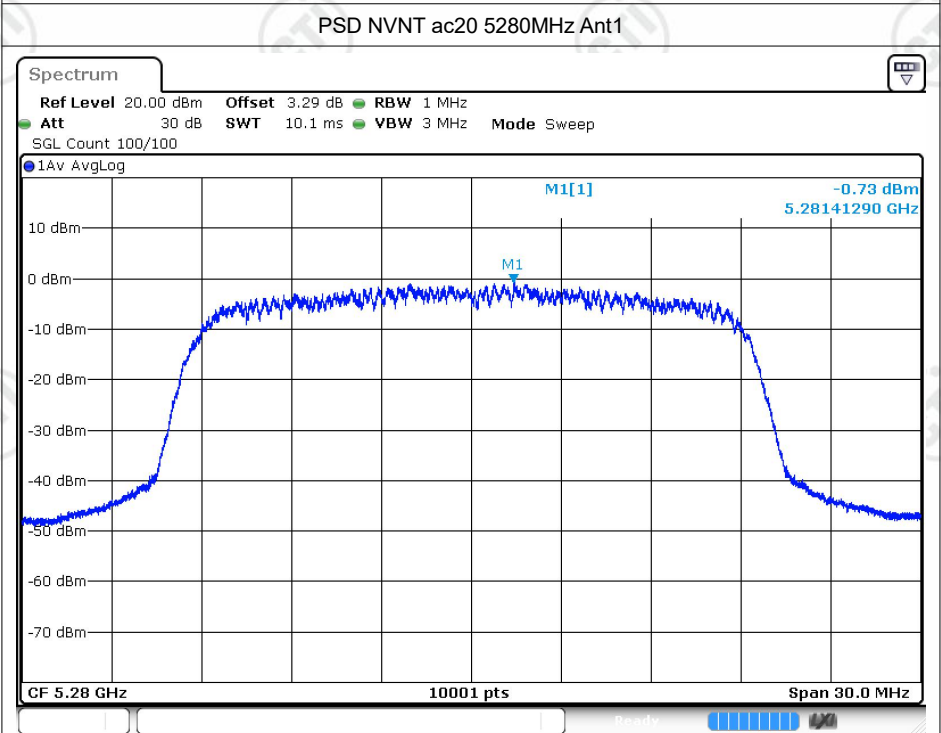


Date: 7.AUG.2025 09:11:40

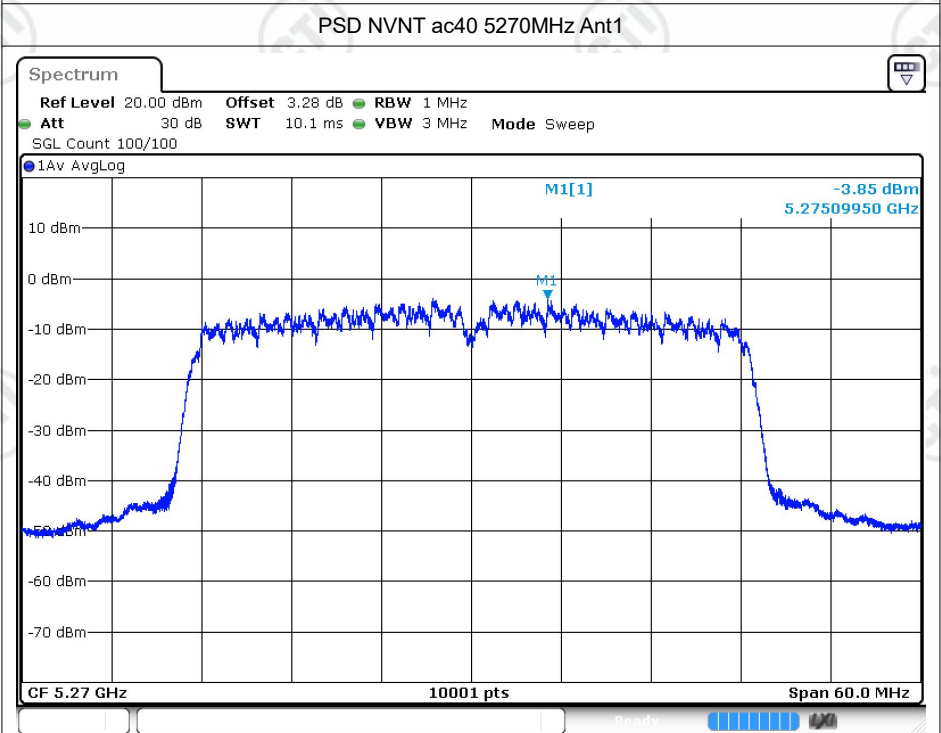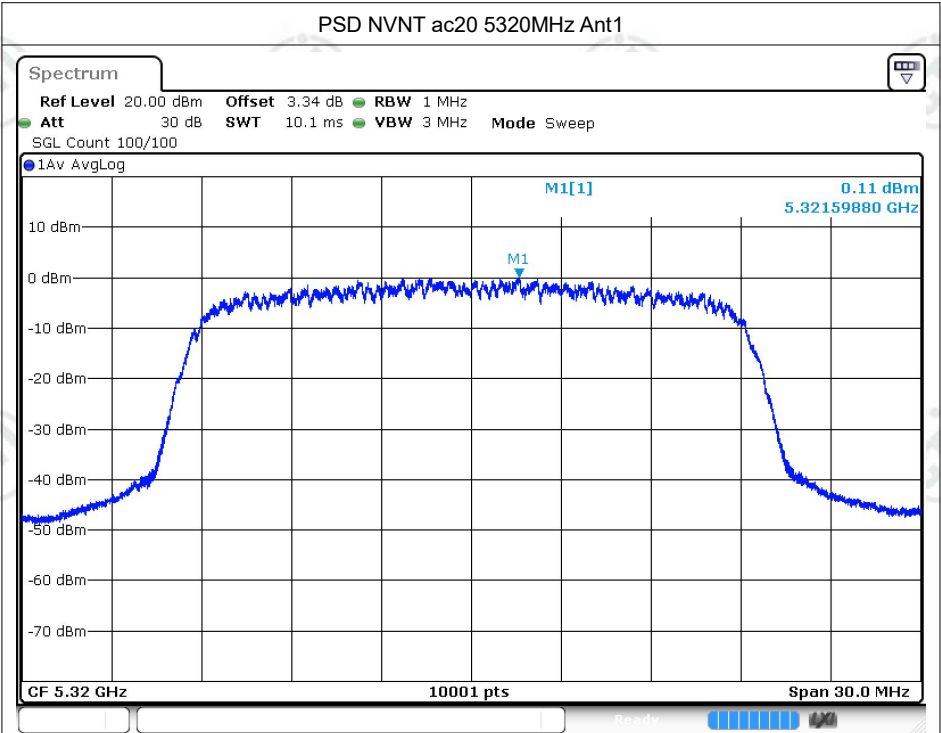

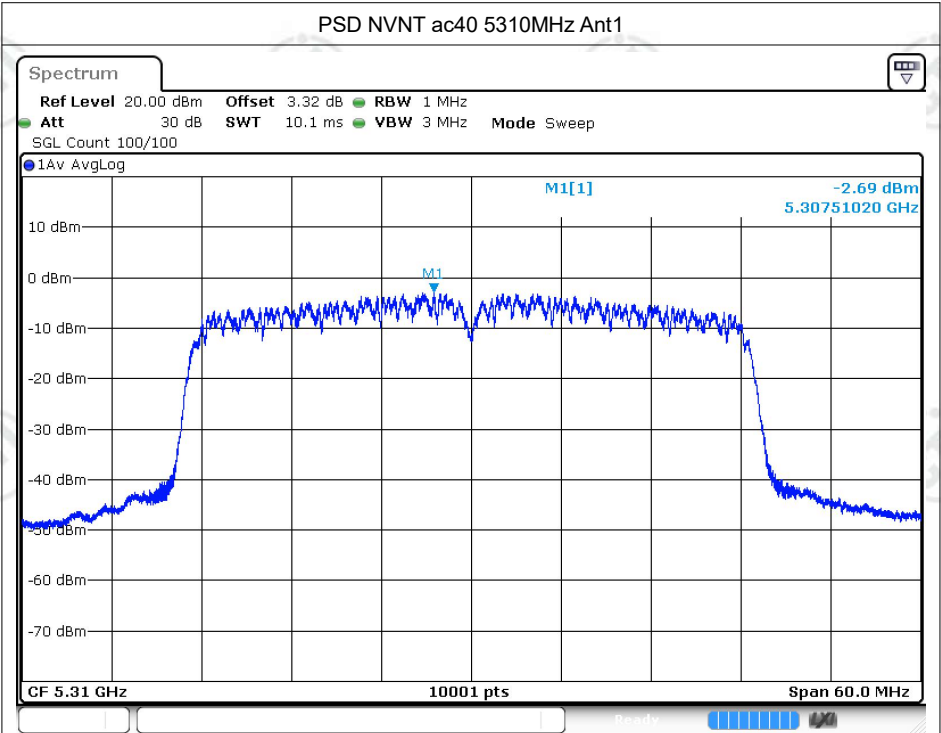

Date: 7.AUG.2025 09:18:37

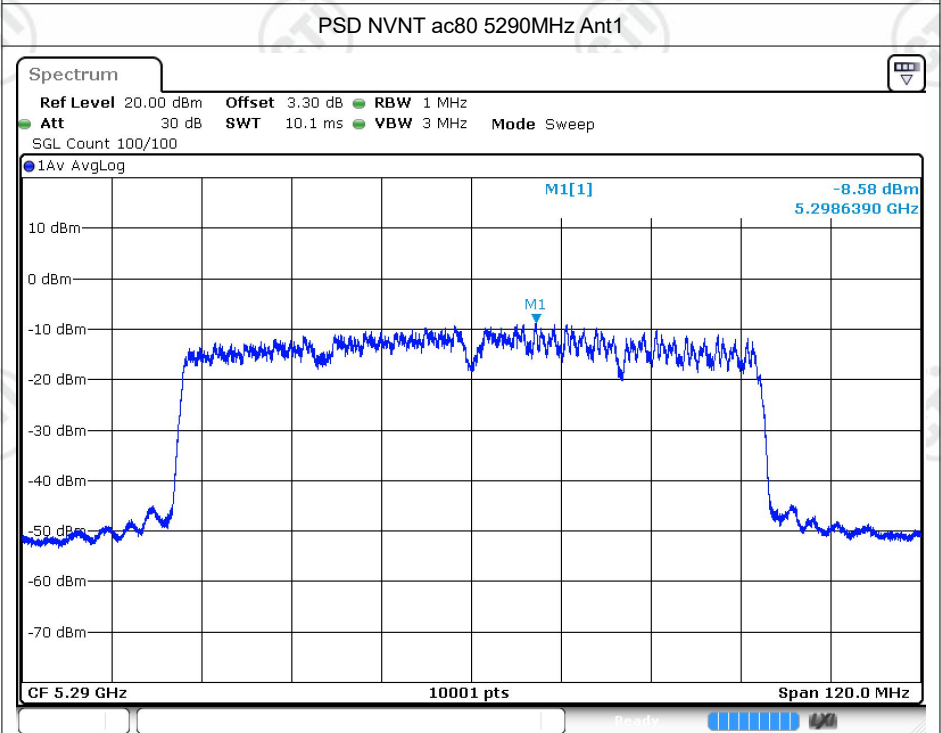

Date: 7.AUG.2025 09:20:10

Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 138V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 120V	a	5260	Ant1	5260	0	0	25	Pass
-10C 120V	a	5260	Ant1	5260	0	0	25	Pass
0C 120V	a	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 120V	a	5260	Ant1	5260	0	0	25	Pass
30C 120V	a	5260	Ant1	5260	0	0	25	Pass
40C 120V	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
50C 120V	a	5260	Ant1	5260	0	0	25	Pass
20C 102V	a	5280	Ant1	5280	0	0	25	Pass
20C 120V	a	5280	Ant1	5280	0	0	25	Pass
20C 138V	a	5280	Ant1	5280	0	0	25	Pass
-20C 120V	a	5280	Ant1	5279.94	-60000	-11.36	25	Pass
-10C 120V	a	5280	Ant1	5280	0	0	25	Pass
0C 120V	a	5280	Ant1	5280	0	0	25	Pass
10C 120V	a	5280	Ant1	5280	0	0	25	Pass
30C 120V	a	5280	Ant1	5279.96	-40000	-7.58	25	Pass
40C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 120V	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	a	5320	Ant1	5319.94	-60000	-11.28	25	Pass
20C 138V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-20C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 120V	a	5320	Ant1	5320	0	0	25	Pass
0C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
30C 120V	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	a	5320	Ant1	5320	0	0	25	Pass
50C 120V	a	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 138V	n20	5260	Ant1	5260	0	0	25	Pass
-20C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-10C 120V	n20	5260	Ant1	5260	0	0	25	Pass
0C 120V	n20	5260	Ant1	5260	0	0	25	Pass
10C 120V	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass

30C 120V	n20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
40C 120V	n20	5260	Ant1	5260	0	0	25	Pass
50C 120V	n20	5260	Ant1	5260	0	0	25	Pass
20C 102V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
20C 120V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
20C 138V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
-20C 120V	n20	5280	Ant1	5280	0	0	25	Pass
-10C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
0C 120V	n20	5280	Ant1	5280	0	0	25	Pass
10C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 120V	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
50C 120V	n20	5280	Ant1	5280	0	0	25	Pass
20C 102V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	n20	5320	Ant1	5320	0	0	25	Pass
20C 138V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-20C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
-10C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
30C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
40C 120V	n20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
50C 120V	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 102V	n40	5270	Ant1	5270	0	0	25	Pass
20C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 138V	n40	5270	Ant1	5270	0	0	25	Pass
-20C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-10C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
0C 120V	n40	5270	Ant1	5269.92	-80000	-15.18	25	Pass
10C 120V	n40	5270	Ant1	5270	0	0	25	Pass
30C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
40C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
50C 120V	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 102V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 138V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-20C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-10C 120V	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
0C 120V	n40	5310	Ant1	5310	0	0	25	Pass
10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
30C 120V	n40	5310	Ant1	5310	0	0	25	Pass
40C 120V	n40	5310	Ant1	5310	0	0	25	Pass

50C 120V	n40	5310	Ant1	5310	0	0	25	Pass
20C 102V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
20C 120V	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
20C 138V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
-20C 120V	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
-10C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
0C 120V	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
10C 120V	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
30C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
40C 120V	ac20	5260	Ant1	5259.94	-60000	-11.41	25	Pass
50C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
20C 102V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 138V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
-20C 120V	ac20	5280	Ant1	5279.94	-60000	-11.36	25	Pass
-10C 120V	ac20	5280	Ant1	5280	0	0	25	Pass
0C 120V	ac20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
10C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
30C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
40C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
50C 120V	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
20C 102V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
20C 120V	ac20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 138V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
-20C 120V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
-10C 120V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
0C 120V	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
10C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
30C 120V	ac20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
40C 120V	ac20	5320	Ant1	5320	0	0	25	Pass
50C 120V	ac20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
20C 102V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 138V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-20C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
-10C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
0C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
10C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
30C 120V	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
40C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
50C 120V	ac40	5270	Ant1	5269.92	-80000	-15.18	25	Pass
20C 102V	ac40	5310	Ant1	5310	0	0	25	Pass

20C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 138V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-20C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
-10C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
0C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
10C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
30C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
40C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
50C 120V	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
20C 102V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 138V	ac80	5290	Ant1	5290	0	0	25	Pass
-20C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
-10C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
0C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
10C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
30C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
40C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
50C 120V	ac80	5290	Ant1	5290	0	0	25	Pass

*** End of Report ***