





Test Graphs



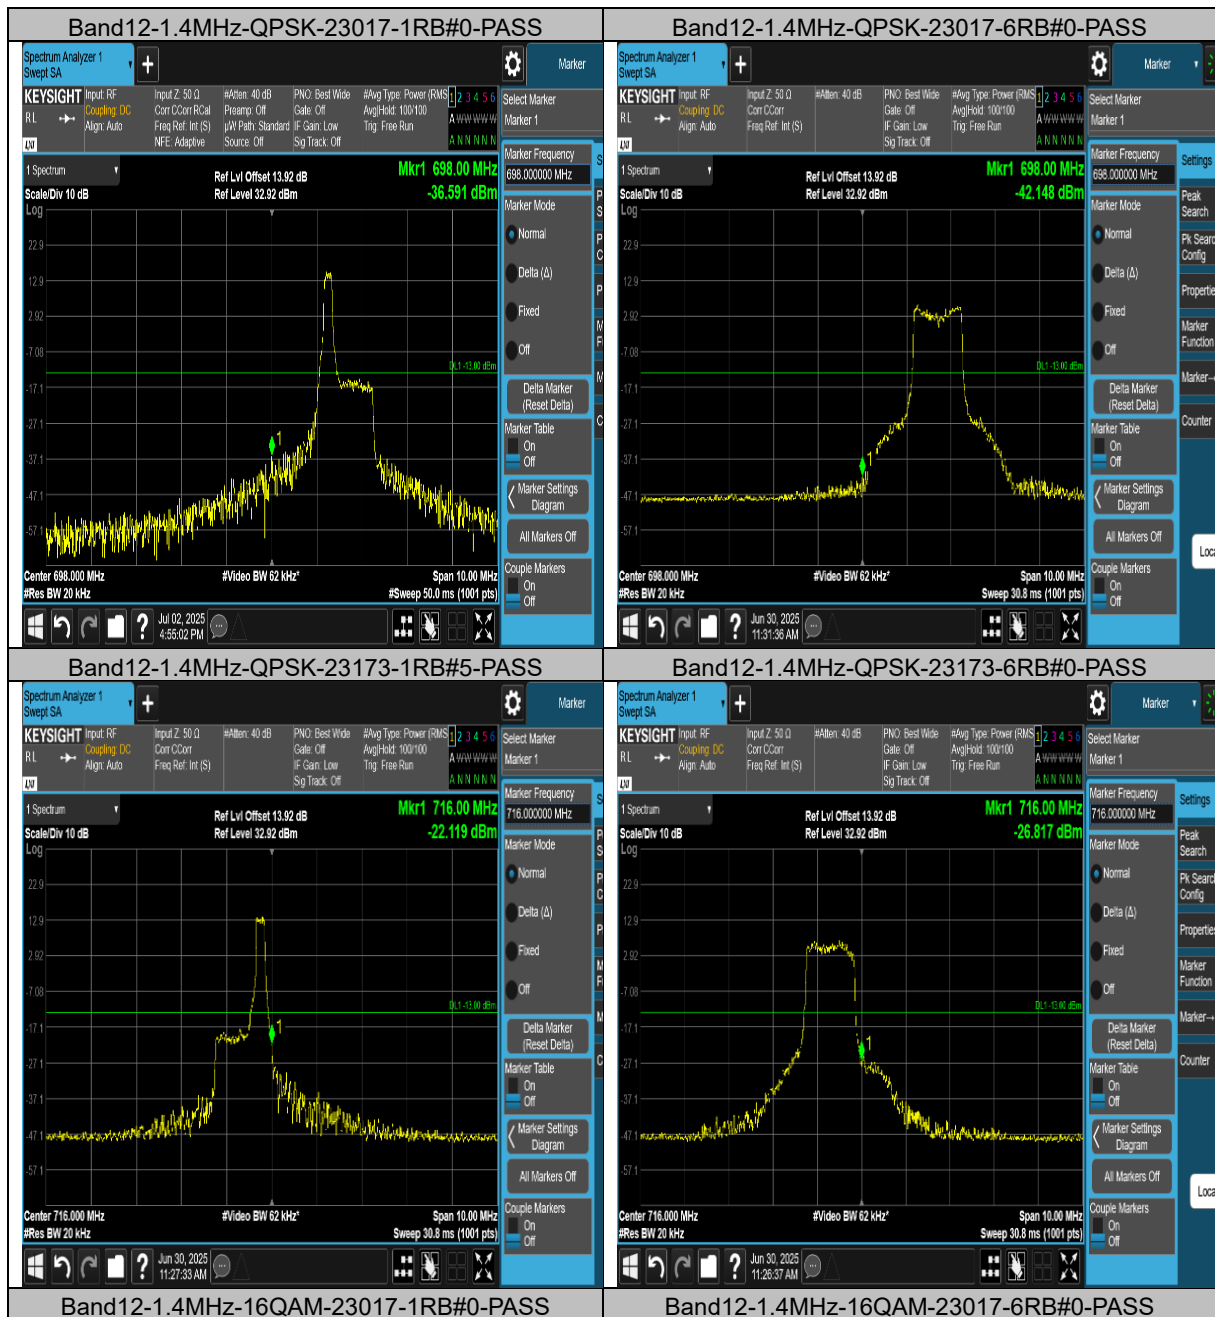

BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

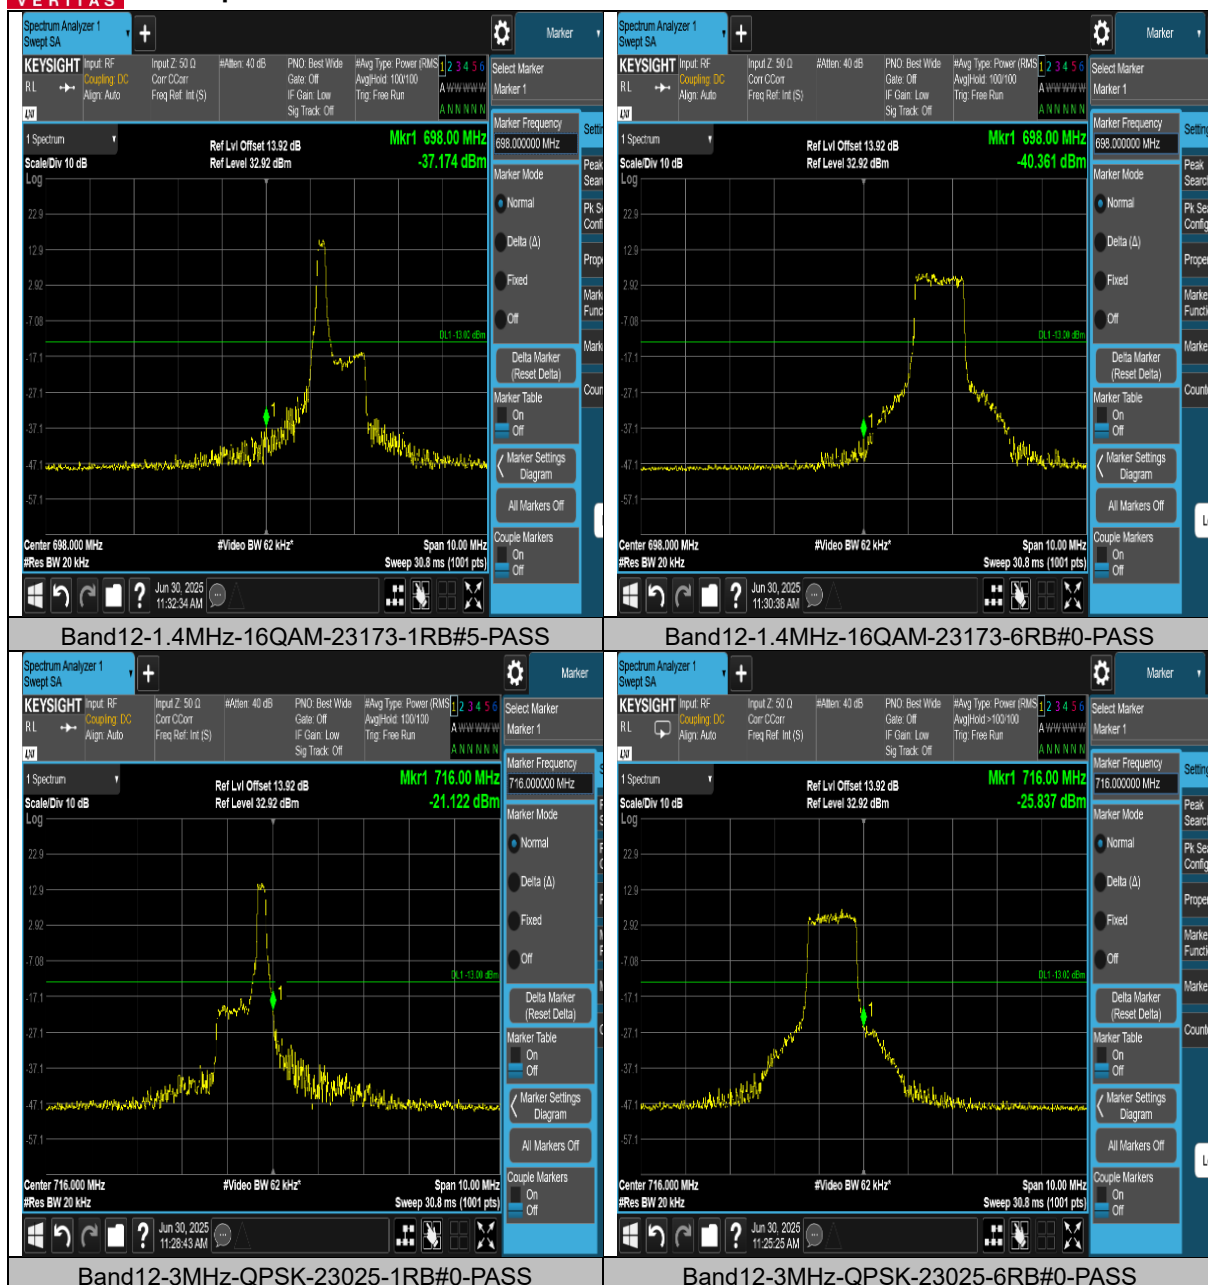


Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

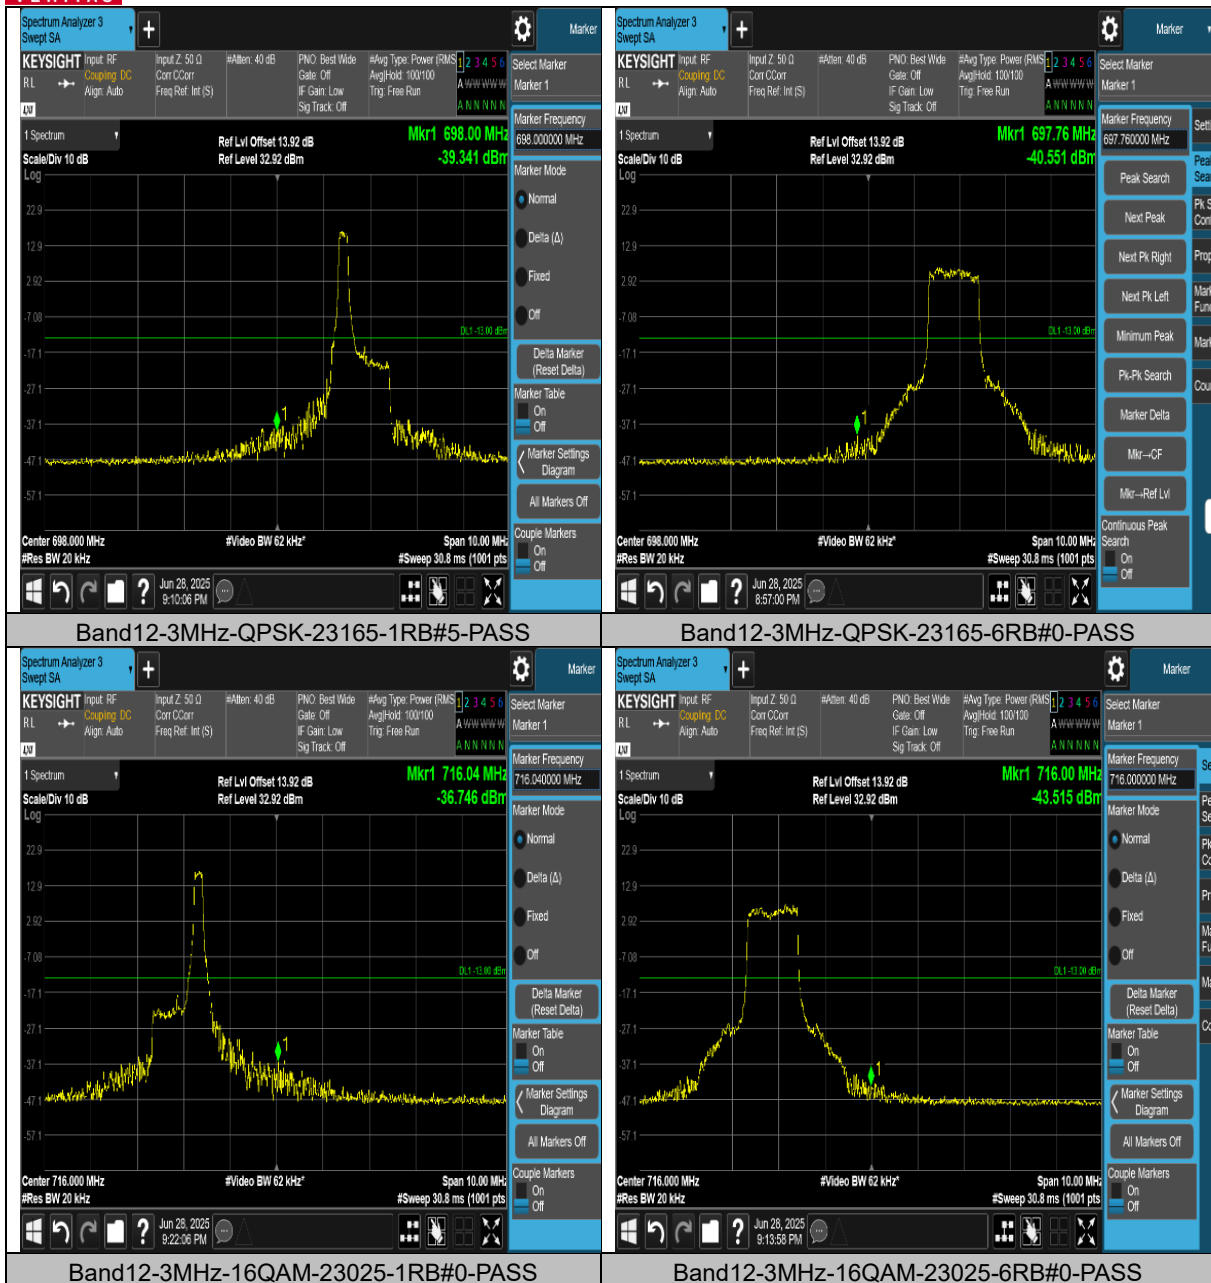


Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

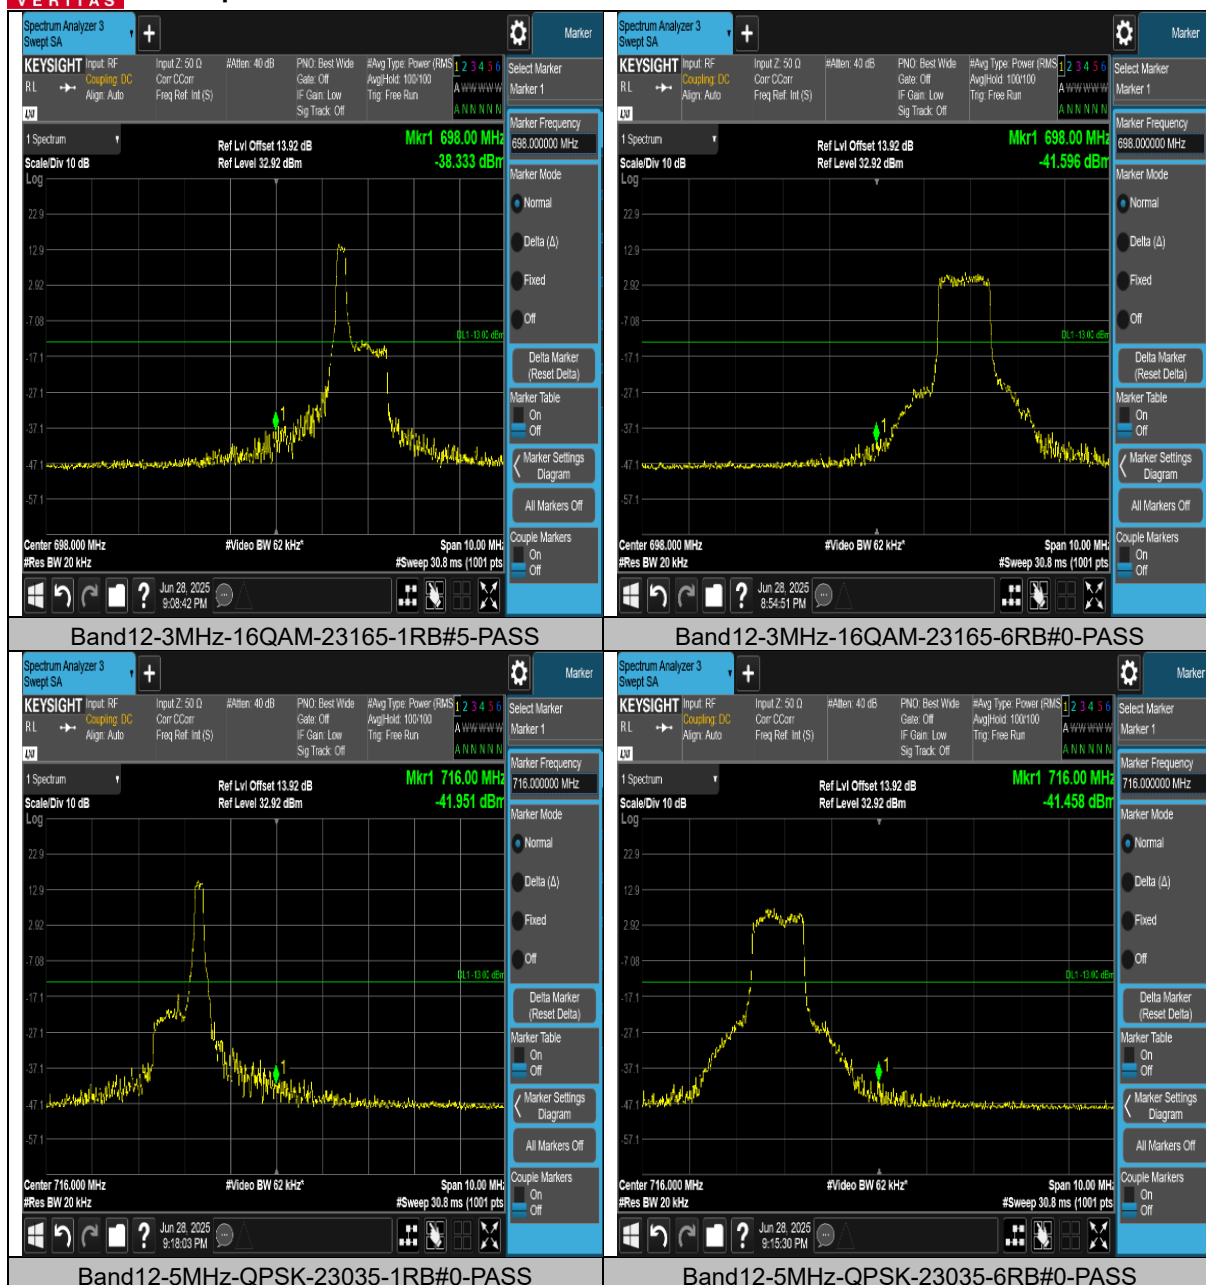


Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008




BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

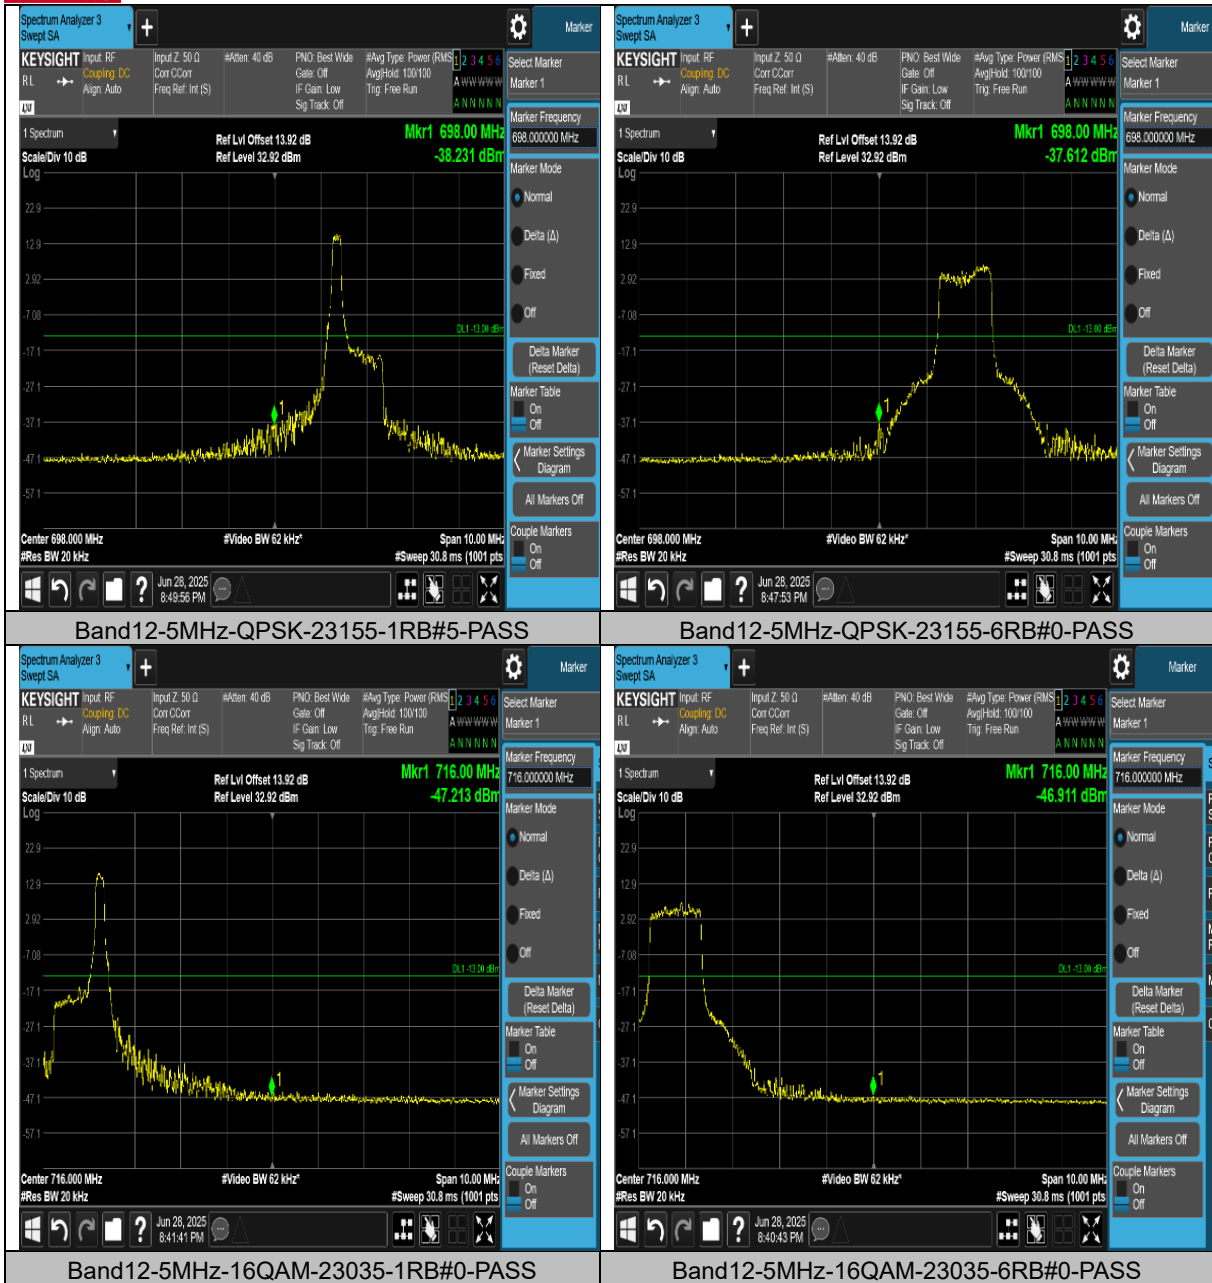




BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

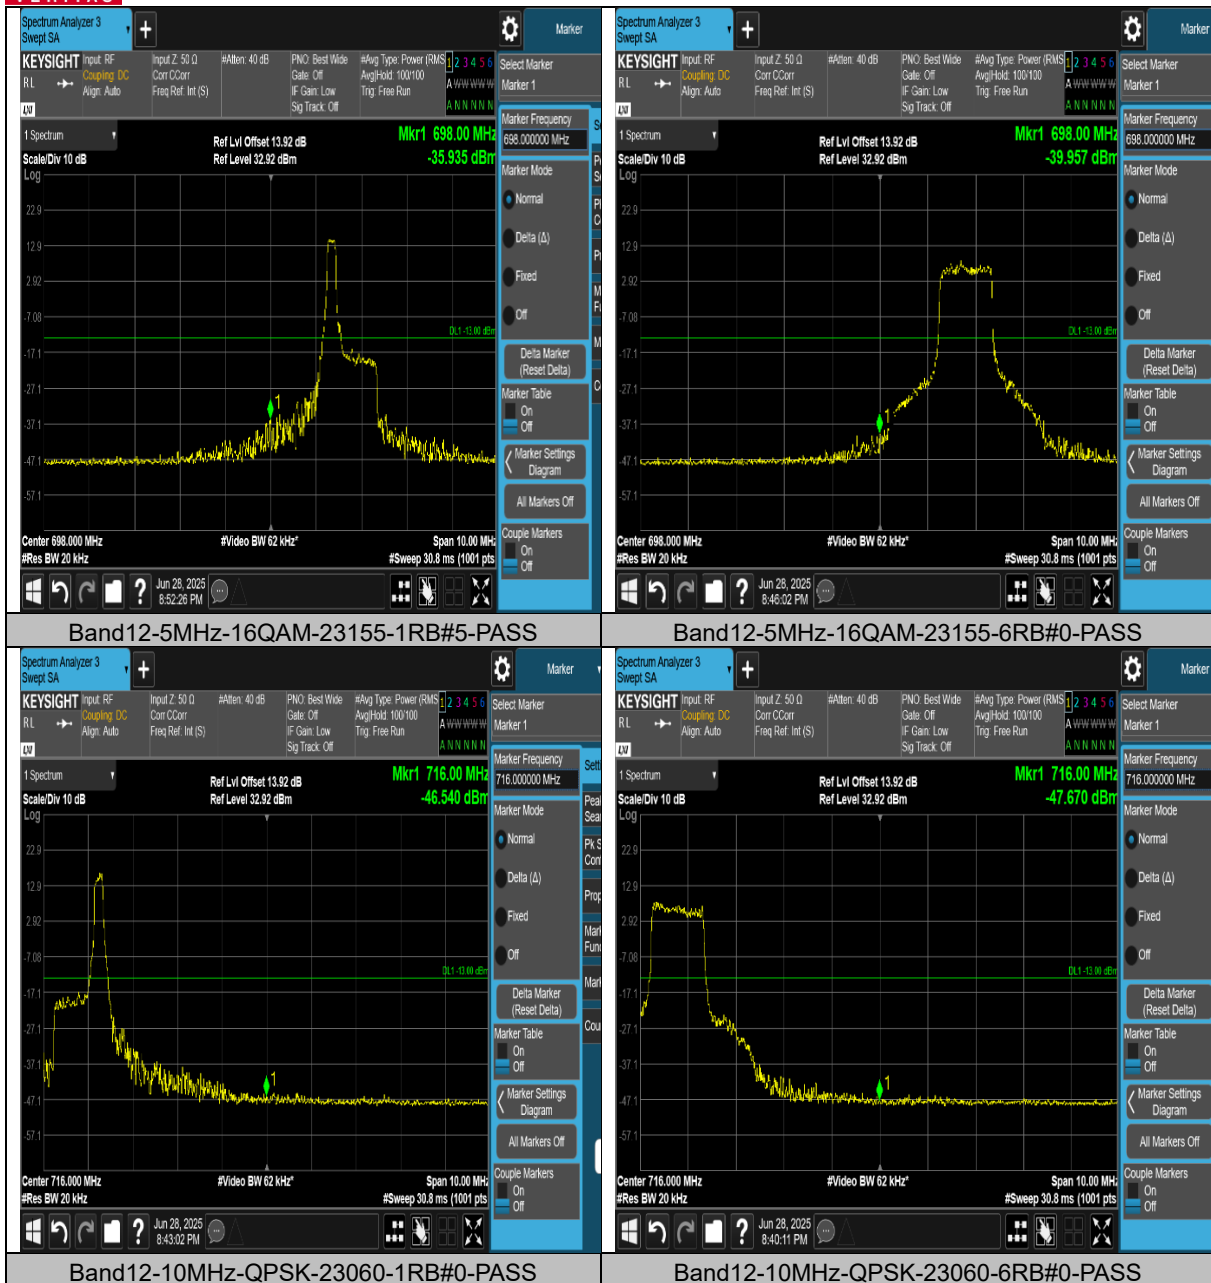




BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

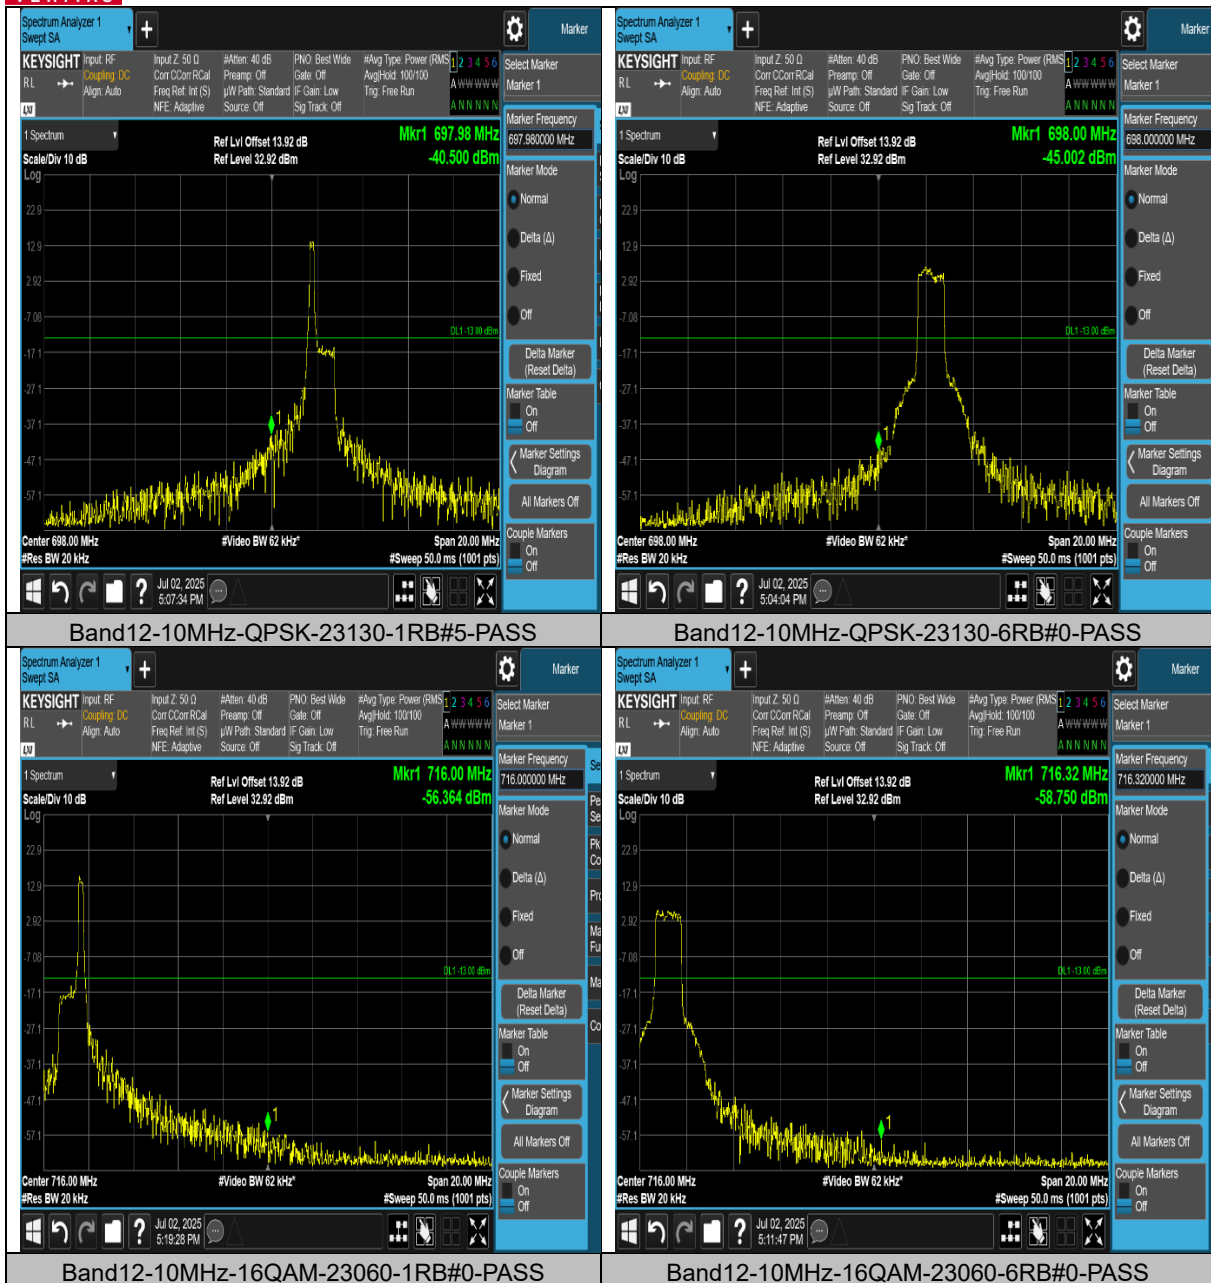



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

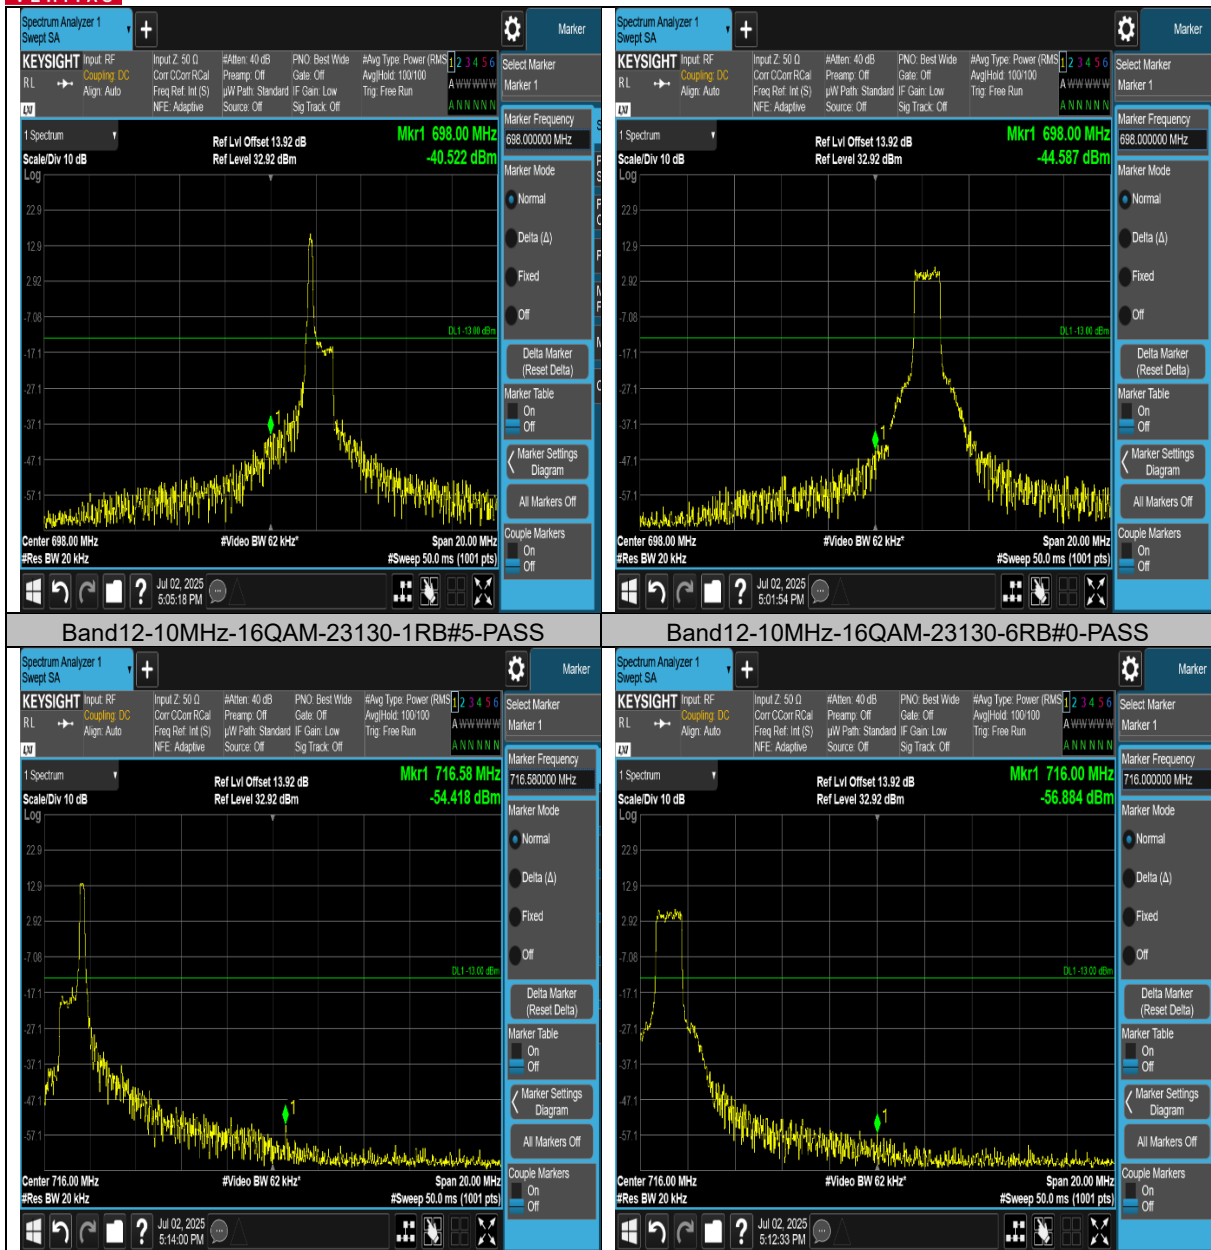

Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008



CONDUCTED SPURIOUS EMISSION

Test Result


Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band12	1.4MHz	QPSK	23017	1RB#0	30~1000	-38.08	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	1000~3000	-35.67	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	3000~10000	-34.20	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	30~1000	-36.87	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	1000~3000	-35.56	PASS
Band12	1.4MHz	QPSK	23095	1RB#0	3000~10000	-34.12	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	30~1000	-37.59	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	1000~3000	-35.74	PASS
Band12	1.4MHz	QPSK	23173	1RB#0	3000~10000	-33.88	PASS
Band12	3MHz	QPSK	23025	1RB#0	30~1000	-35.17	PASS
Band12	3MHz	QPSK	23025	1RB#0	1000~3000	-35.78	PASS
Band12	3MHz	QPSK	23025	1RB#0	3000~10000	-34.40	PASS
Band12	3MHz	QPSK	23095	1RB#0	30~1000	-36.36	PASS
Band12	3MHz	QPSK	23095	1RB#0	1000~3000	-35.68	PASS
Band12	3MHz	QPSK	23095	1RB#0	3000~10000	-34.41	PASS
Band12	3MHz	QPSK	23165	1RB#0	30~1000	-36.19	PASS
Band12	3MHz	QPSK	23165	1RB#0	1000~3000	-35.75	PASS
Band12	3MHz	QPSK	23165	1RB#0	3000~10000	-33.48	PASS
Band12	5MHz	QPSK	23035	1RB#0	30~1000	-37.15	PASS
Band12	5MHz	QPSK	23035	1RB#0	1000~3000	-35.58	PASS
Band12	5MHz	QPSK	23035	1RB#0	3000~10000	-34.10	PASS
Band12	5MHz	QPSK	23095	1RB#0	30~1000	-37.95	PASS
Band12	5MHz	QPSK	23095	1RB#0	1000~3000	-26.28	PASS
Band12	5MHz	QPSK	23095	1RB#0	3000~10000	-34.04	PASS
Band12	5MHz	QPSK	23155	1RB#0	30~1000	-36.72	PASS
Band12	5MHz	QPSK	23155	1RB#0	1000~3000	-35.61	PASS
Band12	5MHz	QPSK	23155	1RB#0	3000~10000	-33.48	PASS
Band12	10MHz	QPSK	23060	1RB#0	30~1000	-37.35	PASS
Band12	10MHz	QPSK	23060	1RB#0	1000~3000	-35.70	PASS
Band12	10MHz	QPSK	23060	1RB#0	3000~10000	-34.32	PASS
Band12	10MHz	QPSK	23095	1RB#0	30~1000	-37.52	PASS
Band12	10MHz	QPSK	23095	1RB#0	1000~3000	-35.39	PASS
Band12	10MHz	QPSK	23095	1RB#0	3000~10000	-34.39	PASS
Band12	10MHz	QPSK	23130	1RB#0	30~1000	-36.04	PASS
Band12	10MHz	QPSK	23130	1RB#0	1000~3000	-35.79	PASS
Band12	10MHz	QPSK	23130	1RB#0	3000~10000	-34.23	PASS

Test Graphs

Band12-1.4MHz-QPSK-23017-1RB#0-30~1000-PASS	Band12-1.4MHz-QPSK-23017-1RB#0-1000~3000-PASS
---	---



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

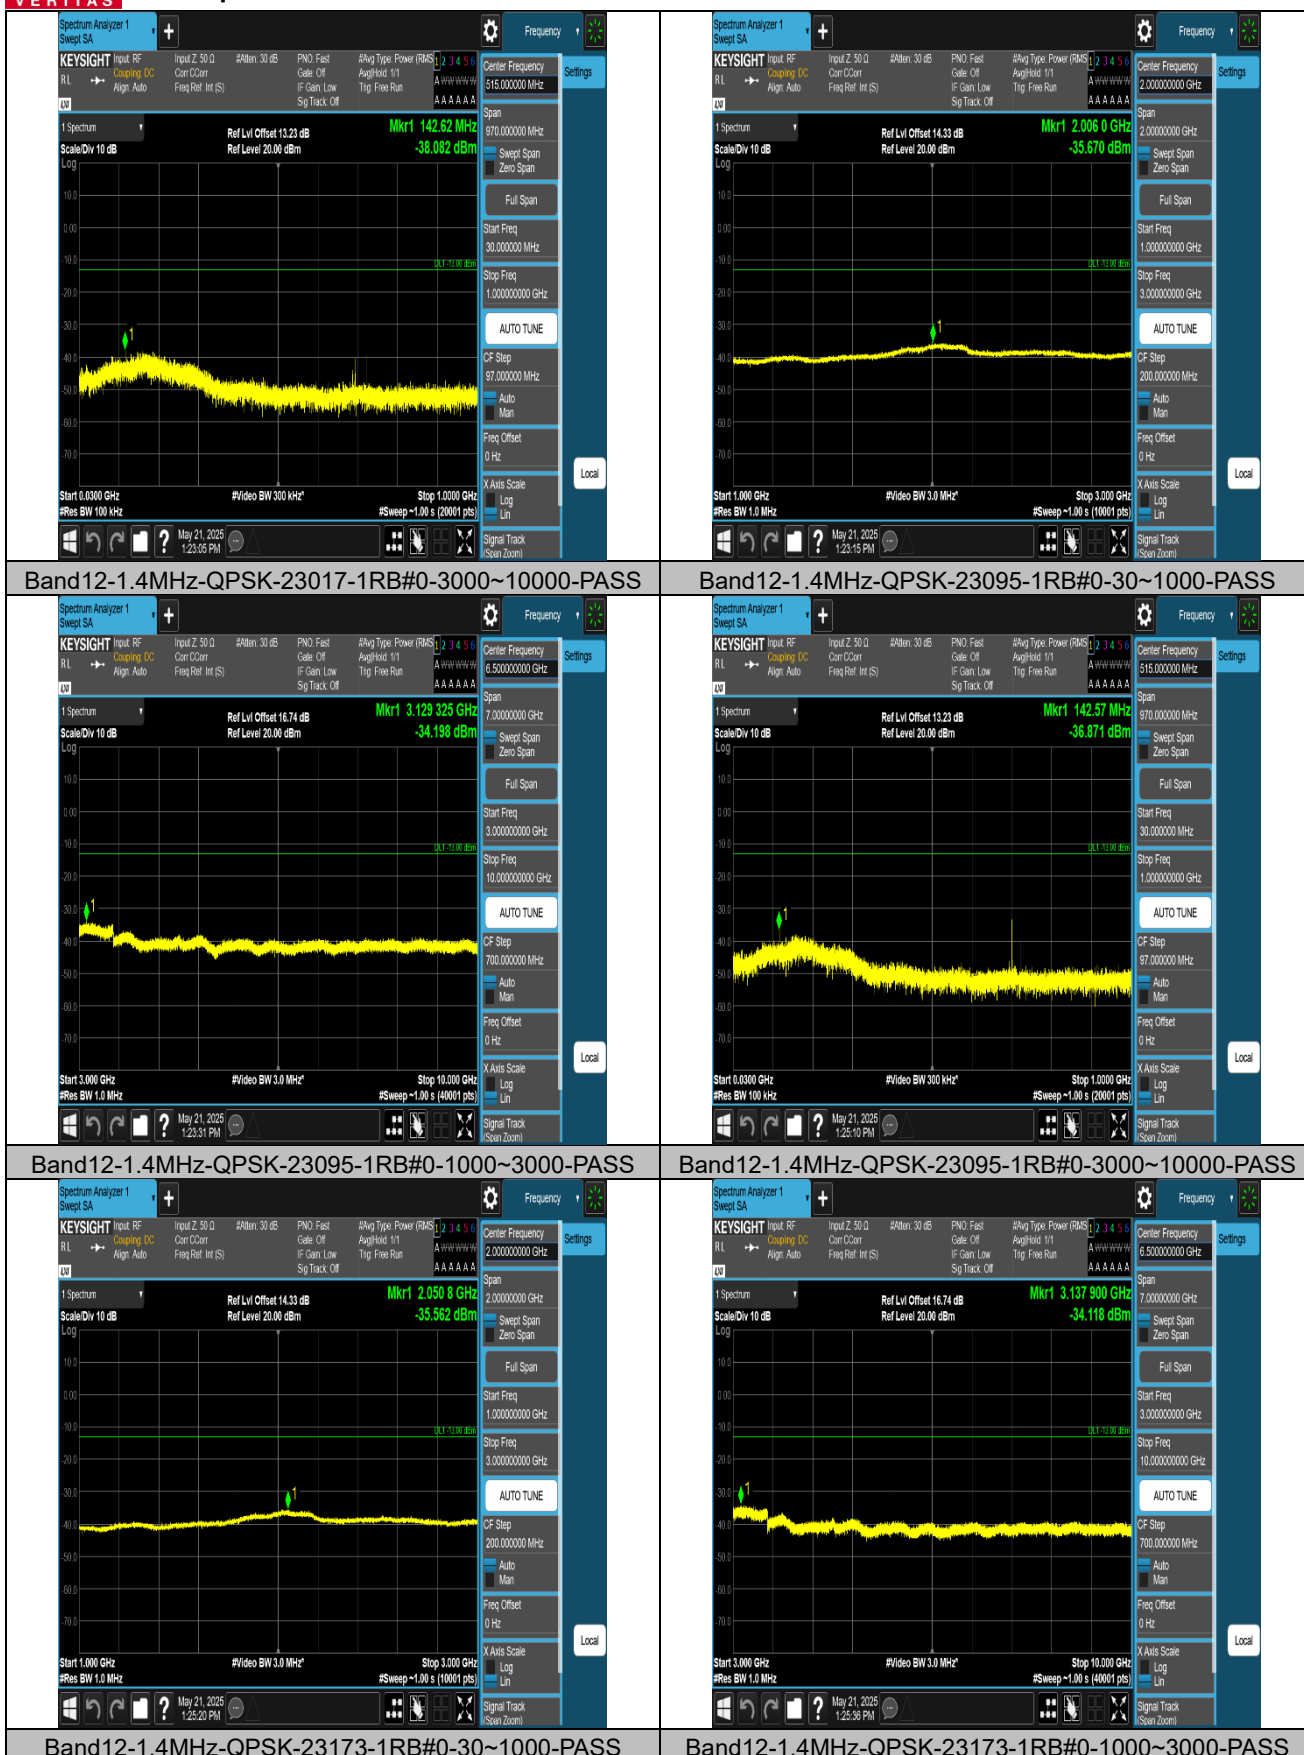


Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

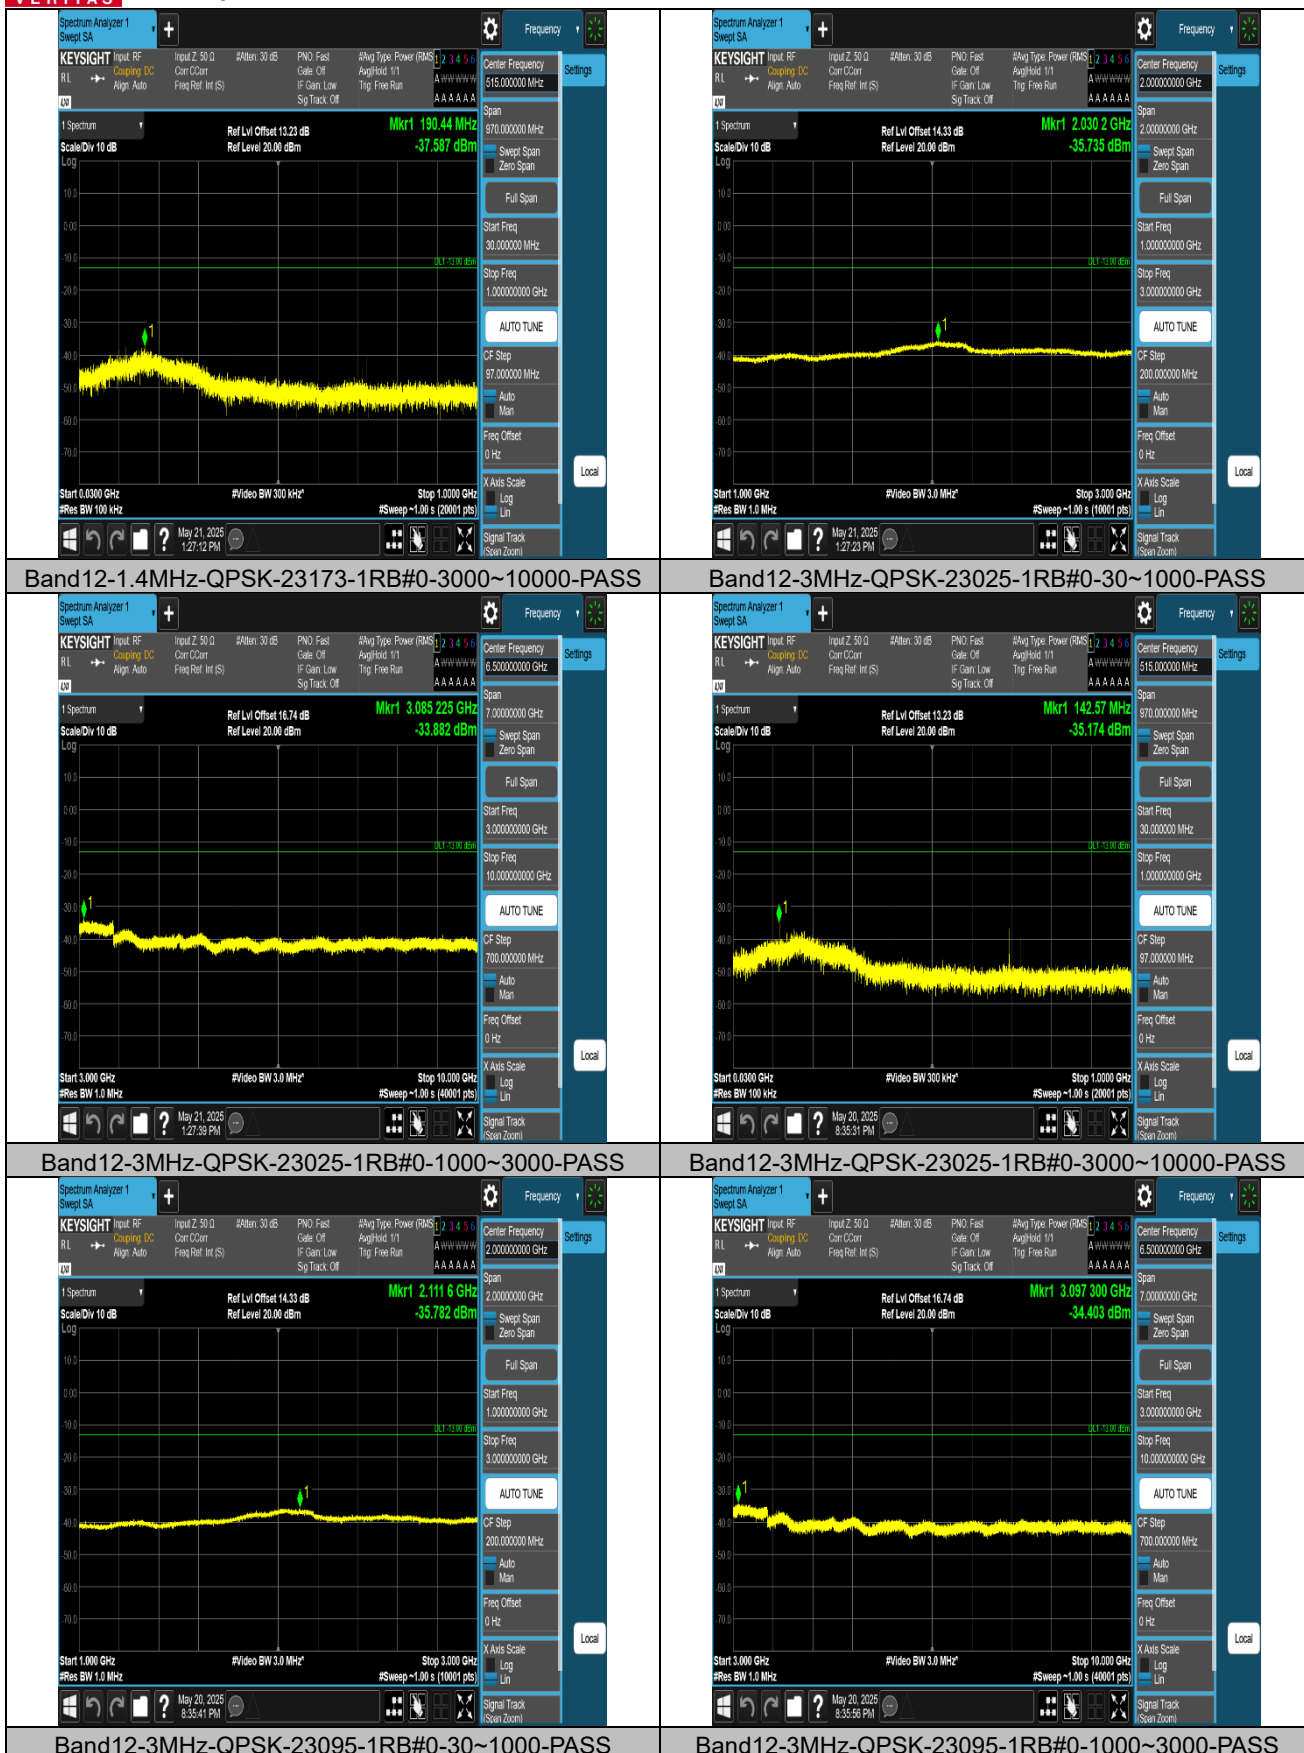


Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008



BUREAU VERITAS Test Report No.: PSU-QSU2505080113RF03

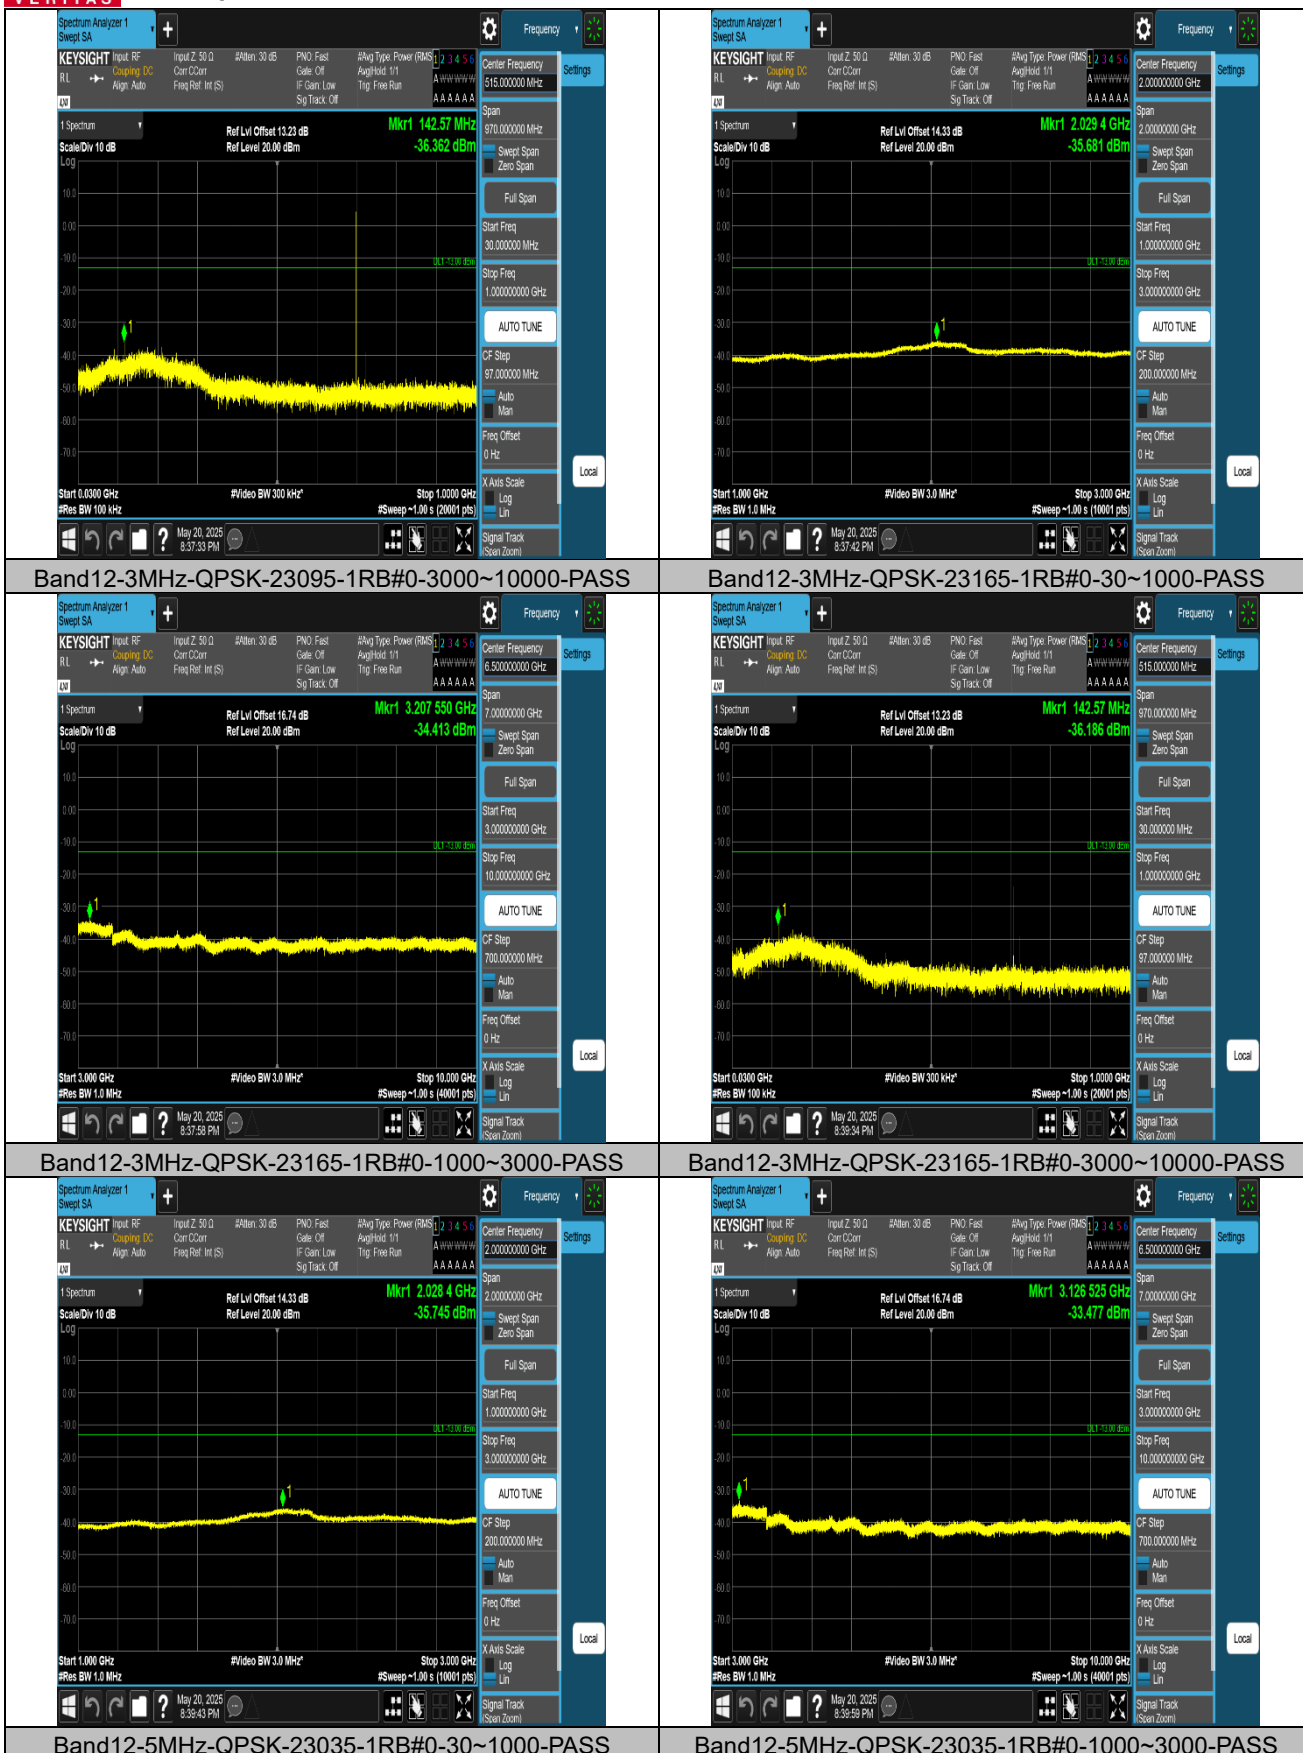

Huarui 7layers High Technology
(Suzhou) Co., Ltd.

Tower N, Innovation Center, 88 Zuyi Road, High-tech
District, Suzhou City, Anhui Province, China

Tel: +86 (0557) 368 1008